

Appendix Test Data

Report No.:	1813C50286612504	Test Sample No.:	1-2-2
Start Test Date:	2025-6-23	Finish Test Date:	2025-6-30
Test Engineer:	Hu Sen Guan	Auditor:	Justin Feng
Temperature:	26.7°C	Relative Humidity:	55%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.72	5169.96	5190.68	---	---
11A	Ant1	5200	21.16	5190.08	5211.24	---	---
11A	Ant1	5240	20.68	5229.88	5250.56	---	---
11A	Ant1	5745	22.12	5734.08	5756.20	---	---
11A	Ant1	5785	21.44	5774.80	5796.24	---	---
11A	Ant1	5825	21.60	5814.64	5836.24	---	---
11N20SISO	Ant1	5180	20.96	5169.56	5190.52	---	---
11N20SISO	Ant1	5200	21.96	5189.44	5211.40	---	---
11N20SISO	Ant1	5240	21.40	5229.36	5250.76	---	---
11N20SISO	Ant1	5745	24.44	5733.96	5758.40	---	---
11N20SISO	Ant1	5785	25.44	5771.68	5797.12	---	---
11N20SISO	Ant1	5825	22.24	5813.84	5836.08	---	---
11N40SISO	Ant1	5190	39.12	5170.64	5209.76	---	---
11N40SISO	Ant1	5230	39.60	5210.32	5249.92	---	---
11N40SISO	Ant1	5755	42.24	5735.08	5777.32	---	---
11N40SISO	Ant1	5795	45.84	5774.36	5820.20	---	---
11AC20SISO	Ant1	5180	21.40	5169.60	5191.00	---	---
11AC20SISO	Ant1	5200	21.84	5189.40	5211.24	---	---
11AC20SISO	Ant1	5240	21.00	5229.56	5250.56	---	---
11AC20SISO	Ant1	5745	22.96	5734.40	5757.36	---	---
11AC20SISO	Ant1	5785	22.92	5774.40	5797.32	---	---
11AC20SISO	Ant1	5825	22.92	5812.76	5835.68	---	---
11AC40SISO	Ant1	5190	41.92	5170.16	5212.08	---	---
11AC40SISO	Ant1	5230	42.72	5210.08	5252.80	---	---
11AC40SISO	Ant1	5755	47.44	5732.52	5779.96	---	---

11AC40SISO	Ant1	5795	45.04	5772.92	5817.96	---	---
11AC80SISO	Ant1	5210	79.68	5170.32	5250.00	---	---
11AC80SISO	Ant1	5775	82.24	5735.00	5817.24	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

Test Graphs

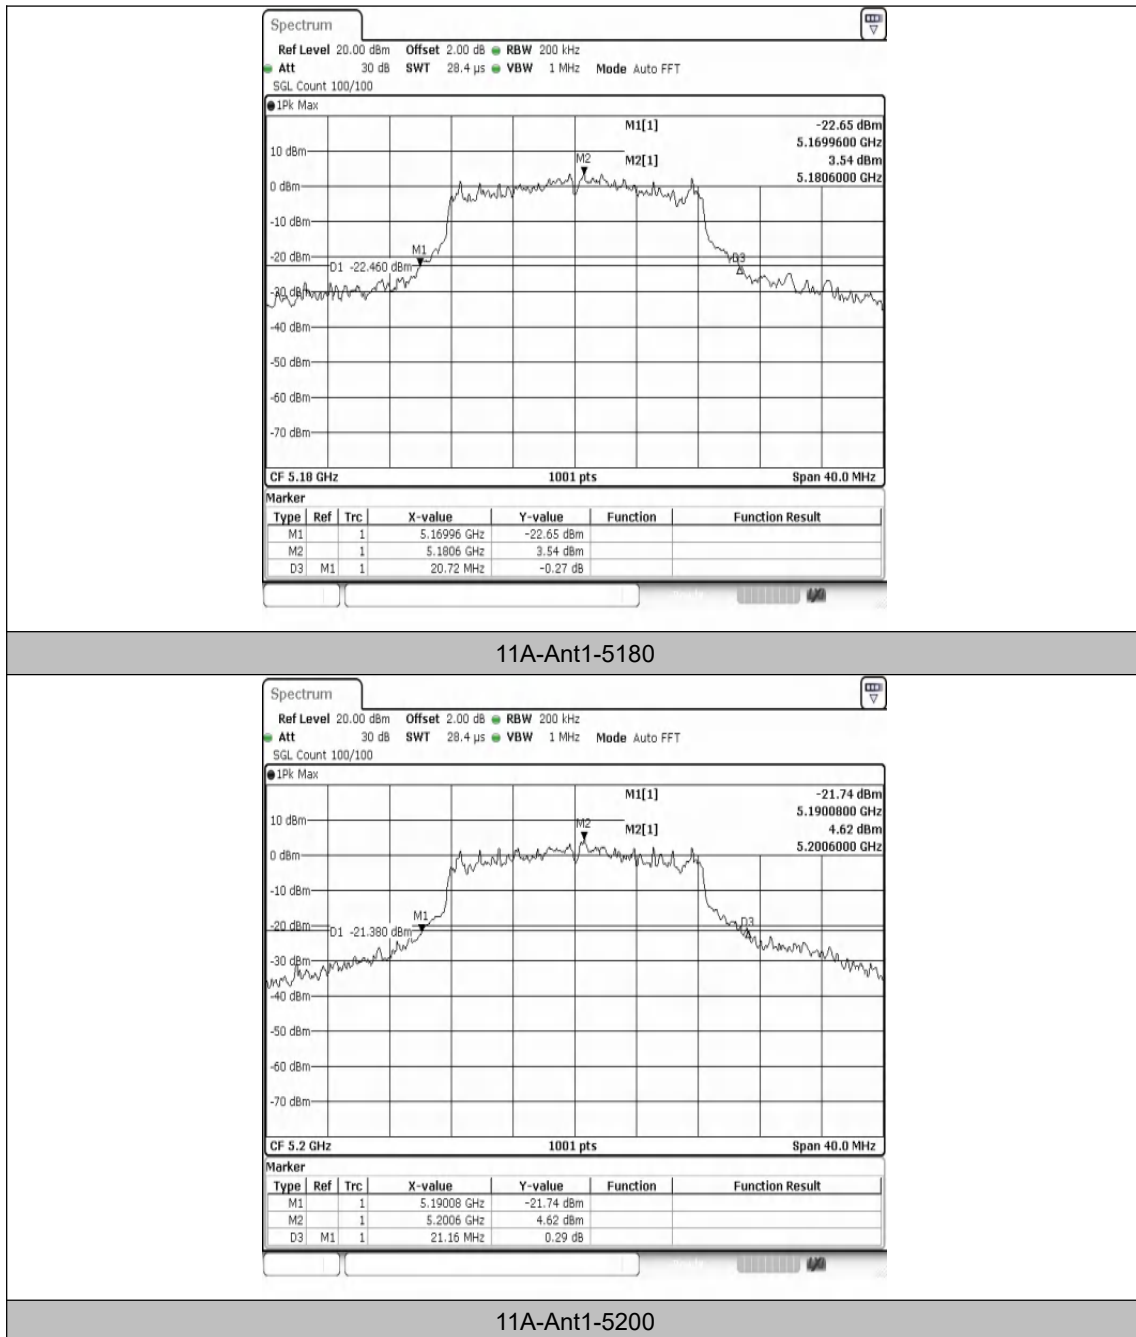


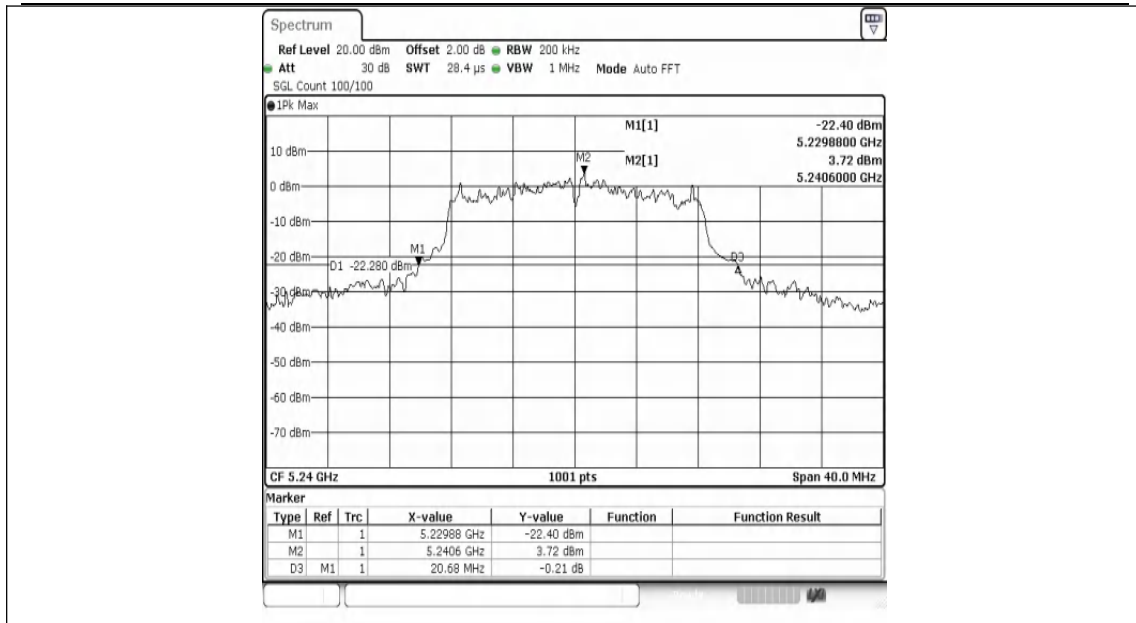


11A-Ant1-5240

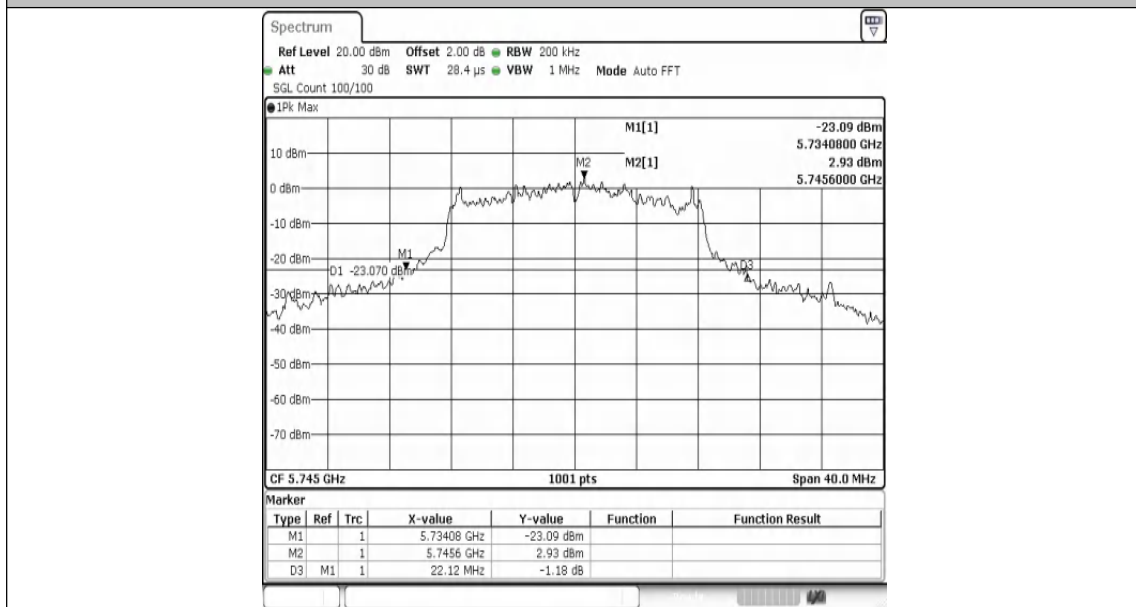


11A-Ant1-5745

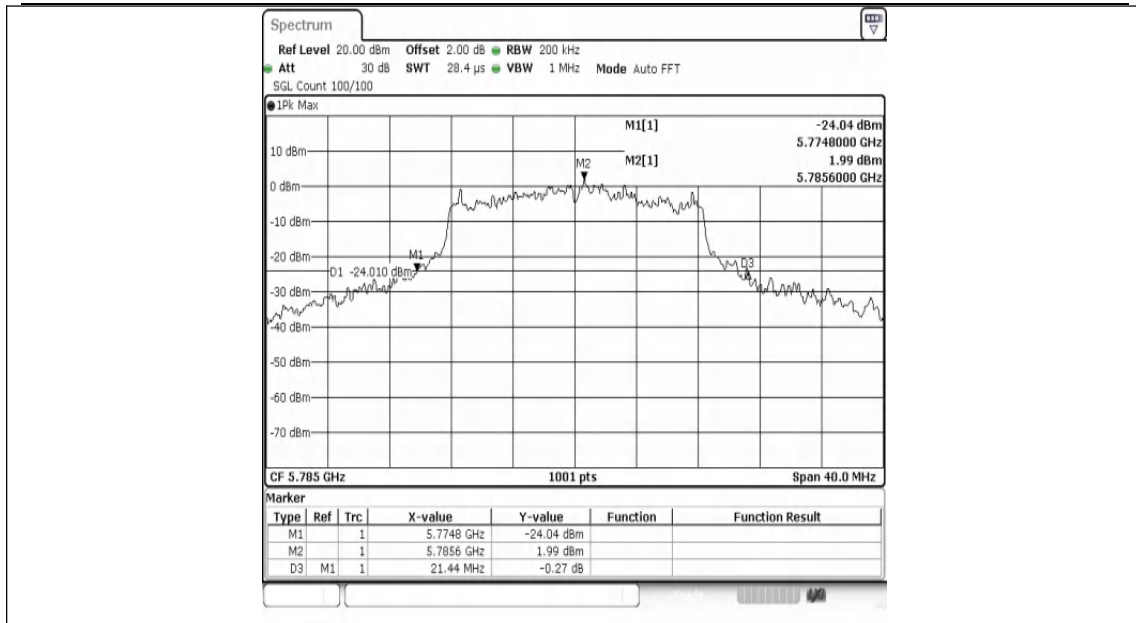



11A-Ant1-5785

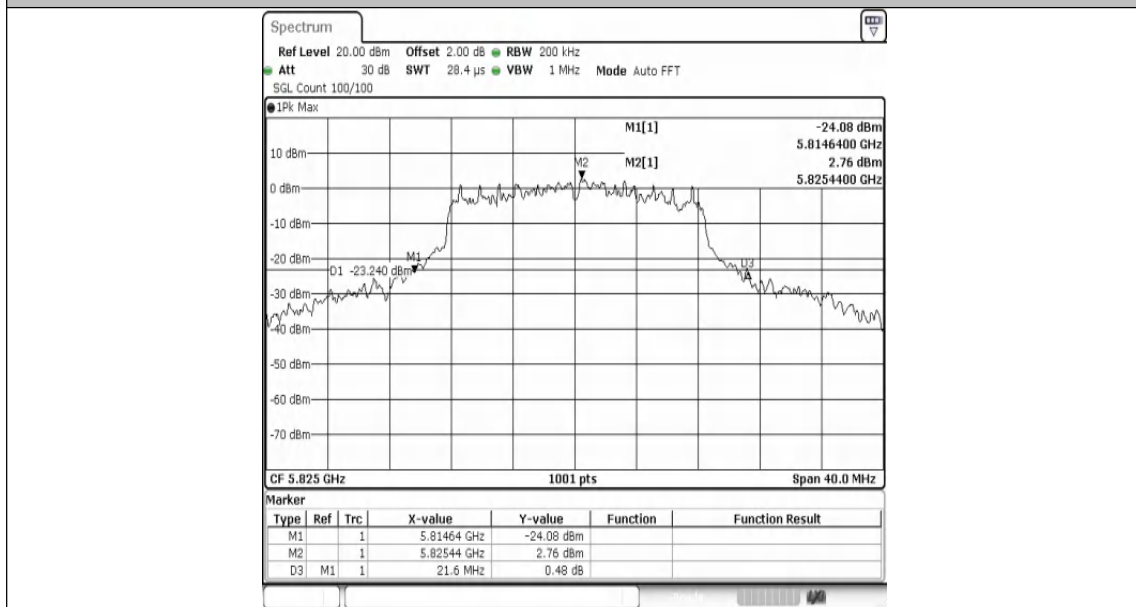



11A-Ant1-5825

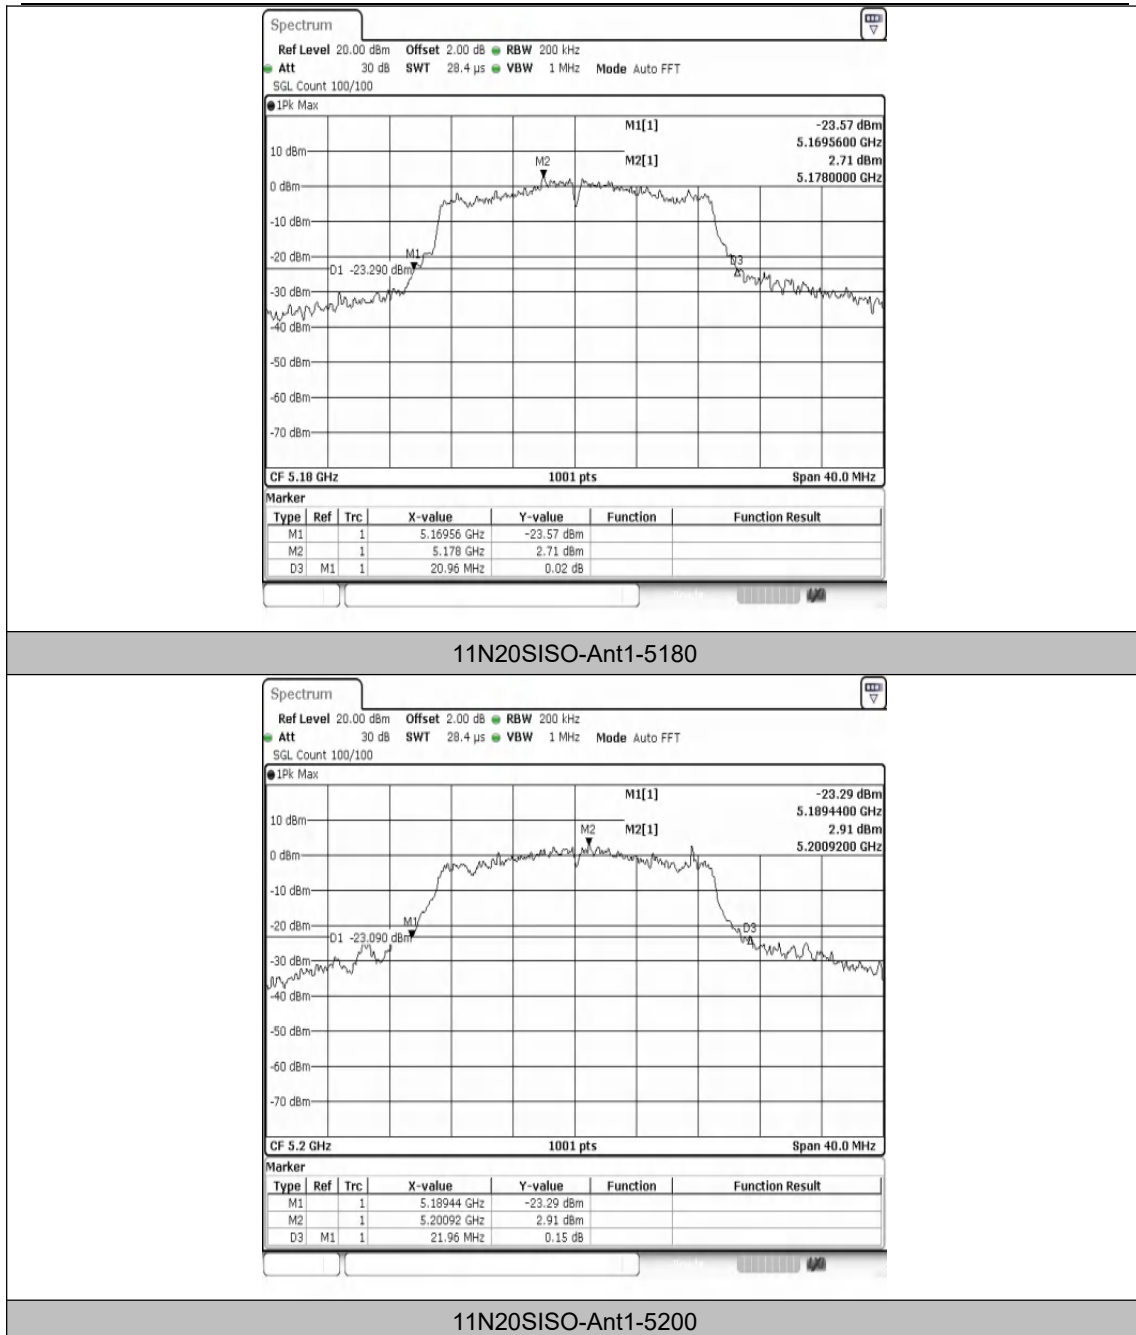


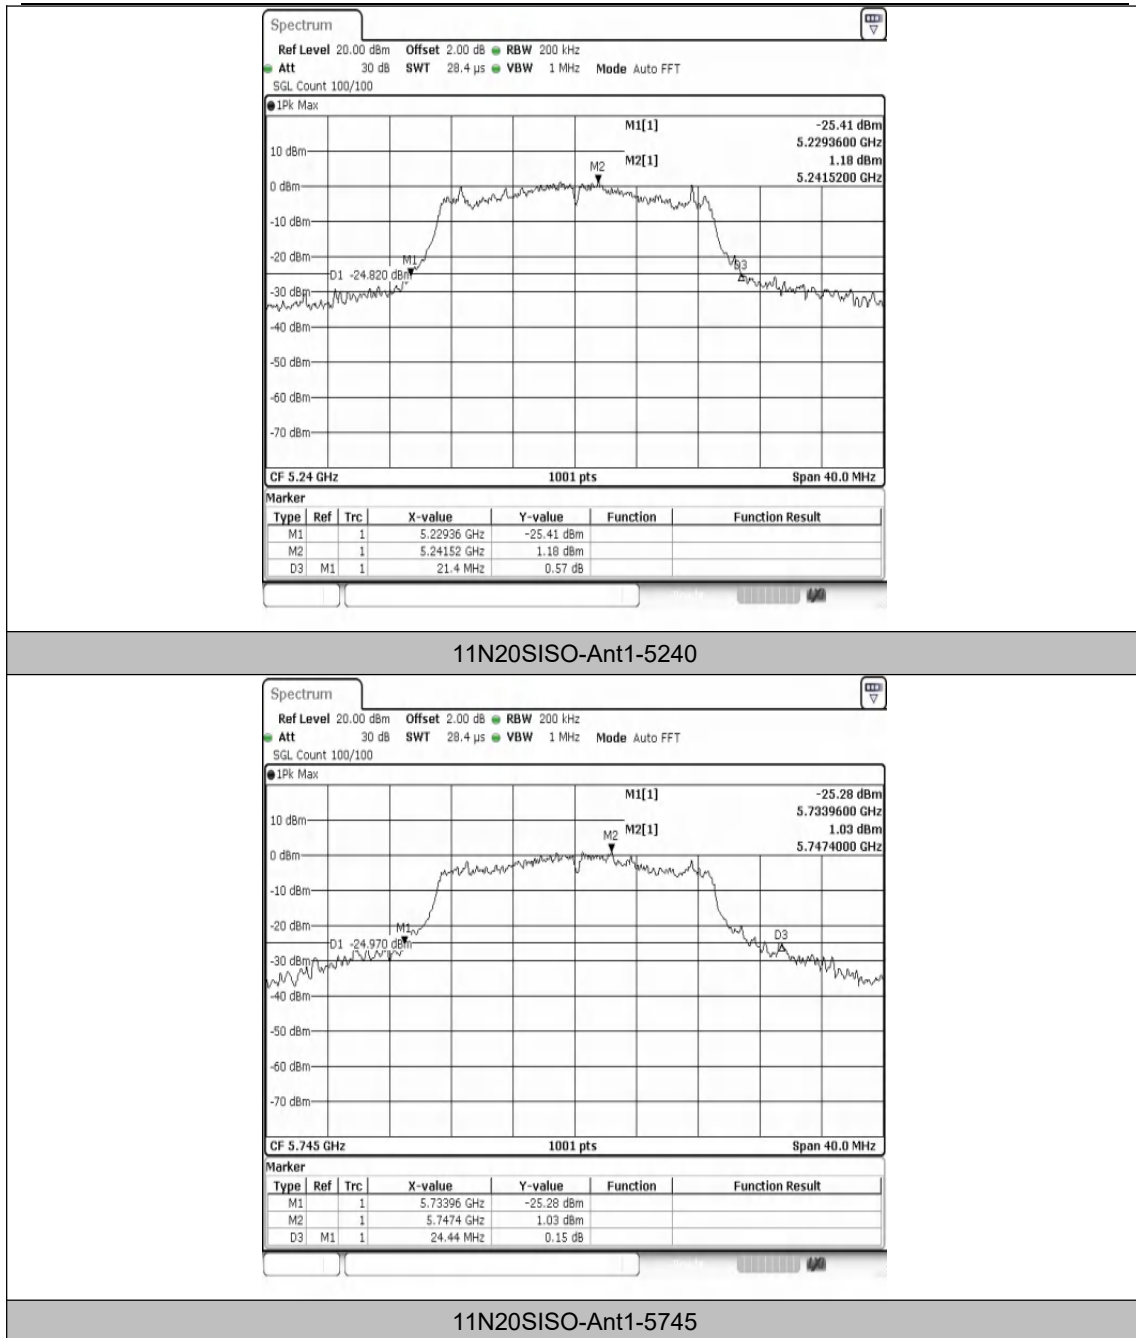


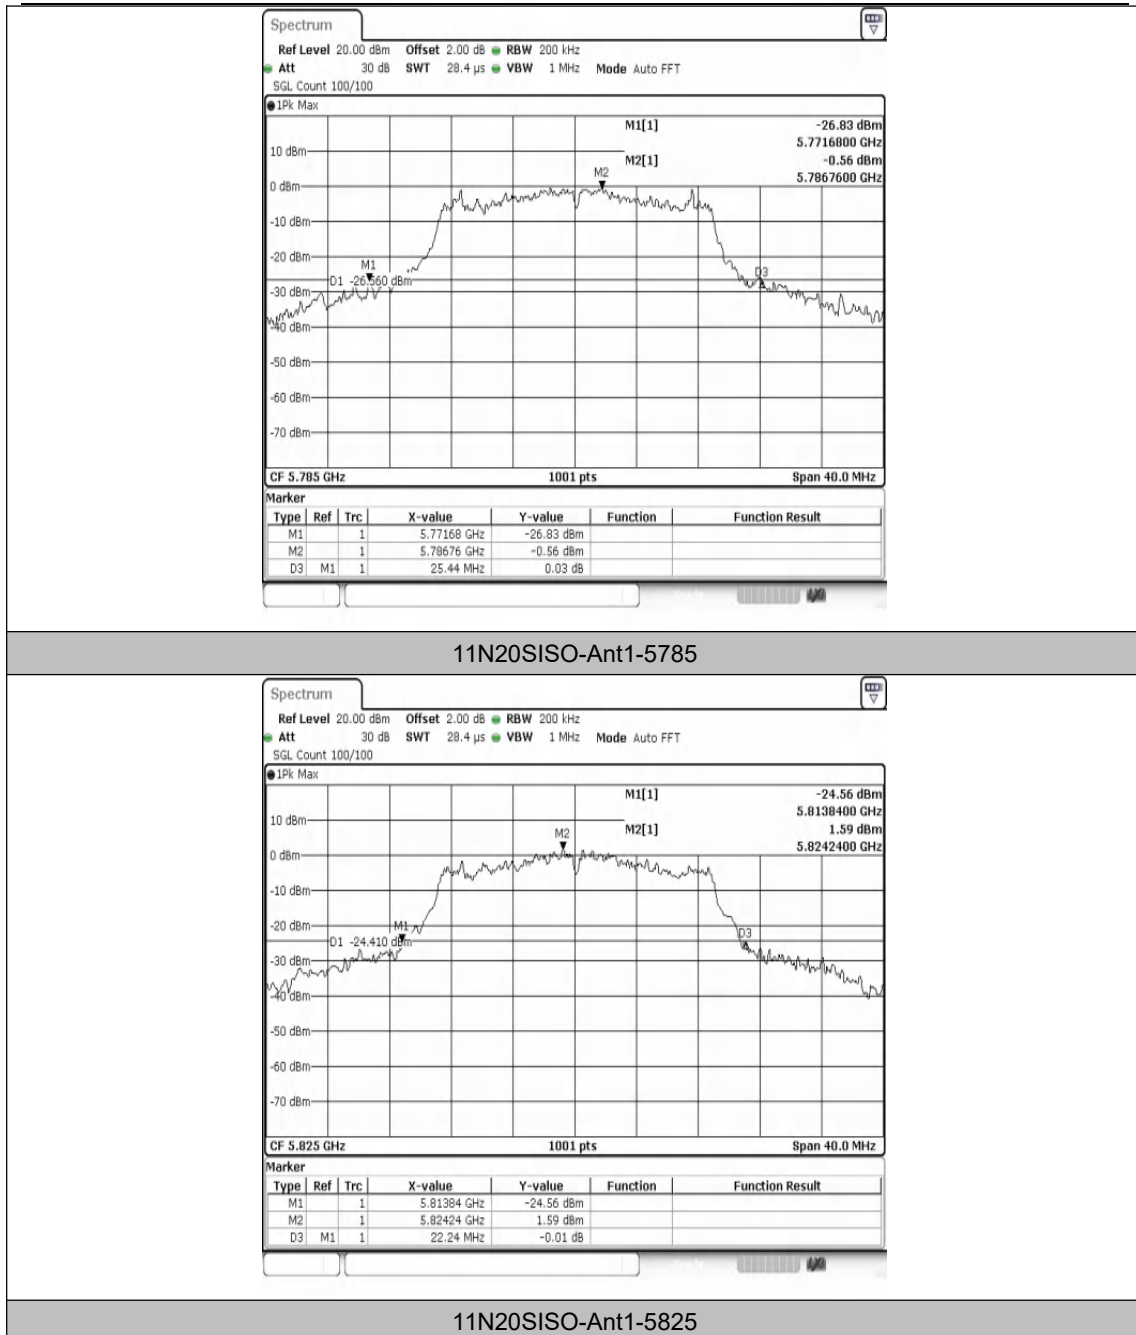


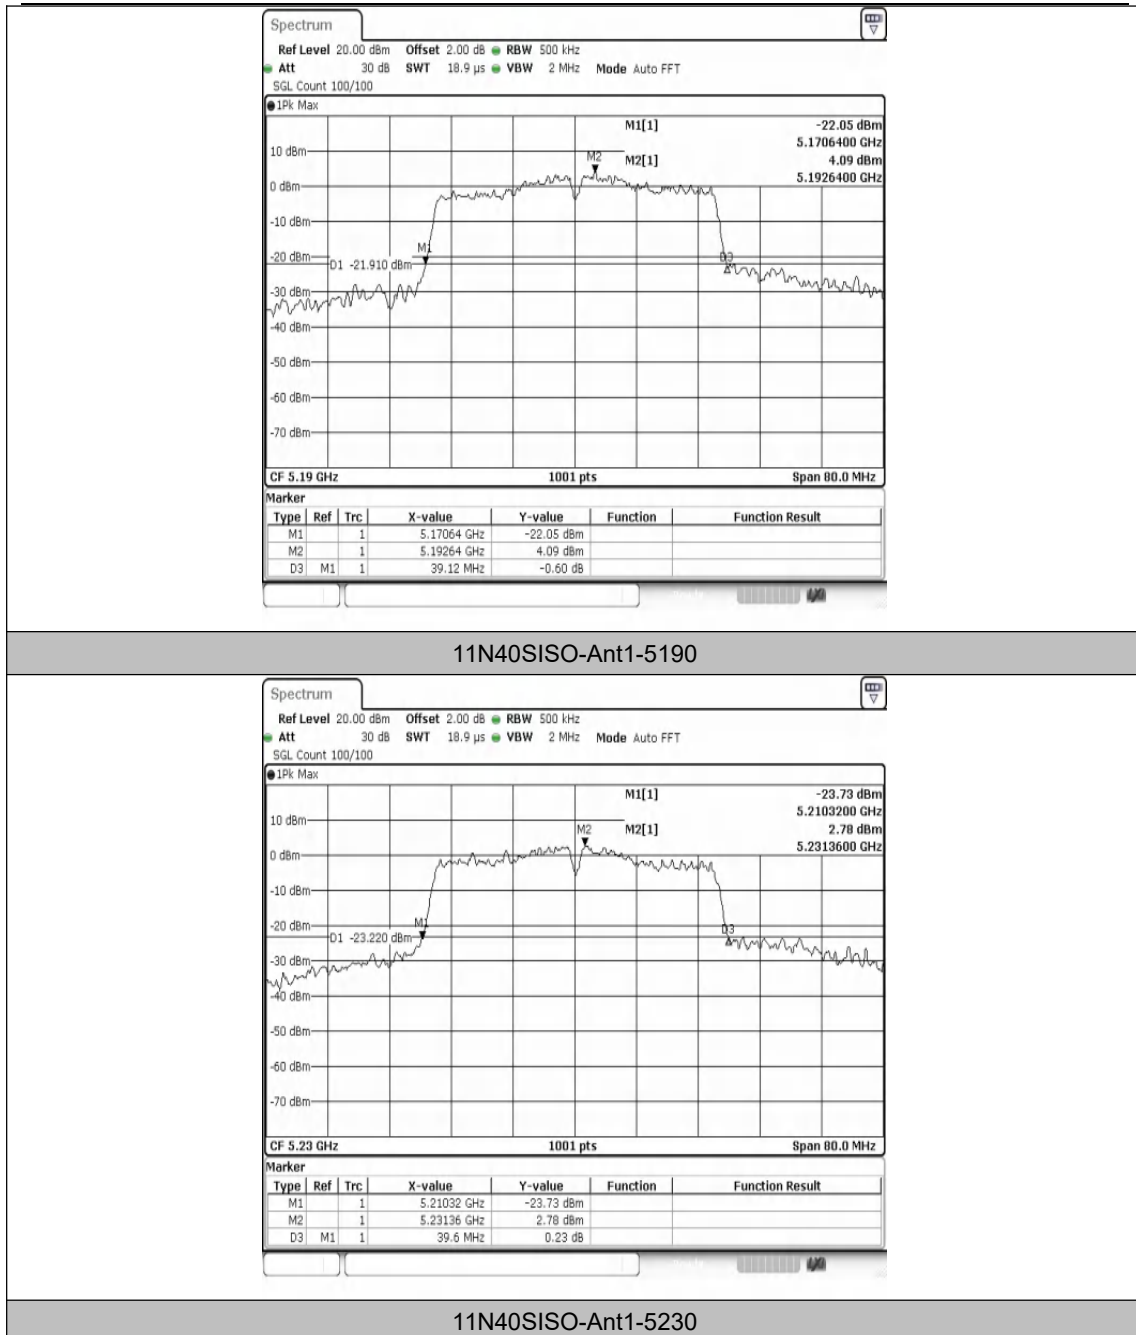


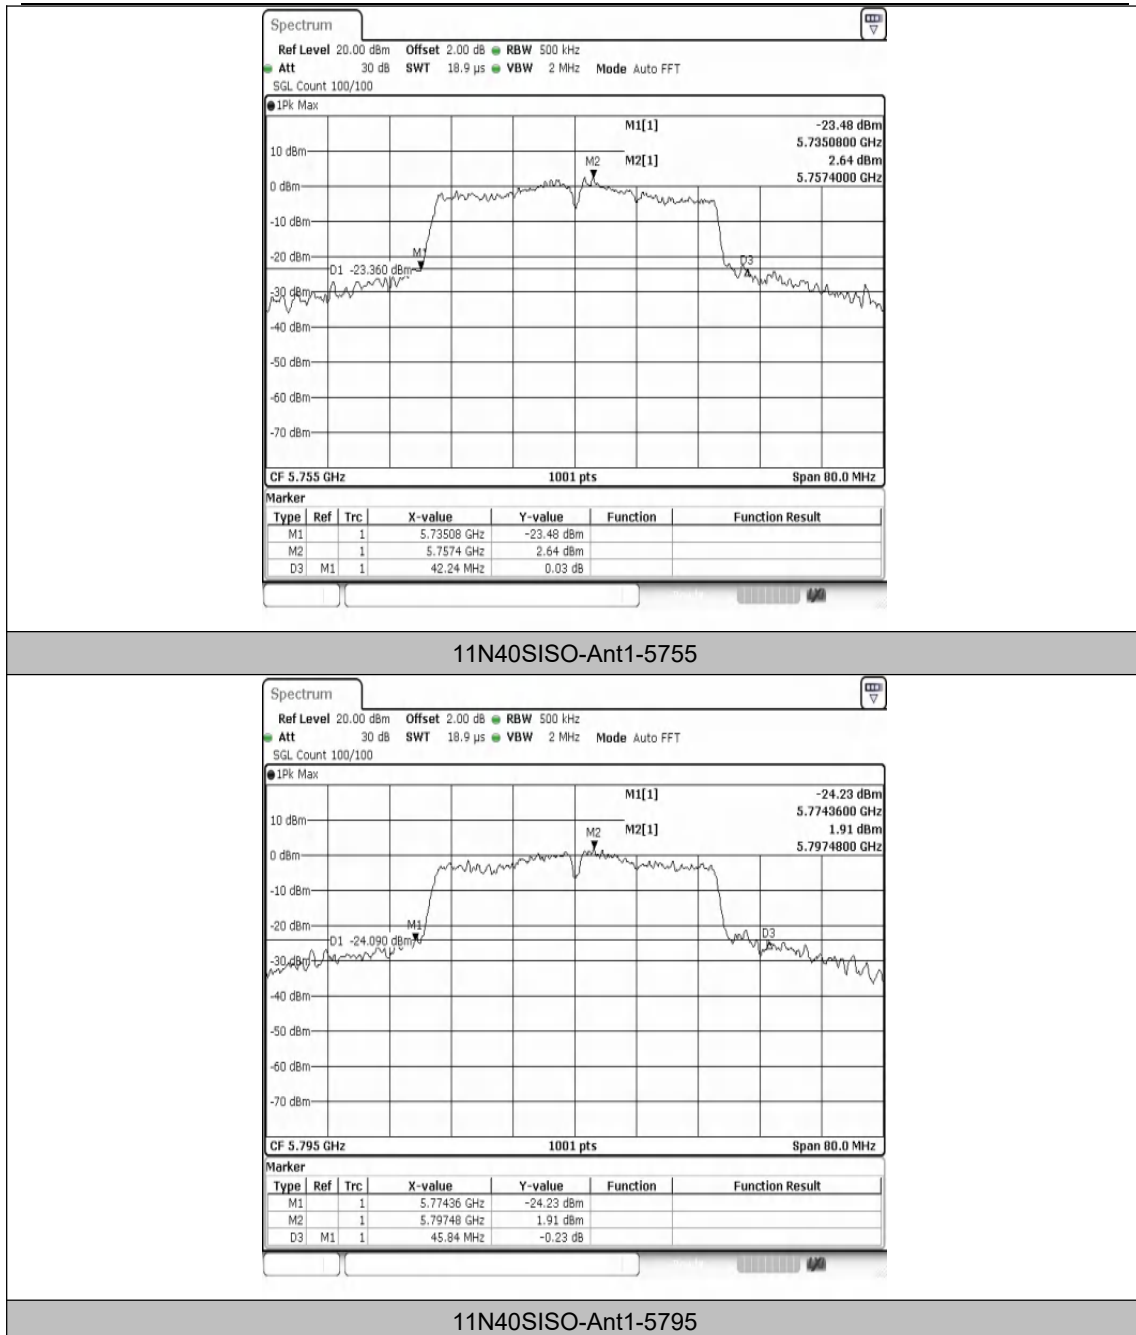

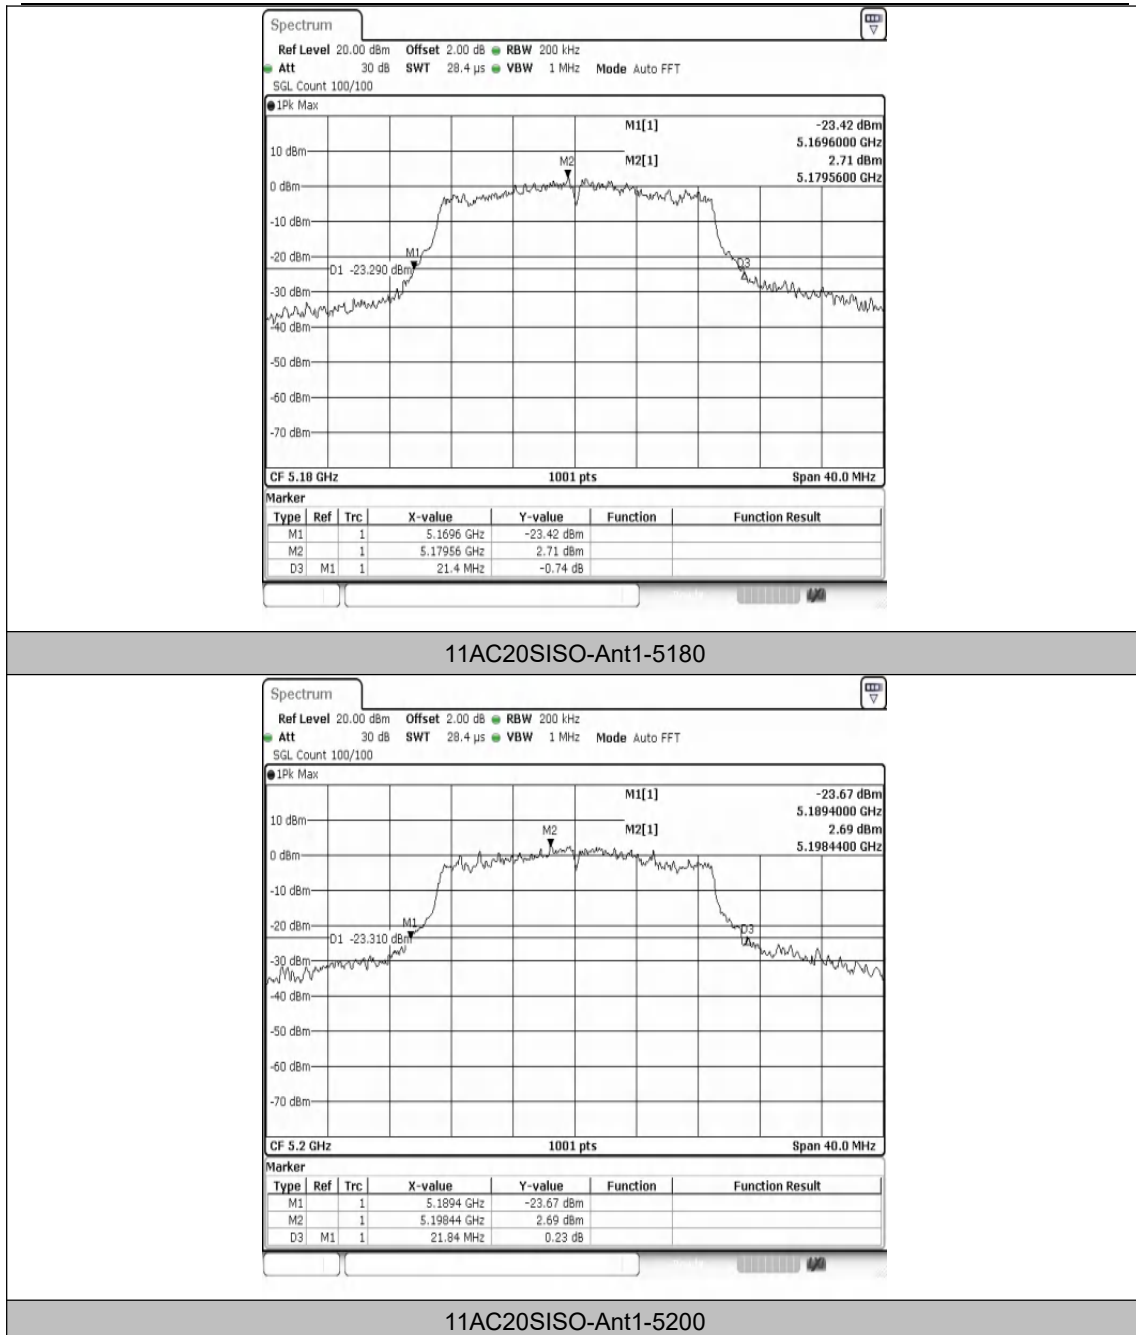


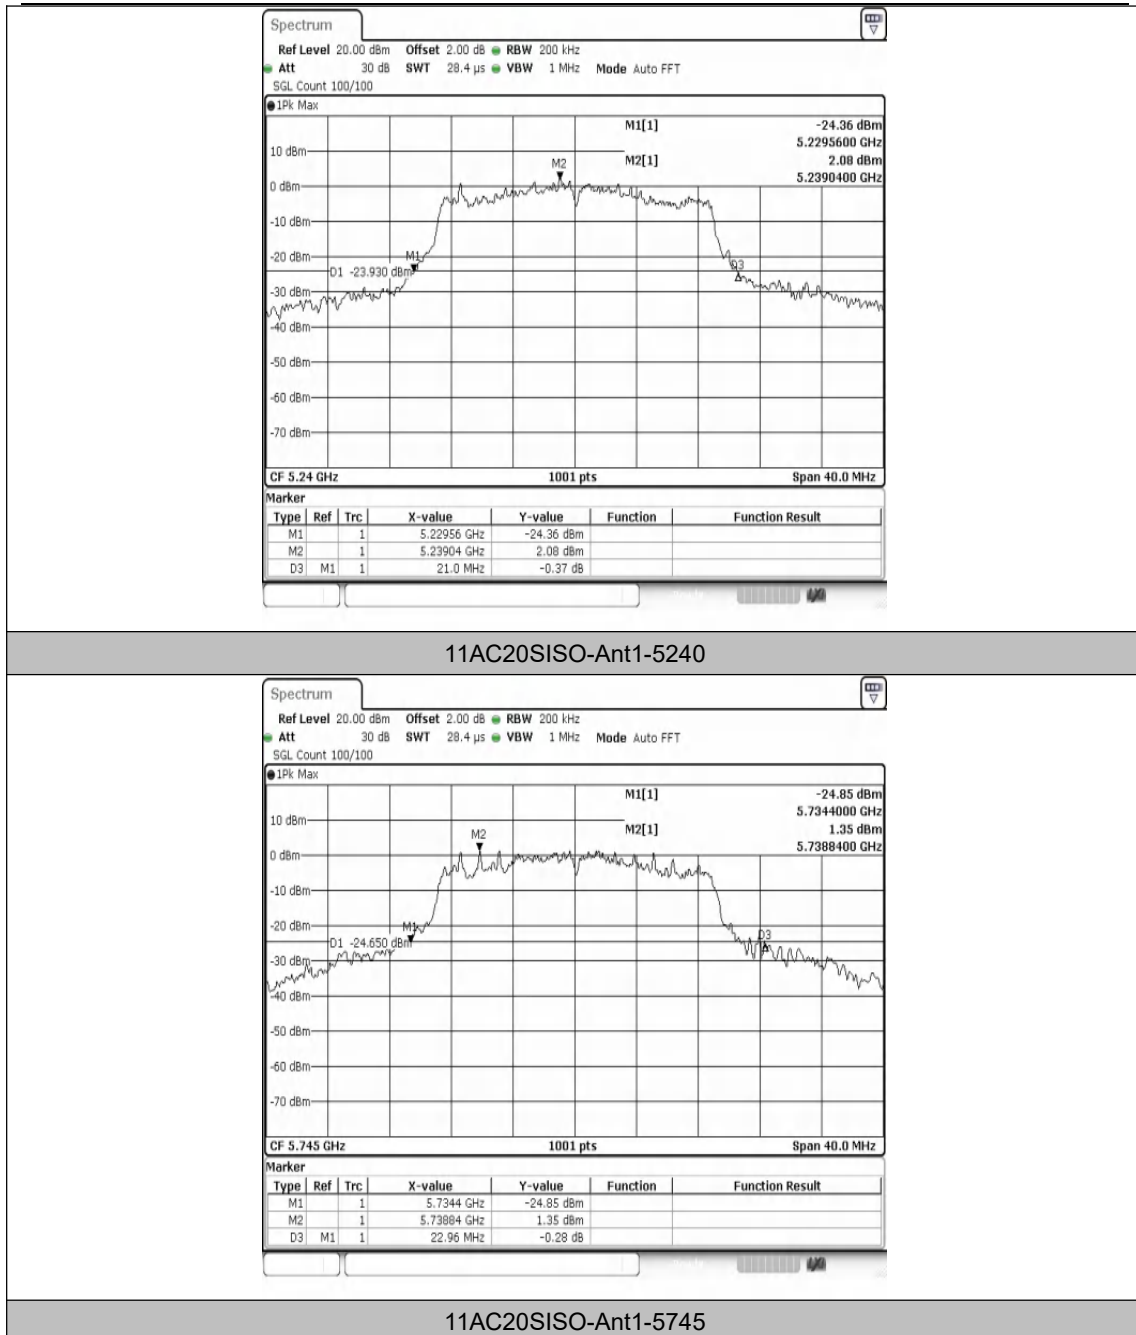

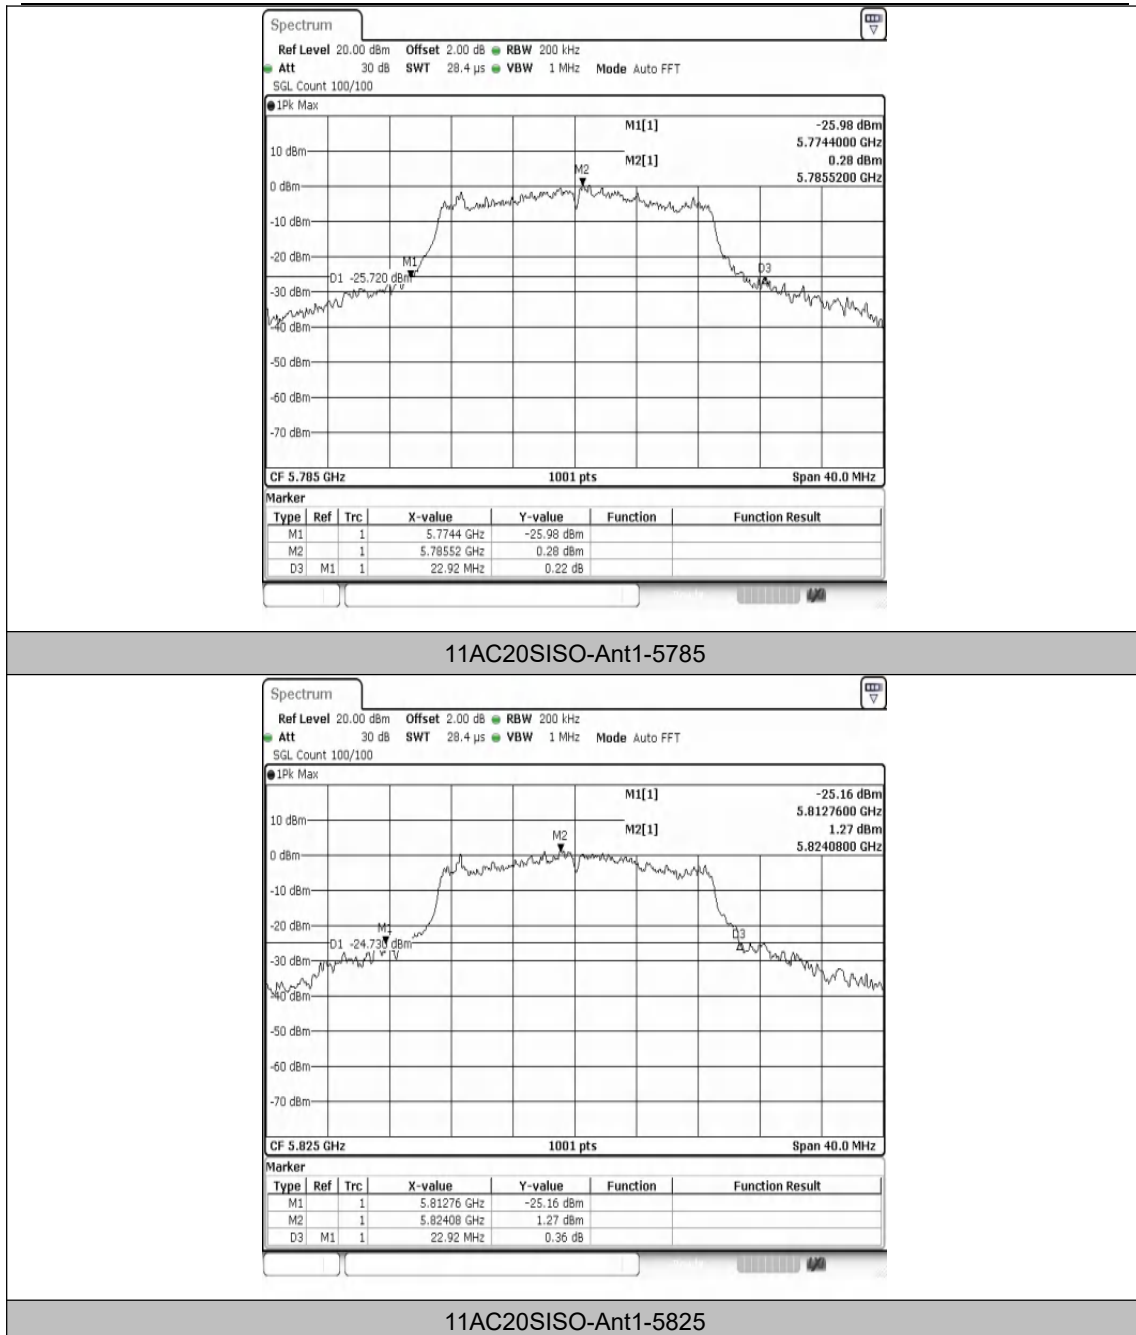


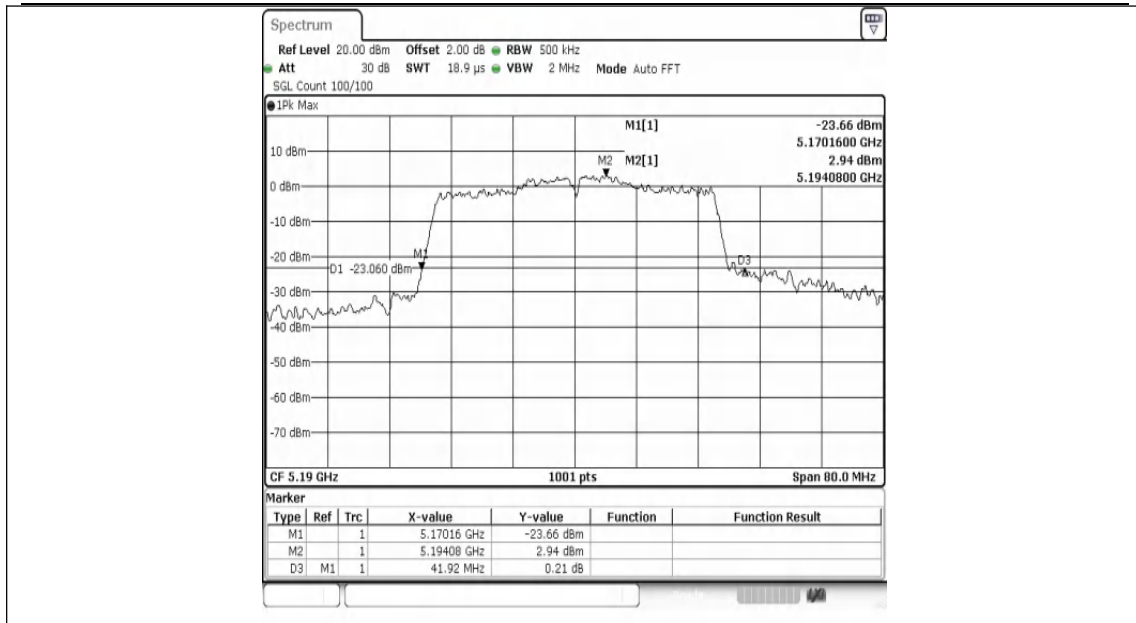


11AC40SISO-Ant1-5190

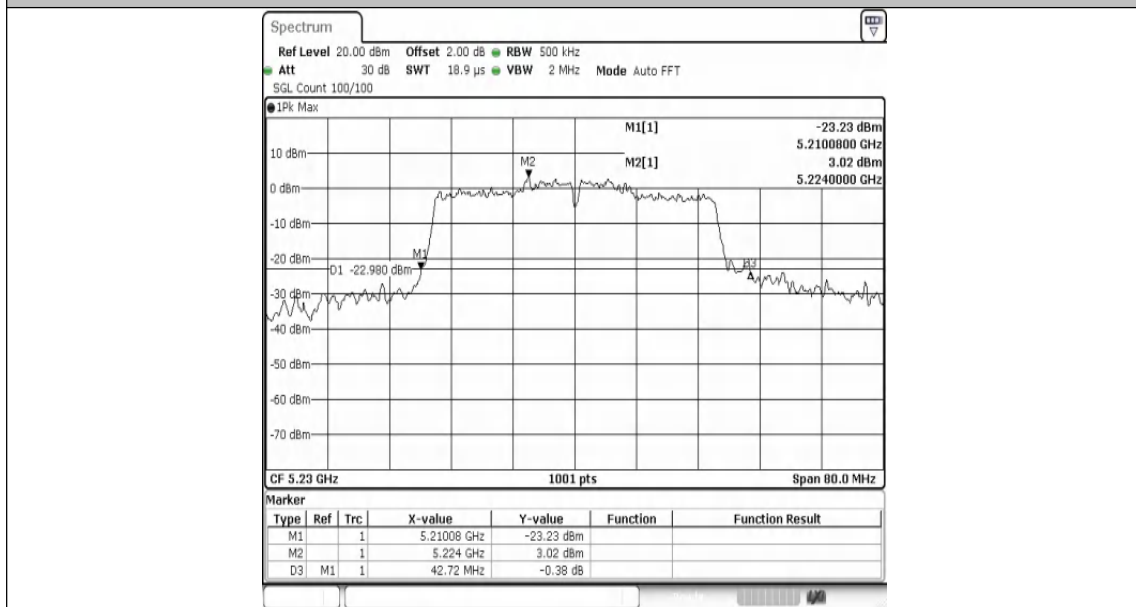

11AC40SISO-Ant1-5230

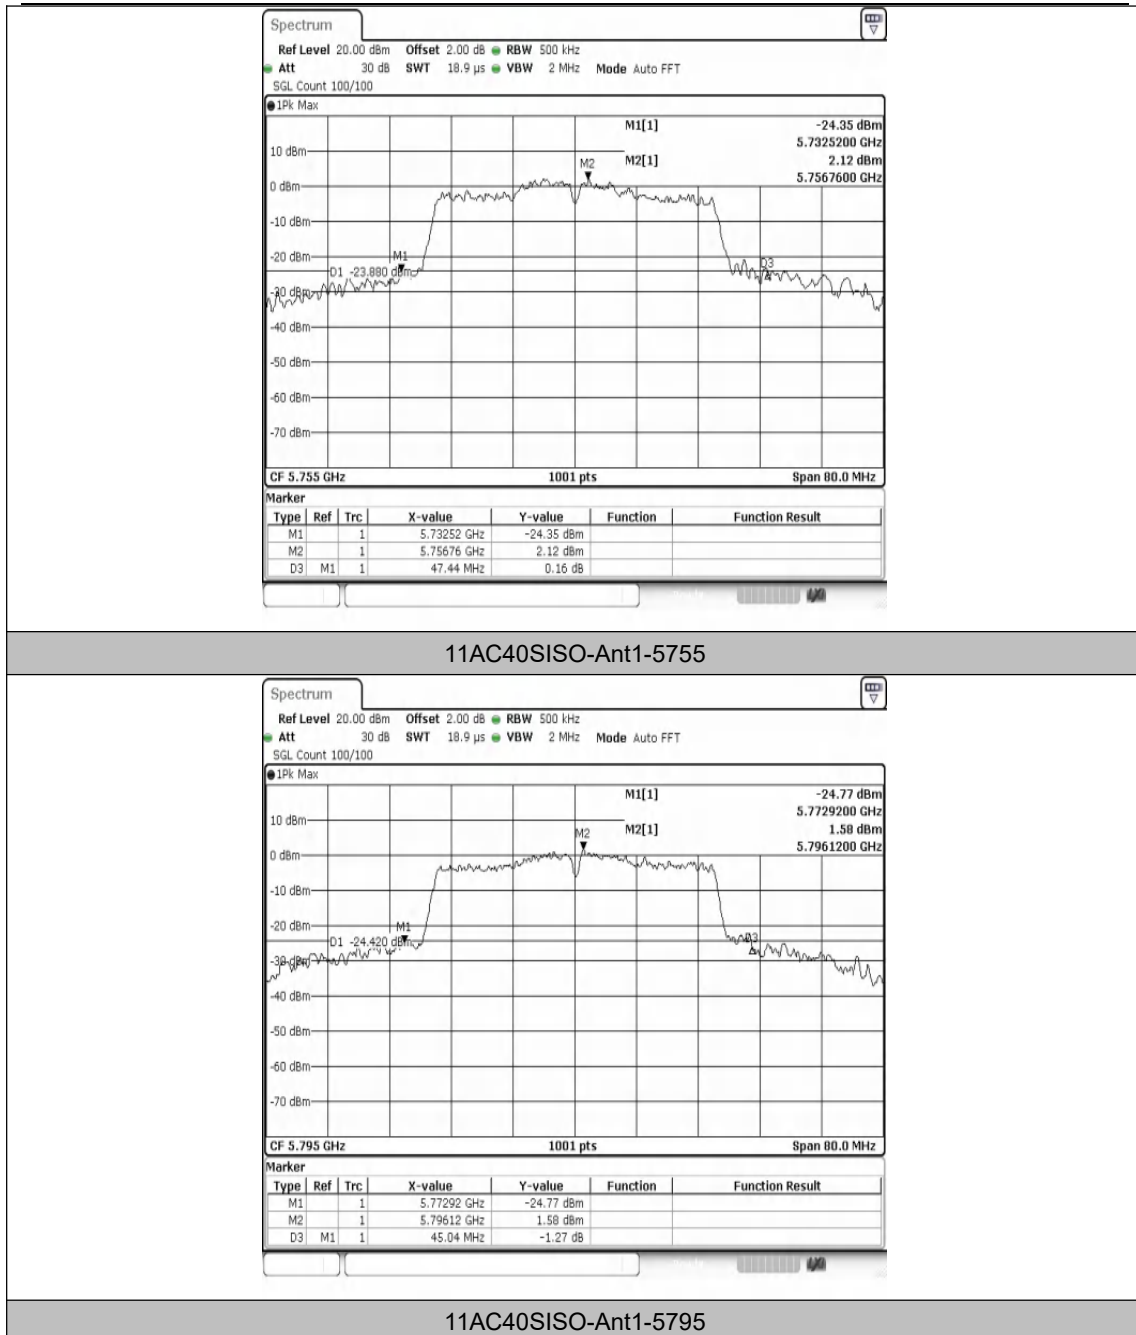

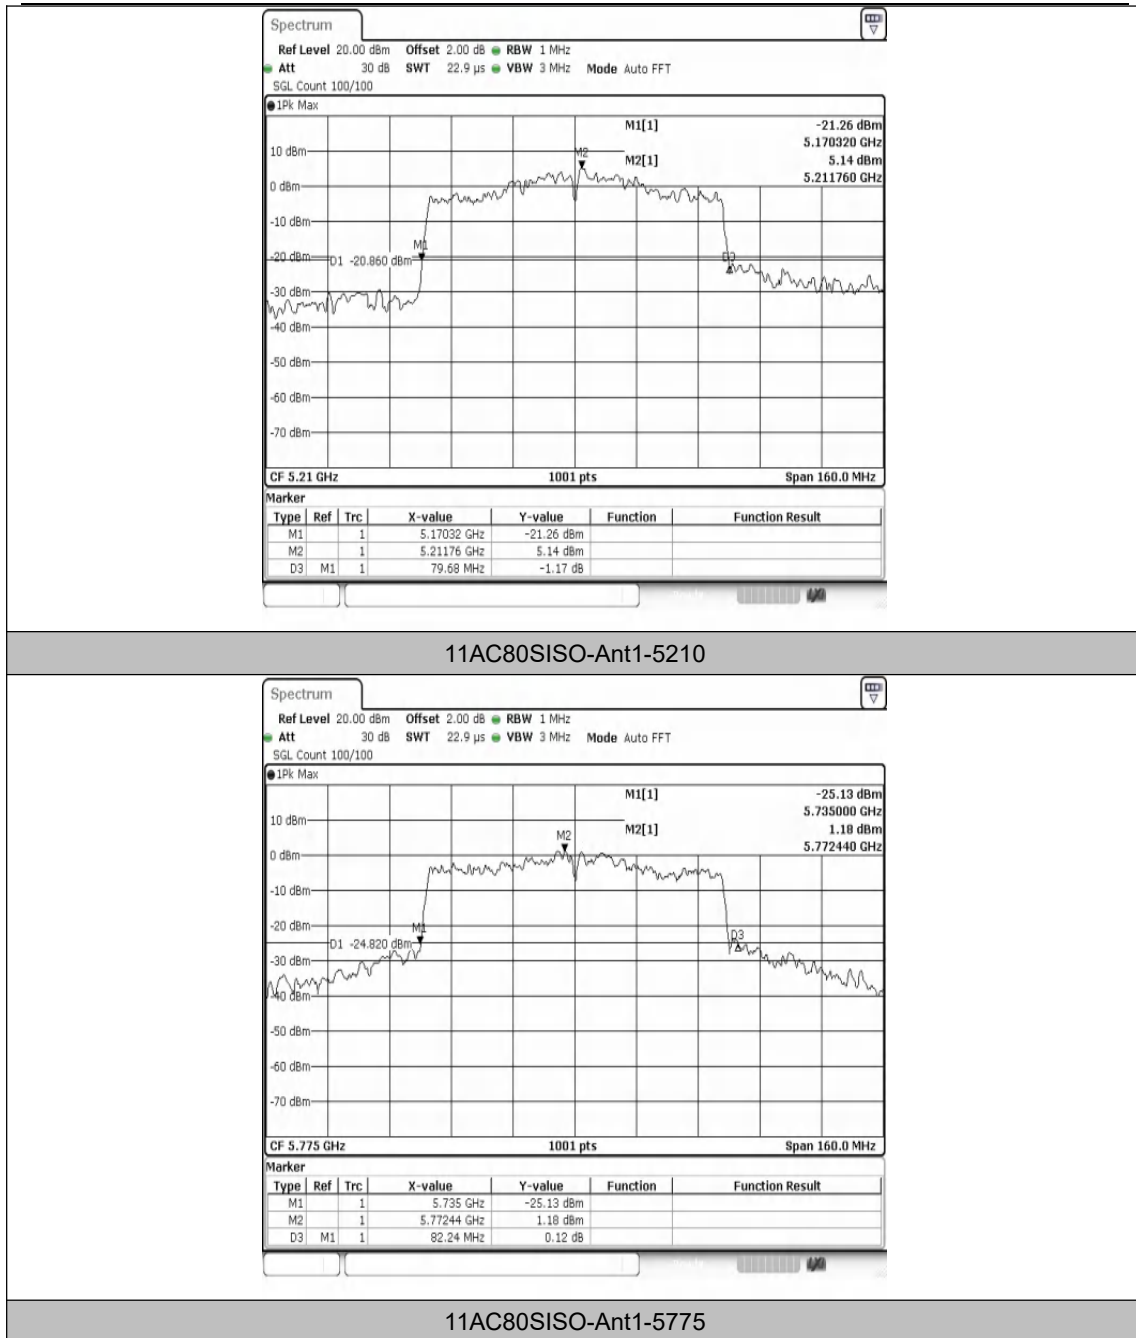



Appendix A2: 99% Occupied Bandwidth

Test Result


Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.063	5171.6883	5188.7512	---	---
11A	Ant1	5200	17.143	5191.6883	5208.8312	---	---
11A	Ant1	5240	17.063	5231.5285	5248.5914	---	---
11A	Ant1	5745	17.143	5736.5285	5753.6713	---	---
11A	Ant1	5785	17.143	5776.5285	5793.6713	---	---
11A	Ant1	5825	17.063	5816.4885	5833.5514	---	---
11N20SISO	Ant1	5180	18.541	5170.8891	5189.4306	---	---
11N20SISO	Ant1	5200	18.422	5191.0090	5209.4306	---	---
11N20SISO	Ant1	5240	18.422	5230.8092	5249.2308	---	---
11N20SISO	Ant1	5745	18.701	5735.6893	5754.3906	---	---
11N20SISO	Ant1	5785	18.701	5775.7293	5794.4306	---	---
11N20SISO	Ant1	5825	18.222	5815.9291	5834.1508	---	---
11N40SISO	Ant1	5190	36.364	5172.1778	5208.5415	---	---
11N40SISO	Ant1	5230	36.683	5211.7782	5248.4615	---	---
11N40SISO	Ant1	5755	36.603	5736.6184	5773.2218	---	---
11N40SISO	Ant1	5795	36.843	5776.6983	5813.5415	---	---
11AC20SISO	Ant1	5180	18.102	5171.0889	5189.1908	---	---
11AC20SISO	Ant1	5200	18.342	5190.8891	5209.2308	---	---
11AC20SISO	Ant1	5240	18.182	5231.1289	5249.3107	---	---
11AC20SISO	Ant1	5745	18.462	5735.7293	5754.1908	---	---
11AC20SISO	Ant1	5785	18.581	5775.8891	5794.4705	---	---
11AC20SISO	Ant1	5825	18.022	5816.1289	5834.1508	---	---
11AC40SISO	Ant1	5190	36.364	5172.0180	5208.3816	---	---
11AC40SISO	Ant1	5230	36.364	5211.7782	5248.1419	---	---
11AC40SISO	Ant1	5755	36.444	5736.7782	5773.2218	---	---
11AC40SISO	Ant1	5795	36.444	5776.8581	5813.3017	---	---
11AC80SISO	Ant1	5210	75.924	5172.7572	5248.6813	---	---
11AC80SISO	Ant1	5775	76.404	5736.9580	5813.3616	---	---

Test Graphs

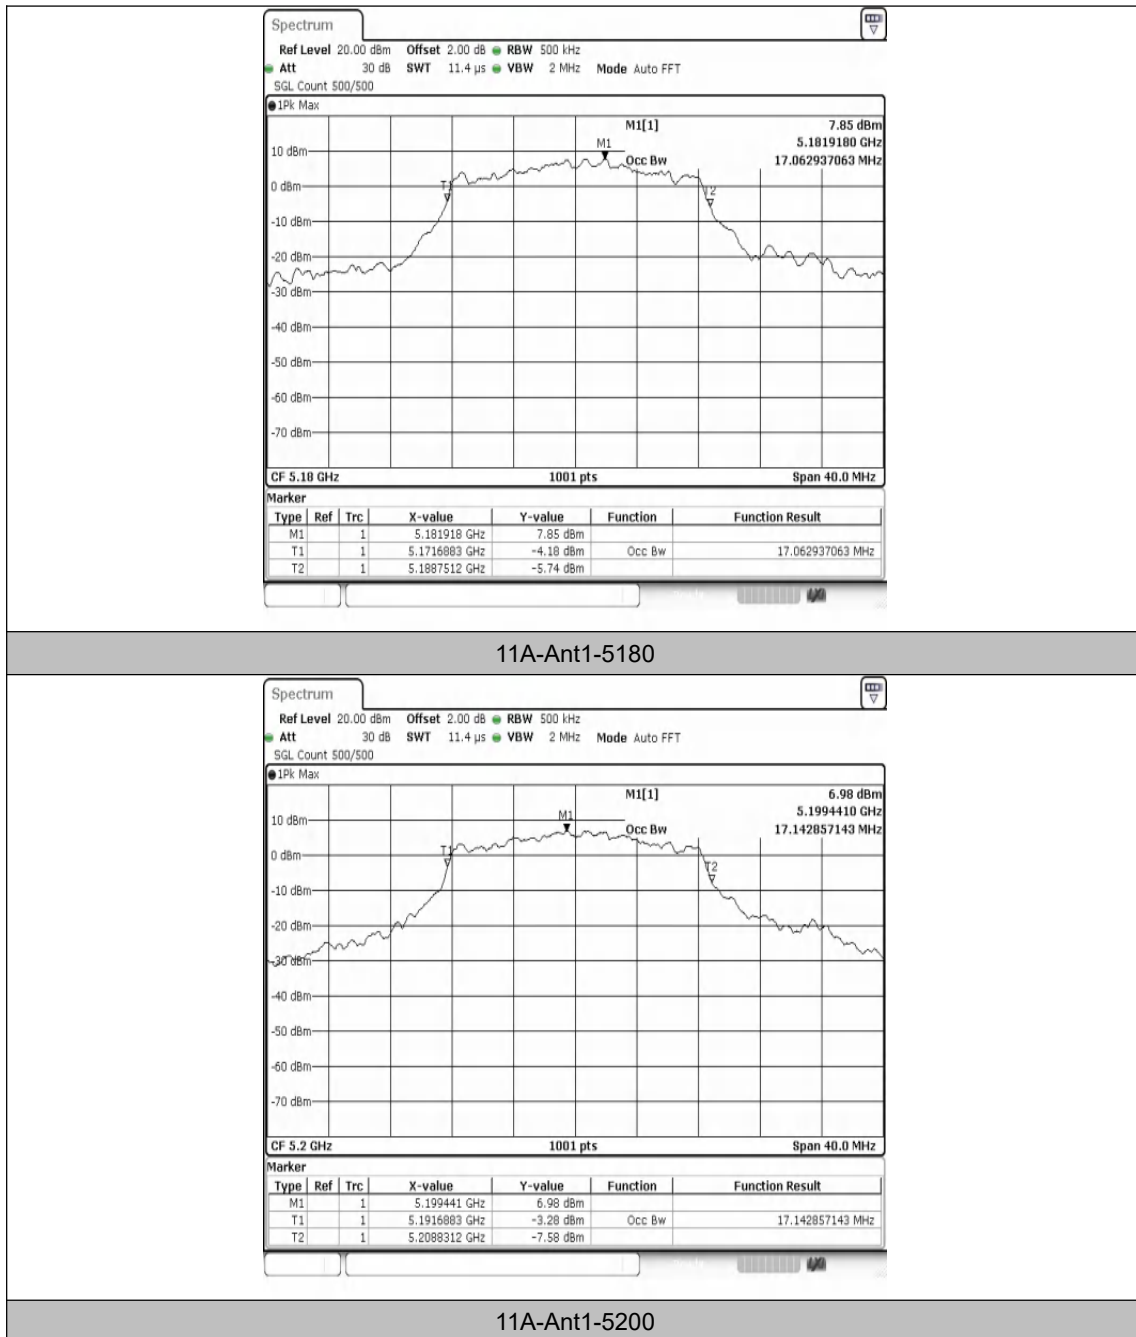


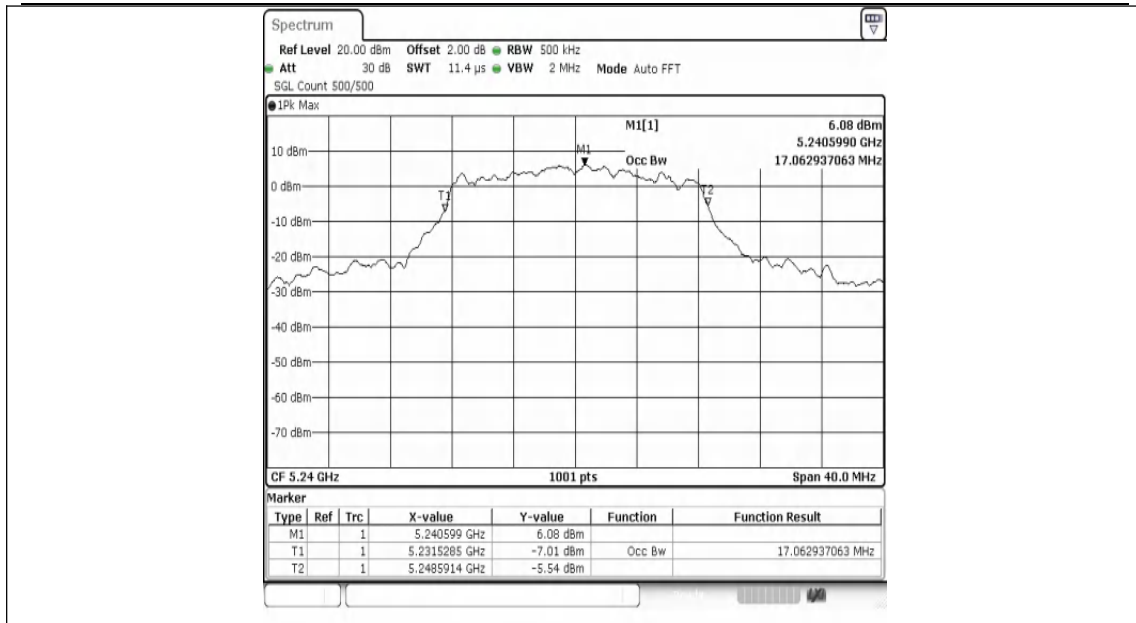



11A-Ant1-5240

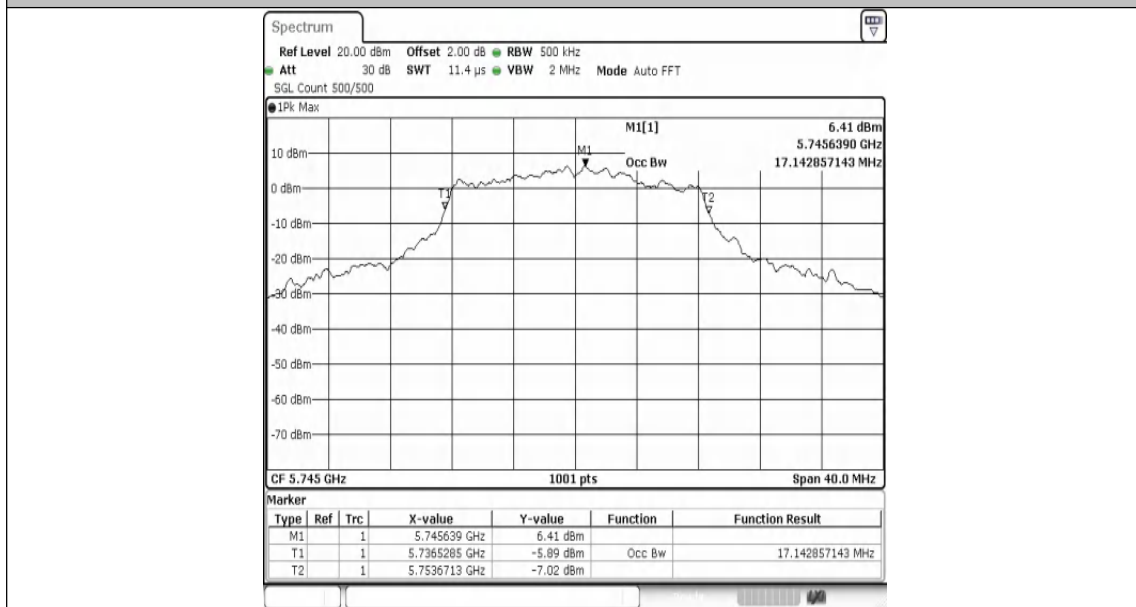



11A-Ant1-5745

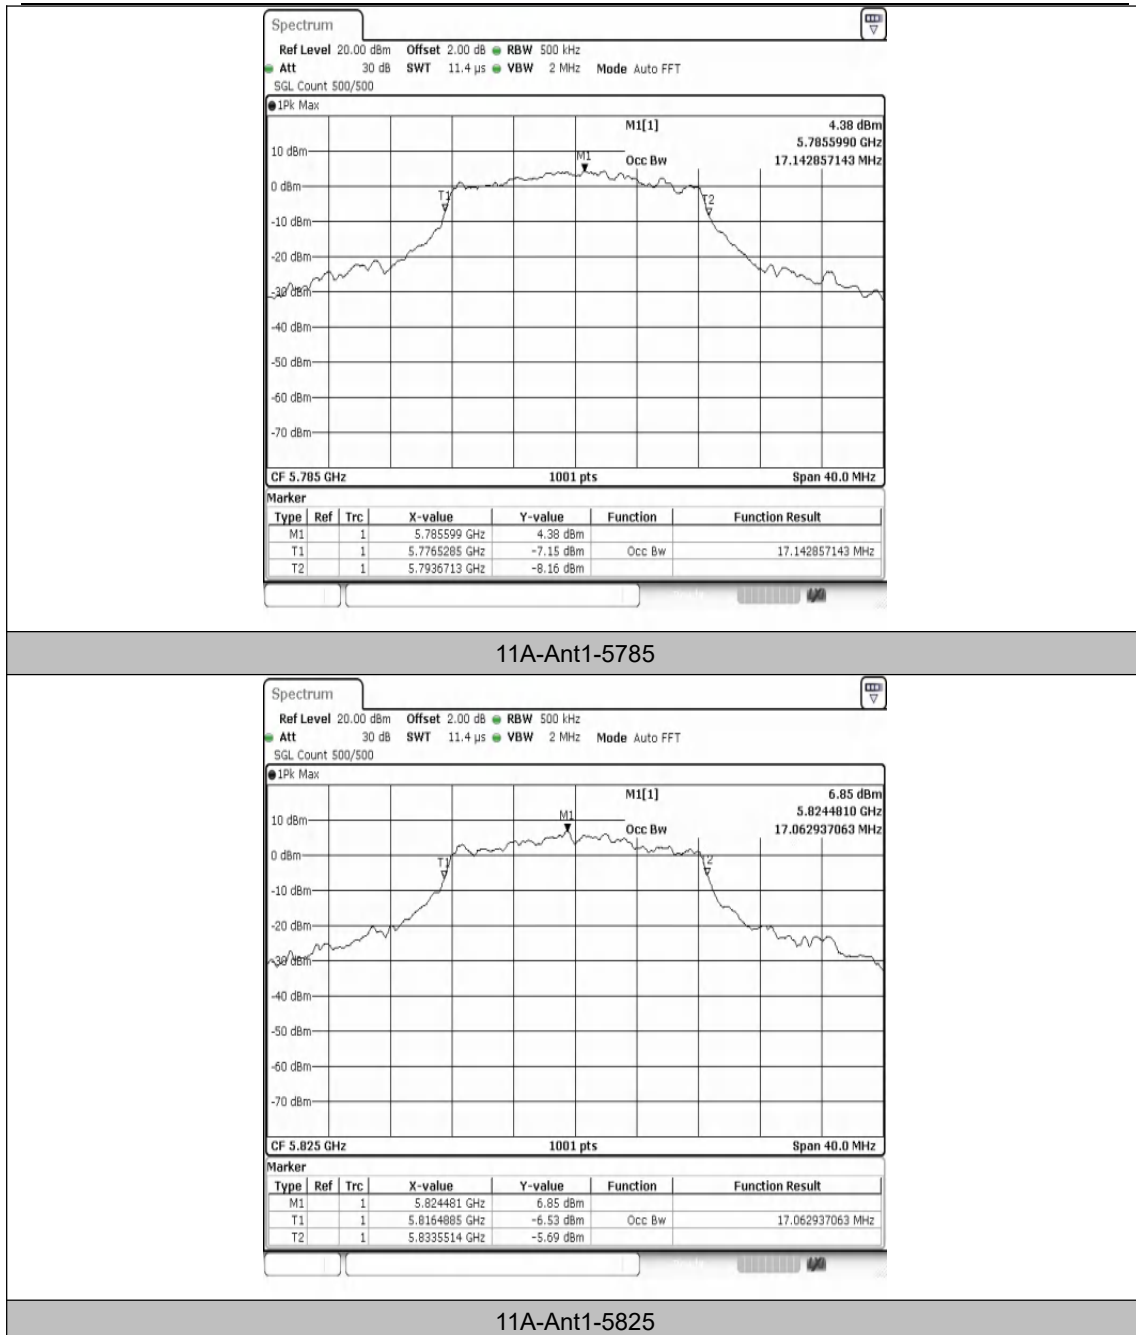


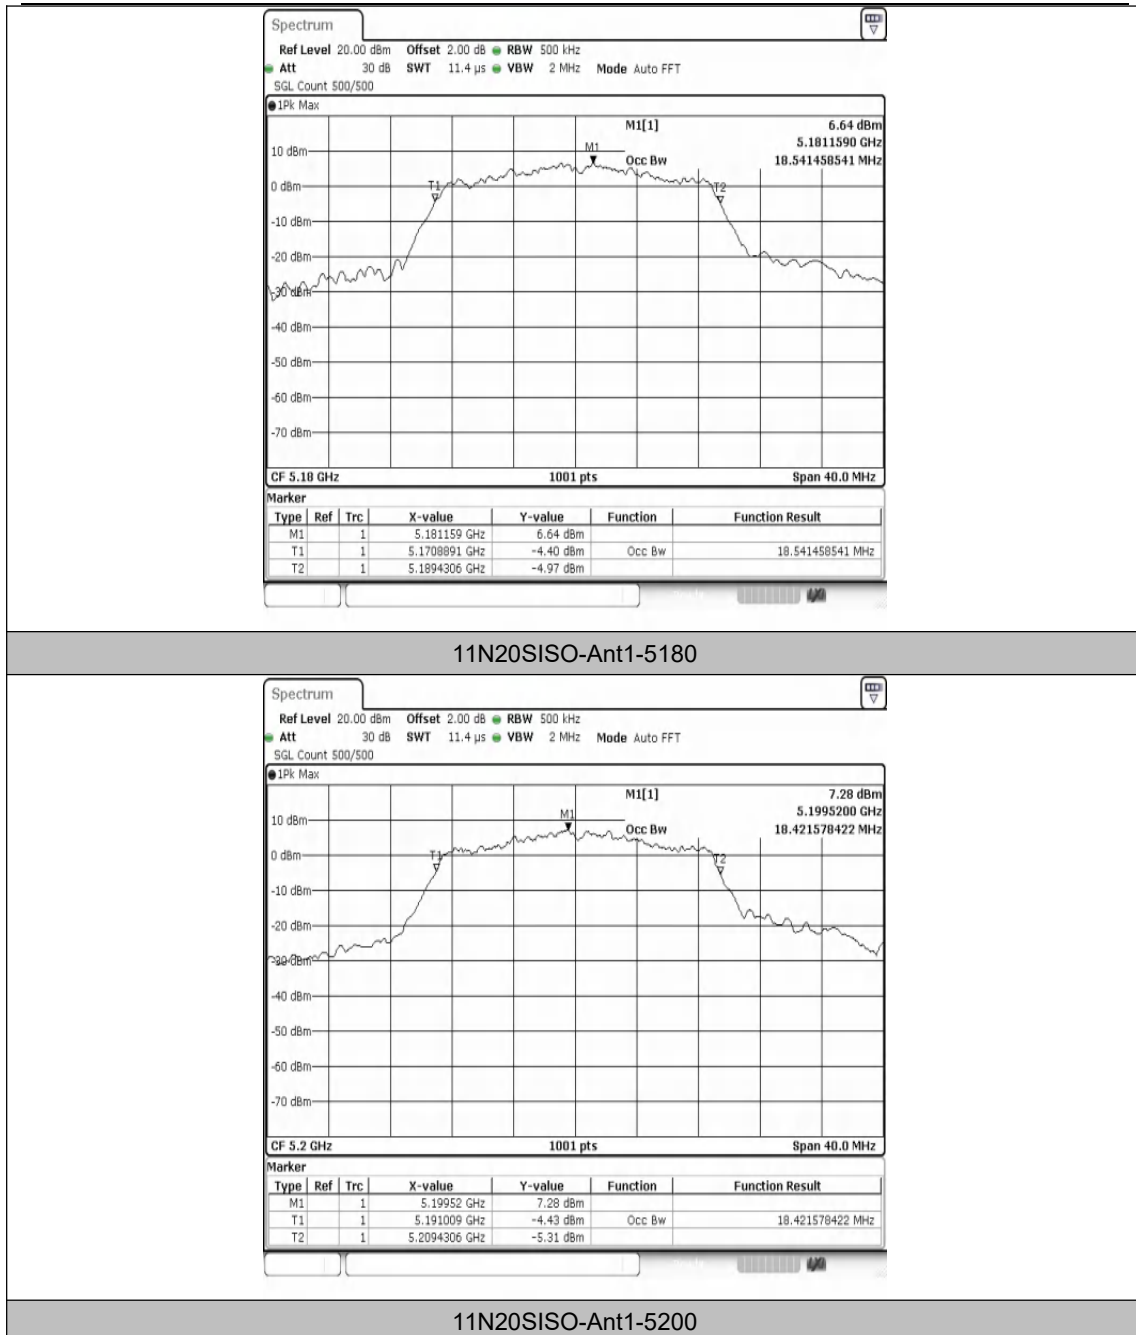


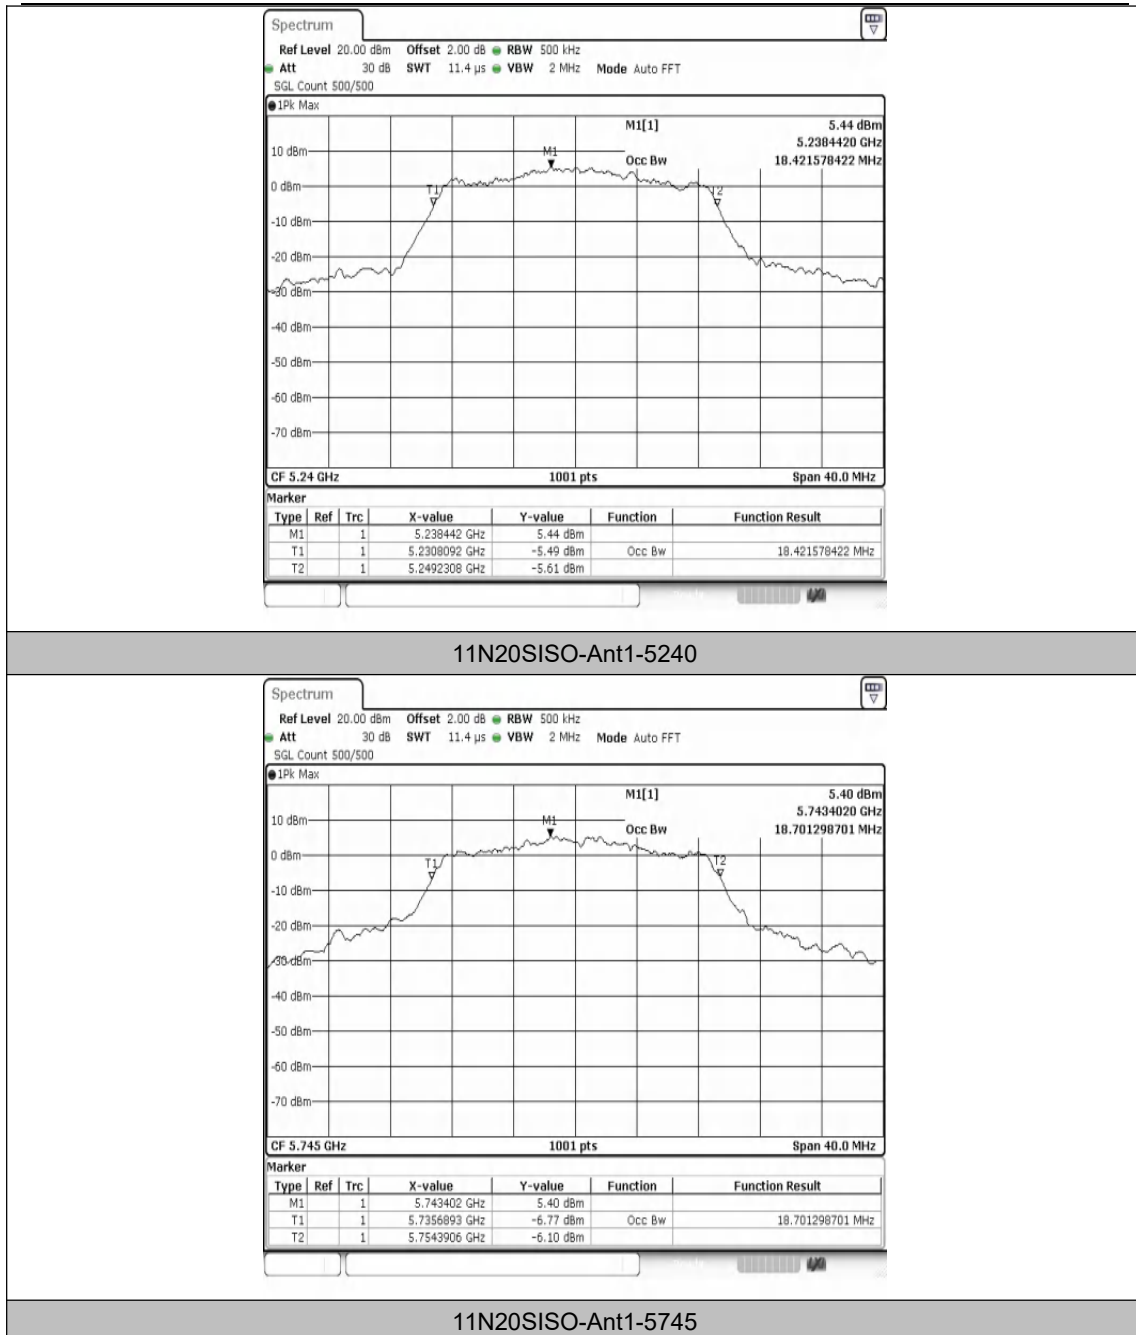


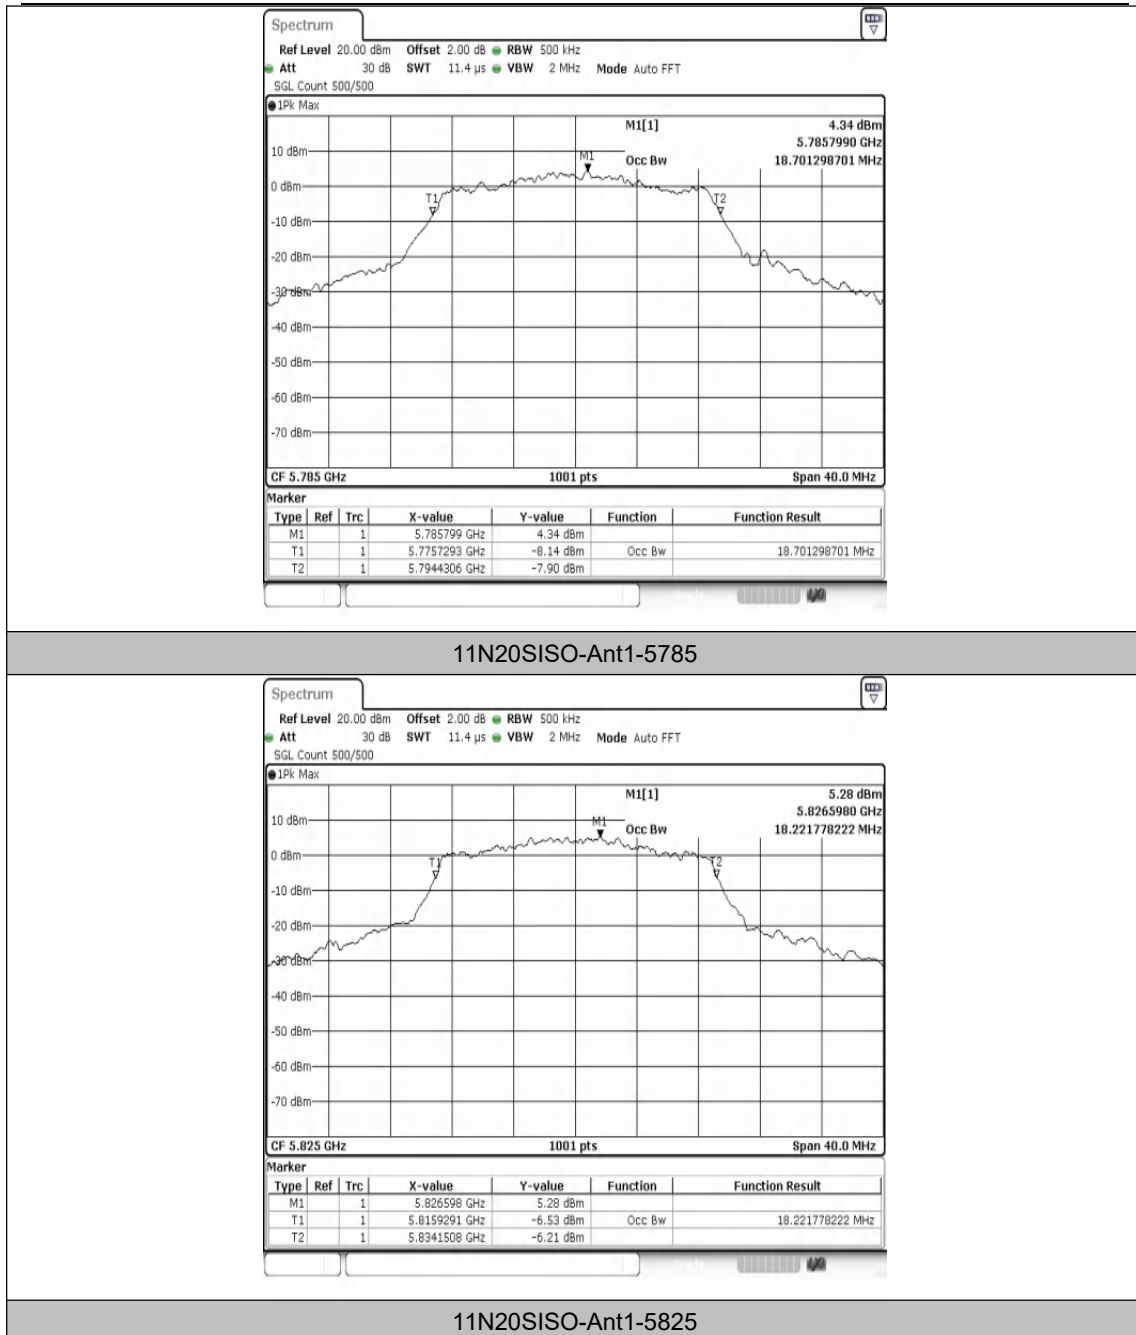


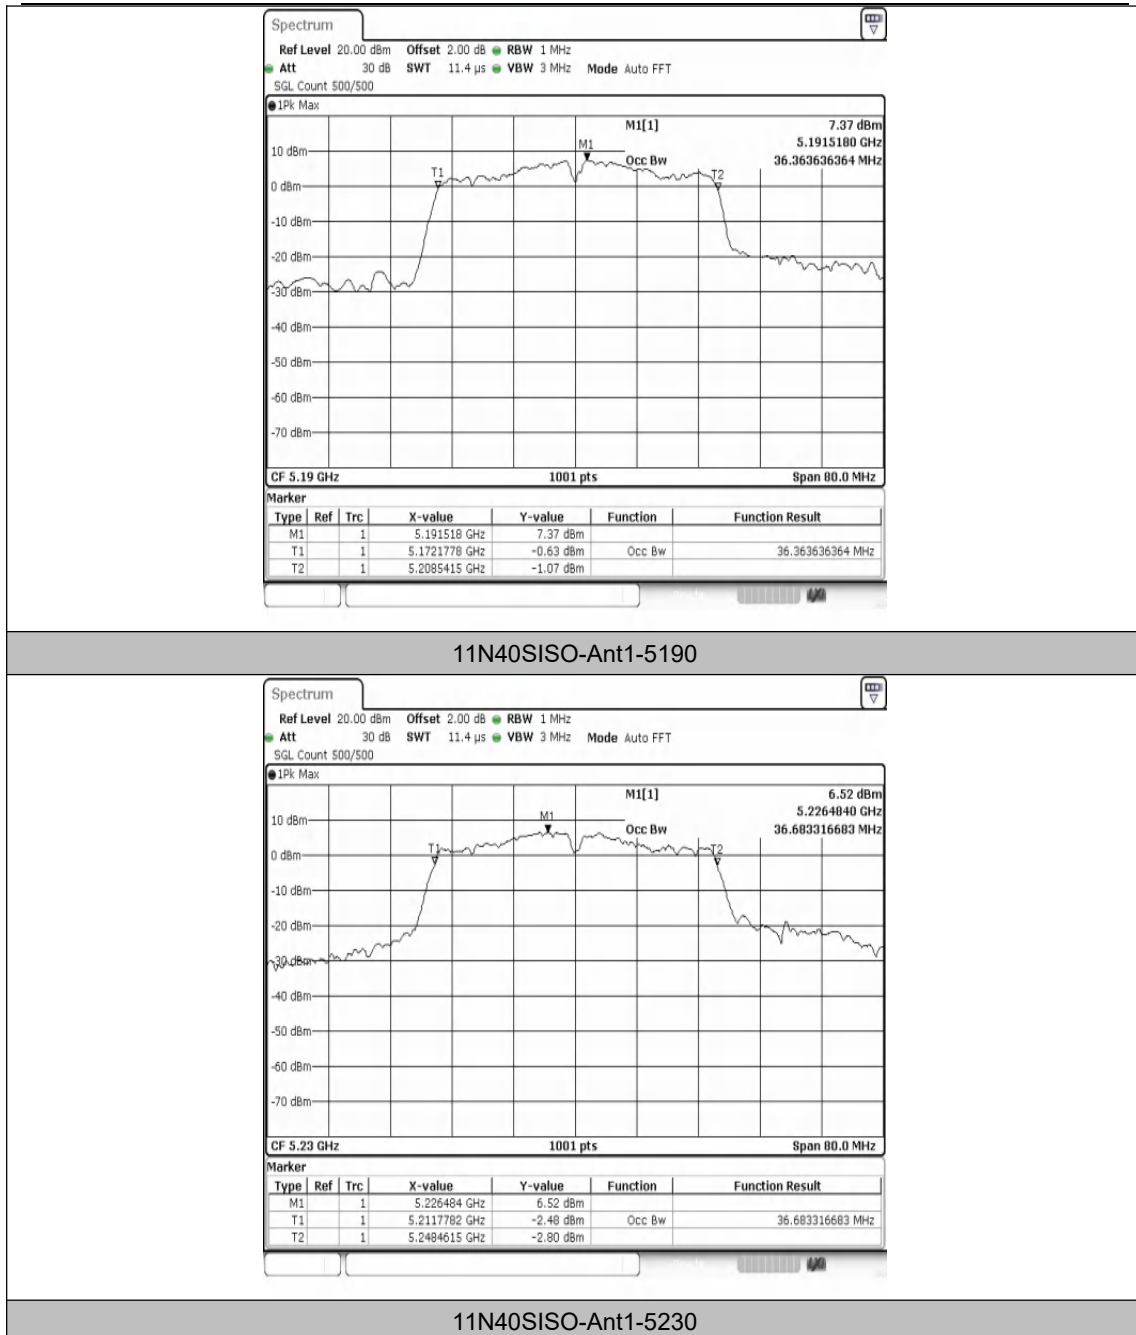


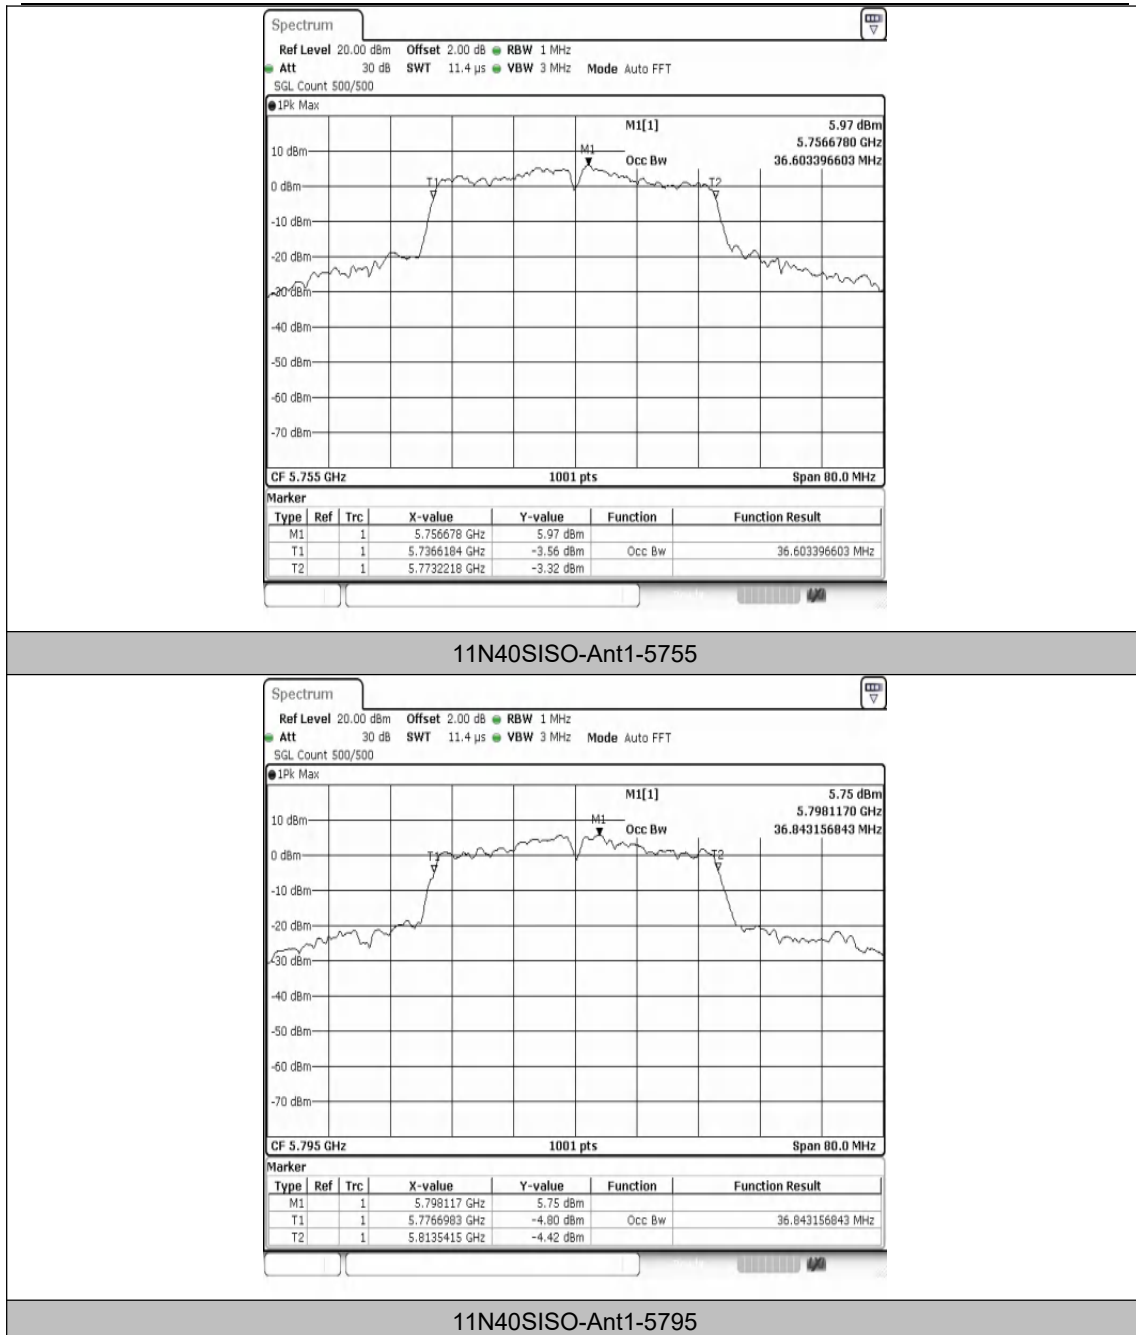


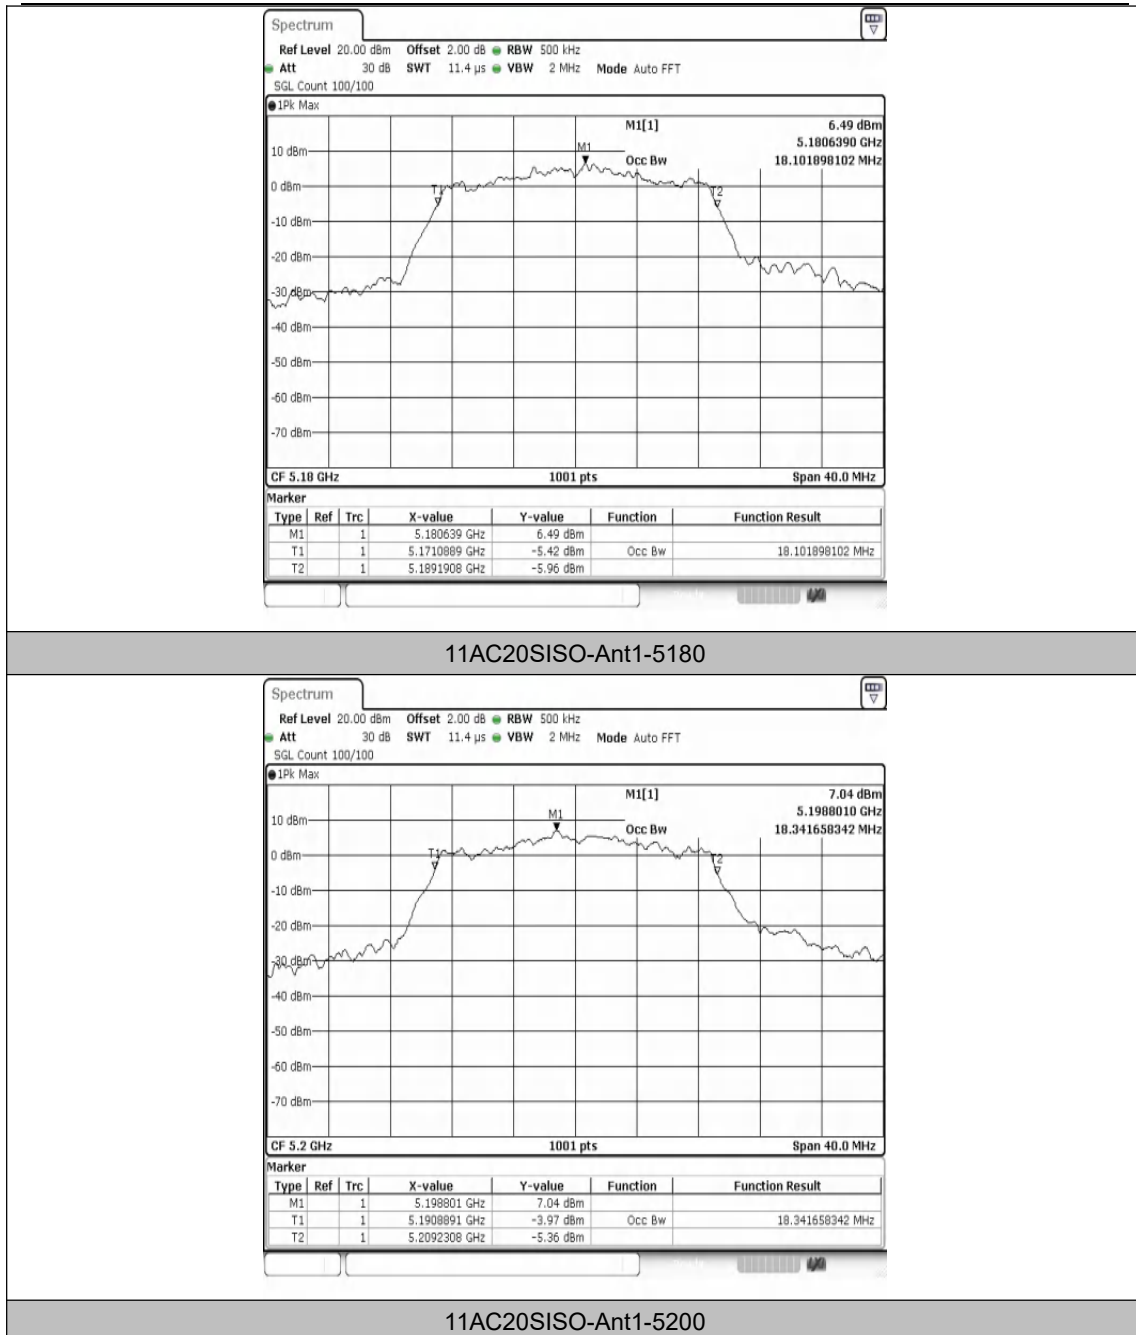


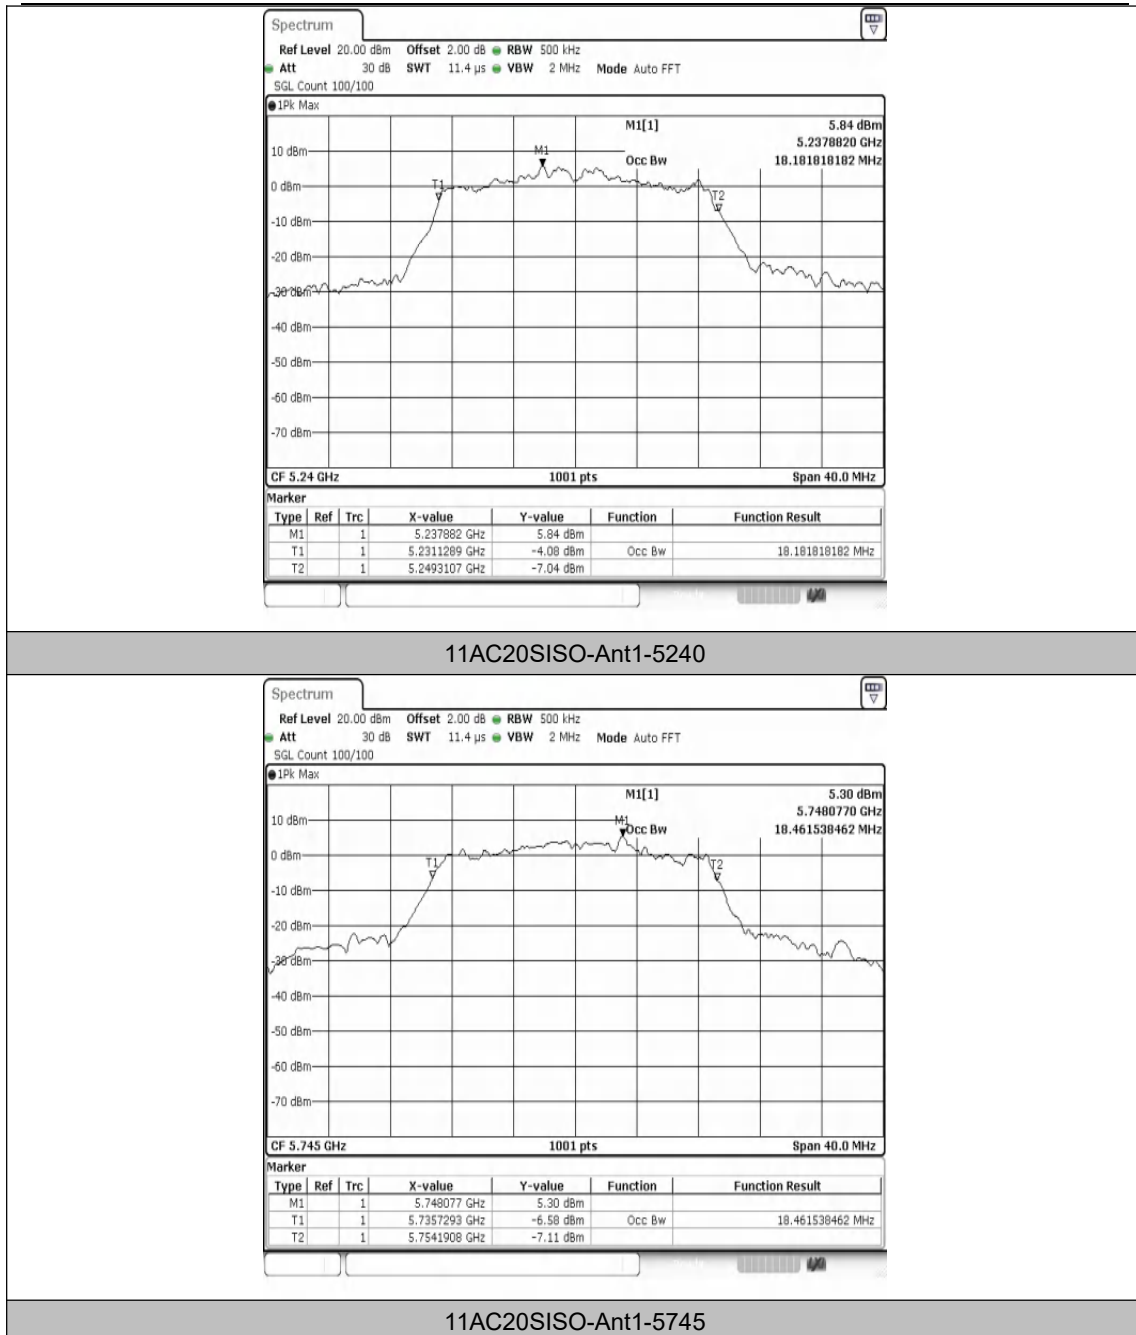

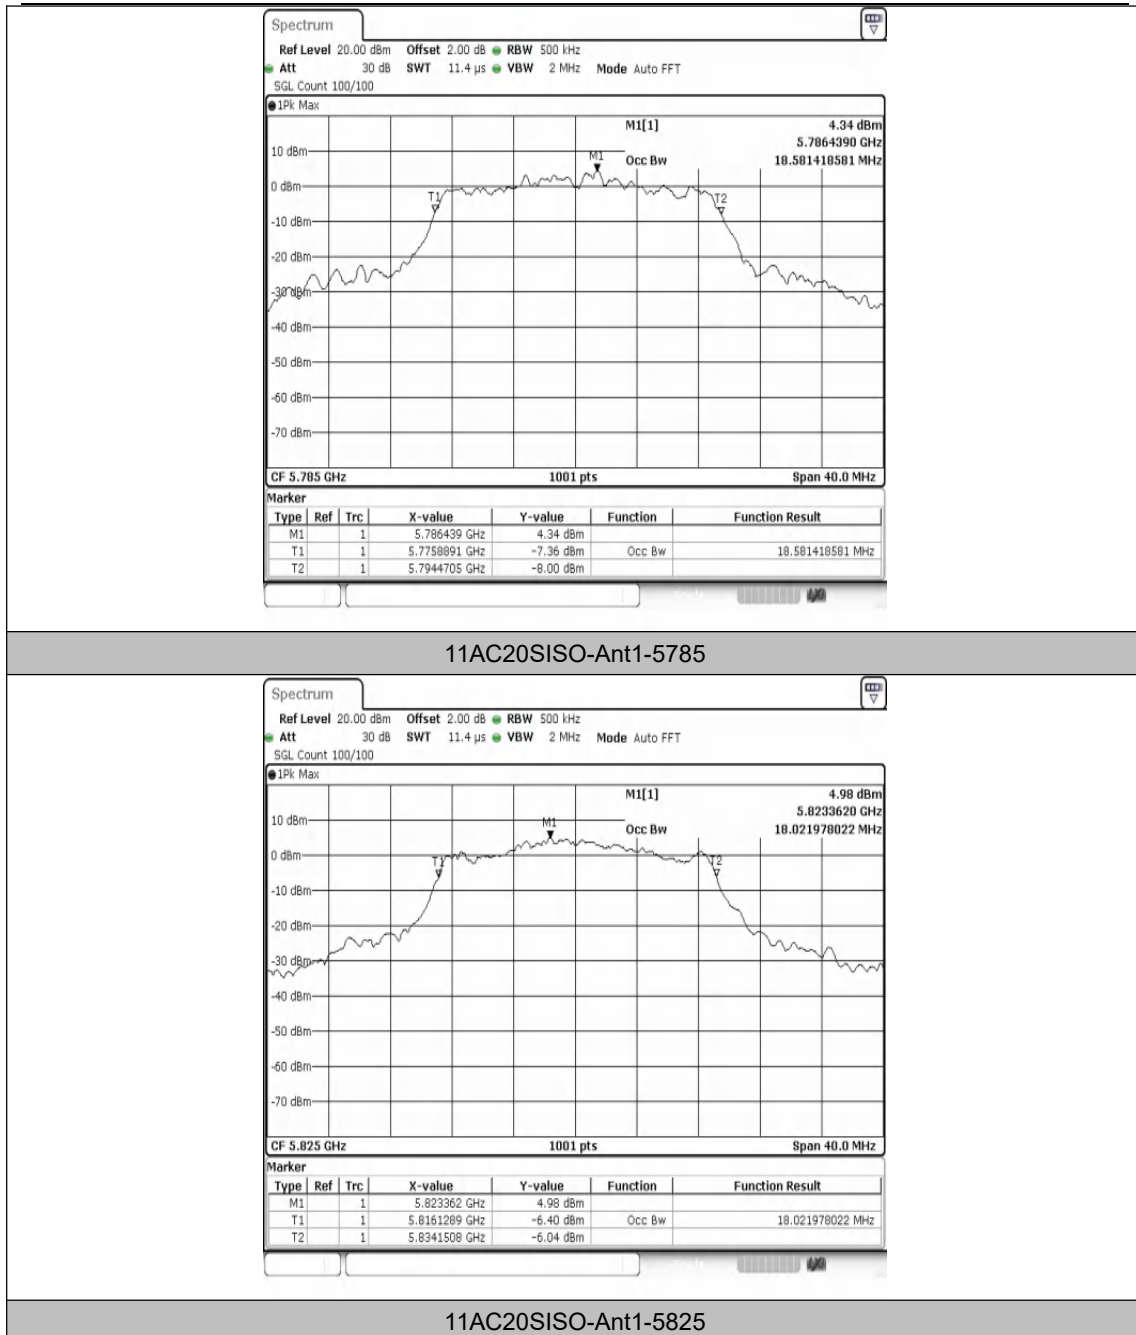

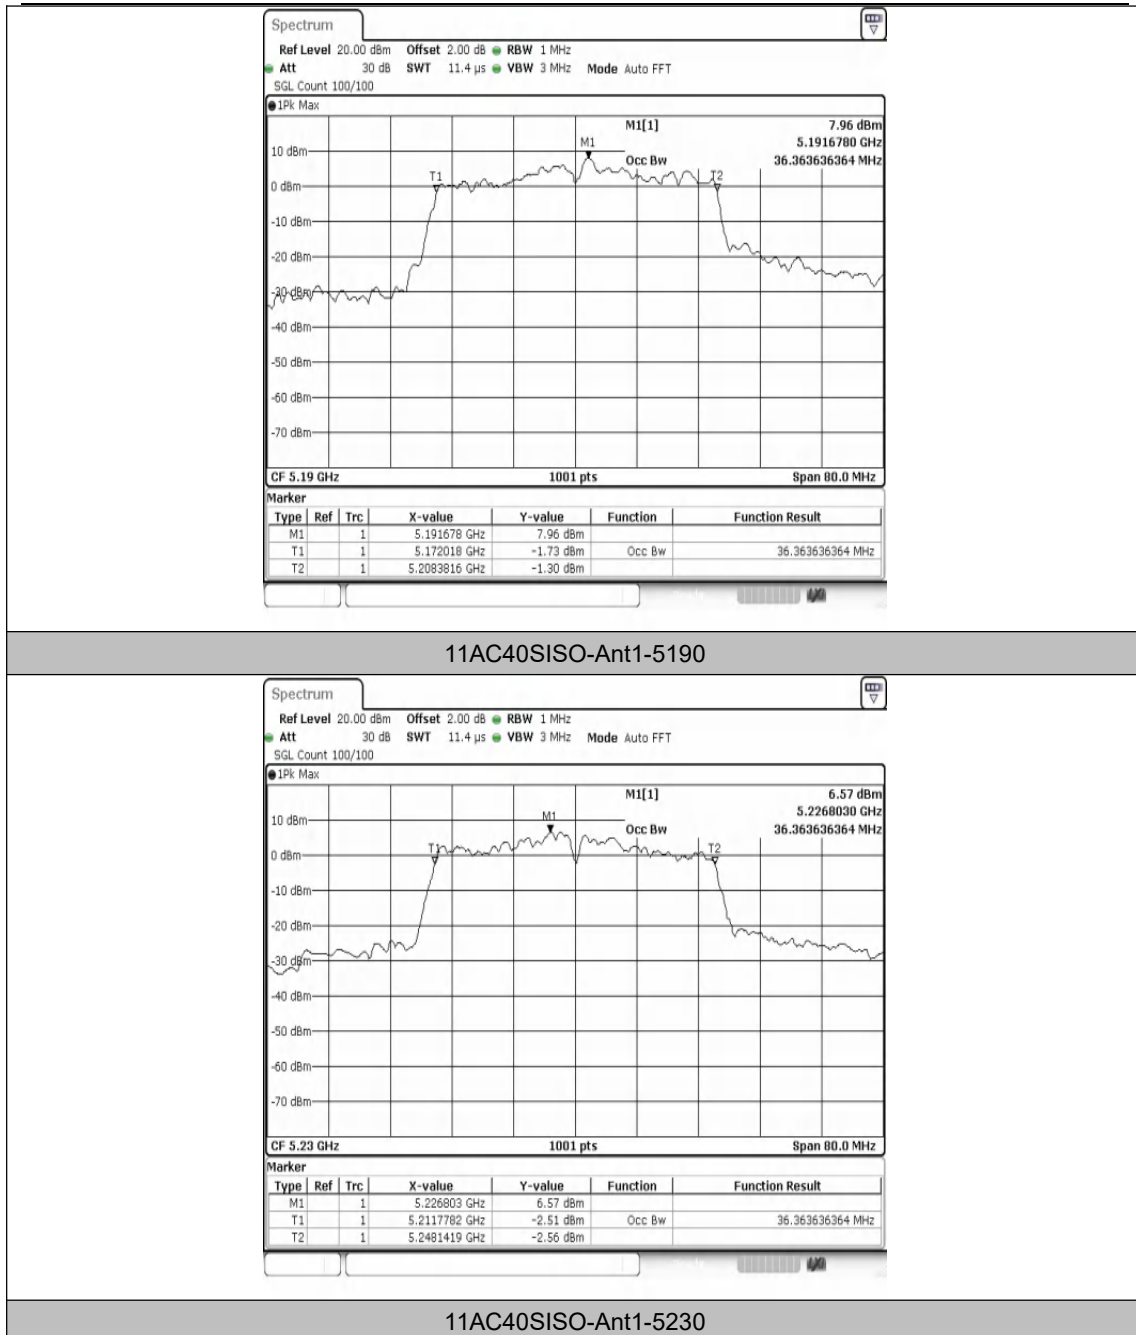

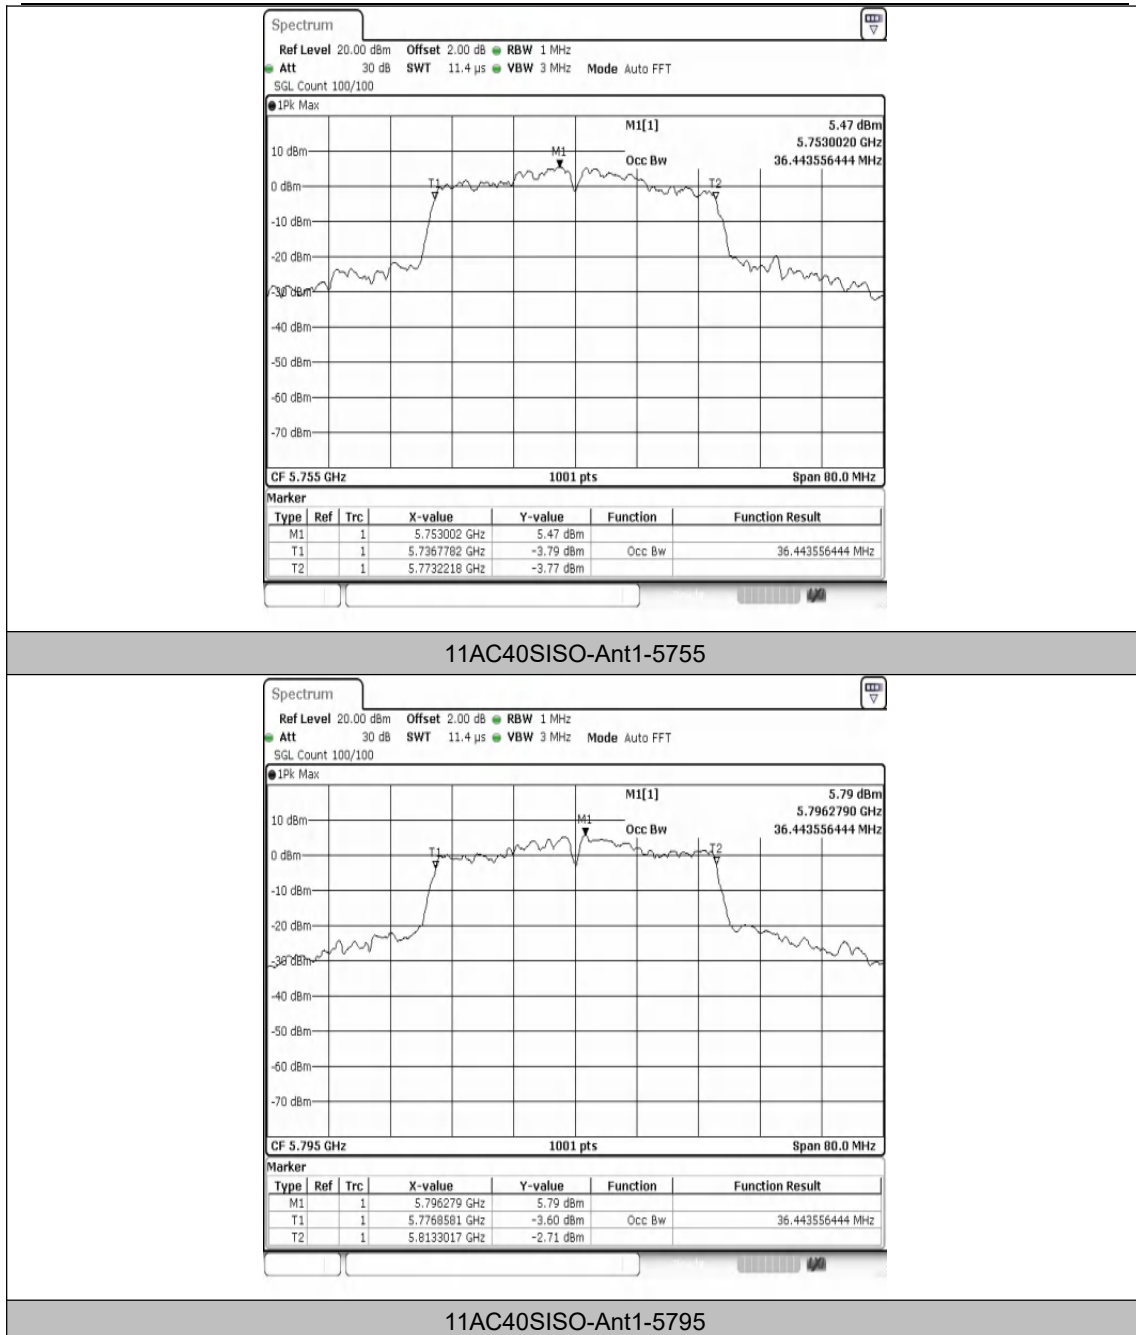

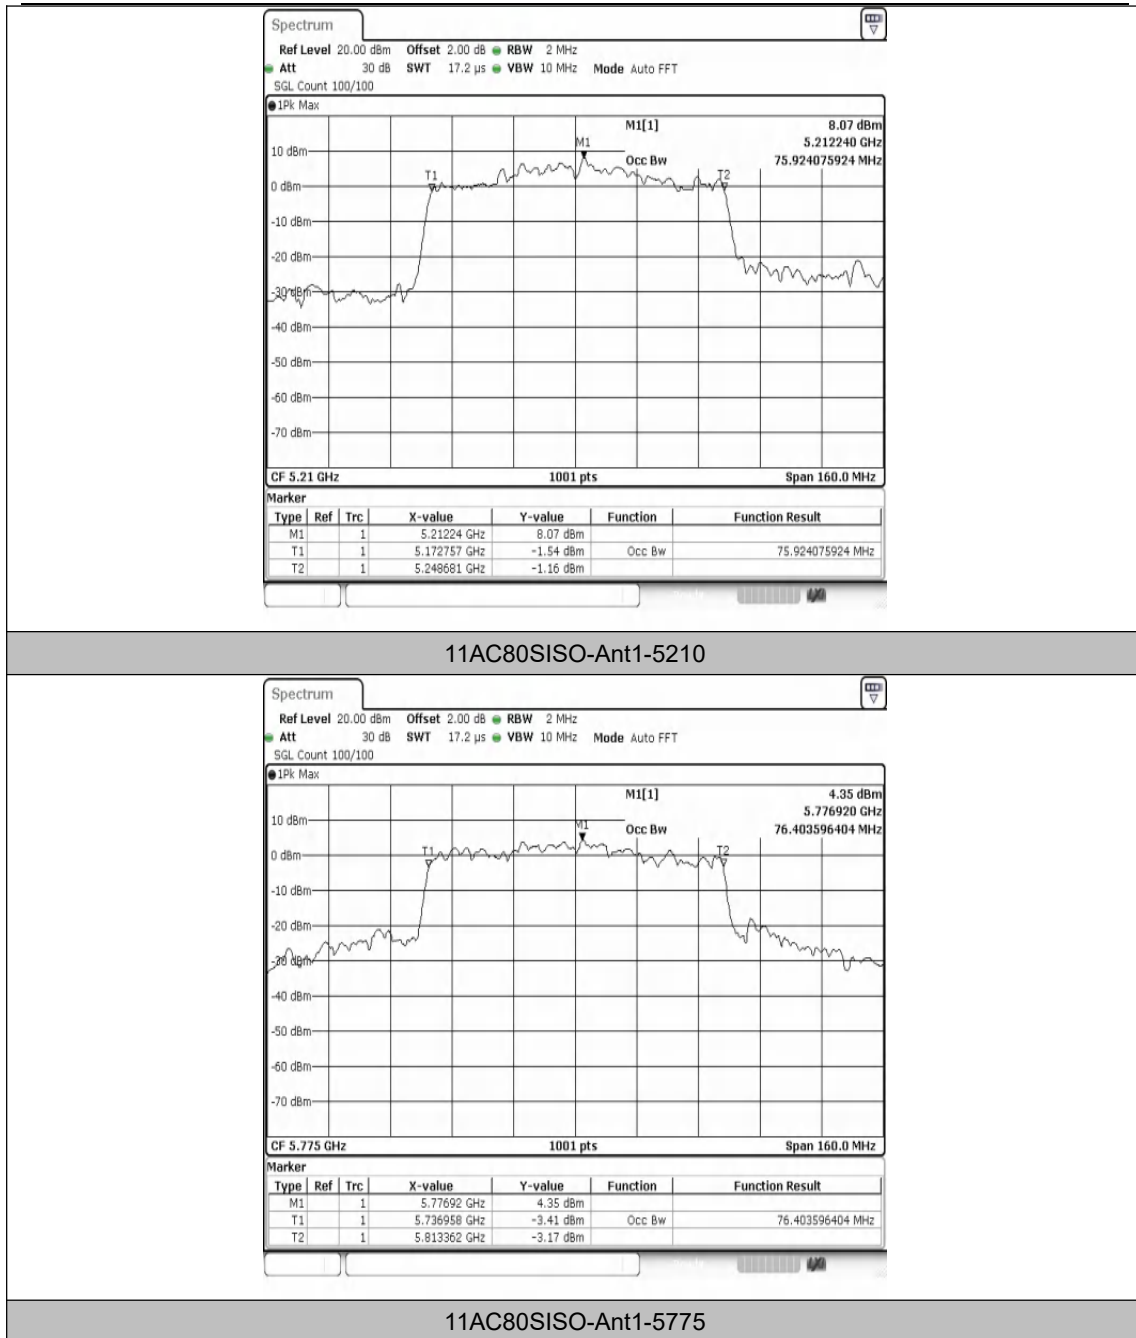


Appendix A3: Minimum 6dB Bandwidth


Test Result B4


Test Mode	Antenna	Frequency [MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	15.12	5737.56	5752.68	0.5	PASS
11A	Ant1	5785	15.36	5777.32	5792.68	0.5	PASS
11A	Ant1	5825	15.32	5817.32	5832.64	0.5	PASS
11N20SISO	Ant1	5745	13.84	5738.76	5752.60	0.5	PASS
11N20SISO	Ant1	5785	17.04	5776.60	5793.64	0.5	PASS
11N20SISO	Ant1	5825	17.56	5816.32	5833.88	0.5	PASS
11N40SISO	Ant1	5755	35.36	5737.32	5772.68	0.5	PASS
11N40SISO	Ant1	5795	35.68	5777.56	5813.24	0.5	PASS
11AC20SISO	Ant1	5745	17.16	5736.68	5753.84	0.5	PASS
11AC20SISO	Ant1	5785	15.64	5777.60	5793.24	0.5	PASS
11AC20SISO	Ant1	5825	13.92	5817.52	5831.44	0.5	PASS
11AC40SISO	Ant1	5755	27.60	5737.24	5764.84	0.5	PASS
11AC40SISO	Ant1	5795	35.20	5777.48	5812.68	0.5	PASS
11AC80SISO	Ant1	5775	75.36	5737.40	5812.76	0.5	PASS





Test Graphs B4

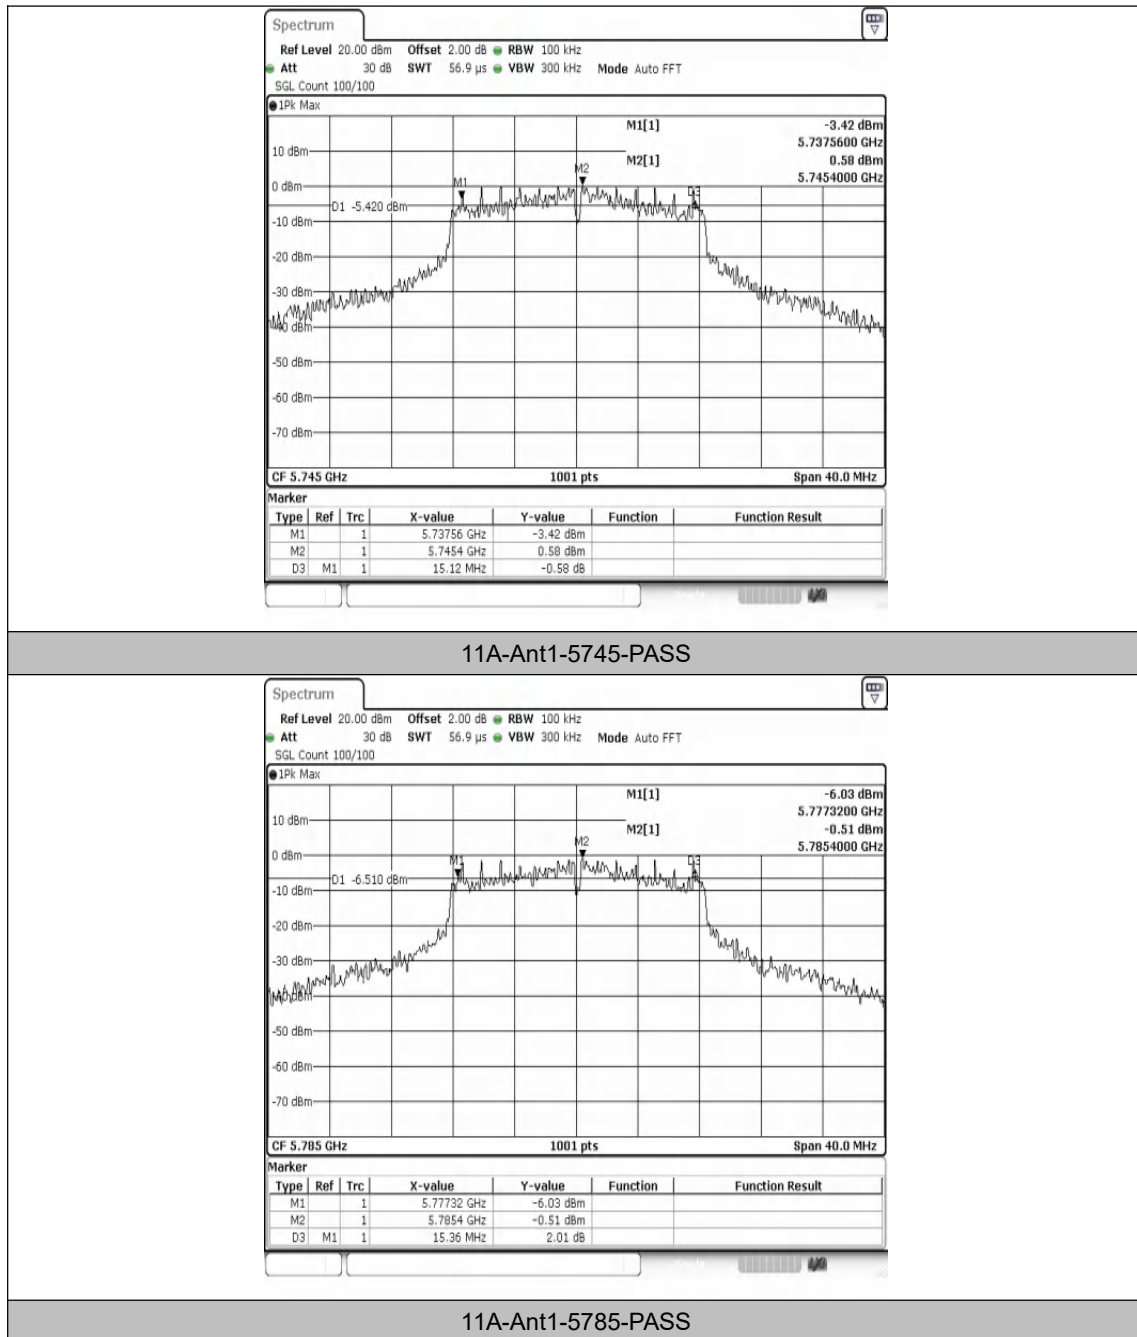

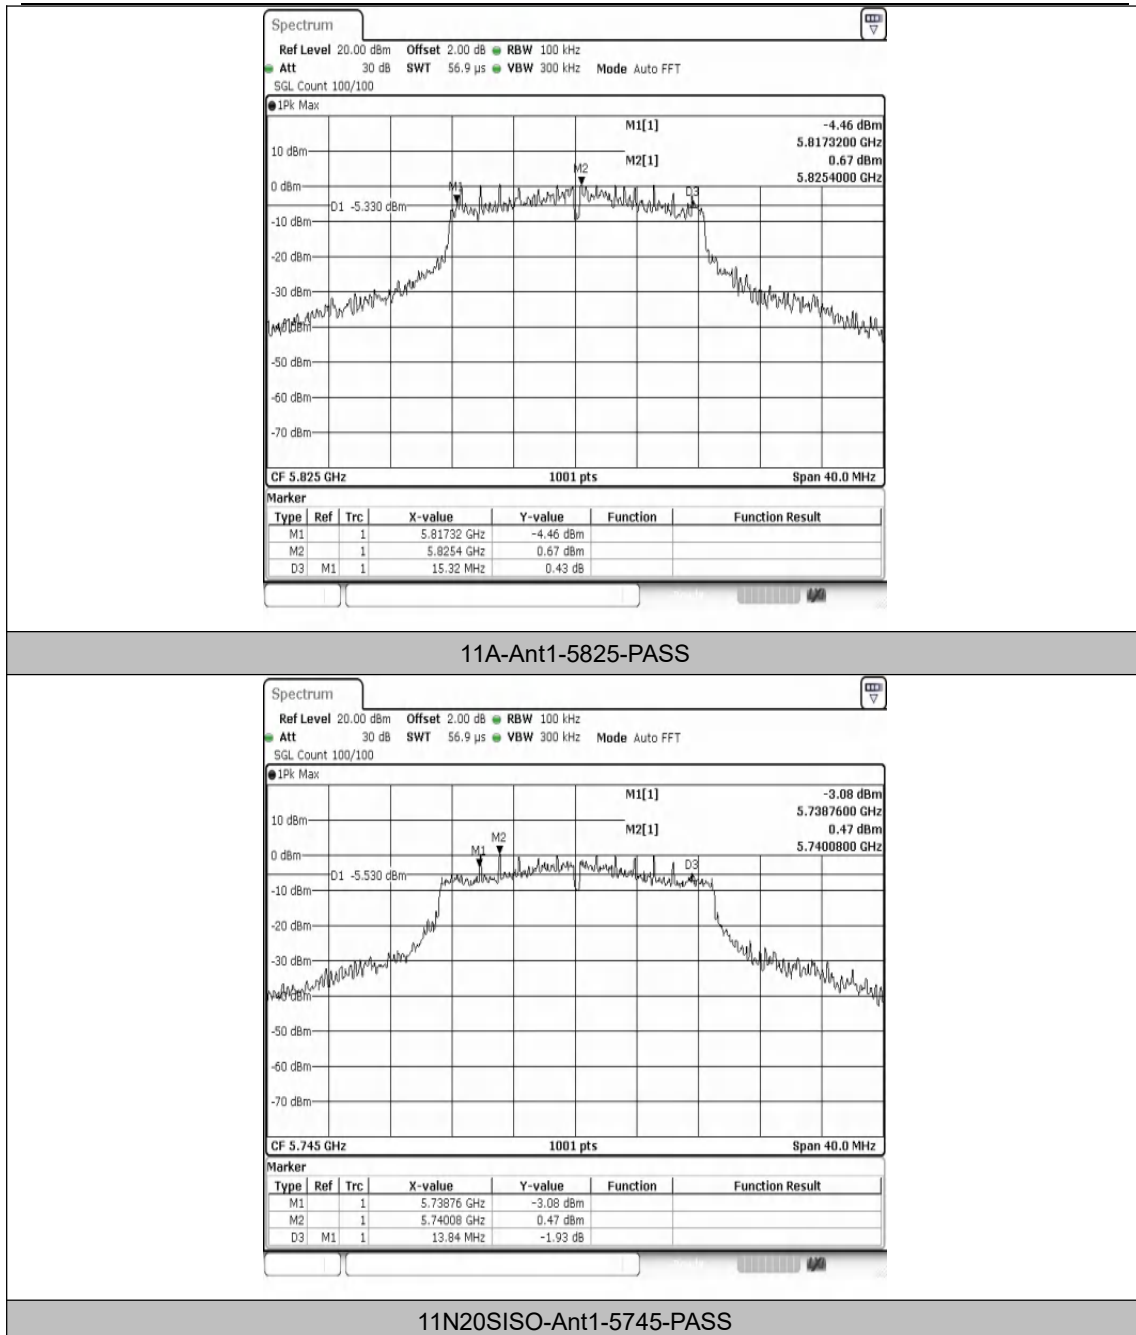


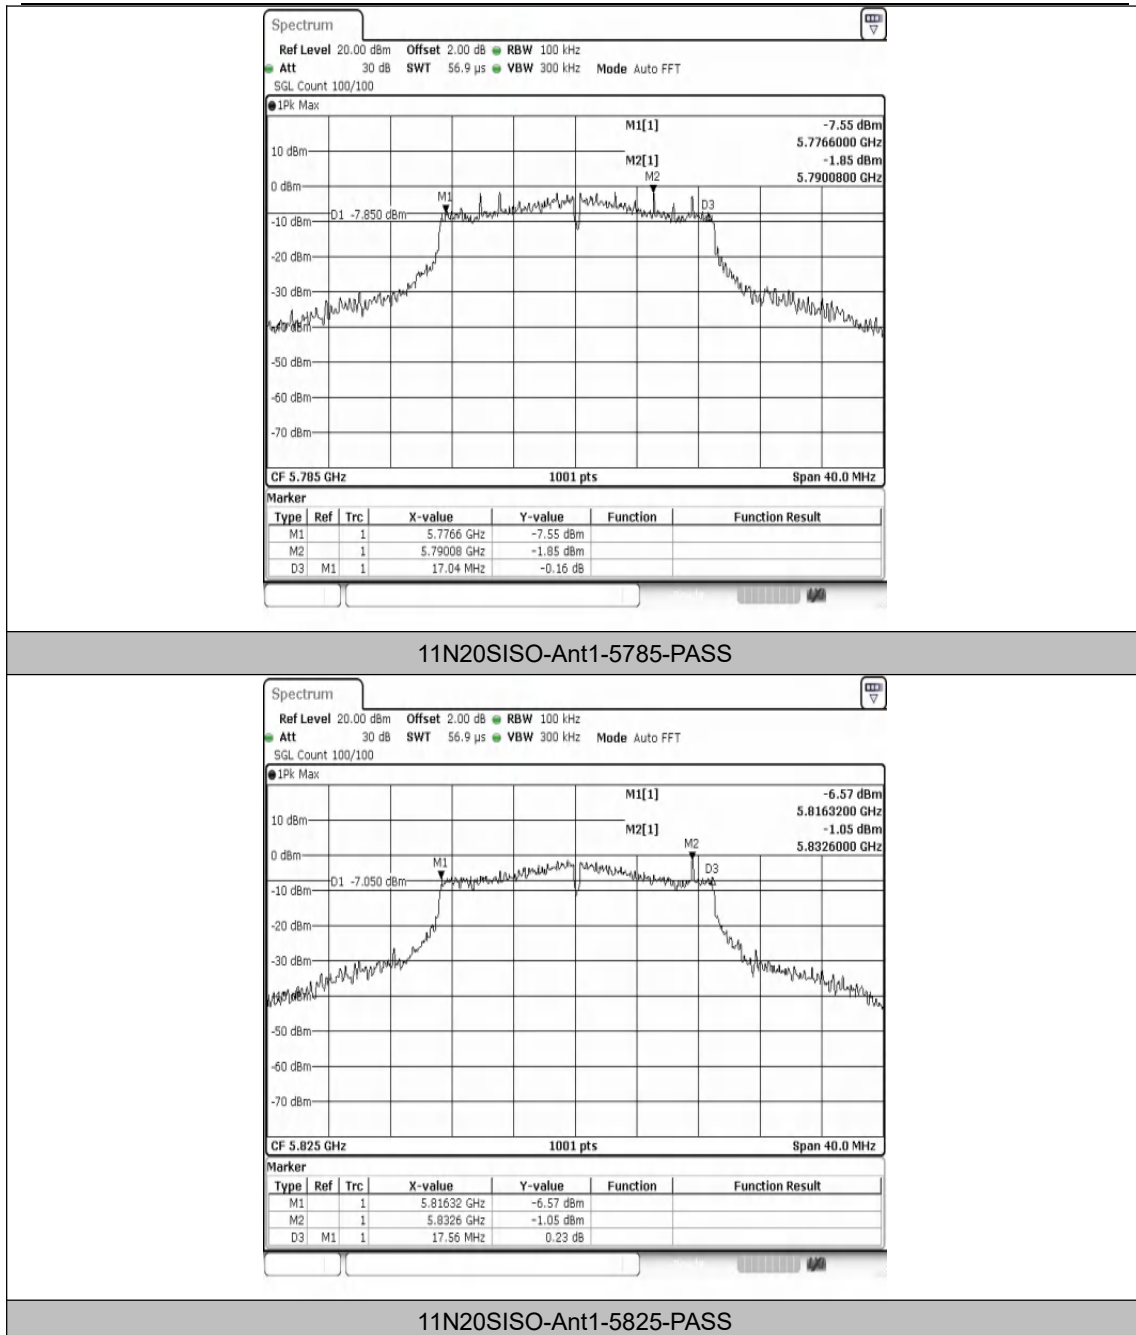

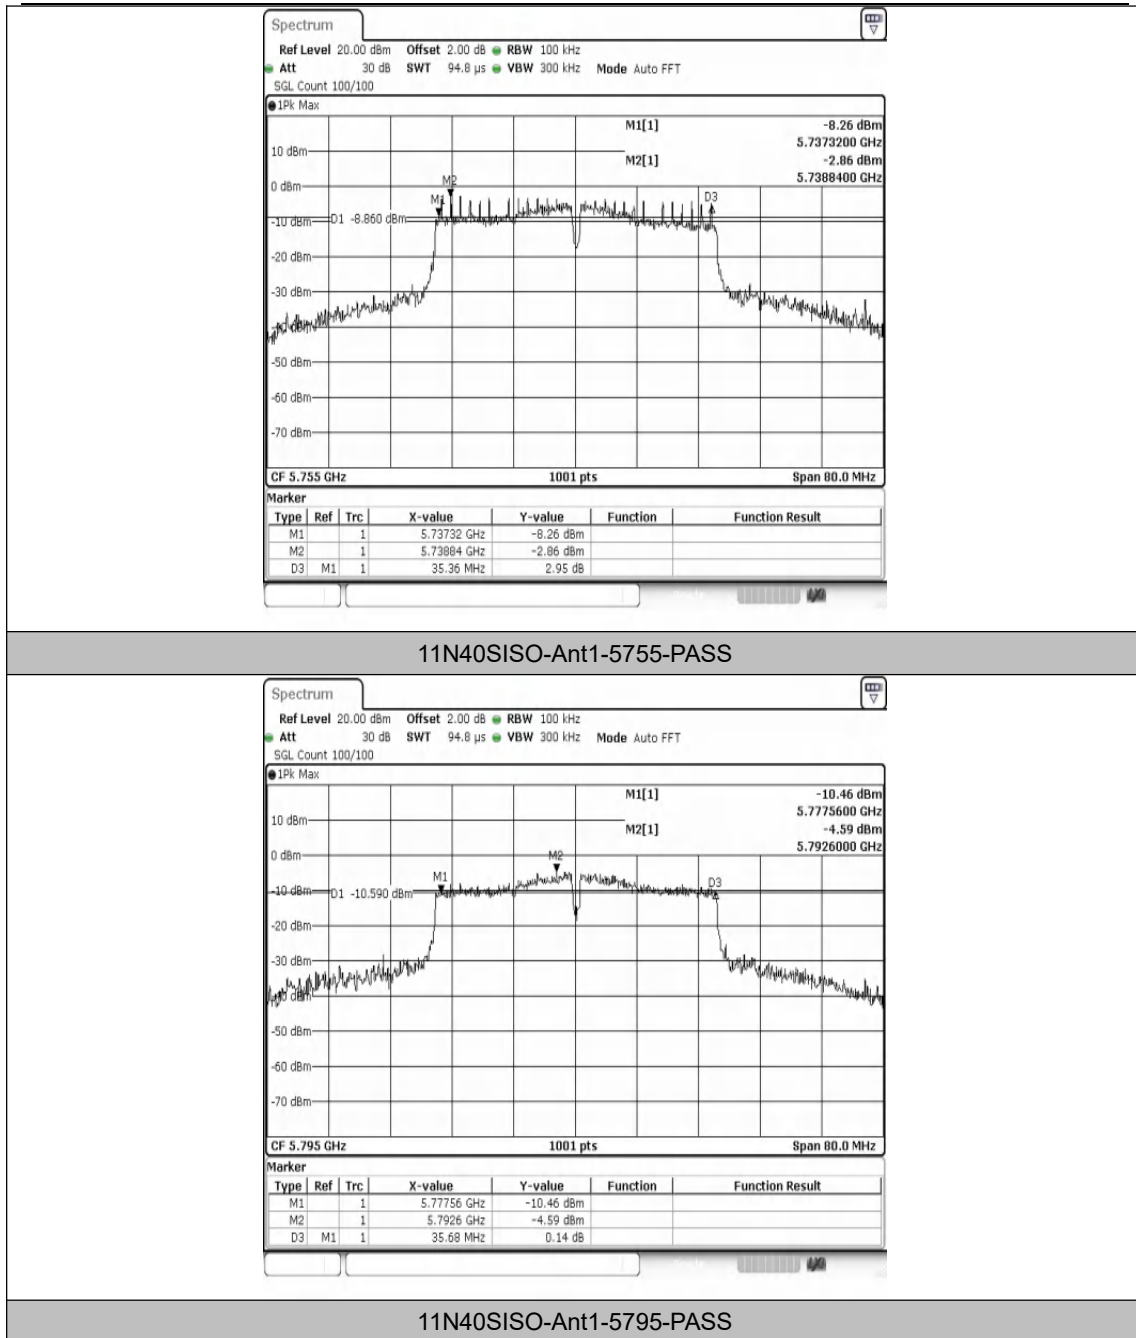


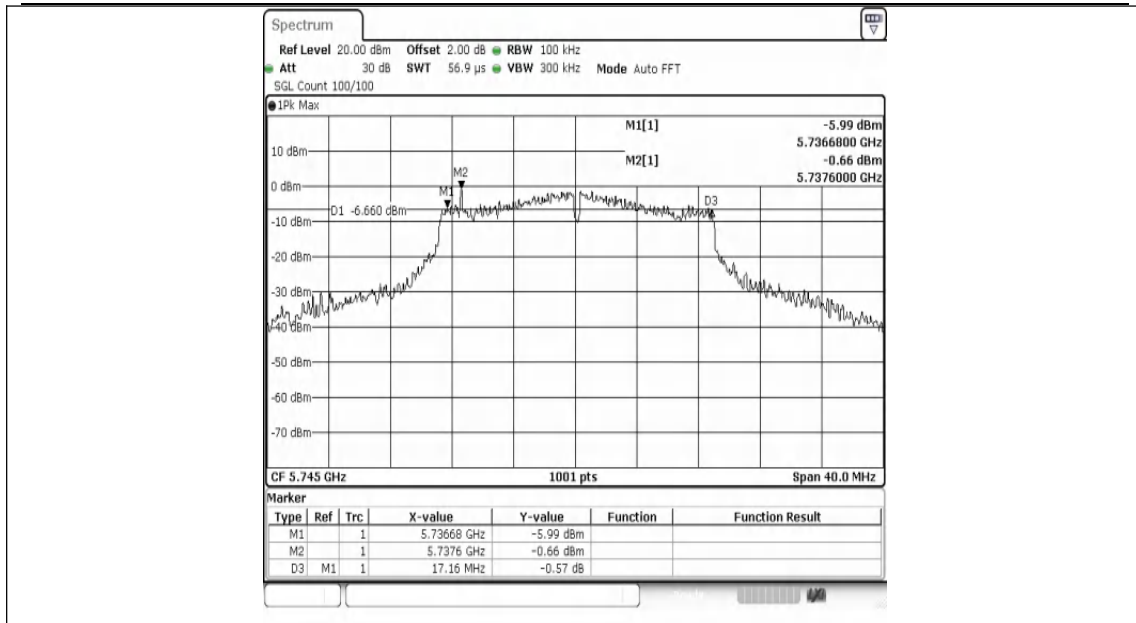


11AC20SISO-Ant1-5745-PASS

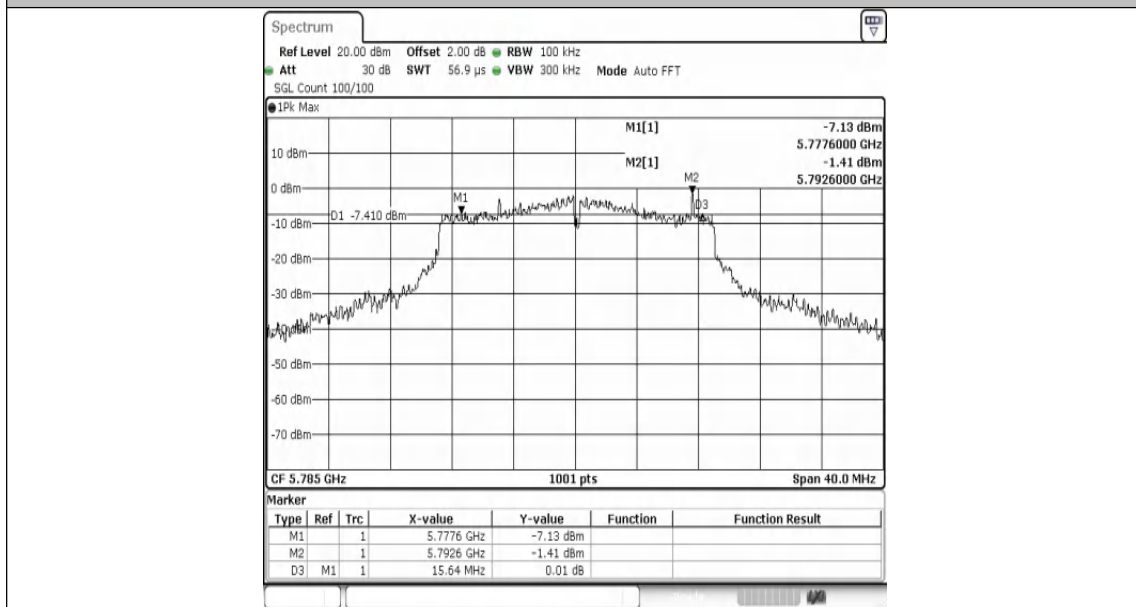


11AC20SISO-Ant1-5785-PASS

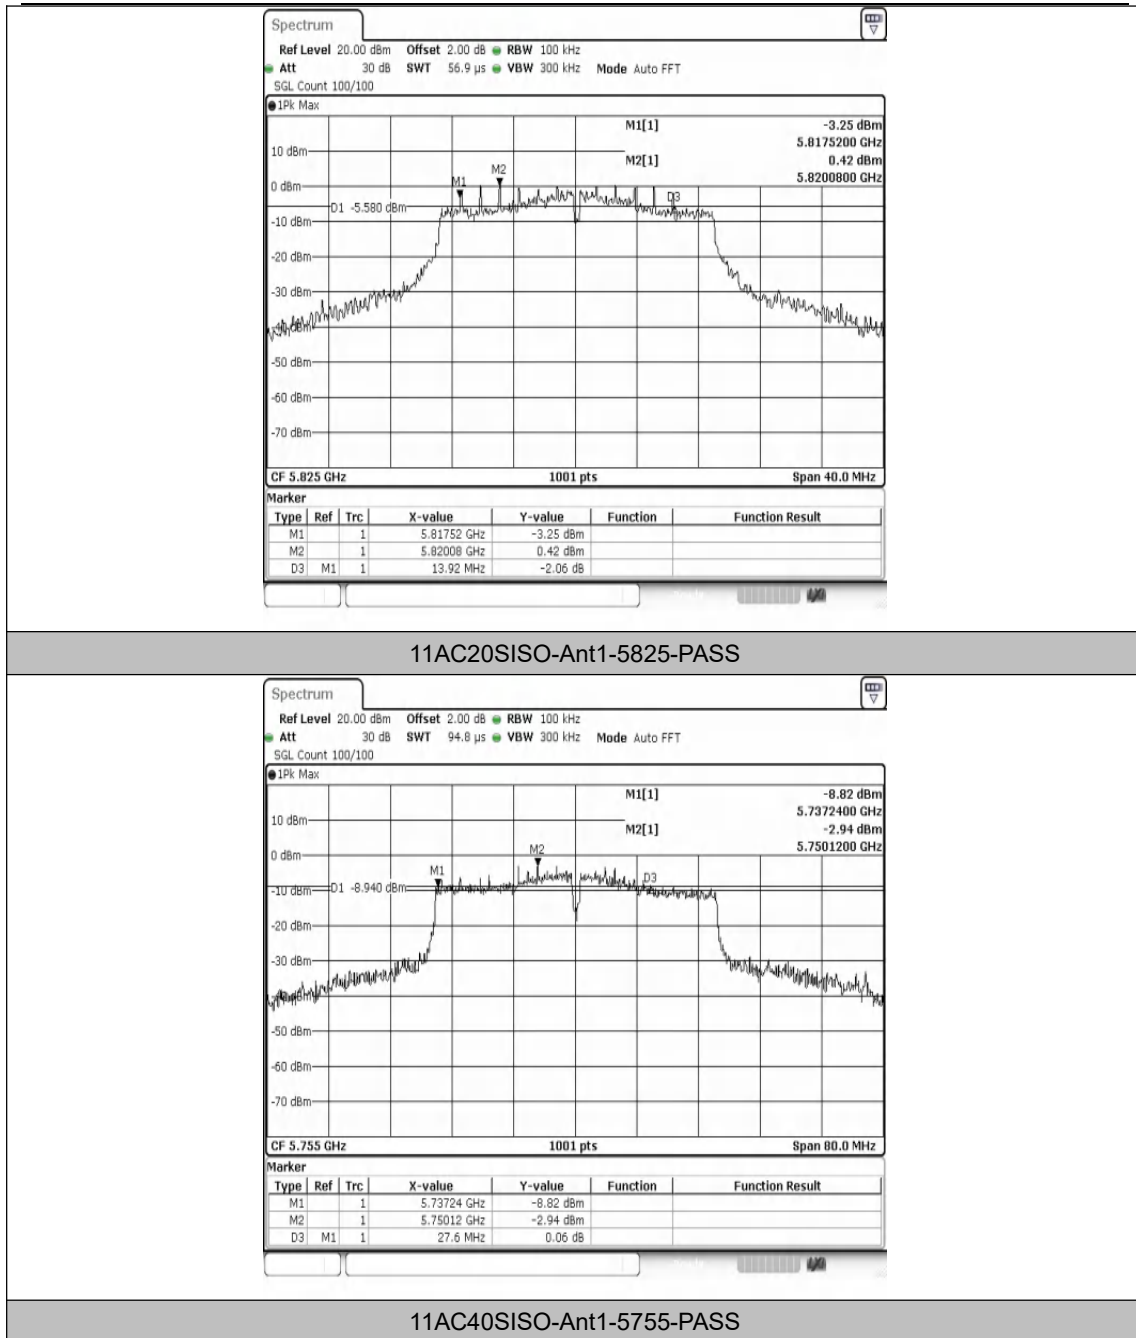

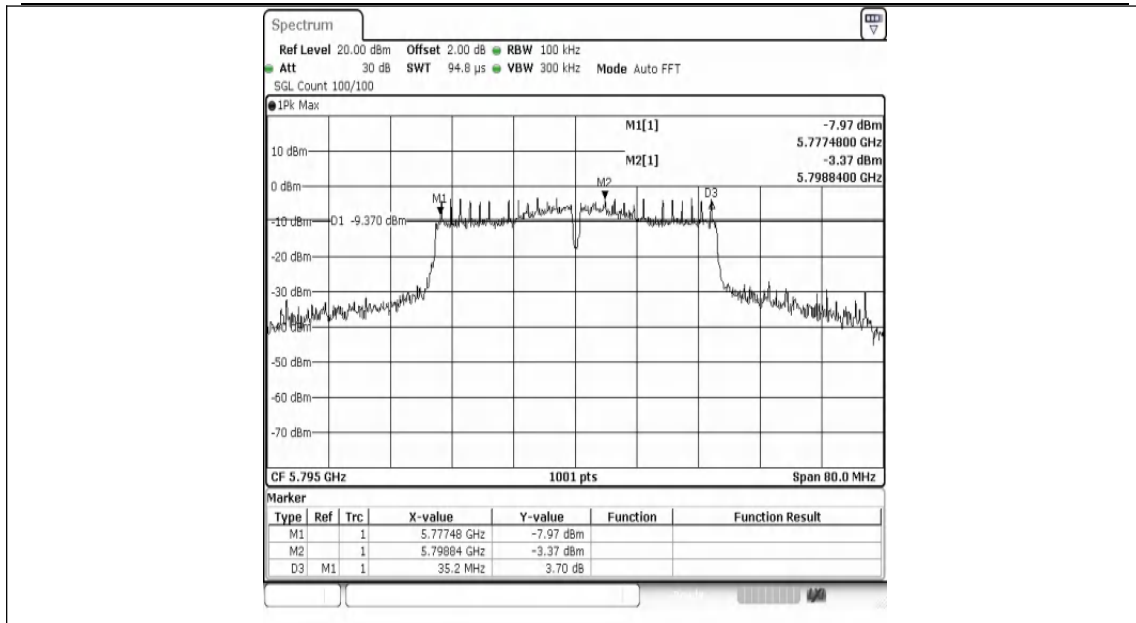

11AC40SISO-Ant1-5795-PASS

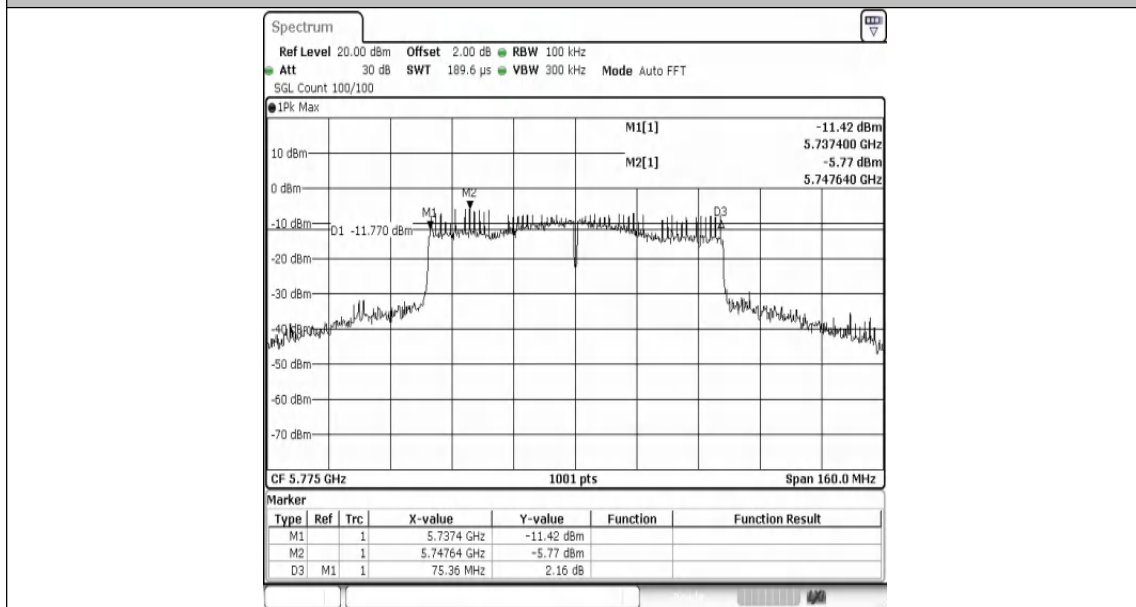


11AC80SISO-Ant1-5775-PASS


Appendix B: Duty Cycle


Test Result


Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	0.24	0.30	80.00	0.97	4.17
11A	Ant1	5200	0.24	0.30	80.00	0.97	4.17
11A	Ant1	5240	0.24	0.30	80.00	0.97	4.17
11A	Ant1	5745	0.24	0.30	80.00	0.97	4.17
11A	Ant1	5785	0.24	0.30	80.00	0.97	4.17
11A	Ant1	5825	0.24	0.30	80.00	0.97	4.17
11N20SISO	Ant1	5180	1.92	1.98	96.97	0.13	0.52
11N20SISO	Ant1	5200	1.92	1.97	97.46	0.11	0.52
11N20SISO	Ant1	5240	1.92	1.98	96.97	0.13	0.52
11N20SISO	Ant1	5745	1.92	1.97	97.46	0.11	0.52
11N20SISO	Ant1	5785	1.92	1.97	97.46	0.11	0.52
11N20SISO	Ant1	5825	1.92	1.97	97.46	0.11	0.52
11N40SISO	Ant1	5190	0.65	0.69	94.20	0.26	1.54
11N40SISO	Ant1	5230	0.65	0.69	94.20	0.26	1.54
11N40SISO	Ant1	5755	0.65	0.69	94.20	0.26	1.54
11N40SISO	Ant1	5795	0.94	0.99	94.95	0.23	1.06
11AC20SISO	Ant1	5180	1.31	1.35	97.04	0.13	0.76
11AC20SISO	Ant1	5200	1.31	1.36	96.32	0.16	0.76
11AC20SISO	Ant1	5240	1.31	1.36	96.32	0.16	0.76
11AC20SISO	Ant1	5745	1.31	1.36	96.32	0.16	0.76
11AC20SISO	Ant1	5785	1.31	1.36	96.32	0.16	0.76
11AC20SISO	Ant1	5825	1.31	1.36	96.32	0.16	0.76
11AC40SISO	Ant1	5190	0.65	0.69	94.20	0.26	1.54
11AC40SISO	Ant1	5230	0.65	0.69	94.20	0.26	1.54
11AC40SISO	Ant1	5755	0.65	0.69	94.20	0.26	1.54
11AC40SISO	Ant1	5795	0.65	0.69	94.20	0.26	1.54
11AC80SISO	Ant1	5210	0.32	0.36	88.89	0.51	3.13
11AC80SISO	Ant1	5775	0.32	0.36	88.89	0.51	3.13


Test Graphs

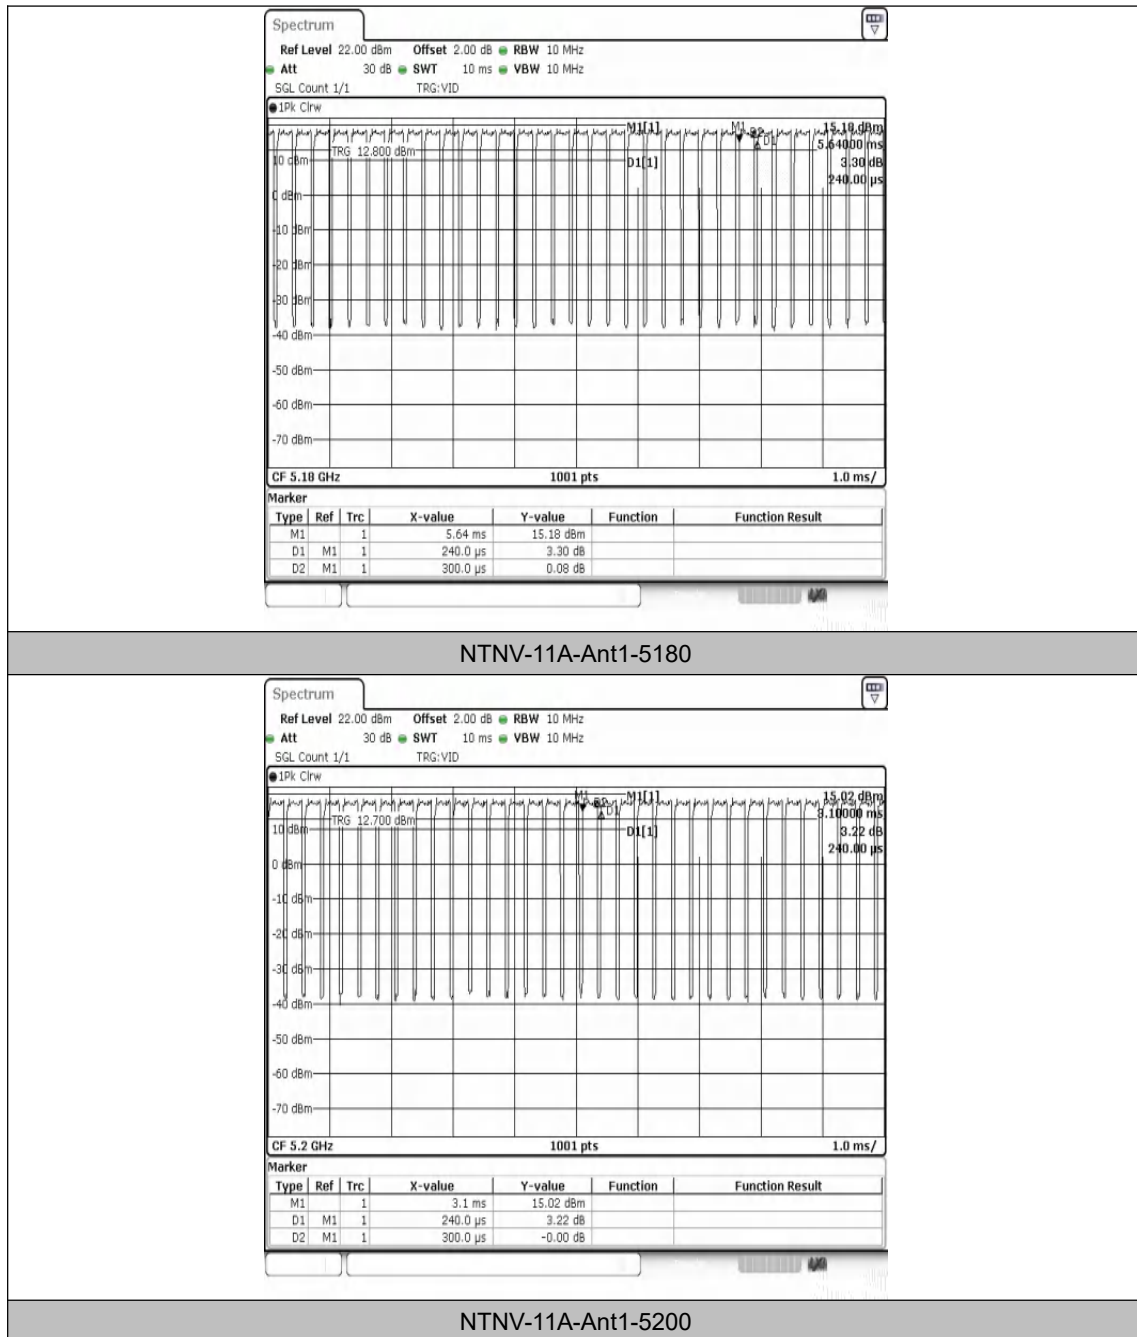


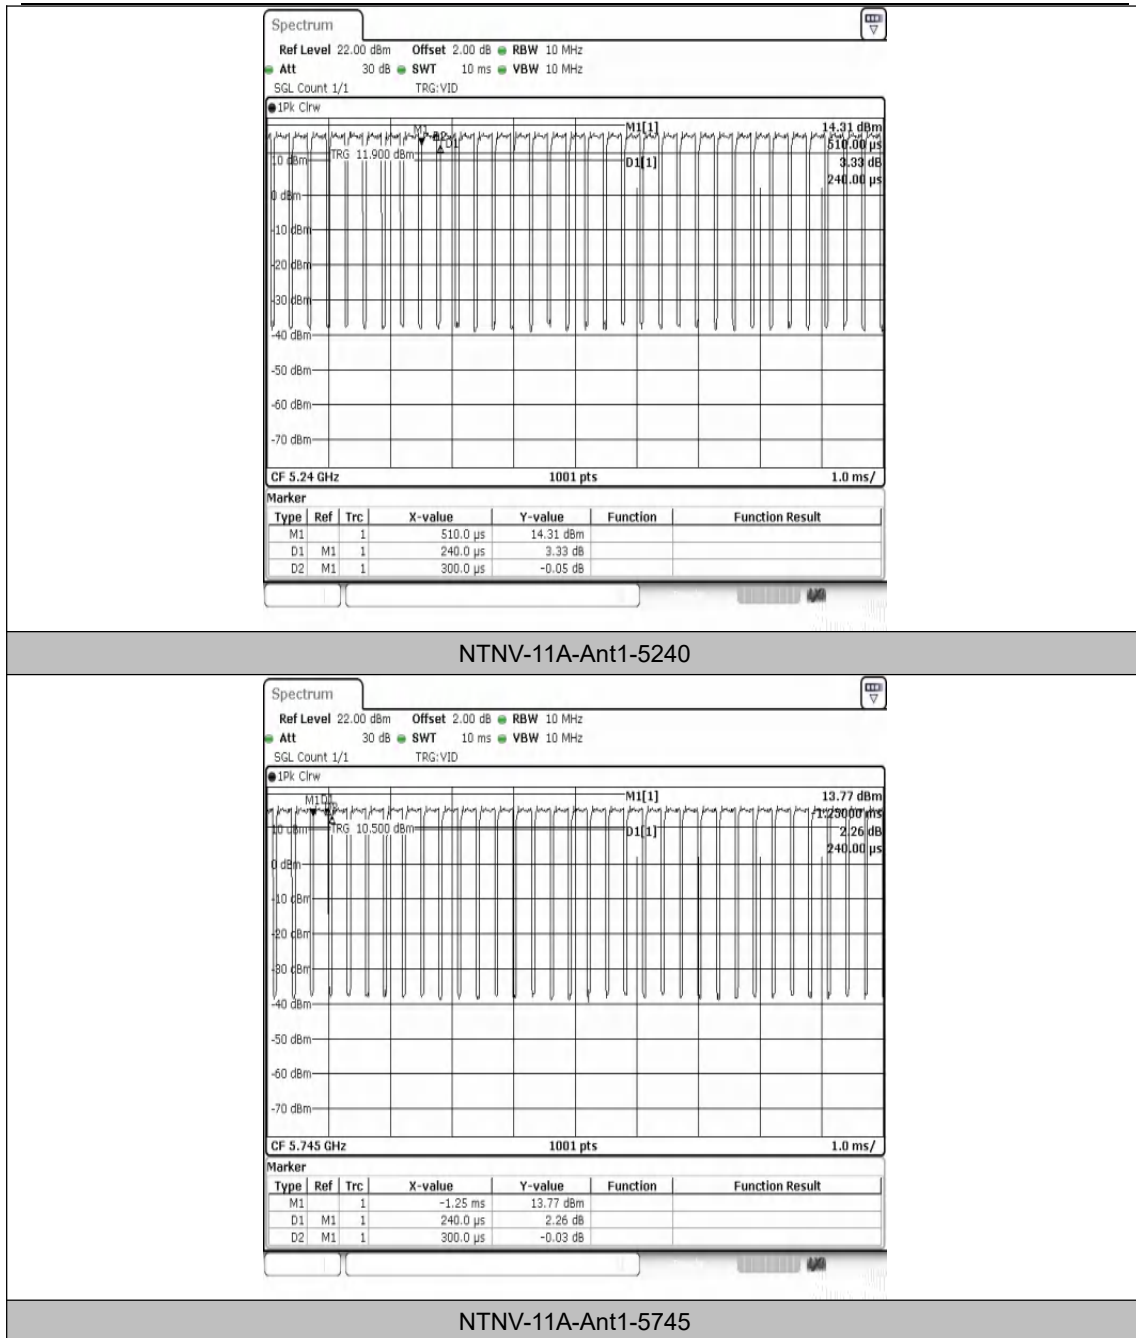


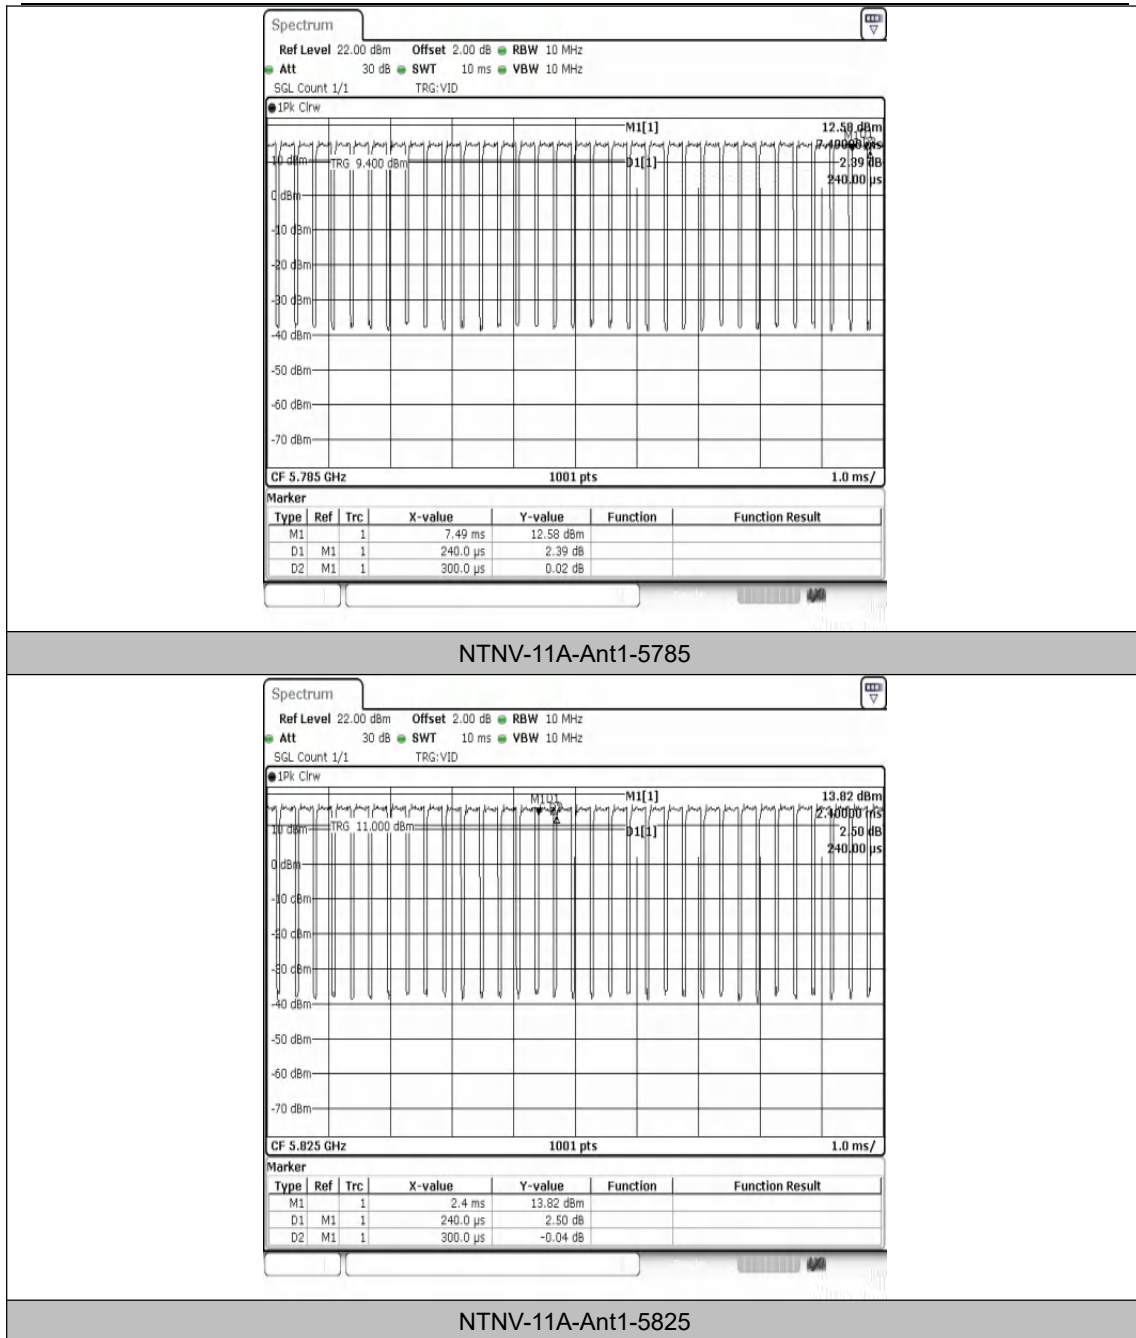


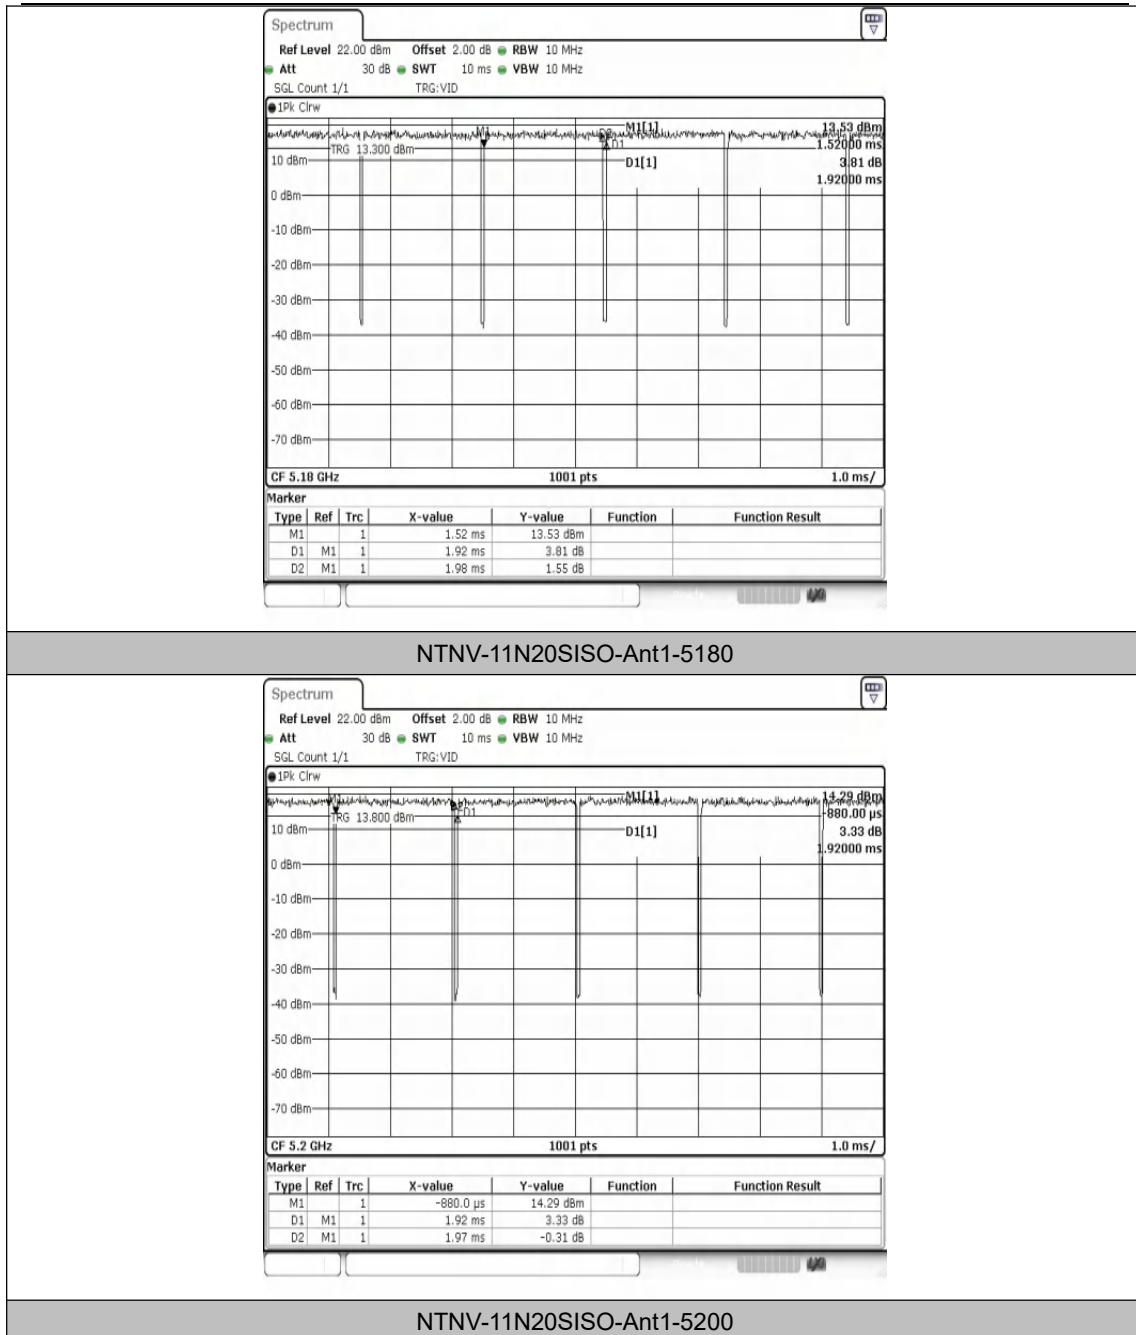


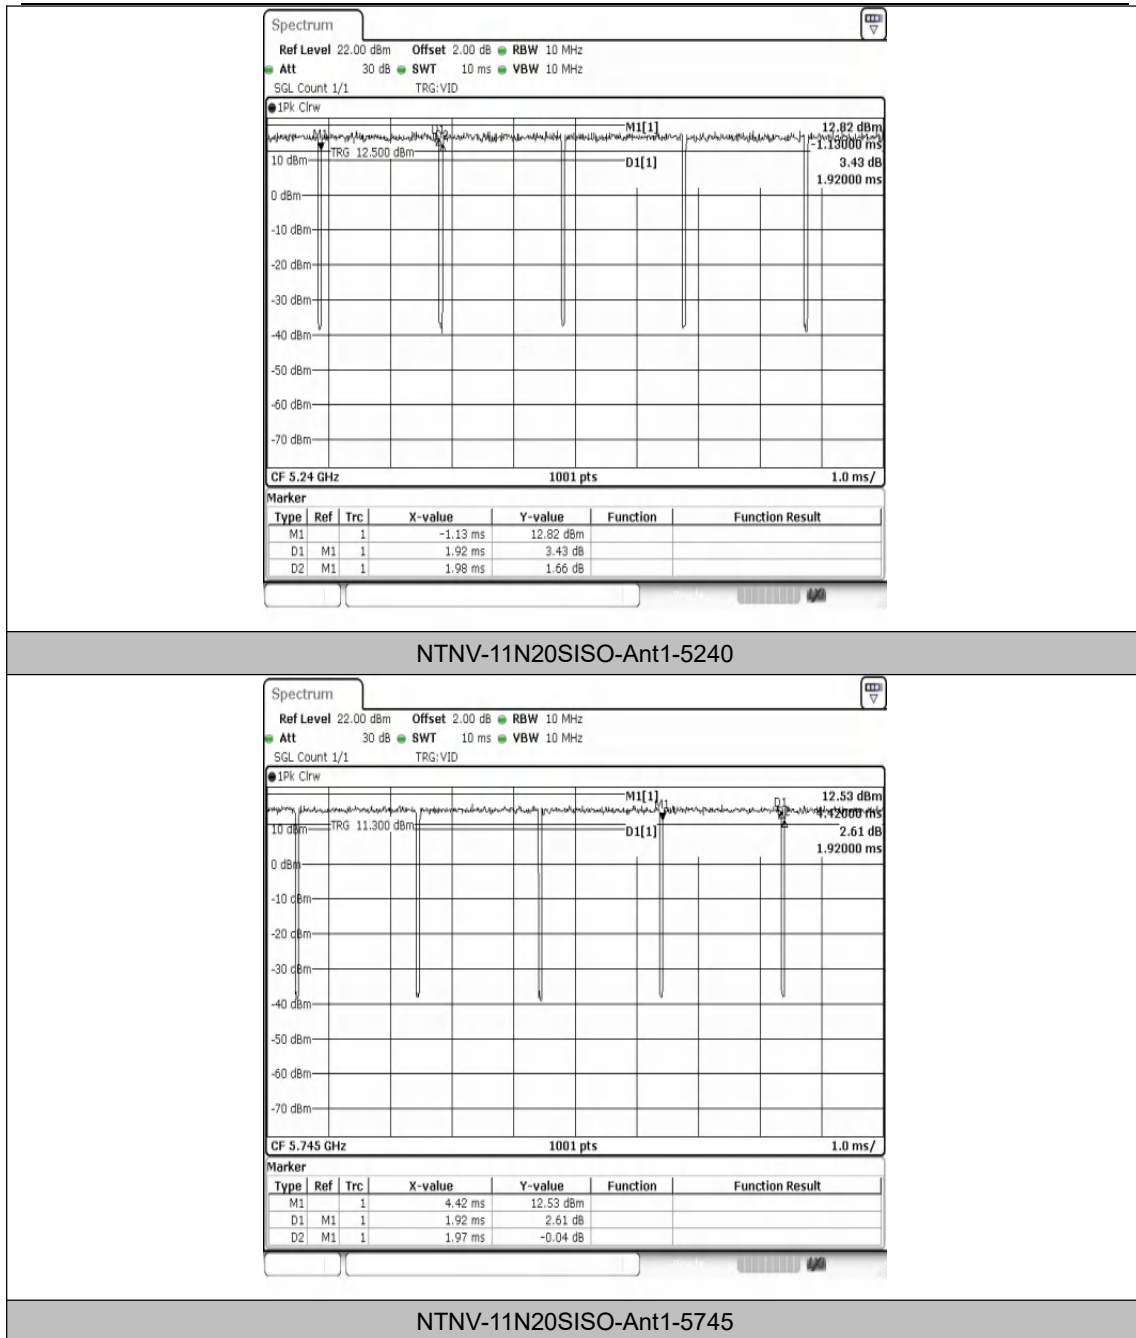


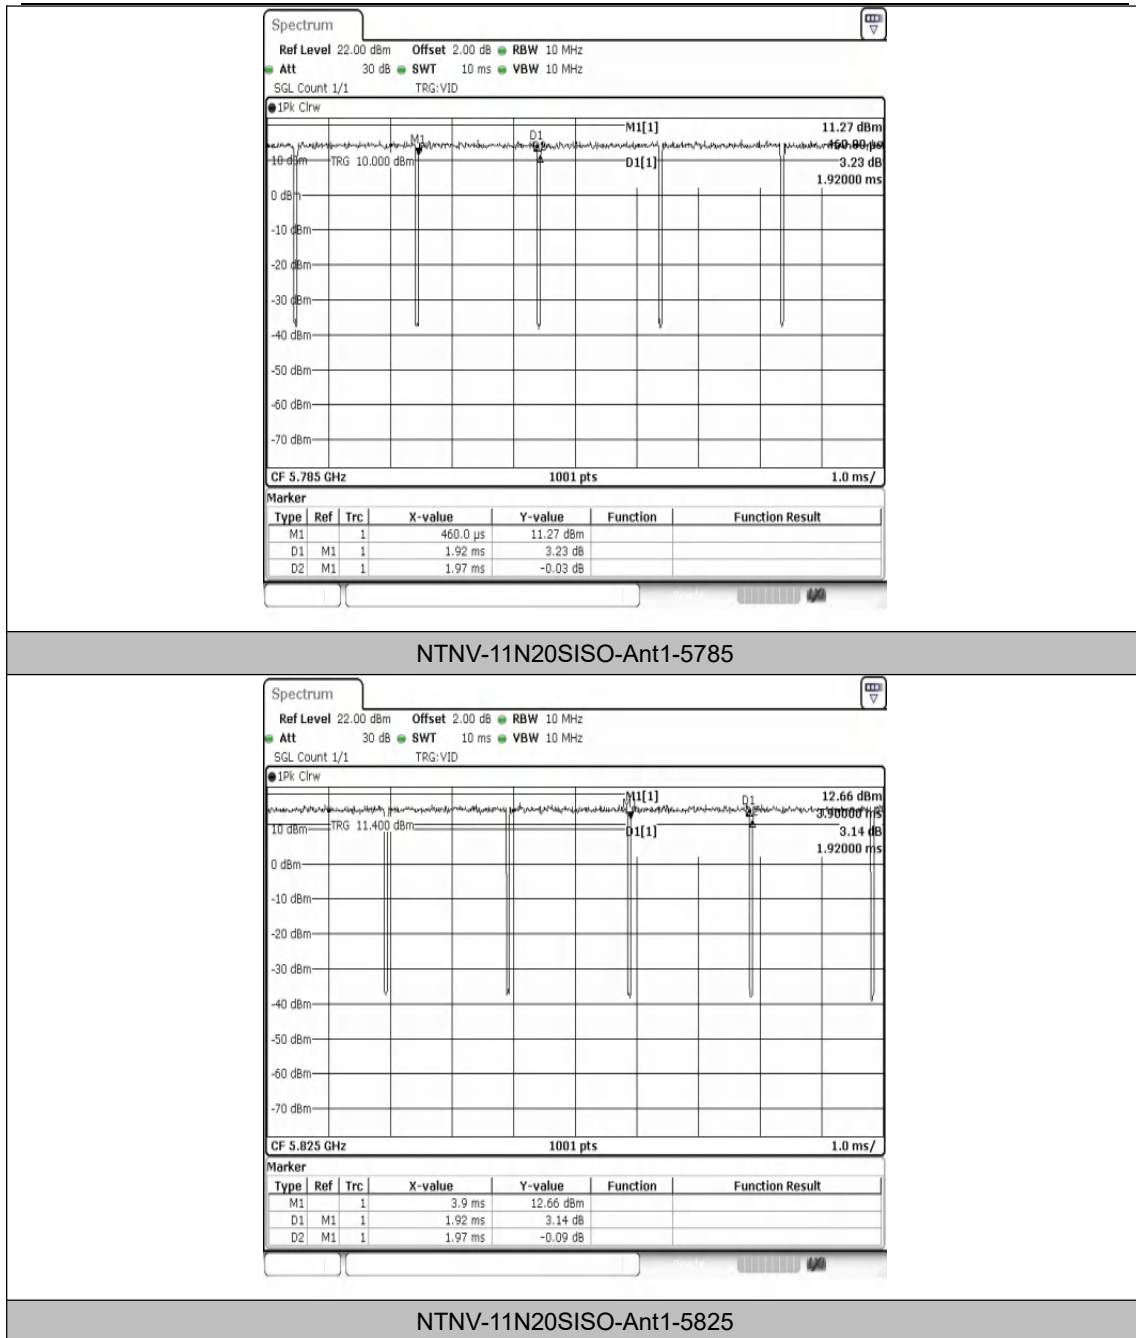


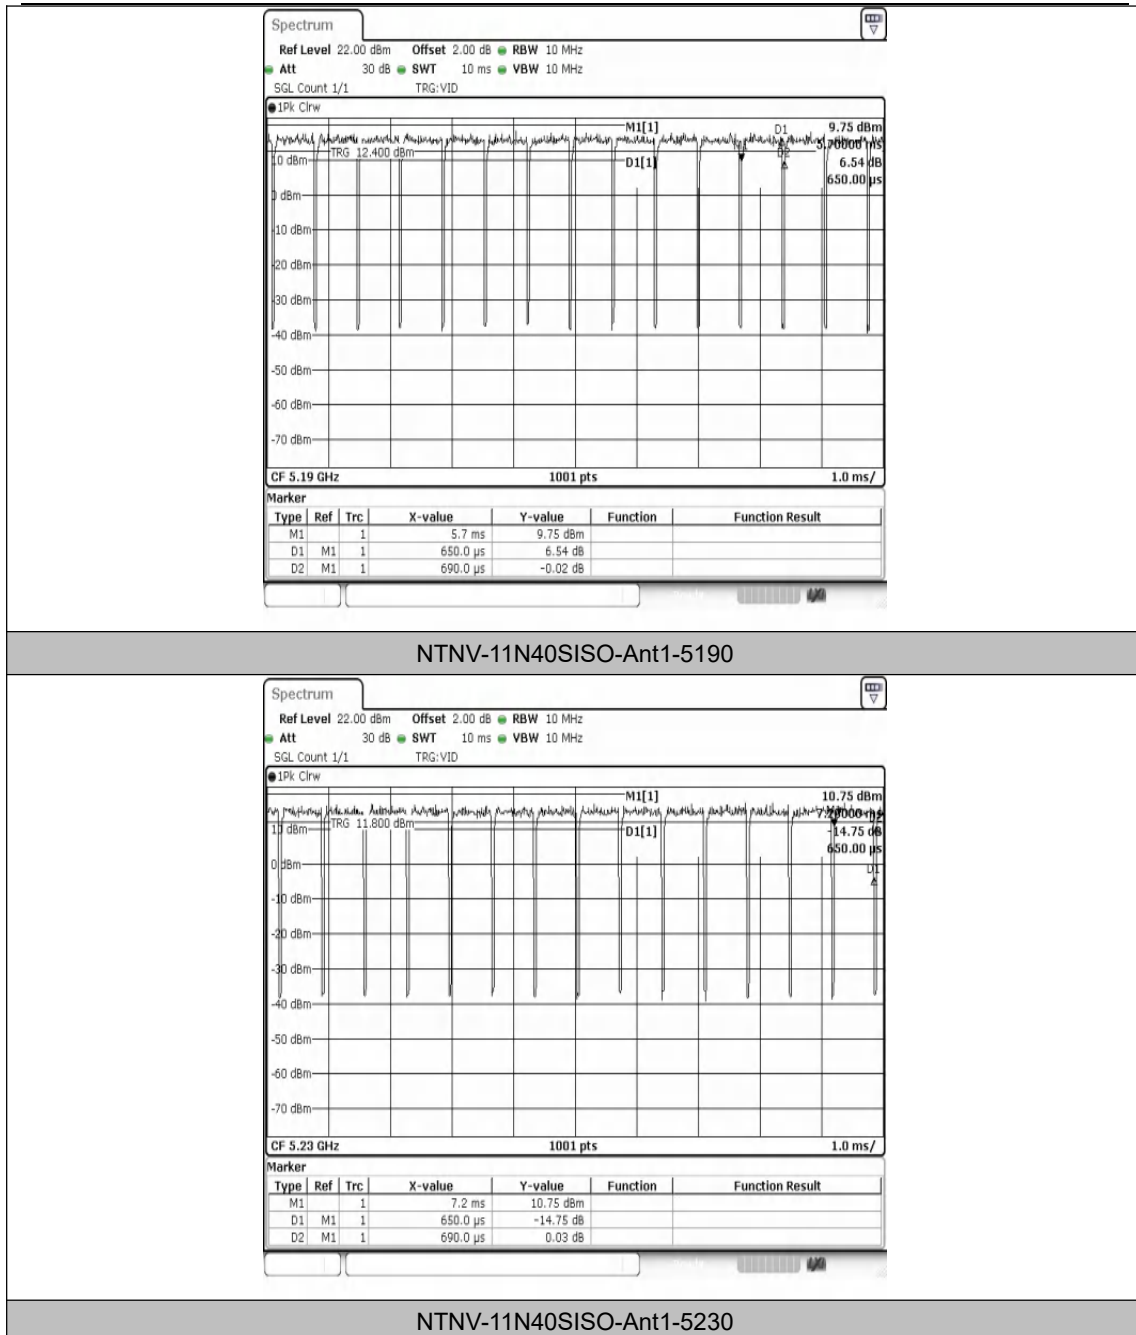


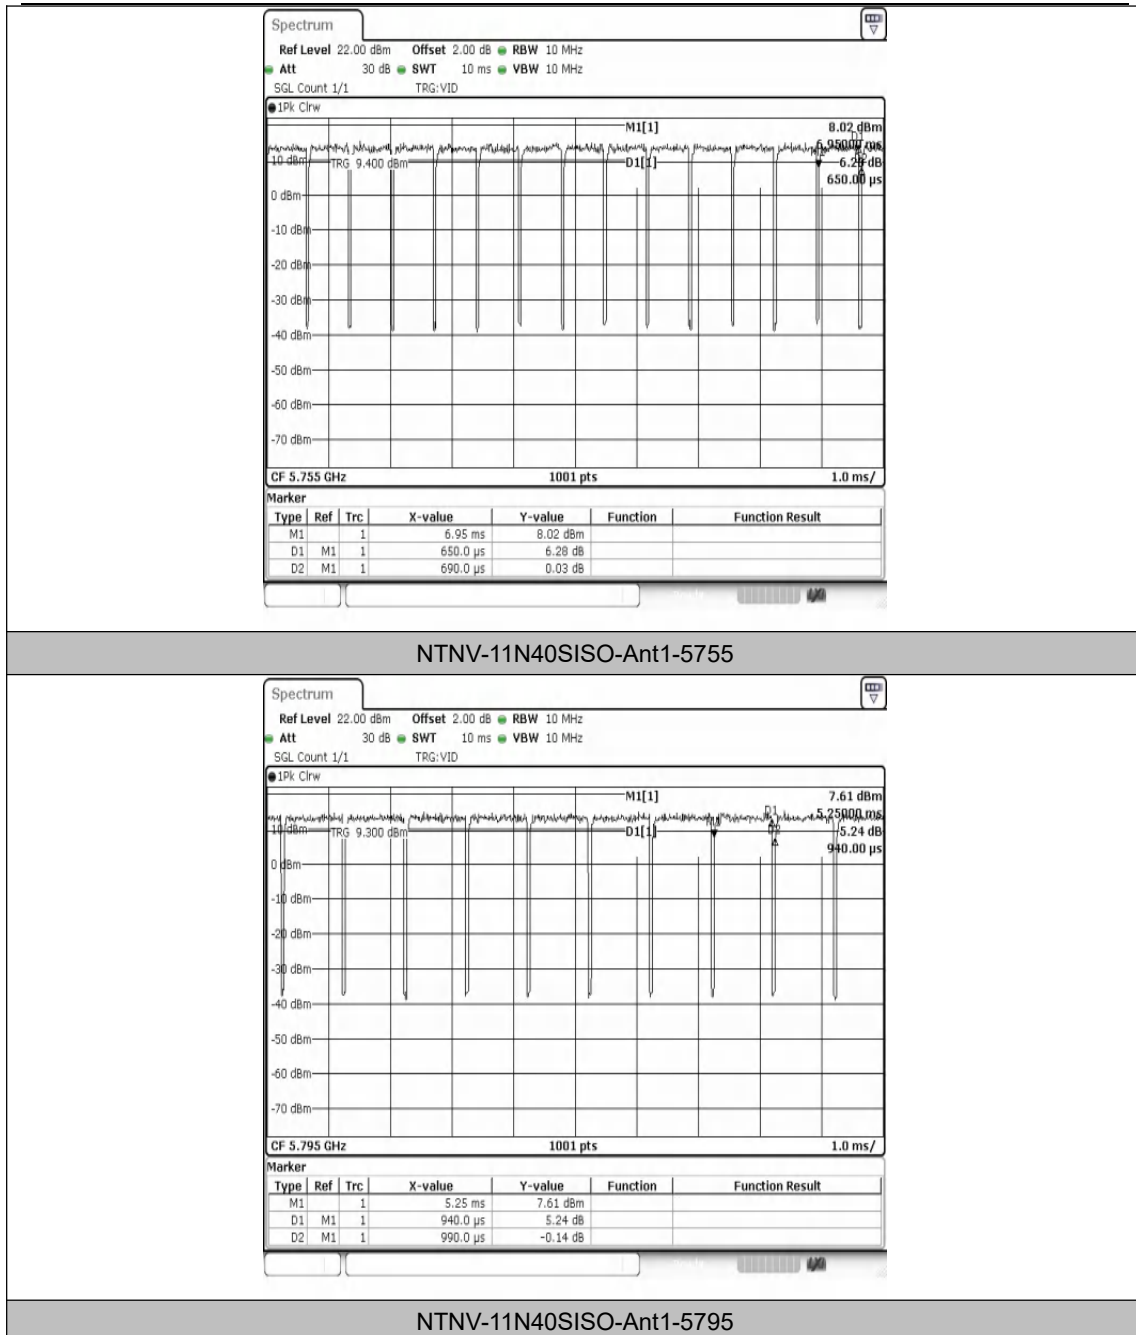


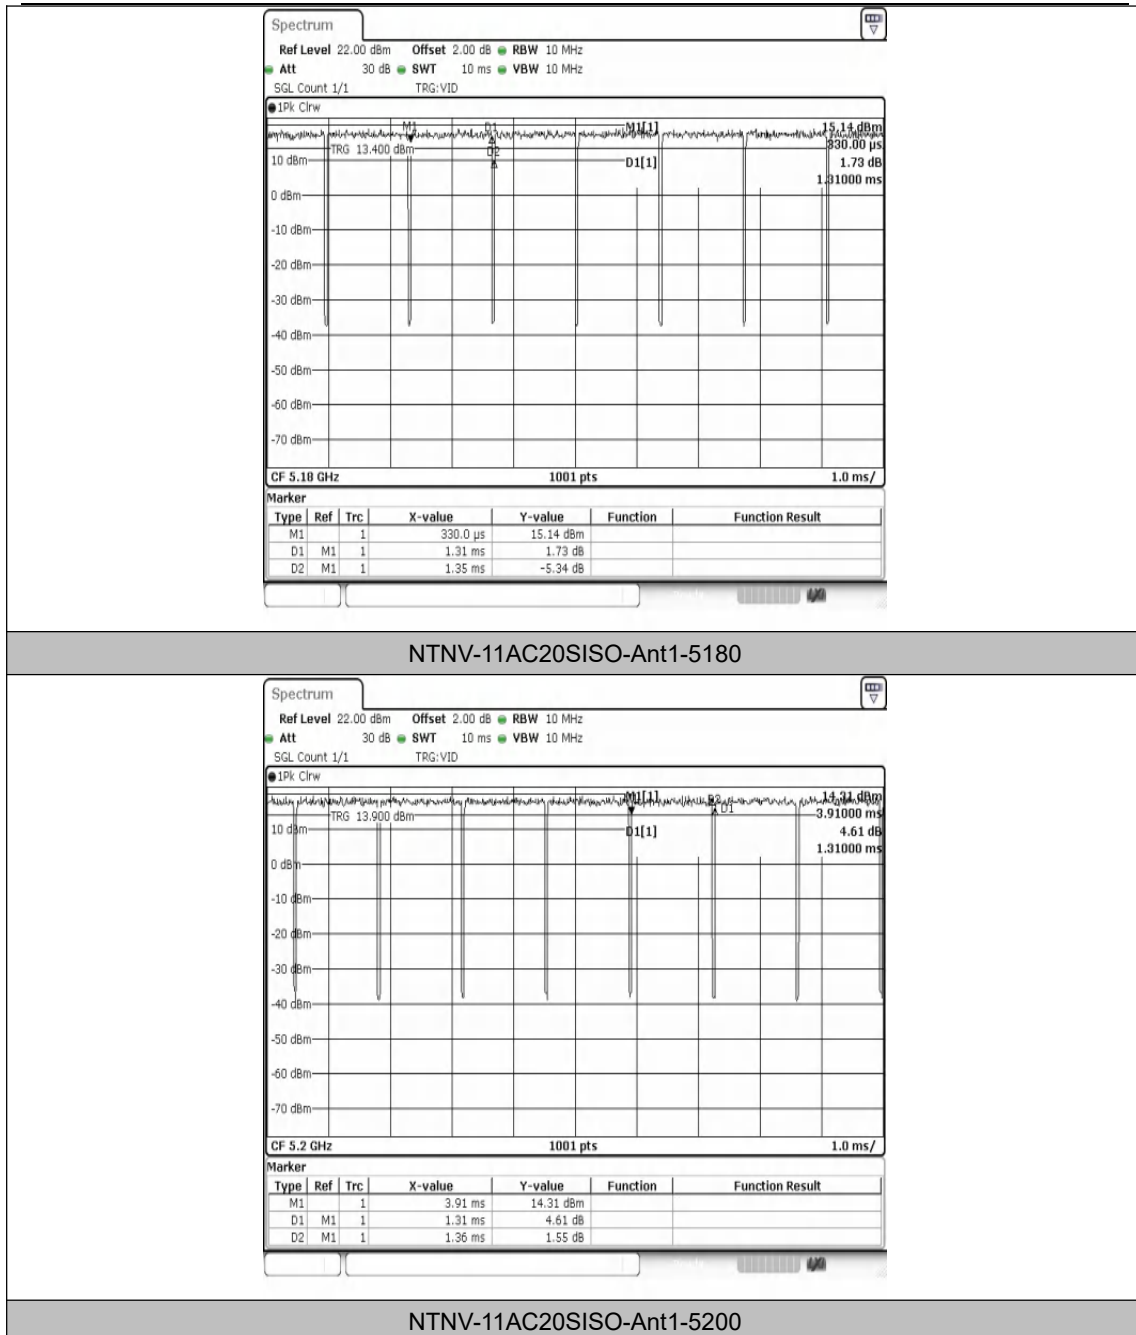


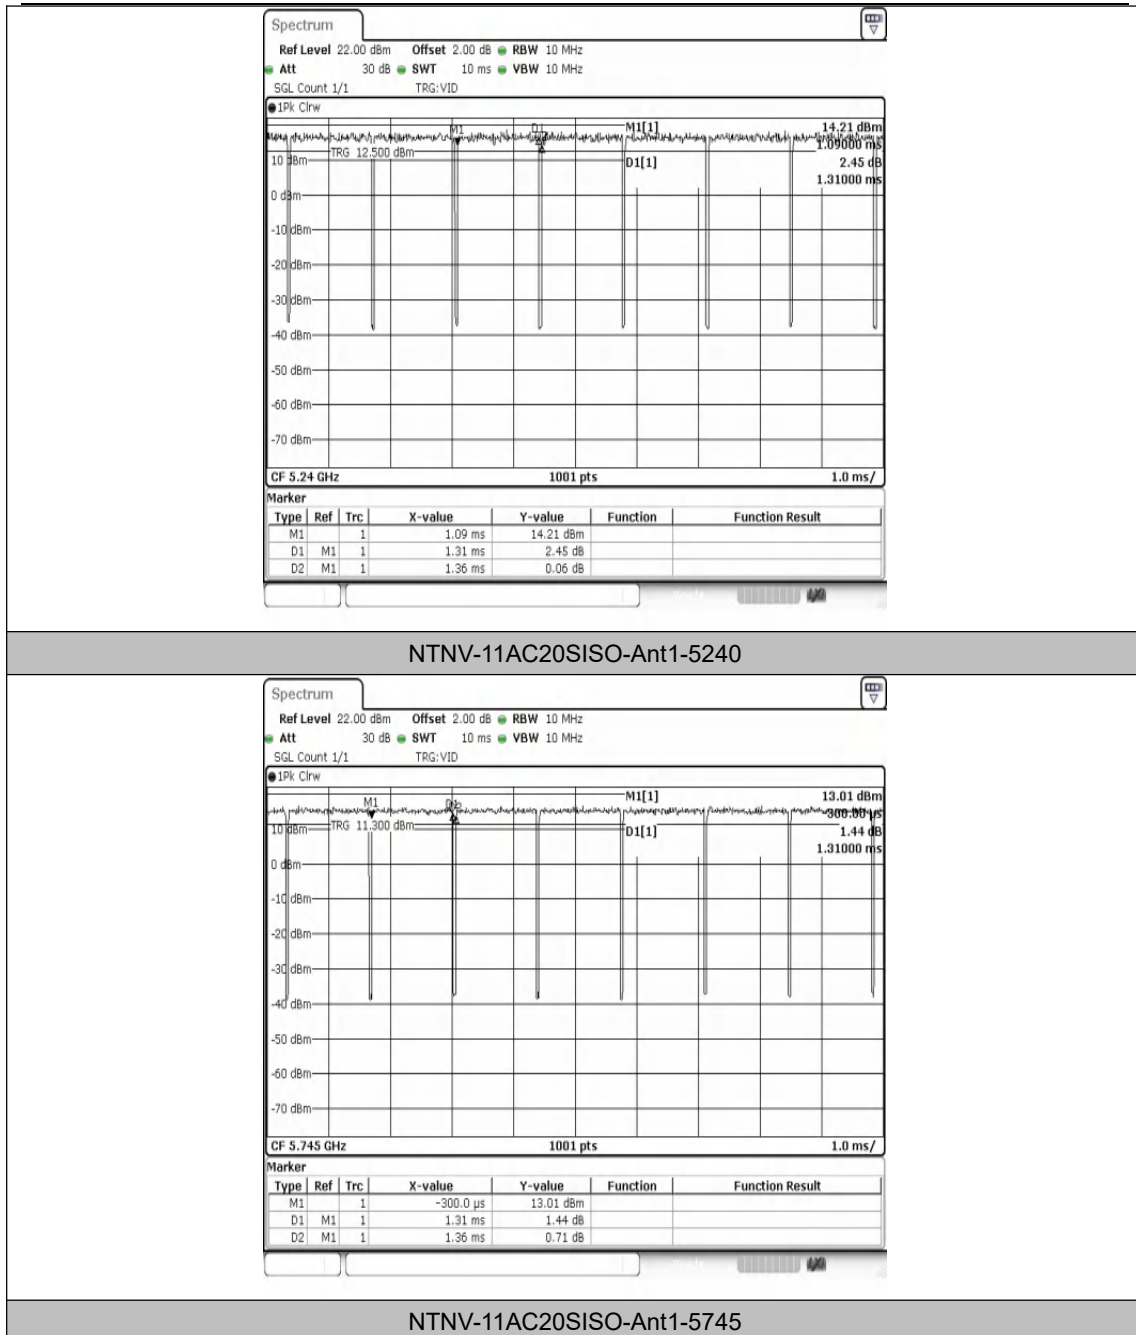

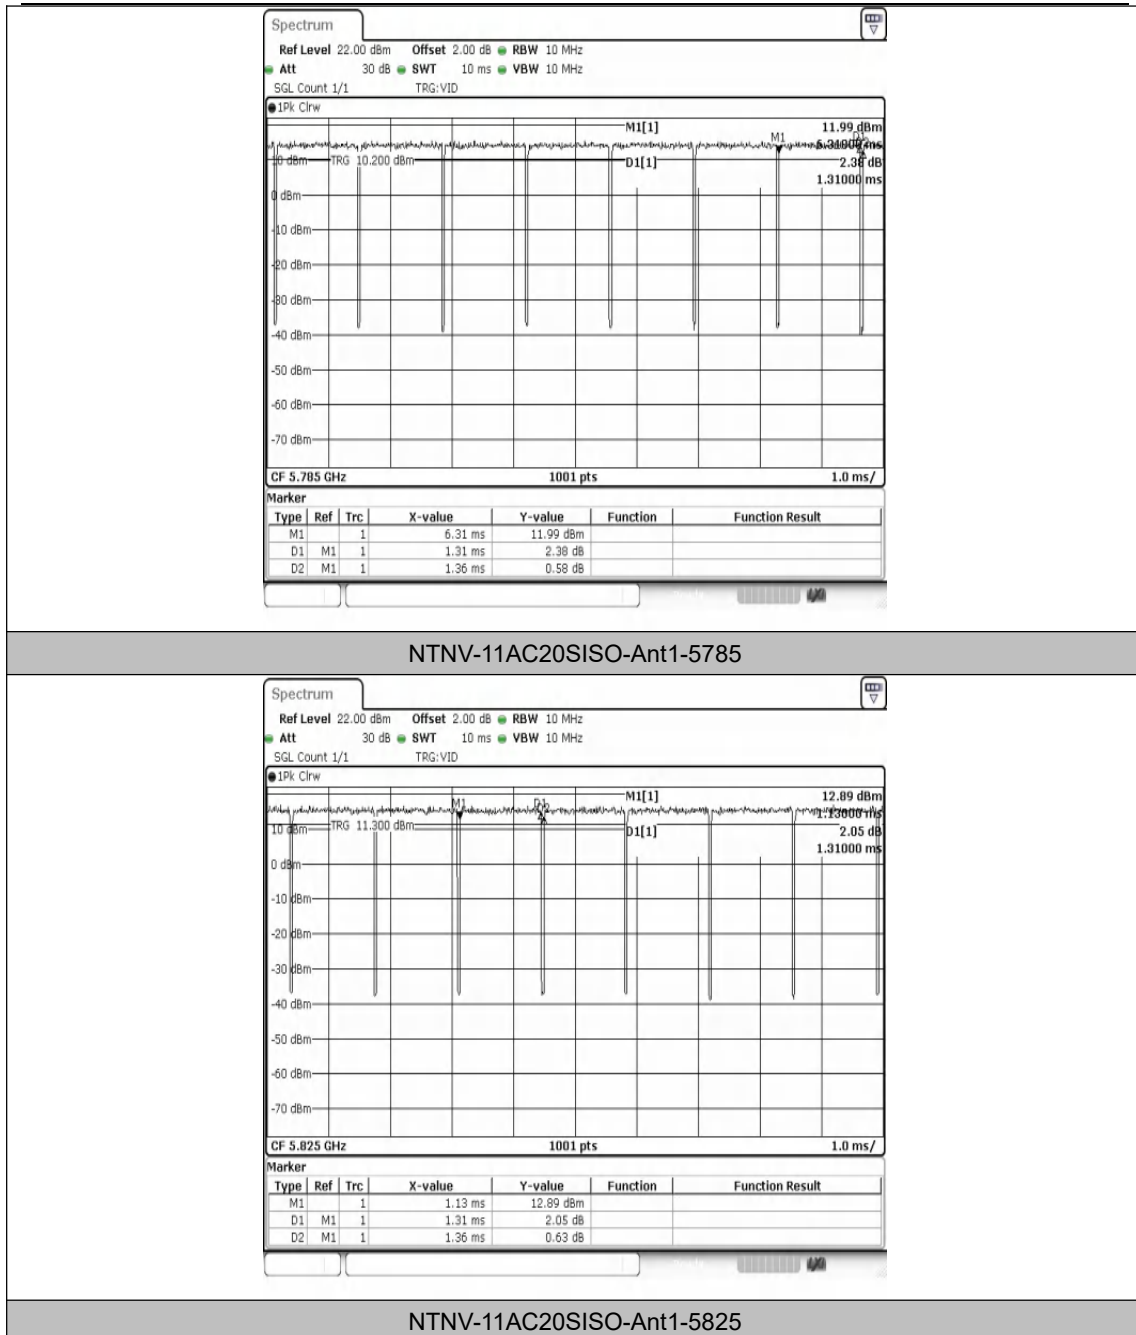

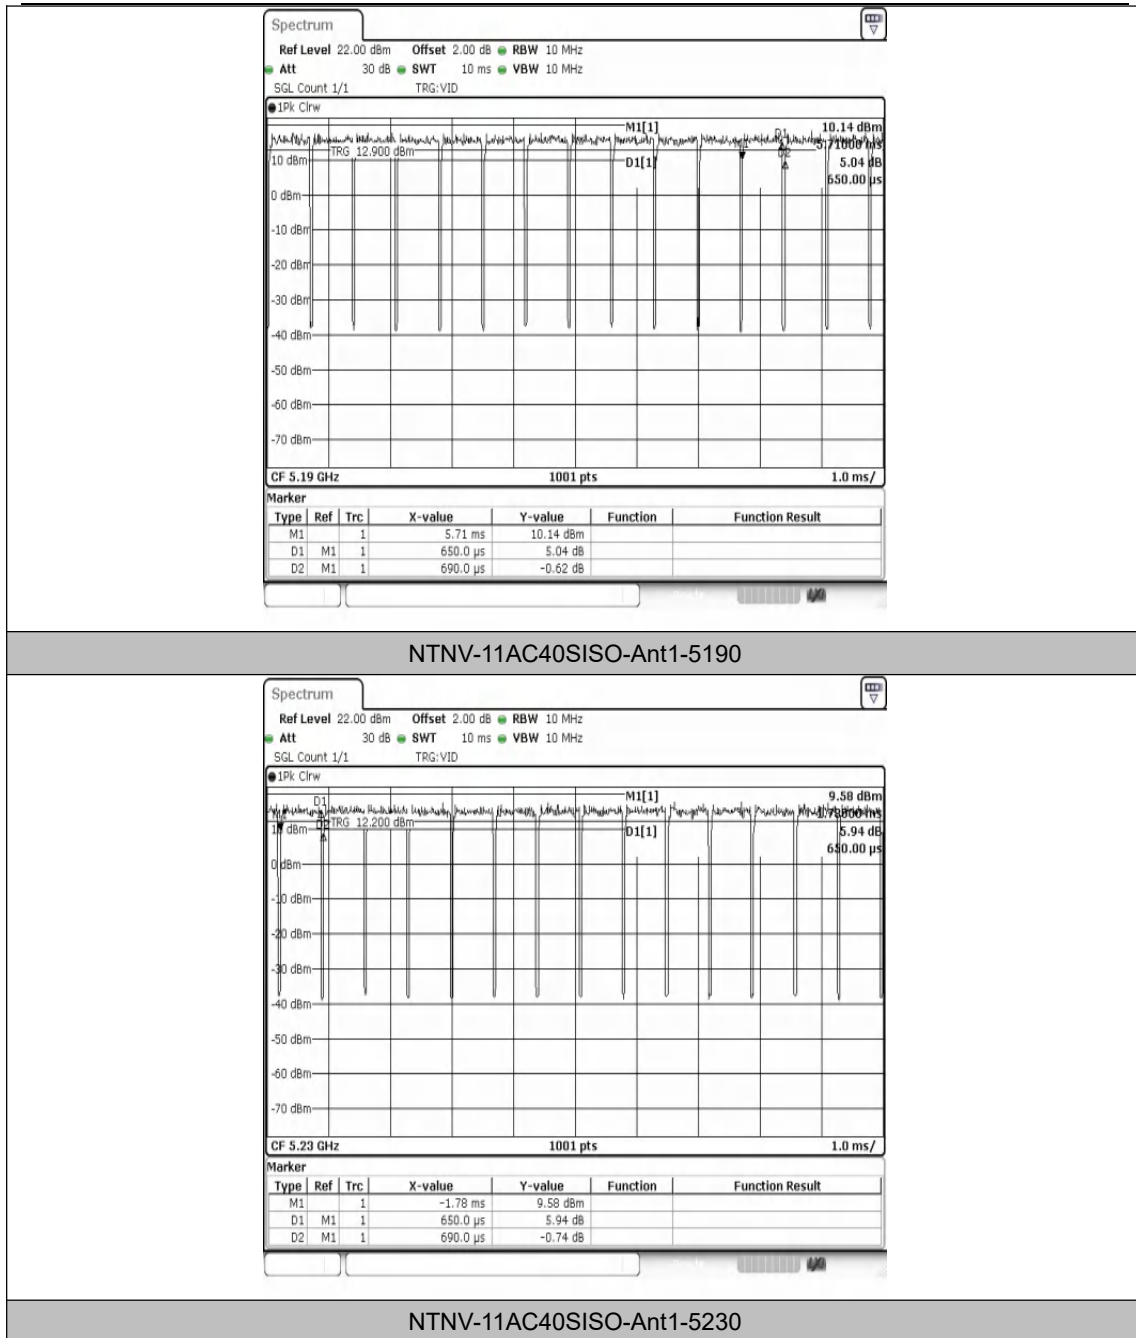

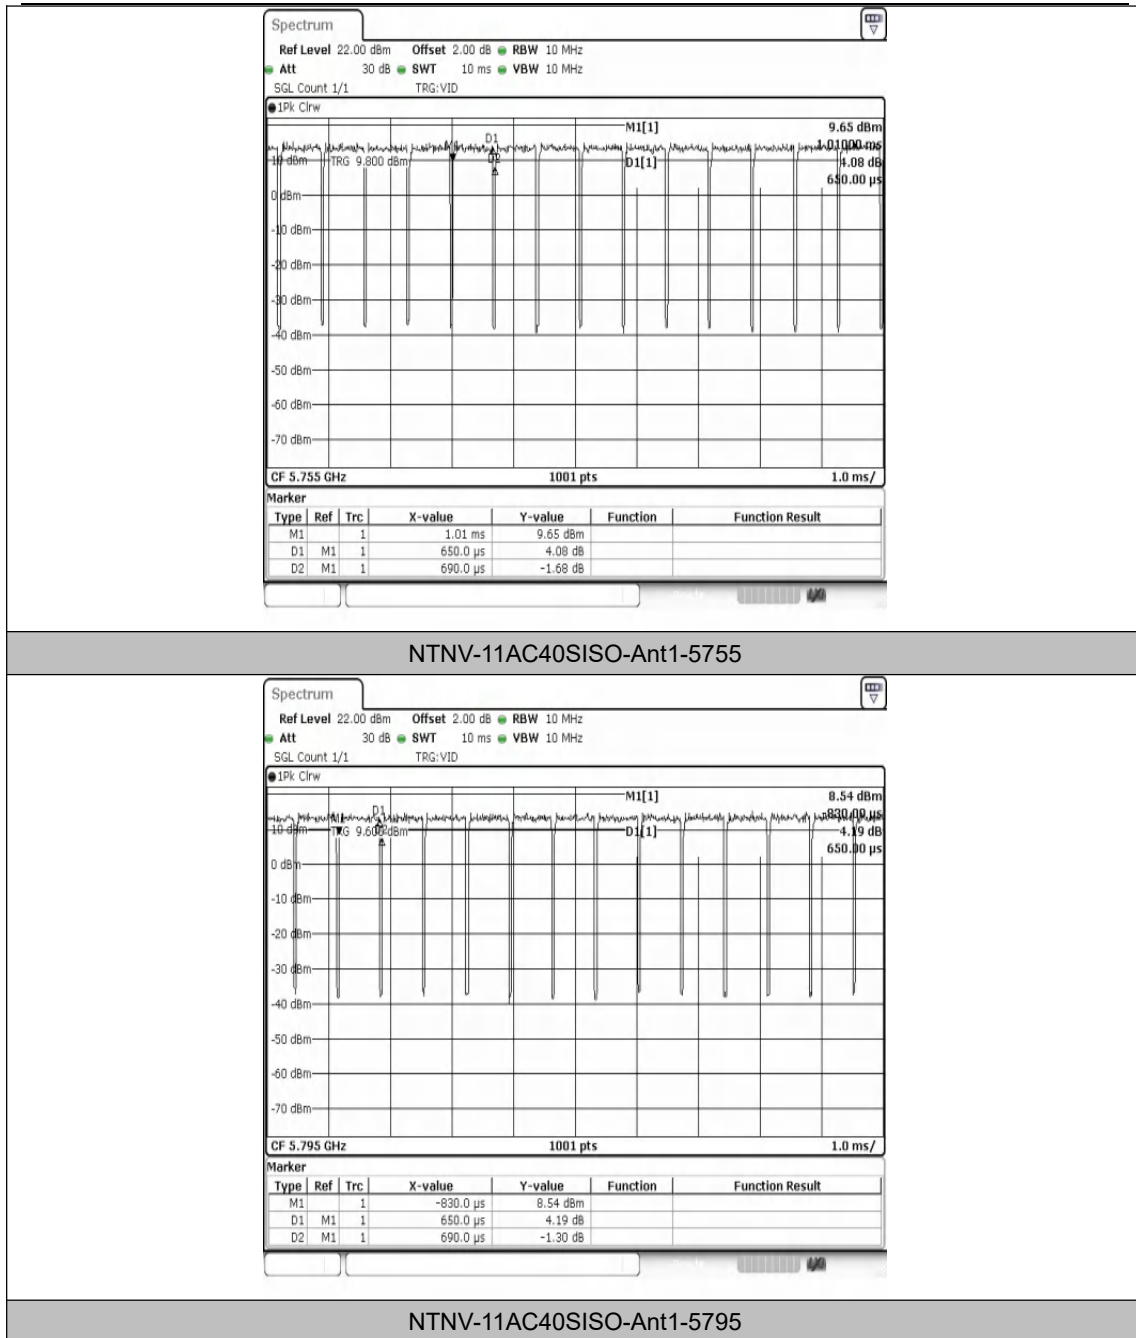

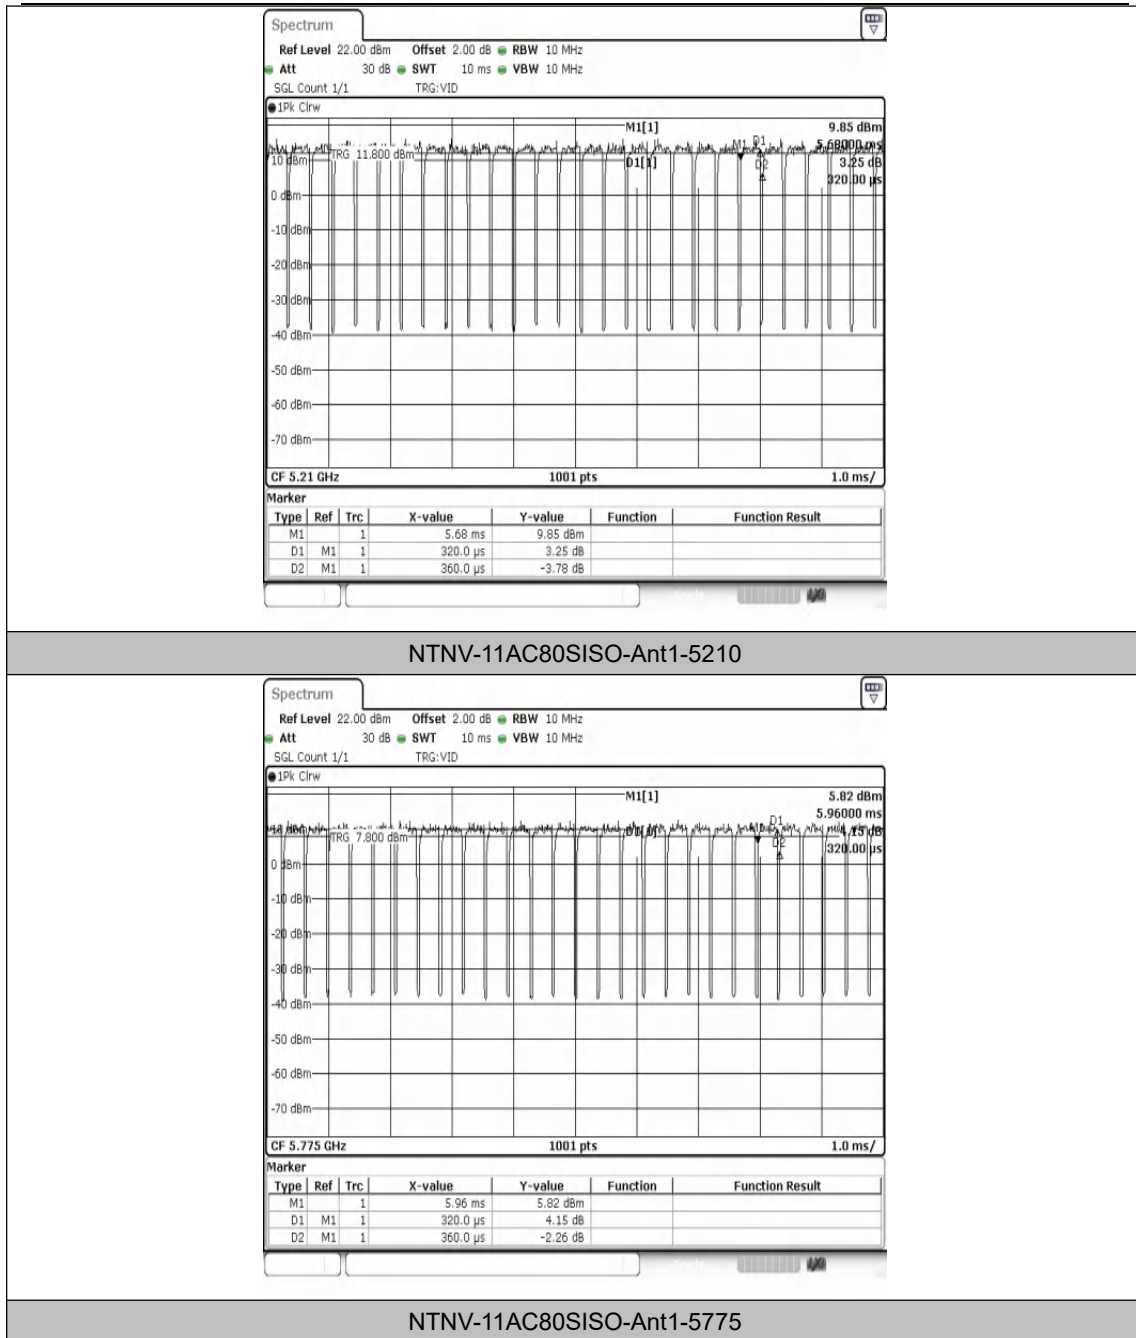


Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	12.00	80.00	0.97	12.97	≤23.98	PASS
11A	Ant1	5200	11.92	80.00	0.97	12.89	≤23.98	PASS
11A	Ant1	5240	11.02	80.00	0.97	11.99	≤23.98	PASS
11A	Ant1	5745	10.61	80.00	0.97	11.58	≤30.00	PASS
11A	Ant1	5785	9.60	80.00	0.97	10.57	≤30.00	PASS
11A	Ant1	5825	10.86	80.00	0.97	11.83	≤30.00	PASS
11N20SISO	Ant1	5180	12.21	96.97	0.13	12.34	≤23.98	PASS
11N20SISO	Ant1	5200	12.86	97.46	0.11	12.97	≤23.98	PASS
11N20SISO	Ant1	5240	11.50	96.97	0.13	11.63	≤23.98	PASS
11N20SISO	Ant1	5745	11.27	97.46	0.11	11.38	≤30.00	PASS
11N20SISO	Ant1	5785	10.15	97.46	0.11	10.26	≤30.00	PASS
11N20SISO	Ant1	5825	11.16	97.46	0.11	11.27	≤30.00	PASS
11N40SISO	Ant1	5190	12.38	94.20	0.26	12.64	≤23.98	PASS
11N40SISO	Ant1	5230	11.64	94.20	0.26	11.90	≤23.98	PASS
11N40SISO	Ant1	5755	10.72	94.20	0.26	10.98	≤30.00	PASS
11N40SISO	Ant1	5795	10.59	94.95	0.23	10.82	≤30.00	PASS
11AC20SISO	Ant1	5180	12.28	97.04	0.13	12.41	≤23.98	PASS
11AC20SISO	Ant1	5200	12.90	96.32	0.16	13.06	≤23.98	PASS
11AC20SISO	Ant1	5240	11.34	96.32	0.16	11.50	≤23.98	PASS
11AC20SISO	Ant1	5745	11.29	96.32	0.16	11.45	≤30.00	PASS
11AC20SISO	Ant1	5785	10.19	96.32	0.16	10.35	≤30.00	PASS
11AC20SISO	Ant1	5825	11.21	96.32	0.16	11.37	≤30.00	PASS
11AC40SISO	Ant1	5190	12.42	94.20	0.26	12.68	≤23.98	PASS
11AC40SISO	Ant1	5230	11.74	94.20	0.26	12.00	≤23.98	PASS
11AC40SISO	Ant1	5755	10.75	94.20	0.26	11.01	≤30.00	PASS
11AC40SISO	Ant1	5795	10.60	94.20	0.26	10.86	≤30.00	PASS
11AC80SISO	Ant1	5210	11.79	88.89	0.51	12.30	≤23.98	PASS
11AC80SISO	Ant1	5775	9.86	88.89	0.51	10.37	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Graphs Channel Power

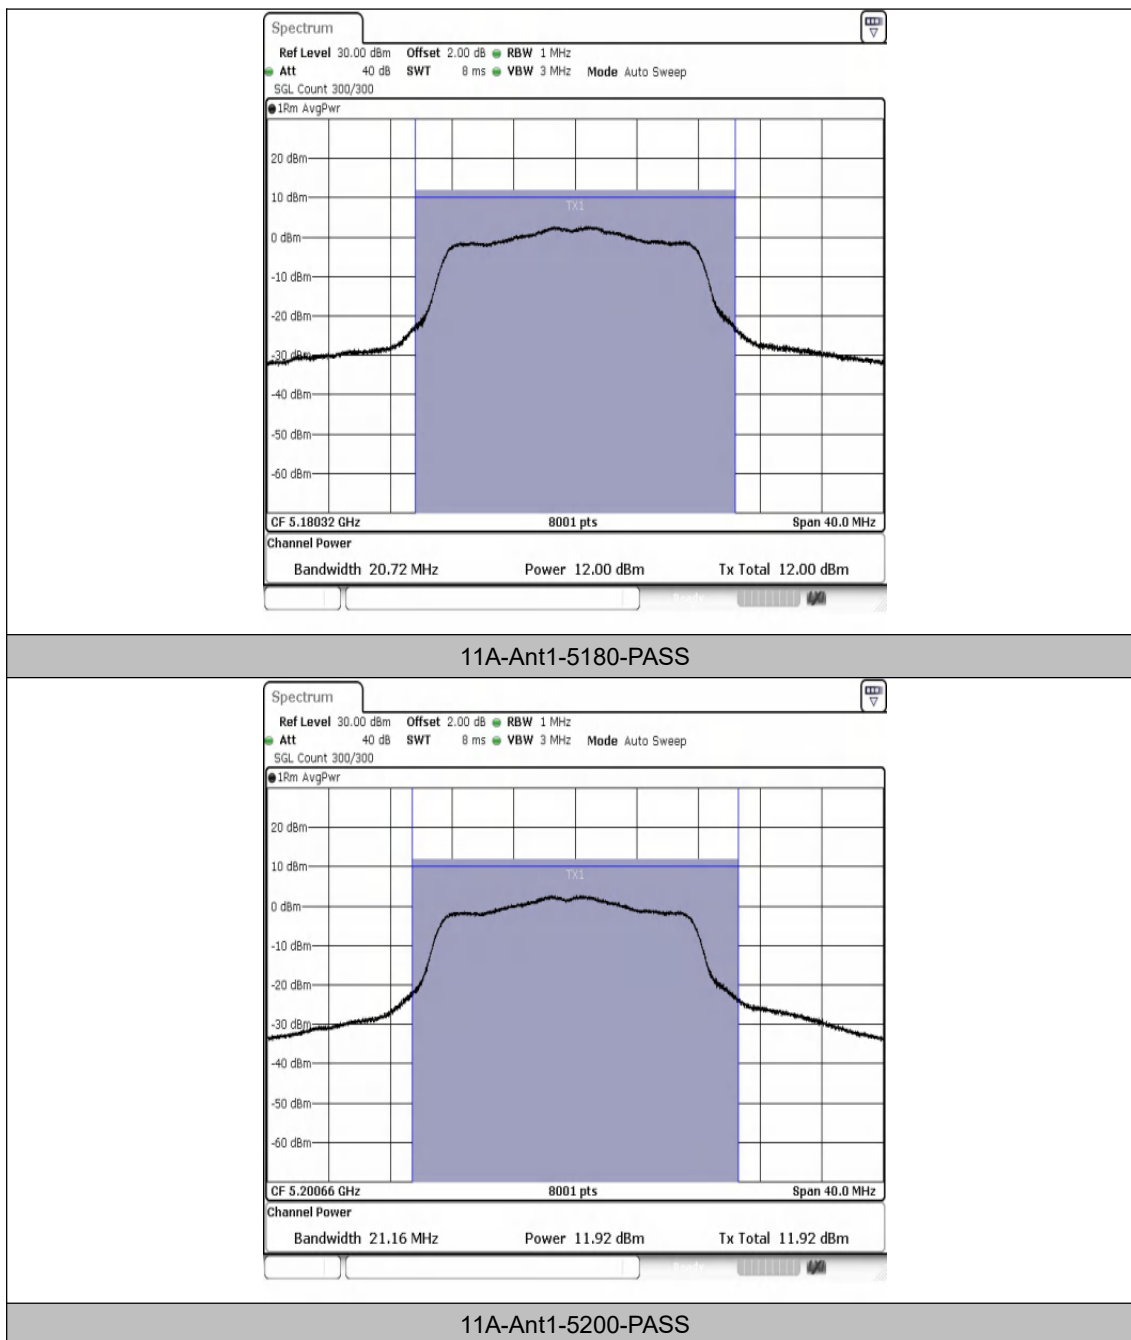


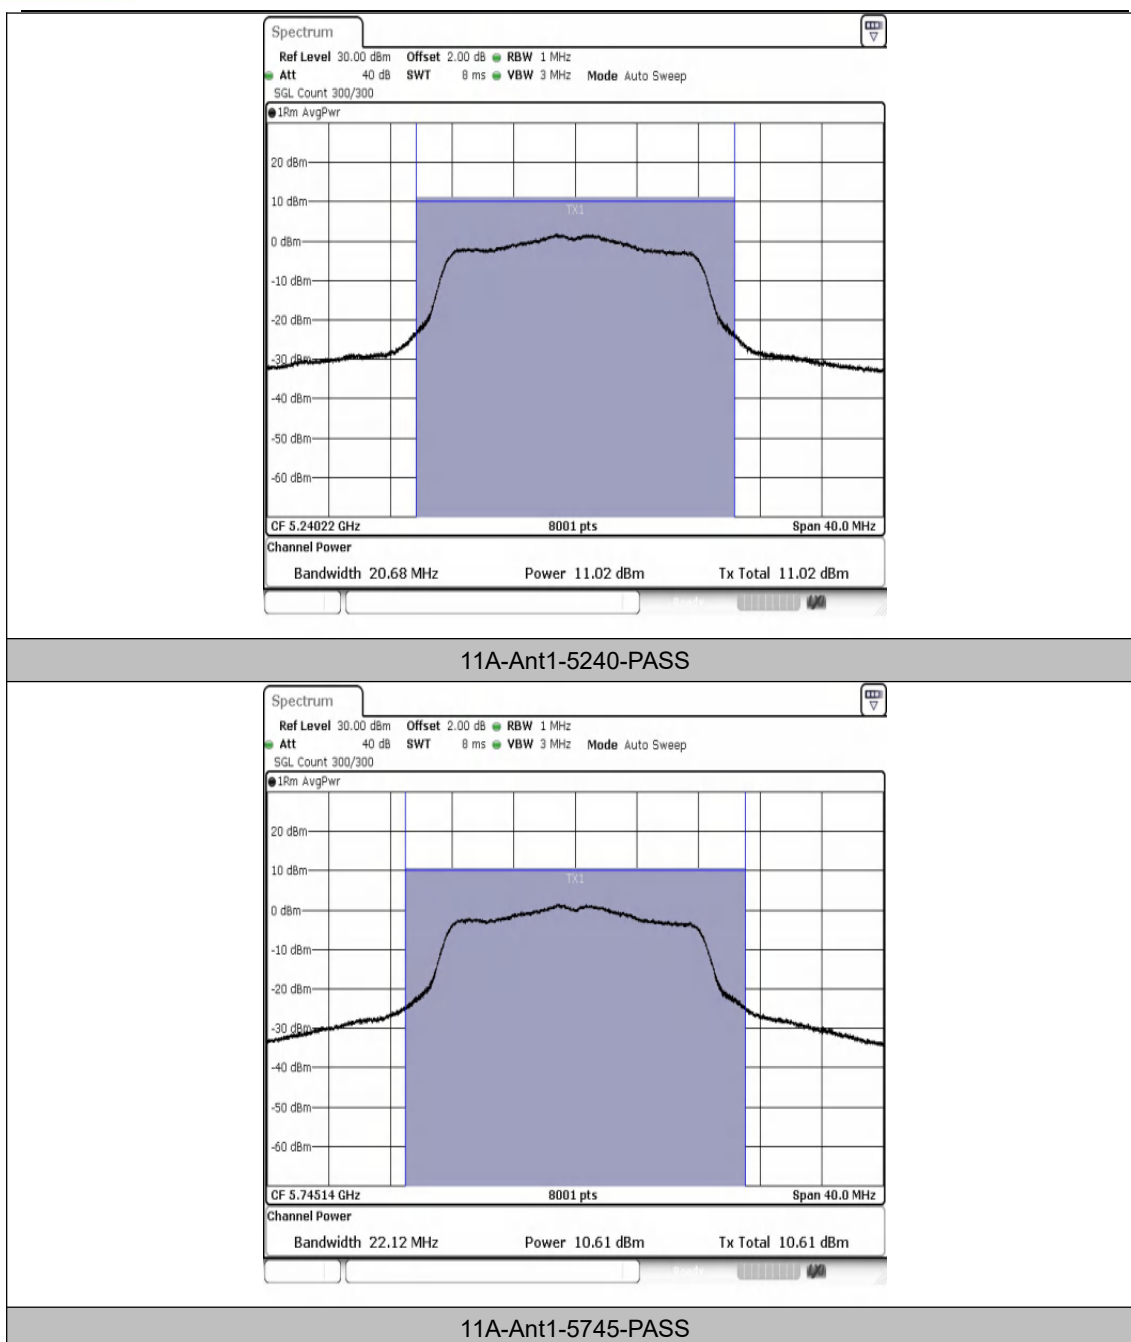

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

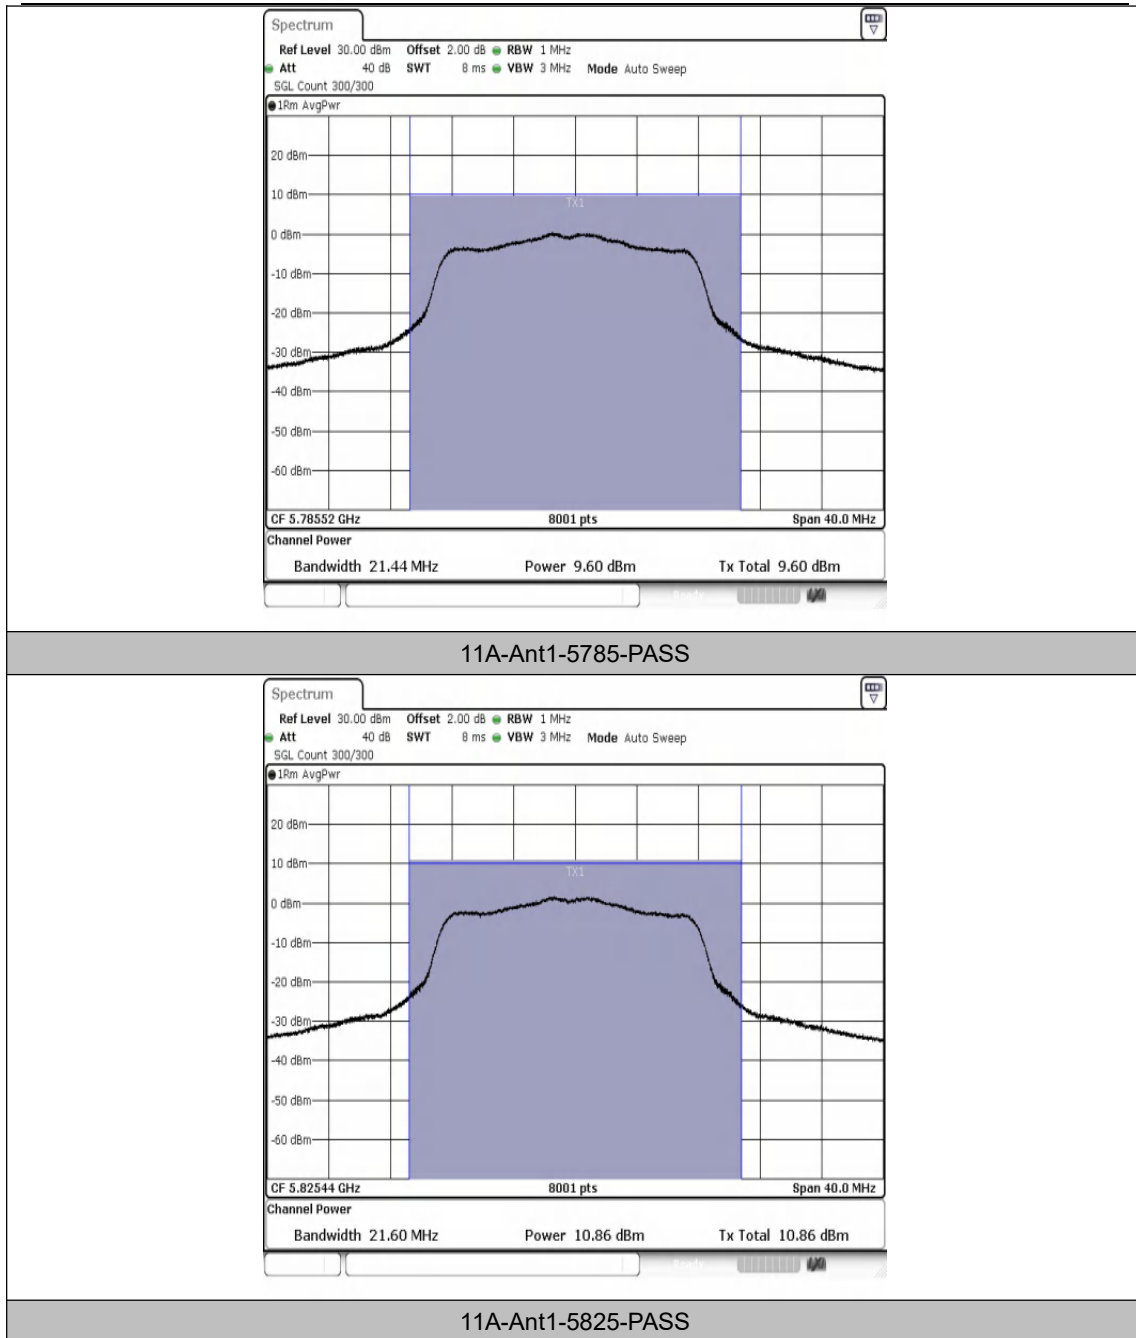



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

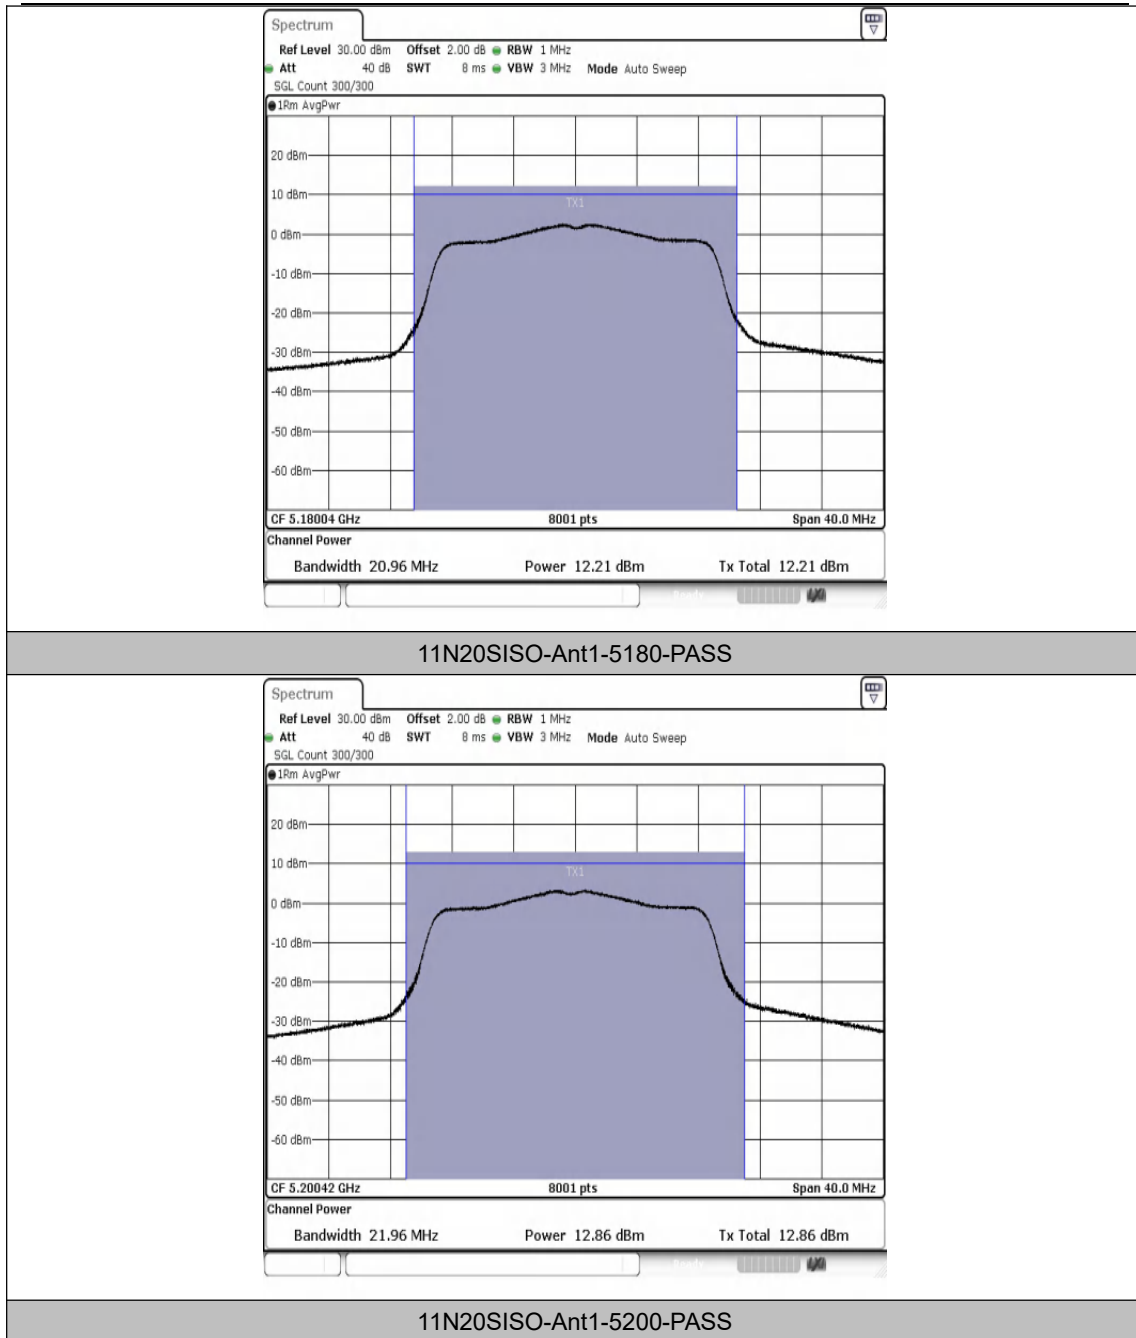

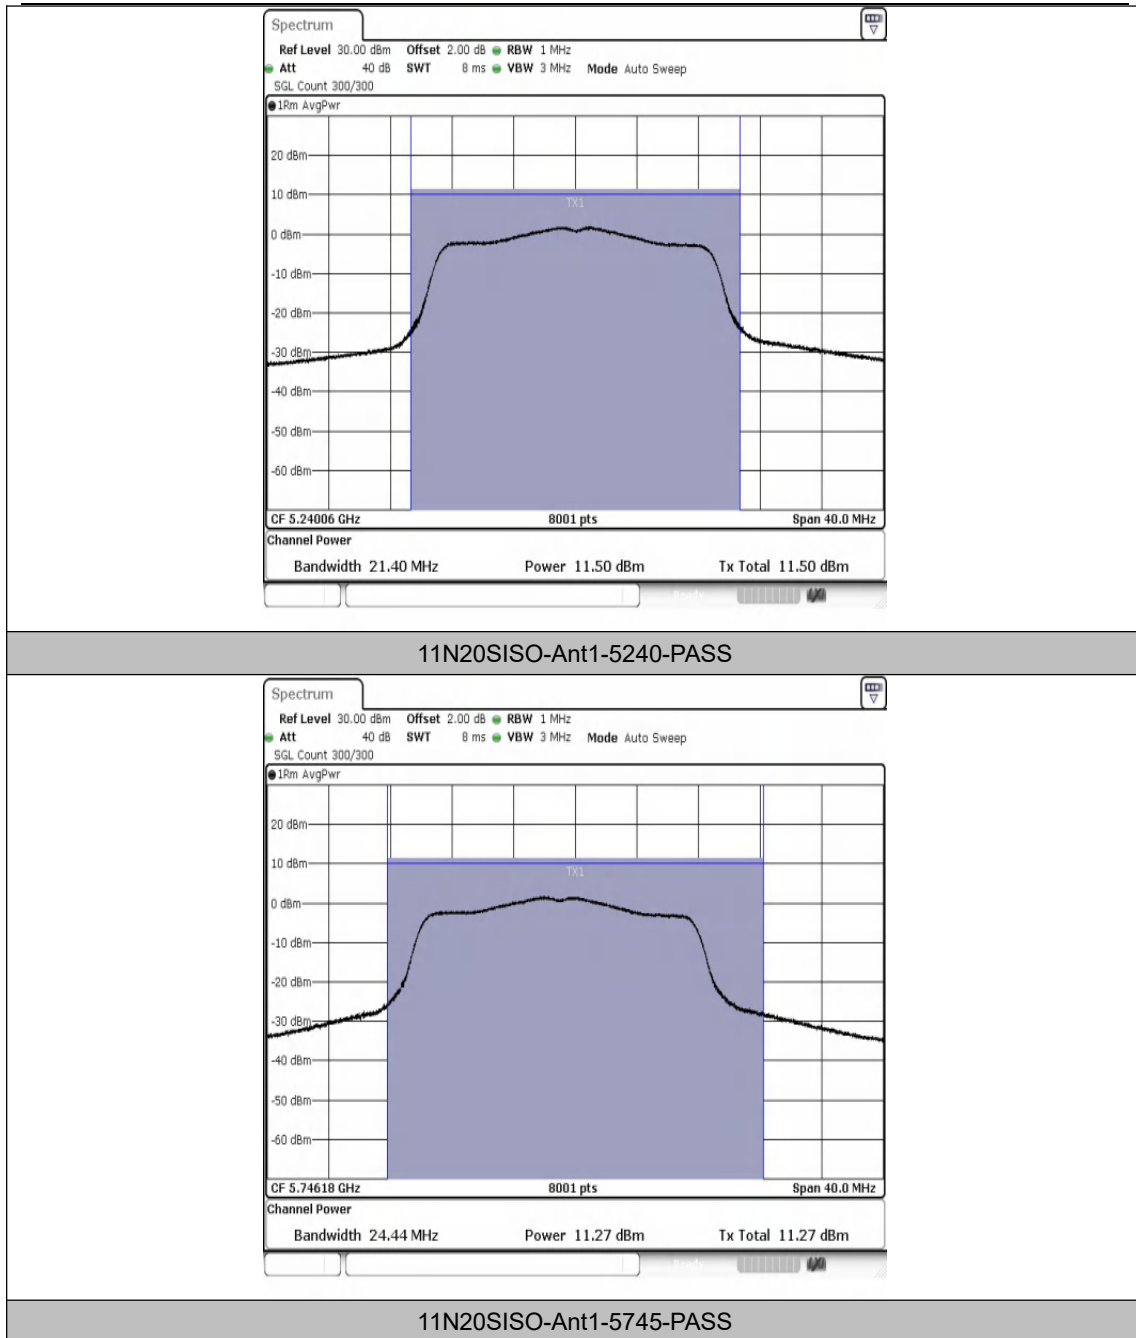

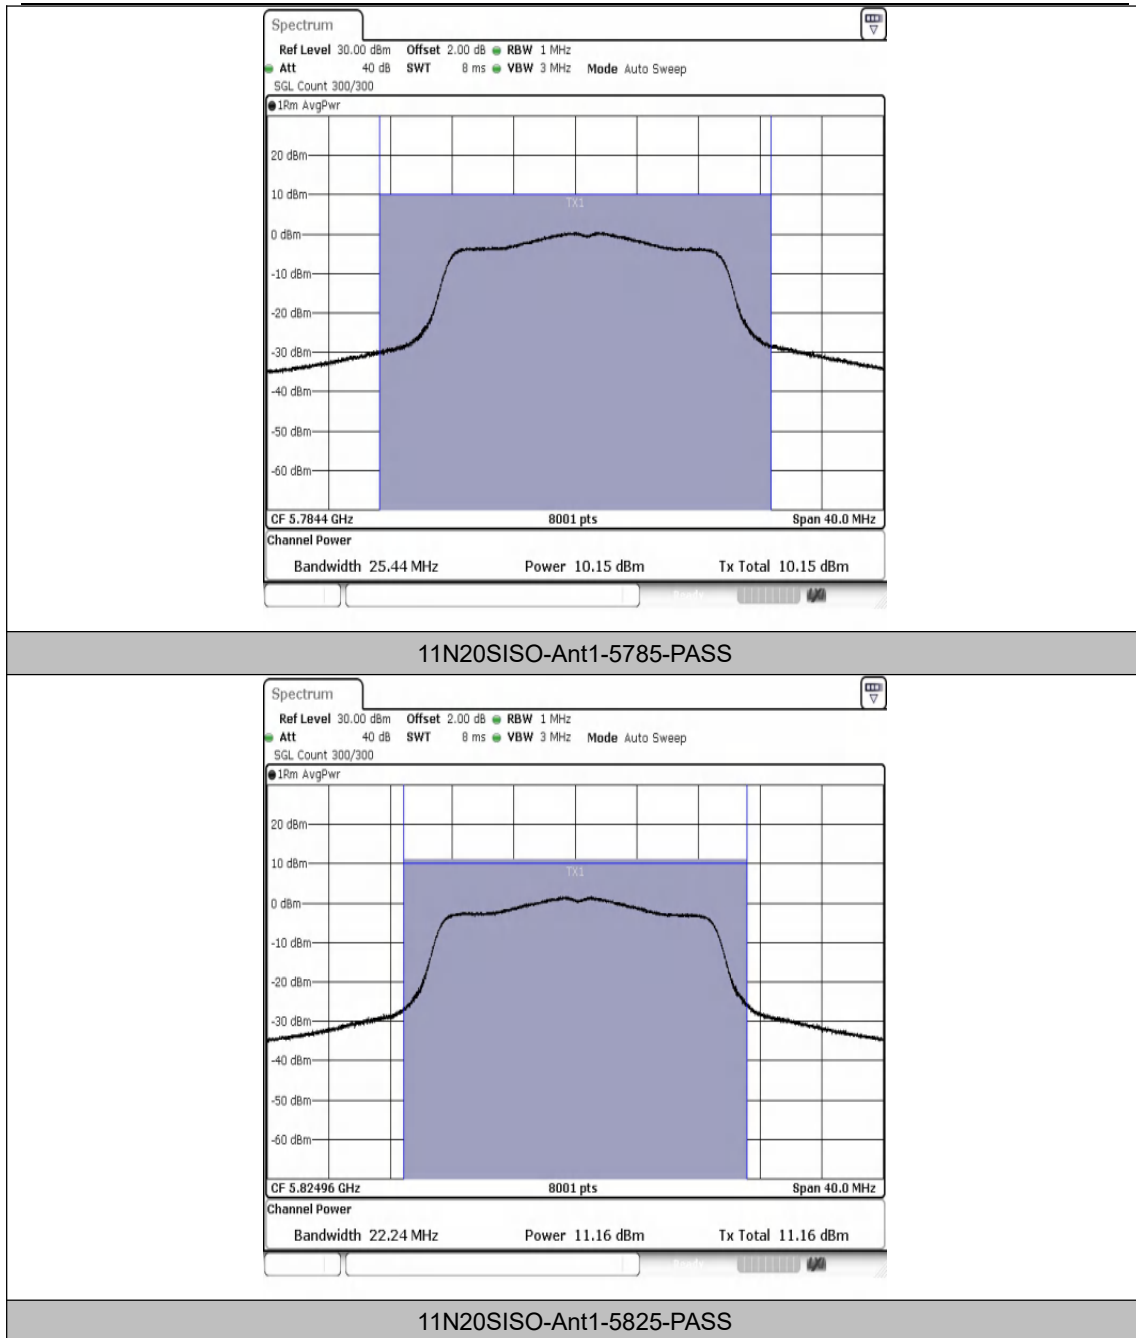

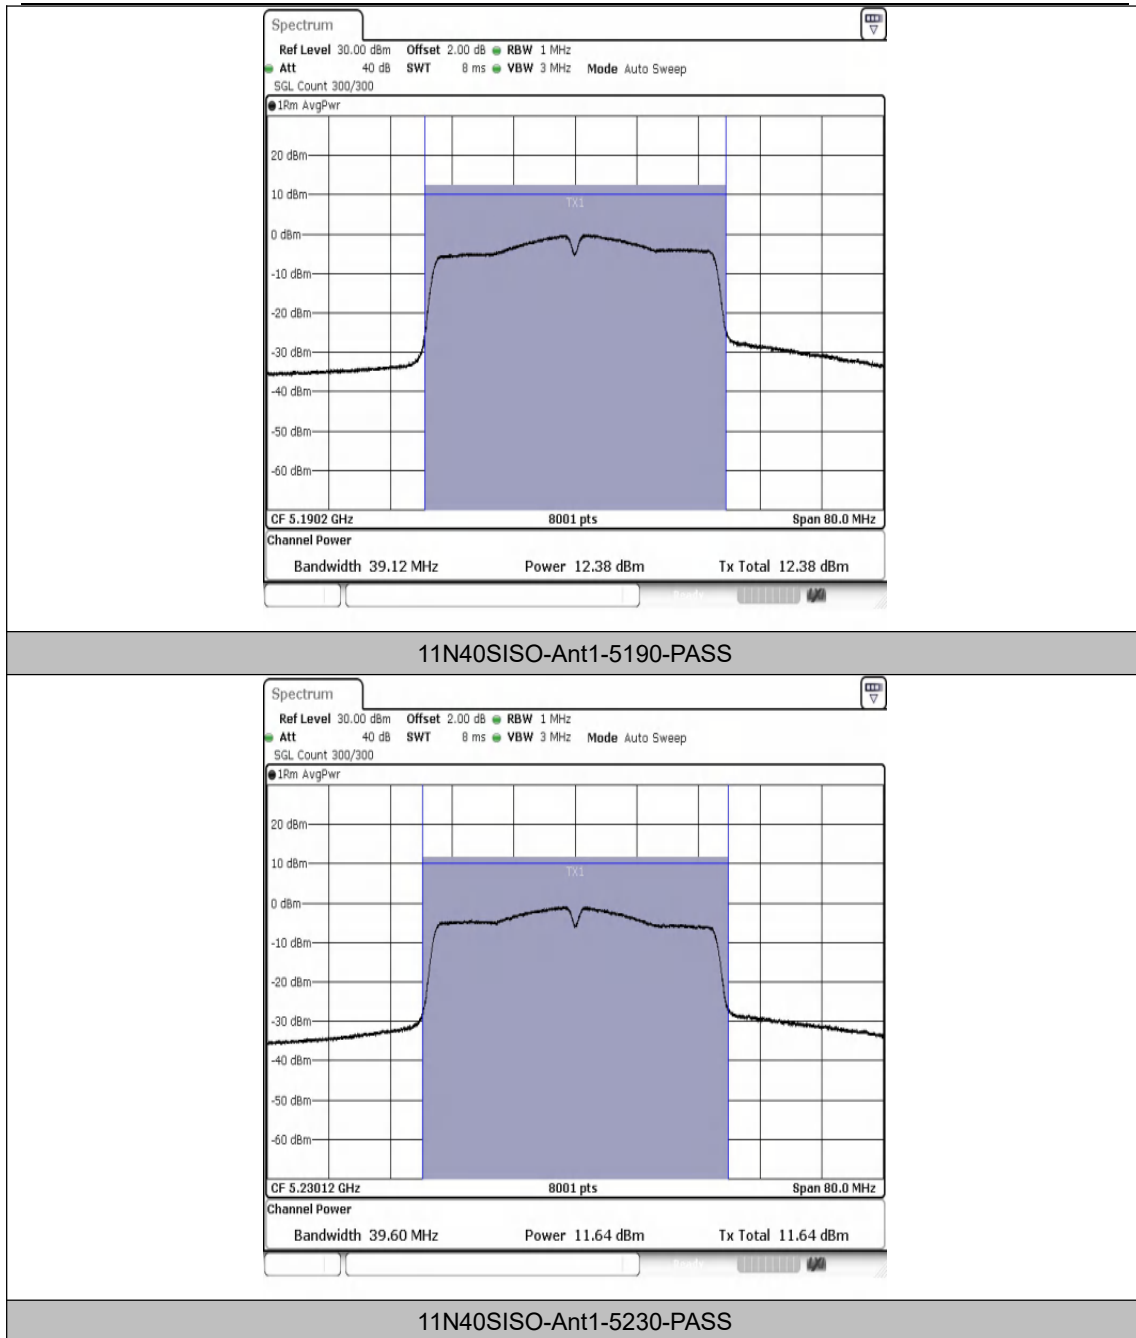


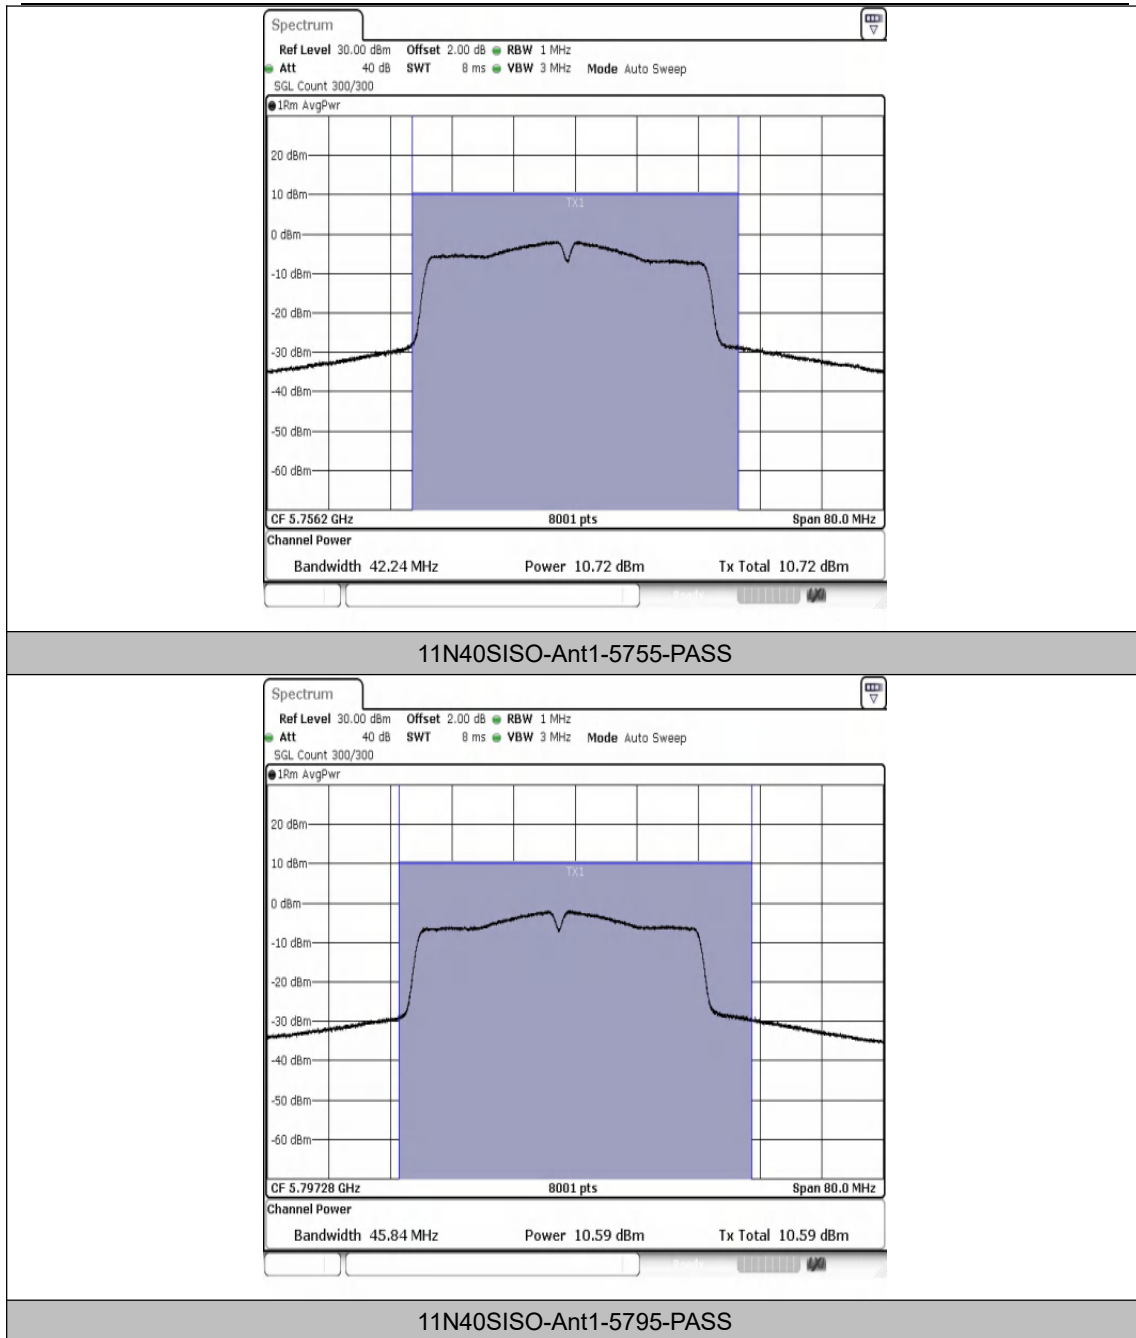

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

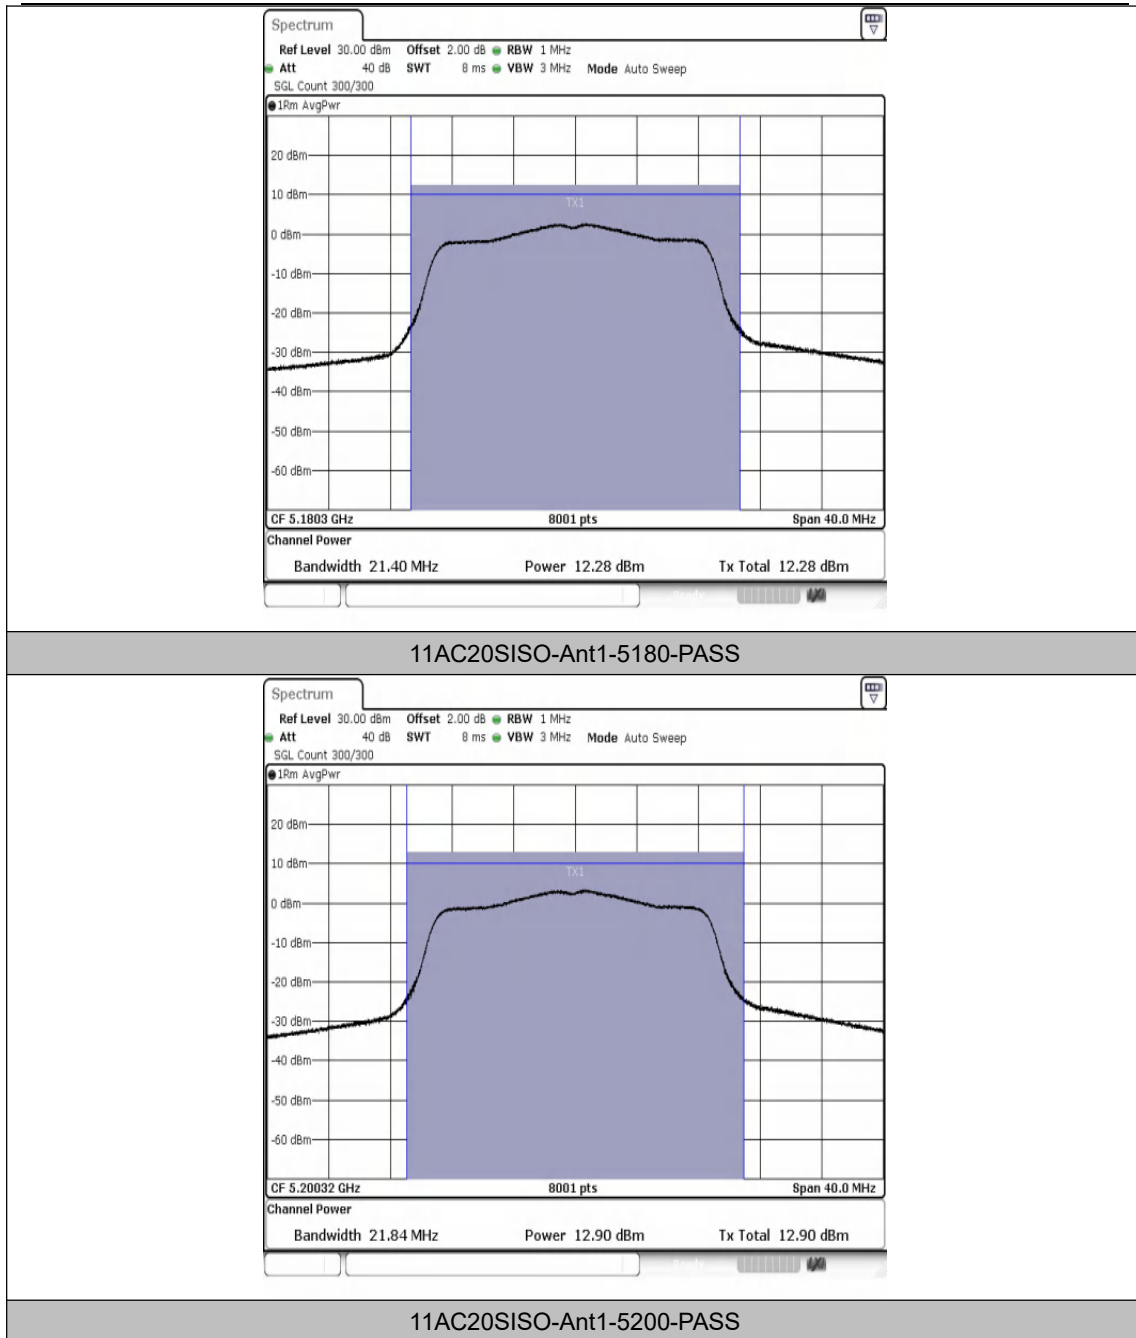


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

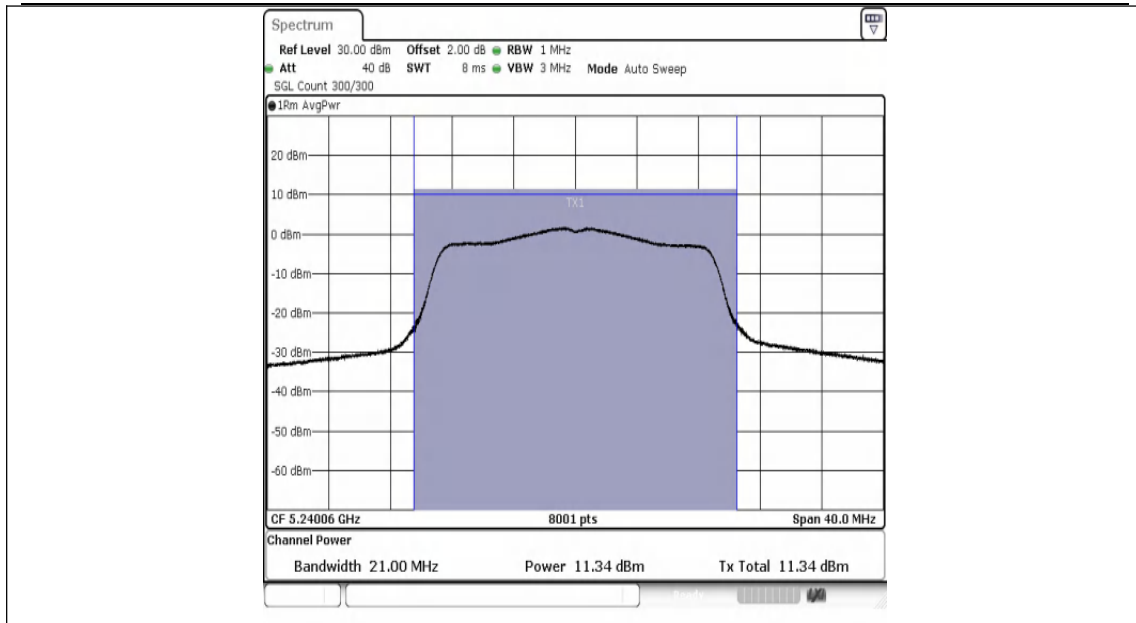



11AC20SISO-Ant1-5240-PASS

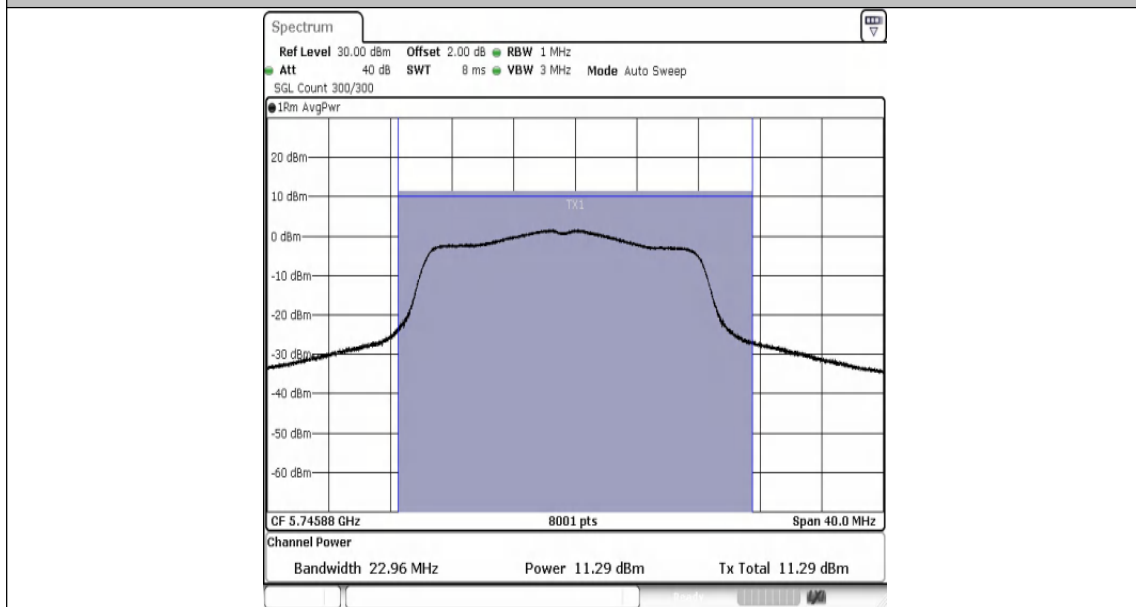


11AC20SISO-Ant1-5745-PASS

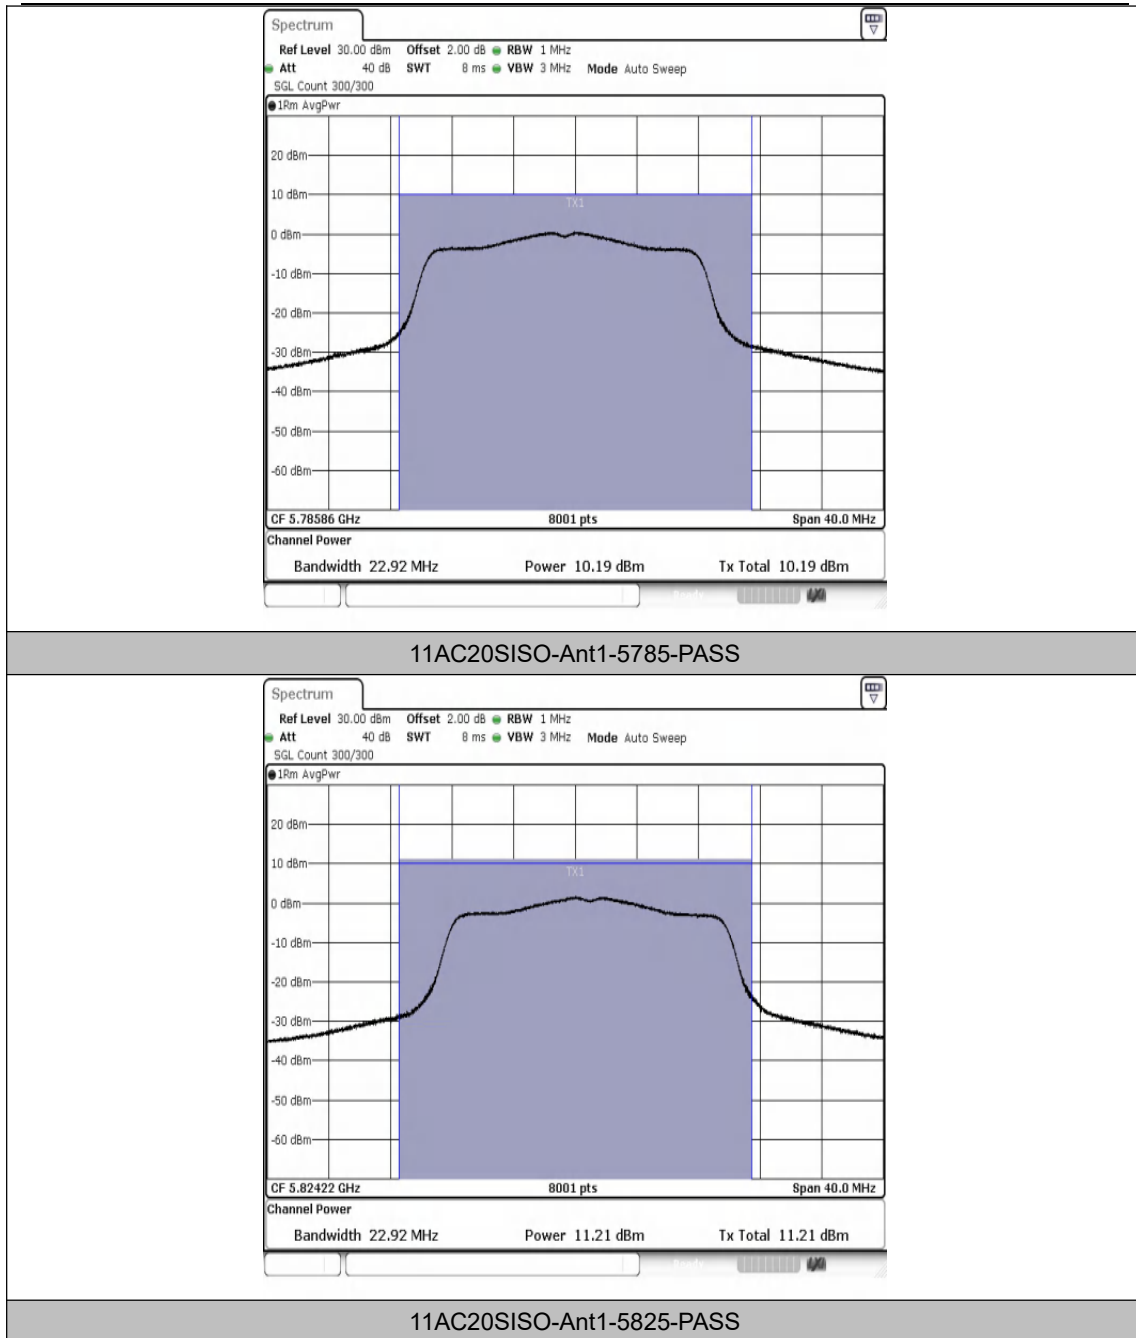

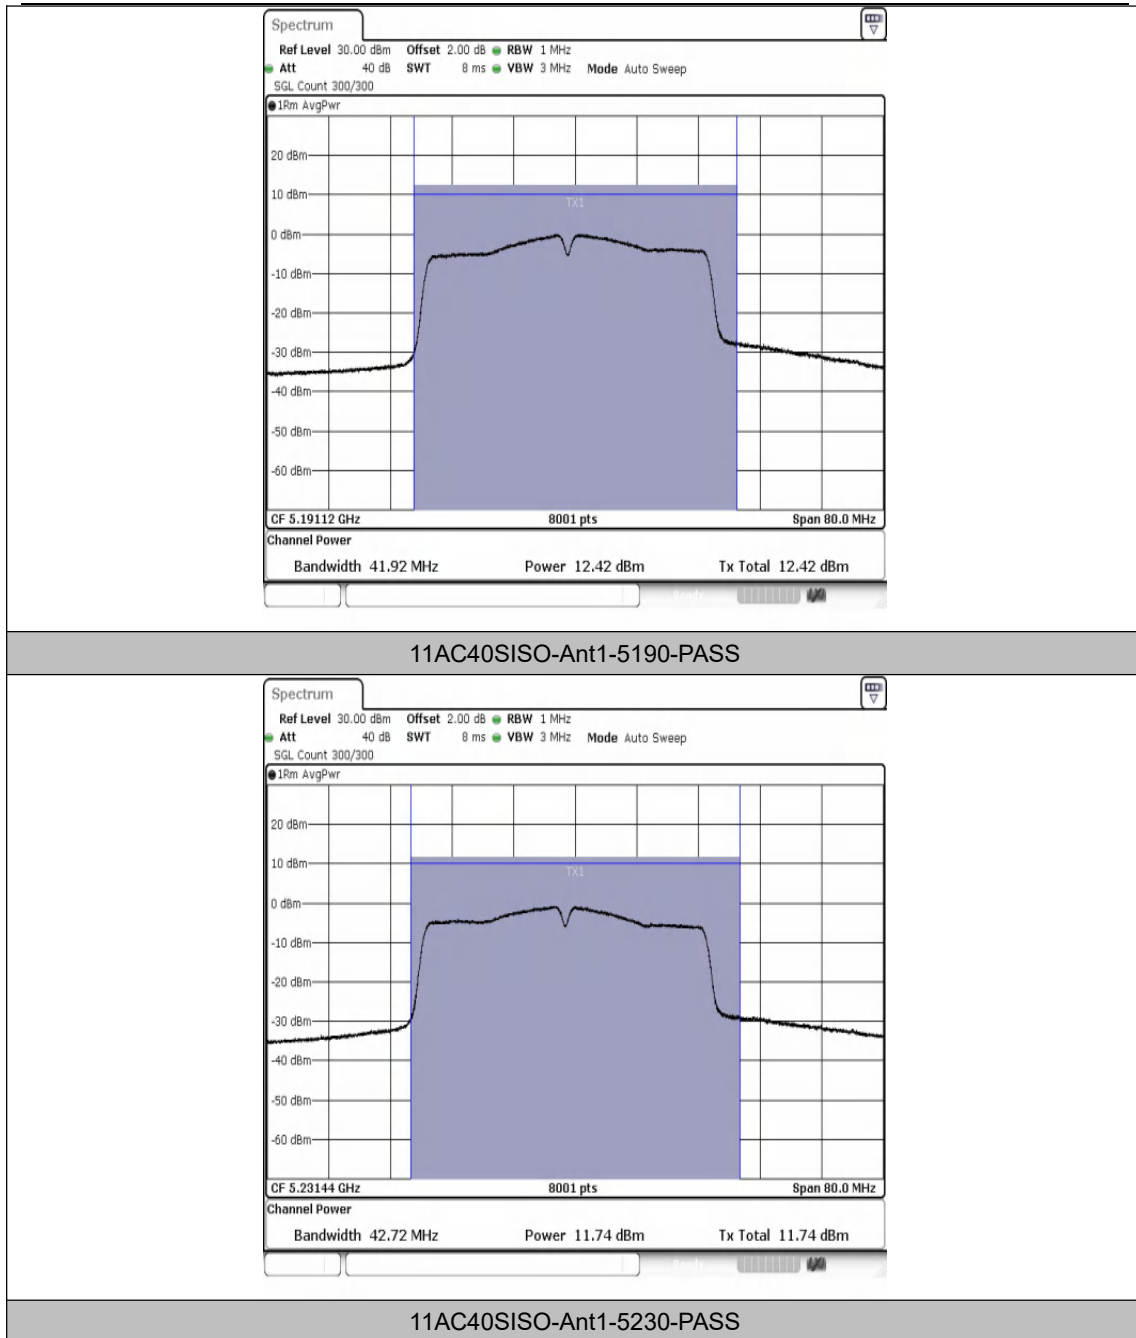

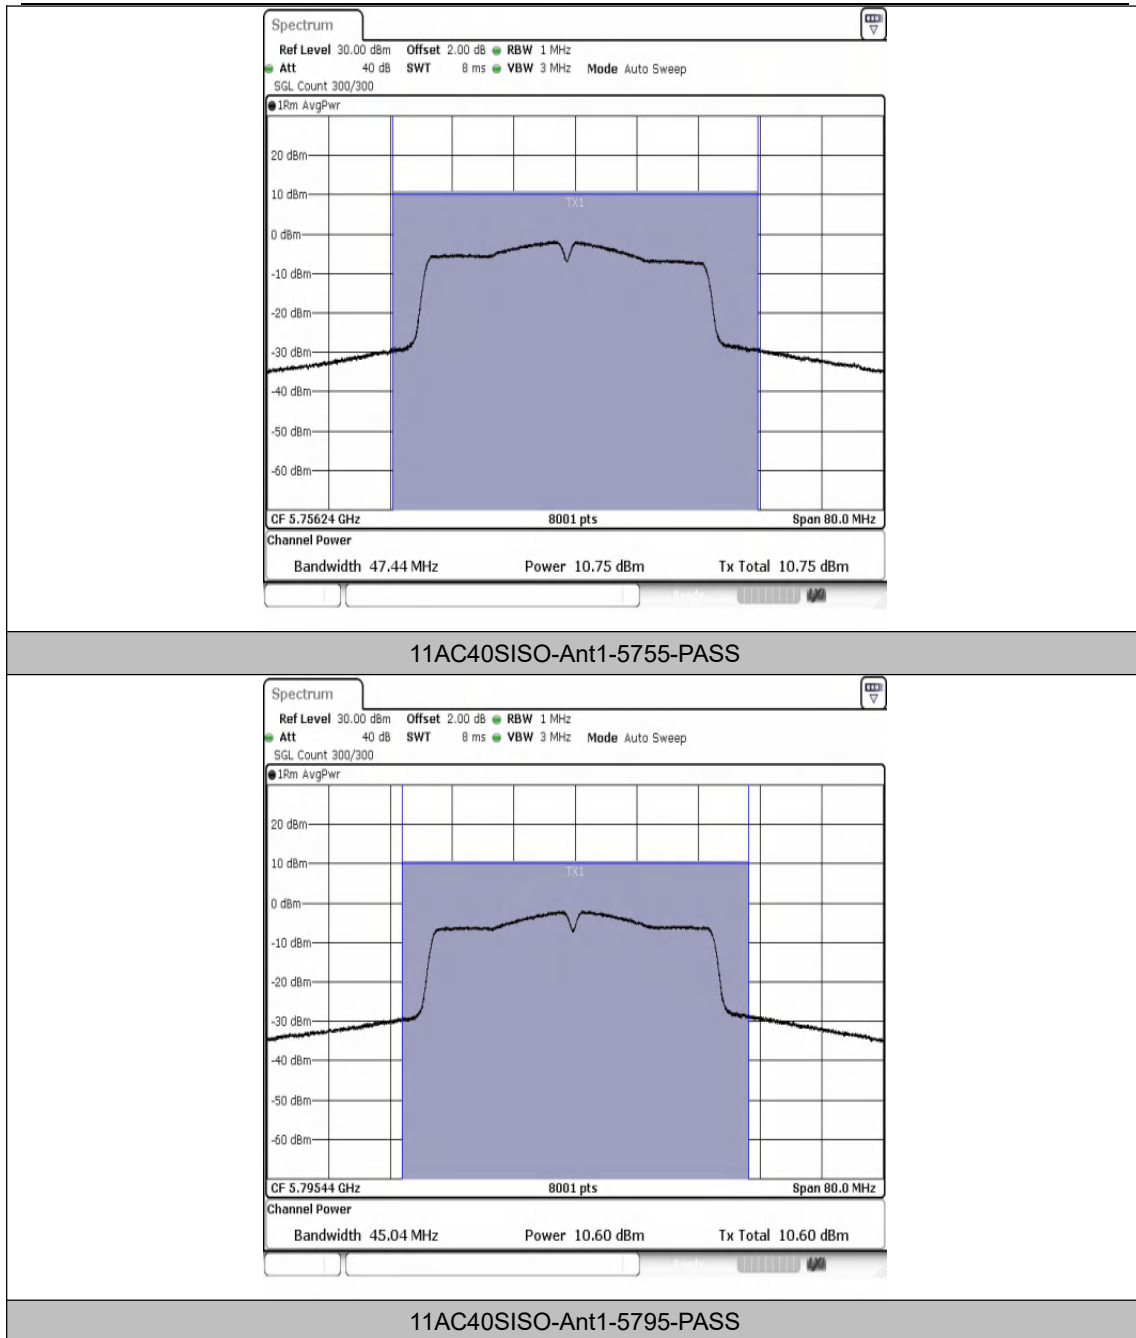

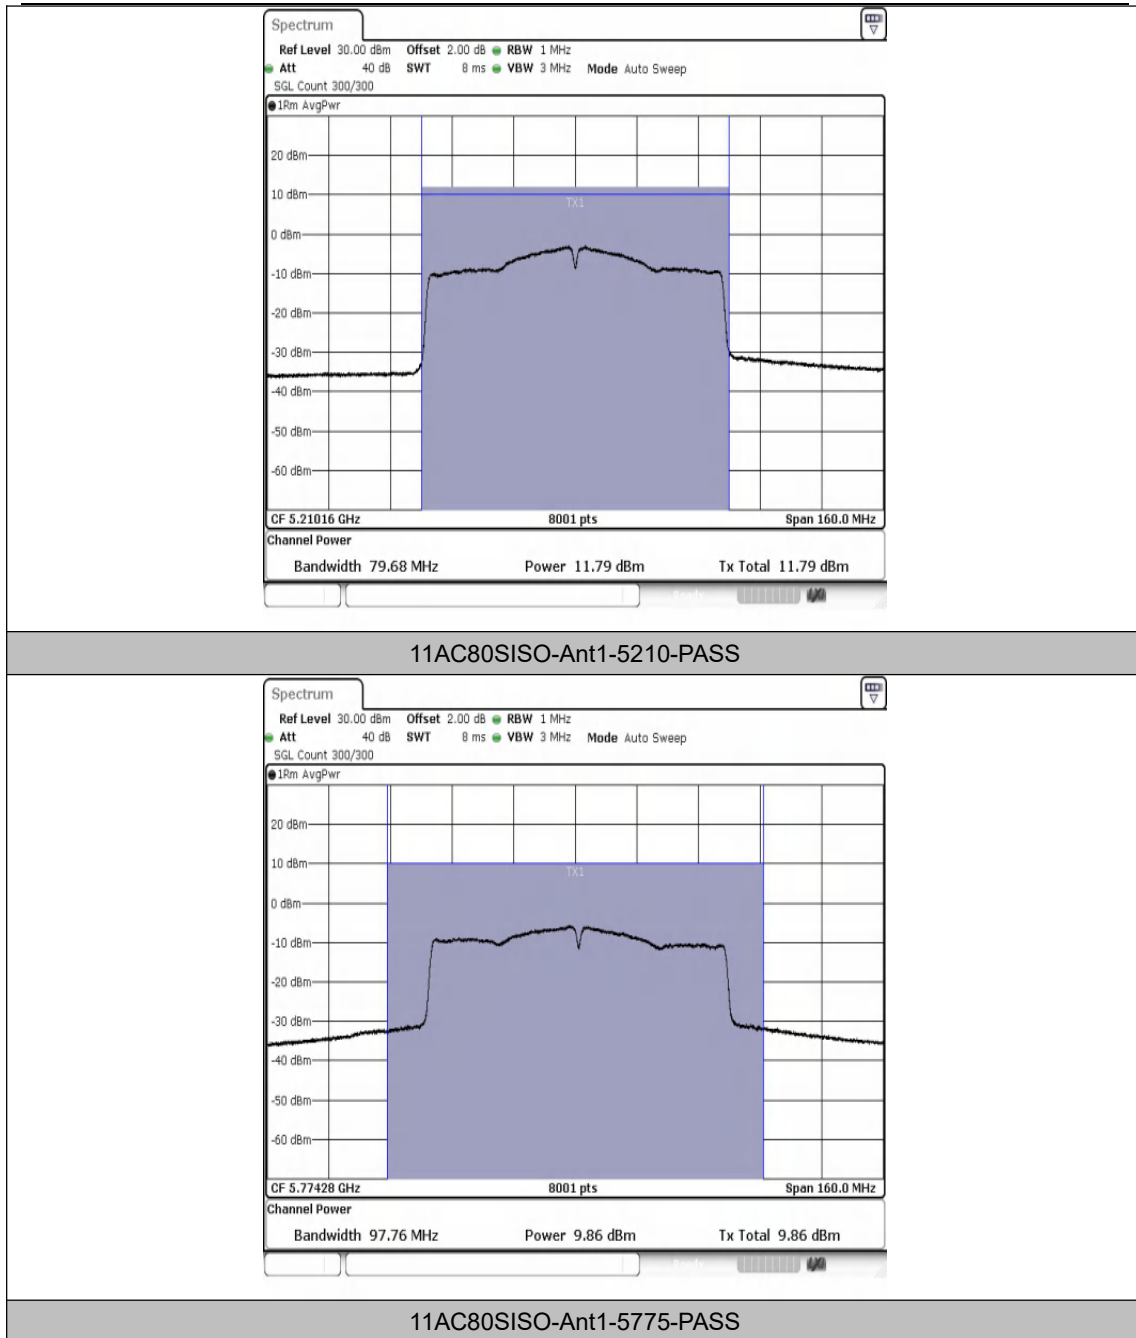

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	2.27	0.97	3.24	≤11.00	PASS
11A	Ant1	5200	1.92	0.97	2.89	≤11.00	PASS
11A	Ant1	5240	1.95	0.97	2.92	≤11.00	PASS
11N20SISO	Ant1	5180	2.75	0.13	2.88	≤11.00	PASS
11N20SISO	Ant1	5200	2.97	0.11	3.08	≤11.00	PASS
11N20SISO	Ant1	5240	2.25	0.13	2.38	≤11.00	PASS
11N40SISO	Ant1	5190	0.05	0.26	0.31	≤11.00	PASS
11N40SISO	Ant1	5230	-0.63	0.26	-0.37	≤11.00	PASS
11AC20SISO	Ant1	5180	1.99	0.13	2.12	≤11.00	PASS
11AC20SISO	Ant1	5200	3.88	0.16	4.04	≤11.00	PASS
11AC20SISO	Ant1	5240	1.55	0.16	1.71	≤11.00	PASS
11AC40SISO	Ant1	5190	-0.19	0.26	0.07	≤11.00	PASS
11AC40SISO	Ant1	5230	-0.69	0.26	-0.43	≤11.00	PASS
11AC80SISO	Ant1	5210	-2.8	0.51	-2.29	≤11.00	PASS

Note: 1.The and cable loss is compensated in the graph.


Test Result B4

Test Mode	Antenna	Frequency[MHz]	Reading Result [dBm/500KHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit [dBm/500 KHz]	Verdict
11A	Ant1	5745	-0.82	0.97	0.15	≤30.00	PASS
11A	Ant1	5785	-1.94	0.97	-0.97	≤30.00	PASS
11A	Ant1	5825	-1.46	0.97	-0.49	≤30.00	PASS
11N20SISO	Ant1	5745	-1.24	0.11	-1.13	≤30.00	PASS
11N20SISO	Ant1	5785	-2.86	0.11	-2.75	≤30.00	PASS
11N20SISO	Ant1	5825	-0.83	0.11	-0.72	≤30.00	PASS
11N40SISO	Ant1	5755	-4.72	0.26	-4.46	≤30.00	PASS
11N40SISO	Ant1	5795	-4.77	0.23	-4.54	≤30.00	PASS
11AC20SISO	Ant1	5745	-1.28	0.16	-1.12	≤30.00	PASS
11AC20SISO	Ant1	5785	-2.29	0.16	-2.13	≤30.00	PASS
11AC20SISO	Ant1	5825	-1.45	0.16	-1.29	≤30.00	PASS
11AC40SISO	Ant1	5755	-4.28	0.26	-4.02	≤30.00	PASS
11AC40SISO	Ant1	5795	-4.43	0.26	-4.17	≤30.00	PASS
11AC80SISO	Ant1	5775	-9.03	0.51	-8.52	≤30.00	PASS

Note : 1.The and cable loss is compensated in the graph.




Test Graphs B1

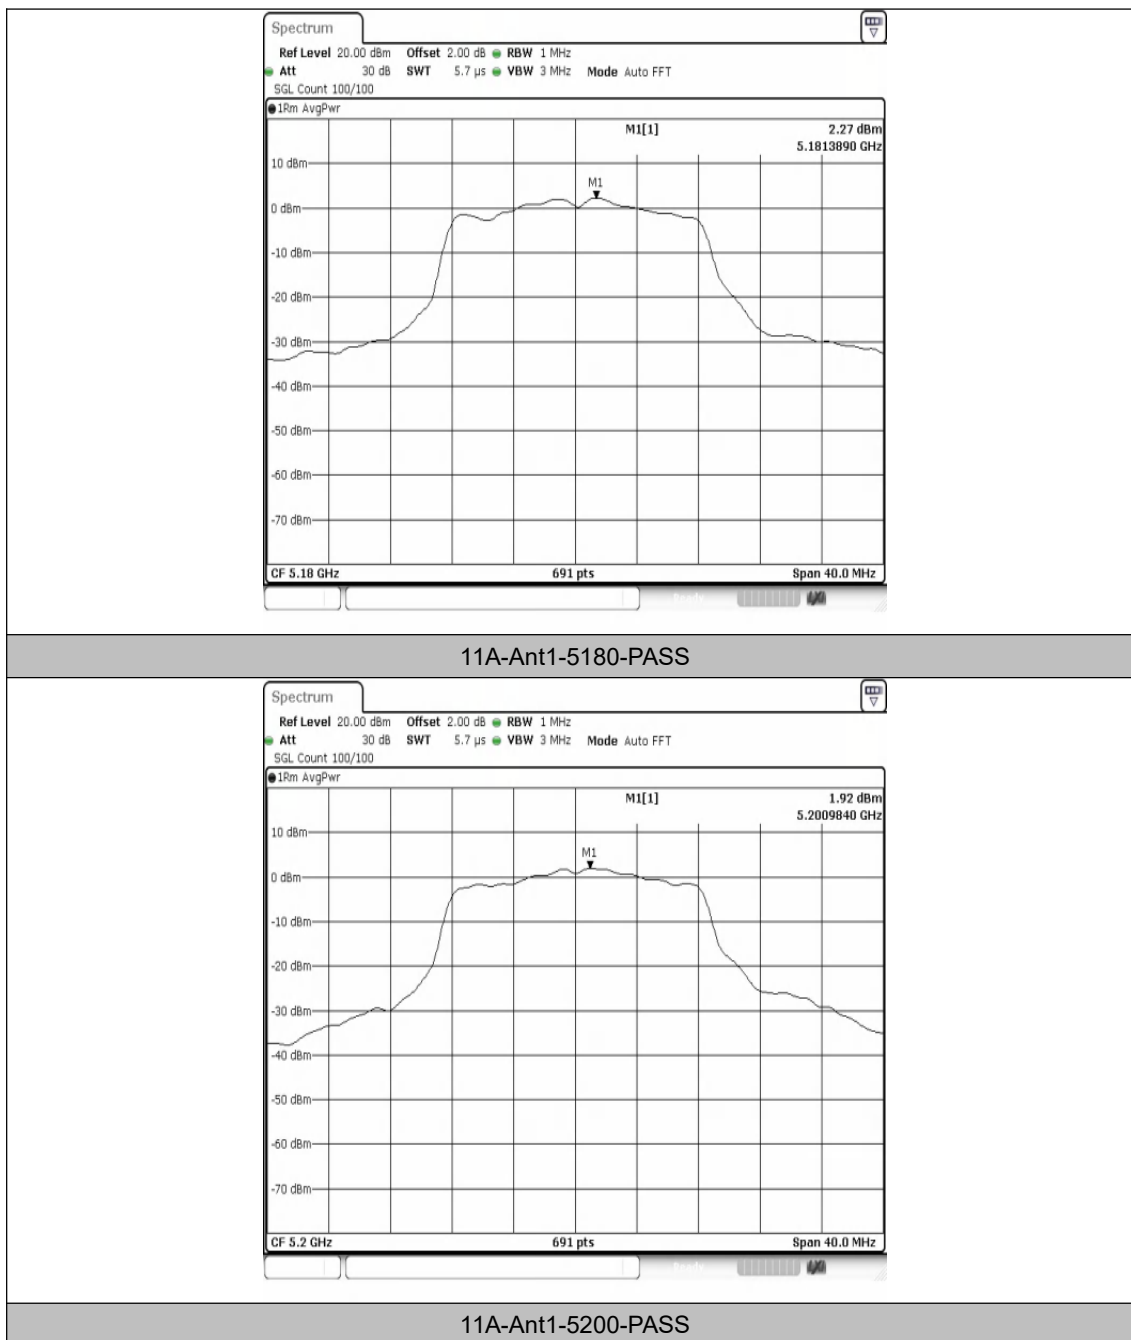

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

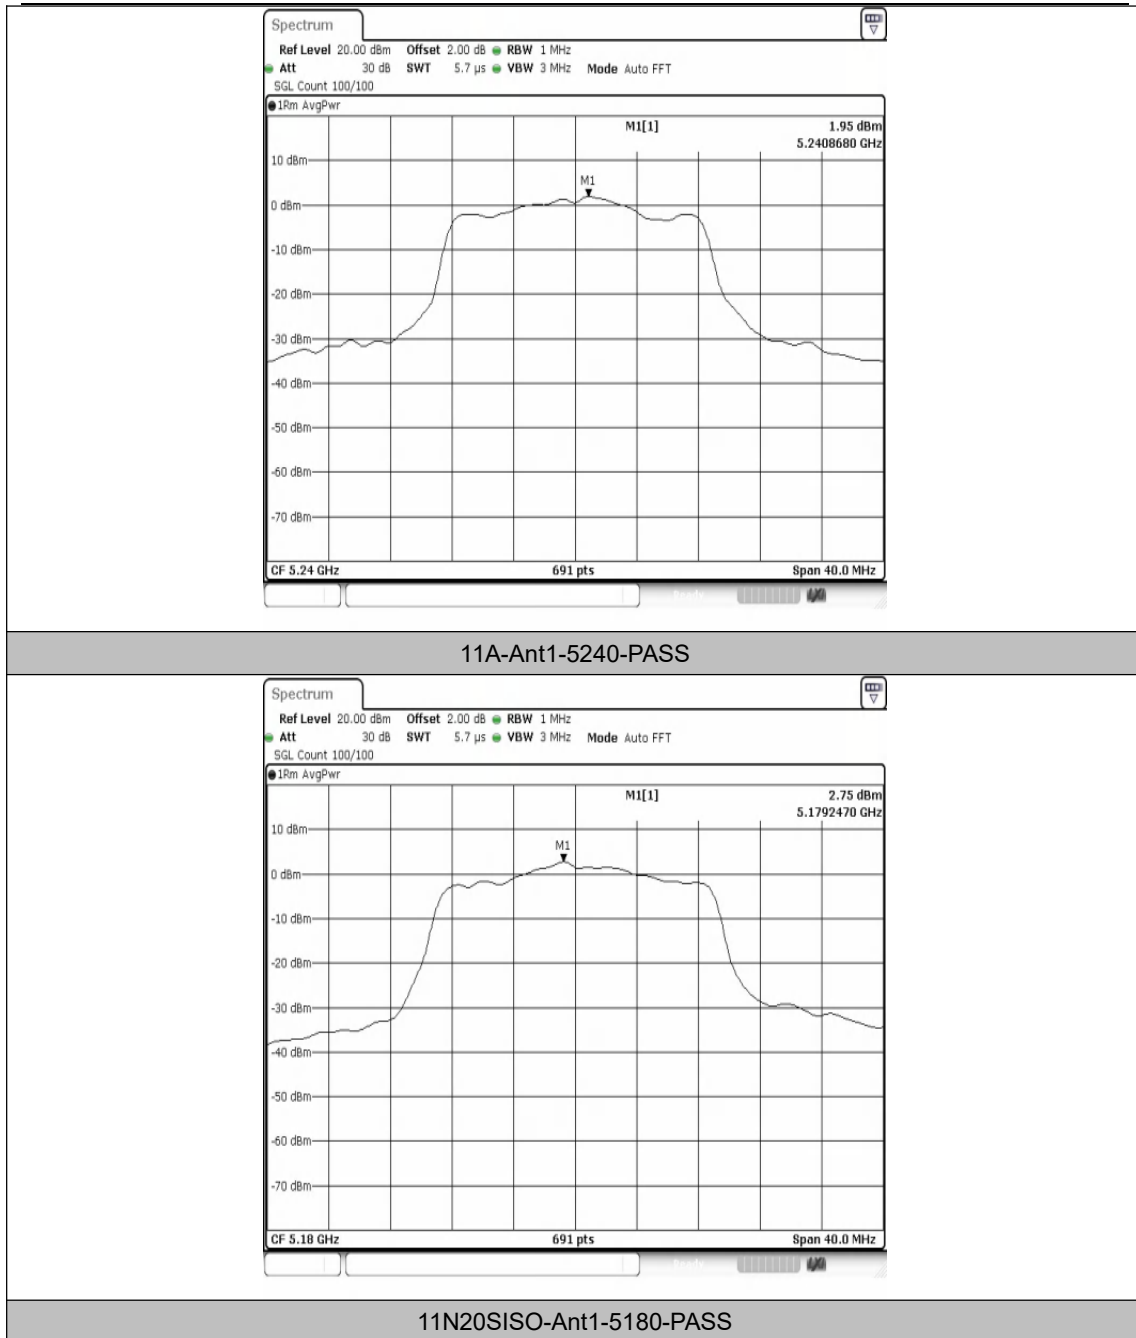

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

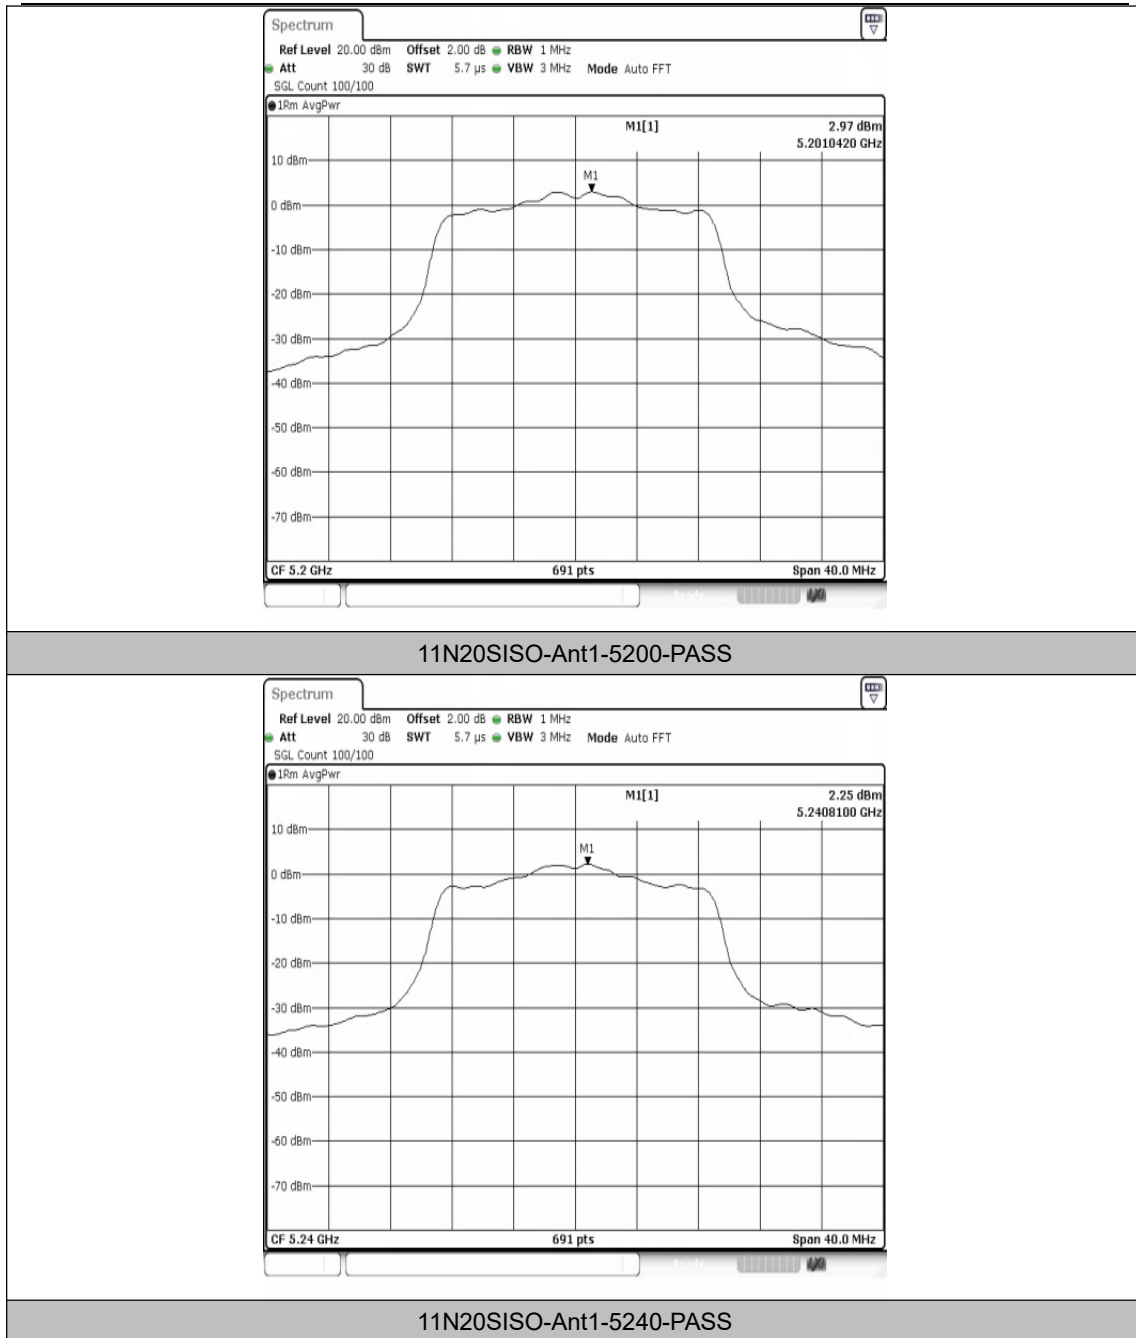


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86) 0755-26066440 Email: service@anbotek.com


 Hotline
 400-003-0500
www.anbotek.com

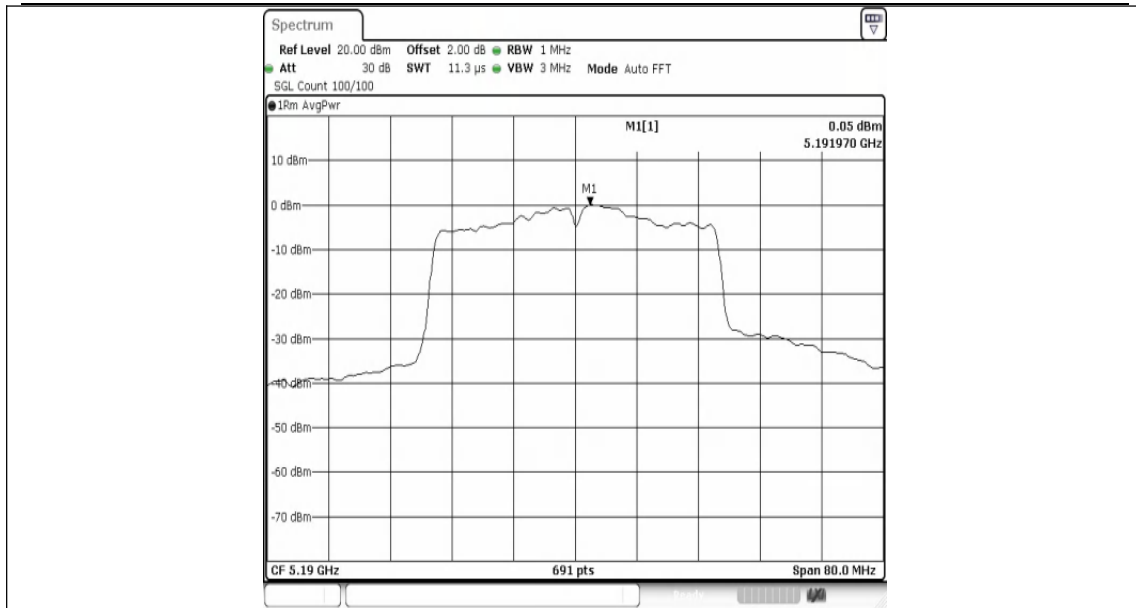


11N40SISO-Ant1-5190-PASS

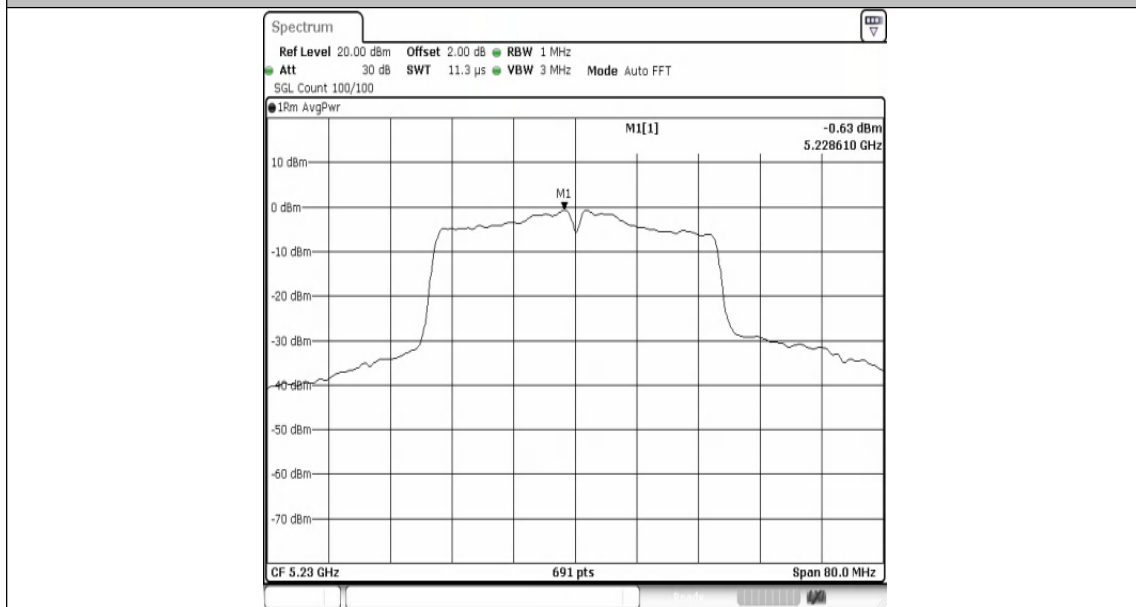


11N40SISO-Ant1-5230-PASS

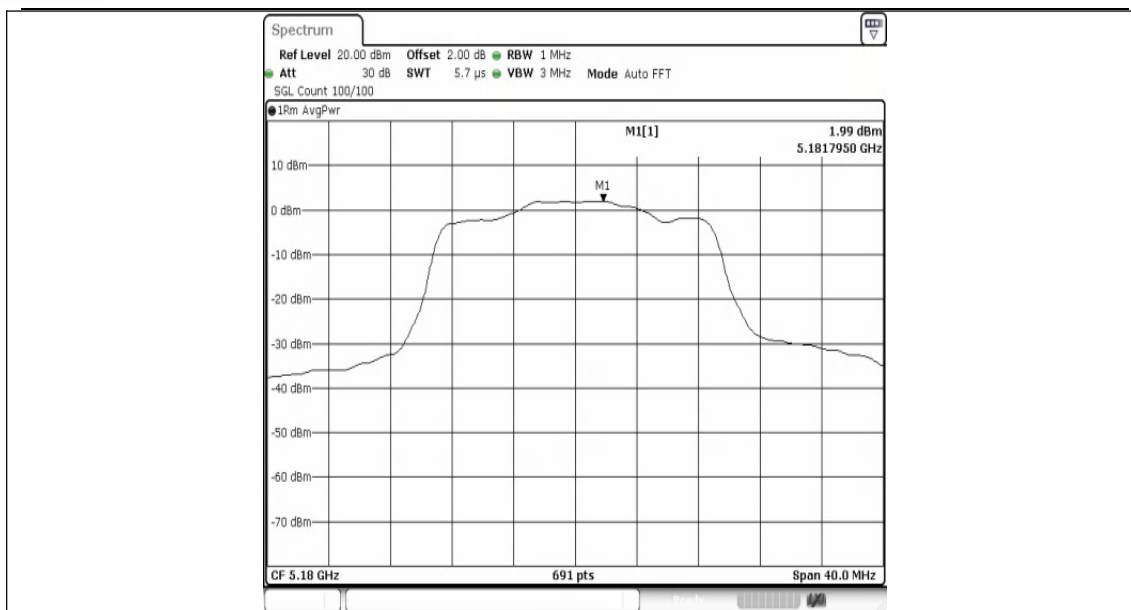


11AC20SISO-Ant1-5180-PASS

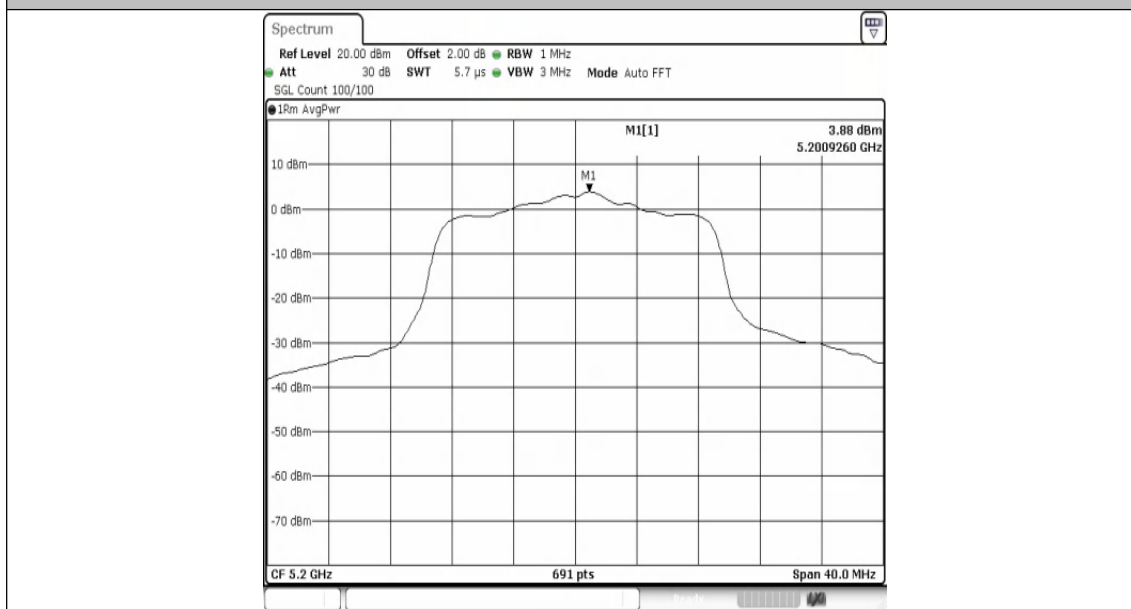


11AC20SISO-Ant1-5200-PASS

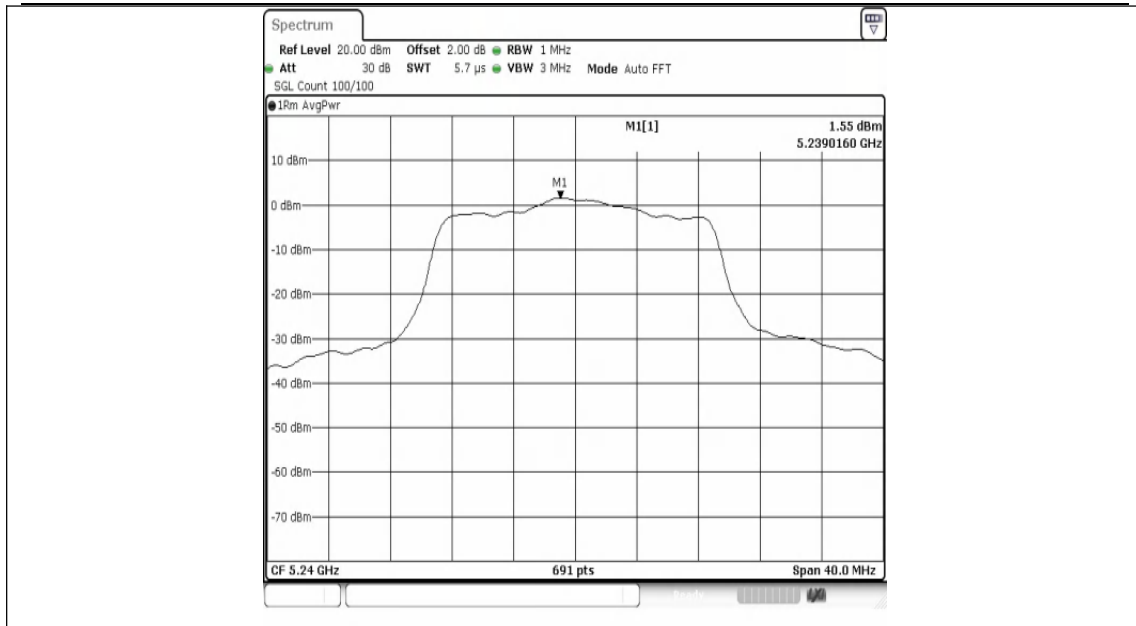


11AC20SISO-Ant1-5240-PASS

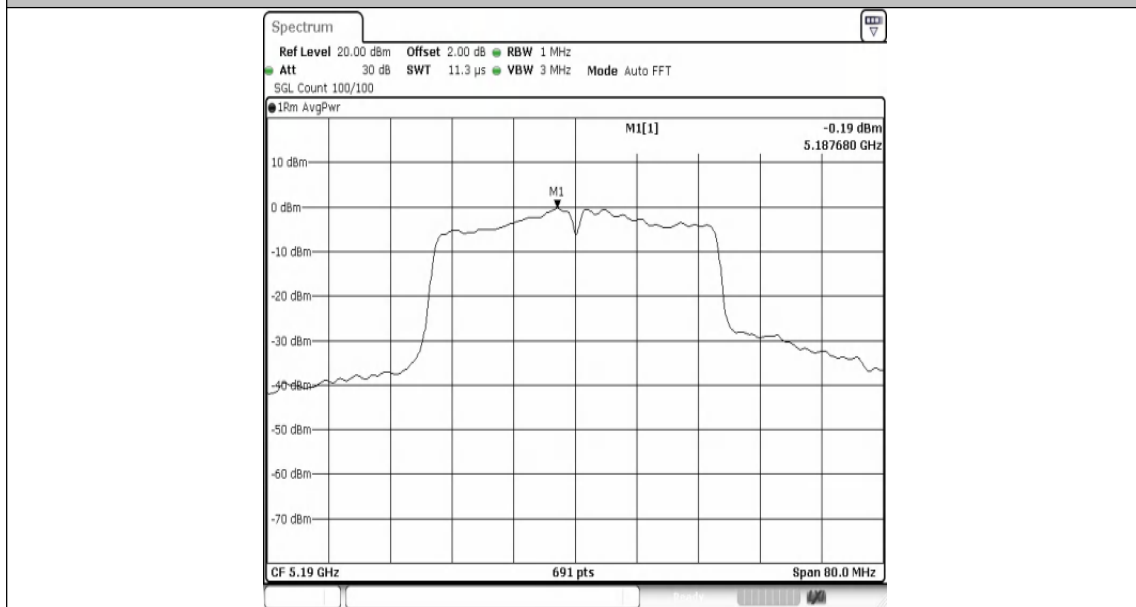

11AC40SISO-Ant1-5190-PASS

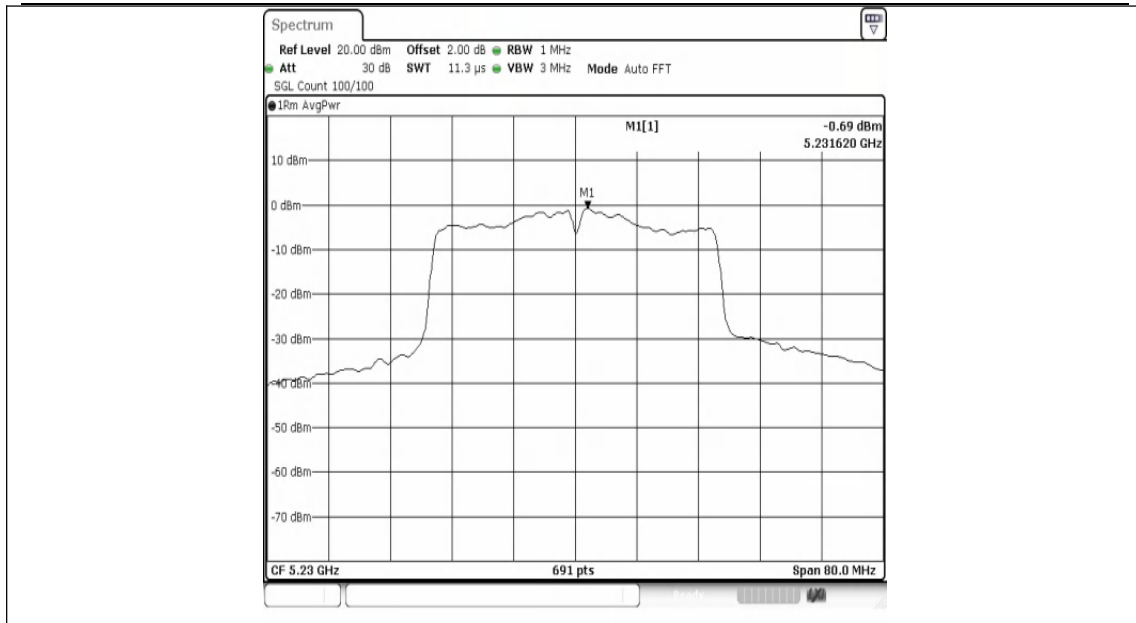


11AC40SISO-Ant1-5230-PASS

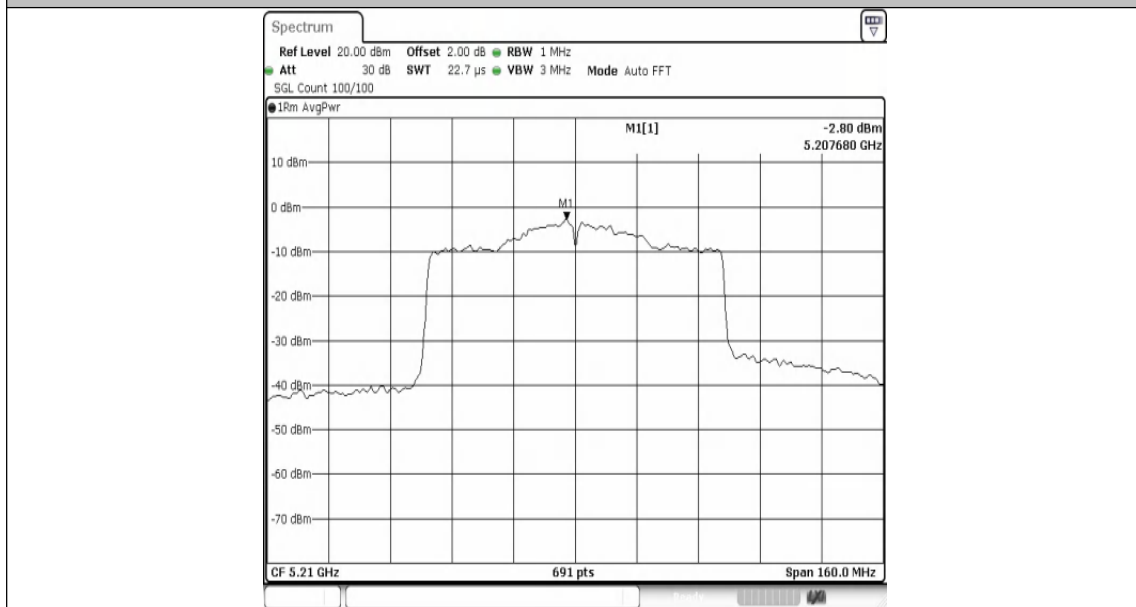

11AC80SISO-Ant1-5210-PASS


Test Graphs B4

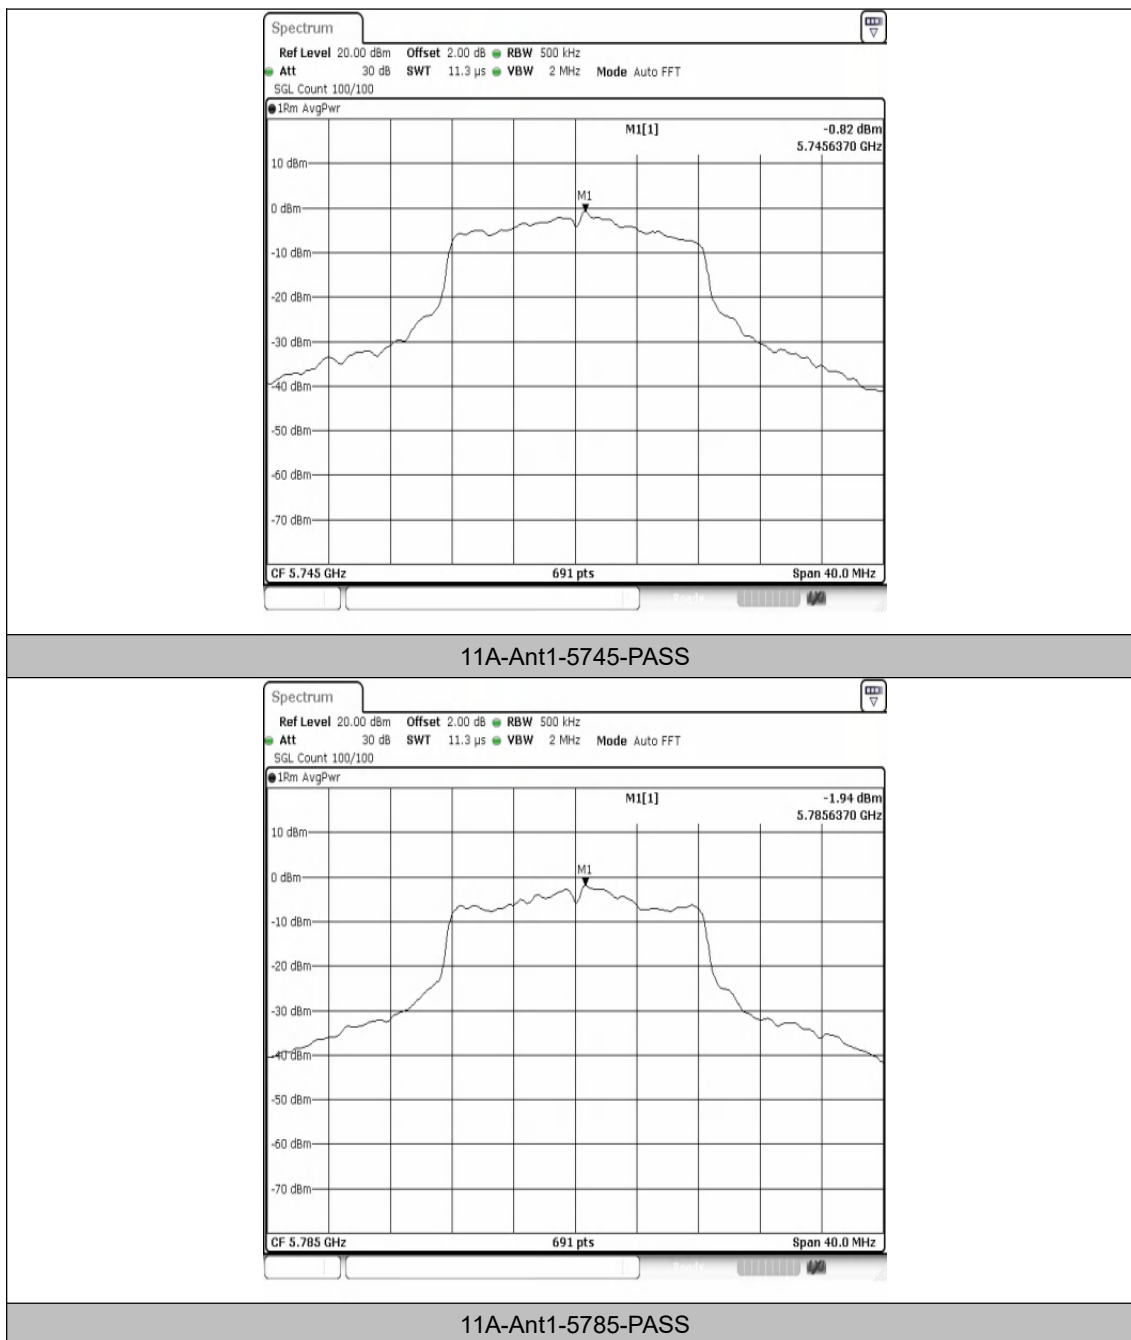

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

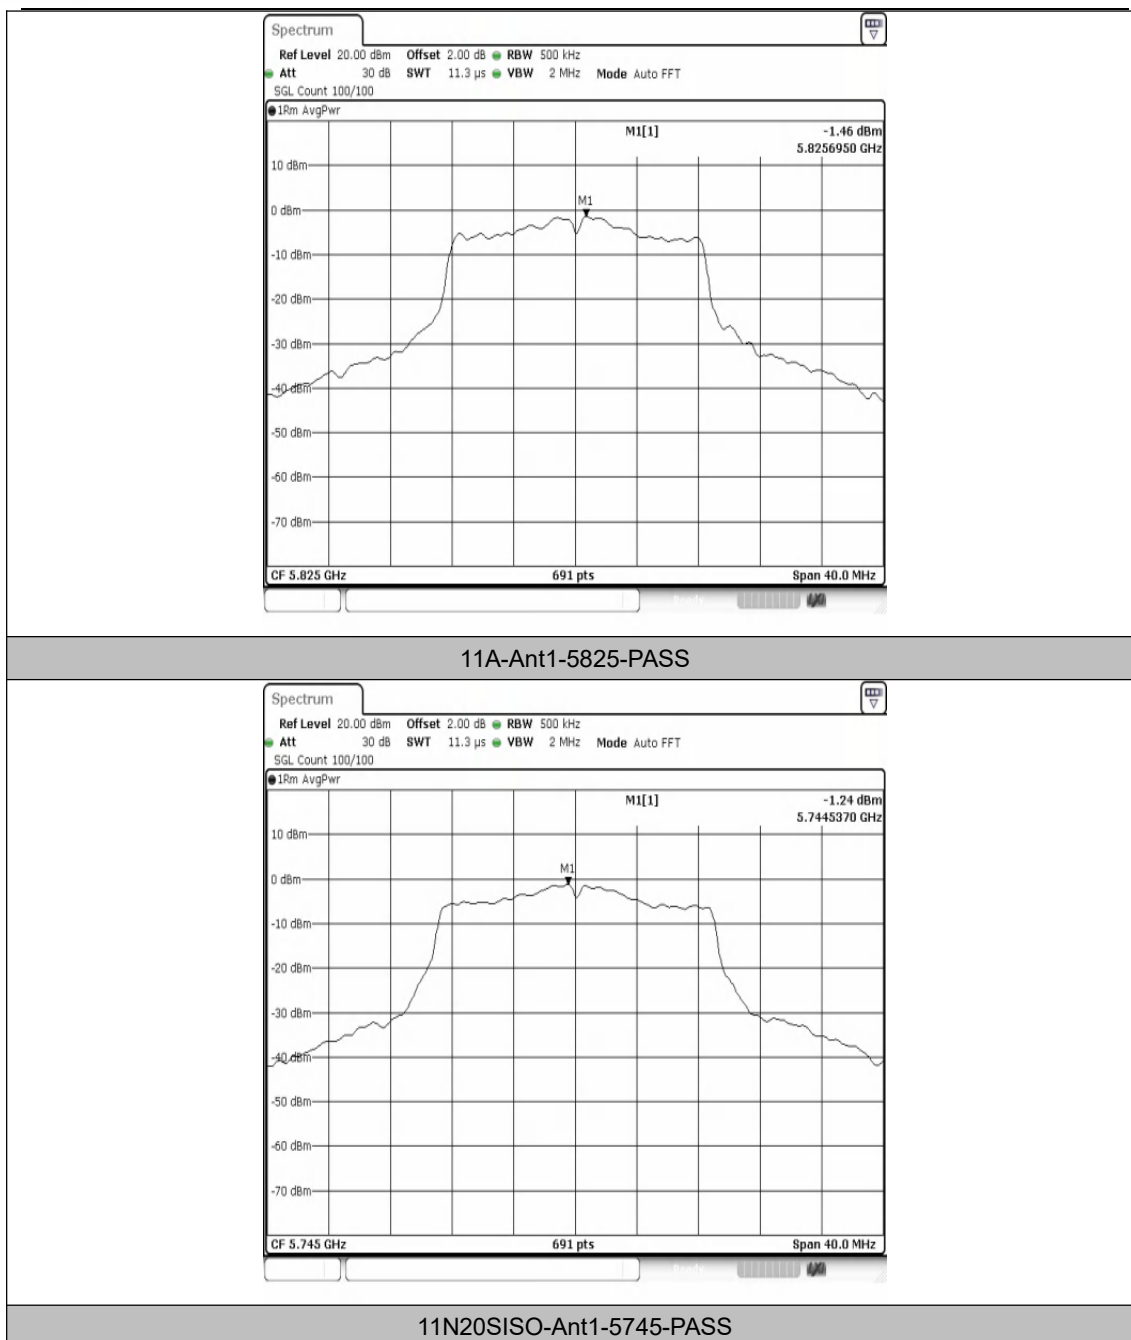

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

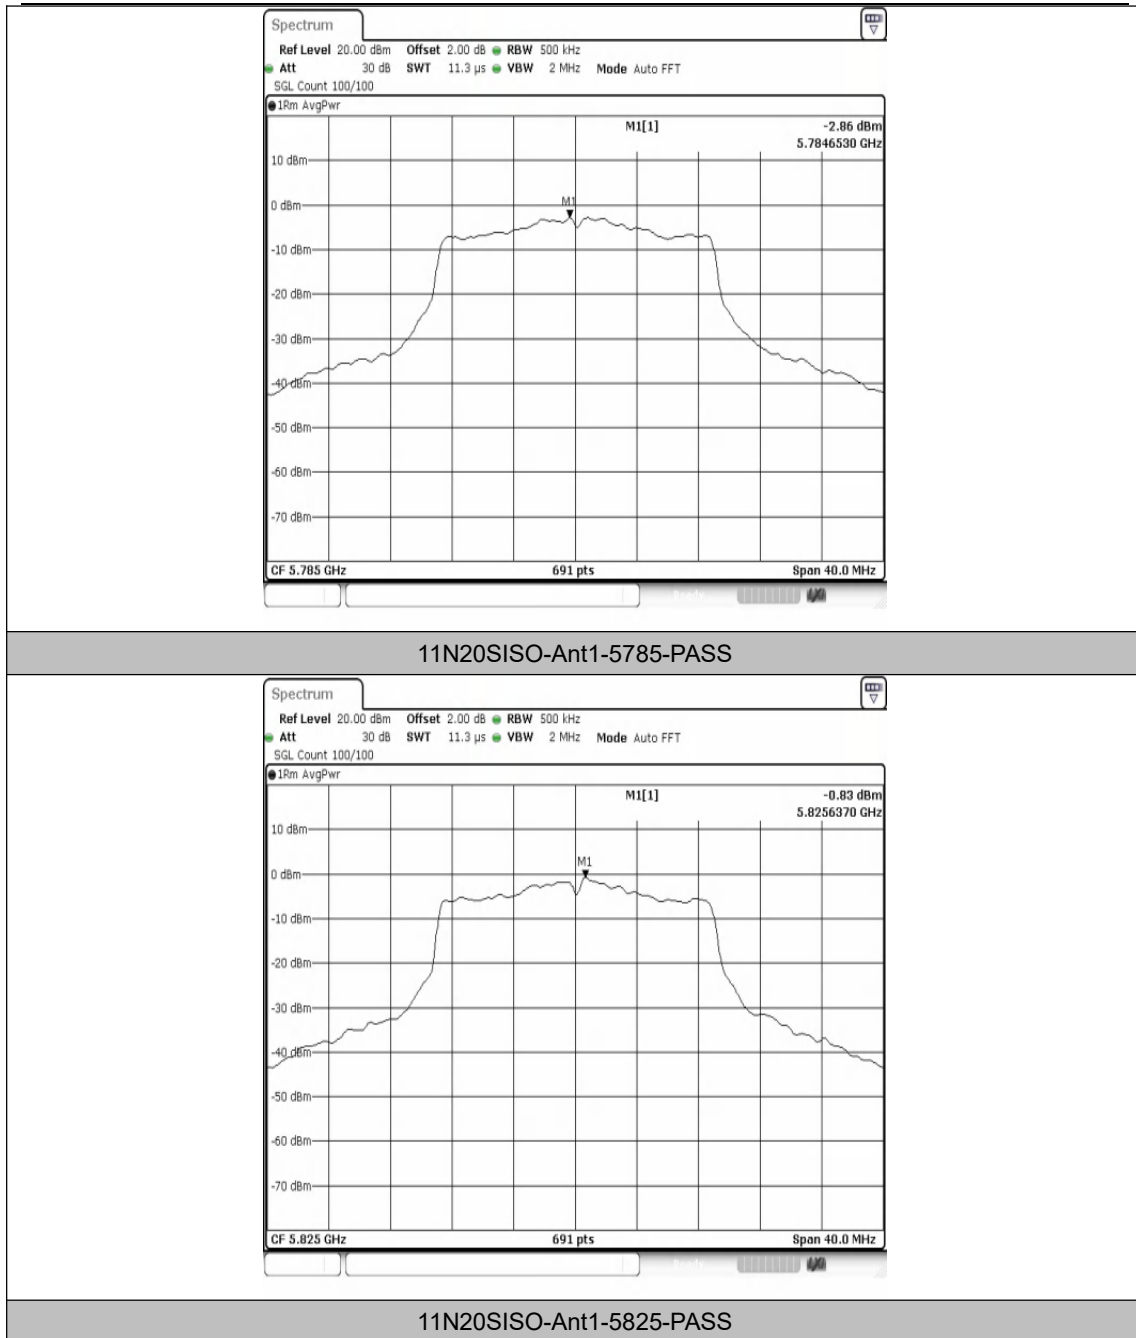


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

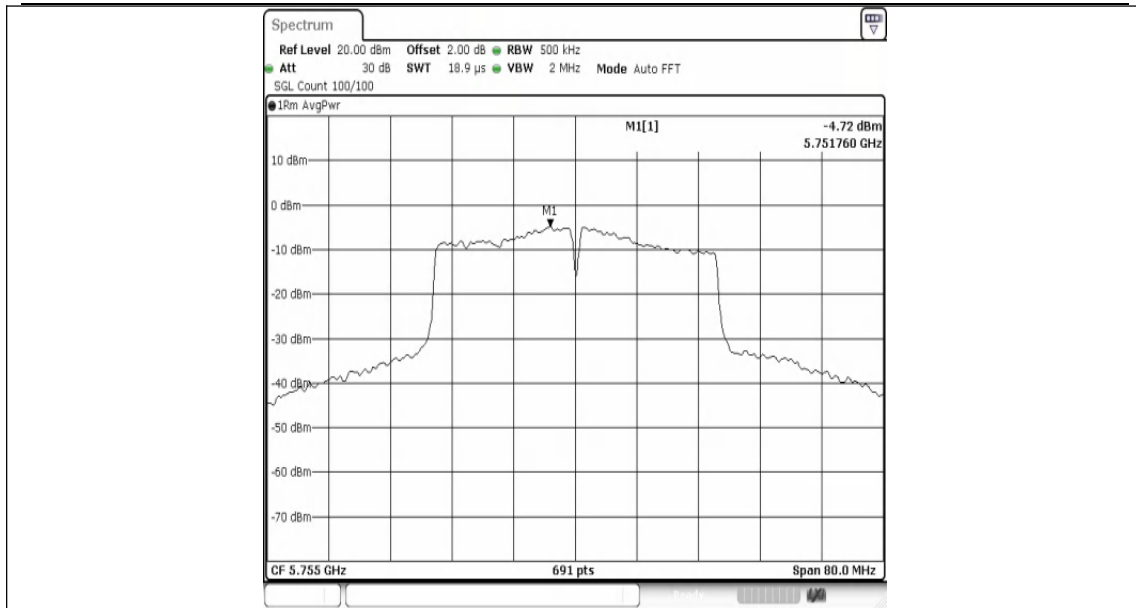

11N40ISO-Ant1-5755-PASS

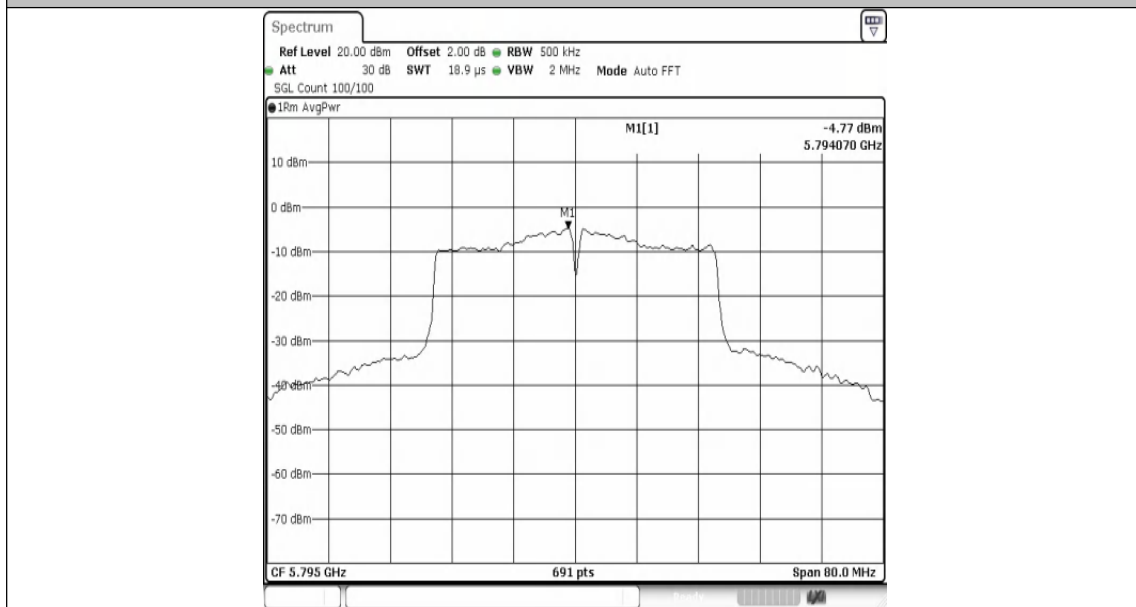


11N40ISO-Ant1-5795-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

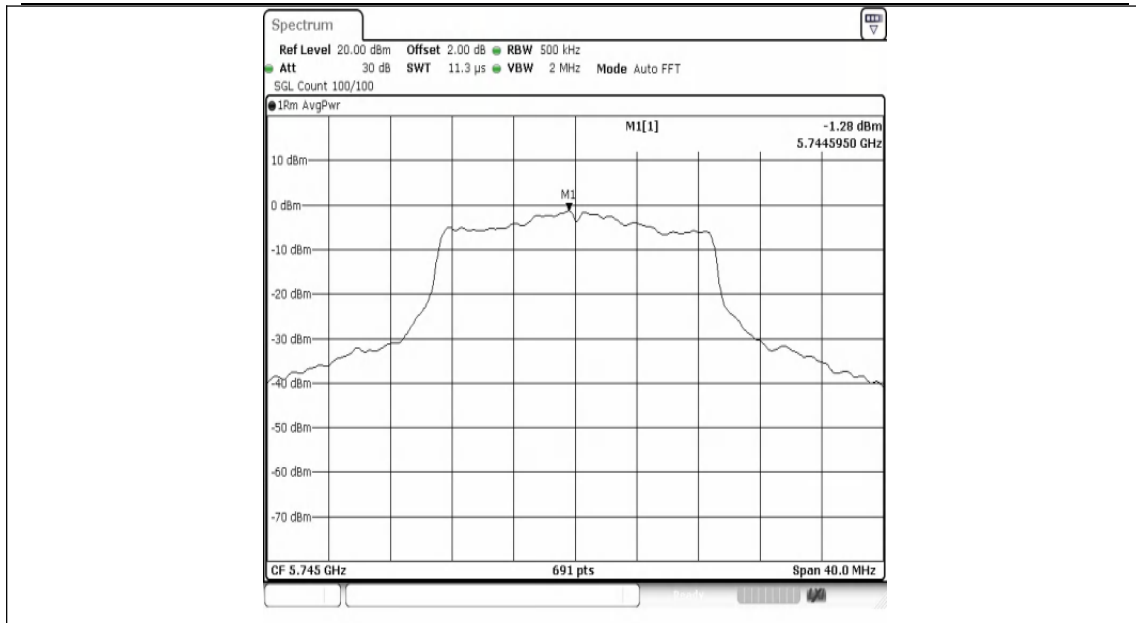


11AC20SISO-Ant1-5745-PASS

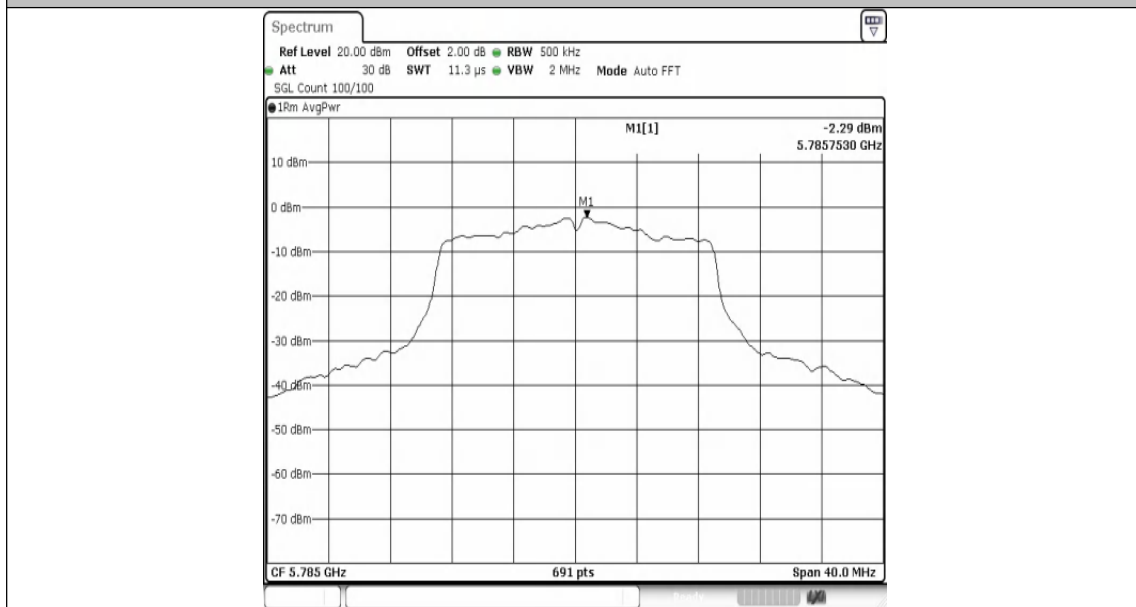


11AC20SISO-Ant1-5785-PASS

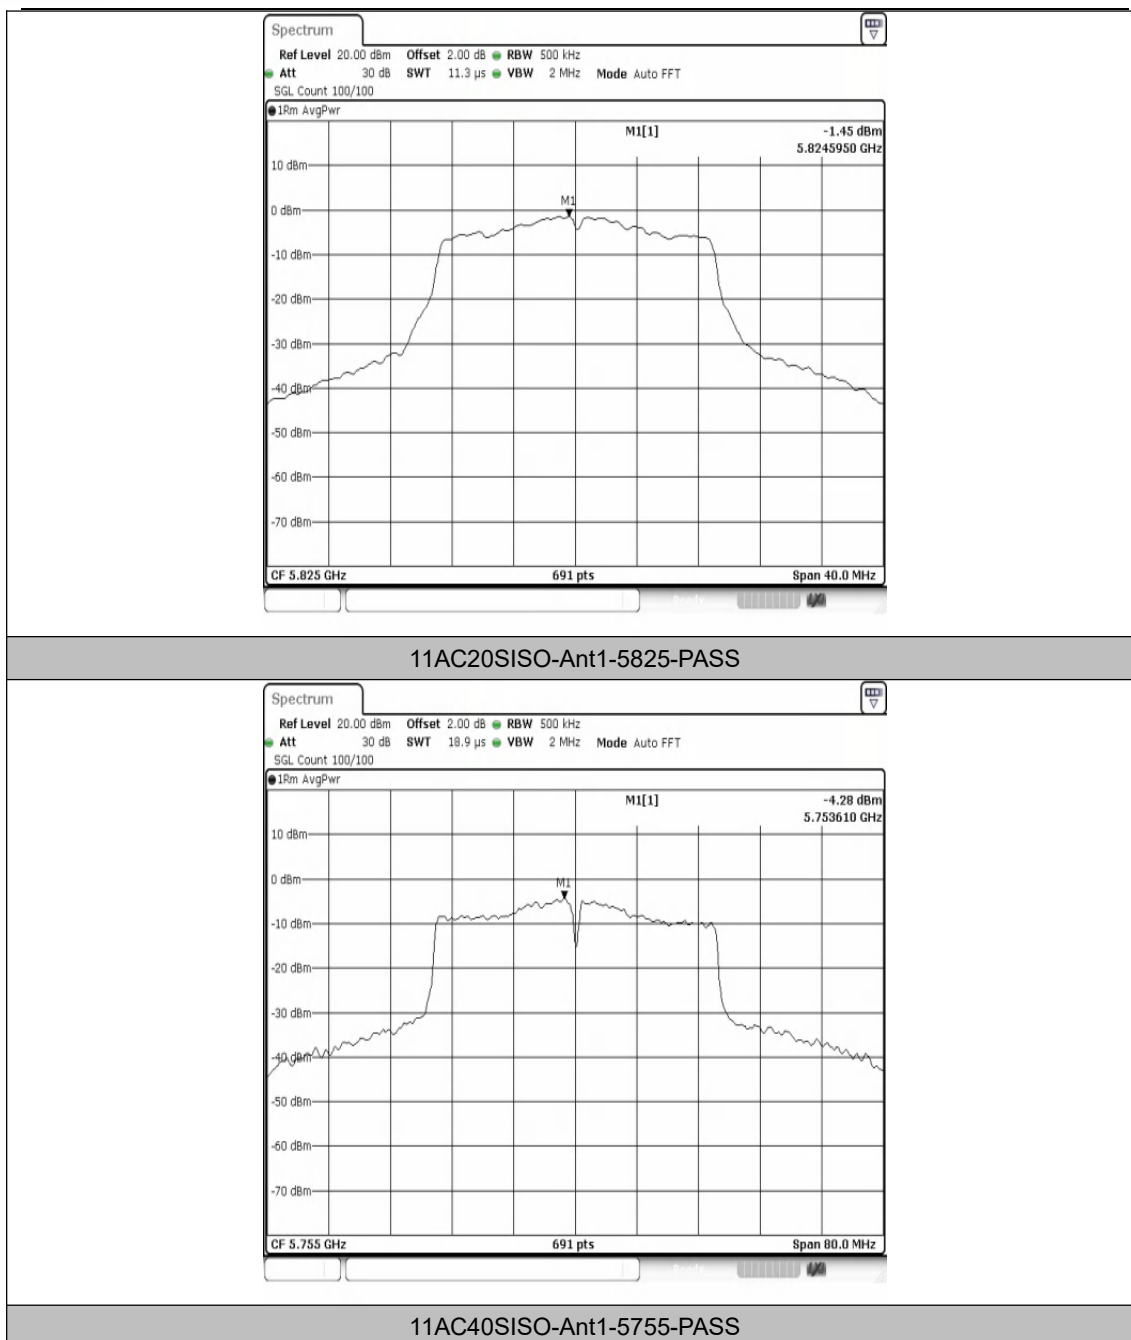

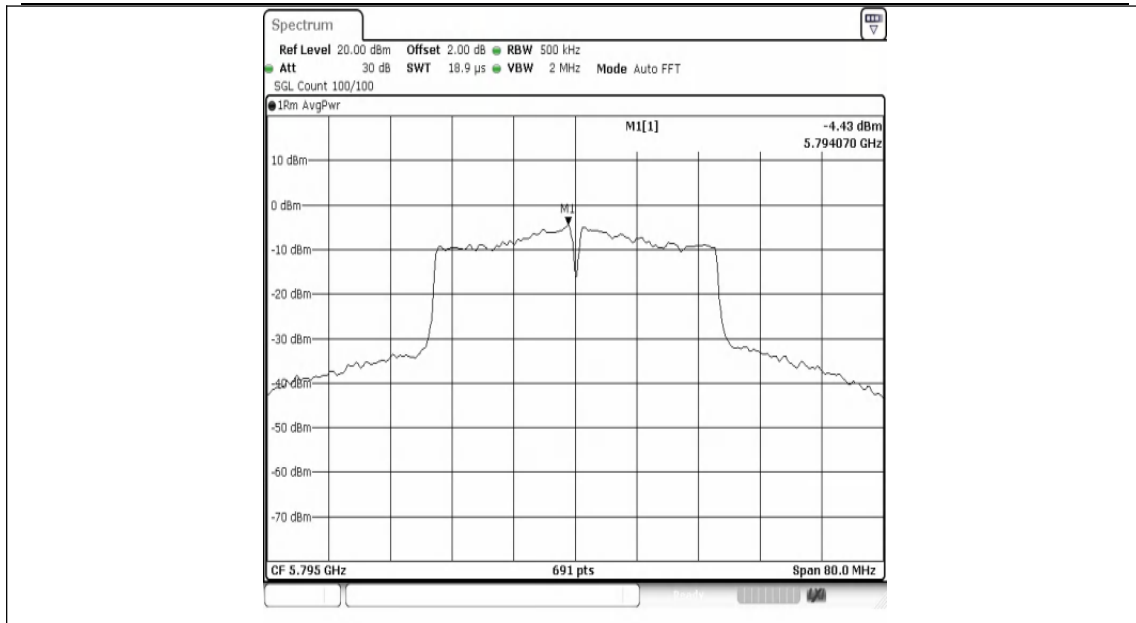

11AC40SISO-Ant1-5795-PASS

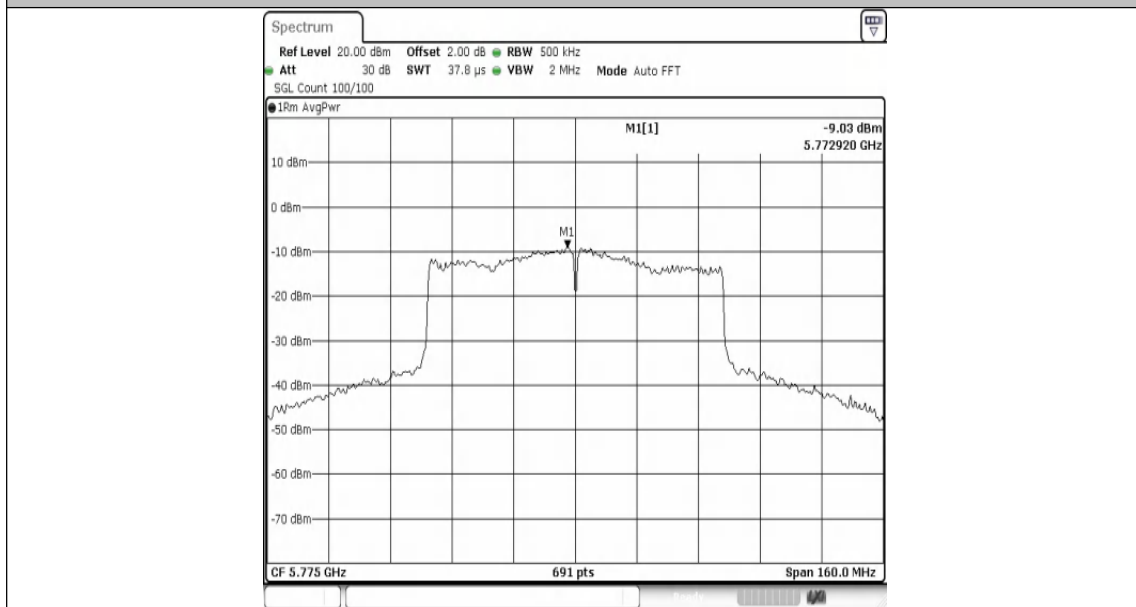

11AC80SISO-Ant1-5775-PASS

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-29.3	≤-27	PASS
11A	Ant1	High	5240	-43.32	≤-27	PASS
11N20SISO	Ant1	Low	5180	-30.2	≤-27	PASS
11N20SISO	Ant1	High	5240	-43.3	≤-27	PASS
11N40SISO	Ant1	Low	5190	-27.77	≤-27	PASS
11N40SISO	Ant1	High	5230	-42.02	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-31.7	≤-27	PASS
11AC20SISO	Ant1	High	5240	-42.9	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-30.35	≤-27	PASS
11AC40SISO	Ant1	High	5230	-42.24	≤-27	PASS
11AC80SISO	Ant1	High	5210	-38.05	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-31.07	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4


Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-31.56	≤15.98	PASS
11A	Ant1	Low	5745	5700~5720	-28.51	≤14.95	PASS
11A	Ant1	Low	5745	5650~5700	-47.35	≤-26.88	PASS
11A	Ant1	Low	5745	5760~5650	-46.66	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-39.63	≤15.65	PASS
11A	Ant1	High	5825	5855~5875	-39.68	≤13.41	PASS
11A	Ant1	High	5825	5875~5925	-46.33	≤-26.73	PASS
11A	Ant1	High	5825	5925~5935	-46.03	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-35.53	≤16.36	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-36.91	≤12.99	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-44.78	≤-26.14	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-45.23	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-38.28	≤16.54	PASS
11N20SISO	Ant1	High	5825	5855~5875	-43.48	≤10.95	PASS
11N20SISO	Ant1	High	5825	5875~5925	-46.24	≤-26.87	PASS
11N20SISO	Ant1	High	5825	5925~5935	-44.26	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-28.05	≤15.90	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-27.04	≤15.09	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-44.61	≤-25.92	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-44.82	≤-27	PASS


11N40SISO	Ant1	High	5795	5850~5855	-42.59	≤15.85	PASS
11N40SISO	Ant1	High	5795	5855~5875	-42.3	≤10.41	PASS
11N40SISO	Ant1	High	5795	5875~5925	-45.4	≤-26.61	PASS
11N40SISO	Ant1	High	5795	5925~5935	-45.07	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-26.33	≤20.92	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-33.07	≤14.43	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-45.82	≤-26.51	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-44.76	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-41.41	≤15.65	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-43.36	≤11.11	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-45.56	≤-26.87	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-44.84	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-25.66	≤15.90	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-26.16	≤15.36	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-44.66	≤-26.36	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-44.34	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-42.06	≤15.85	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-43.74	≤10.41	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-45.32	≤-26.97	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-44.47	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-23.6	≤16.18	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-27.88	≤11.46	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-43.99	≤-26.54	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-42.8	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-34.45	≤15.98	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-37.33	≤10.62	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-45.28	≤-26.86	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-44.63	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.





Test Graphs B1

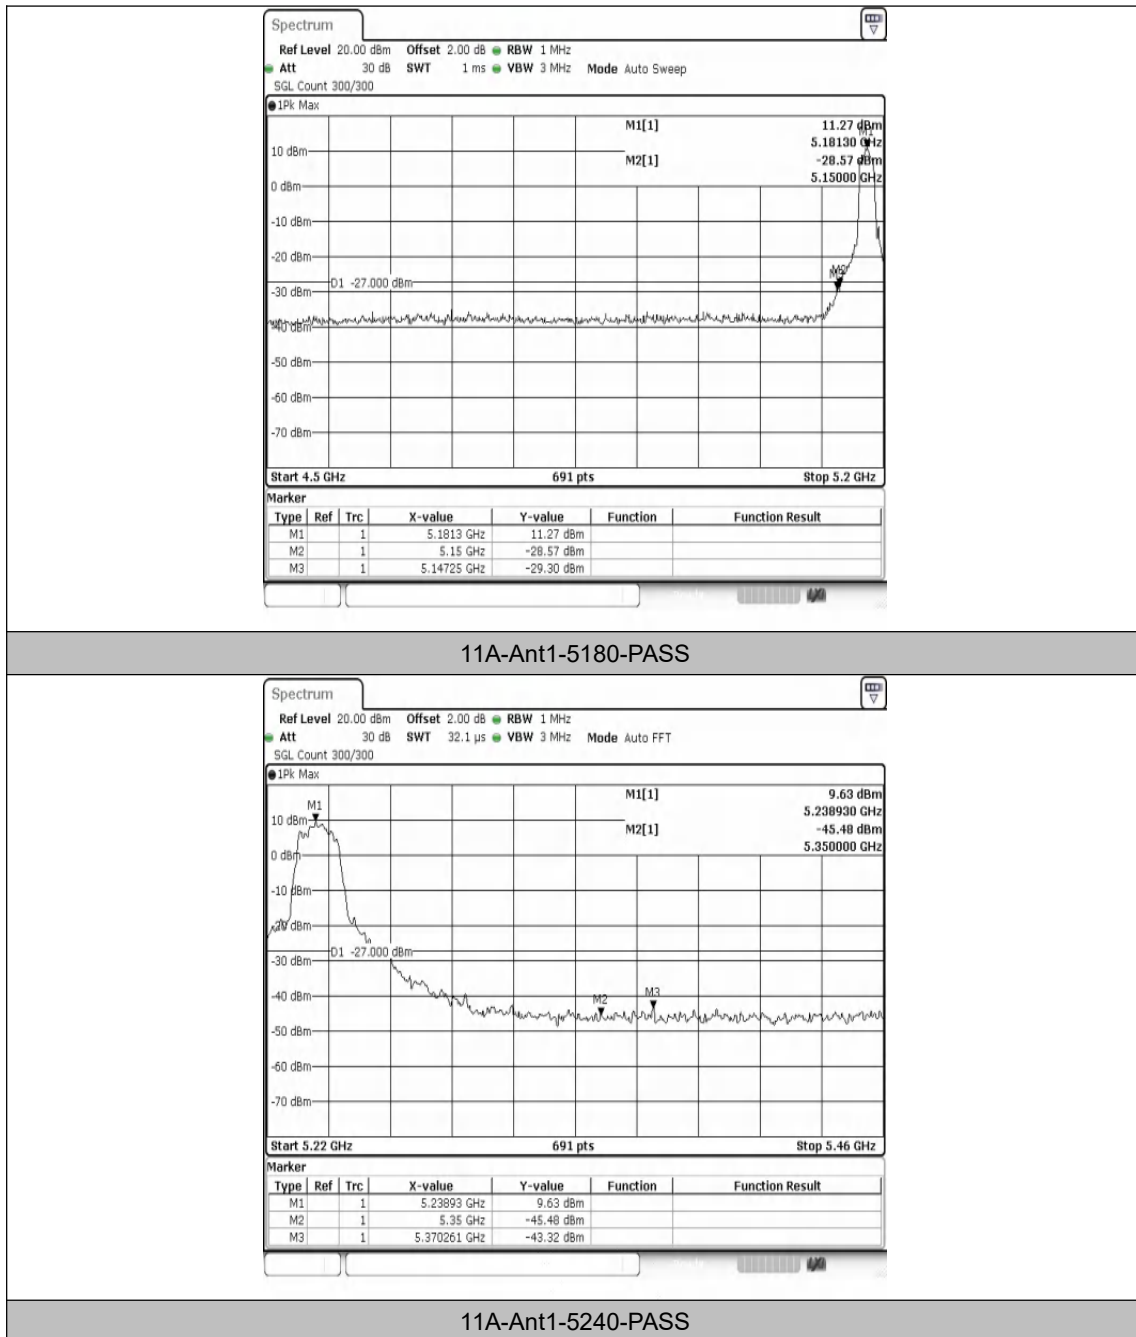


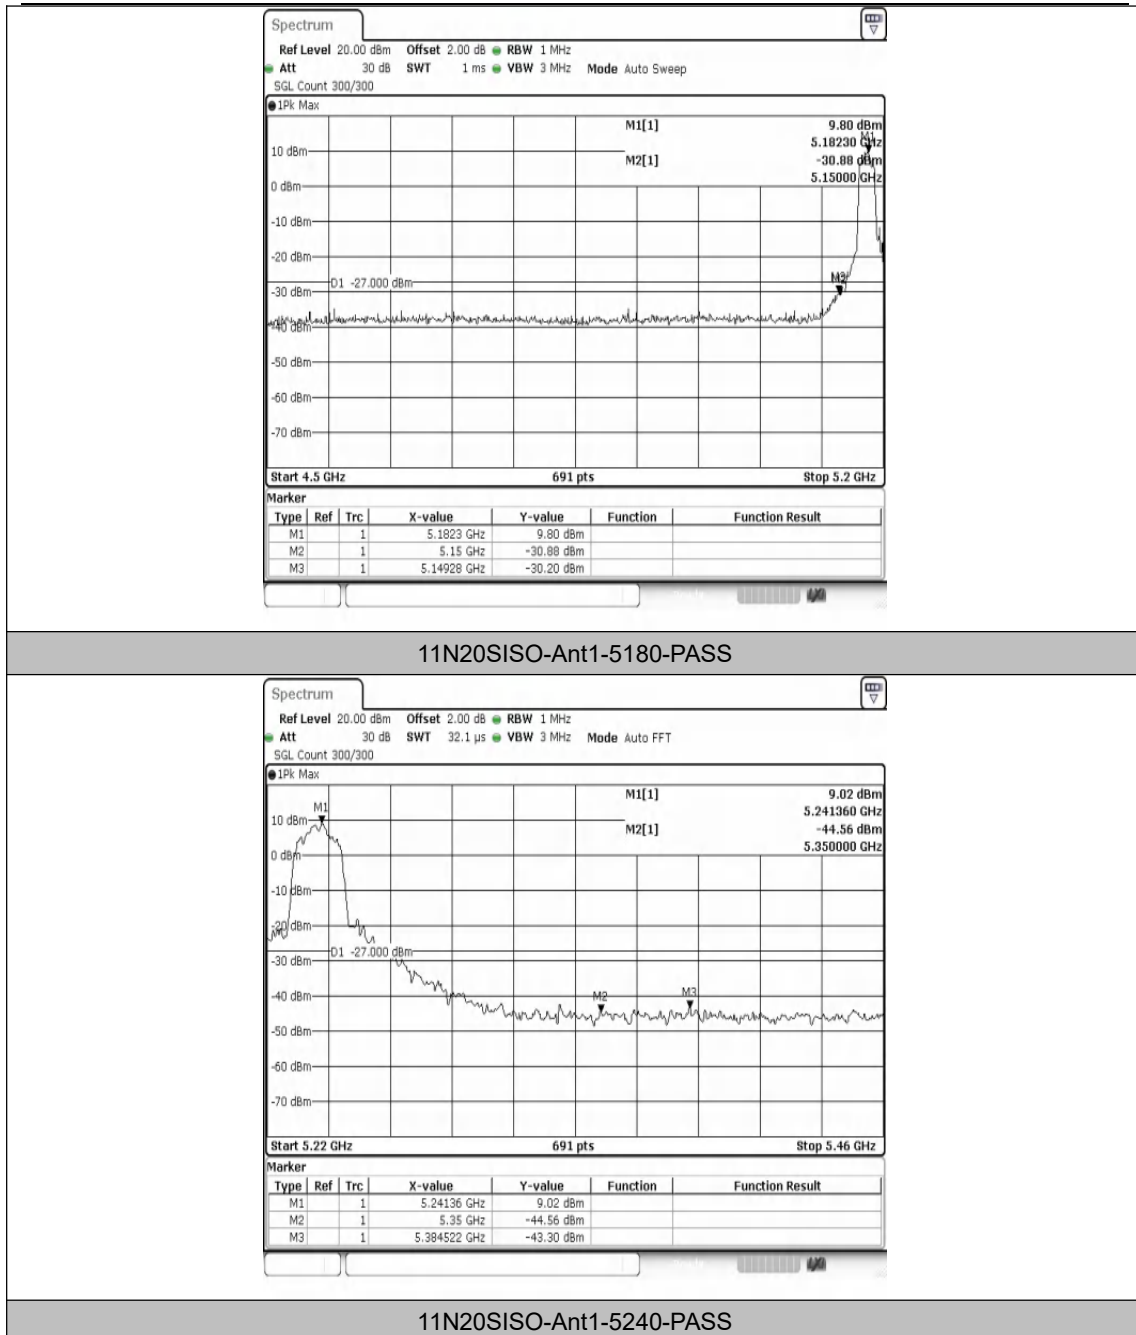

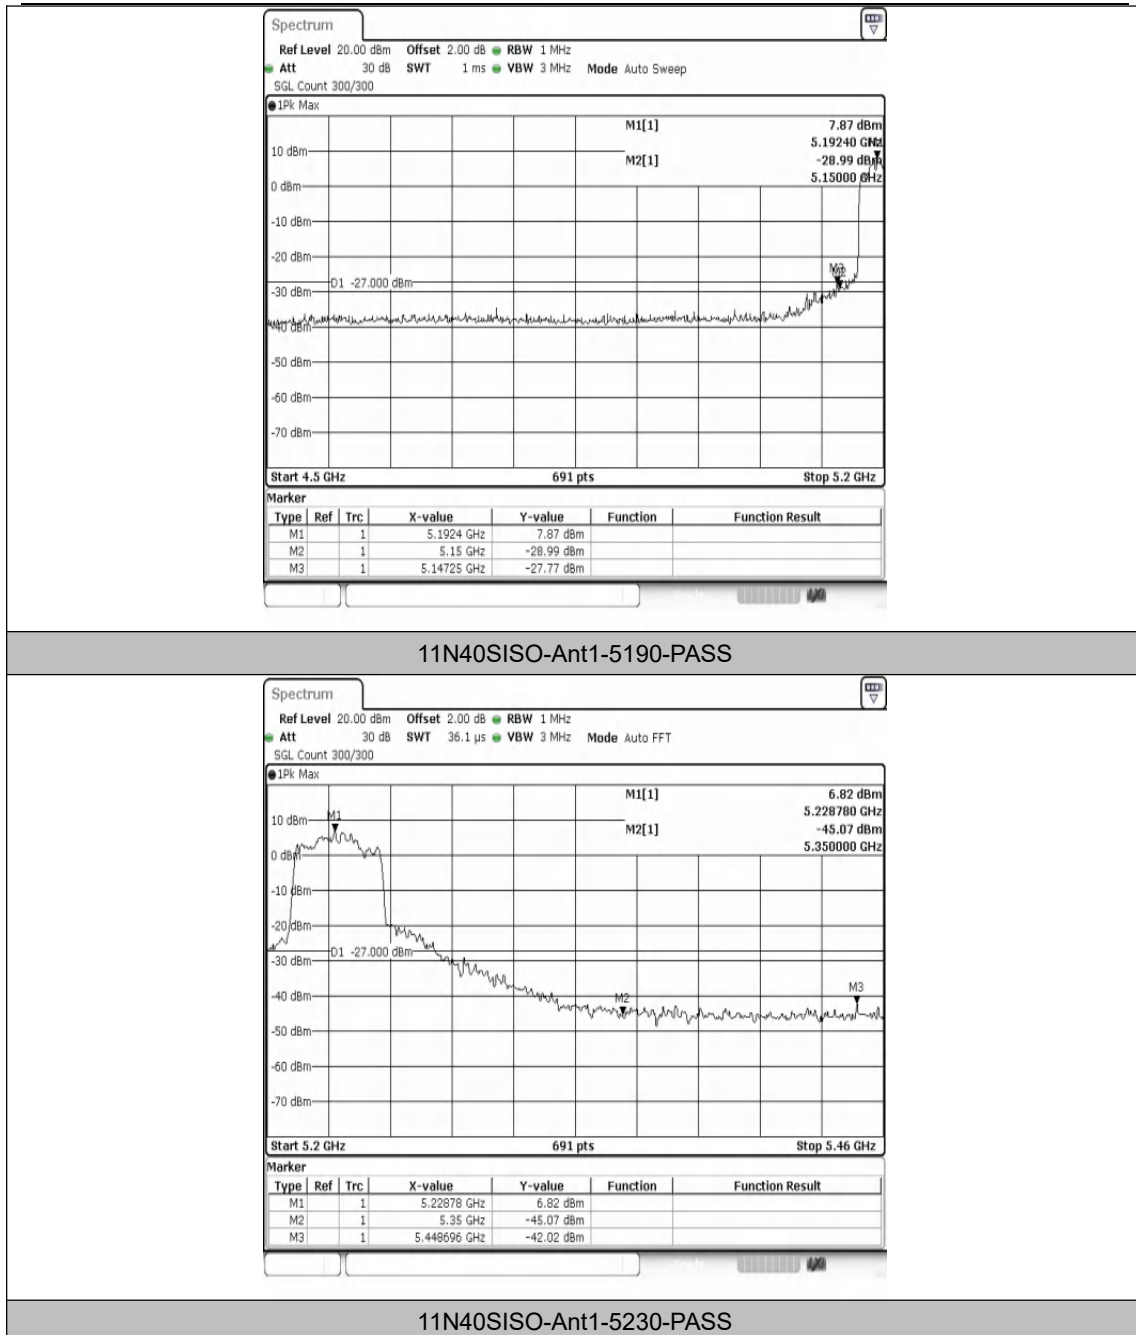


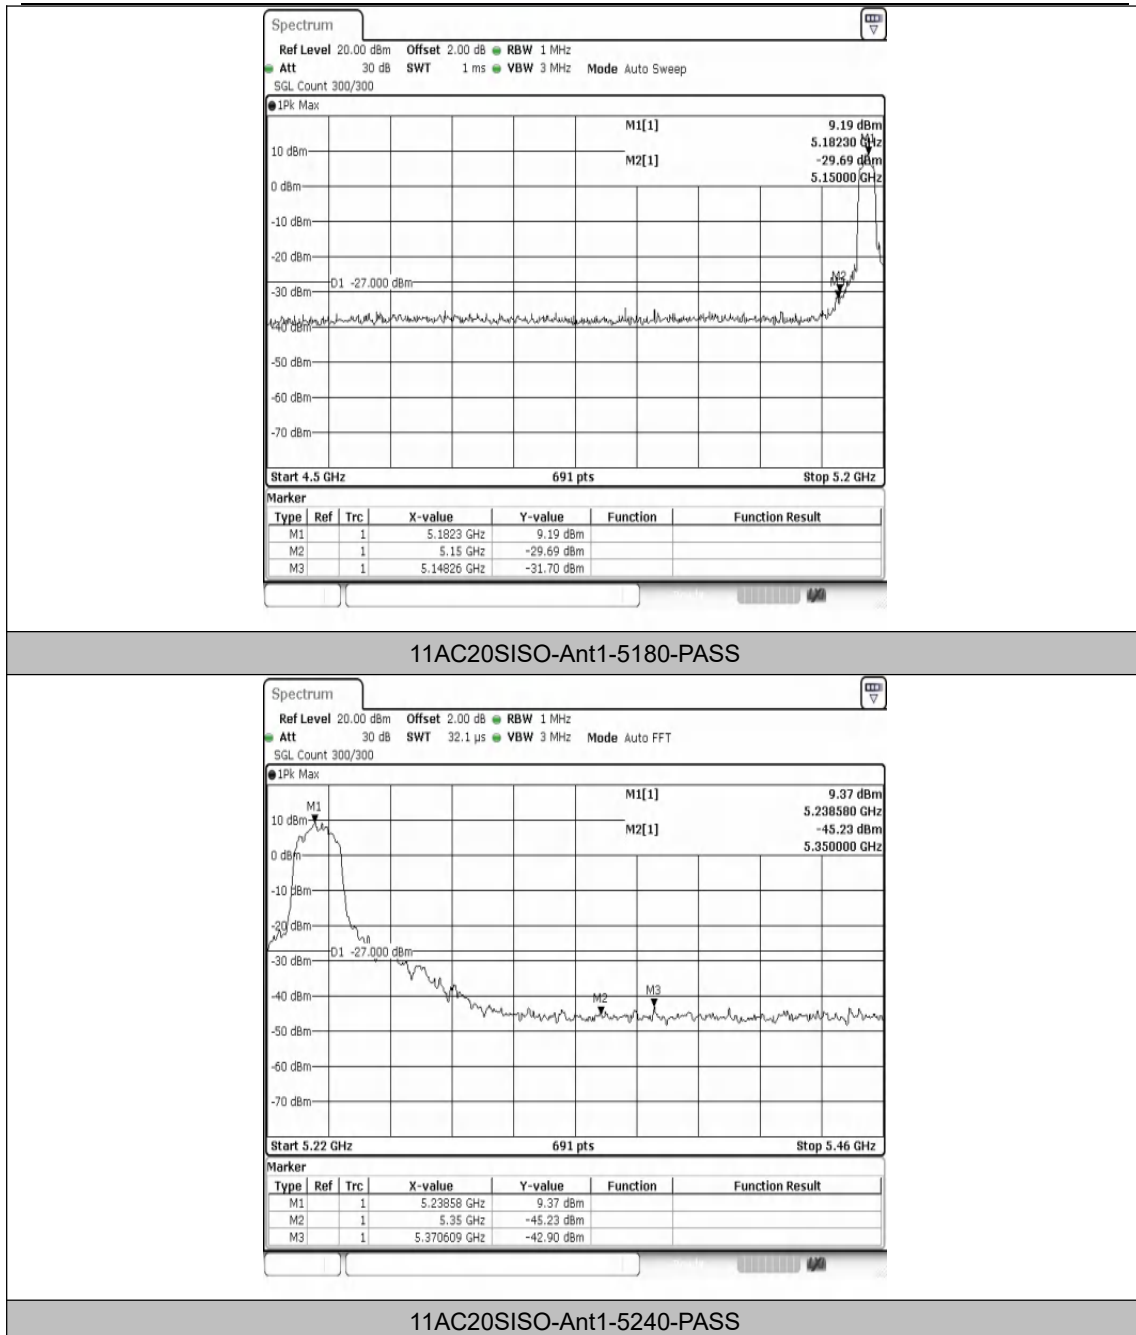


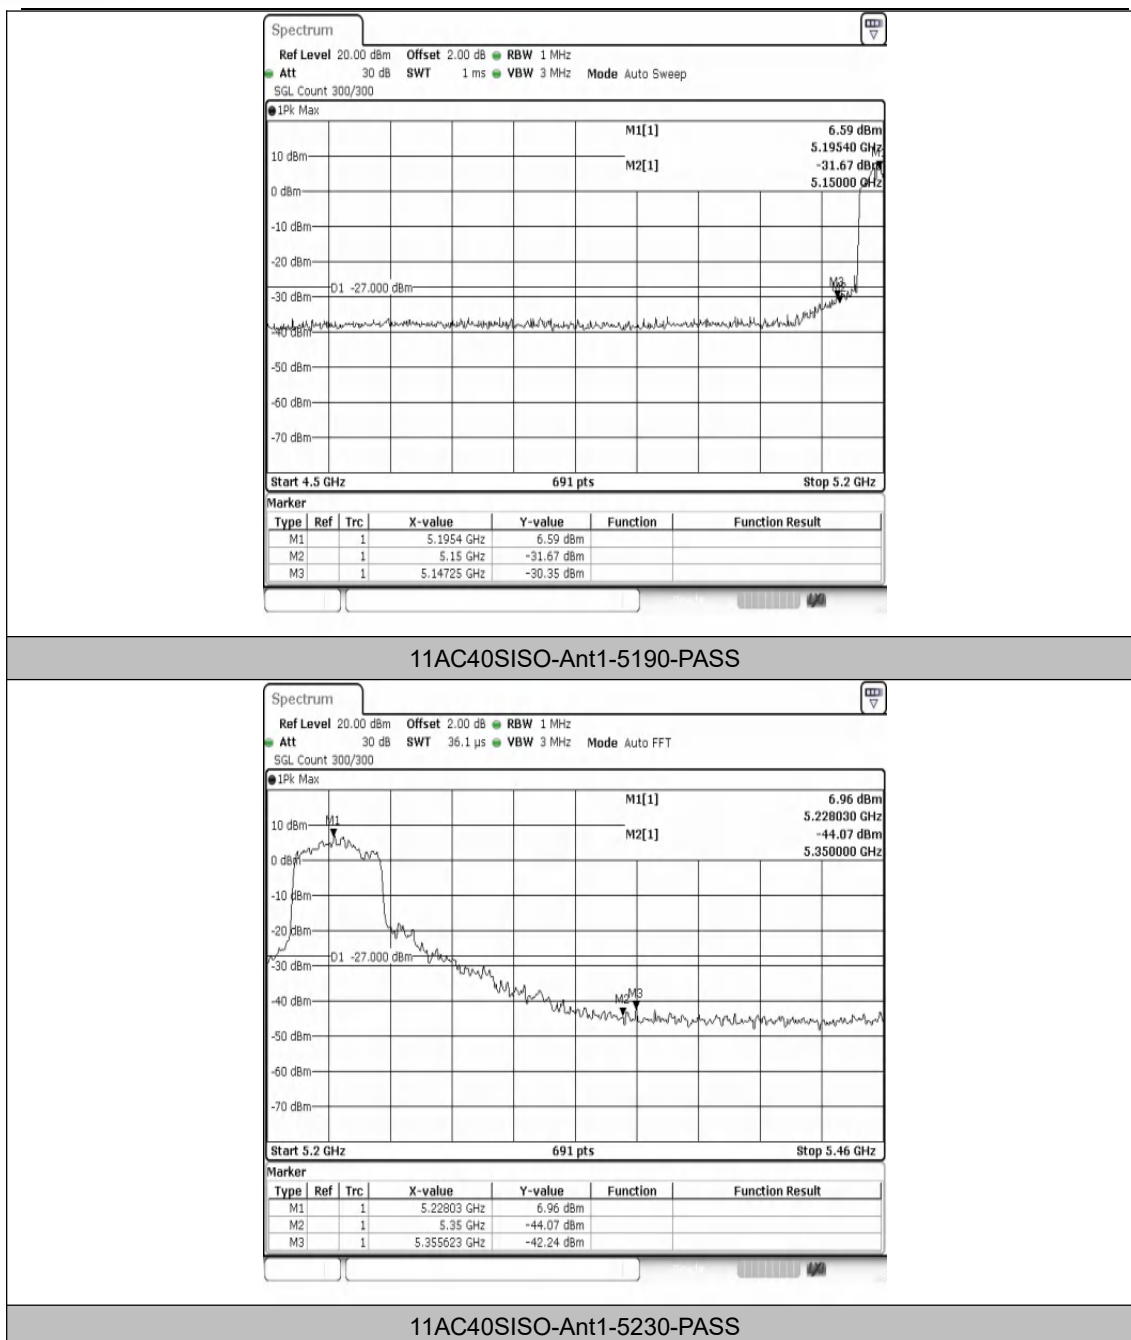


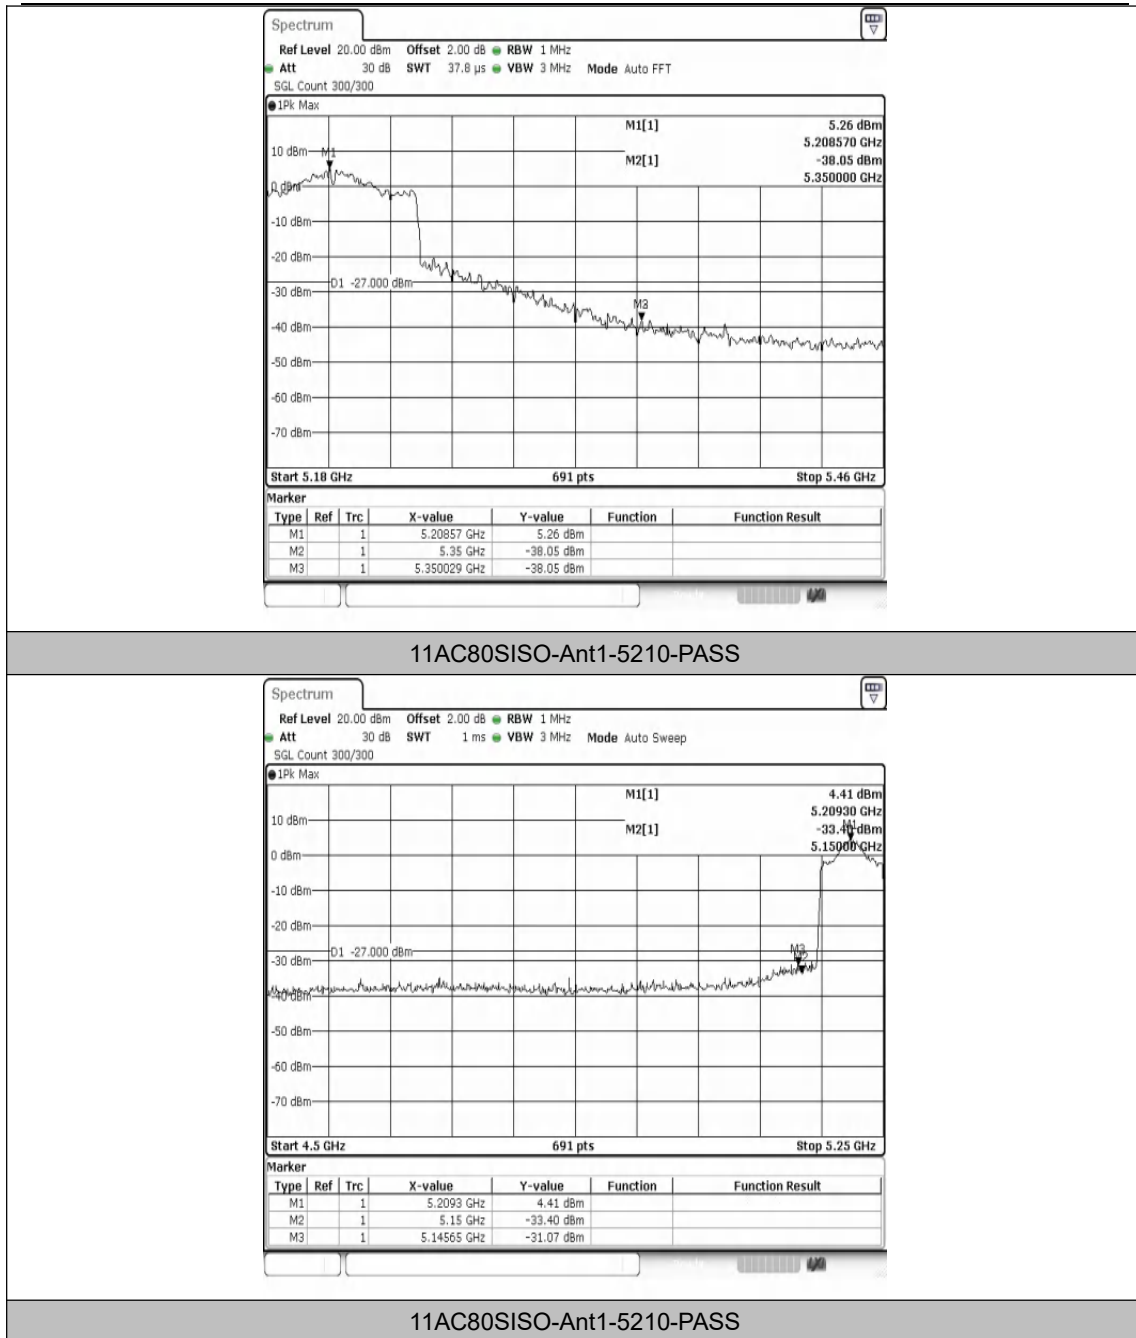


Test Graphs B4

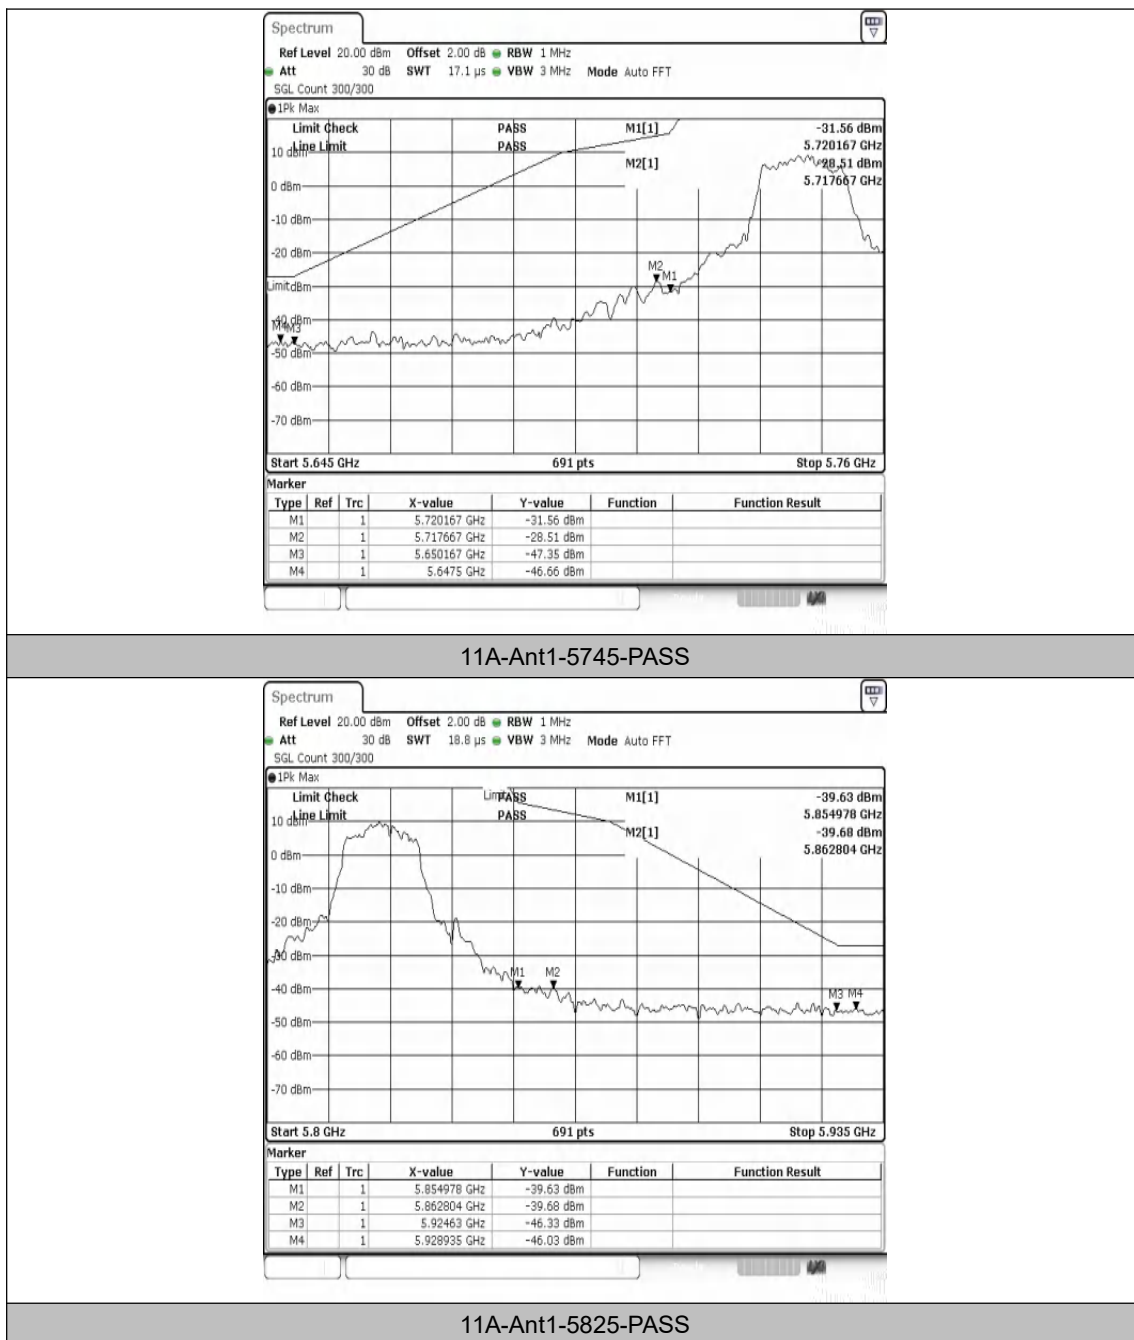


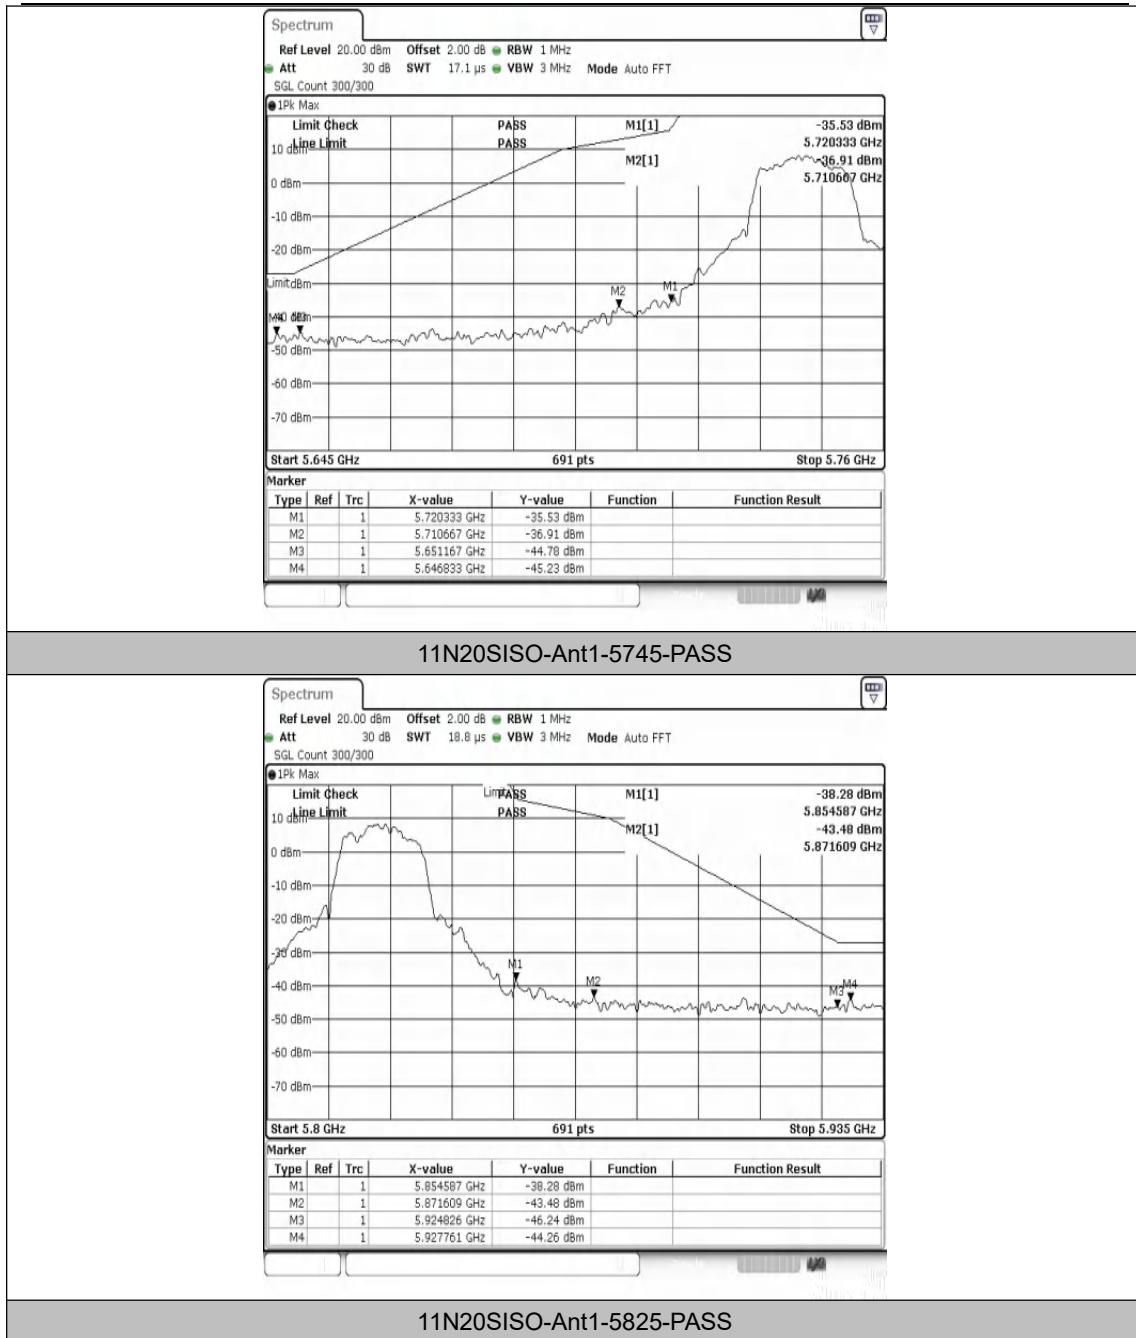

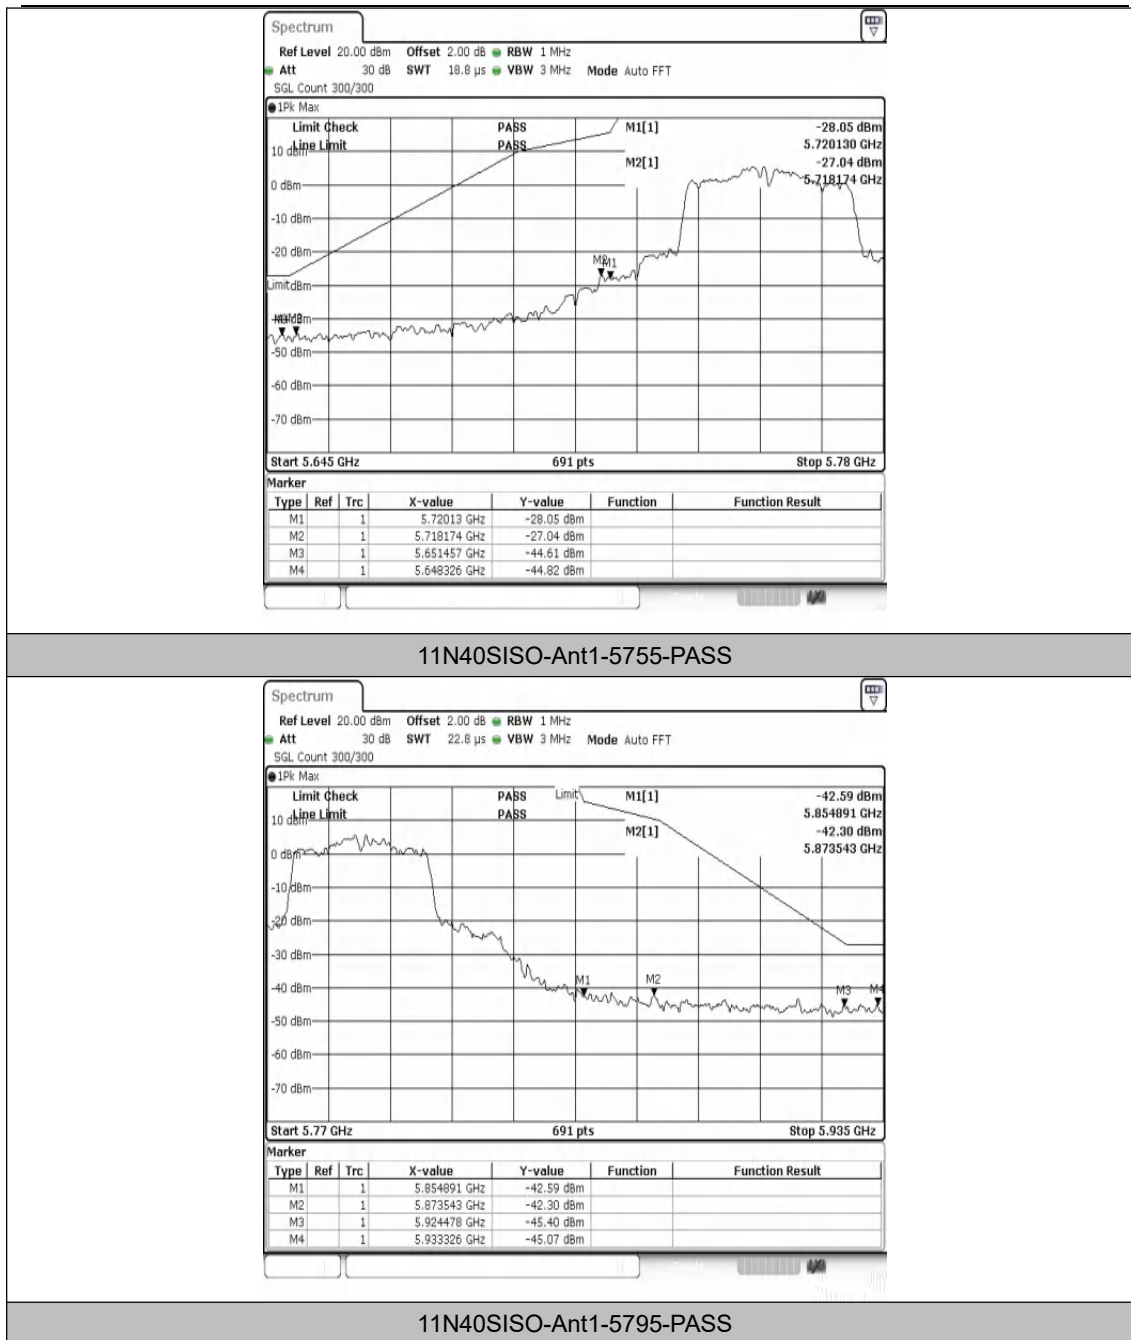


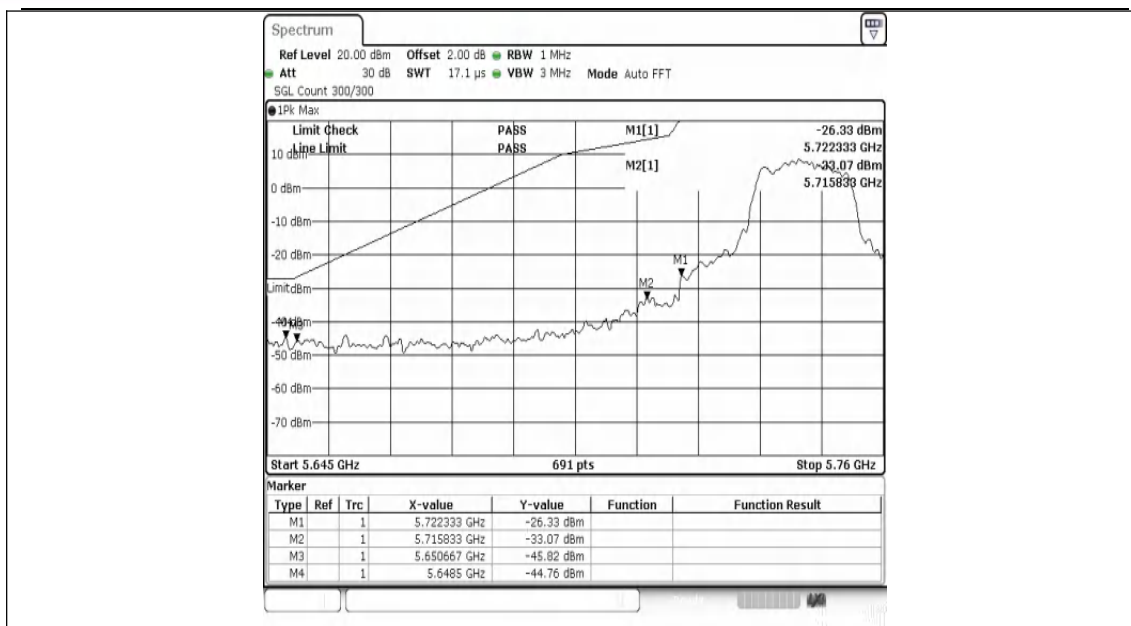


11AC20SISO-Ant1-5745-PASS

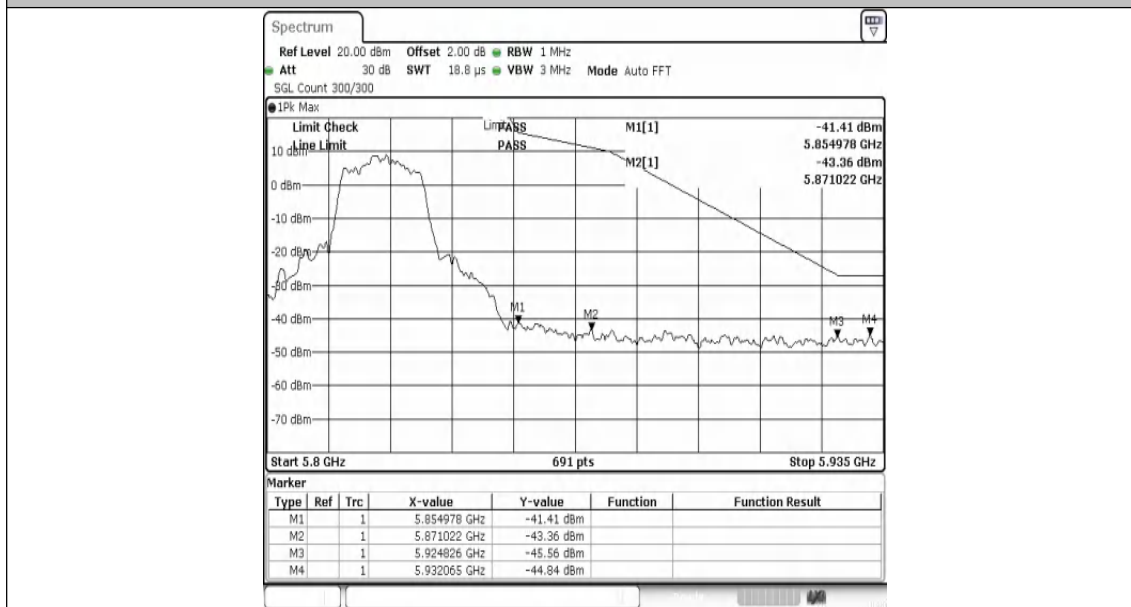


11AC20SISO-Ant1-5825-PASS

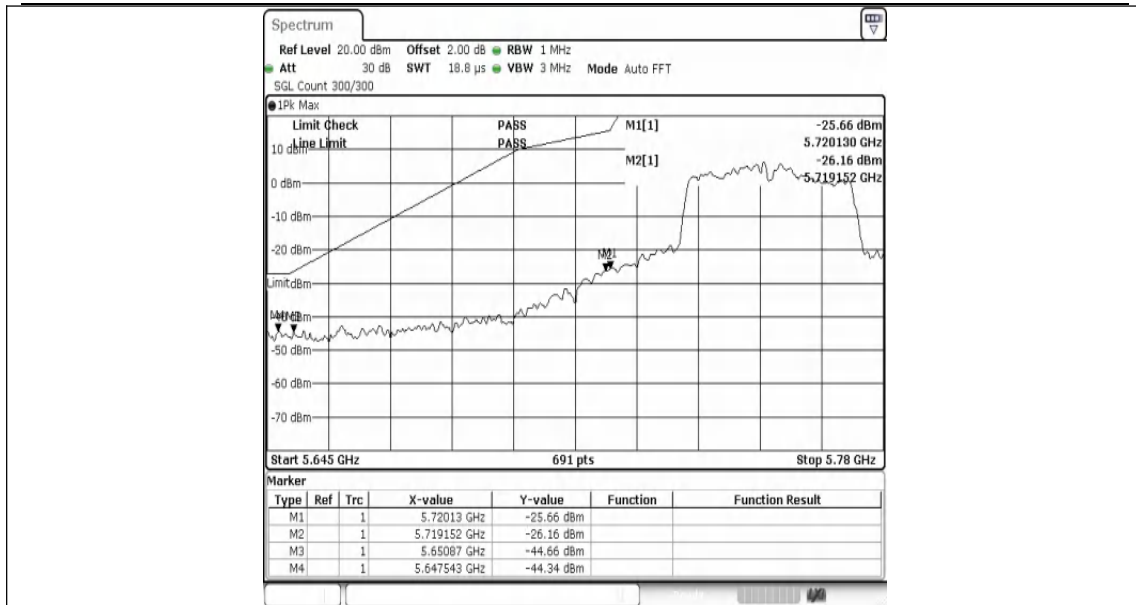

11AC40SISO-Ant1-5755-PASS

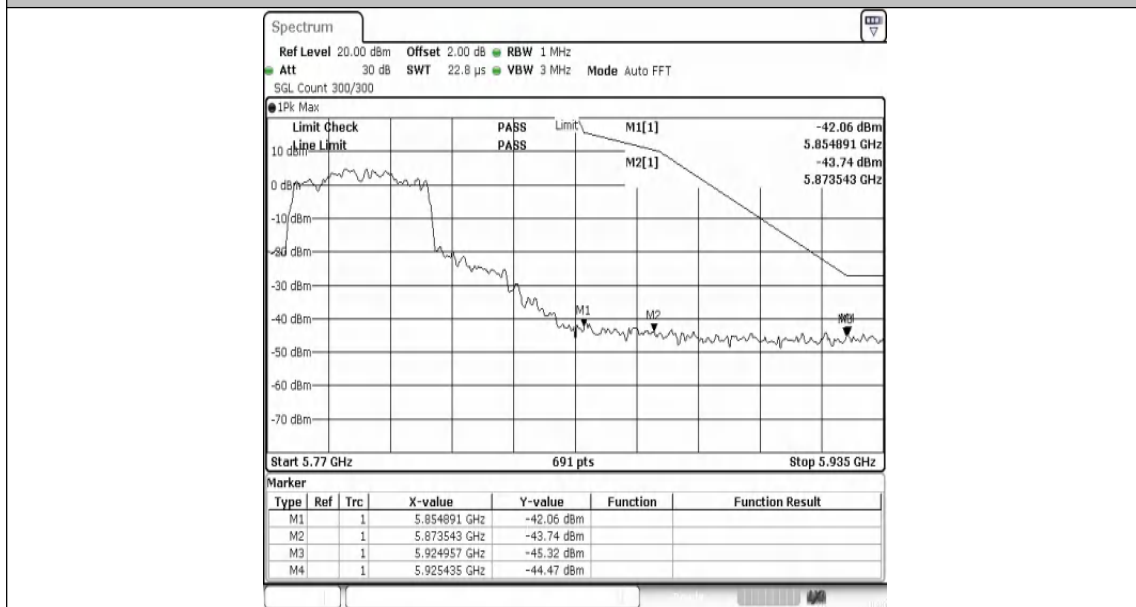

11AC40SISO-Ant1-5795-PASS

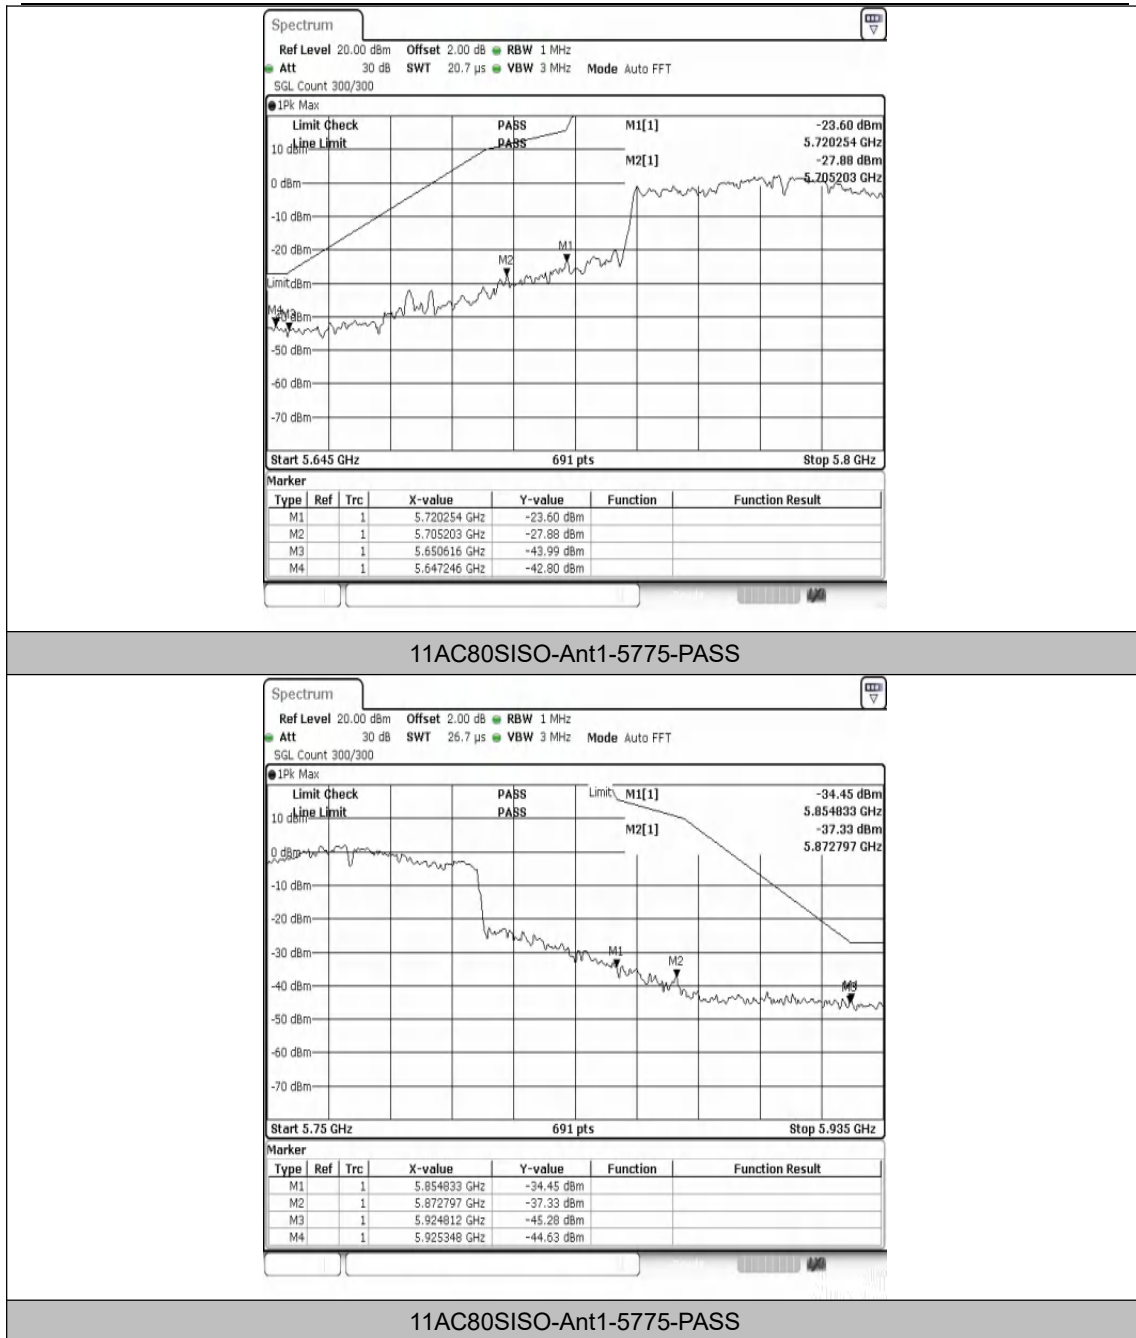

---End---