



J.5 Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band26	1.4MHz	26797	QPSK	1	0	Low	30	1000	-36.38	PASS
Band26	1.4MHz	26797	QPSK	1	0	Low	1000	5000	-43.38	PASS
Band26	1.4MHz	26797	QPSK	1	0	Low	5000	12000	-59.14	PASS
Band26	1.4MHz	26797	QPSK	1	0	Low	12000	26500	-44.32	PASS
Band26	1.4MHz	26915	QPSK	1	0	Low	30	1000	-33.25	PASS
Band26	1.4MHz	26915	QPSK	1	0	Low	1000	5000	-42.98	PASS
Band26	1.4MHz	26915	QPSK	1	0	Low	5000	12000	-58.86	PASS
Band26	1.4MHz	26915	QPSK	1	0	Low	12000	26500	-43.58	PASS
Band26	1.4MHz	27033	QPSK	1	0	High	30	1000	-33.38	PASS
Band26	1.4MHz	27033	QPSK	1	0	High	1000	5000	-42.98	PASS
Band26	1.4MHz	27033	QPSK	1	0	High	5000	12000	-58.67	PASS
Band26	1.4MHz	27033	QPSK	1	0	High	12000	26500	-43.84	PASS
Band26	1.4MHz	26797	16QAM	1	0	Low	30	1000	-35.62	PASS
Band26	1.4MHz	26797	16QAM	1	0	Low	1000	5000	-43.33	PASS
Band26	1.4MHz	26797	16QAM	1	0	Low	5000	12000	-59.26	PASS
Band26	1.4MHz	26797	16QAM	1	0	Low	12000	26500	-44.07	PASS
Band26	1.4MHz	26915	16QAM	1	0	Low	30	1000	-32.71	PASS
Band26	1.4MHz	26915	16QAM	1	0	Low	1000	5000	-43.03	PASS
Band26	1.4MHz	26915	16QAM	1	0	Low	5000	12000	-58.71	PASS
Band26	1.4MHz	26915	16QAM	1	0	Low	12000	26500	-43.78	PASS
Band26	1.4MHz	27033	16QAM	1	0	High	30	1000	-37.11	PASS
Band26	1.4MHz	27033	16QAM	1	0	High	1000	5000	-42.96	PASS
Band26	1.4MHz	27033	16QAM	1	0	High	5000	12000	-58.85	PASS
Band26	1.4MHz	27033	16QAM	1	0	High	12000	26500	-43.68	PASS
Band26	3MHz	26805	QPSK	1	0	Low	30	1000	-36.98	PASS
Band26	3MHz	26805	QPSK	1	0	Low	1000	5000	-43.37	PASS
Band26	3MHz	26805	QPSK	1	0	Low	5000	12000	-59.13	PASS
Band26	3MHz	26805	QPSK	1	0	Low	12000	26500	-44.13	PASS
Band26	3MHz	26915	QPSK	1	0	Low	30	1000	-33.55	PASS
Band26	3MHz	26915	QPSK	1	0	Low	1000	5000	-43	PASS
Band26	3MHz	26915	QPSK	1	0	Low	5000	12000	-58.88	PASS
Band26	3MHz	26915	QPSK	1	0	Low	12000	26500	-43.88	PASS
Band26	3MHz	27025	QPSK	1	0	High	30	1000	-36.42	PASS
Band26	3MHz	27025	QPSK	1	0	High	1000	5000	-43.12	PASS





Band26	3MHz	27025	QPSK	1	0	High	5000	12000	-58.79	PASS
Band26	3MHz	27025	QPSK	1	0	High	12000	26500	-43.94	PASS
Band26	3MHz	26805	16QAM	1	0	Low	30	1000	-36.27	PASS
Band26	3MHz	26805	16QAM	1	0	Low	1000	5000	-43.58	PASS
Band26	3MHz	26805	16QAM	1	0	Low	5000	12000	-59.27	PASS
Band26	3MHz	26805	16QAM	1	0	Low	12000	26500	-44.25	PASS
Band26	3MHz	26915	16QAM	1	0	Low	30	1000	-37.82	PASS
Band26	3MHz	26915	16QAM	1	0	Low	1000	5000	-42.91	PASS
Band26	3MHz	26915	16QAM	1	0	Low	5000	12000	-58.93	PASS
Band26	3MHz	26915	16QAM	1	0	Low	12000	26500	-43.76	PASS
Band26	3MHz	27025	16QAM	1	0	High	30	1000	-37.1	PASS
Band26	3MHz	27025	16QAM	1	0	High	1000	5000	-42.93	PASS
Band26	3MHz	27025	16QAM	1	0	High	5000	12000	-58.59	PASS
Band26	3MHz	27025	16QAM	1	0	High	12000	26500	-43.91	PASS
Band26	5MHz	26815	QPSK	1	0	Low	30	1000	-33.42	PASS
Band26	5MHz	26815	QPSK	1	0	Low	1000	5000	-43.46	PASS
Band26	5MHz	26815	QPSK	1	0	Low	5000	12000	-59.21	PASS
Band26	5MHz	26815	QPSK	1	0	Low	12000	26500	-44.19	PASS
Band26	5MHz	26915	QPSK	1	0	Low	30	1000	-37.04	PASS
Band26	5MHz	26915	QPSK	1	0	Low	1000	5000	-43.07	PASS
Band26	5MHz	26915	QPSK	1	0	Low	5000	12000	-58.77	PASS
Band26	5MHz	26915	QPSK	1	0	Low	12000	26500	-43.82	PASS
Band26	5MHz	27015	QPSK	1	0	High	30	1000	-37.12	PASS
Band26	5MHz	27015	QPSK	1	0	High	1000	5000	-43.09	PASS
Band26	5MHz	27015	QPSK	1	0	High	5000	12000	-58.9	PASS
Band26	5MHz	27015	QPSK	1	0	High	12000	26500	-43.76	PASS
Band26	5MHz	26815	16QAM	1	0	Low	30	1000	-35.9	PASS
Band26	5MHz	26815	16QAM	1	0	Low	1000	5000	-43.41	PASS
Band26	5MHz	26815	16QAM	1	0	Low	5000	12000	-59.15	PASS
Band26	5MHz	26815	16QAM	1	0	Low	12000	26500	-44.09	PASS
Band26	5MHz	26915	16QAM	1	0	Low	30	1000	-36.86	PASS
Band26	5MHz	26915	16QAM	1	0	Low	1000	5000	-43.11	PASS
Band26	5MHz	26915	16QAM	1	0	Low	5000	12000	-58.85	PASS
Band26	5MHz	26915	16QAM	1	0	Low	12000	26500	-43.94	PASS
Band26	5MHz	27015	16QAM	1	0	High	30	1000	-37.06	PASS
Band26	5MHz	27015	16QAM	1	0	High	1000	5000	-42.91	PASS
Band26	5MHz	27015	16QAM	1	0	High	5000	12000	-58.83	PASS
Band26	5MHz	27015	16QAM	1	0	High	12000	26500	-43.56	PASS
Band26	10MHz	26840	QPSK	1	0	Low	30	1000	-32.36	PASS
Band26	10MHz	26840	QPSK	1	0	Low	1000	5000	-43.36	PASS
Band26	10MHz	26840	QPSK	1	0	Low	5000	12000	-59.28	PASS






Band26	10MHz	26840	QPSK	1	0	Low	12000	26500	-44.32	PASS
Band26	10MHz	26915	QPSK	1	0	Low	30	1000	-37.1	PASS
Band26	10MHz	26915	QPSK	1	0	Low	1000	5000	-42.98	PASS
Band26	10MHz	26915	QPSK	1	0	Low	5000	12000	-58.57	PASS
Band26	10MHz	26915	QPSK	1	0	Low	12000	26500	-43.78	PASS
Band26	10MHz	26990	QPSK	1	0	High	30	1000	-34.35	PASS
Band26	10MHz	26990	QPSK	1	0	High	1000	5000	-43.07	PASS
Band26	10MHz	26990	QPSK	1	0	High	5000	12000	-58.82	PASS
Band26	10MHz	26990	QPSK	1	0	High	12000	26500	-43.69	PASS
Band26	10MHz	26840	16QAM	1	0	Low	30	1000	-37.56	PASS
Band26	10MHz	26840	16QAM	1	0	Low	1000	5000	-43.34	PASS
Band26	10MHz	26840	16QAM	1	0	Low	5000	12000	-59.19	PASS
Band26	10MHz	26840	16QAM	1	0	Low	12000	26500	-44.29	PASS
Band26	10MHz	26915	16QAM	1	0	Low	30	1000	-34.25	PASS
Band26	10MHz	26915	16QAM	1	0	Low	1000	5000	-42.95	PASS
Band26	10MHz	26915	16QAM	1	0	Low	5000	12000	-58.66	PASS
Band26	10MHz	26915	16QAM	1	0	Low	12000	26500	-43.69	PASS
Band26	10MHz	26990	16QAM	1	0	High	30	1000	-37.29	PASS
Band26	10MHz	26990	16QAM	1	0	High	1000	5000	-43.04	PASS
Band26	10MHz	26990	16QAM	1	0	High	5000	12000	-58.75	PASS
Band26	10MHz	26990	16QAM	1	0	High	12000	26500	-43.63	PASS
Band26	15MHz	26865	QPSK	1	0	Low	30	1000	-35.81	PASS
Band26	15MHz	26865	QPSK	1	0	Low	1000	5000	-43.15	PASS
Band26	15MHz	26865	QPSK	1	0	Low	5000	12000	-58.8	PASS
Band26	15MHz	26865	QPSK	1	0	Low	12000	26500	-43.85	PASS
Band26	15MHz	26915	QPSK	1	0	Low	30	1000	-36.76	PASS
Band26	15MHz	26915	QPSK	1	0	Low	1000	5000	-43.06	PASS
Band26	15MHz	26915	QPSK	1	0	Low	5000	12000	-58.73	PASS
Band26	15MHz	26915	QPSK	1	0	Low	12000	26500	-43.72	PASS
Band26	15MHz	26965	QPSK	1	0	High	30	1000	-37.13	PASS
Band26	15MHz	26965	QPSK	1	0	High	1000	5000	-43.04	PASS
Band26	15MHz	26965	QPSK	1	0	High	5000	12000	-58.85	PASS
Band26	15MHz	26965	QPSK	1	0	High	12000	26500	-43.83	PASS
Band26	15MHz	26865	16QAM	1	0	Low	30	1000	-37.04	PASS
Band26	15MHz	26865	16QAM	1	0	Low	1000	5000	-43.05	PASS
Band26	15MHz	26865	16QAM	1	0	Low	5000	12000	-58.52	PASS
Band26	15MHz	26865	16QAM	1	0	Low	12000	26500	-43.71	PASS
Band26	15MHz	26915	16QAM	1	0	Low	30	1000	-37.11	PASS
Band26	15MHz	26915	16QAM	1	0	Low	1000	5000	-43.09	PASS
Band26	15MHz	26915	16QAM	1	0	Low	5000	12000	-58.79	PASS
Band26	15MHz	26915	16QAM	1	0	Low	12000	26500	-43.89	PASS






Band26	15MHz	26965	16QAM	1	0	High	30	1000	-36.62	PASS
Band26	15MHz	26965	16QAM	1	0	High	1000	5000	-43.06	PASS
Band26	15MHz	26965	16QAM	1	0	High	5000	12000	-58.95	PASS
Band26	15MHz	26965	16QAM	1	0	High	12000	26500	-43.68	PASS

Test Graphs

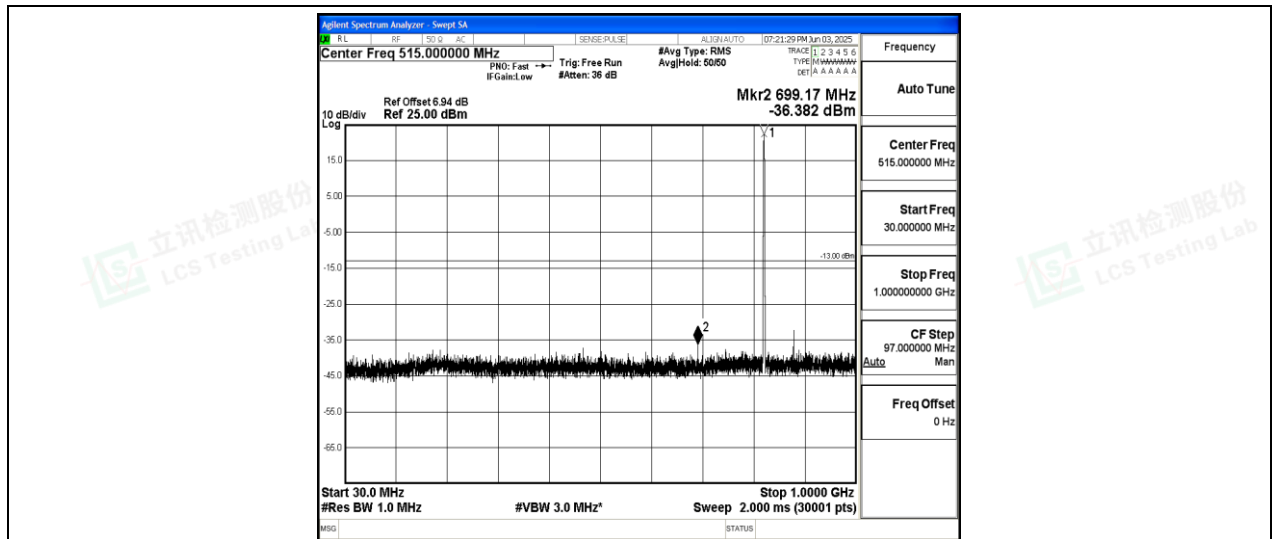


Band26-1.4MHz-QPSK-26797-1-0-Low-30-1000--36.38-PASS

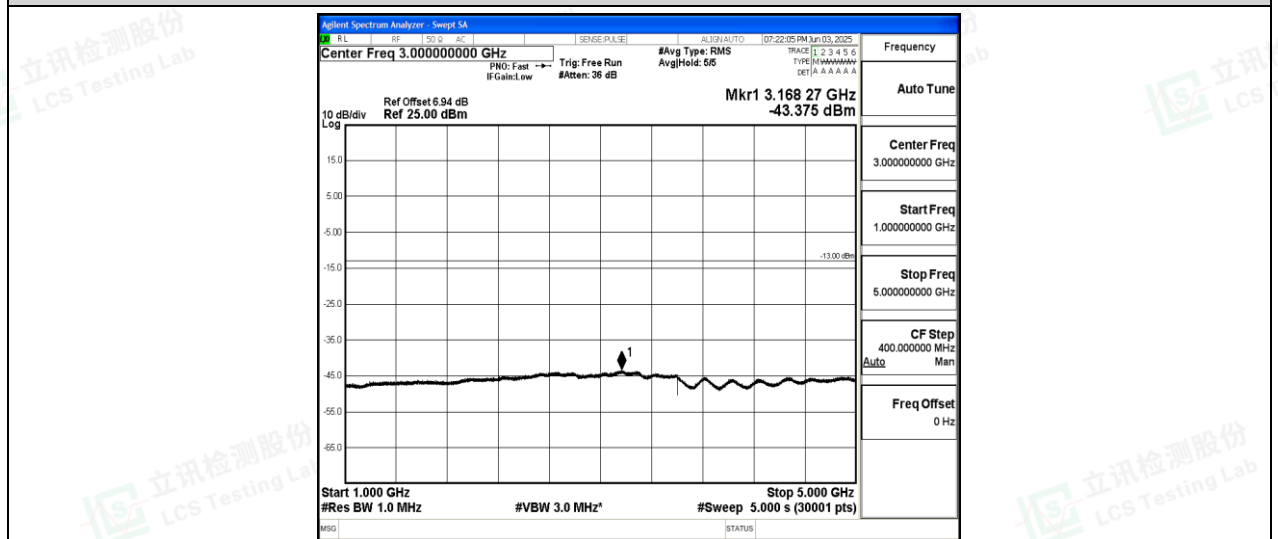


Band26-1.4MHz-QPSK-26797-1-0-Low-1000-5000--43.38-PASS




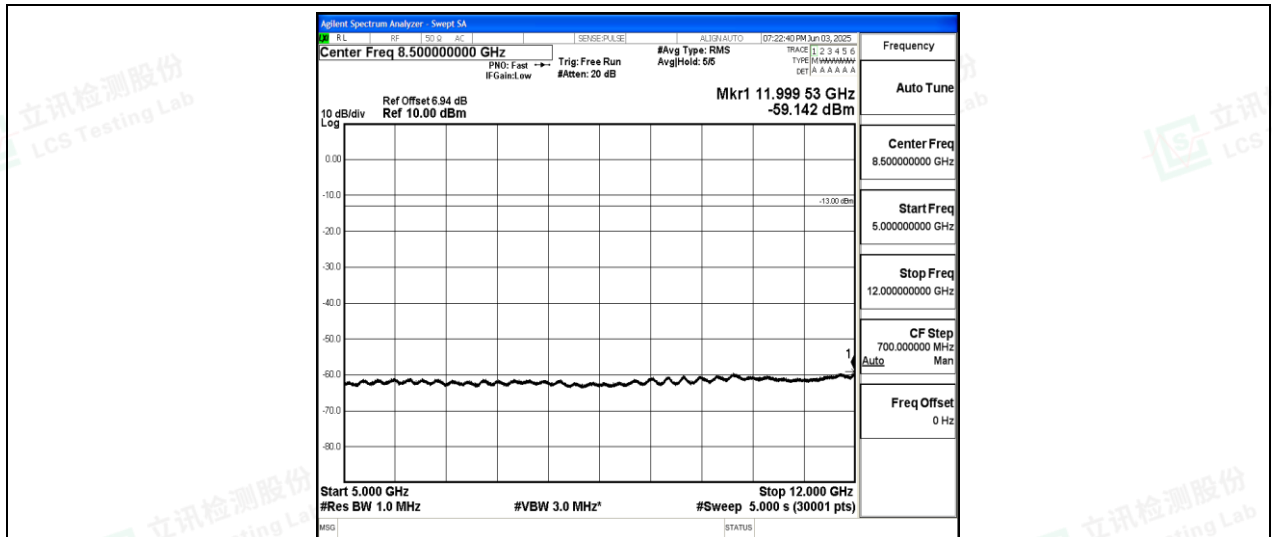

Band26-1.4MHz-QPSK-26797-1-0-Low-5000-12000--59.14-PASS

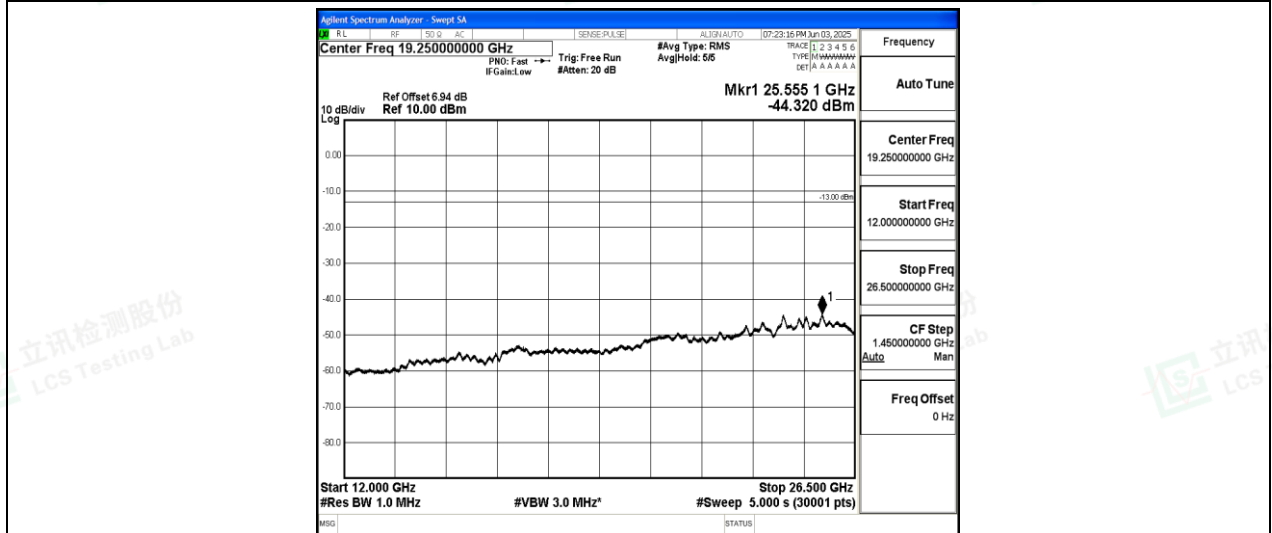

Band26-1.4MHz-QPSK-26797-1-0-Low-12000-26500--44.32-PASS

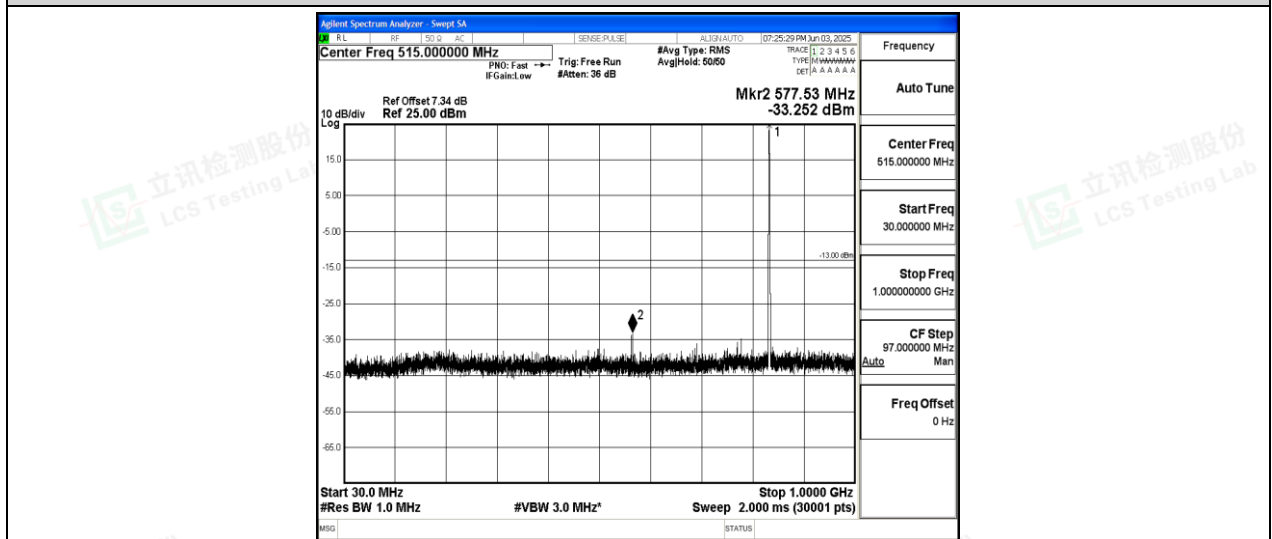

Band26-1.4MHz-QPSK-26915-1-0-Low-30-1000--33.25-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

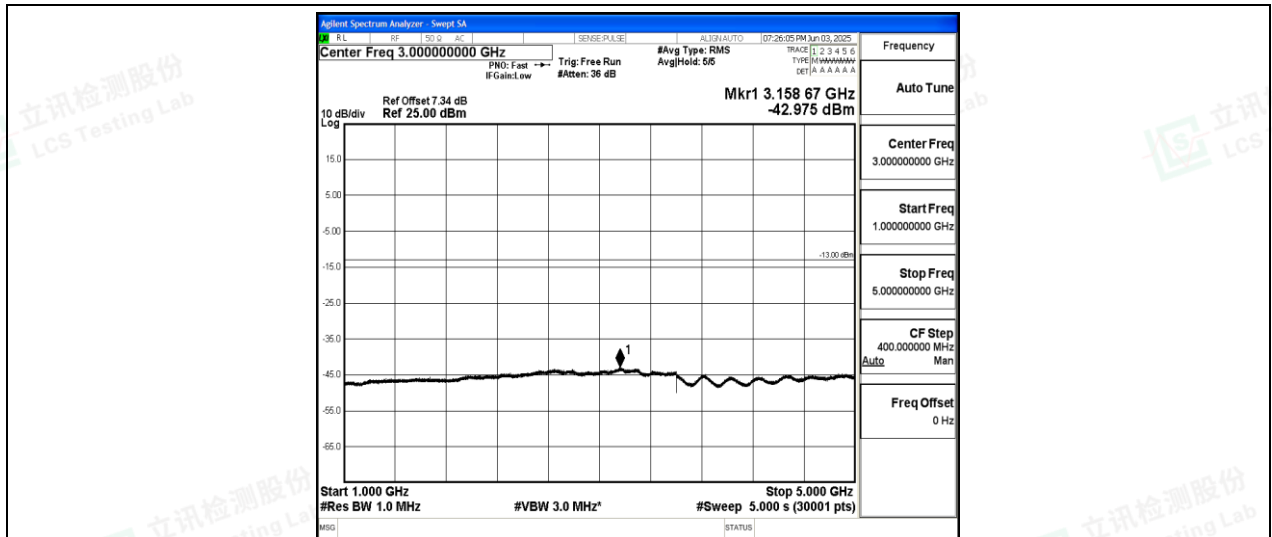

Band26-1.4MHz-QPSK-26915-1-0-Low-1000-5000--42.98-PASS

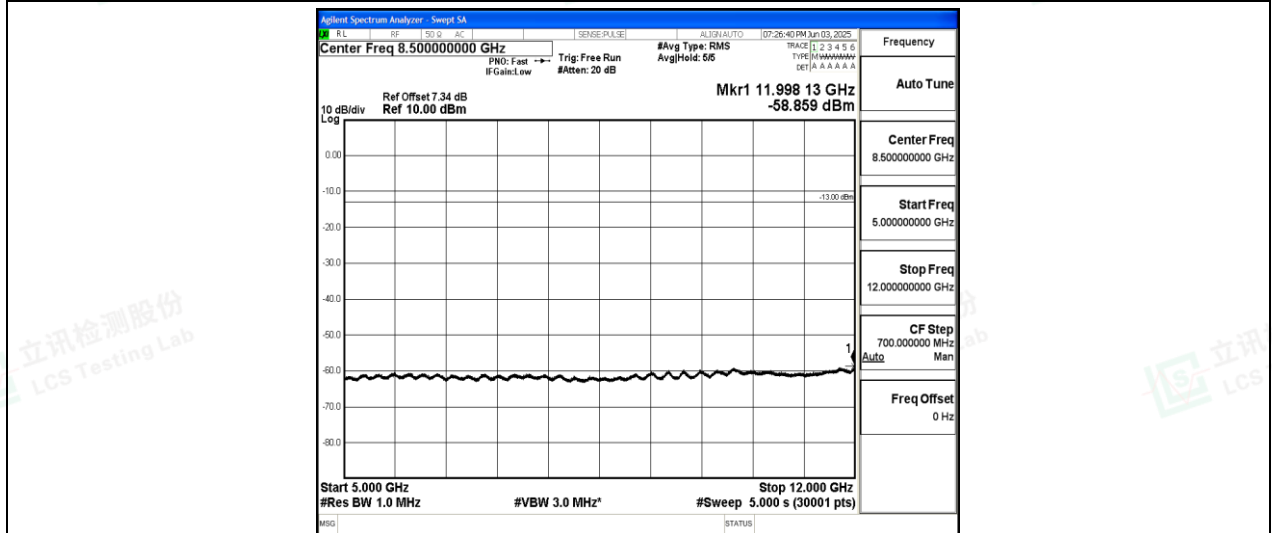

Band26-1.4MHz-QPSK-26915-1-0-Low-5000-12000--58.86-PASS

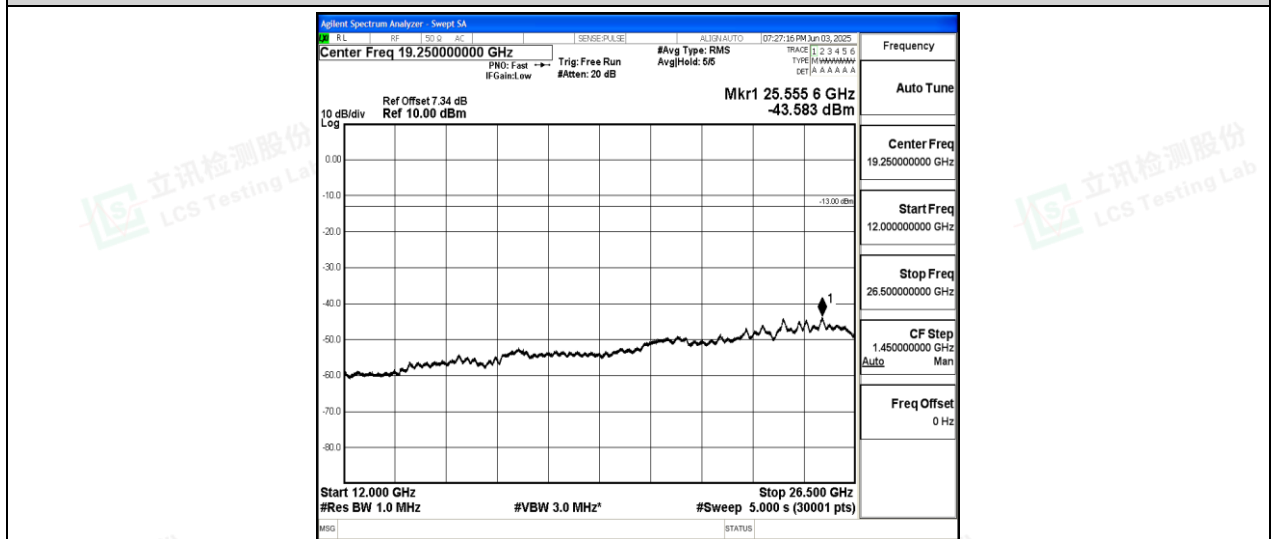

Band26-1.4MHz-QPSK-26915-1-0-Low-12000-26500--43.58-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

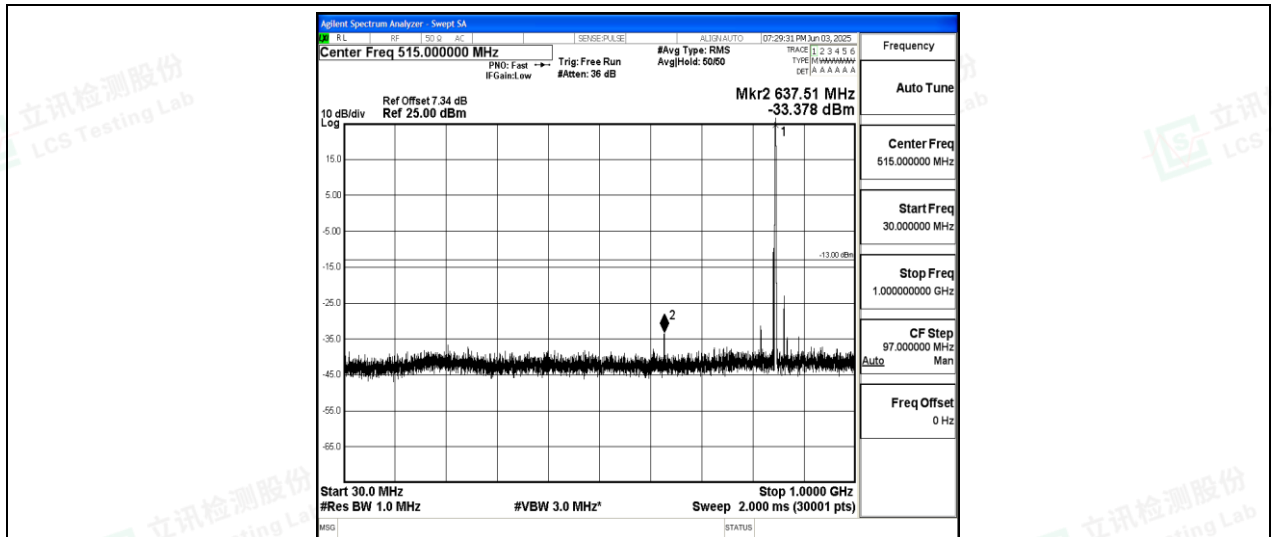

Band26-1.4MHz-QPSK-27033-1-0-High-30-1000--33.38-PASS

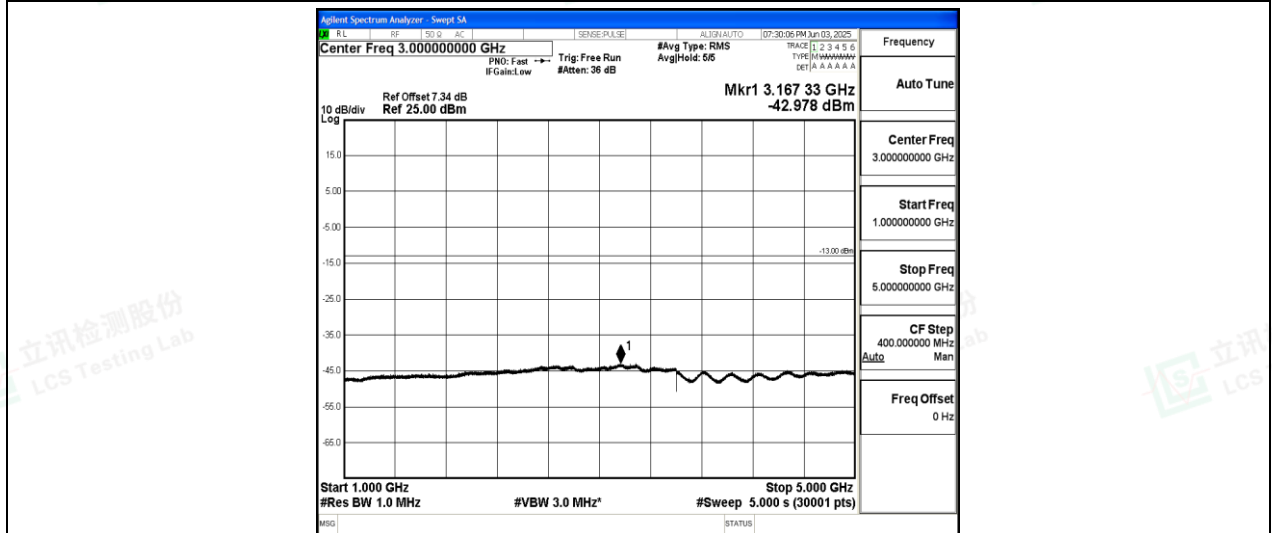

Band26-1.4MHz-QPSK-27033-1-0-High-1000-5000--42.98-PASS

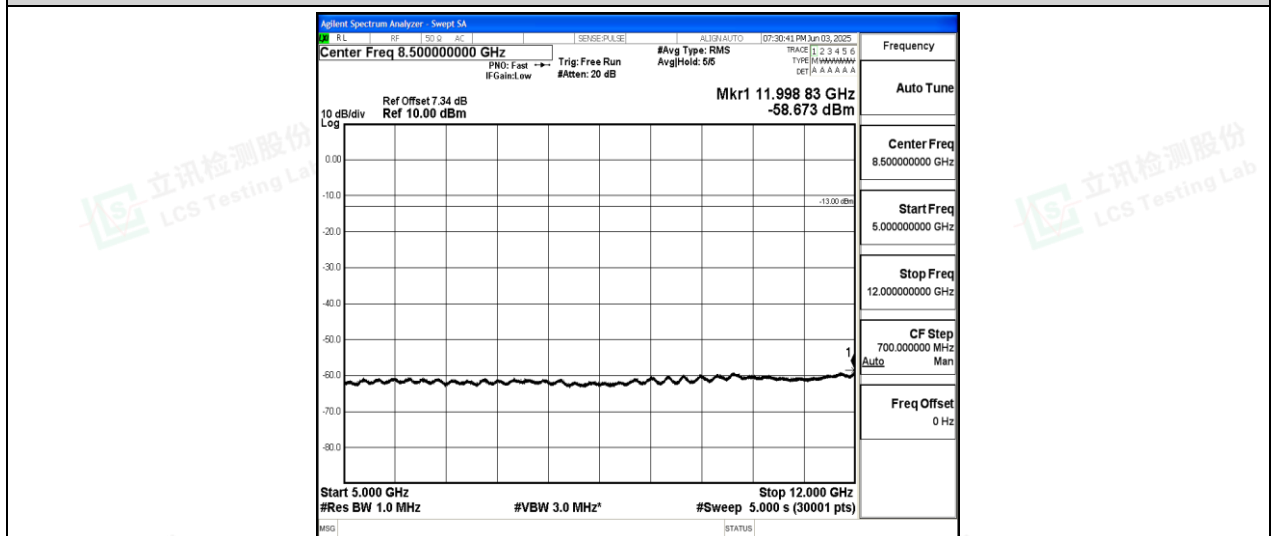

Band26-1.4MHz-QPSK-27033-1-0-High-5000-12000--58.67-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

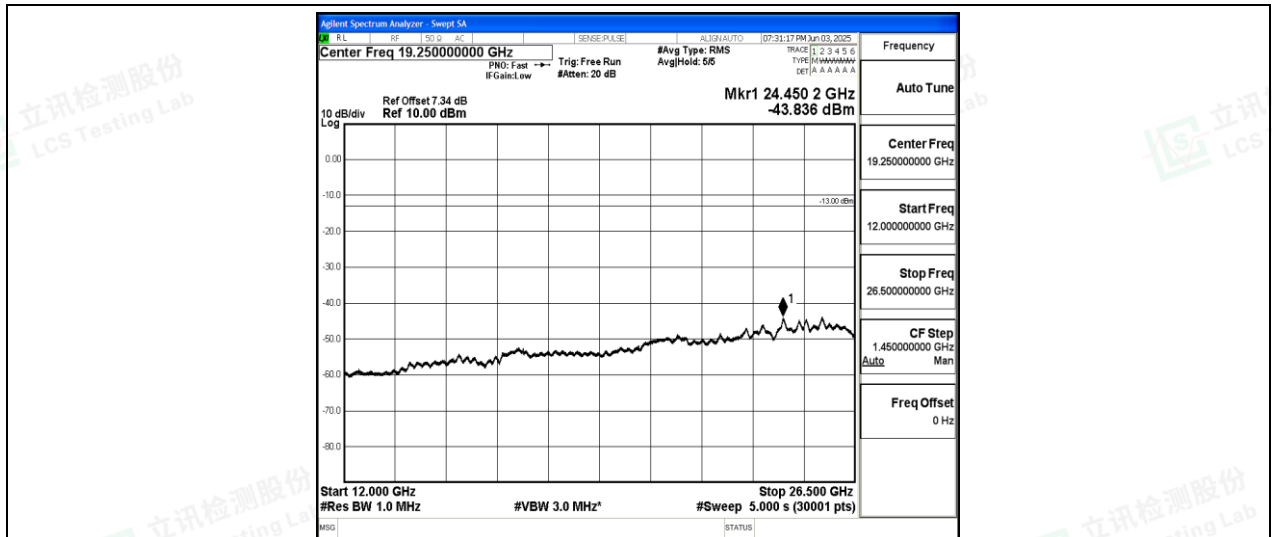

Band26-1.4MHz-QPSK-27033-1-0-High-12000-26500--43.84-PASS

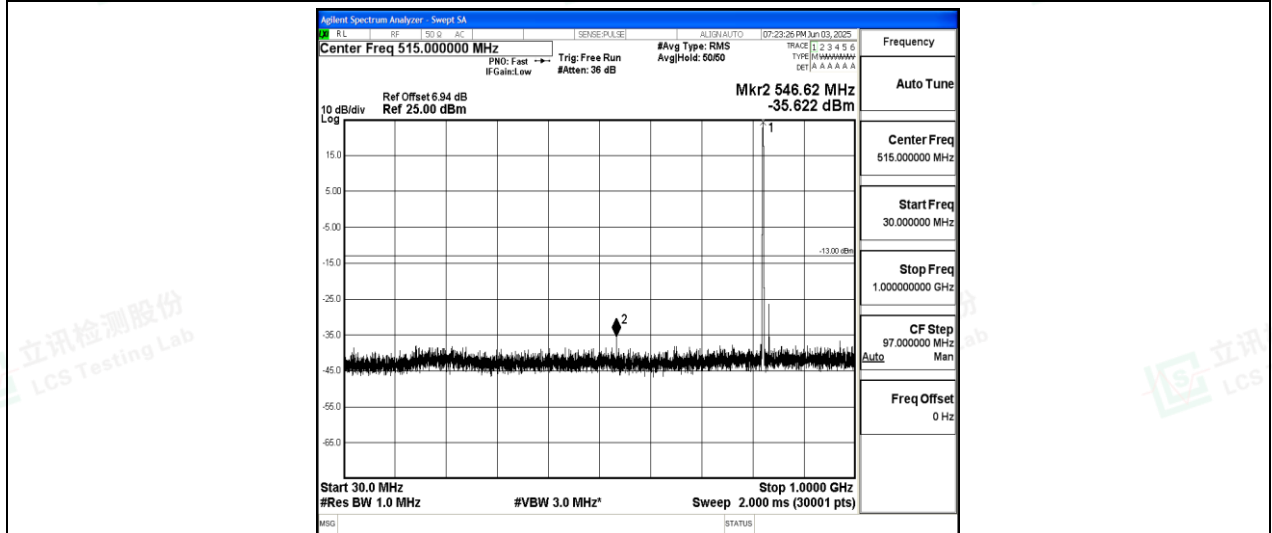

Band26-1.4MHz-16QAM-26797-1-0-Low-30-1000--35.62-PASS

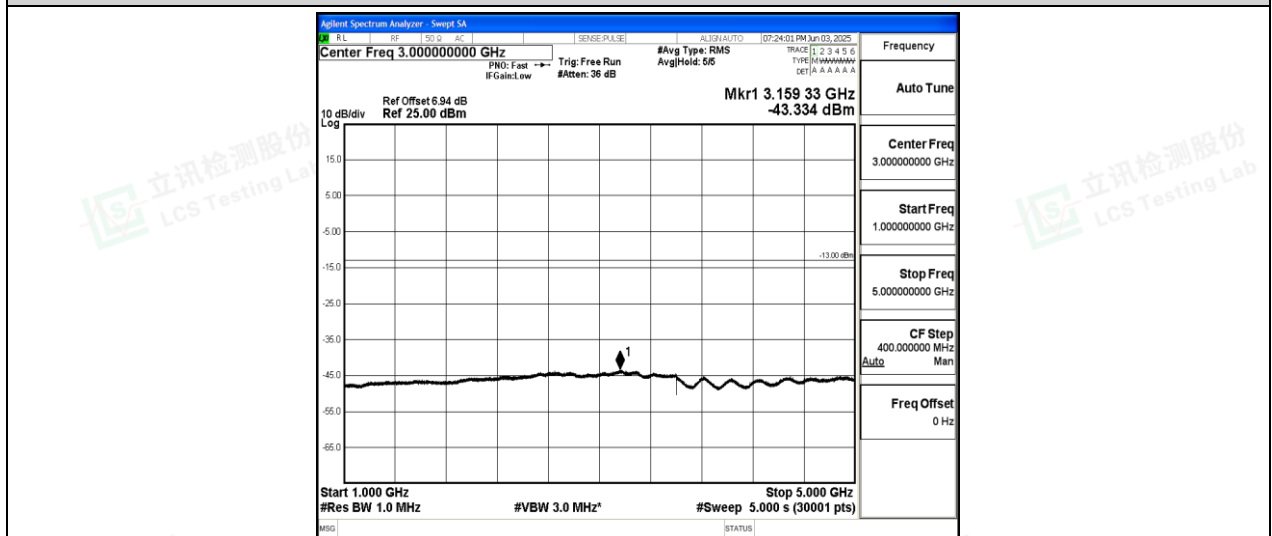

Band26-1.4MHz-16QAM-26797-1-0-Low-1000-5000--43.33-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

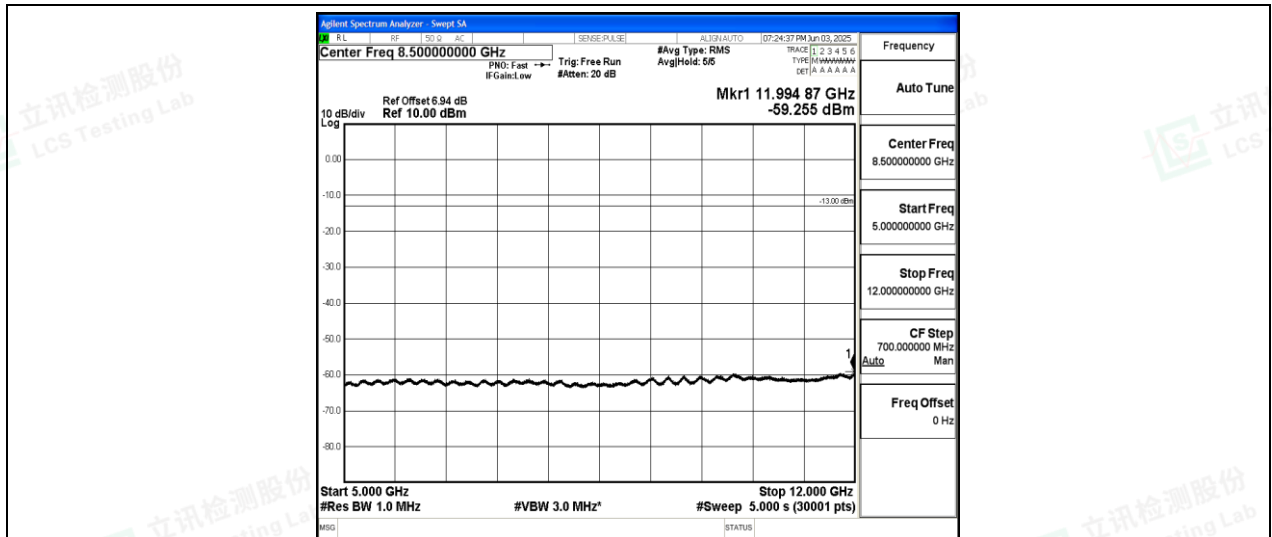

Band26-1.4MHz-16QAM-26797-1-0-Low-5000-12000--59.26-PASS

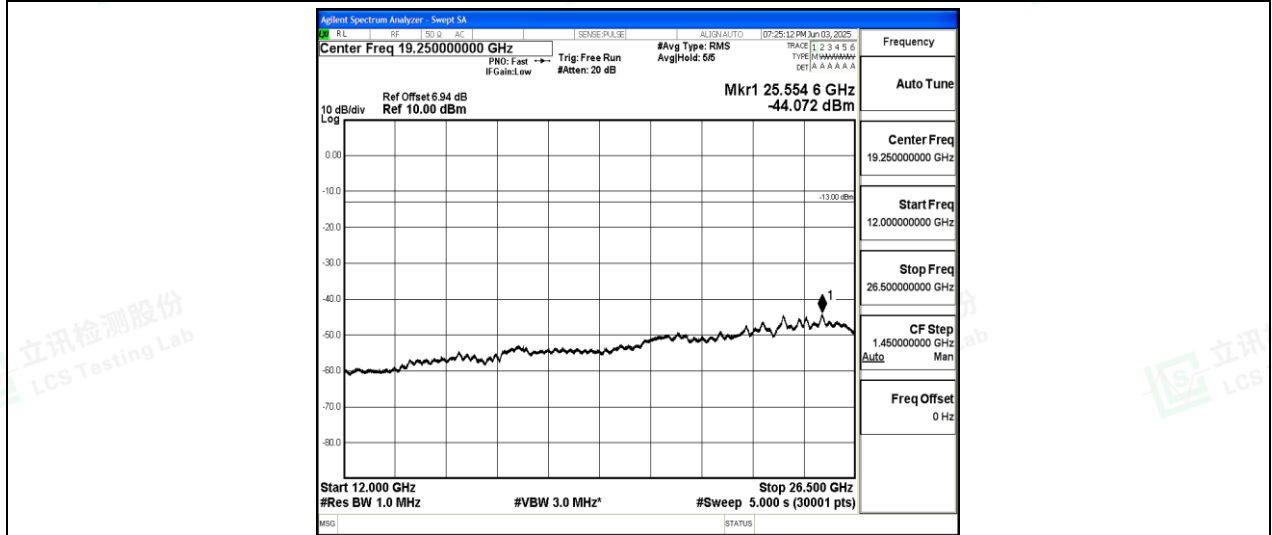

Band26-1.4MHz-16QAM-26797-1-0-Low-12000-26500--44.07-PASS

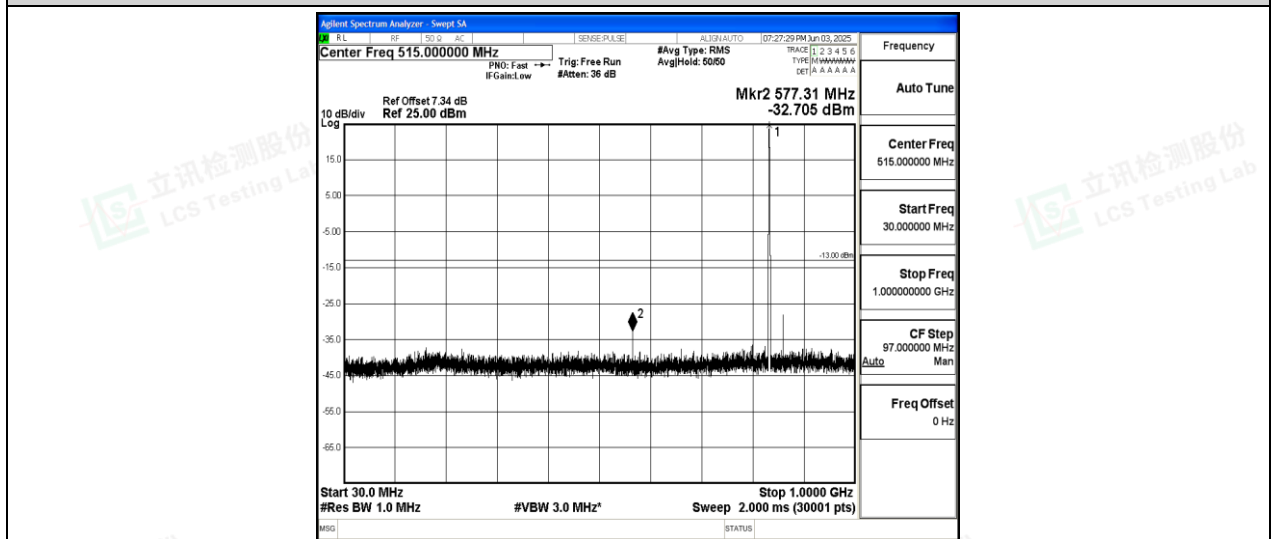

Band26-1.4MHz-16QAM-26915-1-0-Low-30-1000--32.71-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

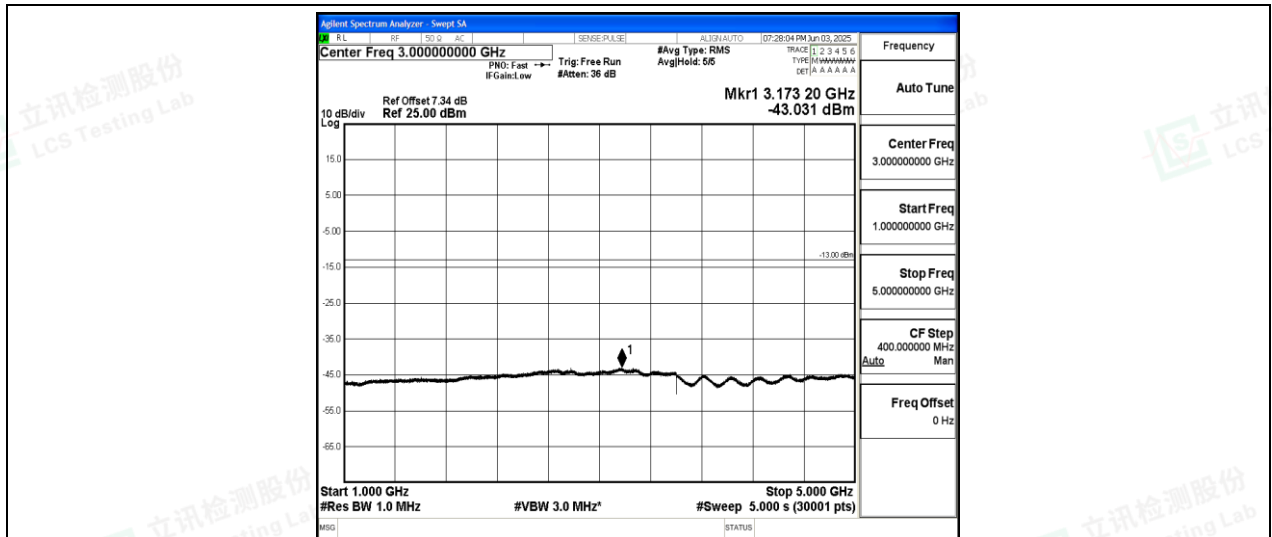

Band26-1.4MHz-16QAM-26915-1-0-Low-1000-5000--43.03-PASS

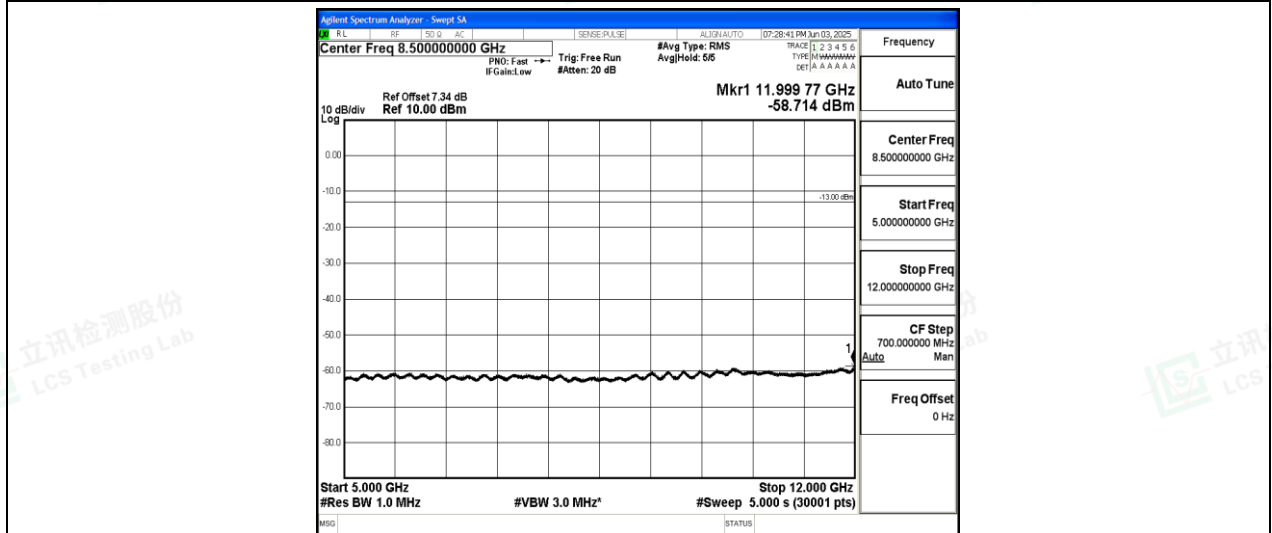

Band26-1.4MHz-16QAM-26915-1-0-Low-5000-12000--58.71-PASS

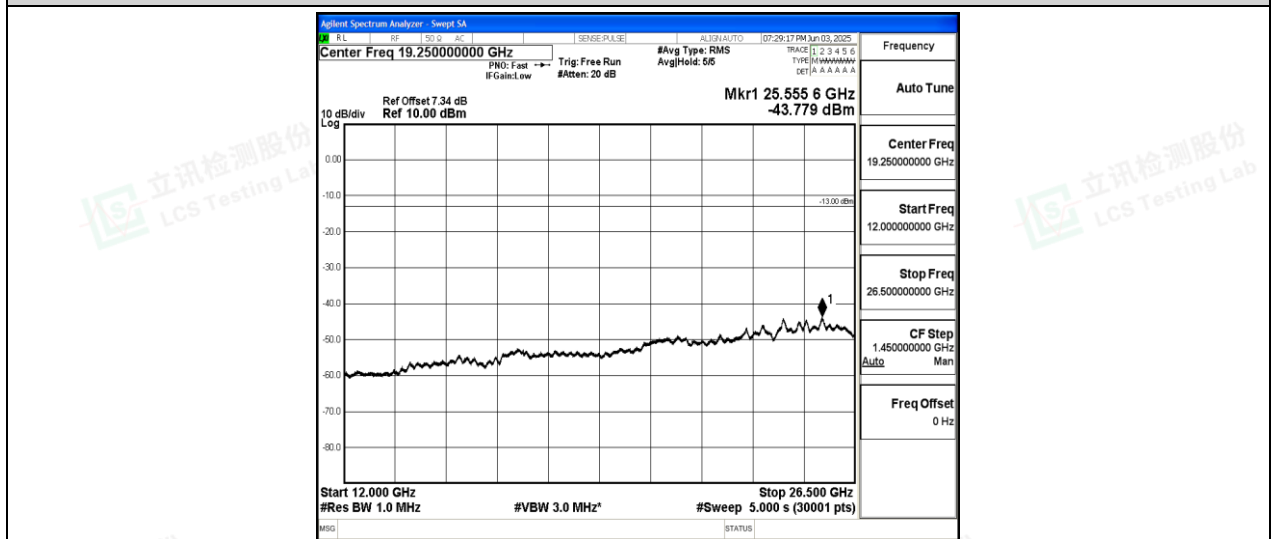

Band26-1.4MHz-16QAM-26915-1-0-Low-12000-26500--43.78-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

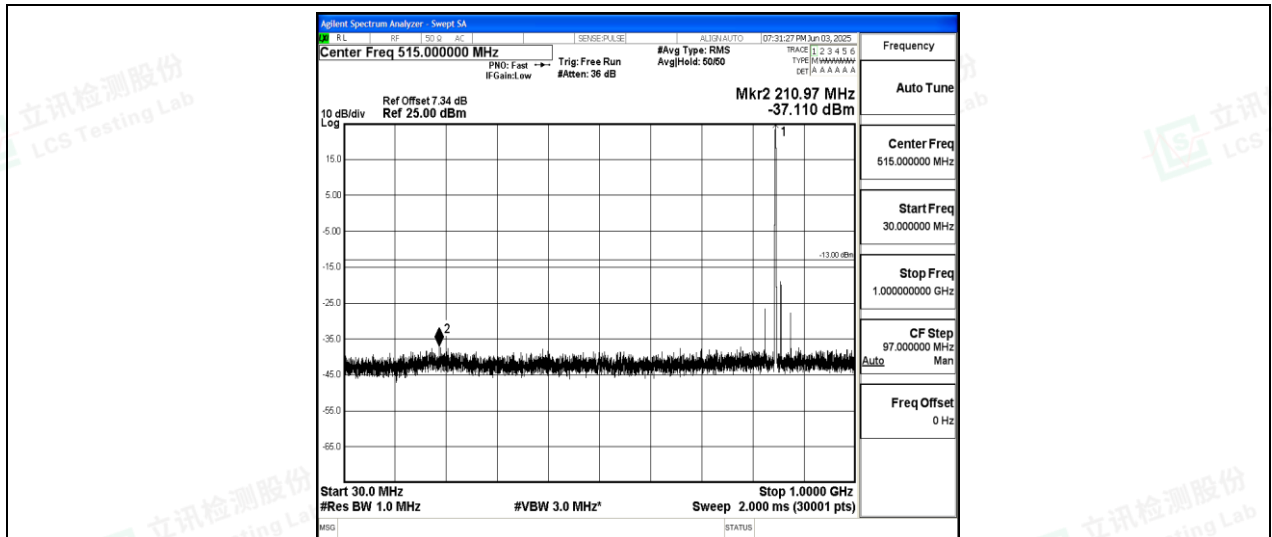

Band26-1.4MHz-16QAM-27033-1-0-High-30-1000--37.11-PASS

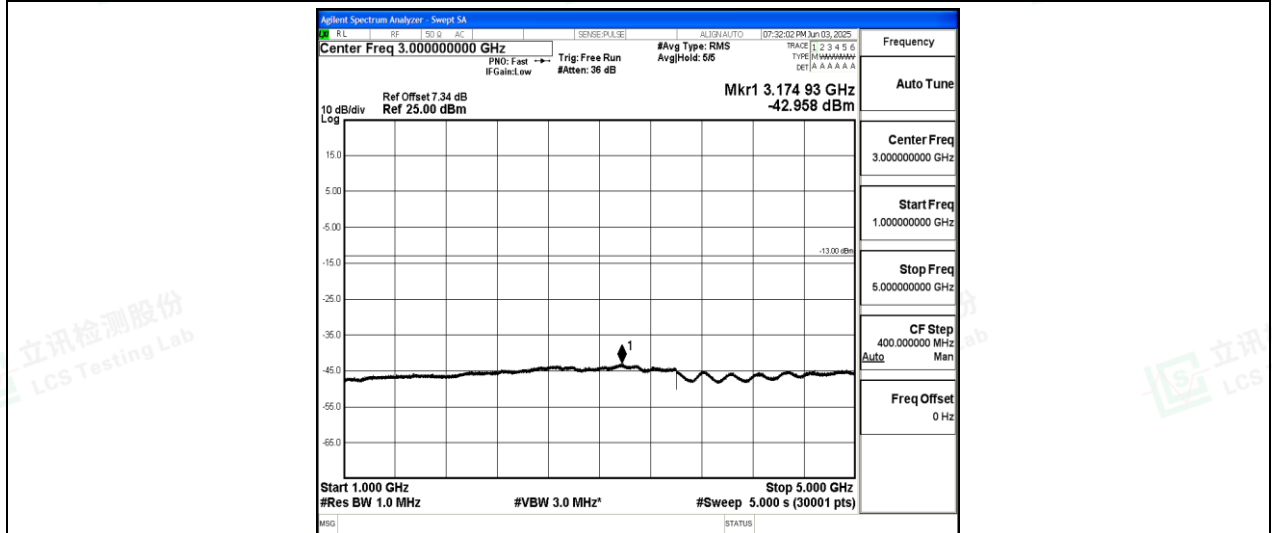

Band26-1.4MHz-16QAM-27033-1-0-High-1000-5000--42.96-PASS

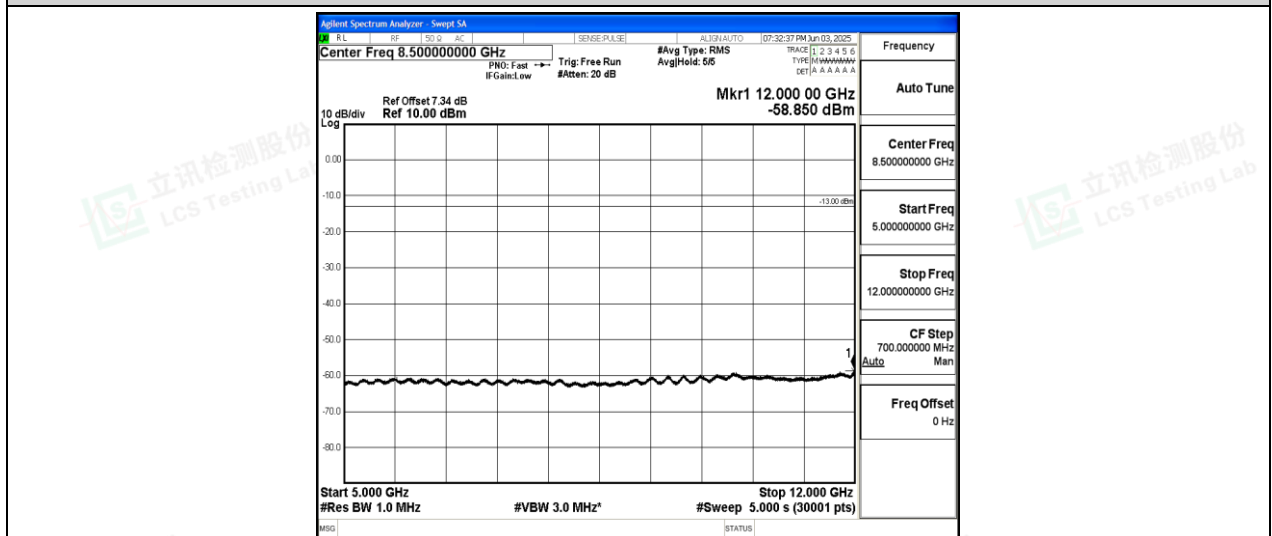

Band26-1.4MHz-16QAM-27033-1-0-High-5000-12000--58.85-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

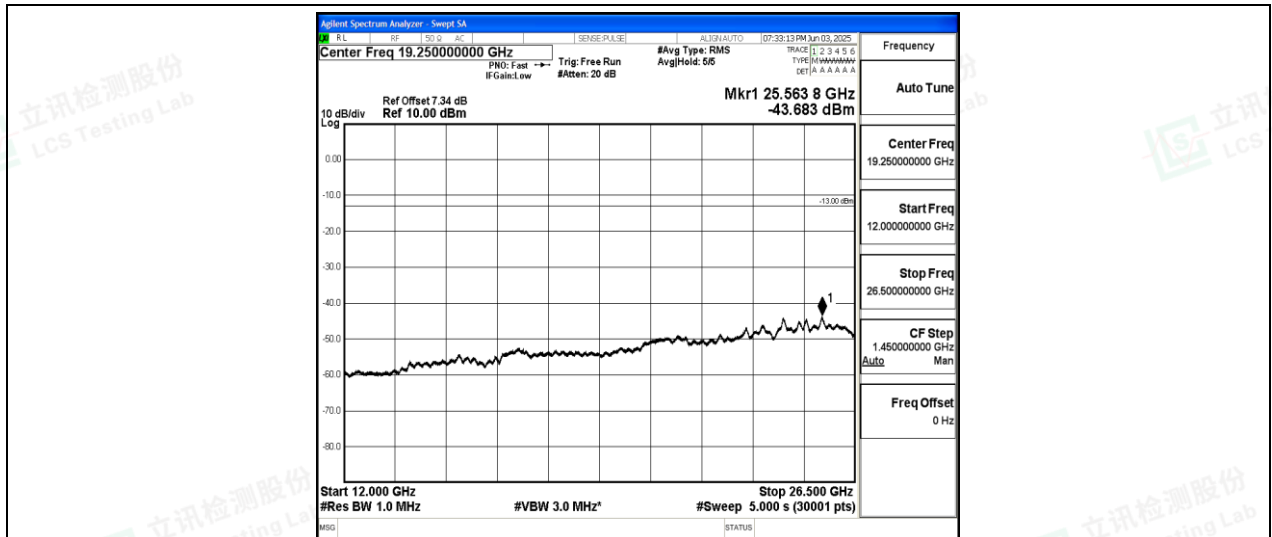

Band26-1.4MHz-16QAM-27033-1-0-High-12000-26500--43.68-PASS

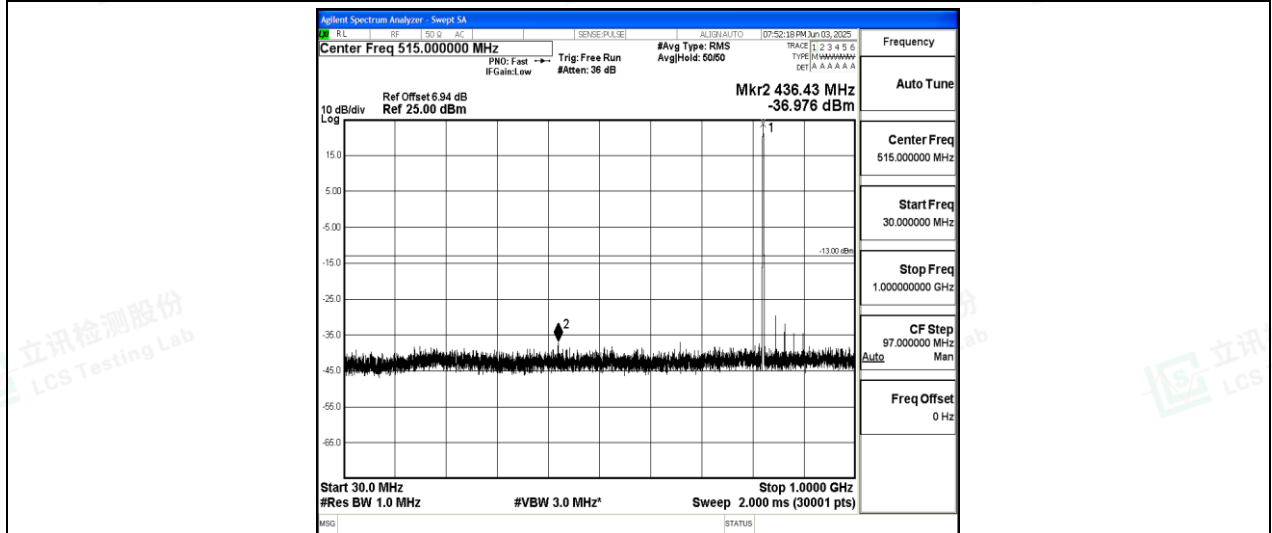

Band26-3MHz-QPSK-26805-1-0-Low-30-1000--36.98-PASS

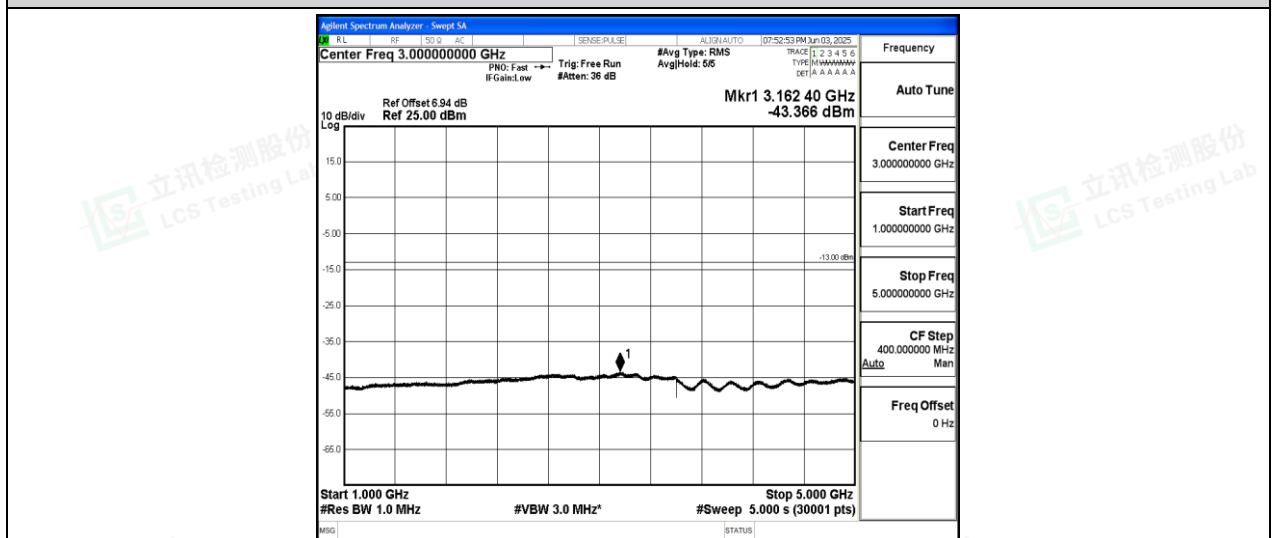

Band26-3MHz-QPSK-26805-1-0-Low-1000-5000--43.37-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

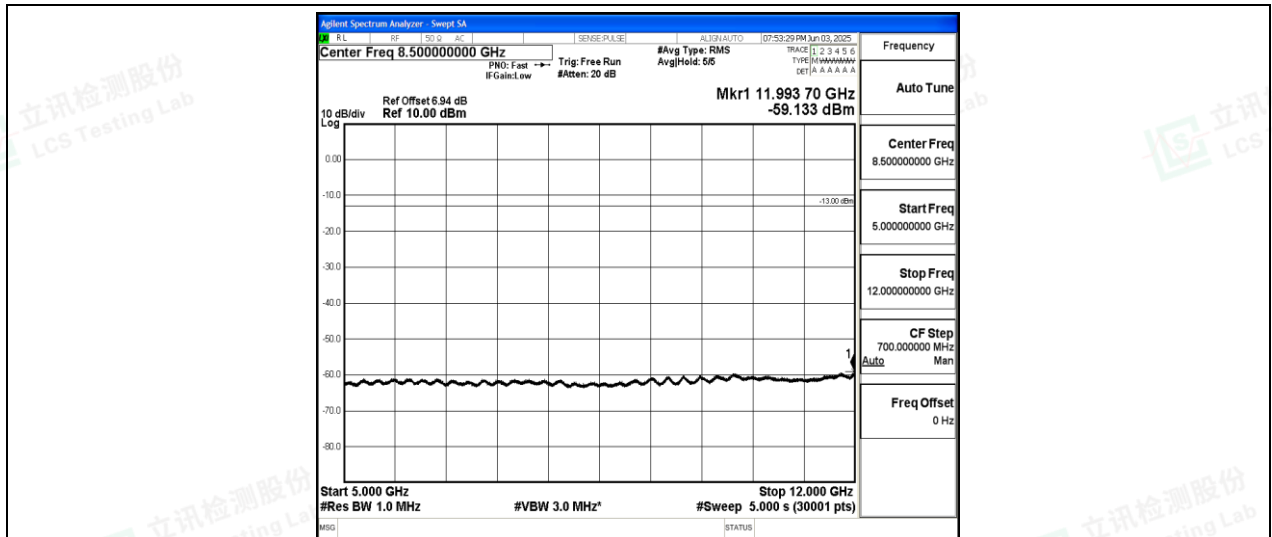

Band26-3MHz-QPSK-26805-1-0-Low-5000-12000--59.13-PASS

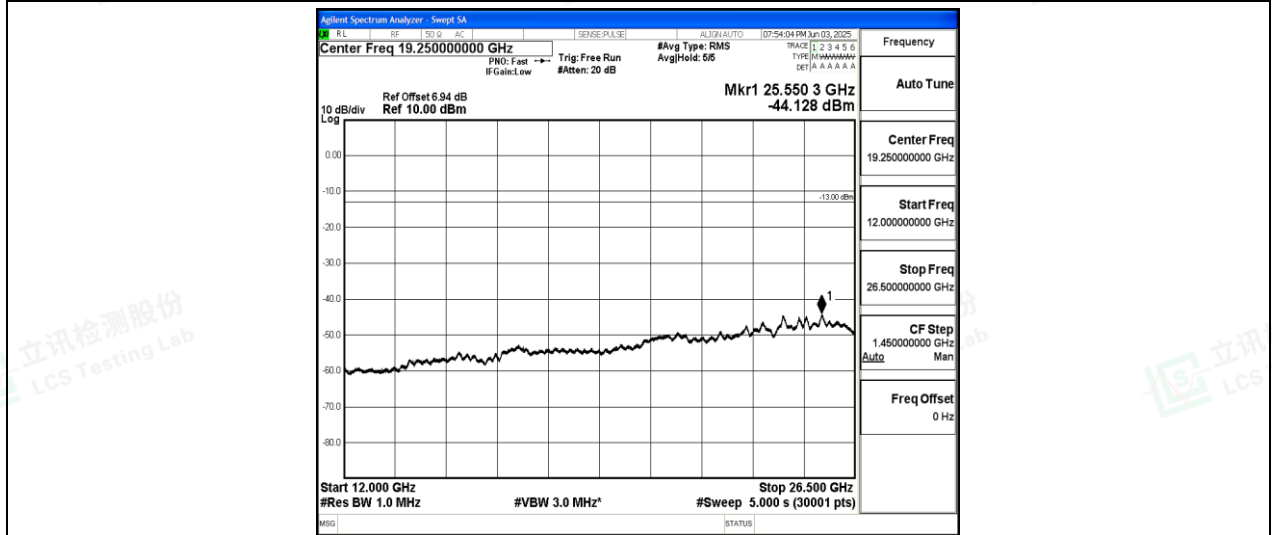

Band26-3MHz-QPSK-26805-1-0-Low-12000-26500--44.13-PASS

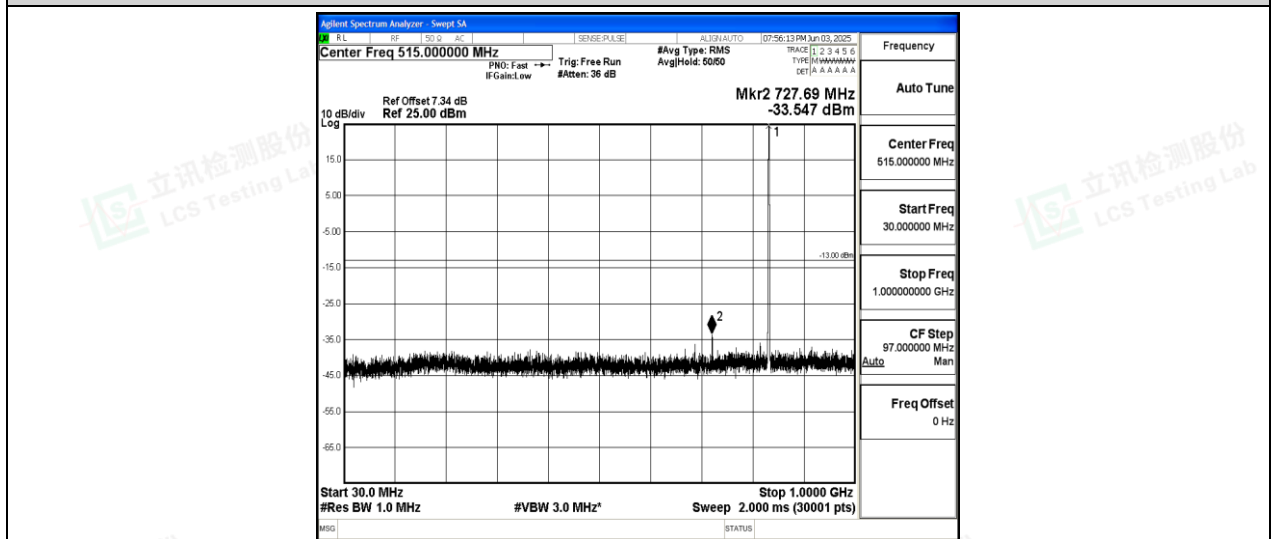

Band26-3MHz-QPSK-26915-1-0-Low-30-1000--33.55-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

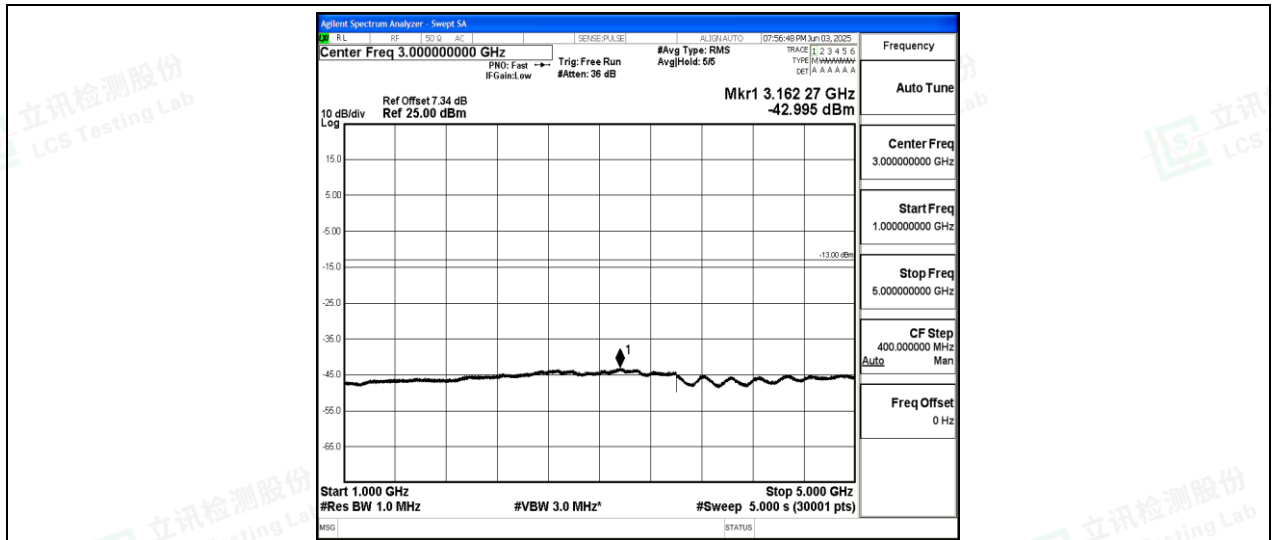

Band26-3MHz-QPSK-26915-1-0-Low-1000-5000--43-PASS

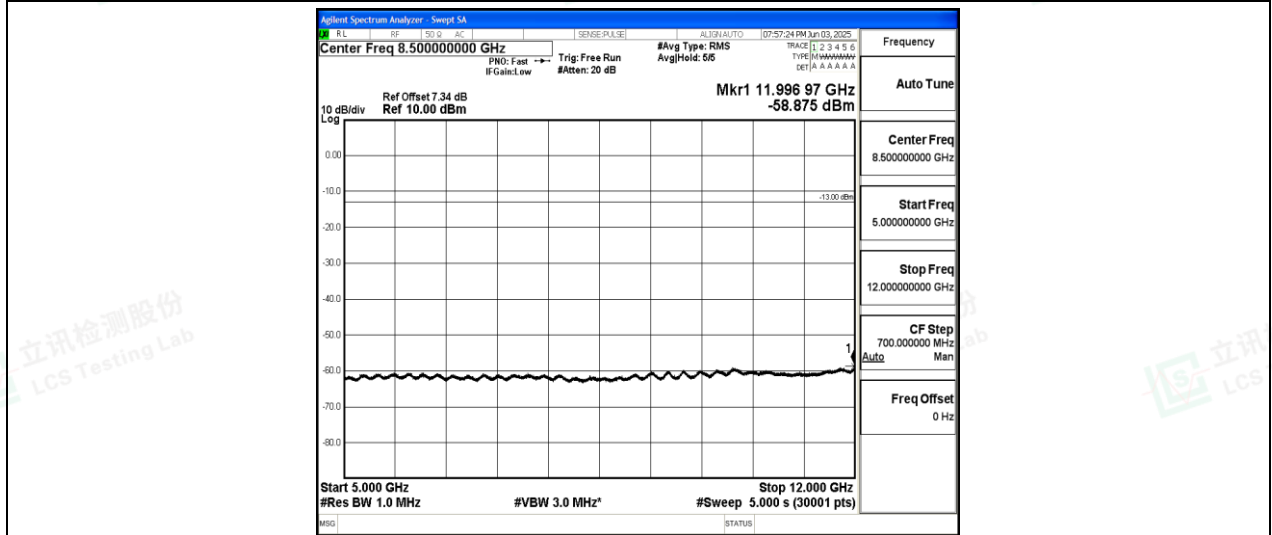

Band26-3MHz-QPSK-26915-1-0-Low-5000-12000--58.88-PASS

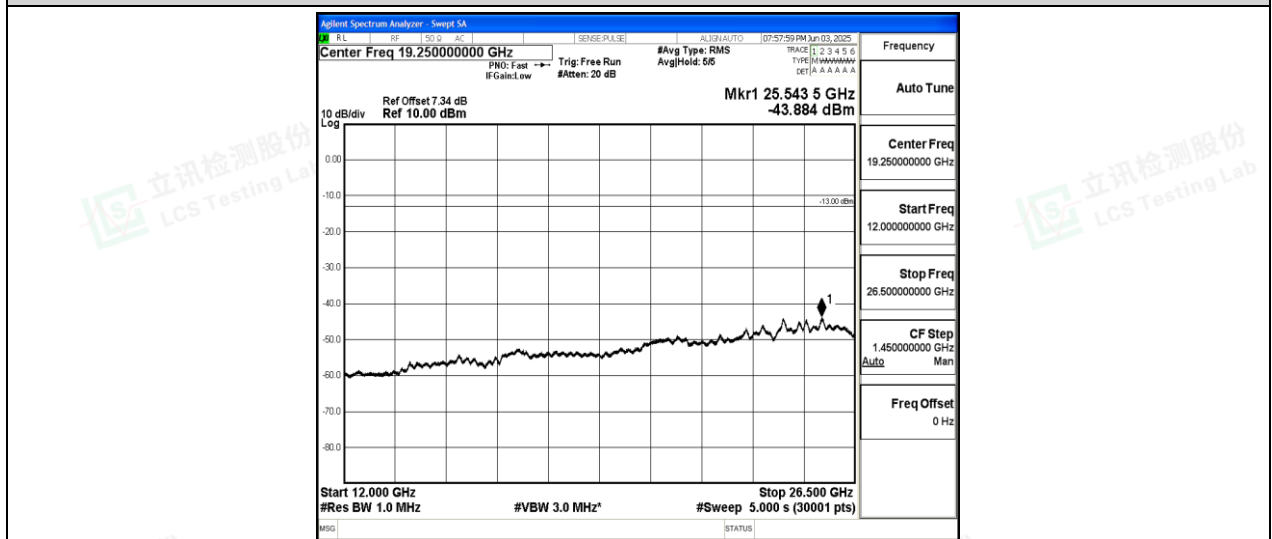

Band26-3MHz-QPSK-26915-1-0-Low-12000-26500--43.88-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

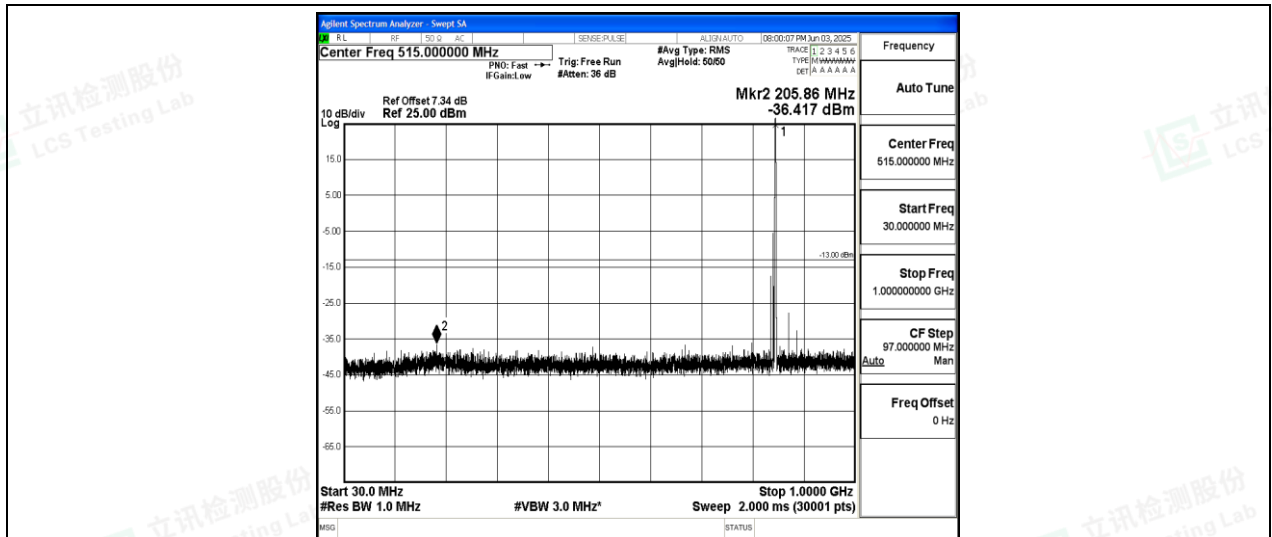

Band26-3MHz-QPSK-27025-1-0-High-30-1000--36.42-PASS

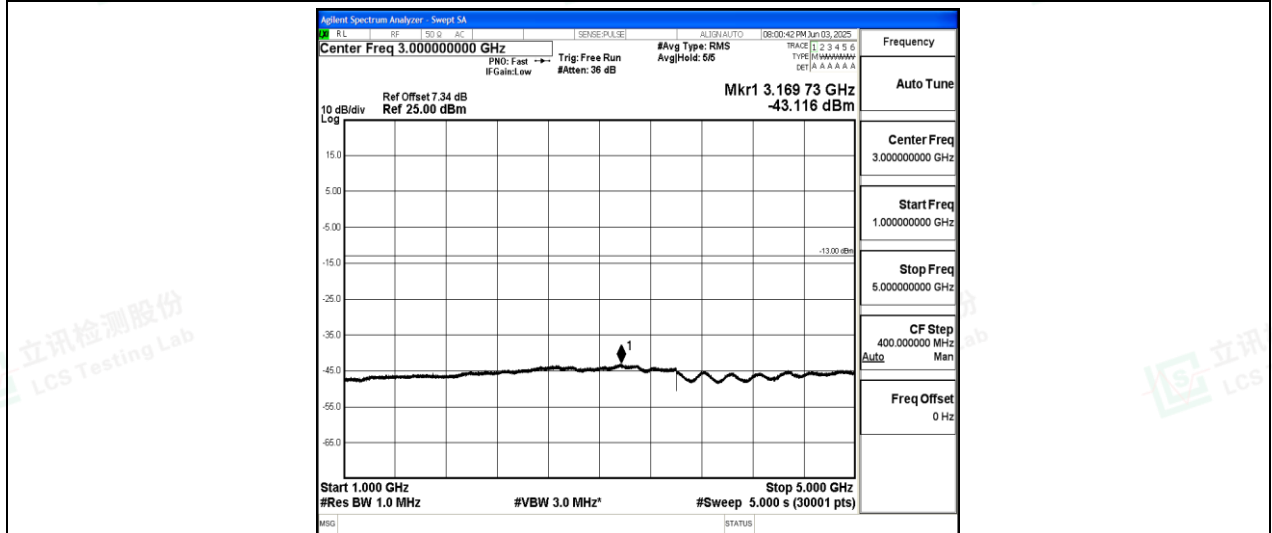

Band26-3MHz-QPSK-27025-1-0-High-1000-5000--43.12-PASS

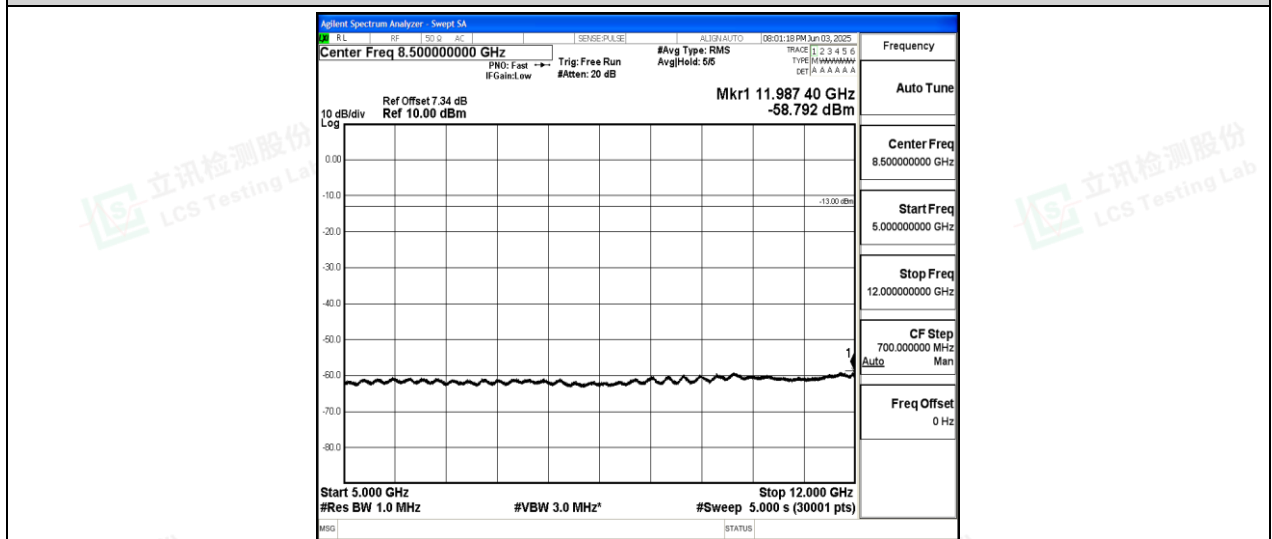

Band26-3MHz-QPSK-27025-1-0-High-5000-12000--58.79-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

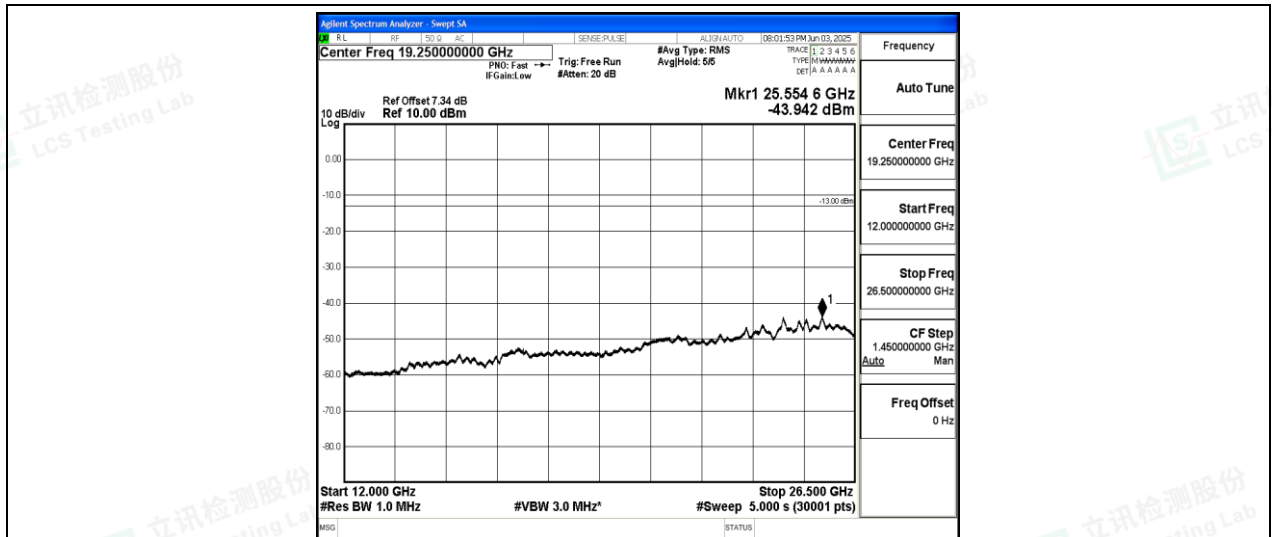

Band26-3MHz-QPSK-27025-1-0-High-12000-26500--43.94-PASS

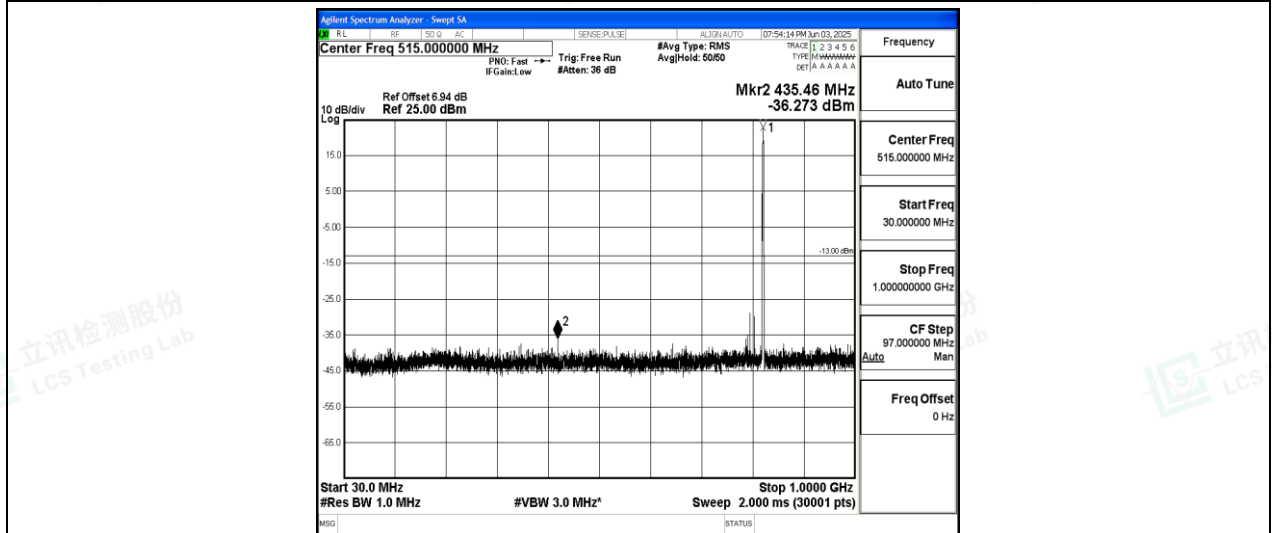

Band26-3MHz-16QAM-26805-1-0-Low-30-1000--36.27-PASS

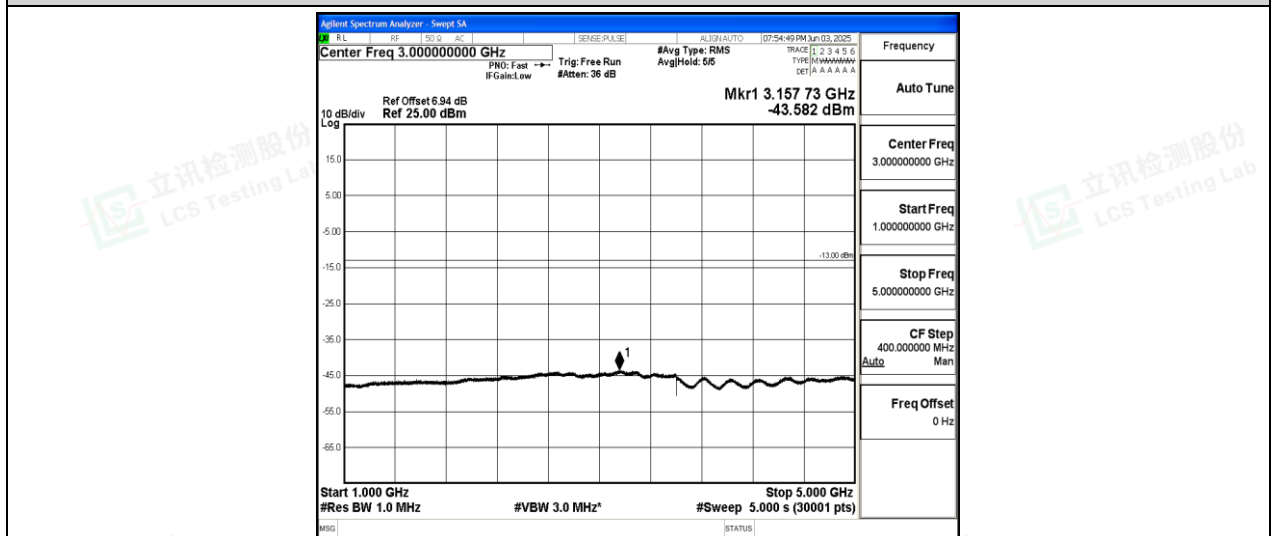

Band26-3MHz-16QAM-26805-1-0-Low-1000-5000--43.58-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

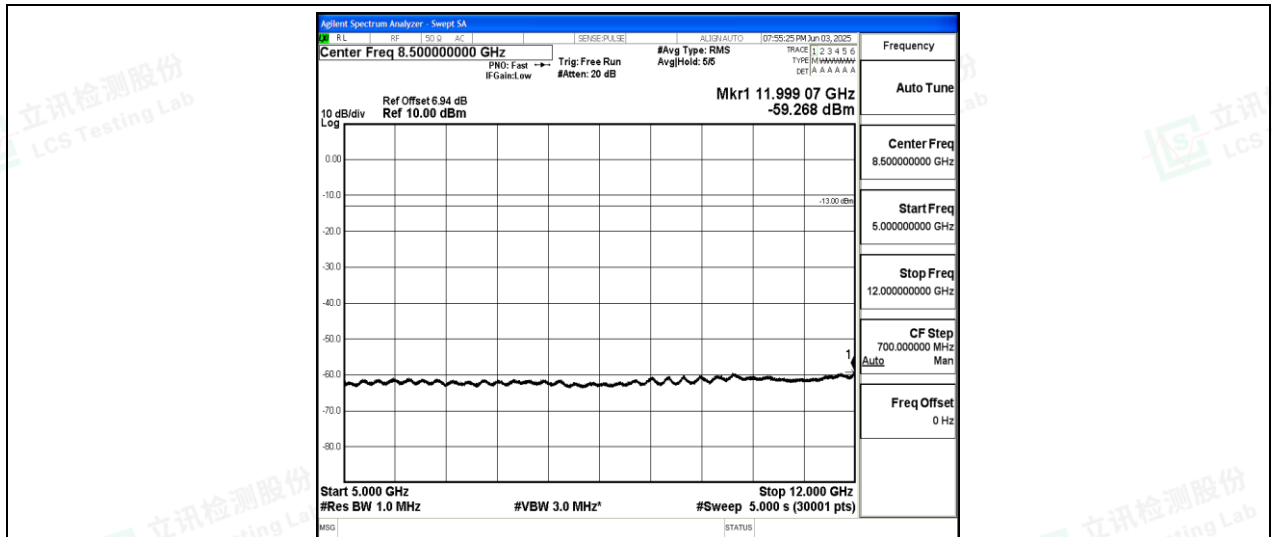

Band26-3MHz-16QAM-26805-1-0-Low-5000-12000--59.27-PASS

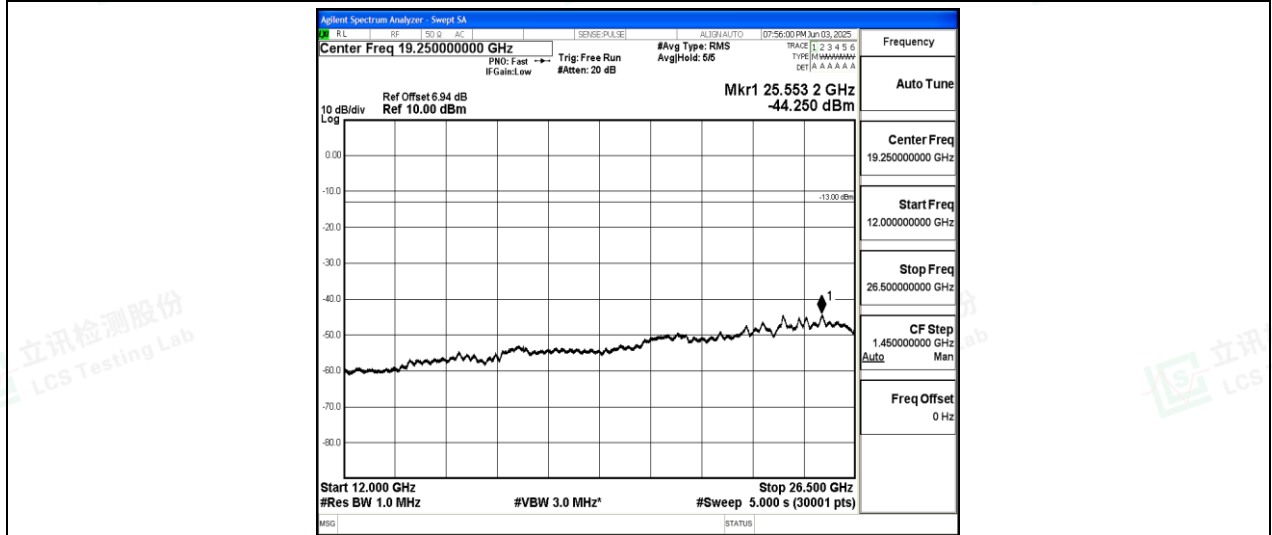

Band26-3MHz-16QAM-26805-1-0-Low-12000-26500--44.25-PASS

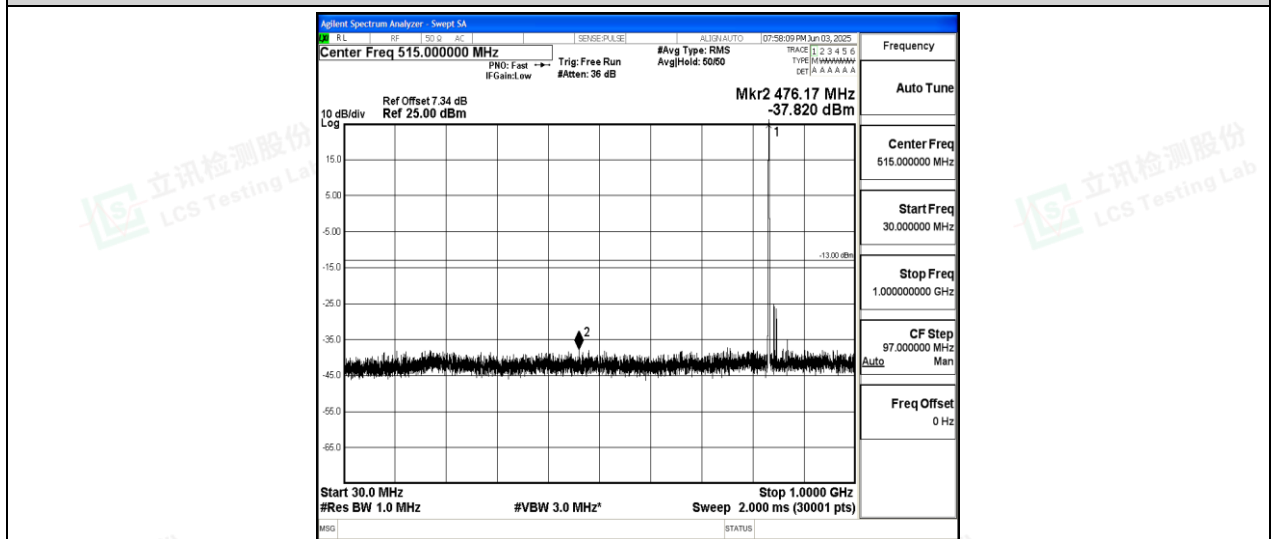

Band26-3MHz-16QAM-26915-1-0-Low-30-1000--37.82-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

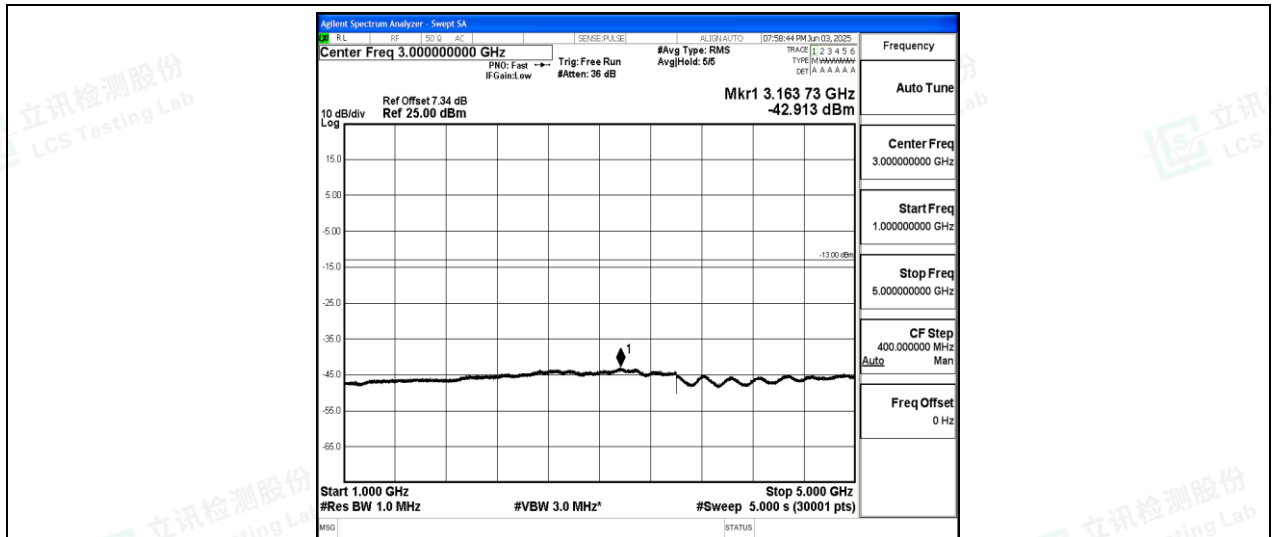

Band26-3MHz-16QAM-26915-1-0-Low-1000-5000--42.91-PASS

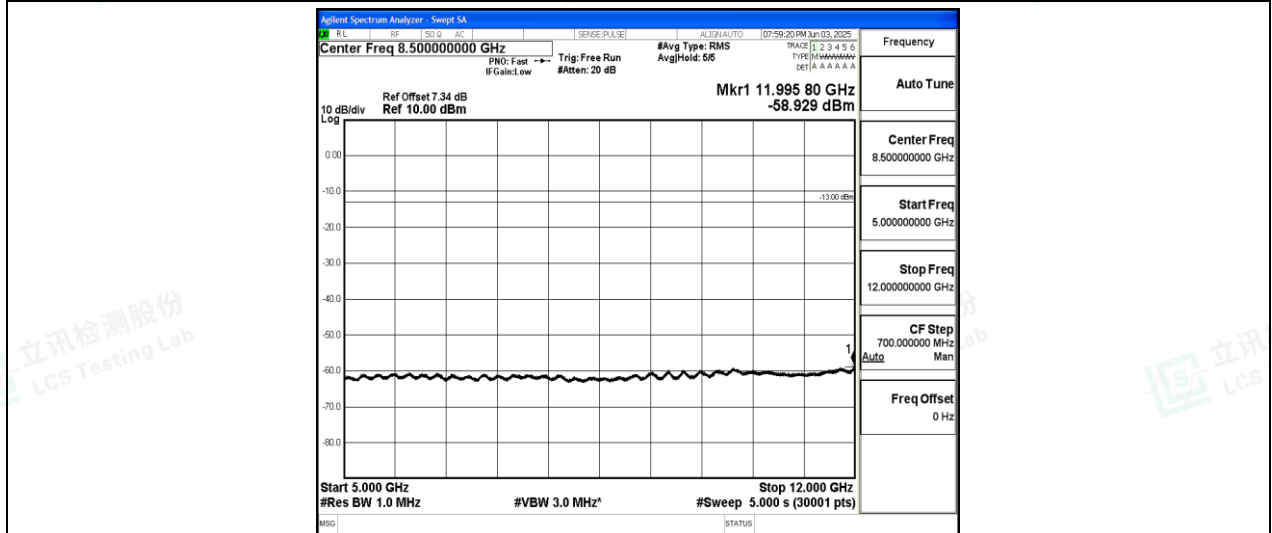

Band26-3MHz-16QAM-26915-1-0-Low-5000-12000--58.93-PASS

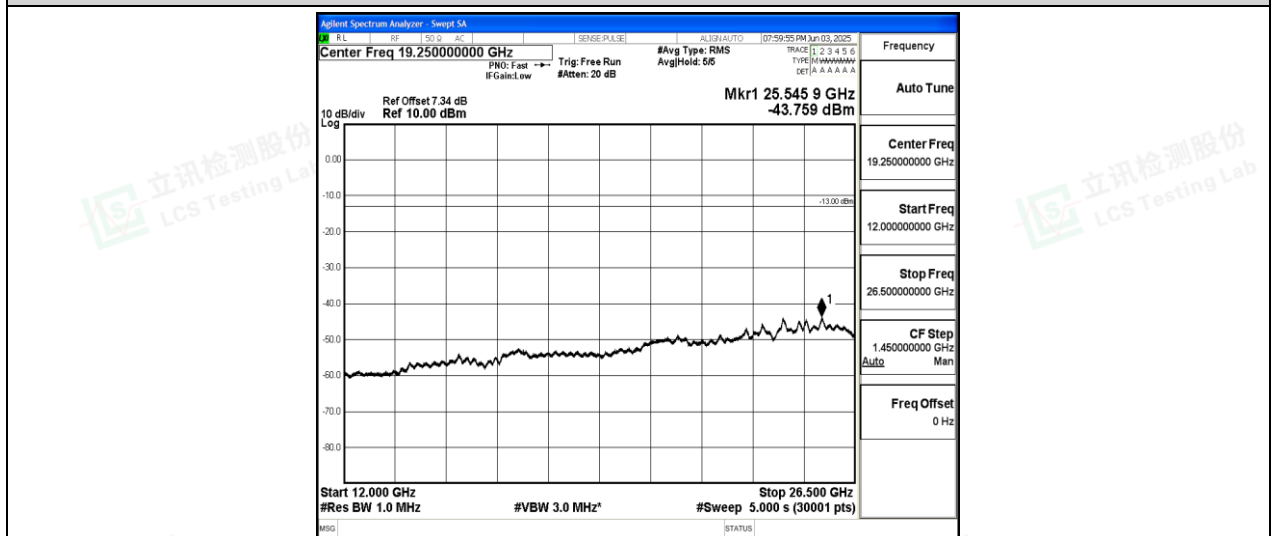

Band26-3MHz-16QAM-26915-1-0-Low-12000-26500--43.76-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

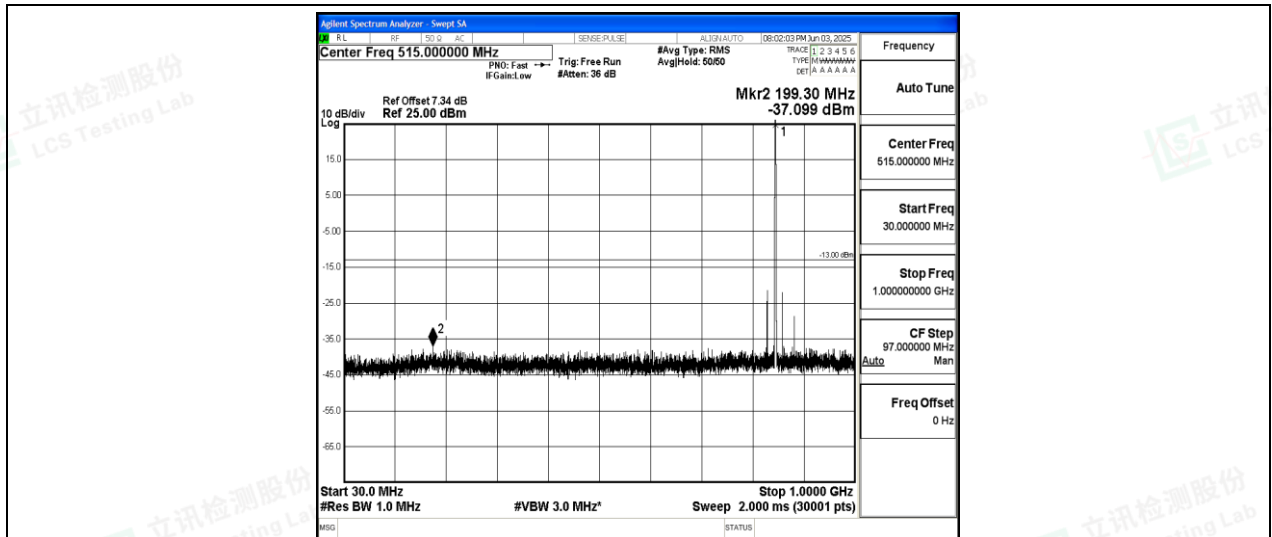

Band26-3MHz-16QAM-27025-1-0-High-30-1000--37.1-PASS

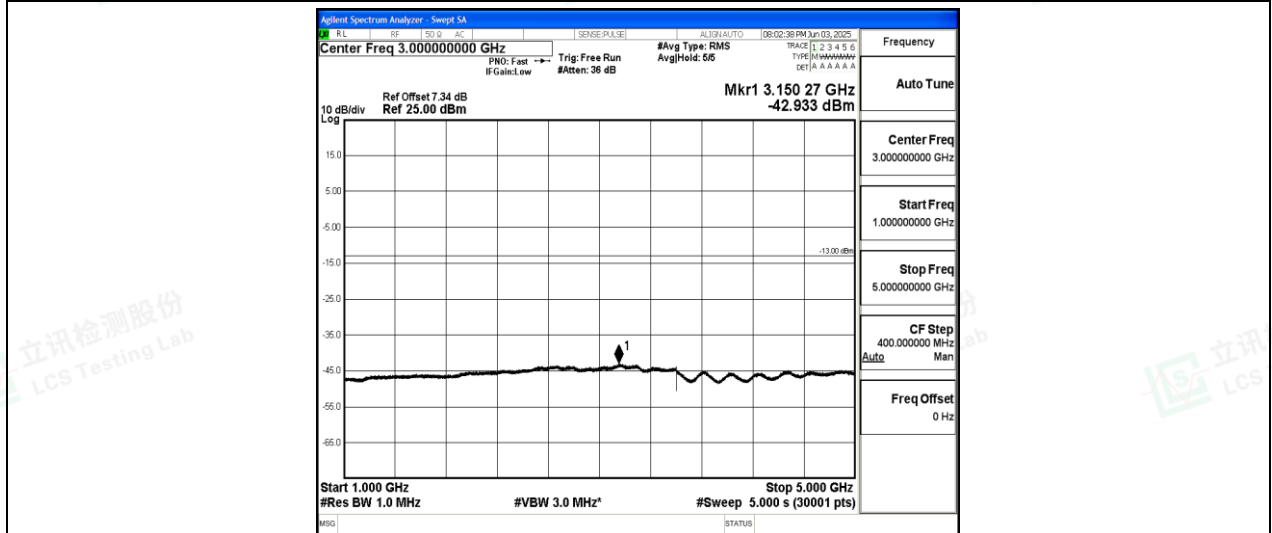

Band26-3MHz-16QAM-27025-1-0-High-1000-5000--42.93-PASS

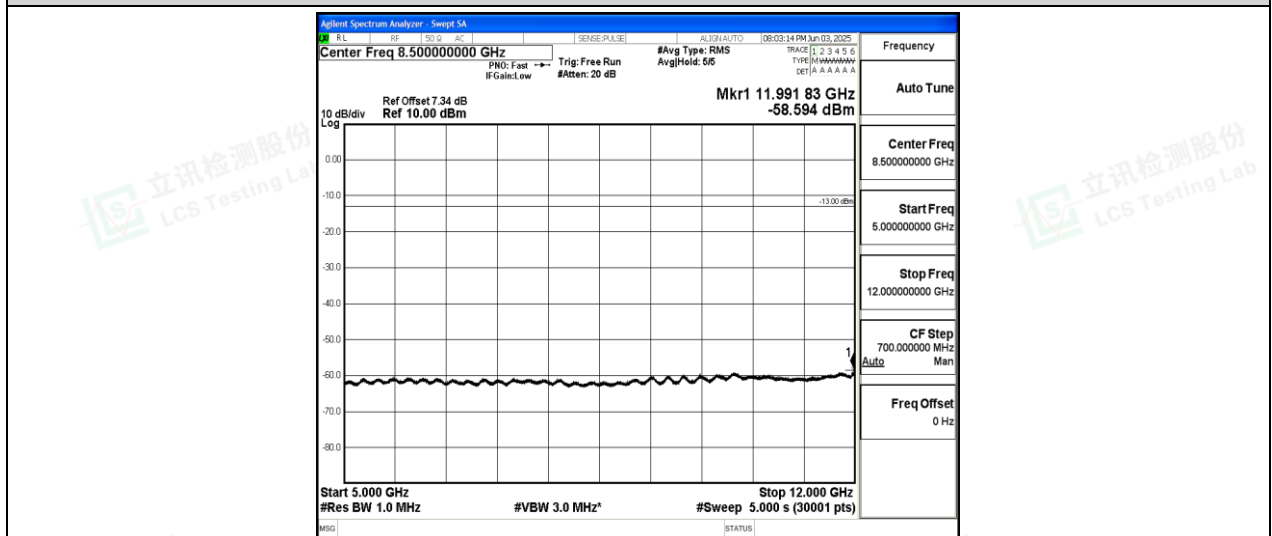

Band26-3MHz-16QAM-27025-1-0-High-5000-12000--58.59-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

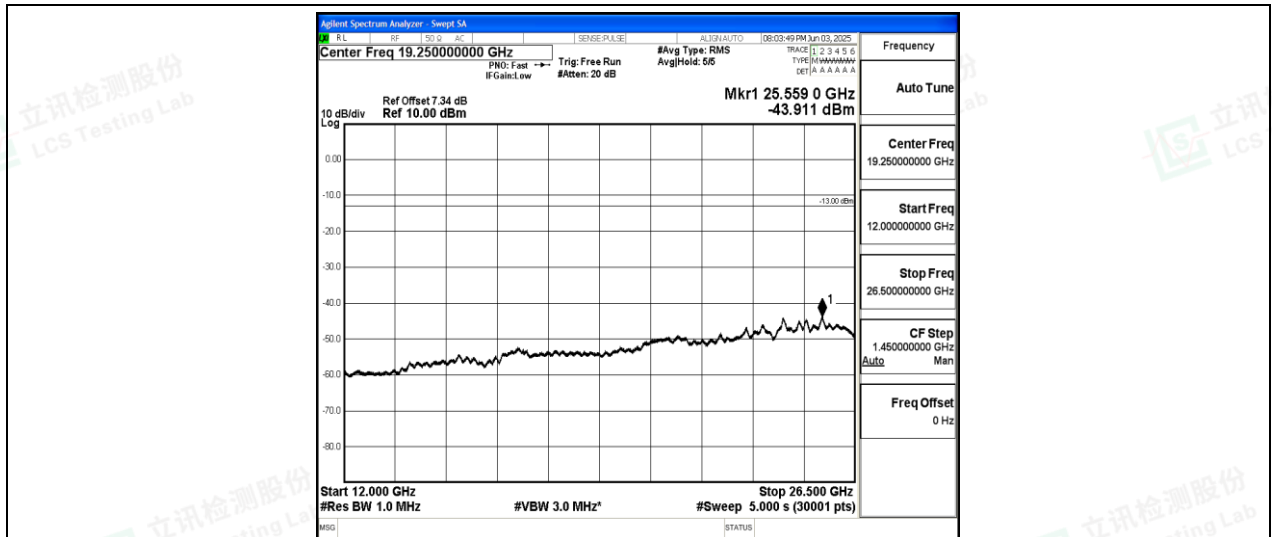

Band26-3MHz-16QAM-27025-1-0-High-12000-26500--43.91-PASS

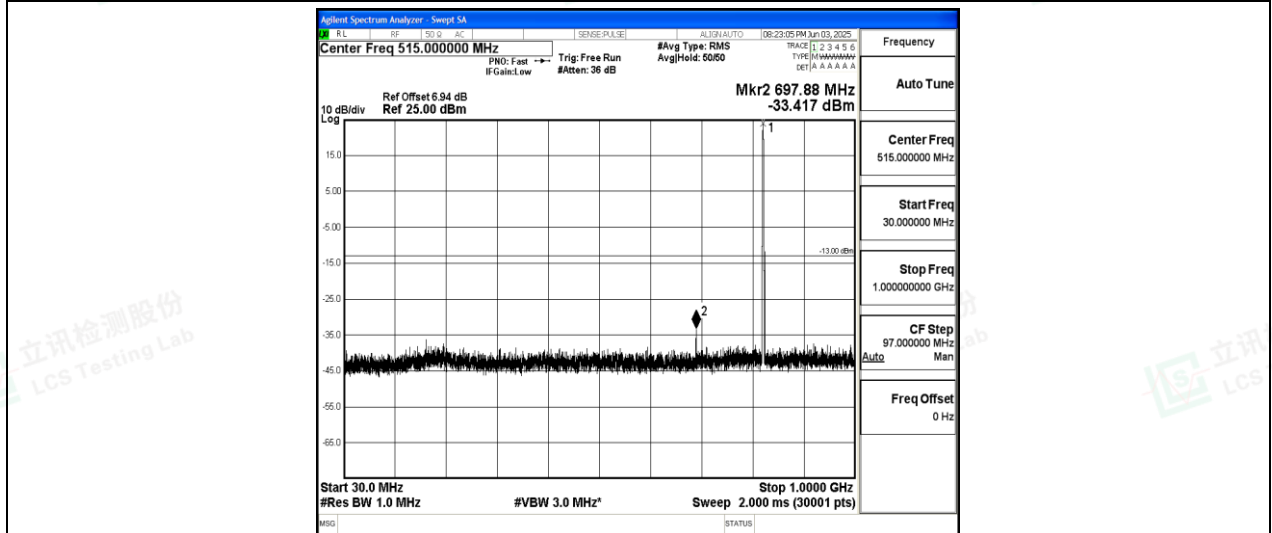

Band26-5MHz-QPSK-26815-1-0-Low-30-1000--33.42-PASS

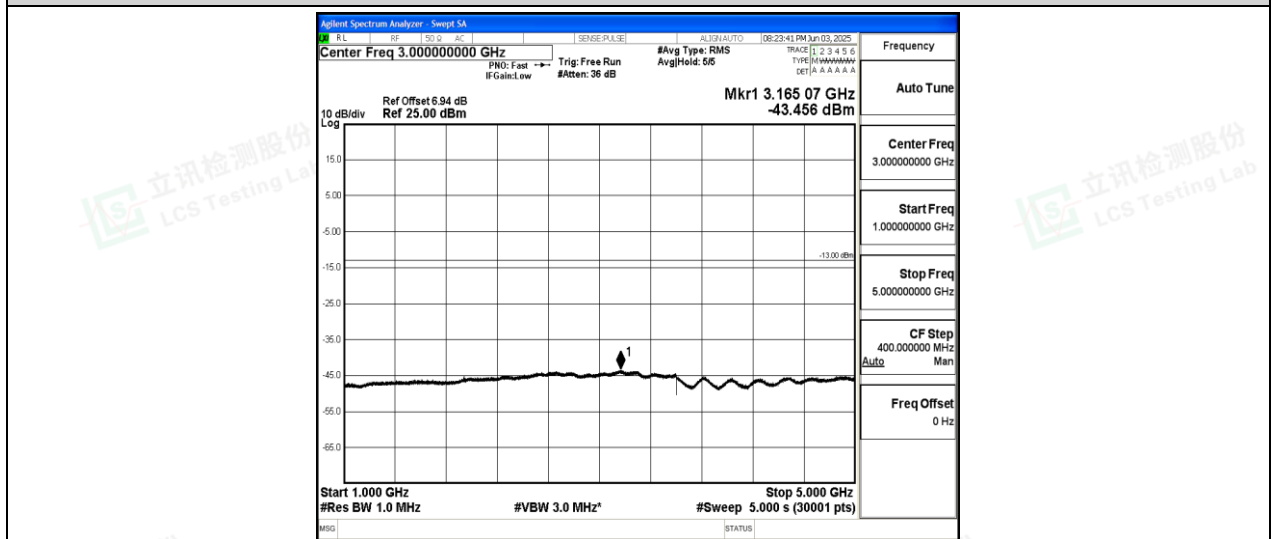

Band26-5MHz-QPSK-26815-1-0-Low-1000-5000--43.46-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

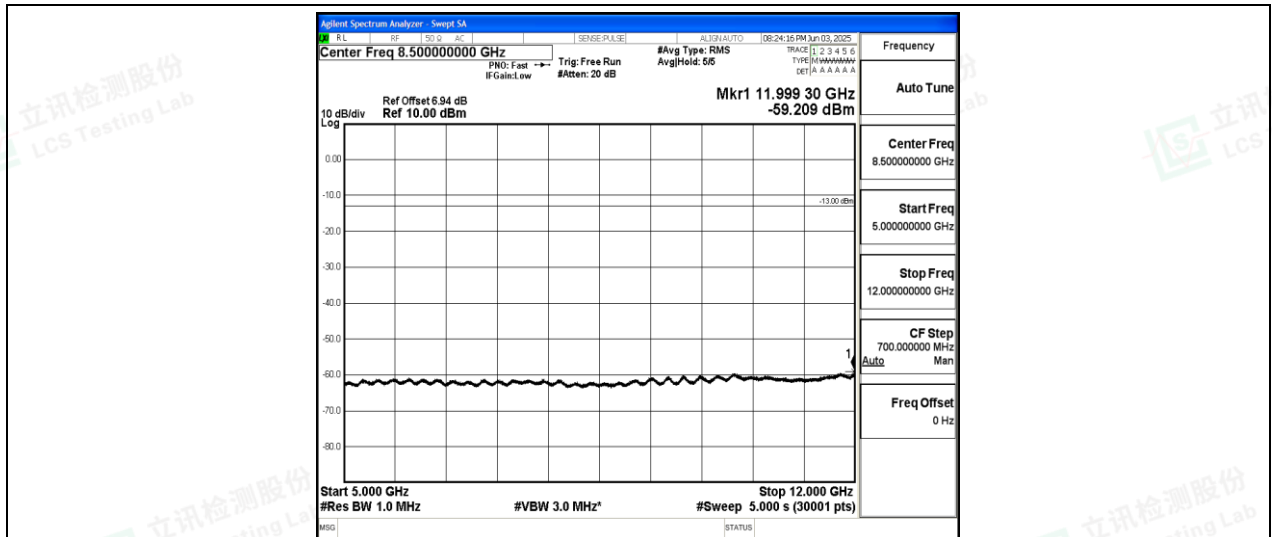

Band26-5MHz-QPSK-26815-1-0-Low-5000-12000--59.21-PASS

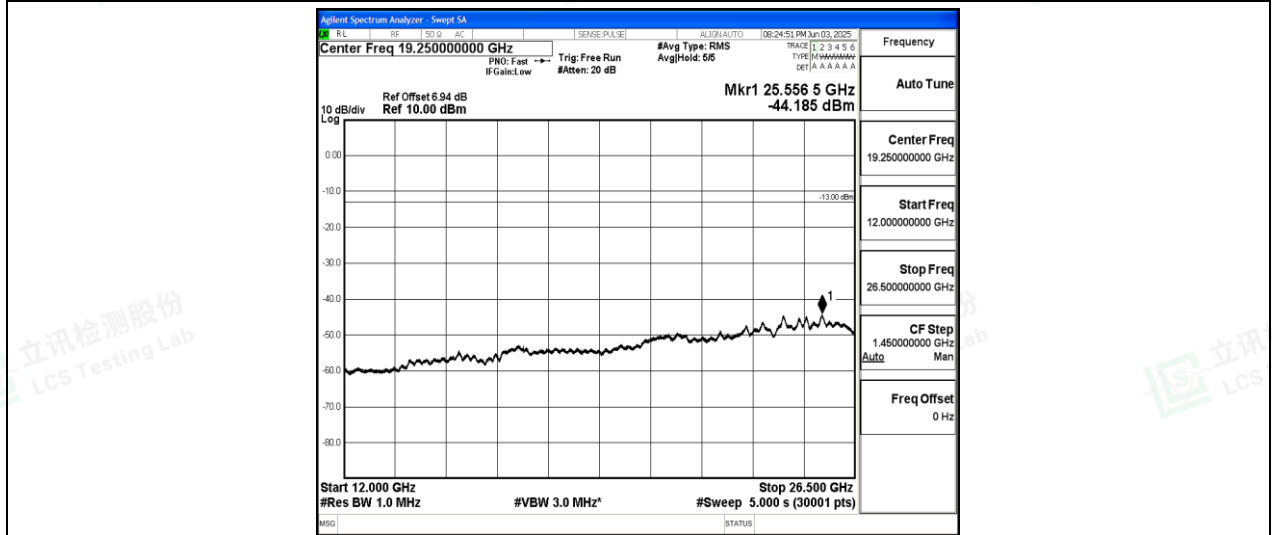

Band26-5MHz-QPSK-26815-1-0-Low-12000-26500--44.19-PASS

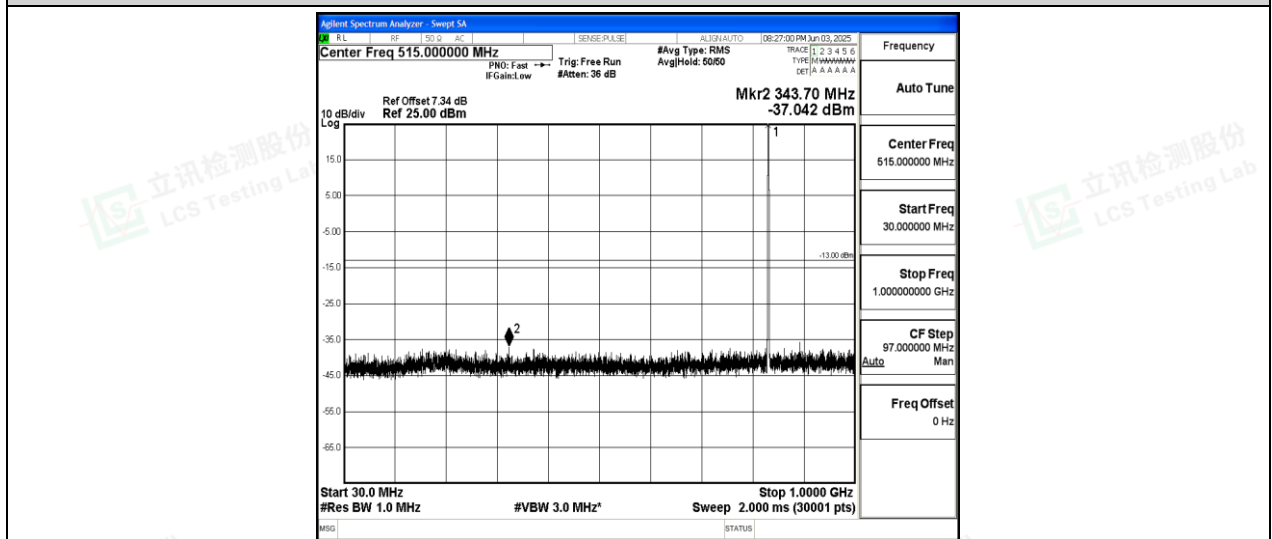

Band26-5MHz-QPSK-26915-1-0-Low-30-1000--37.04-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

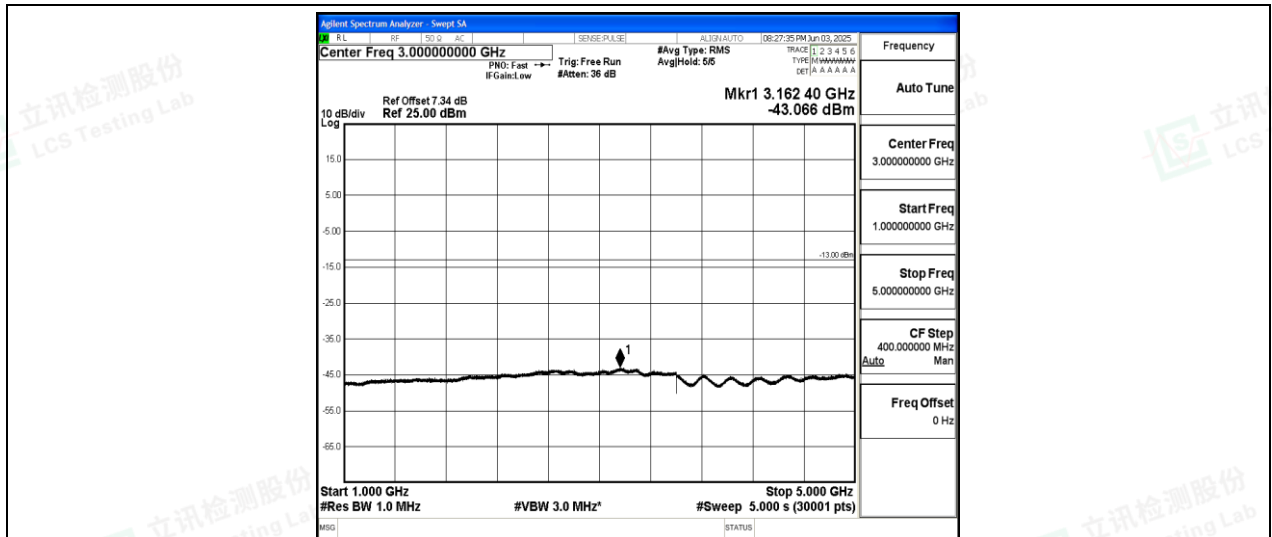

Band26-5MHz-QPSK-26915-1-0-Low-1000-5000--43.07-PASS

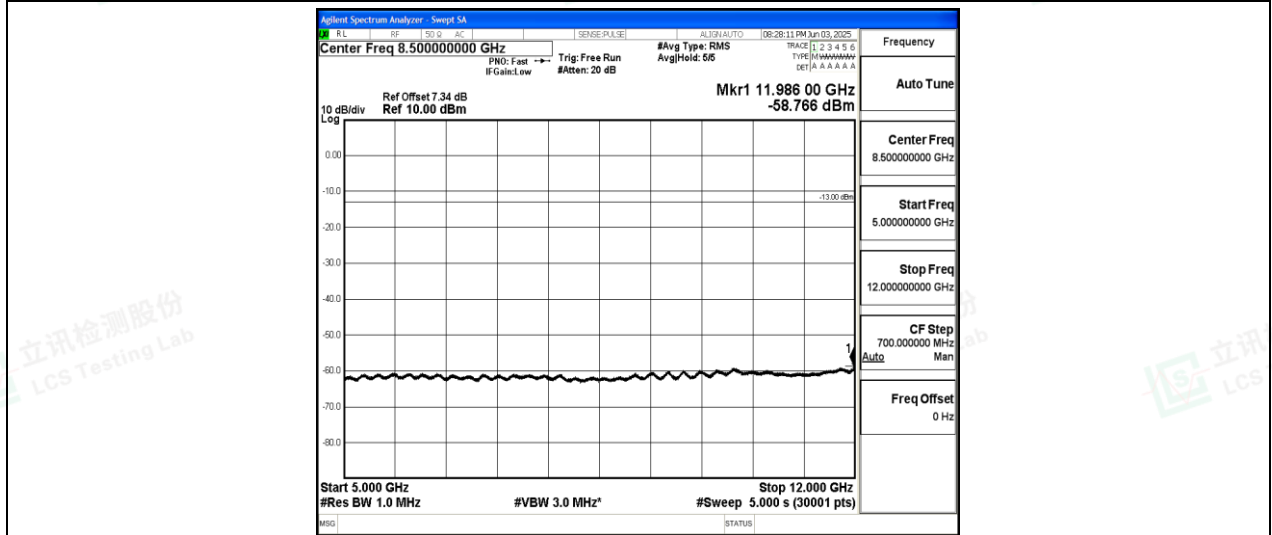

Band26-5MHz-QPSK-26915-1-0-Low-5000-12000--58.77-PASS

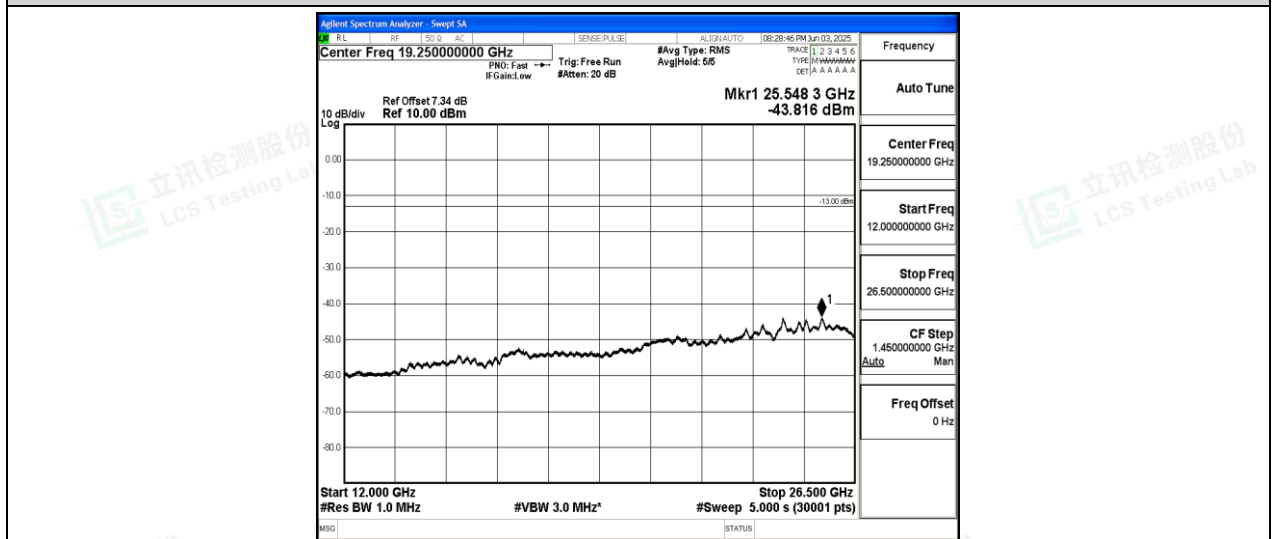

Band26-5MHz-QPSK-26915-1-0-Low-12000-26500--43.82-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

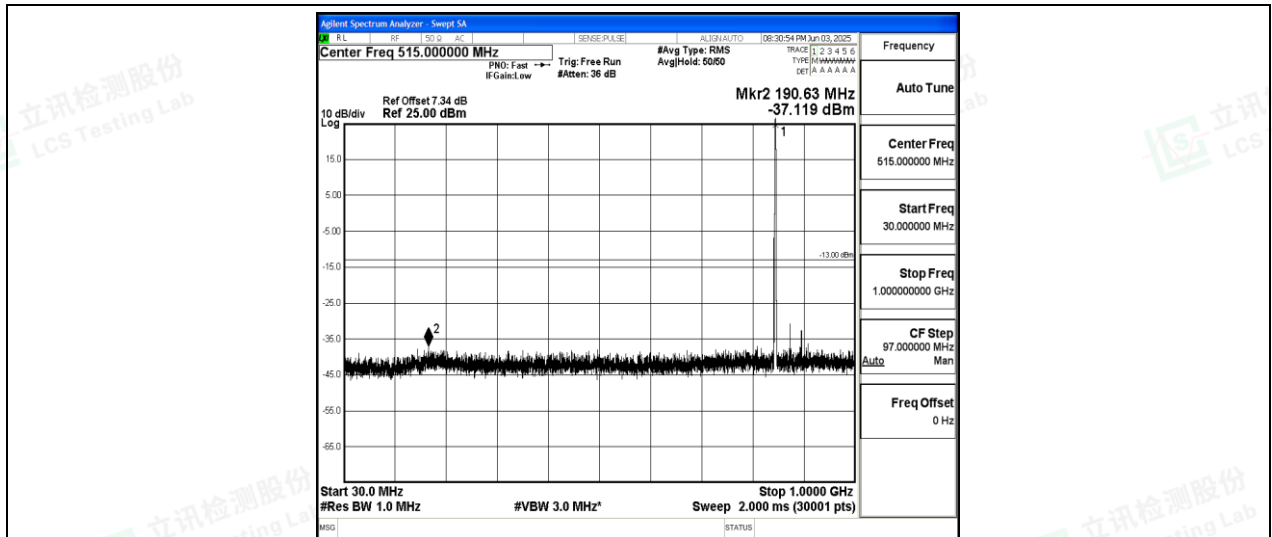

Band26-5MHz-QPSK-27015-1-0-High-30-1000--37.12-PASS

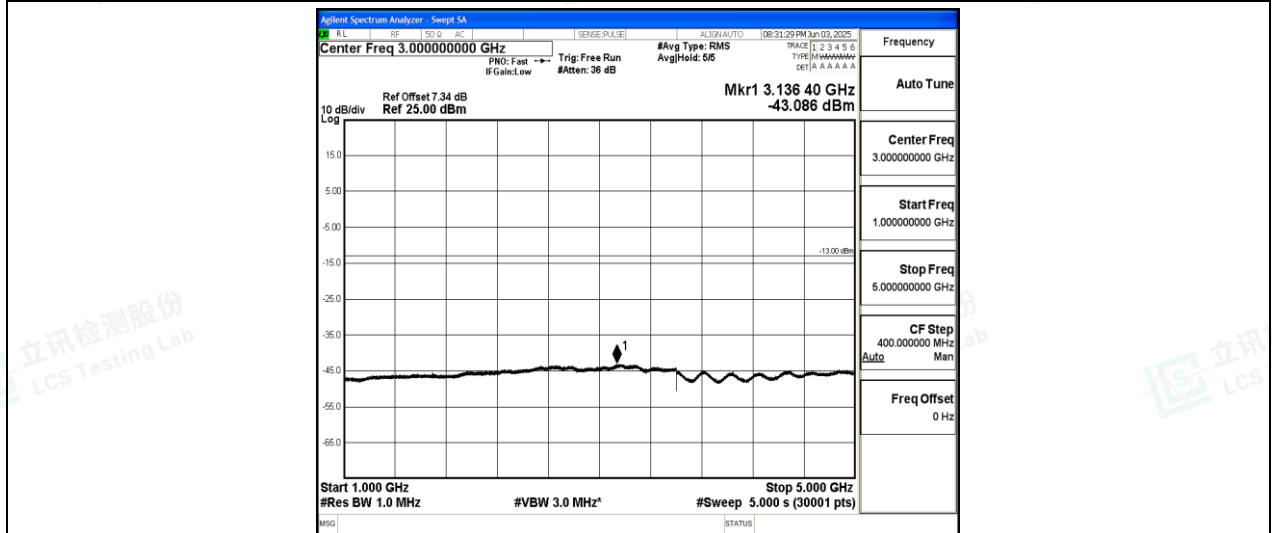

Band26-5MHz-QPSK-27015-1-0-High-1000-5000--43.09-PASS

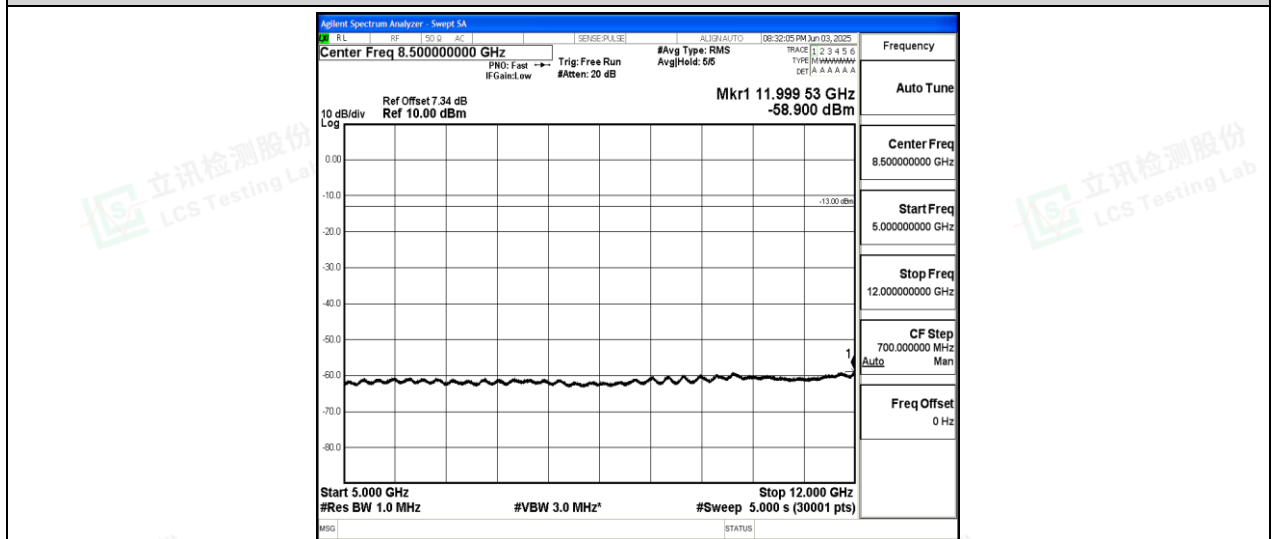

Band26-5MHz-QPSK-27015-1-0-High-5000-12000--58.9-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

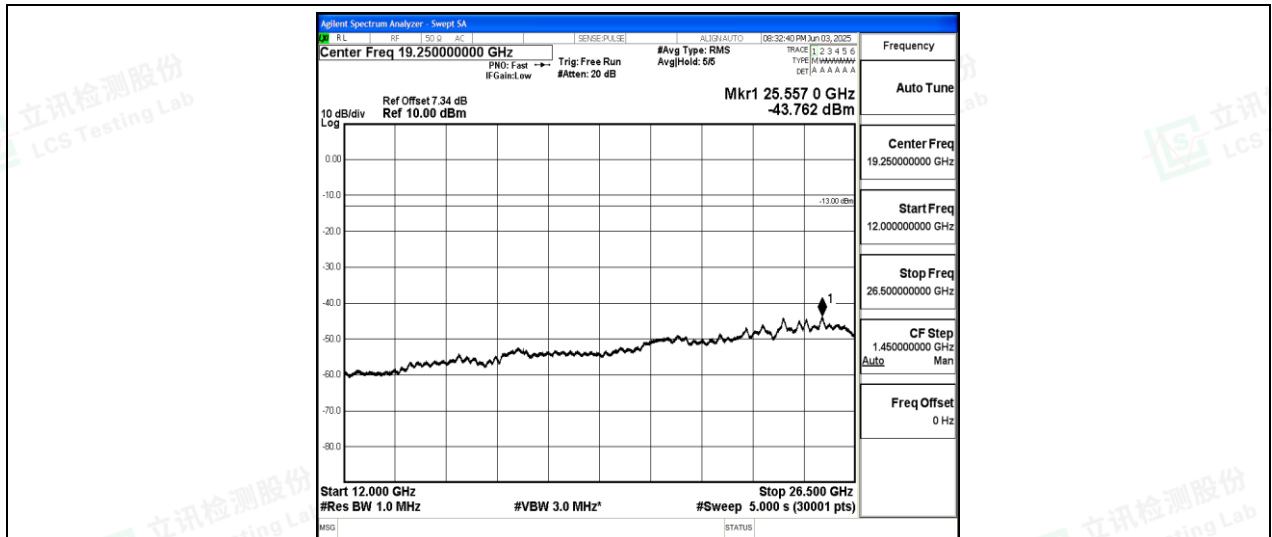

Band26-5MHz-QPSK-27015-1-0-High-12000-26500--43.76-PASS

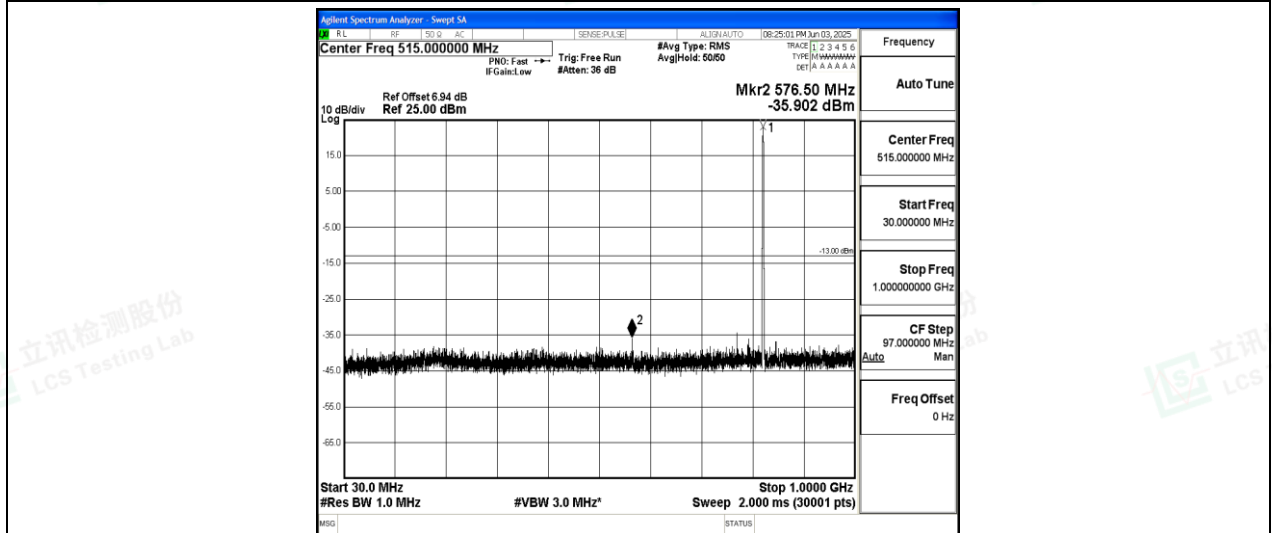

Band26-5MHz-16QAM-26815-1-0-Low-30-1000--35.9-PASS

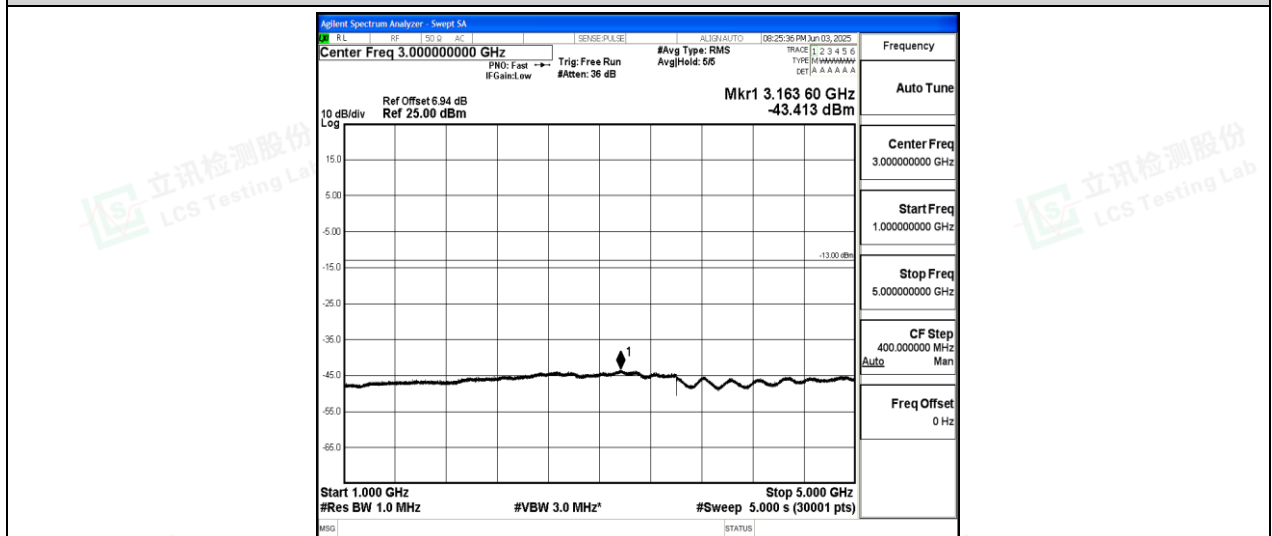

Band26-5MHz-16QAM-26815-1-0-Low-1000-5000--43.41-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

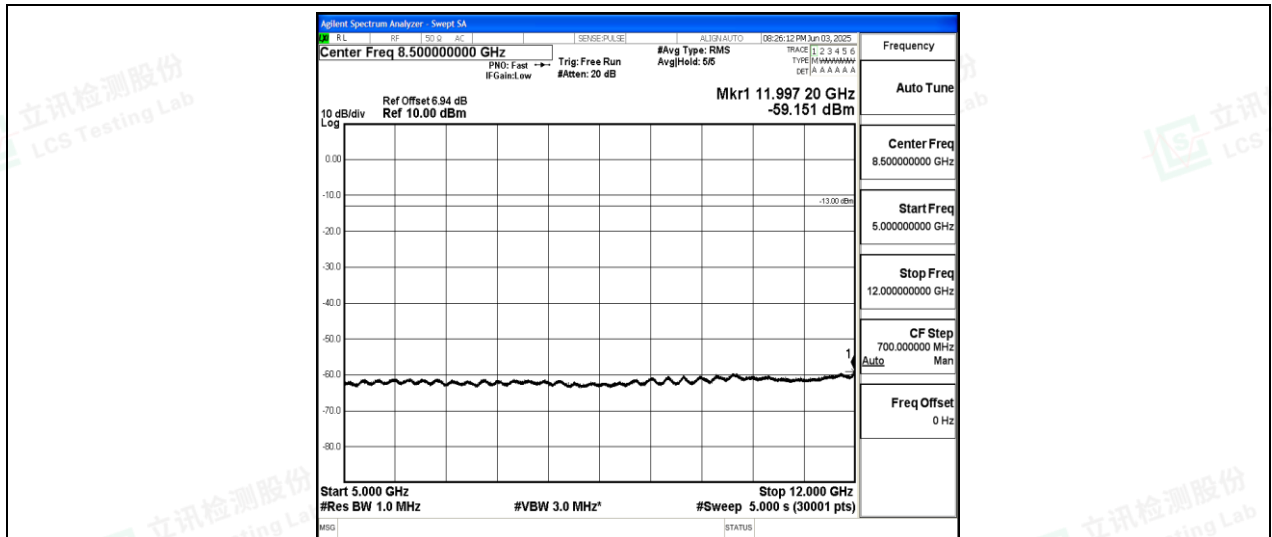

Band26-5MHz-16QAM-26815-1-0-Low-5000-12000--59.15-PASS

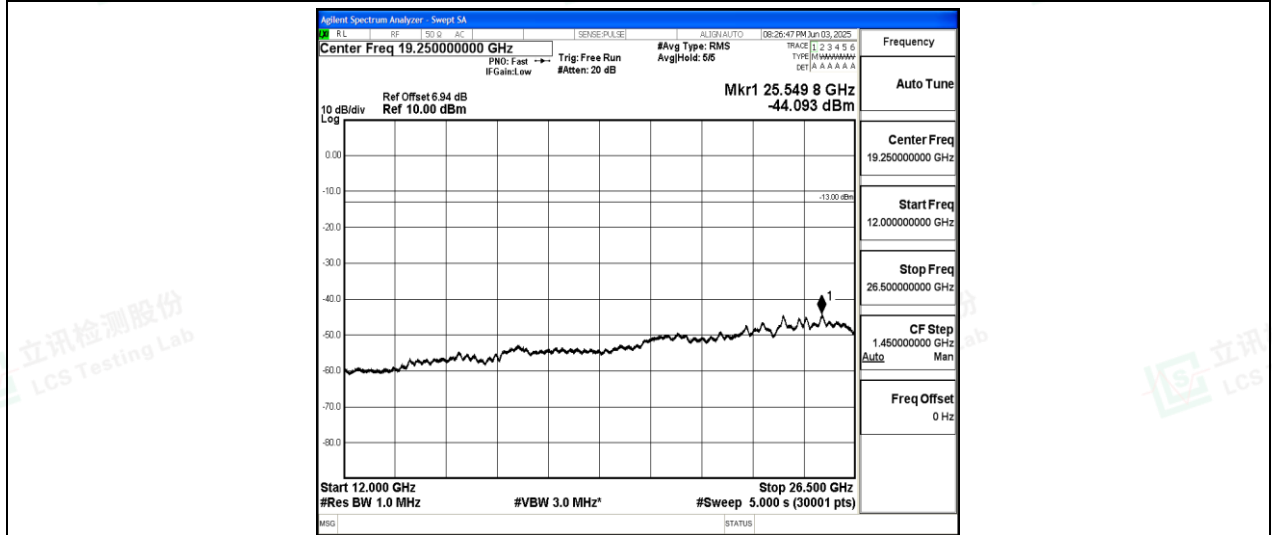

Band26-5MHz-16QAM-26815-1-0-Low-12000-26500--44.09-PASS

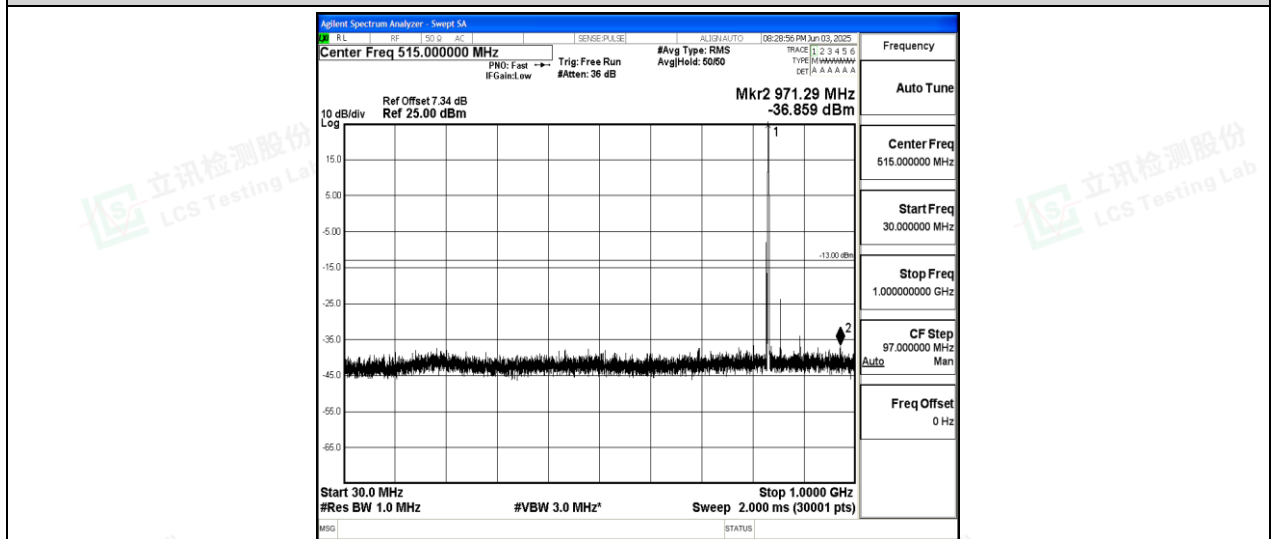

Band26-5MHz-16QAM-26915-1-0-Low-30-1000--36.86-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity