








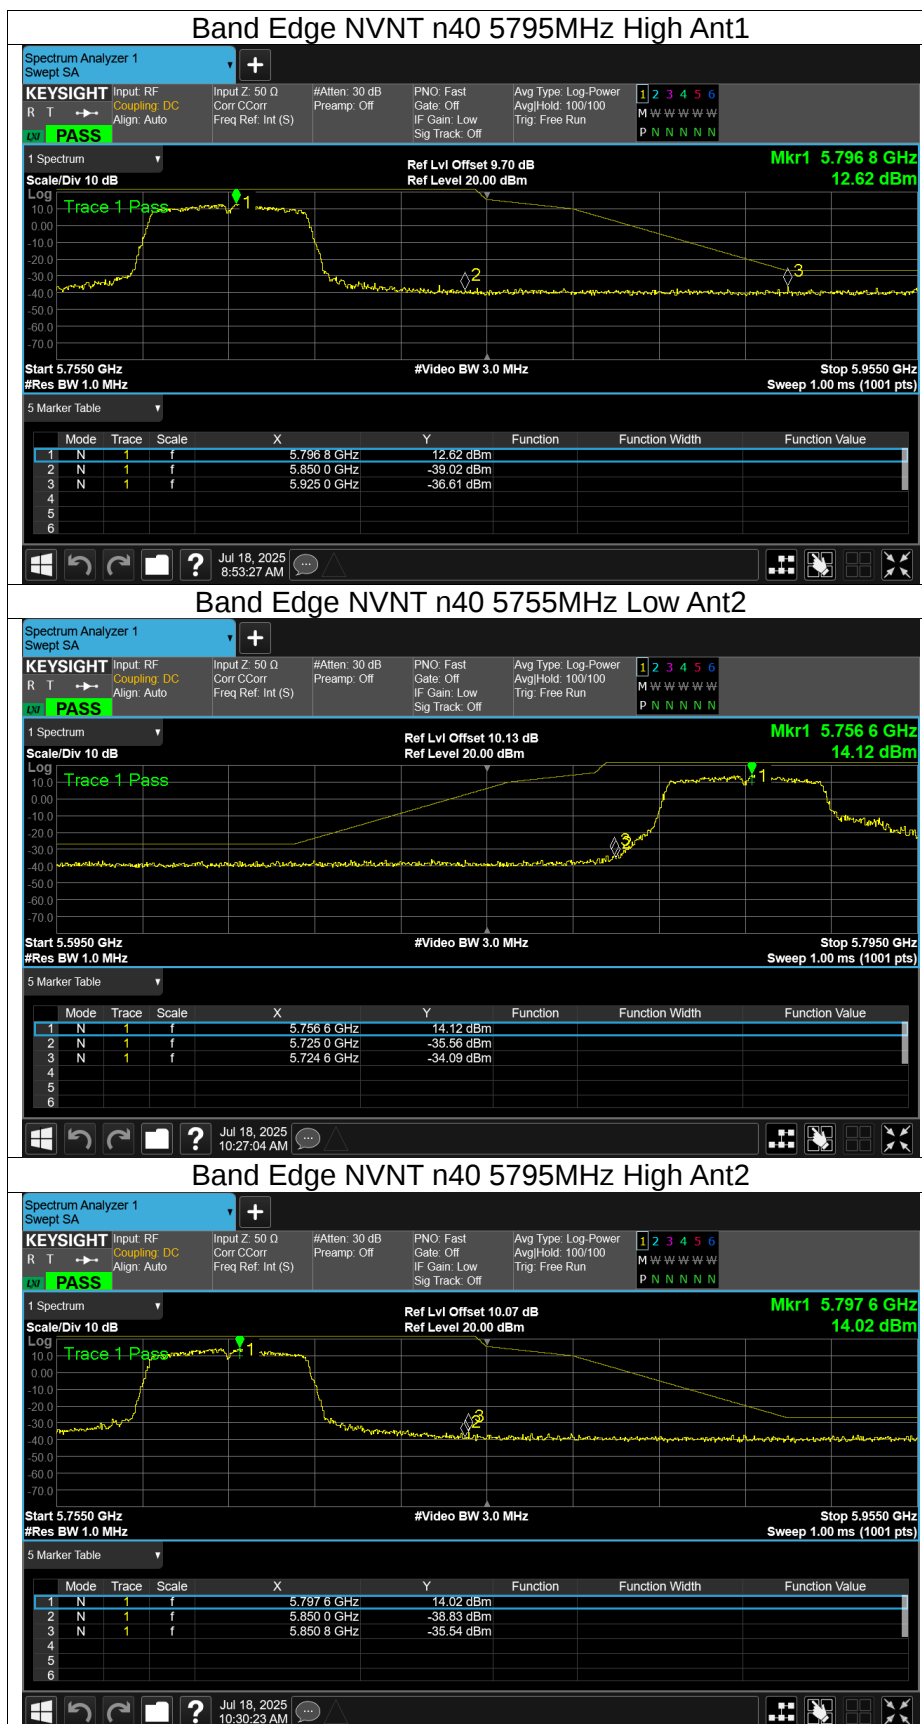


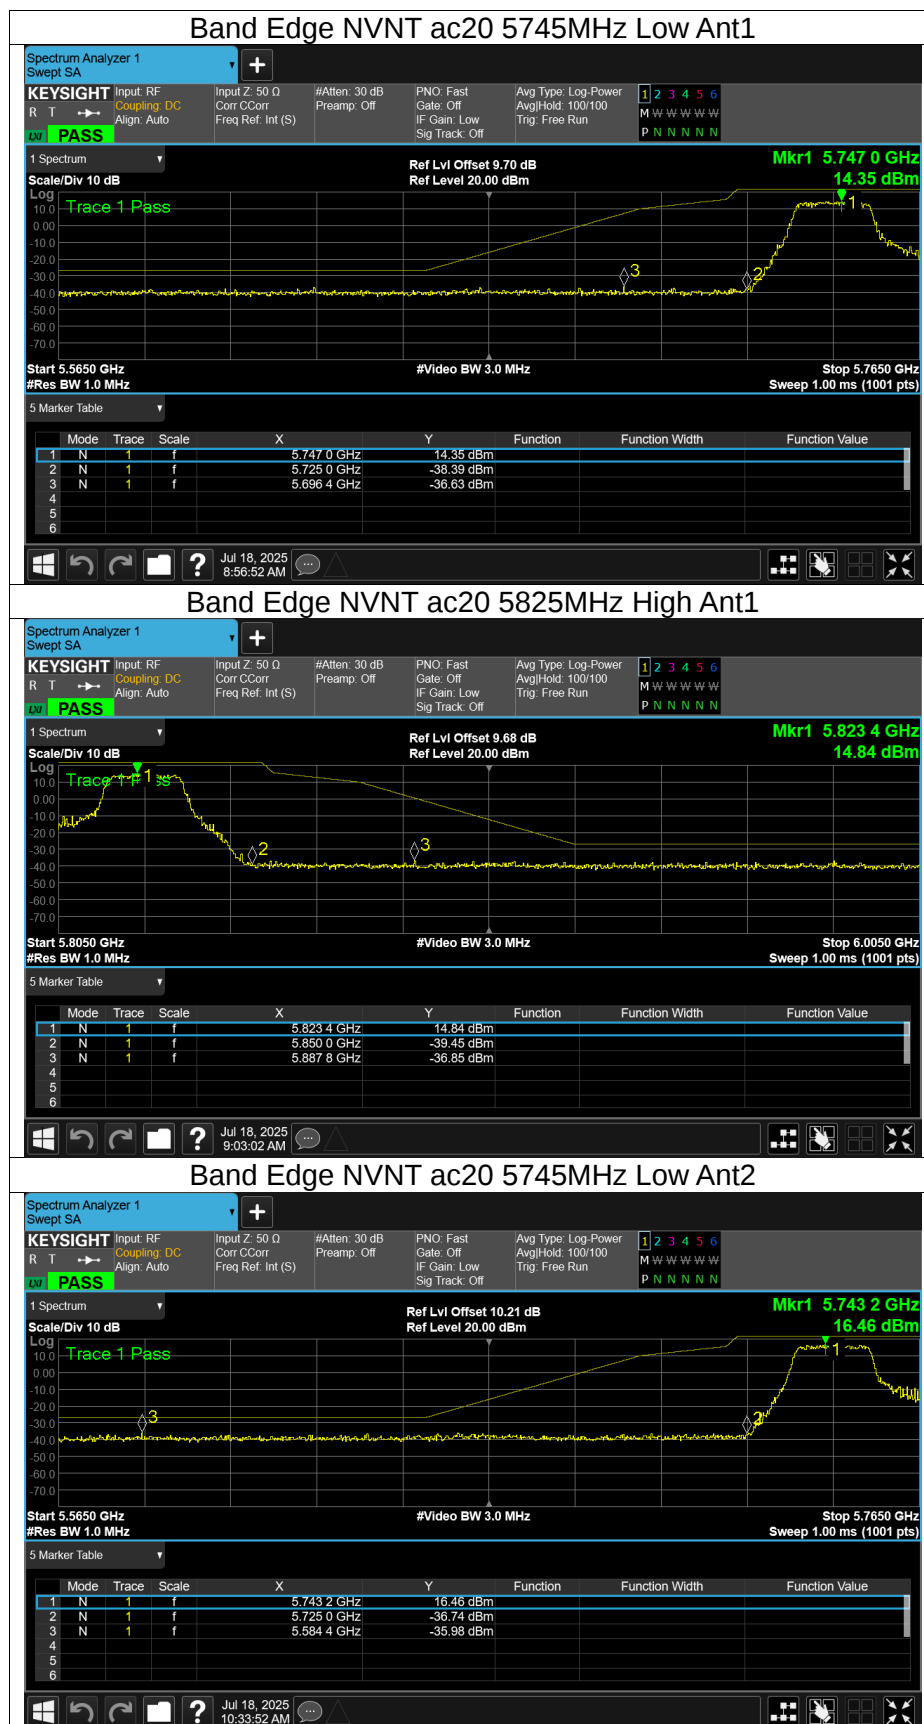


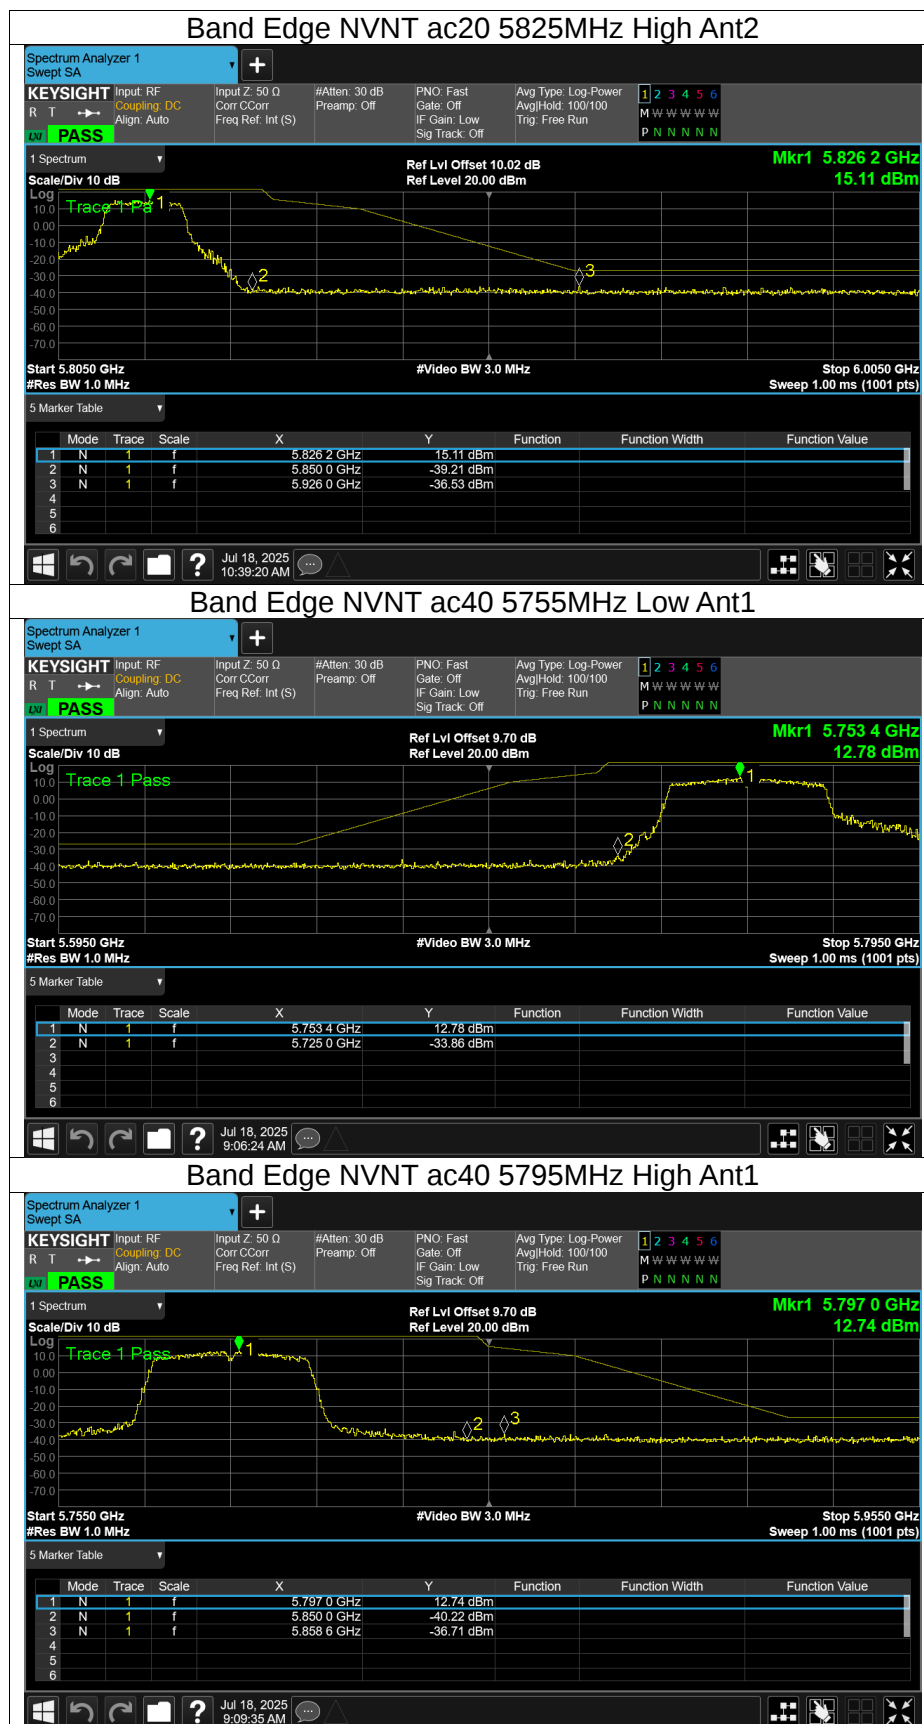


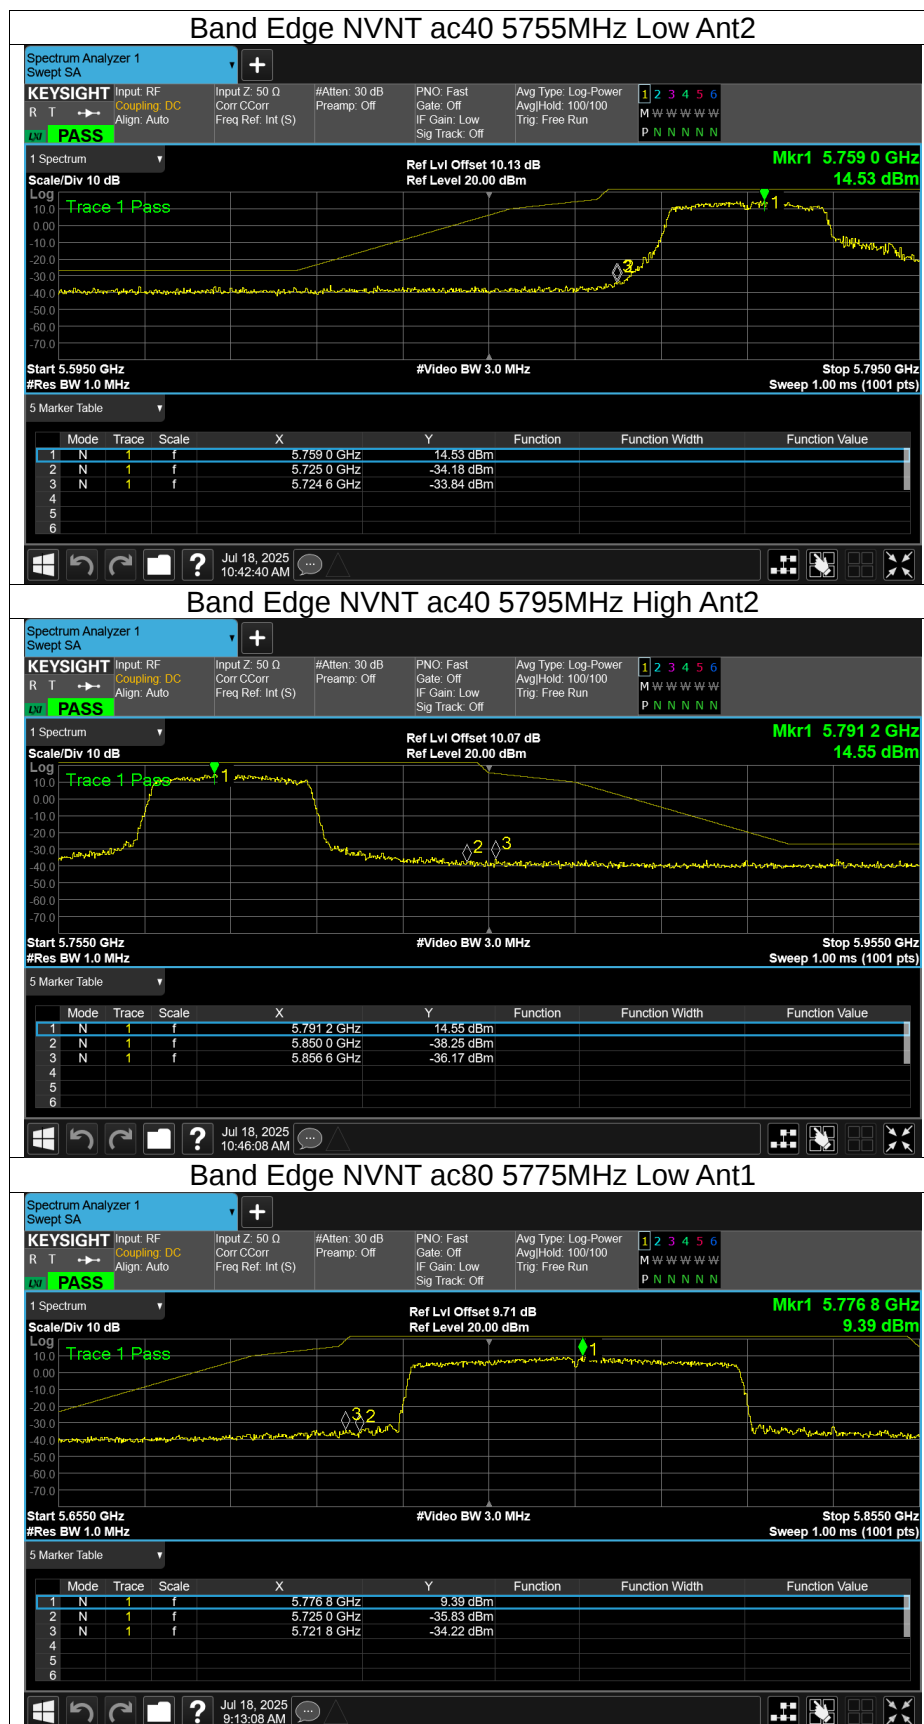

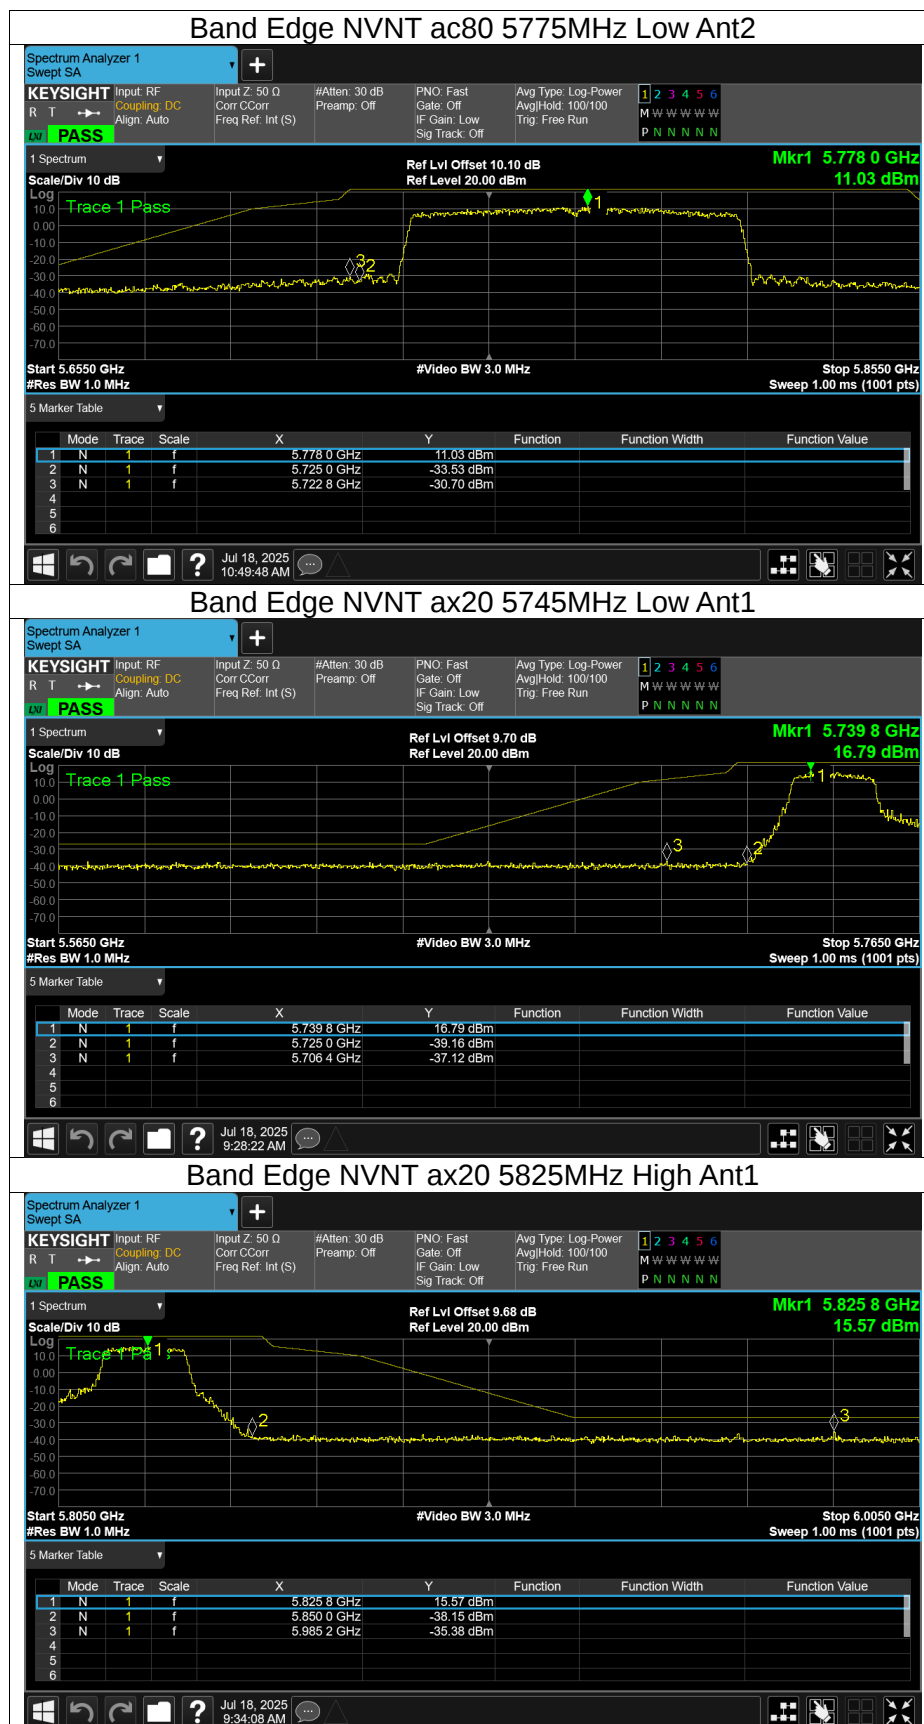

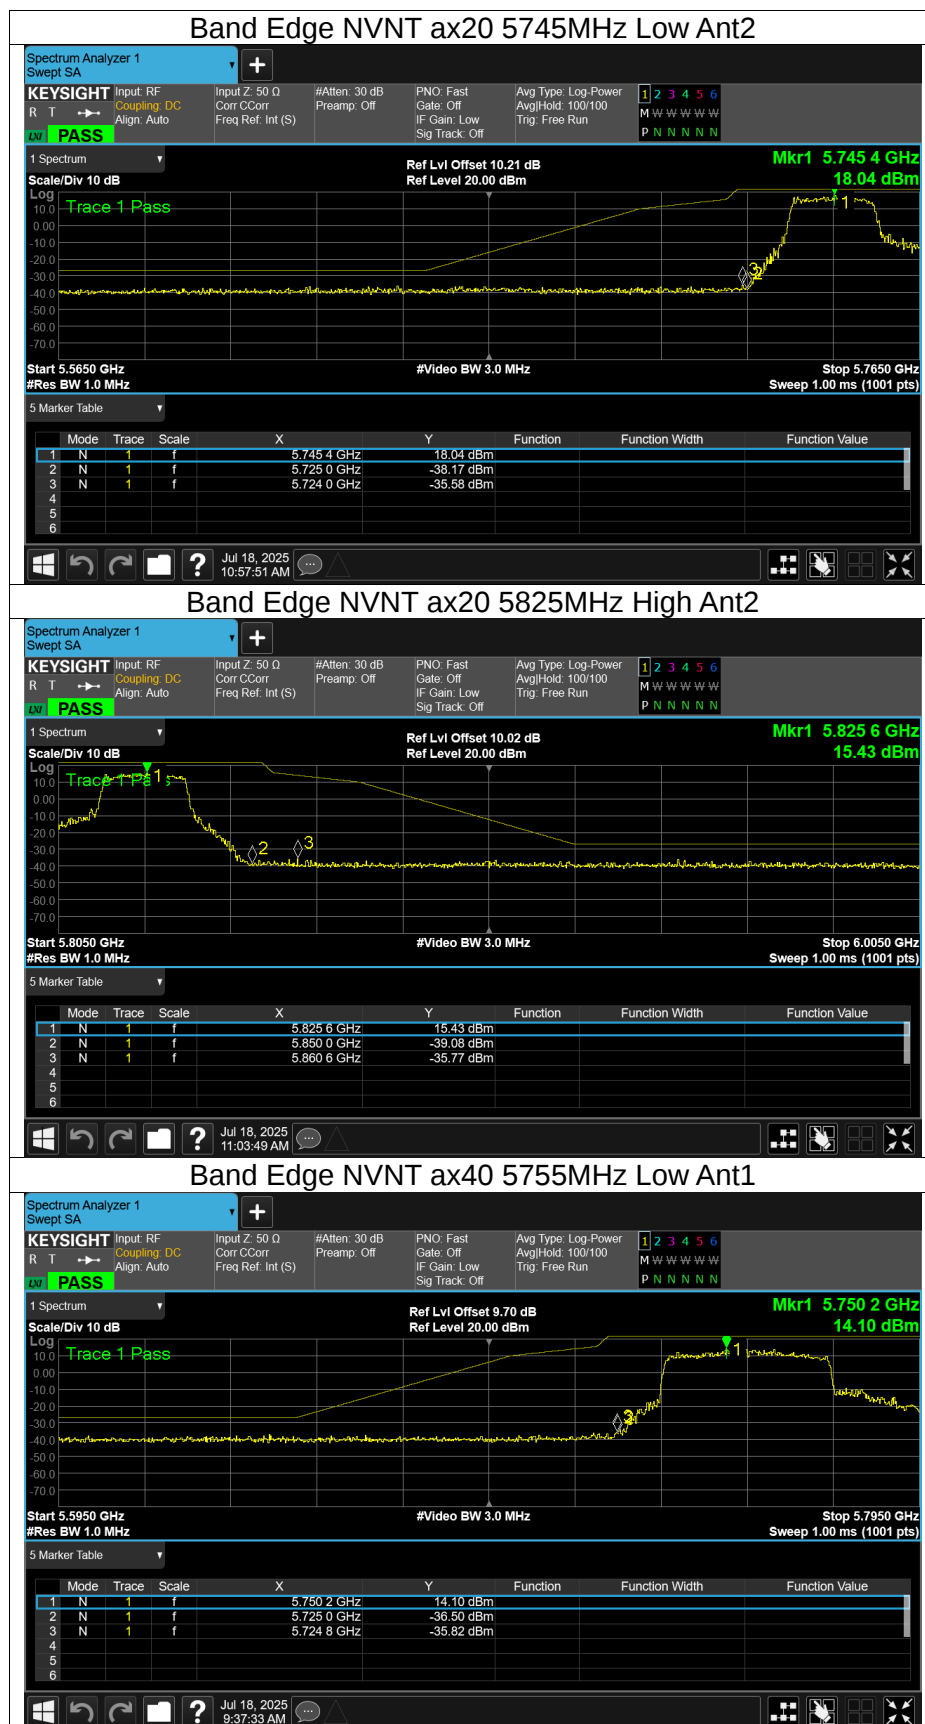

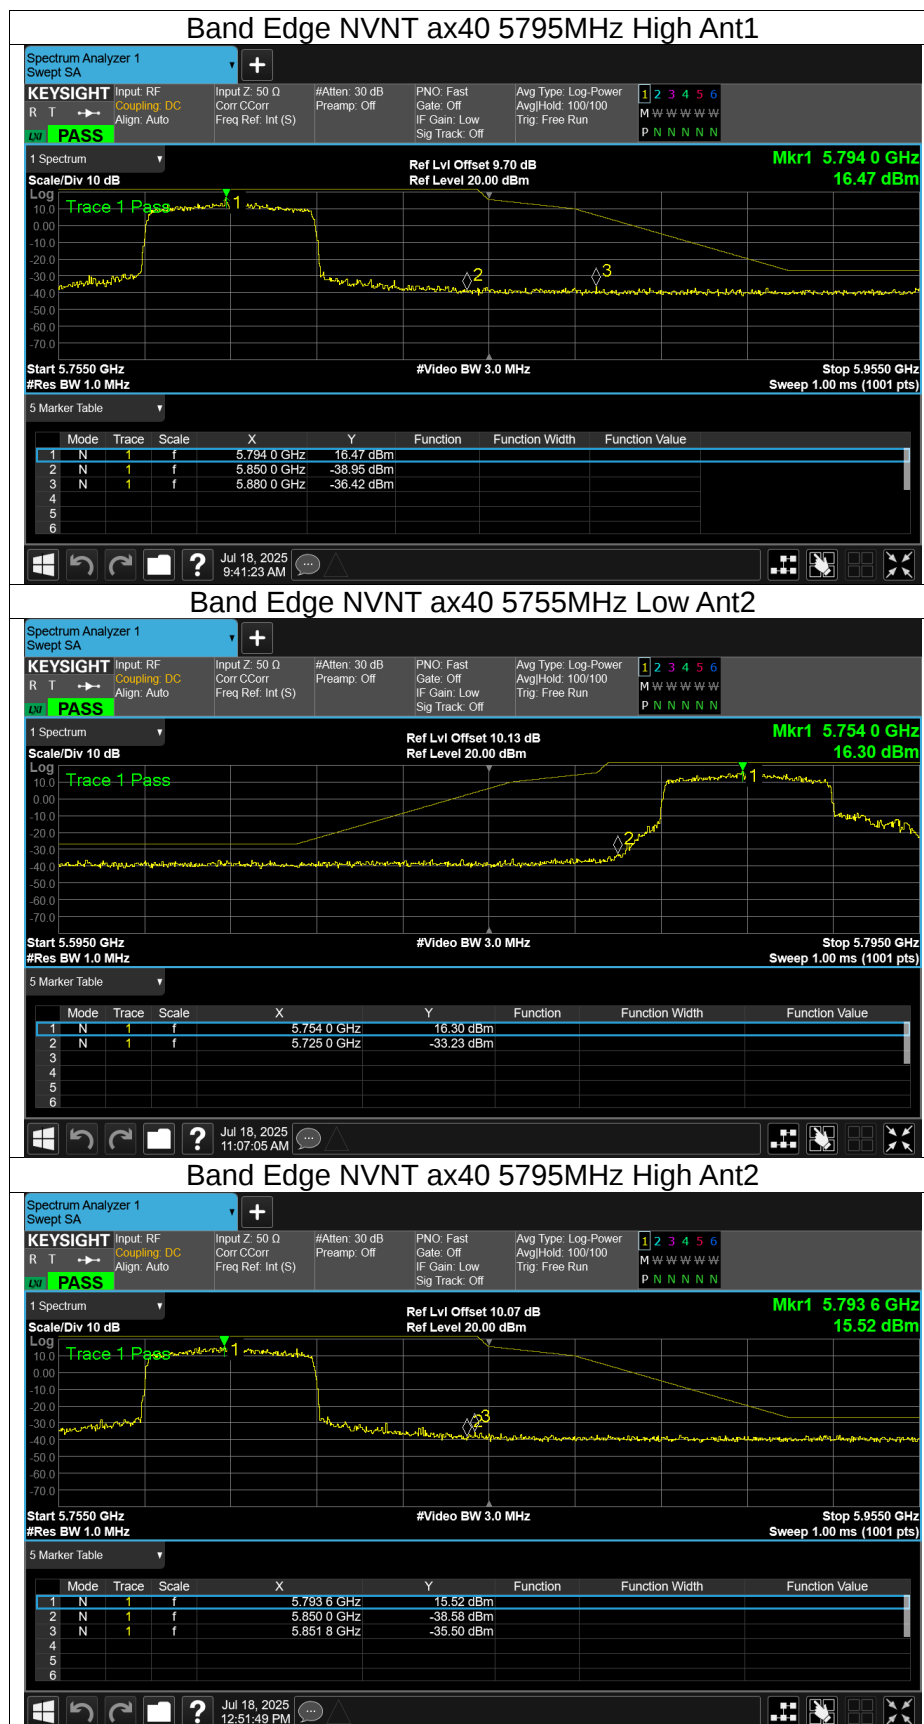

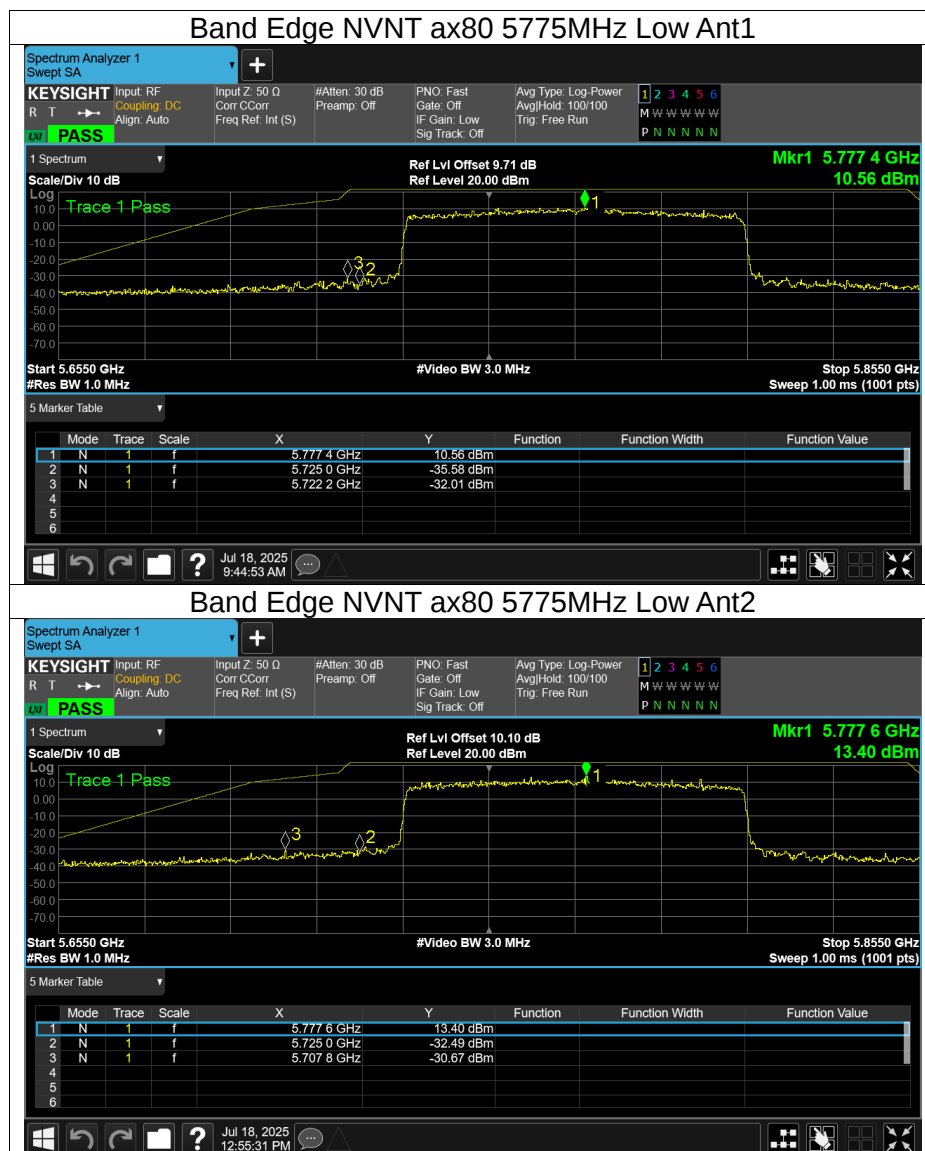



Restrict Band

Condi tion	Mode	Frequ ency (MHz)	Antenn a	Spur Freq (MH z)	Power (dBm)	Gain (dBi)	E (dBu V/m)	Detector	Lim it (dB uV/ m)	Verdi ct
NVNT	a	5745	Ant1	5650	-39.24	5	-34.24	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-49.68	5	-44.68	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-39.8	5	-34.8	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-49.23	5	-44.23	Average	10	Pass
NVNT	a	5745	Ant1	5720	-39.09	5	-34.09	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-48.46	5	-43.46	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-30.8	5	-25.8	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-44.54	5	-39.54	Average	27	Pass
NVNT	a	5825	Ant1	5850	-38.57	5	-33.57	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-48.42	5	-43.42	Average	27	Pass
NVNT	a	5825	Ant1	5855	-40.37	5	-35.37	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-48.82	5	-43.82	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-37.24	5	-32.24	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-49.25	5	-44.25	Average	10	Pass
NVNT	a	5825	Ant1	5925	-40.17	5	-35.17	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-49.47	5	-44.47	Average	-27	Pass
NVNT	a	5745	Ant2	5650	-39.24	5	-34.24	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-48.6	5	-43.6	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-39.18	5	-34.18	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-48.12	5	-43.12	Average	10	Pass
NVNT	a	5745	Ant2	5720	-33.66	5	-28.66	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-45.89	5	-40.89	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-27.3	5	-22.3	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-39.87	5	-34.87	Average	27	Pass
NVNT	a	5825	Ant2	5850	-37.71	5	-32.71	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-47.71	5	-42.71	Average	27	Pass
NVNT	a	5825	Ant2	5855	-37.67	5	-32.67	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-47.83	5	-42.83	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-39.82	5	-34.82	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-48.72	5	-43.72	Average	10	Pass
NVNT	a	5825	Ant2	5925	-40.14	5	-35.14	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-48.55	5	-43.55	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-41.29	5	-36.29	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-49.88	5	-44.88	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-40.35	5	-35.35	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-49.5	5	-44.5	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-40.69	5	-35.69	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-49.38	5	-44.38	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-38.09	5	-33.09	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-48.97	5	-43.97	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-37.97	5	-32.97	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-48.94	5	-43.94	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-41.61	5	-36.61	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-49.26	5	-44.26	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-40.52	5	-35.52	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-49.51	5	-44.51	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-40.91	5	-35.91	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-49.63	5	-44.63	Average	-27	Pass
NVNT	n20	5745	Ant2	5650	-38.51	5	-33.51	Peak	-27	Pass



NVNT	n20	5745	Ant2	5650	-48.87	5	-43.87	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-39.79	5	-34.79	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-48.66	5	-43.66	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-37.16	5	-32.16	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-47.91	5	-42.91	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-37.95	5	-32.95	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-47.02	5	-42.02	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-38.9	5	-33.9	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-48.45	5	-43.45	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-38.57	5	-33.57	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-48.68	5	-43.68	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-37.57	5	-32.57	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-48.9	5	-43.9	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-39.49	5	-34.49	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-49.09	5	-44.09	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-39.58	5	-34.58	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-49.47	5	-44.47	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-39.78	5	-34.78	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-49.27	5	-44.27	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-37.34	5	-32.34	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-48.39	5	-43.39	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-36.64	5	-31.64	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-44.2	5	-39.2	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-38.44	5	-33.44	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-49.19	5	-44.19	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-40.19	5	-35.19	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-49.35	5	-44.35	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-40.49	5	-35.49	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-49.06	5	-44.06	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-41.21	5	-36.21	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-49.25	5	-44.25	Average	-27	Pass
NVNT	n40	5755	Ant2	5650	-38.27	5	-33.27	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-48.18	5	-43.18	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-39.12	5	-34.12	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-47.93	5	-42.93	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-38.34	5	-33.34	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-46.72	5	-41.72	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-32.37	5	-27.37	Peak	27	Pass
NVNT	n40	5755	Ant2	5725	-42.87	5	-37.87	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-40.74	5	-35.74	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-48.29	5	-43.29	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-39.8	5	-34.8	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-48.03	5	-43.03	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-39.71	5	-34.71	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-48.17	5	-43.17	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-39.21	5	-34.21	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-48.84	5	-43.84	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-41.02	5	-36.02	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-49.36	5	-44.36	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-38.85	5	-33.85	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-49.31	5	-44.31	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-39.83	5	-34.83	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-48.7	5	-43.7	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-40.03	5	-35.03	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-47.93	5	-42.93	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-38.41	5	-33.41	Peak	27	Pass



NVNT	ac20	5825	Ant1	5850	-48.69	5	-43.69	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-38.51	5	-33.51	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-48.64	5	-43.64	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-39.98	5	-34.98	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-49.18	5	-44.18	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-38.4	5	-33.4	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-49.3	5	-44.3	Average	-27	Pass
NVNT	ac20	5745	Ant2	5650	-38.1	5	-33.1	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-48.5	5	-43.5	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-38.69	5	-33.69	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-48.04	5	-43.04	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-38.44	5	-33.44	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-47.65	5	-42.65	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-37.74	5	-32.74	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-46.78	5	-41.78	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-40.22	5	-35.22	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-48.27	5	-43.27	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-39.4	5	-34.4	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-48.59	5	-43.59	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-41.24	5	-36.24	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-48.4	5	-43.4	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-38.43	5	-33.43	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-48.77	5	-43.77	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-39.73	5	-34.73	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-48.99	5	-43.99	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-39.24	5	-34.24	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-48.77	5	-43.77	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-37.72	5	-32.72	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-47.8	5	-42.8	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-34.8	5	-29.8	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-44.15	5	-39.15	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-40.03	5	-35.03	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-48.44	5	-43.44	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-39.81	5	-34.81	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-48.97	5	-43.97	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-40.8	5	-35.8	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-48.74	5	-43.74	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-39.92	5	-34.92	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-48.27	5	-43.27	Average	-27	Pass
NVNT	ac40	5755	Ant2	5650	-40.65	5	-35.65	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-47.85	5	-42.85	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-37.39	5	-32.39	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-48.06	5	-43.06	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-38.7	5	-33.7	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-46.52	5	-41.52	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-34.55	5	-29.55	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-42.55	5	-37.55	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-38.48	5	-33.48	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-47.69	5	-42.69	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-39.47	5	-34.47	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-47.86	5	-42.86	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-39.88	5	-34.88	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-47.76	5	-42.76	Average	10	Pass
NVNT	ac40	5795	Ant2	5925	-40.18	5	-35.18	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-48.77	5	-43.77	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-40.3	5	-35.3	Peak	-27	Pass



NVNT	ac80	5775	Ant1	5650	-48.76	5	-43.76	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-38.23	5	-33.23	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-47.12	5	-42.12	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-37.31	5	-32.31	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-46.49	5	-41.49	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-36.85	5	-31.85	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-44.33	5	-39.33	Average	27	Pass
NVNT	ac80	5775	Ant2	5650	-39.11	5	-34.11	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-47.27	5	-42.27	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-36.17	5	-31.17	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-44.58	5	-39.58	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-34.12	5	-29.12	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-43.33	5	-38.33	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-33	5	-28	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-41.84	5	-36.84	Average	27	Pass
NVNT	ax20	5745	Ant1	5650	-39.91	5	-34.91	Peak	-27	Pass
NVNT	ax20	5745	Ant1	5650	-49.45	5	-44.45	Average	-27	Pass
NVNT	ax20	5745	Ant1	5700	-39.76	5	-34.76	Peak	10	Pass
NVNT	ax20	5745	Ant1	5700	-49.11	5	-44.11	Average	10	Pass
NVNT	ax20	5745	Ant1	5720	-38.64	5	-33.64	Peak	15.6	Pass
NVNT	ax20	5745	Ant1	5720	-48.95	5	-43.95	Average	15.6	Pass
NVNT	ax20	5745	Ant1	5725	-38.62	5	-33.62	Peak	27	Pass
NVNT	ax20	5745	Ant1	5725	-47.75	5	-42.75	Average	27	Pass
NVNT	ax20	5825	Ant1	5850	-39.34	5	-34.34	Peak	27	Pass
NVNT	ax20	5825	Ant1	5850	-48.07	5	-43.07	Average	27	Pass
NVNT	ax20	5825	Ant1	5855	-39.03	5	-34.03	Peak	15.6	Pass
NVNT	ax20	5825	Ant1	5855	-48.9	5	-43.9	Average	15.6	Pass
NVNT	ax20	5825	Ant1	5875	-39.61	5	-34.61	Peak	10	Pass
NVNT	ax20	5825	Ant1	5875	-48.97	5	-43.97	Average	10	Pass
NVNT	ax20	5825	Ant1	5925	-39.68	5	-34.68	Peak	-27	Pass
NVNT	ax20	5825	Ant1	5925	-49.28	5	-44.28	Average	-27	Pass
NVNT	ax20	5745	Ant2	5650	-38.51	5	-33.51	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-48.28	5	-43.28	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-37.57	5	-32.57	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-48.07	5	-43.07	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-39.25	5	-34.25	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-47.57	5	-42.57	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-36.61	5	-31.61	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-46.48	5	-41.48	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-37.12	5	-32.12	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-48.1	5	-43.1	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-39.01	5	-34.01	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-48.52	5	-43.52	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-38.54	5	-33.54	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-49.01	5	-44.01	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-40.34	5	-35.34	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-48.91	5	-43.91	Average	-27	Pass
NVNT	ax40	5755	Ant1	5650	-40.81	5	-35.81	Peak	-27	Pass
NVNT	ax40	5755	Ant1	5650	-49.15	5	-44.15	Average	-27	Pass
NVNT	ax40	5755	Ant1	5700	-39.97	5	-34.97	Peak	10	Pass
NVNT	ax40	5755	Ant1	5700	-48.99	5	-43.99	Average	10	Pass
NVNT	ax40	5755	Ant1	5720	-38.35	5	-33.35	Peak	15.6	Pass
NVNT	ax40	5755	Ant1	5720	-47.9	5	-42.9	Average	15.6	Pass
NVNT	ax40	5755	Ant1	5725	-34.84	5	-29.84	Peak	27	Pass
NVNT	ax40	5755	Ant1	5725	-44.88	5	-39.88	Average	27	Pass
NVNT	ax40	5795	Ant1	5850	-39.47	5	-34.47	Peak	27	Pass



NVNT	ax40	5795	Ant1	5850	-48.19	5	-43.19	Average	27	Pass
NVNT	ax40	5795	Ant1	5855	-40.81	5	-35.81	Peak	15.6	Pass
NVNT	ax40	5795	Ant1	5855	-48.73	5	-43.73	Average	15.6	Pass
NVNT	ax40	5795	Ant1	5875	-38.32	5	-33.32	Peak	10	Pass
NVNT	ax40	5795	Ant1	5875	-48.21	5	-43.21	Average	10	Pass
NVNT	ax40	5795	Ant1	5925	-40.47	5	-35.47	Peak	-27	Pass
NVNT	ax40	5795	Ant1	5925	-49.11	5	-44.11	Average	-27	Pass
NVNT	ax40	5755	Ant2	5650	-39.32	5	-34.32	Peak	-27	Pass
NVNT	ax40	5755	Ant2	5650	-48.44	5	-43.44	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-38.28	5	-33.28	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-47.63	5	-42.63	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-37.36	5	-32.36	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-46.8	5	-41.8	Average	15.6	Pass
NVNT	ax40	5755	Ant2	5725	-31.13	5	-26.13	Peak	27	Pass
NVNT	ax40	5755	Ant2	5725	-42.94	5	-37.94	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-38.66	5	-33.66	Peak	27	Pass
NVNT	ax40	5795	Ant2	5850	-48.04	5	-43.04	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-38.84	5	-33.84	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-48.54	5	-43.54	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-38.87	5	-33.87	Peak	10	Pass
NVNT	ax40	5795	Ant2	5875	-48.09	5	-43.09	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-39.94	5	-34.94	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-48.51	5	-43.51	Average	-27	Pass
NVNT	ax80	5775	Ant1	5650	-40.23	5	-35.23	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5650	-49.31	5	-44.31	Average	-27	Pass
NVNT	ax80	5775	Ant1	5700	-38.69	5	-33.69	Peak	10	Pass
NVNT	ax80	5775	Ant1	5700	-46.68	5	-41.68	Average	10	Pass
NVNT	ax80	5775	Ant1	5720	-36.92	5	-31.92	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5720	-45.97	5	-40.97	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5725	-36.52	5	-31.52	Peak	27	Pass
NVNT	ax80	5775	Ant1	5725	-44.9	5	-39.9	Average	27	Pass
NVNT	ax80	5775	Ant2	5650	-38.5	5	-33.5	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-47.95	5	-42.95	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-34.45	5	-29.45	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-44.87	5	-39.87	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-33.57	5	-28.57	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-43.35	5	-38.35	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-32.78	5	-27.78	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-41.76	5	-36.76	Average	27	Pass

