

Appendix Test Data

| | | | |
|------------------|------------------|--------------------|--------------------|
| Report No.: | 1812C50386312502 | Test Sample No.: | 1-2-2 |
| Start Test Date: | 2025-08-27 | Finish Test Date: | 2025-09-18 |
| Test Engineer: | <i>Alex Peng</i> | Auditor: | <i>Justin Feng</i> |
| Temperature: | 25°C | Relative Humidity: | 45% |
| Pressure: | 101kPa | | |

Appendix A: 6dB Bandwidth

Test Result

| Test Mode | Antenna | Frequency[MHz] | 6dB BW [MHz] | FL[MHz] | FH[MHz] | Limit[MHz] | Verdict |
|-----------|---------|----------------|--------------|----------|----------|------------|---------|
| 11B | Ant1 | 2412 | 8.200 | 2407.960 | 2416.160 | 0.5 | PASS |
| 11B | Ant1 | 2437 | 8.200 | 2432.960 | 2441.160 | 0.5 | PASS |
| 11B | Ant1 | 2462 | 8.200 | 2457.960 | 2466.160 | 0.5 | PASS |
| 11G | Ant1 | 2412 | 16.040 | 2404.040 | 2420.080 | 0.5 | PASS |
| 11G | Ant1 | 2437 | 16.080 | 2429.040 | 2445.120 | 0.5 | PASS |
| 11G | Ant1 | 2462 | 16.040 | 2454.120 | 2470.160 | 0.5 | PASS |
| 11N20SISO | Ant1 | 2412 | 17.400 | 2403.360 | 2420.760 | 0.5 | PASS |
| 11N20SISO | Ant1 | 2437 | 17.120 | 2428.600 | 2445.720 | 0.5 | PASS |
| 11N20SISO | Ant1 | 2462 | 17.200 | 2453.640 | 2470.840 | 0.5 | PASS |
| 11N40SISO | Ant1 | 2422 | 35.760 | 2404.480 | 2440.240 | 0.5 | PASS |
| 11N40SISO | Ant1 | 2437 | 34.800 | 2420.120 | 2454.920 | 0.5 | PASS |
| 11N40SISO | Ant1 | 2452 | 33.920 | 2436.000 | 2469.920 | 0.5 | PASS |


Test Graphs





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

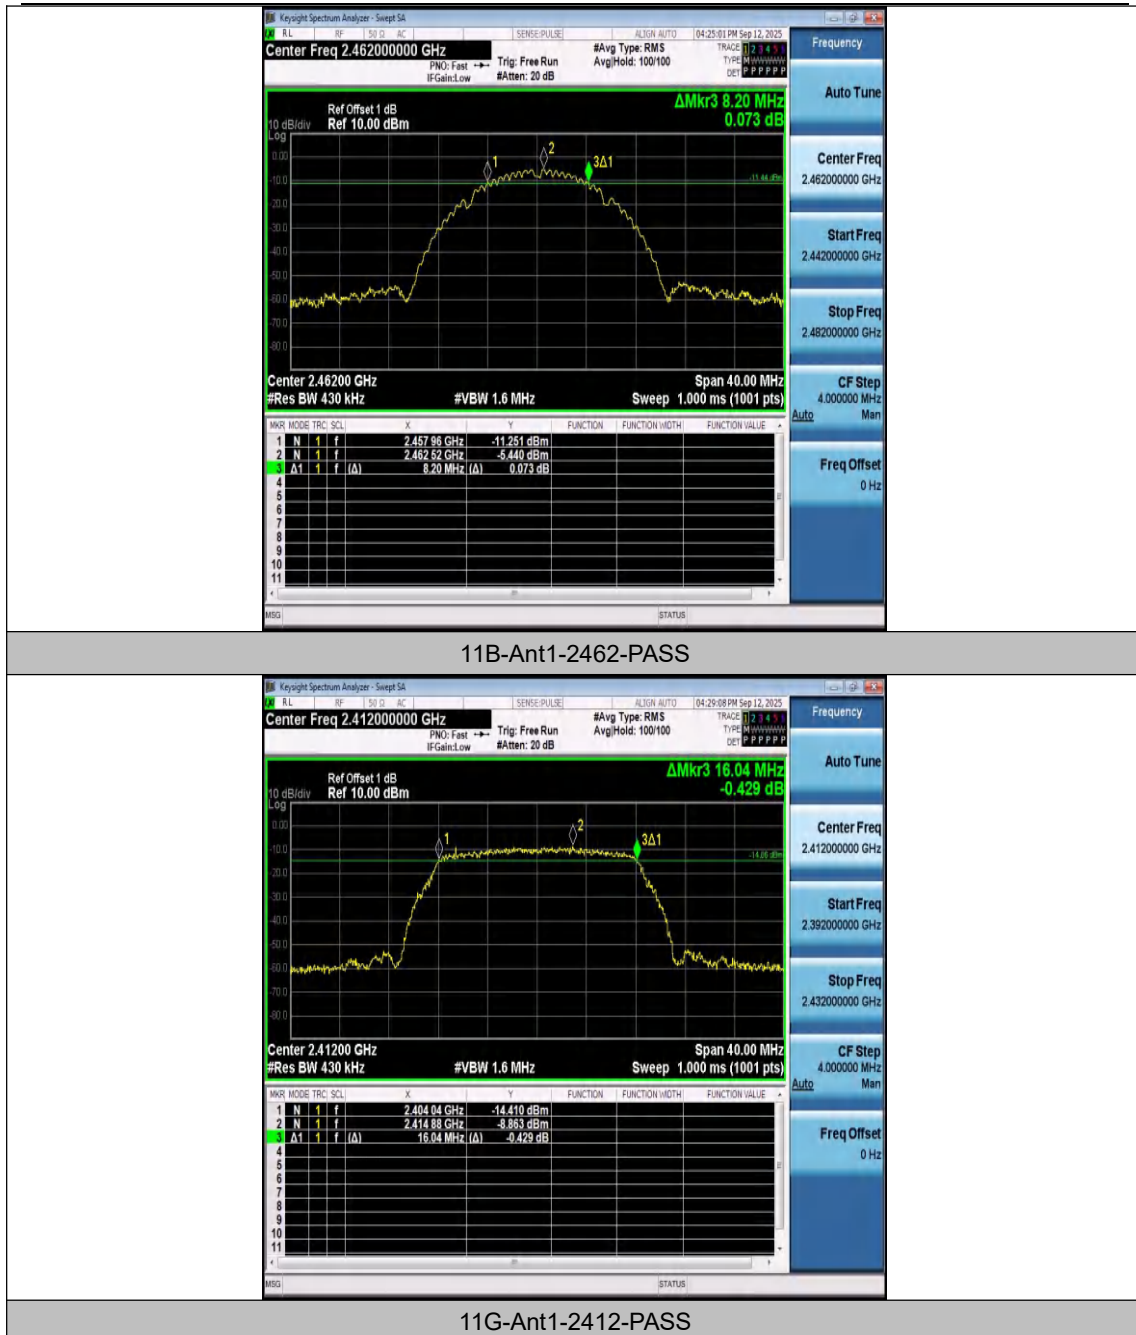

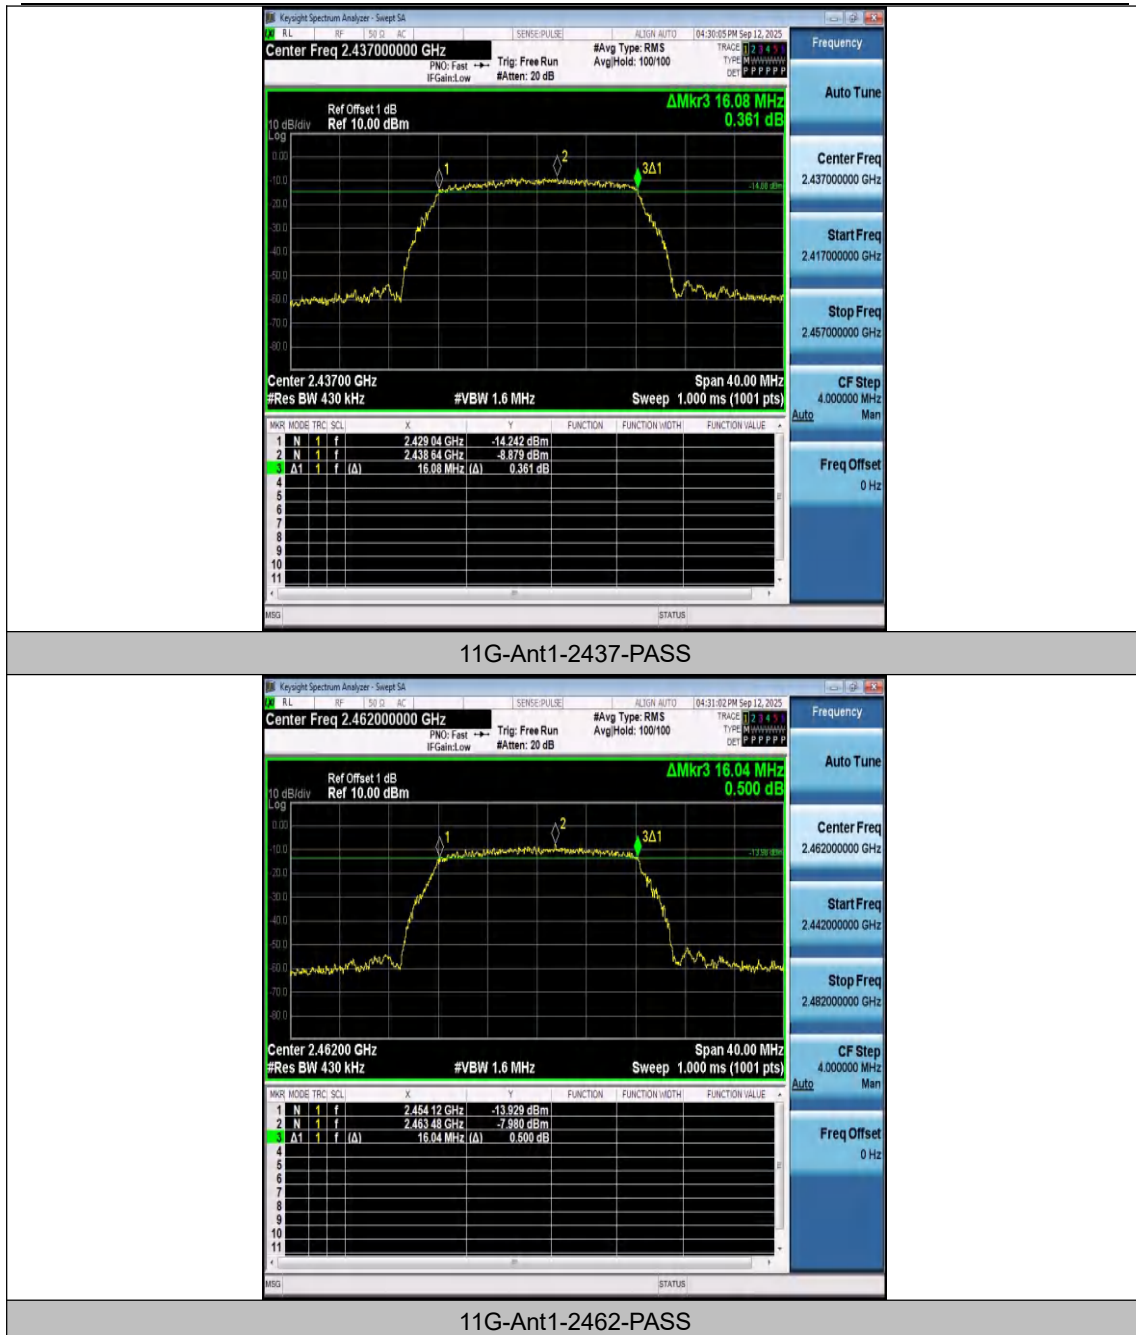


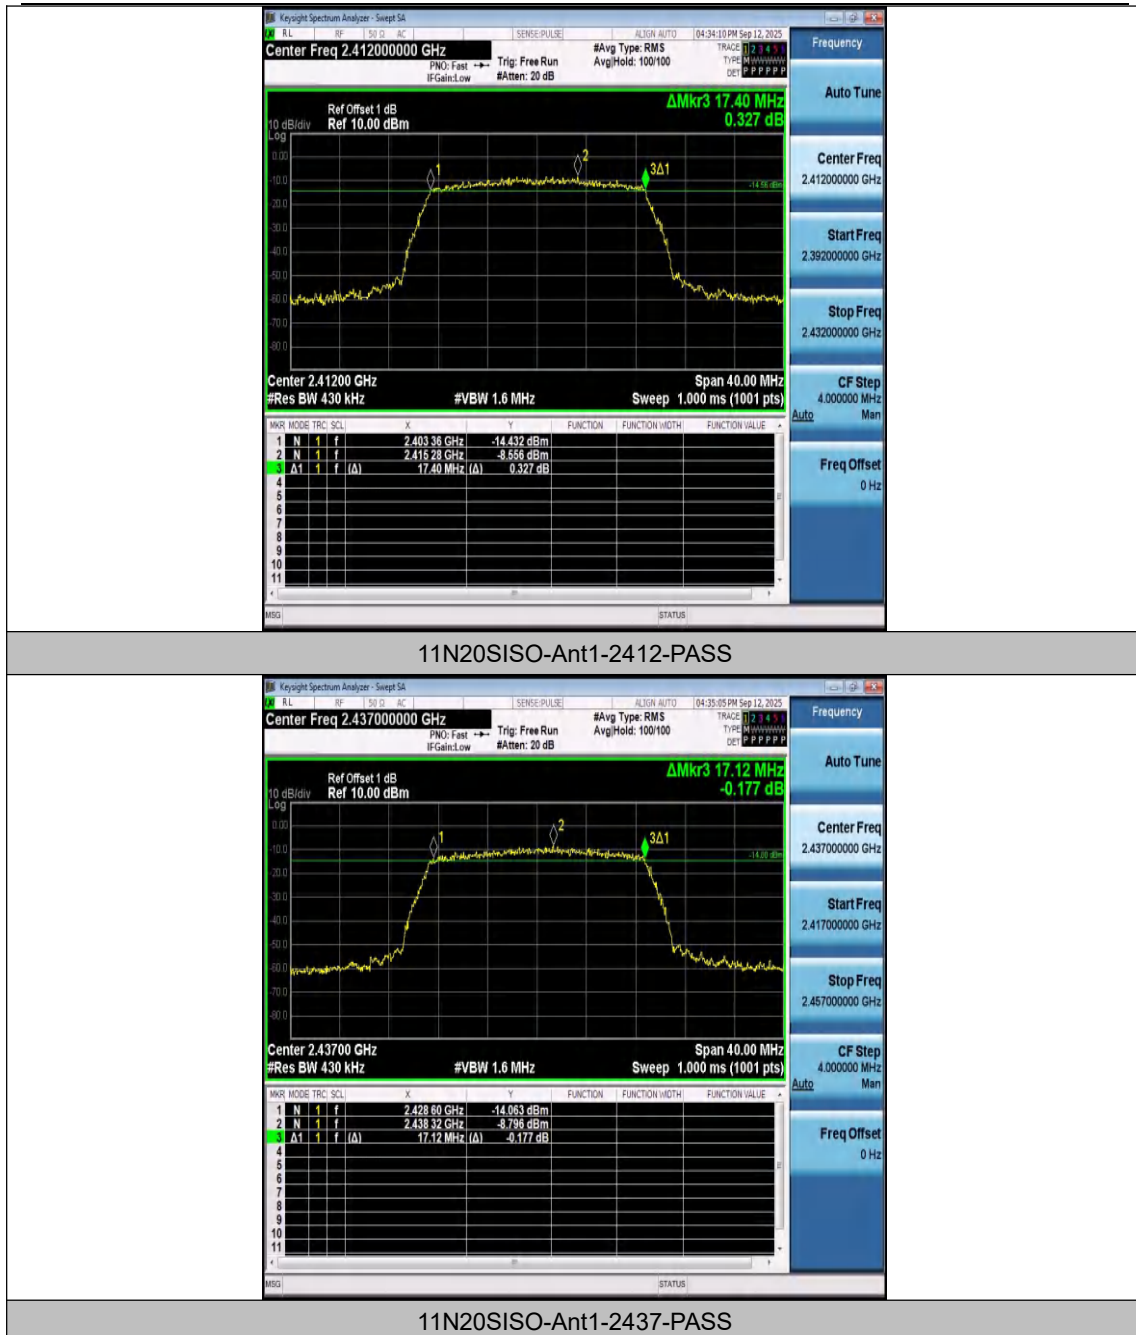


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

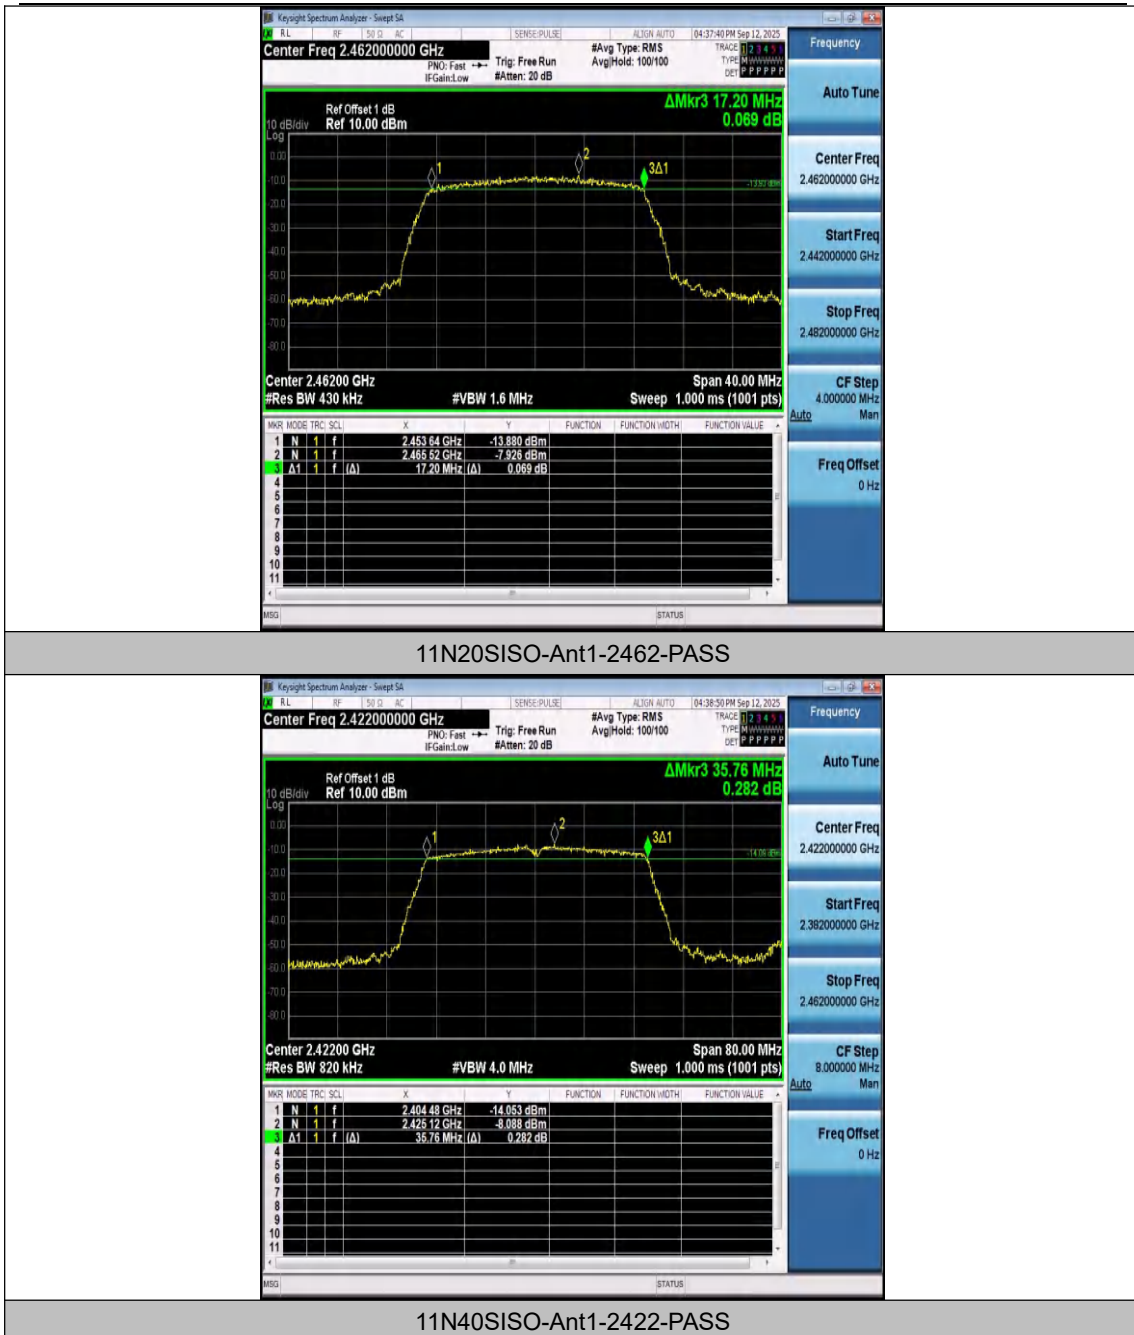

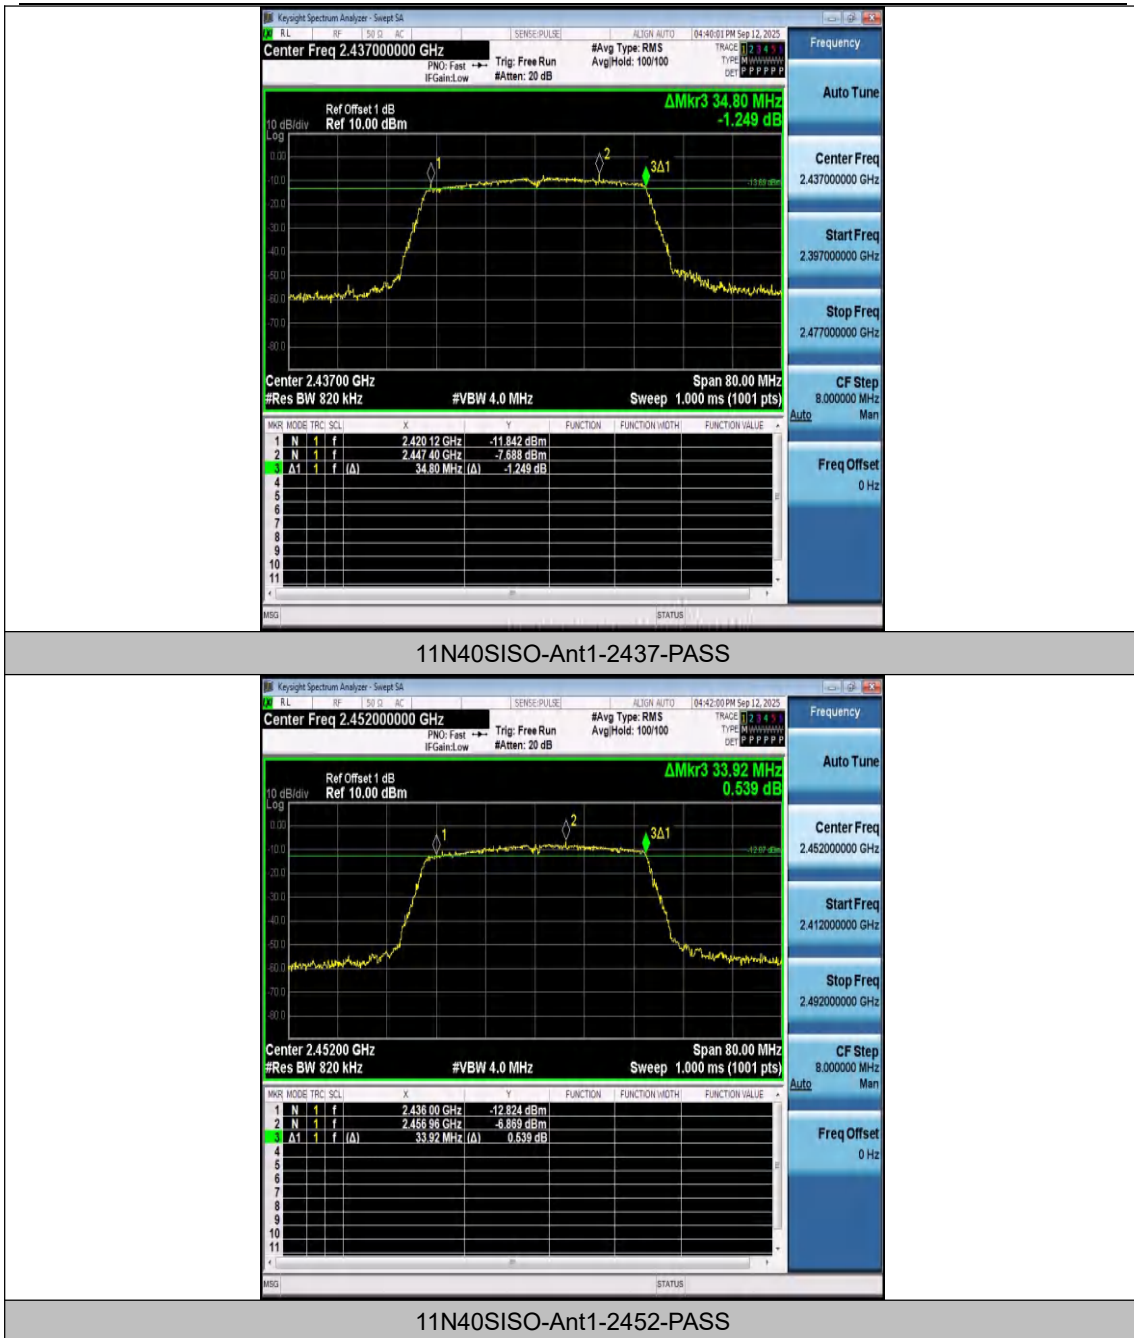

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

| Test Mode | Antenna | Channel Frequency[MHz] | OCB [MHz] | FL[MHz] | FH[MHz] | Limit[MHz] | Verdict |
|-----------|---------|------------------------|-----------|-----------|-----------|------------|---------|
| 11B | Ant1 | 2412 | 13.943 | 2405.0663 | 2419.0093 | --- | --- |
| 11B | Ant1 | 2437 | 13.894 | 2430.0850 | 2443.9790 | --- | --- |
| 11B | Ant1 | 2462 | 13.792 | 2455.1363 | 2468.9283 | --- | --- |
| 11G | Ant1 | 2412 | 16.470 | 2403.7964 | 2420.2664 | --- | --- |
| 11G | Ant1 | 2437 | 16.444 | 2428.8067 | 2445.2507 | --- | --- |
| 11G | Ant1 | 2462 | 16.482 | 2453.7662 | 2470.2482 | --- | --- |
| 11N20SISO | Ant1 | 2412 | 17.539 | 2403.2513 | 2420.7903 | --- | --- |
| 11N20SISO | Ant1 | 2437 | 17.554 | 2428.2477 | 2445.8017 | --- | --- |
| 11N20SISO | Ant1 | 2462 | 17.489 | 2453.2715 | 2470.7605 | --- | --- |
| 11N40SISO | Ant1 | 2422 | 35.262 | 2404.4414 | 2439.7034 | --- | --- |
| 11N40SISO | Ant1 | 2437 | 35.285 | 2419.4386 | 2454.7236 | --- | --- |
| 11N40SISO | Ant1 | 2452 | 35.237 | 2434.4440 | 2469.6810 | --- | --- |


Test Graphs





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

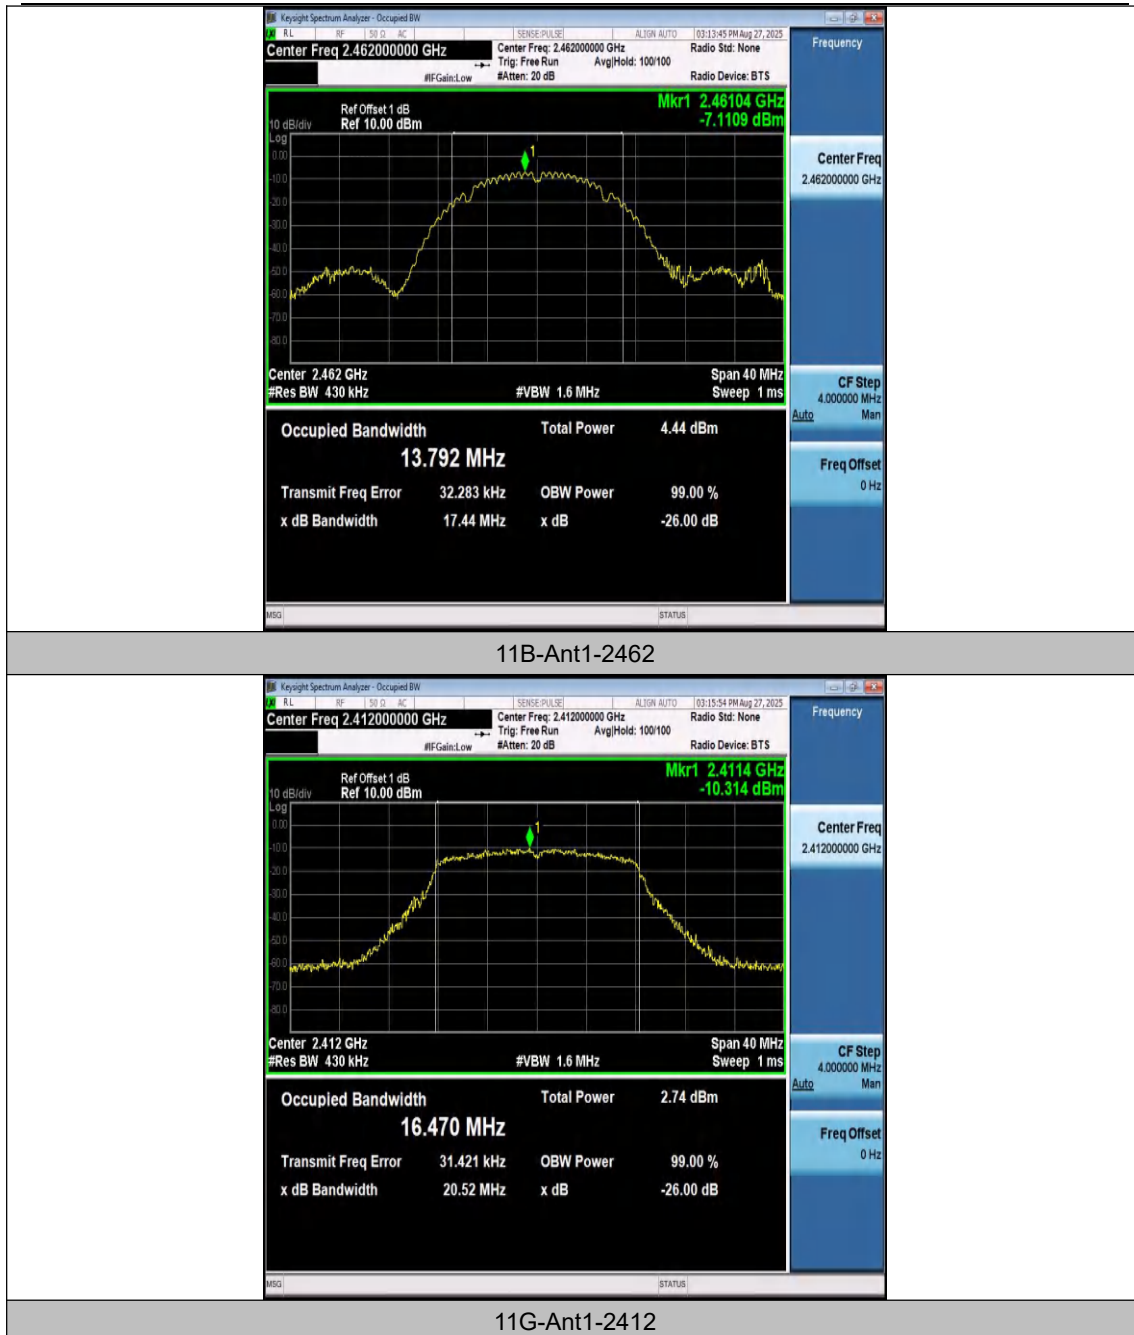

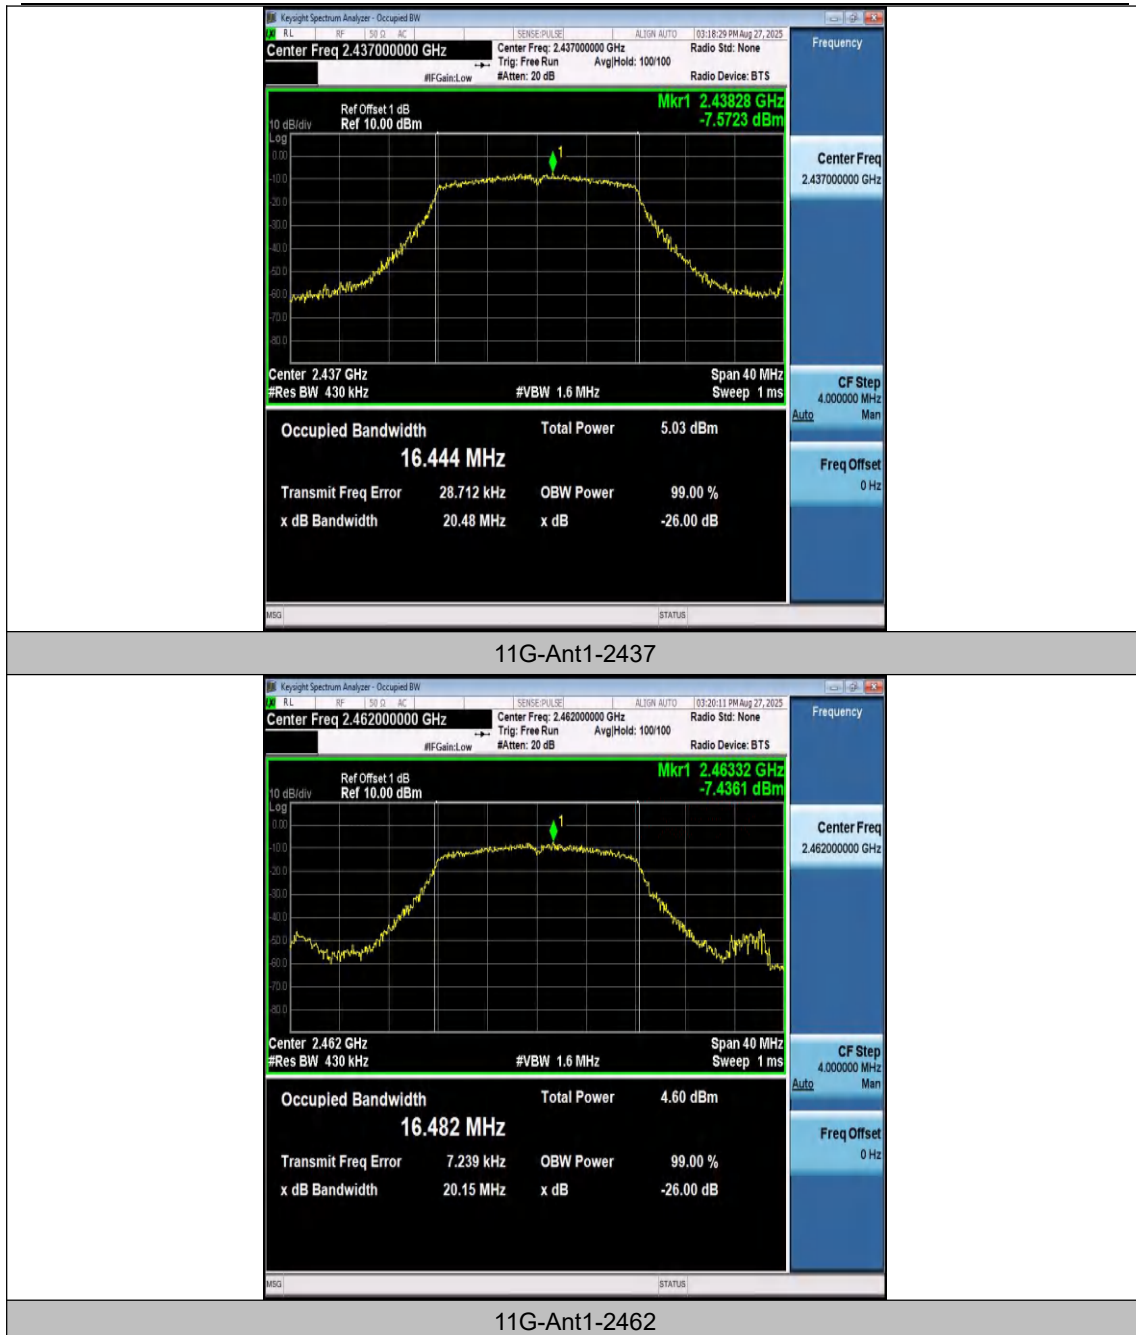


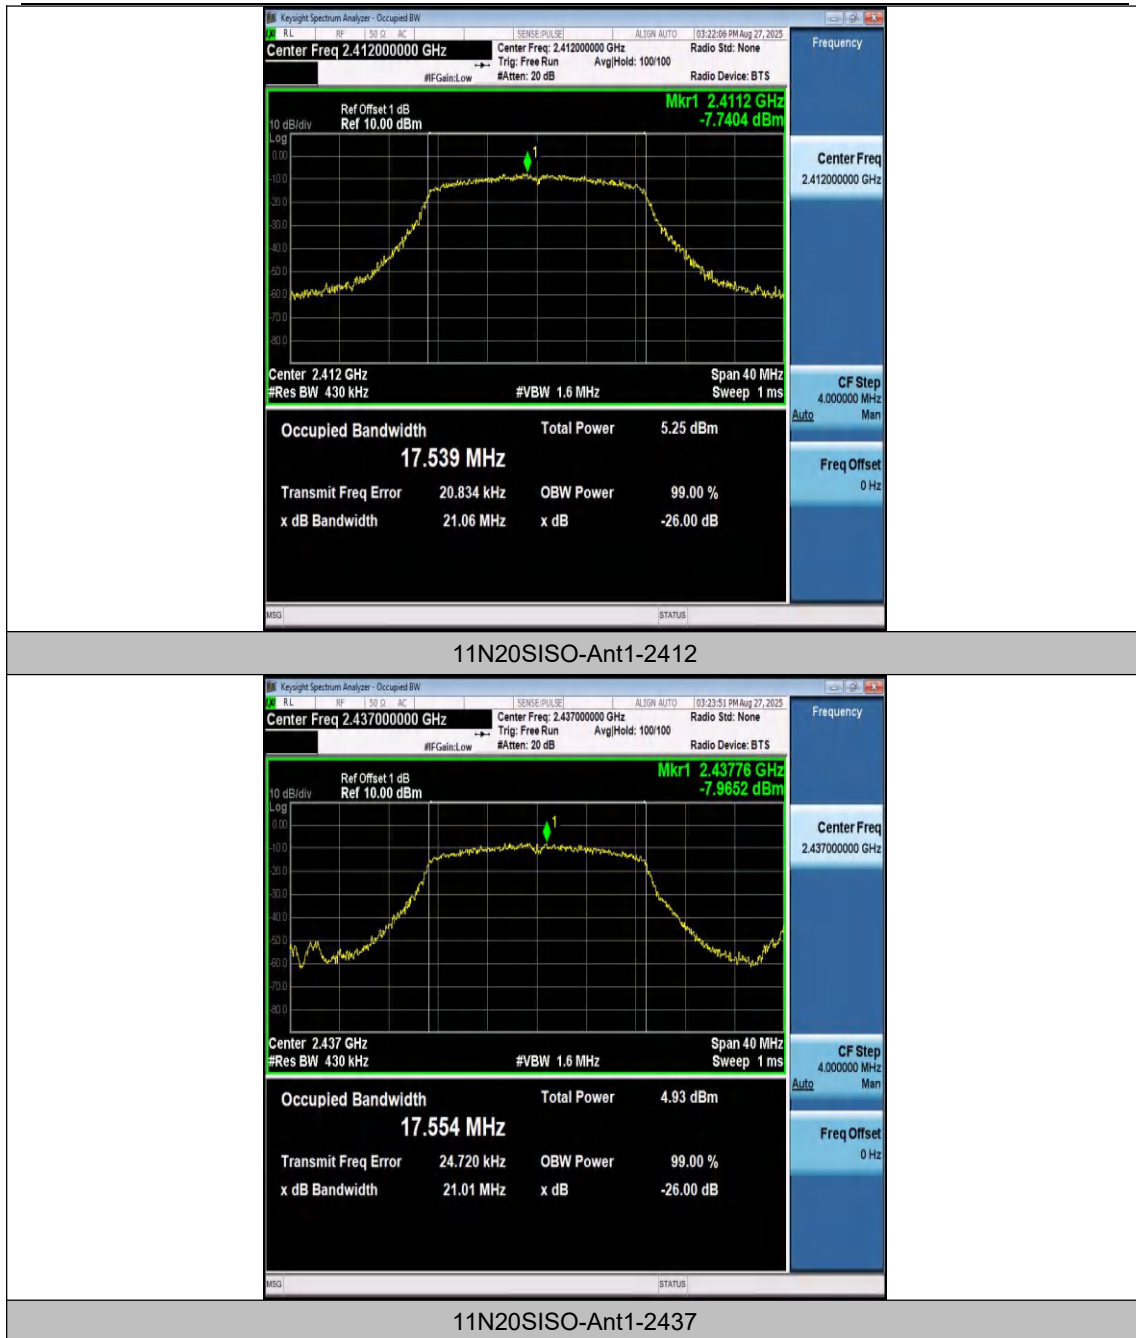

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

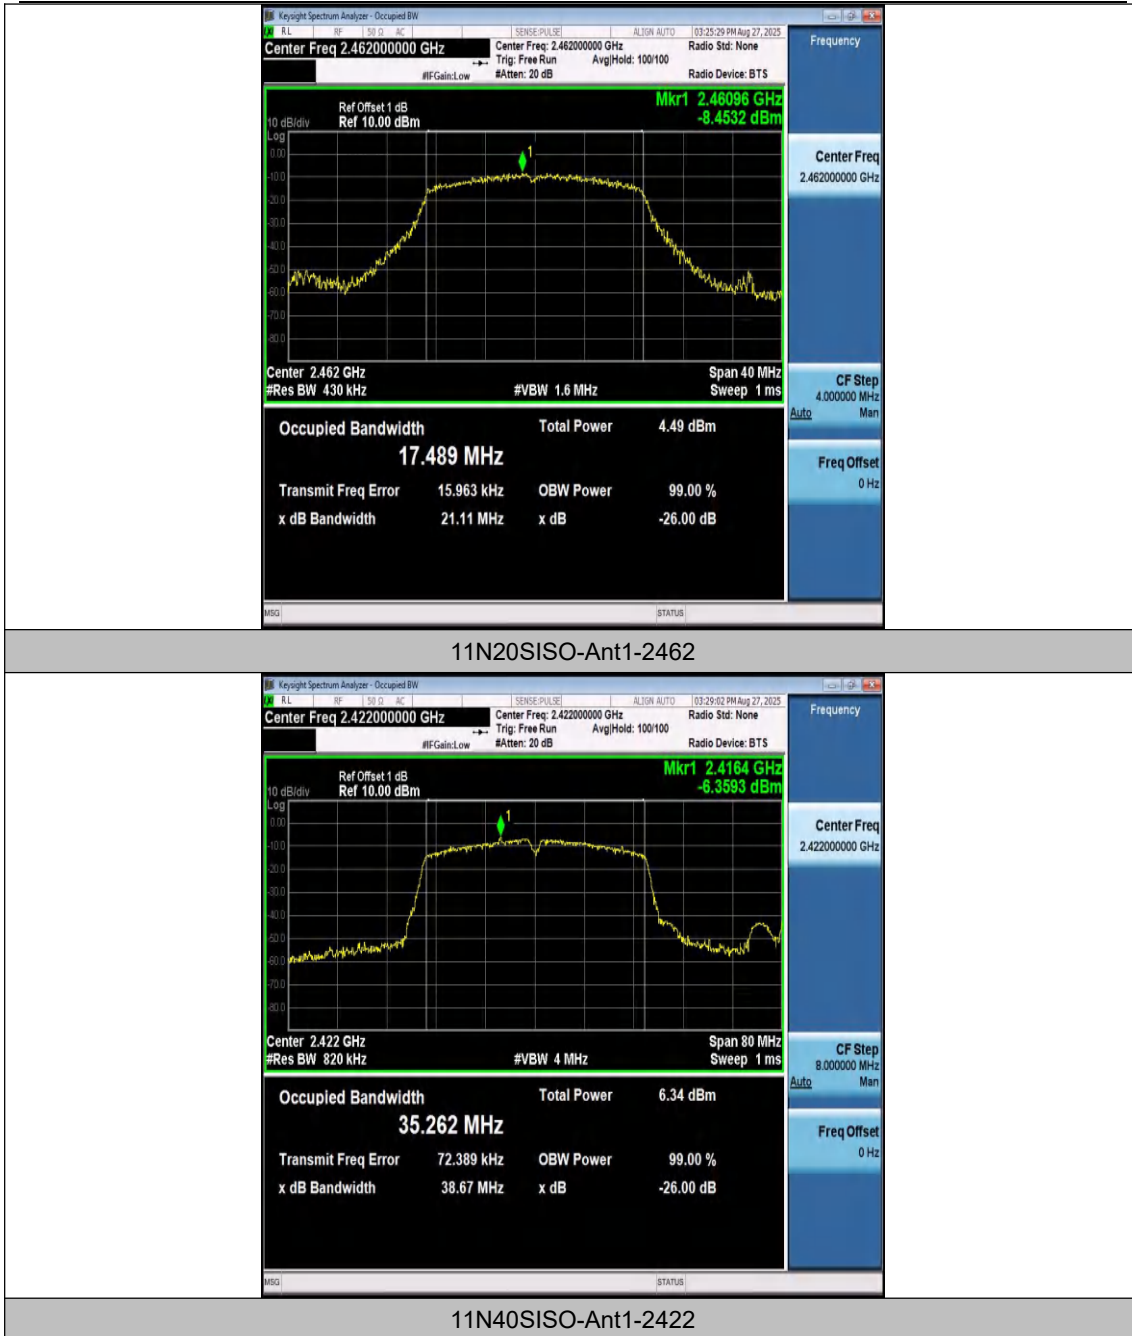

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

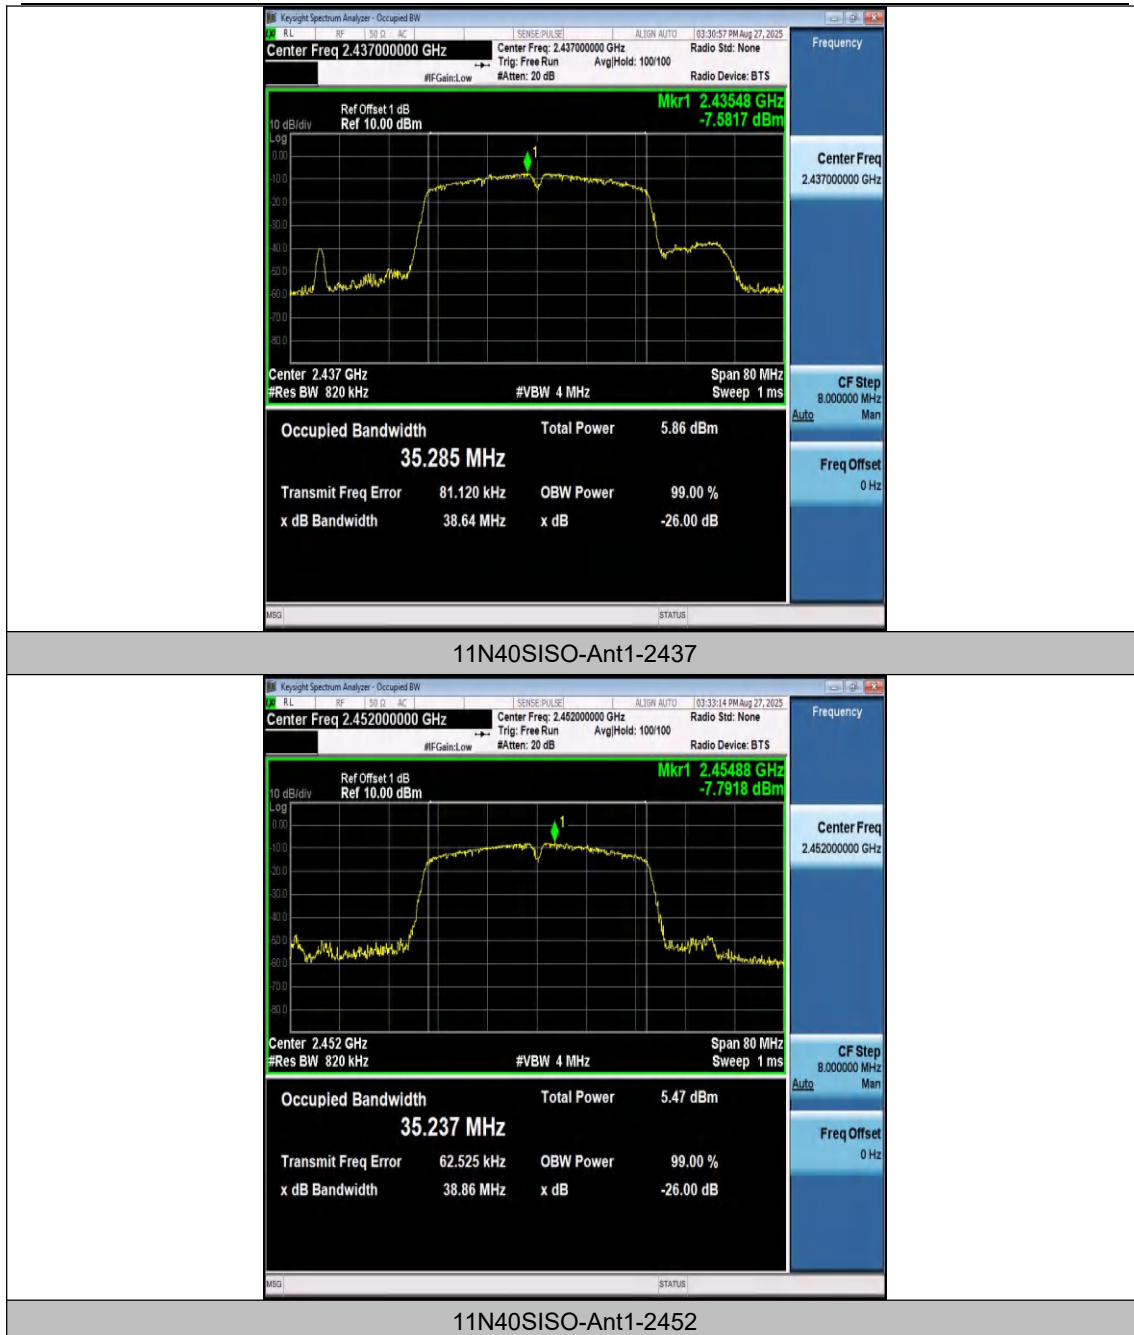

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum conducted output power

Test Result Average

| Test Mode | Antenna | Frequency[MHz] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|----------------|--------------|-------------|---------|
| 11B | Ant1 | 2412 | 1.80 | ≤30.00 | PASS |
| 11B | Ant1 | 2437 | 1.56 | ≤30.00 | PASS |
| 11B | Ant1 | 2462 | 2.17 | ≤30.00 | PASS |
| 11G | Ant1 | 2412 | -1.81 | ≤30.00 | PASS |
| 11G | Ant1 | 2437 | -2.00 | ≤30.00 | PASS |
| 11G | Ant1 | 2462 | -1.80 | ≤30.00 | PASS |
| 11N20SISO | Ant1 | 2412 | -1.69 | ≤30.00 | PASS |
| 11N20SISO | Ant1 | 2437 | -2.12 | ≤30.00 | PASS |
| 11N20SISO | Ant1 | 2462 | -1.15 | ≤30.00 | PASS |
| 11N40SISO | Ant1 | 2422 | -1.59 | ≤30.00 | PASS |
| 11N40SISO | Ant1 | 2437 | -1.66 | ≤30.00 | PASS |
| 11N40SISO | Ant1 | 2452 | -0.81 | ≤30.00 | PASS |

Note: The cable loss are compensated in the graph.


Test Graphs Average

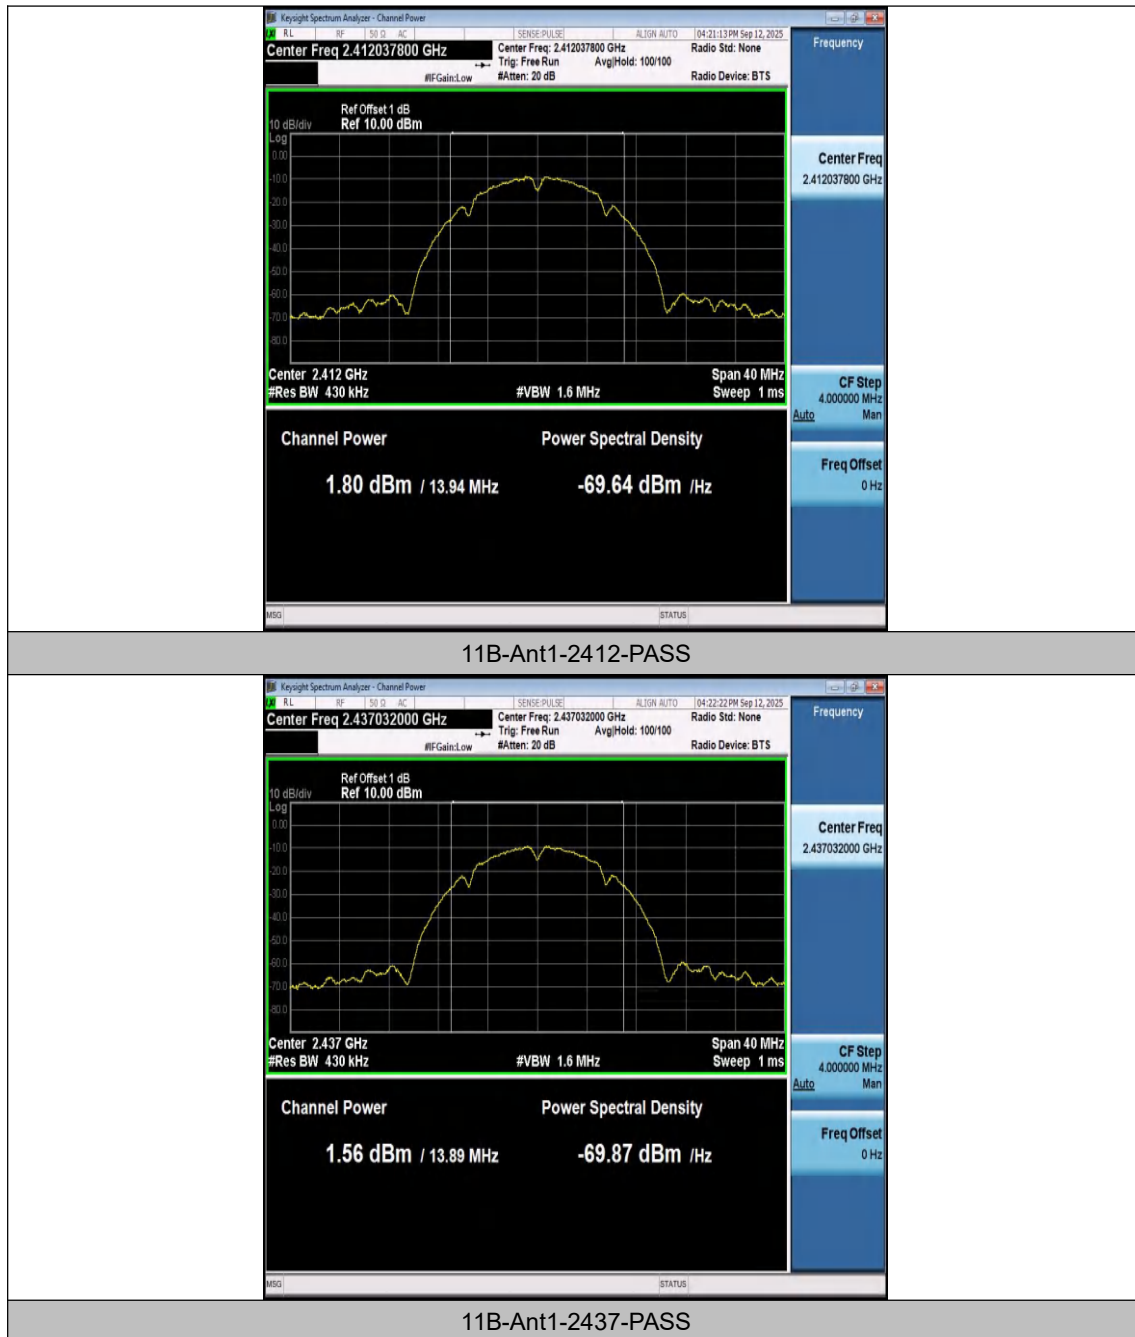

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

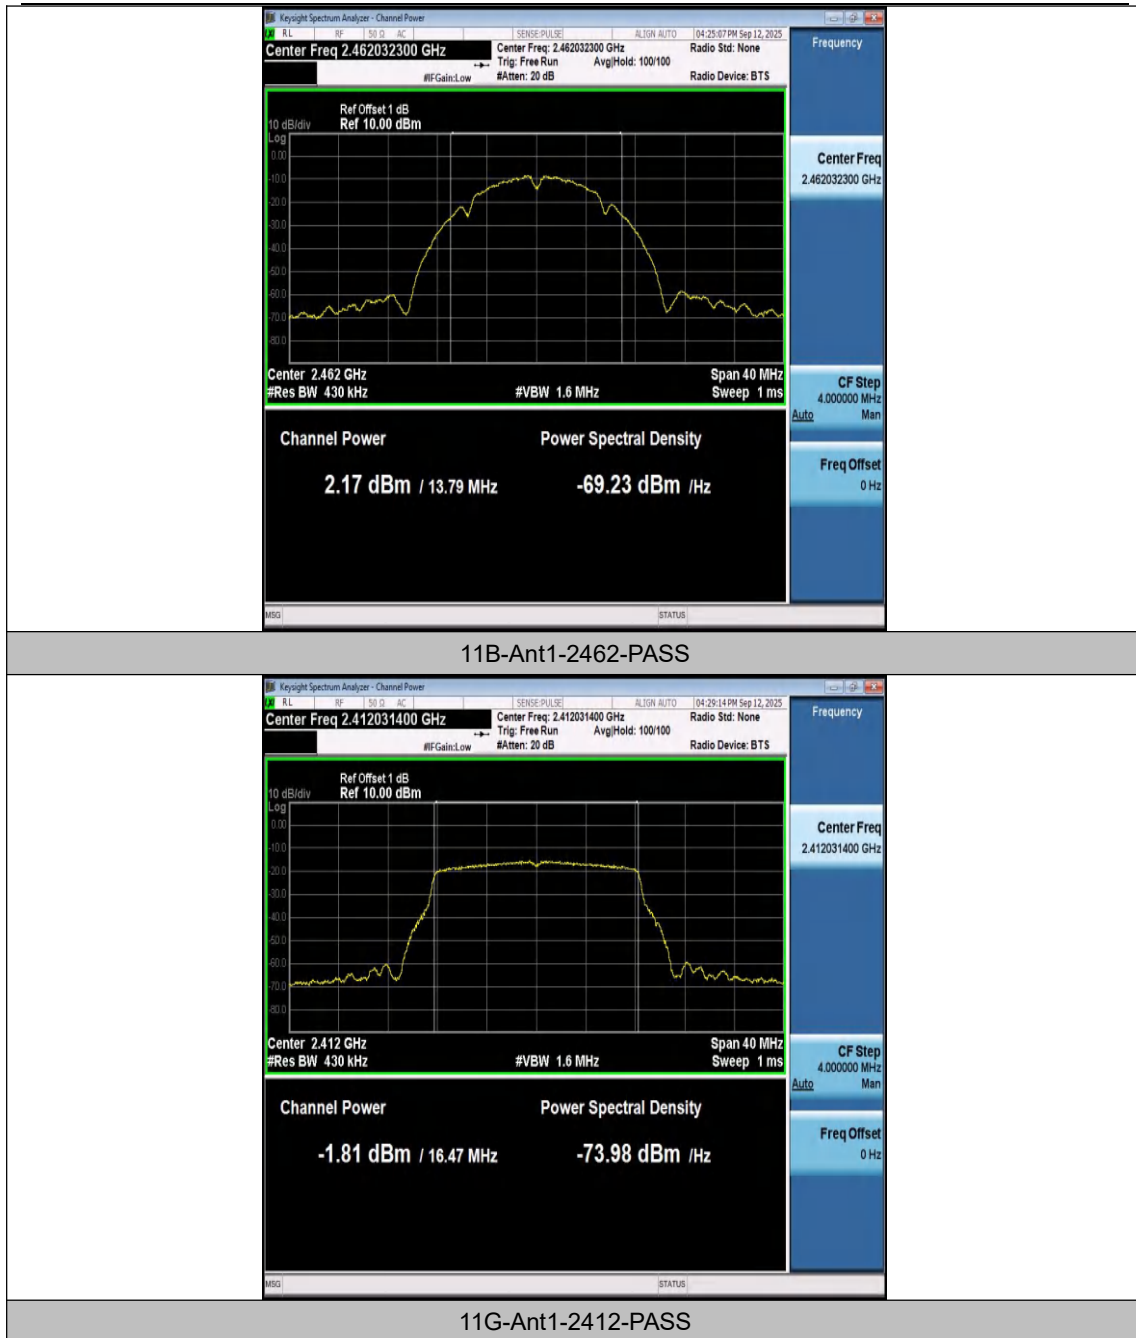

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

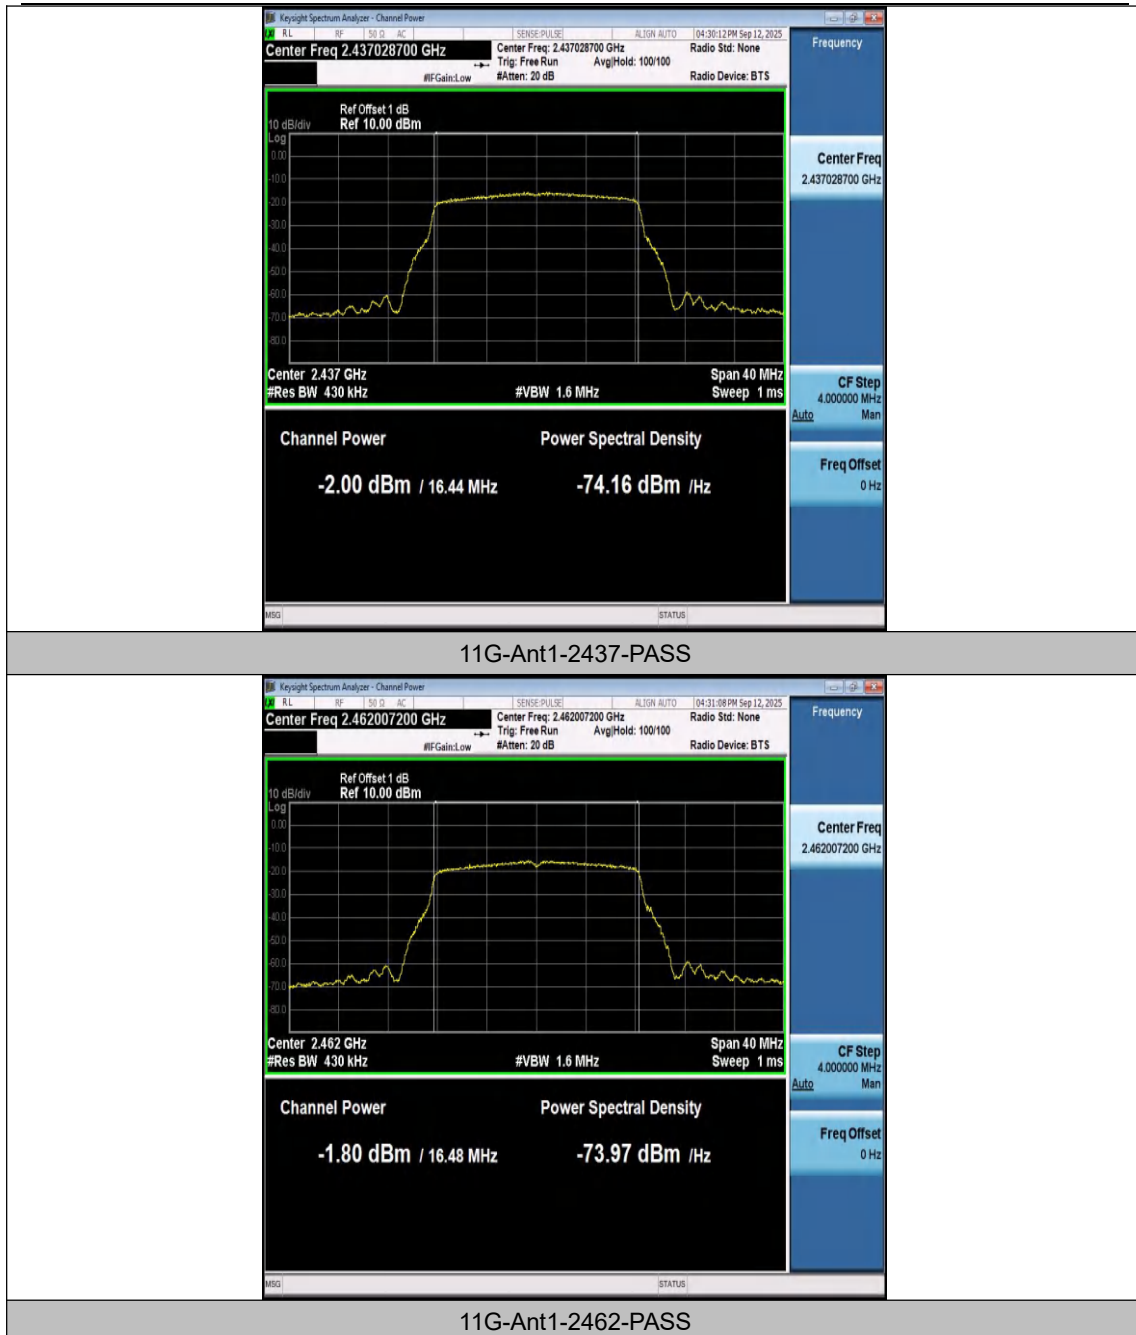


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

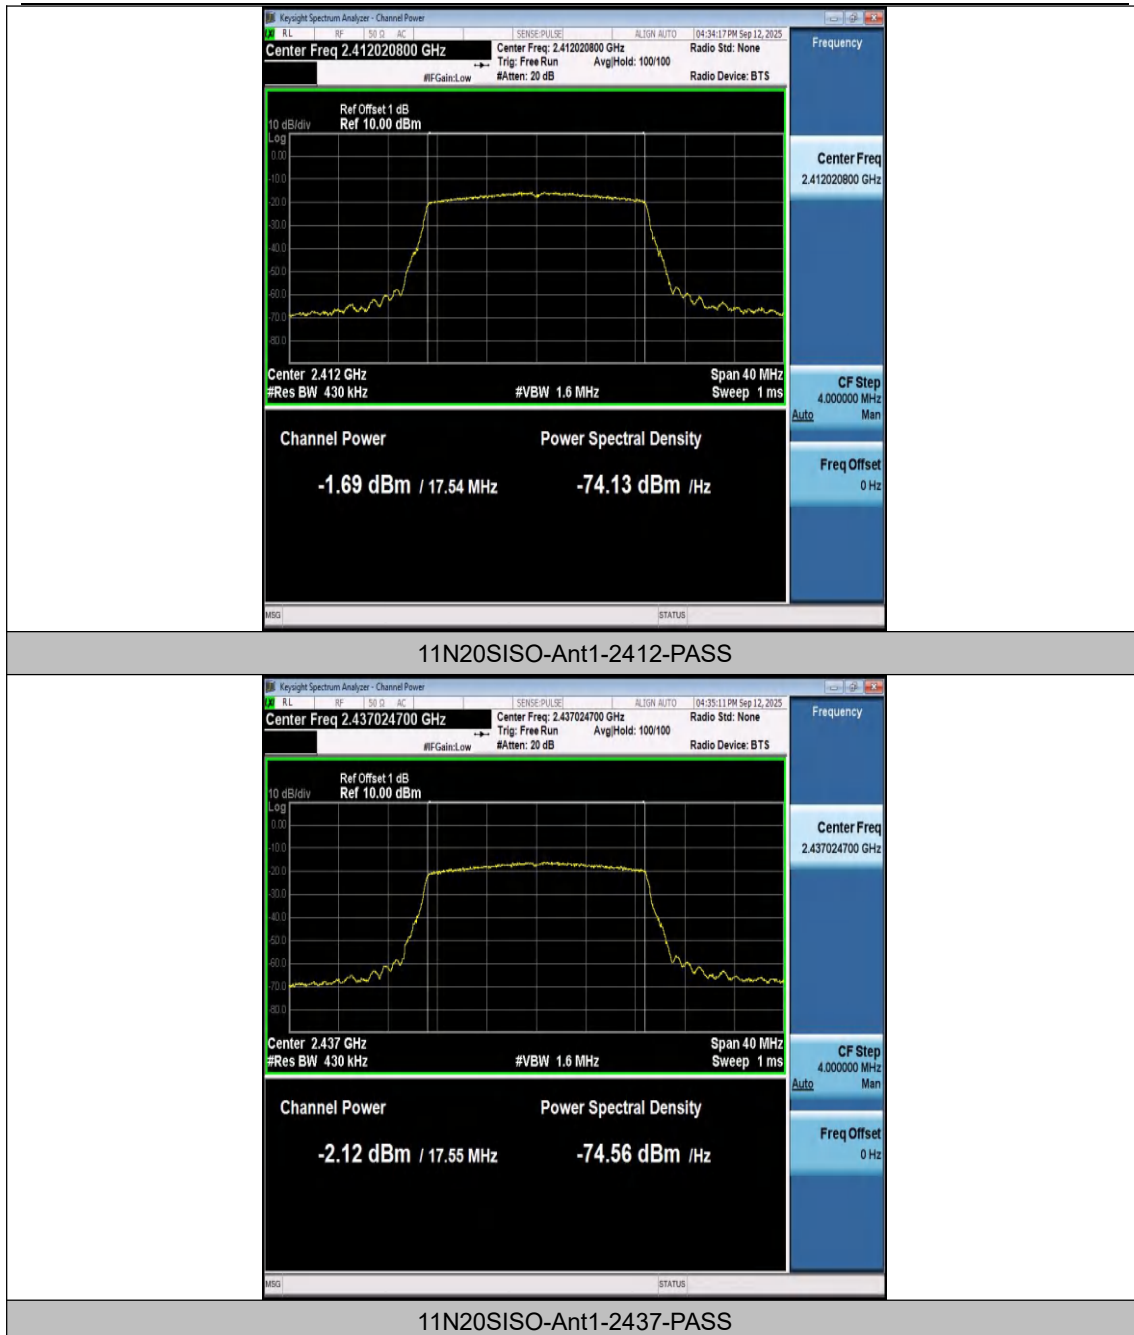


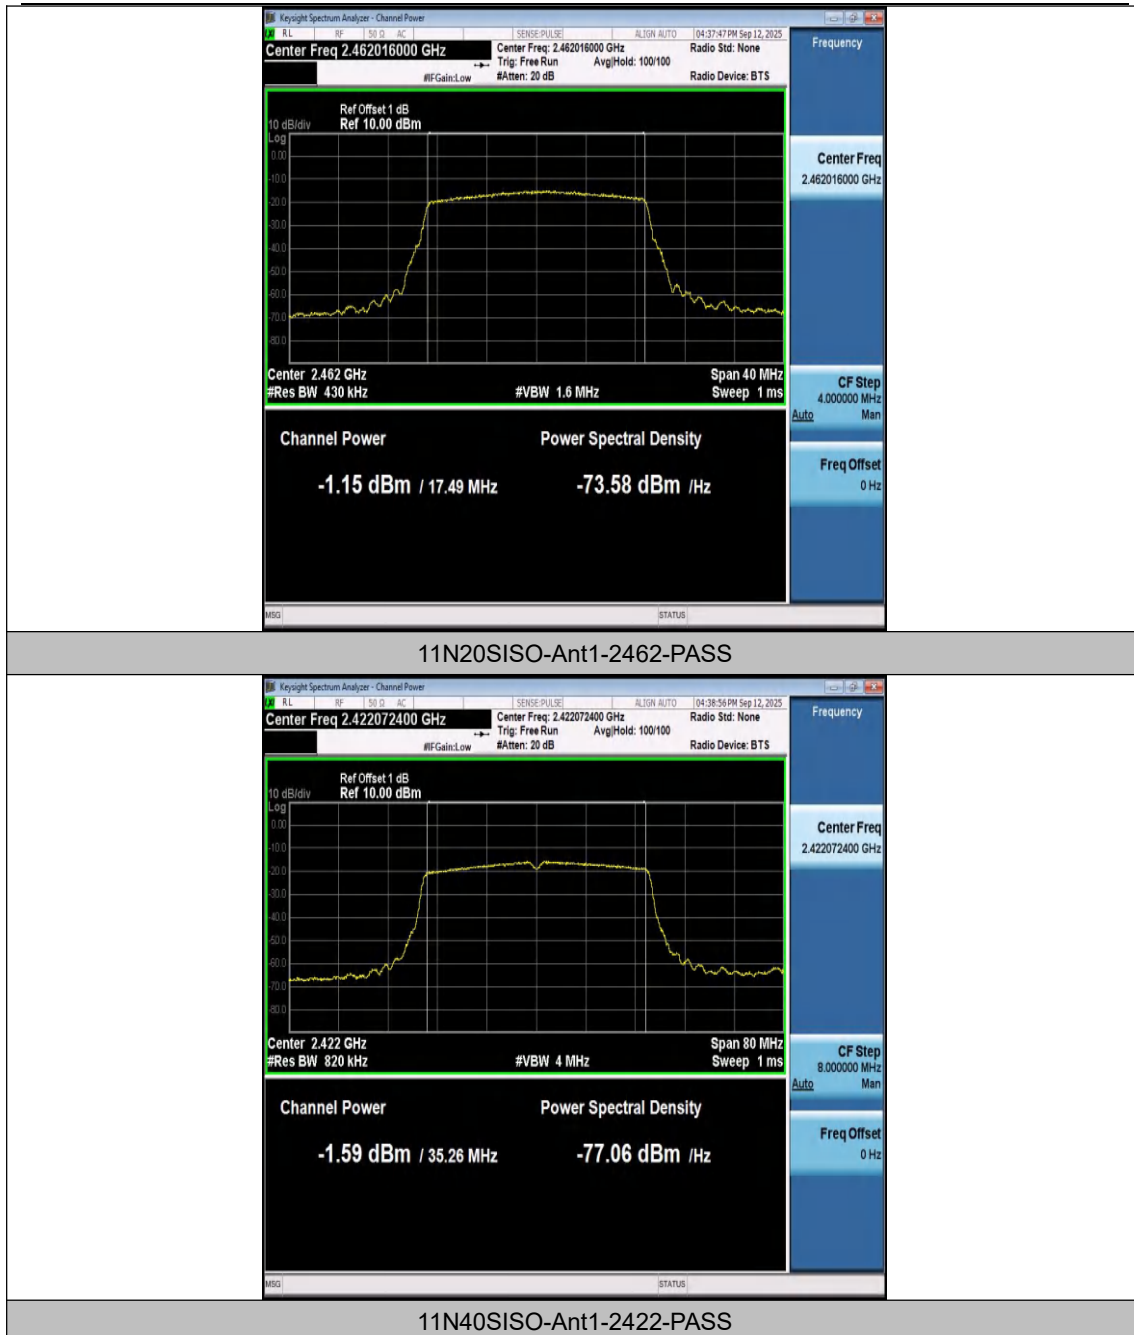

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

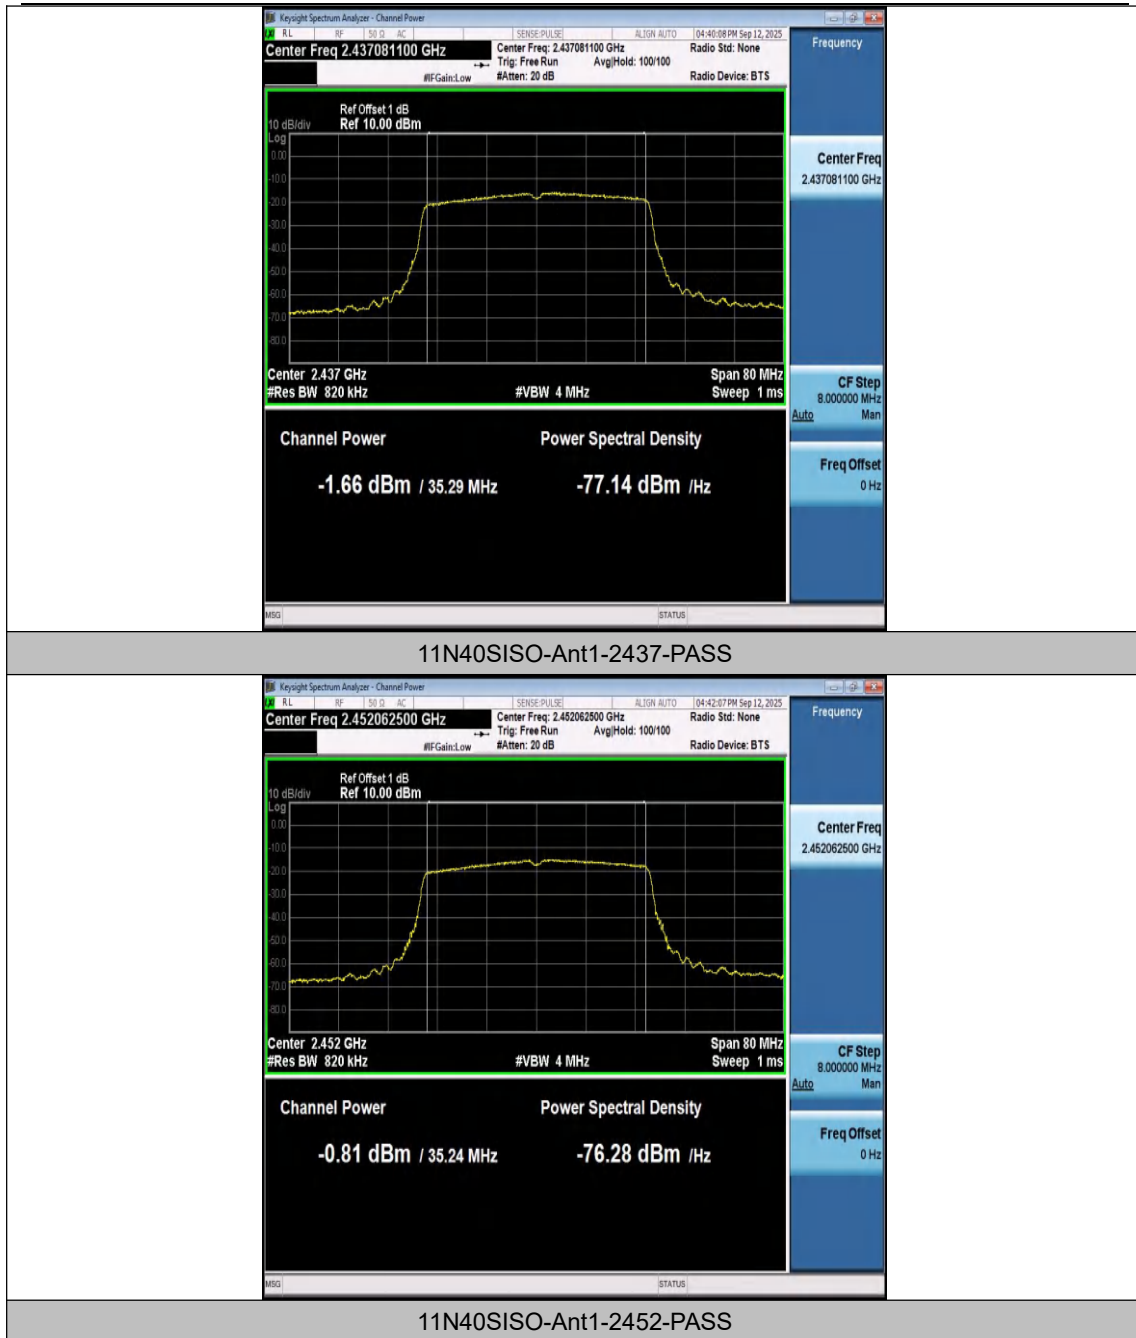

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Maximum power spectral density

Test Result

| Test Mode | Antenna | Frequency[MHz] | Result[dBm/30kHz] | Limit[dBm/3kHz] | Verdict |
|-----------|---------|----------------|-------------------|-----------------|---------|
| 11B | Ant1 | 2412 | -19.59 | ≤8.00 | PASS |
| 11B | Ant1 | 2437 | -20.00 | ≤8.00 | PASS |
| 11B | Ant1 | 2462 | -19.05 | ≤8.00 | PASS |
| 11G | Ant1 | 2412 | -21.64 | ≤8.00 | PASS |
| 11G | Ant1 | 2437 | -20.44 | ≤8.00 | PASS |
| 11G | Ant1 | 2462 | -22.83 | ≤8.00 | PASS |
| 11N20SISO | Ant1 | 2412 | -21.63 | ≤8.00 | PASS |
| 11N20SISO | Ant1 | 2437 | -20.21 | ≤8.00 | PASS |
| 11N20SISO | Ant1 | 2462 | -18.15 | ≤8.00 | PASS |
| 11N40SISO | Ant1 | 2422 | -21.21 | ≤8.00 | PASS |
| 11N40SISO | Ant1 | 2437 | -20.34 | ≤8.00 | PASS |
| 11N40SISO | Ant1 | 2452 | -19.28 | ≤8.00 | PASS |

Note: The cable loss are compensated in the graph.


Test Graphs

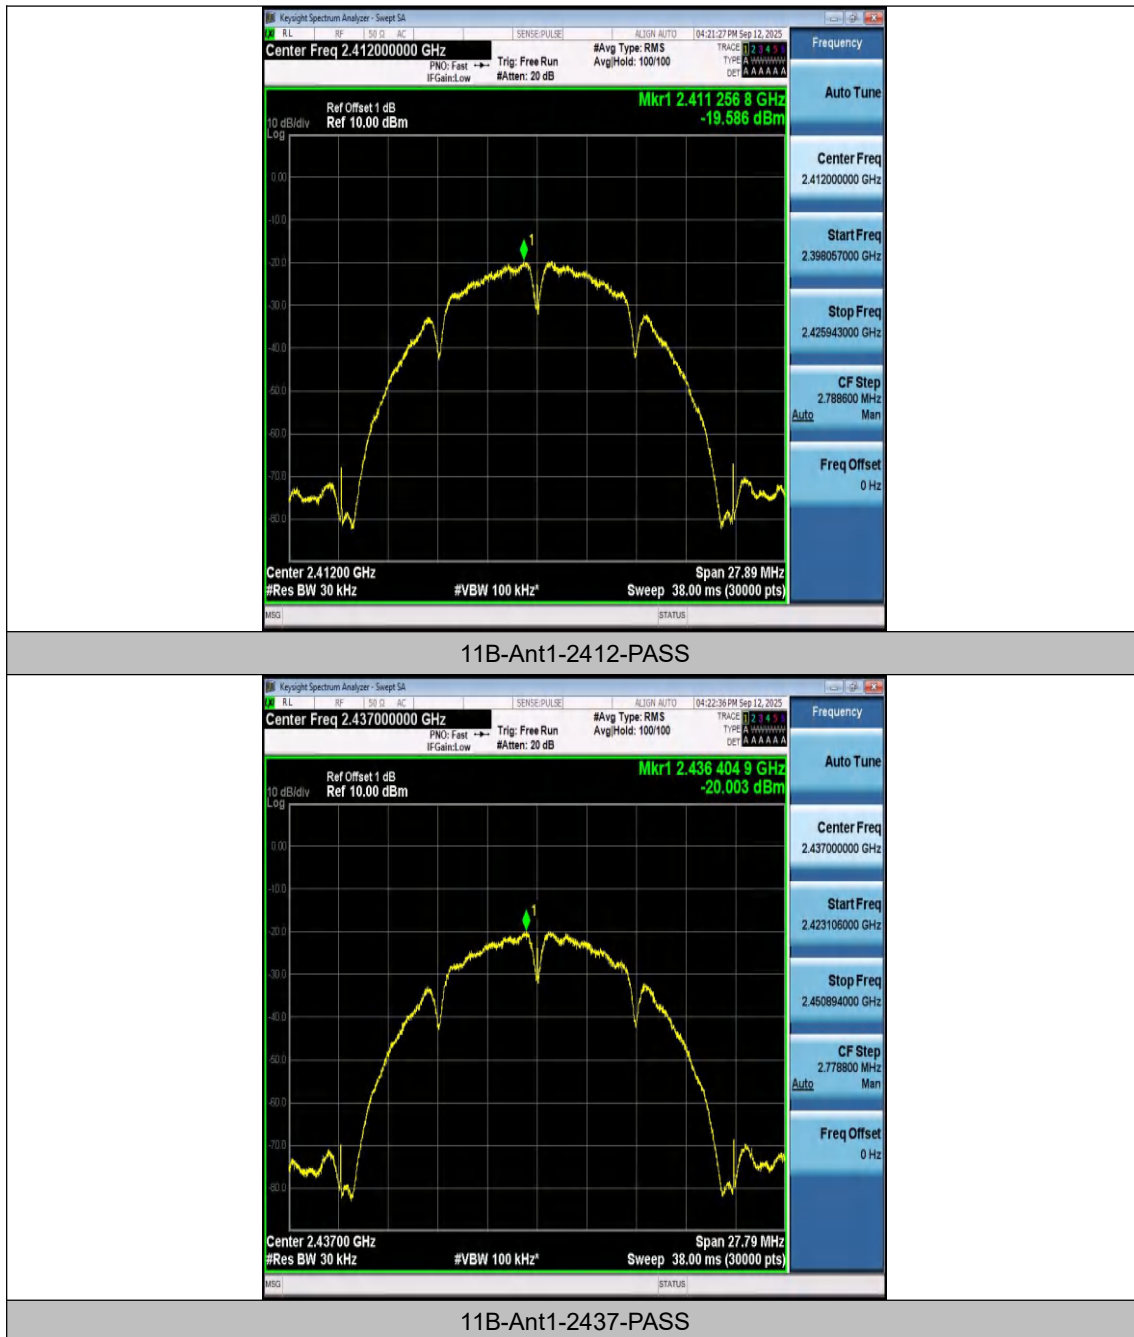

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

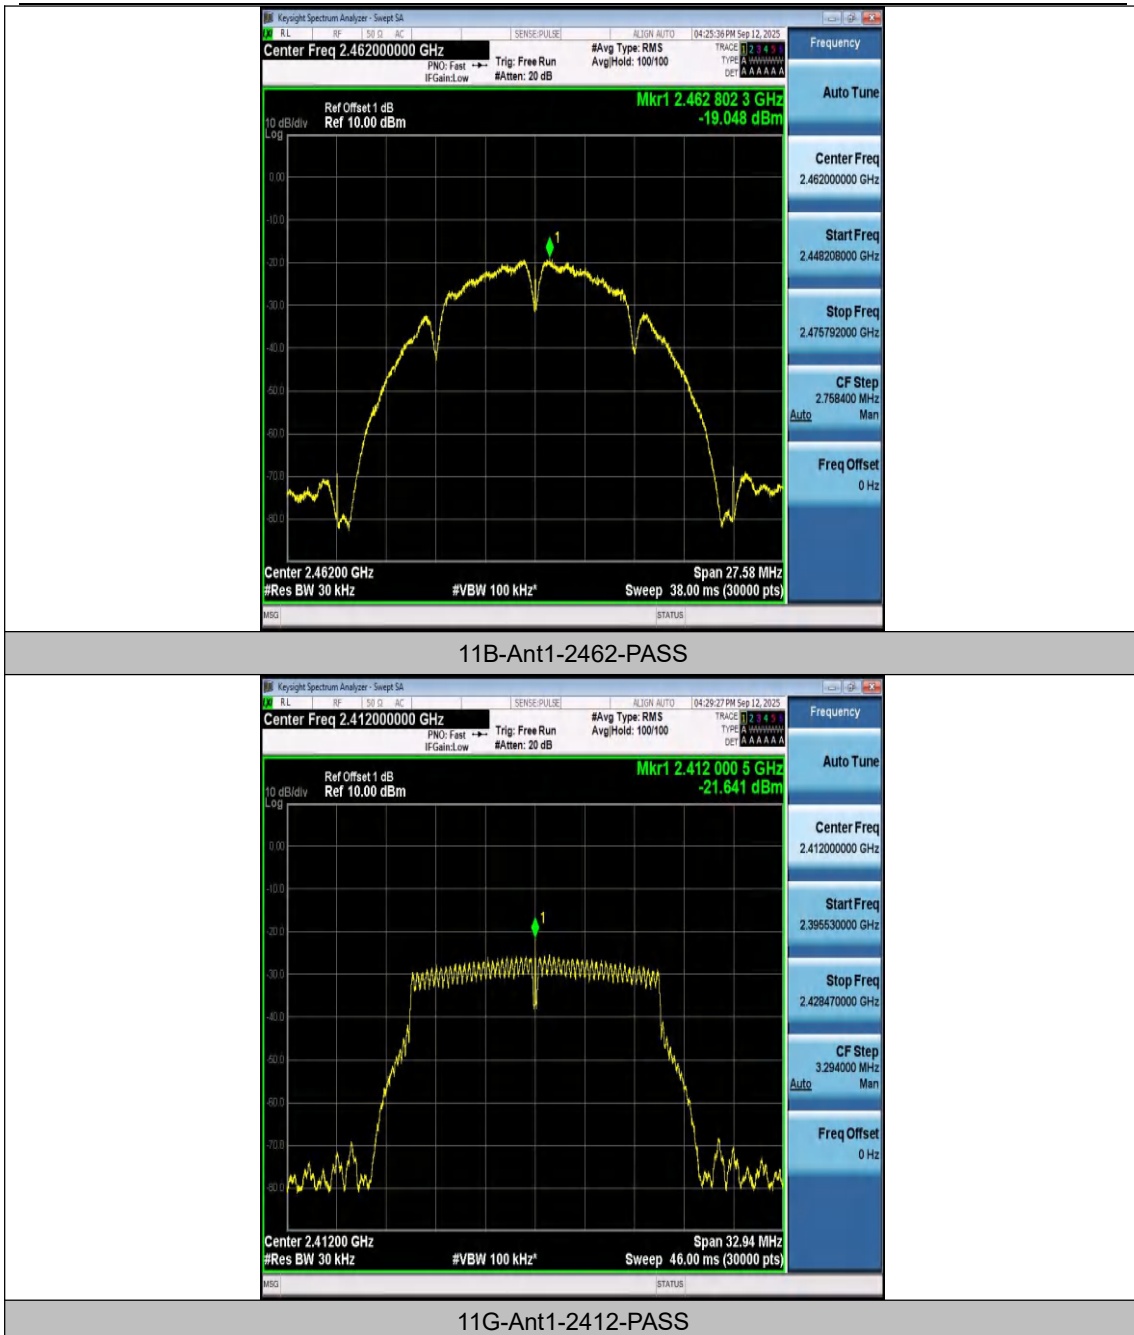

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

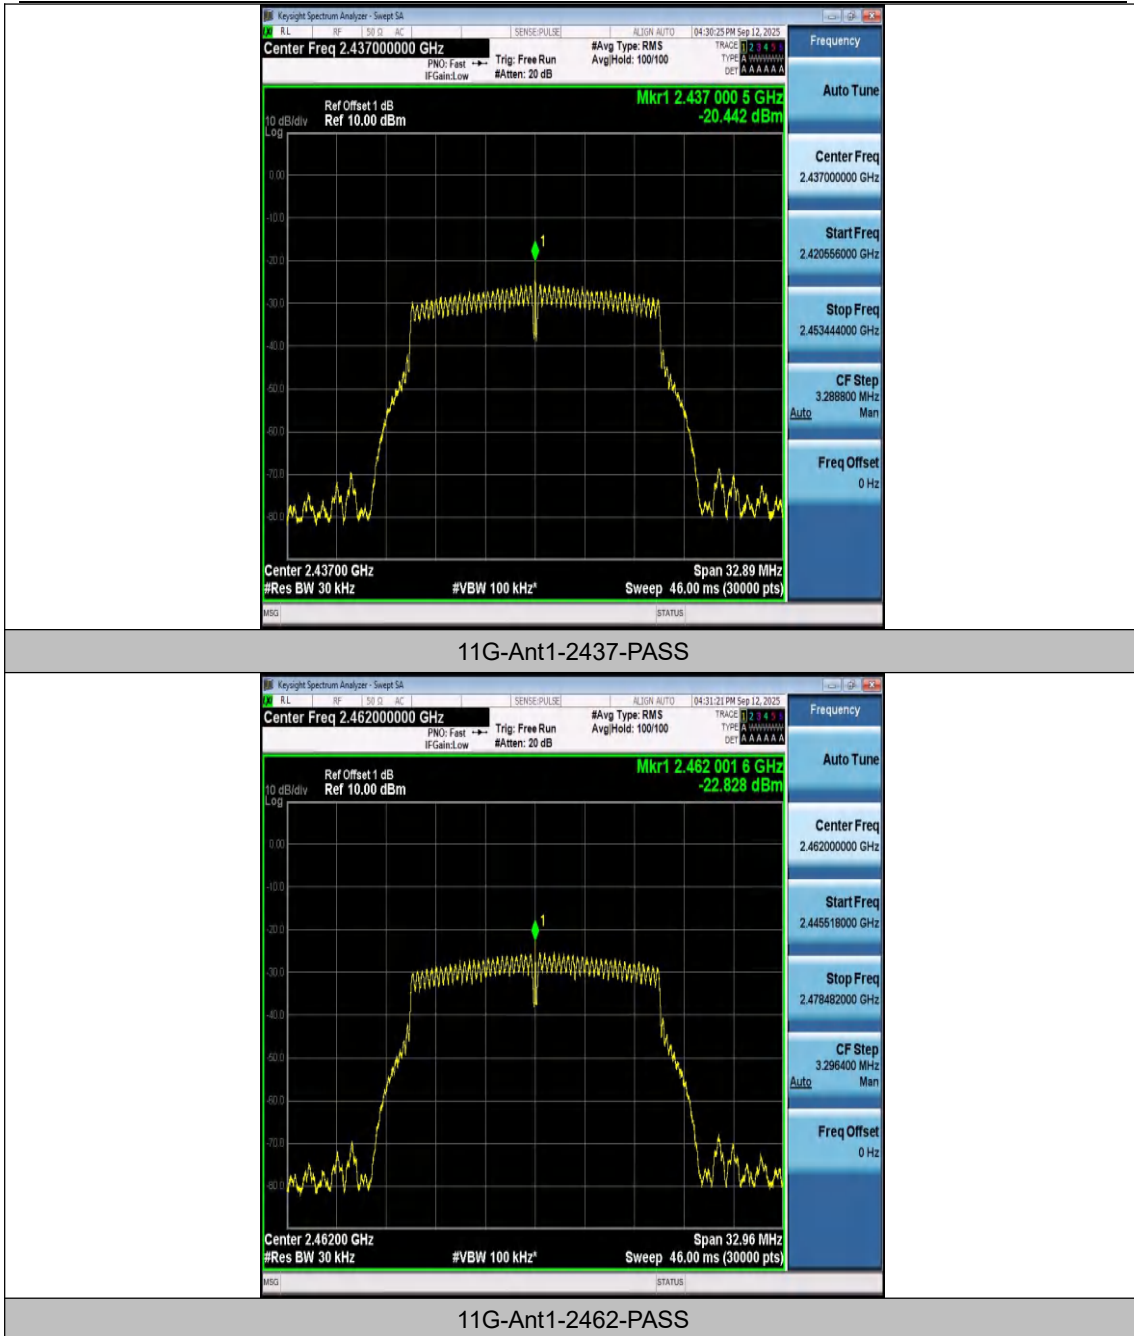

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

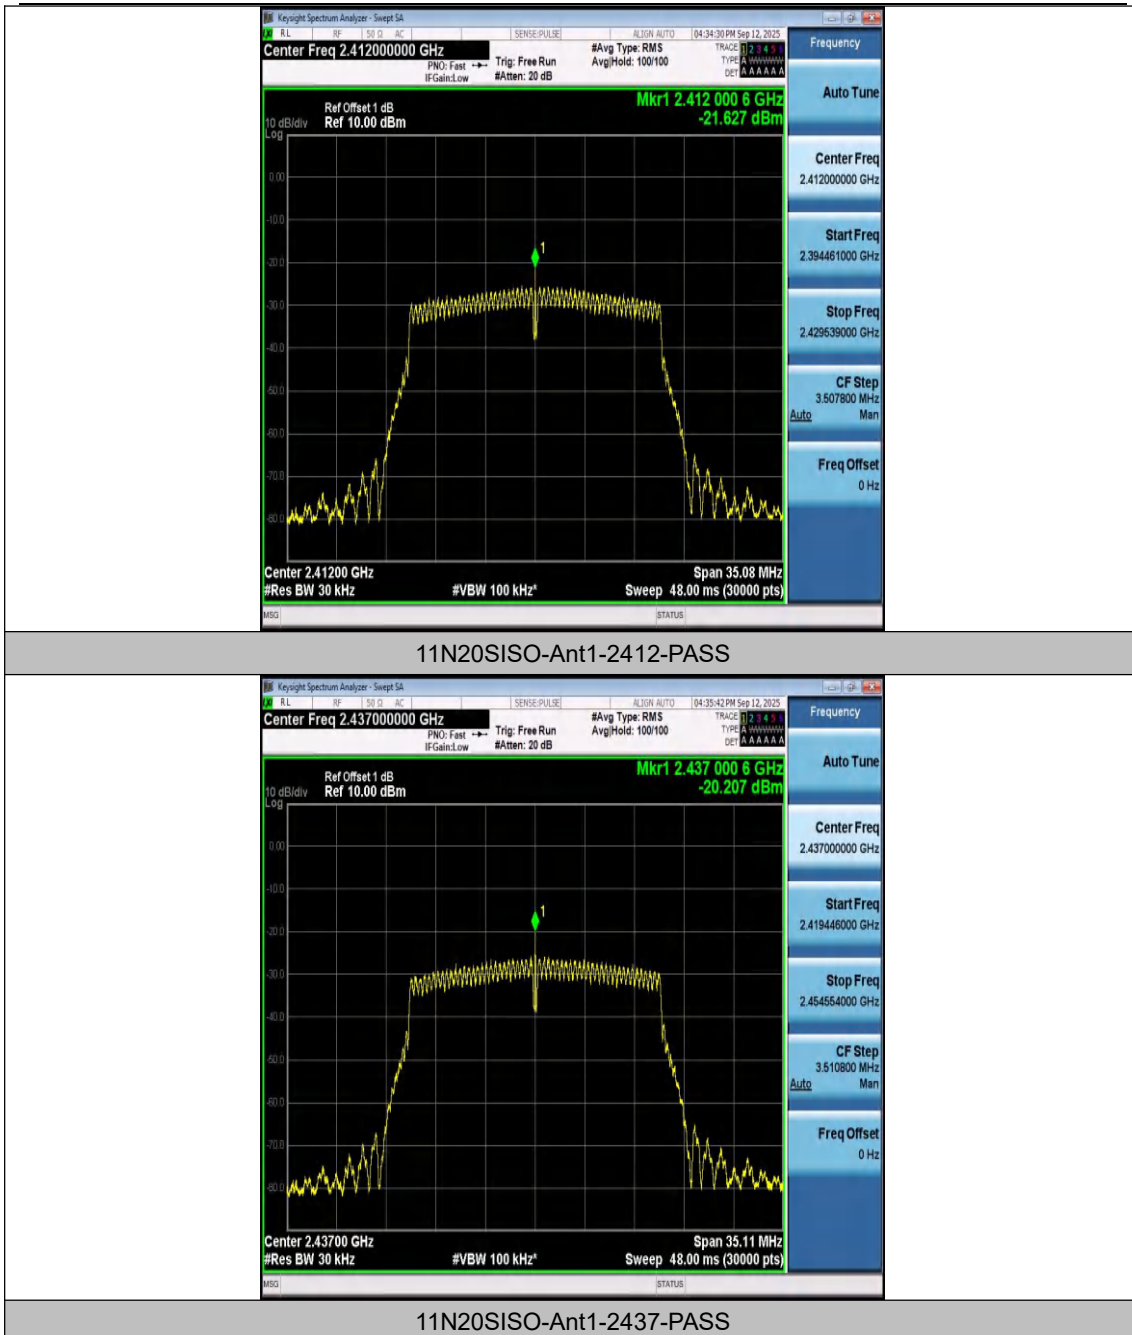

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

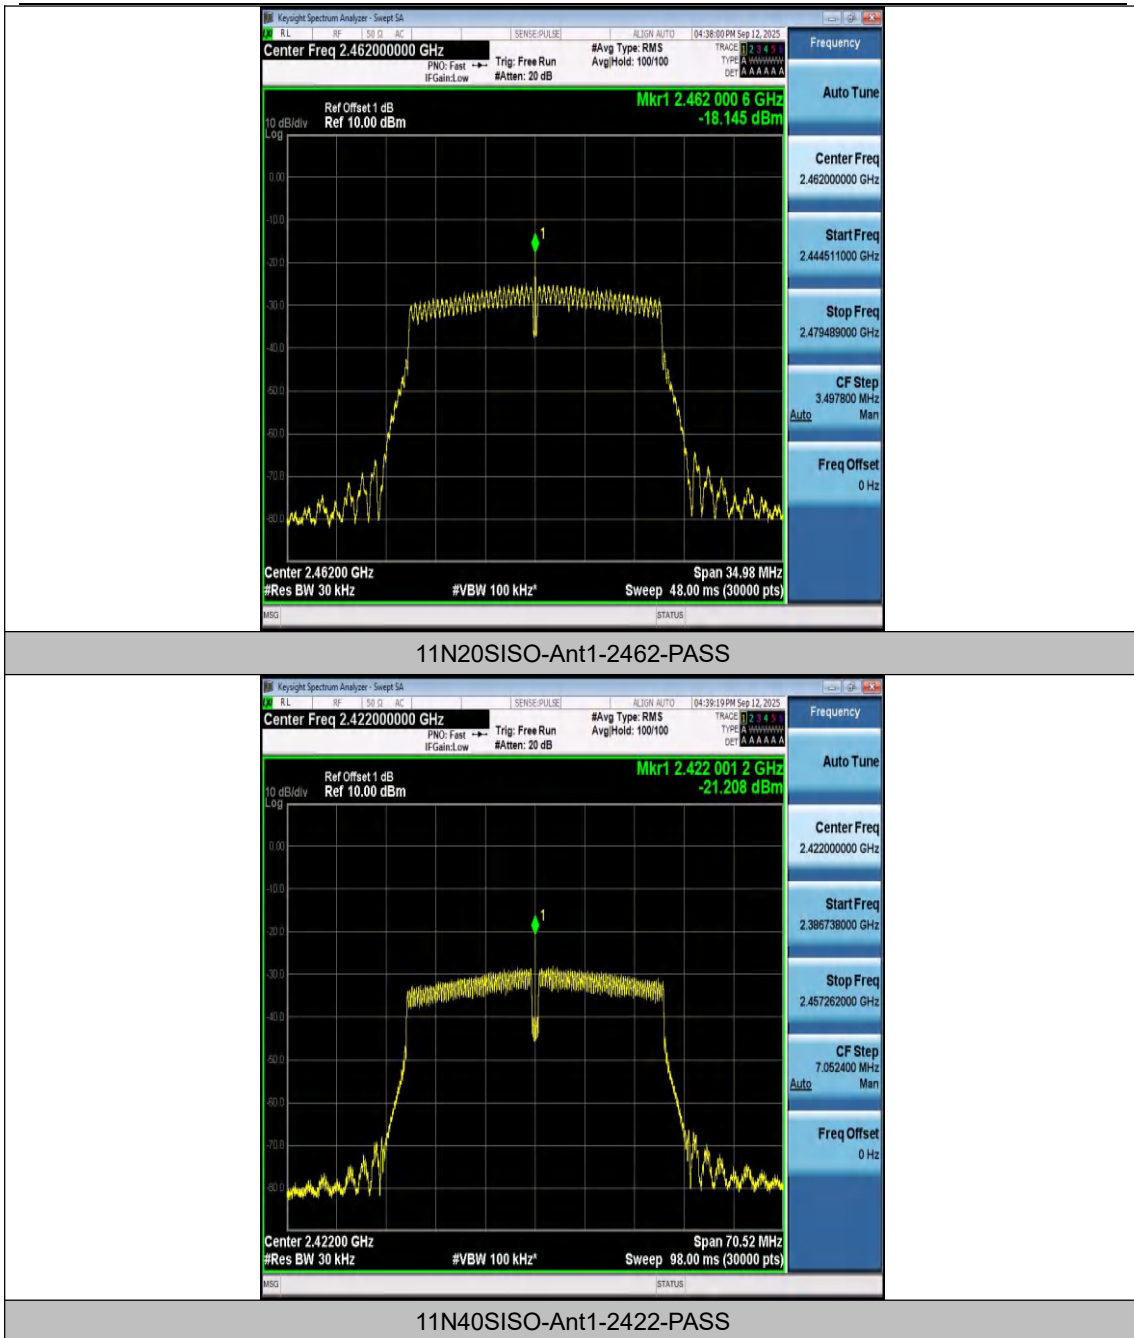

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

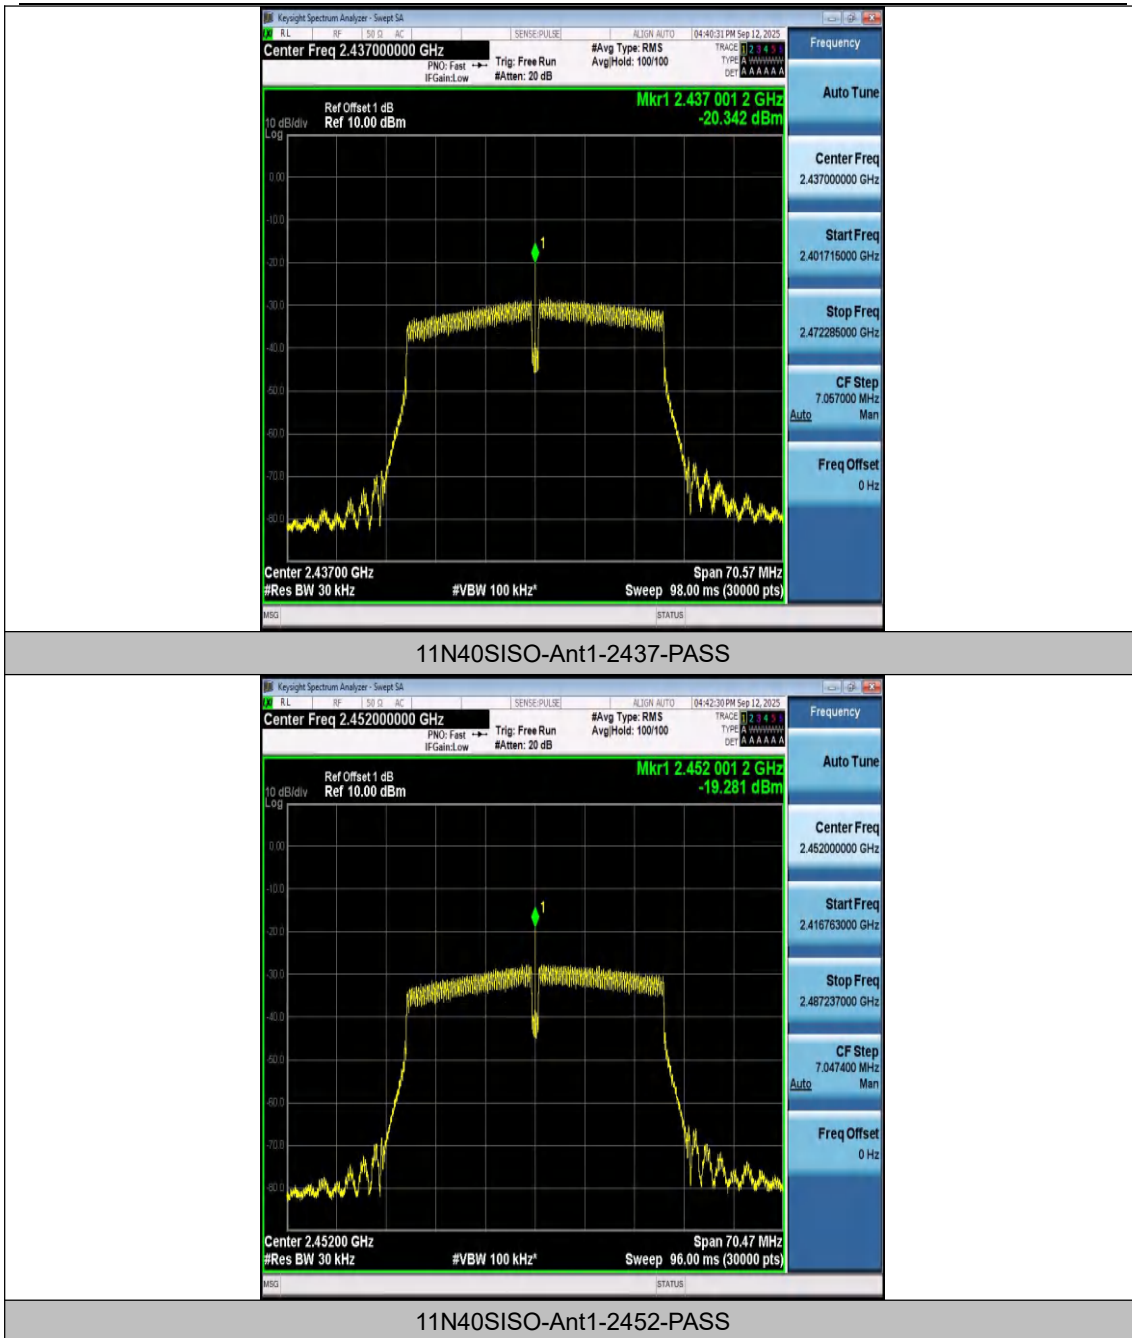

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix E: Conducted Band edge

Test Result

| Test Mode | Antenna | Ch. Name | Frequency[MHz] | Ref. Level[dBm] | Result[dBm] | Limit[dBm] | Verdict |
|-----------|---------|----------|----------------|-----------------|-------------|------------|---------|
| 11B | Ant1 | Low | 2412 | -8.61 | -50.79 | ≤-38.61 | PASS |
| 11B | Ant1 | High | 2462 | -7.68 | -45.96 | ≤-37.68 | PASS |
| 11G | Ant1 | Low | 2412 | -10.27 | -52.81 | ≤-40.27 | PASS |
| 11G | Ant1 | High | 2462 | -13.30 | -46.93 | ≤-43.3 | PASS |
| 11N20SISO | Ant1 | Low | 2412 | -12.63 | -53.22 | ≤-42.63 | PASS |
| 11N20SISO | Ant1 | High | 2462 | -9.72 | -63.01 | ≤-39.72 | PASS |
| 11N40SISO | Ant1 | Low | 2422 | -13.05 | -55.83 | ≤-43.05 | PASS |
| 11N40SISO | Ant1 | High | 2452 | -14.06 | -64.61 | ≤-44.06 | PASS |

Test Graphs

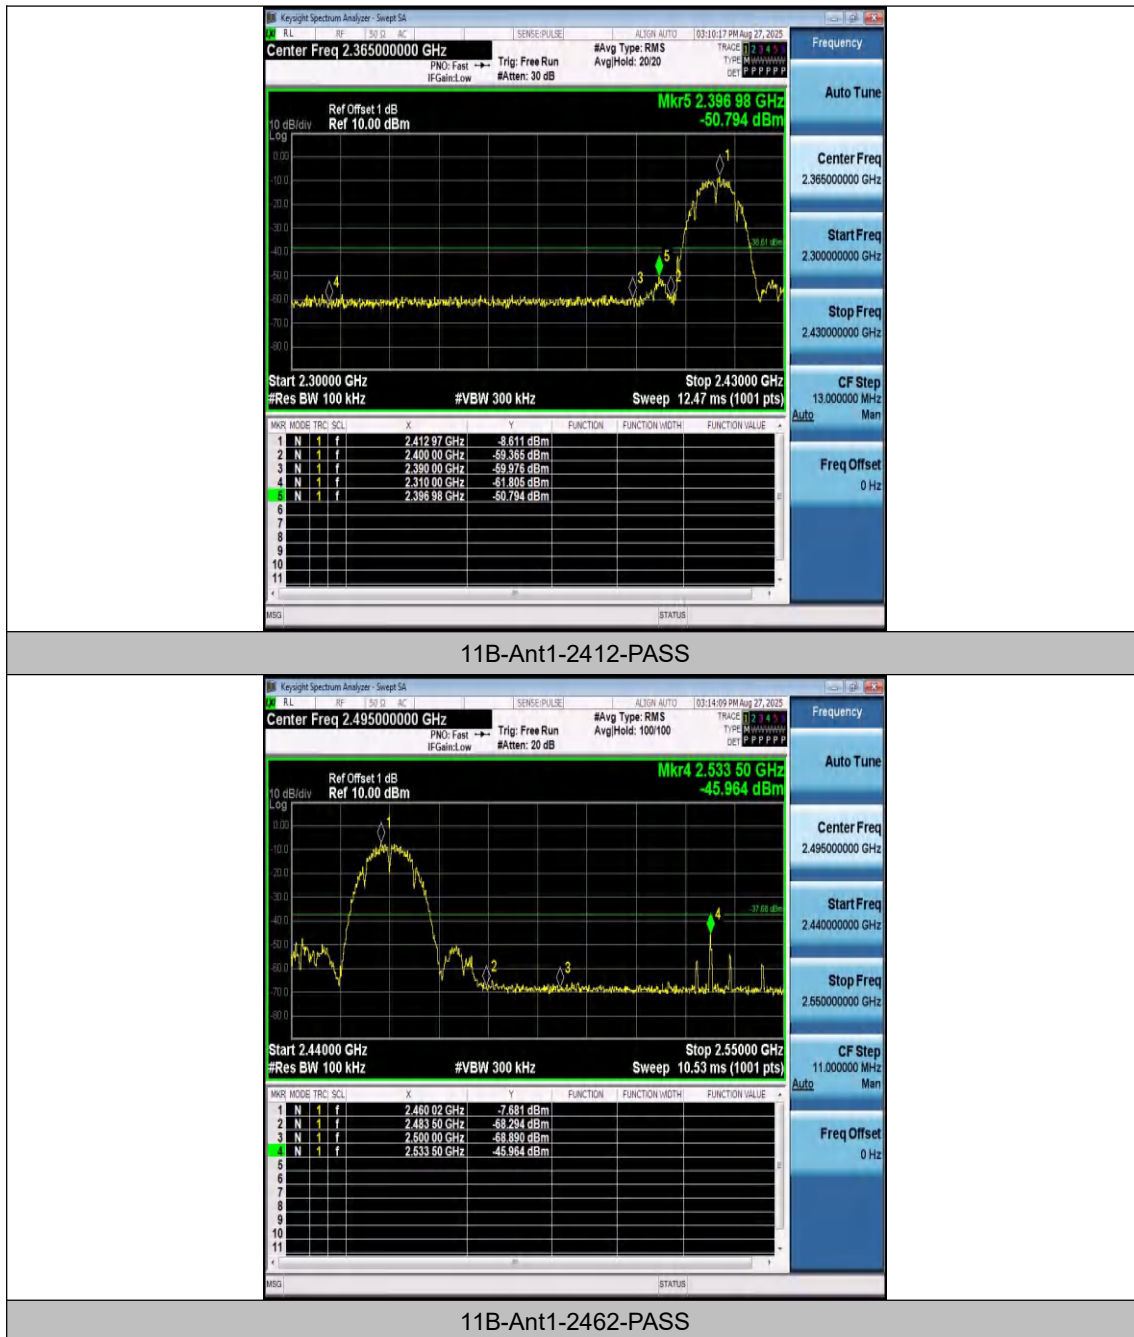


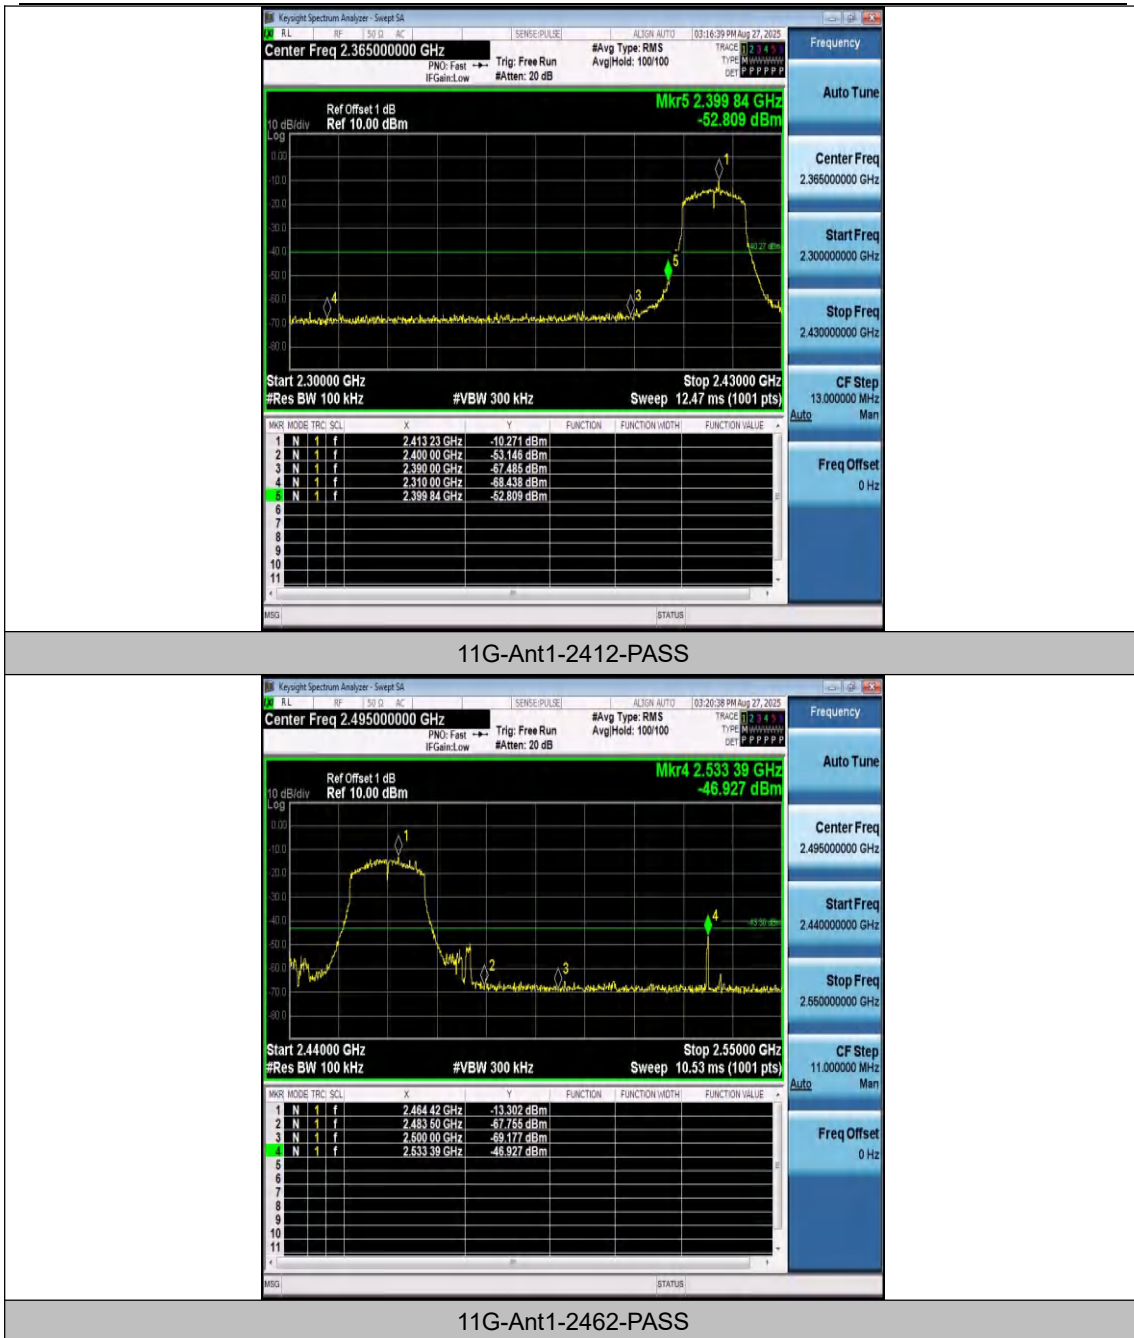


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

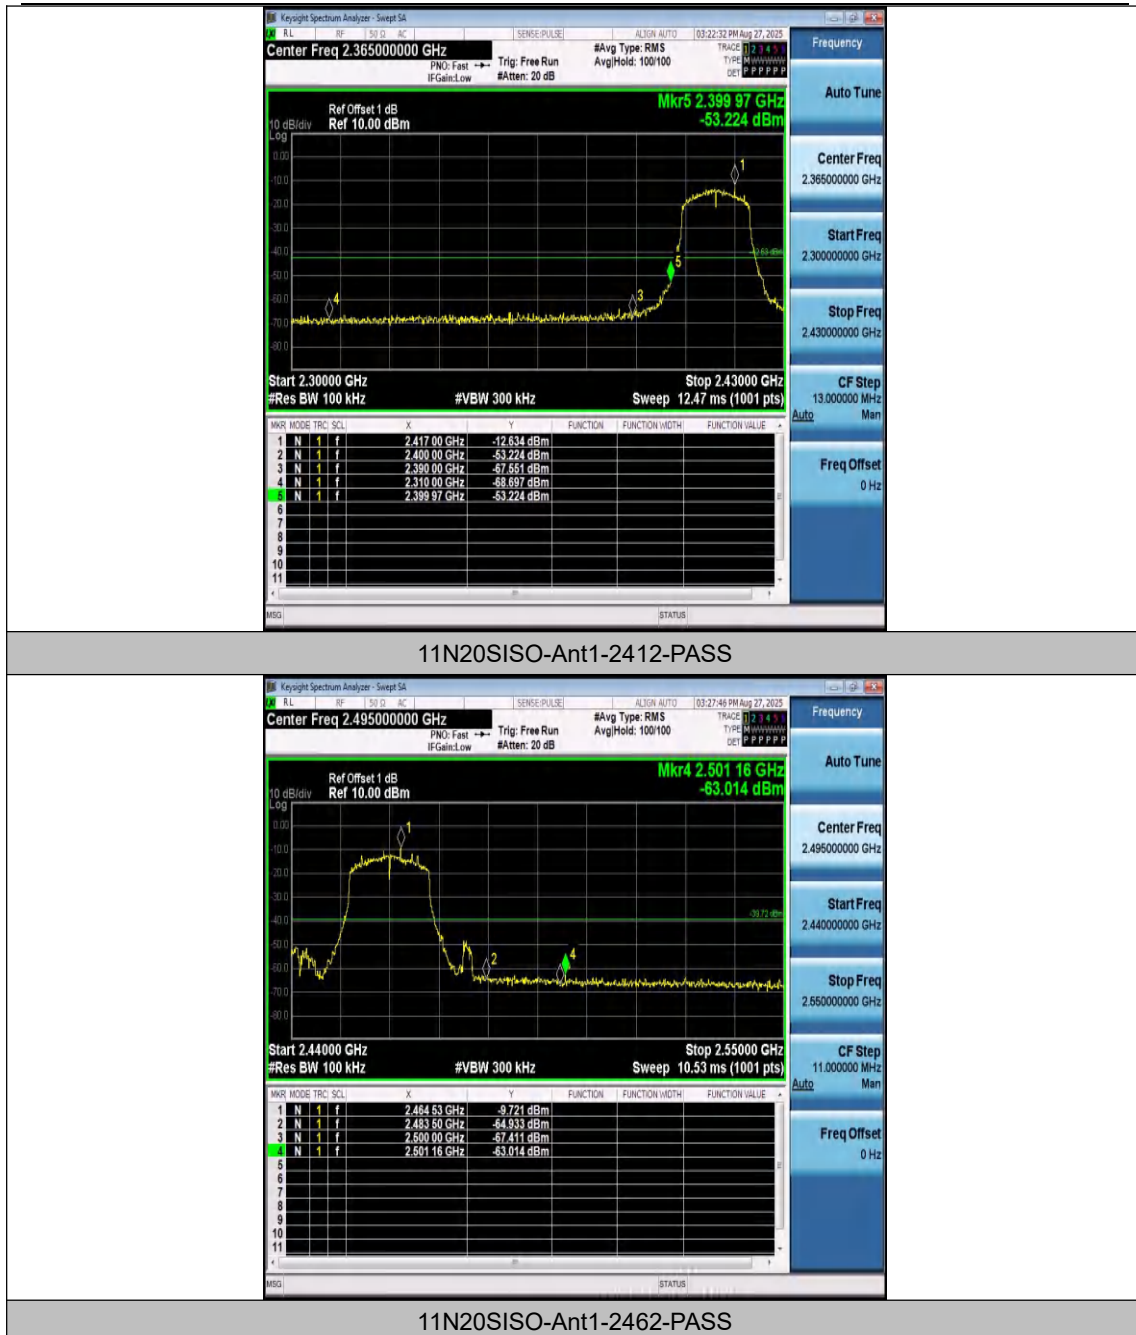

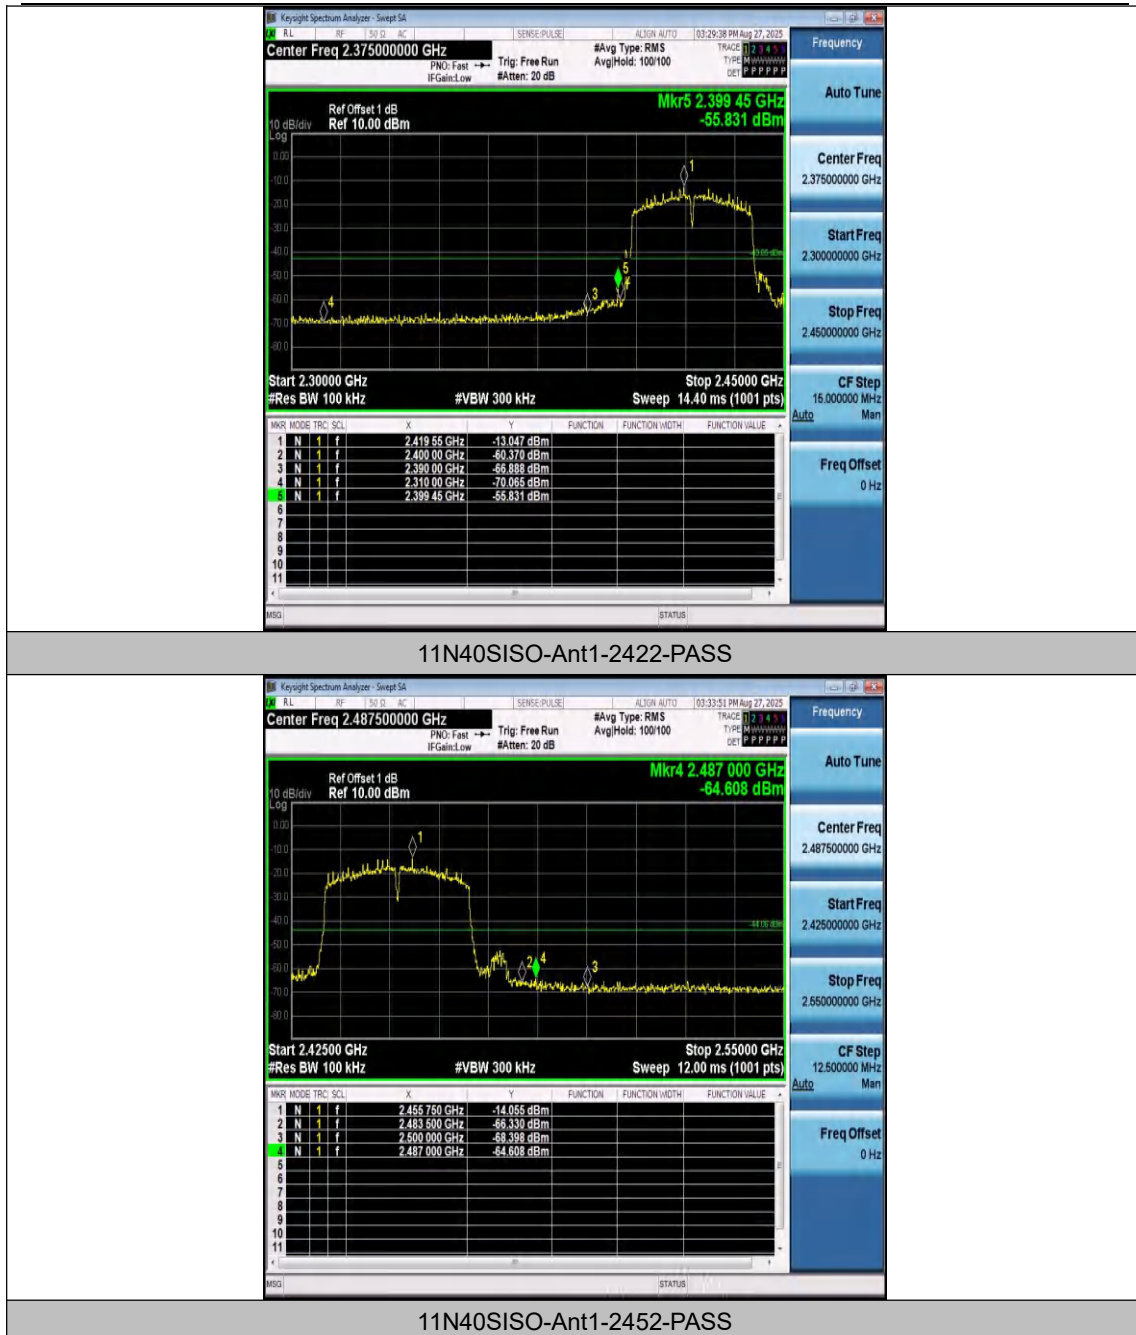

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Conducted Spurious Emission

Test Result

| Test Mode | Antenna | Frequency [MHz] | Freq. Range [Mhz] | Ref. Level [dBm] | Result [dBm] | Limit [dBm] | Verdict |
|-----------|---------|-----------------|-------------------|------------------|--------------|-------------|---------|
| 11B | Ant1 | 2412 | 0~Reference | -8.32 | -8.32 | --- | PASS |
| 11B | Ant1 | 2412 | 30~1000 | -8.32 | -66.54 | ≤-38.32 | PASS |
| 11B | Ant1 | 2412 | 1000~26500 | -8.32 | -53.36 | ≤-38.32 | PASS |
| 11B | Ant1 | 2437 | 0~Reference | -6.69 | -6.69 | --- | PASS |
| 11B | Ant1 | 2437 | 30~1000 | -6.69 | -64.93 | ≤-36.69 | PASS |
| 11B | Ant1 | 2437 | 1000~26500 | -6.69 | -53.79 | ≤-36.69 | PASS |
| 11B | Ant1 | 2462 | 0~Reference | -7.17 | -7.17 | --- | PASS |
| 11B | Ant1 | 2462 | 30~1000 | -7.17 | -65.61 | ≤-37.17 | PASS |
| 11B | Ant1 | 2462 | 1000~26500 | -7.17 | -53.63 | ≤-37.17 | PASS |
| 11G | Ant1 | 2412 | 0~Reference | -12.62 | -12.62 | --- | PASS |
| 11G | Ant1 | 2412 | 30~1000 | -12.62 | -68.05 | ≤-42.62 | PASS |
| 11G | Ant1 | 2412 | 1000~26500 | -12.62 | -53.93 | ≤-42.62 | PASS |
| 11G | Ant1 | 2437 | 0~Reference | -11.76 | -11.76 | --- | PASS |
| 11G | Ant1 | 2437 | 30~1000 | -11.76 | -67.52 | ≤-41.76 | PASS |
| 11G | Ant1 | 2437 | 1000~26500 | -11.76 | -46.39 | ≤-41.76 | PASS |
| 11G | Ant1 | 2462 | 0~Reference | -12.13 | -12.13 | --- | PASS |
| 11G | Ant1 | 2462 | 30~1000 | -12.13 | -68.48 | ≤-42.13 | PASS |
| 11G | Ant1 | 2462 | 1000~26500 | -12.13 | -49.05 | ≤-42.13 | PASS |
| 11N20SISO | Ant1 | 2412 | 0~Reference | -10.40 | -10.40 | --- | PASS |
| 11N20SISO | Ant1 | 2412 | 30~1000 | -10.40 | -67.7 | ≤-40.4 | PASS |
| 11N20SISO | Ant1 | 2412 | 1000~26500 | -10.40 | -53.44 | ≤-40.4 | PASS |
| 11N20SISO | Ant1 | 2437 | 0~Reference | -14.05 | -14.05 | --- | PASS |
| 11N20SISO | Ant1 | 2437 | 30~1000 | -14.05 | -66.67 | ≤-44.05 | PASS |
| 11N20SISO | Ant1 | 2437 | 1000~26500 | -14.05 | -44.27 | ≤-44.05 | PASS |
| 11N20SISO | Ant1 | 2462 | 0~Reference | -9.80 | -9.80 | --- | PASS |
| 11N20SISO | Ant1 | 2462 | 30~1000 | -9.80 | -67.56 | ≤-39.8 | PASS |
| 11N20SISO | Ant1 | 2462 | 1000~26500 | -9.80 | -46.25 | ≤-39.8 | PASS |
| 11N40SISO | Ant1 | 2422 | 0~Reference | -12.76 | -12.76 | --- | PASS |
| 11N40SISO | Ant1 | 2422 | 30~1000 | -12.76 | -67.69 | ≤-42.76 | PASS |
| 11N40SISO | Ant1 | 2422 | 1000~26500 | -12.76 | -43.34 | ≤-42.76 | PASS |
| 11N40SISO | Ant1 | 2437 | 0~Reference | -13.79 | -13.79 | --- | PASS |
| 11N40SISO | Ant1 | 2437 | 30~1000 | -13.79 | -64.75 | ≤-43.79 | PASS |
| 11N40SISO | Ant1 | 2437 | 1000~26500 | -13.79 | -53.4 | ≤-43.79 | PASS |
| 11N40SISO | Ant1 | 2452 | 0~Reference | -14.39 | -14.39 | --- | PASS |
| 11N40SISO | Ant1 | 2452 | 30~1000 | -14.39 | -66.77 | ≤-44.39 | PASS |
| 11N40SISO | Ant1 | 2452 | 1000~26500 | -14.39 | -53.43 | ≤-44.39 | PASS |


Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'Input Correction' of the Spectrum Analyzer during the test.

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

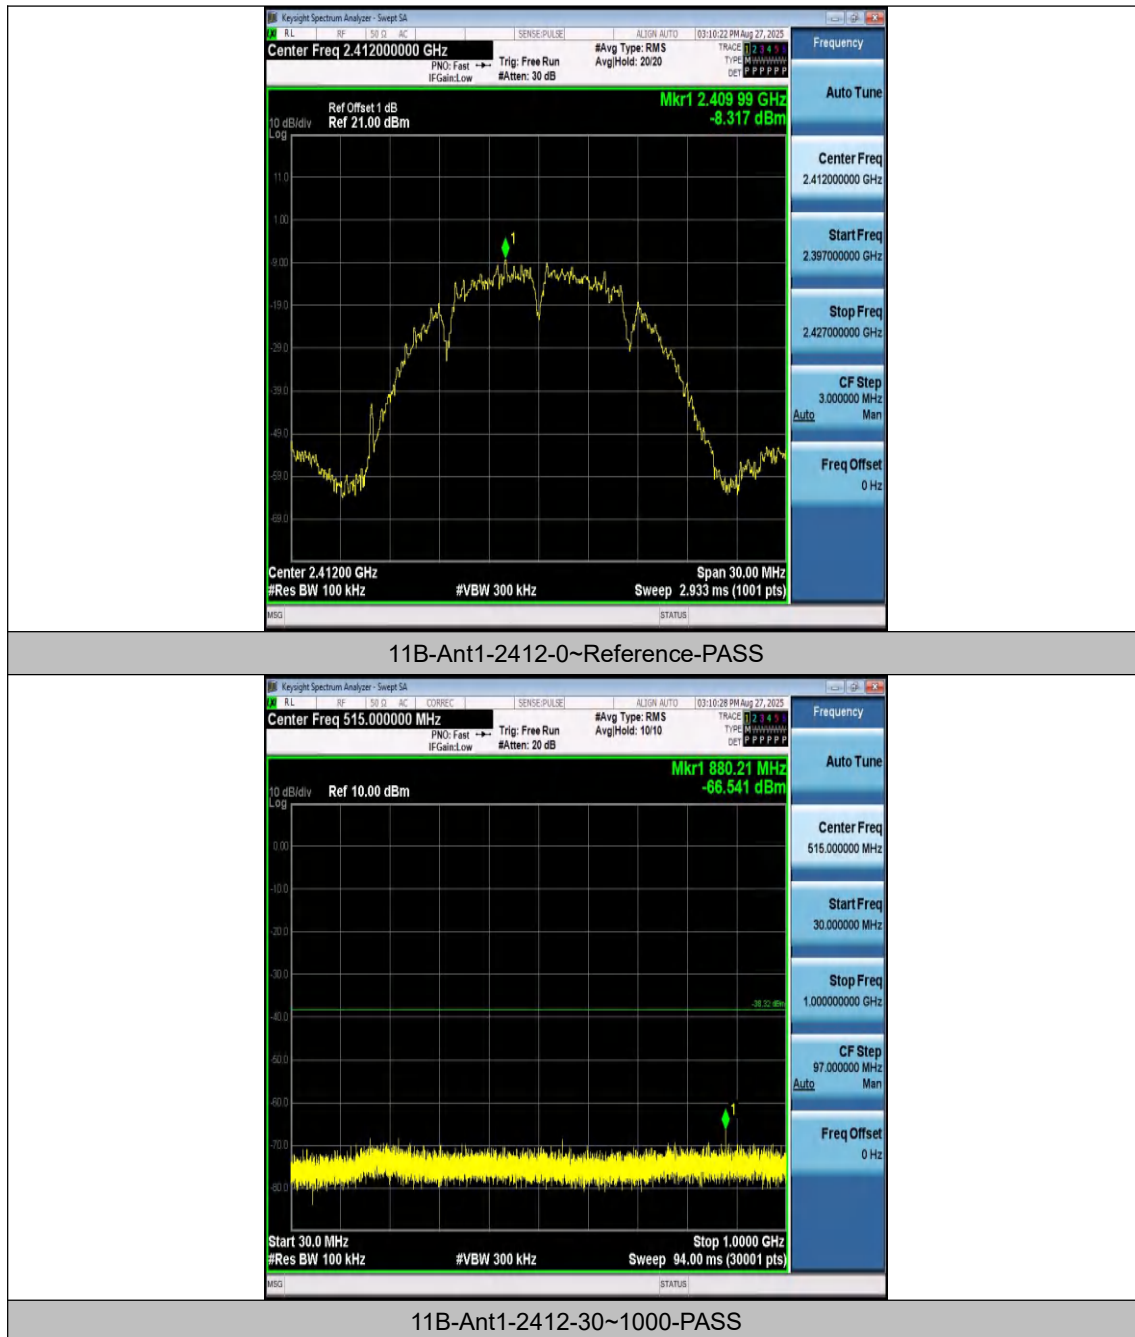

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

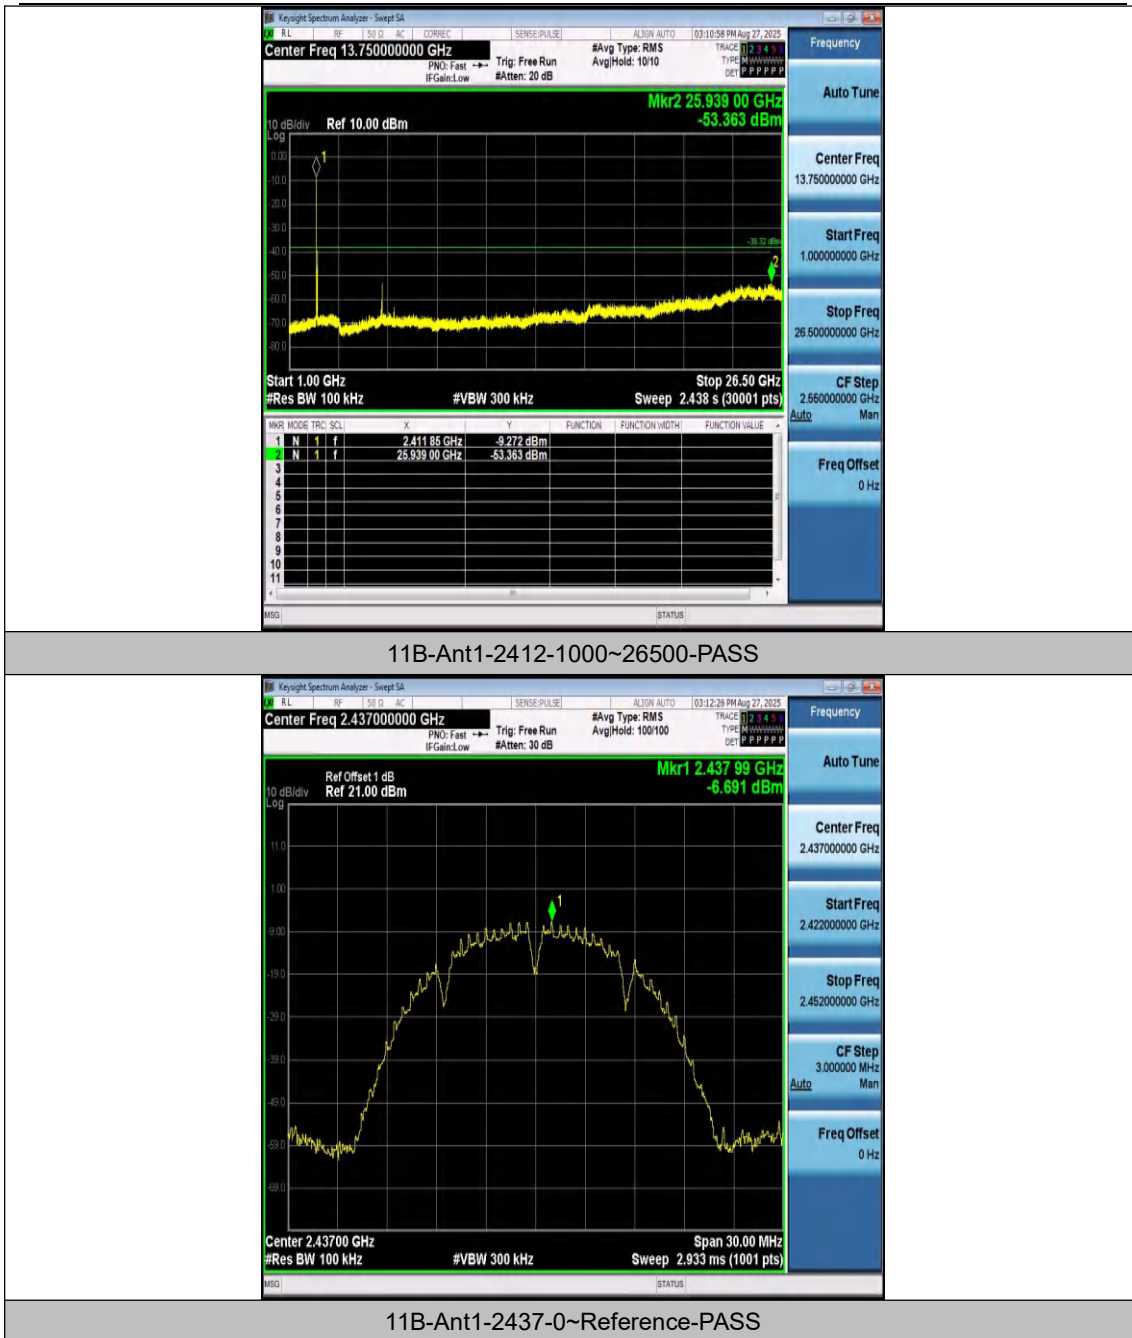

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

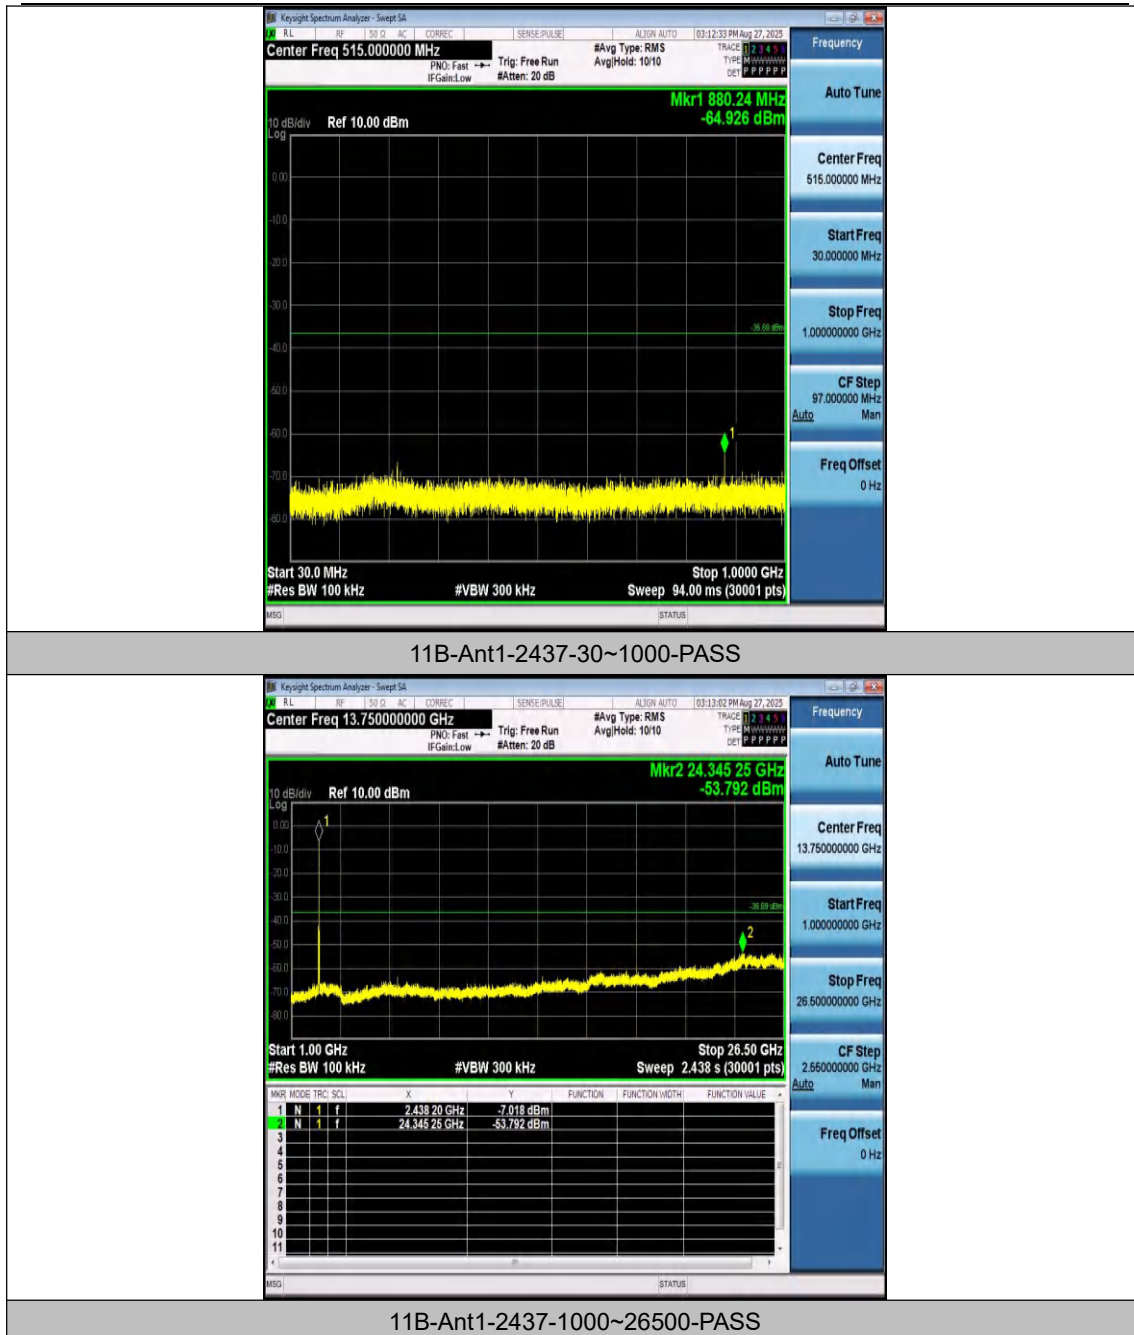

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

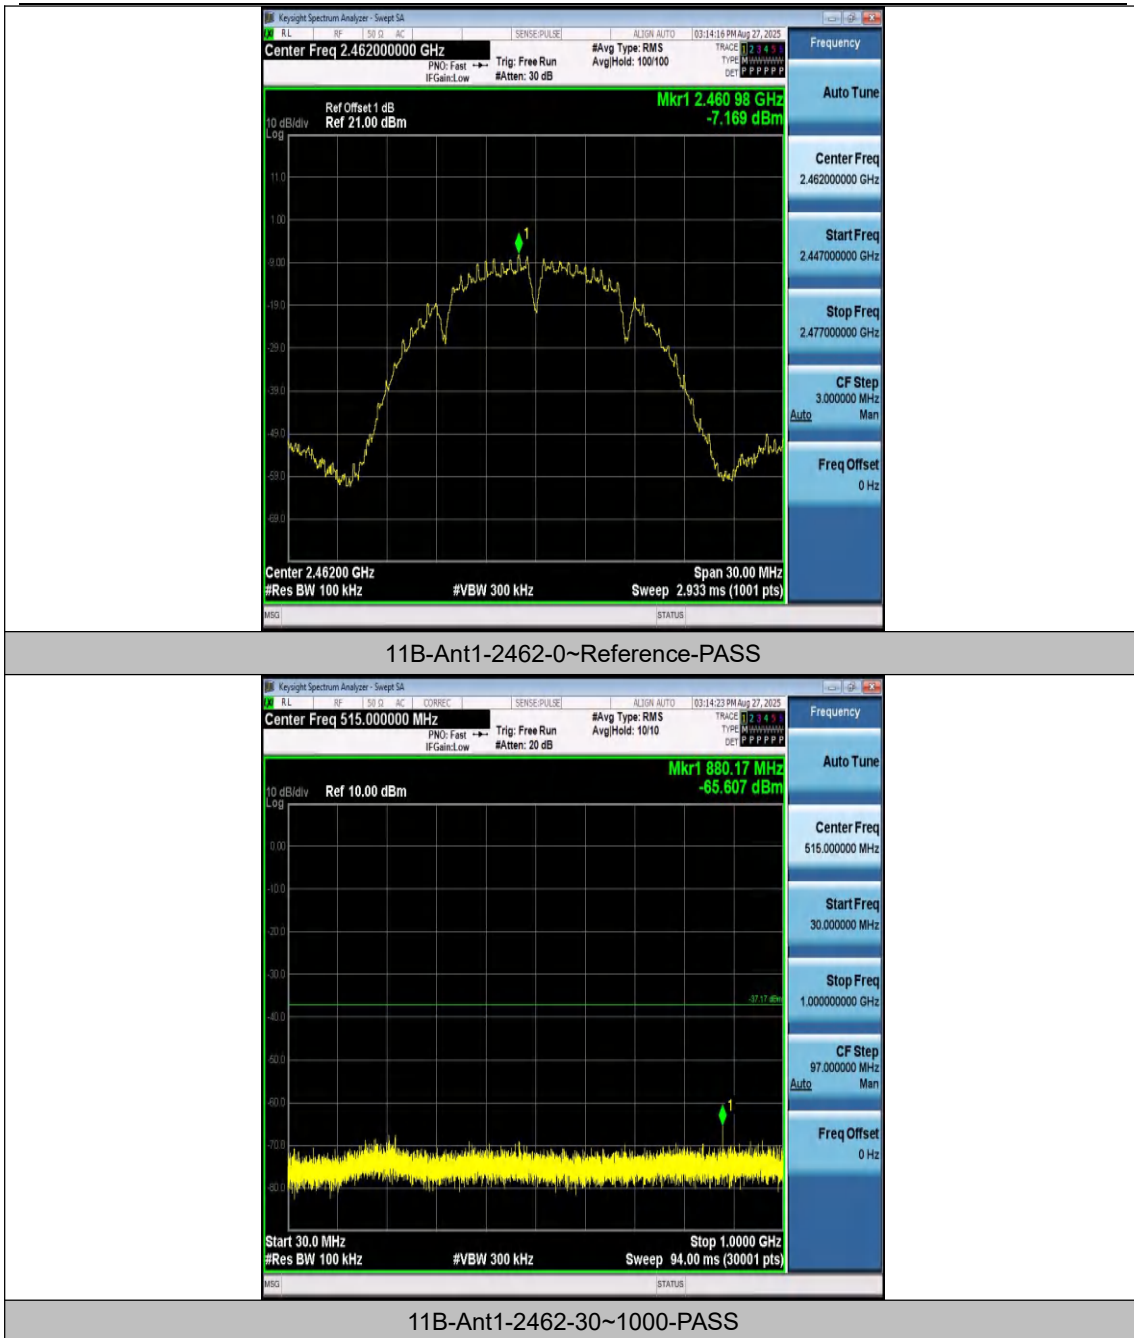

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

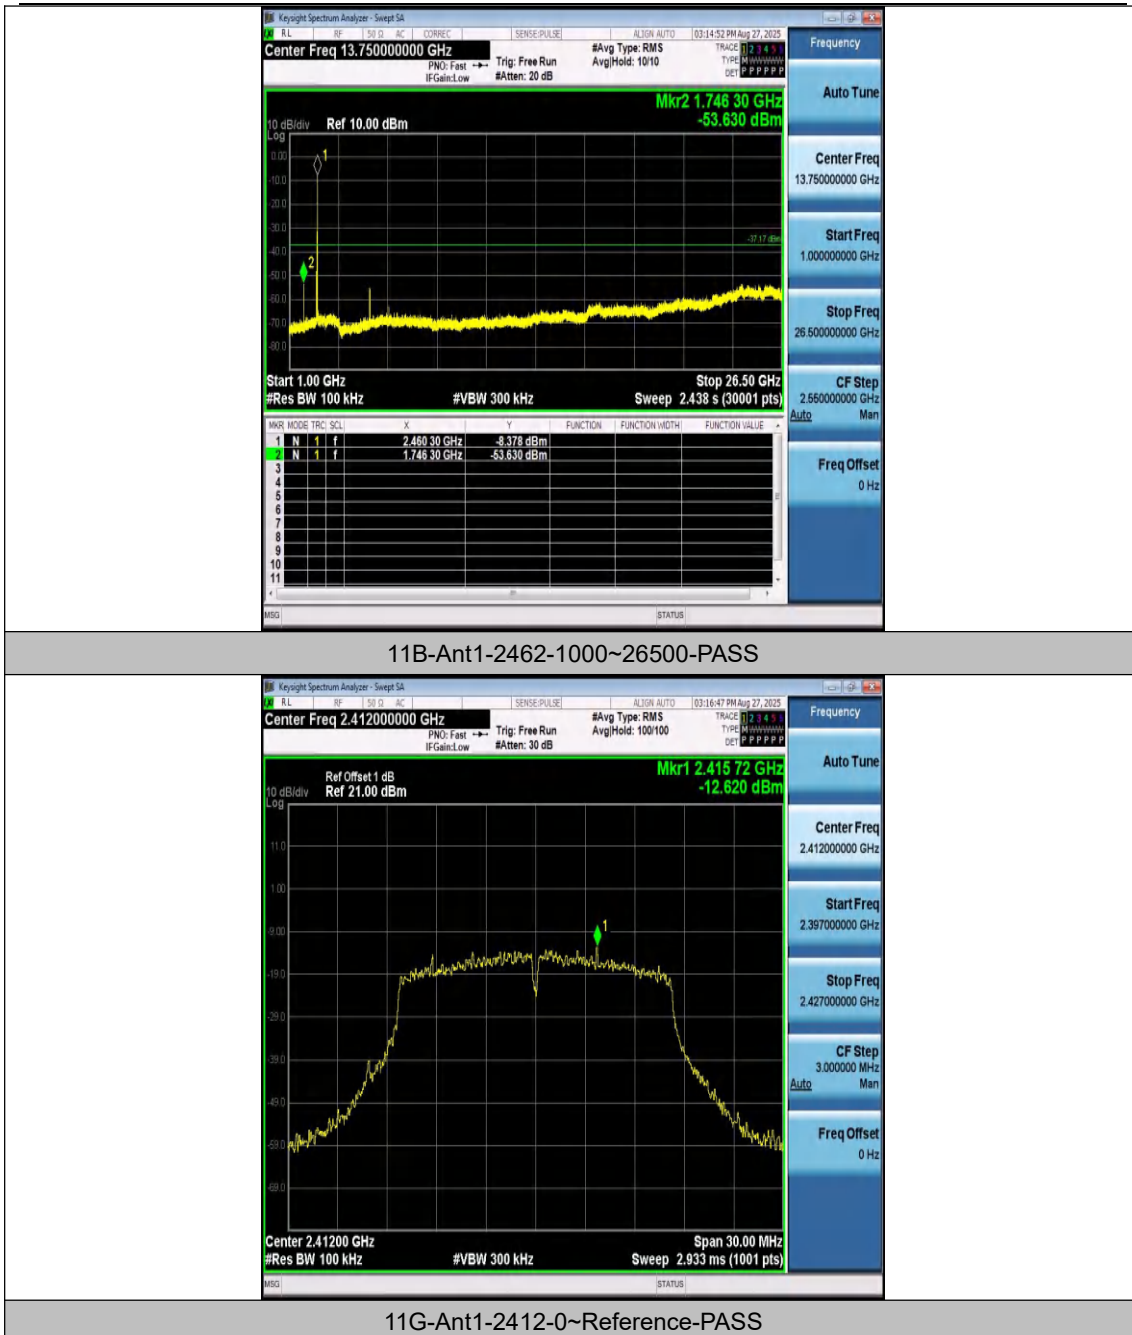

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

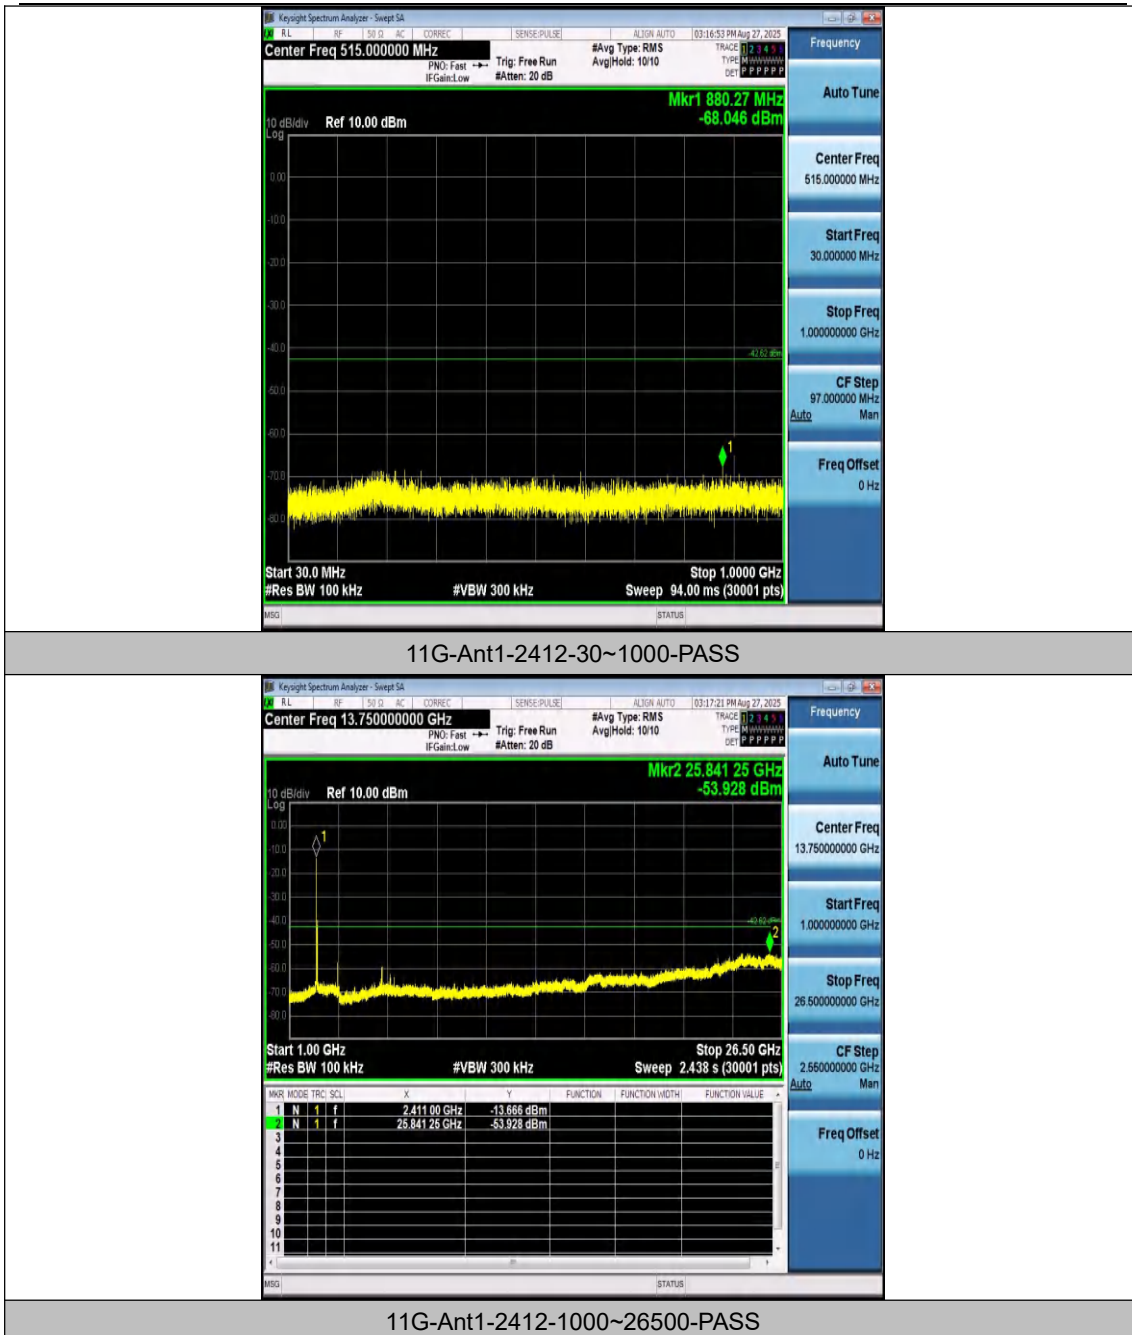

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

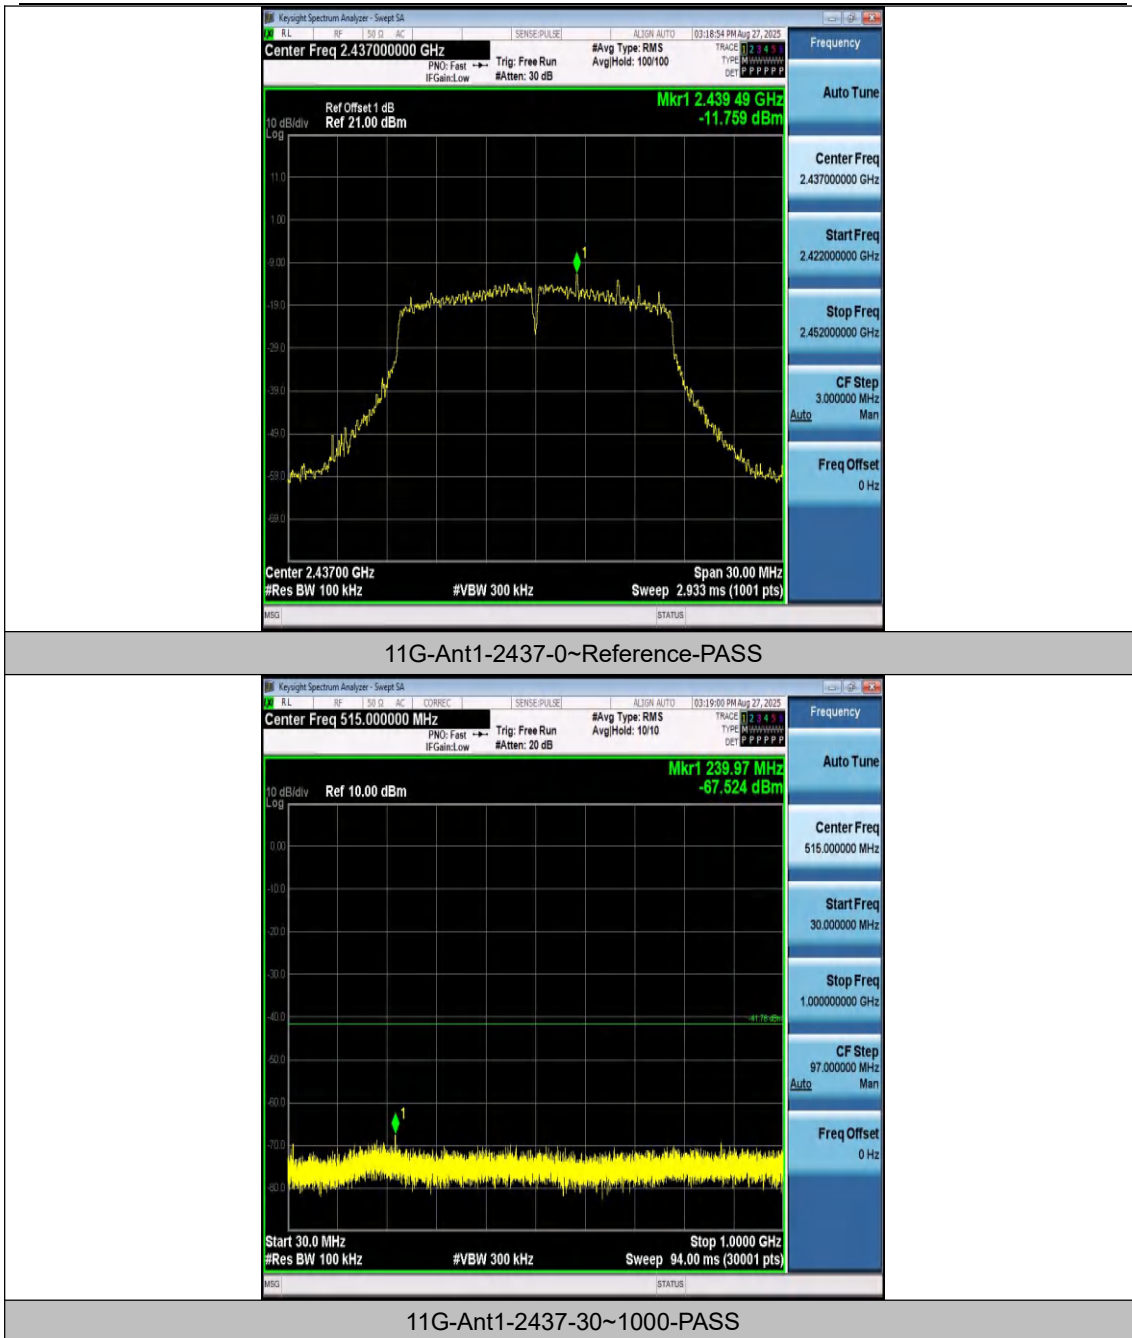

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

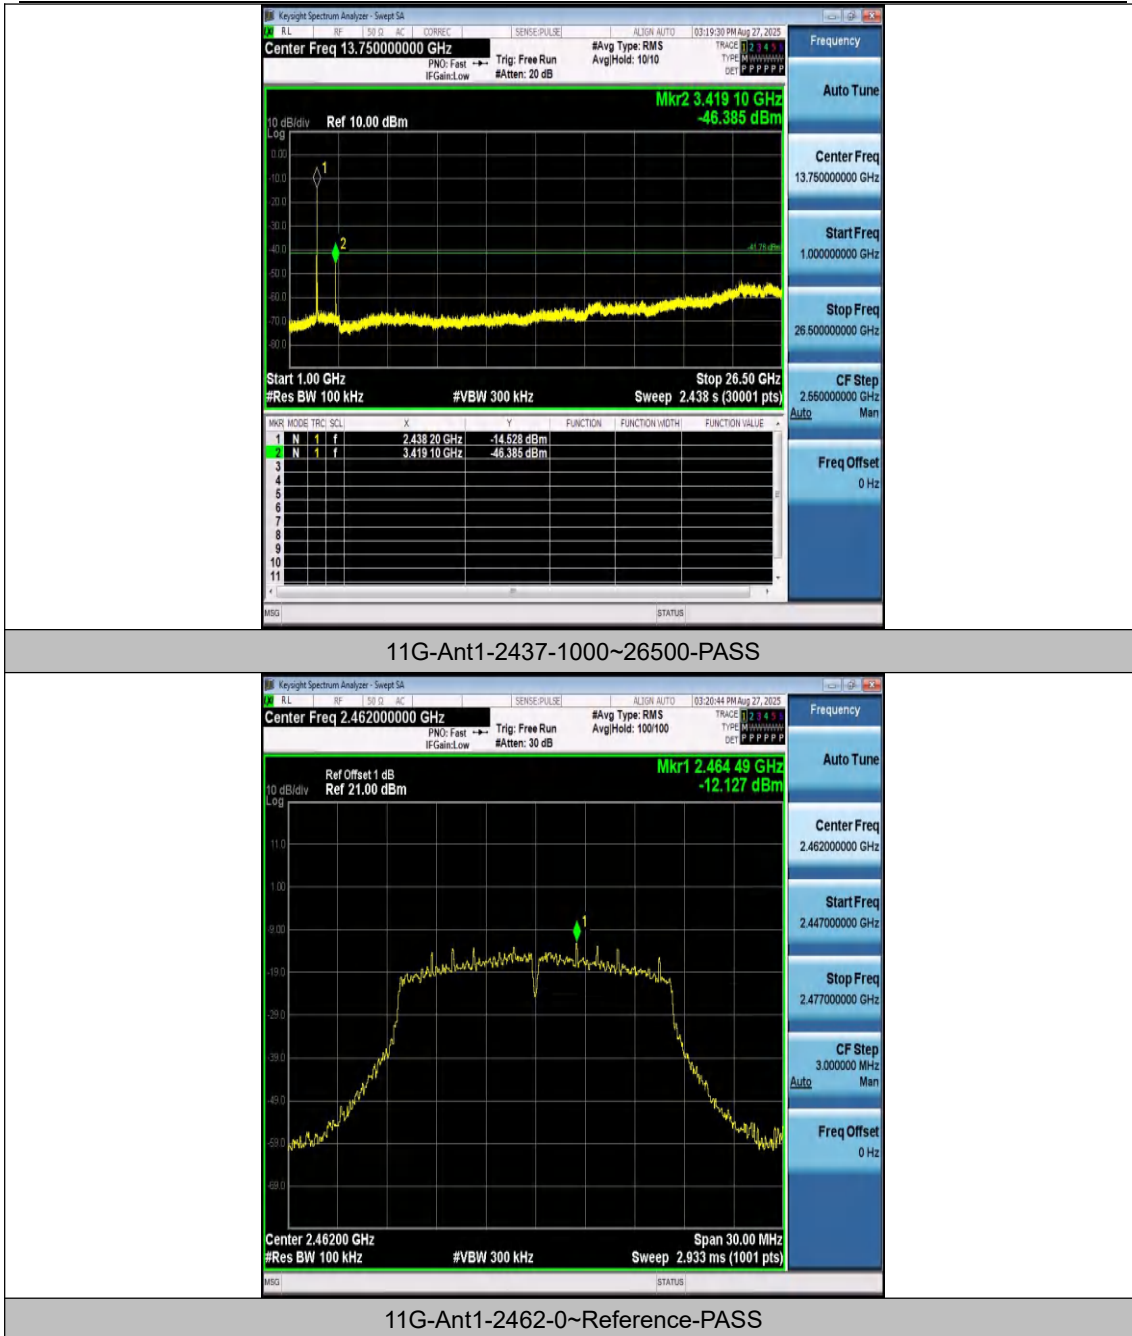

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

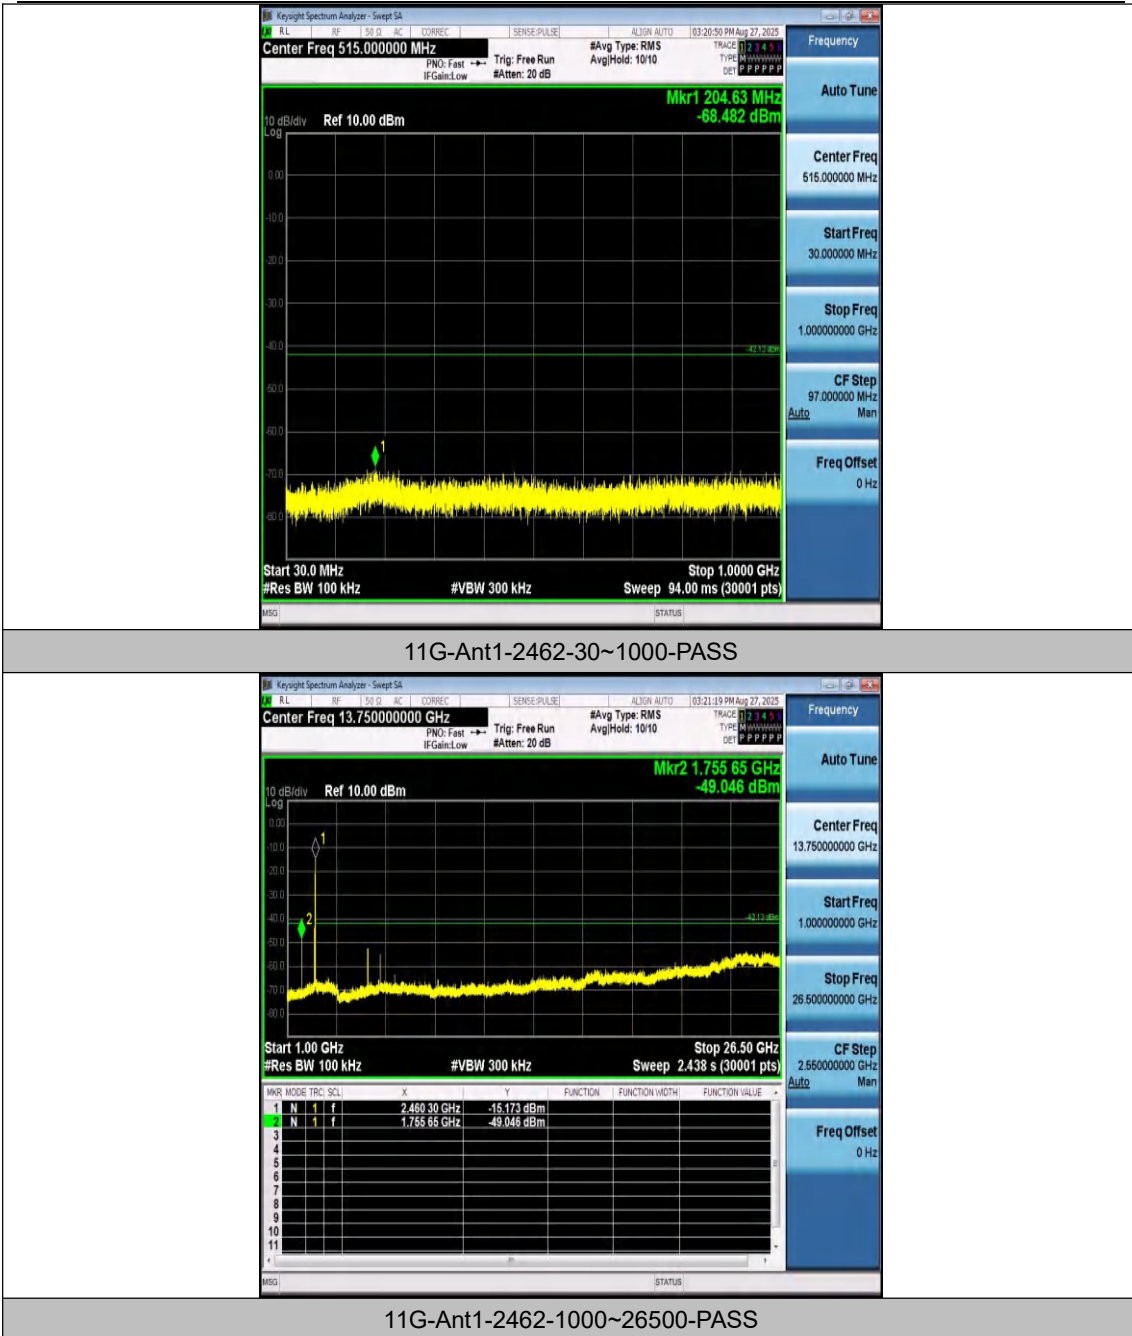

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

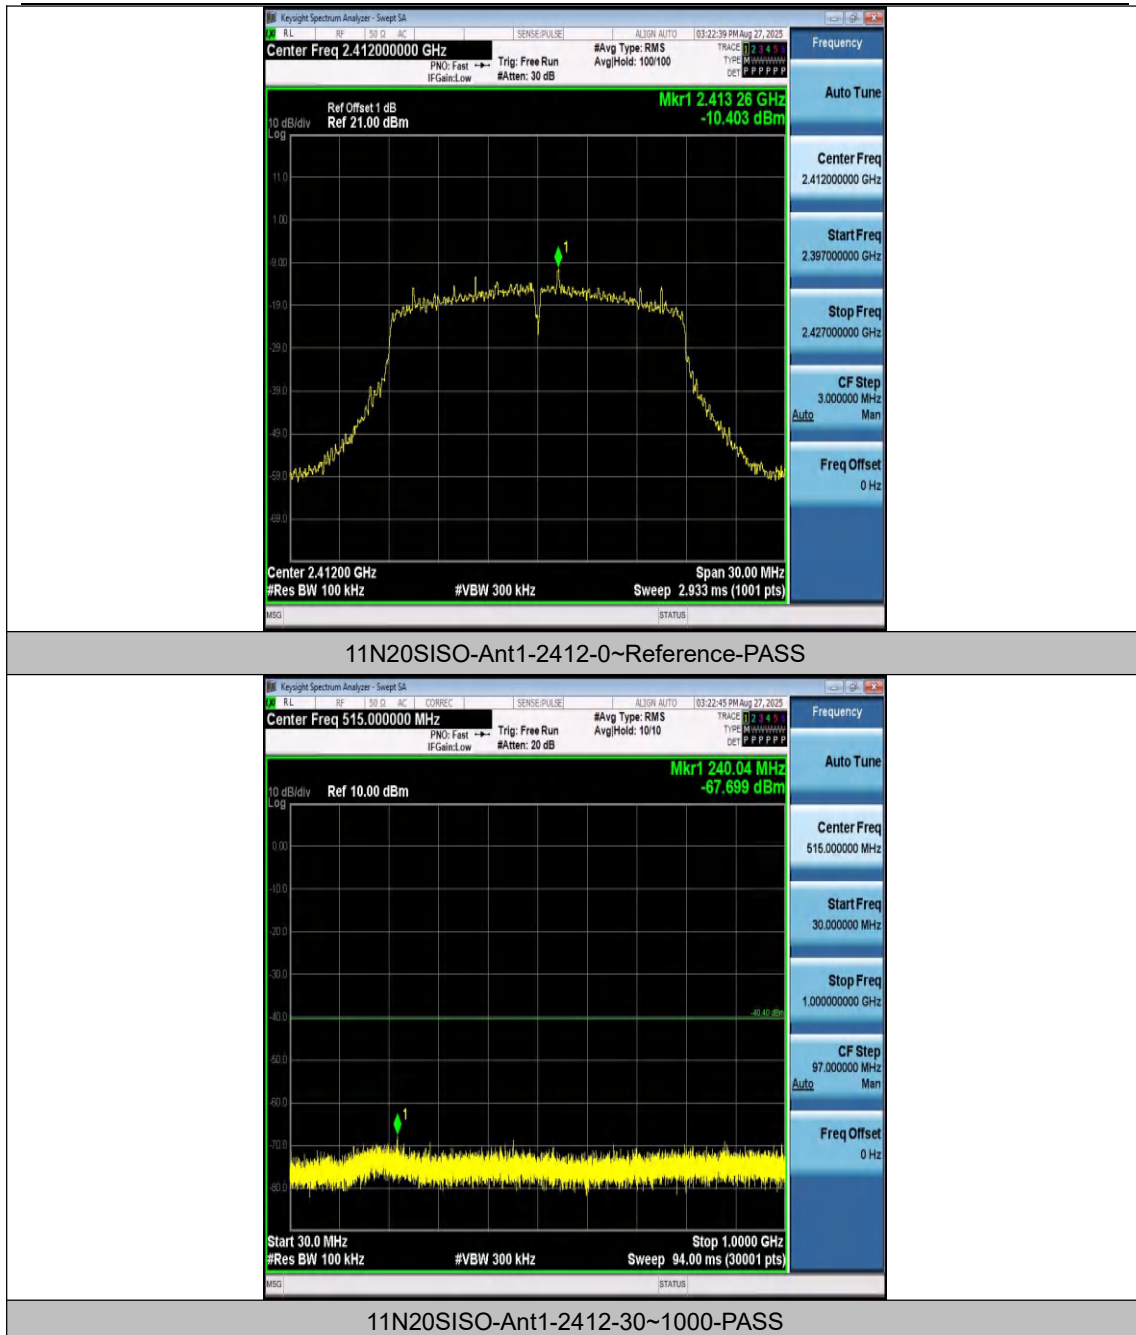

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

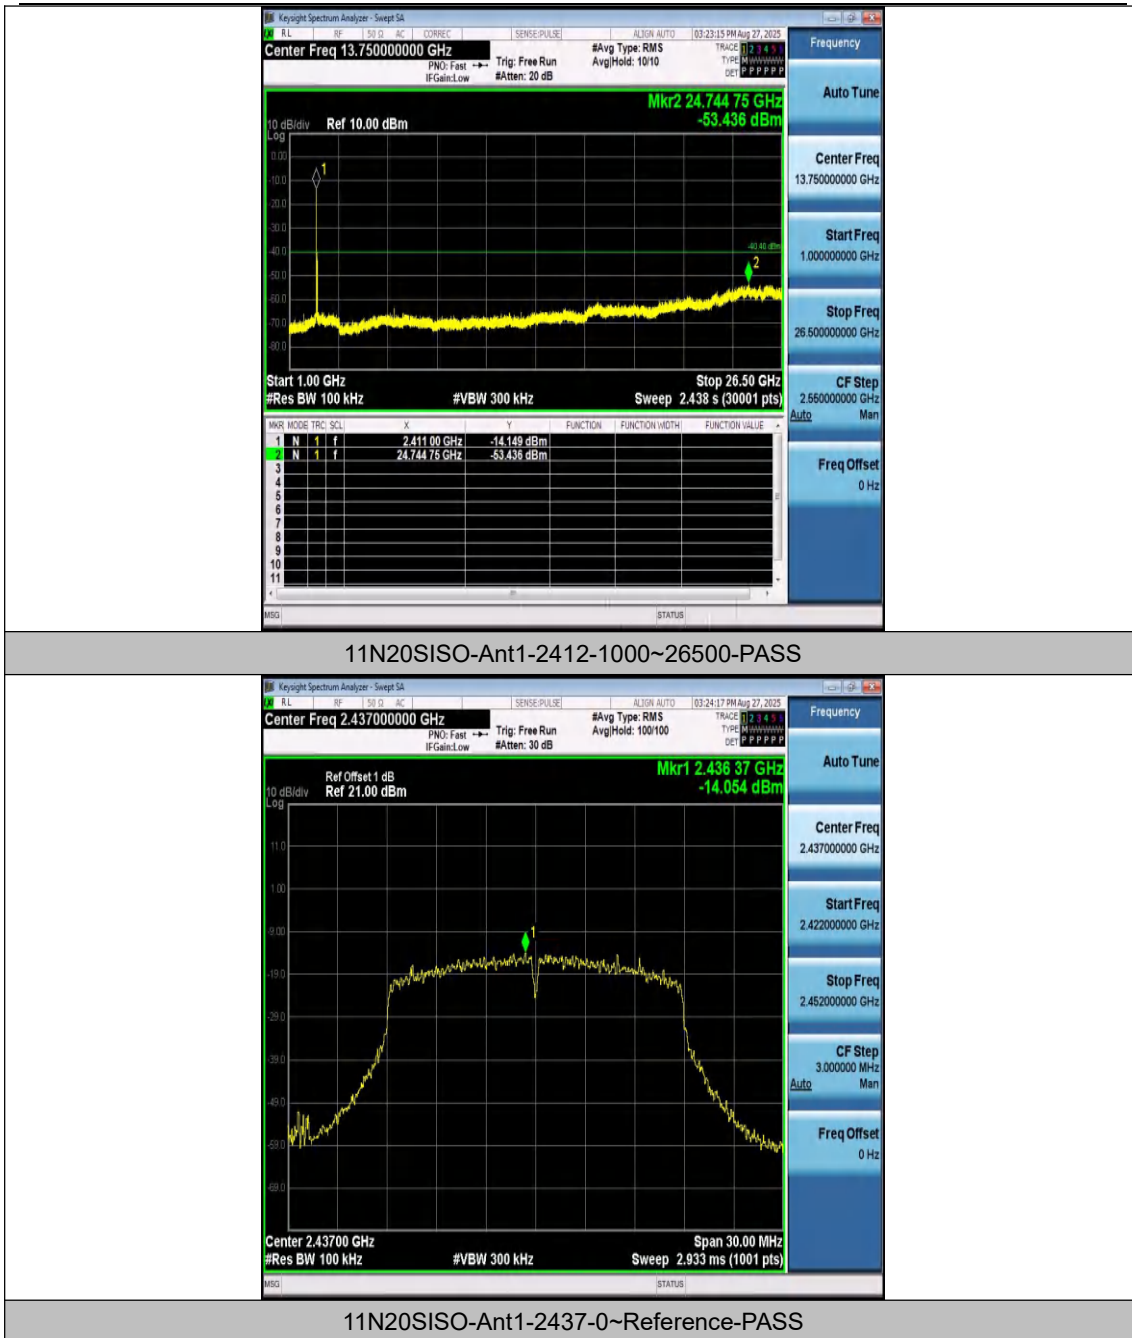

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

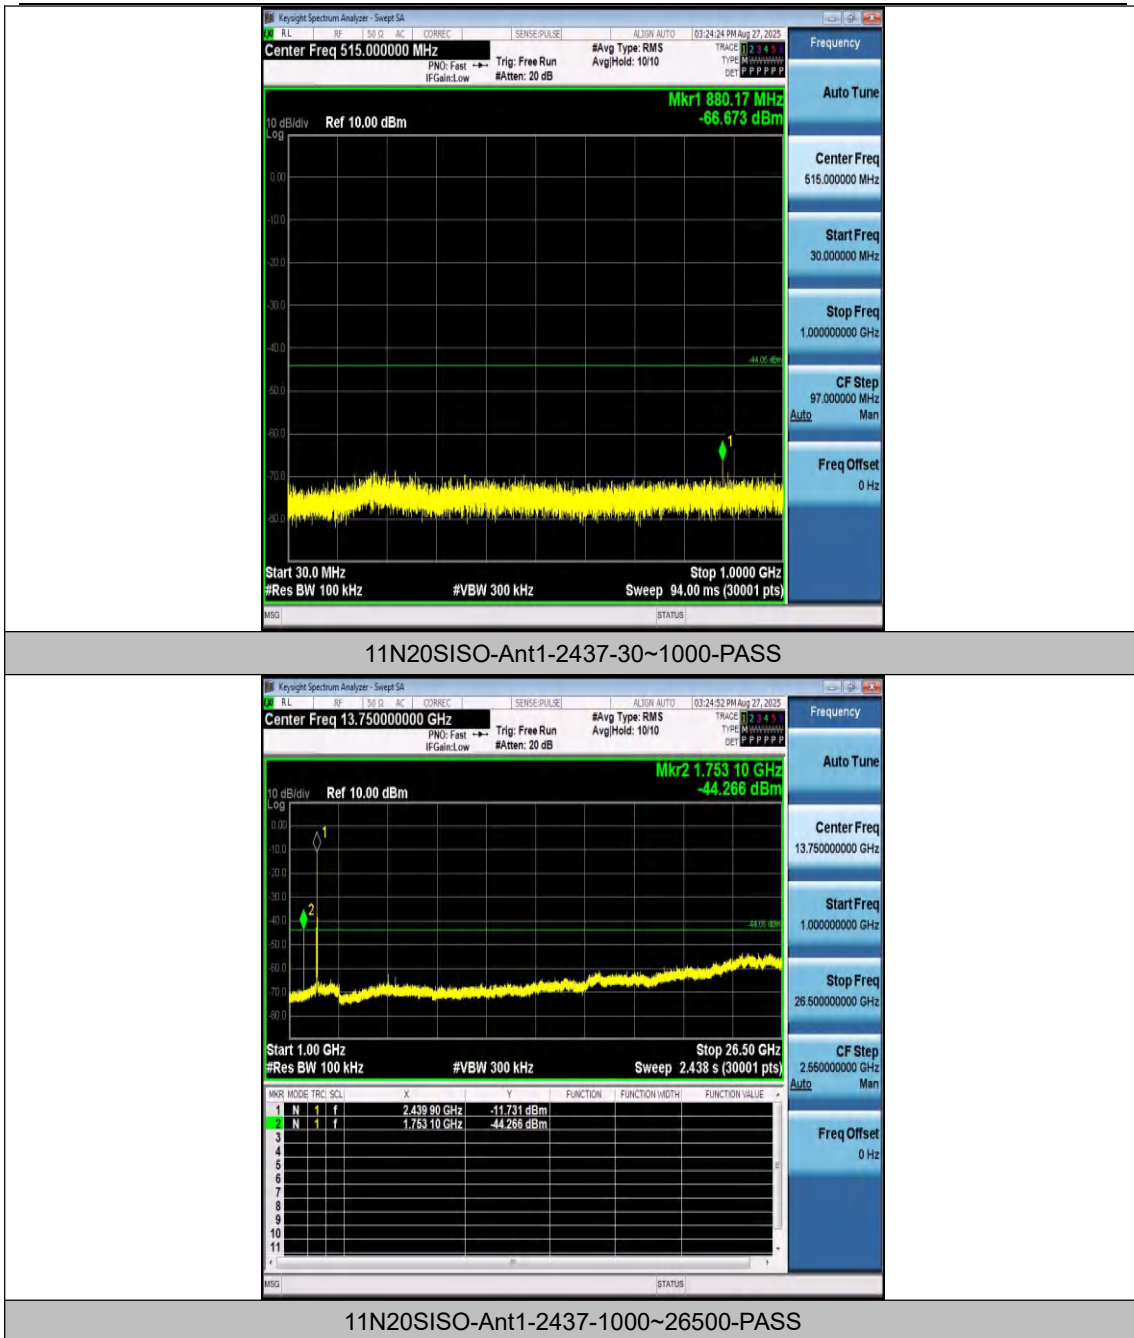

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

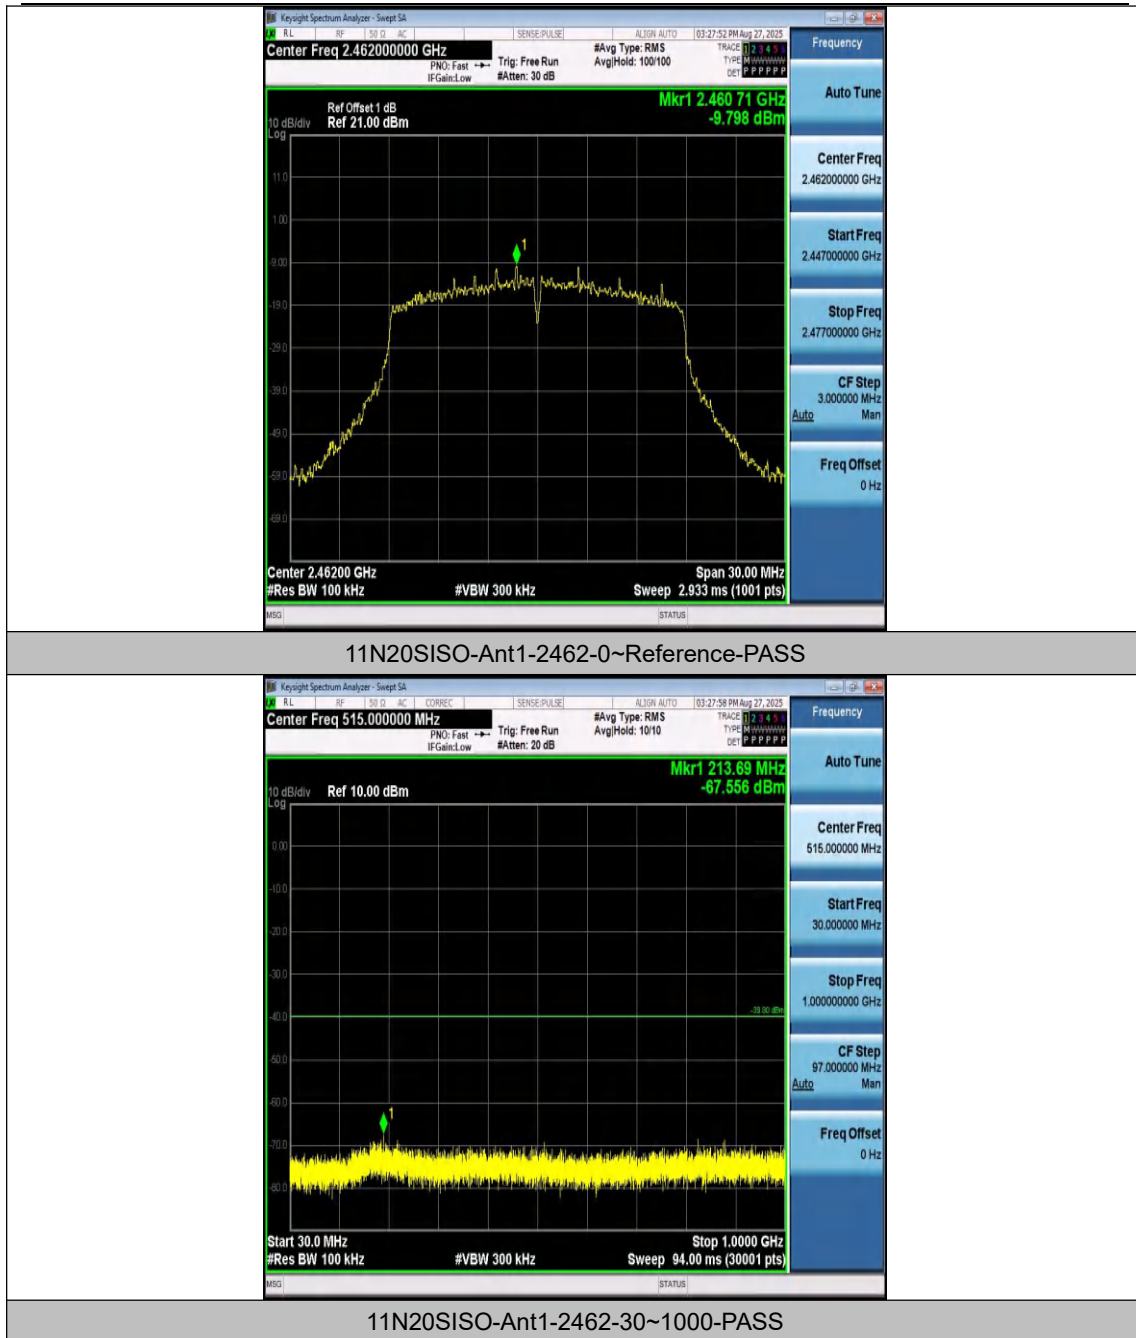

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

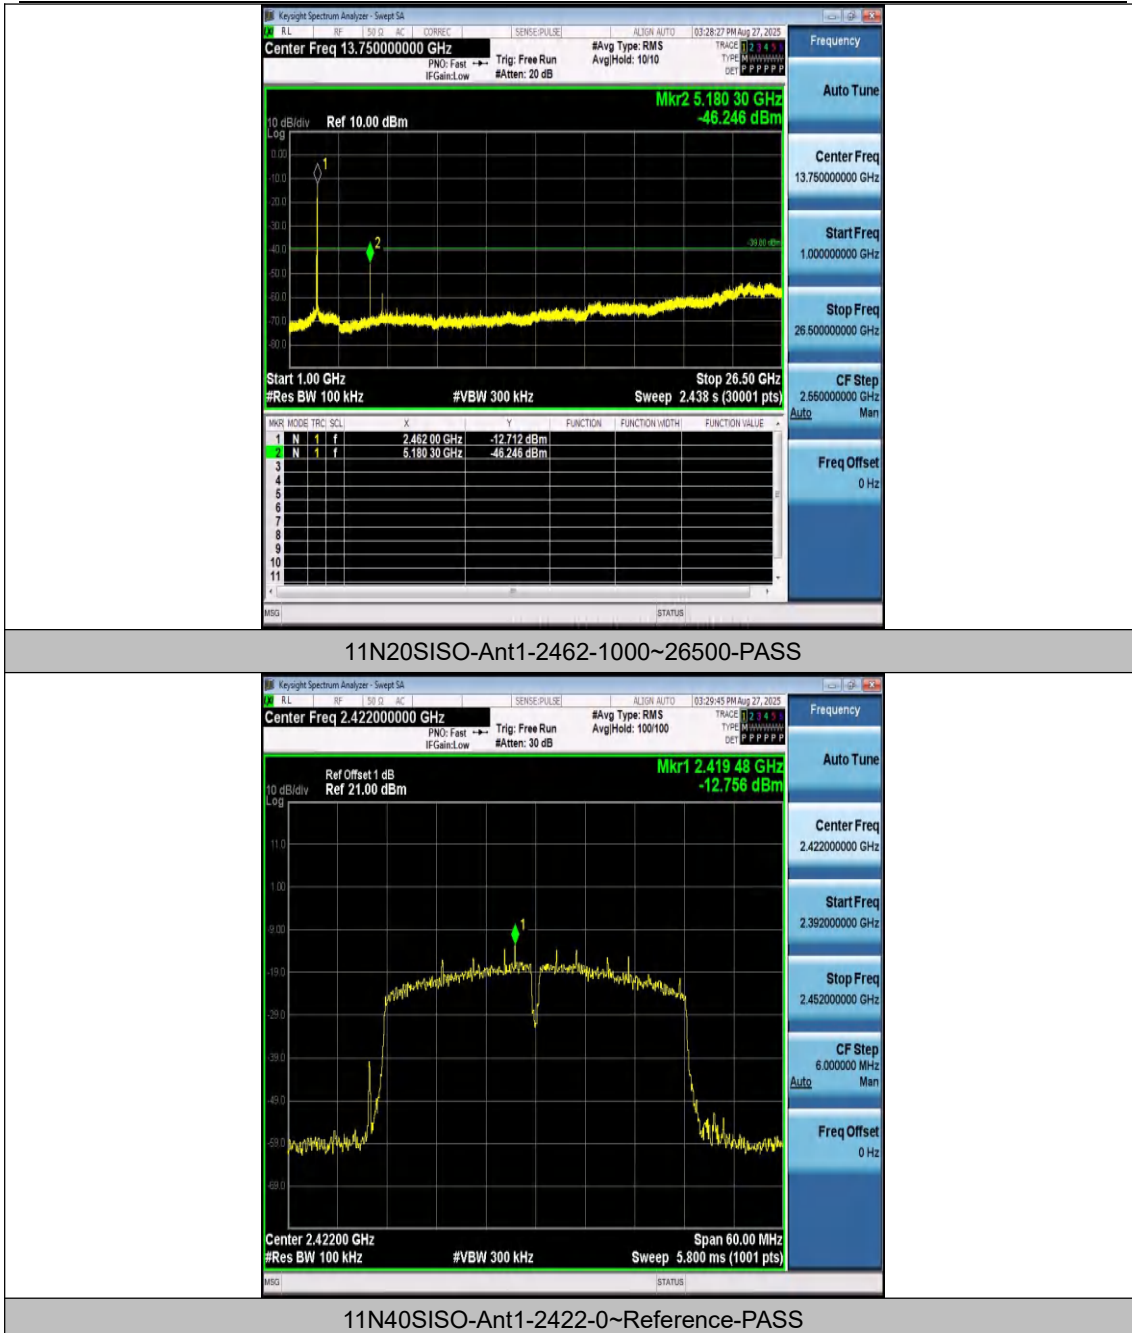

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

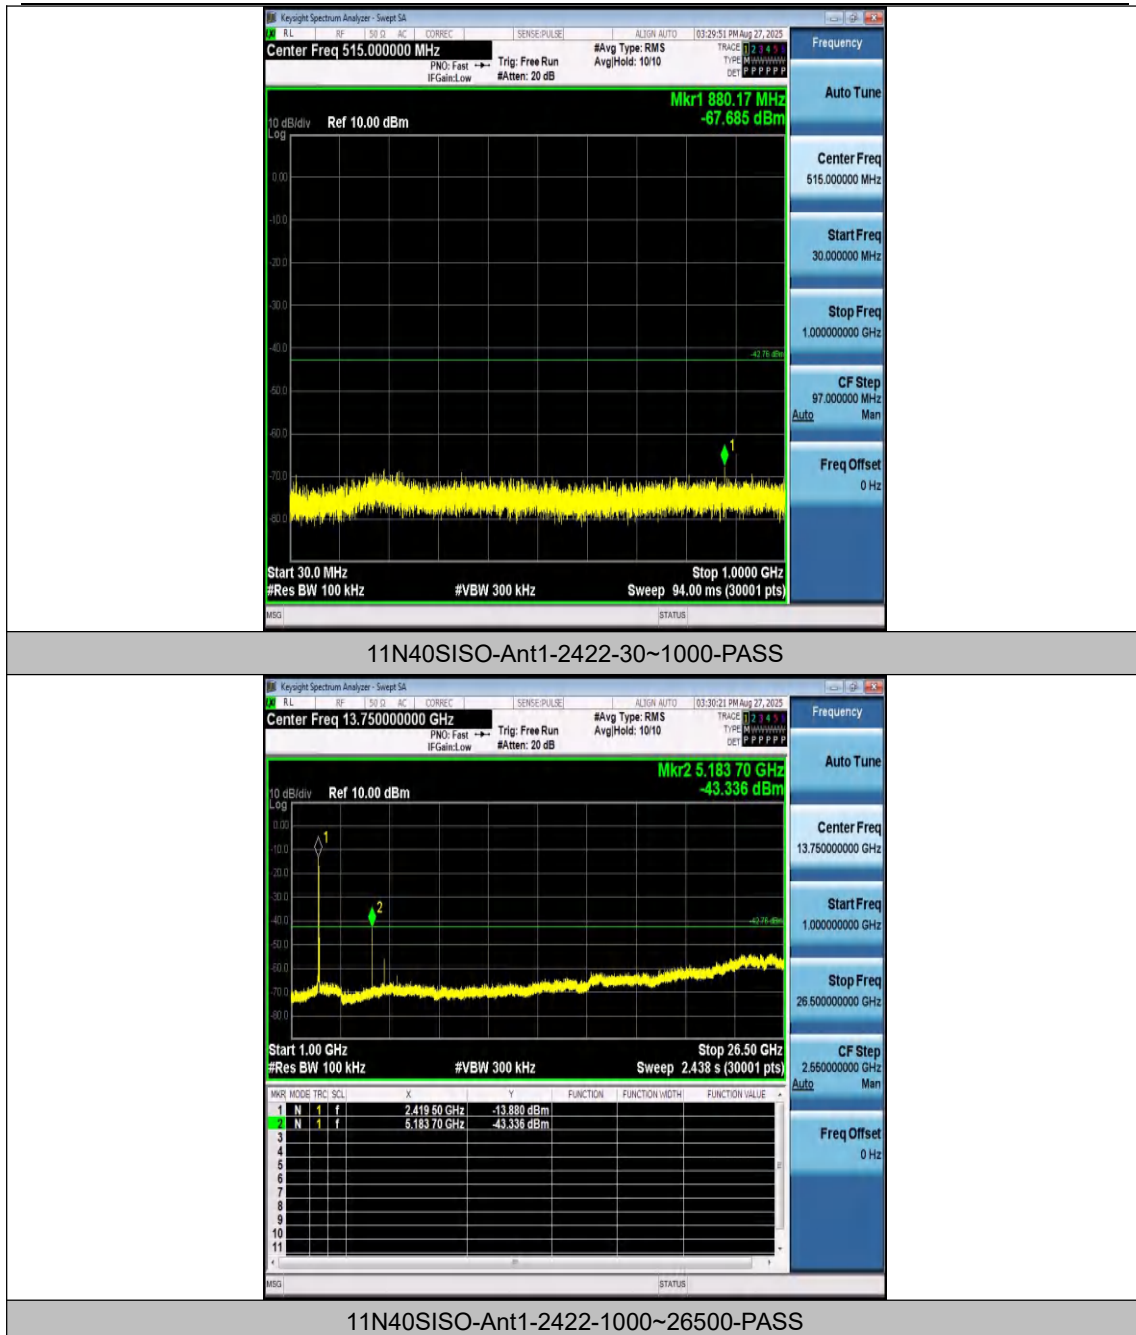

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

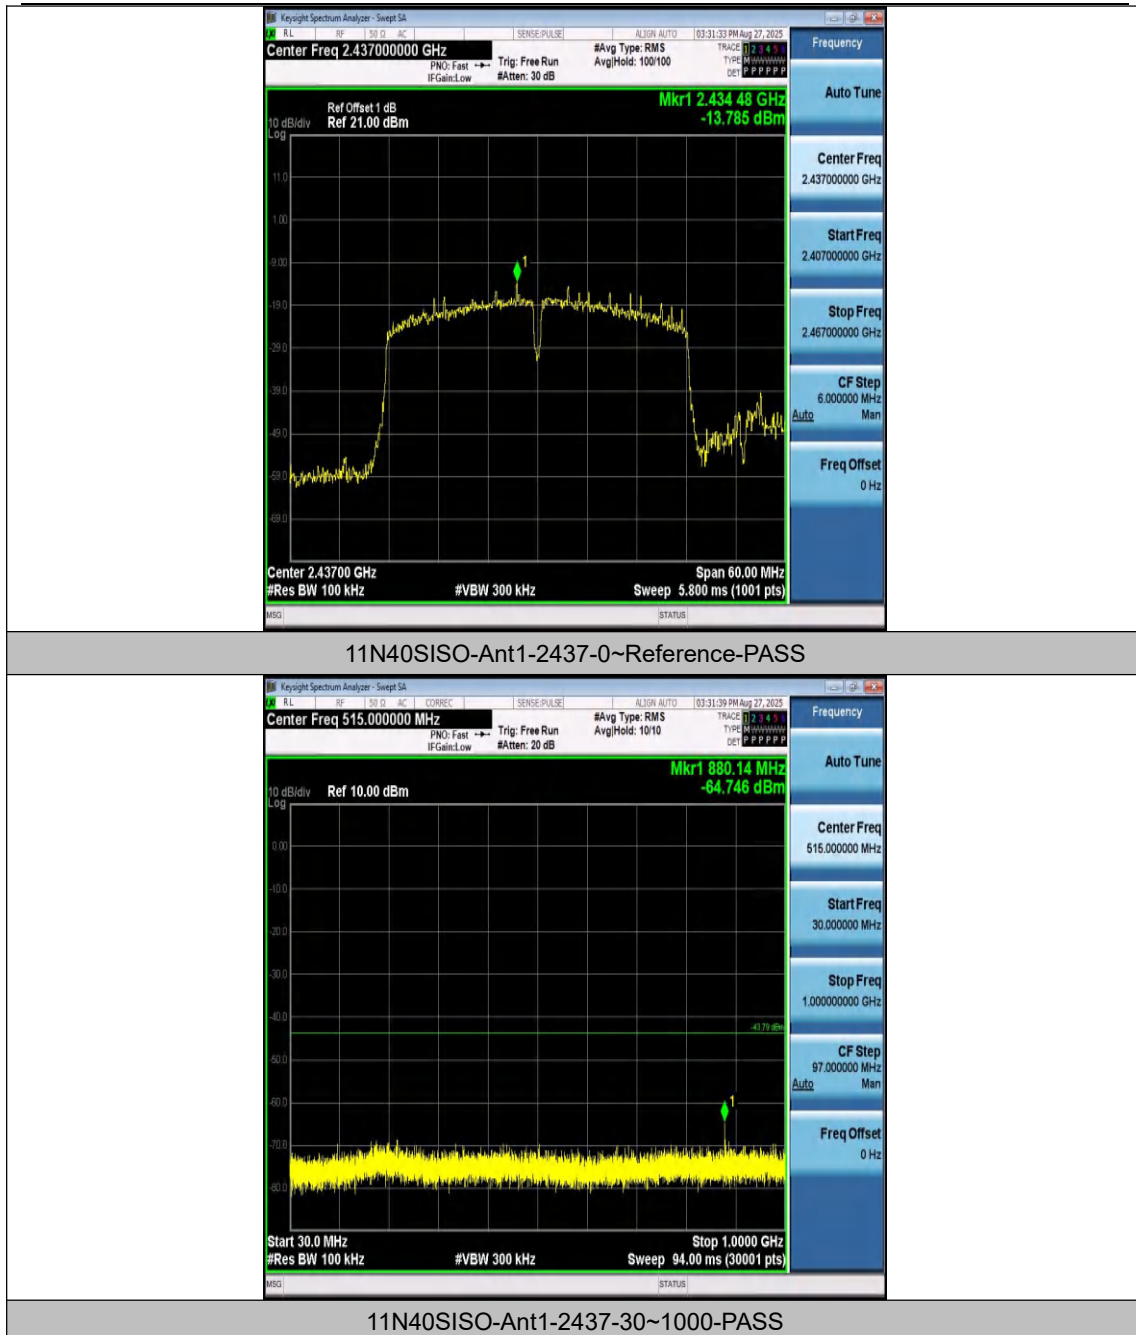

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

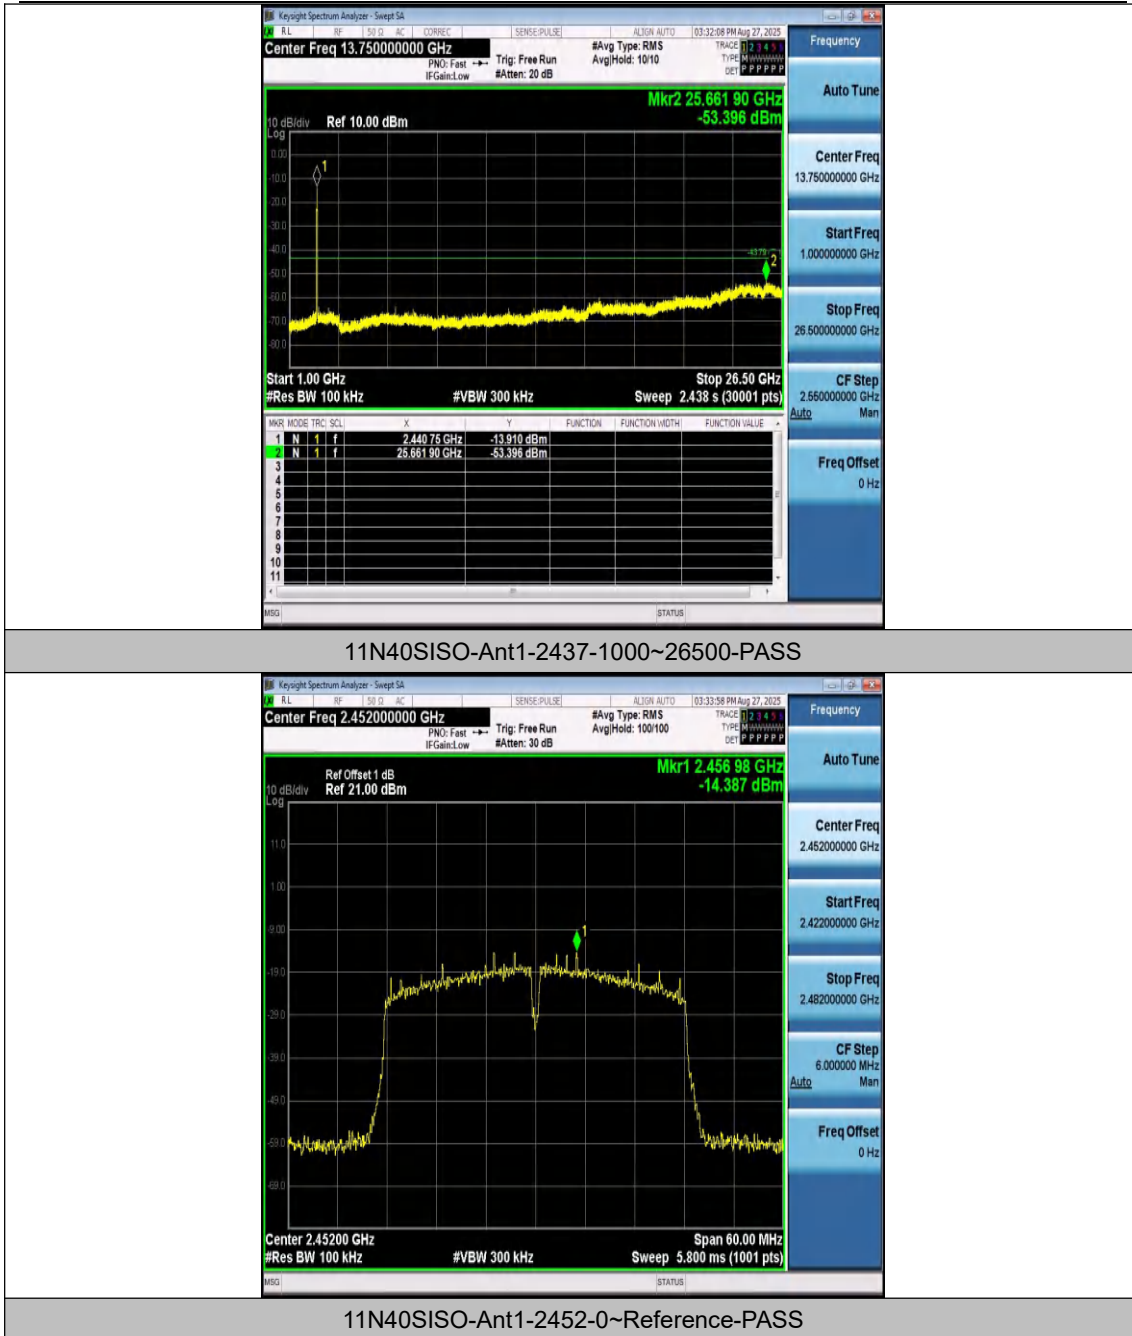

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

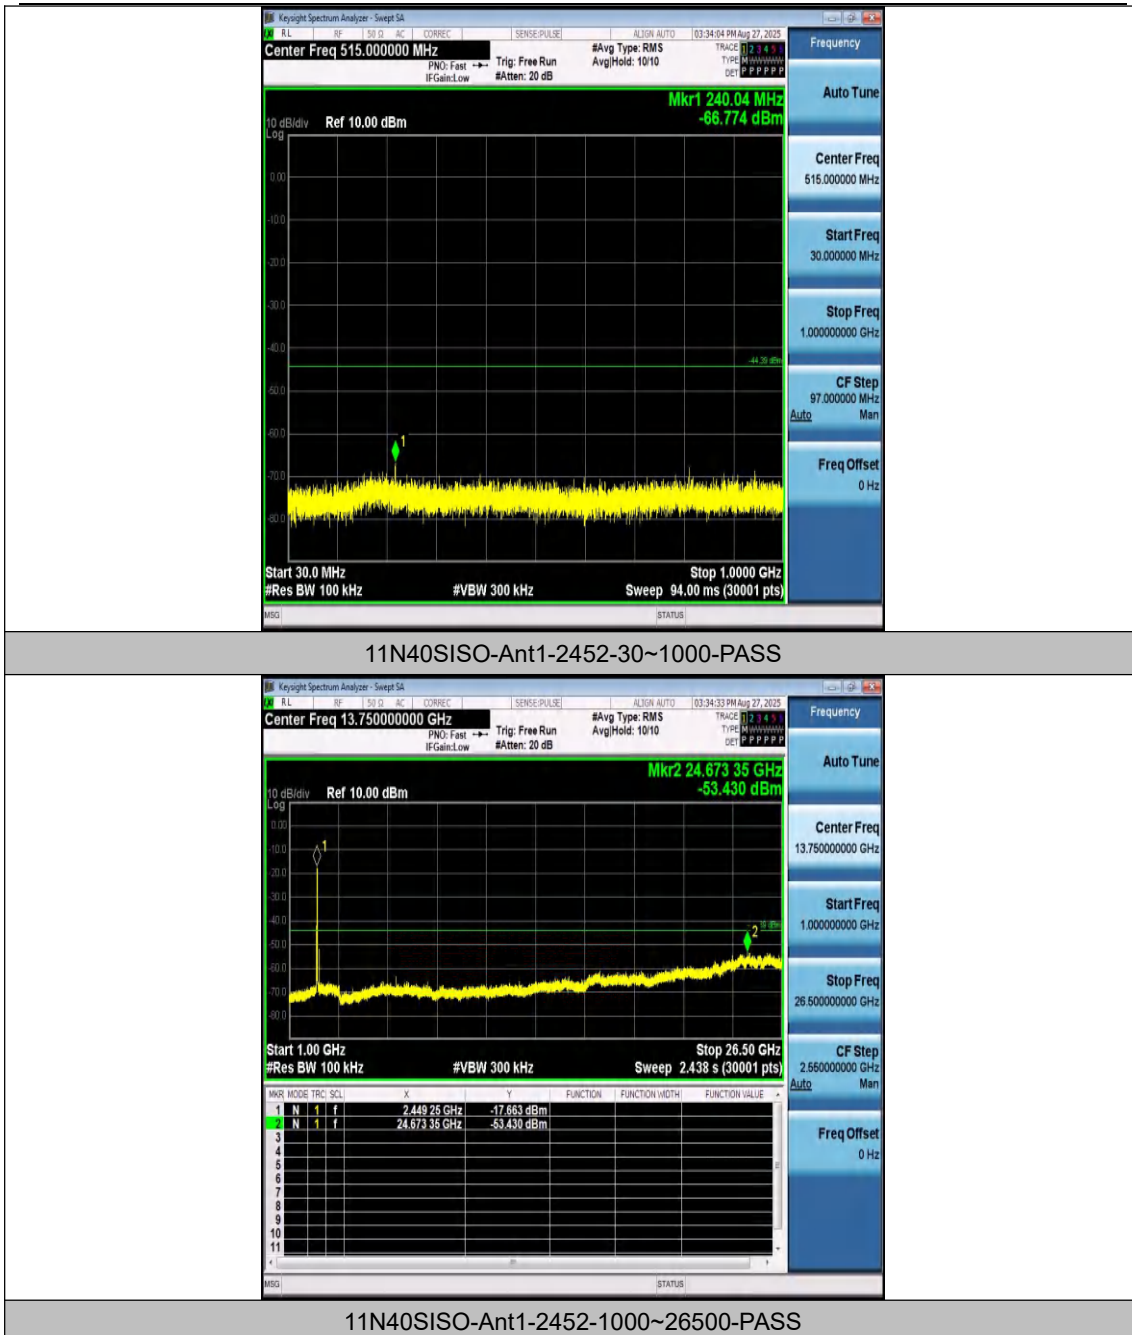

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Duty Cycle

Test Result

| Test Mode | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Factor |
|-----------|---------|----------------|----------------------------|--------------------------|----------------|--------|
| 11B | Ant1 | 2412 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11B | Ant1 | 2437 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11B | Ant1 | 2462 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11G | Ant1 | 2412 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11G | Ant1 | 2437 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11G | Ant1 | 2462 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11N20SISO | Ant1 | 2412 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11N20SISO | Ant1 | 2437 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11N20SISO | Ant1 | 2462 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11N40SISO | Ant1 | 2422 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11N40SISO | Ant1 | 2437 | 100.00 | 100.00 | 100.00 | 0.00 |
| 11N40SISO | Ant1 | 2452 | 100.00 | 100.00 | 100.00 | 0.00 |


Test Graphs

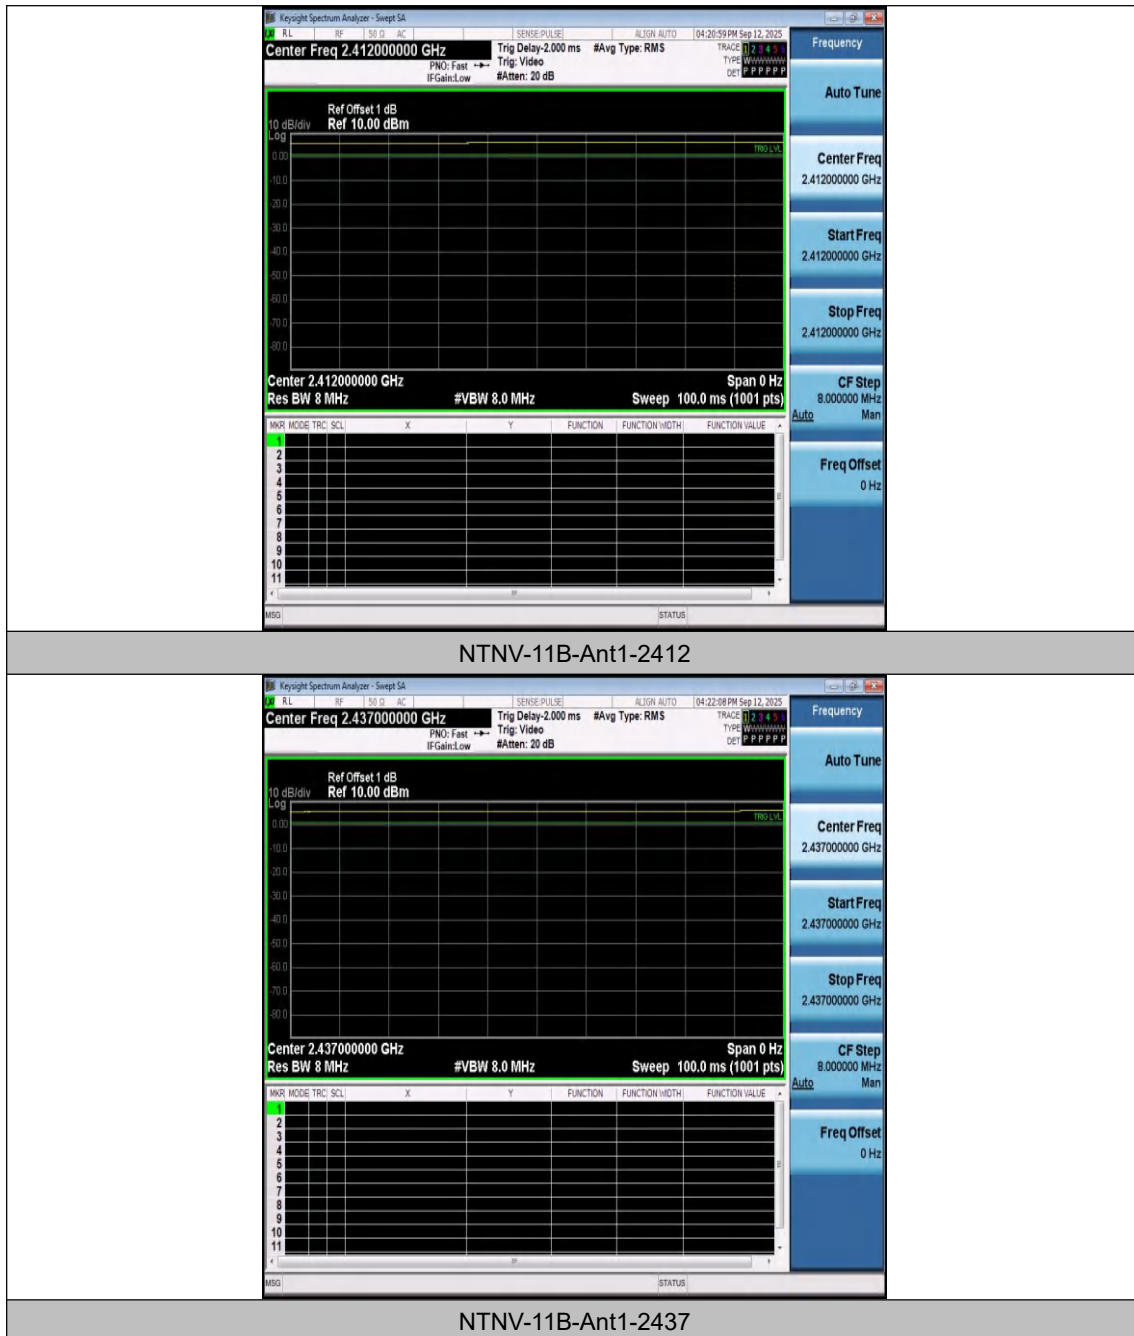

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

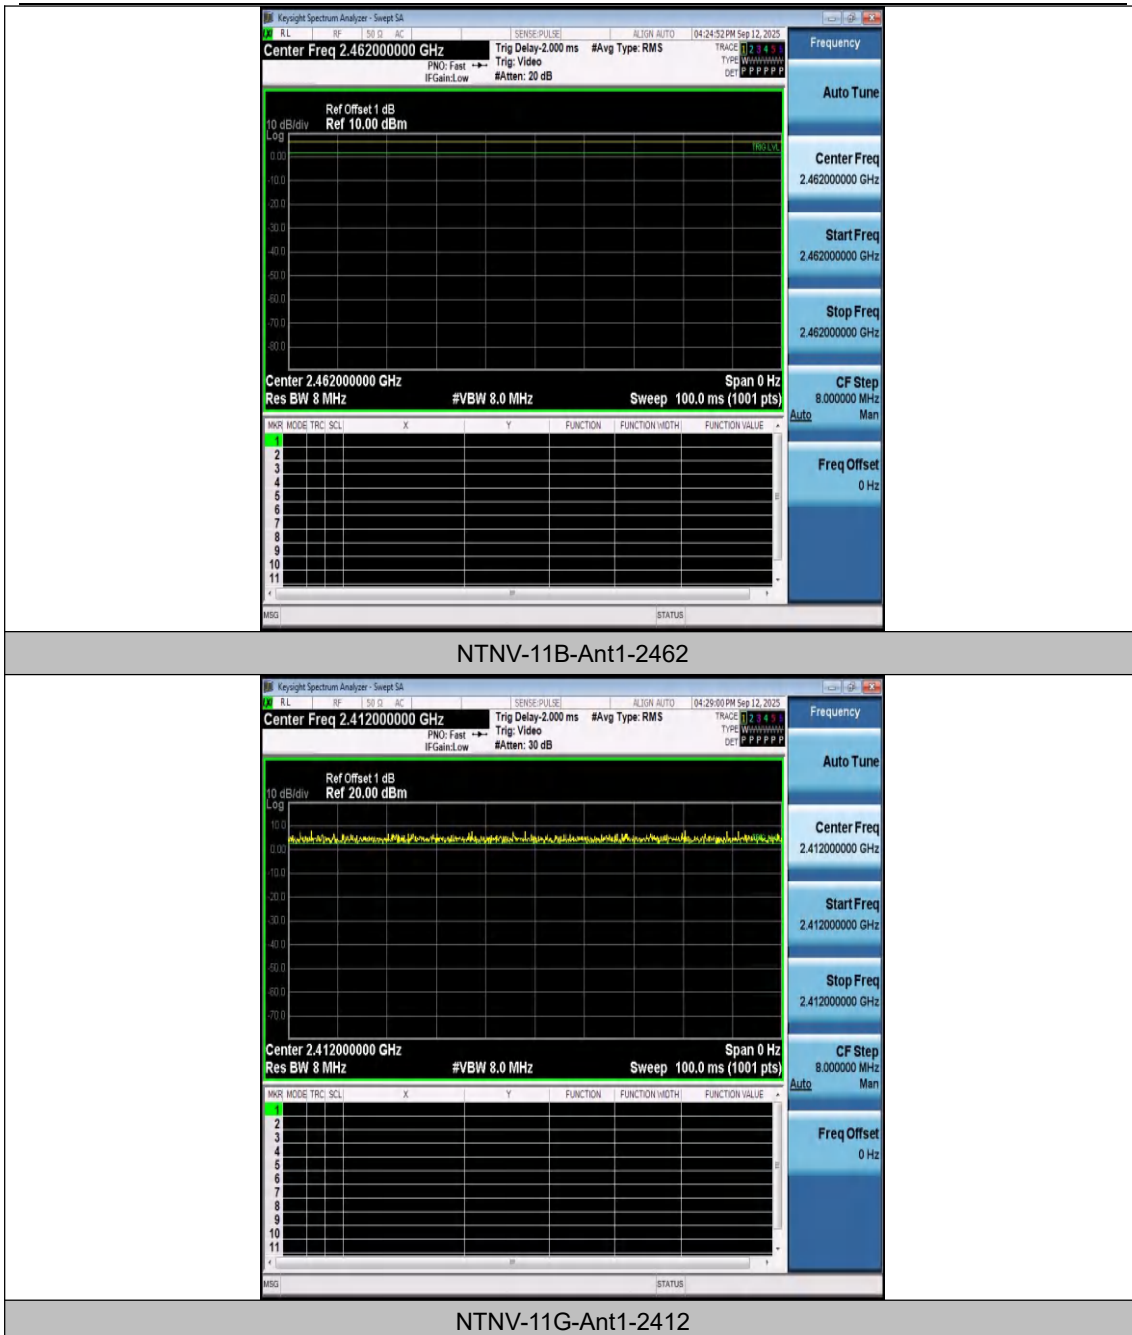

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

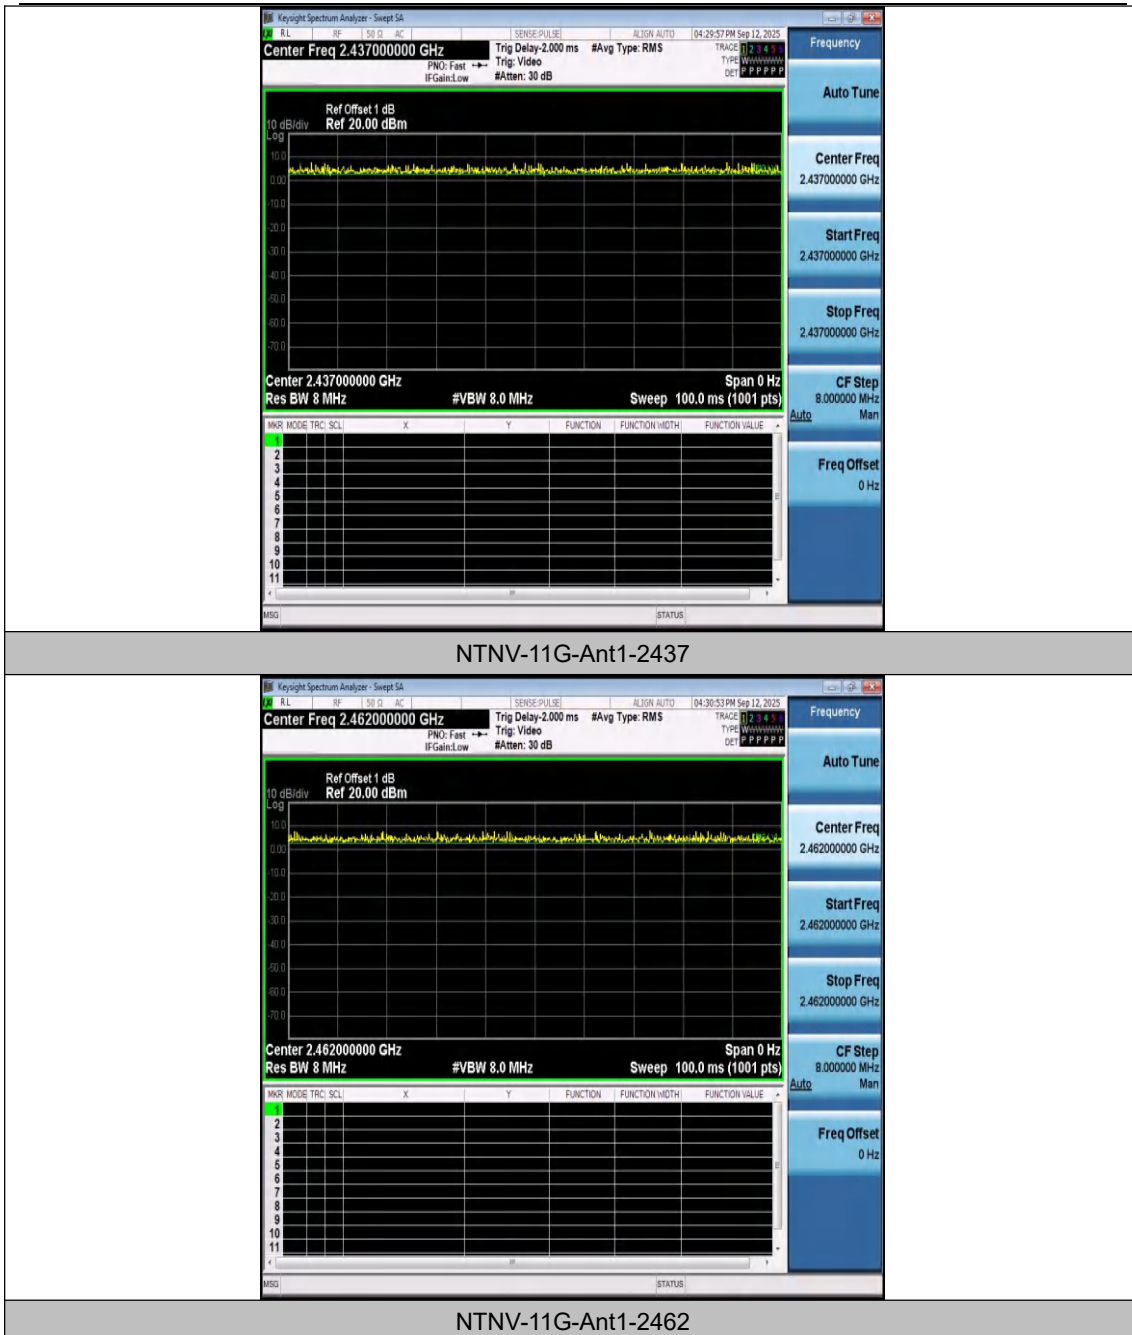

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

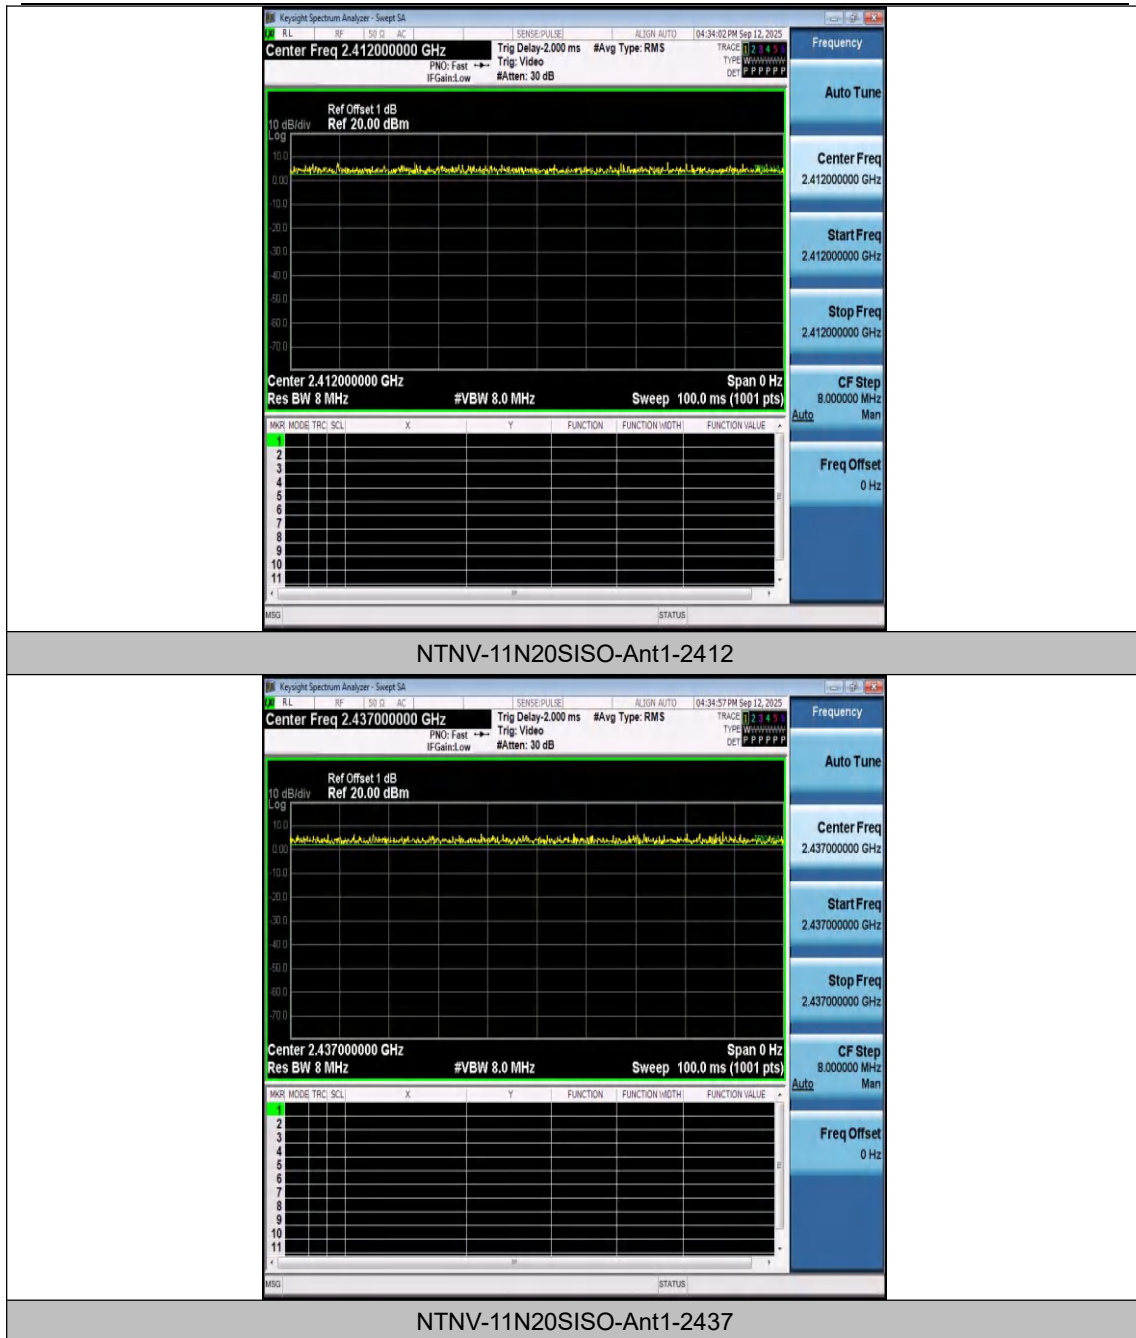

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

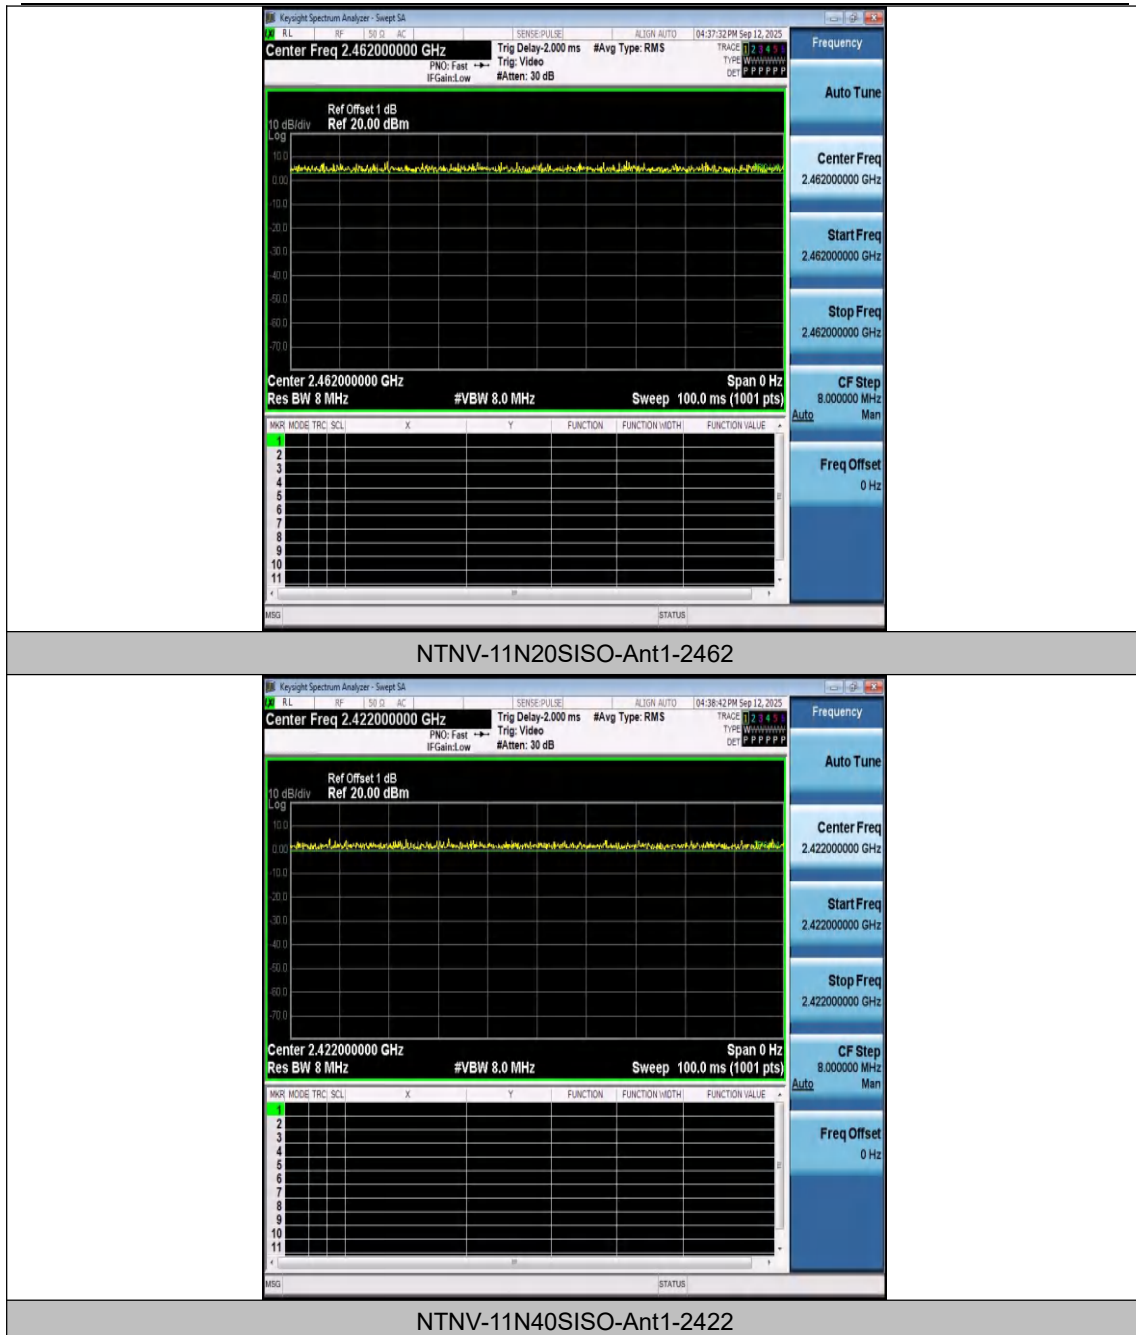

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

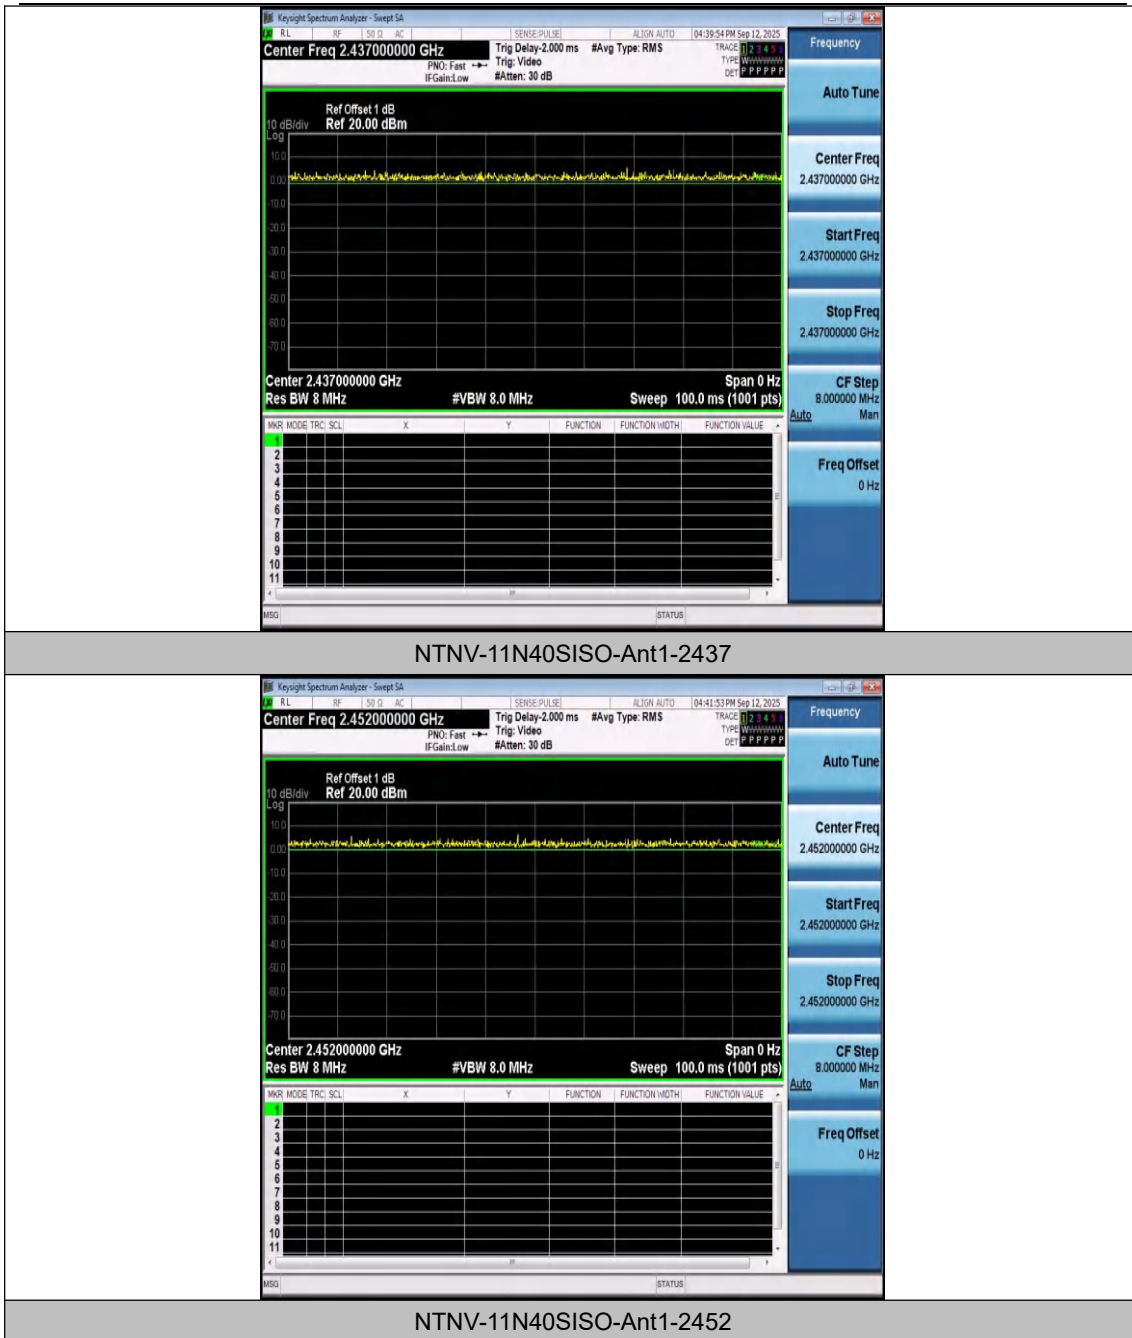

---End---