




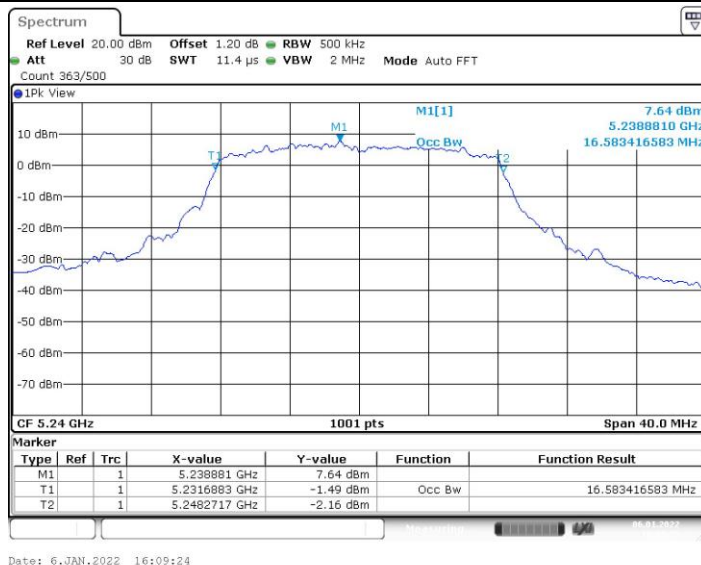

11A_Ant1_5260

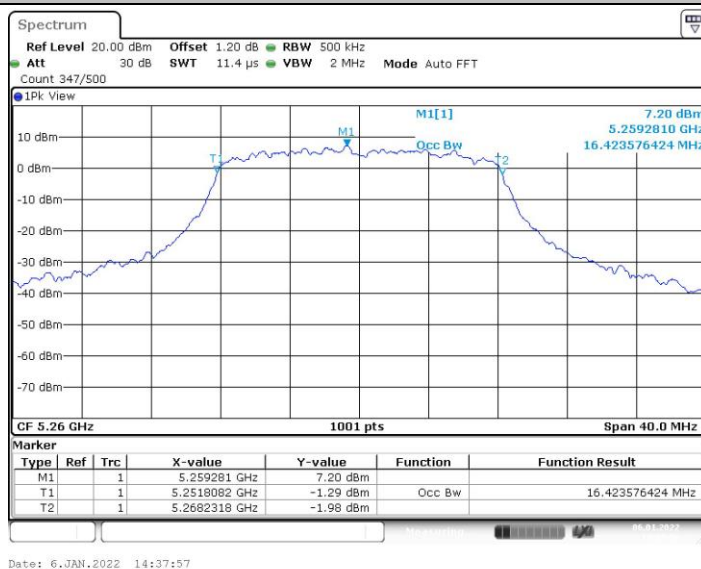


11A_Ant1_5280

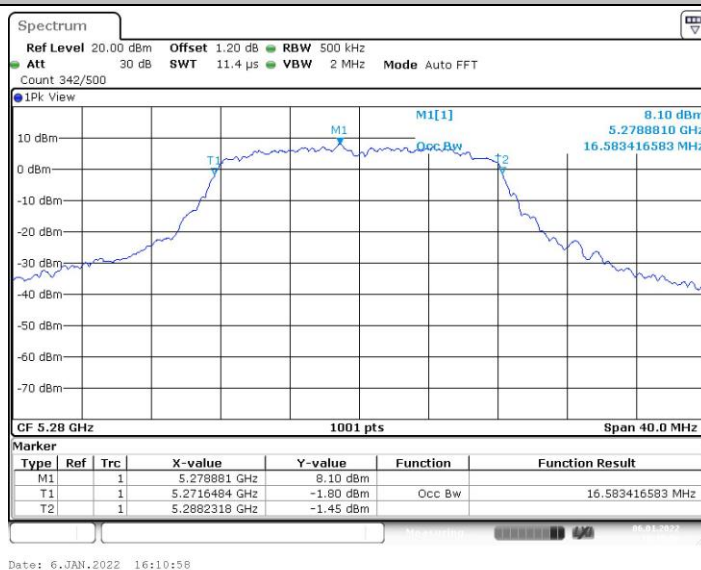




11A_Ant1_5320

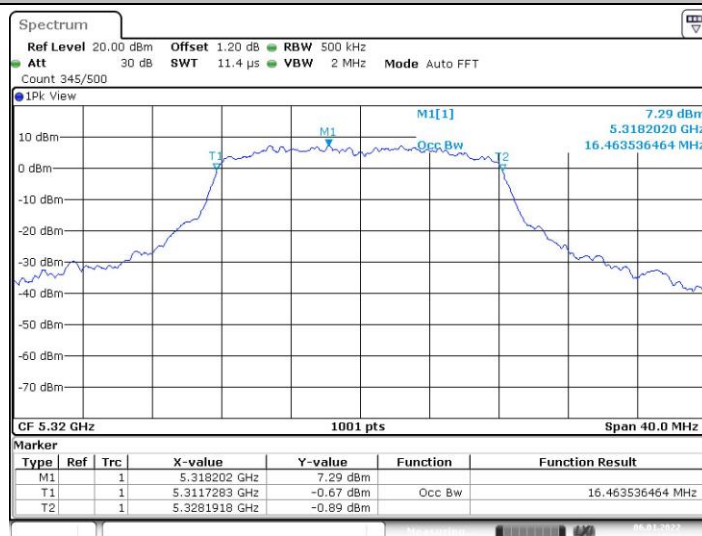


Date: 6.JAN.2022 16:12:31

11A_Ant1_5500

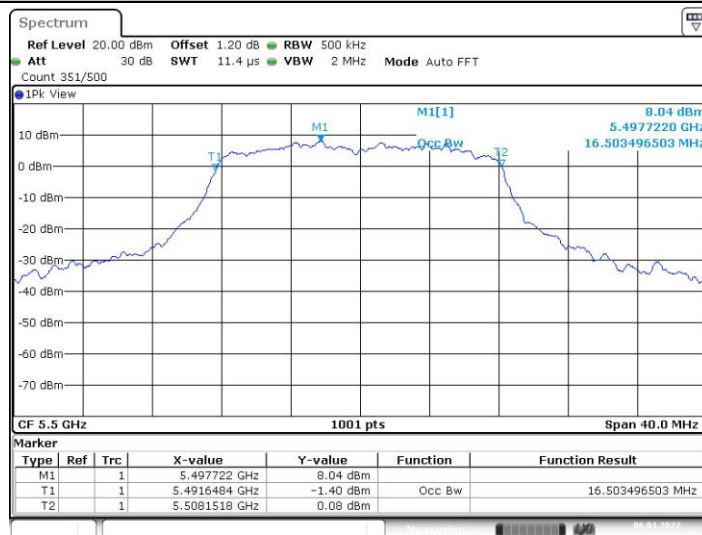


Date: 6.JAN.2022 16:14:17


11A_Ant1_5580

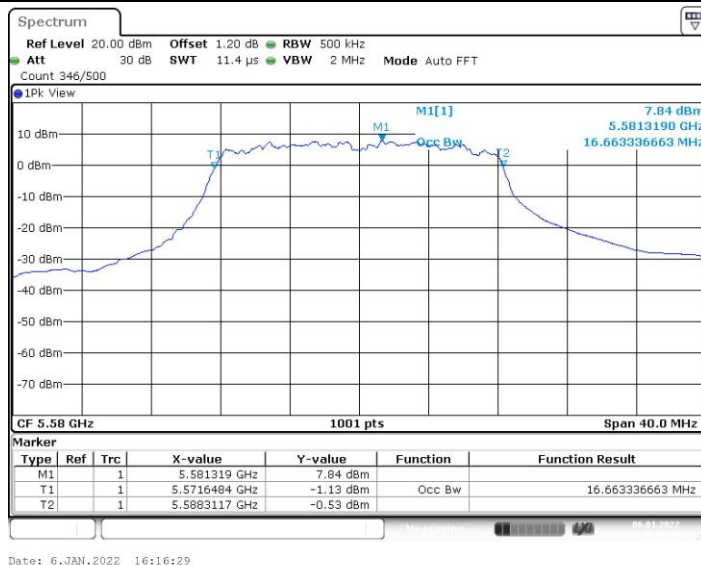

11A_Ant1_5700

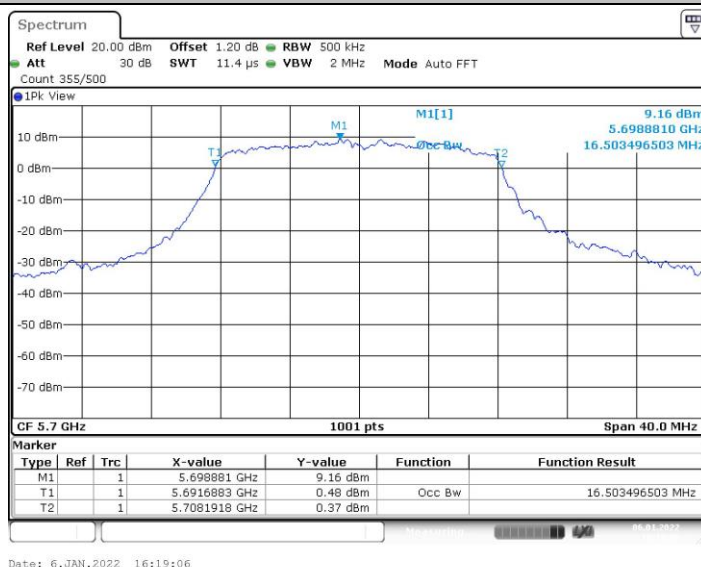


11A_Ant1_5720

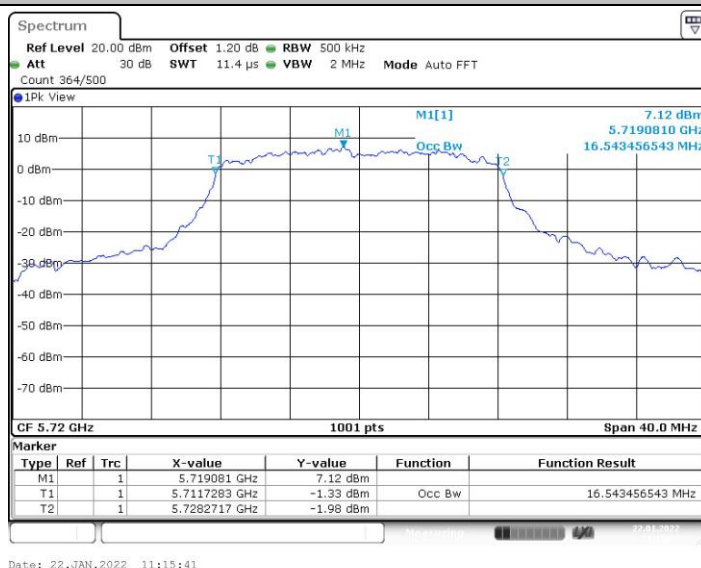




11A_Ant1_5745

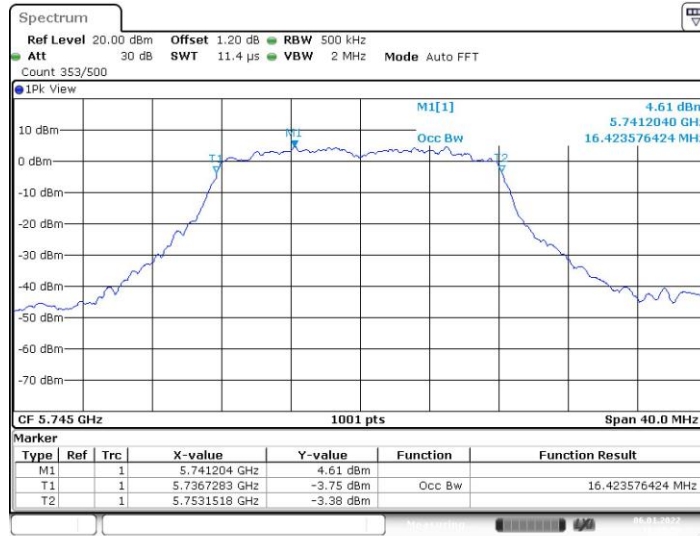

Date: 6.JAN.2022 16:20:59

11A_Ant1_5785

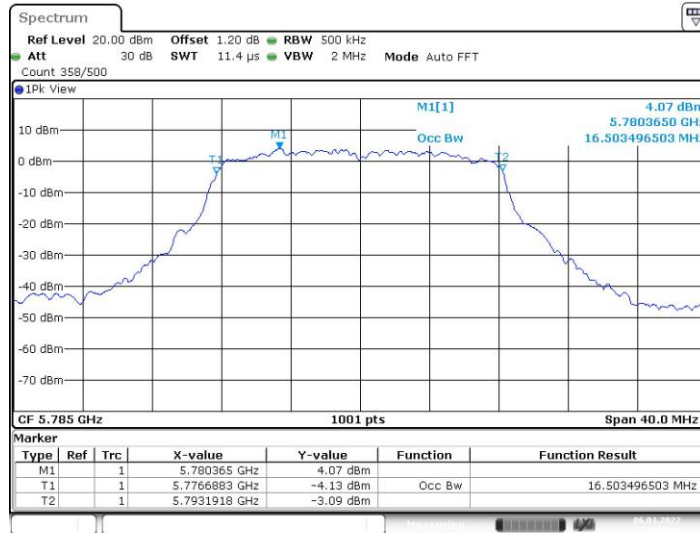


Date: 6.JAN.2022 16:28:00


11A_Ant1_5825



11N20SISO_Ant1_5180

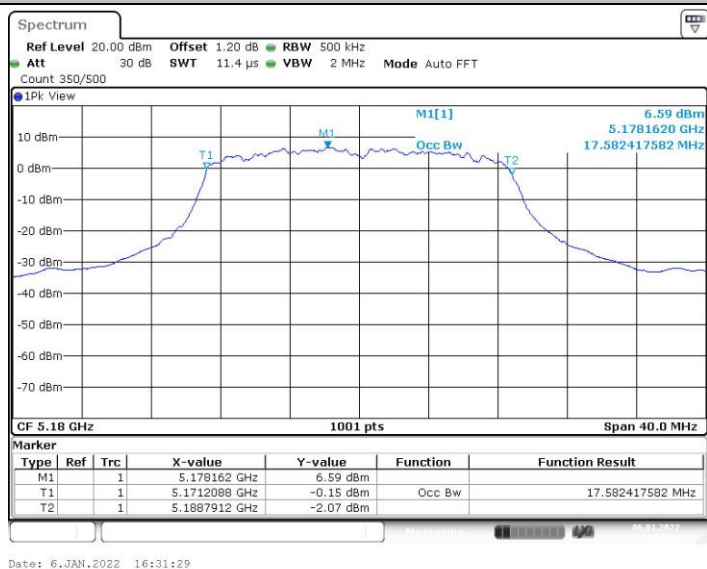


11N20SISO_Ant1_5200

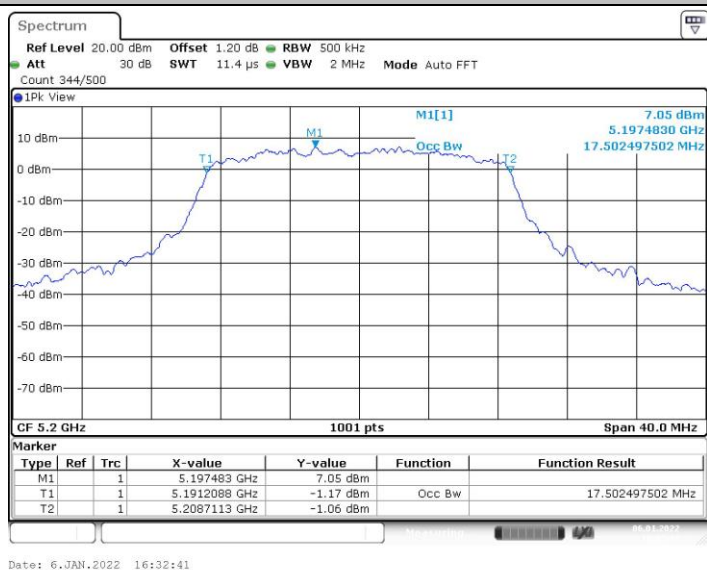




11N20SISO_Ant1_5240

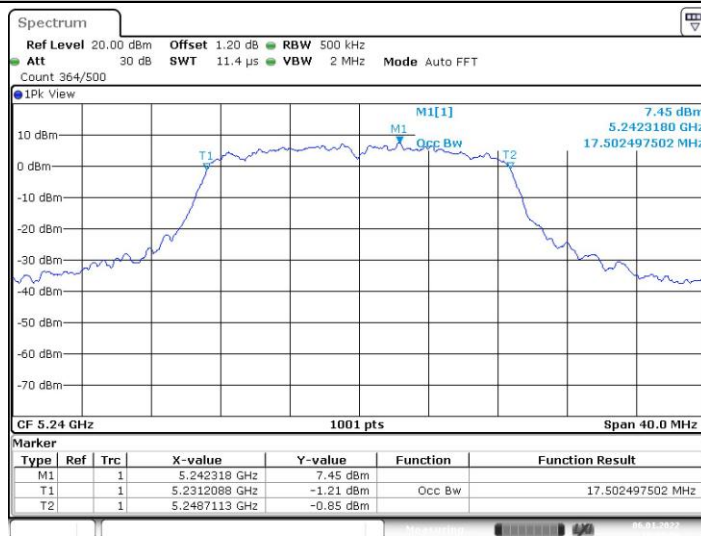


Date: 6.JAN.2022 16:33:50

11N20SISO_Ant1_5260

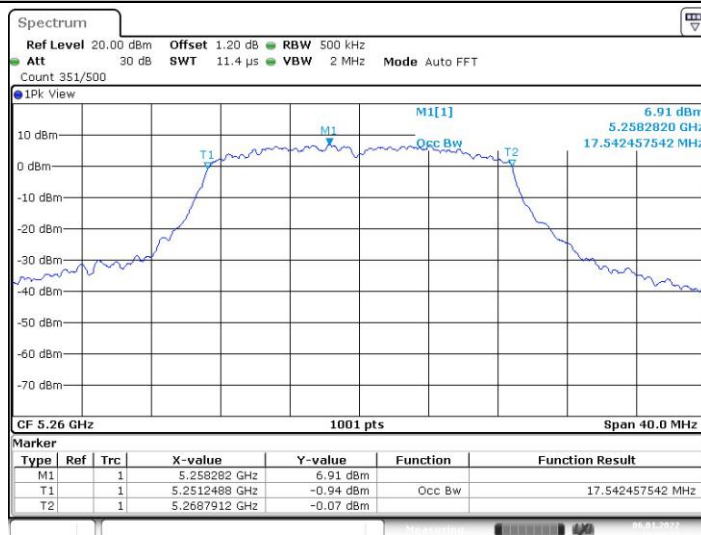


Date: 6.JAN.2022 16:35:16


11N20SISO_Ant1_5280

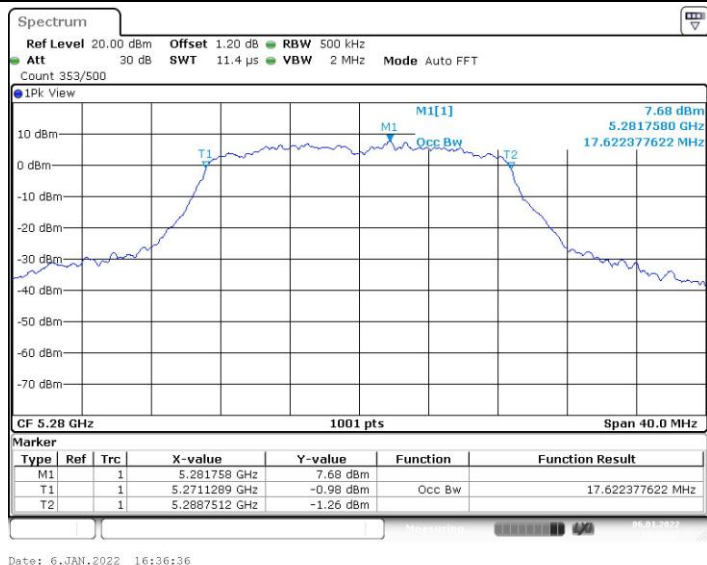

11N20SISO_Ant1_5320

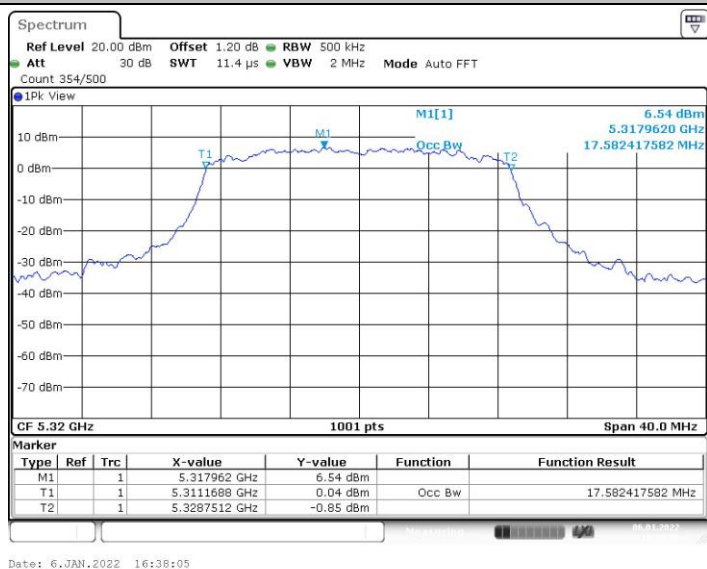

11N20SISO_Ant1_5500

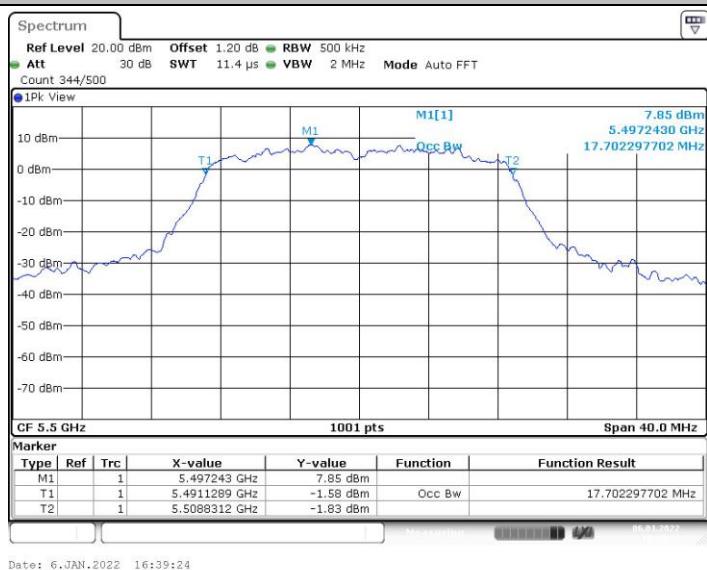




11N20SISO_Ant1_5580




Date: 6.JAN.2022 16:40:39

11N20SISO_Ant1_5700

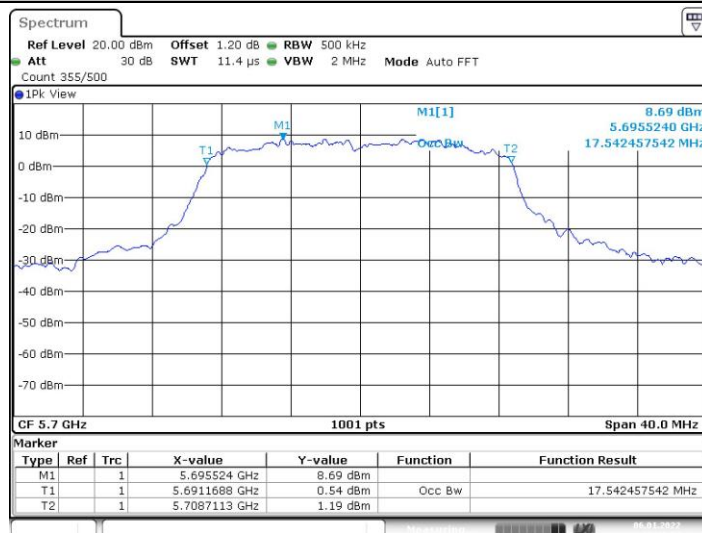

Date: 6.JAN.2022 16:41:57

11N20SISO_Ant1_5720

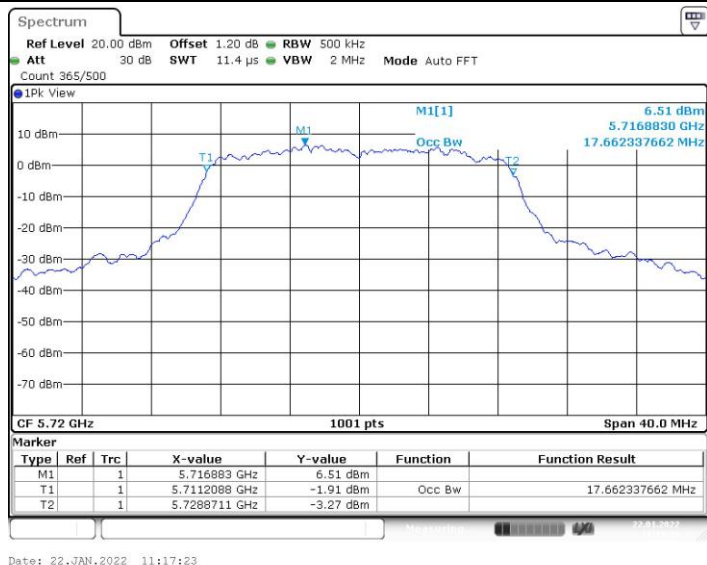

11N20SISO_Ant1_5745




11N20SISO_Ant1_5785







11N20SISO_Ant1_5825

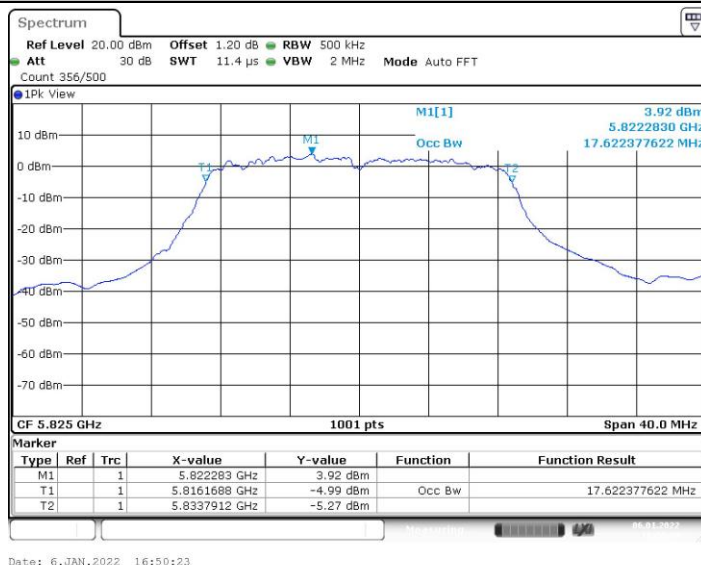


11N40SISO_Ant1_5190

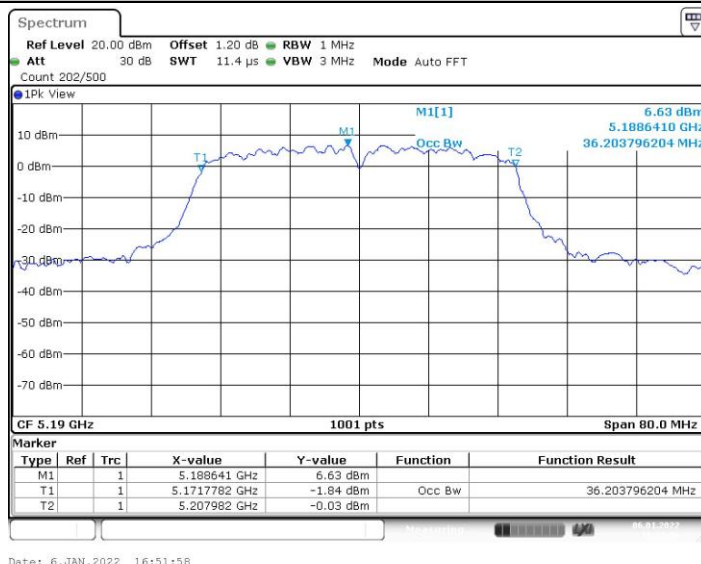


11N40SISO_Ant1_5230

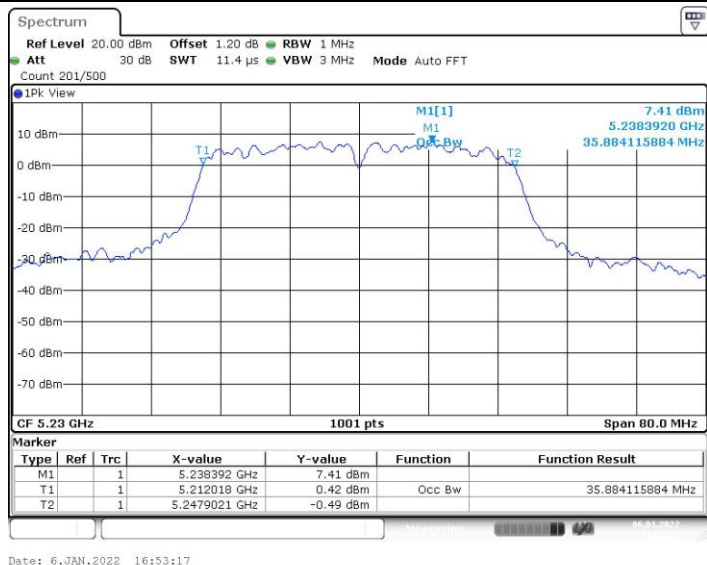

11N40SISO_Ant1_5270

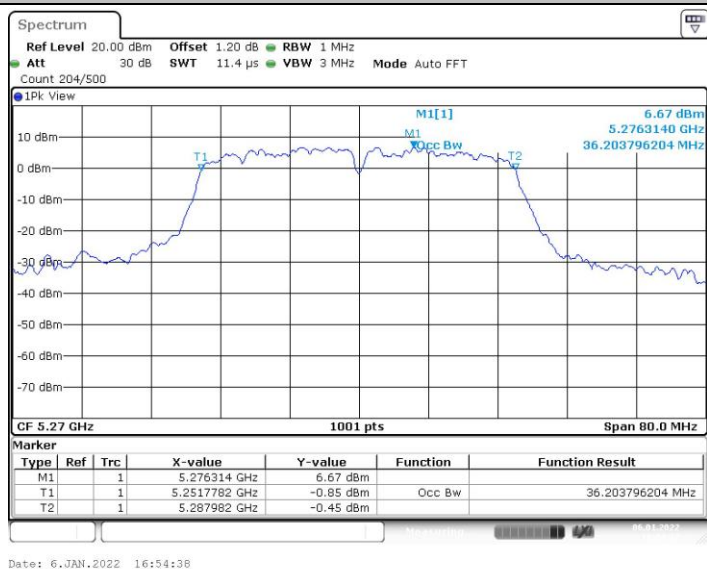

11N40SISO_Ant1_5310

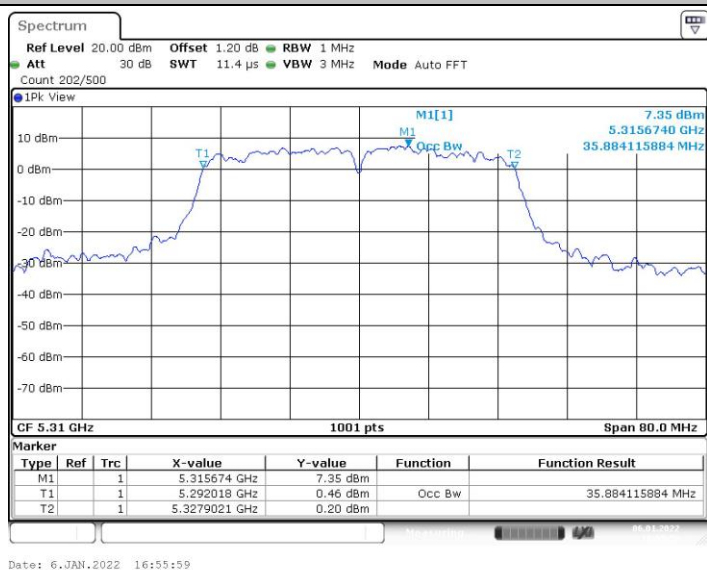



11N40SISO_Ant1_5510




Date: 6.JAN.2022 16:57:24

11N40SISO_Ant1_5550




Date: 6.JAN.2022 16:58:44


11N40SISO_Ant1_5670

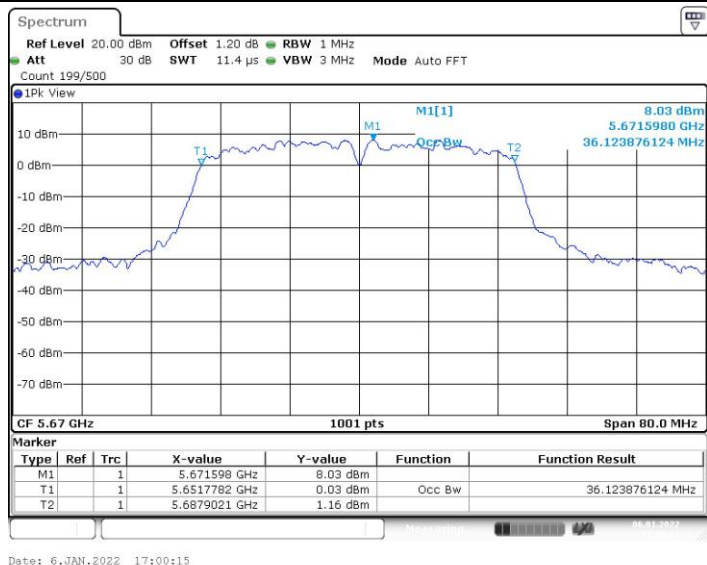

11N40SISO_Ant1_5710

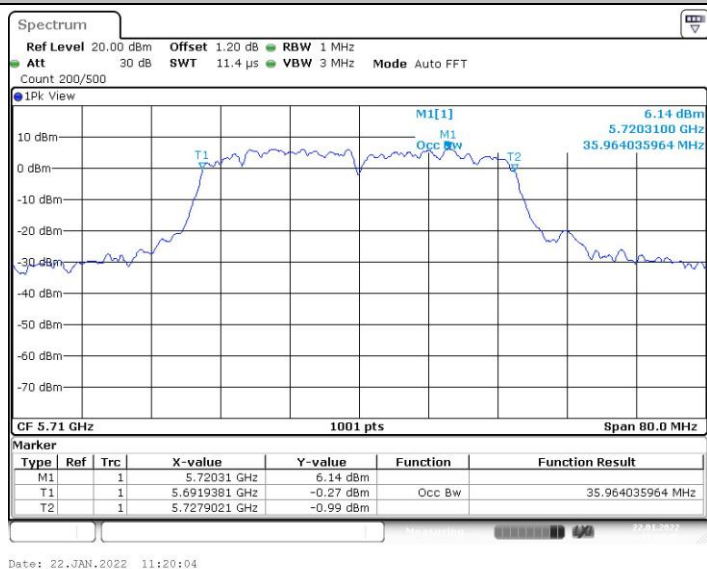


11N40SISO_Ant1_5755

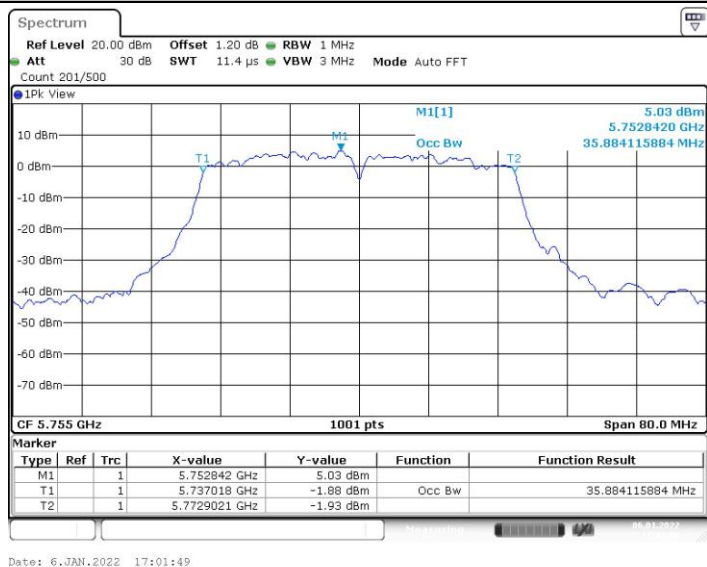




11N40SISO_Ant1_5795

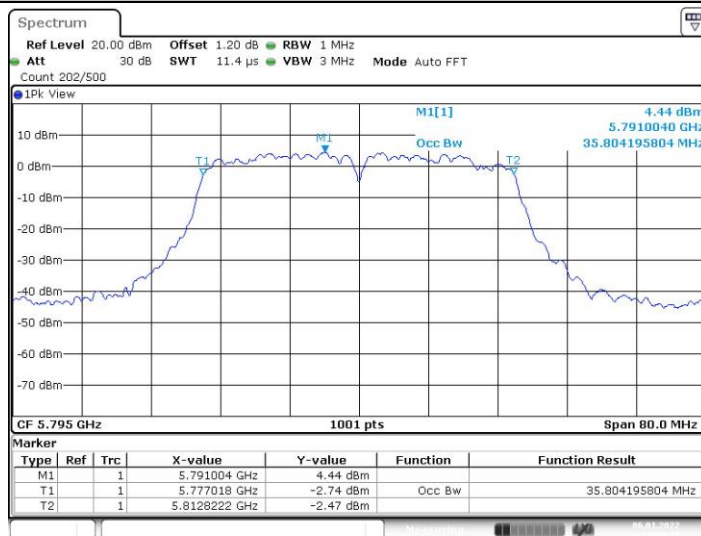


Date: 6.JAN.2022 17:03:26

11AC20SISO_Ant1_5180

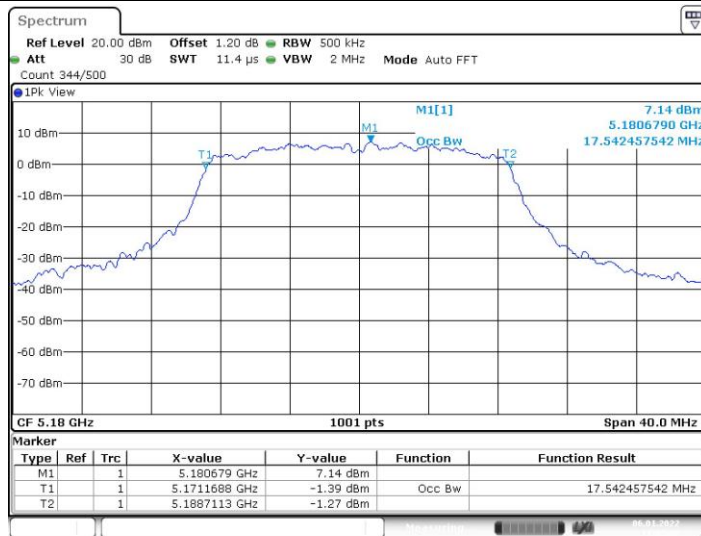


Date: 6.JAN.2022 17:05:02


11AC20SISO_Ant1_5200

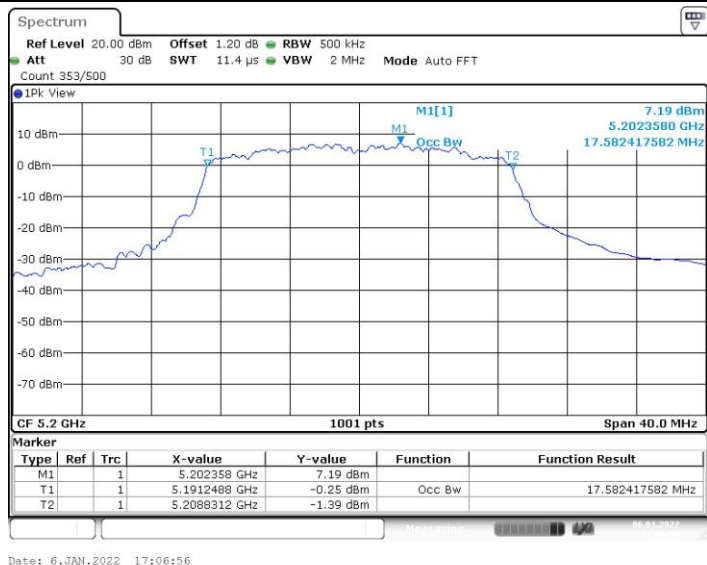

11AC20SISO_Ant1_5240

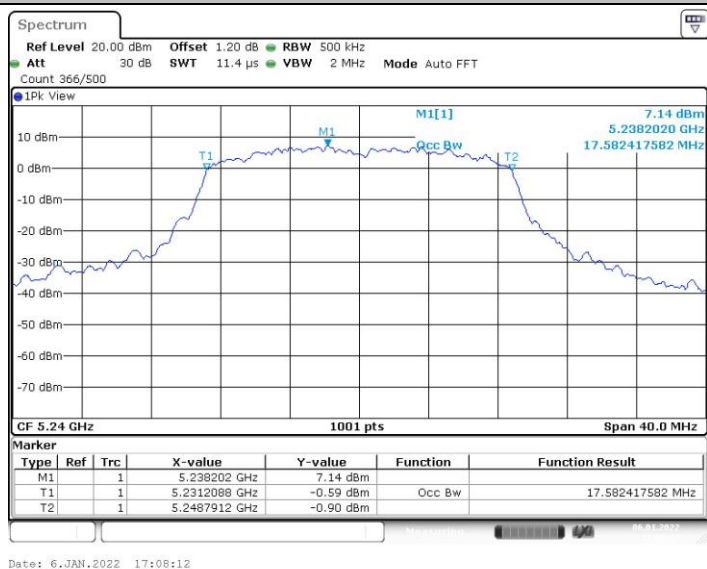


11AC20SISO_Ant1_5260

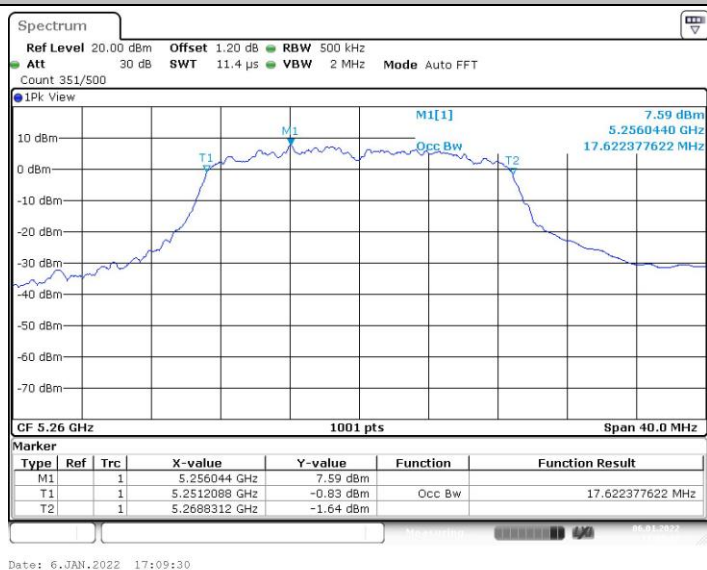




11AC20SISO_Ant1_5280

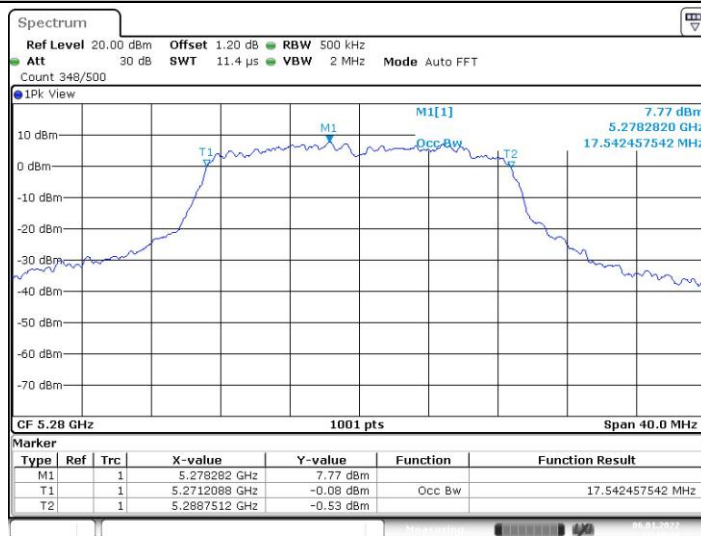

Date: 6.JAN.2022 17:10:41

11AC20SISO_Ant1_5320

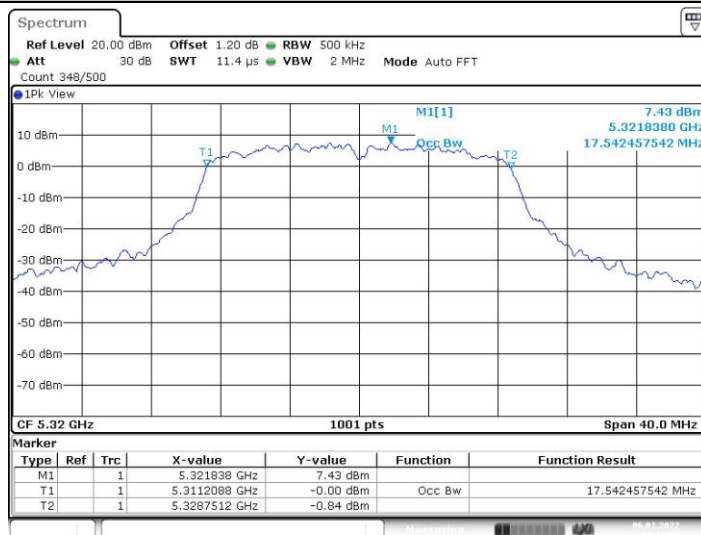


Date: 6.JAN.2022 17:11:52

11AC20SISO_Ant1_5500



11AC20SISO_Ant1_5580

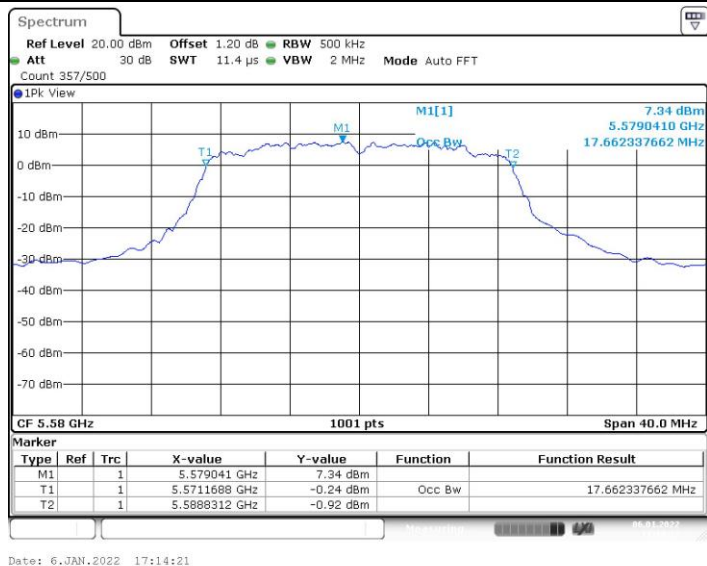


11AC20SISO_Ant1_5700






11AC20SISO_Ant1_5720

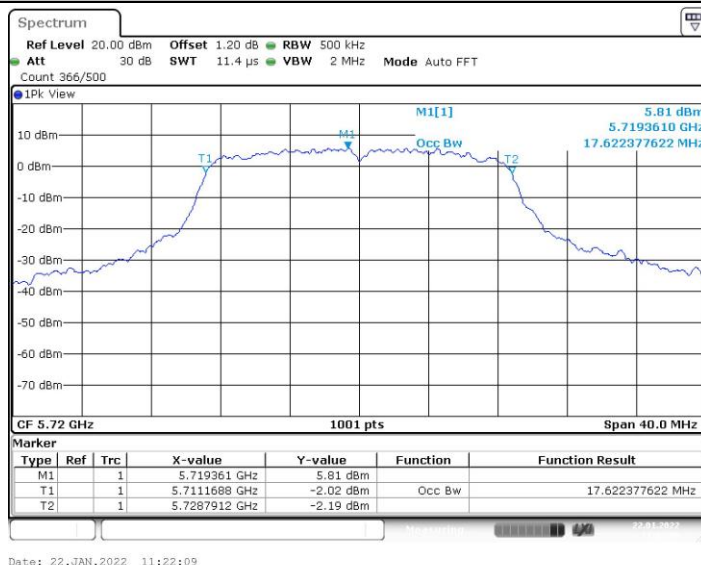


11AC20SISO_Ant1_5745

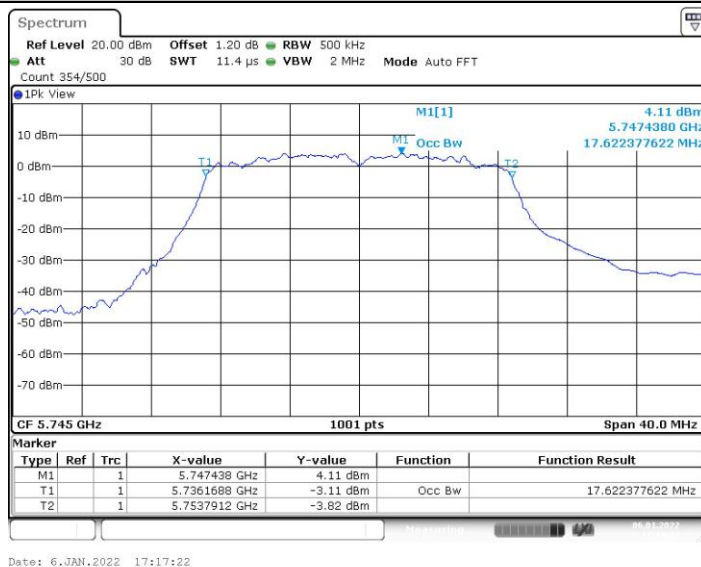


11AC20SISO_Ant1_5785



11AC20SISO_Ant1_5825

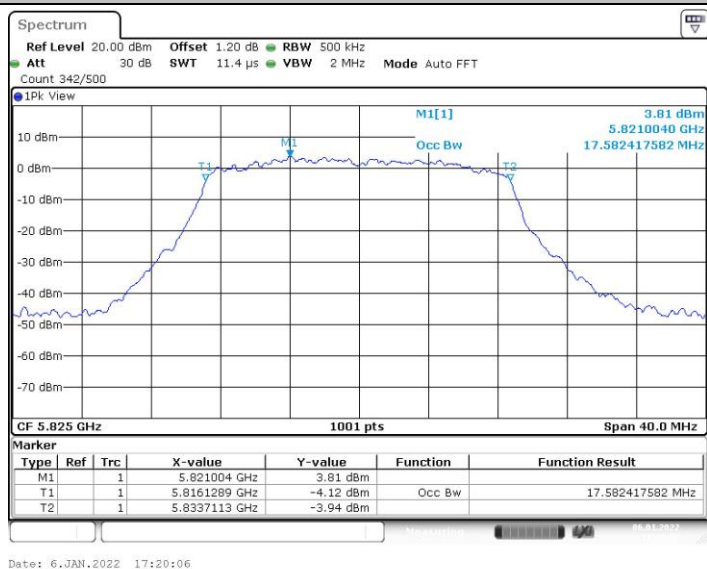


11AC40SISO_Ant1_5190

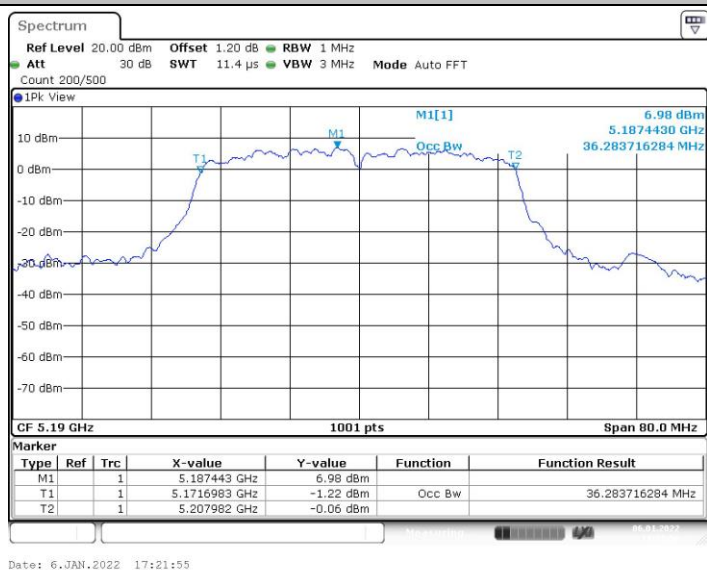




11AC40SISO_Ant1_5230

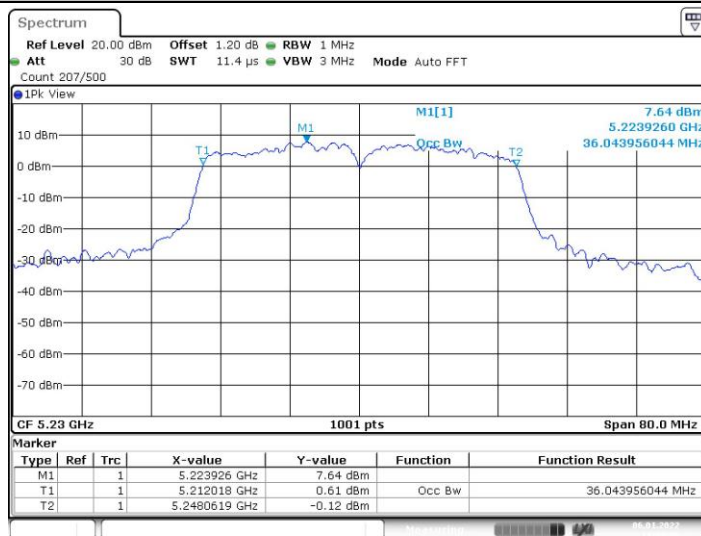


Date: 6.JAN.2022 17:23:08

11AC40SISO_Ant1_5270

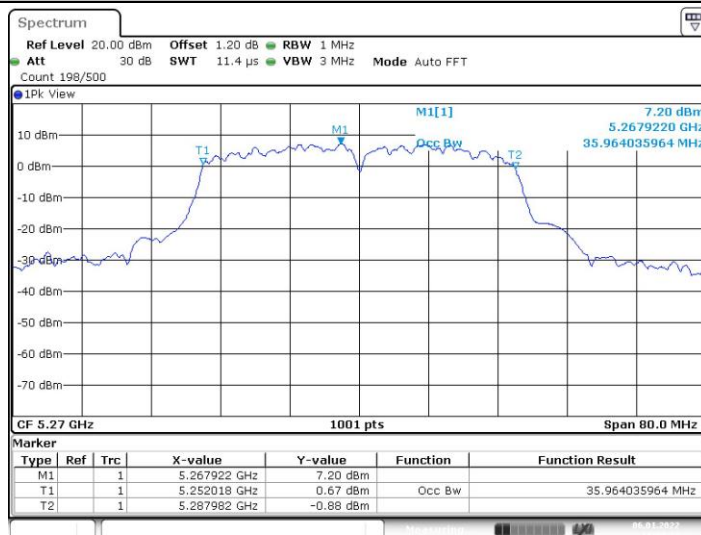


Date: 6.JAN.2022 17:24:21


11AC40SISO_Ant1_5310

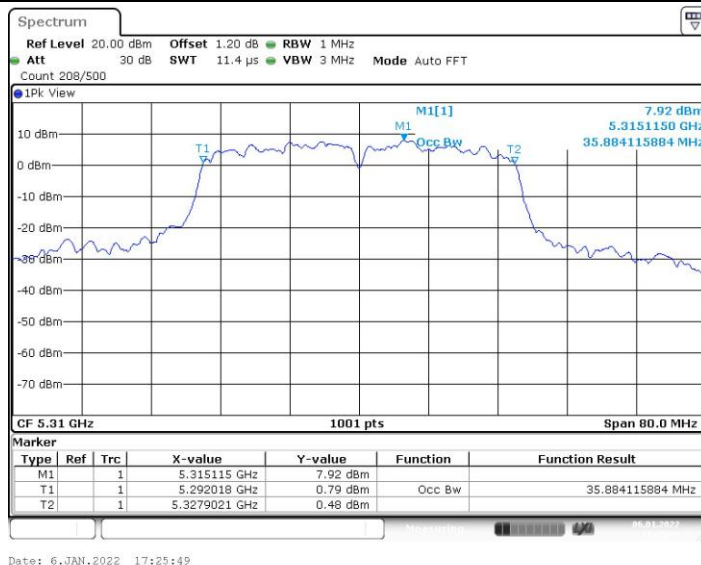

11AC40SISO_Ant1_5510

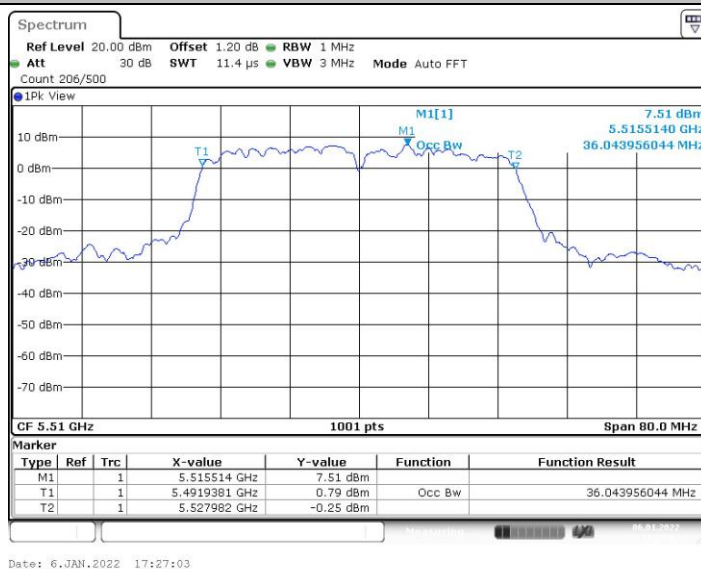


11AC40SISO_Ant1_5550

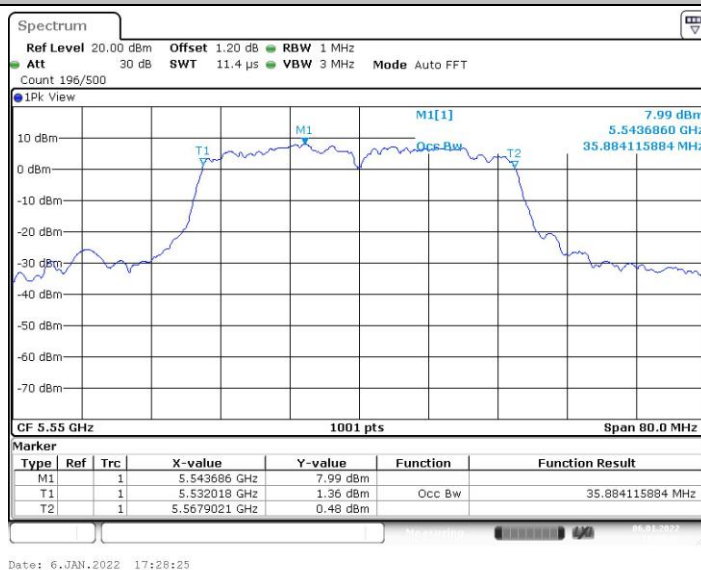




11AC40SISO_Ant1_5670

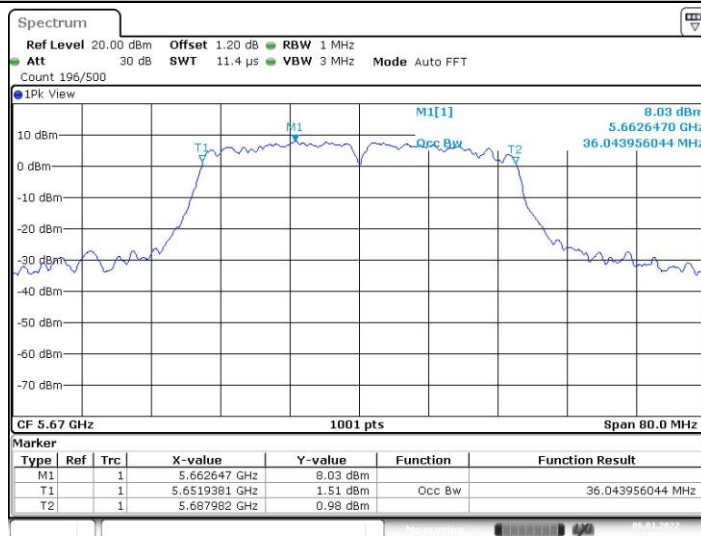


Date: 6.JAN.2022 17:30:12

11AC40SISO_Ant1_5710

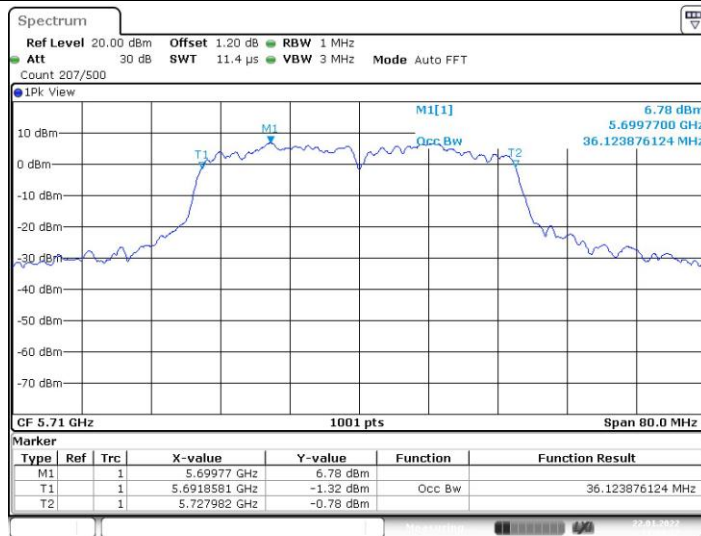


Date: 22.JAN.2022 11:24:27


11AC40SISO_Ant1_5755

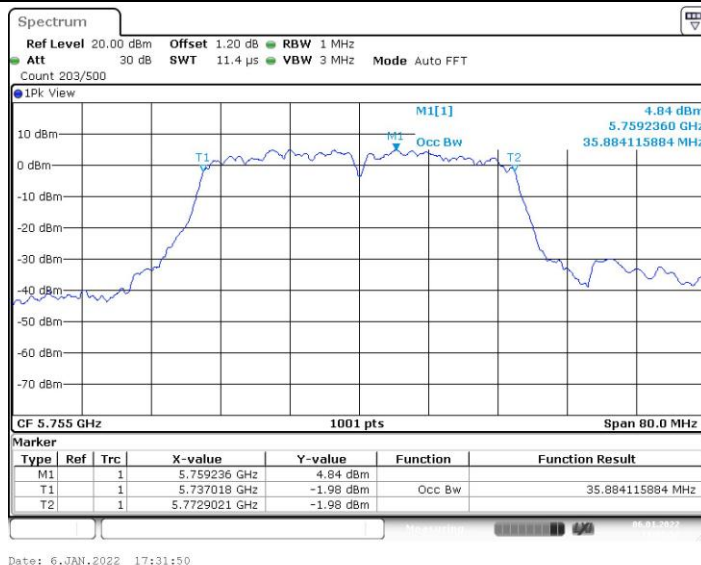

11AC40SISO_Ant1_5795

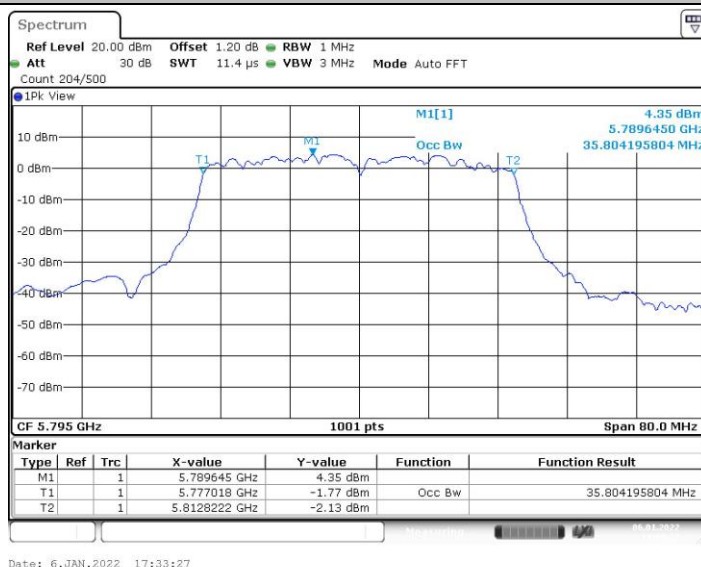


11AC80SISO_Ant1_5210

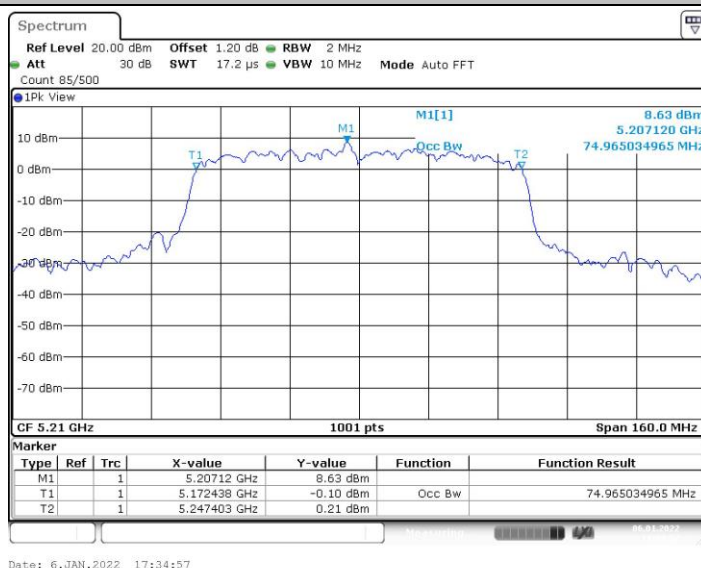




11AC80SISO_Ant1_5290

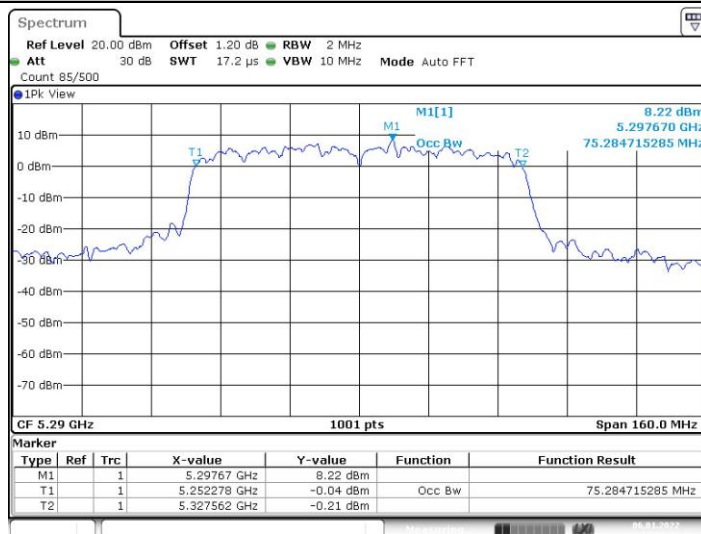


Date: 6.JAN.2022 17:36:15

11AC80SISO_Ant1_5530

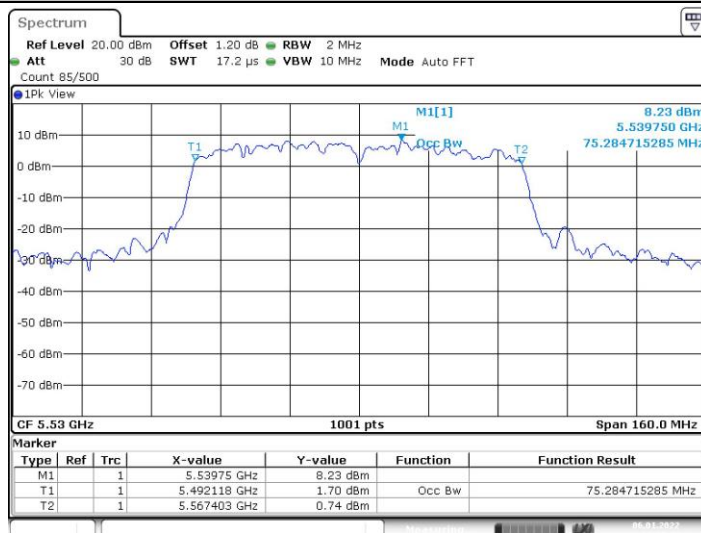


Date: 6.JAN.2022 17:37:42


11AC80SISO_Ant1_5610

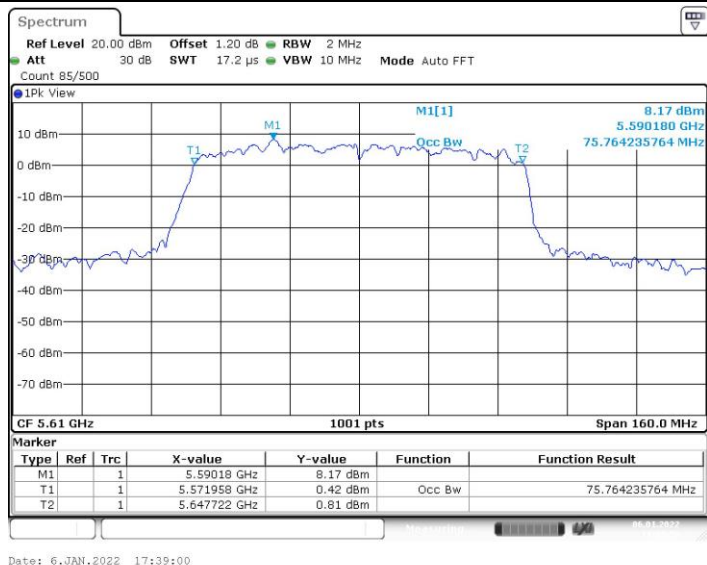

11AC80SISO_Ant1_5690

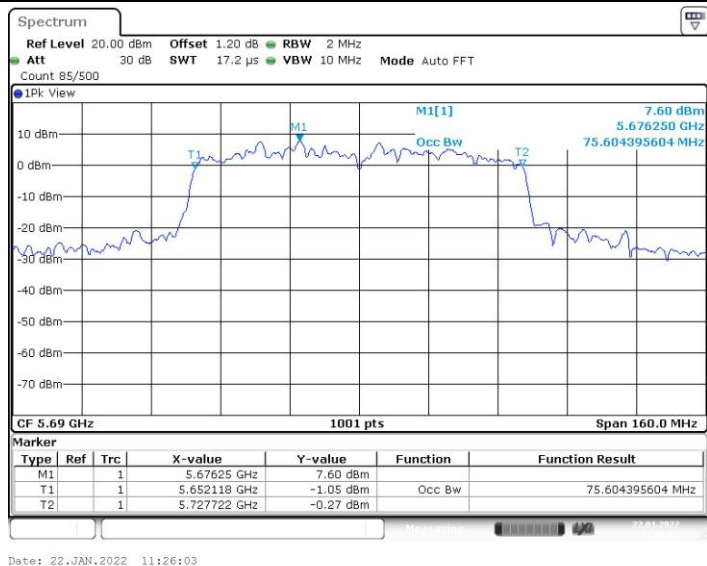

11AC80SISO_Ant1_5775

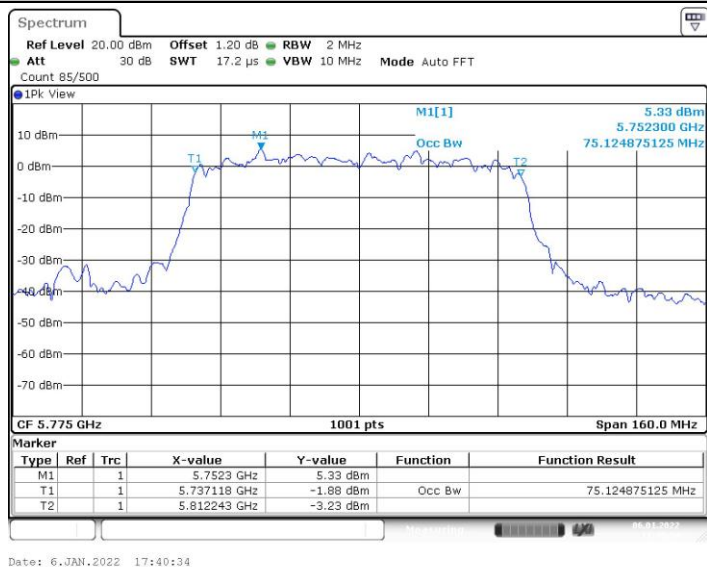



Appendix A3: Min emission bandwidth


Test Result

TestMode	Antenna	Channel	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	13.92	5738.64	5752.56	0.5	PASS
		5785	16.28	5776.80	5793.08	0.5	PASS
		5825	15.08	5817.44	5832.52	0.5	PASS
11N20SISO	Ant1	5745	15.08	5737.40	5752.48	0.5	PASS
		5785	16.92	5776.44	5793.36	0.5	PASS
		5825	16.28	5816.56	5832.84	0.5	PASS
11N40SISO	Ant1	5755	35.12	5737.40	5772.52	0.5	PASS
		5795	35.12	5777.40	5812.52	0.5	PASS
11AC20SISO	Ant1	5745	14.44	5737.44	5751.88	0.5	PASS
		5785	13.92	5778.64	5792.56	0.5	PASS
		5825	16.56	5816.56	5833.12	0.5	PASS
11AC40SISO	Ant1	5755	35.12	5737.40	5772.52	0.5	PASS
		5795	31.92	5780.60	5812.52	0.5	PASS
11AC80SISO	Ant1	5775	67.68	5738.68	5806.36	0.5	PASS




Test Graphs


11A_Ant1_5745

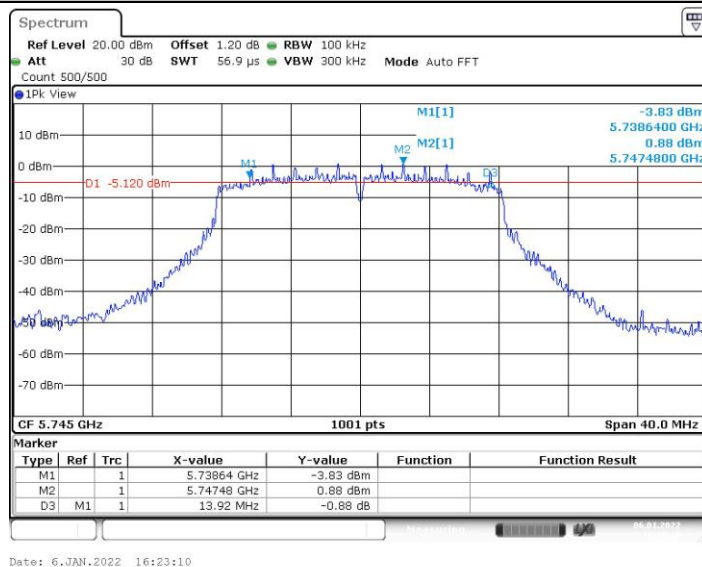


11A_Ant1_5785

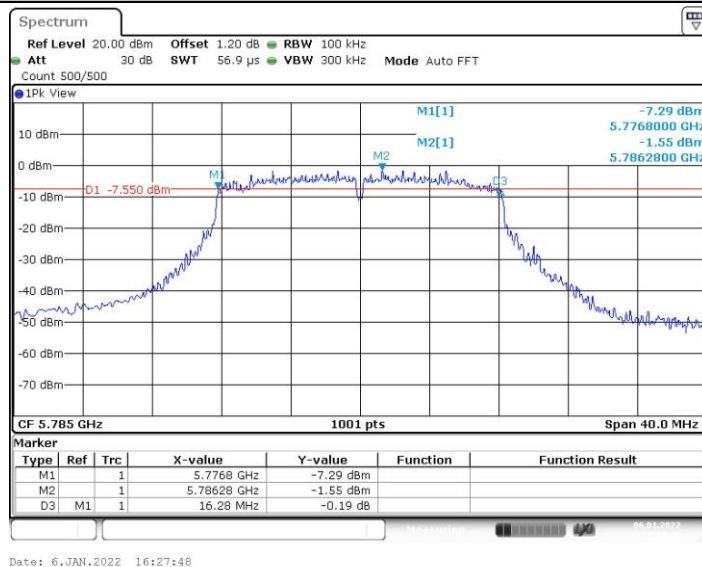


11A_Ant1_5825

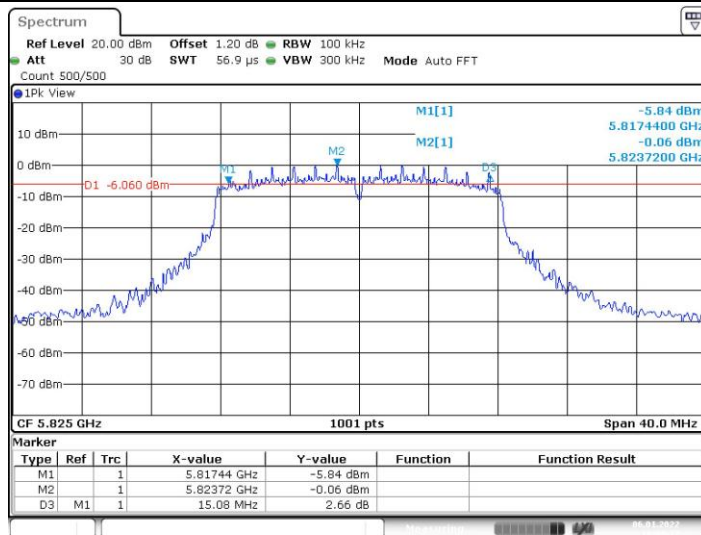

11N20SISO_Ant1_5745

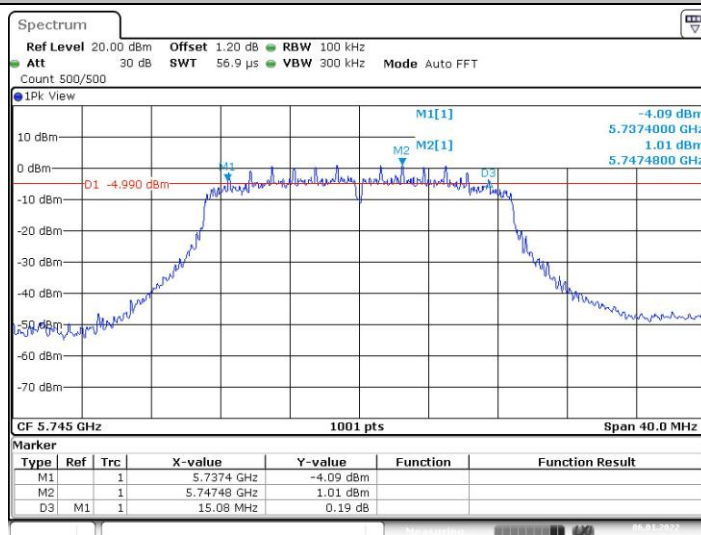


11N20SISO_Ant1_5785

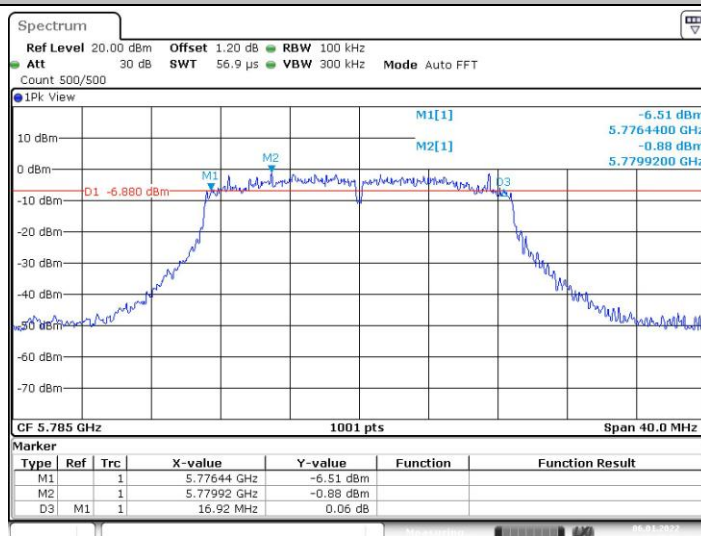




11N20SISO_Ant1_5825

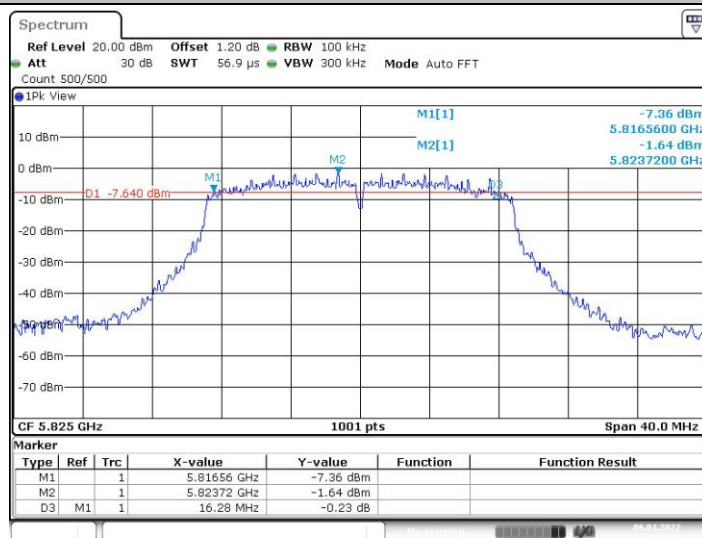


Date: 6.JAN.2022 16:50:12

11N40SISO_Ant1_5755

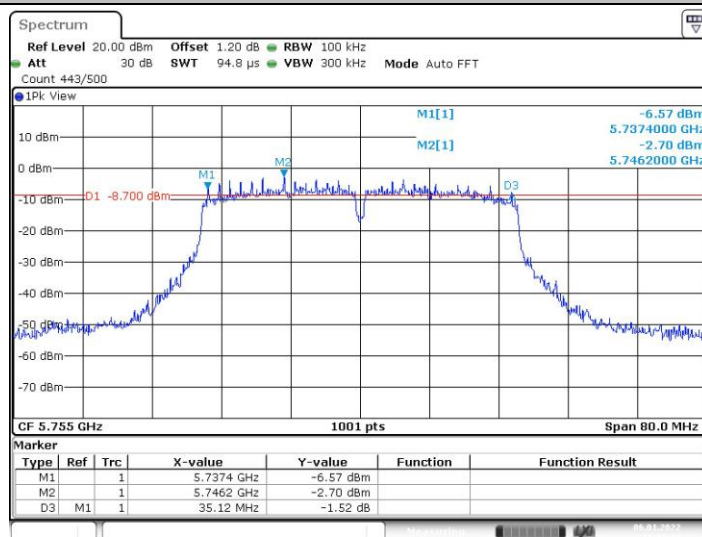


Date: 6.JAN.2022 17:01:38


11N40SISO_Ant1_5795

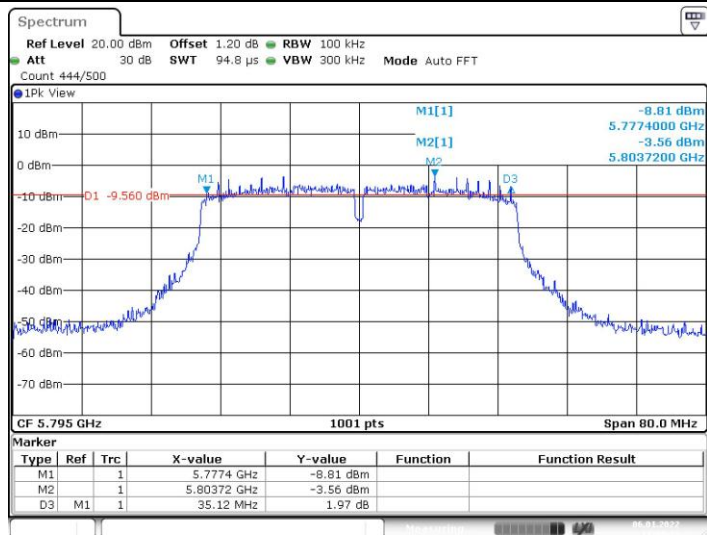

11AC20SISO_Ant1_5745

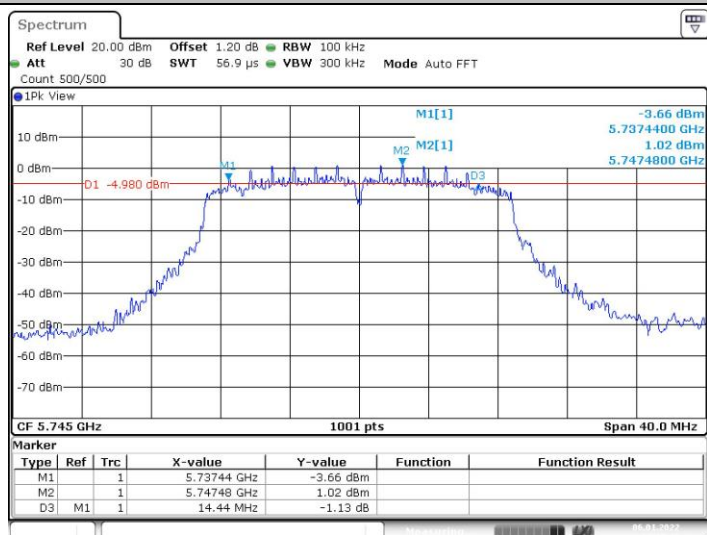


11AC20SISO_Ant1_5785

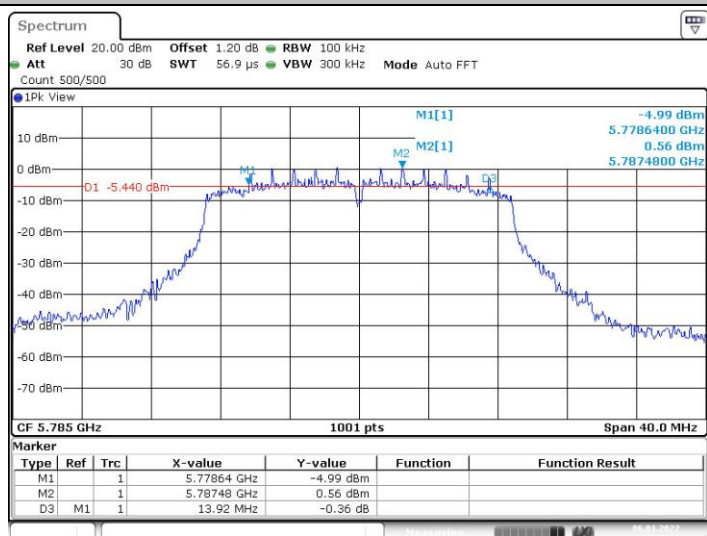





11AC20SISO_Ant1_5825

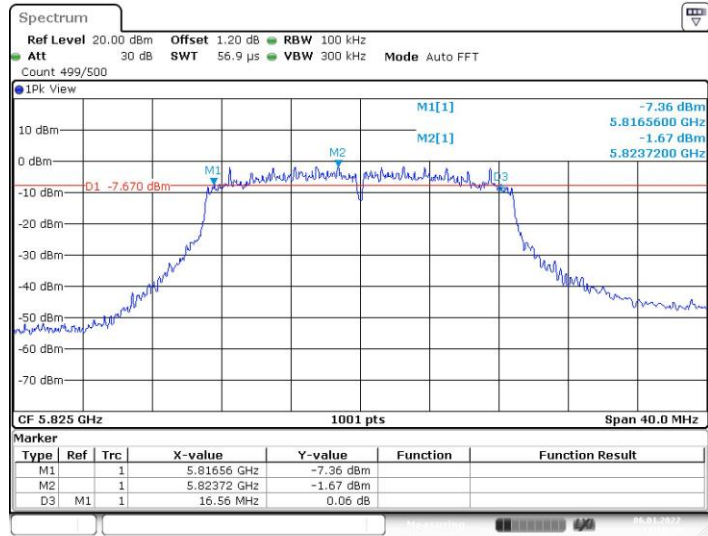

11AC40SISO_Ant1_5755

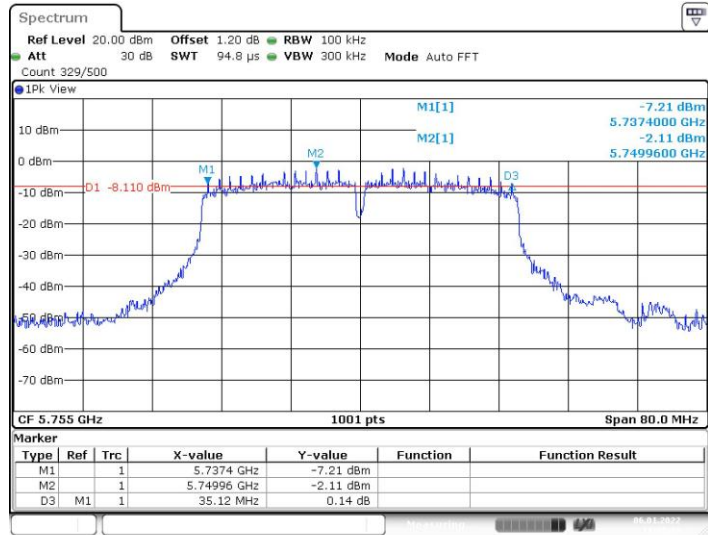


11AC40SISO_Ant1_5795

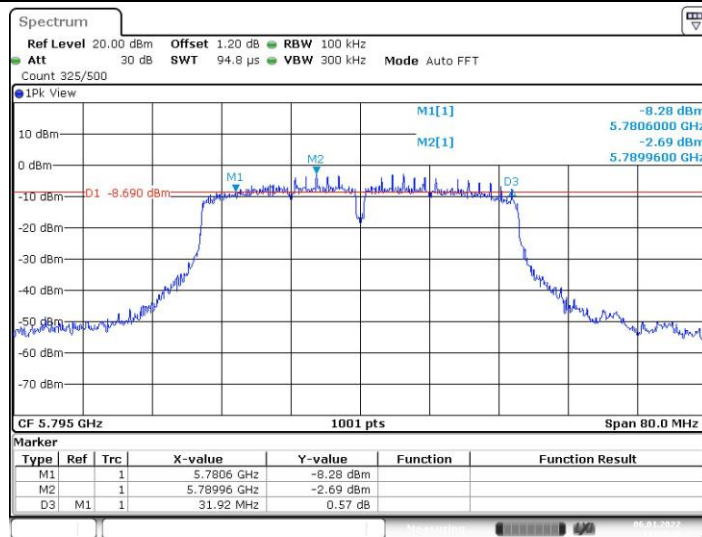

Date: 6.JAN.2022 17:33:15

11AC80SISO_Ant1_5775

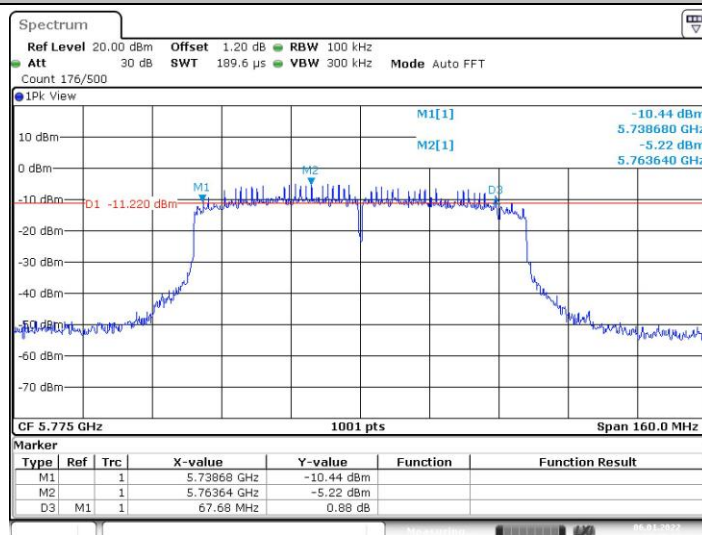

Date: 6.JAN.2022 17:40:22



Appendix B: Maximum conducted output power

Test Result

TestMode	Antenna	Channel	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	5180	15.35	≤30	PASS
		5200	15.31	≤30	PASS
		5240	15.15	≤30	PASS
		5260	15.19	≤24	PASS
		5280	15.75	≤24	PASS
		5320	15.57	≤24	PASS
		5500	15.78	≤24	PASS
		5580	15.83	≤24	PASS
		5700	17.45	≤24	PASS
		5720_UNII-2C	17.25	≤24	PASS
		5720_UNII-3	17.24	≤30	PASS
		5745	13.21	≤30	PASS
		5785	12.63	≤30	PASS
		5825	12.24	≤30	PASS
11N20SISO	Ant1	5180	15.43	≤30	PASS
		5200	15.52	≤30	PASS
		5240	15.17	≤30	PASS
		5260	15.04	≤24	PASS
		5280	15.57	≤24	PASS
		5320	15.33	≤24	PASS
		5500	15.75	≤24	PASS
		5580	15.42	≤24	PASS
		5700	17.40	≤24	PASS
		5720_UNII-2C	17.25	≤24	PASS
		5720_UNII-3	17.25	≤30	PASS
		5745	13.04	≤30	PASS
		5785	12.78	≤30	PASS
		5825	12.01	≤30	PASS
11N40SISO	Ant1	5190	15.13	≤30	PASS
		5230	14.89	≤30	PASS
		5270	14.68	≤24	PASS
		5310	15.02	≤24	PASS
		5510	15.17	≤24	PASS
		5550	15.18	≤24	PASS
		5670	15.73	≤24	PASS
		5710_UNII-2C	16.93	≤24	PASS
		5710_UNII-3	16.94	≤30	PASS
		5755	12.62	≤30	PASS