

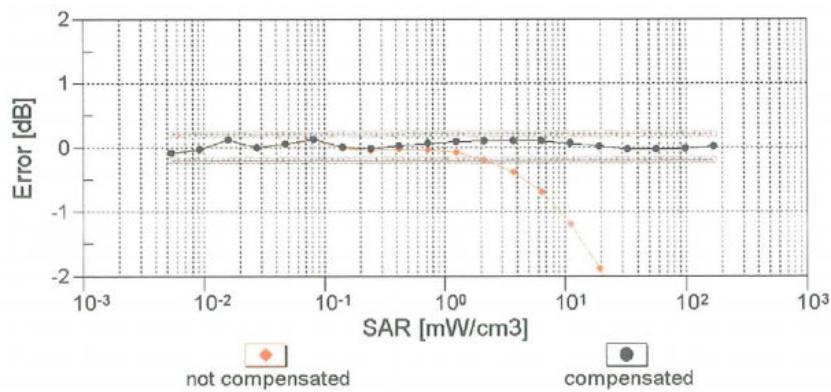


Dynamic Range $f(\text{SAR}_{\text{head}})$ (TEM cell , $f_{\text{eval}}= 1900 \text{ MHz}$)


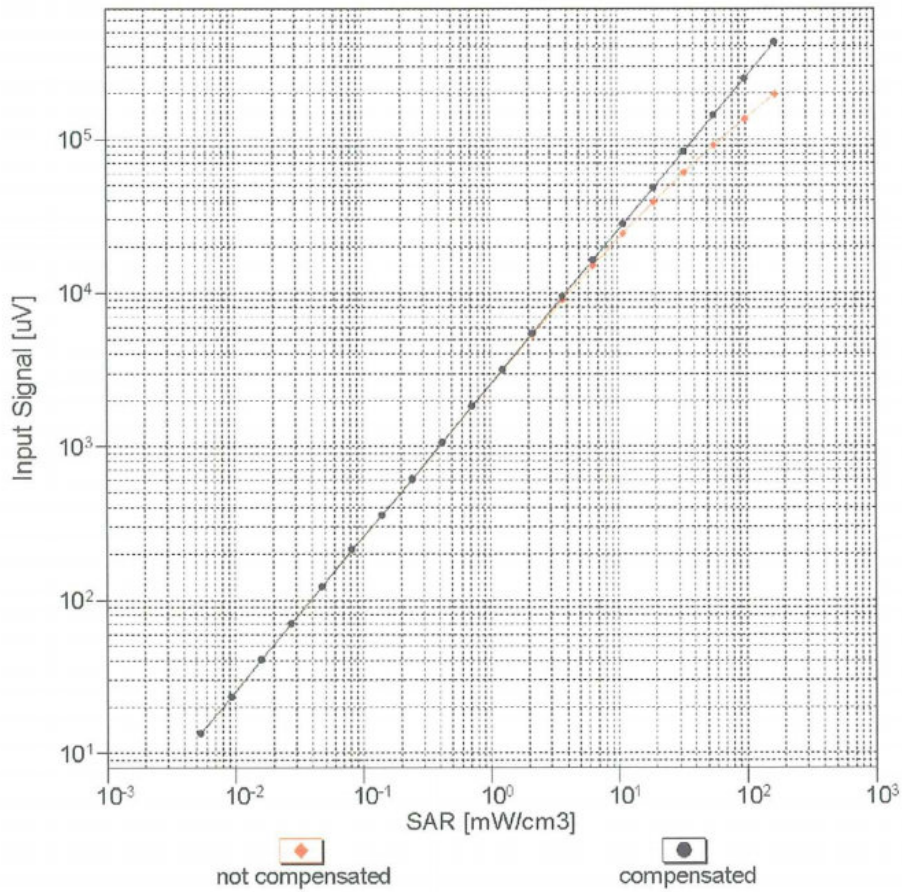


Uncertainty of Linearity Assessment: $\pm 0.6\%$ ($k=2$)

Conversion Factor Assessment

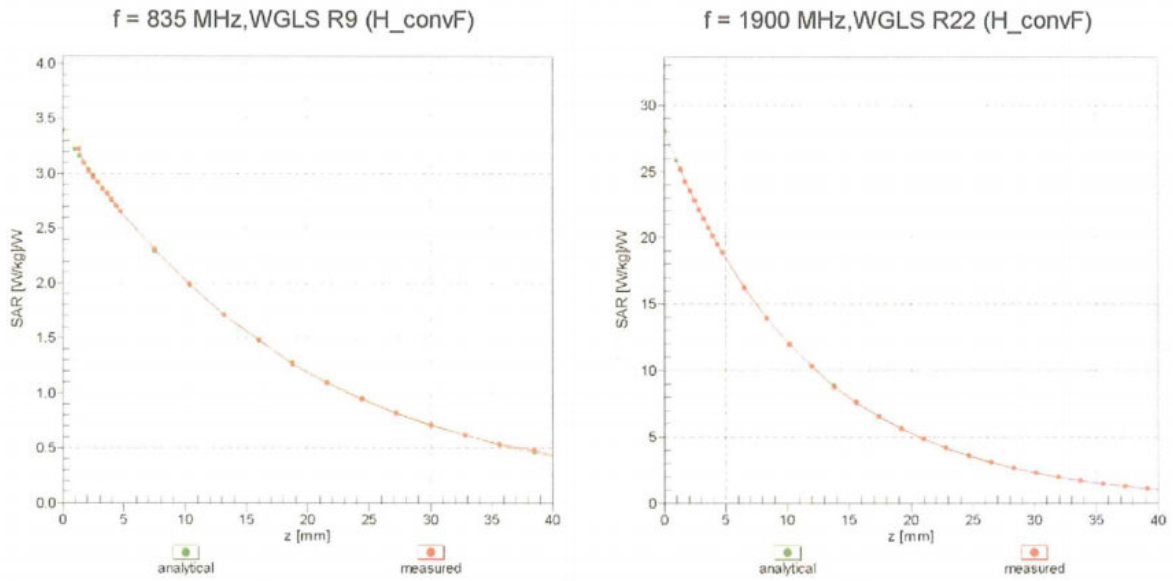

Deviation from Isotropy in Liquid Error (ϕ, ϑ), f = 900 MHz

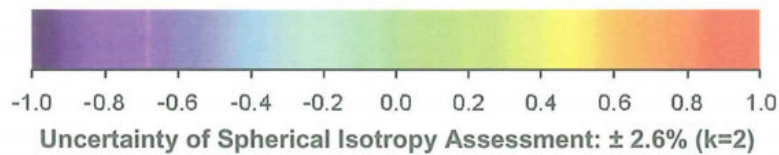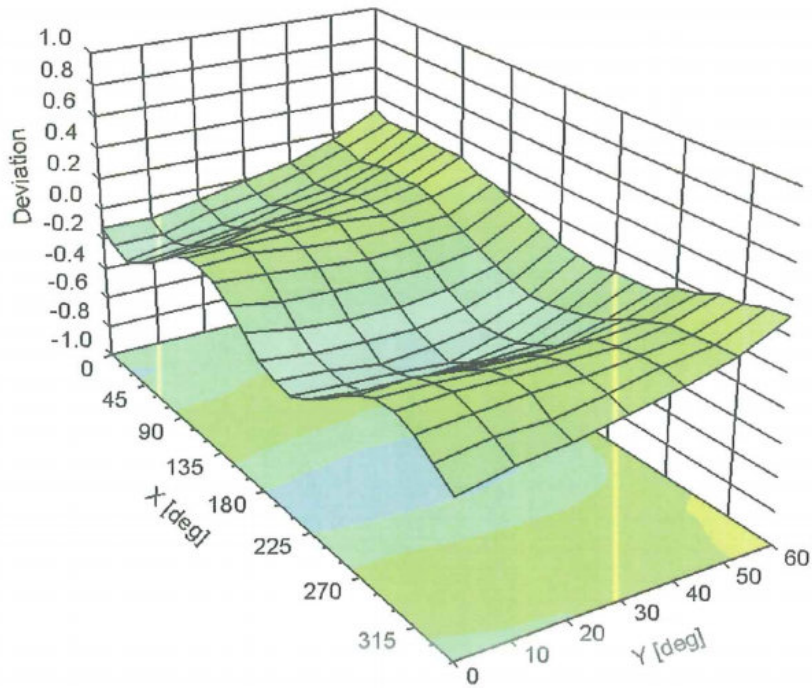

DASY/EASY - Parameters of Probe: EX3DV4 - SN:3911

Other Probe Parameters

Sensor Arrangement	Triangular
Connector Angle (°)	80
Mechanical Surface Detection Mode	enabled
Optical Surface Detection Mode	disabled
Probe Overall Length	337 mm
Probe Body Diameter	10 mm
Tip Length	9 mm
Tip Diameter	2.5 mm
Probe Tip to Sensor X Calibration Point	1 mm
Probe Tip to Sensor Y Calibration Point	1 mm
Probe Tip to Sensor Z Calibration Point	1 mm
Recommended Measurement Distance from Surface	1.4 mm



Appendix E. Product Equality Declaration

Lenovo Mobile Communication Technology Ltd.

No.999, Qishan North 2nd Road, Information & Optoelectronics Park, Torch Hi-tech

Industry Development Zone, Xiamen, P.R.China

Tel: 86-10-58866181; Fax: 86-10-56720293

Date: January 13, 2017

Product Equality Declaration

We, Lenovo Mobile Communication Technology Ltd., declare on our sole responsibility for the product of **Dante-Brazil SKU** as below:


The differences between **Dante- Brazil SKU** and previous as below:

Object	1 st Source spec		2 nd Source spec	
	Specifications	Supplier	Specifications	Supplier
Battery	GK40	Amperex	GK40	SUNWODA
Band7 Duplexer	B39272B8674P810	EPCOS	SAYEY2G53BA0F0AR05	Murata
Band28A Duplexer	B8538	EPCOS	SAYEY718MBC0F0A	Murata
Band28B Duplexer	B8539	EPCOS	SAYEY733MBC0F0A	Murata
USB Cable	L25W-051000100AL	Liqi	F25W-051000100A	Fukangyuan
Charger	C-P36 (EU) C-P35 (US)	Acbel	SSW-2919EU C-P36 SPN5944A (EU) SSW-2919UMTJ C-P35 SPN5945A (US)	Salom

Except above, the others are all the same.

Should you have any questions or comments regarding this matter, please have my best attention.

Sincerely yours,

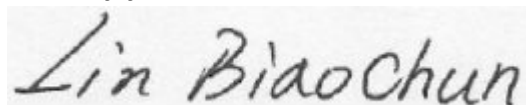

Contact Person: Lin Biao Chun

COMPANY: Motorola Mobility LLC.

Tel:86- 18150396560

E-Mail: Linbc@lenovo.com



Appendix F. Original Report

Please refer to Sporton report number FA693004-05 which is issued separately.