Hearing Aid Compatibility (HAC) T-Coil Test Report

APPLICANT : Motorola Mobility LLC

EQUIPMENT: Mobile Cellular Phone

BRAND NAME: Motorola

MODEL NAME : XT1921-6, XT1921-1

FCC ID : IHDT56XC1

T-RATING : T4

STANDARD : FCC 47 CFR §20.19

ANSI C63.19-2011

We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures and shown the compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Eric Huang / Manager

Approved by: Jones Tsai / Manager





Report No.: HA7D2018-03B

SPORTON INTERNATIONAL INC.

No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 1 of 23 Report Issued Date : Feb. 23, 2018



SPORTON LAB. FCC HAC T-Coil Test Report

Table of Contents

1.	Attest	tation of Test Summary	4			
2.	-					
3.						
4.		ed Standards				
5.		terface and Operating Mode				
6.		urement standards for T-Coil				
	6.1	Frequency Response				
	6.2	T-Coil Signal Quality Categories				
7.	T-Coil	Test Procedure				
	7.1	Test Flow Chart				
	7.2	Test Setup Diagram				
	7.3	Description of EUT Test Position				
8.	Test E	equipment List	14			
9.	T-Coil	testing for CMRS Voice	15			
	9.1	GSM Tests Results				
	9.2	UMTS Tests Results				
	9.3	CDMA Tests Results	16			
	9.4	VoLTE Tests Results	17			
	9.5	VoWiFi Tests Results	19			
10.	T-Coil	testing for OTT VoIP Calling	20			
		rtainty Assessment				
		ences				

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Report No.: HA7D2018-03B



Revision History

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
HA7D2018-03B	Rev. 01	Initial issue of report	Feb. 23, 2018

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 3 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01

1. Attestation of Test Summary

Air Interface	Band MHz	T-Rating	Frequency Response	Magnetic Intensity
	GSM850	T4	Pass	Pass
GSM CMRS Voice	GSM1900	T4	Pass	Pass
	EDGE850	T4	Pass	Pass
OTT over EDGE	EDGE1900	T4	Pass	Pass
	Band 2	T4	Pass	Pass
UMTS CMRS Voice	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 2	T4	Pass	Pass
OTT over UMTS	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	BC0	T4	Pass	Pass
CDMA CMRS Voice	BC1	T4	Pass	Pass
	BC10	T4	Pass	Pass
	BC0	T4	Pass	Pass
OTT over CDMA	BC1	T4	Pass	Pass
	BC10	T4	Pass	Pass
	Band 2	T4	Pass	Pass
	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 7	T4	Pass	Pass
	Band 12	T4	Pass	Pass
	Band 13	T4	Pass	Pass
VoLTE	Band 17	T4	Pass	Pass
	Band 25	T4	Pass	Pass
	Band 26	T4	Pass	Pass
	Band 30	T4	Pass	Pass
	Band 66	T4	Pass	Pass
	Band 38	T4	Pass	Pass
	Band 41	T4	Pass	Pass
OTT aver LTE	Band 25	T4	Pass	Pass
OTT over LTE	Band 41	T4	Pass	Pass
	2450	T4	Pass	Pass
	5200	T4	Pass	Pass
VoWiFI	5300	T4	Pass	Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
OTT over WiFi	2450	T4	Pass	Pass
OTT over WiFi	5300	T4	Pass	Pass
Date Tested		2018/1/23	3 ~ 2018/2/12	

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 4 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01

2. General Information

	Product Feature & Specification
Applicant Name	Motorola Mobility LLC
Equipment Name	Mobile Cellular Phone
Brand Name	Motorola
Model Name	XT1921-6, XT1921-1
FCC ID	IHDT56XC1
HW Version	DVT1B
SW Version	Verizon:fastboot_rjames_vzw_oem_vzw_userdebug_8.0.0_ODP27.62_1030_intcfg-test-keys _vzw.tar.gz Retail:fastboot_rjames_oem_userdebug_8.0.0_OPP27.62_1361_intcfg-test-keys_oem.tar.gz
EUT Stage	Identical Prototype
Exposure category	General Population/Uncontrolled Exposure
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC1: 1851.25 MHz ~ 1908.75 MHz CDMA 2000 BC10: 817.9 MHz ~ 823.1 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 713.5 MHz LTE Band 17: 706.5 MHz ~ 713.5 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 30: 2307.5 MHz ~ 2312.5 MHz LTE Band 36: 814.7 MHz ~ 848.3 MHz LTE Band 66: 1710.7 MHz ~ 1779.3 MHz LTE Band 66: 1710.7 MHz ~ 2617.5 MHz LTE Band 41: 2498.5 MHz ~ 2687.5 MHz LTE Band 41: 2498.5 MHz ~ 2687.5 MHz LTE Band 45: 2412 MHz ~ 2462 MHz WLAN 2.4GHz Band: 5180 MHz ~ 5240 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.3GHz Band: 5745 MHz ~ 5825 MHz Bluetoott: 2402 MHz ~ 2480 MHz
Mode	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA DC-HSDPA CDMA2000: 1xRTT/1xEv-Do(Rev.0)/1xEv-Do(Rev.A) LTE: QPSK, 16QAM WLAN 2.4GHz: 802.11b/g/n HT20 WLAN 5GHz: 802.11a/n HT20/HT40 Bluetooth BR/EDR/LE

Report No.: HA7D2018-03B

 SPORTON INTERNATIONAL INC.
 Page Number
 : 5 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

3. Administration Data

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

	Testing Laboratory					
Test Site	SPORTON INTERNATIONAL INC.					
Test Site Location	No.52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978					
Test Site No.	Sporton Site No. : SAR04-HY					
	Applicant					
Company Name	Motorola Mobility LLC					
Address	222 W,Merchandise Mart Plaza, Chicago IL 60654 USA					
Manufacturer						
Company Name	Motorola Mobility LLC					
Address 222 W,Merchandise Mart Plaza, Chicago IL 60654 USA						

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19-2011
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 6 of 23 Report Issued Date : Feb. 23, 2018

Report No.: HA7D2018-03B

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous	Name of Voice Service	Power Reduction
	0014050		resteu	Transmitter	Service	
	GSM850	VO	Yes	WLAN, BT	CMRS Voice	No
GSM	GSM1900			WLAN, BT		No
	EDGE850	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	EDGE1900					
	850			WLAN, BT		No
UMTS	1750	VO	Yes	WLAN, BT	CMRS Voice	No
	1900			WLAN, BT	(4)	No
	HSPA	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	850	VO	Yes	WLAN, BT	CMRS Voice	No
CDMA	1900			WLAN, BT	Google Duo ⁽¹⁾	No
	EVDO	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	Band 2			WLAN, BT		No
	Band 4			WLAN, BT		No
	Band 5			WLAN, BT	_	No
	Band 7			WLAN, BT	_	No
LTE	Band 12			WLAN, BT	VoLTE	No
(FDD)	Band 13	VD	Yes	WLAN, BT	/ (1)	No
()	Band 17			WLAN, BT	Google Duo ⁽¹⁾	No
	Band 25			WLAN, BT		No
	Band 26			WLAN, BT		No
	Band 30			WLAN, BT		No
	Band 66			WLAN, BT		No
LTE	Band 38	\/D	V	WLAN, BT	VoLTE	No
(TDD)	Band 41	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	2450					No
	5200				VoWiFi	No
Wi-Fi	5300	VD	Yes	GSM,WCDMA,CDMA,LTE	/	No
	5500				Google Duo ⁽¹⁾	No
	5800					No
ВТ	2450	DT	No	GSM,WCDMA,CDMA,LTE	NA	No

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

Remark

 For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of −20 dBm0 should be used.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 7 of 23
Report Issued Date : Feb. 23, 2018


Report No.: HA7D2018-03B

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA7D2018-03B

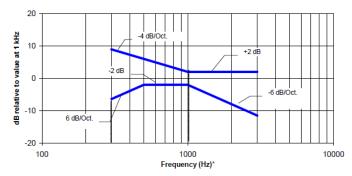

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

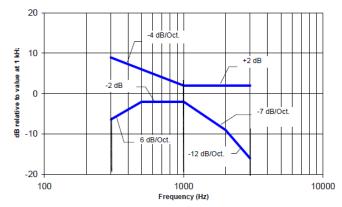

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

 SPORTON INTERNATIONAL INC.
 Page Number
 : 8 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA7D2018-03B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,

Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 9 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

7.1 Test Flow Chart


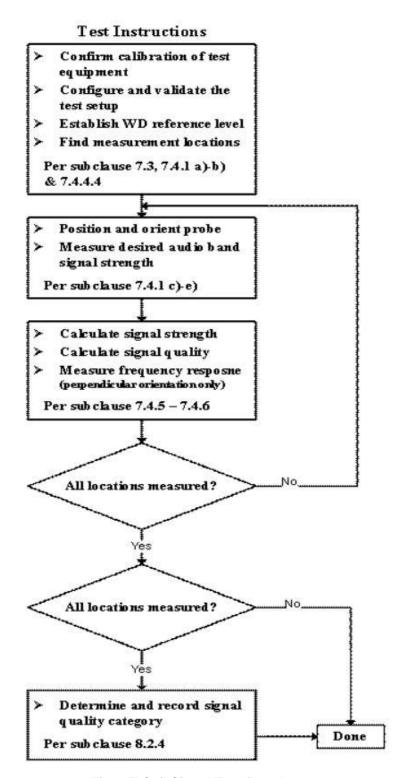


Fig. 2 T-Coil Signal Test flowchart

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 10 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01

7.2 Test Setup Diagram

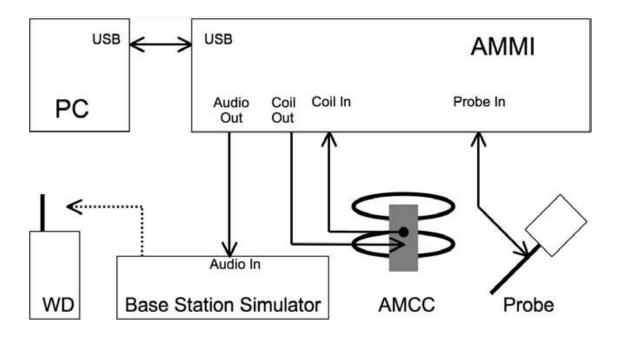

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - CDMA input level: -18dBm0
 - VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0
 - OTT VoIP input Level: -20dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. The test setup used for VoLTE over IMS and VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 5. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 11 of 23
Report Issued Date : Feb. 23, 2018

Report No.: HA7D2018-03B



SPORTON LAB. FCC HAC T-Coil Test Report

The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA7D2018-03B

The below calculation formula is an example and showing how to determine the input level for the air interface for the 2. device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

<An example for determine input level>

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10 Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.39	3.14
10	20	-19.93	-14.40
8.32	18.40	-21.53	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.32
48k_voice_1kHz	1	16.2	-12.7	4.33	36.02
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	70.53

SPORTON INTERNATIONAL INC. Page Number : 12 of 23 TEL: 886-3-327-3456 Report Issued Date: Feb. 23, 2018 FAX: 886-3-328-4978 Report Version : Rev. 01

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

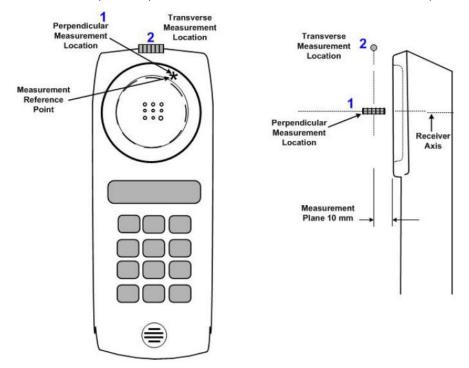


Fig.3 A typical EUT reference and plane for T-Coil measurements

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 13 of 23 Report Issued Date : Feb. 23, 2018

Report No.: HA7D2018-03B

8. Test Equipment List

Manufacturer	Name of Equipment	Type/Model Serial Number	Calib	ration	
Manufacturer	Name of Equipment	i ype/wodei	Last C	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018
SPEAG	Data Acquisition Electronics	DAE4	854	May. 02, 2017	May. 01, 2018
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
Gencom	Thermometer	TE1	TM685-1	Mar. 21, 2017	Mar. 20, 2018
Gencom	Thermometer	TE1	TM685-2	Mar. 21, 2017	Mar. 20, 2018
R&S	Base Station	CMU200	116457	May. 23, 2017	May. 22, 2018
R&S	Base Station	CMW500	157119	Jun. 18, 2017	Jun. 17, 2018

Note:

1. NCR: "No-Calibration Required"

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 14 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01

9. <u>T-Coil testing for CMRS Voice</u>

General Note:

- 1. The middle channel of each frequency band is used for T-Coil testing according ANSI C63.19 2011.
- For VoLTE or VoWiFi radio configuration investigation is choose either one codec and an investigation
 was performed on all frequency band, data rates and modulations and RB configuration to determine the
 radio configuration to be used for testing, the following tests results which the worst case configuration
 would be remarked to be used for the testing for the handset.

Report No.: HA7D2018-03B

- 3. Choose worst case from radio configuration investigation. After investigation was performed to determine the audio codec configuration to be used for testing, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 4. According to 3GPP 36.211 Table 4.2-2, the TDD LTE power class 3 supports uplink-downlink configuration 0 to 6, an investigation was performed to determine the worst-case uplink-downlink configuration and with the FDD LTE worst case radio configuration.
- 5. For VoWiFi codec selection, due to the same with VoLTE codec configuration, therefore, worst codec is choose from VoLTE codec investigation to be used for others air interfaces testing of VoWiFi.

9.1 GSM Tests Results

<Codec Investigation>

Codec	FR V1	HR V1	Orientation	Band / Channel	
ABM 1 (dBA/m)	0.67	1.97			
ABM 2 (dBA/m)	-31.87	-30.66	Axial	GSM850 / 189	
Freq. Response	Pass	Pass	Axiai	G3W630 / 169	
Signal Quality (dB)	32.54	32.63			

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
1	GSM850	CMRS Voice FR V1	189	Axial (Z)	1.97	-30.66	32.63	T4	PASS
'	GSIVIOSO	CIVIRS VOICE_FR VI	109	Transversal (Y)	-5.97	-44.19	38.22	T4	PASS
2	CSM1000	CMRS Voice FR V1	661	Axial (Z)	2.01	-31.70	33.71	T4	PASS
2 GSM1900		CIVING VOICE_FR VT	001	Transversal (Y)	-5.86	-44.39	38.53	T4	FAGG

 SPORTON INTERNATIONAL INC.
 Page Number
 : 15 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

9.2 <u>UMTS Tests Results</u>

<Codec Investigation>

Codec	12.2kbps	7.95kbps	4.75kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	1.66	0.51	0.68		
ABM 2 (dBA/m)	-42.88	-44.16	-44.28	Axial	Band 2 / 9400
Freq. Response	Pass	Pass	Pass	Axiai	Daliu 2 / 9400
Signal Quality (dB)	44.54	44.67	44.96		

Report No.: HA7D2018-03B

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
3	WCDMA II	AMR 12.2Kbps	9400	Axial (Z)	1.66	-42.88	44.54	T4	PASS
3	WCDIVIA II	AIVIR 12.2KUps	9400	Transversal (Y)	-5.76	-44.93	39.17	T4	PASS
4	WCDMA IV	AMR 12.2Kbps	1413	Axial (Z)	1.78	-43.49	45.27	T4	PASS
4	VVCDIVIA IV	AIVIR 12.2KUps	1413	Transversal (Y)	-5.71	-45.70	39.99	T4	PASS
5	WCDMA V	AMR 12.2Kbps	4182	Axial (Z)	0.37	-43.96	44.33	T4	PASS
3	VVCDIVIA V	AIVIN 12.2NDps	4102	Transversal (Y)	-5.72	-45.81	40.09	T4	FASS

9.3 CDMA Tests Results

<Codec Investigation>

Codec	RC1 SO68	RC3 SO68	RC4 SO68	Orientation	Band / Channel	
ABM 1 (dBA/m)	-2.73	-2.29	-3.47			
ABM 2 (dBA/m)	-40.38	-44.20	-44.65	Axial	BC0 / 384	
Freq. Response	Pass	Pass	Pass	Axiai	BC0 / 364	
Signal Quality (dB)	37.65	41.91	41.18			

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
6	CDMA BC0	RC1 SO68	384	Axial (Z)	-2.73	-40.38	37.65	T4	PASS
О	CDIVIA BCU	RC1 5000	304	Transversal (Y)	-9.59	-46.32	36.73	T4	PASS
7	CDMA BC1	RC1 SO68	600	Axial (Z)	-2.80	-42.14	39.34	T4	PASS
′	CDIVIA BC I	RC1 5000	600	Transversal (Y)	-9.90	-46.38	36.48	T4	PASS
8	CDMA BC10	RC1 SO68	580	Axial (Z)	-1.35	-41.07	39.72	T4	PASS
0	CDMA BC10	KC1 5000	560	Transversal (Y)	-10.37	-46.42	36.05	T4	FASS

 SPORTON INTERNATIONAL INC.
 Page Number
 : 16 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

9.4 VoLTE Tests Results

< Radio Configuration Investigation>

Air Interface	Bandwidth (MHz)	Modulation	RB size	RB offset	channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)
LTE B2	20	QPSK	1	0	18900		-0.87	-38.30	37.43
LTE B2	20	QPSK	50	0	18900		-0.65	-39.28	38.63
LTE B2	20	QPSK	100	0	18900		-0.55	-38.79	38.24
LTE B2	20	16QAM	1	0	18900		1.73	-38.93	40.66
LTE B2	15	QPSK	1	0	18900		-0.70	-39.54	38.84
LTE B2	10	QPSK	1	0	18900		-0.67	-39.06	38.39
LTE B2	5	QPSK	1	0	18900		-0.48	-38.62	38.14
LTE B2	3	QPSK	1	0	18900		-0.54	-38.51	37.97
LTE B2	1.4	QPSK	1	0	18900		-0.59	-39.11	38.52
LTE Band 38	20	QPSK	1	0	38000	0	2.81	-35.80	38.61
LTE Band 38	20	QPSK	1	0	38000	1	2.91	-35.80	38.71
LTE Band 38	20	QPSK	1	0	38000	2	3.00	-36.00	39.00
LTE Band 38	20	QPSK	1	0	38000	3	2.64	-36.01	38.65
LTE Band 38	20	QPSK	1	0	38000	4	2.90	-36.14	39.04
LTE Band 38	20	QPSK	1	0	38000	5	2.71	-35.98	38.69
LTE Band 38	20	QPSK	1	0	38000	6	2.95	-35.66	38.61

Report No.: HA7D2018-03B

<AMR Codec Investigation>

Codec	WB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	NB AMR 23.85Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	2.81	-0.50	2.75	1.66		
ABM 2 (dBA/m)	-39.72	-38.42	-38.18	-38.54	Axial	B2 / 20M / 18900
Freq. Response	Pass	Pass	Pass	Pass	Axiai	B2 / 20WI / 10900
Signal Quality (dB)	42.53	37.92	40.93	40.20		

<EVS Codec Investigation>

Codec	EVS SWB 9.6Kbps	EVS SWB 13.2Kbps	EVS WB 5.9Kbps	EVS WB 13.2Kbps	EVS NB 5.9Kbps	EVS NB 13.2Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	2.98	2.88	6.41	1.54	6.12	6.31		
ABM 2 (dBA/m)	-37.71	-38.38	-39.38	-38.16	-37.64	-38.55	Axial	B2 / 20M /
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Axiai	18900
Signal Quality (dB)	40.69	41.23	45.79	39.70	43.76	44.86		

 SPORTON INTERNATIONAL INC.
 Page Number
 : 17 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
9	LTE Band 2	20M QPSK 1RB 0offset AMR 6.60kbps	18900	Axial (Z)	-0.50	-38.42	37.92	T4	PASS
9	LIE Daliu Z	ZUNI_QF3K_TRB_UUIISEL_AIVIR 0.00kbps	10900	Transversal (Y)	-9.33	-44.27	34.94	T4	PASS
10	LTE Band 4	20M QPSK 1RB 0offset AMR 6.60kbps	20175	Axial (Z)	2.71	-38.30	41.01	T4	PASS
10	LIL Daliu 4	ZUNI_QF3K_TKB_UUIISEL_AIVIK U.UUKBPS	20173	Transversal (Y)	-5.97	-43.87	37.90	T4	FAGG
11	LTE Band 5	10M QPSK 1RB 0offset AMR 6.60kbps	20525	Axial (Z)	-0.58	-39.32	38.74	T4	PASS
	LIL Ballu 5	TOW_QF3K_TKB_00liset_AlviK 0.00kbps	20020	Transversal (Y)	-9.12	-45.10	35.98	T4	FAGG
12	LTE Band 7	20M QPSK 1RB 0offset AMR 6.60kbps	21100	Axial (Z)	-0.81	-37.25	36.44	T4	PASS
12	LIL Dallu 1	ZUNI_QF3K_TKB_UUIISEL_AIVIK U.UUKBPS	21100	Transversal (Y)	-9.16	-44.75	35.59	T4	FASS
13	LTE Band 12	10M QPSK 1RB 0offset AMR 6.60kbps	23095	Axial (Z)	2.55	-39.34	41.89	T4	PASS
13	LIE Dallu 12	TOW_QF3K_TRB_OORSEL_AWK 6.60kbps	23093	Transversal (Y)	-7.16	-45.78	38.62	T4	PASS
14	LTE Band 13	10M QPSK 1RB 0offset AMR 6.60kbps	23230	Axial (Z)	2.48	-39.53	42.01	T4	PASS
14	LIL Dallu 13	TOW_QF3K_TKB_OONSEL_AWIK 0.00kbps	23230	Transversal (Y)	-6.02	-45.26	39.24	T4	FASS
15	LTE Band 17	10M_QPSK_1RB_0offset_AMR 6.60kbps	23790	Axial (Z)	-0.86	-39.30	38.44	T4	PASS
13	LIL Dallu 17	TOW_QF3K_TKB_OONSEL_AWIK 0.00kbps	23790	Transversal (Y)	-9.39	-44.65	35.26	T4	FASS
16	LTE Band 25	20M QPSK 1RB 0offset AMR 6.60kbps	26340	Axial (Z)	-0.51	-38.31	37.80	T4	PASS
10	LIE Dallu 23	ZUNI_QF3K_TKB_UUIISEL_AIVIK 0.00KDPS	20340	Transversal (Y)	-9.49	-44.59	35.10	T4	PASS
17	LTE Band 26	15M_QPSK_1RB_0offset_AMR 6.60kbps	26865	Axial (Z)	-0.78	-37.93	37.15	T4	PASS
17	LIE Dallu 20	13IV_QF3K_1KB_00IISet_AIVIK 6.60kbps	20003	Transversal (Y)	-9.96	-44.93	34.97	T4	PASS
18	LTE Band 30	10M QPSK 1RB 0offset AMR 6.60kbps	27710	Axial (Z)	-2.70	-40.73	38.03	T4	PASS
10	LIL Dallu 30	TOW_QF3K_TKB_OONSEL_AWIK 0.00kbps	21110	Transversal (Y)	-9.39	-44.78	35.39	T4	FASS
19	LTE Band 66	20M_QPSK_1RB_0offset_AMR 6.60kbps	132322	Axial (Z)	-0.83	-37.62	36.79	T4	PASS
19	LIL Dand 00	ZUNI_QF3K_TKB_UUIISEL_AIVIK U.UUKBPS	132322	Transversal (Y)	-9.14	-44.28	35.14	T4	FASS
20	LTE Band 38	20M QPSK 1RB 0offset AMR 6.60kbps	38000	Axial (Z)	1.53	-35.66	37.19	T4	PASS
20	LIL Dallu 30	ZOWI_WI SIN_TIND_OURSEL_AWIN 0.00KDPS	30000	Transversal (Y)	-9.39	-44.98	35.59	T4	FAGG
21	LTE Band 41	20M QPSK 1RB 0offset AMR 6.60kbps	40620	Axial (Z)	0.48	-35.72	36.20	T4	PASS
21	LIE Dallu 41	ZUNI_GESK_IND_UUIISEL_AININ 0.0UKDPS	40020	Transversal (Y)	-8.10	-43.91	35.81	T4	FASS

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 18 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01

9.5 VoWiFi Tests Results

< Radio Configuration Investigation>

Air Interface	Bandwidth	Data rate	channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)
802.11b	20	1M	6	3.16	-37.03	40.19
802.11b	20	11M	6	3.23	-37.89	41.12
802.11g	20	6M	6	3.29	-38.07	41.36
802.11g	20	54M	6	3.17	-38.03	41.20
802.11n-HT20	20	MCS0	6	3.27	-39.19	42.46
802.11n-HT20	20	MCS7	6	3.25	-37.78	41.03
802.11a	20	6M	40	3.26	-36.52	39.78
802.11a	20	54M	40	3.12	-38.18	41.30
802.11an-HT20	20	MCS0	40	3.23	-37.45	40.68
802.11an-HT20	20	MCS7	40	3.24	-38.54	41.78
802.11an-HT40	40	MCS0	38	3.21	-37.97	41.18
802.11an-HT40	40	MCS7	38	3.30	-38.49	41.79

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
22	2.4GHz WLAN	802.11b 1Mbps	6	Axial (Z)	1.93	-39.35	41.28	T4	Pass
22	2.4GHZ WLAIN	602.11b HVIDPS	0	Transversal (Y)	-8.13	-44.41	36.28	T4	F455
23	5.2GHz WLAN	000 11 a 6Mbna	40	Axial (Z)	1.94	-38.84	40.78	T4	Pass
23	5.2GHZ WLAIN	802.11a 6Mbps	40	Transversal (Y)	-7.36	-43.40	36.04	T4	Pass
24	5.3GHz WLAN	000 11 a 6Mbna	60	Axial (Z)	2.02	-38.67	40.69	T4	Door
24	5.3GHZ WLAIN	802.11a 6Mbps	60	Transversal (Y)	-7.72	-44.10	36.38	T4	Pass
25	5.5GHz WLAN	000 11 a 6Mbna	124	Axial (Z)	1.83	-39.53	41.36	T4	Pass
23	5.5GHZ WLAIN	802.11a 6Mbps	124	Transversal (Y)	-8.41	-44.58	36.17	T4	F455
26	E 0 C ∐ → \\/ \	902 11a 6Mbpa	157	Axial (Z)	1.58	-40.09	41.67	T4	Pass
26	5.8GHz WLAN	BGHz WLAN 802.11a 6Mbps 1	157	Transversal (Y)	-7.96	-44.24	36.28	T4	rass

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 19 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01

10. T-Coil testing for OTT VolP Calling

General Notes:

- 1. The google Duo VoIP call software is pre-installed on this device and head-to-ear scenario should be consideration, the google Duo only support OPUS audio codec and support 6Kbpa to 75Kbps bitrate. According to KDB 285076 D02, all air interfaces via a data connection with google Duo VoIP calling would be consideration to be tested.
- 2. The test setup used for OTT VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0
- 3. According to VoLTE and VoWiFi radio configuration investigation, the worst case radio configuration is used for OTT over LTE and OTT over WiFi testing.
- 4. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VOLTE and VoWiFi summary test results, the worst case air interface is used for OTT T-Coil testing.
- 5. For OTT VoIP codec investigation test reduction, due to all air interface have the same codec configuration, therefore, the codec investigation was choose UMTS B2 to determine the audio codec configuration to be used for others air interfaces testing.

<Codec Investigation>

Codec	Bitrate 6Kbps	Bitrate 40Kbps	Bitrate 75Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	11.99	12.90	12.86		
ABM 2 (dBA/m)	-33.24	-32.99 -32.64		Axial	UMTS B2 / 9400
Freq. Response	Pass	Pass	Pass	Axiai	OWITS 62 / 9400
Signal Quality (dB)	45.23	45.89	45.50		

<Summary Tests Results>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
27	GSM850	EDGE 2 Tx slots	189	Axial (Z)	5.10	-34.63	39.73	T4	- Pass
21				Transversal (Y)	-5.33	-44.29	38.96	T4	
28	GSM1900	EDGE 2 Tx slots	661	Axial (Z)	-0.06	-35.47	35.41	T4	Pass
28				Transversal (Y)	-6.28	-41.20	34.92	T4	
29	WCDMA II	HSPA	9400	Axial (Z)	11.99	-33.24	45.23	T4	Pass
29				Transversal (Y)	3.17	-42.08	45.25	T4	
30	WCDMA IV	HSPA	1413	Axial (Z)	12.10	-32.52	44.62	T4	- Pass
30				Transversal (Y)	4.37	-39.83	44.20	T4	
31	WCDMA V	HSPA	4182	Axial (Z)	11.54	-33.00	44.54	T4	Pass
31				Transversal (Y)	2.55	-42.40	44.95	T4	
32	CDMA BC0	RTAP 153.6Kbps	384	Axial (Z)	11.17	-40.65	51.82	T4	- Pass
32				Transversal (Y)	2.86	-44.90	47.76	T4	
33	CDMA BC1	RTAP 153.6Kbps	600	Axial (Z)	11.19	-40.78	51.97	T4	- Pass
33				Transversal (Y)	2.92	-45.00	47.92	T4	
34	CDMA BC10	RTAP 153.6Kbps	580	Axial (Z)	10.98	-41.07	52.05	T4	- Pass
34				Transversal (Y)	2.98	-44.88	47.86	T4	

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 Report Issued Date: Feb. 23, 2018 FAX: 886-3-328-4978 FCC ID: IHDT56XC1

Report Version : Rev. 01

: 20 of 23

Page Number



SPORTON LAB. FCC HAC T-Coil Test Report

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality (dB)	T Rating	Frequency Response
35	LTE Band 2	20M_QPSK_1RB_0offset	18900	Axial (Z)	5.72	-37.64	43.36	T4	Pass
				Transversal (Y)	-5.04	-44.34	39.30	T4	
36	LTE Band 38	20M_QPSK_1RB_0offset	38000	Axial (Z)	5.22	-33.13	38.35	T4	Pass
				Transversal (Y)	-6.76	-46.12	39.36	T4	
37	WLAN2.4GHz	802.11b 1Mbps	6	Axial (Z)	7.52	-38.93	46.45	T4	Pass Pass
				Transversal (Y)	-1.06	-43.85	42.79	T4	
38	WLAN5GHz	802.11a 6Mbps	40	Axial (Z)	5.16	-39.87	45.03	T4	
				Transversal (Y)	-3.74	-44.54	40.80	T4	

Remark:

1.

Phone Condition: Mute on; Backlight off; Max Volume The detail frequency response results please refer to appendix A. 2.

Test Engineer: Nick Yu and Steven Chang

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1

Page Number : 21 of 23 Report Issued Date: Feb. 23, 2018

Report No.: HA7D2018-03B

11. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA7D2018-03B

Error Description	Uncertainty Error Description Value (±%)		Probability Distribution Divisor		Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)			
Probe Sensitivity										
Reference Level	Reference Level 3.0		Normal 1		1	± 3.0 %	± 3.0 %			
AMCC Geometry	AMCC Geometry 0.4		√3	1	1	± 0.2 %	± 0.2 %			
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %			
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %			
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %			
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %			
Probe System										
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %			
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %			
Acoustic Noise	oise 1.0 F		√3	0.1	1	± 0.1 %	± 0.6 %			
Probe Angle	Angle 2.3 Recta		√3	1	1	± 1.4 %	± 1.4 %			
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %			
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %			
Field Disturbation	Field Disturbation 0.2 F		√3	1	1	± 0.1 %	± 0.1 %			
		Test Siç	gnal							
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %			
		Position	ning							
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %			
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %			
EUT Positioning	EUT Positioning 1.9		Rectangular √3		1	± 1.1 %	± 1.1 %			
External Contributions										
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %			
Test Signal Variation 2.0 R		Rectangular	√3	1	1	± 1.2 %	± 1.2 %			
	± 4.1 %	± 6.1 %								
Coverage Factor for 95 %							K = 2			
Expanded Uncertainty							± 12.3 %			

Table 8.2 Uncertainty Budget of audio band magnetic measurement

 SPORTON INTERNATIONAL INC.
 Page Number
 : 22 of 23

 TEL: 886-3-327-3456
 Report Issued Date
 : Feb. 23, 2018

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01



12. References

- [1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.
- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] SPEAG DASY System Handbook

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: IHDT56XC1 Page Number : 23 of 23
Report Issued Date : Feb. 23, 2018
Report Version : Rev. 01