

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 1(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Annex A: Probe sensitivity and reference signal measurement plots

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

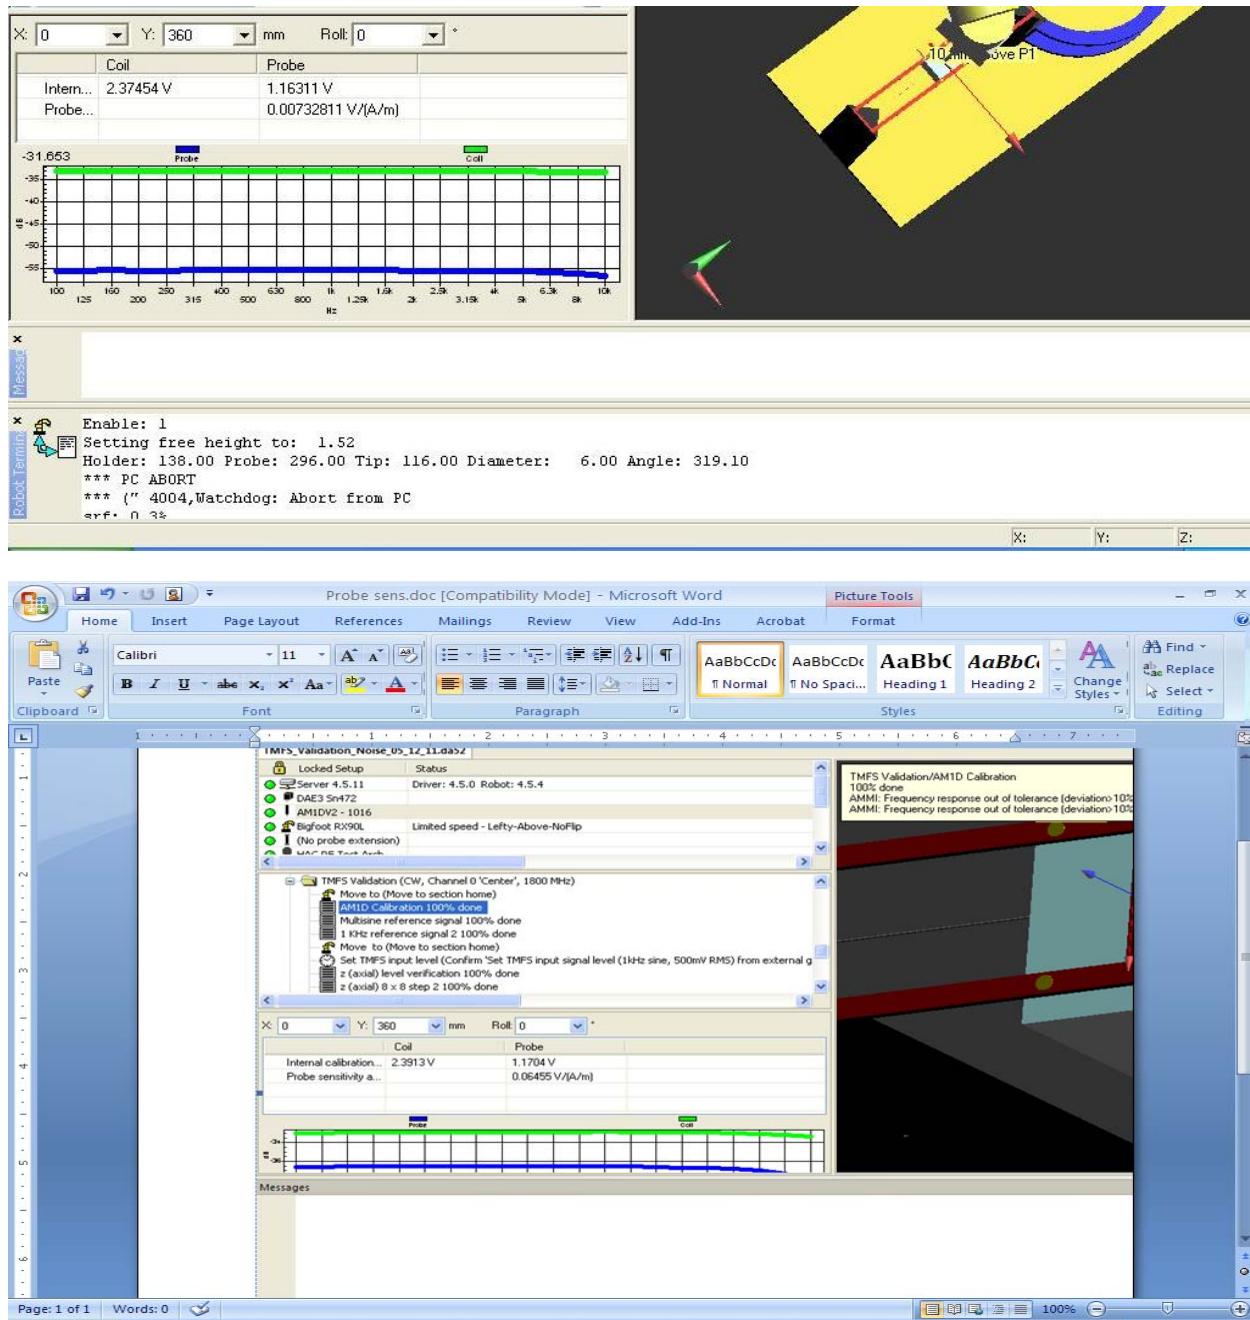
L6ARDs40CW

Figure A1: Probe calibration data for coil and probe

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

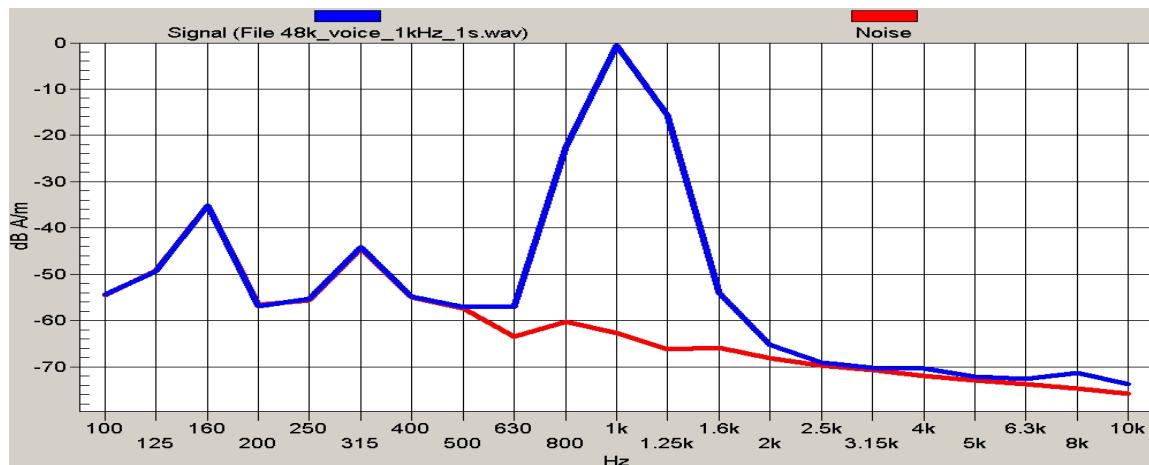
L6ARDS40CW

Figure A2: Reference voice 1 kHz signal and noise

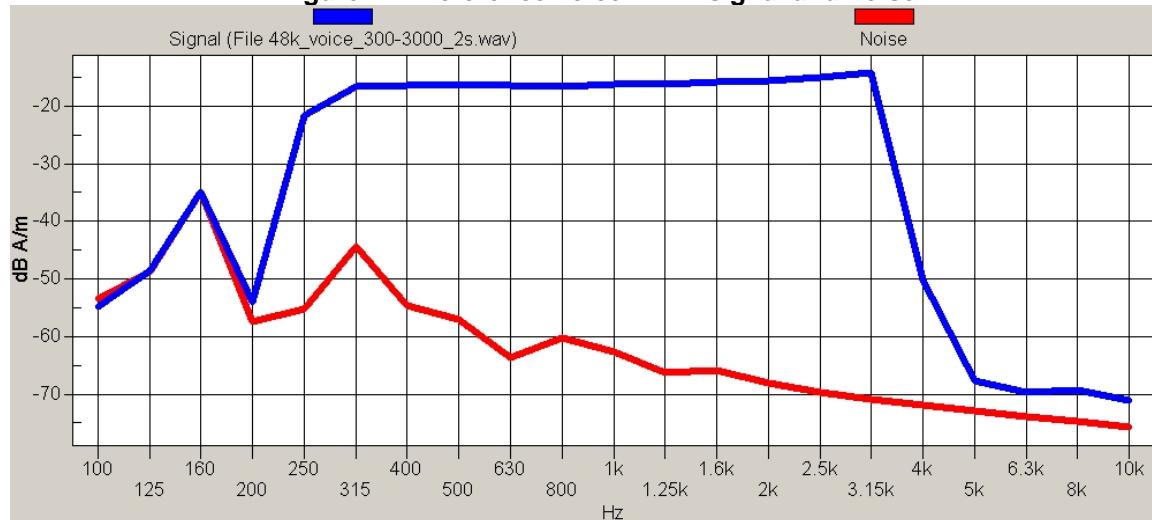


Figure A3: Reference voice simulated signal and noise

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 4(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Annex B: TMFS system validation and ambient data/plots

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 5(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/12/2011 3:20:11 PM

Test Laboratory: RIM Testing Services

TMFS_Validation_Noise_05_12_11

DUT: TMFS; Type: TMFS-1

Communication System: CW; Communication System Band: D1800 (1800.0 MHz); Frequency: 835 MHz, Frequency: 1800 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn472; Calibrated: 3/7/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/Background Noise/z (axial) noise/ABM [HAC-2007] Noise(x,y,z) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM2 = -59.10 dB A/m

Location: 0, 0, 13 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 6(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/Background Noise/x (longitudinal) noise/ABM [HAC-2007] Noise(x,y,z) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM2 = -59.05 dB A/m

Location: 0, 0, 13 mm

T-Coil scan/Background Noise/y (transversal) noise/ABM [HAC-2007] Noise(x,y,z) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM2 = -59.15 dB A/m

Location: 0, 0, 13 mm

T-Coil scan/TMFS Validation/z (axial) 8 x 8 step 2/ABM [HAC-2007] Signal(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: -0.0022 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 7(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Cursor:

ABM1 comp = -20.50 dB A/m

BWC Factor = -0.0022 dB

Location: 0, 0, 3.7 mm

T-Coil scan/TMFS Validation/x (longitudinal) 52 x 16 step 4/ABM [HAC-2007] Signal(x,y,z) (14x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: -0.0022 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -25.54 dB A/m

BWC Factor = -0.0022 dB

Location: -18, 0, 3.7 mm

T-Coil scan/TMFS Validation/y (transversal) 16 x 52 step 4/ABM [HAC-2007] Signal(x,y,z) (5x14x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: -0.0022 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -26.66 dB A/m

BWC Factor = -0.0022 dB

Location: 0, -18, 3.7 mm

T-Coil scan/TMFS Validation/z (axial) at center 100% gain/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_multisine_50_10k_10s.wav

Output Gain: 87.2

Measure Window Start: 2000ms

Measure Window Length: 5000ms

BWC applied: 13.14 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 1.97 dB

BWC Factor = 13.14 dB

Location: 0, 0, 3.7 mm

Author Data

Andrew Becker

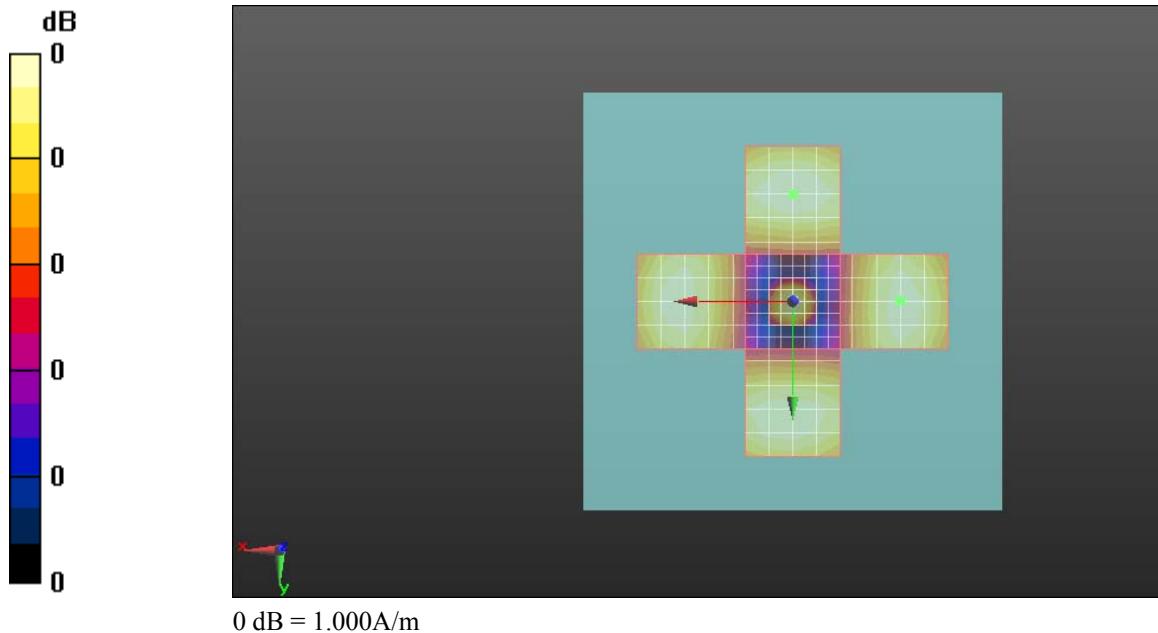
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

Background Noise/z (axial) noise/ABM [HAC-2007] Noise Spectrum(x,y,z,f)
Loc: 0, 0, 13 mm ABM: 0A/m





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**Page
9(59)

Author Data

Andrew Becker

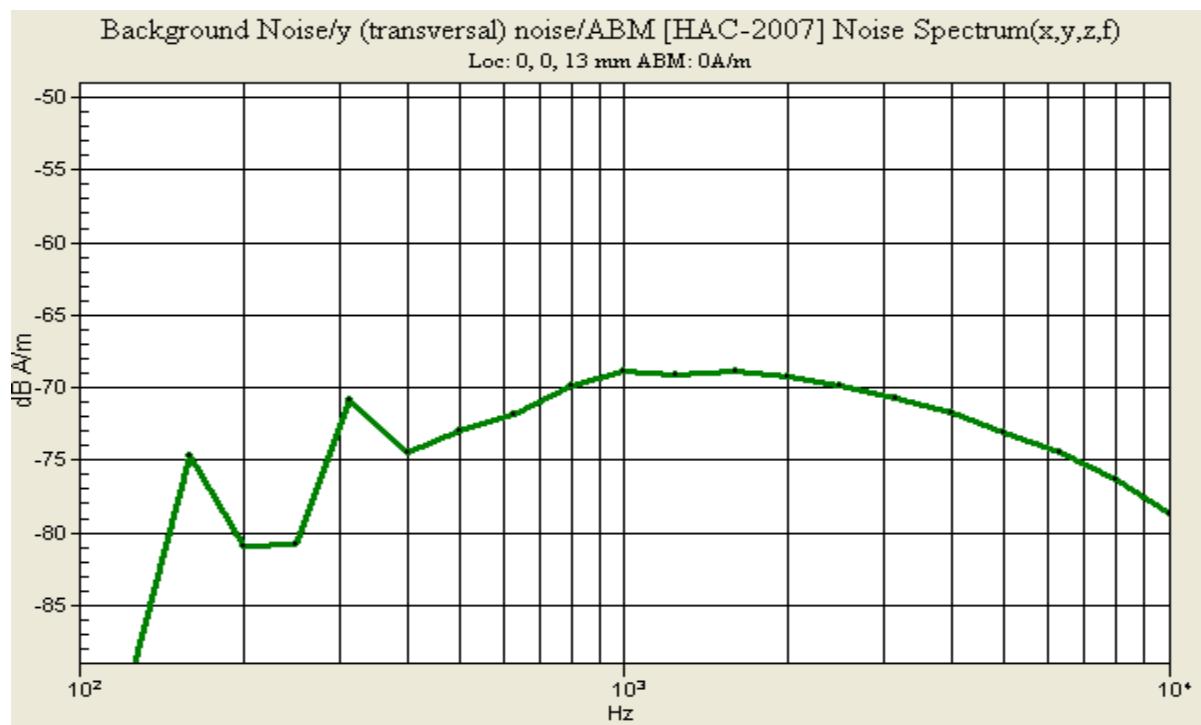
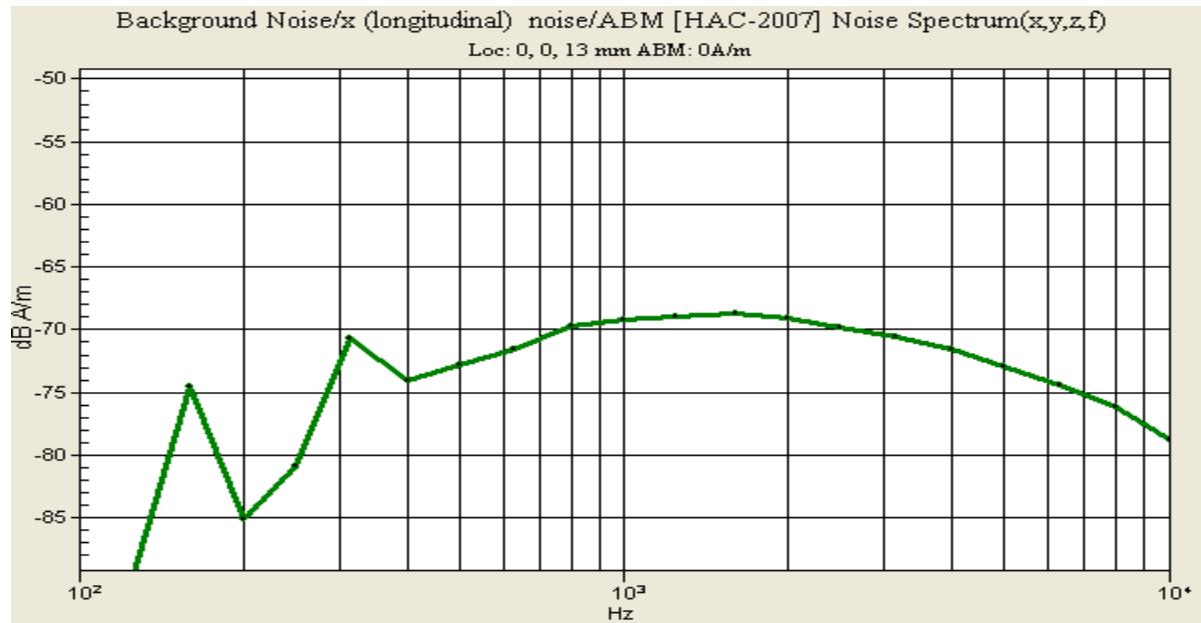
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

10(59)

Author Data

Andrew Becker

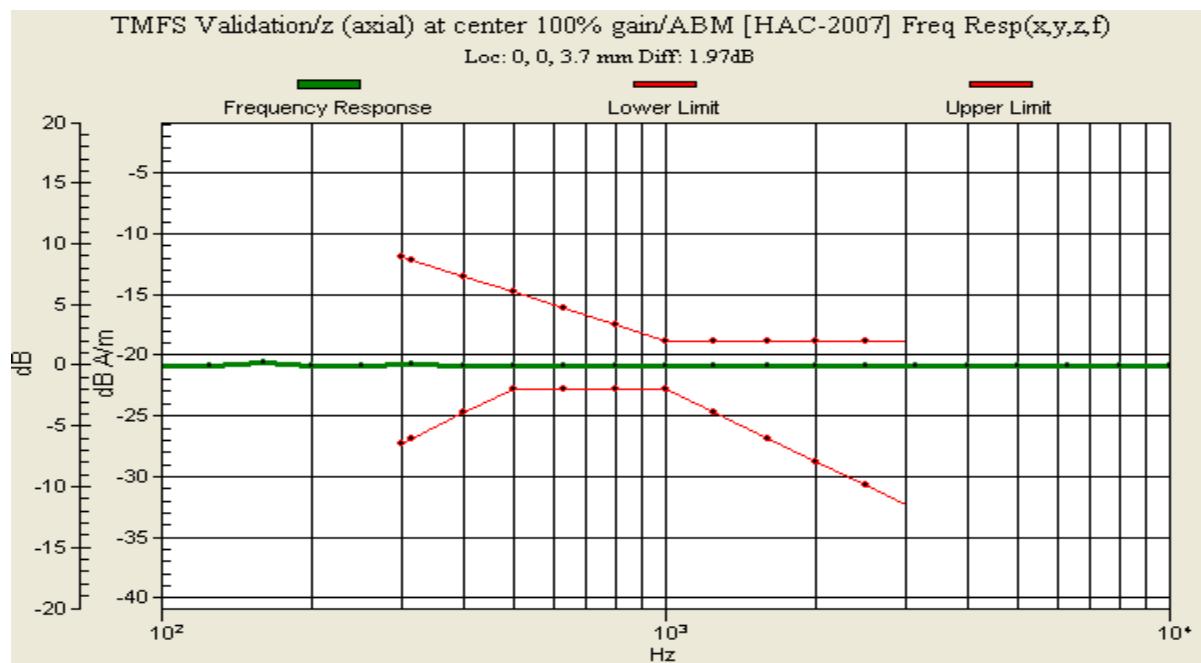
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 11(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Annex C: Audio Band Magnetic measurement data and plots

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 12(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/18/2011 9:11:27 PM, Date/Time: 5/18/2011 9:25:06 PM, Date/Time: 5/18/2011 10:02:47 PM, Date/Time: 5/18/2011 10:08:39 PM, Date/Time: 5/18/2011 10:18:50 PM, Date/Time: 5/18/2011 10:22:23 PM, Date/Time: 5/18/2011 10:32:36 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA800_Alt_Batt_Axial

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 800; Communication System Band: CDMA 2000 BC 10 ; Frequency: 817.9 MHz, Frequency: 820.5 MHz, Frequency: 823.1 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 13(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]

SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.15 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 41.81 dB
 ABM1 comp = 4.47 dB A/m
 BWC Factor = 0.15 dB
 Location: -3, 10, 4.4 mm

T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 54.9
 Measure Window Start: 2000ms
 Measure Window Length: 4000ms
 BWC applied: 10.79 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.95 dB
 BWC Factor = 10.79 dB
 Location: -5, 10, 3.7 mm

T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]

SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.15 dB
 Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 14(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Cursor:

ABM1/ABM2 = 41.72 dB
 ABM1 comp = 4.75 dB A/m
 BWC Factor = 0.15 dB
 Location: -1, 14, 4.4 mm

T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 54.9
 Measure Window Start: 2000ms
 Measure Window Length: 4000ms
 BWC applied: 10.79 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.72 dB
 BWC Factor = 10.79 dB
 Location: -5, 10, 3.7 mm

T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.15 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 42.58 dB
 ABM1 comp = 5.18 dB A/m
 BWC Factor = 0.15 dB
 Location: -3, 12, 4.4 mm

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW
T-Coil scan/General Scans 2 2 2/z (axial) wideband at best S/N
2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 54.9

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.79 dB

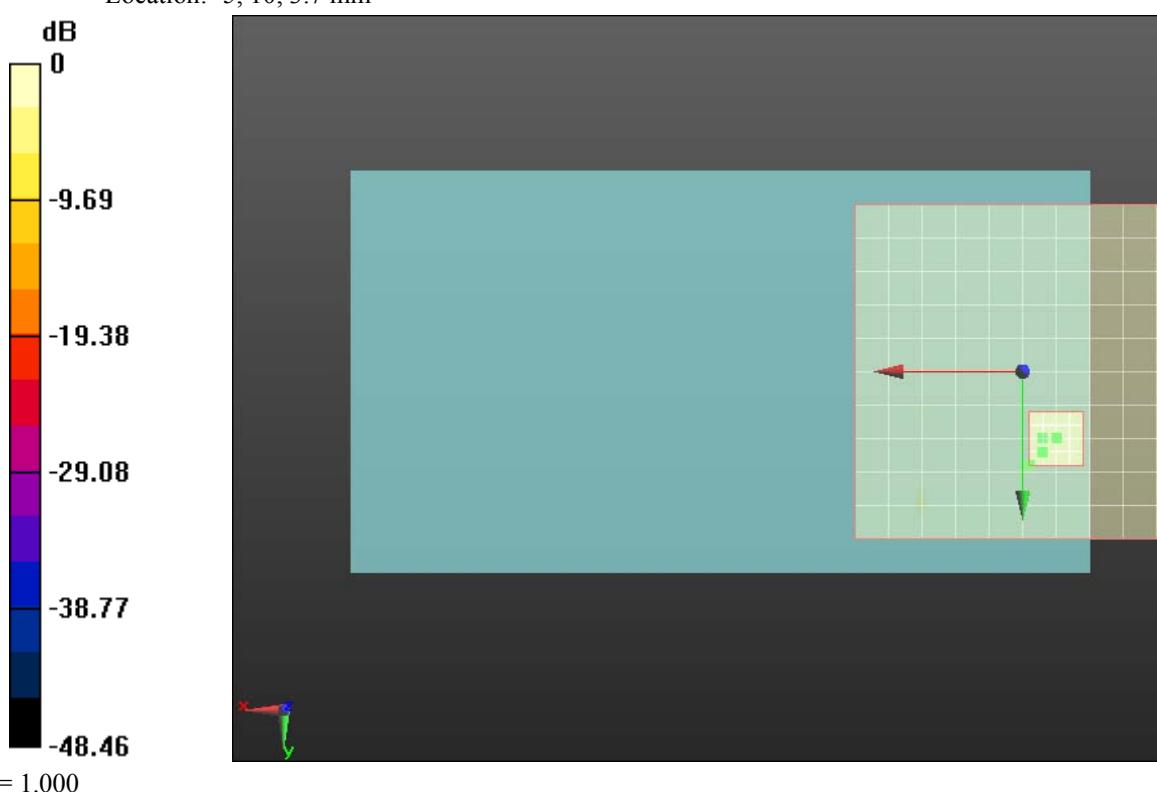
Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.74 dB

BWC Factor = 10.79 dB

Location: -5, 10, 3.7 mm





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

16(59)

Author Data

Andrew Becker

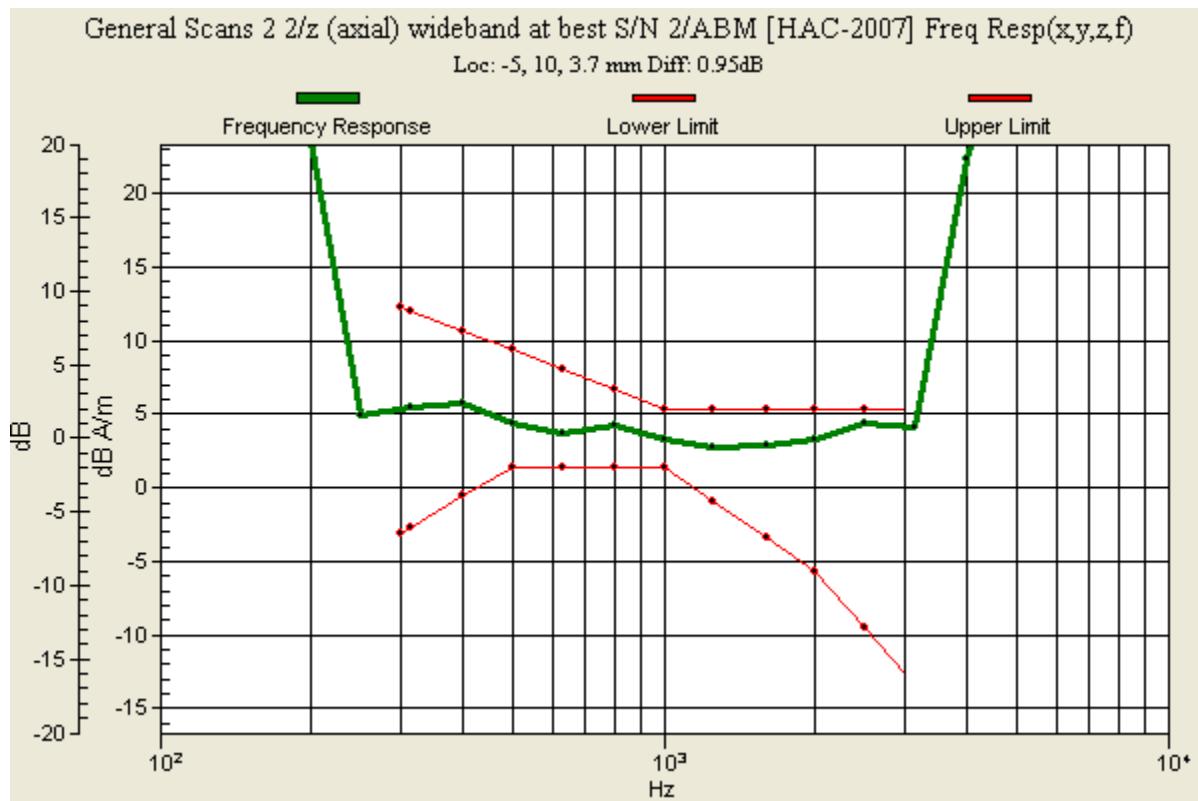
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

Author Data

Andrew Becker

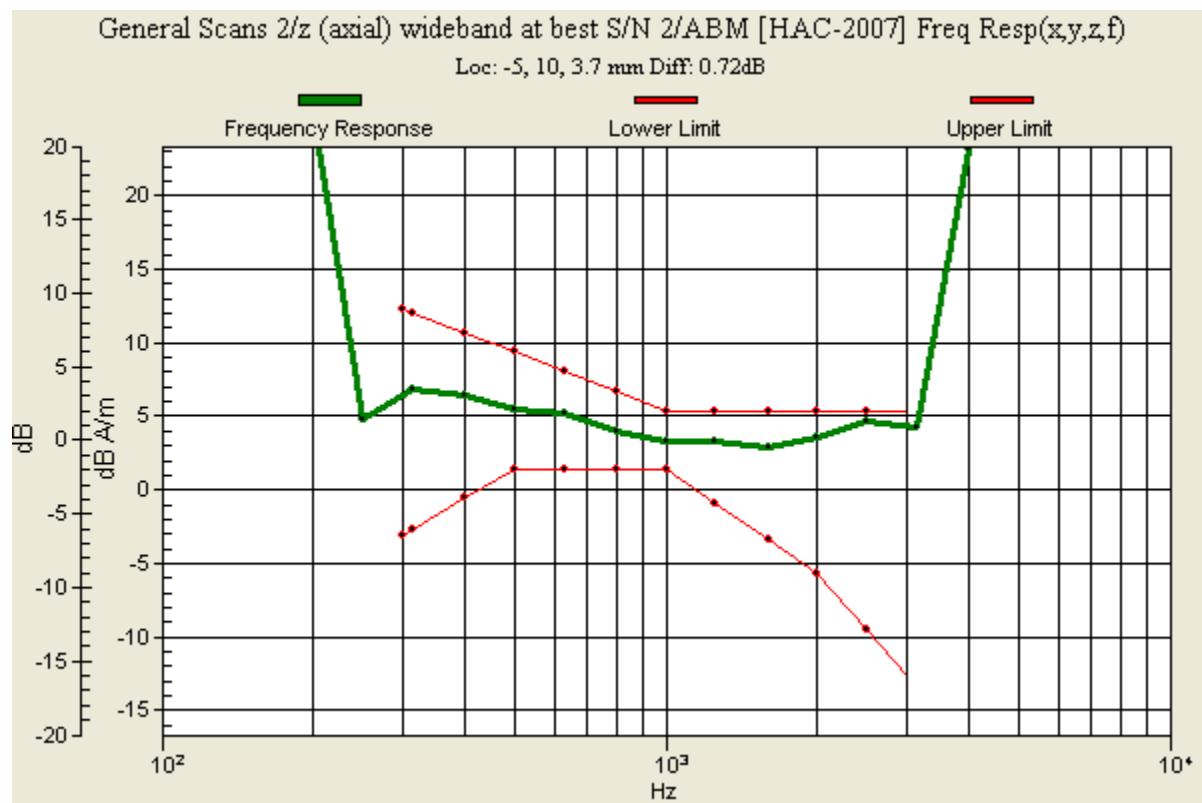
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

18(59)

Author Data

Andrew Becker

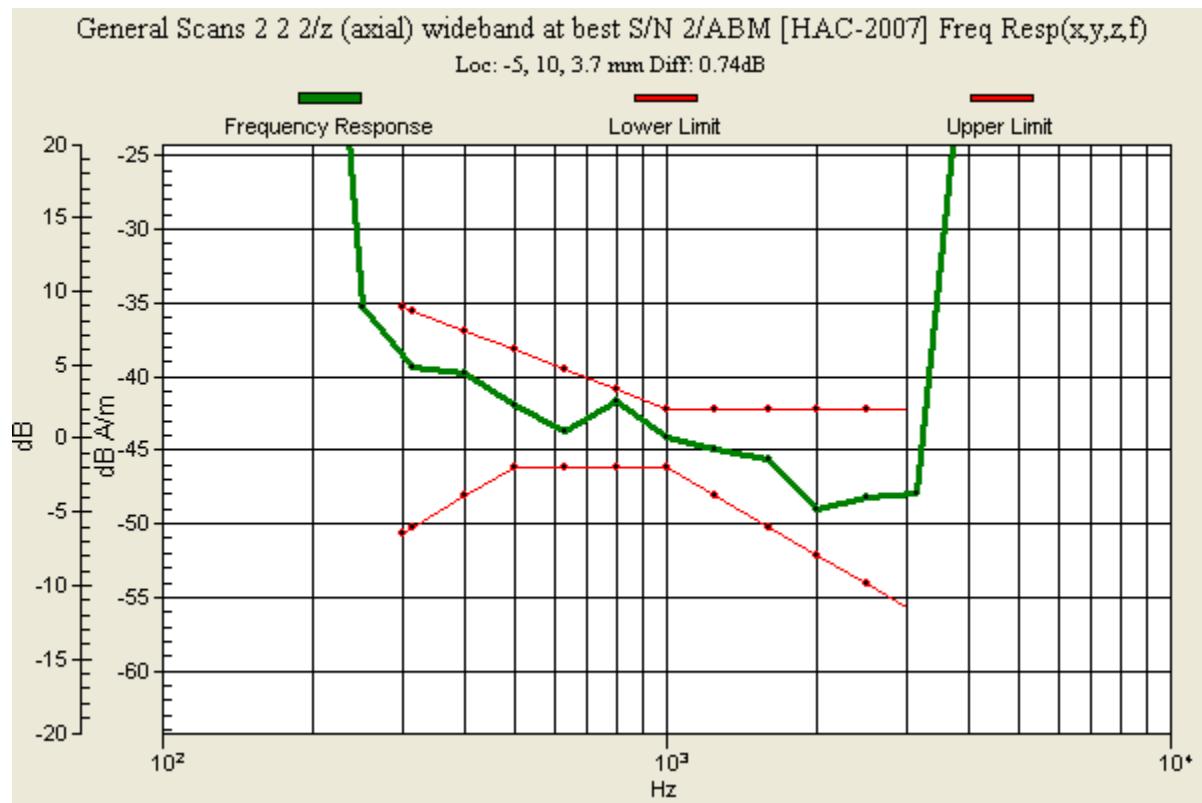
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 19(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Date/Time: 5/18/2011 9:28:14 PM, Date/Time: 5/18/2011 9:42:19 PM, Date/Time: 5/18/2011 10:11:51 PM, Date/Time: 5/18/2011 10:25:34 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA800_Alt_Batt_Radial_L

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 800; Communication System Band: CDMA 2000 BC 10 ; Frequency: 817.9 MHz, Frequency: 820.5 MHz, Frequency: 823.1 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 20(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.51 dB
ABM1 comp = -4.45 dB A/m
BWC Factor = 0.15 dB
Location: 8, 15, 4.4 mm

**T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.12 dB
ABM1 comp = -4.40 dB A/m
BWC Factor = 0.15 dB
Location: 8, 15, 4.4 mm

**T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.14 dB
ABM1 comp = -3.36 dB A/m
BWC Factor = 0.15 dB
Location: 8, 15, 4.4 mm

Author Data

Andrew Becker

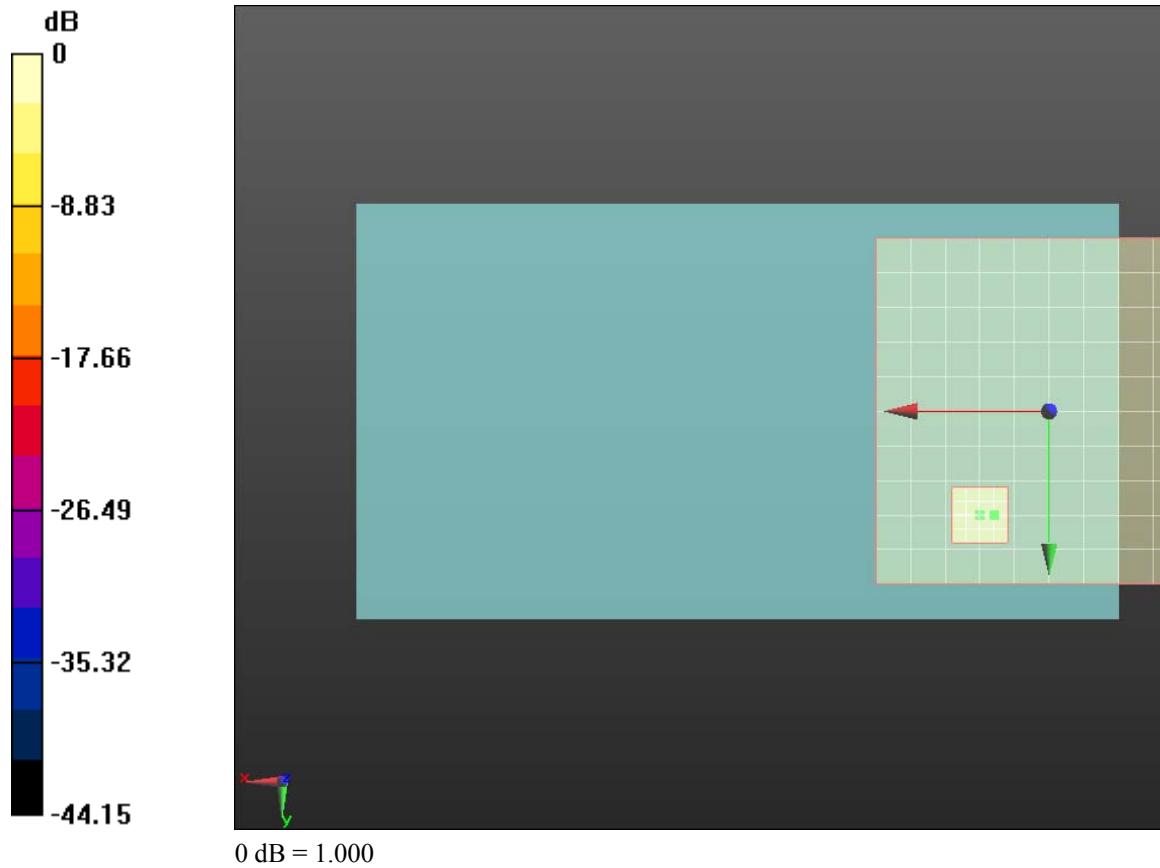
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 22(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/18/2011 9:45:47 PM, Date/Time: 5/18/2011 9:59:19 PM, Date/Time: 5/18/2011 10:15:22 PM, Date/Time: 5/19/2011 12:23:34 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA800_Alt_Batt_Radial_T

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 800; Communication System Band: CDMA 2000 BC 10 ; Frequency: 817.9 MHz, Frequency: 820.5 MHz, Frequency: 823.1 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 23(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM

[HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.37 dB

ABM1 comp = -6.79 dB A/m

BWC Factor = 0.15 dB

Location: 1, 0, 4.4 mm

T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 47.15 dB

ABM1 comp = -9.74 dB A/m

BWC Factor = 0.15 dB

Location: 5, 2, 4.4 mm

T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM

[HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.46 dB

ABM1 comp = -7.89 dB A/m

BWC Factor = 0.15 dB

Location: 1, 2, 4.4 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

24(59)

Author Data

Andrew Becker

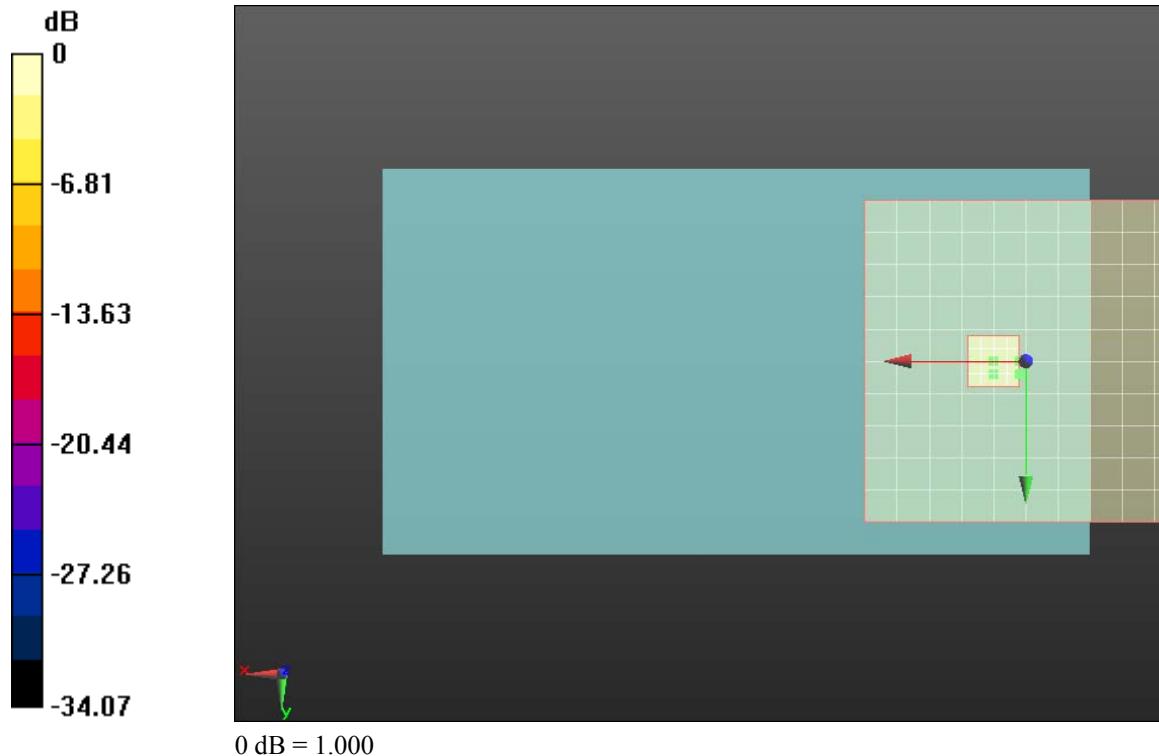
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 25(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/18/2011 10:46:35 PM, Date/Time: 5/18/2011 11:00:20 PM, Date/Time: 5/18/2011 11:38:04 PM, Date/Time: 5/18/2011 11:42:17 PM, Date/Time: 5/18/2011 11:52:23 PM, Date/Time: 5/18/2011 11:54:49 PM, Date/Time: 5/19/2011 12:04:53 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA850_Alt_Batt_Axial

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 850; Communication System Band: CDMA 2000 Cellular; Frequency: 824.7 MHz, Frequency: 836.52 MHz, Frequency: 848.52 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 26(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]

SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 43.47 dB

ABM1 comp = 5.33 dB A/m

BWC Factor = 0.15 dB

Location: -2, 14, 4.4 mm

T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 54.9

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.60 dB

BWC Factor = 10.80 dB

Location: 0, 10, 3.7 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 27(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]

SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 43.73 dB

ABM1 comp = 4.92 dB A/m

BWC Factor = 0.15 dB

Location: -2, 14, 4.4 mm

T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 54.9

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.79 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 1.91 dB

BWC Factor = 10.79 dB

Location: 0, 10, 3.7 mm

T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW**Cursor:**

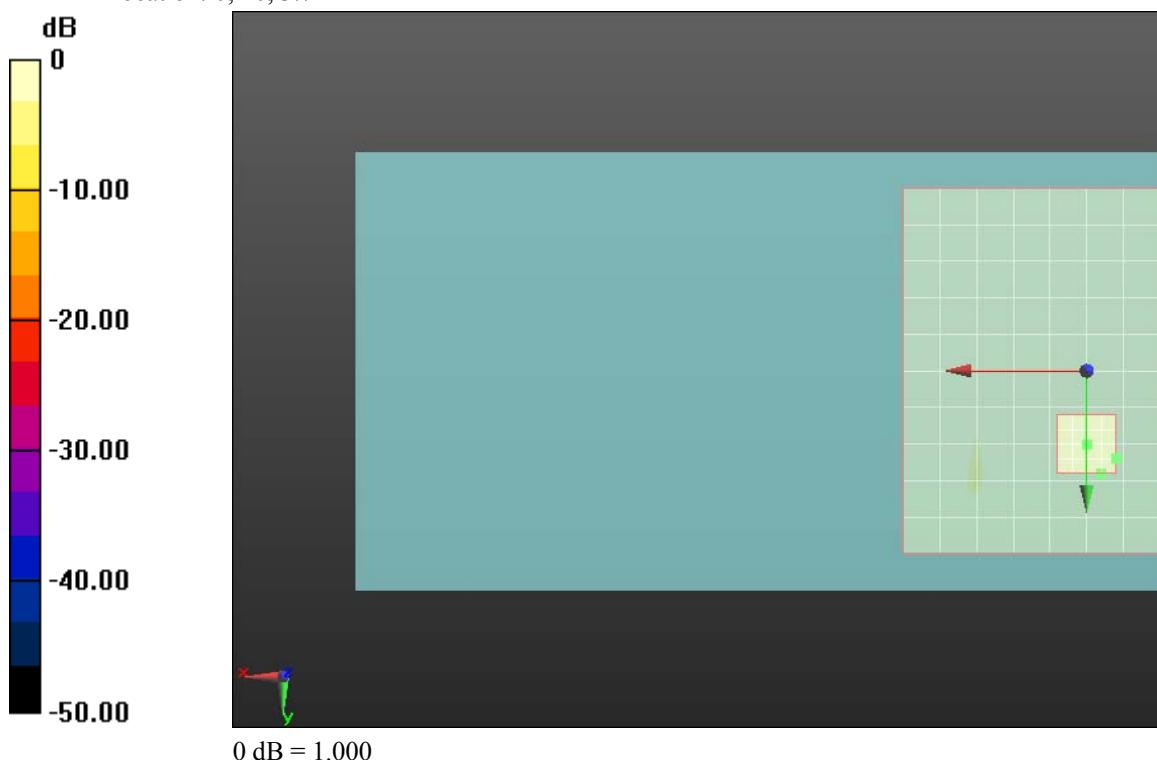
ABM1/ABM2 = 43.16 dB
 ABM1 comp = 4.54 dB A/m
 BWC Factor = 0.15 dB
 Location: -4, 12, 4.4 mm

**T-Coil scan/General Scans 2 2 2/z (axial) wideband at best S/N
2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):**

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 54.9
 Measure Window Start: 2000ms
 Measure Window Length: 4000ms
 BWC applied: 10.79 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.98 dB
 BWC Factor = 10.79 dB
 Location: 0, 10, 3.7 mm



Author Data

Andrew Becker

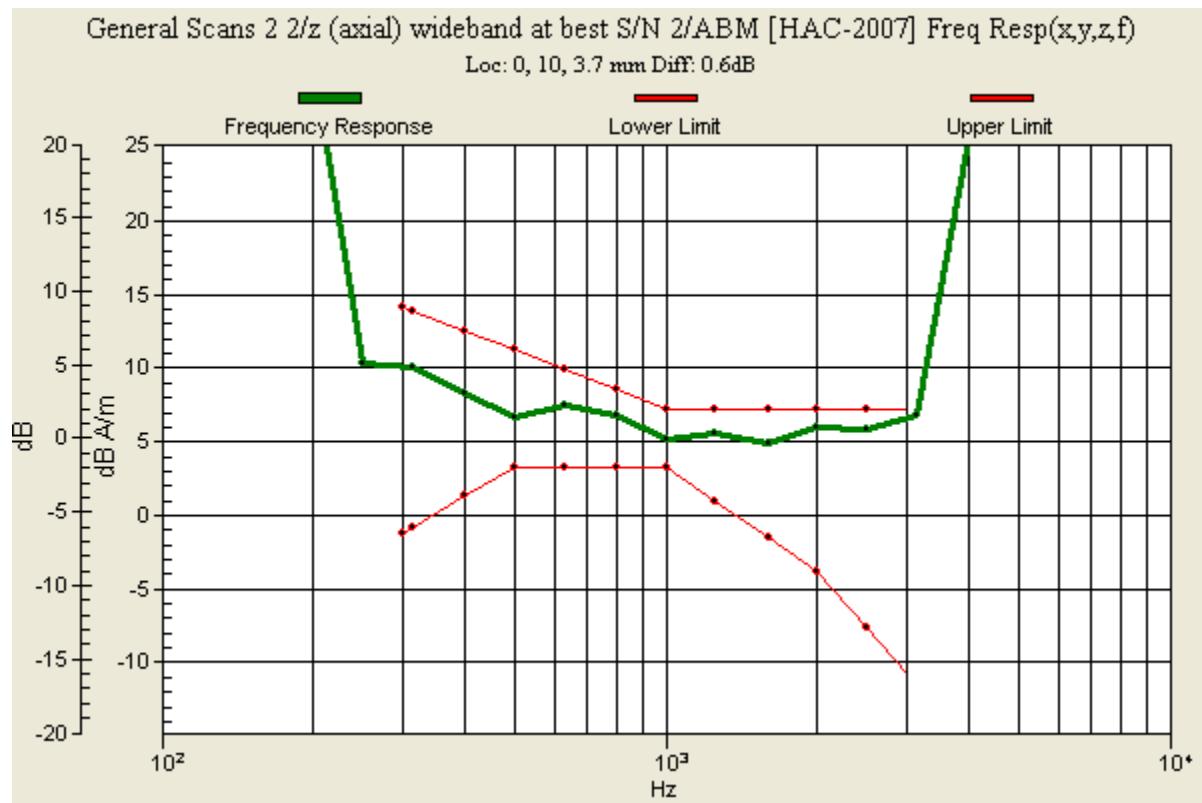
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

30(59)

Author Data

Andrew Becker

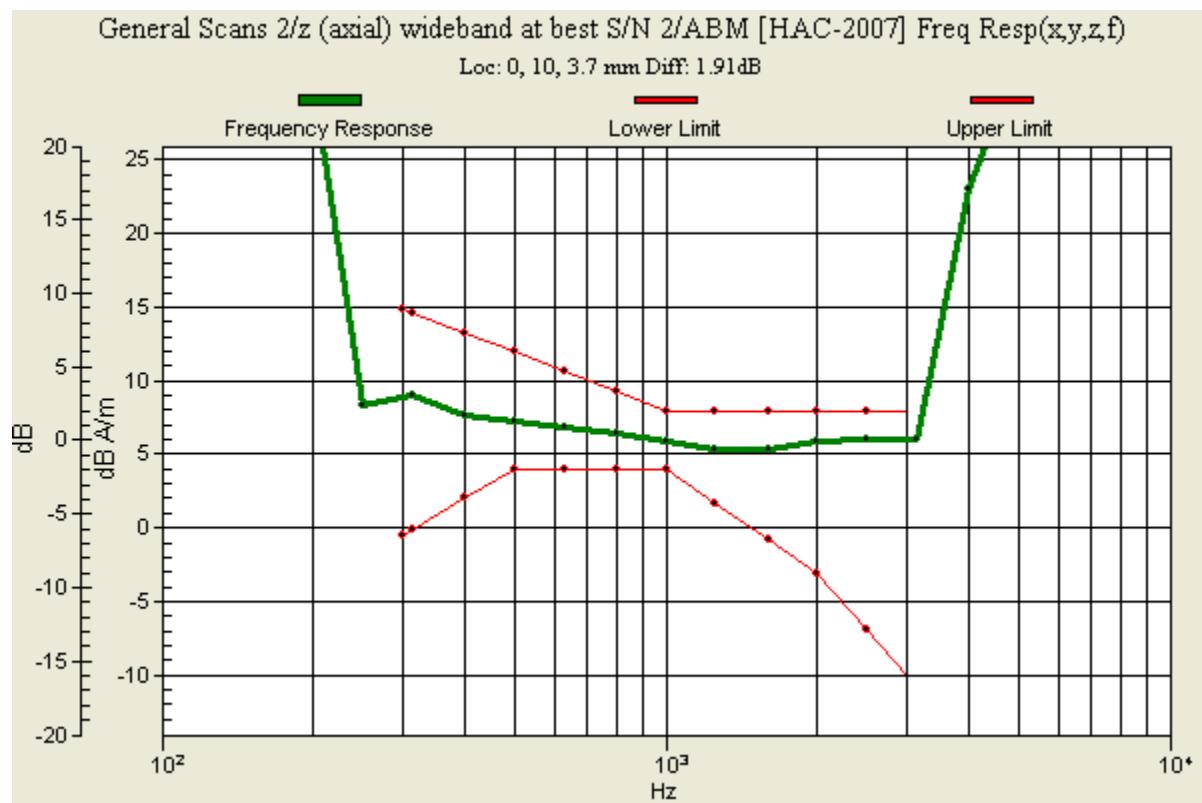
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

31(59)

Author Data

Andrew Becker

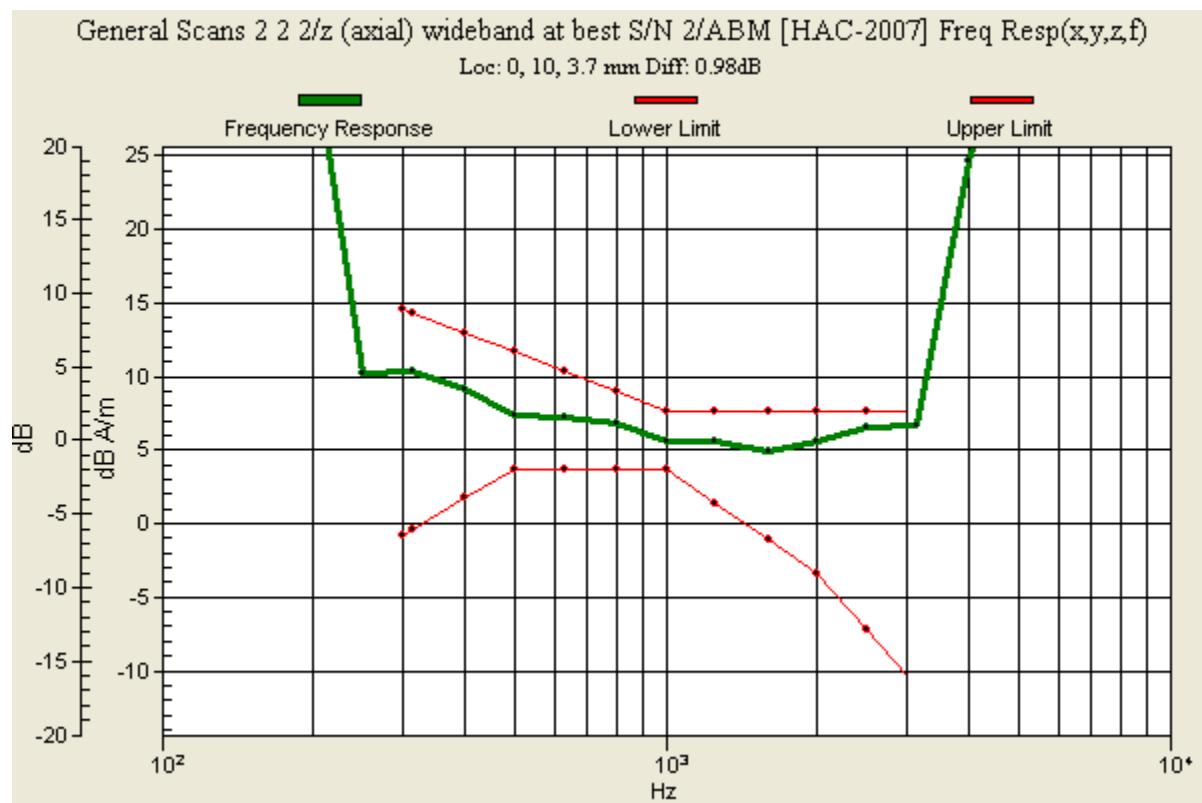
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 32(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Date/Time: 5/18/2011 11:03:29 PM, Date/Time: 5/18/2011 11:17:39 PM, Date/Time: 5/18/2011 11:45:28 PM, Date/Time: 5/18/2011 11:57:58 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA850_Alt_Batt_Radial_L

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 850; Communication System Band: CDMA 2000 Cellular; Frequency: 824.7 MHz, Frequency: 836.52 MHz, Frequency: 848.52 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 33(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.75 dB
ABM1 comp = -3.65 dB A/m
BWC Factor = 0.15 dB
Location: 8, 15, 4.4 mm

**T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.21 dB
ABM1 comp = -3.50 dB A/m
BWC Factor = 0.15 dB
Location: 8, 13, 4.4 mm

**T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.97 dB
ABM1 comp = -4.06 dB A/m
BWC Factor = 0.15 dB
Location: 8, 15, 4.4 mm

Author Data

Andrew Becker

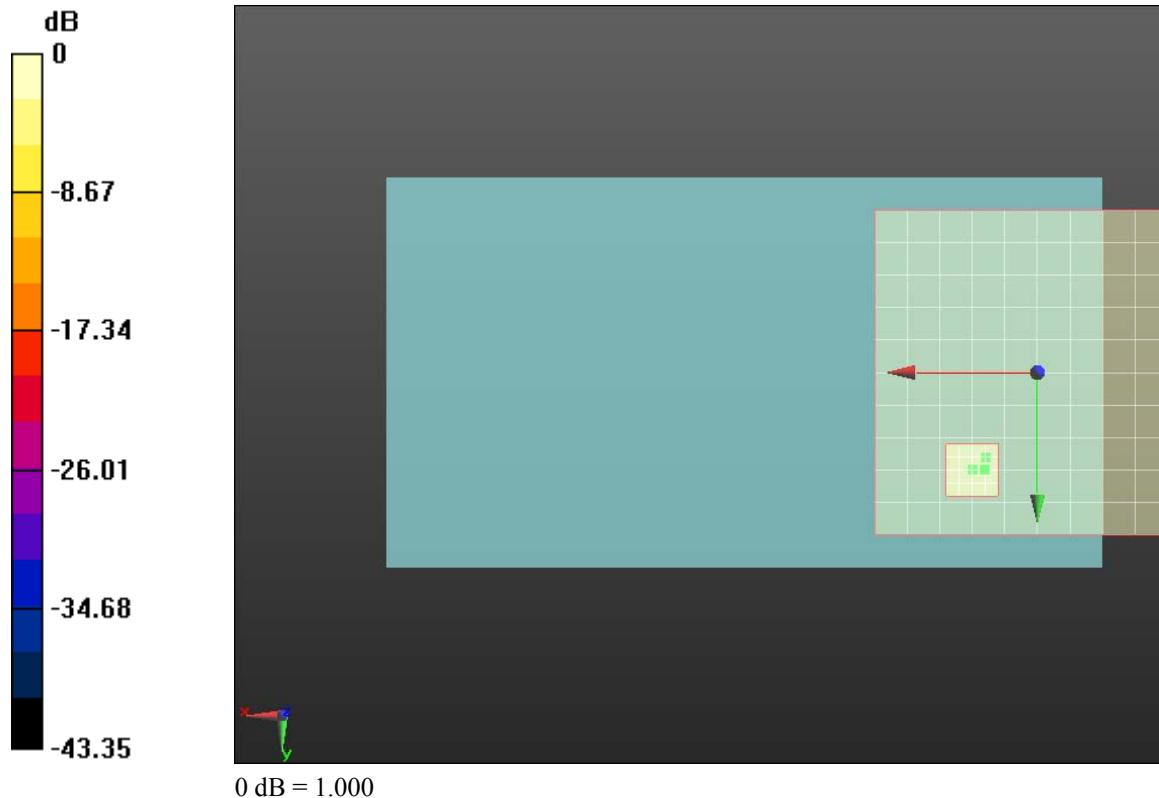
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 35(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/18/2011 11:21:07 PM, Date/Time: 5/18/2011 11:34:38 PM, Date/Time: 5/18/2011 11:48:57 PM, Date/Time: 5/19/2011 12:01:27 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA850_Alt_Batt_Radial_T

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 850; Communication System Band: CDMA 2000 Cellular; Frequency: 824.7 MHz Frequency: 836.52 MHz, Frequency: 848.52 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 36(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM

[HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.12 dB

ABM1 comp = -7.66 dB A/m

BWC Factor = 0.15 dB

Location: 0, 2, 4.4 mm

T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.27 dB

ABM1 comp = -6.95 dB A/m

BWC Factor = 0.15 dB

Location: 0, 0, 4.4 mm

T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM

[HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.69 dB

ABM1 comp = -6.62 dB A/m

BWC Factor = 0.15 dB

Location: 0, 0, 4.4 mm

Author Data

Andrew Becker

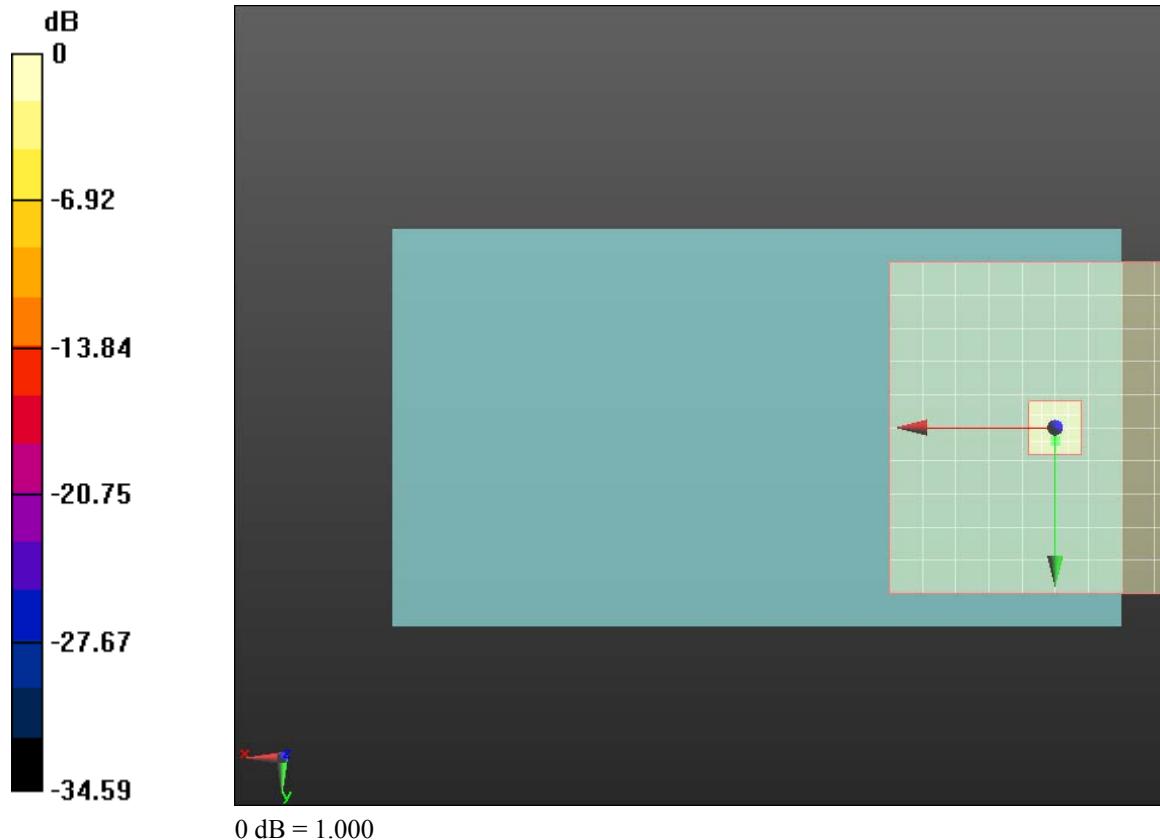
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 38(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/19/2011 12:39:56 AM, Date/Time: 5/19/2011 12:53:27 AM, Date/Time: 5/19/2011 1:32:19 AM, Date/Time: 5/19/2011 1:41:07 AM, Date/Time: 5/19/2011 1:51:34 AM, Date/Time: 5/19/2011 1:54:27 AM, Date/Time: 5/19/2011 2:04:23 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA1900_Alt_Batt_Axial

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 1900; Communication System Band: CDMA 2000 PCS; Frequency: 1851.25 MHz, Frequency: 1880 MHz, Frequency: 1908.5 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/z (axial) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 39(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/General Scans 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]

SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 43.26 dB

ABM1 comp = 4.43 dB A/m

BWC Factor = 0.15 dB

Location: -3, 13, 4.4 mm

T-Coil scan/General Scans 2 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 54.9

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.79 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.32 dB

BWC Factor = 10.79 dB

Location: -5, 15, 3.7 mm

T-Coil scan/General Scans 2/z (axial) 2mm 8 x 8/ABM [HAC-2007]

SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 40(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Cursor:

ABM1/ABM2 = 42.57 dB
 ABM1 comp = 4.25 dB A/m
 BWC Factor = 0.15 dB
 Location: -3, 13, 4.4 mm

T-Coil scan/General Scans 2/z (axial) wideband at best S/N 2/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 54.9
 Measure Window Start: 2000ms
 Measure Window Length: 4000ms
 BWC applied: 10.79 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.94 dB
 BWC Factor = 10.79 dB
 Location: -5, 15, 3.7 mm

T-Coil scan/General Scans 2 2 2/z (axial) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.15 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 44.28 dB
 ABM1 comp = 6.13 dB A/m
 BWC Factor = 0.15 dB
 Location: -3, 11, 4.4 mm

T-Coil scan/General Scans 2 2 2/z (axial) wideband at best S/N/ABM [HAC-2007] Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 54.9
 Measure Window Start: 300ms
 Measure Window Length: 2000ms
 BWC applied: 10.79 dB
 Device Reference Point: 0, 0, -6.3 mm

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

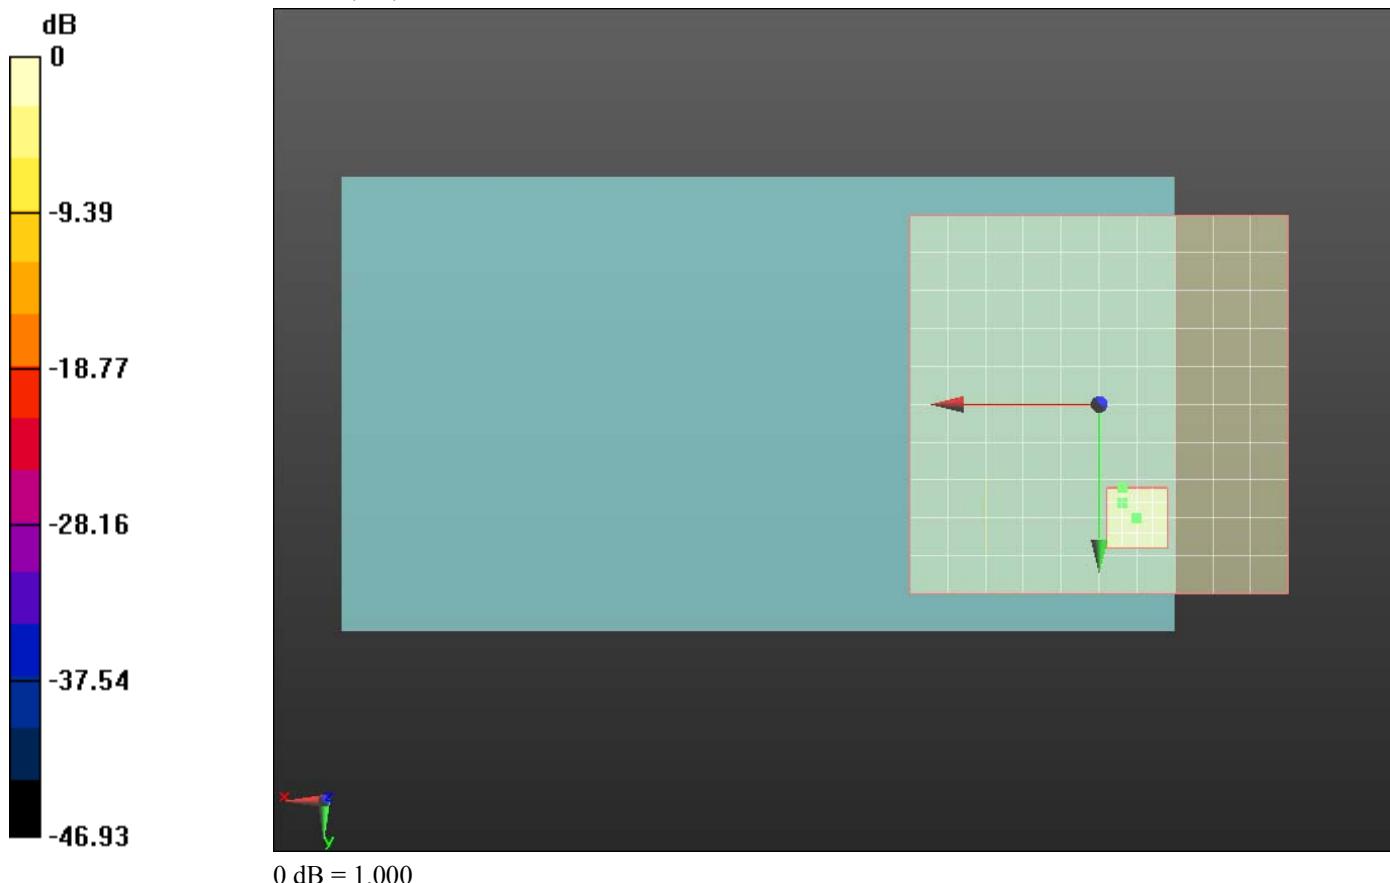
FCC ID

L6ARDS40CW**Cursor:**

Diff = 0.77 dB

BWC Factor = 10.79 dB

Location: -5, 15, 3.7 mm





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

42(59)

Author Data

Andrew Becker

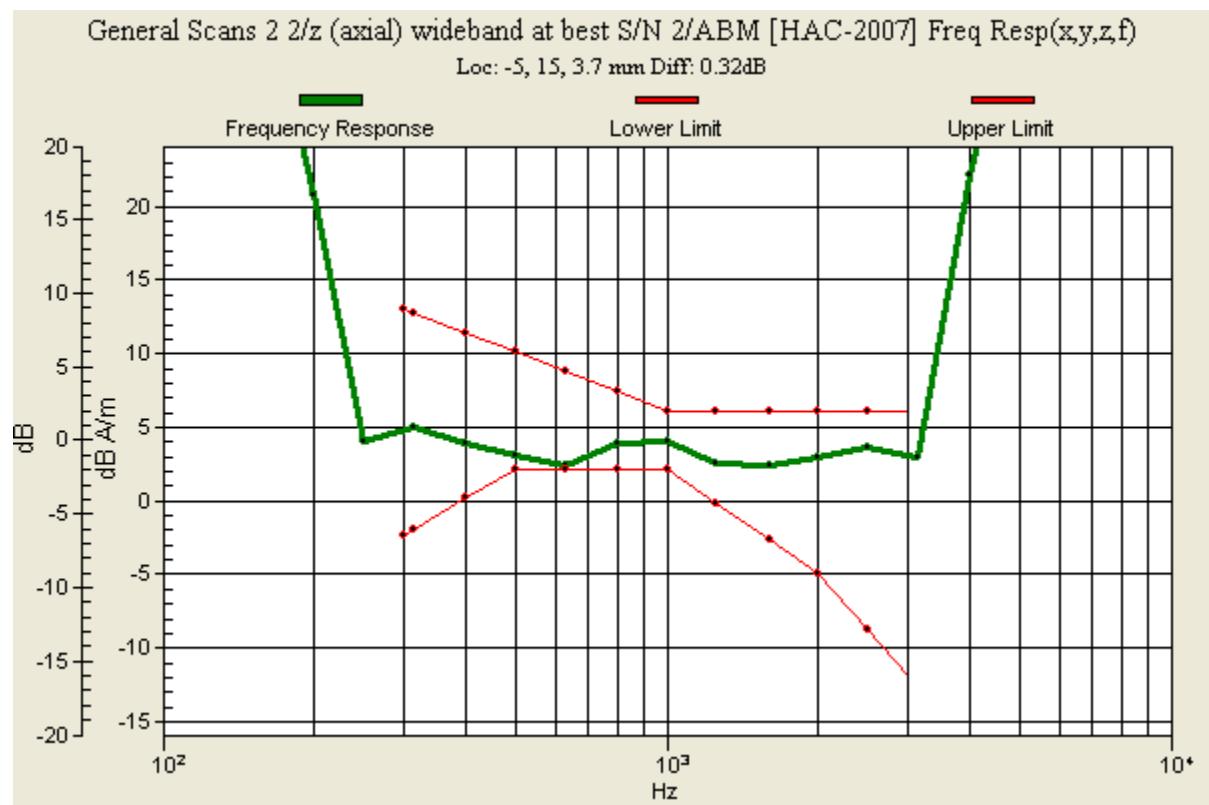
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

Author Data

Andrew Becker

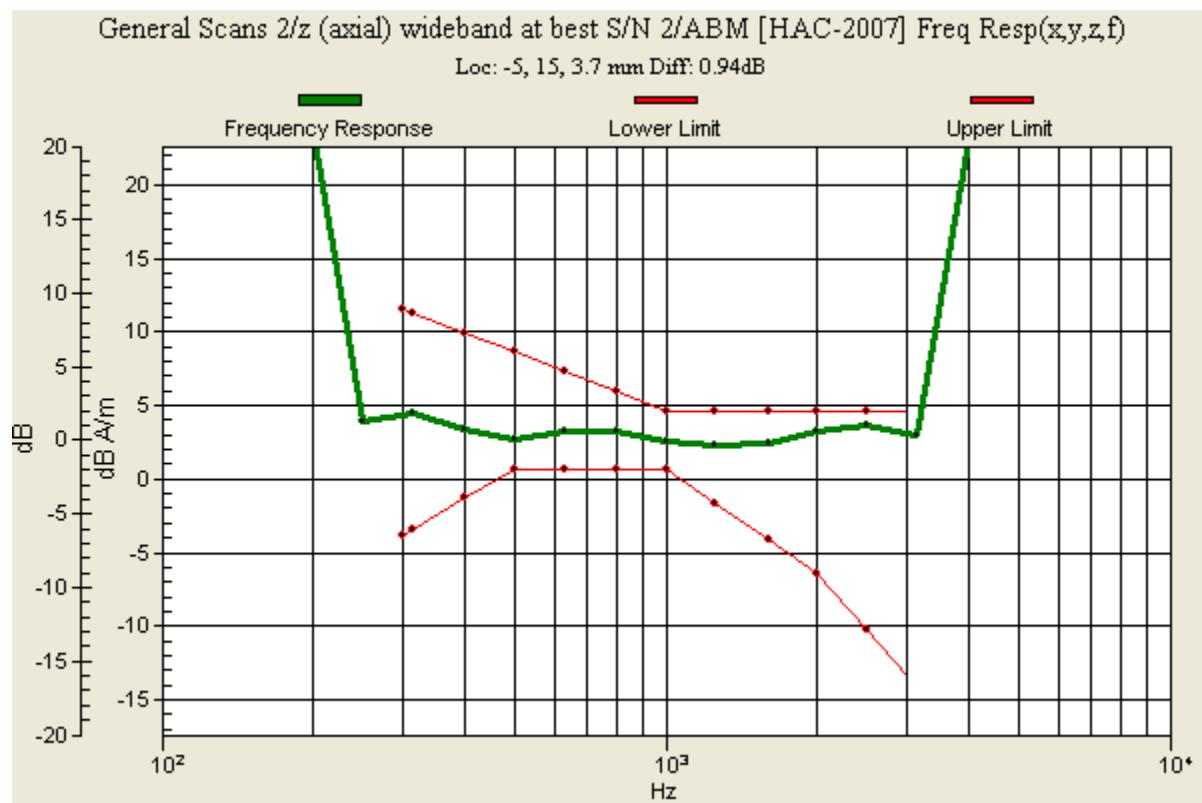
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

Author Data

Andrew Becker

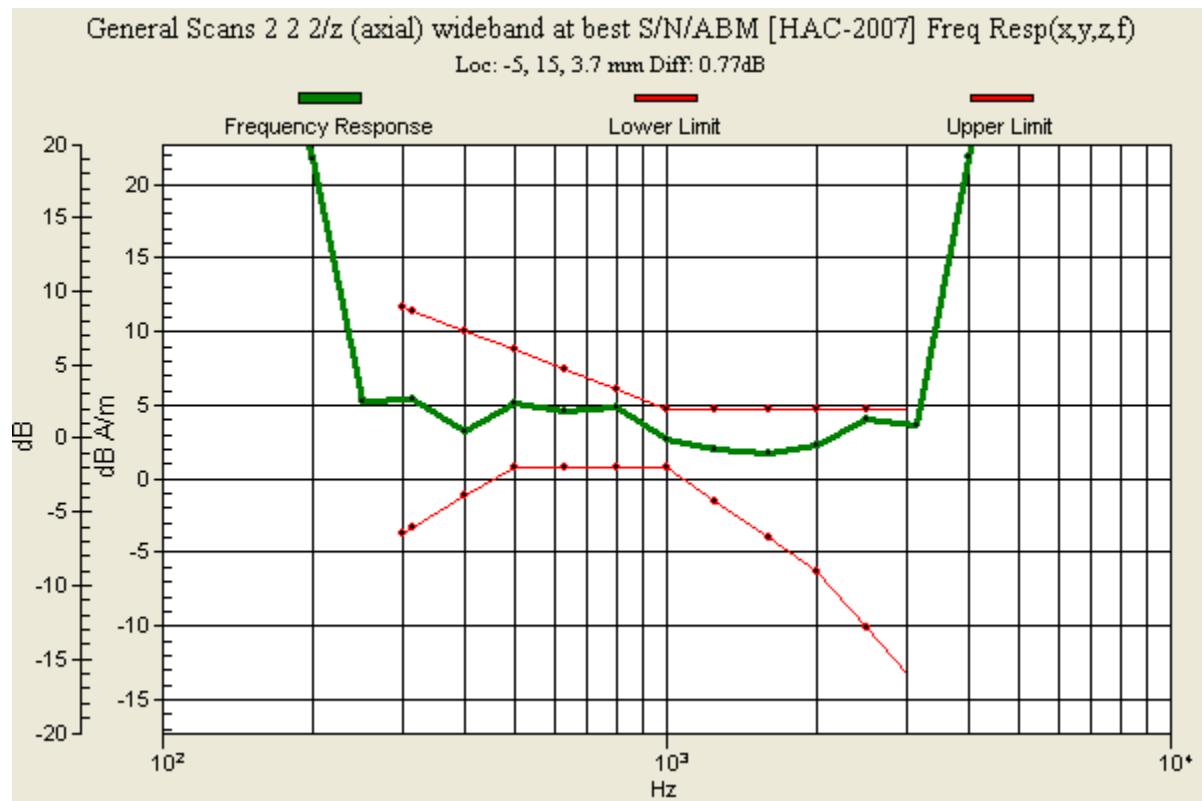
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 45(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Date/Time: 5/19/2011 12:56:33 AM, Date/Time: 5/19/2011 1:11:48 AM, Date/Time: 5/19/2011 1:44:31 AM, Date/Time: 5/19/2011 1:57:44 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA1900_Alt_Batt_Radial_L

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 1900; Communication System Band: CDMA 2000 PCS;
Frequency: 1851.25 MHz, Frequency: 1880 MHz, Frequency: 1908.5 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/x (longitudinal) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 46(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

**T-Coil scan/General Scans 2 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.42 dB
ABM1 comp = -3.68 dB A/m
BWC Factor = 0.15 dB
Location: 8, 15, 4.4 mm

**T-Coil scan/General Scans 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.29 dB
ABM1 comp = -2.16 dB A/m
BWC Factor = 0.15 dB
Location: 8, 11, 4.4 mm

**T-Coil scan/General Scans 2 2 2/x (longitudinal) 2mm 8 x 8/ABM
[HAC-2007] SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.15 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.21 dB
ABM1 comp = -3.22 dB A/m
BWC Factor = 0.15 dB
Location: 8, 13, 4.4 mm

Author Data

Andrew Becker

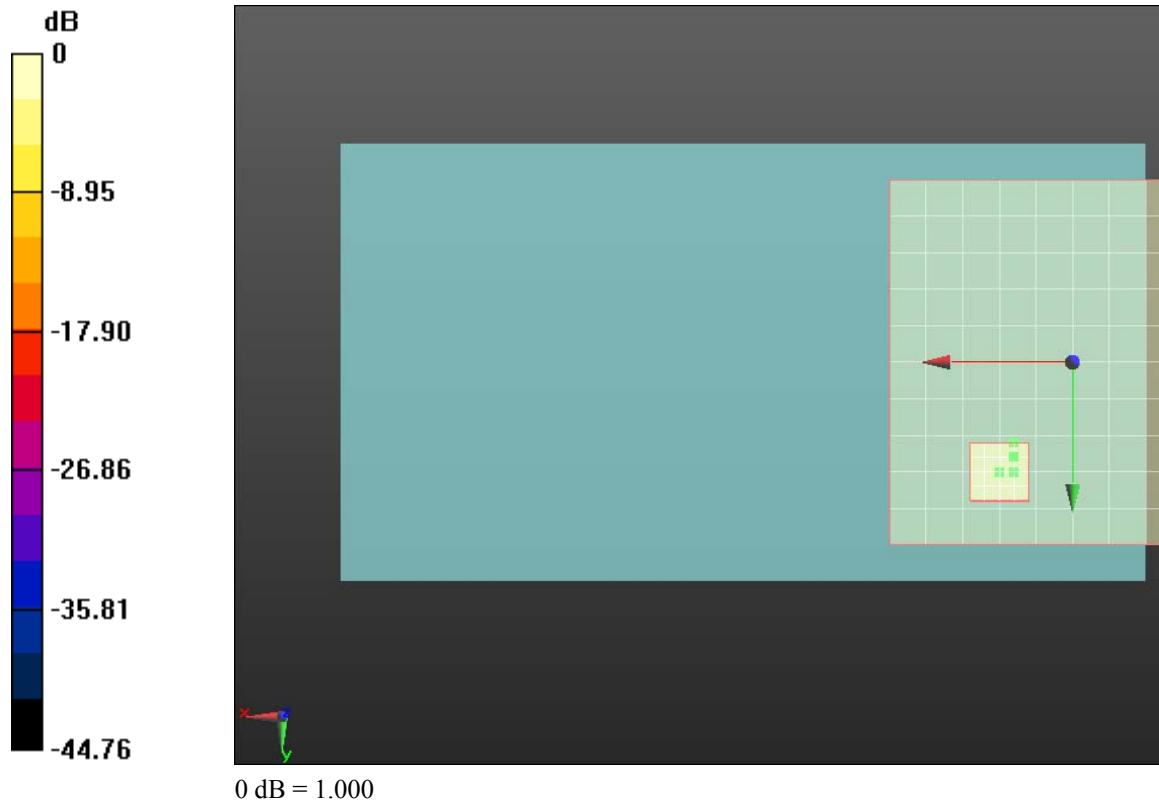
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 48(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

Date/Time: 5/19/2011 1:15:18 AM, Date/Time: 5/19/2011 1:28:53 AM, Date/Time: 5/19/2011 1:48:04 AM, Date/Time: 5/19/2011 2:01:14 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_CDMA1900_Alt_Batt_Radial_T

DUT: BlackBerry; Type: Sample; Serial: 32E4DC07

Communication System: CDMA 1900; Communication System Band: CDMA 2000 PCS; Frequency: 1880 MHz, Frequency: 1851.25 MHz, Frequency: 1908.5 MHz; Communication System PAR: 0 dB

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY5 Configuration:

- Probe: AM1DV2 - 1016; ; Calibrated: 3/7/2011
- Sensor-Surface: 0mm (Fix Surface)
- Electronics: DAE3 Sn473; Calibrated: 1/21/2011
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.6 (2); SEMCAD X Version 14.4.4 (2829)

T-Coil scan/General Scans 2/y (transversal) 5.0mm 50 x 50/ABM [HAC-2007]

SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 49(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW

T-Coil scan/General Scans 2 2/y (transversal) 2mm 8 x 8/ABM

[HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.58 dB

ABM1 comp = -7.76 dB A/m

BWC Factor = 0.15 dB

Location: -1, 2, 4.4 mm

T-Coil scan/General Scans 2/y (transversal) 2mm 8 x 8/ABM [HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.32 dB

ABM1 comp = -6.72 dB A/m

BWC Factor = 0.15 dB

Location: -1, 0, 4.4 mm

T-Coil scan/General Scans 2 2 2/y (transversal) 2mm 8 x 8/ABM

[HAC-2007] SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.15 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.87 dB

ABM1 comp = -8.41 dB A/m

BWC Factor = 0.15 dB

Location: -1, 2, 4.4 mm

Author Data

Andrew Becker

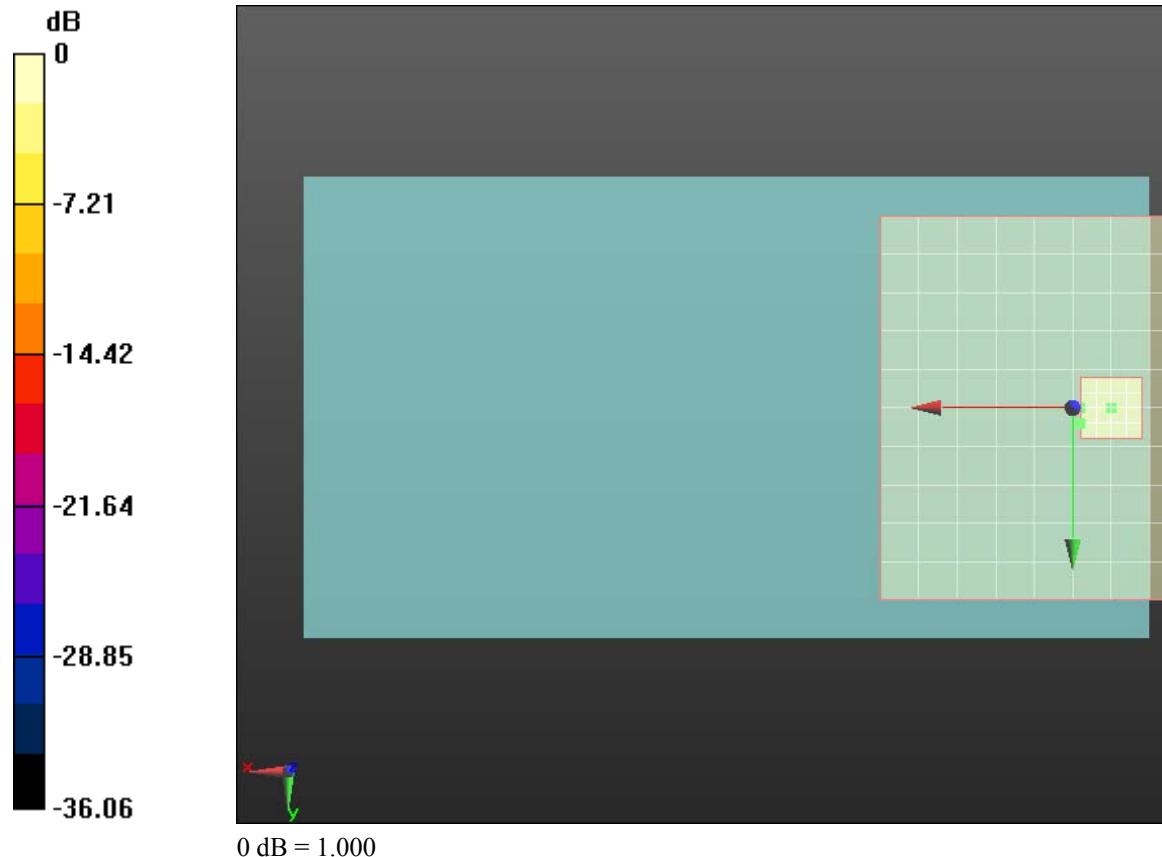
Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW	Page 51(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12

Annex D: Probe/TMFS calibration certificate



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

52(59)

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

Calibration Laboratory of
Schmid & Partner
Engineering AG
Zeughausstrasse 43, 8004 Zurich, Switzerland



S Schweizerischer Kalibrierdienst
C Service suisse d'étalonnage
S Servizio svizzero di testatura
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)
The Swiss Accreditation Service is one of the signatories to the EA
Multilateral Agreement for the recognition of calibration certificates
Client **RTS (RIM Testing Services)**

Accreditation No.: **SCS 108**Certificate No: **AM1DV2-1016_Mar11****CALIBRATION CERTIFICATE**Object **AM1DV2 - SN: 1016**Calibration procedure(s) **QA CAL-24.v2**
Calibration procedure for AM1D magnetic field probes and TMFS in the
audio rangeCalibration date: **March 7, 2011**

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI).
The measurements and the uncertainties with confidence probability are given on the following pages and are part of the certificate.

All calibrations have been conducted in the closed laboratory facility: environment temperature (22 ± 3)°C and humidity < 70%.

Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID #	Cal Date (Certificate No.)	Scheduled Calibration
Kathley Multimeter Type 2001	SN: 0810278	28-Sep-10 (No:10376)	Sep-11
Reference Probe AM1DV2	SN: 1008	18-Jan-11 (No. AM1D-1008_Jan11)	Jan-12
DAE4	SN: 781	20-Oct-10 (No. DAE4-781_Oct10)	Oct-11

Secondary Standards	ID #	Check Date (in house)	Scheduled Check
AMCC	1050	15-Oct-09 (in house check Oct-09)	Oct-11

Calibrated by:

Name: **Mike Mell** Function: **Laboratory Technician**

Signature:

Approved by:

Name: **Rin Bomhoff** Function: **R&D Director**

Signature:

Issued: March 9, 2011

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

Certificate No: AM1D-1016_Mar11

Page 1 of 3

 RIM Testing Services™	Document			Page
	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW		53(59)	
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW	

References

- [1] ANSI C63.19-2007
American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY4 manual, Chapter: Hearing Aid Compatibility (HAC) T-Coil Extension

Description of the AM1D probe

The AM1D Audio Magnetic Field Probe is a fully shielded magnetic field probe for the frequency range from 100 Hz to 20 kHz. The pickup coil is compliant with the dimensional requirements of [1]. The probe includes a symmetric low noise amplifier for the signal available at the shielded 3 pin connector at the side. Power is supplied via the same connector (phantom power supply) and monitored via the LED near the connector. The 7 pin connector at the end of the probe does not carry any signals, but determines the angle of the sensor when mounted on the DAE. The probe supports mechanical detection of the surface.

The single sensor in the probe is arranged in a tilt angle allowing measurement of 3 orthogonal field components when rotating the probe by 120° around its axis. It is aligned with the perpendicular component of the field, if the probe axis is tilted nominally 35.3° above the measurement plane, using the connector rotation and sensor angle stated below.

The probe is fully RF shielded when operated with the matching signal cable (shielded) and allows measurement of audio magnetic fields in the close vicinity of RF emitting wireless devices according to [1] without additional shielding.

Handling of the item

The probe is manufactured from stainless steel. In order to maintain the performance and calibration of the probe, it must not be opened. The probe is designed for operation in air and shall not be exposed to humidity or liquids. For proper operation of the surface detection and emergency stop functions in a DASY system, the probe must be operated with the special probe cup provided (larger diameter).

Methods Applied and Interpretation of Parameters

- **Coordinate System:** The AM1D probe is mounted in the DASY system for operation with a HAC Test Arch phantom with AMCC Helmholtz calibration coil according to [2], with the tip pointing to "southwest" orientation.
- **Functional Test:** The functional test preceding calibration includes test of Noise level
RF immunity (1kHz AM modulated signal). The shield of the probe cable must be well connected. Frequency response verification from 100 Hz to 10 kHz.
- **Connector Rotation:** The connector at the end of the probe does not carry any signals and is used for fixation to the DAE only. The probe is operated in the center of the AMCC Helmholtz coil using a 1 kHz magnetic field signal. Its angle is determined from the two minima at nominally +120° and -120° rotation, so the sensor in the tip of the probe is aligned to the vertical plane in z-direction, corresponding to the field maximum in the AMCC Helmholtz calibration coil.
- **Sensor Angle:** The sensor tilting in the vertical plane from the ideal vertical direction is determined from the two minima at nominally +120° and -120°. DASY system uses this angle to align the sensor for radial measurements to the x and y axis in the horizontal plane.
- **Sensitivity:** With the probe sensor aligned to the z-field in the AMCC, the output of the probe is compared to the magnetic field in the AMCC at 1 kHz. The field in the AMCC Helmholtz coil is given by the geometry and the current through the coil, which is monitored on the precision shunt resistor of the coil.



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**Page
54(59)

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW**AM1D probe identification and configuration data**

Item	AM1DV2 Audio Magnetic 1D Field Probe
Type No	SP AM1 001 AC
Serial No	1016

Overall length	296 mm
Tip diameter	6.0 mm (at the tip)
Sensor offset	3.0 mm (centre of sensor from tip)
Internal Amplifier	40 dB

Manufacturer / Origin	Schmid & Partner Engineering AG, Zurich, Switzerland
Manufacturing date	Apr-2006
Last calibration date	March 17, 2010

Calibration dataConnector rotation angle (in DASY system) **251.5 °** +/- 3.6 ° (k=2)Sensor angle (in DASY system) **3.69 °** +/- 0.5 ° (k=2)Sensitivity at 1 kHz (in DASY system) **0.0652 V / (A/m)** +/- 2.2 % (k=2)



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

55(59)

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW

Calibration Laboratory of
Schmid & Partner
Engineering AG
Zeughausstrasse 43, 8004 Zurich, Switzerland



S Schweizerischer Kalibrierdienst
C Service suisse d'étalonnage
S Servizio svizzero di toratura
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)
The Swiss Accreditation Service is one of the signatories to the EA
Multilateral Agreement for the recognition of calibration certificates

Accreditation No.: **SCS 108**

Client

RTS (RIM Testing Services)Certificate No: **TMFS_1003_Jan10****CALIBRATION CERTIFICATE**

Object / Identification

TMFS-1 ~ SN: 1003

Calibration procedure(s)

QA CAL-24.v2**Calibration procedure for AM1D magnetic field probes and TMFS in the
audio range**

Calibration date

January 22, 2010

Condition of the calibrated item

In Tolerance

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI).
The calibrations have been conducted in the R&D laboratory facility: environment temperature (22 ± 3 °C) and humidity < 70%.

Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID #	Cal Date (Calibrated by, Certificate No.)	Scheduled Calibration
Keithley Multimeter Type 2001	SN: 0610278	1-Oct-09 (No: 8025)	Oct-10
Secondary Standards	ID #	Cal / Check Date	Scheduled Calibration Check
AMCC Reference Probe AM1DV2	1050	15-Oct-09 (in house check Oct-09)	Oct-11
AMMI Audio Measuring Instrument	SN: 1008	21-Jan-10 (No: AM1D-1008_Jan10)	Jan-11
Agilent WF Generator 33120A	1052	14-Jul-09 (in house check Jul-09)	Jul-11
	MY40005298	13-Oct-09 (in house check Oct-09)	Oct-11

Calibrated by:

Name: **Miss Meier** Function: **Laboratory Technician** Signature:

Approved by:

Name: **Fin Bomhoff** Function: **R&D Director** Signature:

Issued: January 25, 2010

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

Certificate No: **TMFS_1003_Jan10**

Page 1 of 5



Document	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW			Page 56(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW	

References

- [1] ANSI-PC63.19-2007 American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY4 manual, Chapter 29: Hearing Aid Compatibility (HAC) T-Coil Extension (April 2006)

Methods Applied and Interpretation of Parameters

- **Coordinate System:** The TMFS is mounted underneath the HAC Test Arch touching equivalently to a wireless device according to [2] 29.2.2.: In "North" orientation, the TMFS signal connector is directed to the north, with x and y axes of TMFS and Test arch coinciding (see fig. 1). The rotational symmetry axis of the TMFS is aligned to the center of the HAC test Arch. For East, South and West configuration, the TMFS has been rotated clockwise in steps of 90°, so the connector looks into the specified direction. The evaluation of the radial direction is referenced to the device orientation (x equivalent to South direction).
- **Measurement Plane:** In coincidence with standard [1], the measurement plane (probe sensor center) is selected to be at a distance of 10 mm above the the surface of the TMFS touching the frame. The 50 x 50 mm scan area is aligned to the center of the unit. The scanning plane is verified to be parallel to the phantom frame before the measurements using the predefined "Geometry and signal check" procedure according to the predefined procedures described in [2].
- **Measurement Conditions:** Calibration of AM1D probe and AMMI are according to [2]. The 1 kHz sine signal for the level measurement is supplied from an external, independent generator via a BNC cable to TMFS IN and monitored at TMFS OUT with an independent RMS voltmeter or Audio Analyzer. The level is set to 0.5 Vrms and monitored during the scans.
- For the frequency response, a higher suppression of the background ambient magnetic field over the full frequency range was achieved by placing the TMFS in a magnetically shielded box. The AM1D probe was fixed without robot positioner near the axial maximum for this measurement. The background noise suppression was typ. 30 dB at 100 Hz (minimum) and 42 dB at 1 kHz. The predefined multisine signal (48k_multisine_50-10000_10s.wav) was used and evaluated in the third-octave bands from 100 Hz to 10000 Hz.

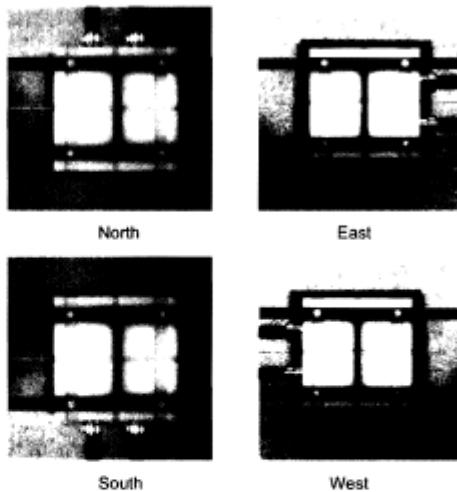


Fig. 1 TMFS scanning measurement configurations



Document	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW			Page 57(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW	

1 Measurement Conditions

DASY system configuration, as far as not given on page 1.

DASY Version	DASY5	V5.2 B162
DASY PP Version	SEMCAD	V14.0 B59
Phantom	HAC Test Arch	SD HAC P01 BA, #1002
Distance TMFS Top - Probe Centre	10 mm	
Scan resolution	dx, dy = 5 mm	area = 50 x 50 mm
Frequency	for field scans	1 kHz
Signal level to TMFS	for field scans	500 mV RMS
Signal	for frequency response	multisine signal 50-10000 Hz, each third-octave band

Table 1: System configuration

2 Axial Maximum Field

Configuration	East	South	West	North	Subset Average	Average
Axial Max	-20.17	-20.17	-20.16	-20.17		-20.17
TMFS Y Axis 1st Max	-25.74	-25.74	-25.70	-25.70		
TMFS Y Axis 2nd Max	-25.82	-25.66	-25.02	-25.7		
Longitudinal Max Avg	-25.83	-25.70	-25.86	-25.70	-25.77	
TMFS X Axis 1st Max	-25.73	-25.71	-25.73	-25.67		
TMFS X Axis 2nd Max	-25.68	-25.91	-25.67	-25.96		
Transversal Max Avg	-25.71	-25.81	-25.70	-25.82	-25.76	
Radial Max						-25.77

Table 2: Axial and radial field maxima measured with probe center at 10mm distance in dB A/m

The maximum was calculated as the average from the values measured in the 4 orientations listed in table 2.

Axial Maximum -20.17 dB A/m (+/- 0.33dB, k=2)

3 Radial Maximum Field

In addition, the average from the 16 maxima of the radial field listed in table 2 (measured at 10mm) was calculated:

Radial Maximum -25.77 dB A/m



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RDS41CW**

Page

58(59)

Author Data

Andrew Becker

Dates of Test

May 12-19, 2011

Report No

RTS-2604-1107-12

FCC ID

L6ARDS40CW**4 Appendix****4.1 Frequency response**

Max. deviation measured, relative to 1 kHz: min. -0.03, max. +0.02 dB

Frequency [Hz]	Response [dB]
100	0.02
125	0.00
160	-0.01
200	0.00
250	0.02
315	-0.01
400	0.00
500	0.00
630	0.00
800	0.00
1000	0.00
1250	-0.01
1600	-0.01
2000	-0.01
2500	-0.01
3150	-0.01
4000	-0.02
5000	-0.02
6300	-0.03
8000	-0.03
10000	-0.03

Table 3: Frequency response

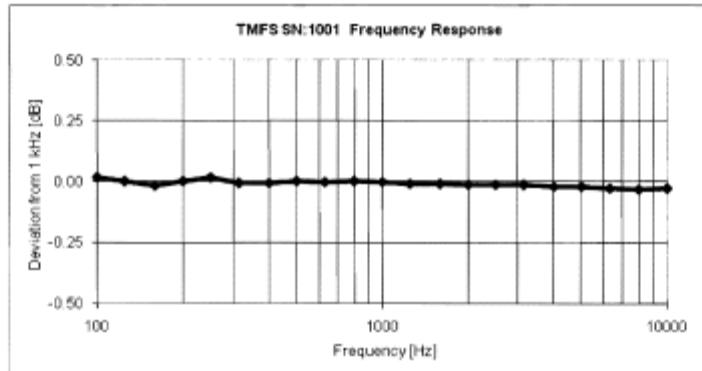


Fig. 2 Frequency response 100 to 10'000 Hz

Document	Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RDS41CW			Page
				59(59)
Author Data Andrew Becker	Dates of Test May 12-19, 2011	Report No RTS-2604-1107-12	FCC ID L6ARDS40CW	

4.2 Field plots

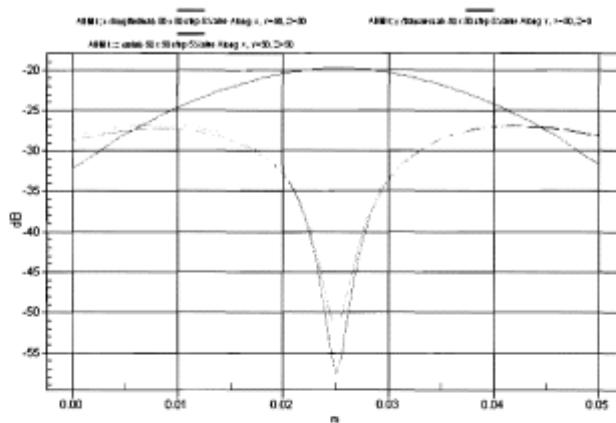


Fig. 3: Typical 2D field plots for x (red), y (green) and z (blue) components

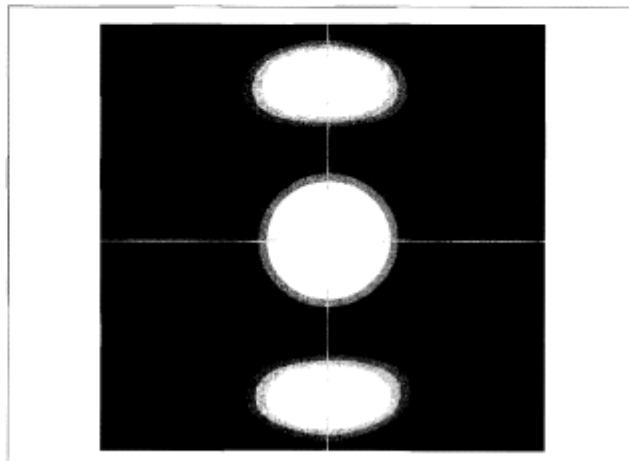


Fig. 4: Superposed field plots of z (axial), x and y radial magnetic field, 50 x 50 mm, individual scaling: white = max. field level, black = -4dB below max. The lines show the position of the 2D field plot of figure 3.