



849 NW STATE ROAD 45
NEWBERRY, FL 32669 USA
PH: 888.472.2424 OR 352.472.5500
FAX: 352.472.2030
EMAIL: INFO@TIMCOENGR.COM
[HTTP://WWW.TIMCOENGR.COM](http://WWW.TIMCOENGR.COM)

**FCC PART 95 SUBPART D
TEST REPORT
FOR CB TRANSCEIVERS**

APPLICANT	MIDLAND RADIO CORPORATION
	5900 PARRETTA DRIVE KANSAS CITY MISSOURI 64120 USA
FCC ID	MMA9001Z
MODEL NUMBER	9001z
PRODUCT DESCRIPTION	MOBILE CB TRANSCEIVER
DATE SAMPLE RECEIVED	10/30/2009
DATE TESTED	11/19/2009
TESTED BY	Richard Block
APPROVED BY	Mario de Aranzeta
TIMCO REPORT NO.	2628AUT9TestReport.doc
TEST RESULTS	<input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL

**THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL
WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.**





TABLE OF CONTENTS

GENERAL REMARKS.....	3
GENERAL INFORMATION.....	4
TEST ENVIRONMENT.....	5
TEST SETUP SUMMARY.....	5
EQUIPMENT LIST.....	6
TEST PROCEDURE.....	7
RF POWER OUTPUT.....	8
MODULATION CHARACTERISTICS.....	9
AUDIO FREQUENCY RESPONSE.....	9
AUDIO LOW PASS FILTER RESPONSE.....	10
AUDIO INPUT VS MODULATION.....	11
OCCUPIED BANDWIDTH.....	12
SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED).....	14
FIELD STRENGTH OF SPURIOUS EMISSIONS.....	16
FREQUENCY STABILITY.....	18
RADIATED EMISSIONS TEST SETUP PHOTO.....	19

GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

The test results relate only to the items tested.

Summary

The device under test does:

- fulfill the general approval requirements as identified in this test report
- not fulfill the general approval requirements as identified in this test report

Attestations

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025 requirements.



Testing Certificate # 0955-01

I attest that the necessary measurements were made, under my supervision, at:

Timco Engineering Inc.
849 NW State Road 45
Newberry, Fl 32669



Authorized Signatory Name:

Mario de Aranzeta C.E.T.
Compliance Engineer/ Lab. Supervisor

Date: 11/20/2009

GENERAL INFORMATION

DUT Specification

DUT Description	MOBILE CB TRANSCEIVER
FCC ID	MMA9001Z
Model Number	9001Z
Serial Number	N/A
Operating Frequency	26.965-27.405 MHz
No. of Channels	40
Type of Emission	6K00A3E Bn = 2M M = 3000 Bn = 6000
Modulation	AM
DUT Power Source	<input type="checkbox"/> 110-120Vac/50- 60Hz
	<input checked="" type="checkbox"/> DC Power
	<input type="checkbox"/> Battery Operated Exclusively
Test Item	<input type="checkbox"/> Prototype
	<input checked="" type="checkbox"/> Pre-Production
	<input type="checkbox"/> Production
Type of Equipment	<input type="checkbox"/> Fixed
	<input checked="" type="checkbox"/> Mobile
	<input type="checkbox"/> Portable

APPLICANT: MIDLAND RADIO CORPORATION

FCC ID: MMA9001Z

REPORT #: M\MidlandRadio_MMA\2628AUT9\2628AUT9TestReport.doc



TEST ENVIRONMENT

Test Facility	Timco Engineering, Inc. 849 NW State Road 45 Newberry, FL 32669 USA.
Test Condition in the laboratory	Temperature: 26°C Relative humidity: 50%

TEST SETUP SUMMARY

Test Setup Diagram/Description	The DUT was placed on the turntable per setup per ANSI C63.4: 2003. A test set up photo is provided for clarification.
Deviation from the standard/procedure	No deviation
Modification of DUT	No modification
Applicable Standards	EIA/TIA-382-A, FCC CFR 47 PART 95

APPLICANT: MIDLAND RADIO CORPORATION

FCC ID: MMA9001Z

REPORT #: M\MidlandRadio_MMA\2628AUT9\2628AUT9TestReport.doc



EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3/10-Meter OATS	TEI	N/A	N/A	Listed 3/20/07	3/19/10
3-Meter OATS	TEI	N/A	N/A	Listed 2/5/09	2/5/12
3-Meter Semi-Anechoic Chamber	Panashield	N/A	N/A	Listed 5/11/07	5/10/10
Analyzer Open-Frame Tower Preamplifier	HP	8449B	3008A01075	CAL 7/22/09	7/22/11
Analyzer Open-Frame Tower Quasi-Peak Adapter	HP	85650A	2043A00305	CAL 7/22/09	7/22/11
Analyzer Open-Frame Tower RF Preselector	HP	85685A	3107A01282	CAL 7/22/09	7/22/11
Analyzer Open-Frame Tower Spectrum Analyzer	HP	8566B/85662A	2627A03154/2648A14276	CAL 7/22/09	7/22/11
Antenna: Biconnical	Eaton	94455-1	1057	CAL 1/15/08	1/15/10
Antenna: Biconnical	Electro-Metrics	BIA-25	1171	CAL 10/1/09	10/1/11
Antenna: Log-Periodic	Eaton	96005	1243	CAL 12/13/07	12/13/09
LISN	Electro-Metrics	ANS-25/2	2604	CAL 10/1/09	10/1/11
LISN	Electro-Metrics	EM-7820	2682	CAL 9/24/09	10/24/11
Signal Generator	HP	8640B	2308A21464	CAL 8/4/09	8/4/11

APPLICANT: MIDLAND RADIO CORPORATION

FCC ID: MMA9001Z

REPORT #: M\MidlandRadio_MMA\2628AUT9\2628AUT9TestReport.doc



TEST PROCEDURE

Power Line Conducted Interference: The procedure used was EIA/TIA-382-A using a 50uH LISN. Both lines were observed with the UUT transmitting. The bandwidth of the spectrum analyzer was 10 kHz with an appropriate sweep speed.

Bandwidth 20 dB: The measurements were made with the spectrum analyzer's resolution bandwidth (RBW) = 1 MHz and the video bandwidth (VBW) = 3 MHz and the span set as shown on plot.

Power Output: The RF power output was measured at the antenna feed point using a peak power meter.

Antenna Conducted Emissions: The RBW = 100 kHz, VBW = 300 kHz and the span set to 10.0 MHz and the spectrum was scanned from 30 MHz to the 10th Harmonic of the fundamental. Above 1 GHz the resolution bandwidth was 1 MHz and the VBW = 3 MHz and the span to 50 MHz.

Radiation Interference: The test procedure used was EIA/TIA-382-A using an Agilent spectrum receiver with pre-selector. The bandwidth (RBW) of the spectrum EIA/TIA-382-A receiver was 100 kHz up to 1 GHz and 1 MHz above 1 GHz with an appropriate sweep speed. The VBW above 1 GHz was 3 MHz. The analyzer was calibrated in dB above a microvolt at the output of the antenna.

RF POWER OUTPUT


Rule Part No.: Part 2.1033(c), Part 95

Test Requirements:

Method of Measurement: RF power is measured by connecting a 50-ohm, resistive wattmeter to the RF output connector. With a nominal battery voltage and the transmitter properly adjusted the RF output measures:

Test Data: OUTPUT POWER: HIGH – 4 Watts

Test Setup Diagram:

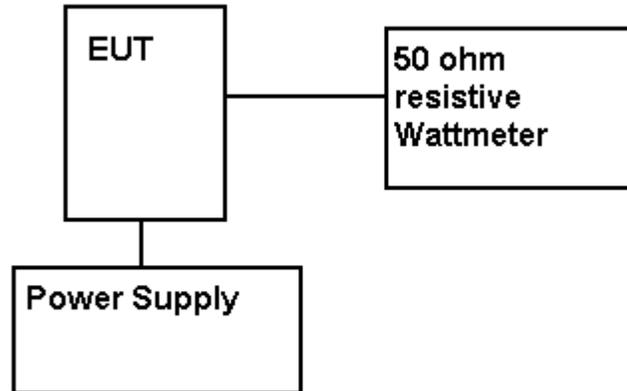

Part 2.1033 (C)(8) DC Input into the final amplifier

INPUT POWER: $(13.8V)(1.32A) = 18.21$ Watts


MODULATION CHARACTERISTICS

AUDIO FREQUENCY RESPONSE

Rule Part No.: Part 2.1047(a)(b)

Method of Measurement:

The audio frequency response was measured in accordance with EIA/TIA-382-A with no exception. A curve or equivalent data showing the frequency response of the audio modulating circuit over a range of 100 – 5000Hz shall be submitted. The audio frequency response curve is shown below.

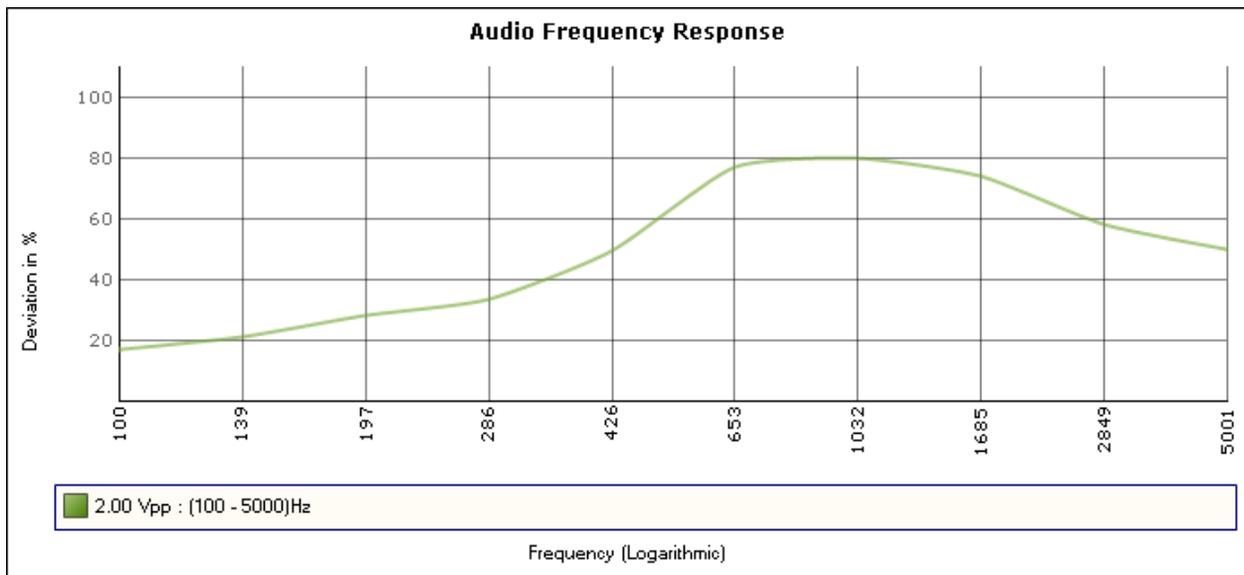


AUDIO LOW PASS FILTER RESPONSE

Rule Part No.: Part 2.1047(a)(b)

Required for voice modulated communication equipment

For equipment required to have an audio low-pass filter, a curve showing the frequency response of the filter or of all the circuitry installed between the modulation limiter and the modulated stage shall be submitted.

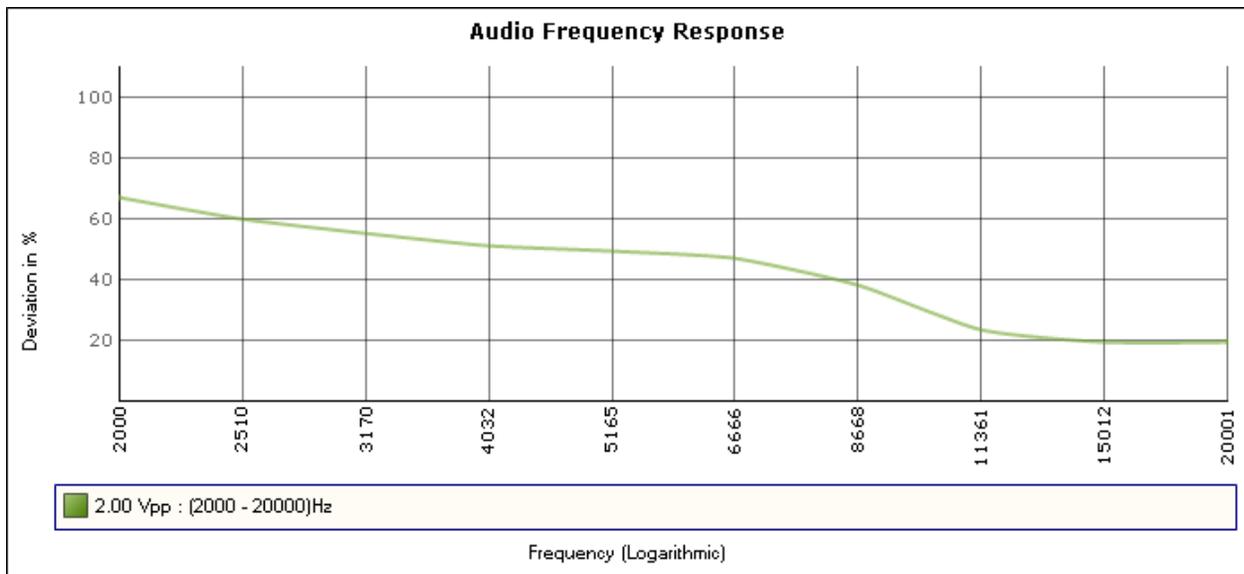


AUDIO INPUT VS MODULATION

Rule Part No.: Part 2.1047(a)(b)

Test Requirements: Modulation cannot exceed 100%

Method of Measurement: The audio input level needed for a particular percentage of modulation was measured in accordance with EIA/TIA-382-A. The audio input curves versus modulation are shown below. Curves are provided for audio input frequencies of 300, 1000, and 3000 Hz.

Test data:

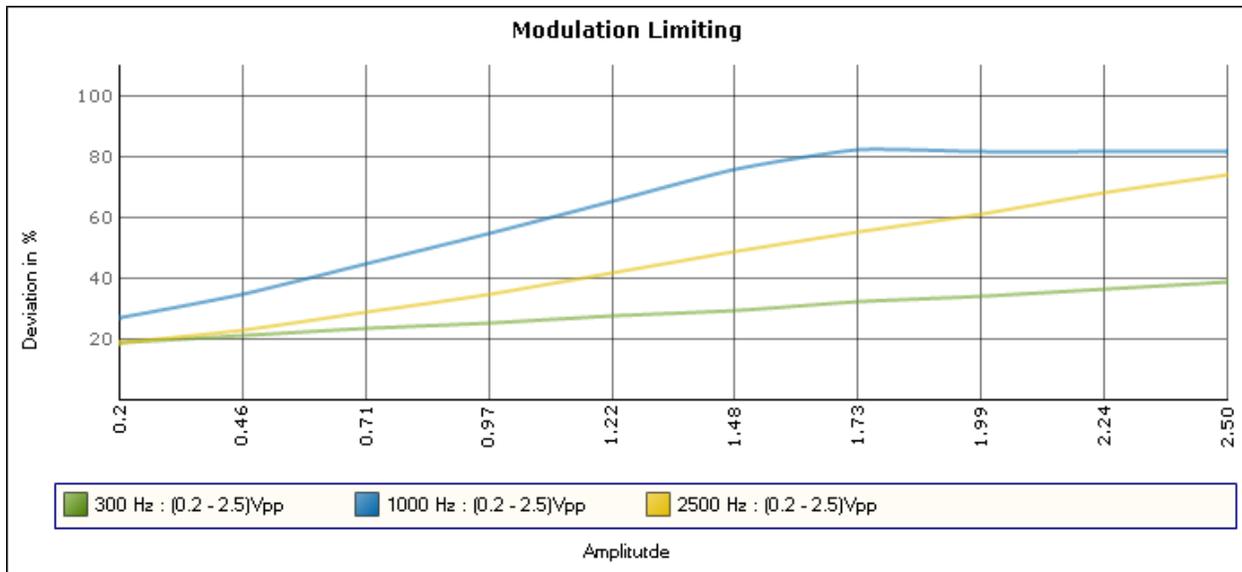

OCCUPIED BANDWIDTH


2.1049

95.631(c) Data in the plots shows that the sidebands from greater than 50% to 100% of the authorized bandwidth must be attenuated by at least 25dB and from 100 to 250% the sidebands must be attenuated by at least 35dB. Beyond 250% the sidebands must be attenuated by at least $53 + 10\log(TP)$. The transmitter was modulated with 2500 Hz, adjusted for 50% modulation plus 16 dB. The spectrum analyzer was set with the un-modulated carrier at the top of the screen. The test procedure diagram and occupied bandwidth photographs follow.

Radiotelephone transmitter with modulation limiter.

Test procedure diagram

Occupied BW Test Equipment Setup

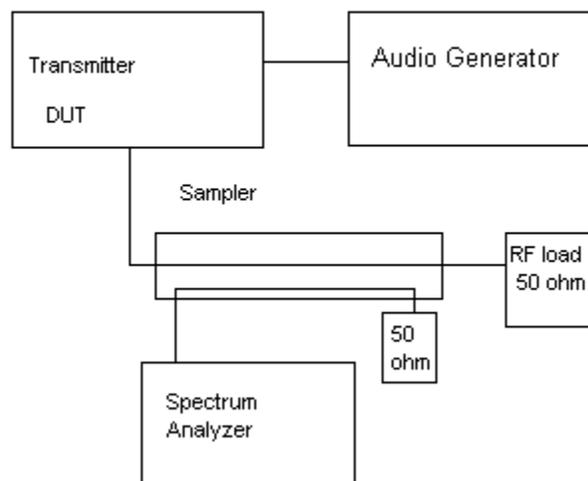


OCCUPIED BANDWIDTH PLOT

NOTES:

Occupied Bandwidth

FCC 95.635 Mask (1) (3) (8) (9)

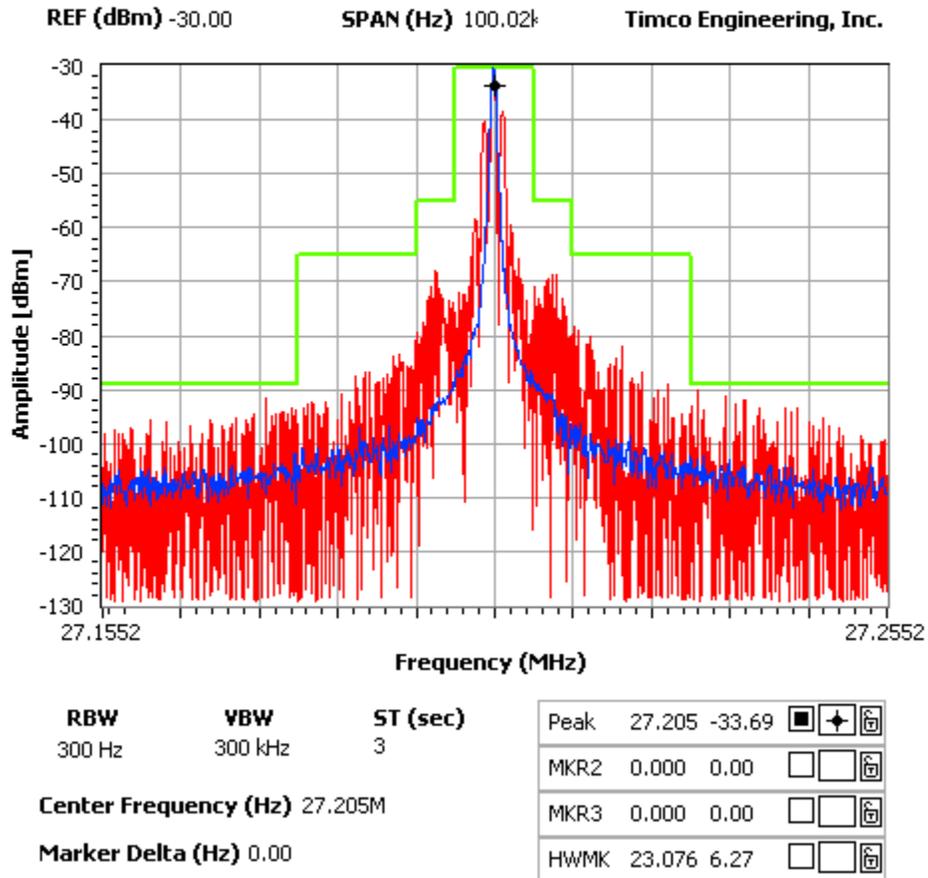



SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED)

Rule Part No.: Part 2.1051(a)


Requirements: $53 + 10\log(TP) = 59.0\text{dB}$. Any emissions above 54 MHz must be 60 dBc.

Method of Measurement: The carrier was modulated 100% using a 2500 Hz tone. The spectrum was scanned from 0.4 to at least the 10th harmonic of the fundamental. The measurements were made in accordance with standard EIA/TIA-382-A.

Test Data:

MHz	dBc	MHz	dBc	MHz	dBc
26.965	0.0	27.185	0.0	27.405	0.0
53.930	64.0	54.370	63.7	54.810	64.9
80.895	66.6	81.555	66.4	82.215	66.9
107.860	82.1	108.740	80.0	109.620	79.7
134.825	84.8	135.925	85.7	137.025	87.9
161.790	88.6	163.110	86.2	164.430	85.2
188.755	79.8	190.295	80.6	191.835	82.2
215.720	84.2	217.480	84.7	219.240	84.3
242.685	86.9	244.665	89.1	246.645	82.5
269.650	70.0	271.850	68.1	274.050	69.8

Method of Measuring Conducted Spurious Emissions

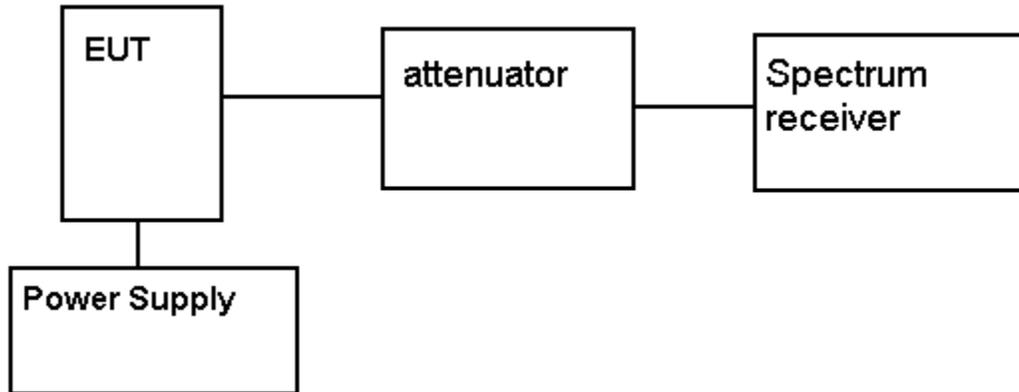

METHOD OF MEASUREMENT: The procedure used was EIA/TIA-382-A.



FIELD STRENGTH OF SPURIOUS EMISSIONS

Rule Parts. No.: Part 2.1053, 95.635(b)(8)(9)

Requirements: Emissions must be attenuated by at least the following below the output of the transmitter.

53 + 10log(4.00) = 59.0 dB or
 FCC Limit for: 8 kHz Authorized BW


At least 53+10Log(T) dB on any frequency removed from the center of the authorized bandwidth by more than 250%. At least 60dB on any frequency twice or greater than twice the fundamental.

Test Data:

Emission Frequency MHz	Ant. Pol	dB Below Carrier (dBc)	Emission Frequency MHz	Ant. Pol	dB Below Carrier (dBc)	Emission Frequency MHz	Ant. Pol	dB Below Carrier (dBc)
26.965	0	0	27.185	0	0	27.405	0	0
53.930	V	99.46	54.370	V	102.66	54.810	V	102.16
80.895	V	104.06	81.555	V	102.56	82.215	V	102.96
107.860	H	89.06	108.740	H	85.06	109.620	H	83.76
134.825	H	96.52	135.925	H	98.22	137.025	H	98.52
161.790	H	100.21	163.110	H	103.21	164.430	H	100.21
188.755	H	94.91	190.295	H	96.11	191.835	H	98.91
215.720	H	85.78	217.480	H	98.98	219.240	H	97.28
242.685	H	88.52	244.665	H	93.42	246.645	H	88.52
269.650	H	78.22	271.850	H	79.42	274.050	H	79.32

METHOD OF MEASUREMENT: The tabulated data shows the results of the radiated field strength emissions test. The spectrum was scanned from 30 MHz to at least the tenth harmonic of the fundamental. This test was conducted per EIA/TIA-382-A using the substitution method. Measurements were made at the test site of TIMCO ENGINEERING, INC. located at 849 NW State Road 45, Newberry, FL 32669.

Test Setup Diagram:

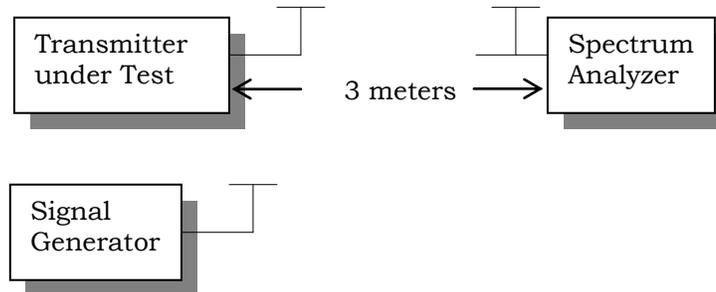

FREQUENCY STABILITY

2.1055(a)(b)(d)

Temperature and voltage tests were performed to verify that the frequency remains within the .005%, 50 ppm specification limit. The test was conducted as follows: The transmitter was placed in the temperature chamber at 25 °C and allowed to stabilize for one hour. The transmitter was keyed ON for one minute during which four frequency readings were recorded at 15-second intervals. The worse case number was taken for temperature plotting. The assigned channel frequency was considered to be the reference frequency. The temperature was then reduced to -30 °C after which the transmitter was again allowed to stabilize for one hour. The transmitter was keyed ON for one minute, and again frequency readings were noted at 15-second intervals. The worst case number was recorded for temperature plotting. This procedure was repeated in 10 degree increments up to + 50 °C.

Readings were also taken at ±15% of the battery voltage of 13.8 VDC.

Test Data:

Assigned Frequency (Ref. Frequency) (MHz)		27.204986
Temperature (°C)	Frequency (MHz)	Frequency Stability (PPM)
-30	27.204683	-11.14
-20	27.204867	-4.37
-10	27.204928	-2.13
0	27.204978	-0.29
+10	27.204991	0.18
+20	27.204989	0.11
+30	27.205033	1.73
+40	27.205045	2.17
+50	27.205048	2.28

Assigned Frequency (Ref. Frequency) (MHz)		
Battery %	Frequency (MHz)	Frequency Stability (PPM)
-15%	27.204985	-0.04
0	27.204986	0
+15%	27.204985	-0.04

RADIATED EMISSIONS TEST SETUP PHOTO

