



849 NW STATE ROAD 45
NEWBERRY, FL 32669 USA
PH: 888.472.2424 OR 352.472.5500
FAX: 352.472.2030
EMAIL: INFO@TIMCOENGR.COM
[HTTP://WWW.TIMCOENGR.COM](http://WWW.TIMCOENGR.COM)

FCC PART 90 TEST REPORT

APPLICANT	MIDLAND RADIO CORPORATION
	5900 PARRETTA DRIVE
	KANSAS CITY MISSOURI 64120 USA
FCC ID	MMA901115
MODEL NUMBER	STM-1115B
PRODUCT DESCRIPTION	VHF MOBILE TRANSCEIVER
DATE SAMPLE RECEIVED	8/13/2008
DATE TESTED	10/8/2008
TESTED BY	Joe Scoglio
APPROVED BY	Mario de Aranzeta
TIMCO REPORT NO.	1882UT8TestReport.doc
TEST RESULTS	<input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL

**THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL
WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.**



Certificate # 0955-01

TABLE OF CONTENTS

GENERAL REMARKS.....	3
GENERAL INFORMATION	4
EQUIPMENT LIST	5
TEST PROCEDURE	6
RF POWER OUTPUT	7
MODULATION CHARACTERISTICS.....	8
VOICE MODULATED COMMUNICATION EQUIPMENT	10
OTHER MODULATION CHARACTERISTICS	13
OCCUPIED BANDWIDTH.....	14
OCCUPIED BANDWIDTH PLOT 12.5kHz.....	16
SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED).....	18
FIELD STRENGTH OF SPURIOUS EMISSIONS.....	21
FREQUENCY STABILITY.....	23
FREQUENCY STABILITY.....	24

GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

Summary

The device under test does:

- fulfill the general approval requirements as identified in this test report
 not fulfill the general approval requirements as identified in this test report

Attestations

This equipment has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025 requirements.



Testing Certificate # 0955-01

I attest that the necessary measurements were made, under my supervision, at:

Timco Engineering Inc.
849 NW State Road 45
Newberry, Fl 32669



Authorized Signatory Name:

Mario de Aranzeta C.E.T.
Compliance Engineer/ Lab. Supervisor

Date: 10/9/2008

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

GENERAL INFORMATION

DUT Specification

DUT Description	VHF MOBILE TRANSCEIVER
FCC ID	MMA901115
Model Number	STM1115B
Operating Frequency	136 – 174 MHz
Type of Emission	11K0F1D, 11K0F2D, 11K0F3E, 16K0F3E
Modulation	FM
DUT Power Source	<input type="checkbox"/> 110–120Vac/50– 60Hz
	<input checked="" type="checkbox"/> DC Power 12V
	<input type="checkbox"/> Battery Operated Exclusively
Test Item	<input type="checkbox"/> Prototype
	<input checked="" type="checkbox"/> Pre-Production
	<input type="checkbox"/> Production
Type of Equipment	<input type="checkbox"/> Fixed
	<input checked="" type="checkbox"/> Mobile
	<input type="checkbox"/> Portable
Test Conditions	The temperature was 26°C with a relative humidity of 50%.
Modification to the DUT	None
Test Exercise	The DUT was placed in continuous transmit mode.
Applicable Standards	ANSI/TIA 603-C:2004, FCC CFR 47 Part 90
Test Facility	Timco Engineering Inc. at 849 NW State Road 45 Newberry, FL 32669 USA.

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3-Meter Semi-Anechoic Chamber	Panashield	N/A	N/A	Listed 5/11/07	5/10/10
AC Voltmeter	HP	400FL	2213A14499	CAL 12/29/06	12/29/08
Coaxial Cable #64	Semflex Inc.	60637	Timco #64	CHAR 3/30/07	3/30/09
Antenna: Dipole Kit	Electro-Metrics	TDA-30/1-4	152	CAL 3/3/06	3/3/09
Antenna: Dipole Kit	Electro-Metrics	TDA-30/1-4	153	CHAR 4/5/06	4/5/09
Frequency Counter	HP	5385A	2730A03025	CAL 7/6/07	7/6/09
Hygro-Thermometer	Extech	445703	0602	CAL 11/15/07	11/15/09
Antenna: Log-Periodic	Electro-Metrics	LPA-25	1122	CAL 12/1/06	12/1/08
Measuring Tape-7.5M	Kraftixx	7.5M PROFI		CHAR 11/13/07	11/13/09
Modulation Analyzer	HP	8901A	3435A06868	CAL 5/9/07	5/9/09
Digital Multimeter	Fluke	FLUKE-77-3	79510405	CAL 5/14/07	5/14/09
System One	Audio Precision	System One	SYS1-45868	CHAR 2/27/08	2/27/10
Analyzer Tan Tower Preamplifier	HP	8449B-H02	3008A00372	CAL 11/30/07	11/30/09
Analyzer Tan Tower Quasi-Peak Adapter	HP	85650A	3303A01690	CAL 11/30/07	11/30/09
Analyzer Tan Tower RF Preselector	HP	85685A	3221A01400	CAL 11/30/07	11/30/09
Analyzer Tan Tower Spectrum Analyzer	HP	8566B Opt 462	3138A07786 3144A20661	CAL 11/30/07	11/30/09
Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 4/25/08	4/25/10

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

TEST PROCEDURE

Power Line Conducted Interference: The procedure used was ANSI/TIA 603-C:2004, using a 50uH LISN. Both lines were observed with the UUT transmitting. The bandwidth of the spectrum analyzer was 10 kHz with an appropriate sweep speed.

Bandwidth 20 dB: The measurements were made with the spectrum analyzer's resolution bandwidth (RBW) = 1 MHz and the video bandwidth (VBW) = 3 MHz and the span set as shown on plot.

Power Output: The RF power output was measured at the antenna feed point using a peak power meter.

Antenna Conducted Emissions: The RBW = 100 kHz, VBW = 300 kHz and the span set to 10.0 MHz and the spectrum was scanned from 30 MHz to the 10th harmonic of the fundamental. Above 1 GHz the resolution bandwidth was 1 MHz and the VBW = 3 MHz and the span to 50 MHz.

Radiation Interference: The test procedure used was ANSI/TIA 603-C:2004, using an Agilent spectrum receiver with pre-selector. The bandwidth (RBW) of the spectrum ANSI/TIA 603-C:2004, receiver was 100 kHz up to 1 GHz and 1 MHz above 1 GHz with an appropriate sweep speed. The VBW above 1 GHz was 3 MHz. The analyzer was calibrated in dB above a microvolt at the output of the antenna. The ambient temperature of the UUT was 76°F with a humidity of 55%.


RF POWER OUTPUT

Rule Part No.: Part 2.1046(a), Part 90

Test Requirements:

Method of Measurement: RF power is measured by connecting a 50-ohm, resistive wattmeter to the RF output connector. With a nominal battery voltage, and the transmitter properly adjusted the RF output measures:

Test Setup Diagram:

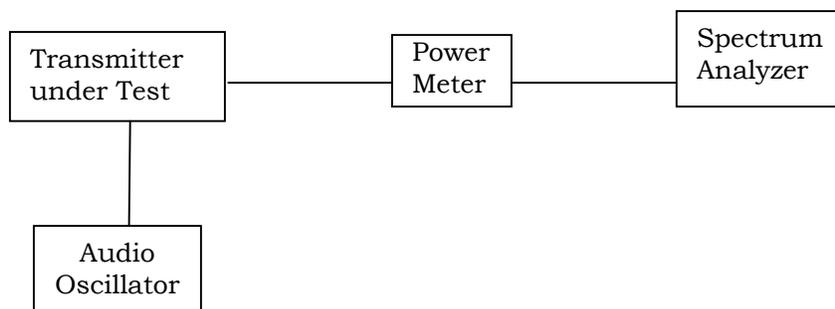

Test Data:

OUTPUT POWER: HIGH – 110.0 Watts
 LOW - 10.0 Watts

Part 2.1033 (C)(8) DC Input into the final amplifier

FOR LOW POWER SETTING INPUT POWER: $(13.6V)(4.0A) = 54.4$ Watts
 FOR HIGH POWER SETTING INPUT POWER: $(13.6V)(18.0A) = 244.8$ Watts

MODULATION CHARACTERISTICS


Rule Part No.: Part 2.1047(a)(b)

Test Requirements:

Method of Measurement:

Audio frequency response

The audio frequency response was measured in accordance with TIA/EIA Specification 603 with no exception. A curve or equivalent data showing the frequency response of the audio modulating circuit over a range of 100 – 5000Hz shall be submitted. The audio frequency response curve is shown below.

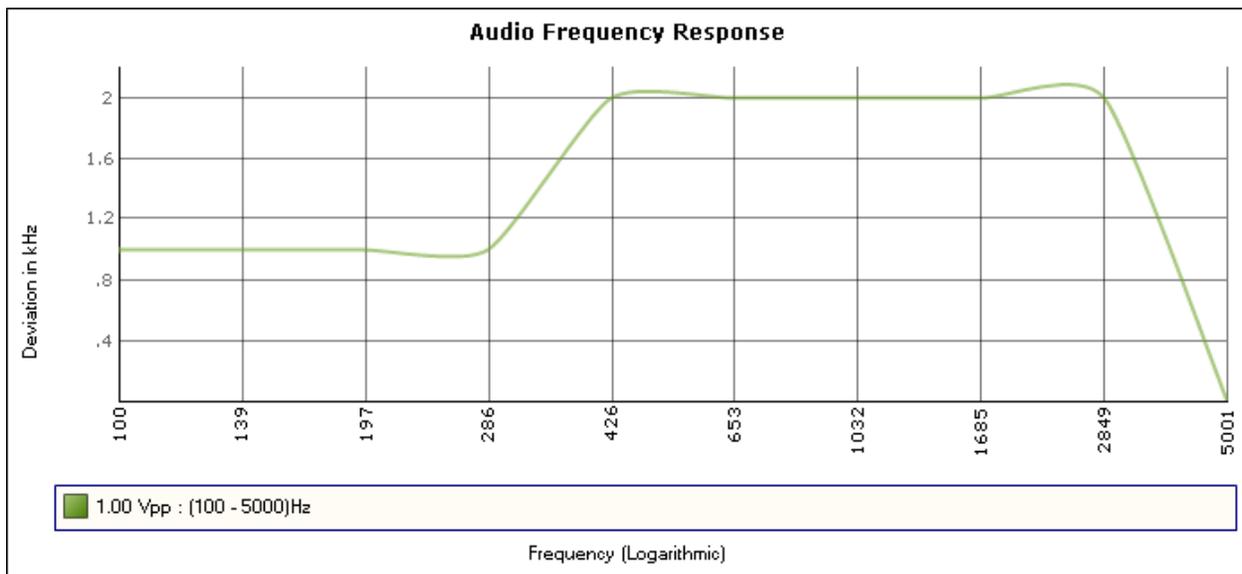


AUDIO FREQUENCY RESPONSE PLOT 12.5KHz

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115


Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

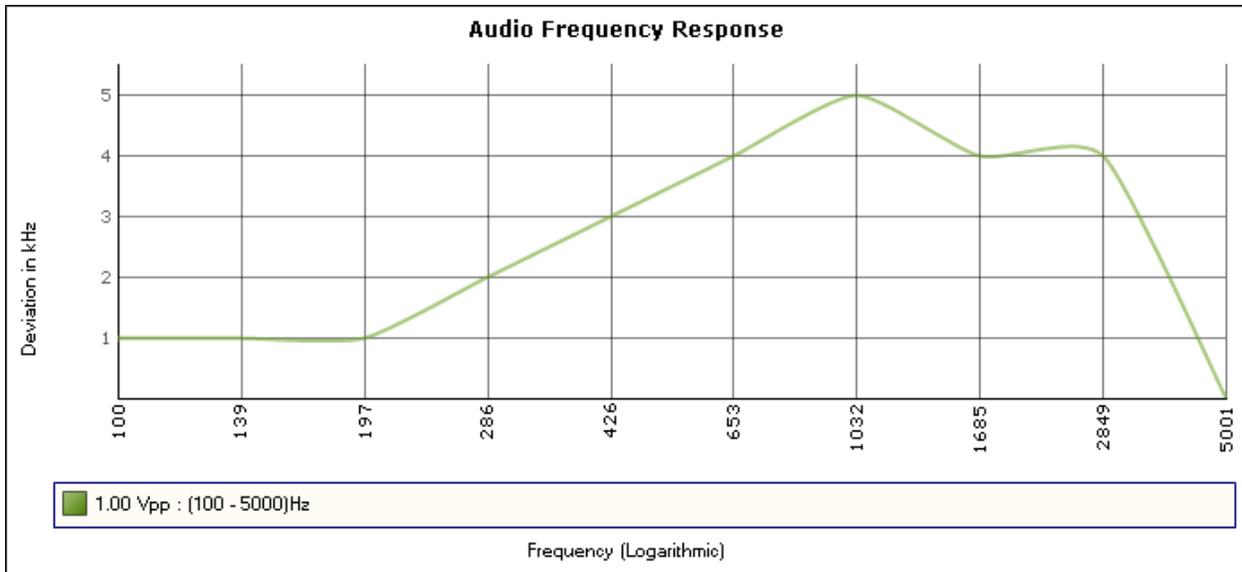


AUDIO FREQUENCY RESPONSE PLOT 25KHz

VOICE MODULATED COMMUNICATION EQUIPMENT

Part 2.1047(a): For equipment required to have an audio low-pass filter, a curve showing the frequency response of the filter, or of all the circuitry installed between the modulation limiter and the modulated stage shall be submitted.

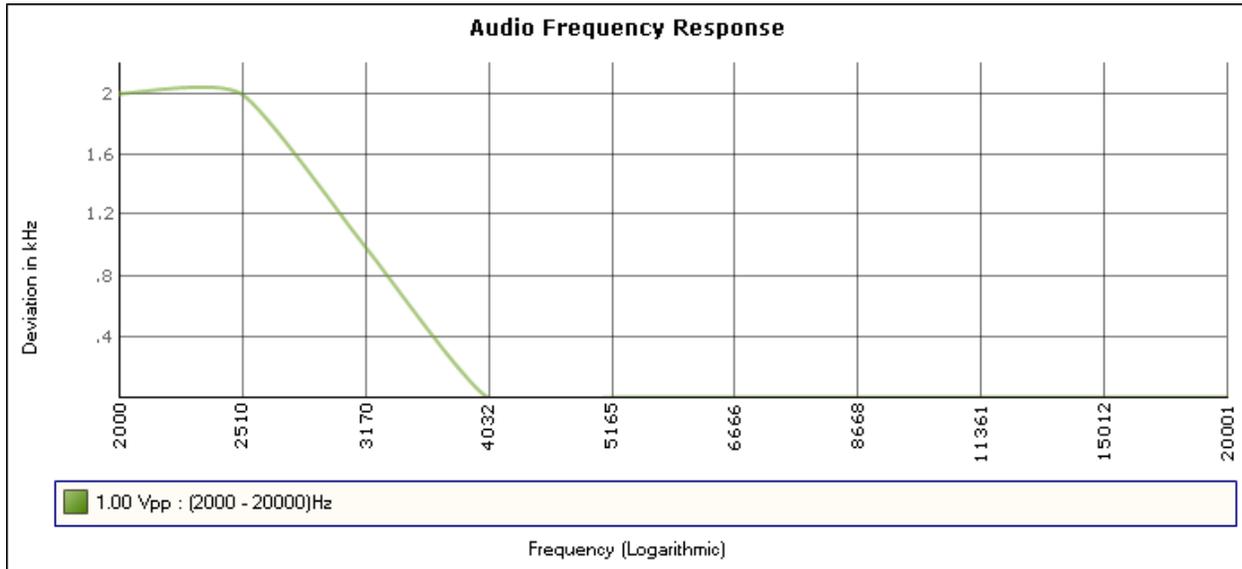

AUDIO LOW PASS FILTER. Plot 12.5KHz

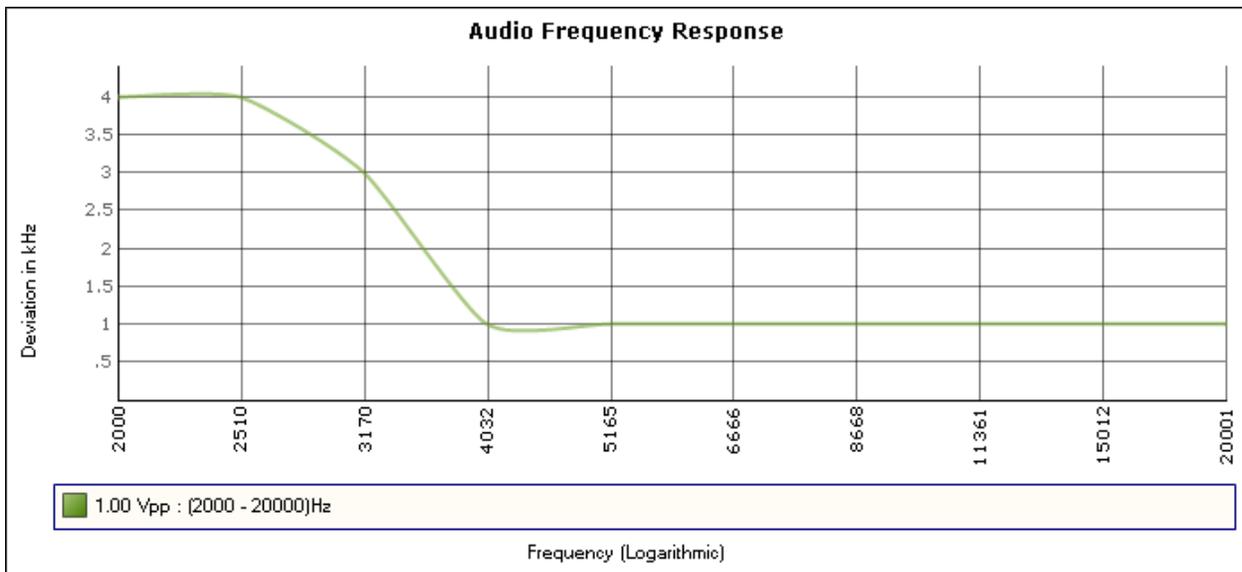

AUDIO LOW PASS FILTER. Plot 25KHz


AUDIO INPUT VERSUS MODULATION

Rule Part No.: Part 2.1047(b) & 90


Test Requirements:

Method of Measurement: **Modulation cannot exceed 100%**, The audio input level needed for a particular percentage of modulation was measured in accordance with ANSI/TIA 603-C: 2004. The audio input curves versus modulation are shown below. Curves are provided for audio input frequencies of 300, 1000, and 3000 Hz.

Test data:

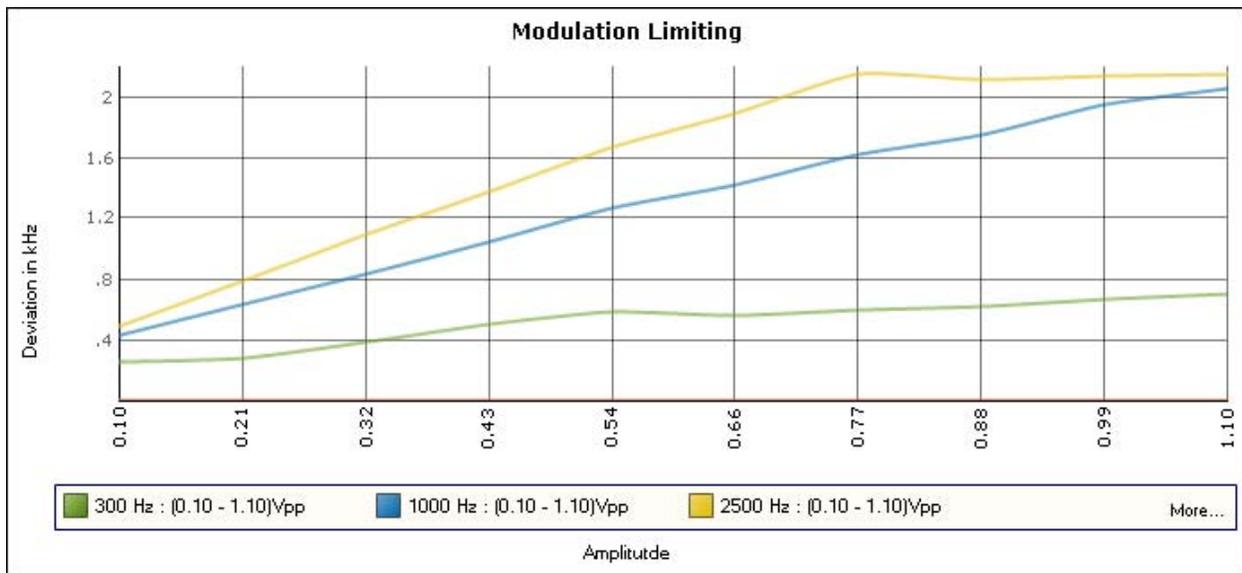

Modulation Limiting Plot 12.5KHz

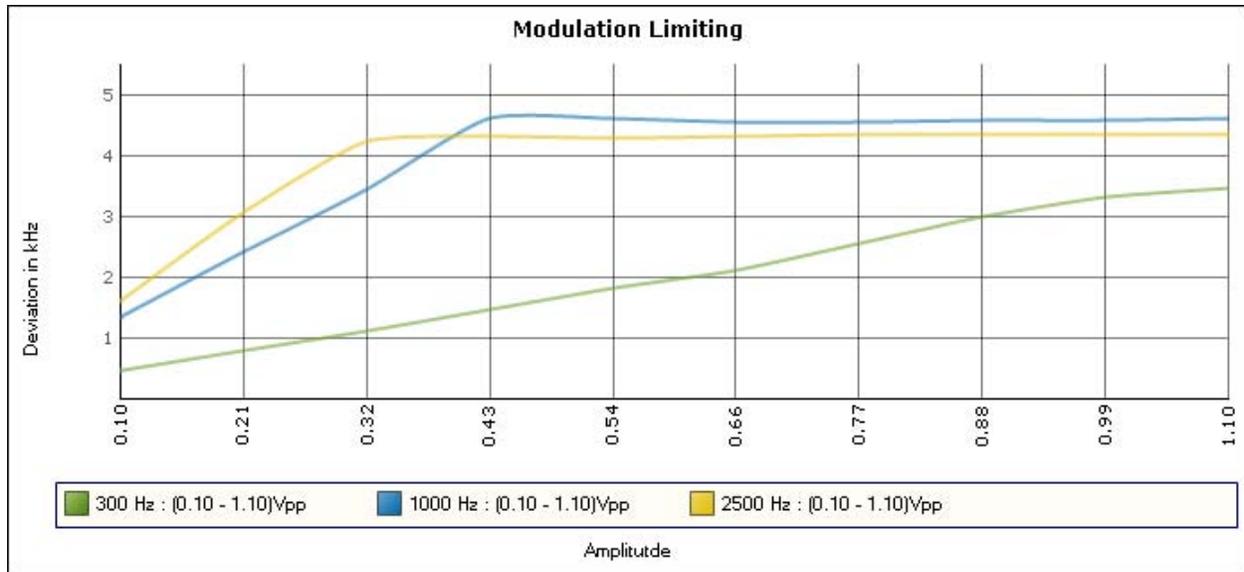

Modulation Limiting Plot 25KHz

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

OTHER MODULATION CHARACTERISTICS

Part 2.1033(c)

Part 2.1033(c) (4) Type of Emission: 11K0F1D

Part 90.209

Part 90.207 $B_n = 2M + 2DK$

$$M = B/2 = 9600/2 = 4800$$

$$D = 700$$

$$K=1$$

$$B_n = 2(4800) + 2(700) = 11.0k$$

Part 2.1033(c)

Part 2.1033(c) (4) Type of Emission: 11K0F2D

Part 90.209

Part 90.207 $B_n = 2M + 2DK$

$$M = B/2 = 9600/2 = 4800$$

$$D = 700$$

$$K=1$$

$$B_n = 2(4800) + 2(700) = 11.0k$$

Part 2.1033(c) (4) Type of Emission: 11K0F3E

Part 90.209

Part 90.207 $B_n = 2M + 2DK$

$$M = 3000$$

$$D = 2500$$

$$K=1$$

$$B_n = 2(3000) + 2(2500) = 11.0k$$

Part 2.1033(c) (4) Type of Emission: 16K0F3E

Part 90.209

Part 90.207 $B_n = 2M + 2DK$

$$M = 3000$$

$$D = 5000$$

$$K=1$$

$$B_n = 2(3000) + 2(5000) = 16.0k$$

OCCUPIED BANDWIDTH

Part 2.1049(c) EMISSION BANDWIDTH:
Part 90.210(b) 25kHz Channel Spacing

Data in the plots show that on any frequency removed from the assigned frequency by more than 50%, but not more than 100%: At least 25dB. On any frequency removed from the assigned frequency by more than 100%, but not more than 250%: At least 35 dB. On any frequency removed from the assigned frequency by more than 250%, of the authorized bandwidth: At least $43 + 10\log(P)$ dB.

Part 90.210(c) 12.5kHz Channel Spacing Not Equipped with a Low Pass Filter

For transmitters that are not equipped with an audio low pass filter pursuant to S90.211 (b), the power of any emission must be attenuated below the un-modulated carrier output power as follows; (1) On any frequency removed from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 5 kHz but not more than 10 kHz: At least $83 \log(f_d/5)$ dB; (2) ON any frequency removed from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 10 kHz, but not more than 250% of the authorized bandwidth: At least $29 \log(f_d/11)$ dB or 50 dB, whichever is the lesser attenuation; (3) On any frequency removed from the center of the authorized bandwidth by more than 250% of the authorized bandwidth: At least $43+10 \log(P_0)$ dB.

Part 90.210(d) Emission Mask D - 12.5 kHz channel BW equipment.

For transmitters designed to operate with a 12.5 kHz channel bandwidth, any emission must be attenuated below the power (P) of the highest emission contained within the authorized bandwidth as follows:

- (1) On any frequency from the center of the authorized bandwidth f_0 to 5.625 kHz removed from f_0 : Zero dB.
- (2) On any frequency from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 5.625 kHz but no more than 12.5 kHz: At least $7.27 (f_d - 2.88 \text{ kHz})$ dB.
- (3) On any frequency removed from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 12.5 kHz: At least $50 + 10\log(P)$ dB or 70 dB, whichever is the lesser attenuation.


Part 90.210(e) Emission Mask E - 6.25 kHz channel BW equipment.

For transmitters designed to operate with a 6.25 kHz bandwidth, any emission must be attenuated below the power (P) of the highest emission contained within the authorized bandwidth as follows:

- (1) On any frequency from the center of the authorized bandwidth f_0 to 3.0 kHz removed from f_0 : Zero dB.
- (2) On any frequency from the center of the authorized bandwidth by a displacement frequency (f_d in kHz) of more than 3.0 kHz but no more than 4.6 kHz: At least $30 + 16.67(f_d - 3.0 \text{ kHz})$ or $55 + 10 \text{ Log}(P)$ or 65, whichever is the lesser attenuation.
- (3) On any frequency removed from the center of the authorized bandwidth by more than 4.6kHz: At least $55 + 10\log(P)$ dB or 65 dB, whichever is the lesser attenuation.

Method of Measurement: ANSI/TIA 603-C: 2004

Test Setup Diagram:

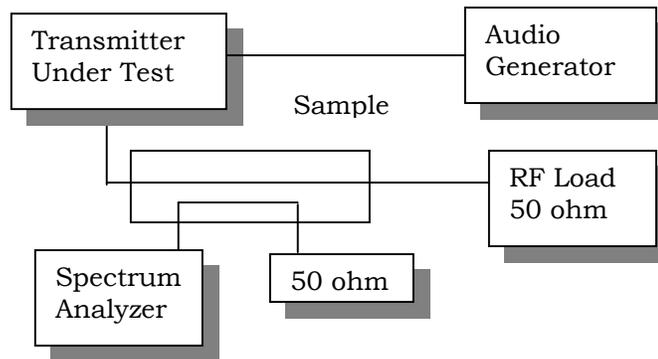


Test Data: See the plots below

NOTES:

Occupied Bandwidth 12.5k

FCC 90.210 Mask D

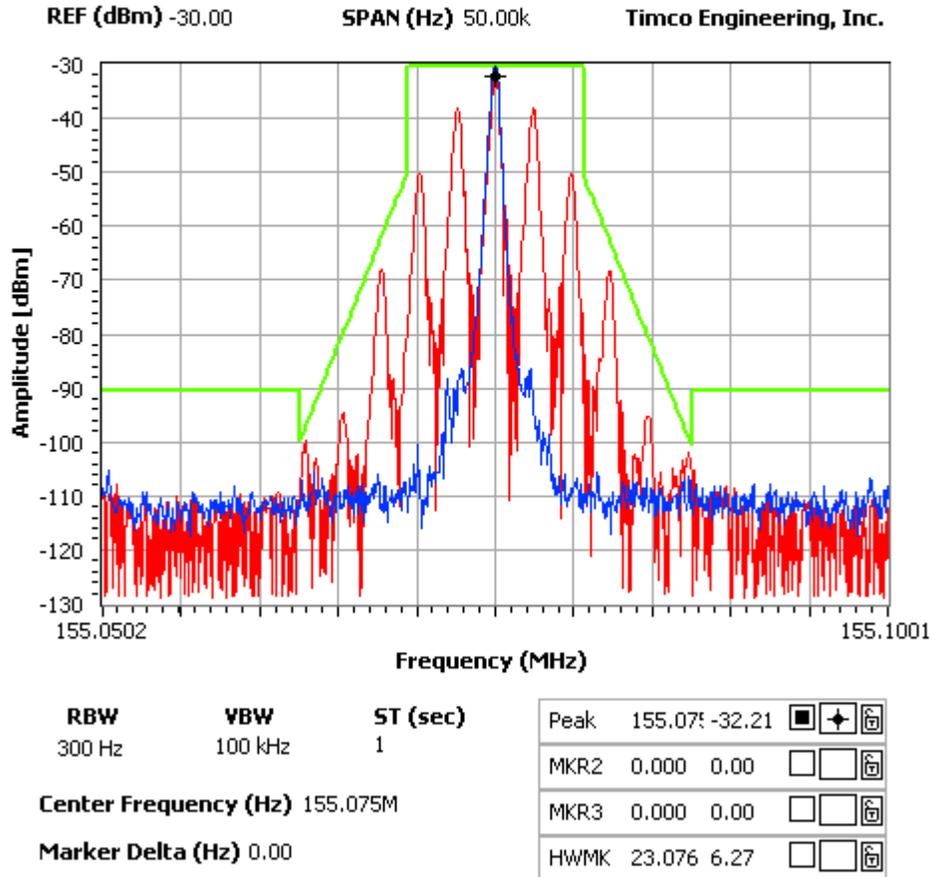

OCCUPIED BANDWIDTH PLOT 12.5kHz


Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

NOTES:

Occupied Bandwidth 25k

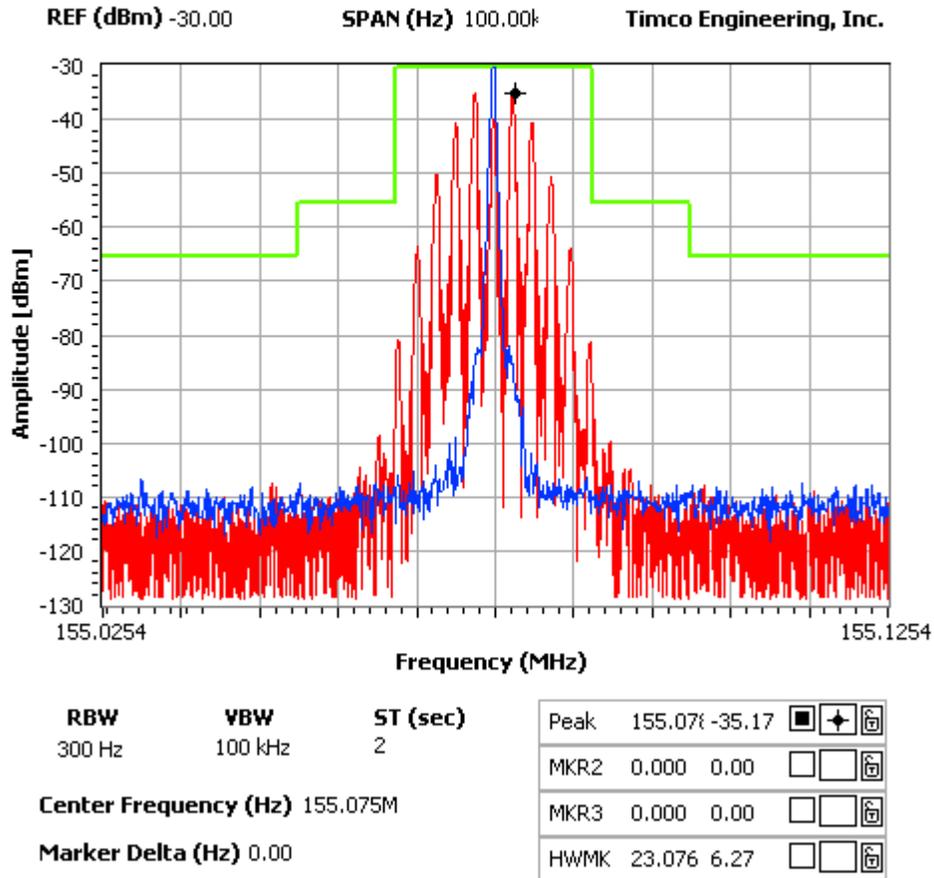

OCCUPIED BANDWIDTH PLOT 25kHz

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

SPURIOUS EMISSIONS AT ANTENNA TERMINALS (CONDUCTED)

Rule Part No.: Part 2.1051(a)

Requirements: 25kHz Channel Spacing = $43+10\log(110) = 63.4$ dBc
 $43+10\log(10) = 53.0$ dBc
 12.5kHz Channel Spacing = $50+10\log(110) = 70.4$ dBc
 $50+10\log(10) = 60.0$ dBc

Method of Measurement: The carrier was modulated 100% using a 2500 Hz tone. The spectrum was scanned from 0.4 to at least the 10th harmonic of the fundamental. The measurements were made in accordance with standard ANSI/TIA 603-C: 2004.

Test Data:

TF HIGH POWER	EF	dB below carrier		TF LOW POWER	EF	dB below carrier
136	136.000	0.0		136	136.000	0.0
	272.100	91.6			272.100	84.4
	408.200	90.6			408.200	100.5
	544.300	114.7			544.300	123.3
	680.300	113.5			680.300	124.5
	816.400	117.1			816.400	124.6
	952.500	111.8			952.500	NE
	1080.600	116.1			1080.600	NE
	1224.600	125.0			1224.600	NE
	1360.700	126.3			1360.700	NE

TF HIGH POWER	EF	dB below carrier		TF LOW POWER	EF	dB below carrier
155	155.000	0.0		155	155.000	0.0
	310.100	101.4			310.100	94.5
	465.200	92.6			465.200	99.0
	620.300	122.2			620.300	119.7
	775.300	106.7			775.300	101.8
	930.400	115.2			930.400	124.7
	1085.500	112.2			1085.500	NE
	1240.600	114.1			1240.600	NE
	1395.600	124.4			1395.600	NE
	1550.700	127.7			1550.700	NE

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc


TF HIGH POWER	EF	dB below carrier		TF LOW POWER	EF	dB below carrier
173.9	173.900	0.0		173.9	173.900	0.0
	347.900	108.0			347.900	102.8
	521.900	92.4			521.900	97.8
	695.900	117.2			695.900	114.8
	869.800	106.7			869.800	111.9
	1043.800	122.6			1043.800	118.6
	1217.800	116.7			1217.800	NE
	1391.800	125.2			1391.800	NE
	1565.700	121.6			1565.700	NE
	1739.700	127.4			1739.700	NE

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

Method of Measuring Conducted Spurious Emissions

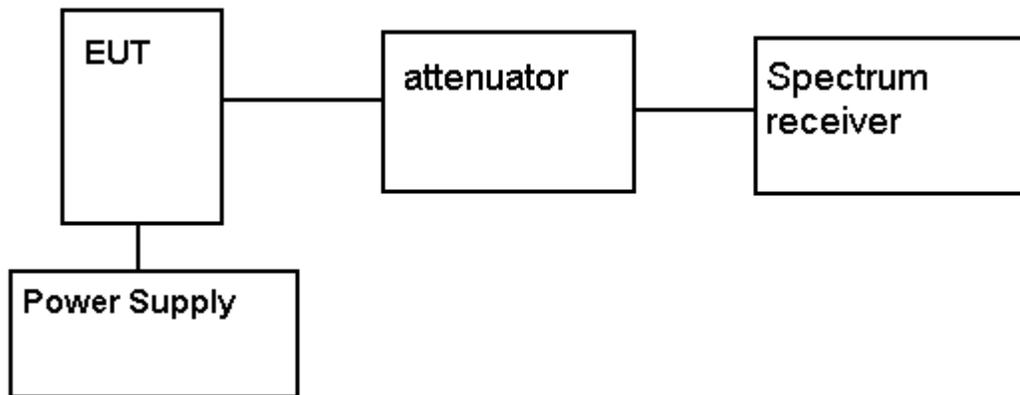


FIELD STRENGTH OF SPURIOUS EMISSIONS

Rule Parts. No.: Part 2.1053

Requirements: 25kHz Channel Spacing = $43+10\log(110) = 63.4$ dBc
 $43+10\log(10) = 53.0$ dBc
 12.5kHz Channel Spacing = $50+10\log(110) = 70.4$ dBc
 $50+10\log(10) = 60.0$ dBc

METHOD OF MEASUREMENT: The tabulated data shows the results of the radiated field strength emissions test. The spectrum was scanned from 30 MHz to at least the tenth harmonic of the fundamental. This test was conducted per ANSI/TIA 603-C: 2004 using the substitution method. Measurements were made at the test site of TIMCO ENGINEERING, INC. located at 849 NW State Road 45, Newberry, FL 32669.

Test Setup Diagram:

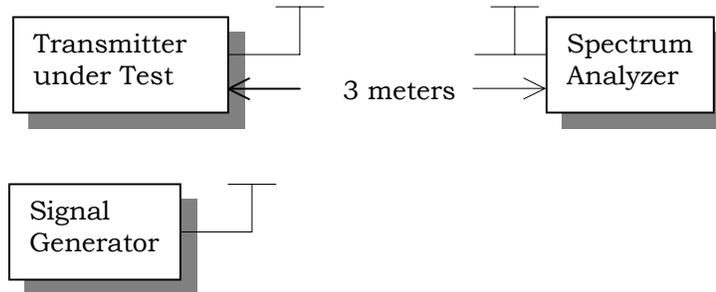

Test Data:

HIGH POWER

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)	Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)	Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
136.00	0	0	155.00	0	0	173.90	0	0
272.10	H	105.42	310.10	H	111.76	347.90	H	102.38
408.20	H	103.7	465.20	H	108.92	521.90	H	114.26
544.30	H	110.36	620.30	H	124.78	869.80	H	116.30
680.30	H	125.1	775.30	V	121.07	1217.80	V	97.89
816.40	H	122.44	1085.50	H	109.19	1391.80	V	96.72
1224.60	V	107.89	1240.60	V	99.50			
1360.70	V	96.86	1395.60	H	97.51			

RADIATED EMISSIONS TEST DATA CONTD.

LOW POWER

Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)		Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)		Emission Frequency MHz	Ant. Polarity	dB Below Carrier (dBc)
136.00	0	0		155.00	0	0		173.90	0	0
272.10	H	101.51		310.10	H	96.65		347.90	H	98.97
408.20	H	99.19		465.20	H	109.41		521.90	H	113.15
544.30	H	112.35		620.30	H	116.67		1217.80	H	98.38
1360.70	V	97.45						1391.80	H	97.01

Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

FREQUENCY STABILITY

Rule Parts. No.: Part 2.1055, Part 90.213

Requirements: Temperature range requirements: -30 to +50° C.
Voltage Variation +, -15%
±2.5 PPM

Method of Measurements: ANSI/TIA 603-C: 2004.

Test Data:

Assigned Frequency (Ref. Frequency) (MHz)		
Temperature (°C)	Frequency (MHz)	Frequency Stability (PPM)
-30	155.050203	1.10
-20	155.050179	0.94
-10	155.050146	0.73
0	155.050087	0.35
+10	155.050070	0.24
+20	155.05006	0.17
+30	155.050013	-0.13
+40	155.049986	-0.30
+50	155.049971	-0.40

Assigned Frequency (Ref. Frequency) (MHz)		
% Battery	Frequency (MHz)	Frequency Stability (PPM)
-15%	155.050033	0.00
0	155.050033	
+15%	155.050033	0.00

FREQUENCY STABILITY

Part 90.214 Transient Frequency Behavior

REQUIREMENTS: Transmitters designed to operate in the 150-174 MHz and 421-512 MHz frequency bands must maintain transient frequencies within the maximum transient frequencies within the maximum frequency difference limits during the time intervals indicated:

Time Intervals	Maximum frequency difference	All Equipment	
		150-174 MHz	421-512 MHz

Transient Frequency Behavior for Equipment Designed to Operate on 25 kHz Channels

t_1^4	± 25.0 kHz	5.0 ms	10.0 ms
t_2	± 12.5 kHz	20.0 ms	25.0 ms
t_3^4	± 25.0 kHz	5.0 ms	10.0 ms

Transient Frequency Behavior for Equipment Designed to Operate on 12.5 kHz Channels


t_1^4	± 12.5 kHz	5.0 ms	10.0 ms
t_2	± 6.25 kHz	20.0 ms	25.0 ms
t_3^4	± 12.5 kHz	5.0 ms	10.0 ms


Transient Frequency Behavior for Equipment Designed to Operate on 6.25 kHz Channels

t_1^4	± 6.25 kHz	5.0 ms	10.0 ms
t_2	± 3.125 kHz	20.0 ms	25.0 ms
t_3^4	± 6.25 kHz	5.0 ms	10.0 ms


TEST PROCEEDURE: ANSI/TIA 603-C:2004, the levels were set as follows:

1. Using the variable attenuator the transmitter level was set to 40 dB below the test receivers maximum input level, then the transmitter was turned off.
2. With the transmitter off the signal generator was set 20dB below the level of the transmitter in the above step, this level will be maintained with the signal generator through-out the test.
3. Reduce the attenuation between the transmitter and the RF detector by 30 dB.
4. With the levels set as above, the transient frequency behavior was observed and recorded.

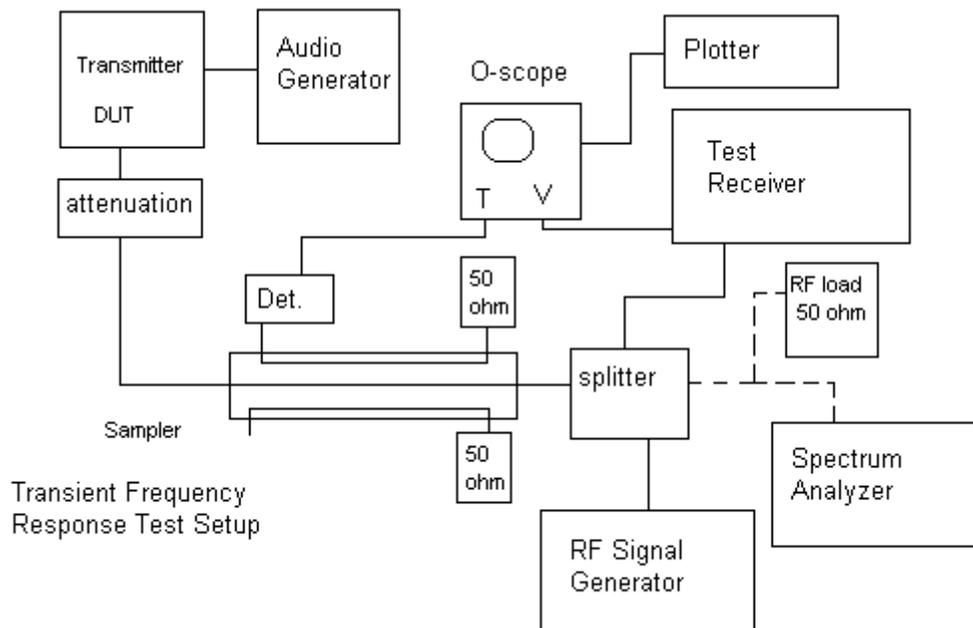

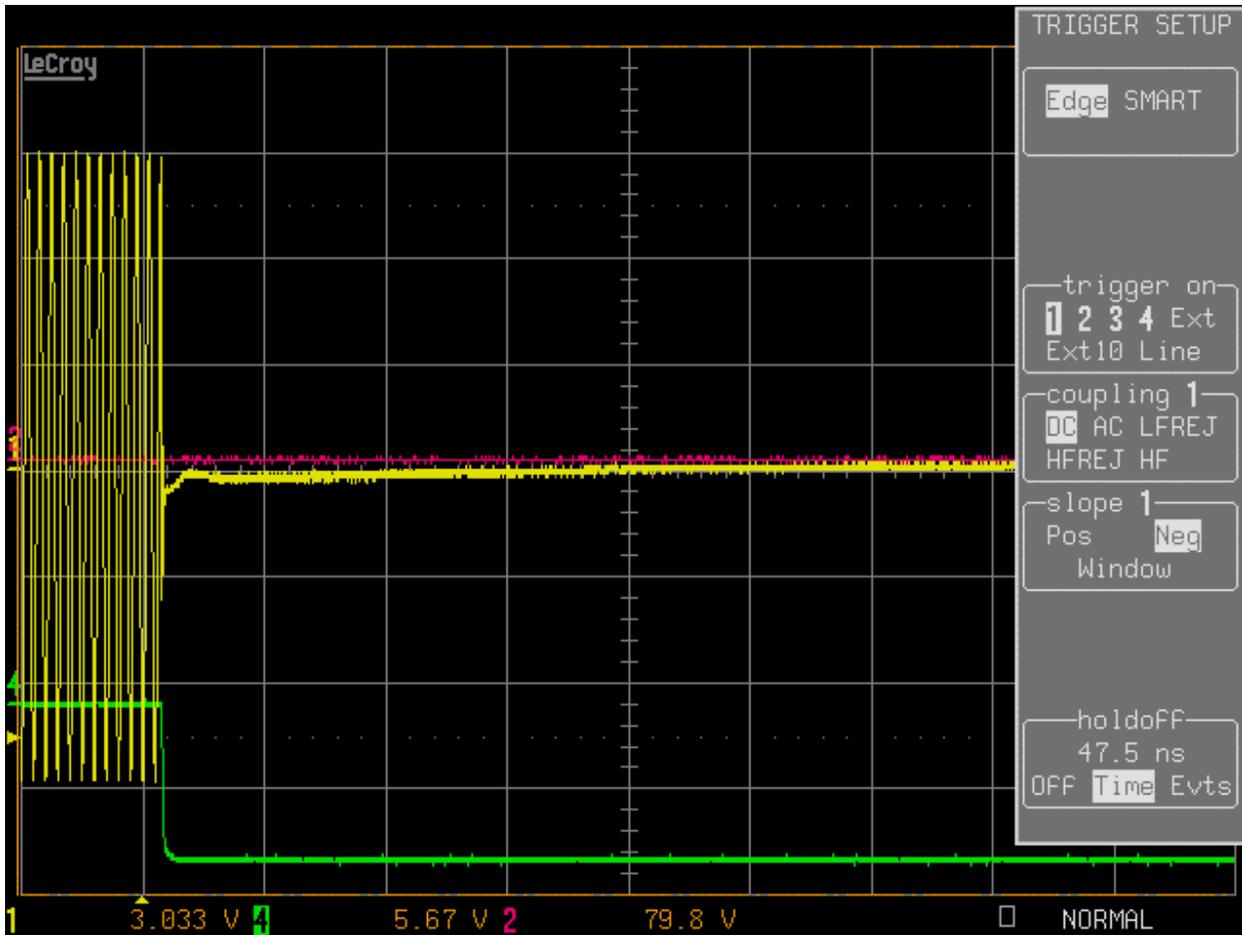

12.5 kHz ON

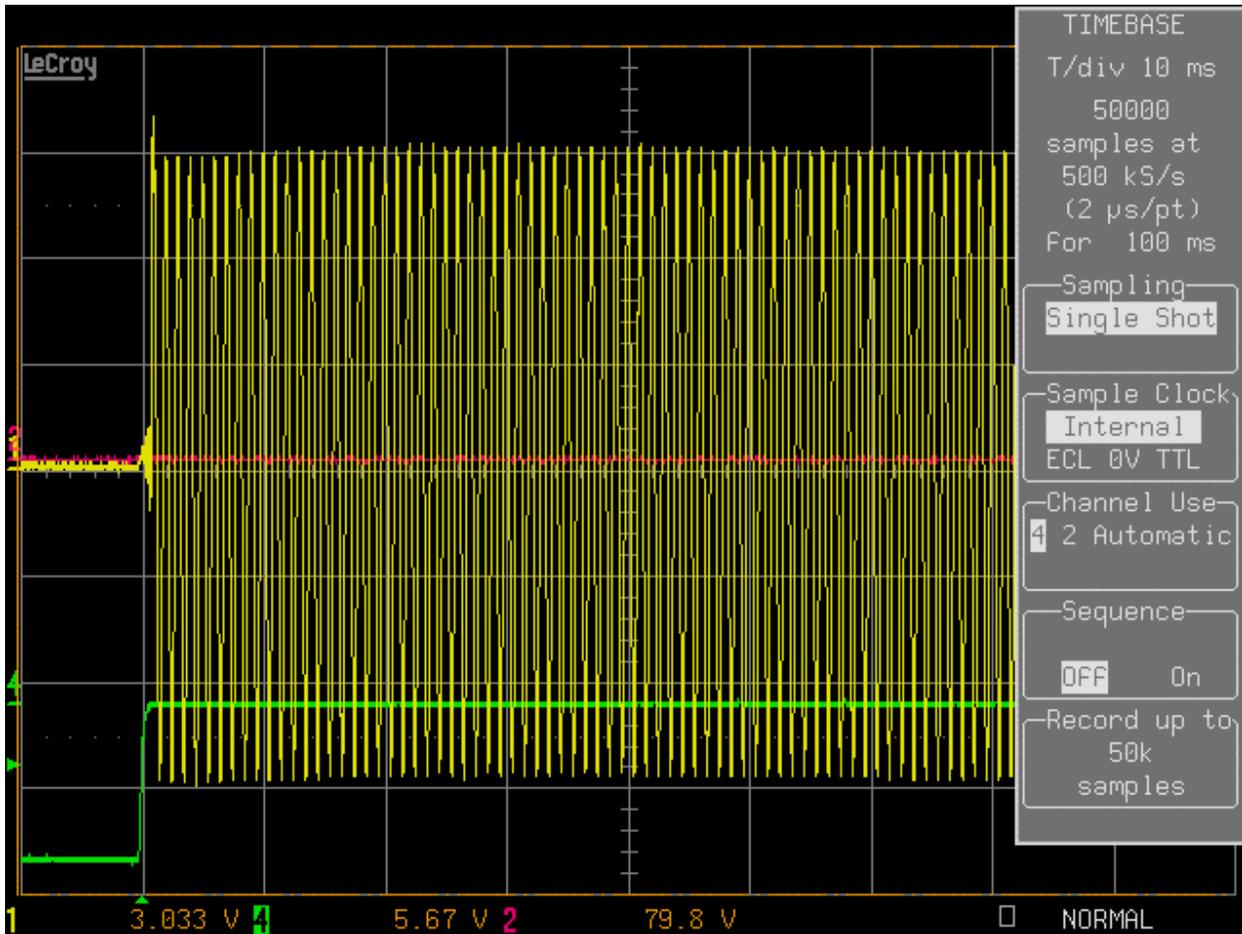


12.5 kHz OFF


Applicant: MIDLAND RADIO CORP.

FCC ID: MMA901115

Report: X:\M\MidlandRadio_MMA\1882UT8\1882UT8TestReport.doc

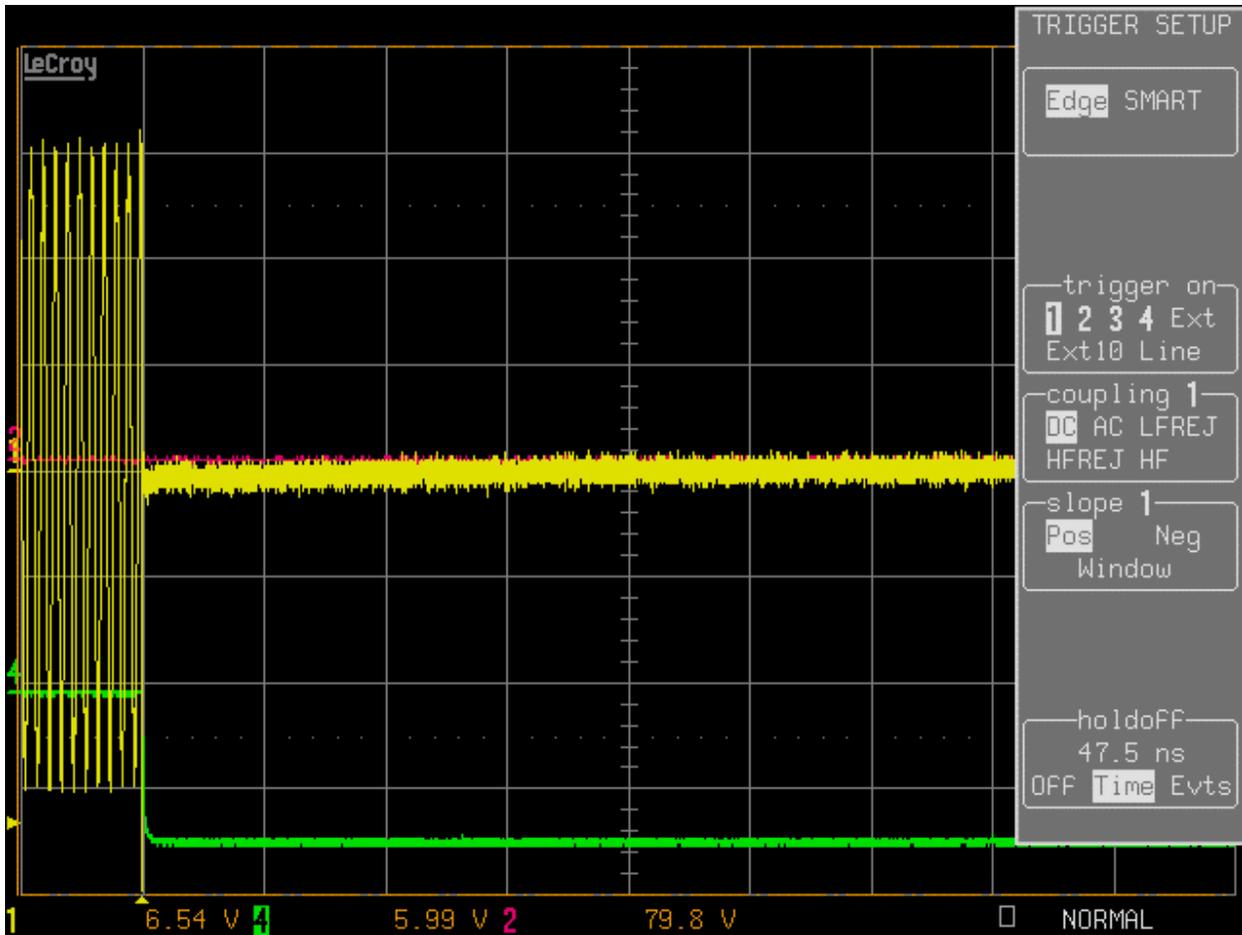

25 kHz ON

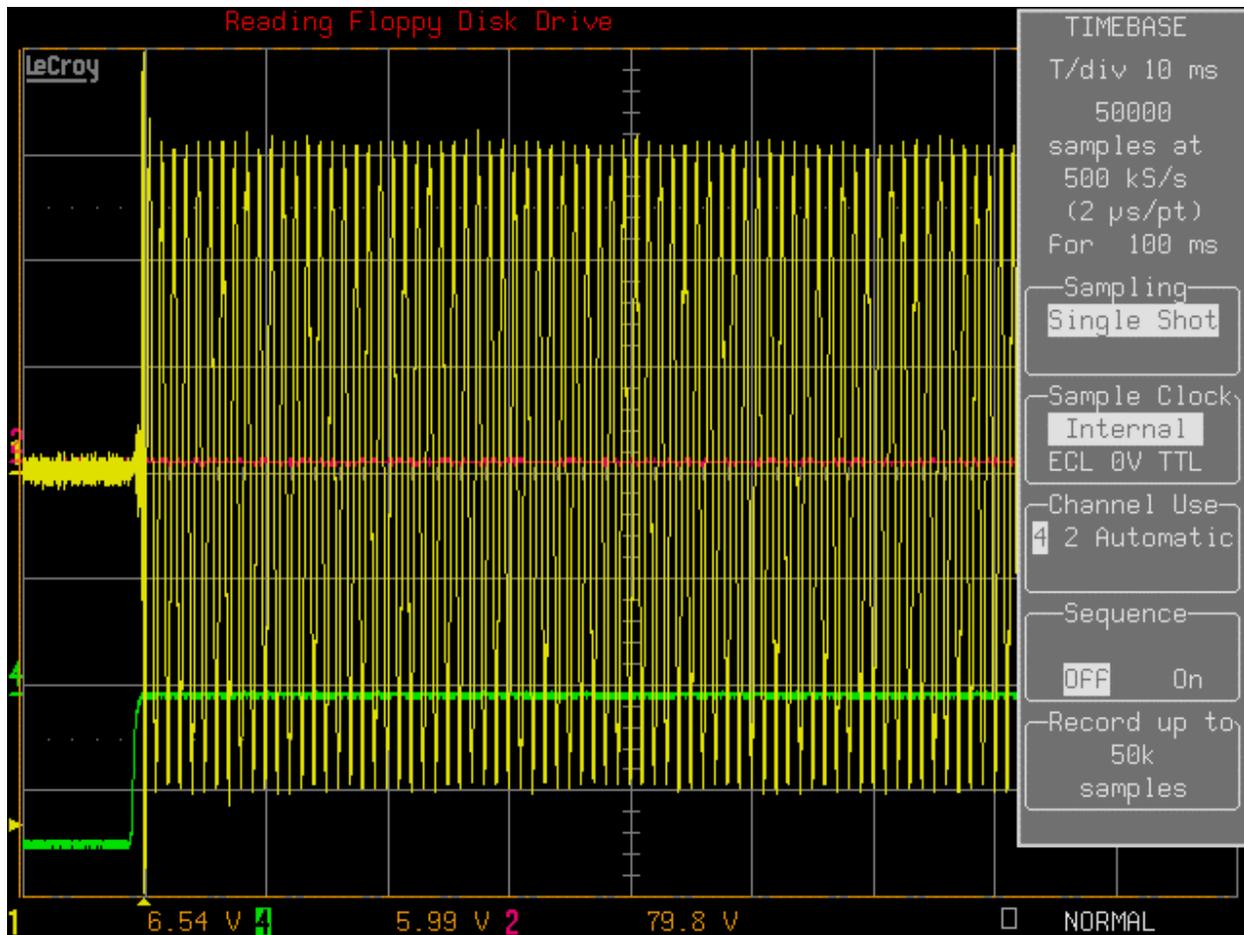

25 kHz OFF