






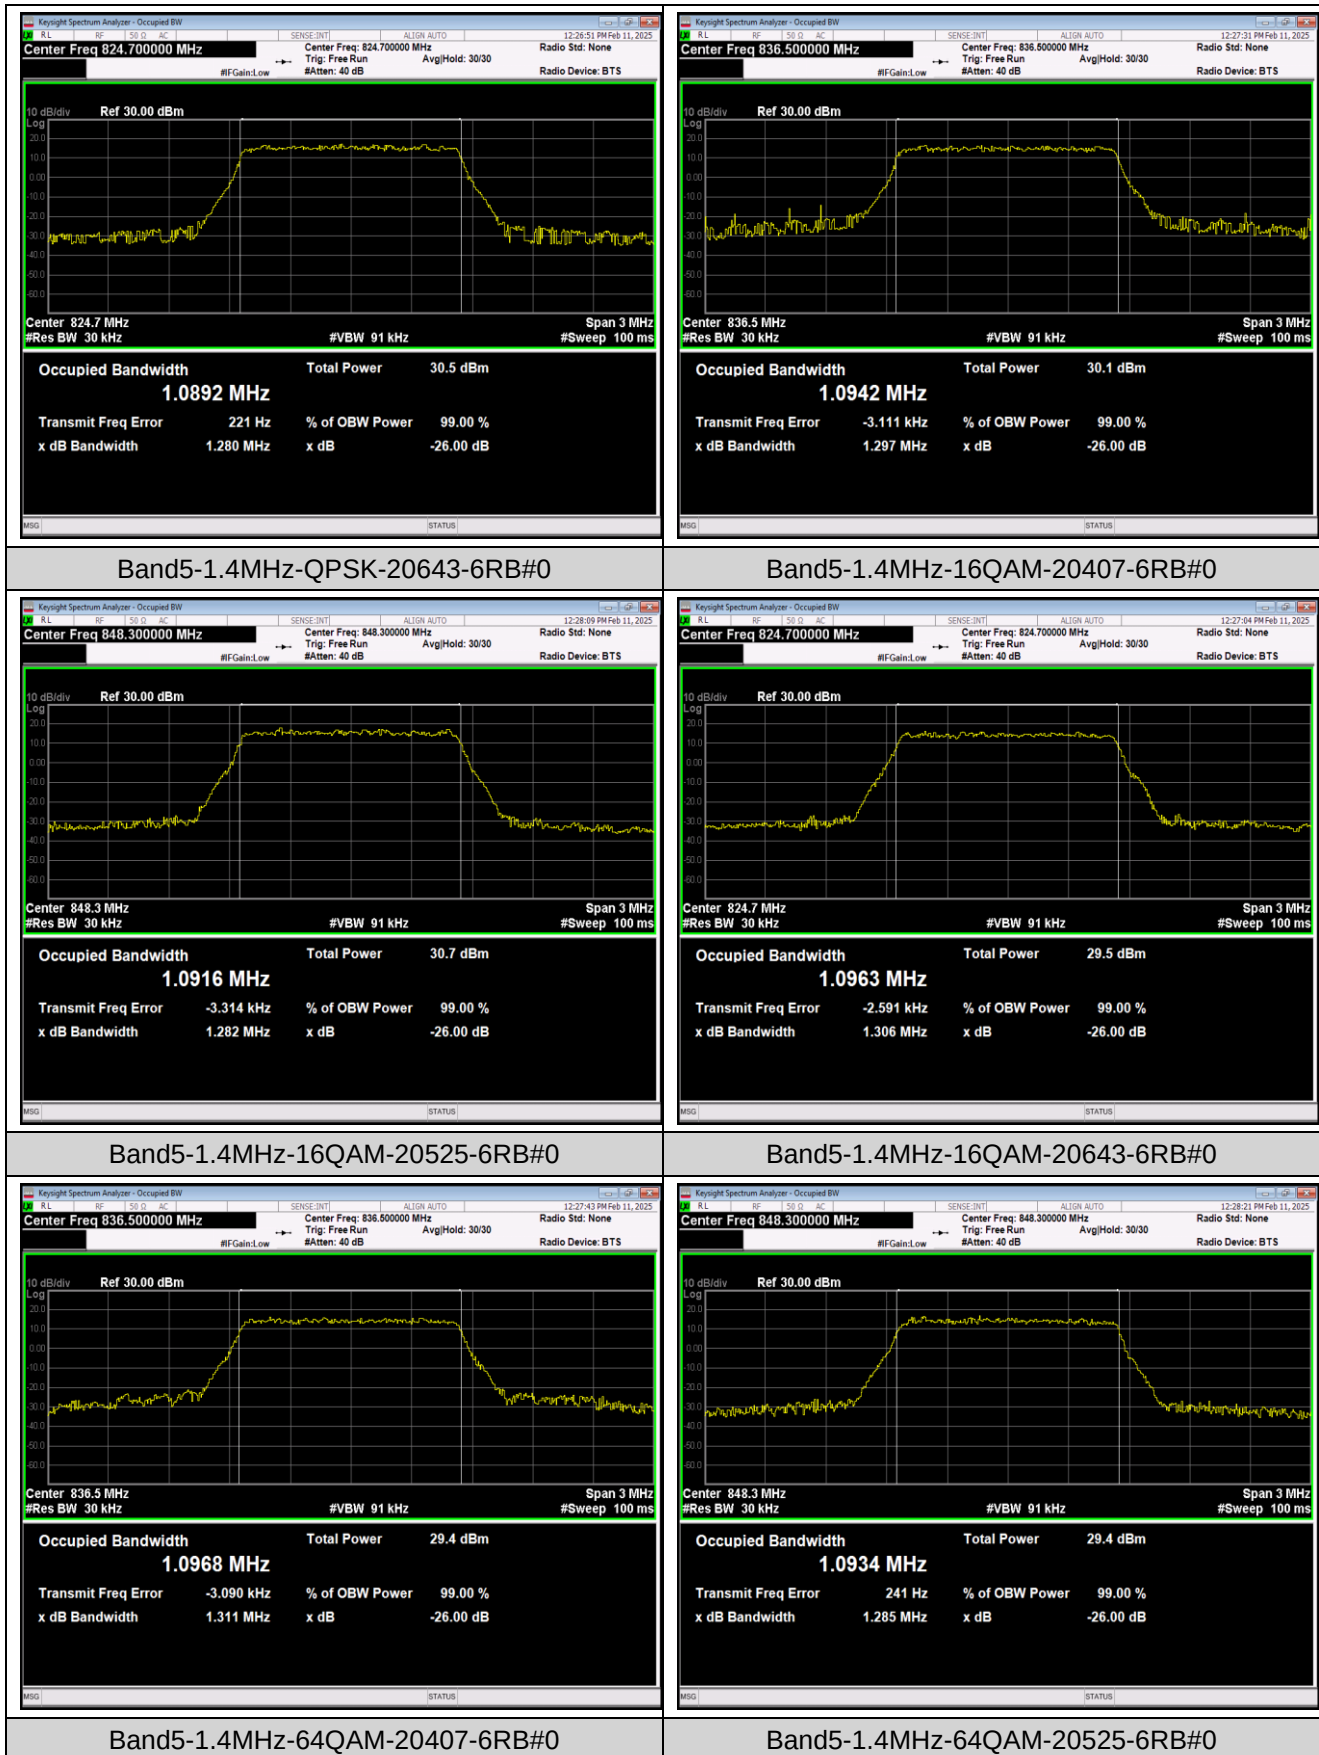


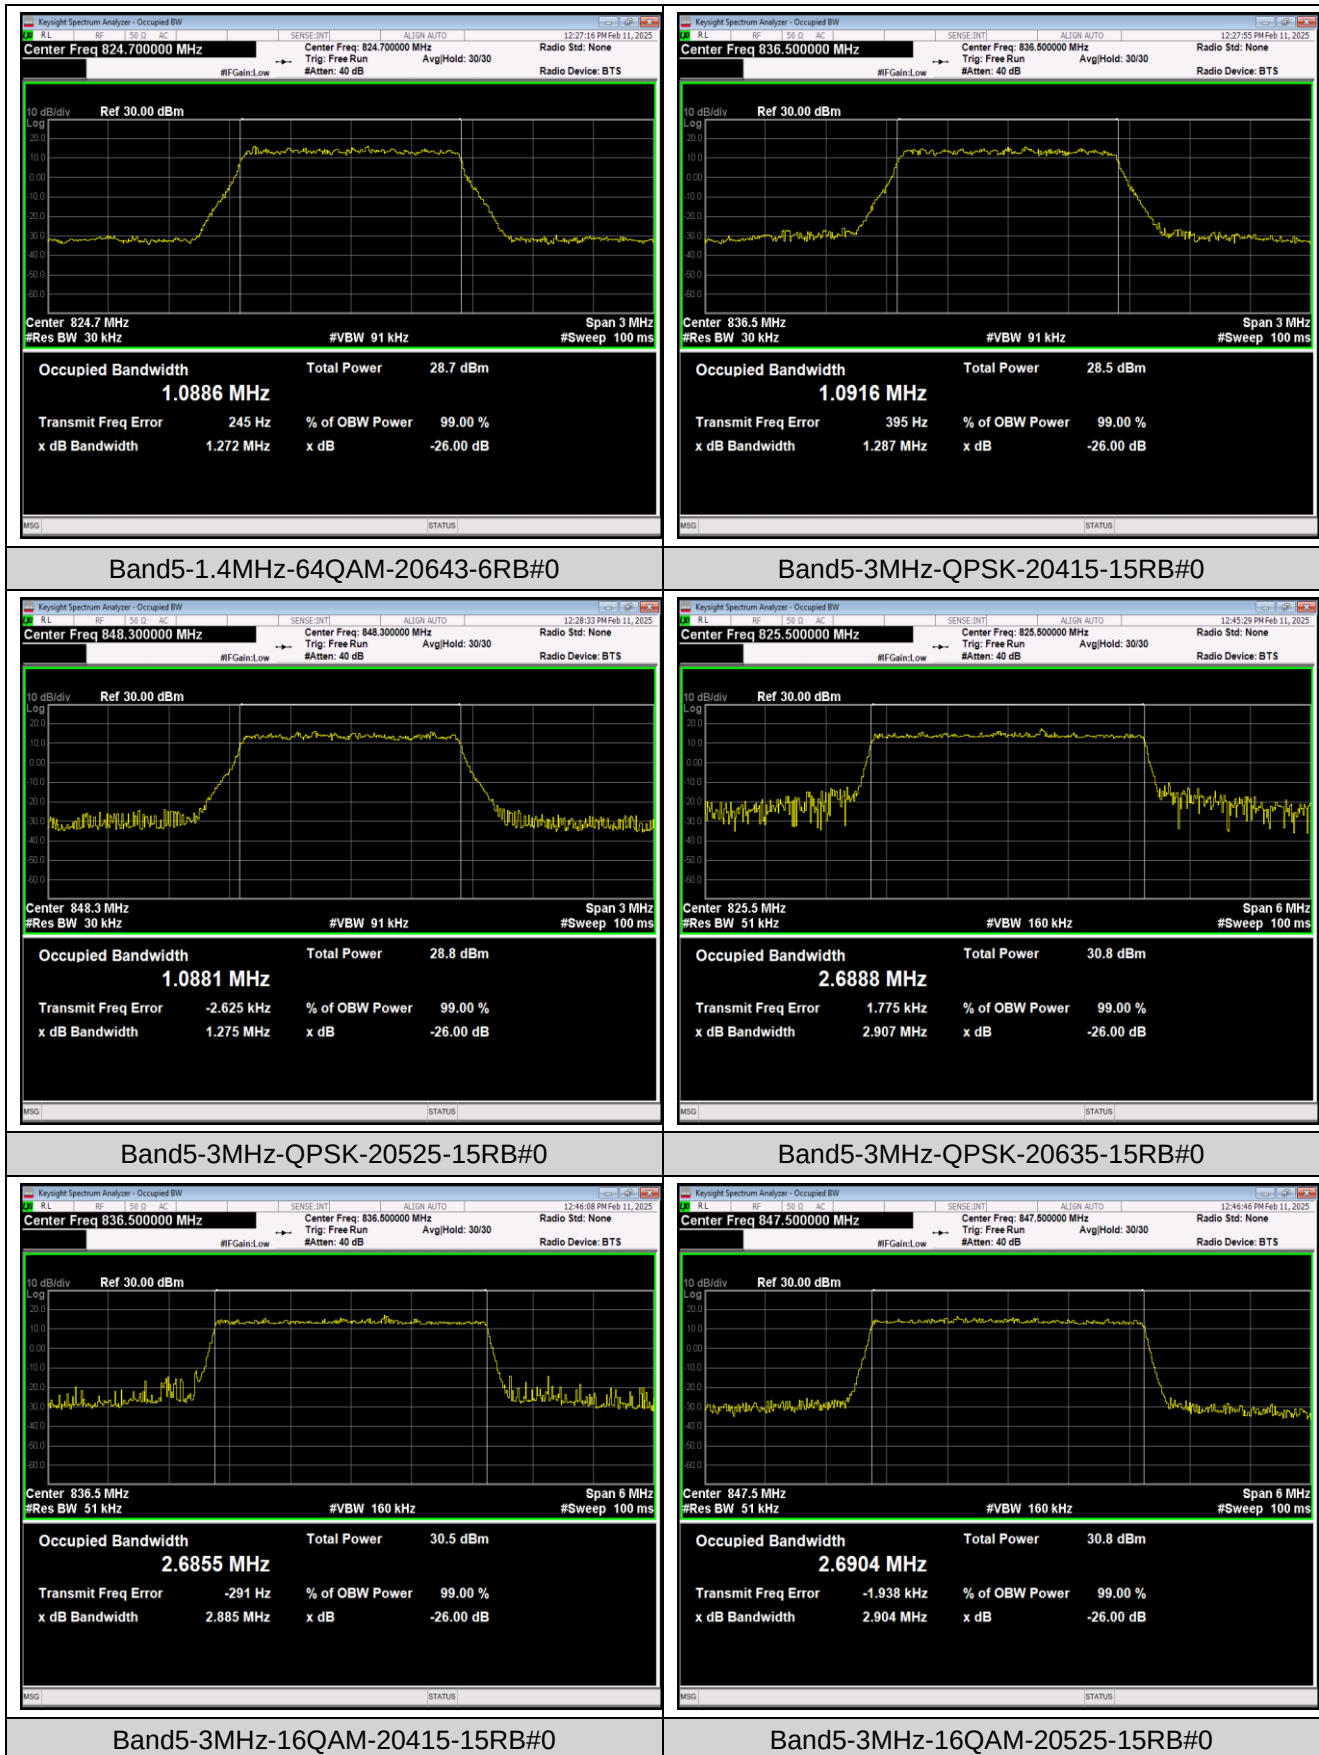


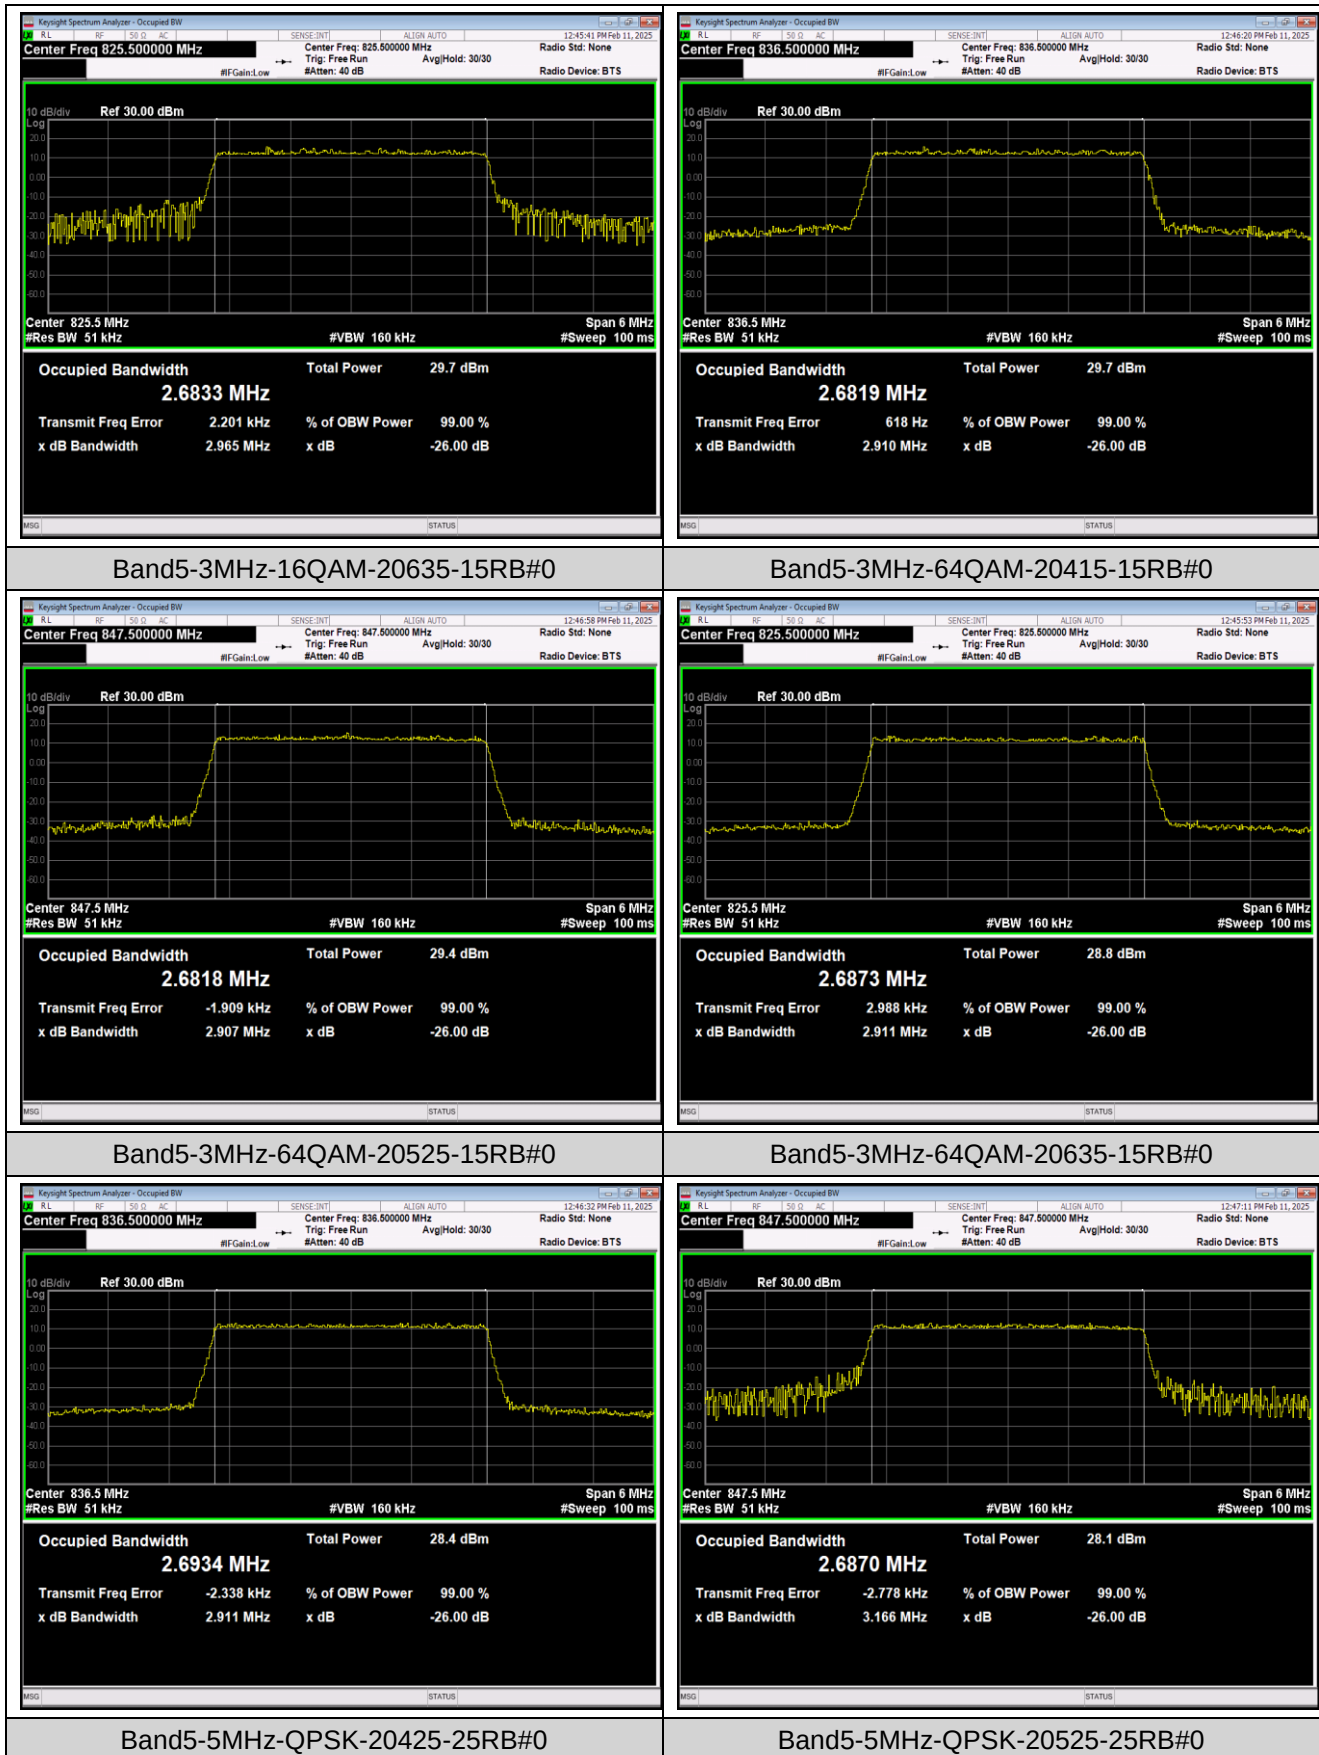


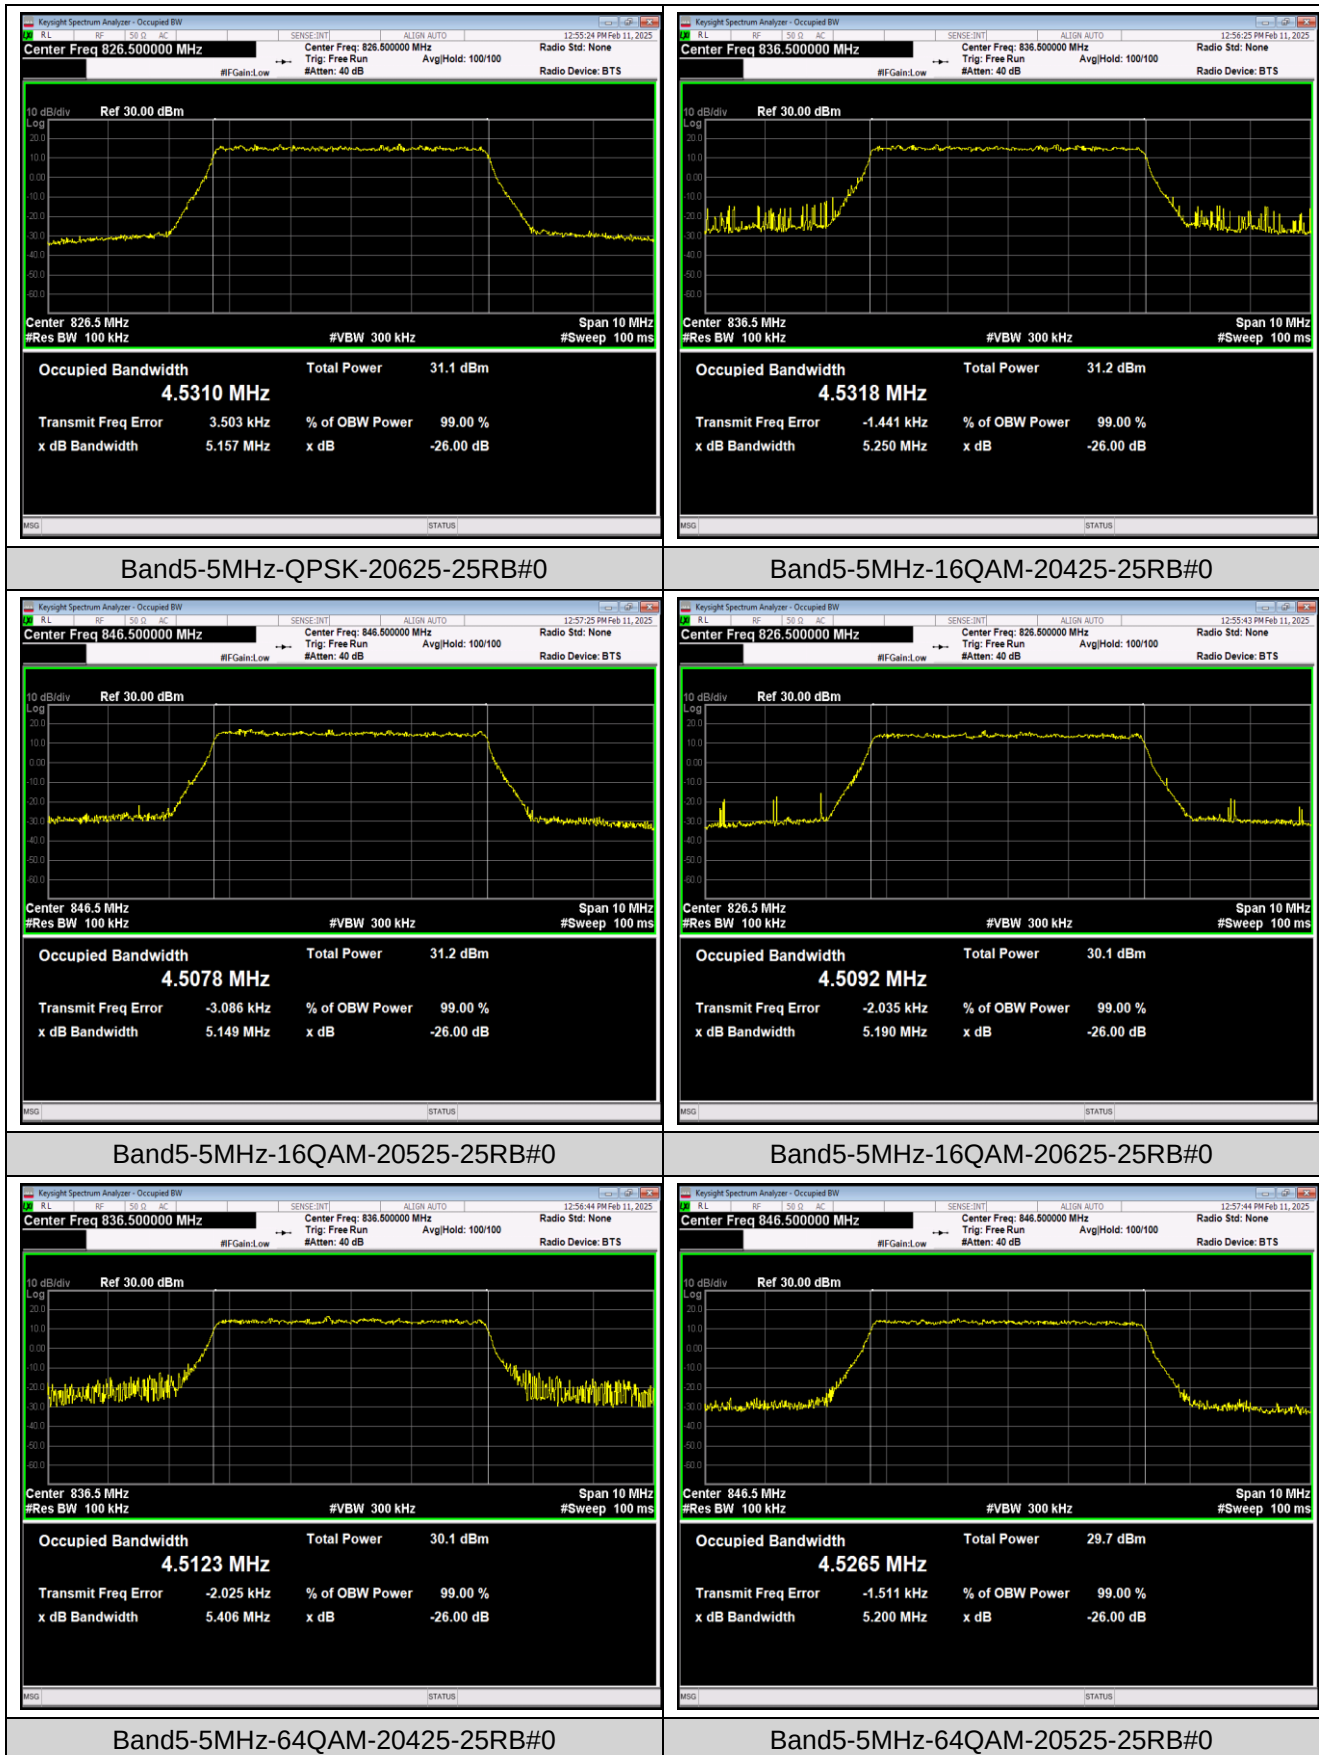


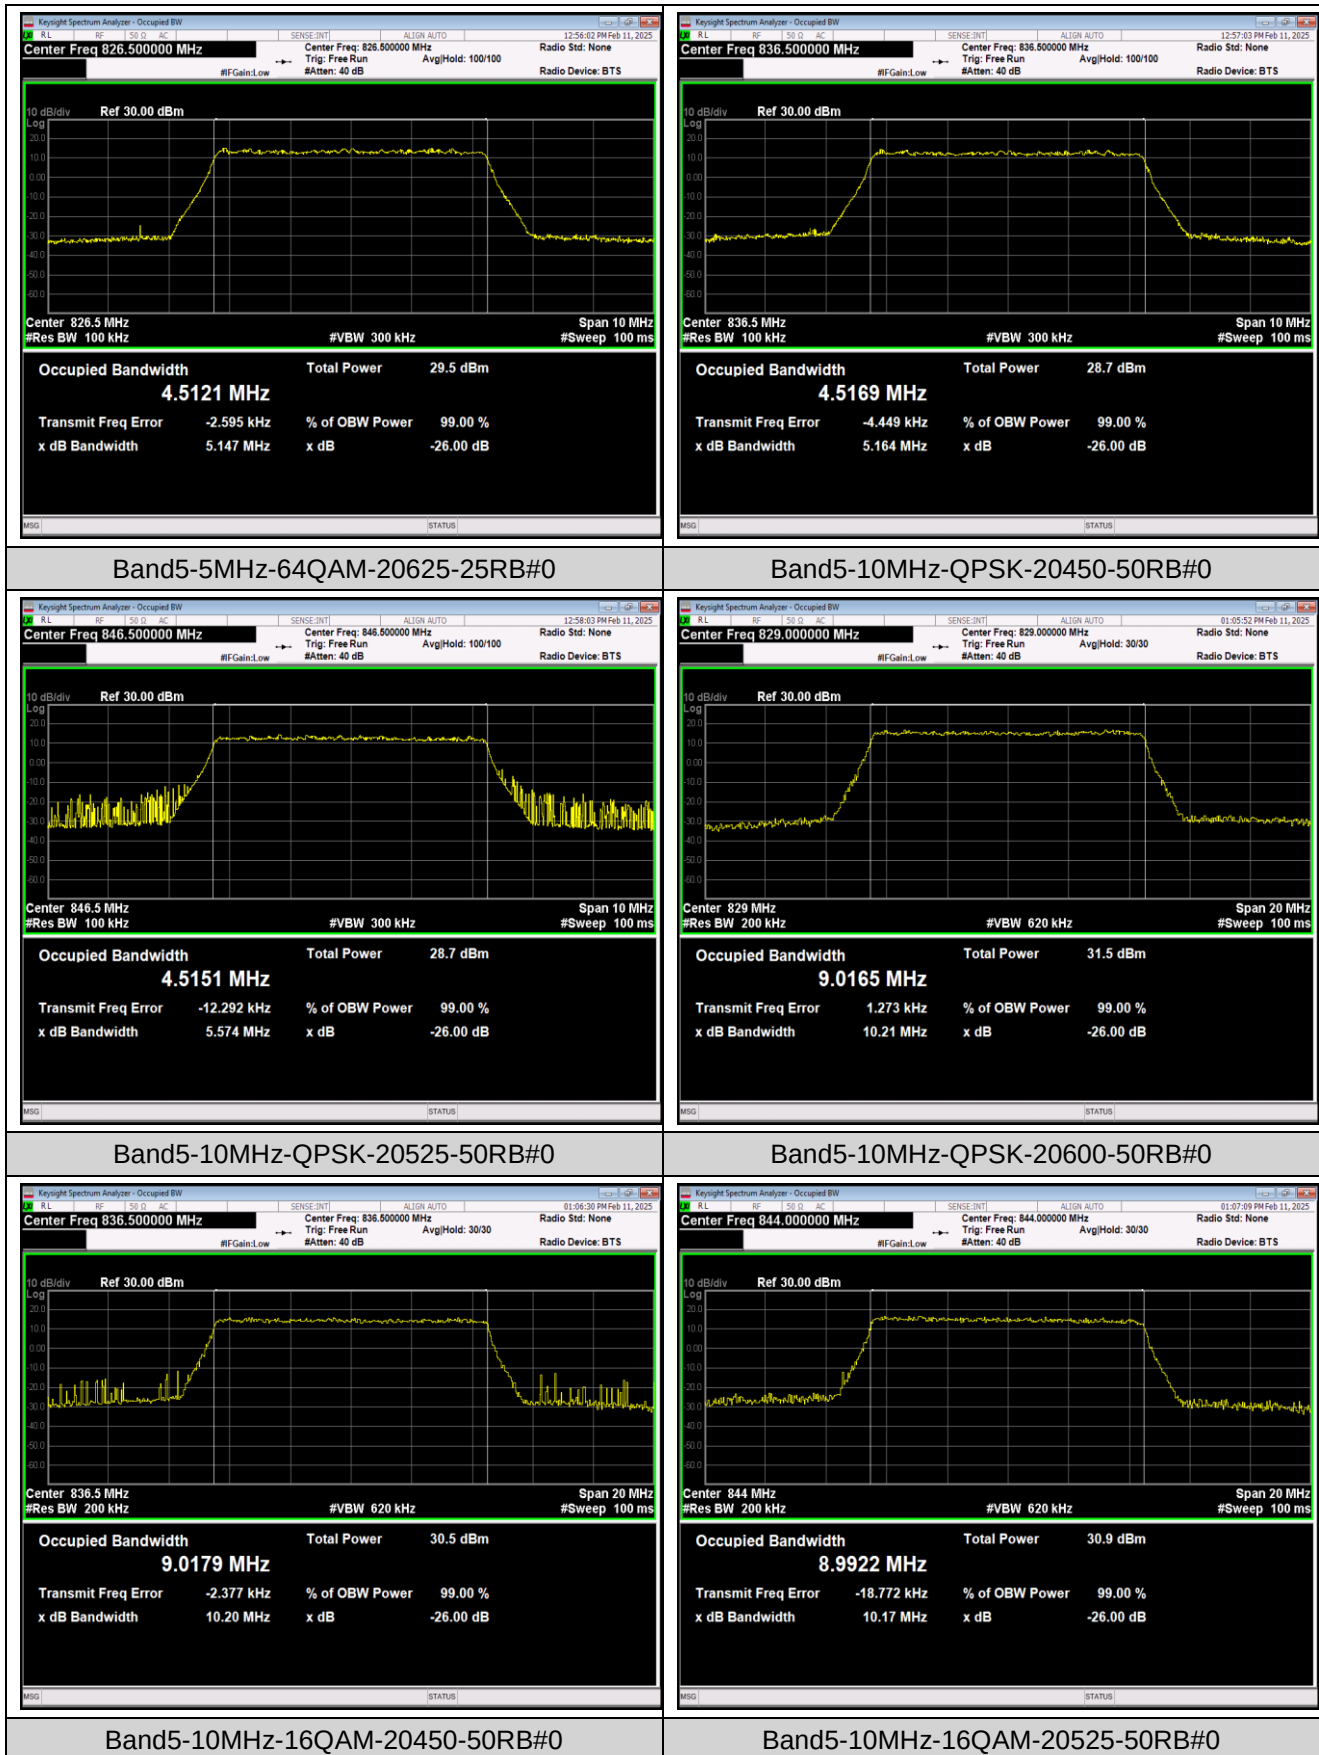


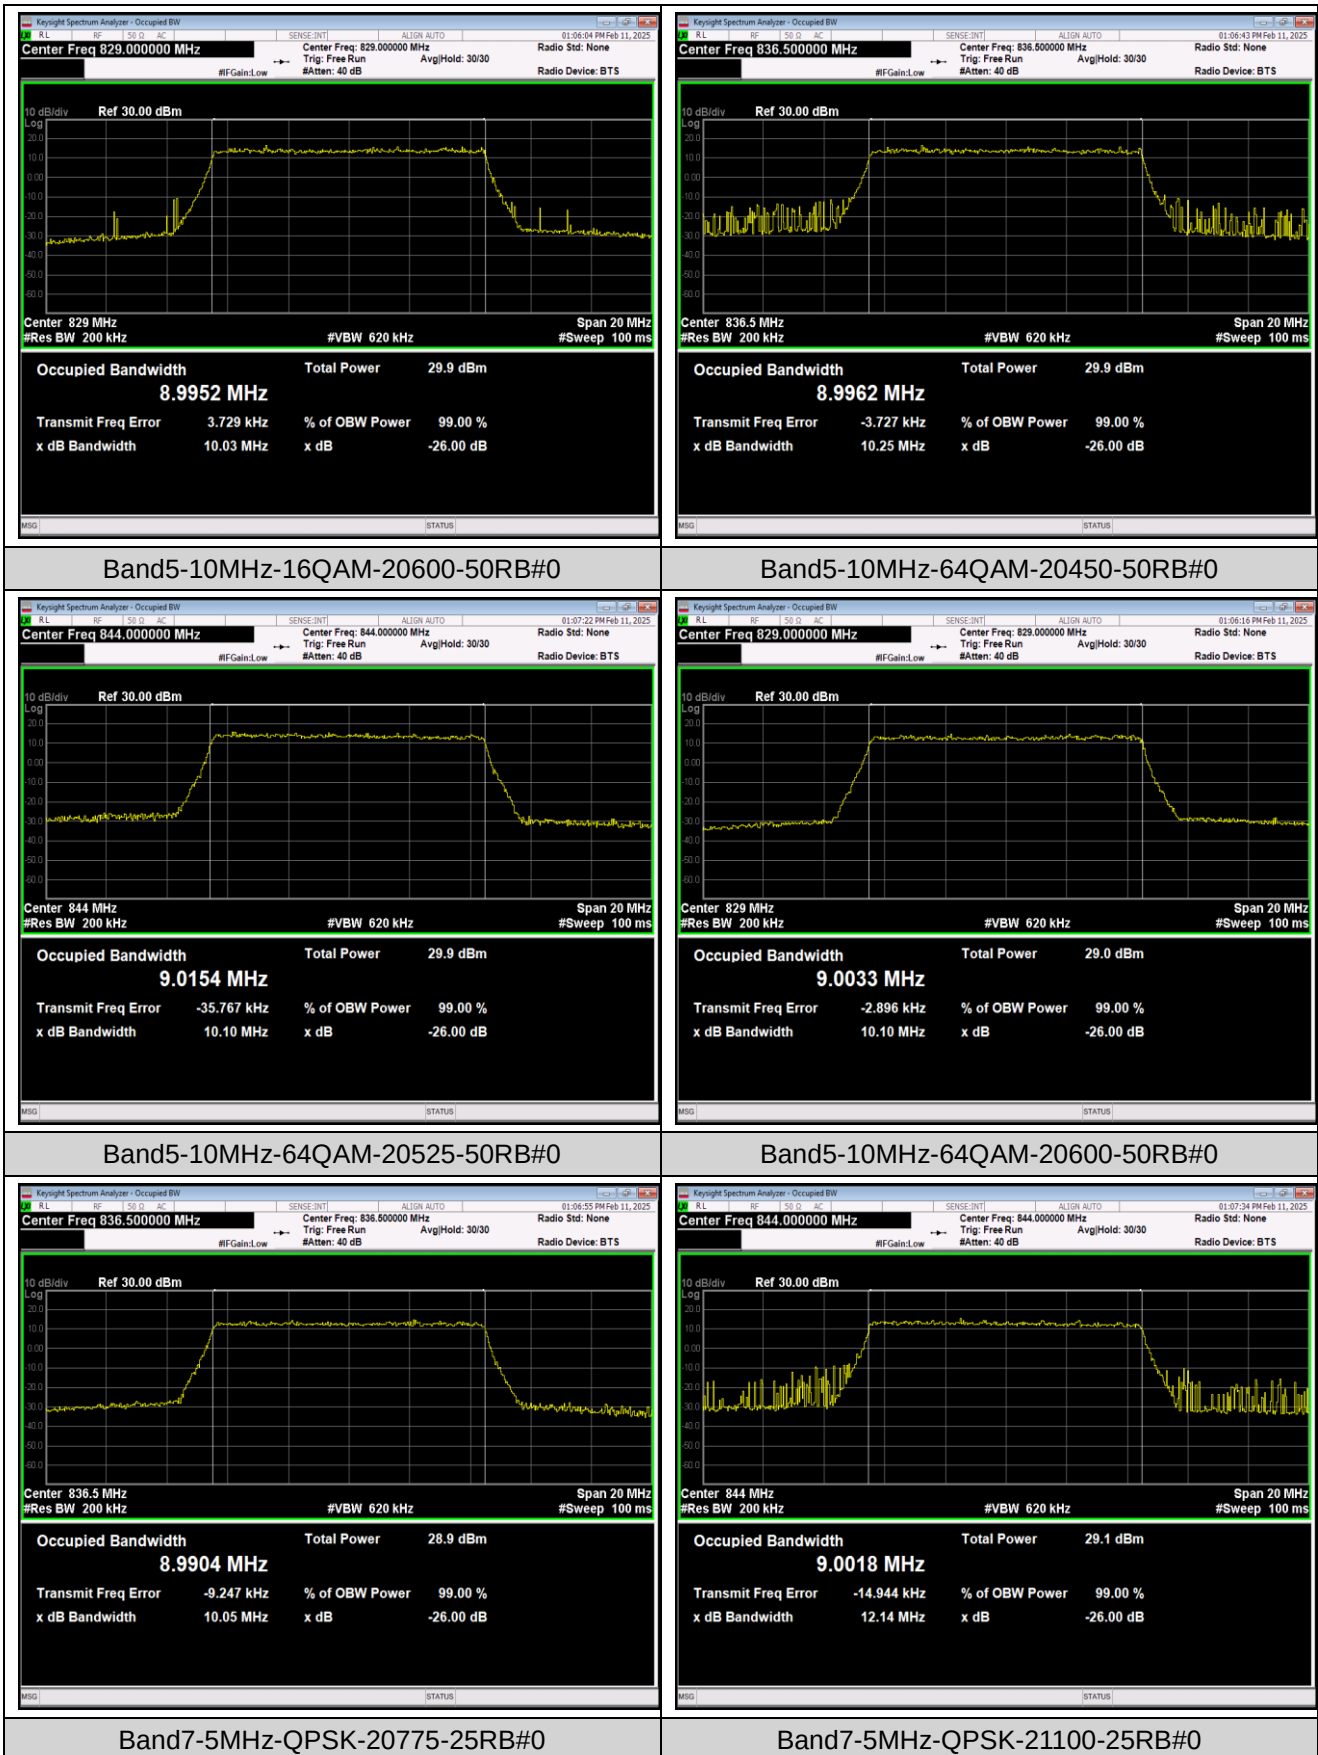


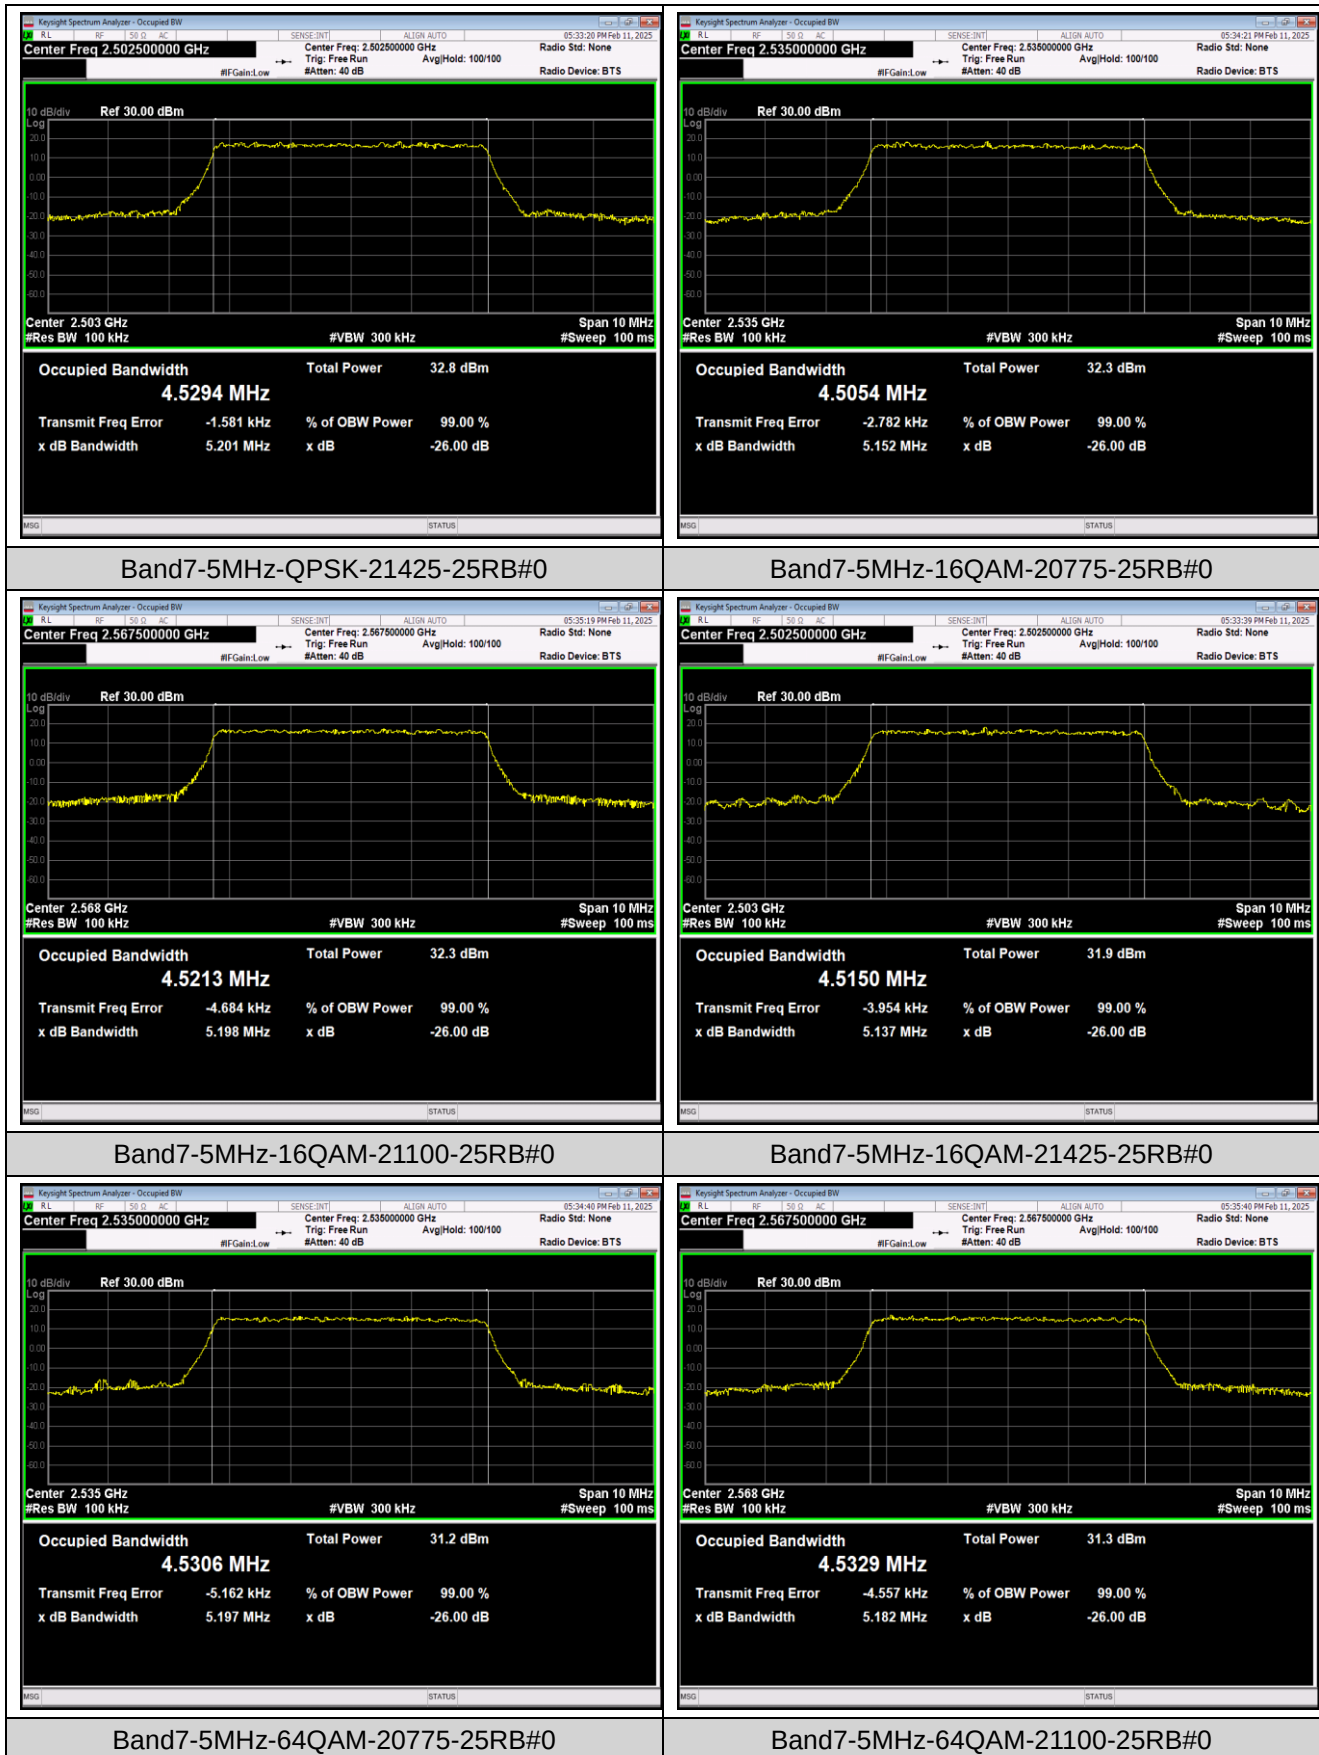

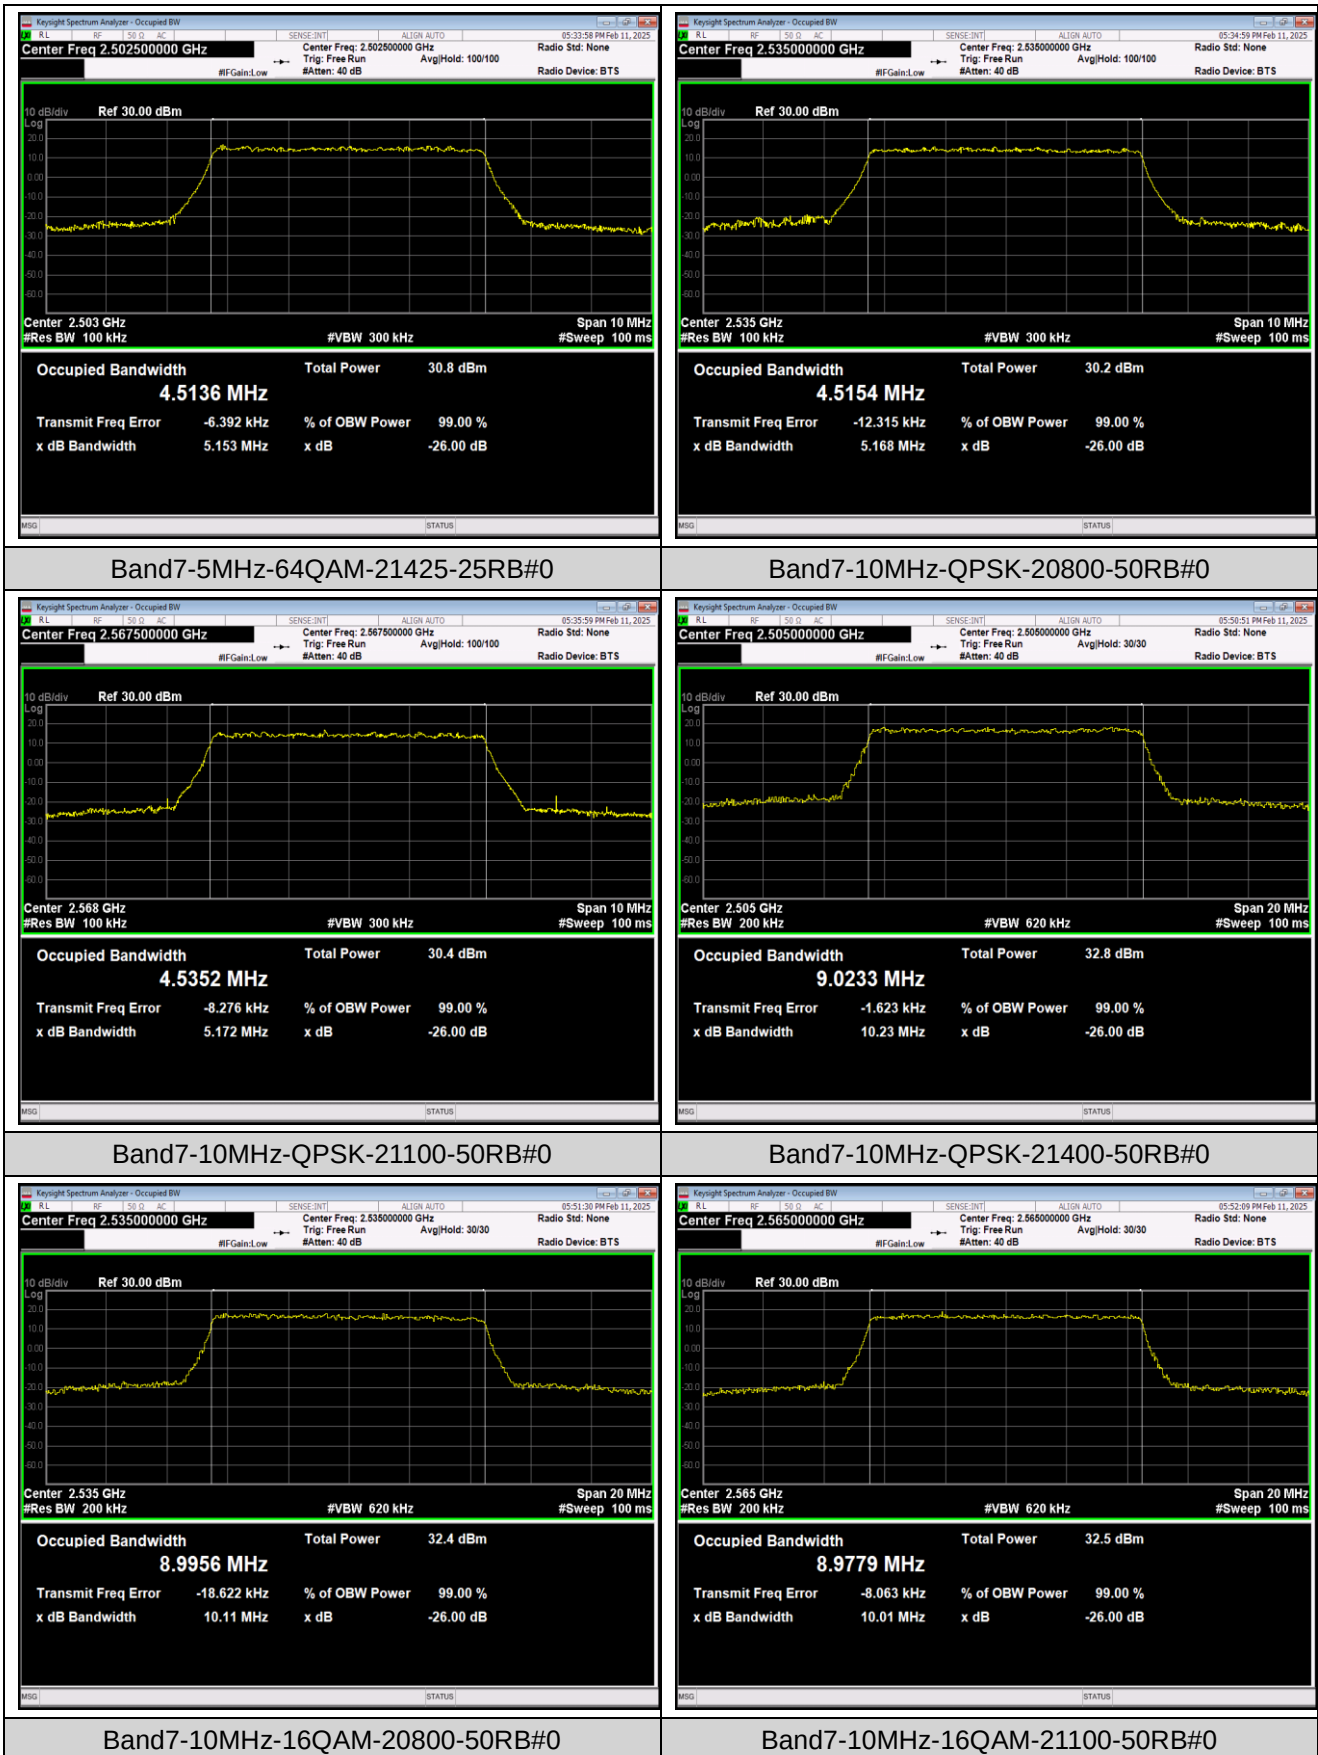

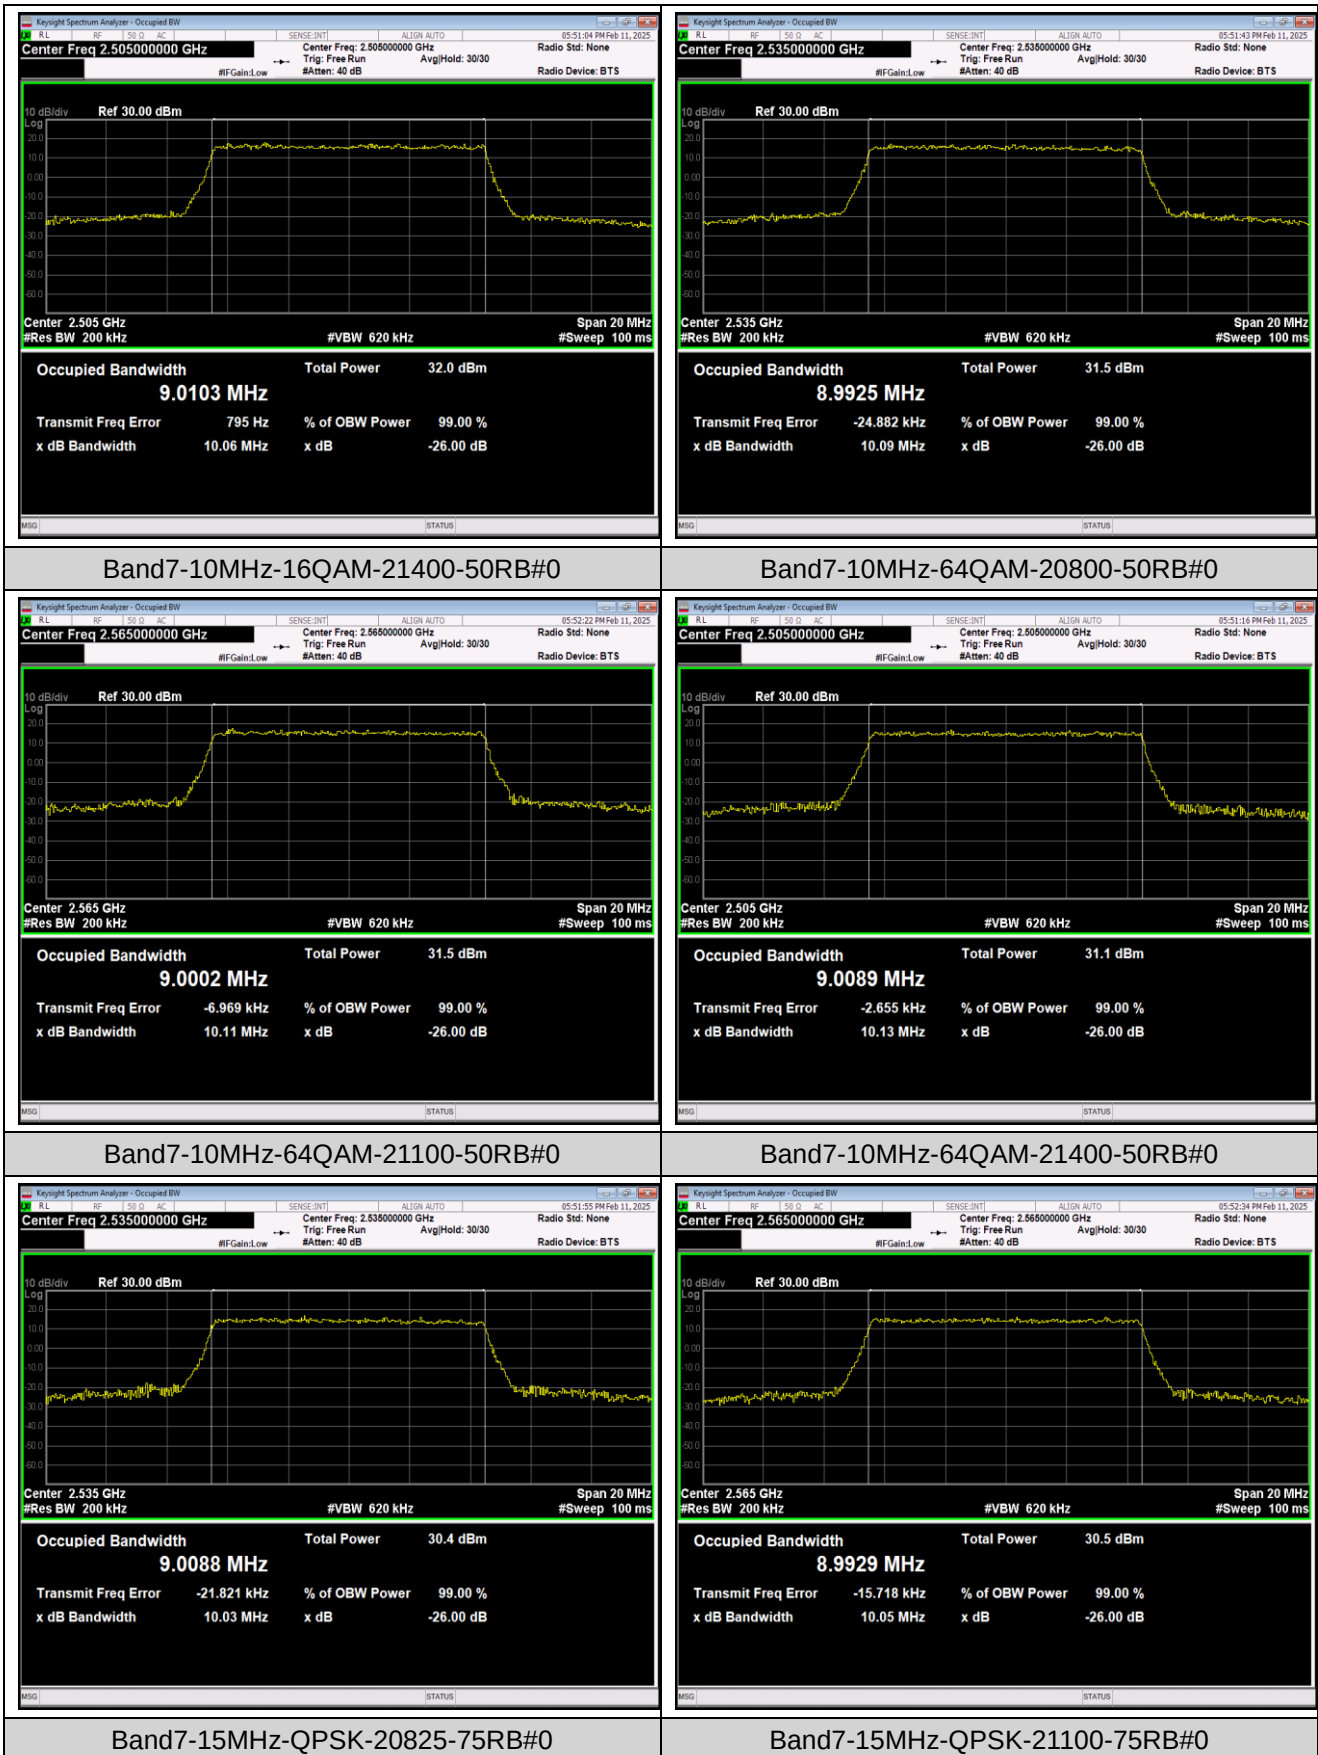

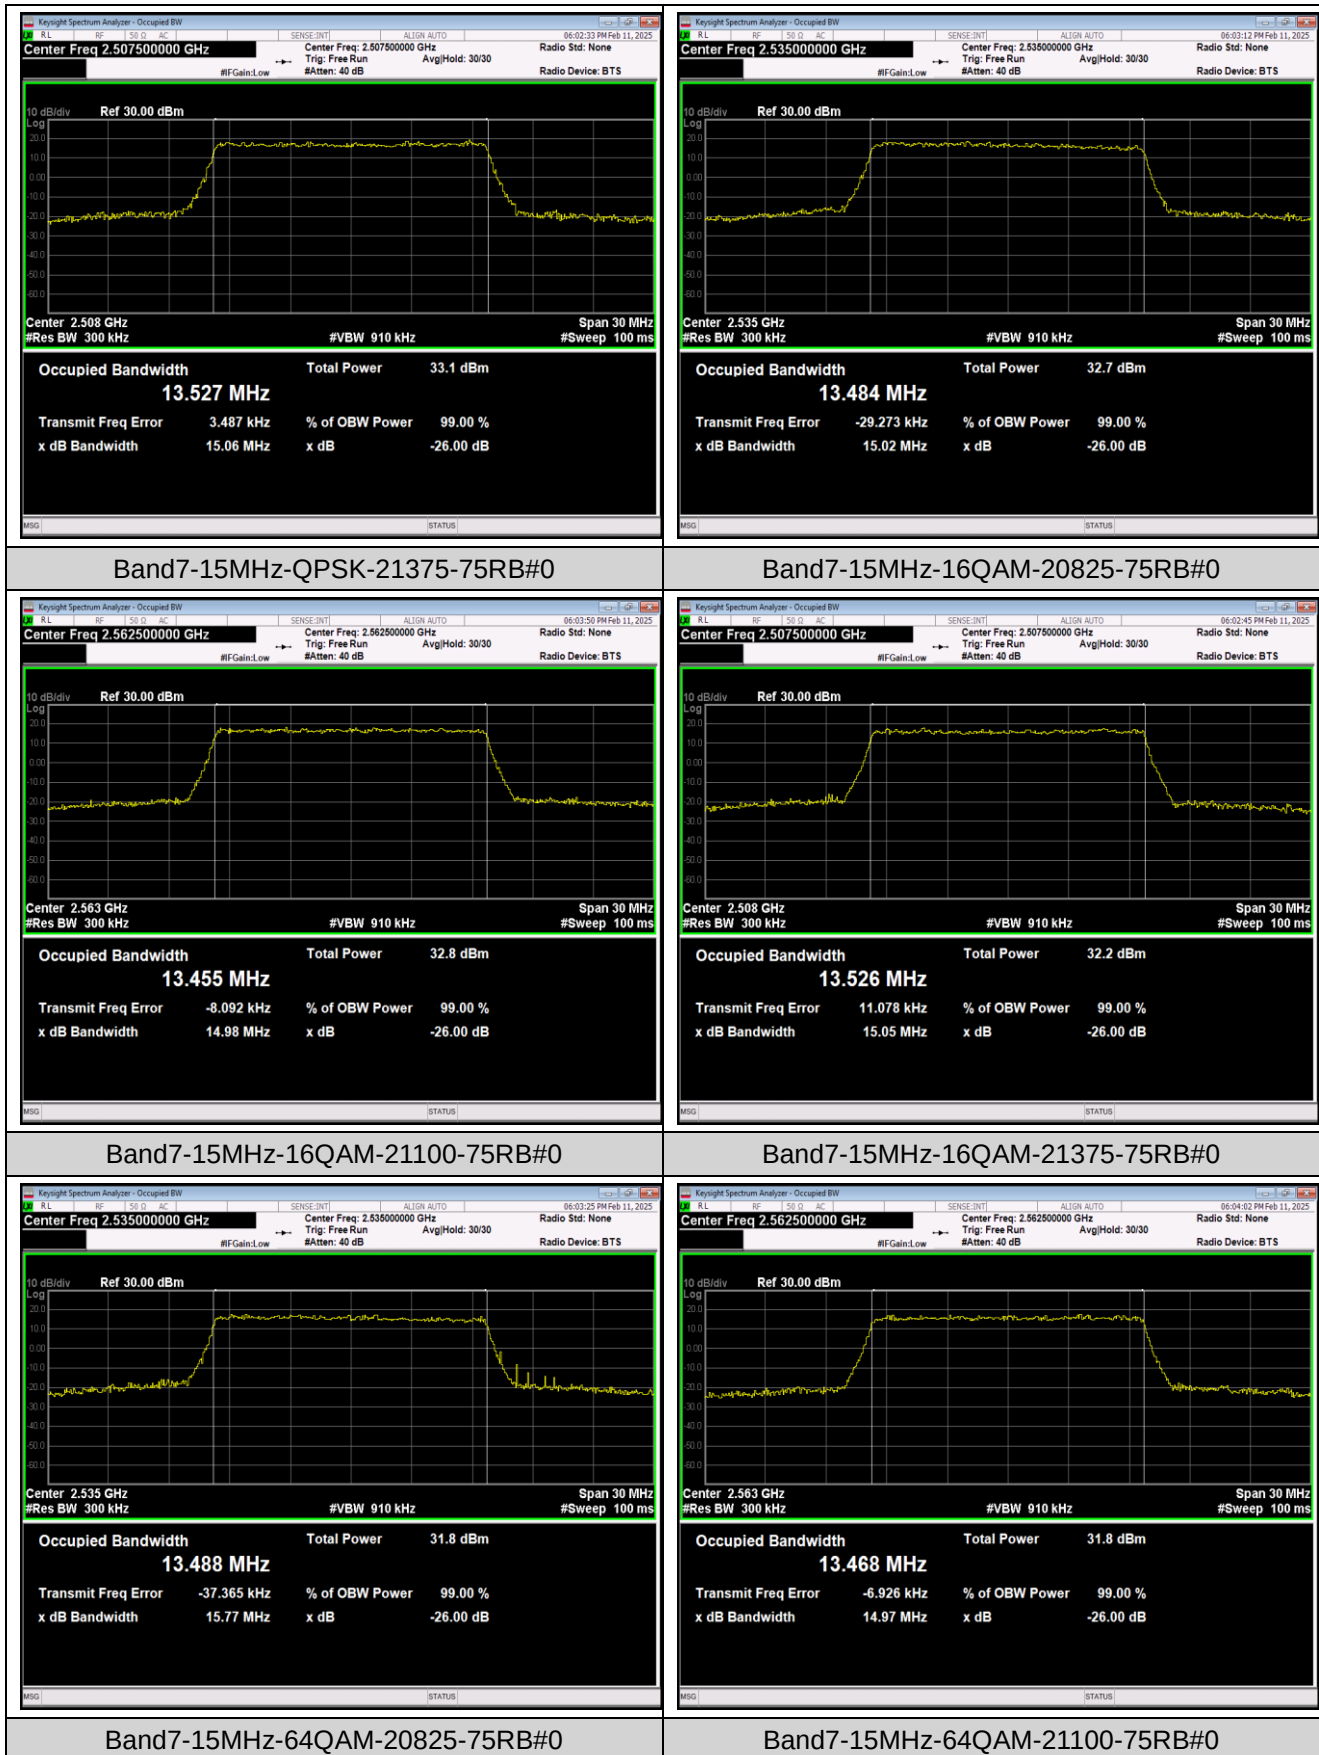

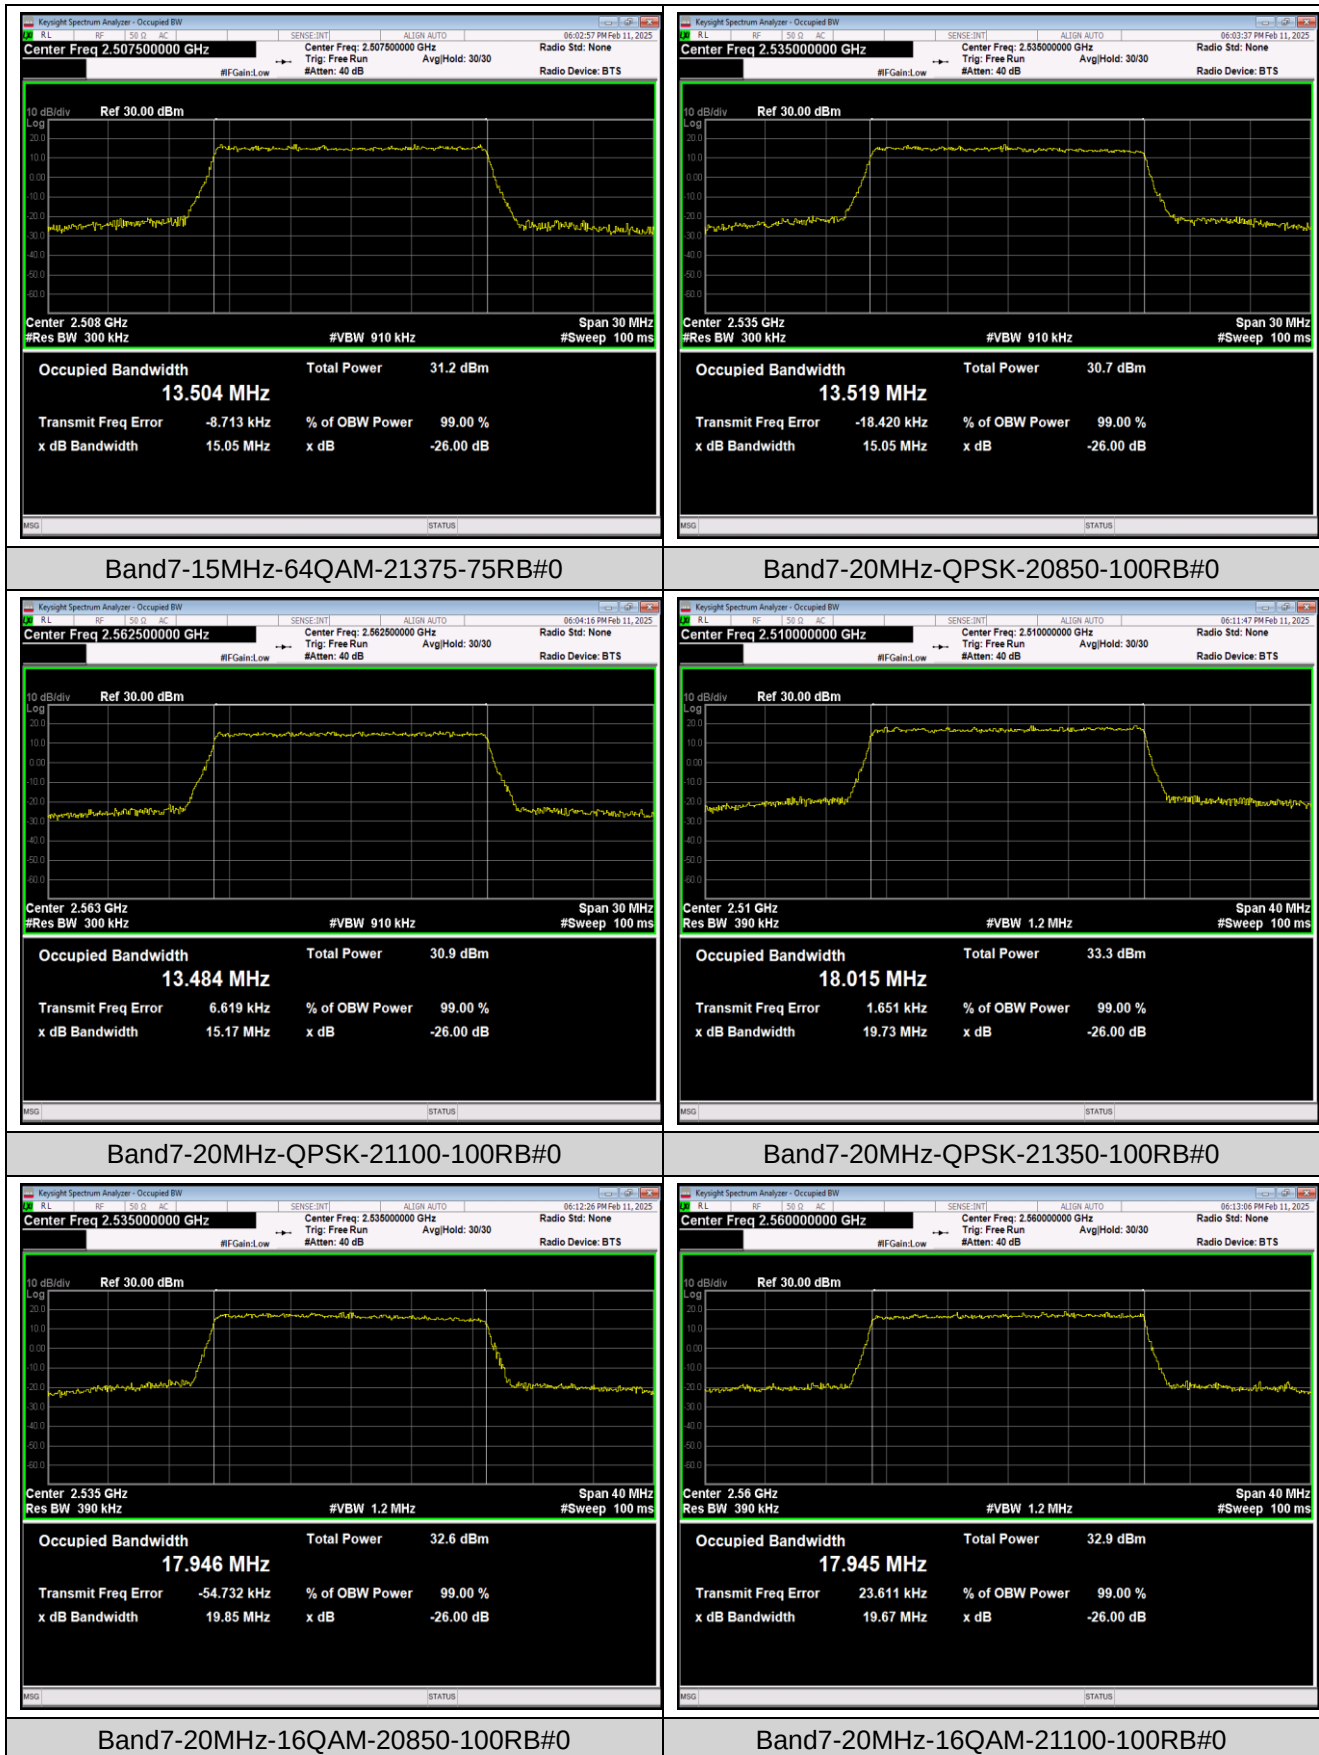



Appendix D: Band Edge

Test Result (worst case)

Band	Bandwidth	Modulation	Channel	RB Config.	Result (dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1RB#0	-34.37,-26.33	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	-25.73,-31.26	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	-29.34,-30.43	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	-36.59,-29.18	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	-25.02,-36.16	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	-31.76,-31.03	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	-35.65,-28.18	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	-28.61,-32.59	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	-28.83,-31.19	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	-37.25,-31.62	PASS
Band4	1.4MHz	16QAM	20393	1RB#5	-28.56,-37.24	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	-32.51,-30.52	PASS
Band4	1.4MHz	64QAM	19957	1RB#0	-35.73,-29.29	PASS
Band4	1.4MHz	64QAM	19957	1RB#5	-28.45,-33.91	PASS
Band4	1.4MHz	64QAM	19957	6RB#0	-28.70,-31.23	PASS
Band4	1.4MHz	64QAM	20393	1RB#0	-37.35,-31.60	PASS
Band4	1.4MHz	64QAM	20393	1RB#5	-26.49,-37.35	PASS
Band4	1.4MHz	64QAM	20393	6RB#0	-32.32,-30.52	PASS
Band4	20MHz	QPSK	20050	1RB#0	-43.13,-34.79	PASS
Band4	20MHz	QPSK	20050	1RB#99	-34.94,-59.36	PASS
Band4	20MHz	QPSK	20050	100RB#0	-31.19,-34.88	PASS
Band4	20MHz	QPSK	20300	1RB#0	-60.58,-37.06	PASS
Band4	20MHz	QPSK	20300	1RB#99	-33.71,-43.11	PASS
Band4	20MHz	QPSK	20300	100RB#0	-37.17,-33.71	PASS
Band4	20MHz	16QAM	20050	1RB#0	-43.27,-32.78	PASS
Band4	20MHz	16QAM	20050	1RB#99	-37.27,-59.30	PASS
Band4	20MHz	16QAM	20050	100RB#0	-31.69,-35.58	PASS
Band4	20MHz	16QAM	20300	1RB#0	-60.48,-39.21	PASS
Band4	20MHz	16QAM	20300	1RB#99	-33.04,-43.60	PASS
Band4	20MHz	16QAM	20300	100RB#0	-37.71,-34.09	PASS
Band4	20MHz	64QAM	20050	1RB#0	-44.03,-35.20	PASS
Band4	20MHz	64QAM	20050	1RB#99	-38.61,-61.05	PASS
Band4	20MHz	64QAM	20050	100RB#0	-33.28,-37.18	PASS
Band4	20MHz	64QAM	20300	1RB#0	-62.00,-39.70	PASS
Band4	20MHz	64QAM	20300	1RB#99	-33.90,-44.48	PASS
Band4	20MHz	64QAM	20300	100RB#0	-39.41,-35.73	PASS

Band5	1.4MHz	QPSK	20407	1RB#0	-49.93,-30.92	PASS
Band5	1.4MHz	QPSK	20407	1RB#5	-51.30,-36.23	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	-42.85,-35.10	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	-35.60,-52.05	PASS
Band5	1.4MHz	QPSK	20643	1RB#5	-28.49,-51.83	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	-35.39,-44.16	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	-50.92,-27.59	PASS
Band5	1.4MHz	16QAM	20407	1RB#5	-51.24,-39.12	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	-42.54,-34.94	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	-36.30,-52.02	PASS
Band5	1.4MHz	16QAM	20643	1RB#5	-29.20,-51.74	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	-36.48,-42.72	PASS
Band5	1.4MHz	64QAM	20407	1RB#0	-50.65,-29.44	PASS
Band5	1.4MHz	64QAM	20407	1RB#5	-51.49,-37.07	PASS
Band5	1.4MHz	64QAM	20407	6RB#0	-42.68,-36.59	PASS
Band5	1.4MHz	64QAM	20643	1RB#0	-37.69,-53.27	PASS
Band5	1.4MHz	64QAM	20643	1RB#5	-32.13,-51.70	PASS
Band5	1.4MHz	64QAM	20643	6RB#0	-37.23,-42.90	PASS
Band5	10MHz	QPSK	20450	1RB#0	-52.60,-25.69	PASS
Band5	10MHz	QPSK	20450	1RB#49	-38.99,-57.87	PASS
Band5	10MHz	QPSK	20450	50RB#0	-45.56,-37.09	PASS
Band5	10MHz	QPSK	20600	1RB#0	-59.19,-36.01	PASS
Band5	10MHz	QPSK	20600	1RB#49	-27.31,-50.84	PASS
Band5	10MHz	QPSK	20600	50RB#0	-39.54,-47.18	PASS
Band5	10MHz	16QAM	20450	1RB#0	-53.65,-28.53	PASS
Band5	10MHz	16QAM	20450	1RB#49	-41.21,-58.54	PASS
Band5	10MHz	16QAM	20450	50RB#0	-45.52,-37.69	PASS
Band5	10MHz	16QAM	20600	1RB#0	-59.39,-38.44	PASS
Band5	10MHz	16QAM	20600	1RB#49	-28.74,-52.28	PASS
Band5	10MHz	16QAM	20600	50RB#0	-39.75,-47.08	PASS
Band5	10MHz	64QAM	20450	1RB#0	-54.03,-29.67	PASS
Band5	10MHz	64QAM	20450	1RB#49	-44.31,-59.50	PASS
Band5	10MHz	64QAM	20450	50RB#0	-46.23,-38.91	PASS
Band5	10MHz	64QAM	20600	1RB#0	-60.53,-39.72	PASS
Band5	10MHz	64QAM	20600	1RB#49	-29.21,-53.01	PASS
Band5	10MHz	64QAM	20600	50RB#0	-40.32,-47.28	PASS
Band7	5MHz	QPSK	20775	1RB#0	-43.68,-38.90,-35.39,-19.59	PASS
Band7	5MHz	QPSK	20775	1RB#24	-48.67,-24.50,-24.31,-52.74	PASS
Band7	5MHz	QPSK	20775	25RB#0	-39.22,-31.64,-27.87,-28.46	PASS
Band7	5MHz	QPSK	21425	1RB#0	-52.67,-26.32,-45.61,-49.14	PASS
Band7	5MHz	QPSK	21425	1RB#24	-19.53,-36.07,-46.46,-43.63	PASS
Band7	5MHz	QPSK	21425	25RB#0	-28.95,-29.72,-37.97,-40.62	PASS

Band7	5MHz	16QAM	20775	1RB#0	-45.12,-39.81,-36.55,-19.37	PASS
Band7	5MHz	16QAM	20775	1RB#24	-48.95,-26.58,-26.26,-52.85	PASS
Band7	5MHz	16QAM	20775	25RB#0	-41.31,-34.92,-29.27,-30.45	PASS
Band7	5MHz	16QAM	21425	1RB#0	-53.74,-28.01,-46.08,-49.06	PASS
Band7	5MHz	16QAM	21425	1RB#24	-19.16,-37.13,-46.76,-45.23	PASS
Band7	5MHz	16QAM	21425	25RB#0	-31.45,-30.97,-39.38,-42.18	PASS
Band7	5MHz	64QAM	20775	1RB#0	-46.40,-41.50,-37.60,-21.93	PASS
Band7	5MHz	64QAM	20775	1RB#24	-48.95,-27.87,-28.12,-53.31	PASS
Band7	5MHz	64QAM	20775	25RB#0	-42.85,-37.04,-30.25,-31.89	PASS
Band7	5MHz	64QAM	21425	1RB#0	-55.16,-29.63,-46.82,-49.43	PASS
Band7	5MHz	64QAM	21425	1RB#24	-20.21,-38.37,-47.33,-45.95	PASS
Band7	5MHz	64QAM	21425	25RB#0	-33.73,-32.24,-41.91,-44.01	PASS
Band7	20MHz	QPSK	20850	1RB#0	-45.12,-40.85,-35.25	PASS
Band7	20MHz	QPSK	20850	1RB#99	-46.36,-44.61,-57.85	PASS
Band7	20MHz	QPSK	20850	100RB#0	-36.18,-33.38,-32.66,-35.70	PASS
Band7	20MHz	QPSK	21350	1RB#0	-58.01,-44.56,-36.68,-50.36	PASS
Band7	20MHz	QPSK	21350	1RB#99	-31.70,-41.44,-45.04,-50.33	PASS
Band7	20MHz	QPSK	21350	100RB#0	-34.53,-31.75,-33.07,-49.09	PASS
Band7	20MHz	16QAM	20850	1RB#0	-45.45,-41.18,-32.63	PASS
Band7	20MHz	16QAM	20850	1RB#99	-46.30,-44.66,-58.33	PASS
Band7	20MHz	16QAM	20850	100RB#0	-36.87,-33.56,-32.62,-35.77	PASS
Band7	20MHz	16QAM	21350	1RB#0	-57.48,-44.41,-39.36,-50.34	PASS
Band7	20MHz	16QAM	21350	1RB#99	-33.67,-41.70,-45.77,-50.35	PASS
Band7	20MHz	16QAM	21350	100RB#0	-37.14,-34.28,-35.97,-49.54	PASS
Band7	20MHz	64QAM	20850	1RB#0	-46.12,-42.00,-32.58	PASS
Band7	20MHz	64QAM	20850	1RB#99	-47.03,-45.32,-59.32	PASS
Band7	20MHz	64QAM	20850	100RB#0	-37.81,-34.44,-33.06,-36.06	PASS
Band7	20MHz	64QAM	21350	1RB#0	-58.36,-45.14,-39.97,-50.39	PASS
Band7	20MHz	64QAM	21350	1RB#99	-33.04,-42.45,-46.47,-50.34	PASS
Band7	20MHz	64QAM	21350	100RB#0	-39.03,-35.87,-38.74,-50.00	PASS

Remark: All bandwidth and all modulation had been tested, but only the worst case data displayed in this report.