
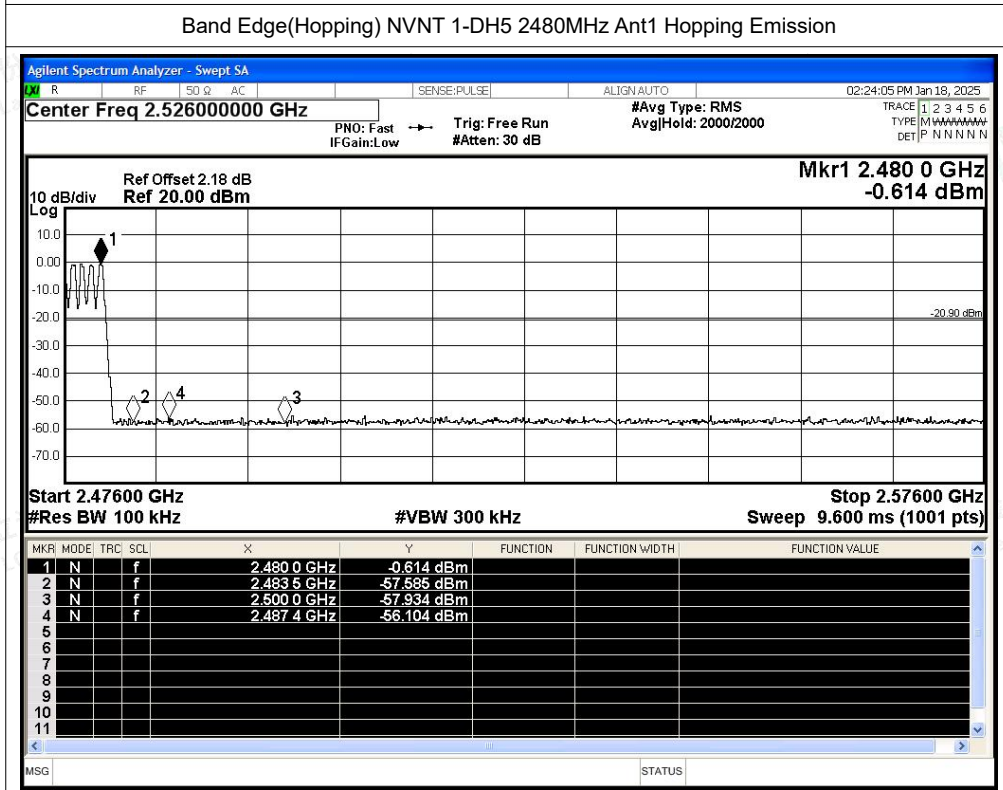



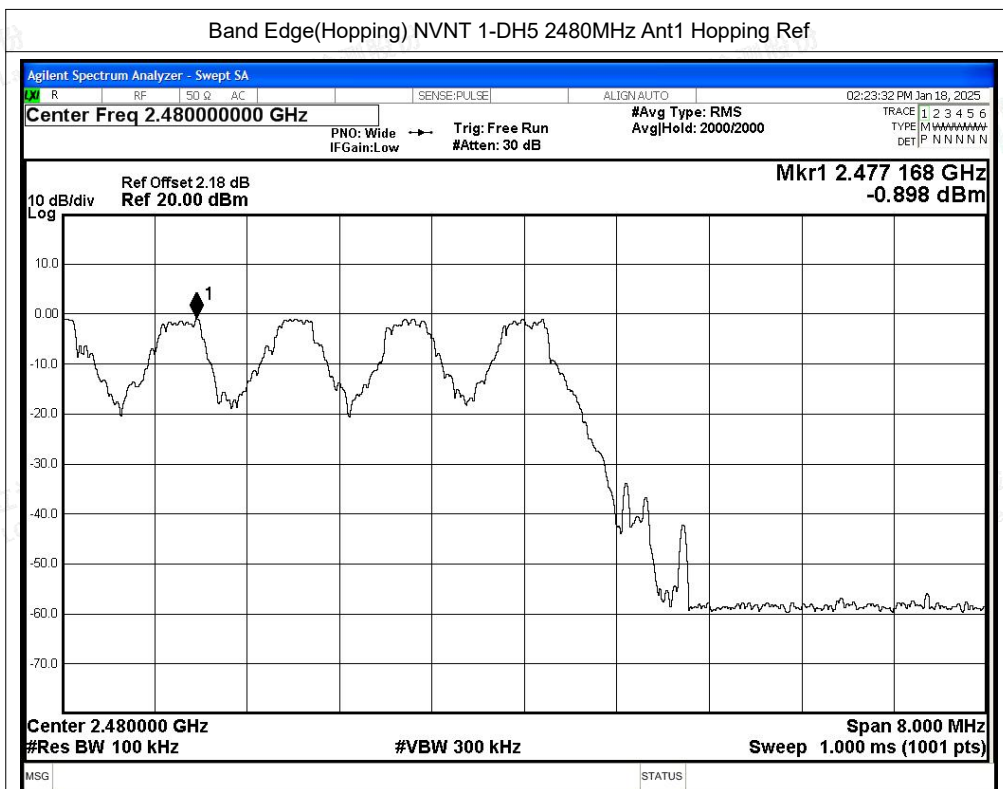


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

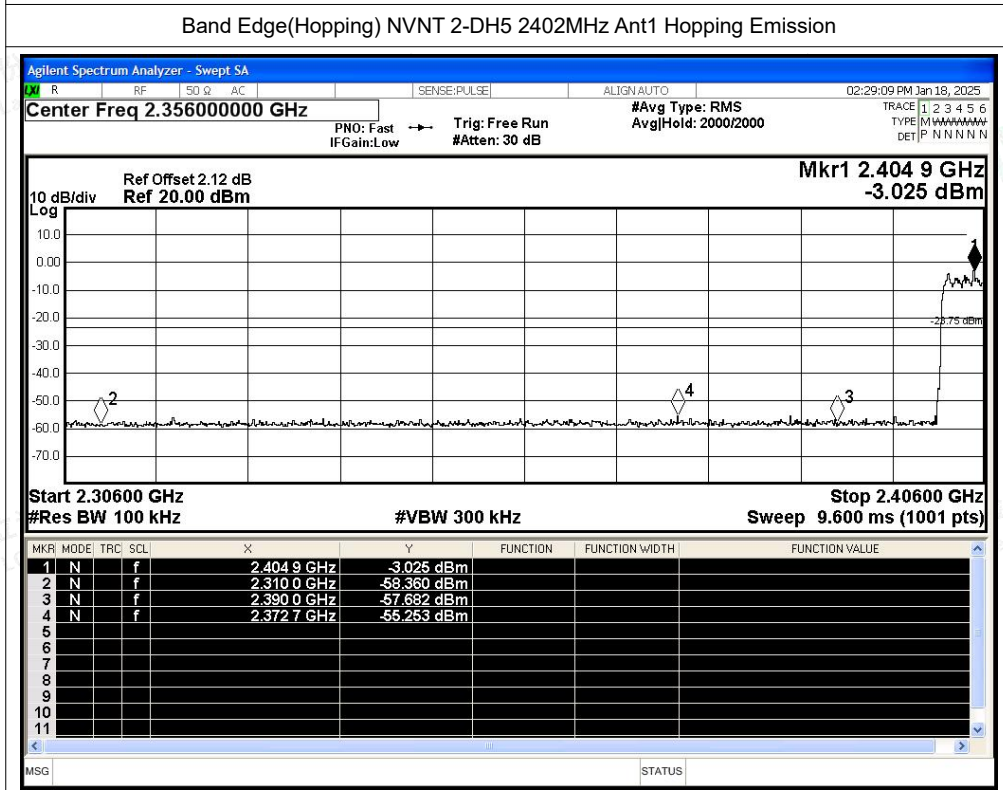
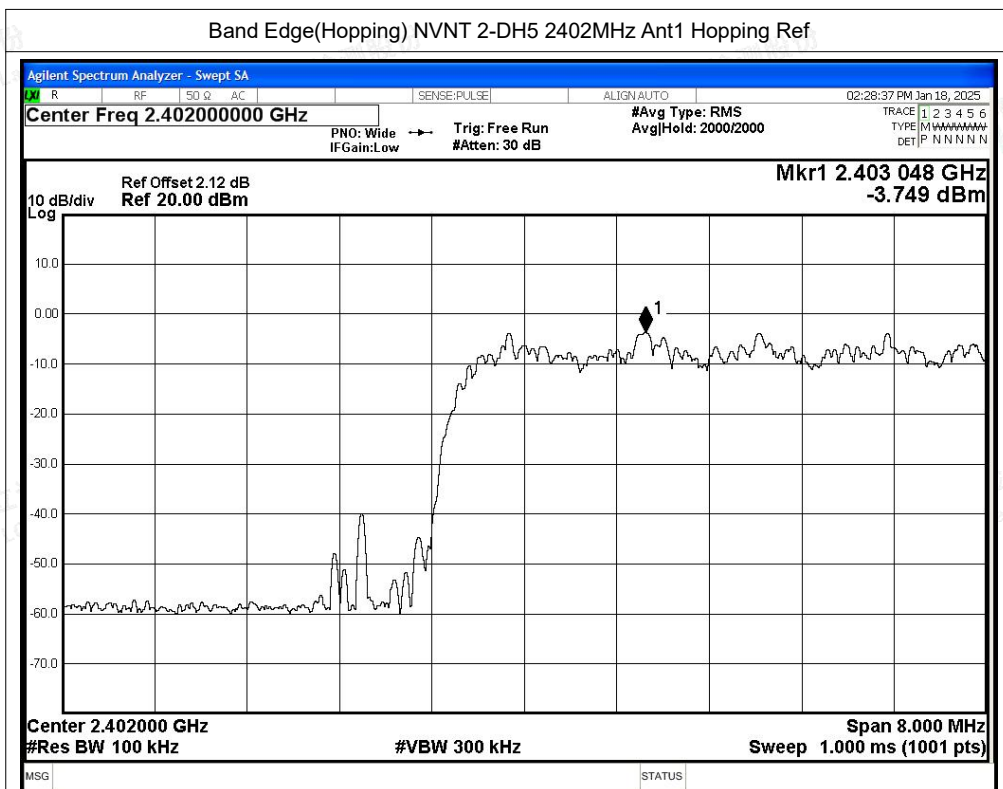


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

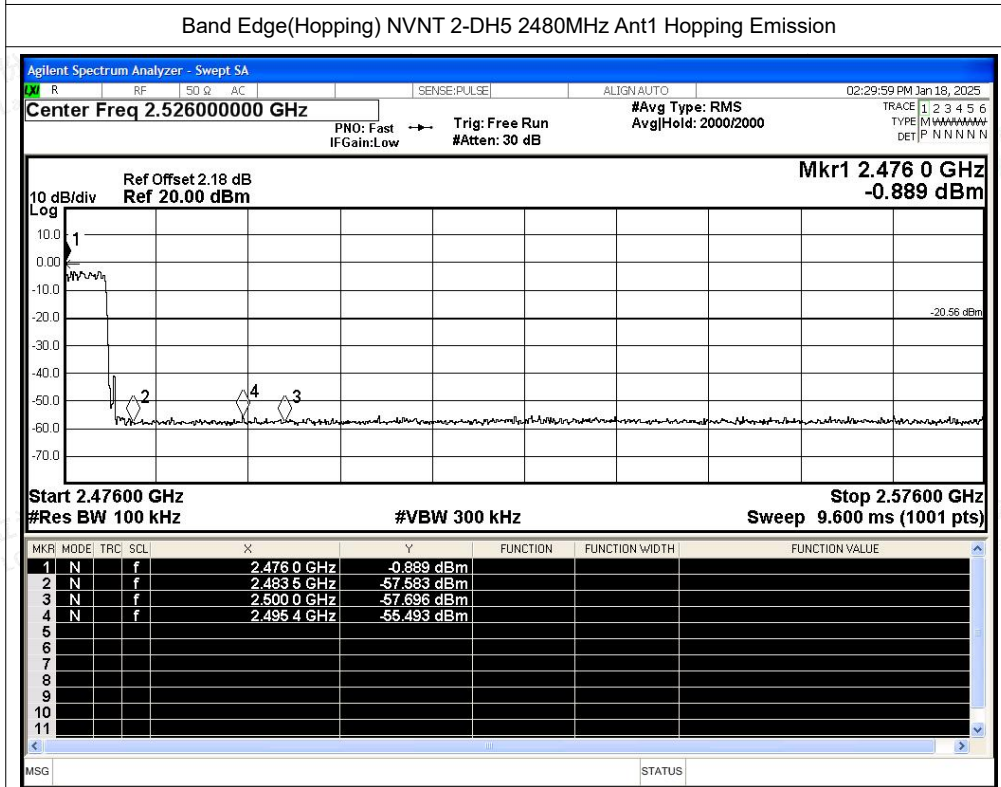
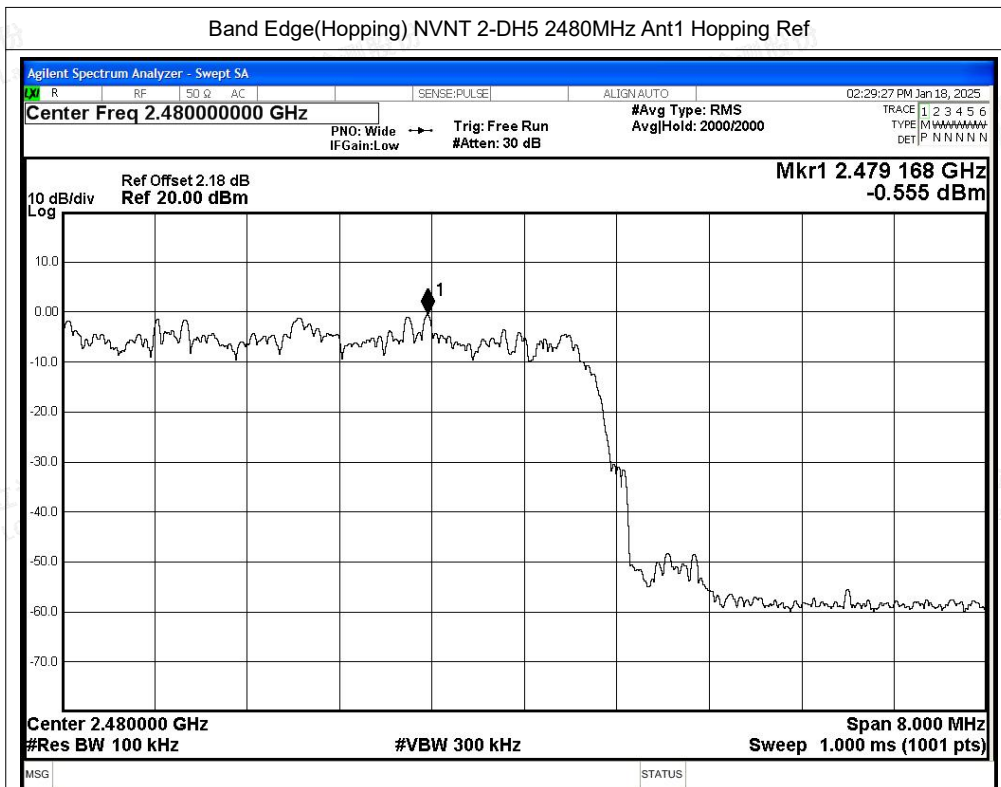


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

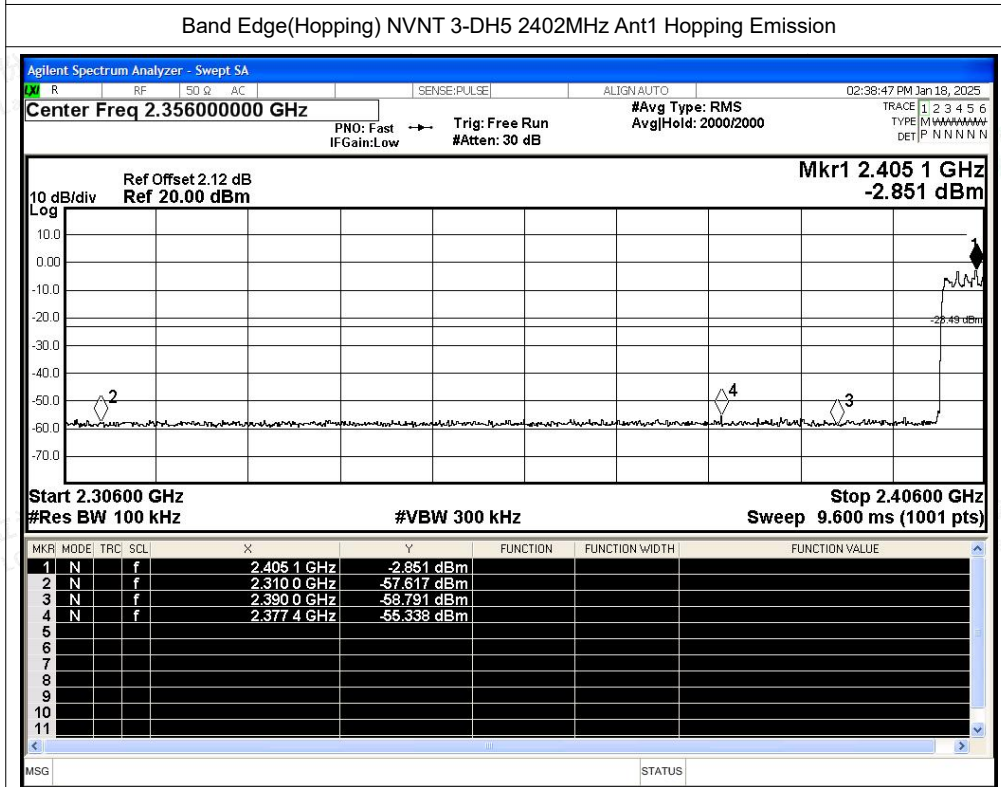
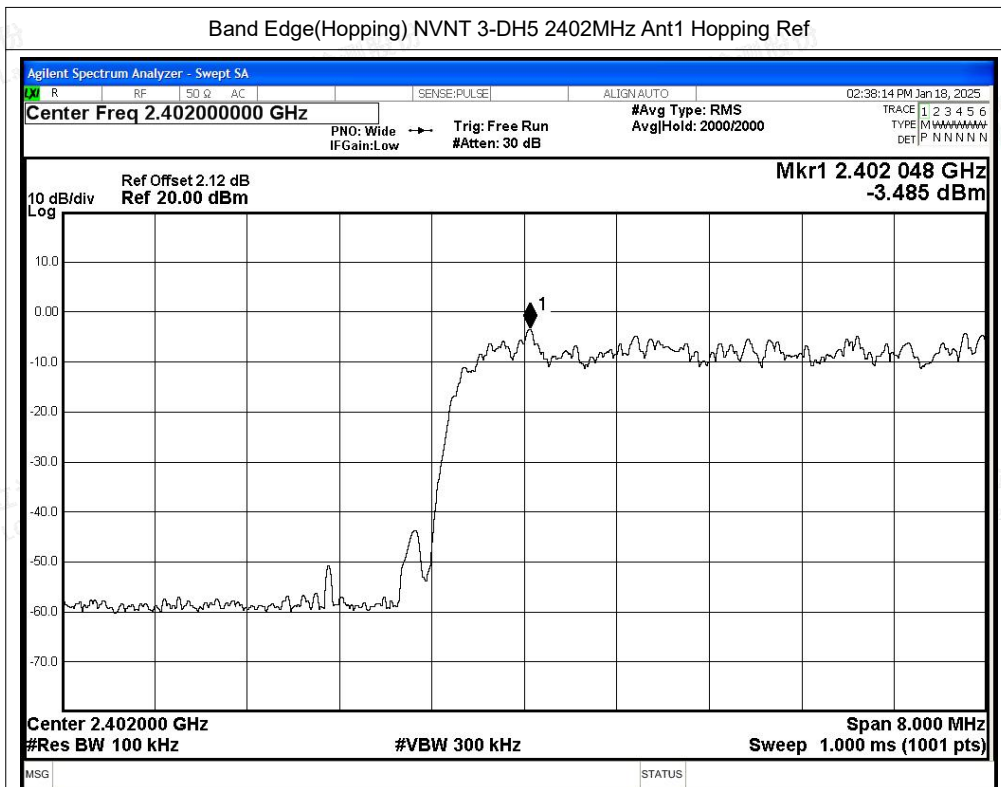


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

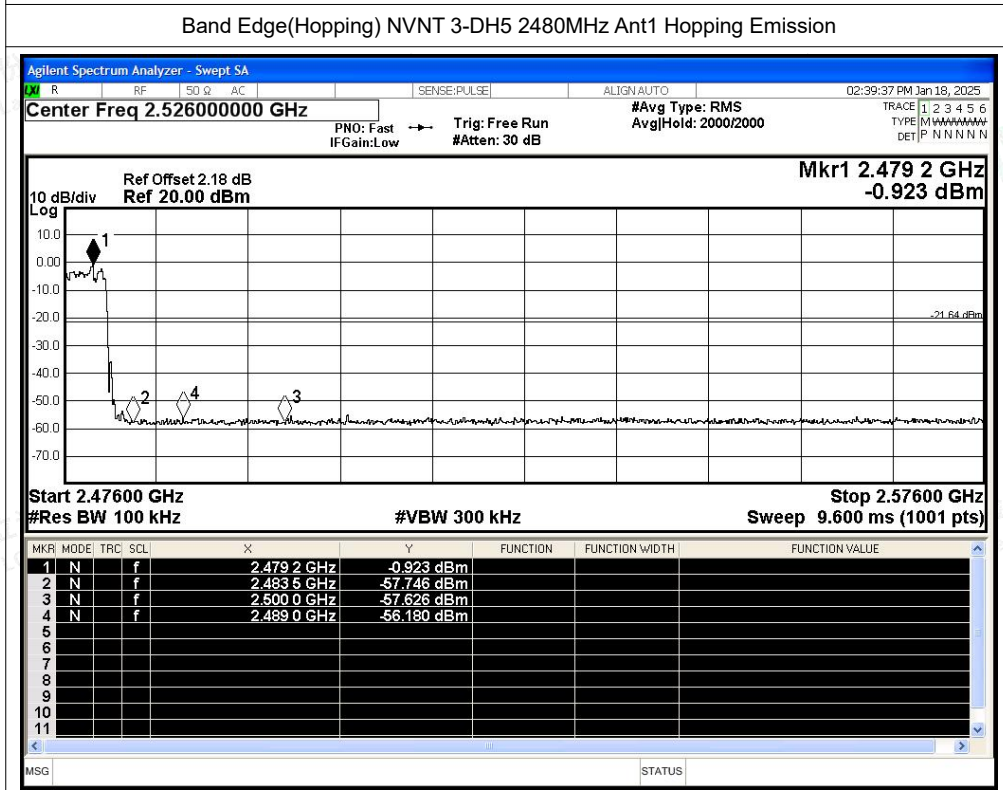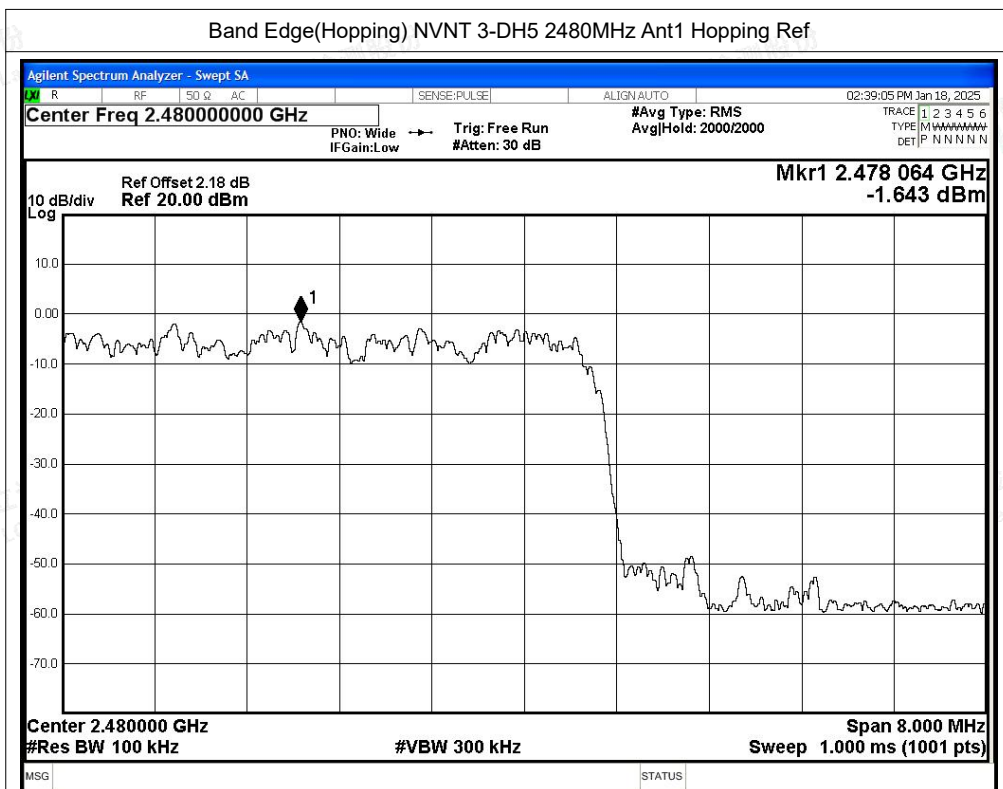

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.7 Conducted RF Spurious Emission


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	-50.53	-20	Pass
NVNT	1-DH5	2441	Ant1	-43.94	-20	Pass
NVNT	1-DH5	2480	Ant1	-58.01	-20	Pass
NVNT	2-DH5	2402	Ant1	-54.42	-20	Pass
NVNT	2-DH5	2441	Ant1	-54.29	-20	Pass
NVNT	2-DH5	2480	Ant1	-47.37	-20	Pass
NVNT	3-DH5	2402	Ant1	-52.7	-20	Pass
NVNT	3-DH5	2441	Ant1	-48.71	-20	Pass
NVNT	3-DH5	2480	Ant1	-54.15	-20	Pass






Test Graphs

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Ref

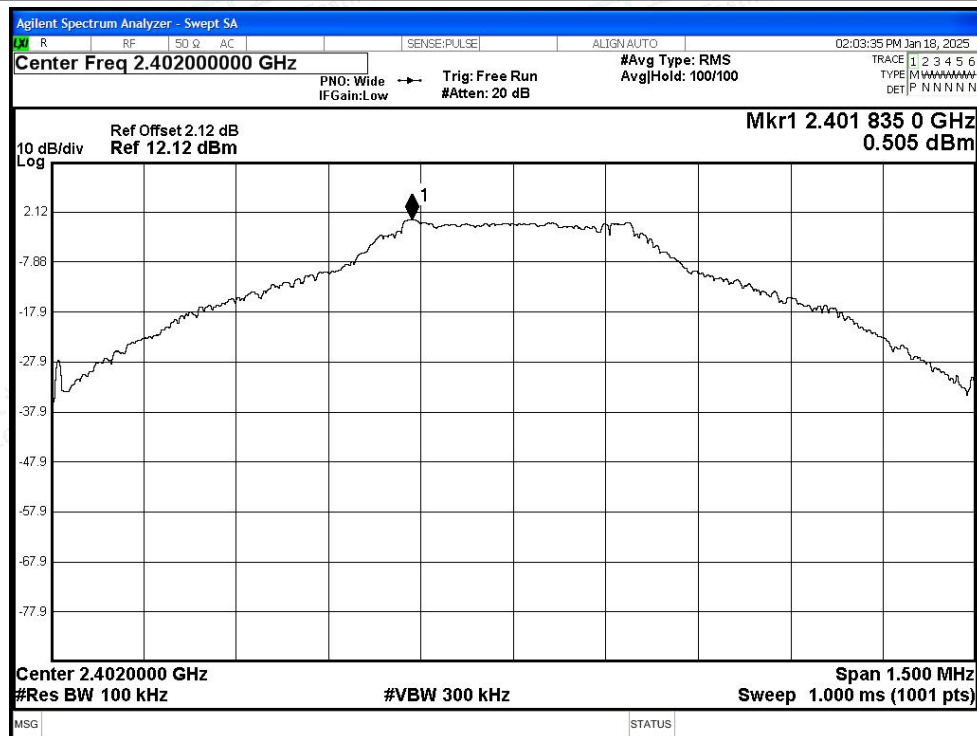

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Emission

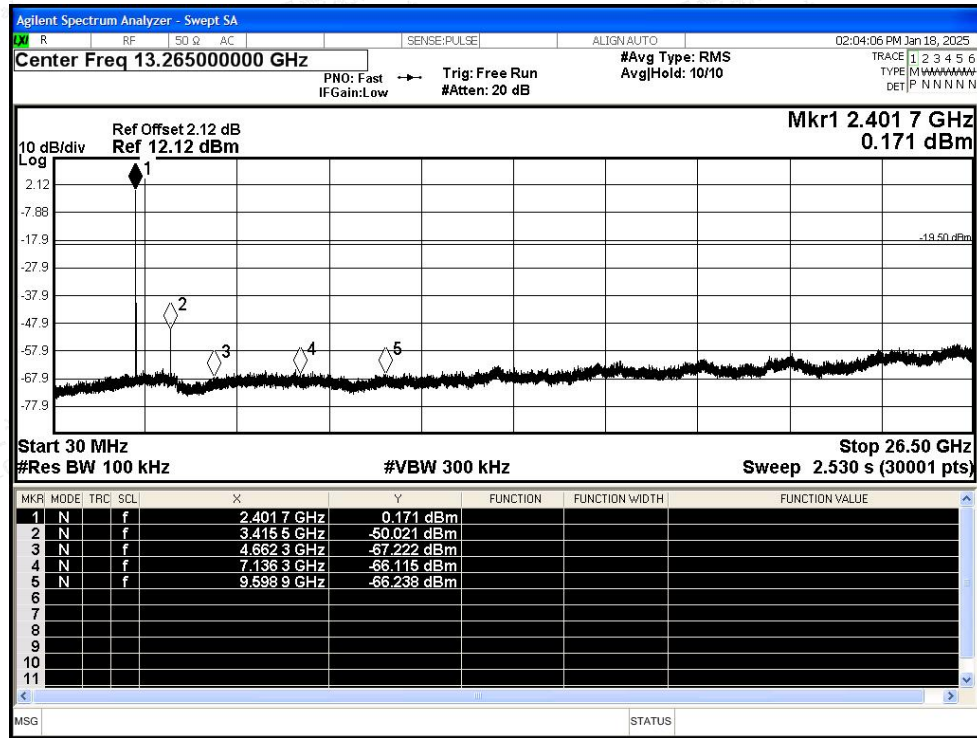

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Ref

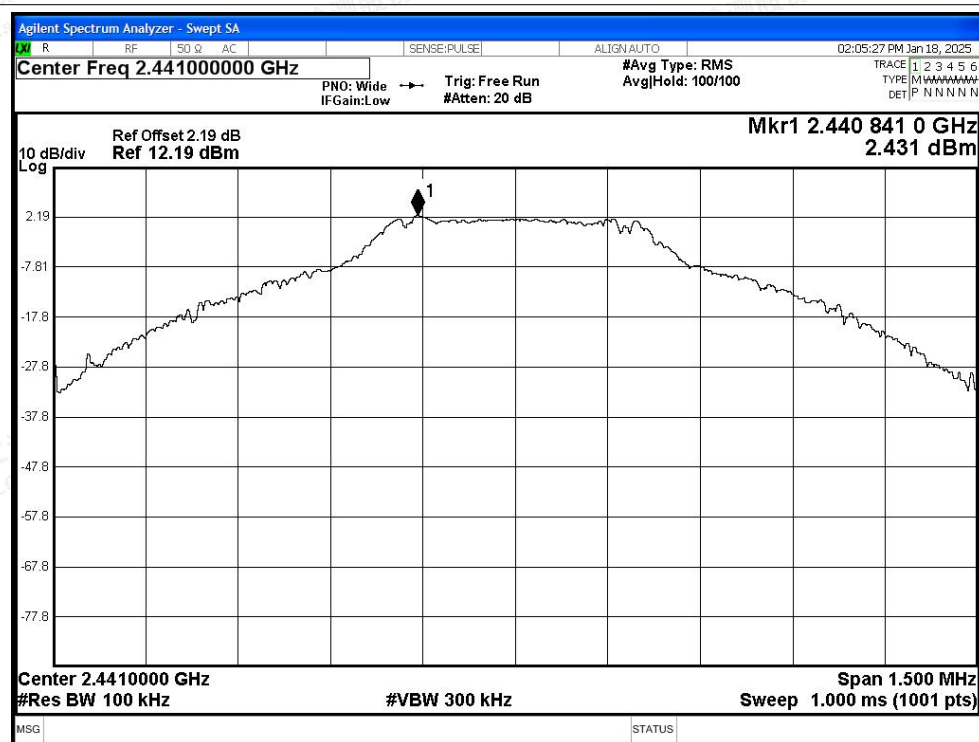


Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Emission

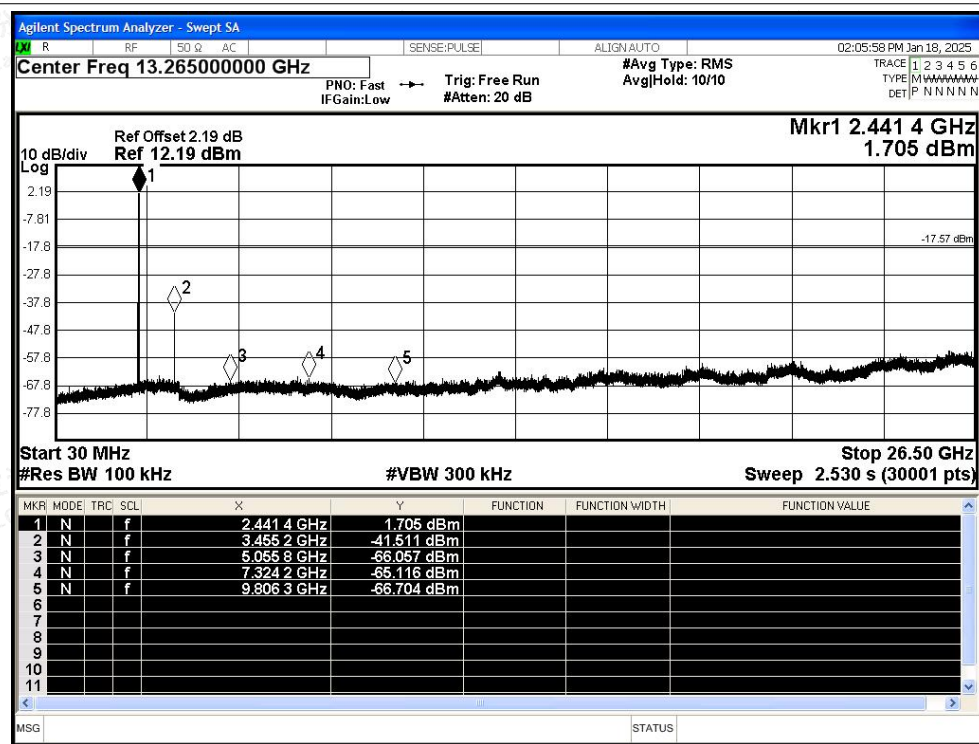




Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Ref

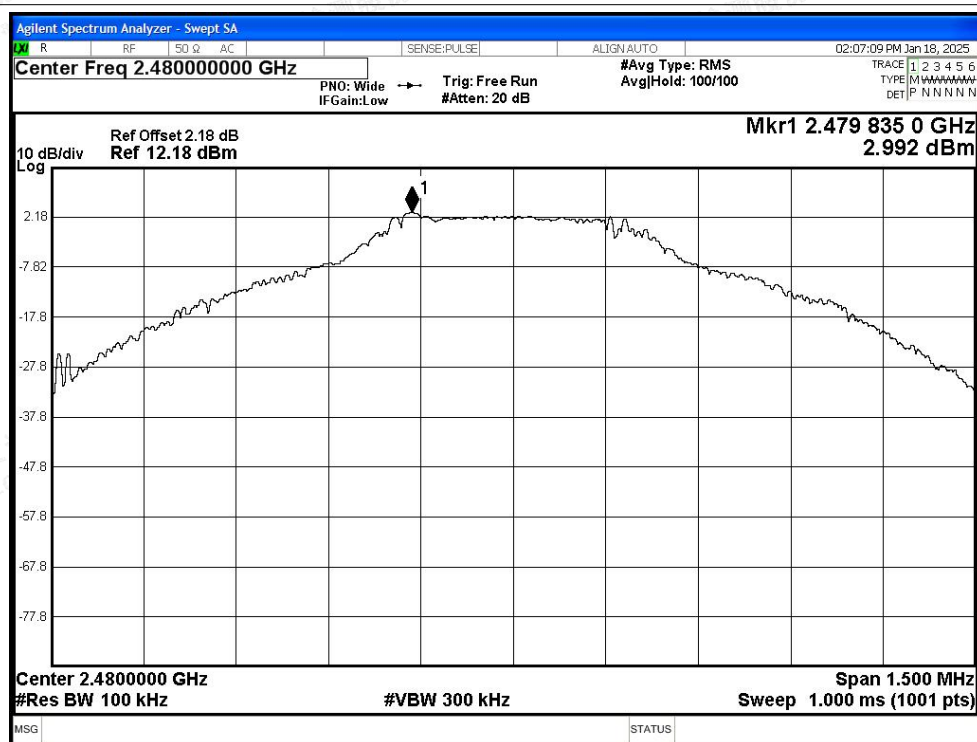

Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Emission

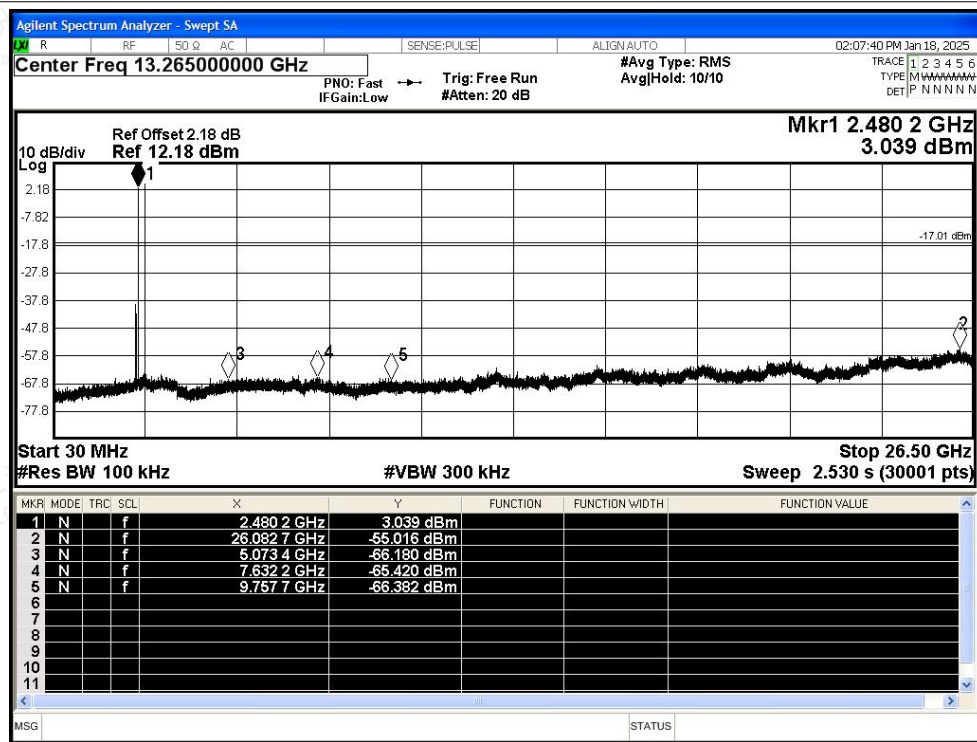

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Ref

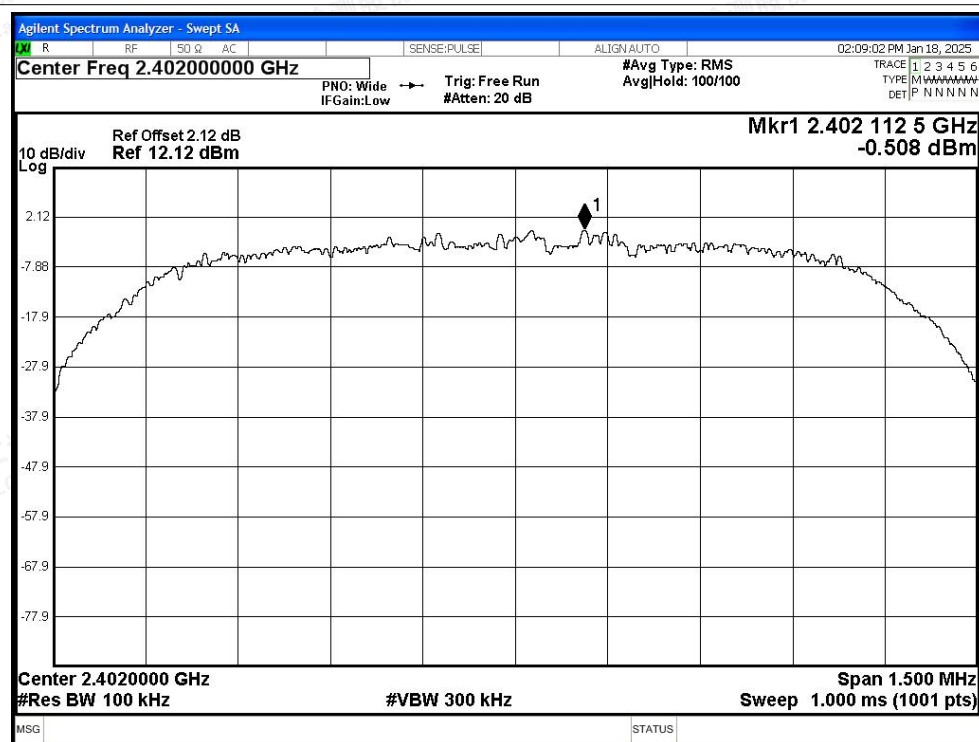

Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

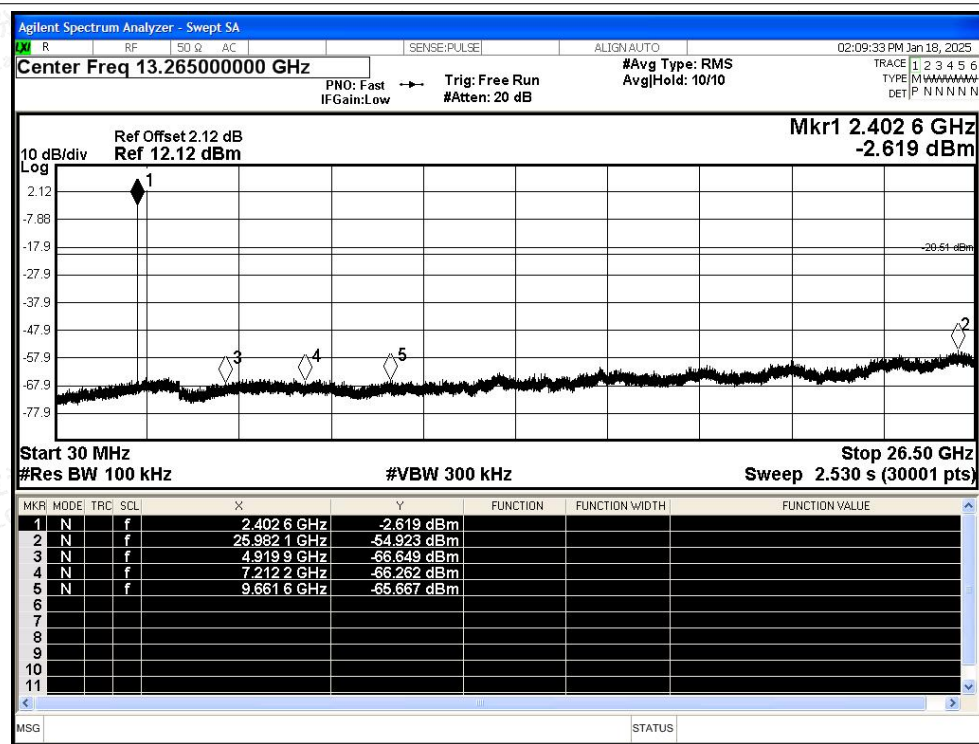

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref

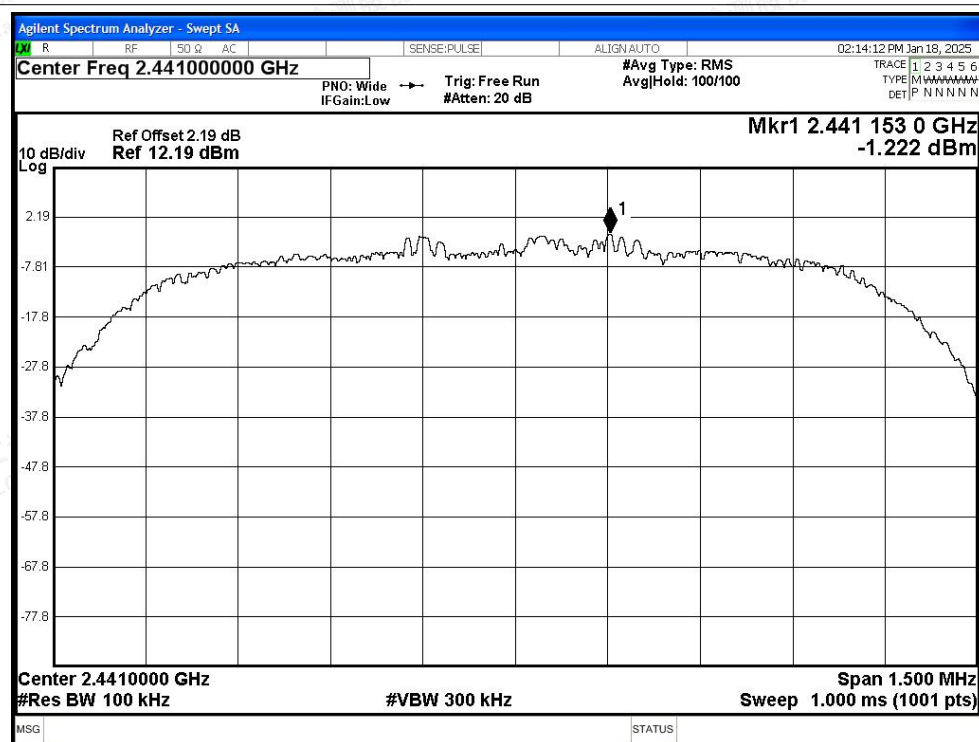

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission

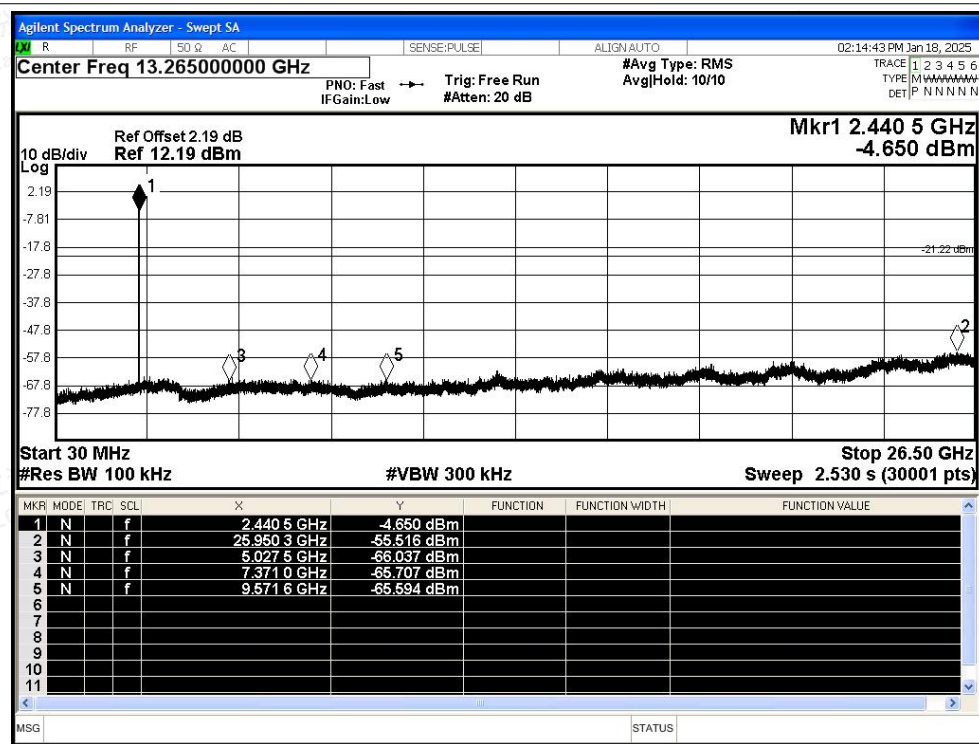

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

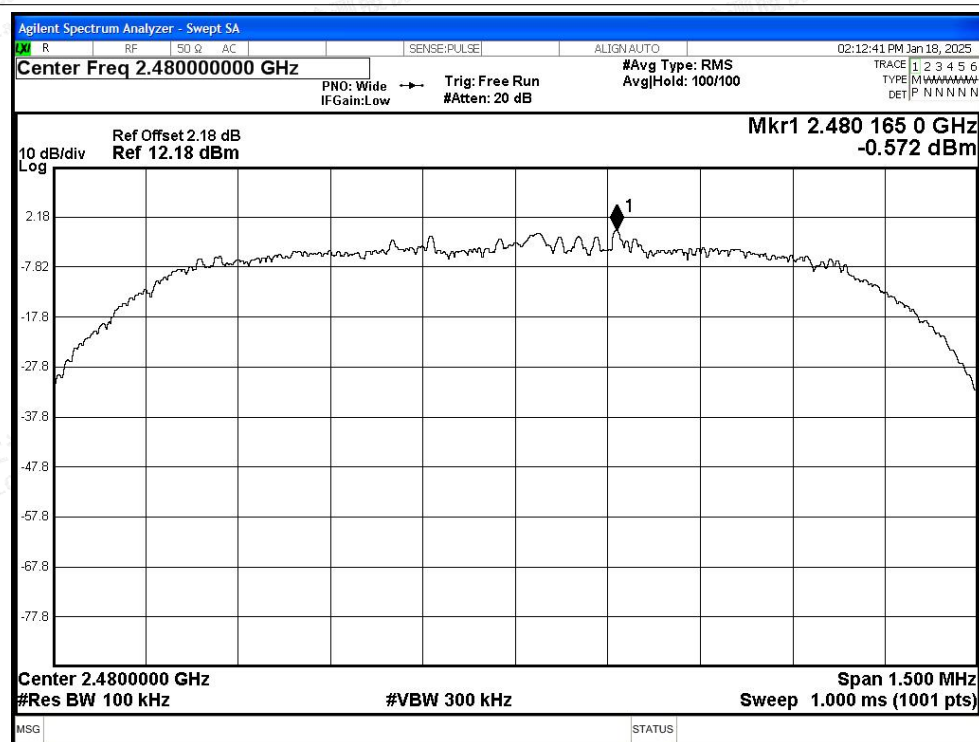

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

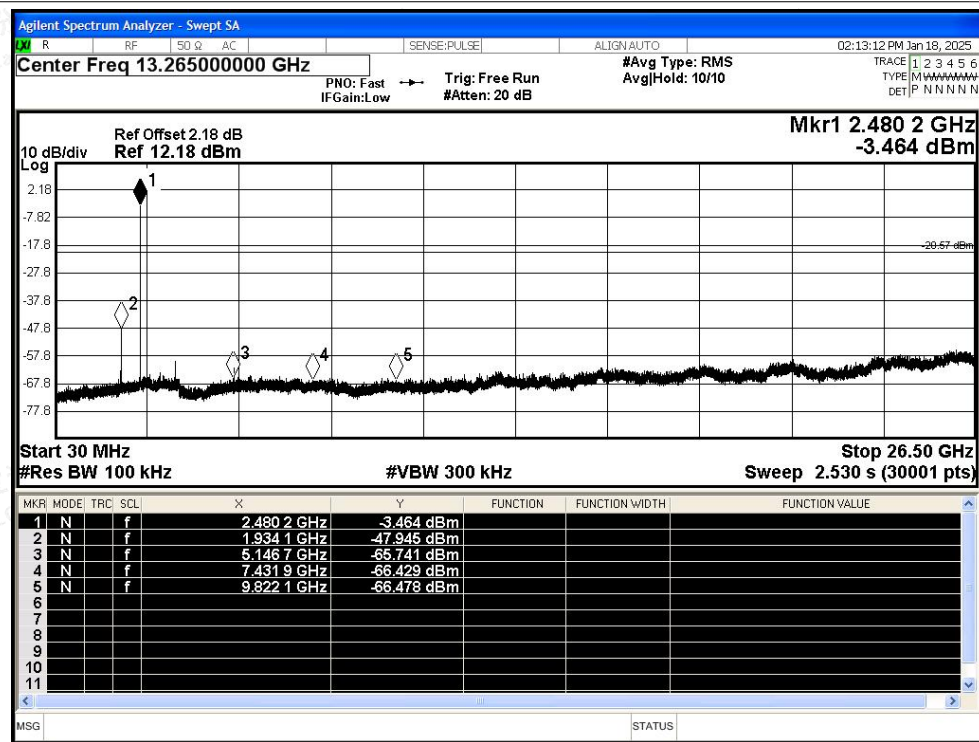

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

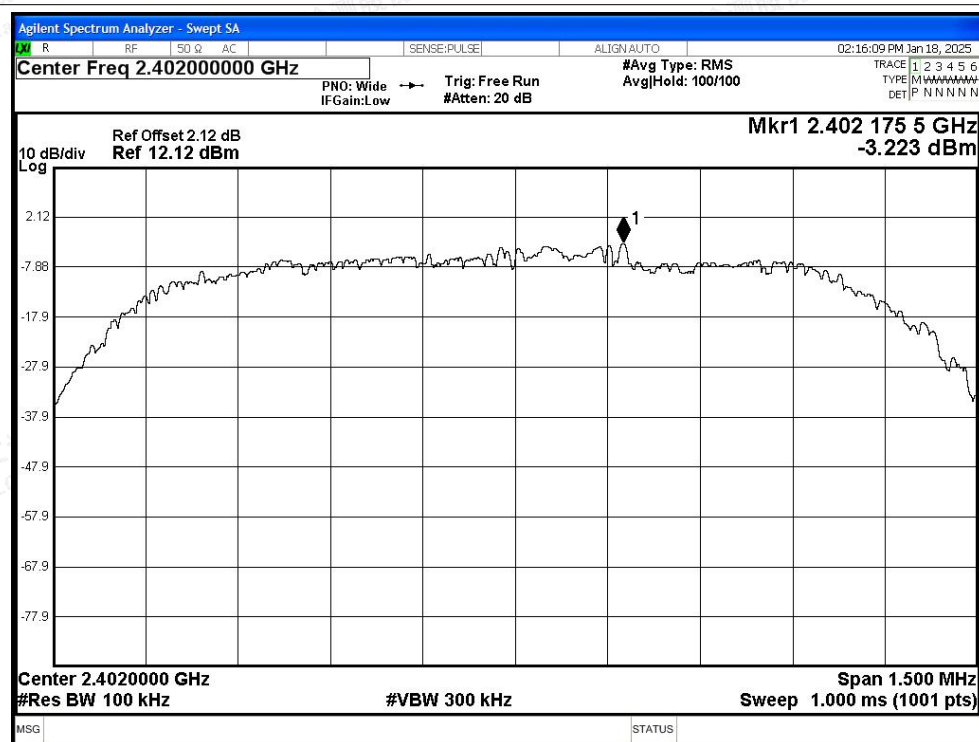

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

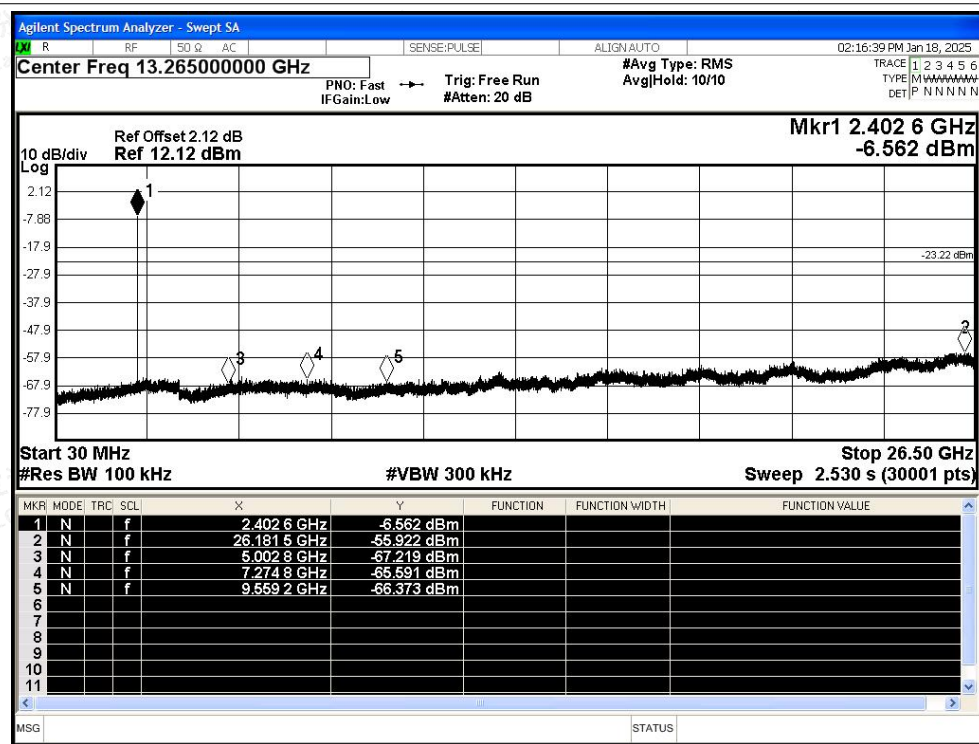

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

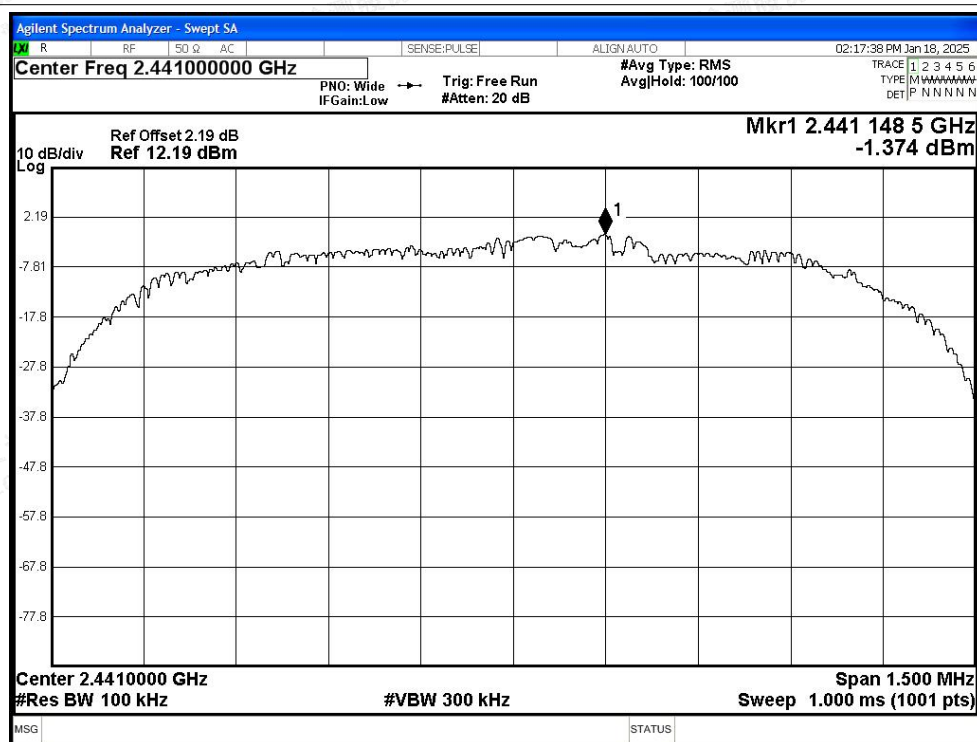

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

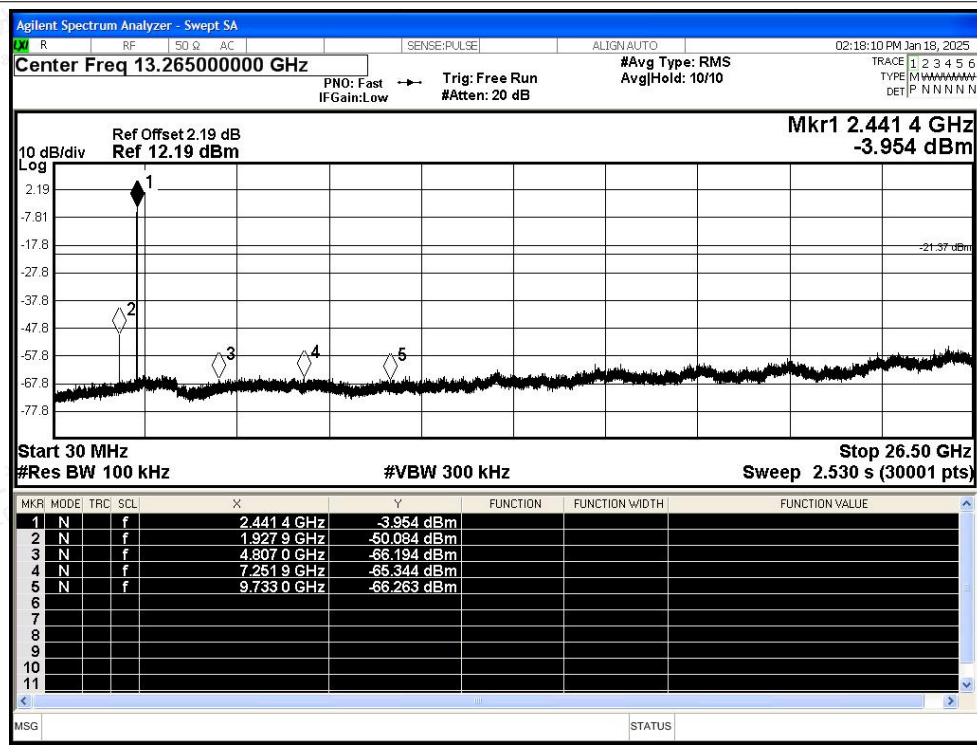

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

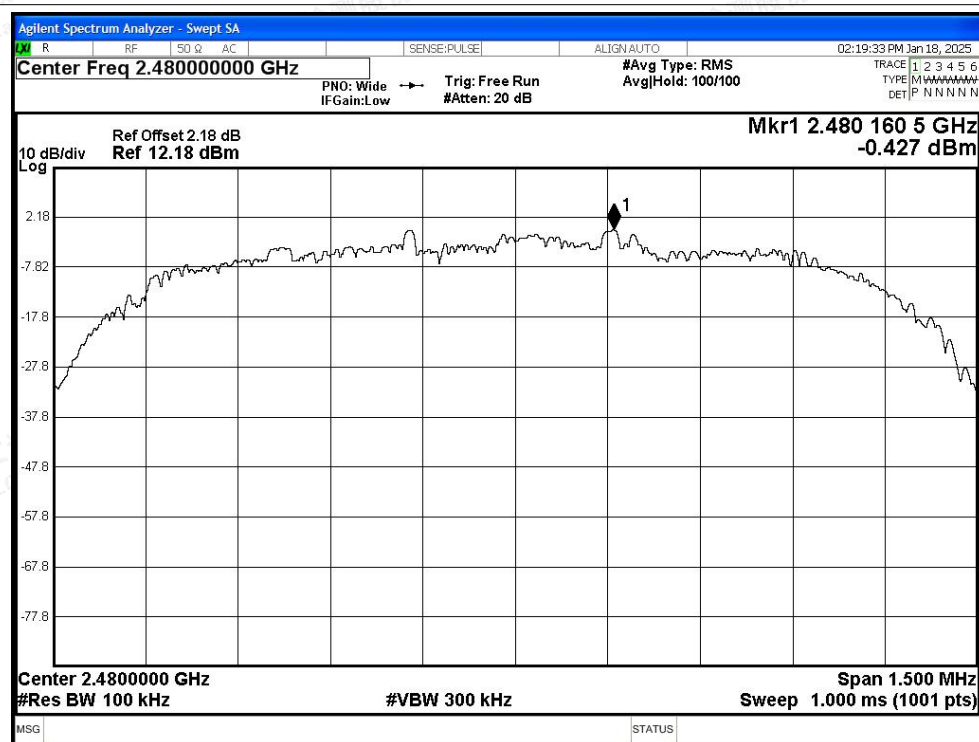

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

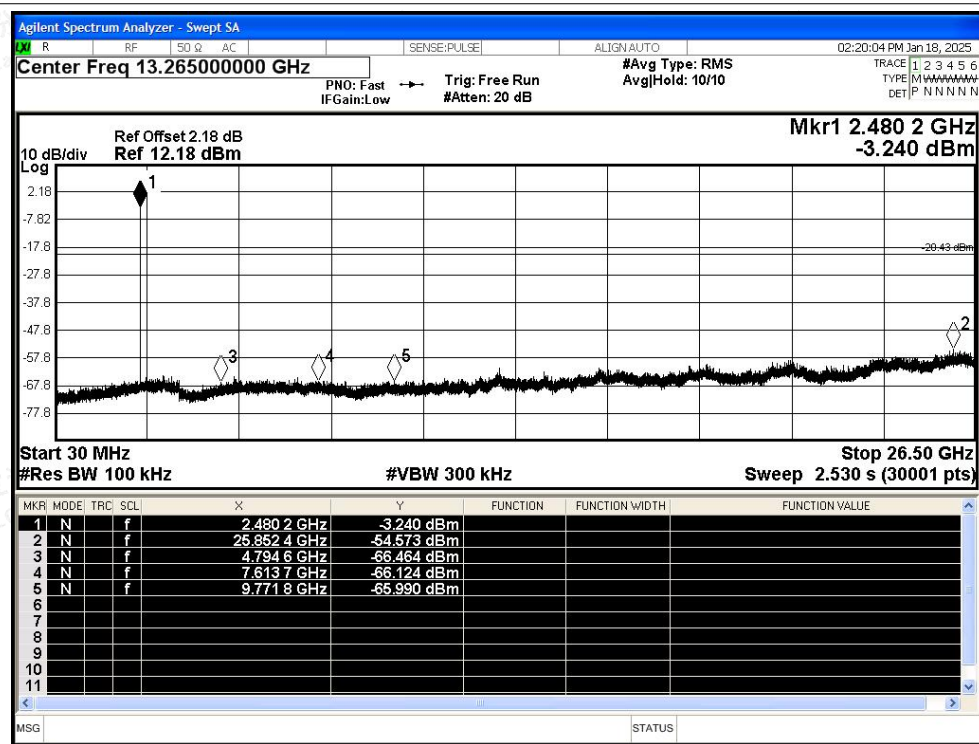

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	77.23	1.12	0.35
NVNT	1-DH5	2441	Ant1	77.25	1.12	0.35
NVNT	1-DH5	2480	Ant1	77.23	1.12	0.35
NVNT	2-DH5	2402	Ant1	76.96	1.14	0.35
NVNT	2-DH5	2441	Ant1	76.91	1.14	0.35
NVNT	2-DH5	2480	Ant1	76.91	1.14	0.35
NVNT	3-DH5	2402	Ant1	76.91	1.14	0.35
NVNT	3-DH5	2441	Ant1	76.91	1.14	0.35
NVNT	3-DH5	2480	Ant1	76.91	1.14	0.35




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

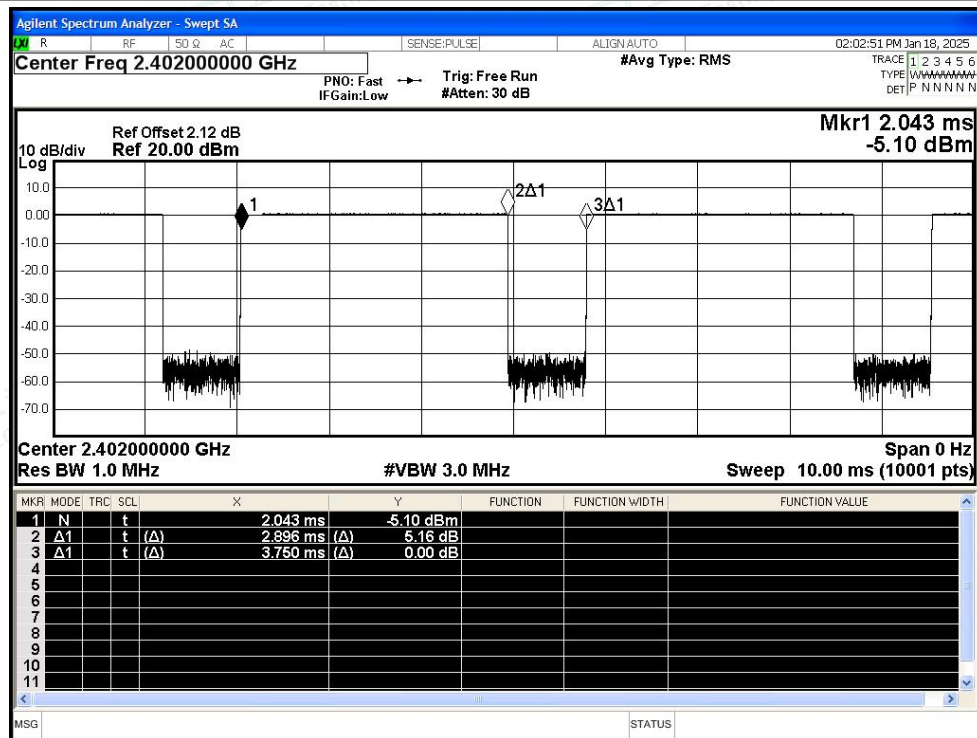

Duty Cycle NVNT 1-DH5 2441MHz Ant1

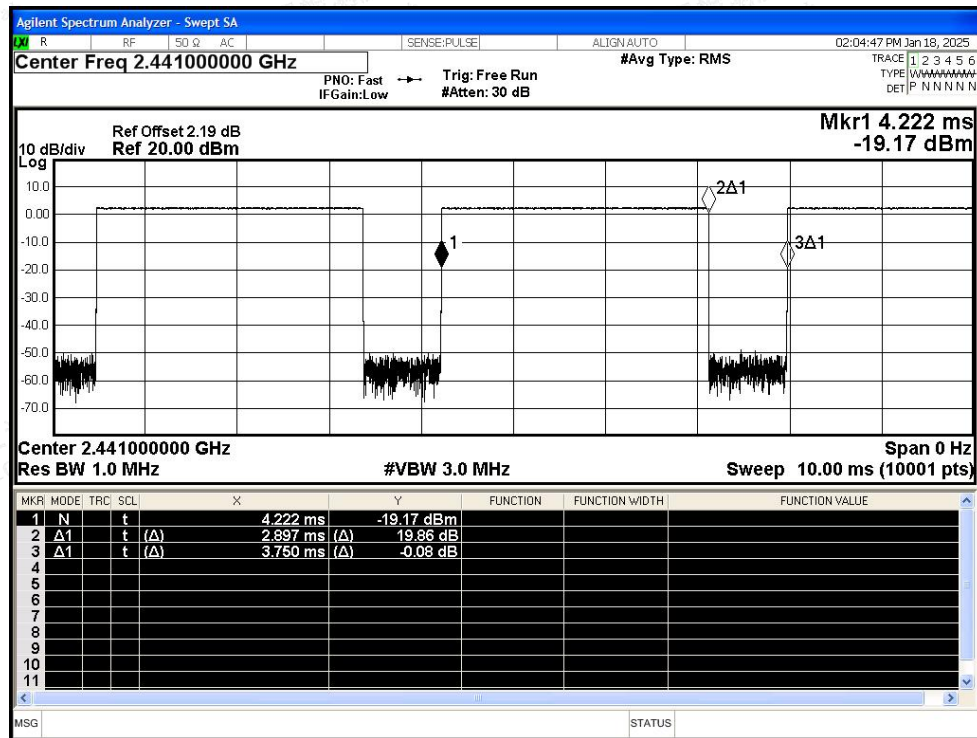

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

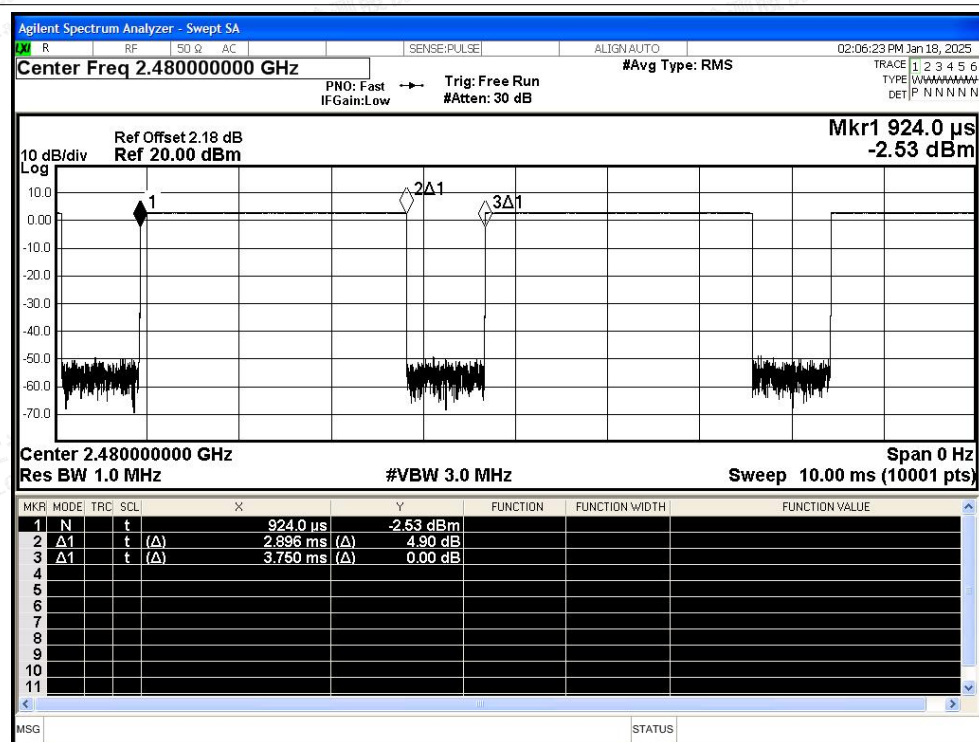

Duty Cycle NVNT 2-DH5 2402MHz Ant1

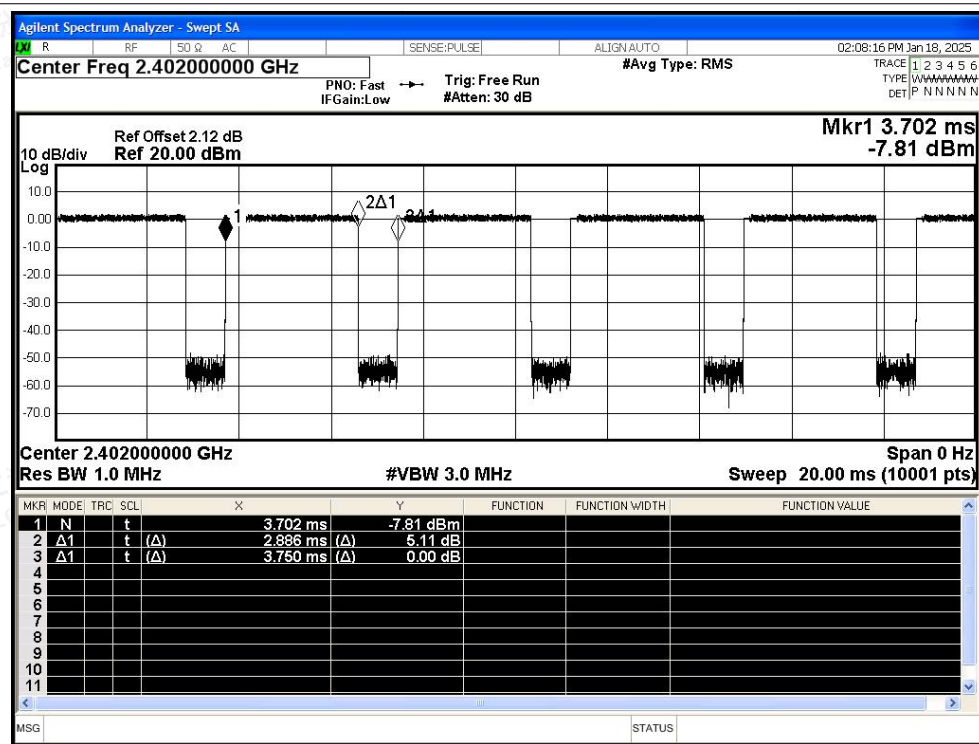

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

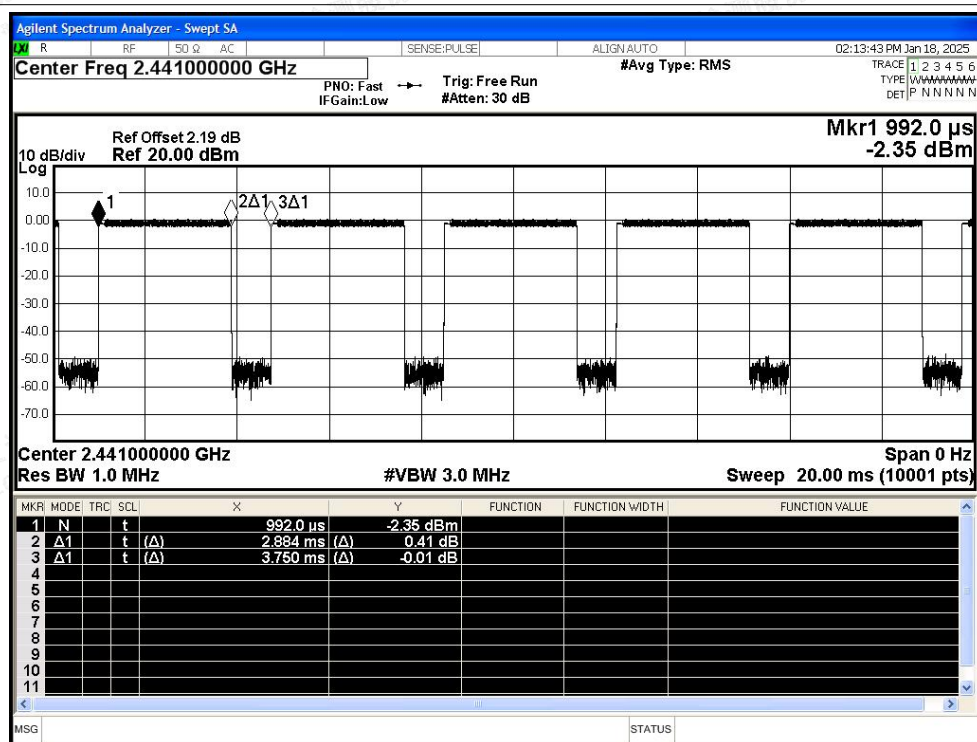

Duty Cycle NVNT 2-DH5 2480MHz Ant1

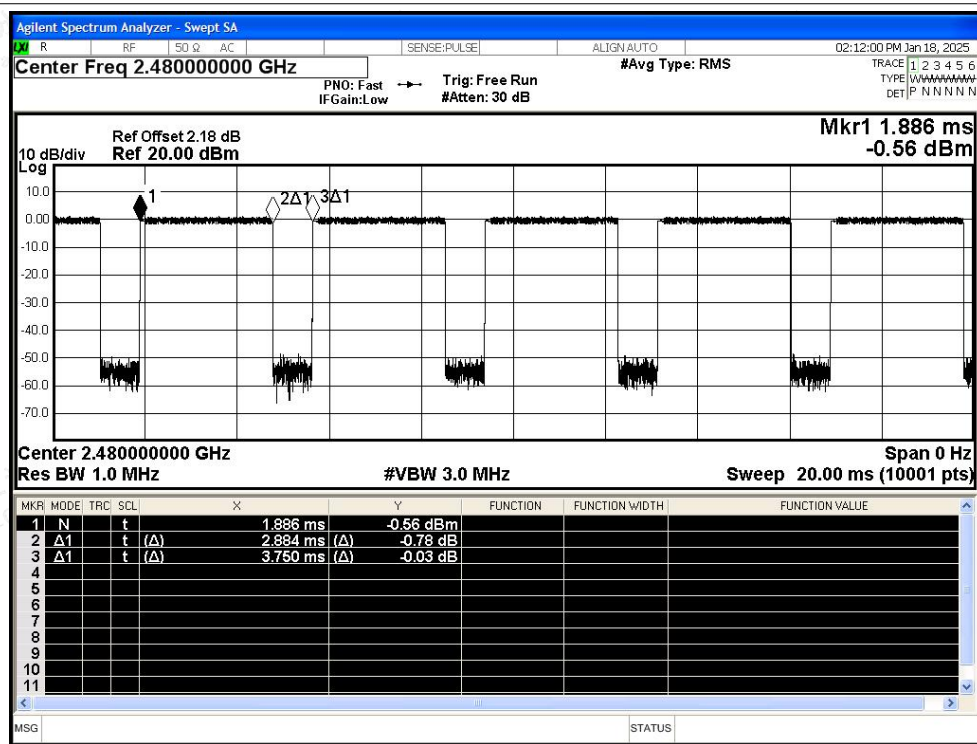

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

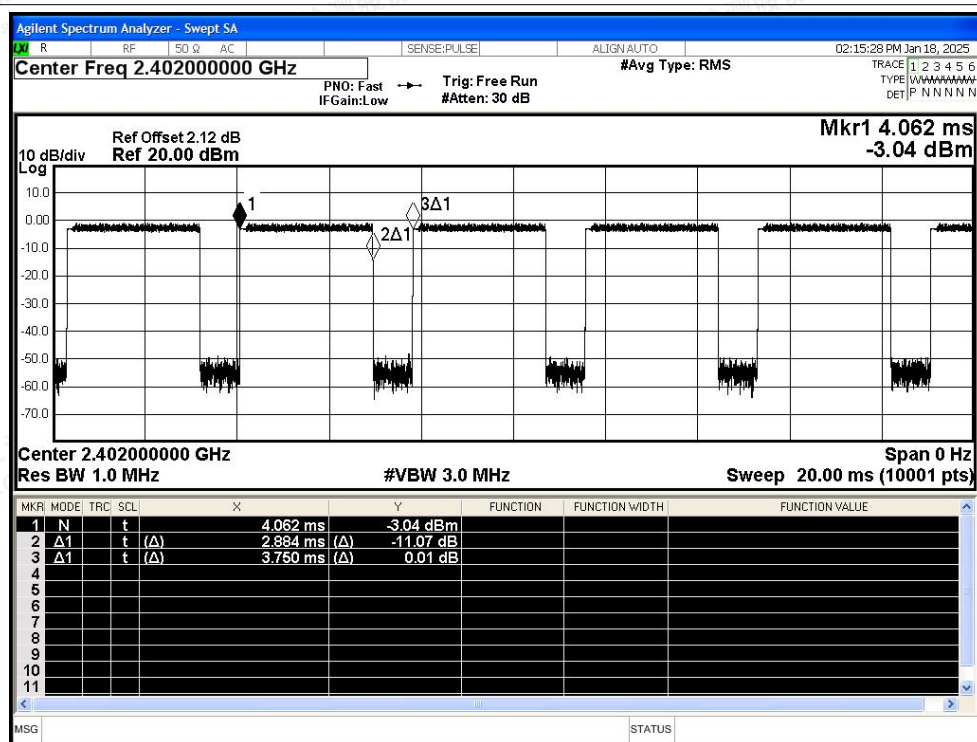

Duty Cycle NVNT 3-DH5 2441MHz Ant1

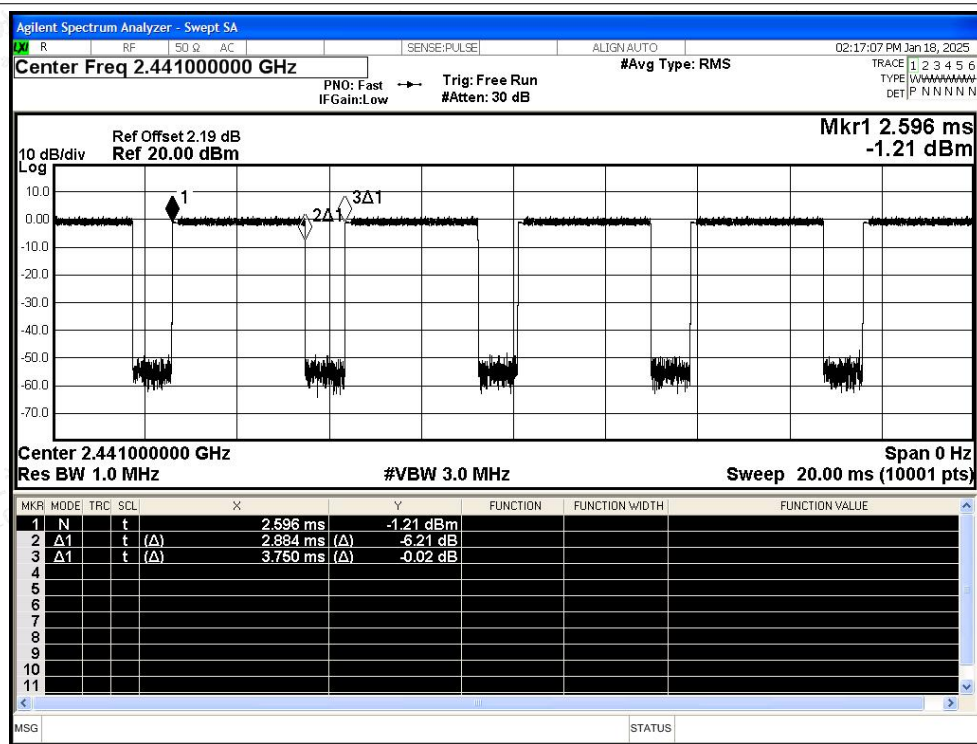


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

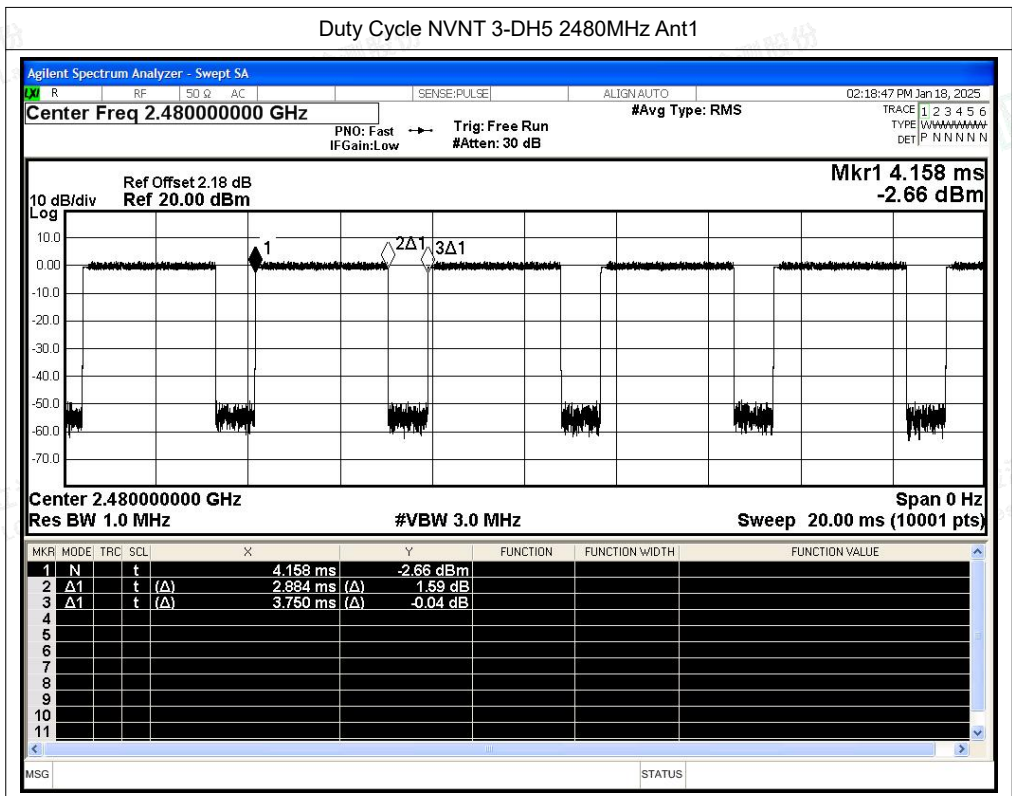



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-50.4	2	-	46.86	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.56	2	1.12	39.82	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2384.592	-47.53	2	-	49.73	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2389.392	-57.49	2	1.12	40.89	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-50.91	2	-	46.35	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.48	2	1.12	39.9	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-48.45	2	-	48.81	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-57.19	2	1.12	41.19	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2491.864	-47.03	2	-	50.23	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.704	-56.73	2	1.12	41.65	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-49.97	2	-	47.29	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-57.69	2	1.12	40.69	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-48.76	2	-	48.5	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.85	2	1.14	39.55	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2364.72	-47.72	2	-	49.54	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2379.216	-57.56	2	1.14	40.84	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-51.77	2	-	45.49	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-57.83	2	1.14	40.57	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-48.76	2	-	48.5	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-57.81	2	1.14	40.59	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2487.016	-46.54	2	-	50.72	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2484.88	-56.97	2	1.14	41.43	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-50.08	2	-	47.18	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-57.54	2	1.14	40.86	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-50.42	2	-	46.84	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-58.65	2	1.14	39.75	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2387.088	-47.13	2	-	50.13	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2367.6	-57.39	2	1.14	41.01	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-50.99	2	-	46.27	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.17	2	1.14	40.23	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-50.33	2	-	46.93	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-57.64	2	1.14	40.76	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2493.28	-46.47	2	-	50.79	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2484.232	-56.95	2	1.14	41.45	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-50.87	2	-	46.39	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-57.73	2	1.14	40.67	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

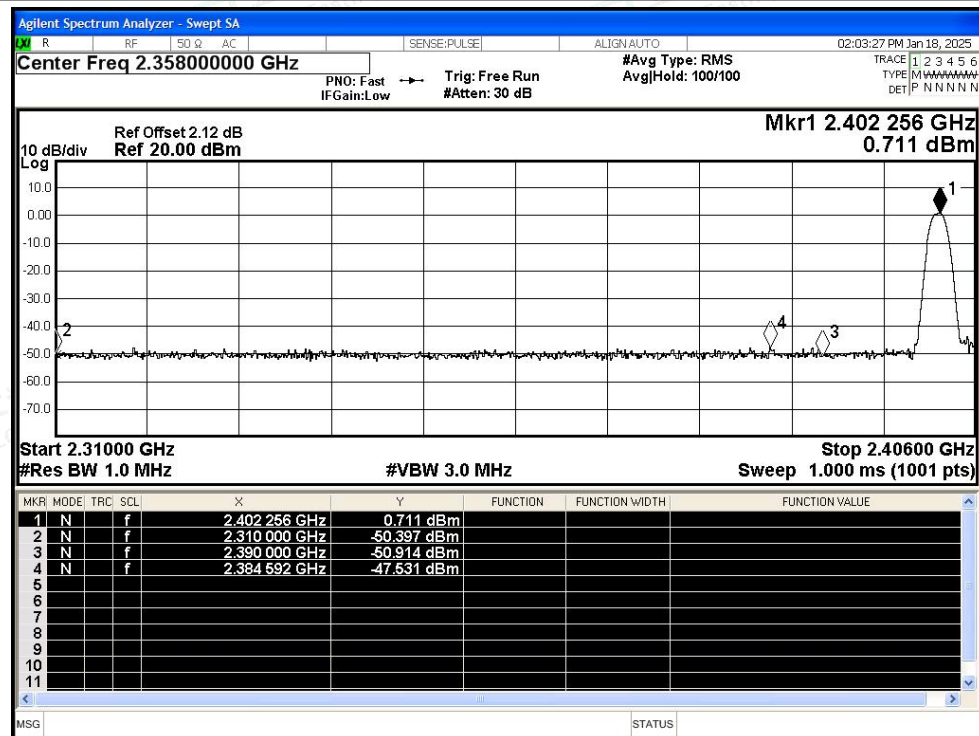

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

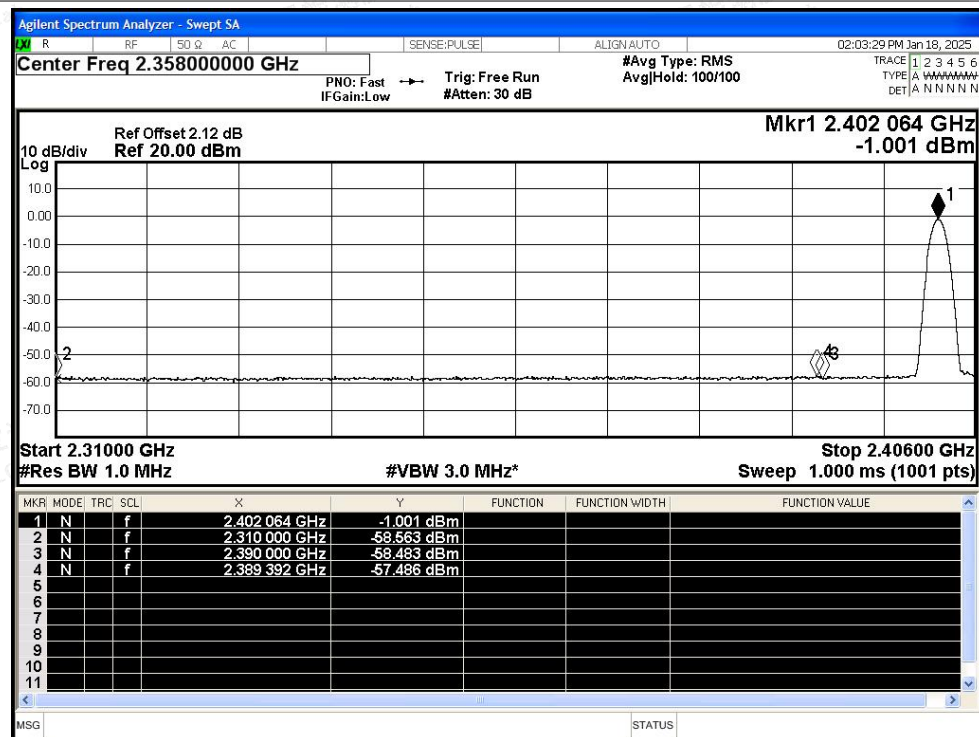

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

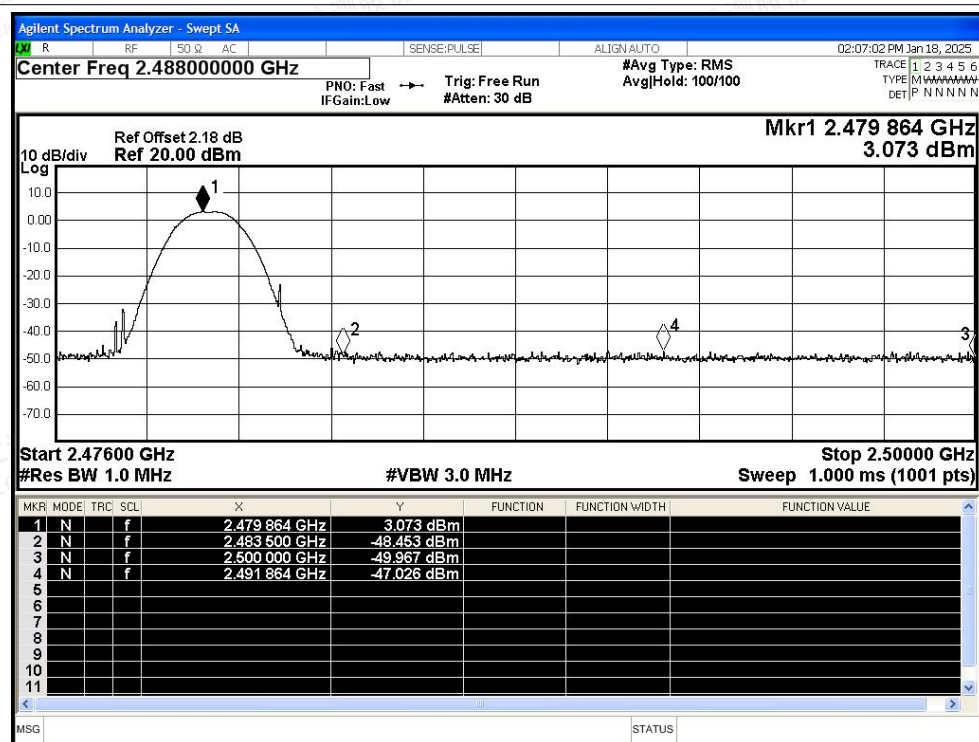

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average

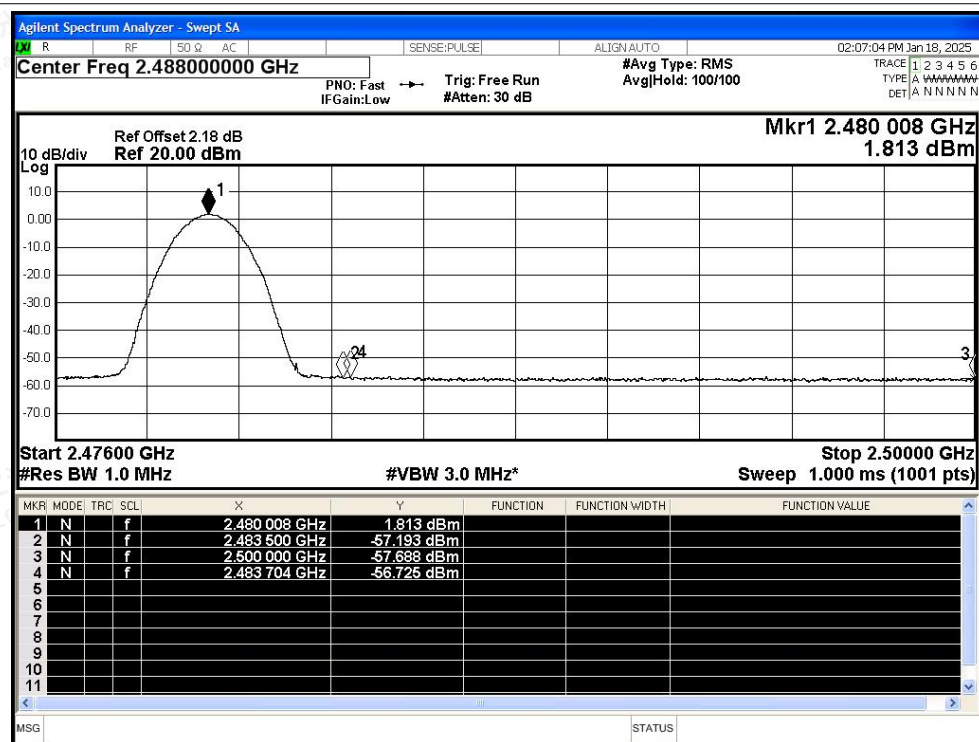

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity