




Report No.: HK08100781
WiFi Mode

Report No.:HK08100781
Scan Settings (1 Range)

Frequencies			Receiver Settings				
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF 60dB

Final Measurement: x QP / + AV
Meas Time: 1 s
Subranges: 16
Acc Margin: 20dB

Transducer No.	Start	Stop	Name
2 1	9k	30M	EW0700
3	9k	30M	EW2454
12	9k	30M	EW0090

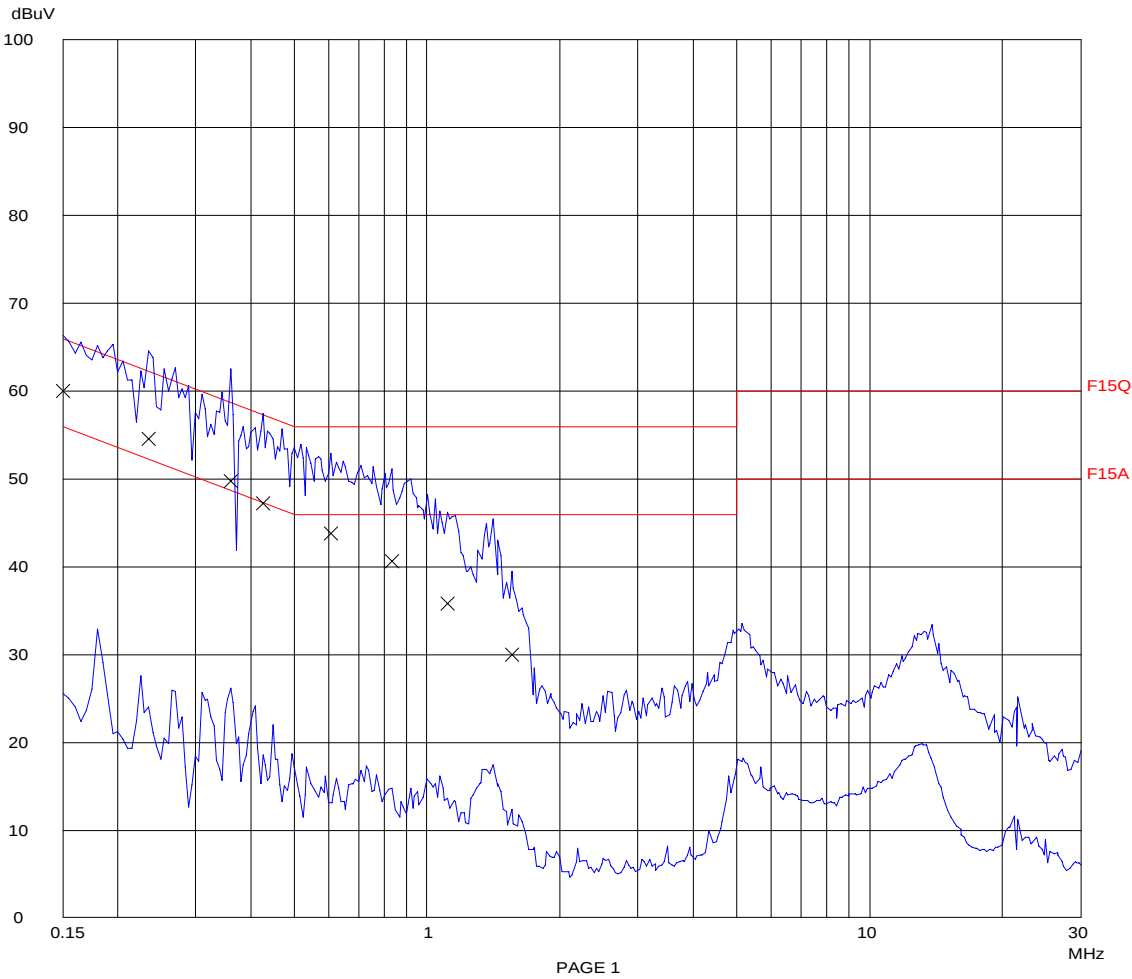



Report No.: HK08100781
WiFi Mode

Report No.:HK08100781

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency	QP Level	QP Limit	Delta
MHz	dBuV	dBuV	dB
0.15000	59.9	66.0	-6.1
0.23500	54.5	62.3	-7.8
0.36000	49.7	58.7	-9.0
0.42500	47.2	57.4	-10.2
0.60500	43.8	56.0	-12.2
0.83500	40.5	56.0	-15.5
1.11000	35.8	56.0	-20.2
1.55500	30.0	56.0	-26.0

Frequency	AV Level	AV Limit	Delta
MHz	dBuV	dBuV	dB

no Results

* limit exceed