TABLE OF CONTENTS LIST

APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

TEST REPORT:

PAGE 1-2....COVER SHEET - GENERAL INFORMATION & TECHNICAL DESCR. PAGE 3.....RF POWER OUTPUT PAGE 4.....MODULATION CHARACTERISTICS PAGE 5.....AUDIO FREQUENCY RESPONSE PLOT PAGE 6.....MODULATION LIMITING PLOT - 300 Hz PAGE 7.....MODULATION LIMITING PLOT - 1000 Hz PAGE 8.....MODULATION LIMITING PLOT - 3000 Hz PAGE 9.....AUDIO LOW PASS FILTER PLOT PAGE 10....OCCUPIED BANDWIDTH PAGE 11.....OCCUPIED BANDWIDTH PLOT - CW PAGE 12.....OCCUPIED BANDWIDTH PLOT - 2.5K TONE PAGE 13.....METHOD OF MEASURING OCCUPIED BANDWIDTH PAGE 14.....FIELD STRENGTH OF SPURIOUS EMISSIONS PAGE 15.....METHOD OF MEASURING RADIATED SPURIOUS EMISSIONS PAGE 16.....FREQUENCY STABILITY PAGE 17.....LIST OF TEST EQUIPMENT

EXHIBITS CONTAINING:

EXHIBIT 1......FCC ID LABEL SAMPLE AND SKETCH OF LOCATION EXHIBIT 2......EXTERNAL PHOTO - FRONT VIEW

EXHIBIT 3......EXTERNAL PHOTO - REAR VIEW

EXHIBIT 4......INTERNAL PHOTO - COMPONENT VIEW - W SHIELD EXHIBIT 5.....INTERNAL PHOTO - COMPONENT SIDE -W/O SHIELD EXHIBIT 6.....INTERNAL PHOTO - SOLDER EXHIBIT 7.....BLOCK DIAGRAM EXHIBIT 8.....SCHEMATIC EXHIBIT 9.....USER'S MANUAL EXHIBIT 10.....CIRCUIT DESCRIPTION EXHIBIT 11.....TUNING PROCEDURE EXHIBIT 12.....TEST SET UP PHOTO

APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

TABLE OF CONTENTS LIST

GENERAL_INFORMATION_REQUIRED FOR TYPE ACCEPTANCE

2.1033(c)(1)(2)SB TELCOM CO., LTD.will manufacture the FCCID: OTVSBTFR541-2 FAMILY RADIO SERVICES 14 CHANNEL TRANSCEIVER in quantity, for use under FCC RULES PART 95. The UUT is a PTT Radio with a maximum duty cycle of 50%.

SB TELCOM CO., LTD. #25-49, JUAN5-DONG, NAM-KU INCHEON KOREA

- 2.1033 (c) TECHNICAL_DESCRIPTION
- 2.1033(c)(3) Instruction book. A draft copy of the instruction manual is included as EXHIBIT 6A-6J.
- 2.1033(c) (4) Type of Emission: 9K8F3E 95.631

Bn = 2M + 2DK M = 3000D = 1900

Bn = 2(3000) + 2(1900) = 9.8K

Authorized Bandwidth 12.5 kHz

2.1033(c)(5) Frequency Range: 1. 462.5625 8. 467.5625 95.627 2. 462.5875 9. 467.5875 3. 462.6125 10. 467.6125 4. 462.6375 11. 467.6375 5. 462.6625 12. 467.6625

6. 462.6875 13. 467.6875 7. 462.7125 14. 467.7125 MHz

- 2.1033(c)(6)(7) Power Output shall not exceed 0.500Watts effective 95.639 radiated power. There can be no provisions for 95.649 increasing the power or varying the power.
- 95.647 The antenna is an integral part to the unit, it cannot be removed without rendering the unit inoperative. In order to remove the antenna the case must unscrewed, then the PCB assemblies must be removed then the antenna can be removed.
 - 2.1033(c)(8) DC Voltages and Current into Final Amplifier:
 FINAL AMPLIFIER ONLY
 Vce = 6.0 Volts DC Ice = 0.20A.
 Pin = 1.2 Watts

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 1 of 17

- 2.1033(c)(9) Tune-up procedure. The tune-up procedure is included in the IN USER'S MANUAL.
- 2.1033(c)(10) Complete Circuit Diagrams: The circuit diagram is included as EXHIBIT 5 of this report. The block diagram is included as EXHIBIT 4 of this report.
- 2.1033(c)(11) A photograph or a drawing of the equipment identifica tion label is included as exhibit No. 2.
- 2.1033(c)(12) Photographs(8"X10") of the equipment of sufficient clarity to reveal equipment construction and layout, including meters, labels for controls, including any view under shields See EXHIBIT 3A-3H.
- 2.1033(c)(13) Digital modulation is not allowed.
- 2.1033(c)(14) The data required by 2.1046 through 2.1057 is submitted below.

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc


Page 2 of 17

2.1046(a) RF_power_output.

95.639

RF power is measured by measuring the radiated power at 3 meters and then replacing the transmitter with a signal generator to determine the effective radiated power. The ERP shall not exceed 0.500 Watts.

MEASURED POWER OUTPUT = 200 milliWatts ERP

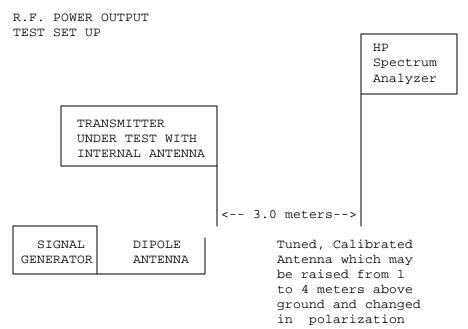

Equipment placed 80cm above ground on a rotatable platform.

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 3 of 17

2.1047(a)(b) Modulation_characteristics:

AUDIO_FREQUENCY_RESPONSE

The audio frequency response was measured in accordance with TIA/EIA Specification 603. The audio frequency response curve is shown on page 5. The audio signal was fed into a dummy microphone circuit and into the microphone connector. The input required to produce 30 percent modulation level was measured.

2.1047(b) Audio_input_versus_modulation


The audio input level needed for a particular perpercentage of modulation was measured in accordance with TIA/EIA Specification 603. The audio input curves versus modulation are shown in pages 6-8. Curves are provided for audio input frequen cies of 300, 1000, and 3000 Hz.

95.637(b) Post Limiter Filter The filter must be between the modulation limiter and the modulated stage. At any frequency between 3 & 20KHz the filter must have an attenuation of 60log (f/3) greater that the attenuation at 1KHz. See the plot; page 9.

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc


Page 4 of 17

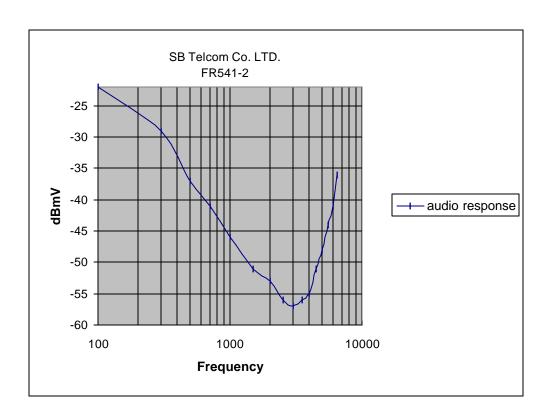

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc


Page 5 of 17

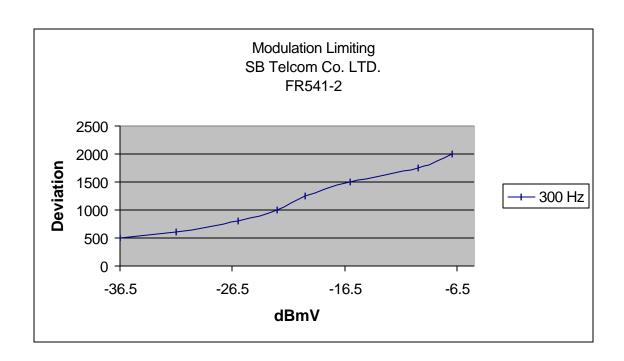

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc


Page 6 of 17

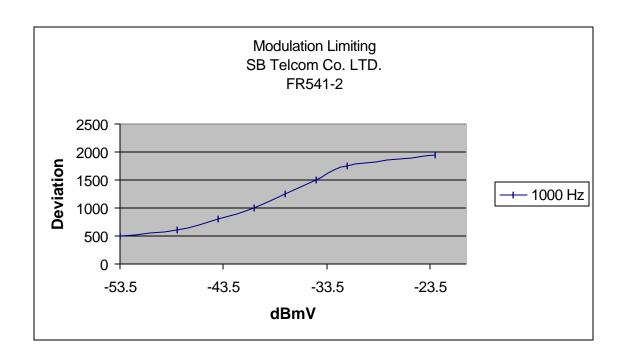

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc


Page 7 of 17

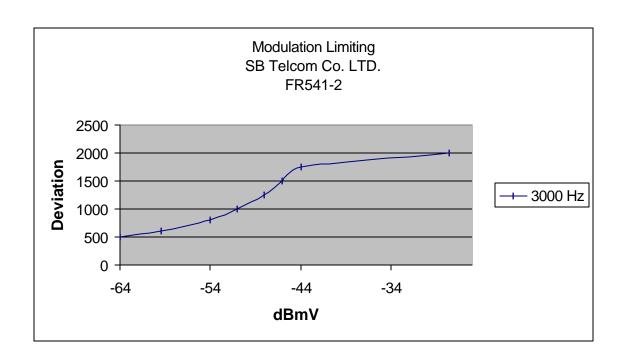

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 8 of 17

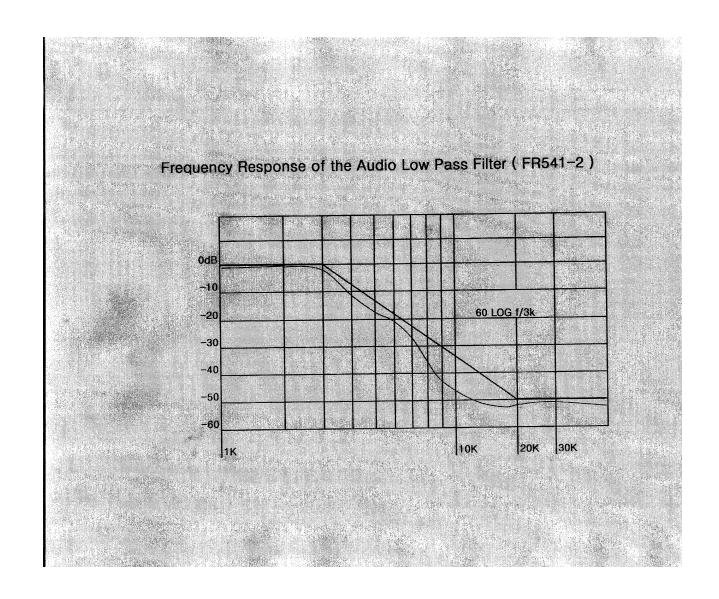

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 9 of 17

2.1049(c) <u>EMISSION BANDWIDTH:</u> 95.633(c)


Data in the plots shows that the sidebands from greater than 50% to 100% of the authorized bandwidth must be attenuated by at least 25dB and from 100 to 250% the sidebands must be attenuated by at least 35dB. Beyond 250% the sidebands must be attenuated by at least 43+log10(TP). The transmitter was modulated with 2500 Hz, adjusted for 50% modulation plus 16 dB. The spectrum analyzer was set with the unmodulated carrier at the top of the screen. The test procedure diagram follows. See the occupied bandwidth plots; pages 11, 12.

APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc


Page 10 of 17

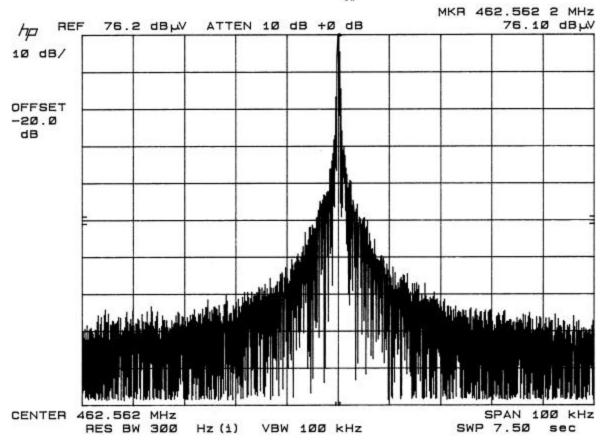

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 11 of 17

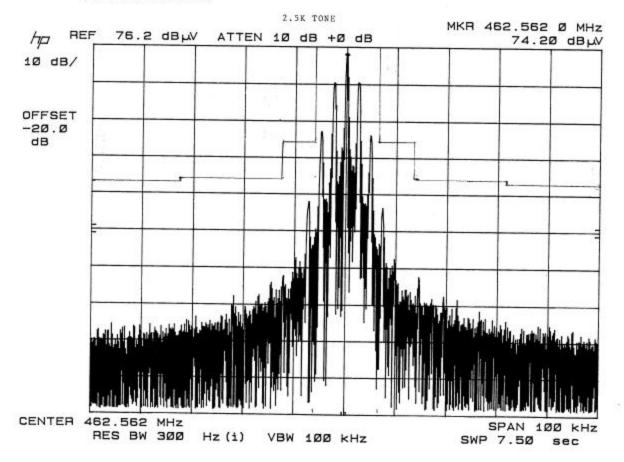

FCC ID: OTVSBTFR541-2


REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 12 of 17

Radiotelephone transmitter with modulation limiter.

Test procedure diagram

OCCUPIED BANDWIDTH MEASUREMENT

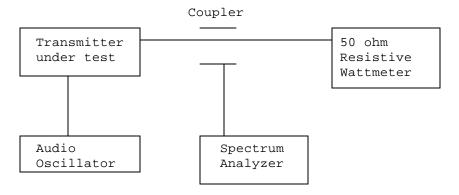

APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

 $REPORT \#: T:\S\SBTELE\1284 ak 1\1284 AK 1 Test Report. doc$

Page 13 of 17

2.1051 Not Applicable, no antenna terminal allowed.

2.1053 <u>UNWANTED_RADIATION</u>:

95.635(b)(4)

REQUIREMENTS: Emissions must be attenuated by at least the

following below the output of the

transmitter.

 $43 + 10\log(TP) = 43 + 10\log(0.2) = 36.01 dB$

TEST DATA:

| Emission | Field | ATTN | |
|-----------|----------------------------|-------|--------|
| Frequency | Strength | dbc | Margin |
| MHz | \mathtt{dBuv}/\mathtt{m} | | đВ |
| 462.60 | 120 60 | 0 00 | 0 00 |
| 462.60 | 120.69 | 0.00 | 0.00 |
| 925.30 | 67.28 | 53.41 | 17.40 |
| 1,388.00 | 76.92 | 43.77 | 7.76 |
| 1,850.70 | 78.09 | 42.60 | 6.59 |
| 2,313.40 | 66.67 | 54.02 | 18.01 |
| 2,776.00 | 64.09 | 56.60 | 20.59 |
| 3,238.70 | 72.33 | 48.36 | 12.35 |
| 3,701.40 | 68.41 | 52.28 | 16.27 |
| 4,164.10 | 67.06 | 53.63 | 17.62 |
| 4,626.80 | 67.32 | 53.37 | 17.36 |
| | | | |

MARGIN = (Field strength of Fund - 36.01 dB) - FS OF EMISSION

METHOD OF MEASUREMENT: The tabulated data shows the results of the radiated field strength of emissions test. The spectrum was scanned from 30 to at least the tenth harmonic of the fundamental. This test was conducted per TIA/EIA STANDARD 603 using the substitution method. Measurements were made at the open field test site of TIMCO ENGINEERING, INC. located at 849 NW State Road 45, Newberry, FL 32669.


APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 14 of 17

Method of Measuring Radiated Spurious Emissions

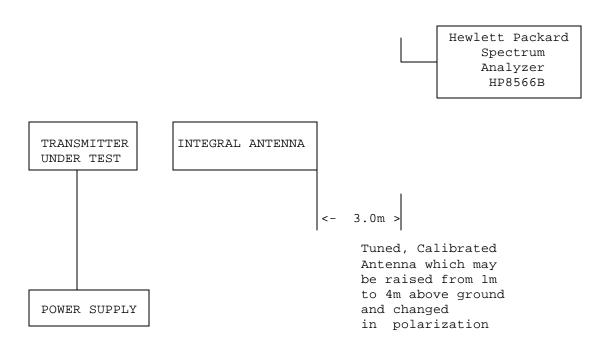

Equipment placed 80cm above ground on a rotatable platform.

APPLICANT: SB TELCOM CO., LTD. FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 15 of 17

2.1055 Frequncy_stability:

Temperature and voltage tests were performed to verify that the frequency remains within the 0.00025%, 2.5 ppm specification limit. The test was conducted as follows: The transmitter was placed in the temperature chamber at 25 degrees C and allowed to stabilize for one hour. The transmitter was keyed ON for one minute during which four frequency readings were recorded at 15 second intervals. The worse case number was taken for temperature plotting. The assigned channel frequency was considered to be the reference frequency. The temperature was then reduced to -20degrees C after which the transmitter was again allowed to stabilize for one hour. The transmitter was keyed ON for one minute, and again frequency readings were noted at 15 second intervals. The worst case number was recorded for temperature plotting. This procedure was repeated in 10 degree increments up to + 50 degrees C.

Readings were also taken at plus and minus 15% of the battery voltage of 6 VDC.

MEASUREMENT DATA:

Assigned Frequency (Ref. Frequency): 462.562 500

| TEMPERATURE °C | FREQUENCY MHz | PPM |
|-------------------------|---------------|-------|
| REFERENCE | 462.562 500 | 00.00 |
| -20 | 462.563 654 | 2.49 |
| -10 | 462.563 161 | 1.43 |
| 0 | 462.562 956 | 0.99 |
| +10 | 462.562 853 | 0.76 |
| +20 | 462.562 593 | 0.20 |
| +30 | 462.562 139 | -0.78 |
| +40 | 462.561 706 | -1.72 |
| +50 | 462.561 557 | -2.04 |
| | | |
| BATT. End-Point 5.1V/dc | 462.562 191 | -0.67 |
| BATT. End-Point 6.9V/dc | 462.562 188 | -0.67 |

RESULTS OF MEASUREMENTS: The maximum frequency variation over the temperature range was -2.04 to +2.49ppm. The maximum frequency variation with voltage was -0.67 ppm.

APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

REPORT #: T:\S\SBTELE\1284ak1\1284AK1TestReport.doc

Page 16 of 17

FCC ID: OTVSBTFR541-2

TEST EQUIPMENT LIST

- 1._X_Spectrum Analyzer: HP 8566B-Opt 462, S/N 3138A07786, w/
 preselector HP 85685A, S/N 3221A01400, Quasi-Peak Adapter
 HP 85650A, S/N 3303A01690 & Preamplifier HP 8449B-OPT H02,
 S/N 3008A00372 Cal. 8/31/01 Due 8/31/02
- 3.__ Biconnical Antenna: Electro-Metrics Model BIA-25, S/N 1171 Cal. 4/26/01 Due 4/26/03
- 4.__ Log-Periodic Antenna: Electro-Metrics Model EM-6950, S/N 632 Char. 10/15/01 Due 10/15/02
- 5.__ Log-Periodic Antenna: Electro-Metrics Model LPA-30, S/N 409 Char. 10/16/01 Due 10/16/02
- 7._X_Double-Ridged Horn Antenna: Electro-Metrics Model RGA-180, 1-18 GHz, S/N 2319 Cal. 12/19/01 Due 12/19/02
- 8.__ 18-26.3GHz Systron Donner Standard Gain Horn #DBE-520-20 No Cal Required
- 9. Horn 40-60GHz: ATM Part #19-443-6R No Cal Required
- 10.__ Line Impedance Stabilization Network: Electro-Metrics Model EM-7820, w/NEMA Adapter S/N 2682 Cal. 3/16/01 Due 3/16/02
- 11._X_Temperature Chamber: Tenney Engineering Model TTRC, S/N 11717-7 Char. 1/27/01 Due 1/27/02

- 14._X_Open Area Test Site #1-3meters Cal. 12/22/99
- 15.__ Signal Generator: HP 8640B, S/N 2308A21464 Cal. 11/15/01 Due 11/15/02
- 16.__ Passive Loop Antenna: EMCO Model 6512, 9KHz to 30MHz, S/N
 9706-1211 Char. 7/10/01 Due 7/10/02
- 17.__ Dipole Antenna Kit: Electro-Metrics Model TDA-30/1-4, S/N 152 Cal. 3/21/01 Due 3/21/02
- 18.__ AC Voltmeter: HP Model 400FL, S/N 2213A14499
 Cal. 10/9/01 Due 10/09/02
- 19._X_Digital Multimeter: Fluke Model 77, S/N 35053830 Char. 1/11/01 Due 1/11/02
- 20.__ Oscilloscope: Tektronix Model 2230, S/N 300572 Char. 2/1/01 Due 2/1/02

APPLICANT: SB TELCOM CO., LTD.

FCC ID: OTVSBTFR541-2

 $REPORT \#: T:\S\SBTELE\1284 ak 1\1284 AK 1 Test Report. doc$

Page 17 of 17