



Report No.: 9909714

Tested By: Hong, Report No.: 9909714

Scan Settings (1 Range)

----- Frequencies ----- Receiver Settings -----

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB


Final Measurement: x QP

Meas Time: 1 s

Subranges: 16

Acc Margin: 20dB

Transducer No.	Start	Stop	Name
3	9k	30M	EI078

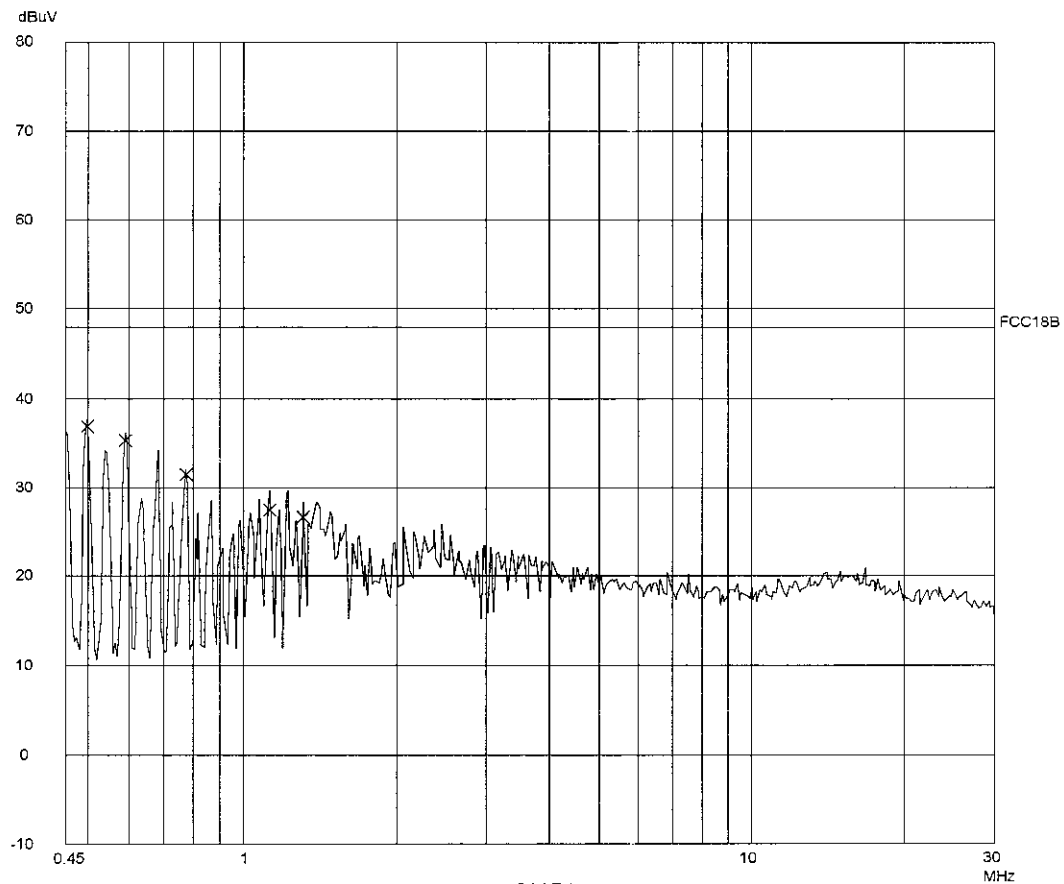



Intertek Testing Services

ETL SEMKO

Report No.: 9909714

Tested By: Hong, Report No.: 9909714

Scan Settings (1 Range)

|----- Frequencies -----|----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency	QP Level	QP Limit
MHz	dBuV	dBuV
0.50000	36.9	48.0
0.59000	35.3	48.0
0.77500	31.4	48.0
1.13000	27.4	48.0
1.31500	26.7	48.0

* limit exceeded