





Restrict Band NVNT ac20 5240MHz Ant1 Peak

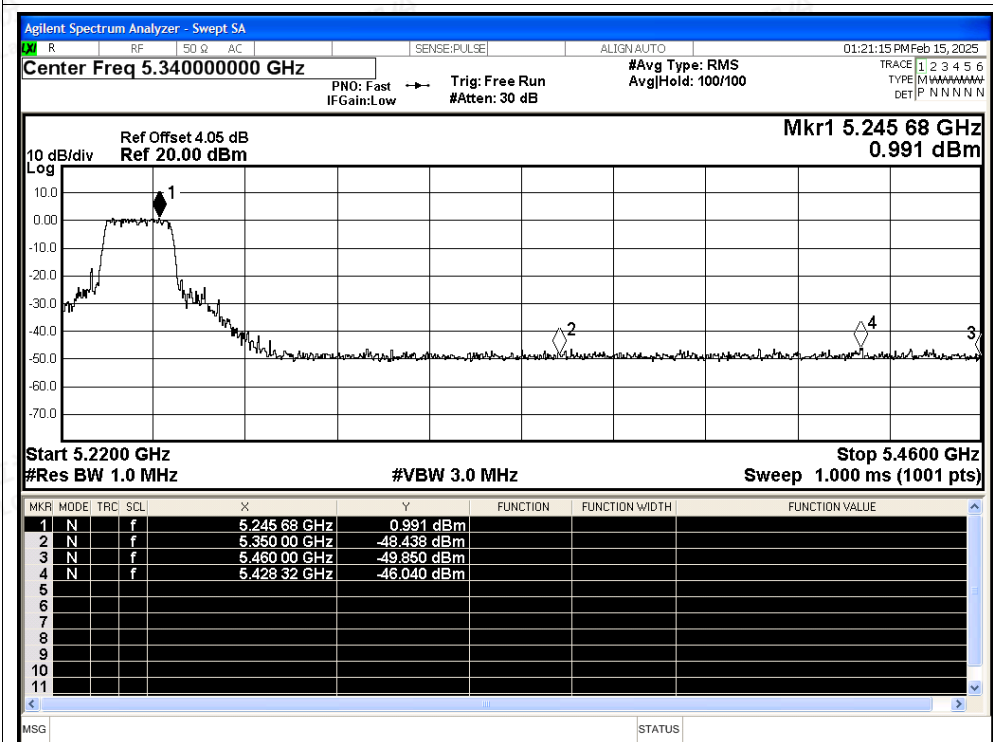

Restrict Band NVNT ac20 5240MHz Ant1 Average

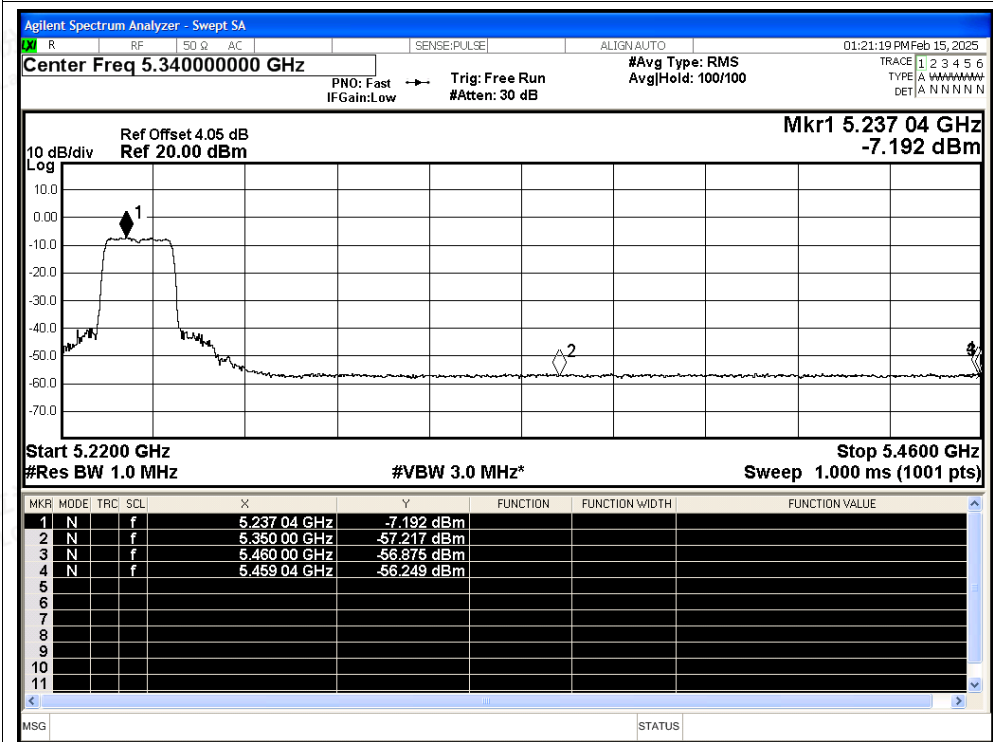

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

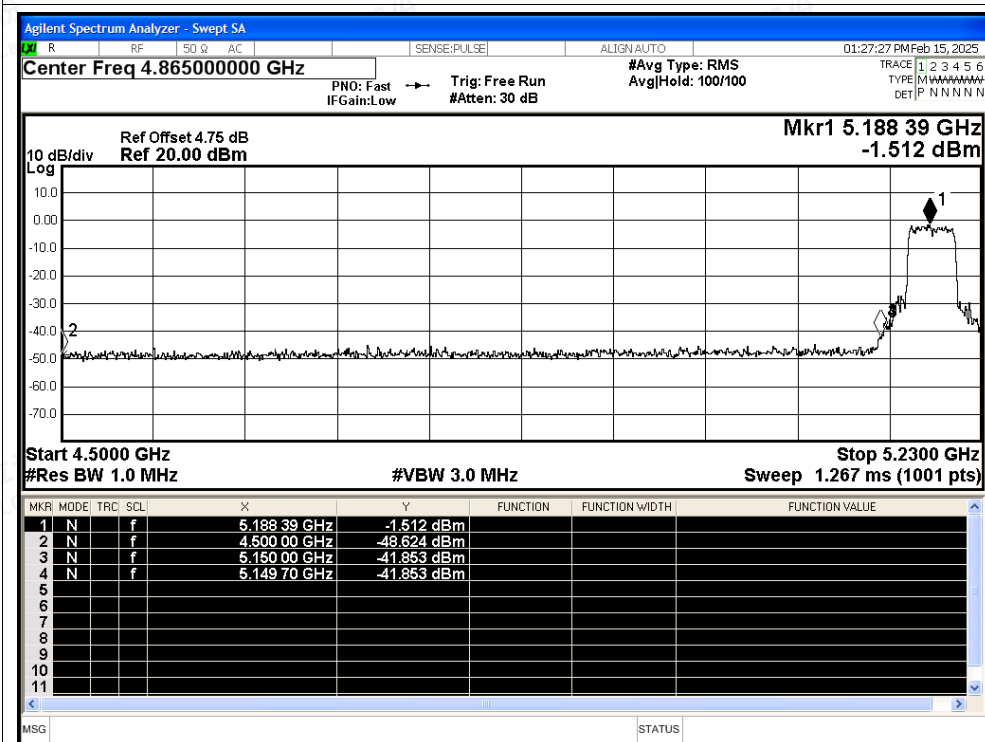

Restrict Band NVNT ac40 5190MHz Ant1 Average

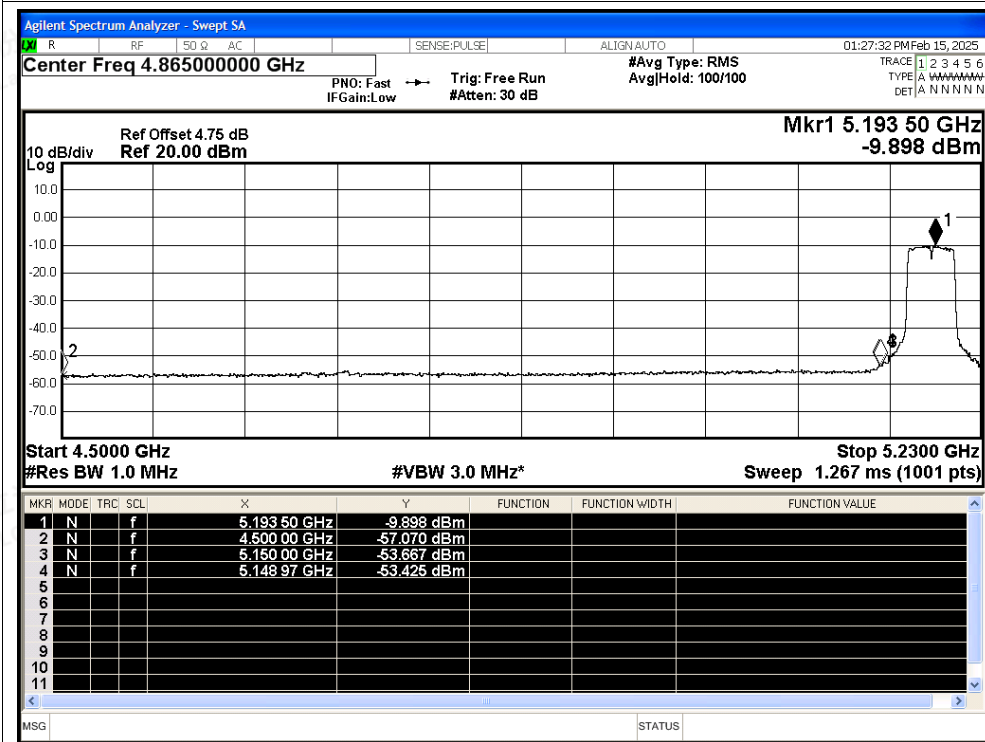

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

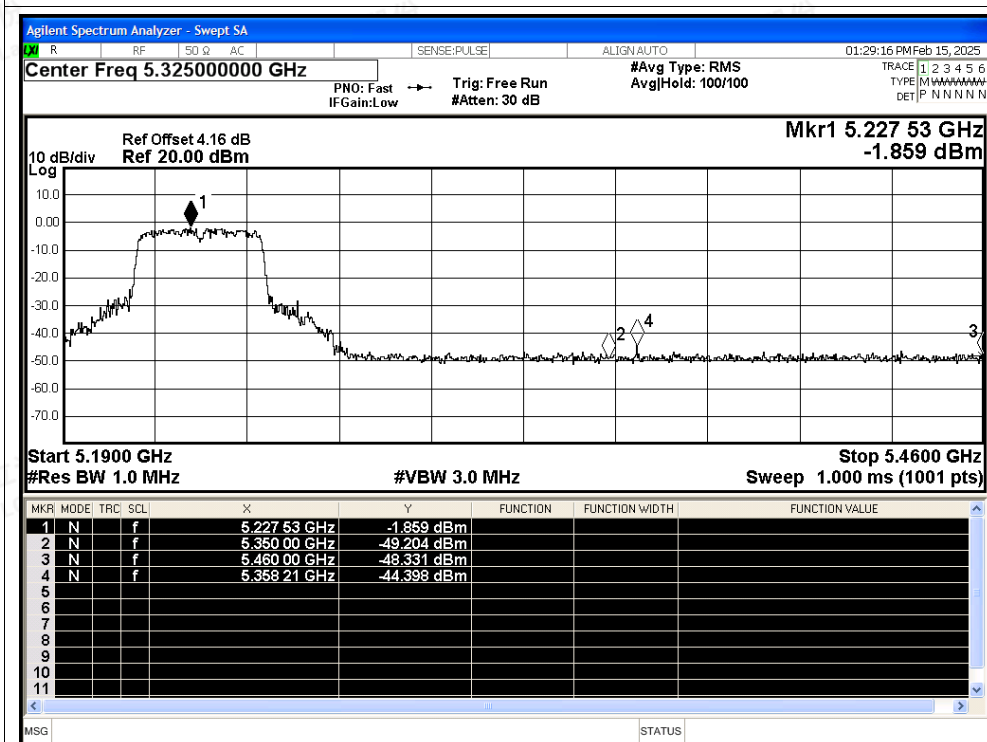

Restrict Band NVNT ac40 5230MHz Ant1 Average

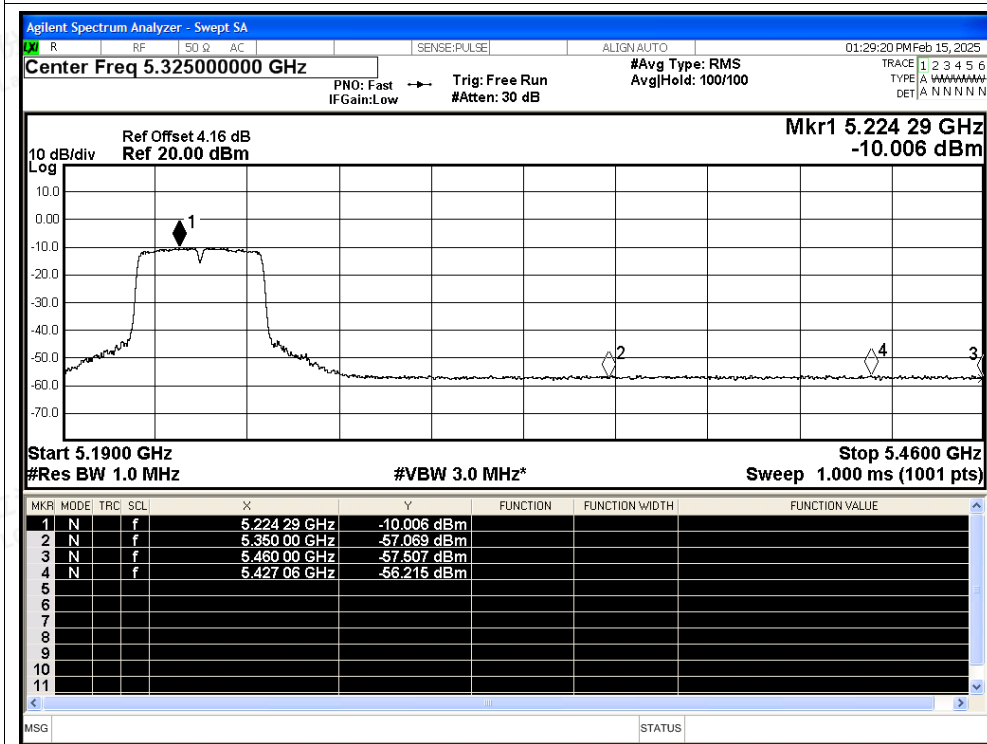

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

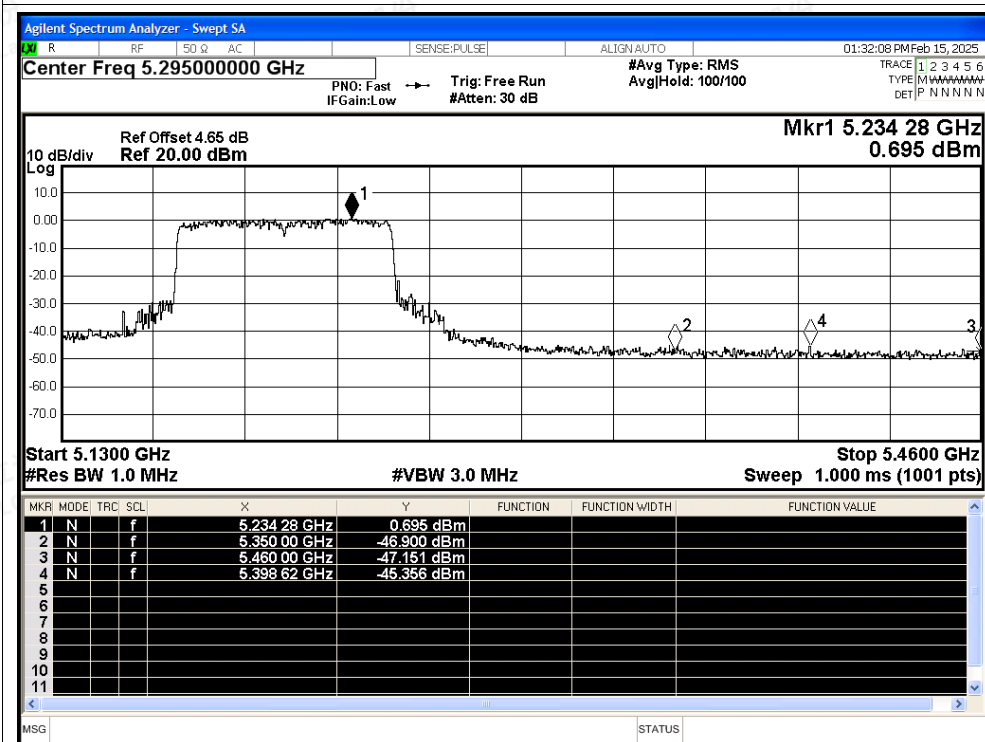

Restrict Band NVNT ac80 5210MHz Ant1 Average

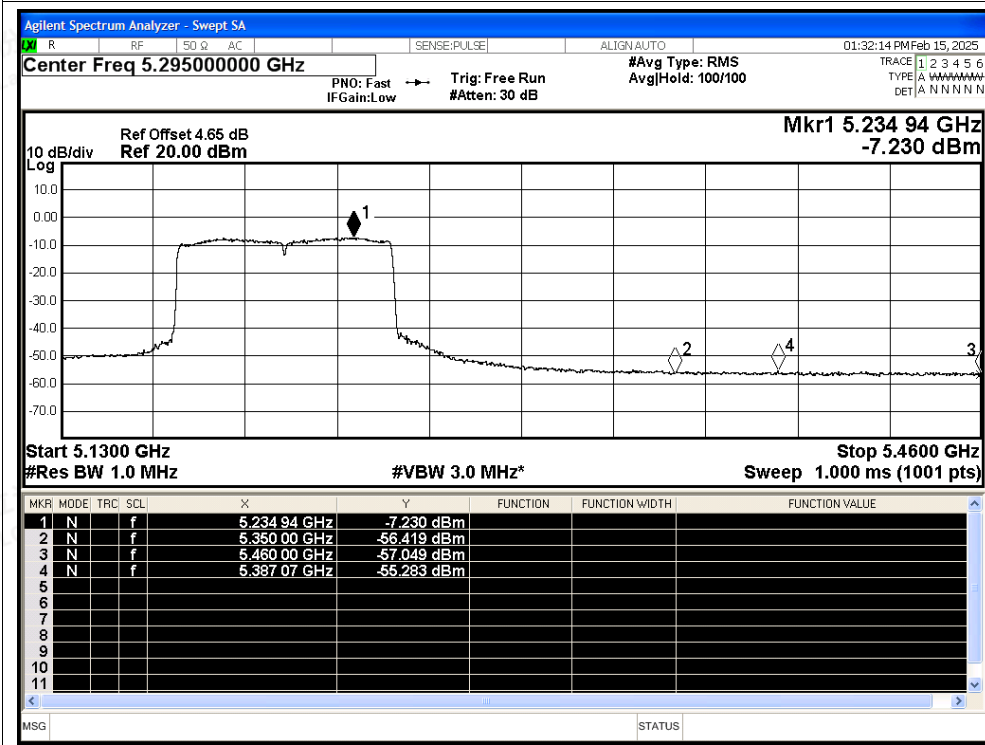

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

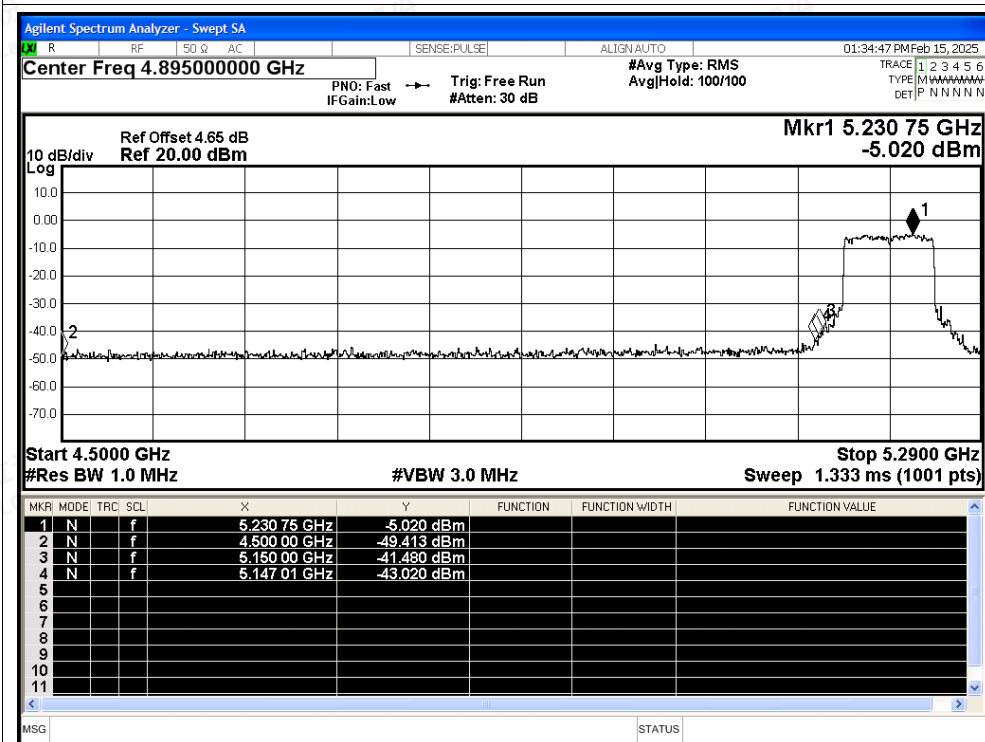

Restrict Band NVNT ac80 5210MHz Ant1 Average

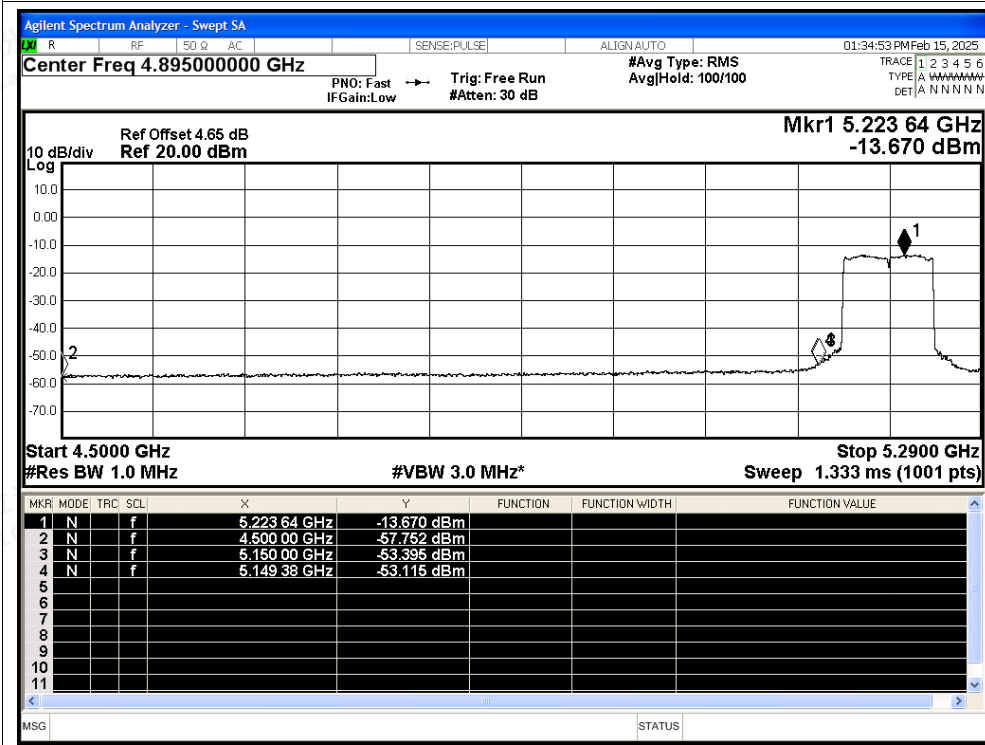

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-49.06	2.88	-	49.05	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-57.06	2.88	0.24	41.29	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-44.84	2.88	-	53.27	Peak	68.2	Pass
NVNT	a	5180	Ant2	5148.2	-54.77	2.88	0.24	43.58	Average	54	Pass
NVNT	a	5180	Ant2	5150	-42.83	2.88	-	55.28	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-54.21	2.88	0.24	44.14	Average	54	Pass
NVNT	a	5240	Ant2	5350	-47.83	2.88	-	50.28	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-56.33	2.88	0.24	42.02	Average	54	Pass
NVNT	a	5240	Ant2	5439.84	-46.59	2.88	-	51.52	Peak	68.2	Pass
NVNT	a	5240	Ant2	5360.4	-55.77	2.88	0.24	42.58	Average	54	Pass
NVNT	a	5240	Ant2	5460	-47.81	2.88	-	50.30	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-56.97	2.88	0.24	41.38	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-48.84	2.88	-	49.27	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-57.53	2.88	0.12	40.70	Average	54	Pass
NVNT	n20	5180	Ant2	5147.5	-44.02	2.88	-	54.09	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-53.86	2.88	0.12	44.37	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-43.66	2.88	-	54.45	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-53.69	2.88	0.12	44.54	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-48.08	2.88	-	50.03	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.41	2.88	0.12	40.82	Average	54	Pass
NVNT	n20	5240	Ant2	5451.6	-45.74	2.88	-	52.37	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5452.56	-56.33	2.88	0.12	41.90	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-49.13	2.88	-	48.98	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57.11	2.88	0.12	41.12	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-50.69	2.88	-	47.42	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-57.75	2.88	0.24	40.60	Average	54	Pass
NVNT	n40	5190	Ant2	5149.7	-40.45	2.88	-	57.66	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-53.4	2.88	0.24	44.95	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-40.45	2.88	-	57.66	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-53.4	2.88	0.24	44.95	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-50.47	2.88	-	47.64	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-57.24	2.88	0.24	41.11	Average	54	Pass
NVNT	n40	5230	Ant2	5400.06	-45.88	2.88	-	52.23	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5402.22	-56.19	2.88	0.24	42.16	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-49.07	2.88	-	49.04	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-56.63	2.88	0.24	41.72	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-48.88	2.88	-	49.23	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-56.9	2.88	0.12	41.33	Average	54	Pass
NVNT	ac20	5180	Ant2	5149.6	-43.52	2.88	-	54.59	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5149.6	-54.55	2.88	0.12	43.68	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-43.11	2.88	-	55.00	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-53.95	2.88	0.12	44.28	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-47.8	2.88	-	50.31	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-56.62	2.88	0.12	41.61	Average	54	Pass
NVNT	ac20	5240	Ant2	5377.2	-46.21	2.88	-	51.90	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5376.48	-56.38	2.88	0.12	41.85	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-46.46	2.88	-	51.65	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.71	2.88	0.12	40.52	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-48.77	2.88	-	49.34	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-56.86	2.88	0.24	41.49	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-42.77	2.88	-	55.34	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-52.8	2.88	0.24	45.55	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-42.77	2.88	-	55.34	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-53.93	2.88	0.24	44.42	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-49.5	2.88	-	48.61	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-57.46	2.88	0.24	40.89	Average	54	Pass
NVNT	ac40	5230	Ant2	5361.18	-45.94	2.88	-	52.17	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5433.27	-56.23	2.88	0.24	42.12	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-48.51	2.88	-	49.60	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-56.99	2.88	0.24	41.36	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.62	2.88	-	49.49	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-55.87	2.88	0.25	42.49	Average	54	Pass
NVNT	ac80	5210	Ant2	5364.96	-45.66	2.88	-	52.45	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5360.67	-55.41	2.88	0.25	42.95	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-48.11	2.88	-	50.00	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.17	2.88	0.25	42.19	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-47.57	2.88	-	50.54	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-57.72	2.88	0.25	40.64	Average	54	Pass
NVNT	ac80	5210	Ant2	5144.64	-43.86	2.88	-	54.25	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5148.59	-53.21	2.88	0.25	45.15	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-44.18	2.88	-	53.93	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-53.32	2.88	0.25	45.04	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

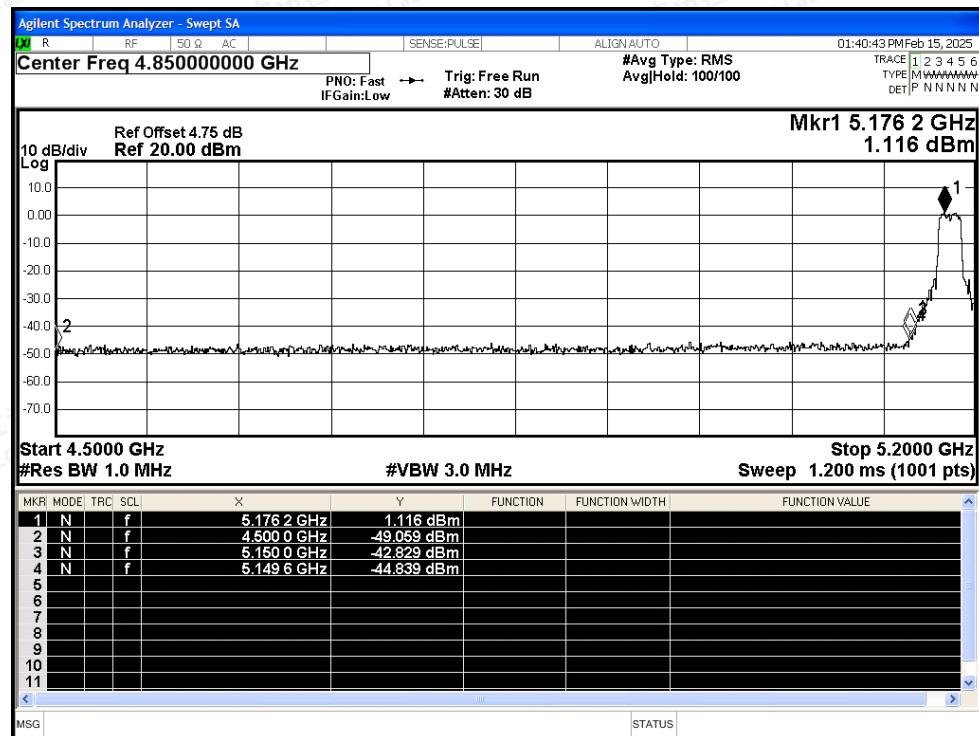

Restrict Band NVNT a 5180MHz Ant2 Average

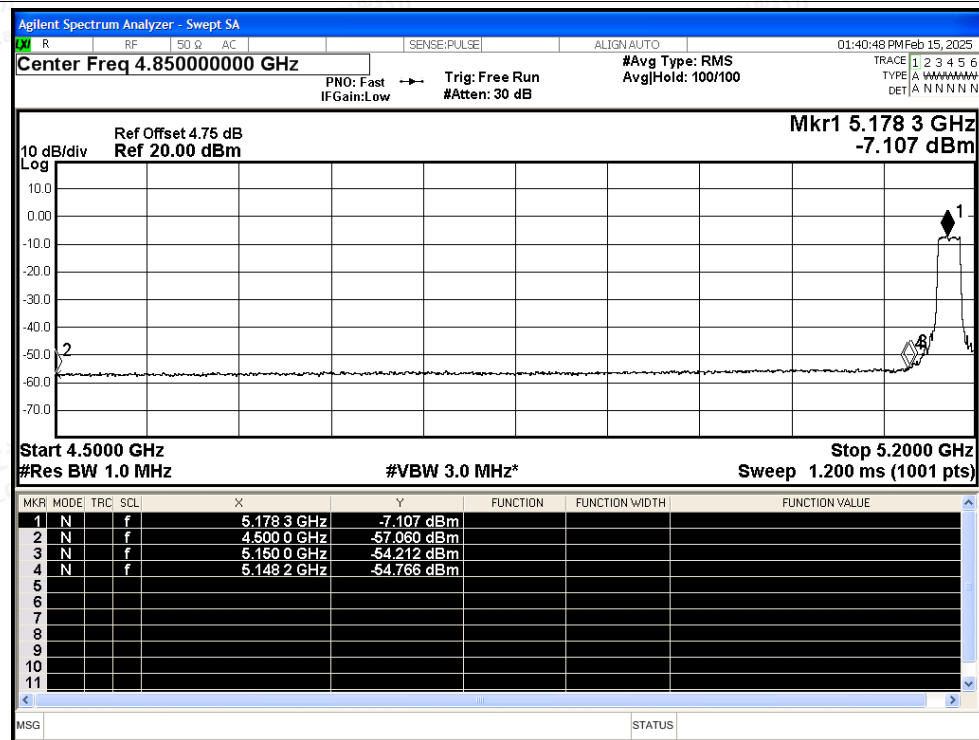

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

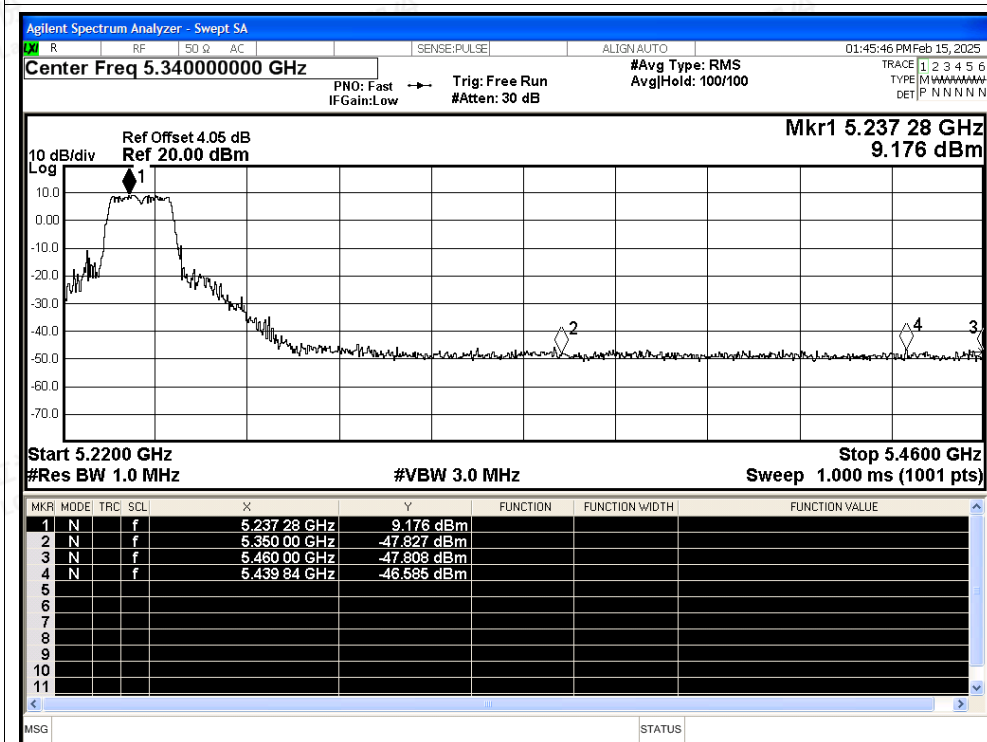

Restrict Band NVNT a 5240MHz Ant2 Average

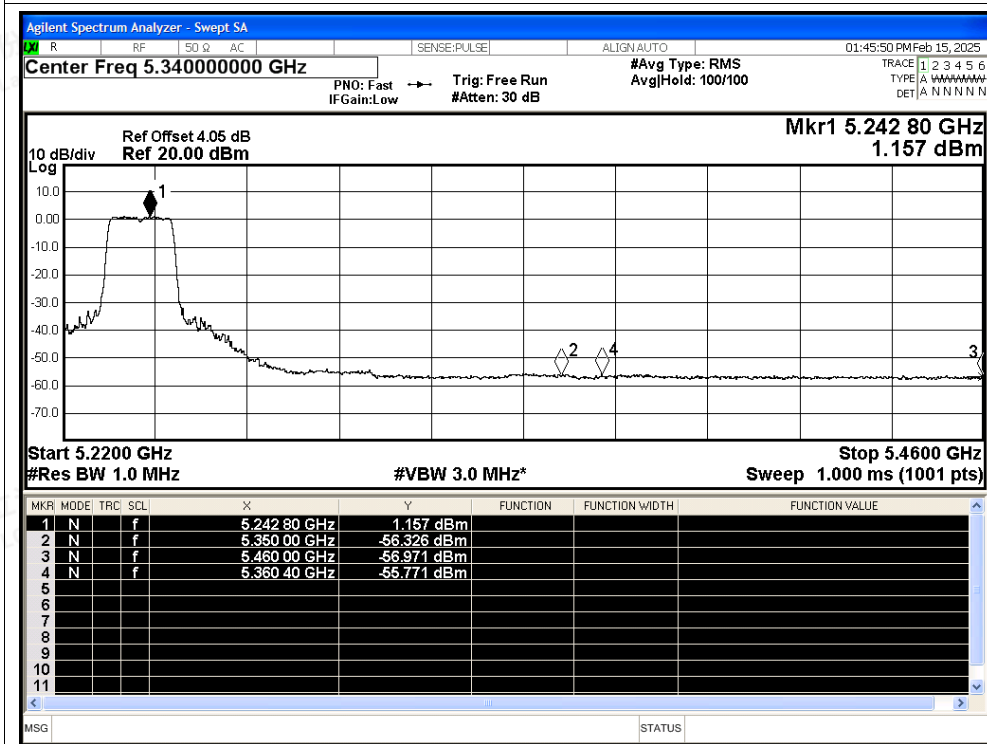

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

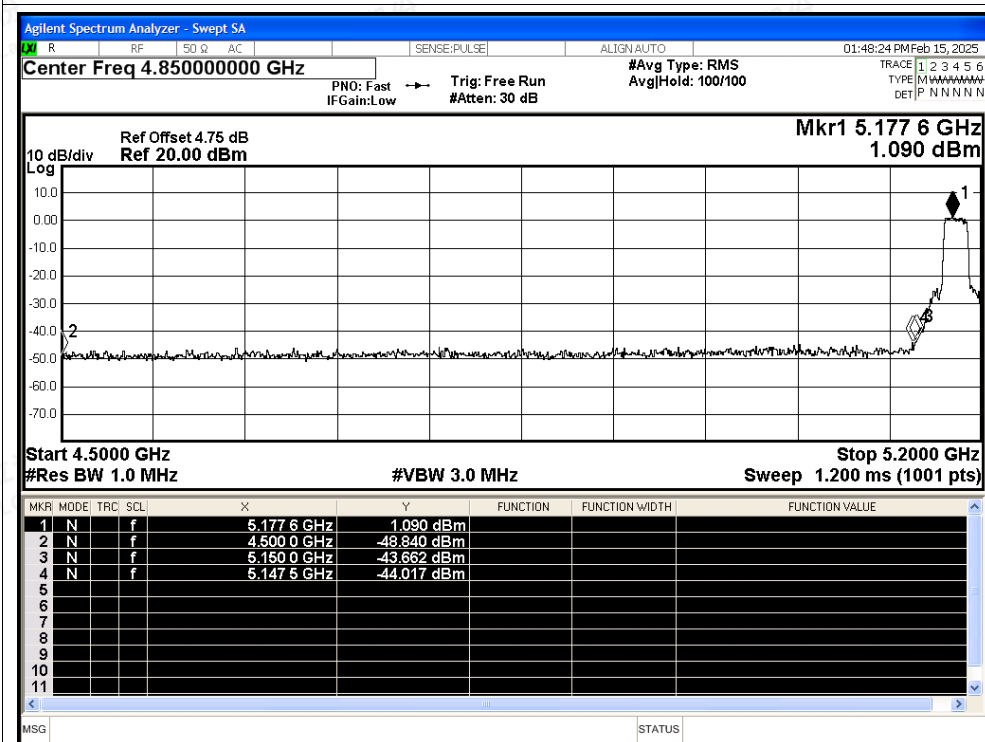

Restrict Band NVNT n20 5180MHz Ant2 Average

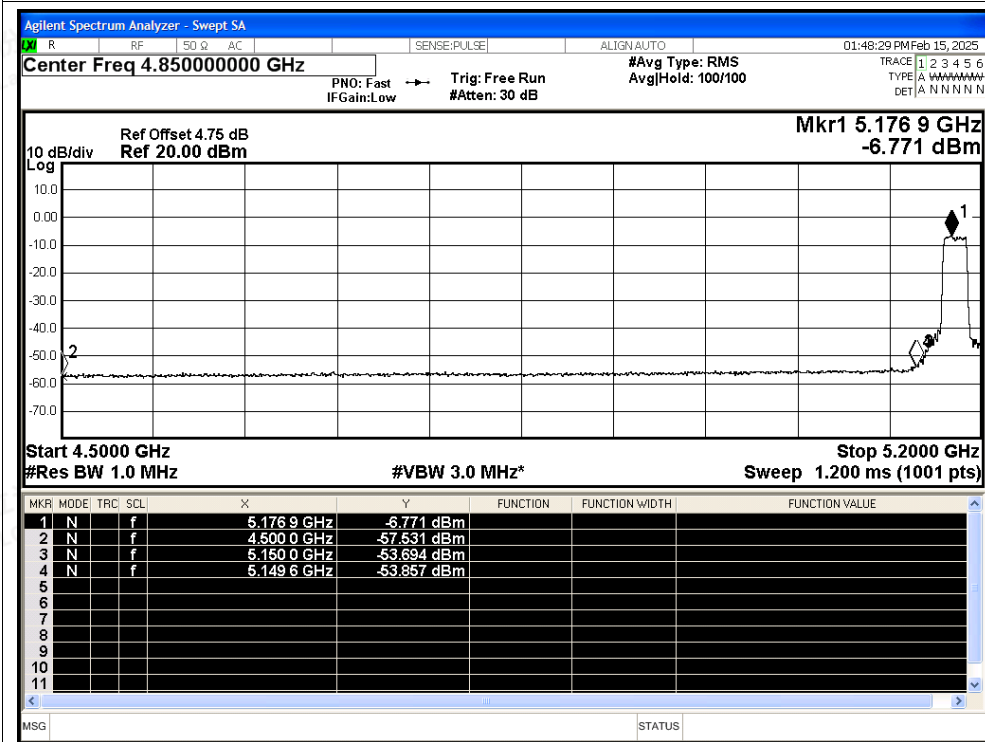

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

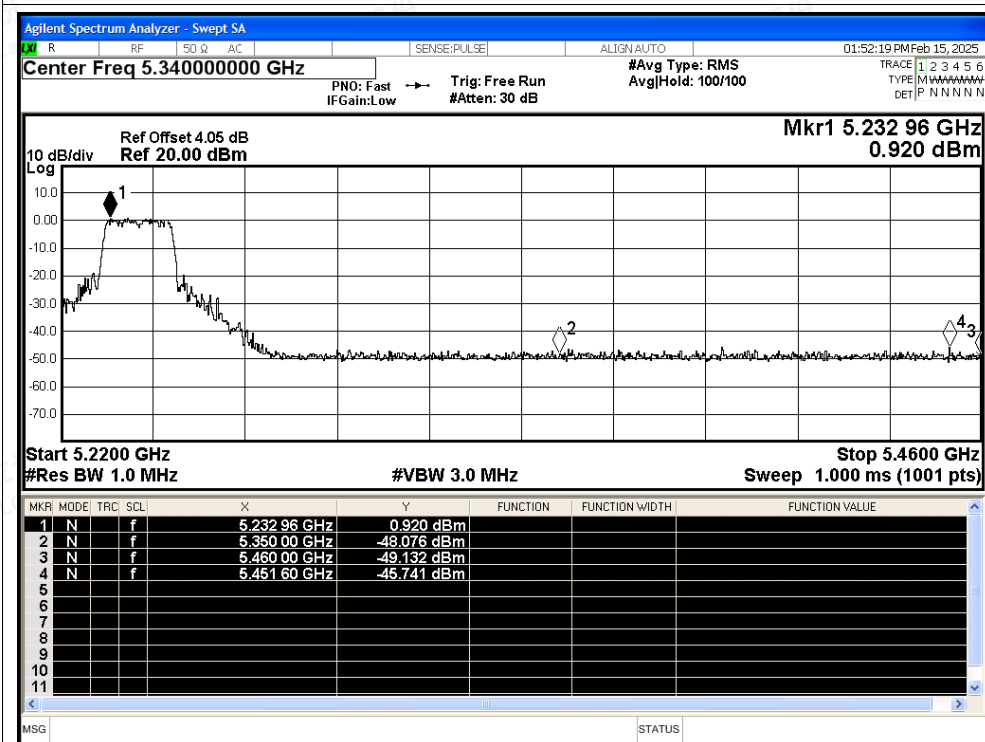

Restrict Band NVNT n20 5240MHz Ant2 Average

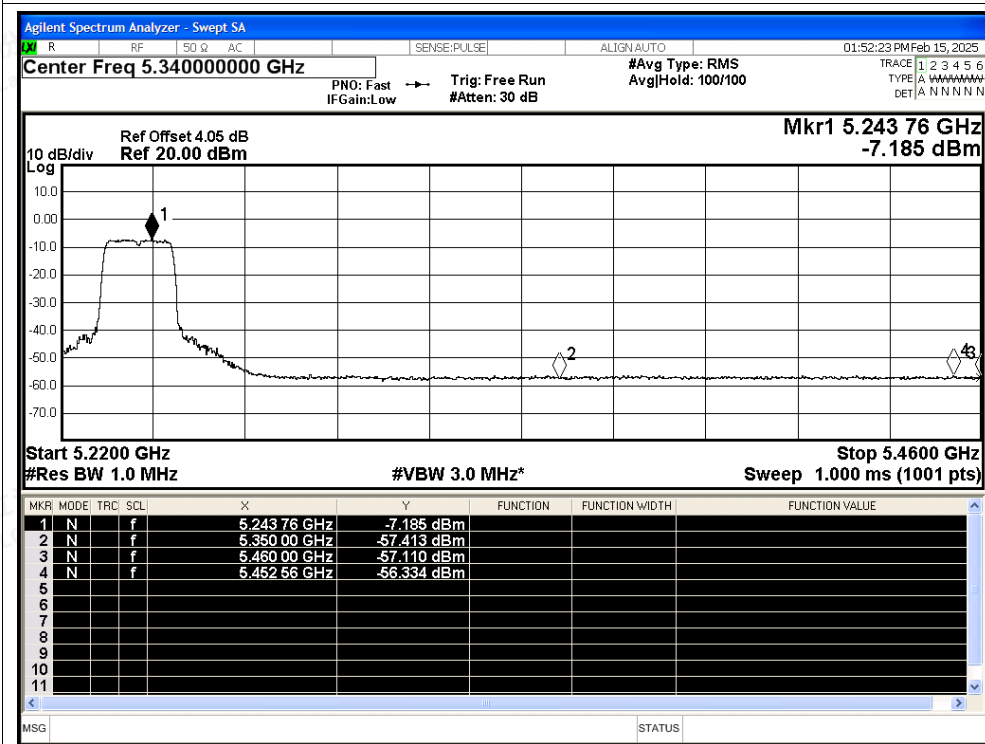

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

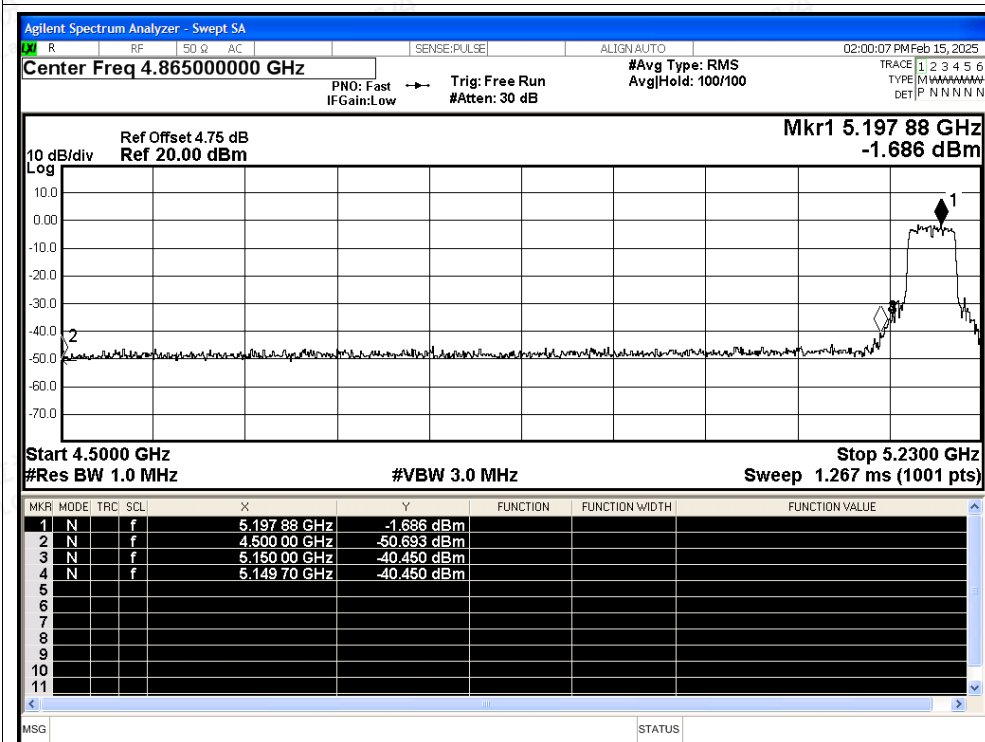

Restrict Band NVNT n40 5190MHz Ant2 Average

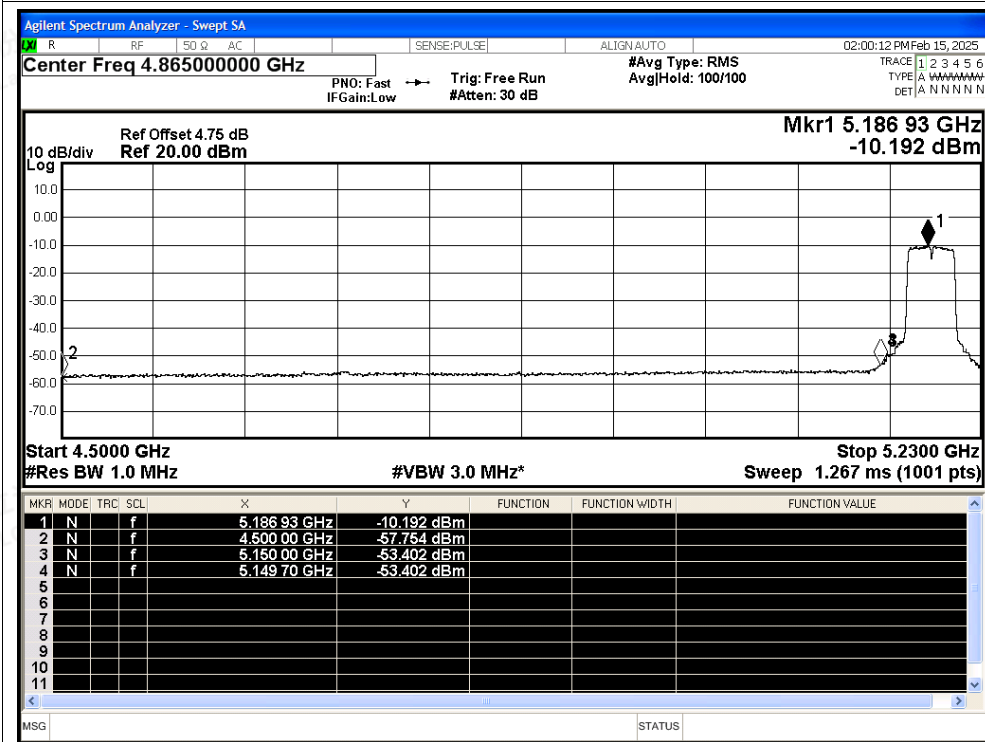

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

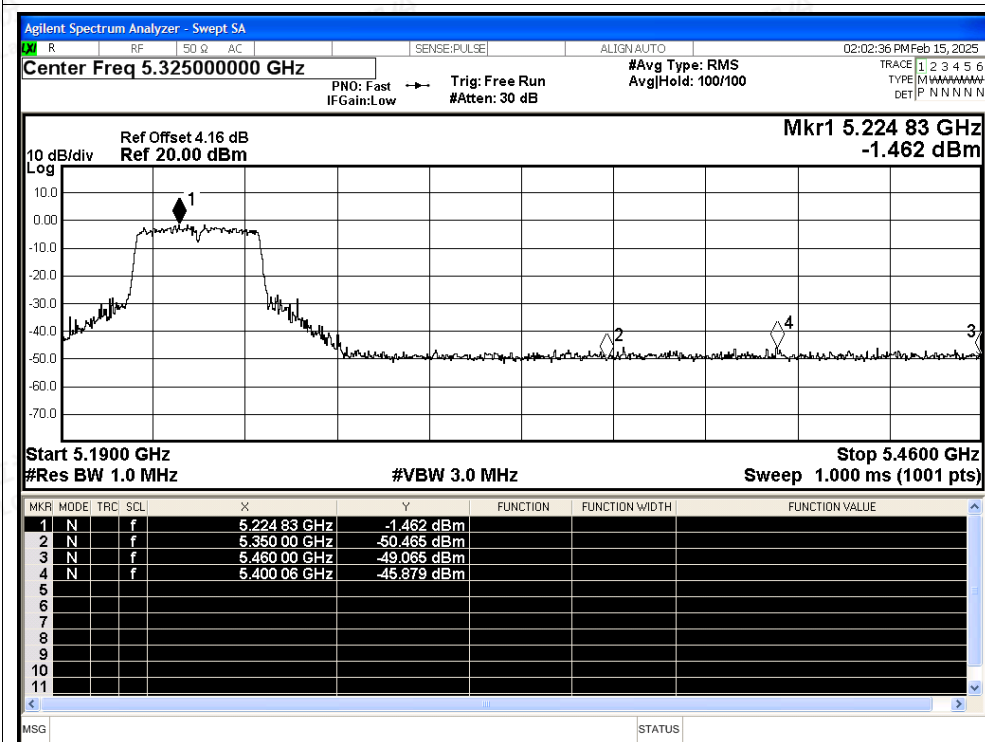

Restrict Band NVNT n40 5230MHz Ant2 Average

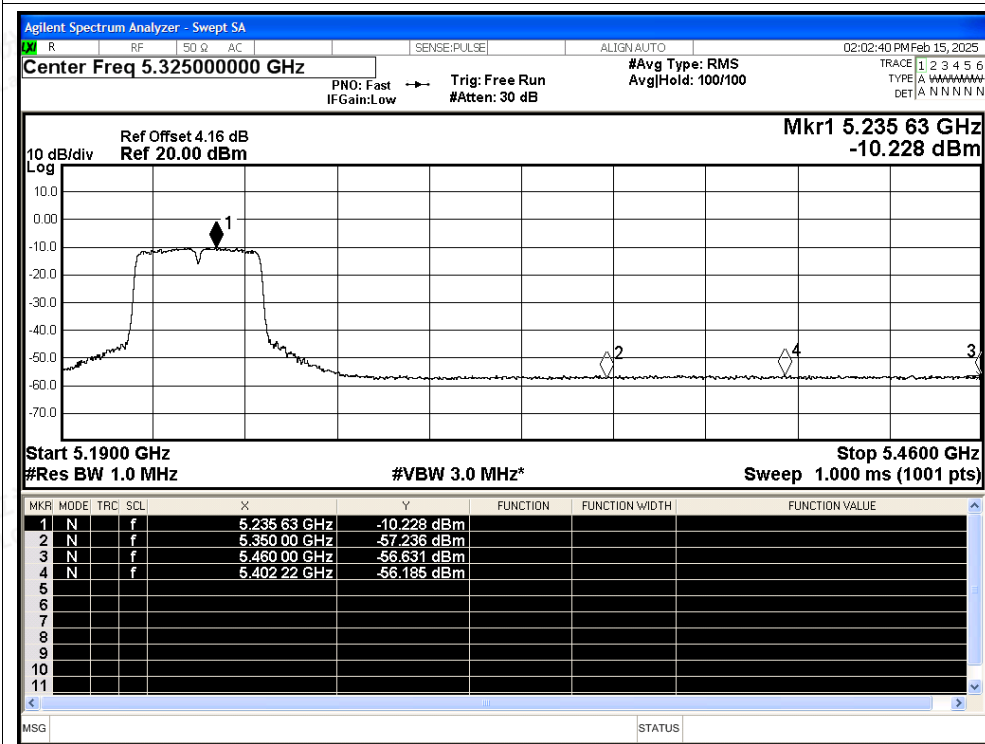

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

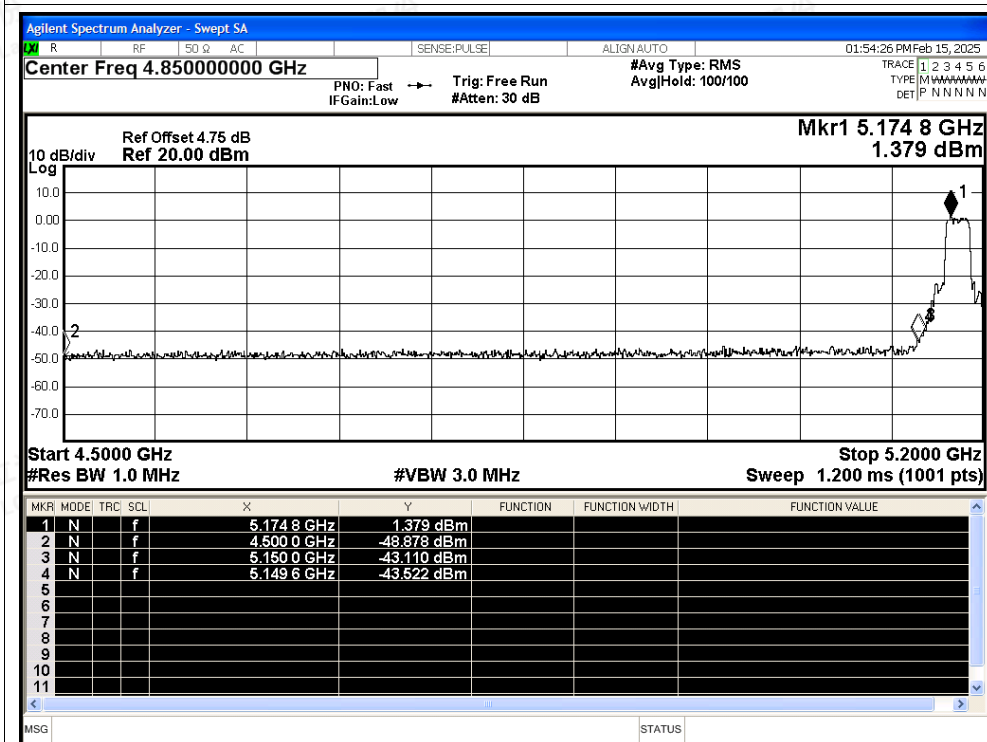

Restrict Band NVNT ac20 5180MHz Ant2 Average

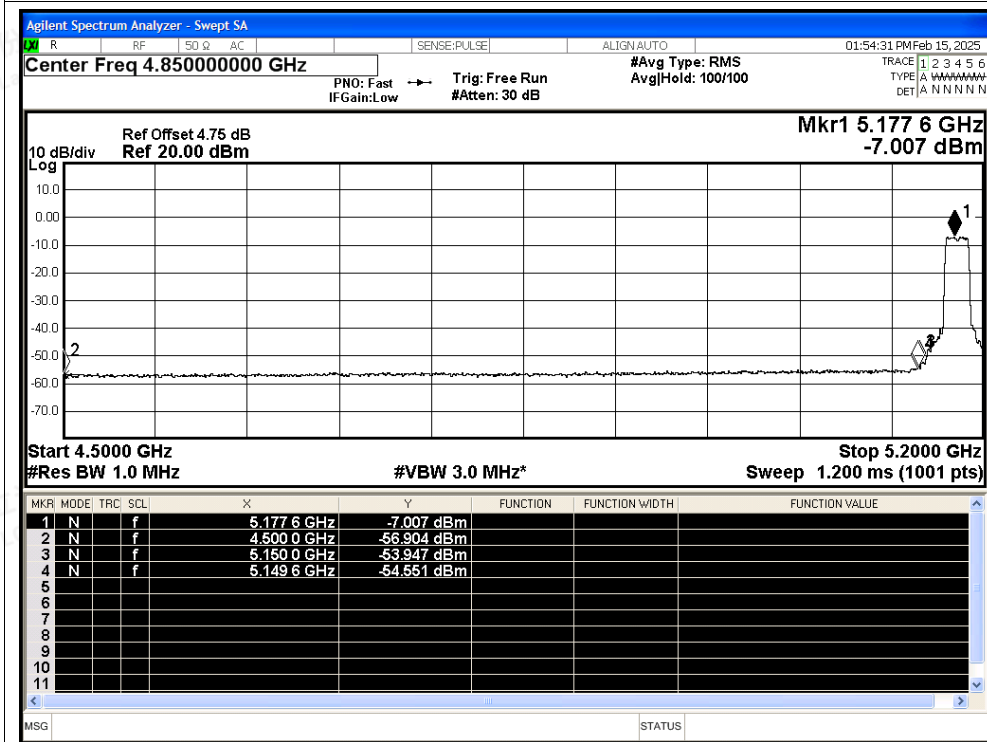

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

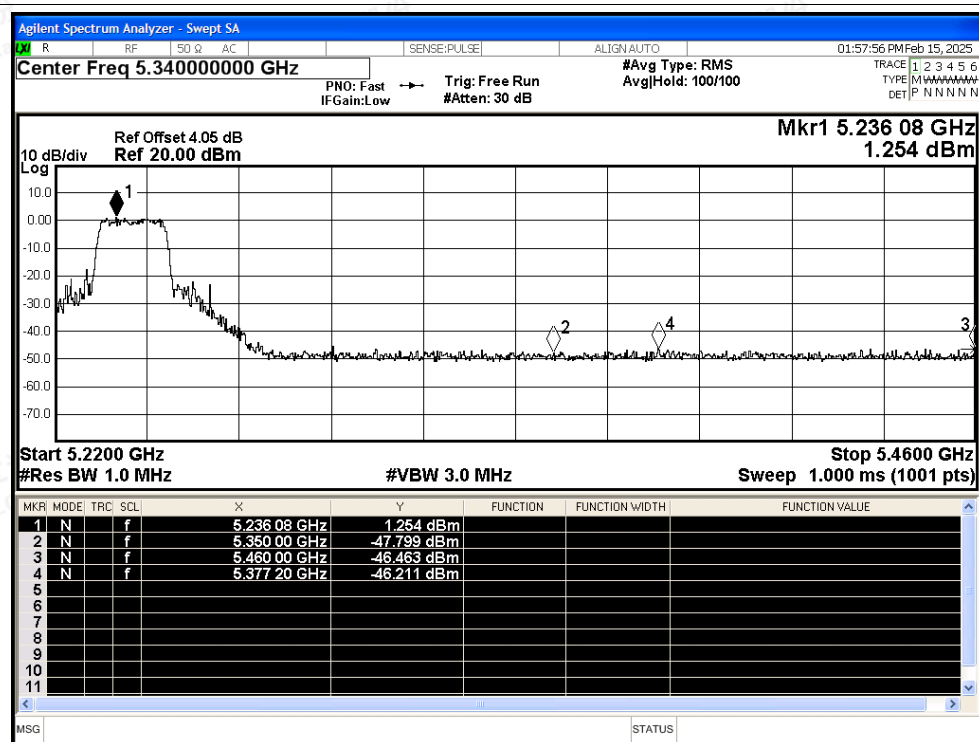

Restrict Band NVNT ac20 5240MHz Ant2 Average


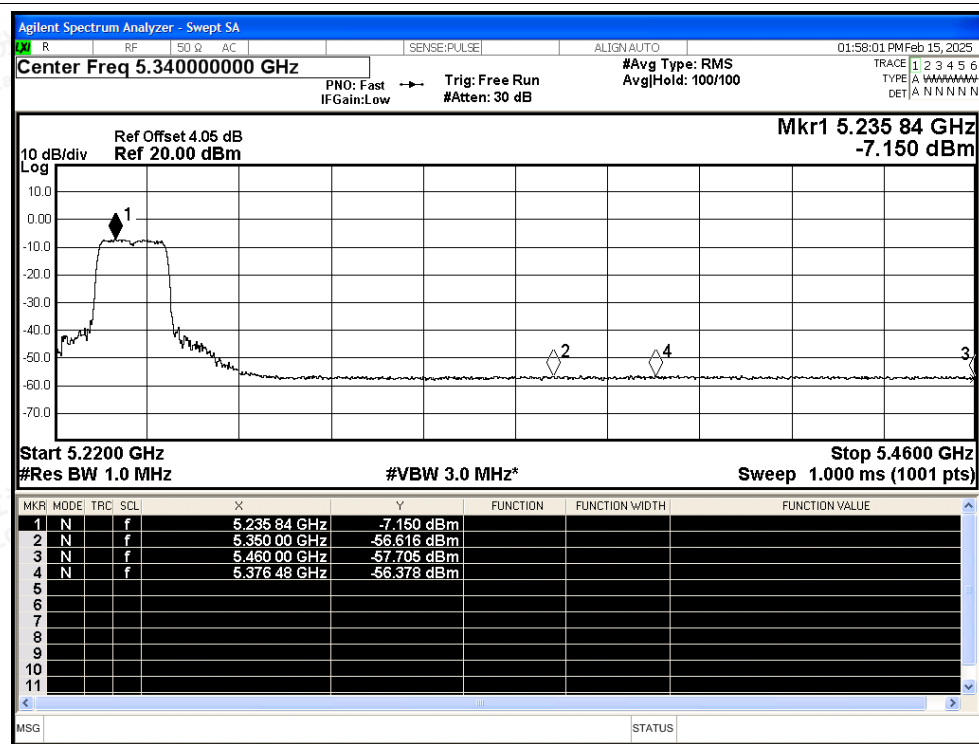


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

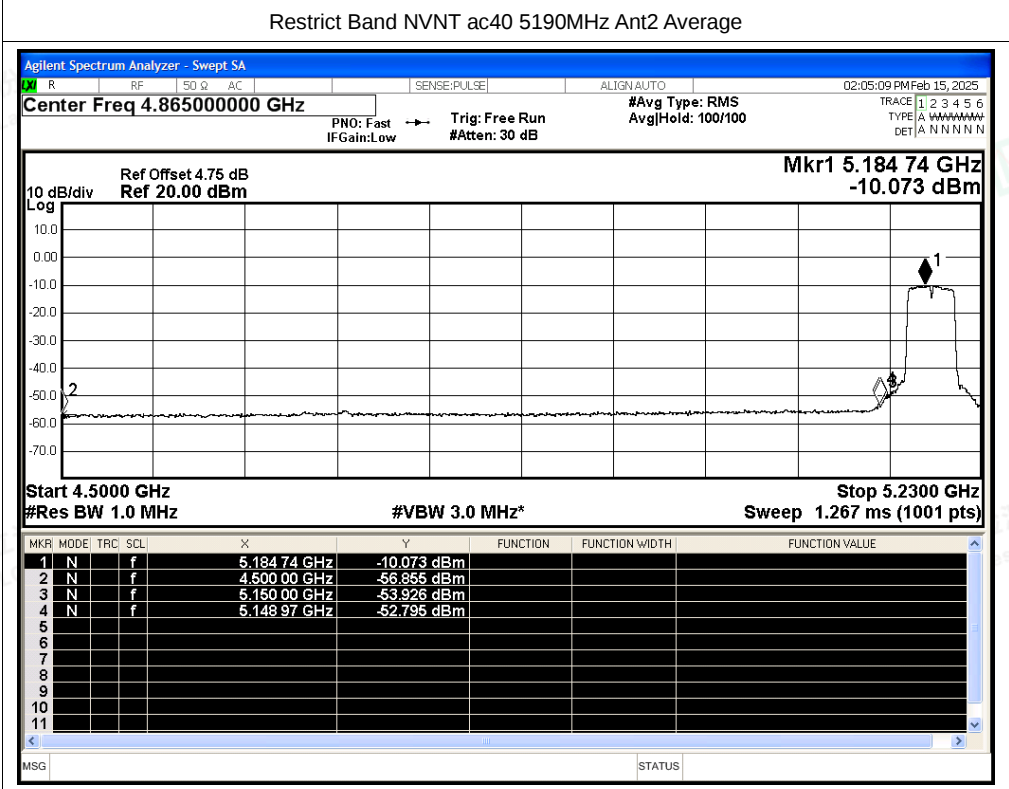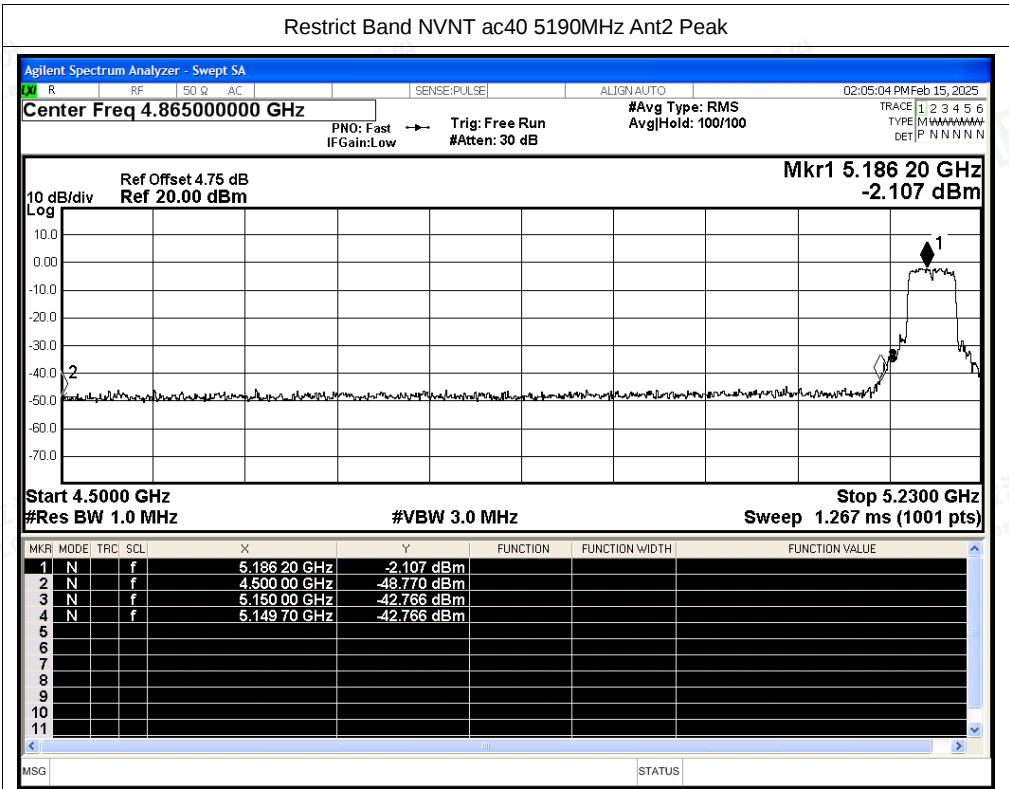




Restrict Band NVNT ac40 5230MHz Ant2 Peak

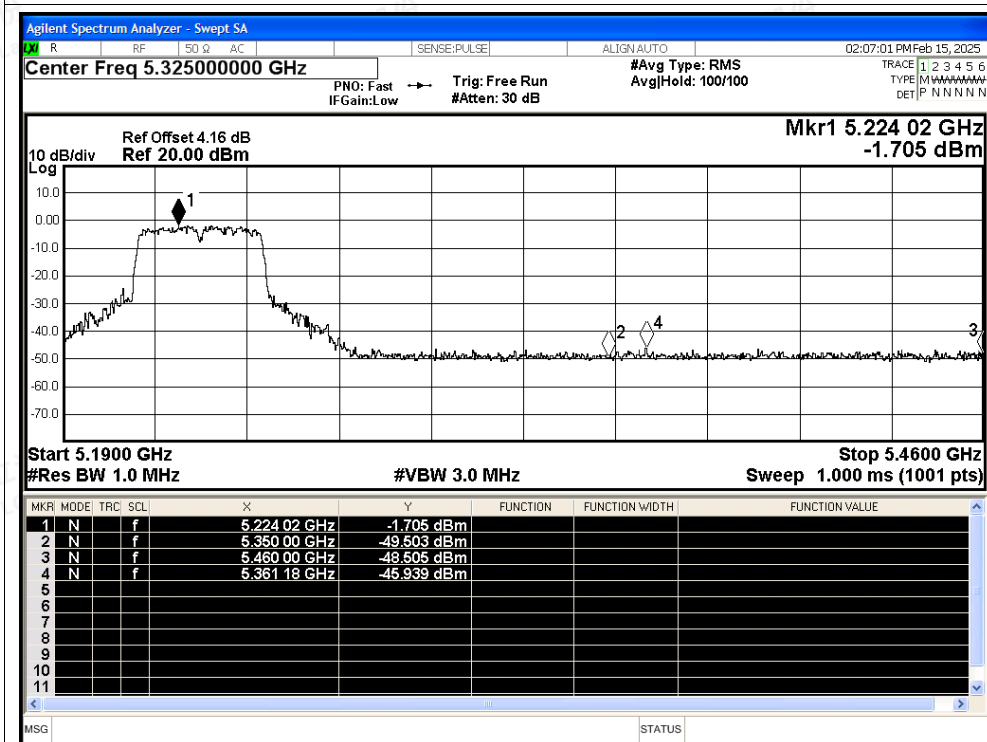

Restrict Band NVNT ac40 5230MHz Ant2 Average

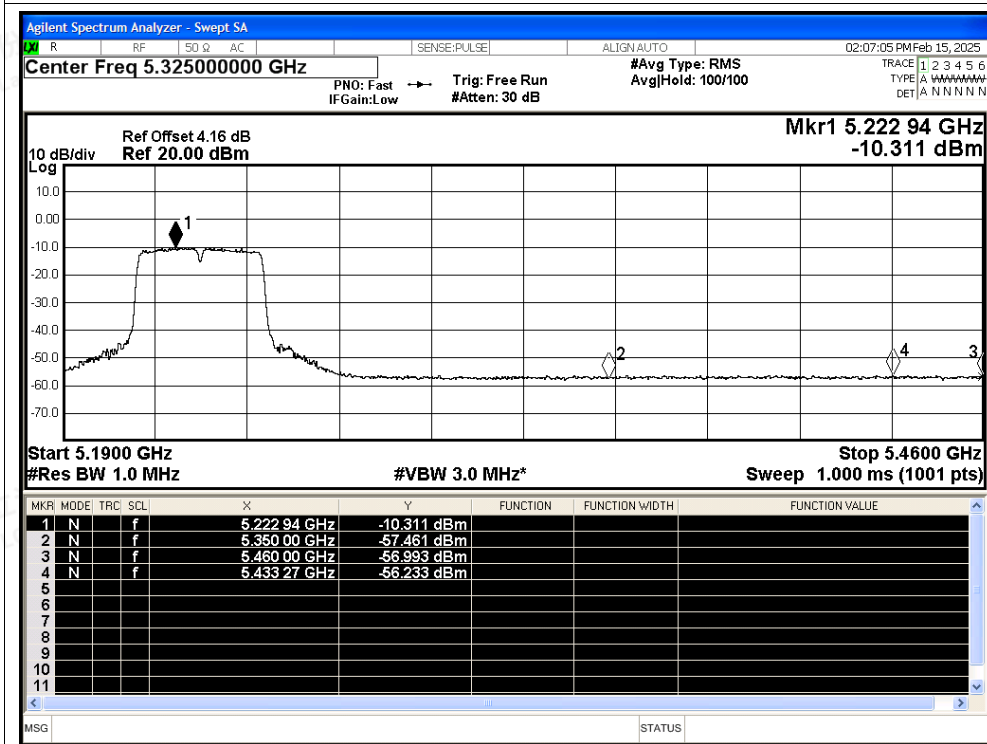

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

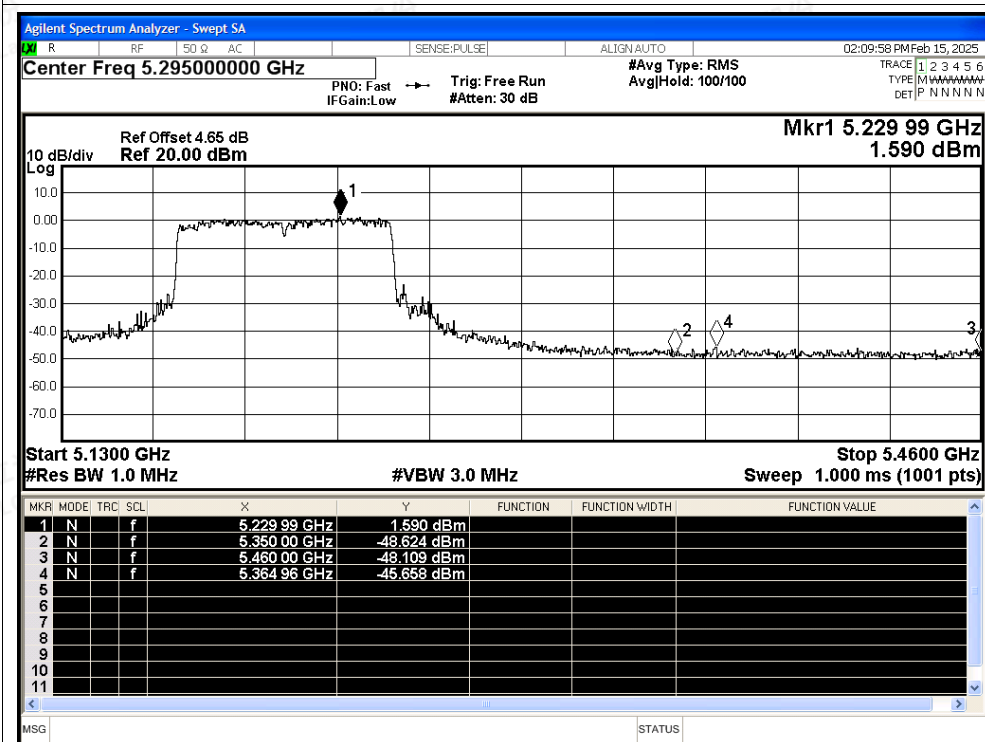

Restrict Band NVNT ac80 5210MHz Ant2 Average

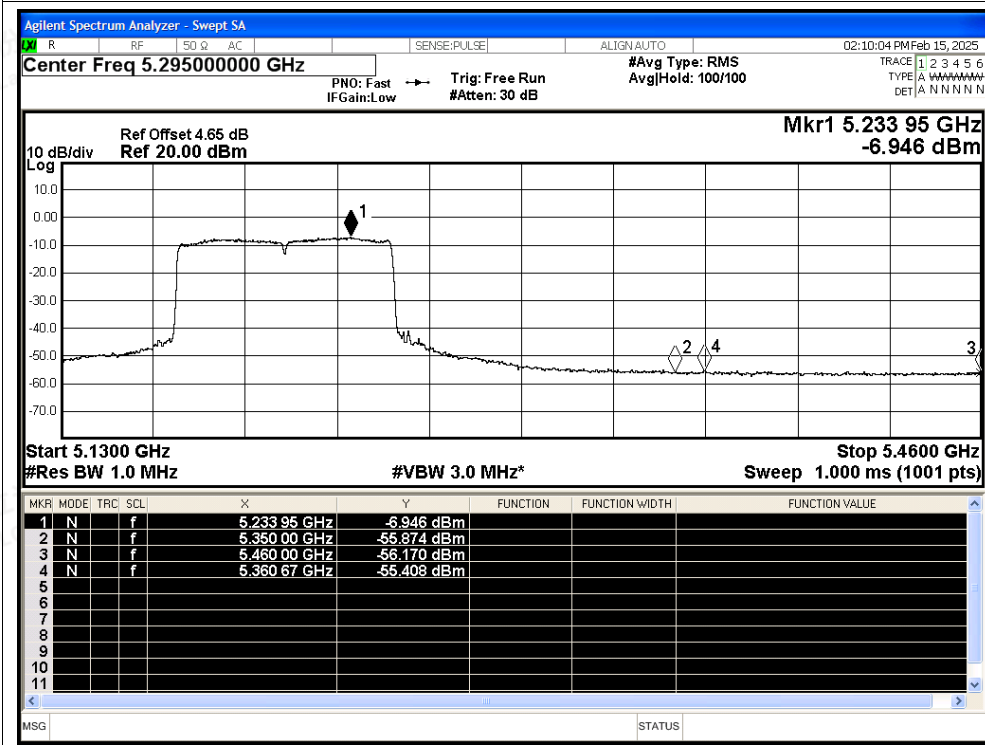

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

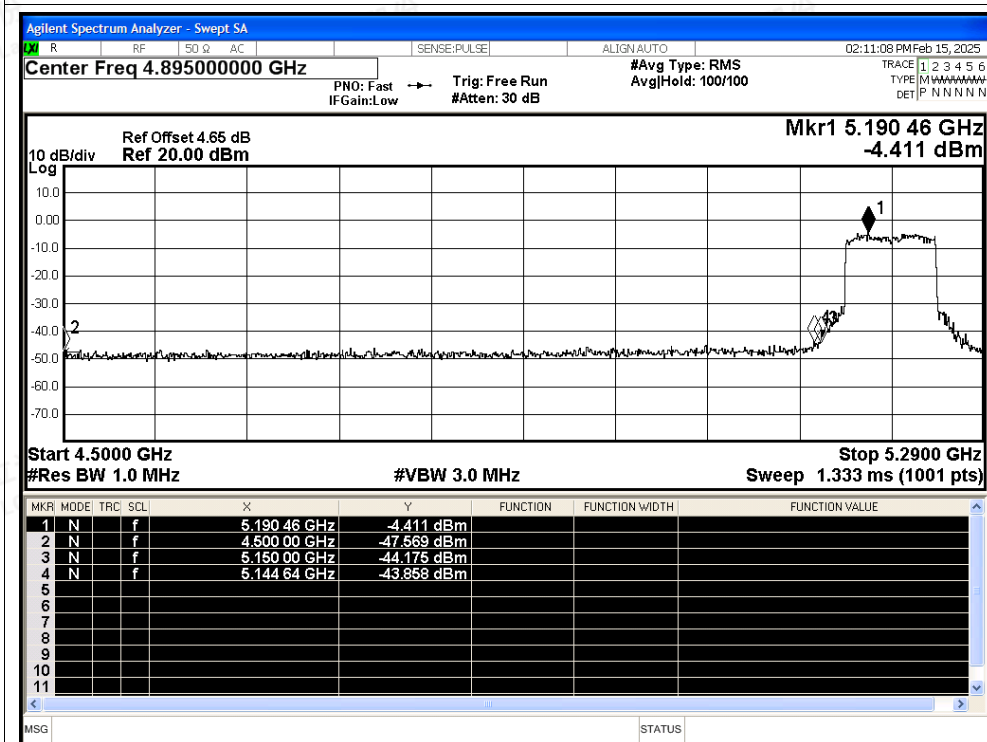

Restrict Band NVNT ac80 5210MHz Ant2 Average

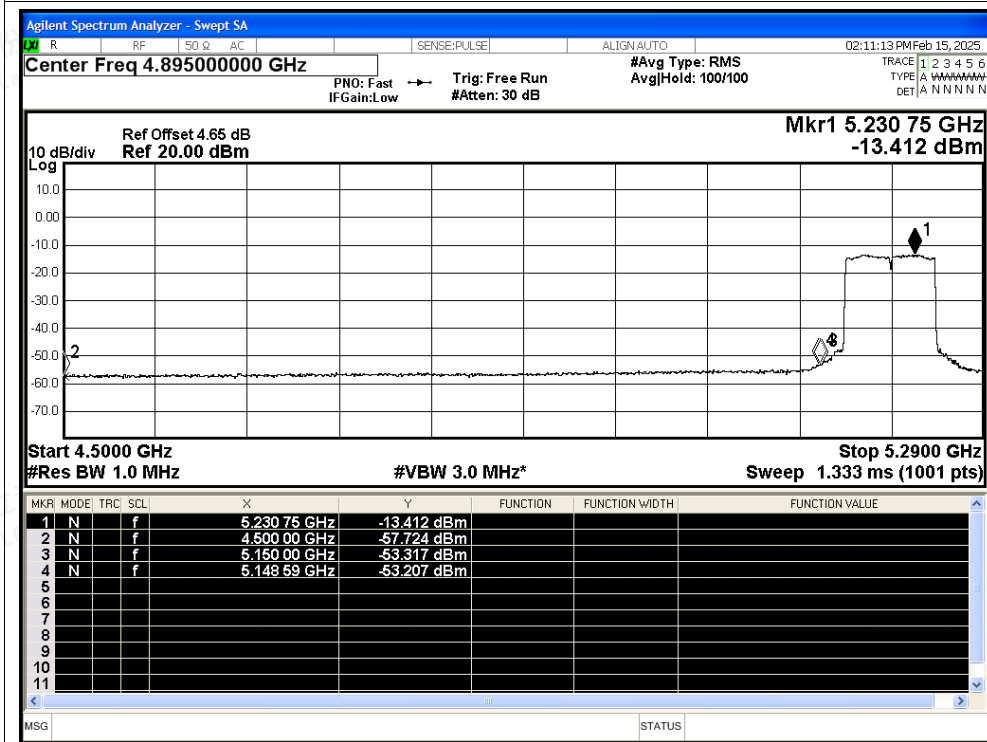

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	Total E (dBuV/ m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-50.03	-48.84	6.00	54.84	Peak	68.2	Pass
NVNT	n20	5180	-57.32	-57.53	6.00	46.81	Average	54	Pass
NVNT	n20	5180	-43.59	-44.02	6.00	60.44	Peak	68.2	Pass
NVNT	n20	5180	-53.45	-53.86	6.00	50.59	Average	54	Pass
NVNT	n20	5180	-43.62	-43.66	6.00	60.60	Peak	68.2	Pass
NVNT	n20	5180	-53.14	-53.69	6.00	50.83	Average	54	Pass
NVNT	n20	5240	-47.38	-48.08	6.00	56.52	Peak	68.2	Pass
NVNT	n20	5240	-56.94	-57.41	6.00	47.07	Average	54	Pass
NVNT	n20	5240	-46.37	-45.74	6.00	58.19	Peak	68.2	Pass
NVNT	n20	5240	-56.24	-56.33	6.00	47.95	Average	54	Pass
NVNT	n20	5240	-47.59	-49.13	6.00	55.95	Peak	68.2	Pass
NVNT	n20	5240	-57.33	-57.11	6.00	47.02	Average	54	Pass
NVNT	n40	5190	-49	-50.69	6.00	54.47	Peak	68.2	Pass
NVNT	n40	5190	-57.45	-57.75	6.00	46.64	Average	54	Pass
NVNT	n40	5190	-41.74	-40.45	6.00	63.19	Peak	68.2	Pass
NVNT	n40	5190	-53.29	-53.4	6.00	50.89	Average	54	Pass
NVNT	n40	5190	-42.67	-40.45	6.00	62.82	Peak	68.2	Pass
NVNT	n40	5190	-53.29	-53.4	6.00	50.89	Average	54	Pass
NVNT	n40	5230	-50.48	-50.47	6.00	53.76	Peak	68.2	Pass
NVNT	n40	5230	-57.84	-57.24	6.00	46.71	Average	54	Pass
NVNT	n40	5230	-45.89	-45.88	6.00	58.35	Peak	68.2	Pass
NVNT	n40	5230	-56.27	-56.19	6.00	48.01	Average	54	Pass
NVNT	n40	5230	-48.91	-49.07	6.00	55.25	Peak	68.2	Pass
NVNT	n40	5230	-56.53	-56.63	6.00	47.66	Average	54	Pass
NVNT	ac20	5180	-49.98	-48.88	6.00	54.84	Peak	68.2	Pass
NVNT	ac20	5180	-57.44	-56.9	6.00	47.08	Average	54	Pass
NVNT	ac20	5180	-41.91	-43.52	6.00	61.60	Peak	68.2	Pass
NVNT	ac20	5180	-54.32	-54.55	6.00	49.80	Average	54	Pass
NVNT	ac20	5180	-44.47	-43.11	6.00	60.50	Peak	68.2	Pass
NVNT	ac20	5180	-53.37	-53.95	6.00	50.59	Average	54	Pass
NVNT	ac20	5240	-48.44	-47.8	6.00	56.13	Peak	68.2	Pass
NVNT	ac20	5240	-57.22	-56.62	6.00	47.33	Average	54	Pass
NVNT	ac20	5240	-46.04	-46.21	6.00	58.11	Peak	68.2	Pass
NVNT	ac20	5240	-56.25	-56.38	6.00	47.92	Average	54	Pass
NVNT	ac20	5240	-49.85	-46.46	6.00	56.41	Peak	68.2	Pass
NVNT	ac20	5240	-56.88	-57.71	6.00	46.96	Average	54	Pass
NVNT	ac40	5190	-48.62	-48.77	6.00	55.54	Peak	68.2	Pass
NVNT	ac40	5190	-57.07	-56.86	6.00	47.27	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-41.85	-42.77	6.00	61.95	Peak	68.2	Pass
NVNT	ac40	5190	-53.43	-52.8	6.00	51.13	Average	54	Pass
NVNT	ac40	5190	-41.85	-42.77	6.00	61.95	Peak	68.2	Pass
NVNT	ac40	5190	-53.67	-53.93	6.00	50.44	Average	54	Pass
NVNT	ac40	5230	-49.2	-49.5	6.00	54.89	Peak	68.2	Pass
NVNT	ac40	5230	-57.07	-57.46	6.00	46.98	Average	54	Pass
NVNT	ac40	5230	-44.4	-45.94	6.00	59.14	Peak	68.2	Pass
NVNT	ac40	5230	-56.22	-56.23	6.00	48.01	Average	54	Pass
NVNT	ac40	5230	-48.33	-48.51	6.00	55.82	Peak	68.2	Pass
NVNT	ac40	5230	-57.51	-56.99	6.00	47.00	Average	54	Pass
NVNT	ac80	5210	-46.9	-48.62	6.00	56.56	Peak	68.2	Pass
NVNT	ac80	5210	-56.42	-55.87	6.00	48.10	Average	54	Pass
NVNT	ac80	5210	-45.36	-45.66	6.00	58.73	Peak	68.2	Pass
NVNT	ac80	5210	-55.28	-55.41	6.00	48.89	Average	54	Pass
NVNT	ac80	5210	-47.15	-48.11	6.00	56.63	Peak	68.2	Pass
NVNT	ac80	5210	-57.05	-56.17	6.00	47.65	Average	54	Pass
NVNT	ac80	5210	-49.41	-47.57	6.00	55.84	Peak	68.2	Pass
NVNT	ac80	5210	-57.75	-57.72	6.00	46.50	Average	54	Pass
NVNT	ac80	5210	-43.02	-43.86	6.00	60.82	Peak	68.2	Pass
NVNT	ac80	5210	-53.12	-53.21	6.00	51.07	Average	54	Pass
NVNT	ac80	5210	-41.48	-44.18	6.00	61.61	Peak	68.2	Pass
NVNT	ac80	5210	-53.4	-53.32	6.00	50.88	Average	54	Pass





Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-48.79	2.88	-	49.32	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-57.05	2.88	0.24	41.30	Average	54	Pass
NVNT	a	5180	Ant3	5091.5	-44.38	2.88	-	53.73	Peak	68.2	Pass
NVNT	a	5180	Ant3	5126.5	-54.55	2.88	0.24	43.80	Average	54	Pass
NVNT	a	5180	Ant3	5150	-46.07	2.88	-	52.04	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-54.47	2.88	0.24	43.88	Average	54	Pass
NVNT	a	5240	Ant3	5350	-48.4	2.88	-	49.71	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-57.3	2.88	0.24	41.05	Average	54	Pass
NVNT	a	5240	Ant3	5453.76	-46.07	2.88	-	52.04	Peak	68.2	Pass
NVNT	a	5240	Ant3	5381.28	-56.3	2.88	0.24	42.05	Average	54	Pass
NVNT	a	5240	Ant3	5460	-49.63	2.88	-	48.48	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-57.43	2.88	0.24	40.92	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-49.49	2.88	-	48.62	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-57.53	2.88	0.12	40.70	Average	54	Pass
NVNT	n20	5180	Ant3	5147.5	-43.68	2.88	-	54.43	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5148.2	-54.37	2.88	0.12	43.86	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-43.93	2.88	-	54.18	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-53.67	2.88	0.12	44.56	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-48.11	2.88	-	50.00	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-57.43	2.88	0.12	40.80	Average	54	Pass
NVNT	n20	5240	Ant3	5387.28	-46.21	2.88	-	51.90	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5386.56	-56.26	2.88	0.12	41.97	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-48.17	2.88	-	49.94	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-57.06	2.88	0.12	41.17	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-49.91	2.88	-	48.20	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-57.45	2.88	0.23	40.89	Average	54	Pass
NVNT	n40	5190	Ant3	5148.24	-42.3	2.88	-	55.81	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5149.7	-53.21	2.88	0.23	45.13	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-43.01	2.88	-	55.10	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-53.21	2.88	0.23	45.13	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-48.81	2.88	-	49.30	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-56.62	2.88	0.24	41.73	Average	54	Pass
NVNT	n40	5230	Ant3	5371.98	-46.08	2.88	-	52.03	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5434.89	-56.28	2.88	0.24	42.07	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-47.28	2.88	-	50.83	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-57.1	2.88	0.24	41.25	Average	54	Pass
NVNT	ac20	5180	Ant3	4500	-48.66	2.88	-	49.45	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	4500	-57.4	2.88	0.12	40.83	Average	54	Pass
NVNT	ac20	5180	Ant3	5148.9	-42.23	2.88	-	55.88	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	5149.6	-54.08	2.88	0.12	44.15	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-44.24	2.88	-	53.87	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-53.97	2.88	0.12	44.26	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-50.41	2.88	-	47.70	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-57.05	2.88	0.12	41.18	Average	54	Pass
NVNT	ac20	5240	Ant3	5368.56	-46.07	2.88	-	52.04	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5406	-56.16	2.88	0.12	42.07	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-49.79	2.88	-	48.32	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-57.5	2.88	0.12	40.73	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-49.74	2.88	-	48.37	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-57.22	2.88	0.24	41.13	Average	54	Pass
NVNT	ac40	5190	Ant3	5149.7	-41.43	2.88	-	56.68	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5149.7	-52.89	2.88	0.24	45.46	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-41.43	2.88	-	56.68	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-52.89	2.88	0.24	45.46	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-49.41	2.88	-	48.70	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-57.37	2.88	0.24	40.98	Average	54	Pass
NVNT	ac40	5230	Ant3	5374.41	-46.75	2.88	-	51.36	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5413.02	-56.19	2.88	0.24	42.16	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-49.44	2.88	-	48.67	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-57.49	2.88	0.24	40.86	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-48.73	2.88	-	49.38	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-56.01	2.88	0.47	42.57	Average	54	Pass
NVNT	ac80	5210	Ant3	5407.53	-45.58	2.88	-	52.53	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5352.42	-55.59	2.88	0.47	42.99	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-49.7	2.88	-	48.41	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-55.9	2.88	0.47	42.68	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-50.38	2.88	-	47.73	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-57.44	2.88	0.47	41.14	Average	54	Pass
NVNT	ac80	5210	Ant3	5145.43	-42.38	2.88	-	55.73	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5149.38	-53.63	2.88	0.47	44.95	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-43.92	2.88	-	54.19	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-53.6	2.88	0.47	44.98	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant3 Peak

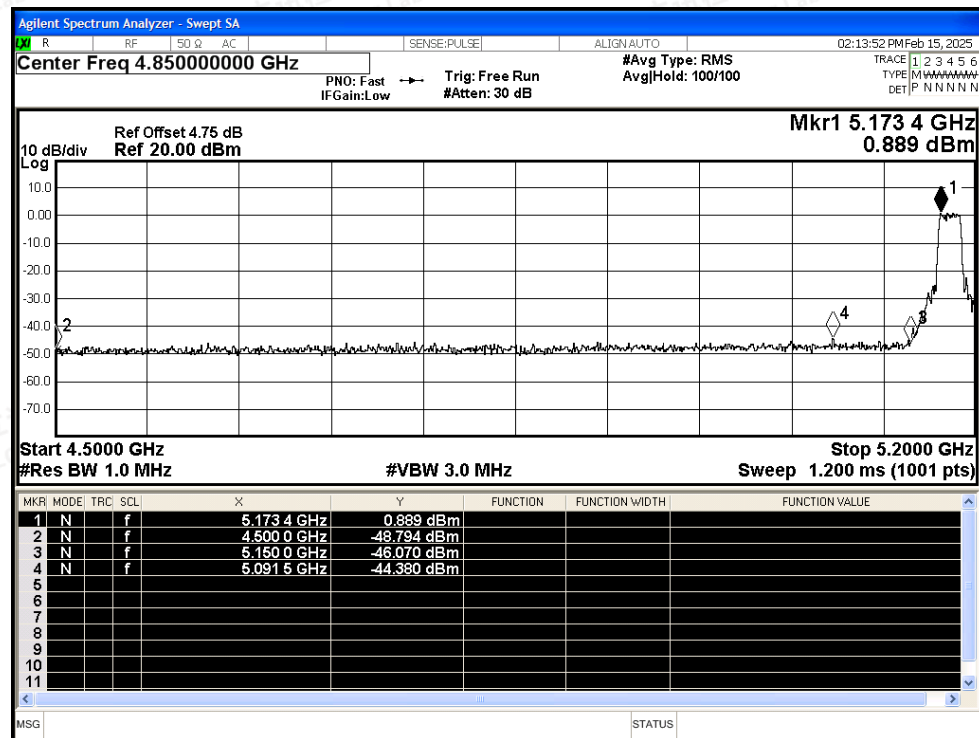

Restrict Band NVNT a 5180MHz Ant3 Average

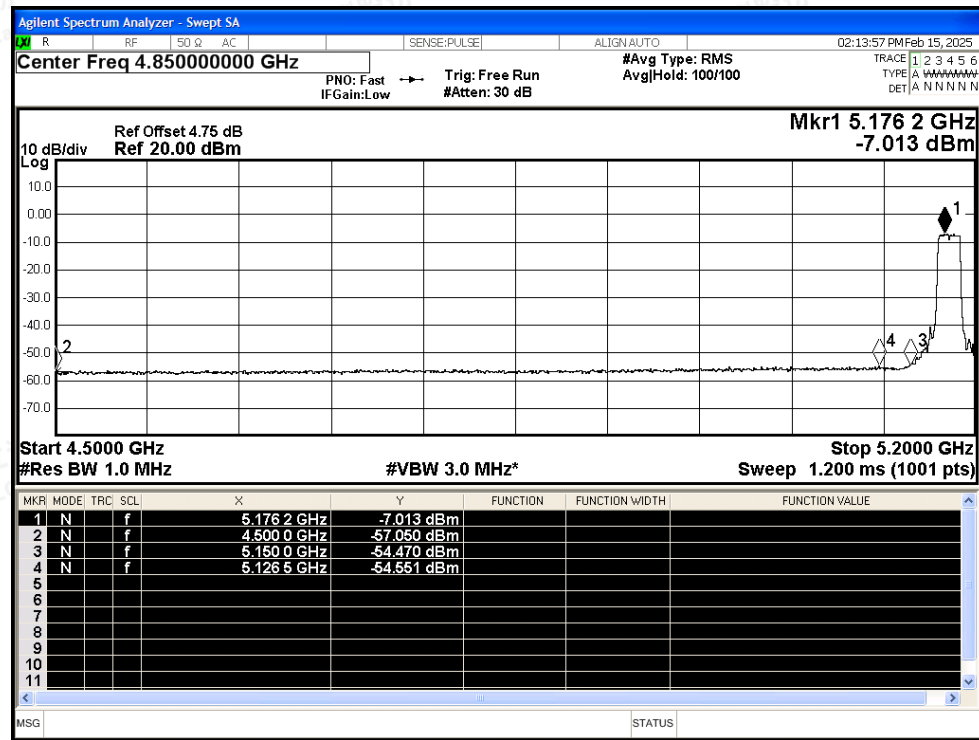

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant3 Peak

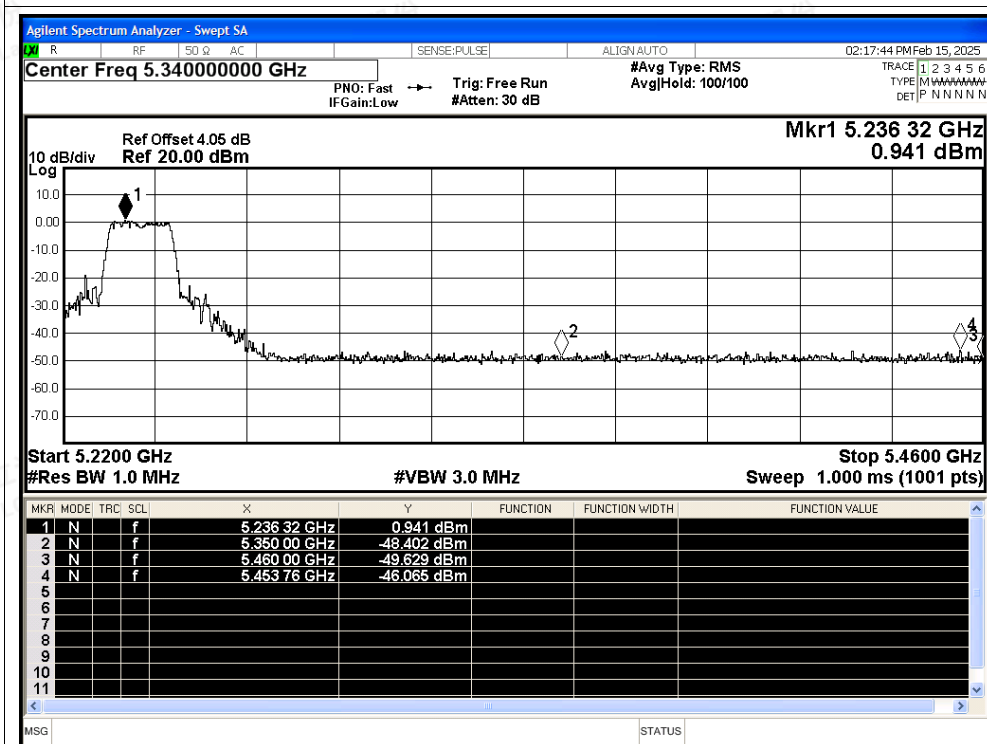

Restrict Band NVNT a 5240MHz Ant3 Average


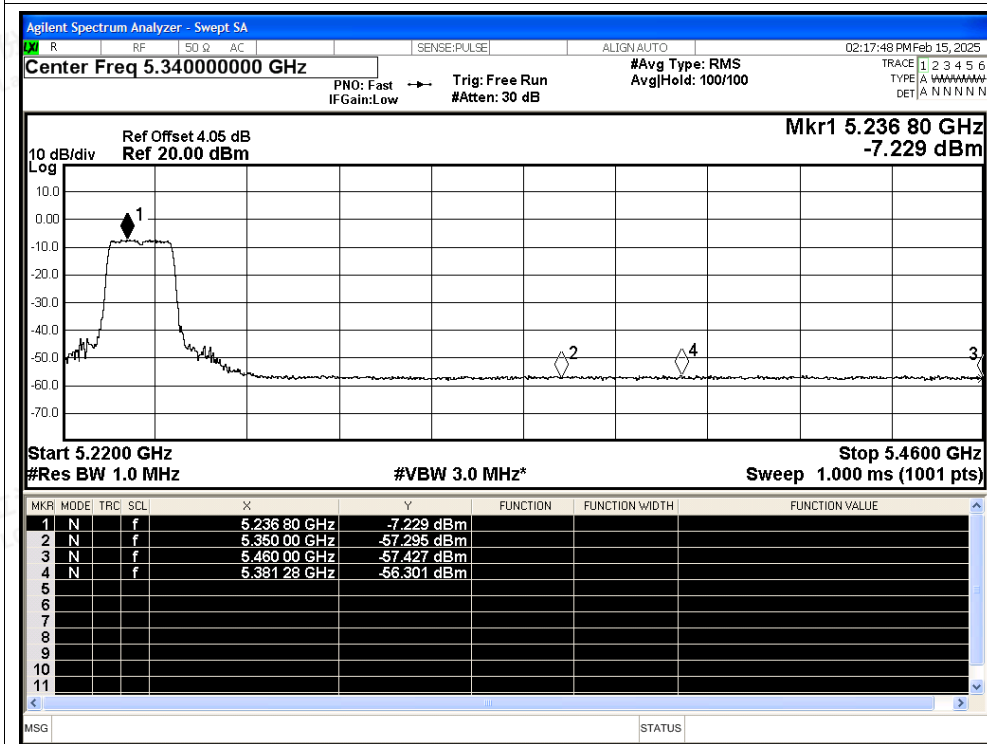


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

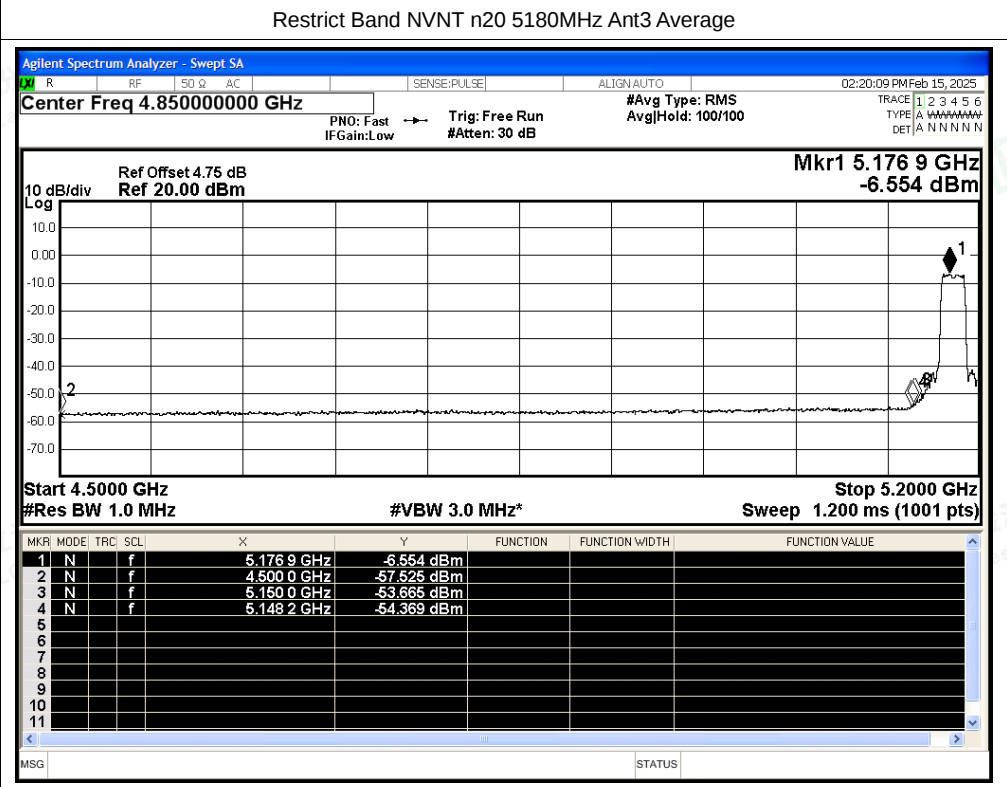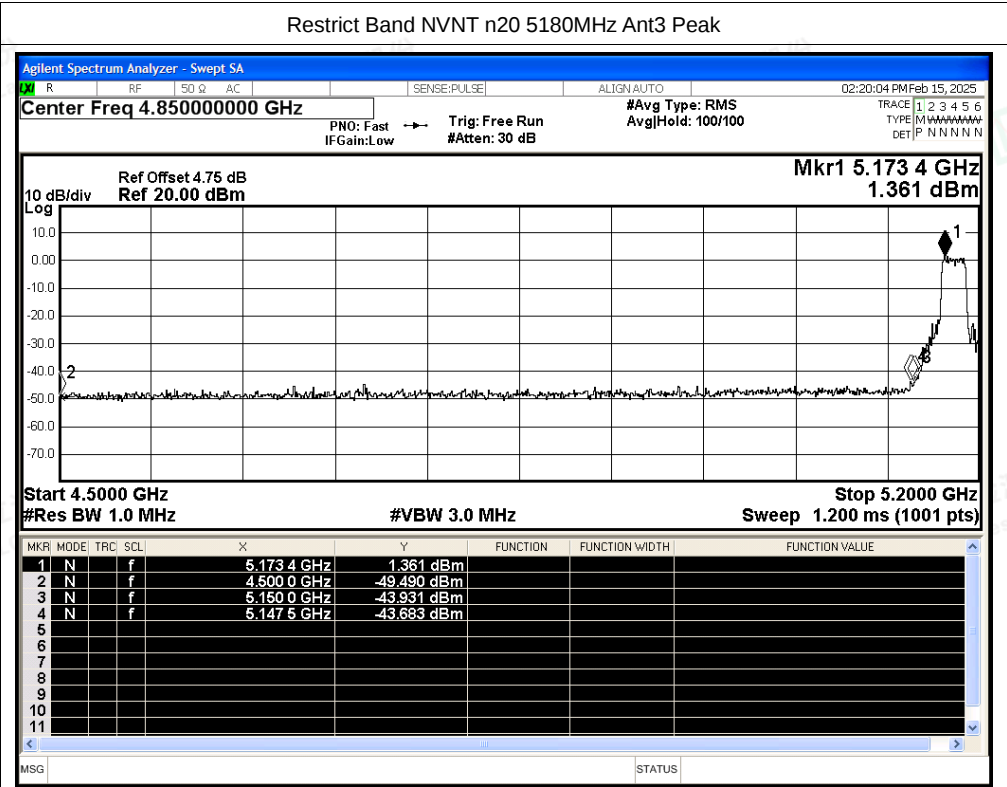




Restrict Band NVNT n20 5240MHz Ant3 Peak

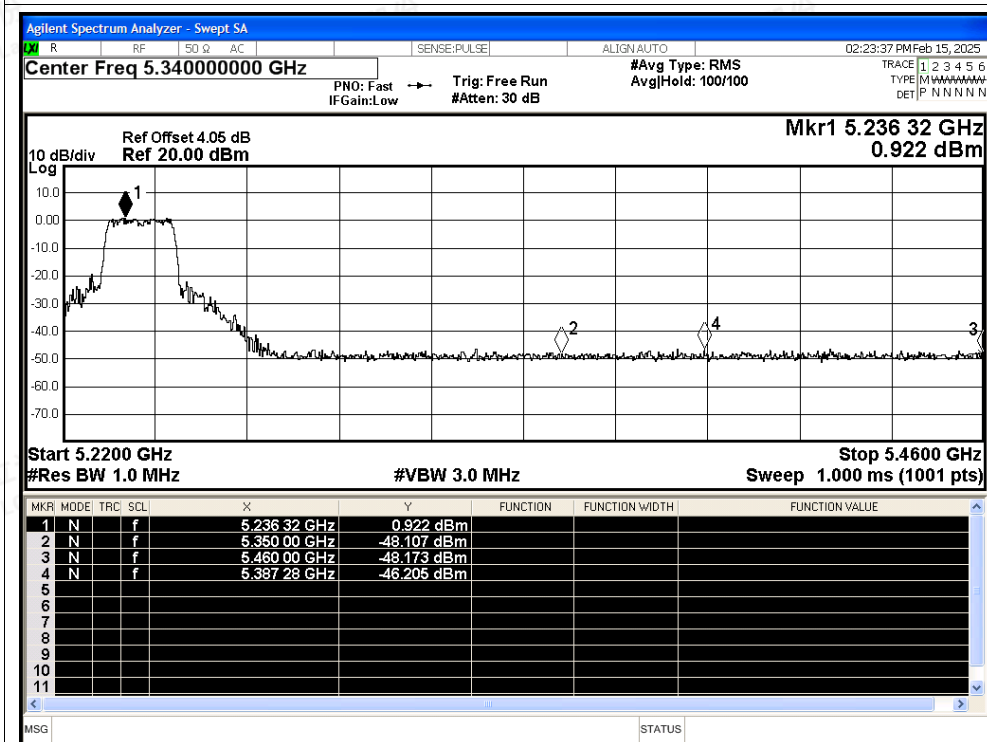

Restrict Band NVNT n20 5240MHz Ant3 Average

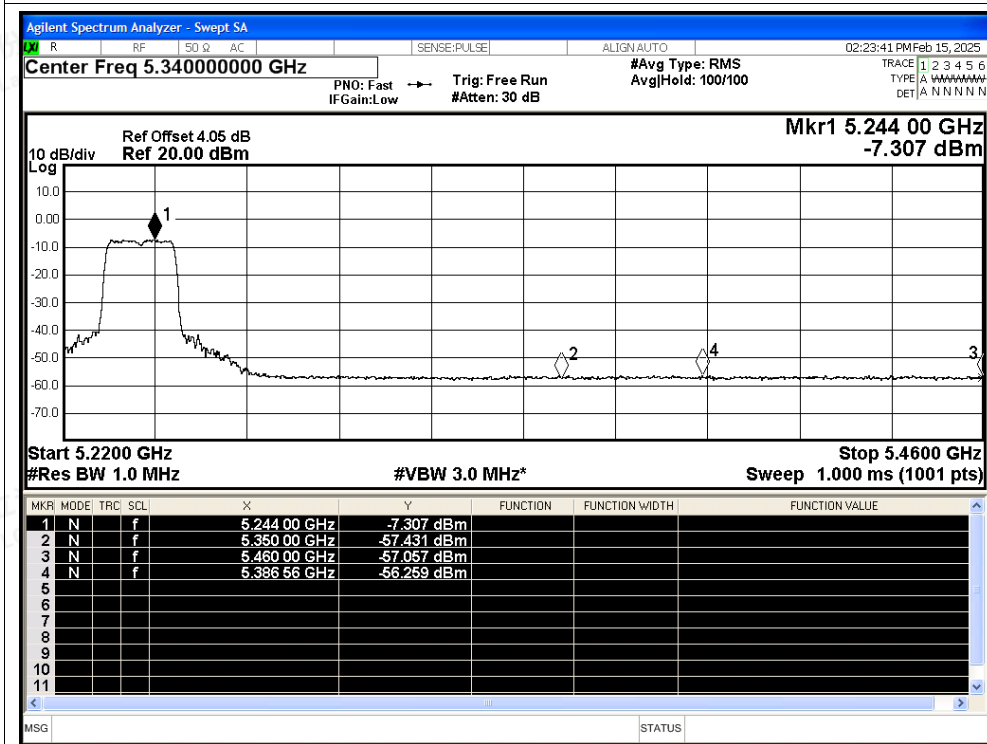

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant3 Peak

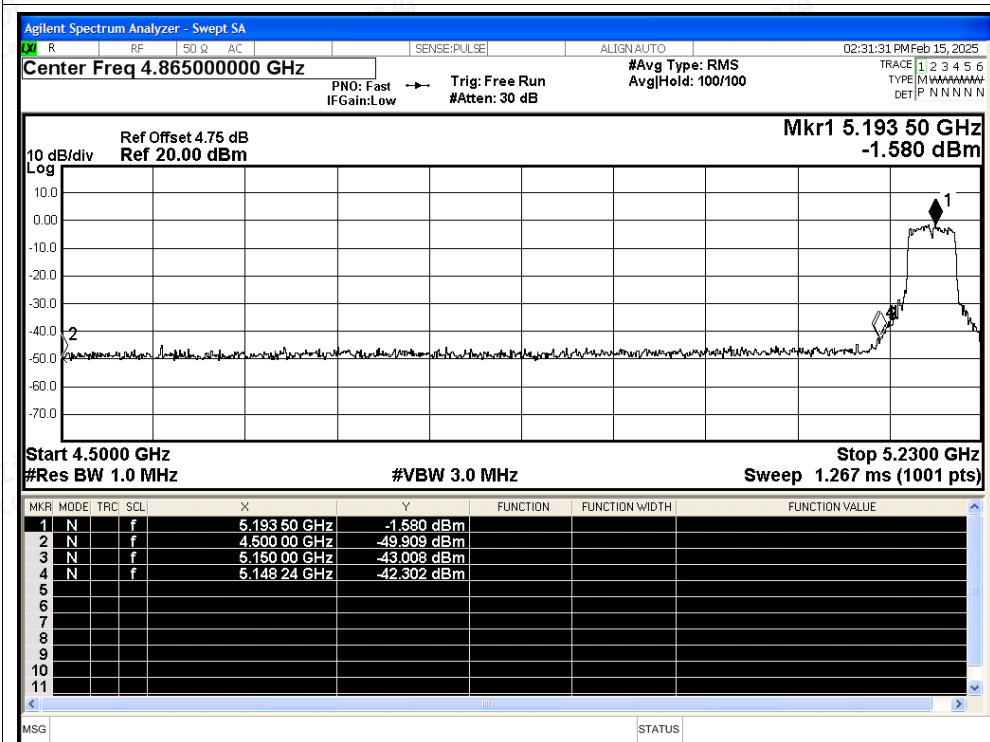

Restrict Band NVNT n40 5190MHz Ant3 Average

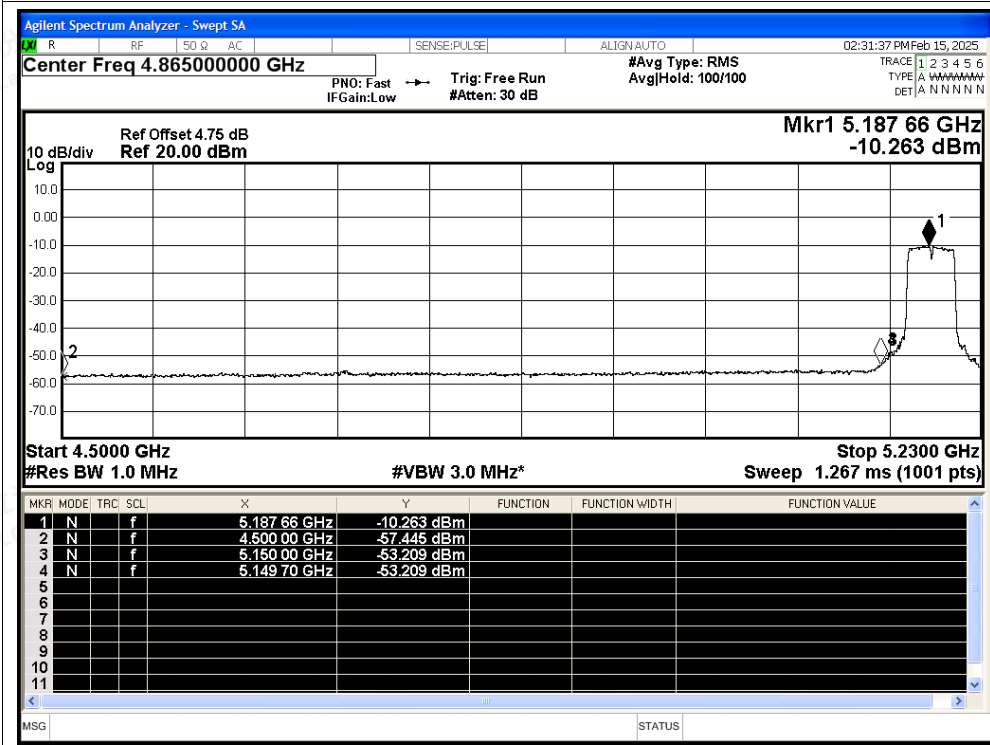

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant3 Peak

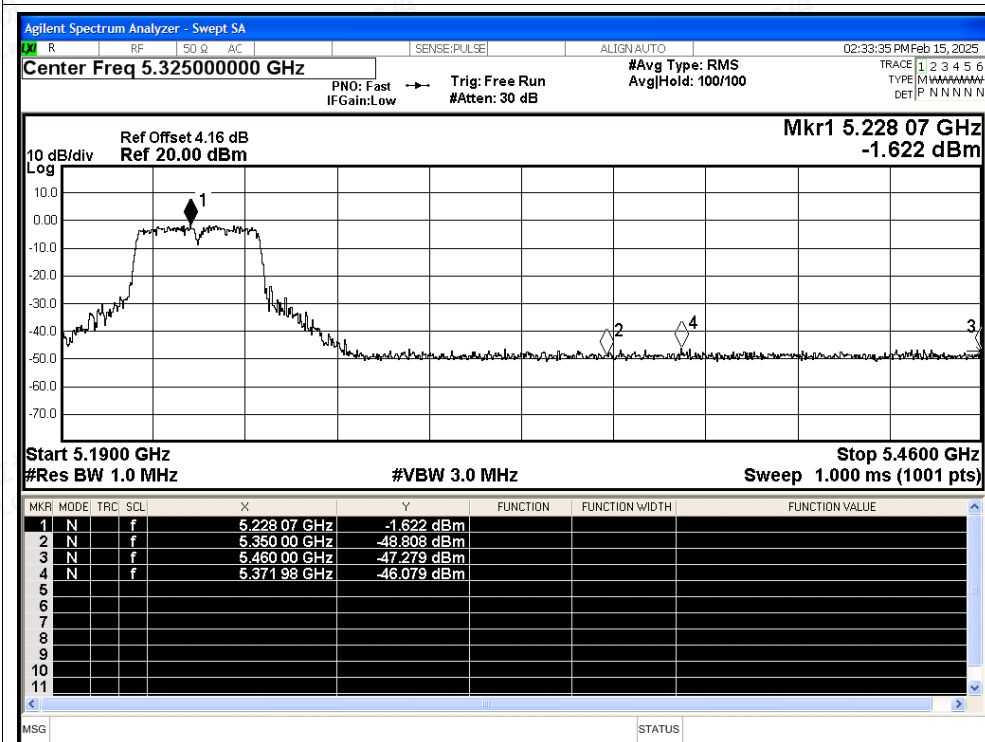

Restrict Band NVNT n40 5230MHz Ant3 Average

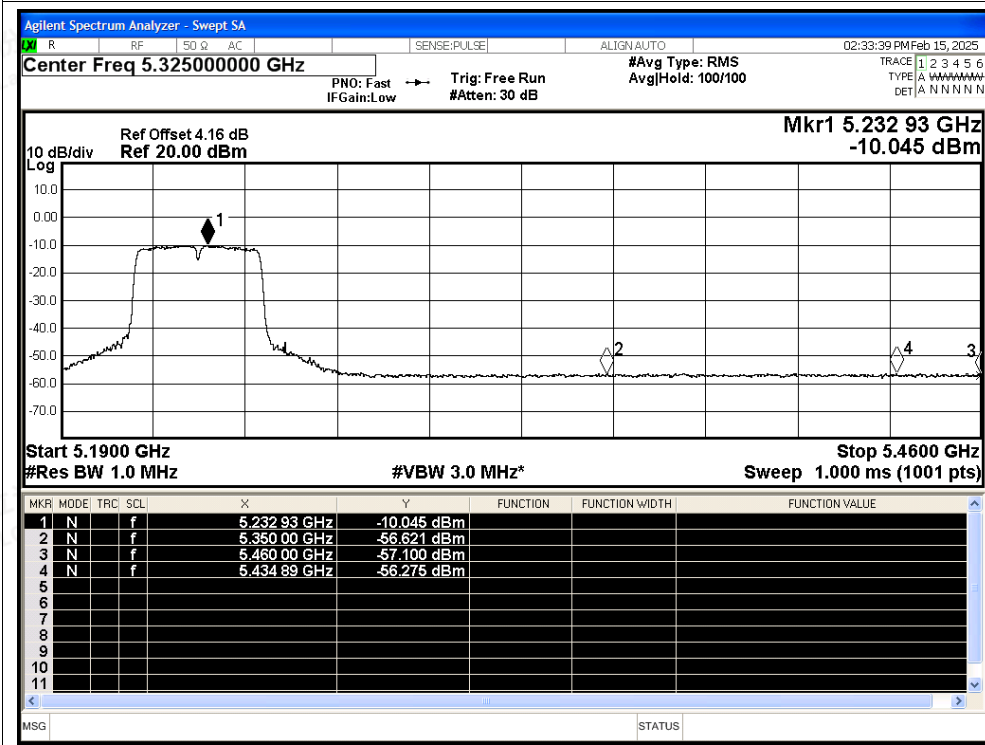

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant3 Peak

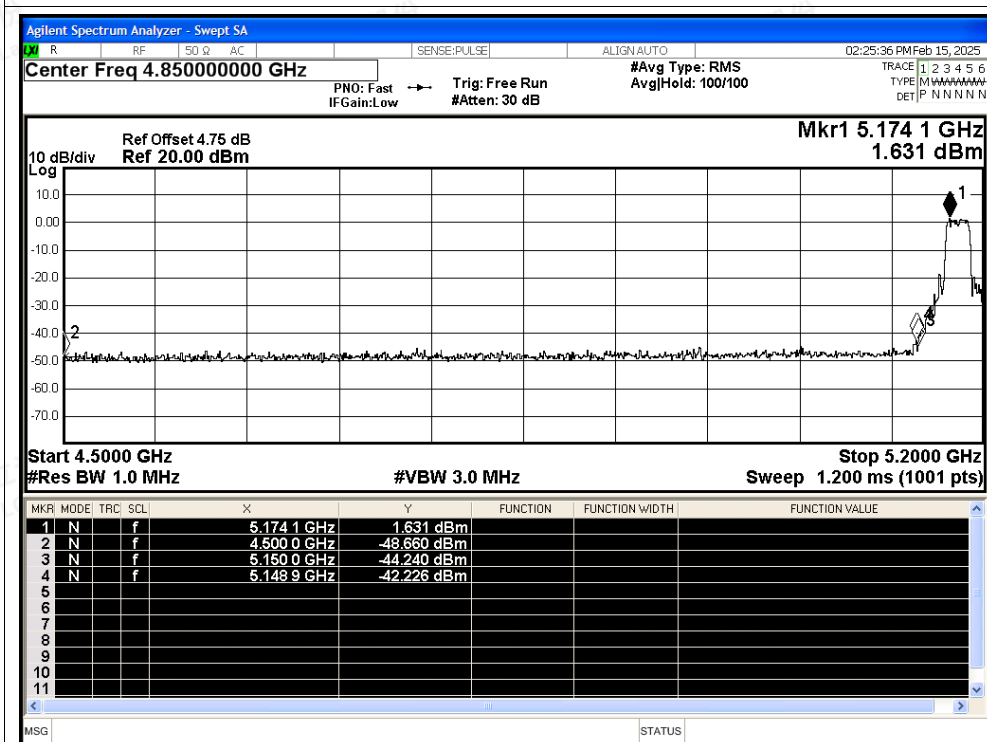

Restrict Band NVNT ac20 5180MHz Ant3 Average

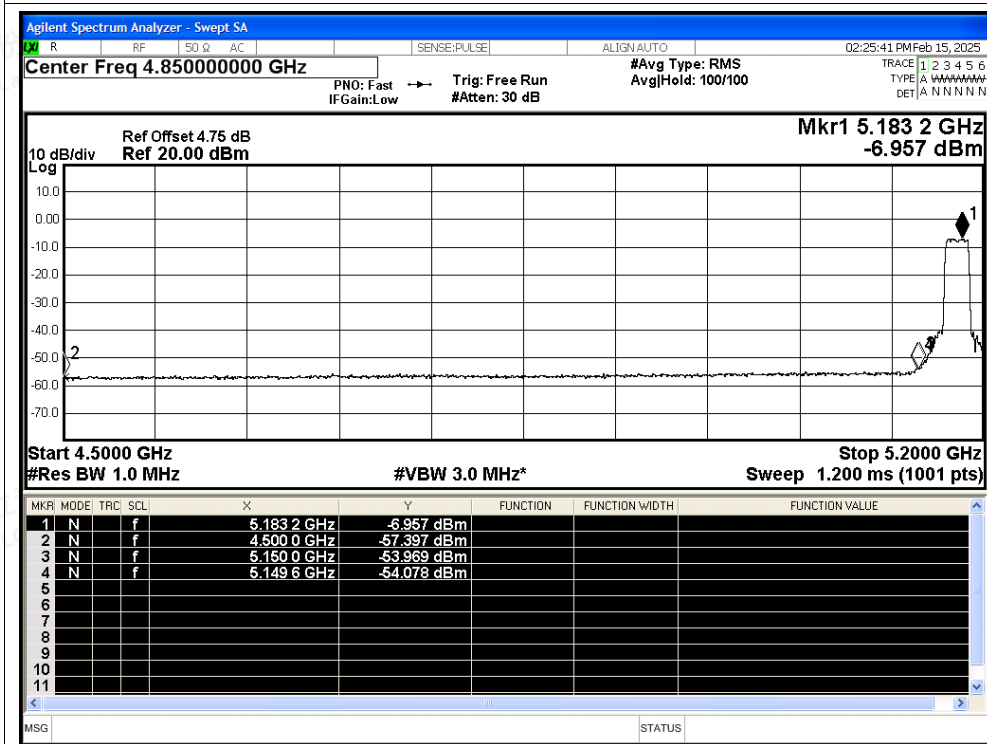

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant3 Peak

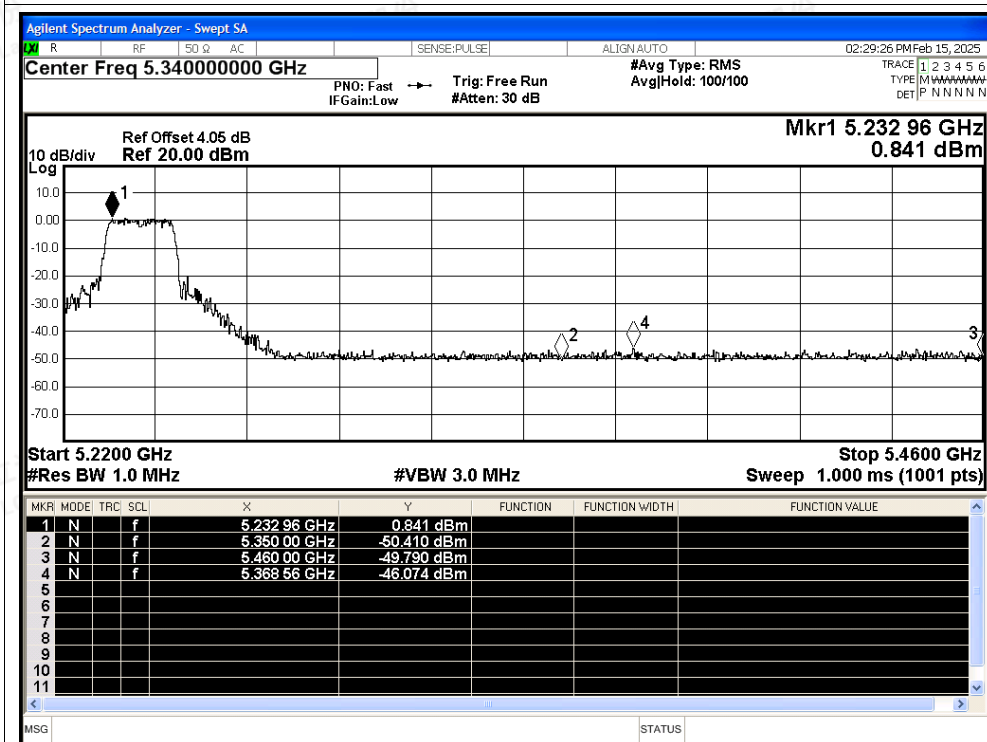

Restrict Band NVNT ac20 5240MHz Ant3 Average

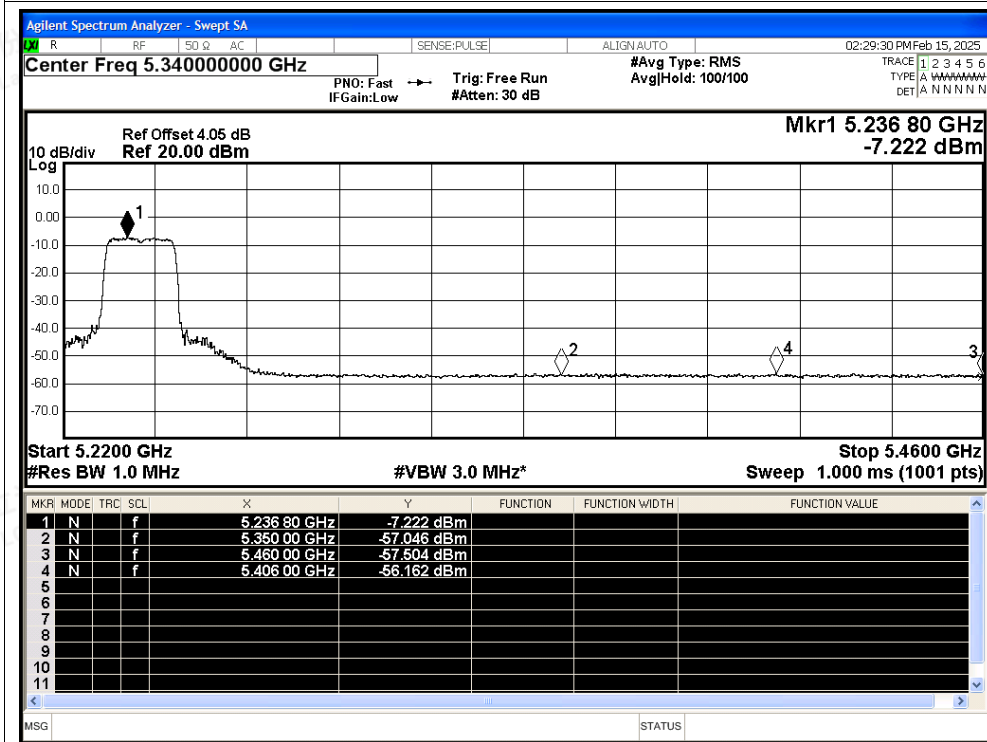

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant3 Peak

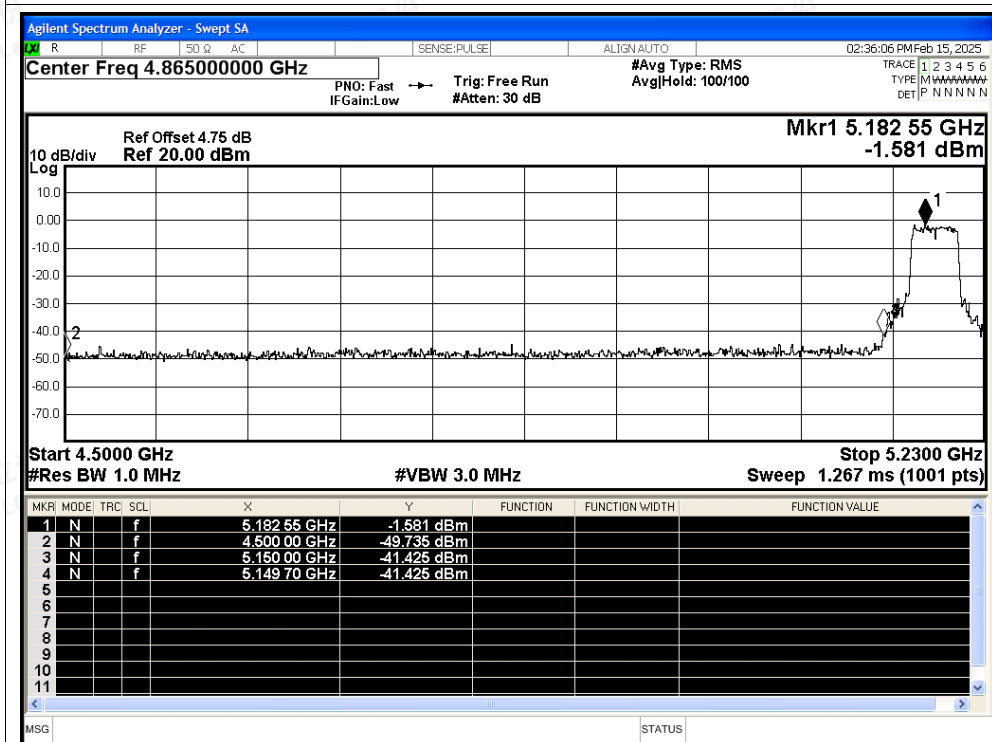

Restrict Band NVNT ac40 5190MHz Ant3 Average

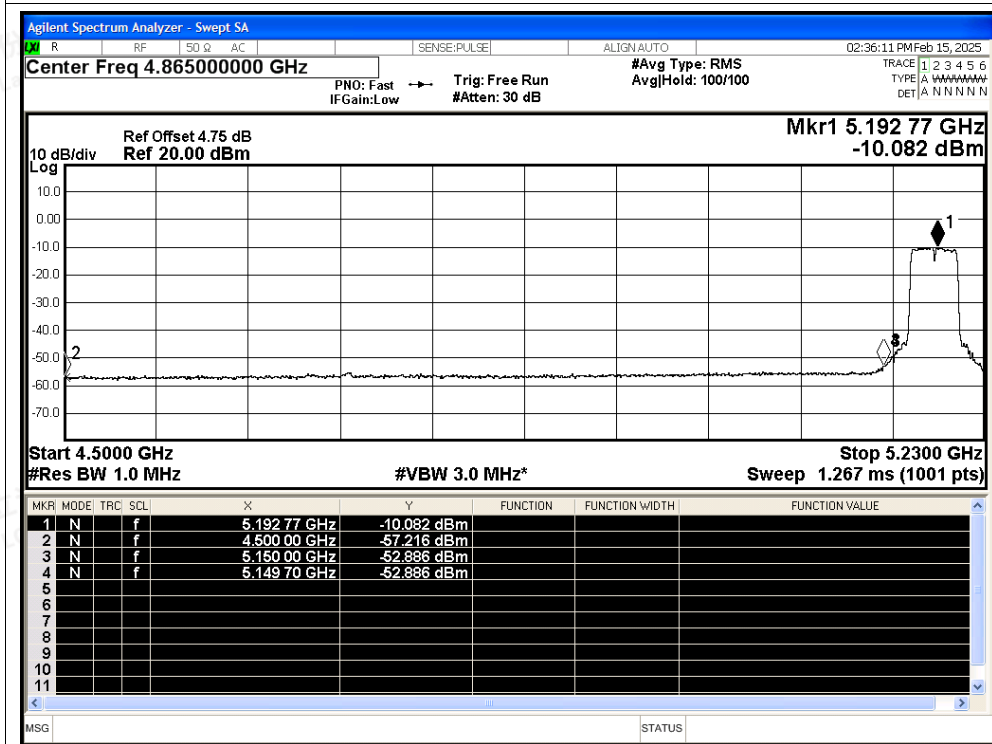

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant3 Peak

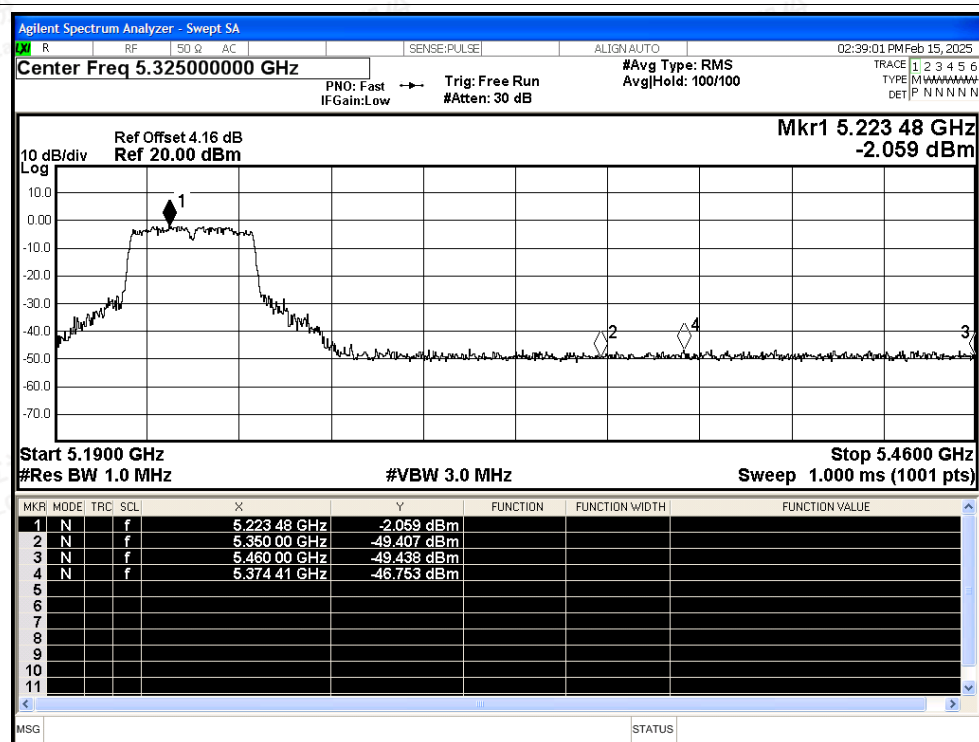

Restrict Band NVNT ac40 5230MHz Ant3 Average

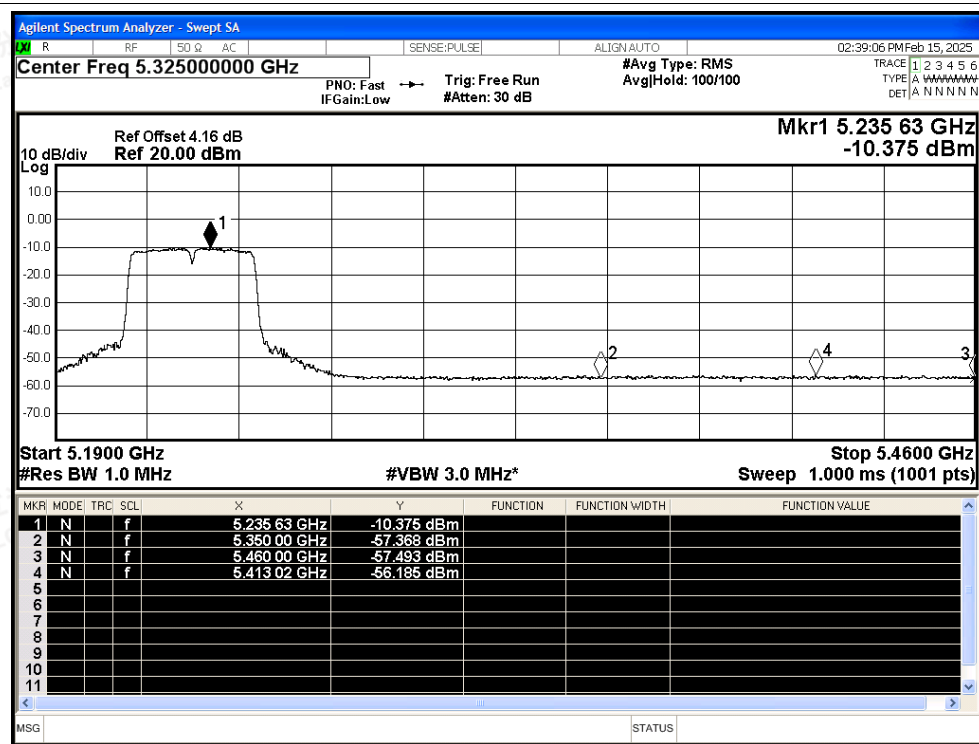

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

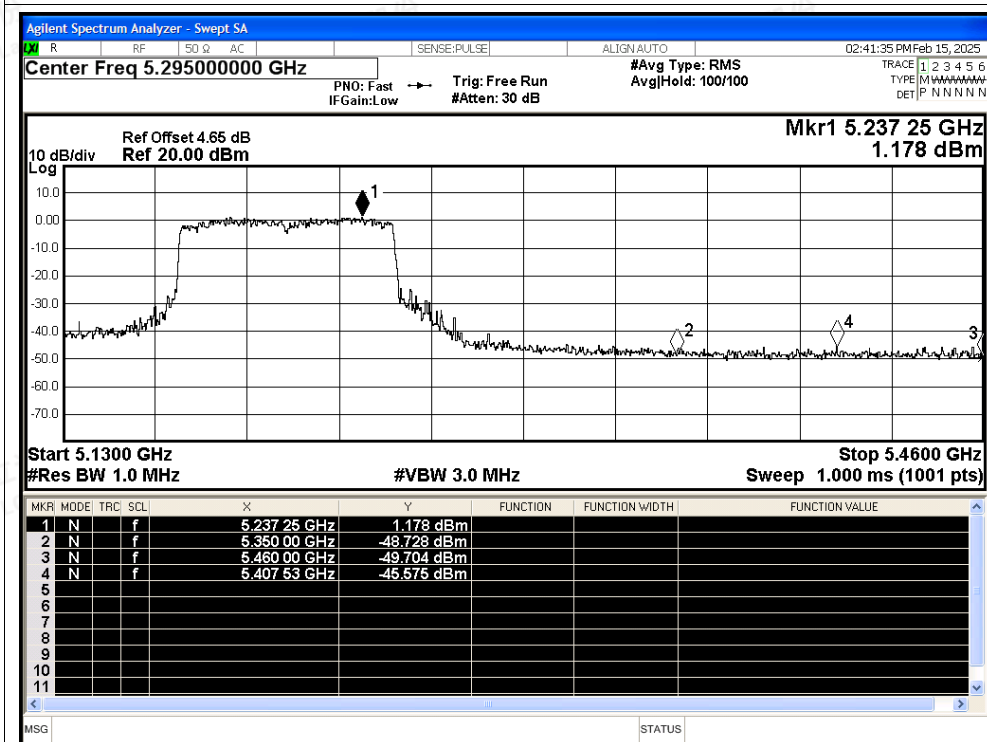

Restrict Band NVNT ac80 5210MHz Ant3 Average

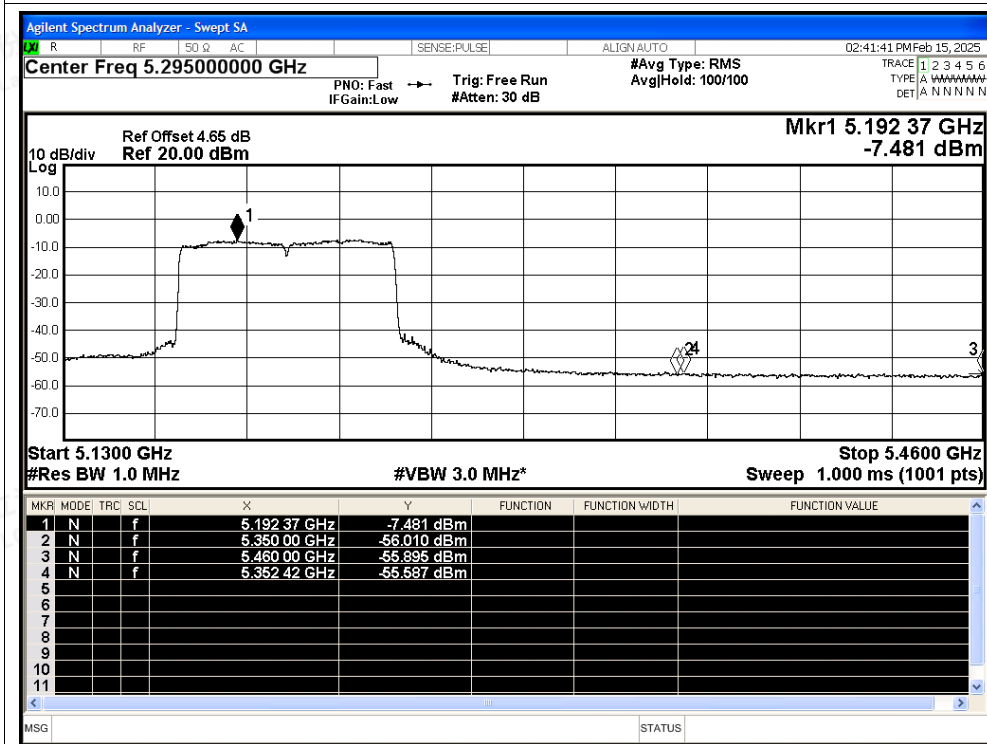

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

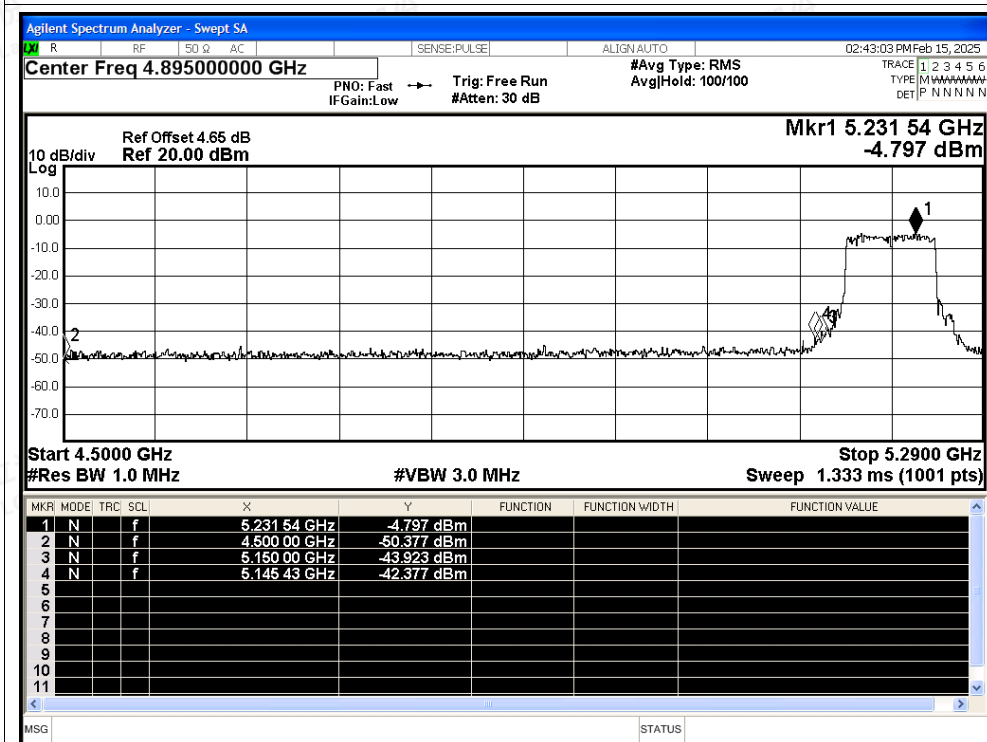

Restrict Band NVNT ac80 5210MHz Ant3 Average

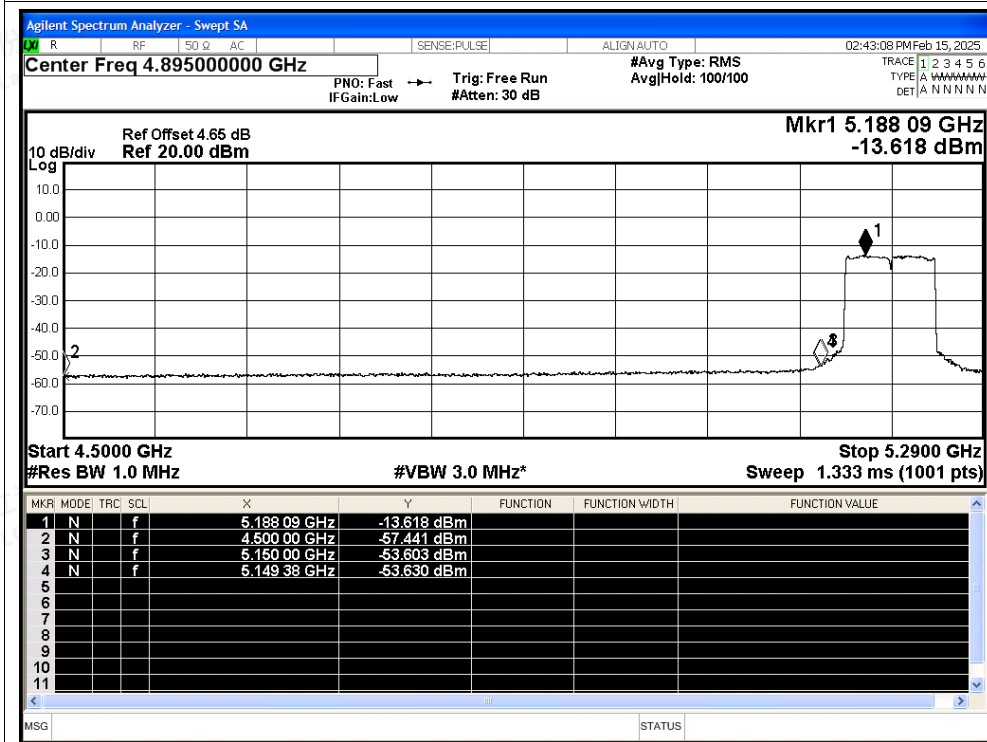

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant4	4500	-48.79	2.88	-	49.32	Peak	68.2	Pass
NVNT	a	5180	Ant4	4500	-57.9	2.88	0.24	40.45	Average	54	Pass
NVNT	a	5180	Ant4	5149.6	-44.73	2.88	-	53.38	Peak	68.2	Pass
NVNT	a	5180	Ant4	5148.9	-54.56	2.88	0.24	43.79	Average	54	Pass
NVNT	a	5180	Ant4	5150	-45.69	2.88	-	52.42	Peak	68.2	Pass
NVNT	a	5180	Ant4	5150	-55.25	2.88	0.24	43.10	Average	54	Pass
NVNT	a	5240	Ant4	5350	-48.1	2.88	-	50.01	Peak	68.2	Pass
NVNT	a	5240	Ant4	5350	-57.15	2.88	0.24	41.20	Average	54	Pass
NVNT	a	5240	Ant4	5370.24	-46.07	2.88	-	52.04	Peak	68.2	Pass
NVNT	a	5240	Ant4	5393.76	-56.5	2.88	0.24	41.85	Average	54	Pass
NVNT	a	5240	Ant4	5460	-50.01	2.88	-	48.10	Peak	68.2	Pass
NVNT	a	5240	Ant4	5460	-57.46	2.88	0.24	40.89	Average	54	Pass
NVNT	n20	5180	Ant4	4500	-48.47	2.88	-	49.64	Peak	68.2	Pass
NVNT	n20	5180	Ant4	4500	-57.52	2.88	0.12	40.71	Average	54	Pass
NVNT	n20	5180	Ant4	5059.3	-44.55	2.88	-	53.56	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5148.9	-54.01	2.88	0.12	44.22	Average	54	Pass
NVNT	n20	5180	Ant4	5150	-39.93	2.88	-	58.18	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5150	-54.27	2.88	0.12	43.96	Average	54	Pass
NVNT	n20	5240	Ant4	5350	-49.7	2.88	-	48.41	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5350	-56.84	2.88	0.12	41.39	Average	54	Pass
NVNT	n20	5240	Ant4	5457.12	-46.14	2.88	-	51.97	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5367.12	-56.25	2.88	0.12	41.98	Average	54	Pass
NVNT	n20	5240	Ant4	5460	-48.6	2.88	-	49.51	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5460	-57.8	2.88	0.12	40.43	Average	54	Pass
NVNT	n40	5190	Ant4	4500	-48.86	2.88	-	49.25	Peak	68.2	Pass
NVNT	n40	5190	Ant4	4500	-57.78	2.88	0.23	40.56	Average	54	Pass
NVNT	n40	5190	Ant4	5148.24	-42.71	2.88	-	55.40	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5149.7	-52.44	2.88	0.23	45.90	Average	54	Pass
NVNT	n40	5190	Ant4	5150	-43.13	2.88	-	54.98	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5150	-52.44	2.88	0.23	45.90	Average	54	Pass
NVNT	n40	5230	Ant4	5350	-50.11	2.88	-	48.00	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5350	-56.86	2.88	0.24	41.49	Average	54	Pass
NVNT	n40	5230	Ant4	5390.88	-46	2.88	-	52.11	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5407.62	-56.31	2.88	0.24	42.04	Average	54	Pass
NVNT	n40	5230	Ant4	5460	-50.22	2.88	-	47.89	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5460	-57.08	2.88	0.24	41.27	Average	54	Pass
NVNT	ac20	5180	Ant4	4500	-49.98	2.88	-	48.13	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	4500	-57.39	2.88	0.12	40.84	Average	54	Pass
NVNT	ac20	5180	Ant4	5148.9	-37.62	2.88	-	60.49	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ac20	5180	Ant4	5148.2	-54.05	2.88	0.12	44.18	Average	54	Pass
NVNT	ac20	5180	Ant4	5150	-40.96	2.88	-	57.15	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	5150	-53.57	2.88	0.12	44.66	Average	54	Pass
NVNT	ac20	5240	Ant4	5350	-48.63	2.88	-	49.48	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5350	-57.6	2.88	0.12	40.63	Average	54	Pass
NVNT	ac20	5240	Ant4	5363.52	-46.04	2.88	-	52.07	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5368.8	-56.44	2.88	0.12	41.79	Average	54	Pass
NVNT	ac20	5240	Ant4	5460	-48.48	2.88	-	49.63	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5460	-57.21	2.88	0.12	41.02	Average	54	Pass
NVNT	ac40	5190	Ant4	4500	-49.96	2.88	-	48.15	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	4500	-57.17	2.88	0.24	41.18	Average	54	Pass
NVNT	ac40	5190	Ant4	5148.24	-42.82	2.88	-	55.29	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5148.97	-53.38	2.88	0.24	44.97	Average	54	Pass
NVNT	ac40	5190	Ant4	5150	-43.03	2.88	-	55.08	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5150	-53.77	2.88	0.24	44.58	Average	54	Pass
NVNT	ac40	5230	Ant4	5350	-49.41	2.88	-	48.70	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5350	-56.75	2.88	0.24	41.60	Average	54	Pass
NVNT	ac40	5230	Ant4	5381.16	-45.02	2.88	-	53.09	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5367.93	-56.16	2.88	0.24	42.19	Average	54	Pass
NVNT	ac40	5230	Ant4	5460	-49.14	2.88	-	48.97	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5460	-57.16	2.88	0.24	41.19	Average	54	Pass
NVNT	ac80	5210	Ant4	5350	-48.82	2.88	-	49.29	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5350	-55.58	2.88	0.25	42.78	Average	54	Pass
NVNT	ac80	5210	Ant4	5363.97	-45.16	2.88	-	52.95	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5369.25	-55.3	2.88	0.25	43.06	Average	54	Pass
NVNT	ac80	5210	Ant4	5460	-49.05	2.88	-	49.06	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5460	-57.15	2.88	0.25	41.21	Average	54	Pass
NVNT	ac80	5210	Ant4	4500	-49.88	2.88	-	48.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	4500	-57.63	2.88	0.25	40.73	Average	54	Pass
NVNT	ac80	5210	Ant4	5149.38	-41.63	2.88	-	56.48	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5149.38	-52.85	2.88	0.25	45.51	Average	54	Pass
NVNT	ac80	5210	Ant4	5150	-42.85	2.88	-	55.26	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5150	-52.93	2.88	0.25	45.43	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant4 Peak

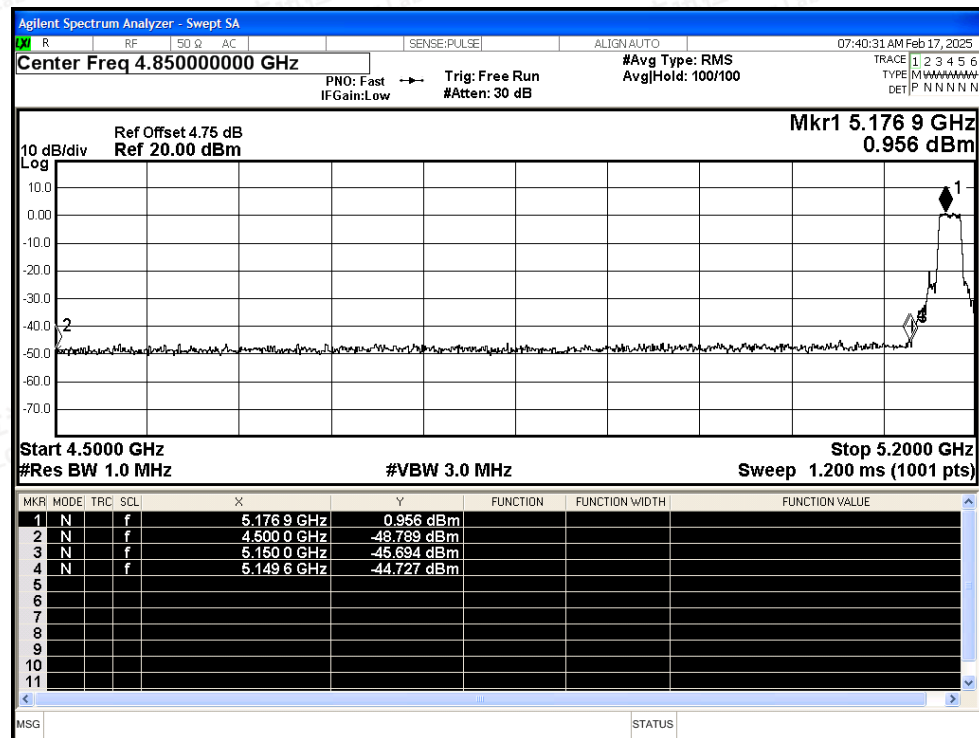

Restrict Band NVNT a 5180MHz Ant4 Average

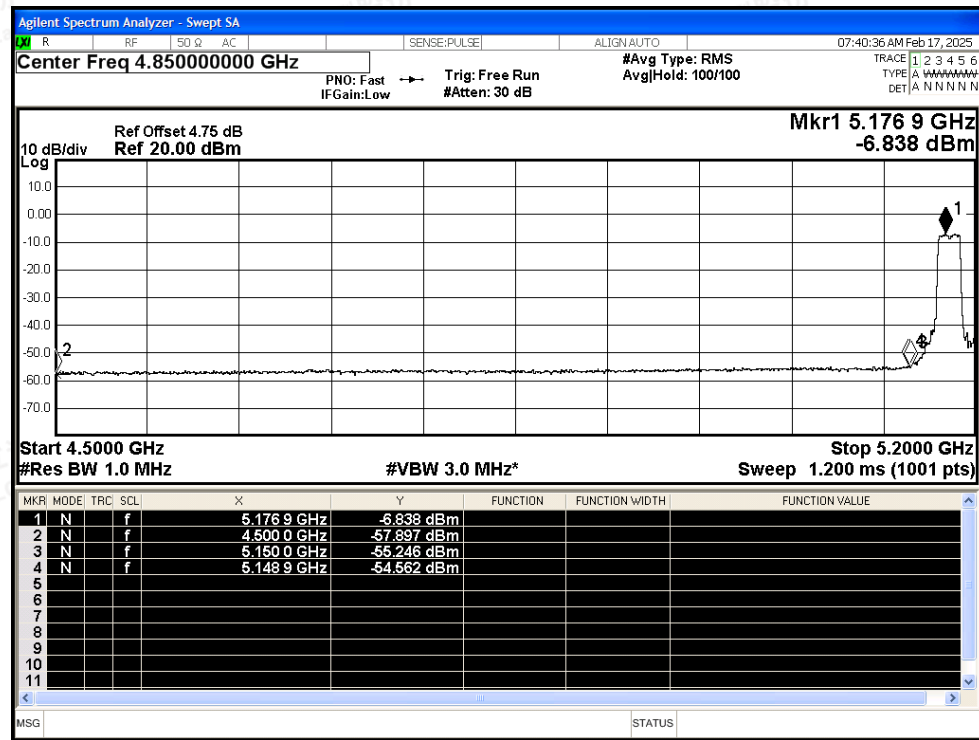

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant4 Peak

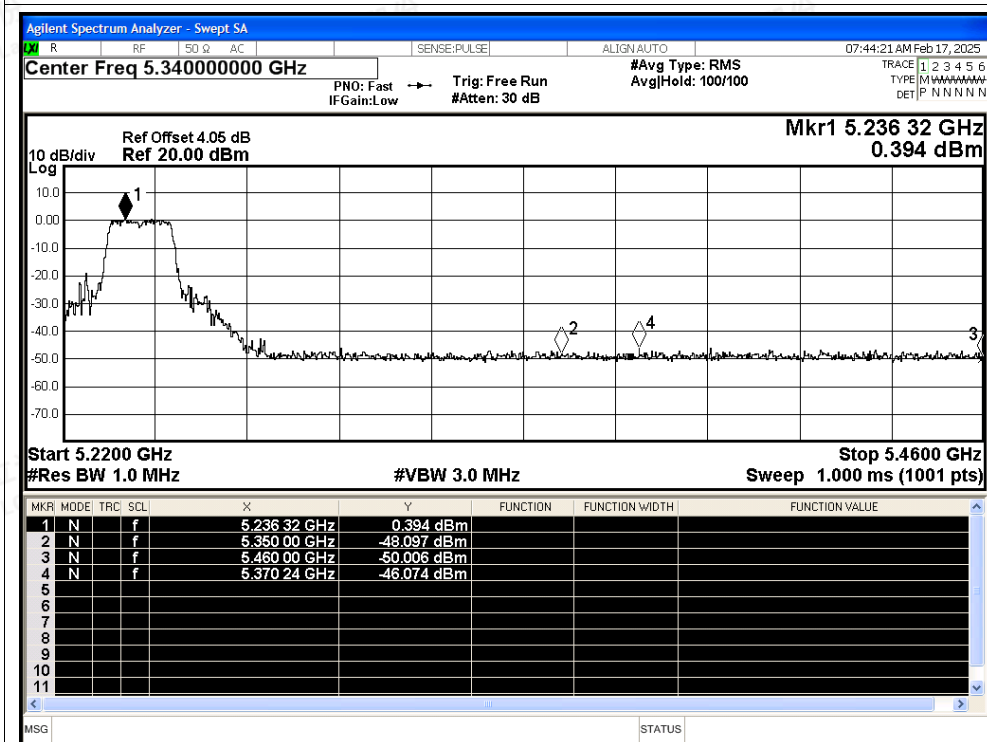

Restrict Band NVNT a 5240MHz Ant4 Average

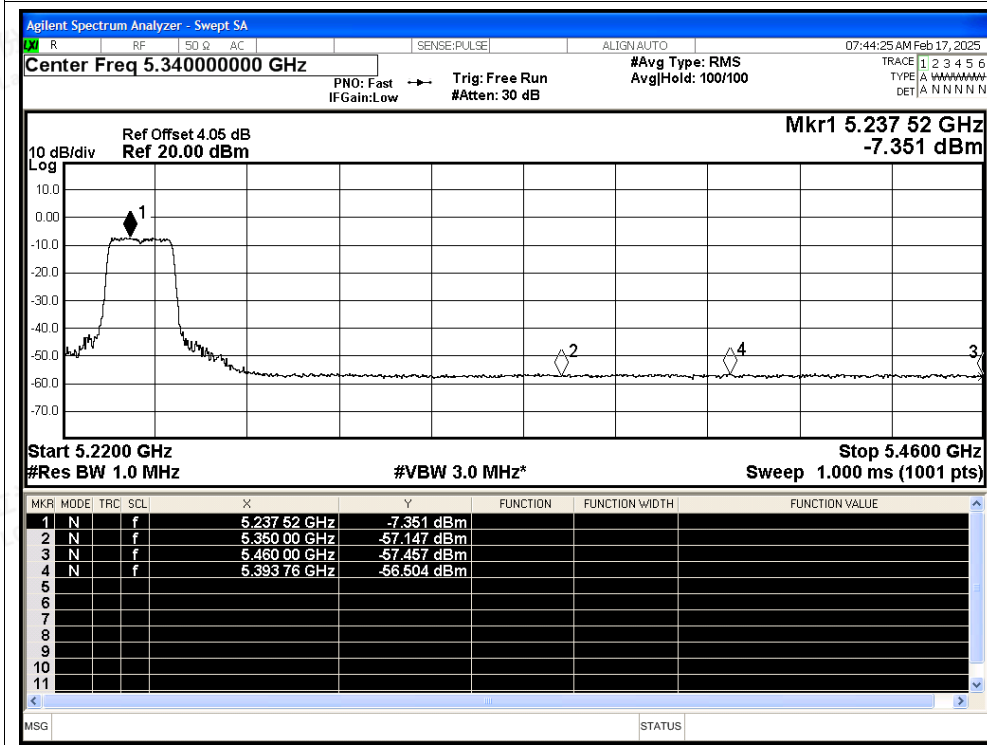

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant4 Peak

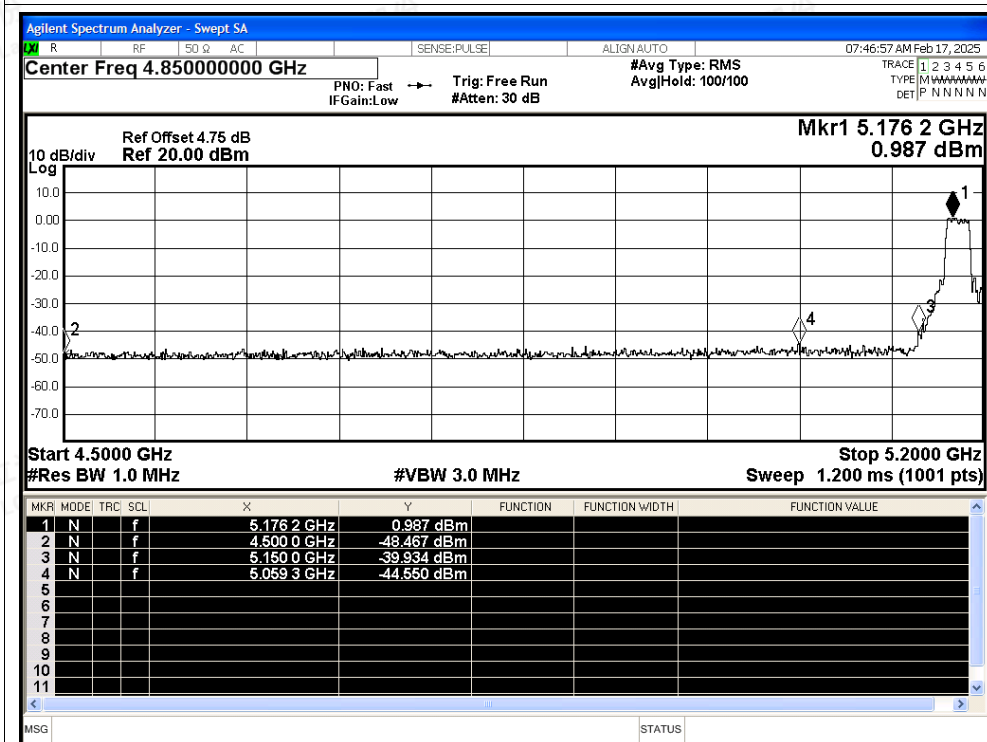

Restrict Band NVNT n20 5180MHz Ant4 Average

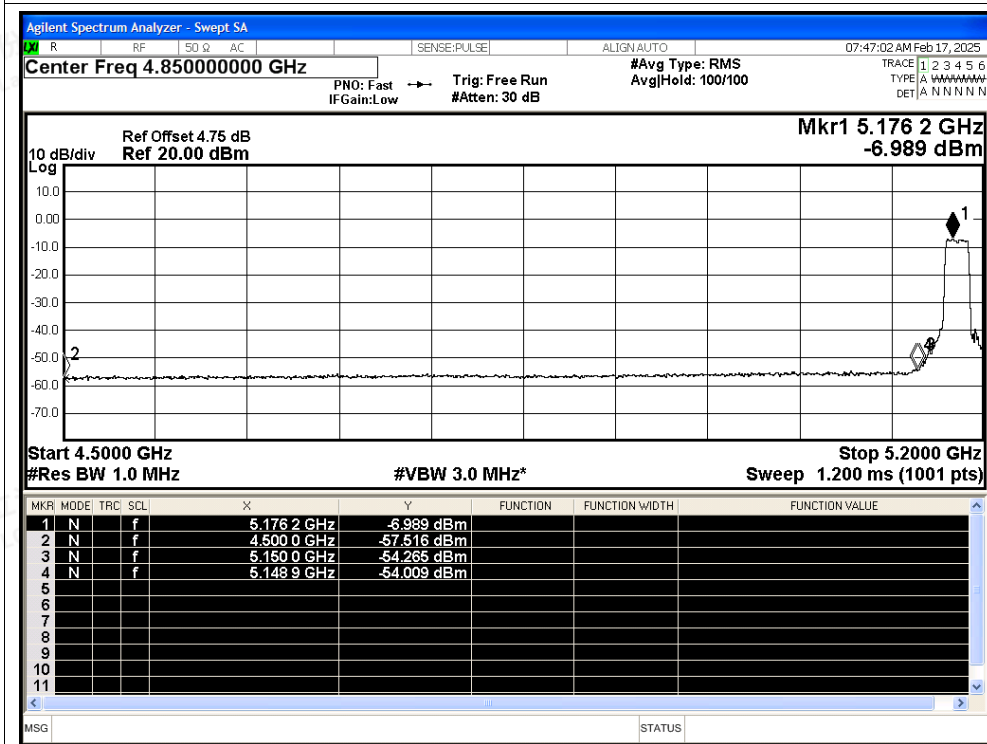

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant4 Peak

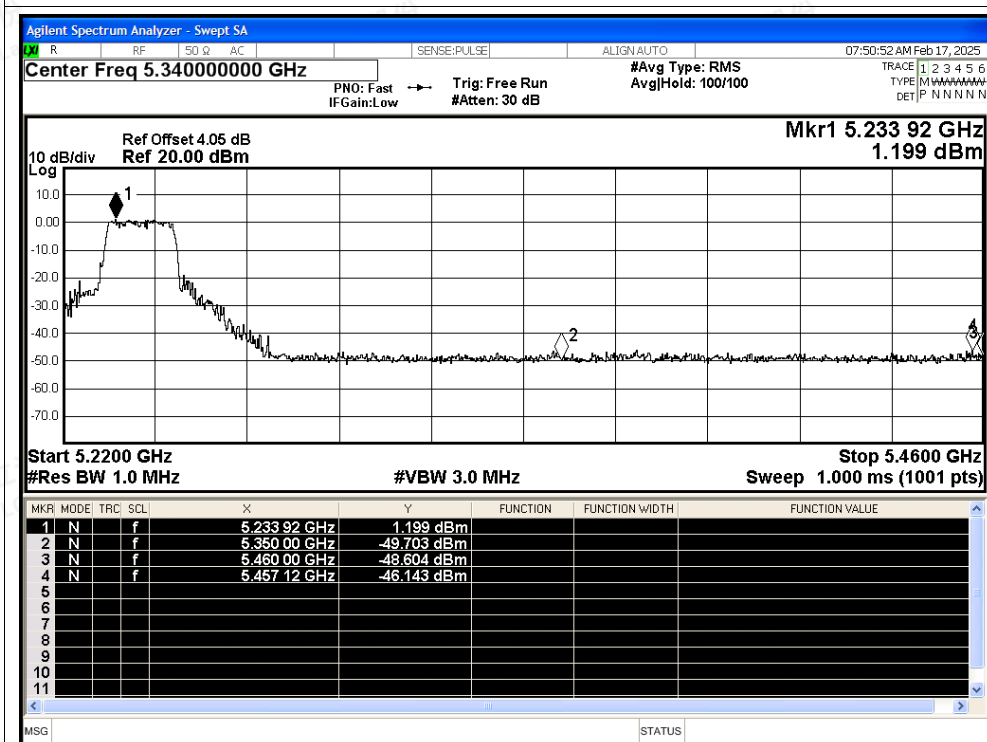

Restrict Band NVNT n20 5240MHz Ant4 Average

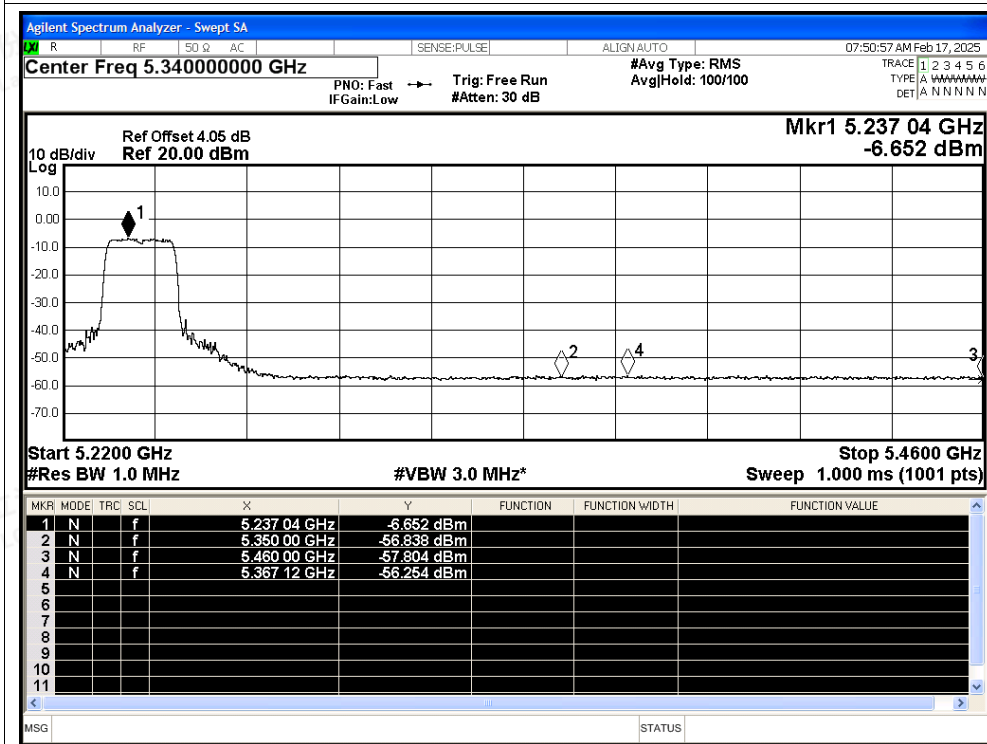

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant4 Peak

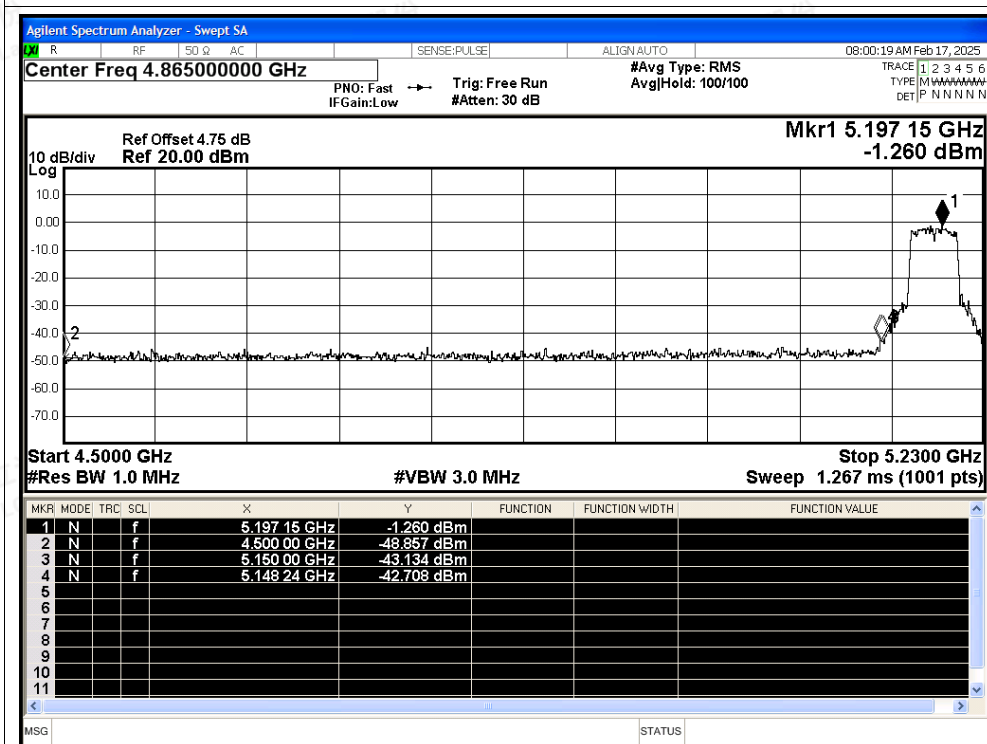

Restrict Band NVNT n40 5190MHz Ant4 Average

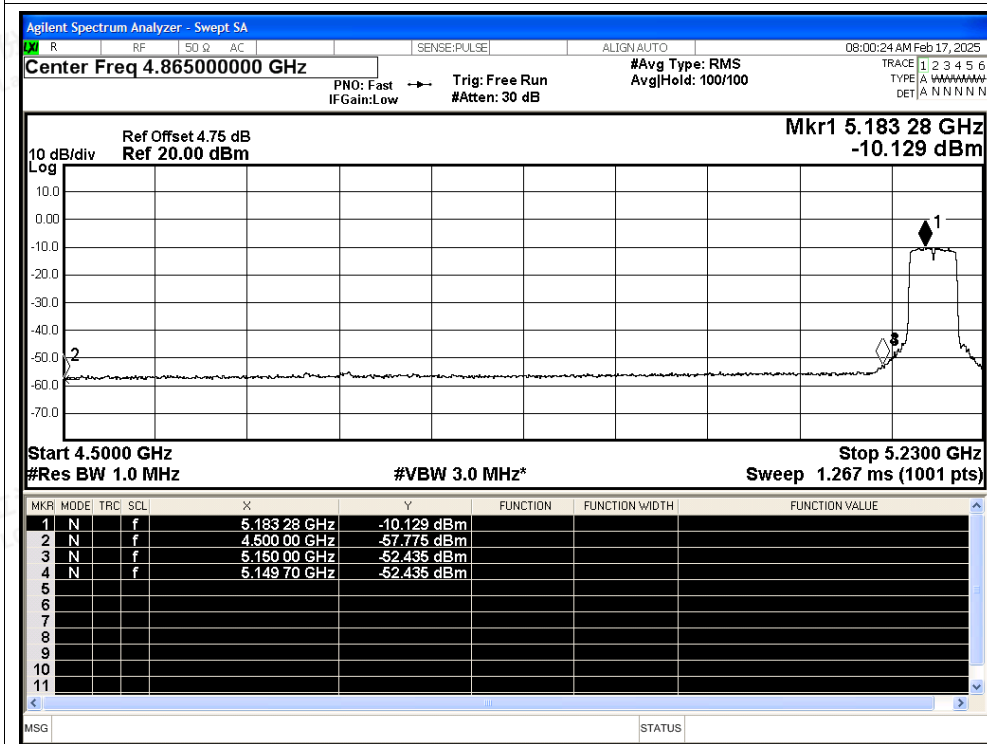

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant4 Peak

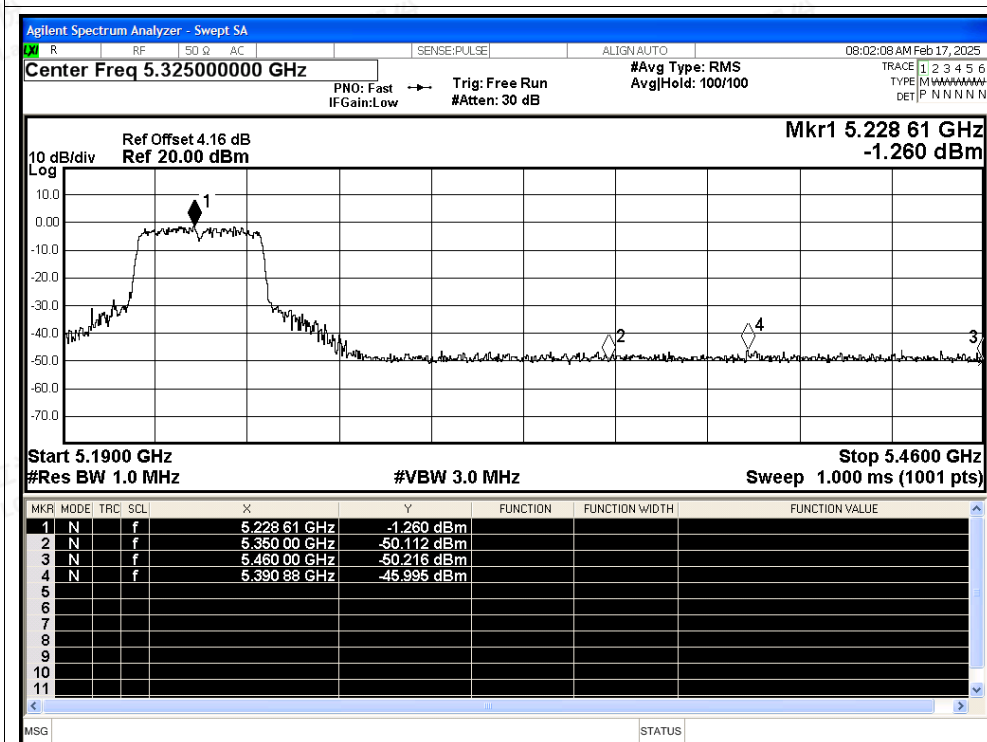

Restrict Band NVNT n40 5230MHz Ant4 Average

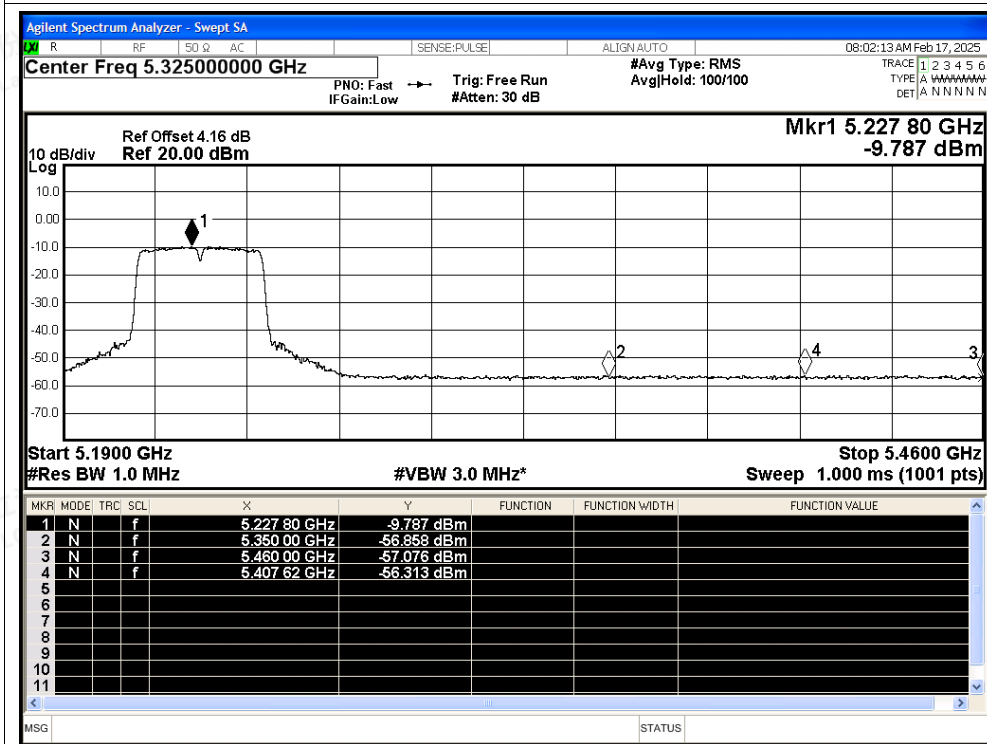

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant4 Peak

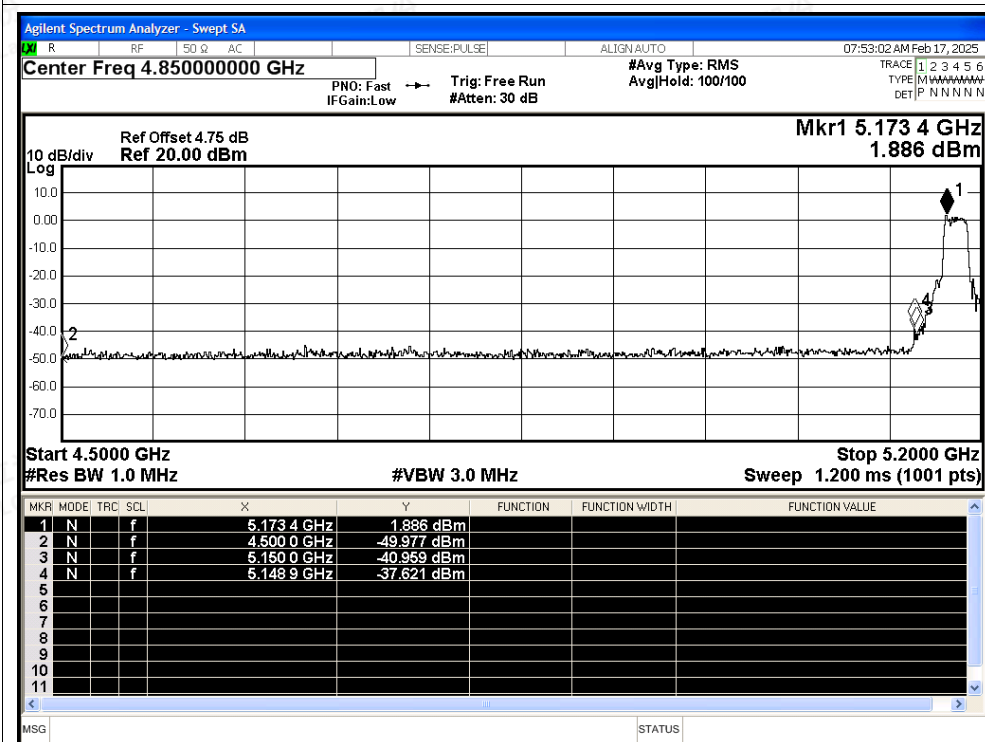

Restrict Band NVNT ac20 5180MHz Ant4 Average

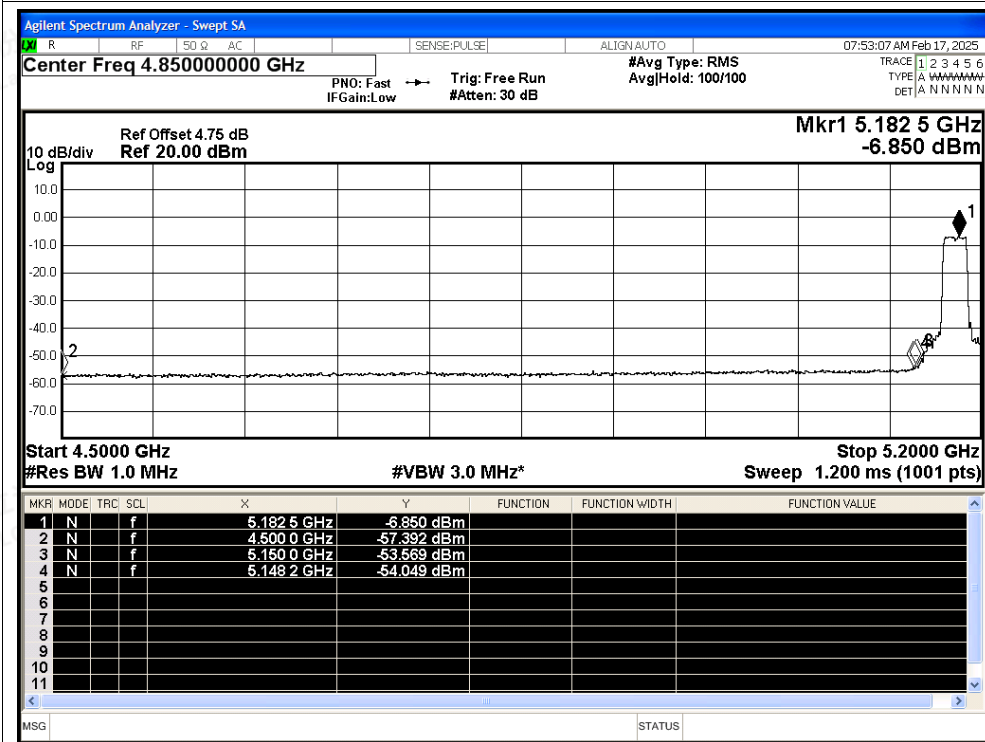

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant4 Peak

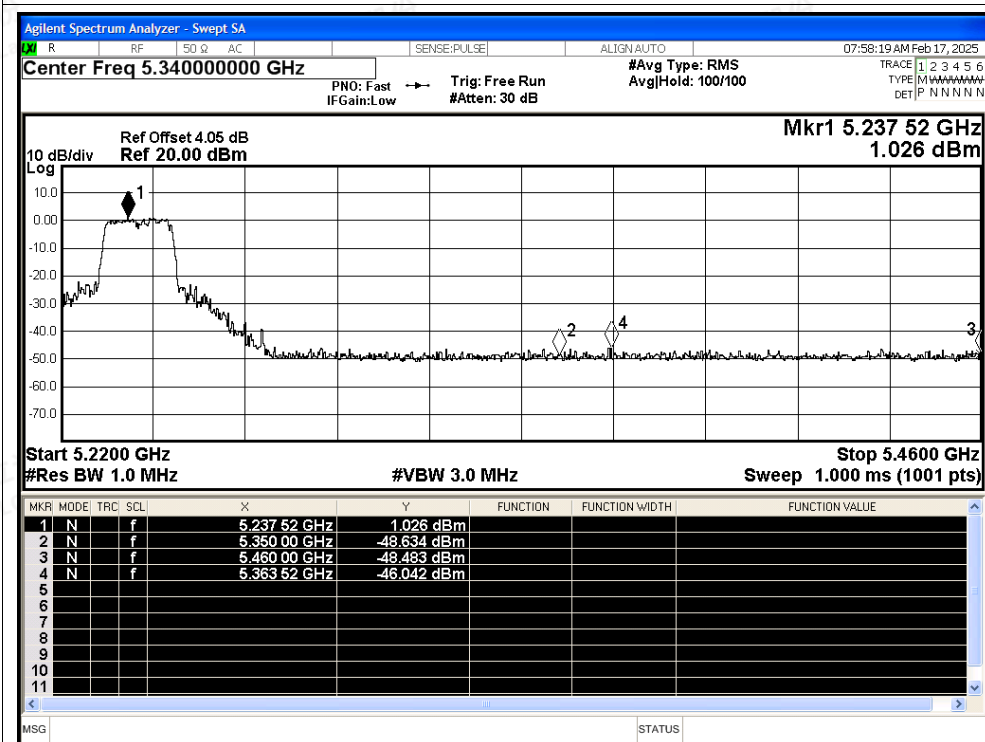

Restrict Band NVNT ac20 5240MHz Ant4 Average

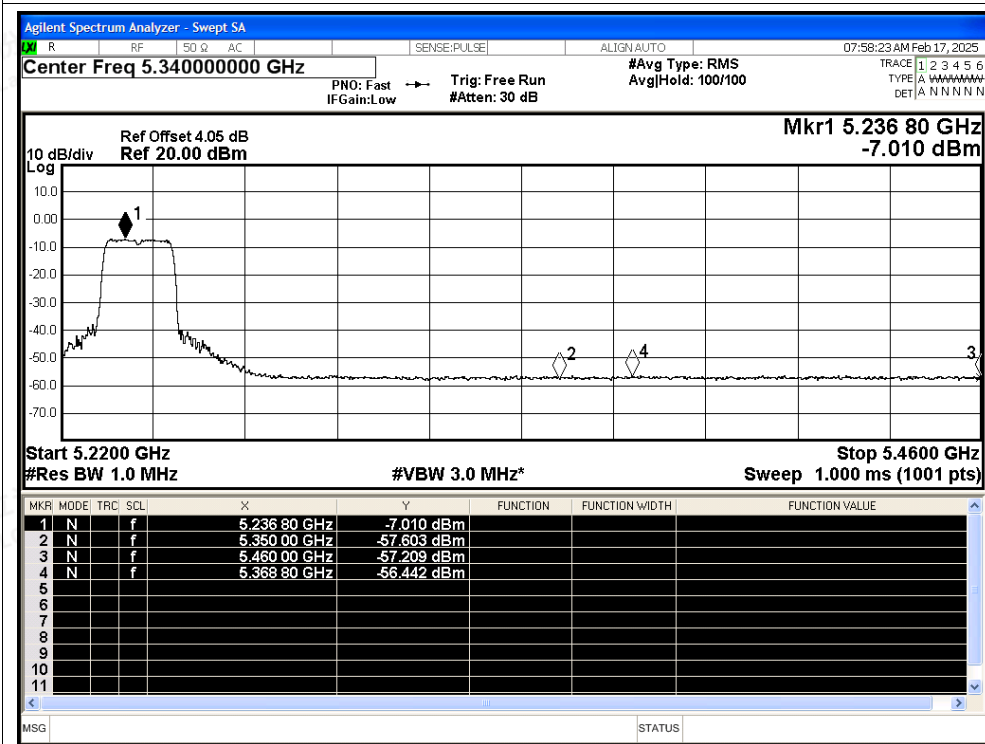

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant4 Peak

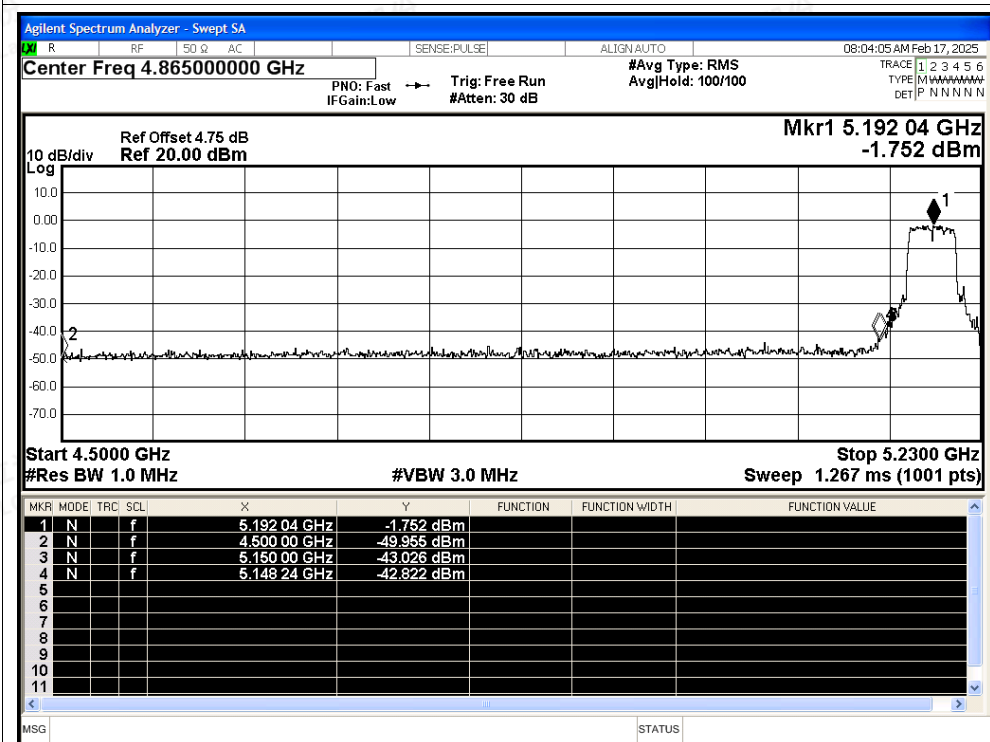

Restrict Band NVNT ac40 5190MHz Ant4 Average

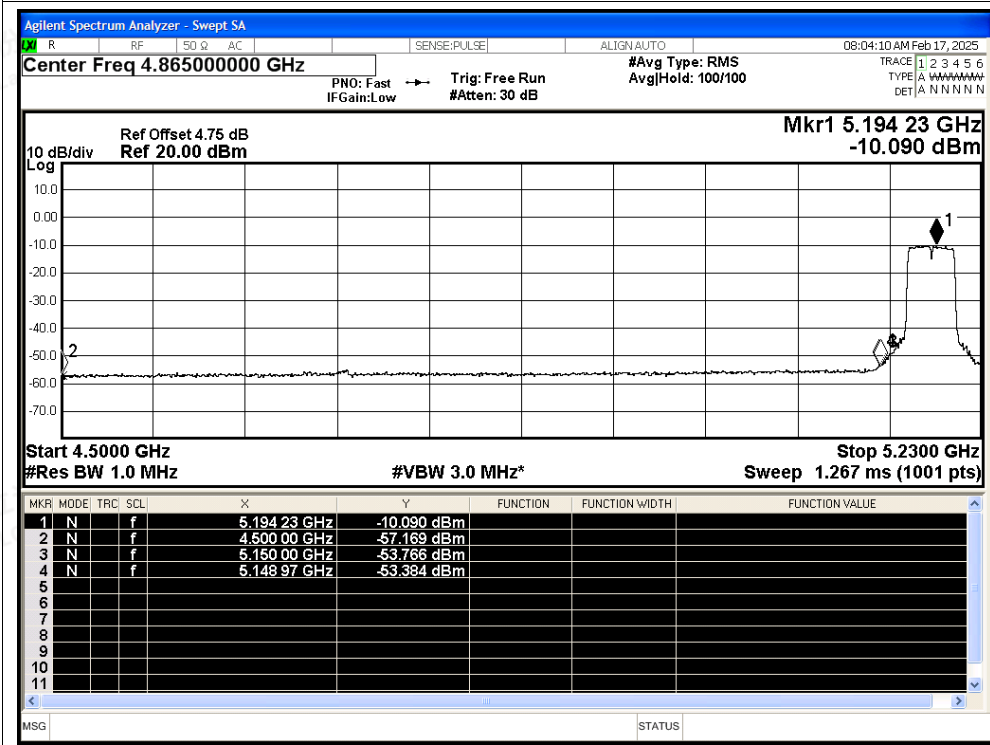

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant4 Peak

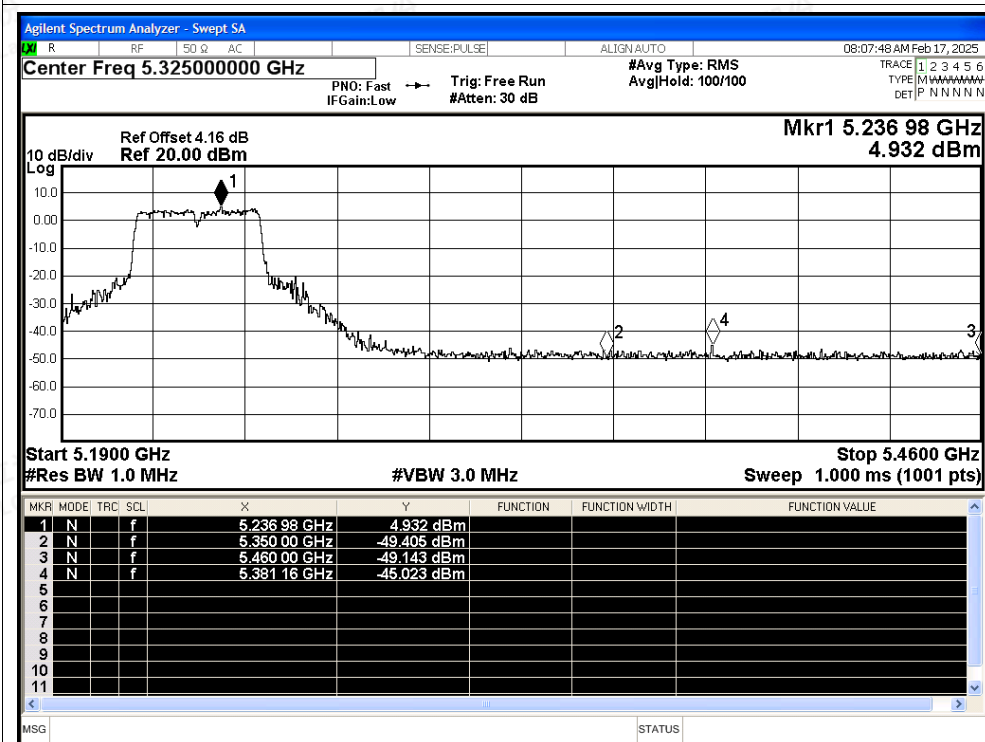

Restrict Band NVNT ac40 5230MHz Ant4 Average

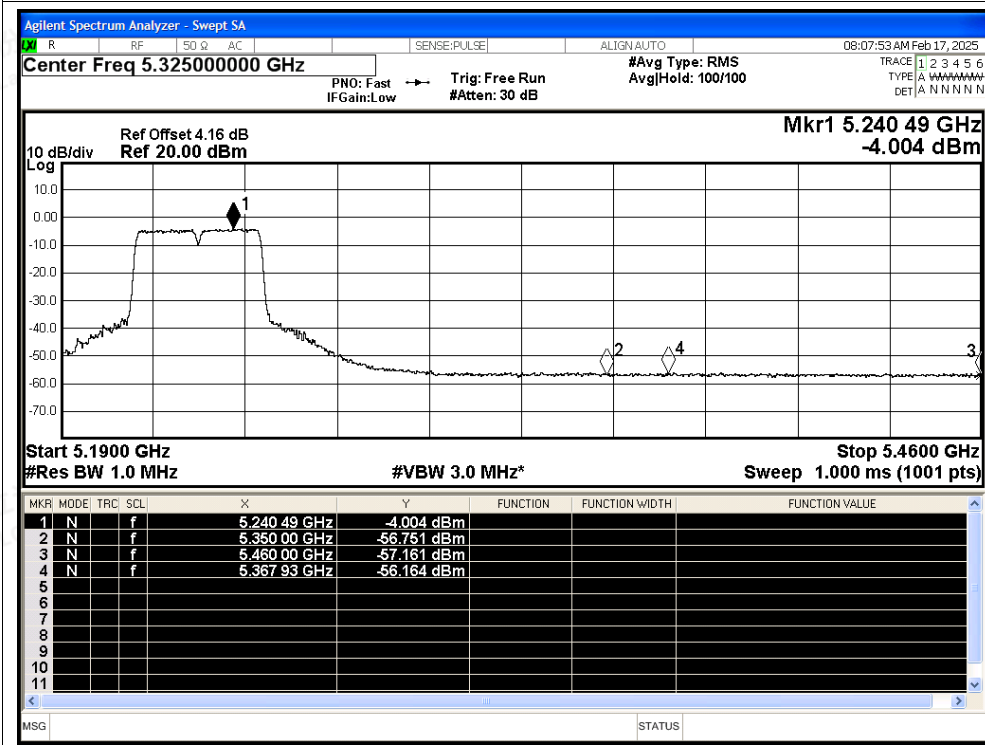

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant4 Peak

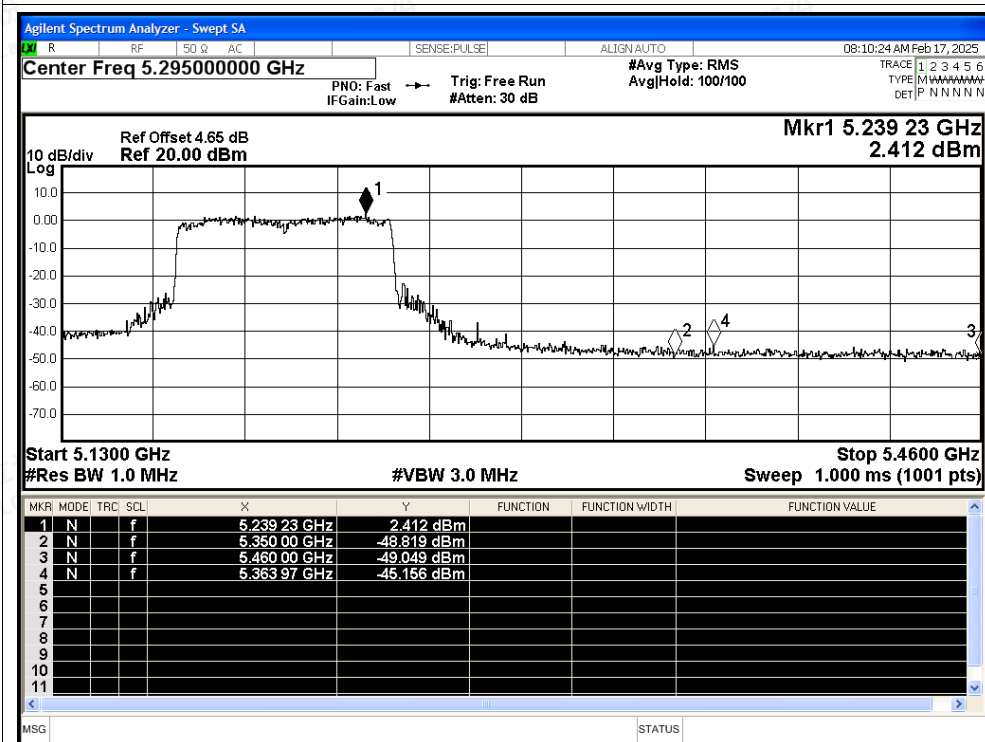

Restrict Band NVNT ac80 5210MHz Ant4 Average

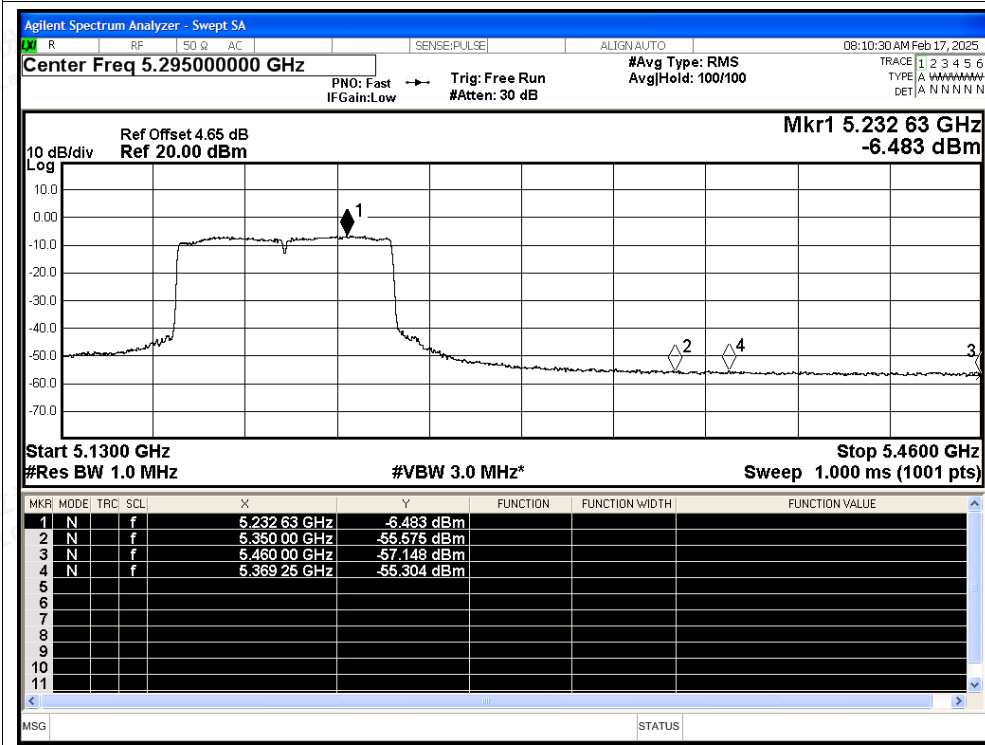

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant4 Peak

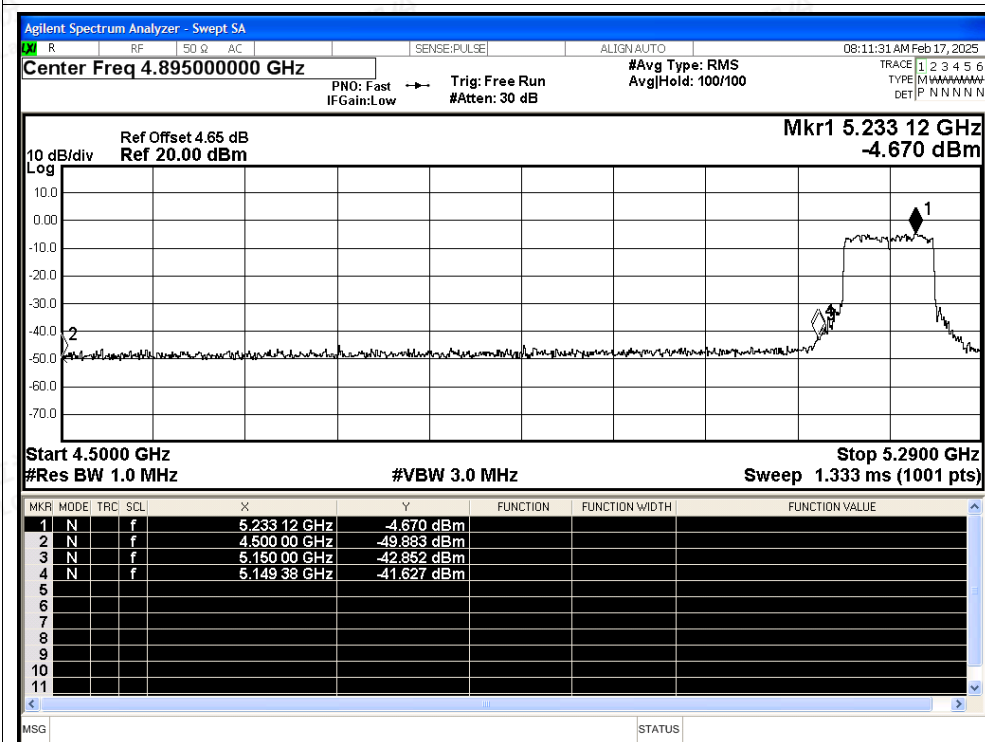

Restrict Band NVNT ac80 5210MHz Ant4 Average

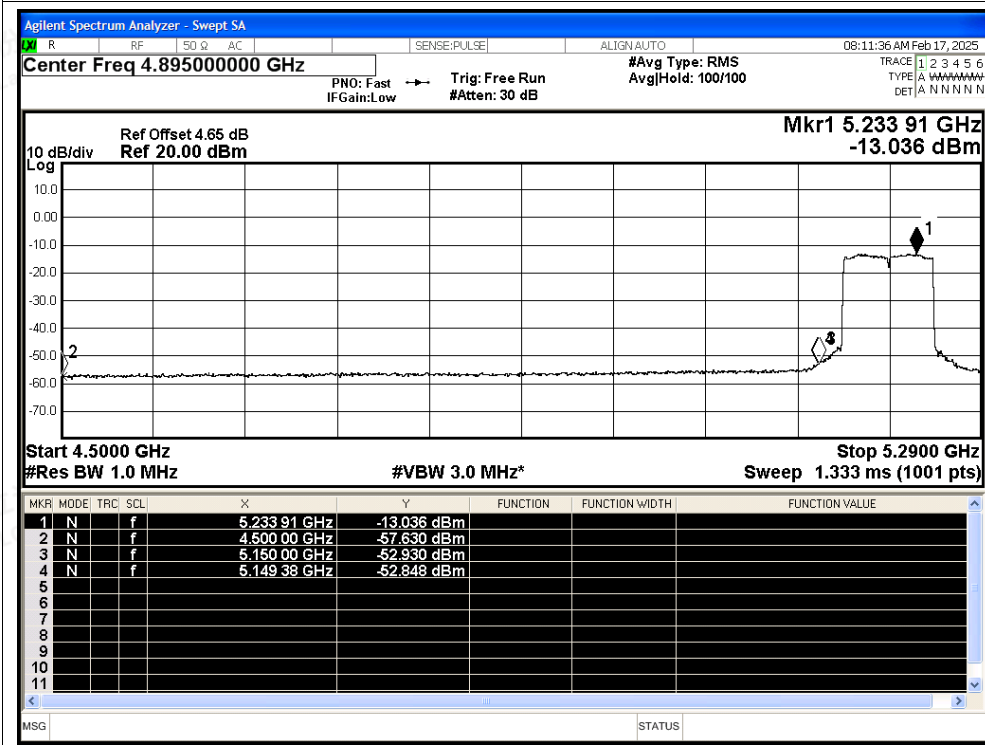

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant3 Power (dBm)	Ant4 Power (dBm)	Gain (dBi)	Total E (dBuV/ m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-49.49	-48.47	6.00	55.29	Peak	68.2	Pass
NVNT	n20	5180	-57.53	-57.52	6.00	46.71	Average	54	Pass
NVNT	n20	5180	-43.68	-44.55	6.00	60.14	Peak	68.2	Pass
NVNT	n20	5180	-54.37	-54.01	6.00	50.05	Average	54	Pass
NVNT	n20	5180	-43.93	-39.93	6.00	62.75	Peak	68.2	Pass
NVNT	n20	5180	-53.67	-54.27	6.00	50.28	Average	54	Pass
NVNT	n20	5240	-48.11	-49.7	6.00	55.41	Peak	68.2	Pass
NVNT	n20	5240	-57.43	-56.84	6.00	47.11	Average	54	Pass
NVNT	n20	5240	-46.21	-46.14	6.00	58.06	Peak	68.2	Pass
NVNT	n20	5240	-56.26	-56.25	6.00	47.98	Average	54	Pass
NVNT	n20	5240	-48.17	-48.6	6.00	55.86	Peak	68.2	Pass
NVNT	n20	5240	-57.06	-57.8	6.00	46.82	Average	54	Pass
NVNT	n40	5190	-49.91	-48.86	6.00	54.88	Peak	68.2	Pass
NVNT	n40	5190	-57.45	-57.78	6.00	46.63	Average	54	Pass
NVNT	n40	5190	-42.3	-42.71	6.00	61.74	Peak	68.2	Pass
NVNT	n40	5190	-53.21	-52.44	6.00	51.43	Average	54	Pass
NVNT	n40	5190	-43.01	-43.13	6.00	61.17	Peak	68.2	Pass
NVNT	n40	5190	-53.21	-52.44	6.00	51.43	Average	54	Pass
NVNT	n40	5230	-48.81	-50.11	6.00	54.83	Peak	68.2	Pass
NVNT	n40	5230	-56.62	-56.86	6.00	47.50	Average	54	Pass
NVNT	n40	5230	-46.08	-46	6.00	58.20	Peak	68.2	Pass
NVNT	n40	5230	-56.28	-56.31	6.00	47.94	Average	54	Pass
NVNT	n40	5230	-47.28	-50.22	6.00	55.73	Peak	68.2	Pass
NVNT	n40	5230	-57.1	-57.08	6.00	47.15	Average	54	Pass
NVNT	ac20	5180	-48.66	-49.98	6.00	54.97	Peak	68.2	Pass
NVNT	ac20	5180	-57.4	-57.39	6.00	46.84	Average	54	Pass
NVNT	ac20	5180	-42.23	-37.62	6.00	64.90	Peak	68.2	Pass
NVNT	ac20	5180	-54.08	-54.05	6.00	50.17	Average	54	Pass
NVNT	ac20	5180	-44.24	-40.96	6.00	61.94	Peak	68.2	Pass
NVNT	ac20	5180	-53.97	-53.57	6.00	50.47	Average	54	Pass
NVNT	ac20	5240	-50.41	-48.63	6.00	54.81	Peak	68.2	Pass
NVNT	ac20	5240	-57.05	-57.6	6.00	46.92	Average	54	Pass
NVNT	ac20	5240	-46.07	-46.04	6.00	58.18	Peak	68.2	Pass
NVNT	ac20	5240	-56.16	-56.44	6.00	47.94	Average	54	Pass
NVNT	ac20	5240	-49.79	-48.48	6.00	55.15	Peak	68.2	Pass
NVNT	ac20	5240	-57.5	-57.21	6.00	46.89	Average	54	Pass
NVNT	ac40	5190	-49.74	-49.96	6.00	54.39	Peak	68.2	Pass
NVNT	ac40	5190	-57.22	-57.17	6.00	47.04	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-41.43	-42.82	6.00	62.17	Peak	68.2	Pass
NVNT	ac40	5190	-52.89	-53.38	6.00	51.11	Average	54	Pass
NVNT	ac40	5190	-41.43	-43.03	6.00	62.08	Peak	68.2	Pass
NVNT	ac40	5190	-52.89	-53.77	6.00	50.93	Average	54	Pass
NVNT	ac40	5230	-49.41	-49.41	6.00	54.83	Peak	68.2	Pass
NVNT	ac40	5230	-57.37	-56.75	6.00	47.19	Average	54	Pass
NVNT	ac40	5230	-46.75	-45.02	6.00	58.44	Peak	68.2	Pass
NVNT	ac40	5230	-56.19	-56.16	6.00	48.06	Average	54	Pass
NVNT	ac40	5230	-49.44	-49.14	6.00	54.95	Peak	68.2	Pass
NVNT	ac40	5230	-57.49	-57.16	6.00	46.92	Average	54	Pass
NVNT	ac80	5210	-48.73	-48.82	6.00	55.46	Peak	68.2	Pass
NVNT	ac80	5210	-56.01	-55.58	6.00	48.45	Average	54	Pass
NVNT	ac80	5210	-45.58	-45.16	6.00	58.87	Peak	68.2	Pass
NVNT	ac80	5210	-55.59	-55.3	6.00	48.80	Average	54	Pass
NVNT	ac80	5210	-49.7	-49.05	6.00	54.88	Peak	68.2	Pass
NVNT	ac80	5210	-55.9	-57.15	6.00	47.76	Average	54	Pass
NVNT	ac80	5210	-50.38	-49.88	6.00	54.12	Peak	68.2	Pass
NVNT	ac80	5210	-57.44	-57.63	6.00	46.70	Average	54	Pass
NVNT	ac80	5210	-42.38	-41.63	6.00	62.25	Peak	68.2	Pass
NVNT	ac80	5210	-53.63	-52.85	6.00	51.02	Average	54	Pass
NVNT	ac80	5210	-43.92	-42.85	6.00	60.89	Peak	68.2	Pass
NVNT	ac80	5210	-53.6	-52.93	6.00	50.99	Average	54	Pass





D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5200	0	0	25	Pass
NVNT	a	5240	Ant1	5240	0	0	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

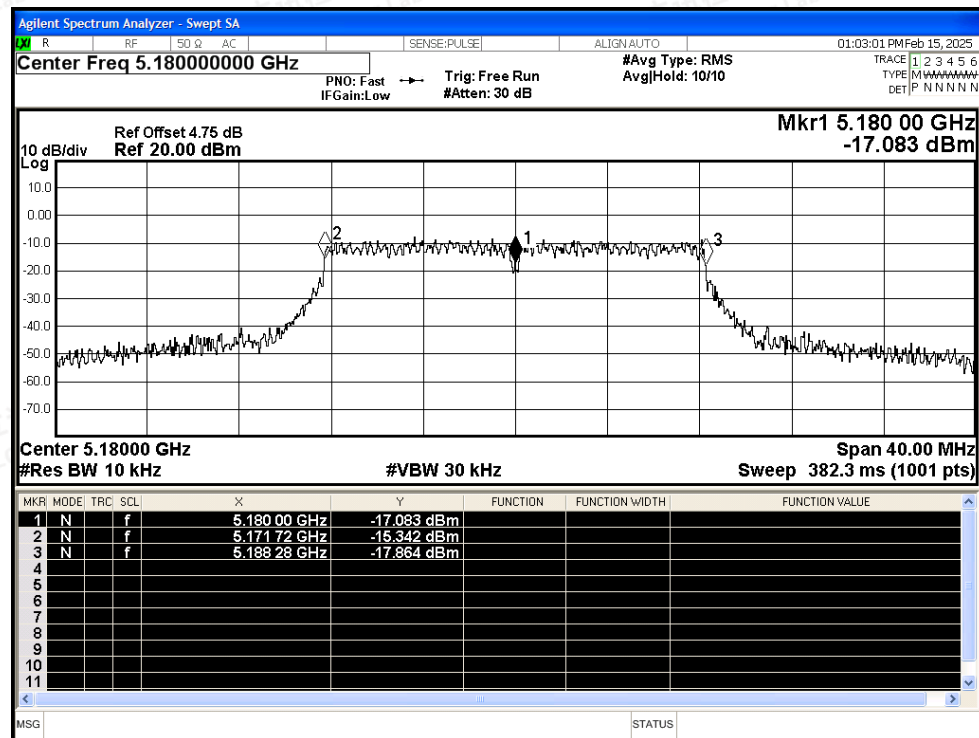

Freq. Stability NVNT a 5200MHz Ant1

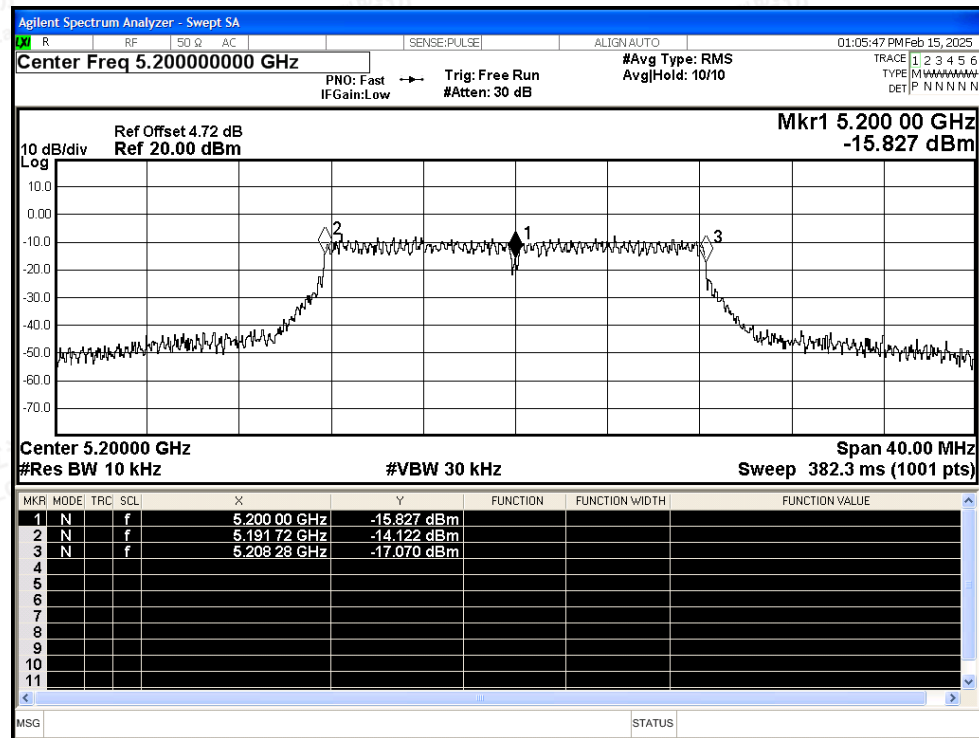

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

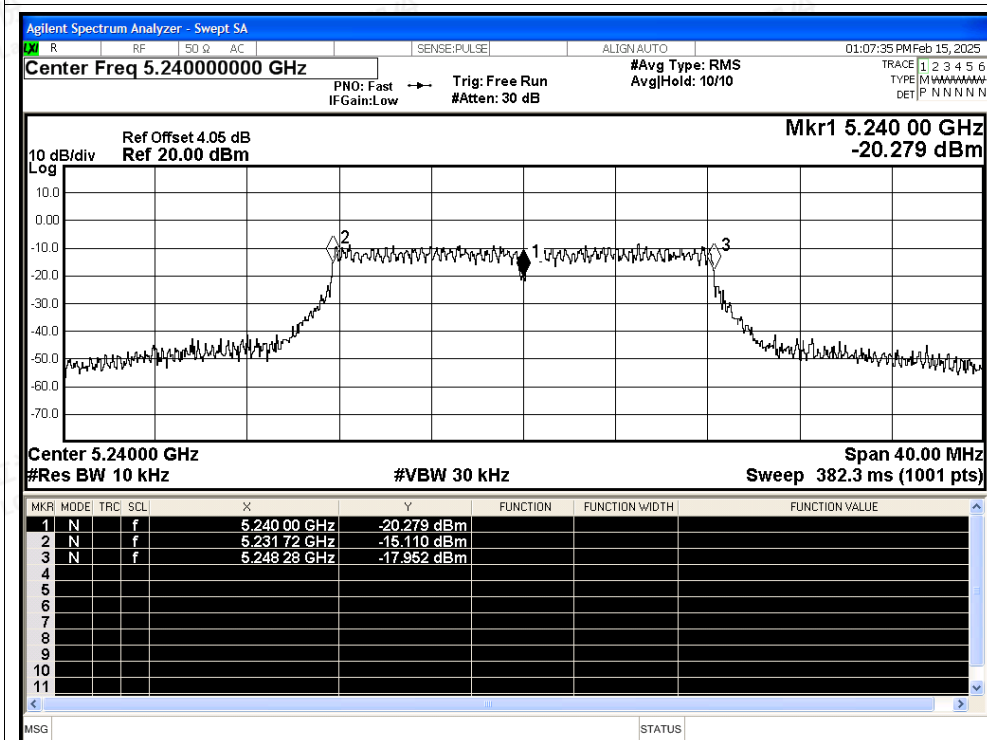

Freq. Stability NVNT n20 5180MHz Ant1

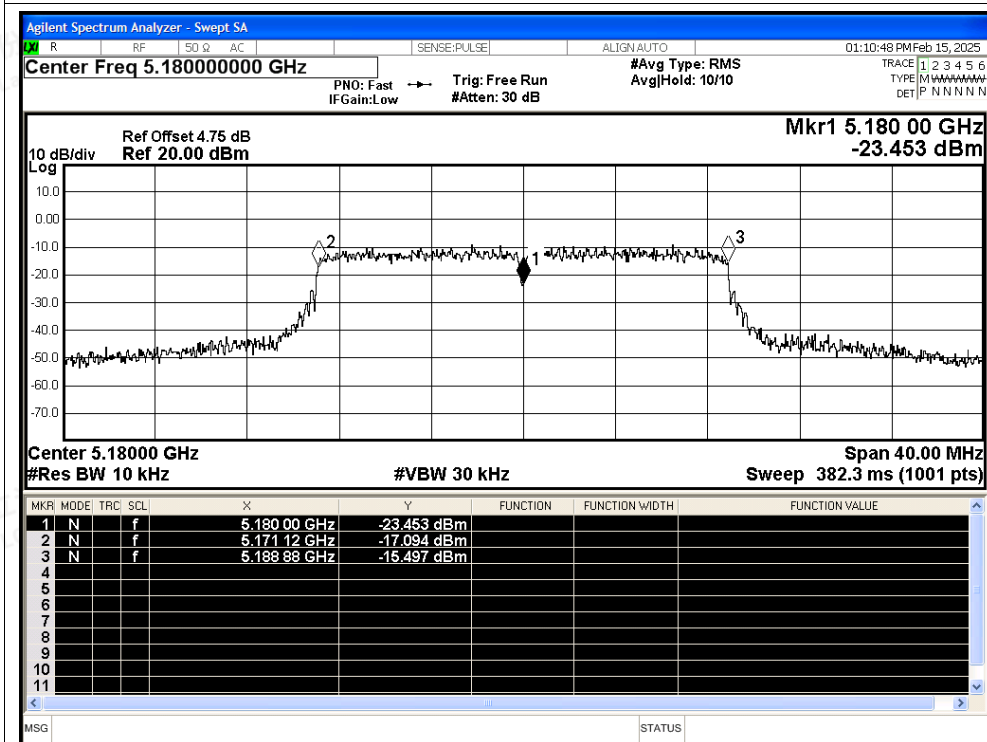

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

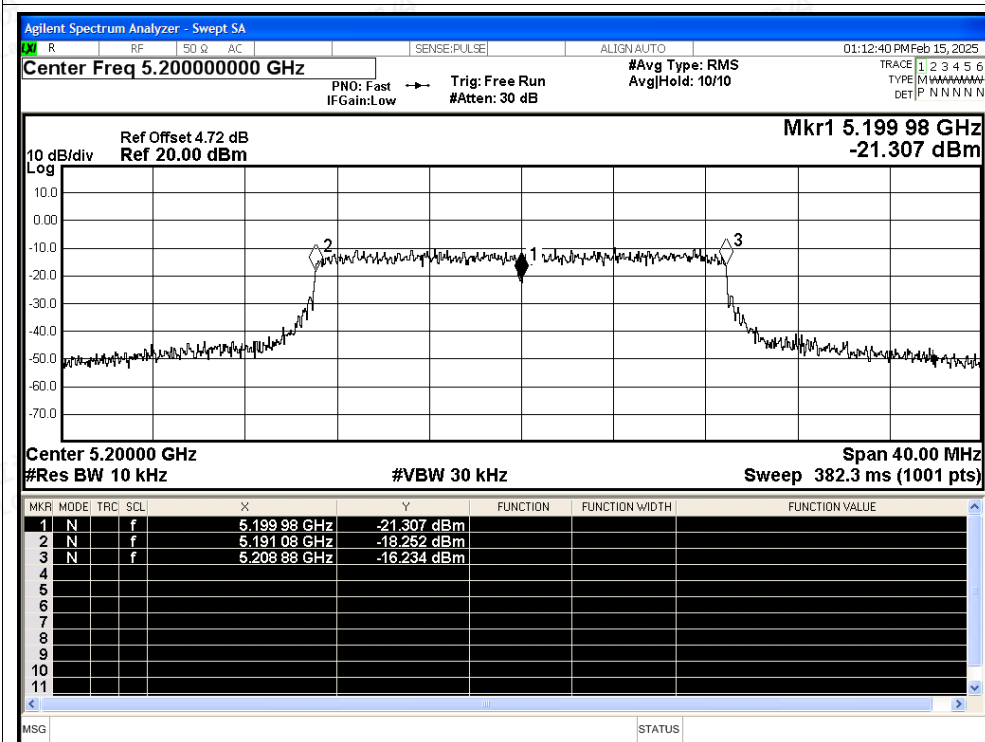

Freq. Stability NVNT n20 5240MHz Ant1

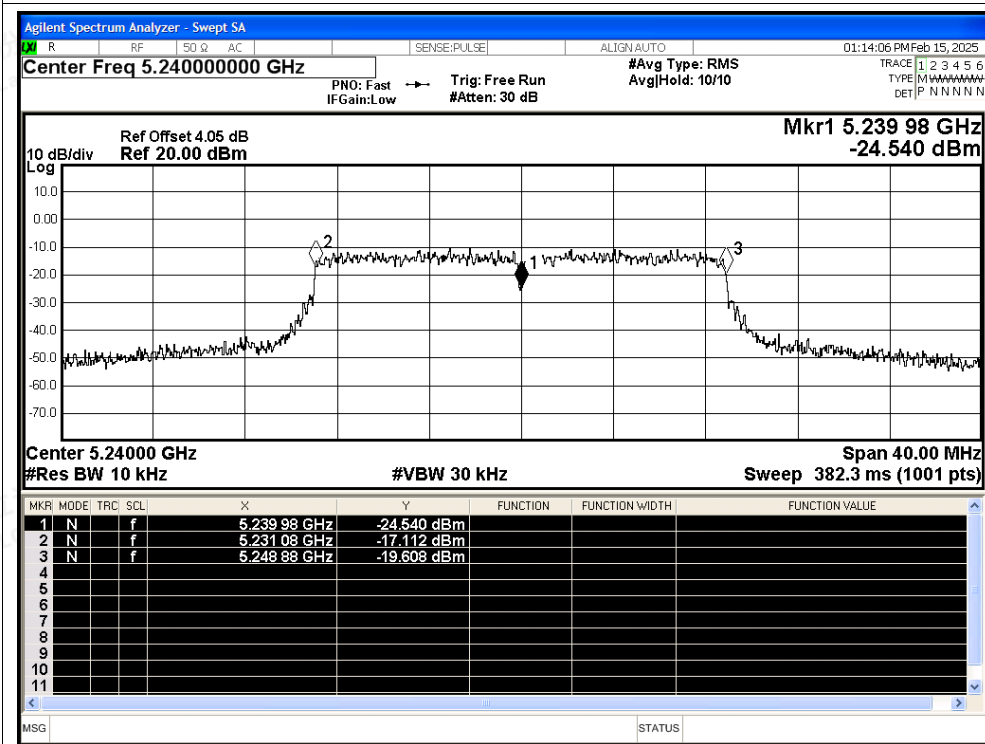

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

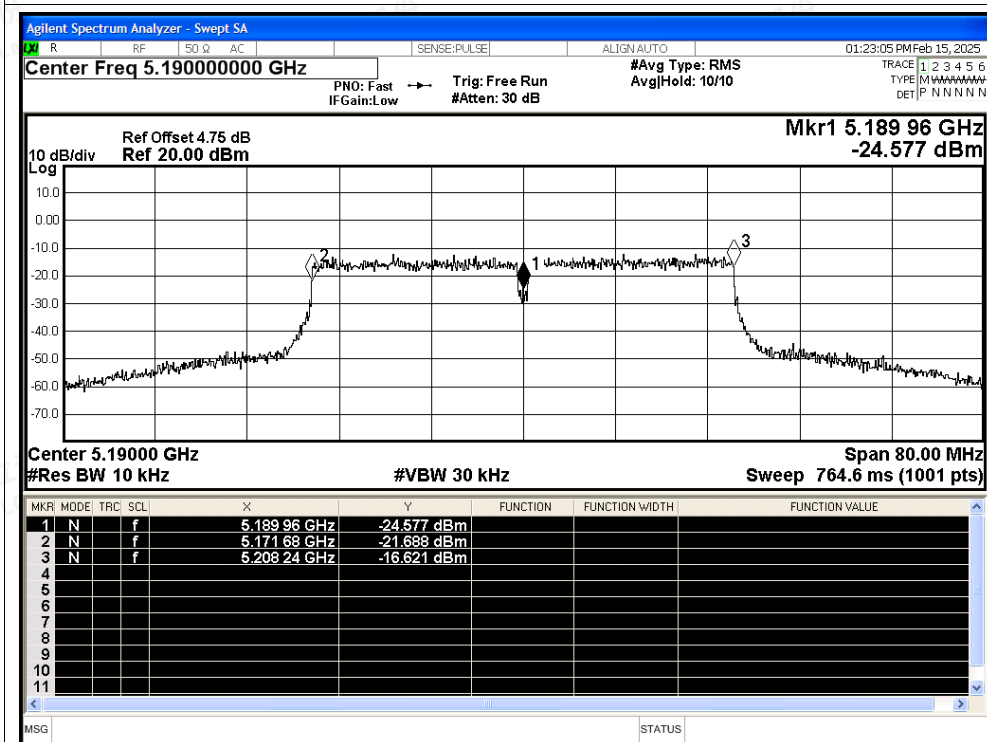

Freq. Stability NVNT n40 5230MHz Ant1

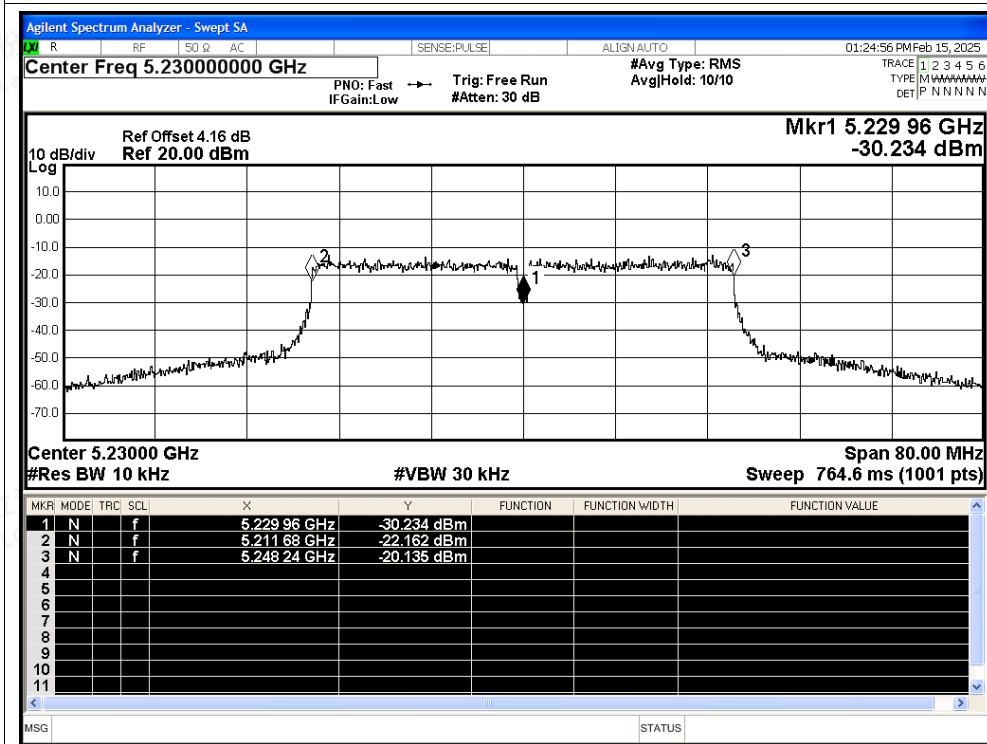

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

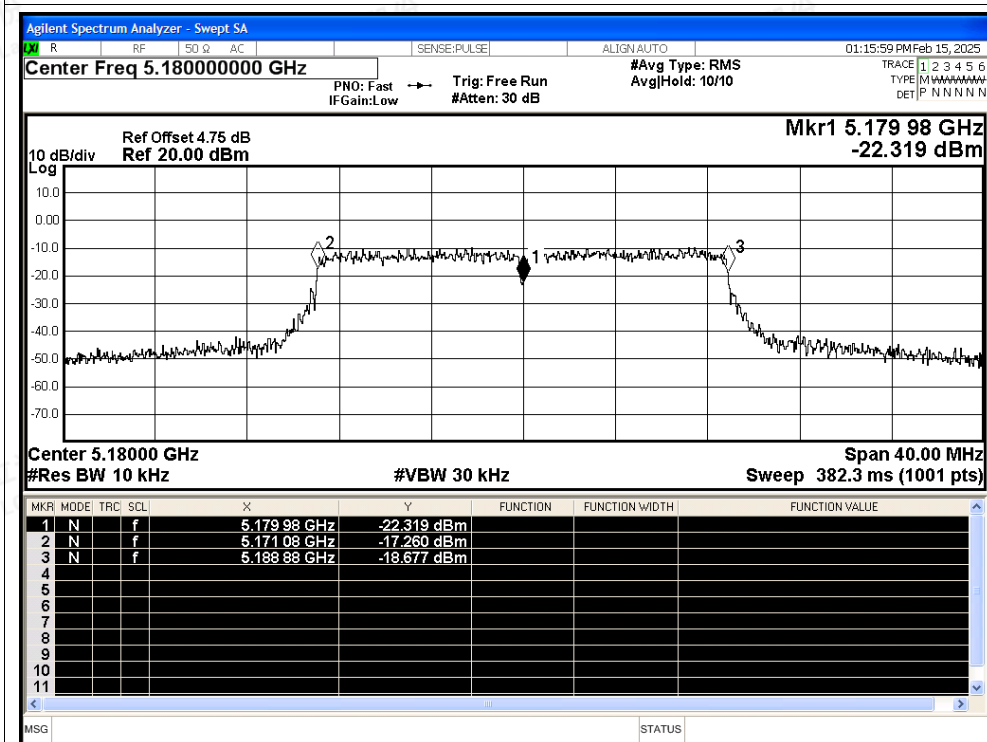

Freq. Stability NVNT ac20 5200MHz Ant1

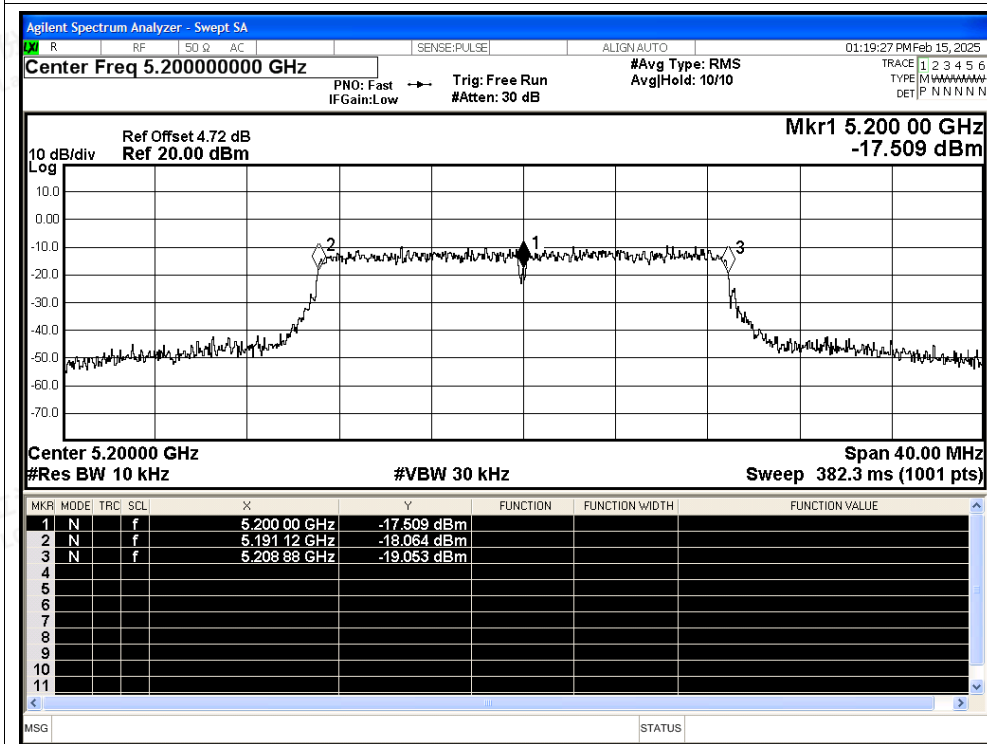

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

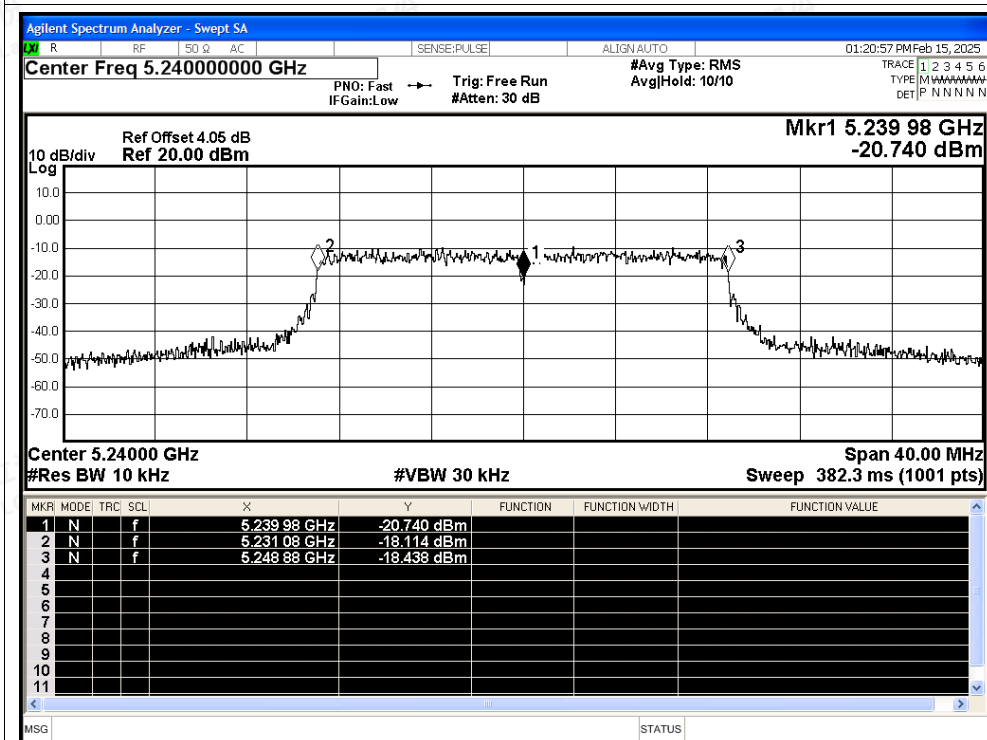

Freq. Stability NVNT ac40 5190MHz Ant1

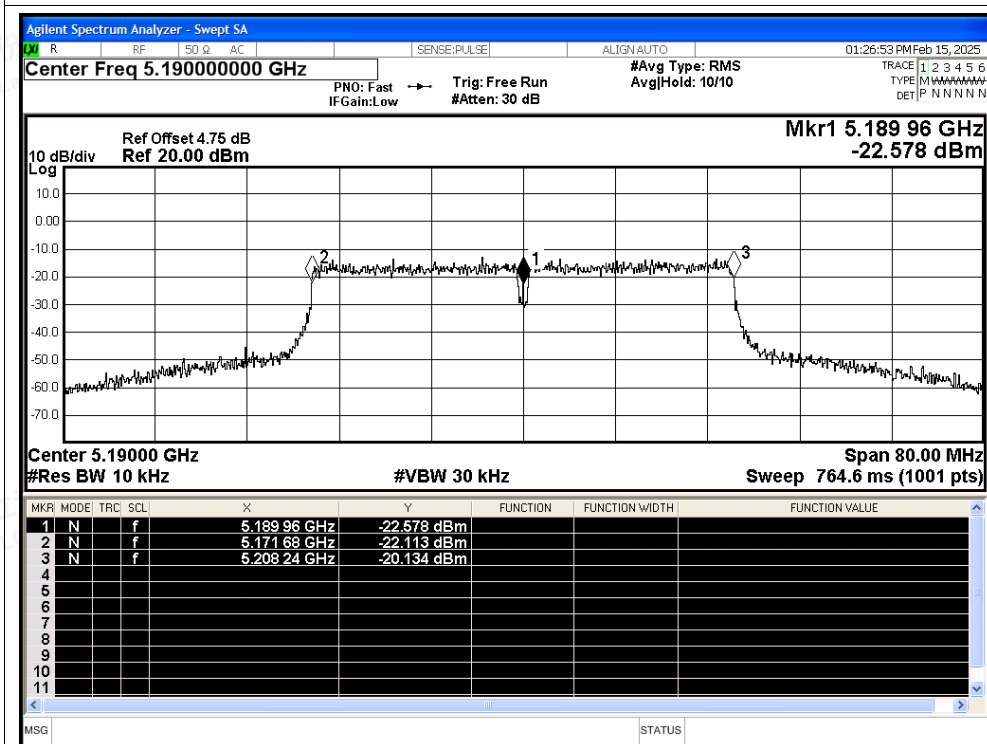

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

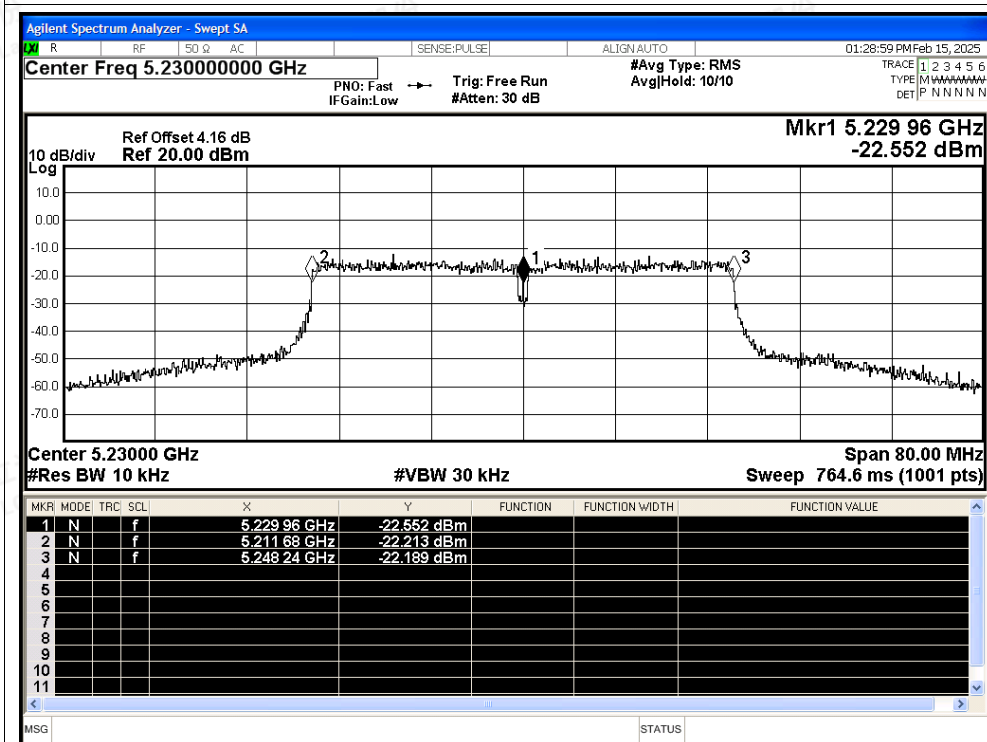

Freq. Stability NVNT ac80 5210MHz Ant1

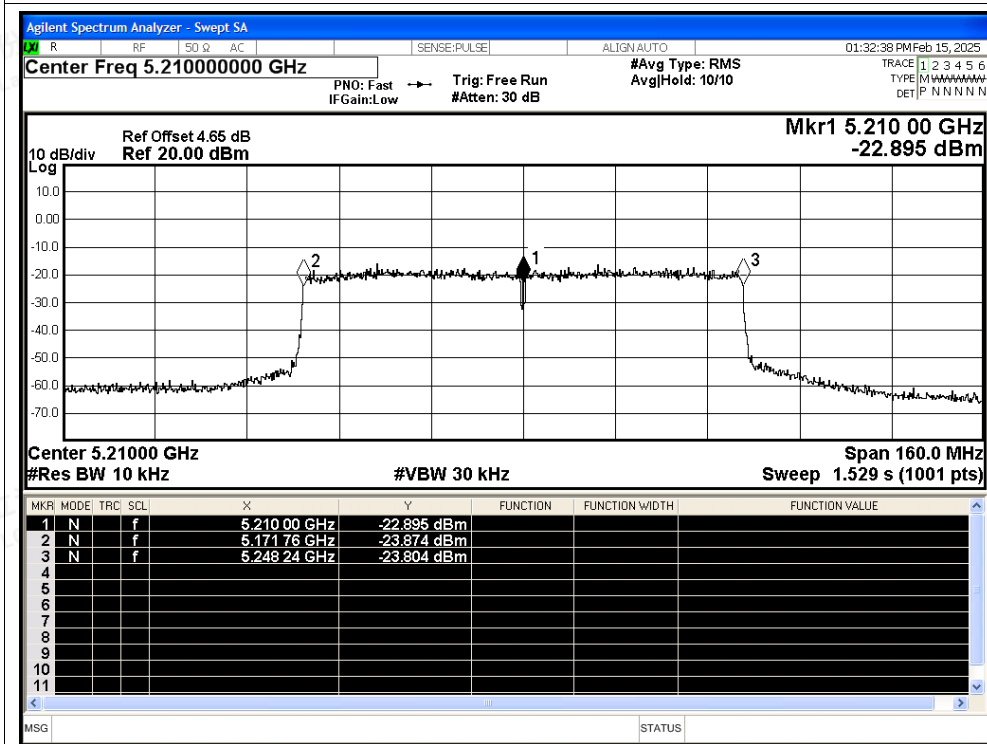


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com



Scan code to check authenticity

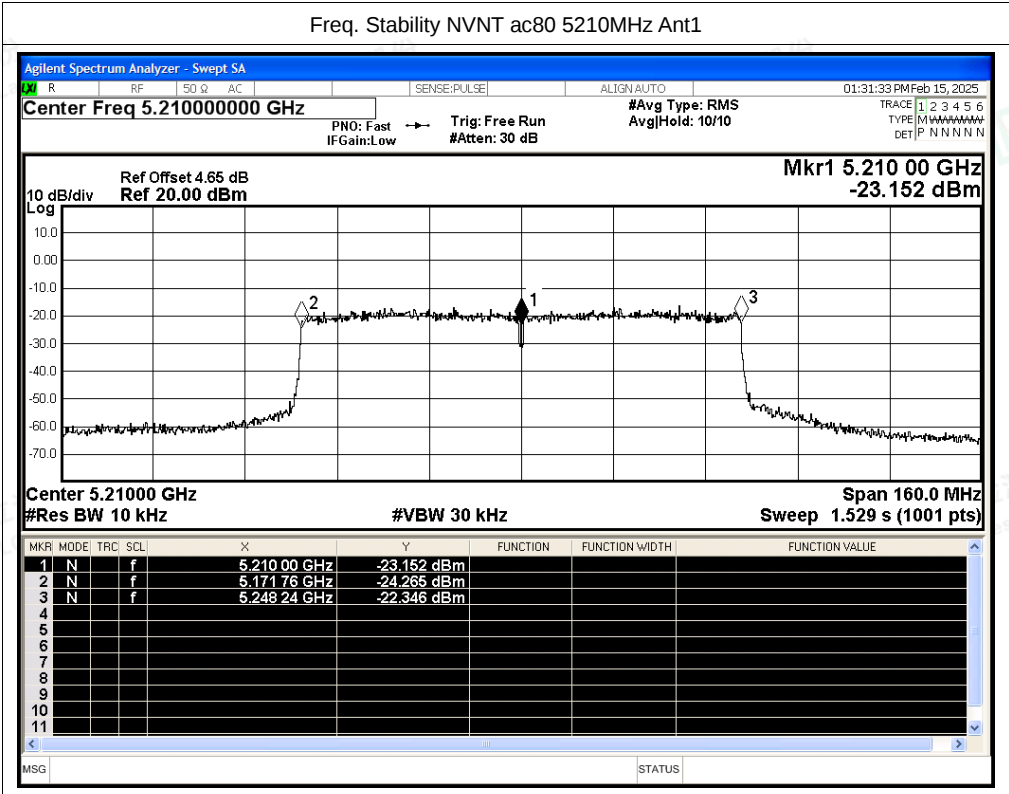




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5240	0	0	25	Pass
NVNT	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5240	0	0	25	Pass
NVNT	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass



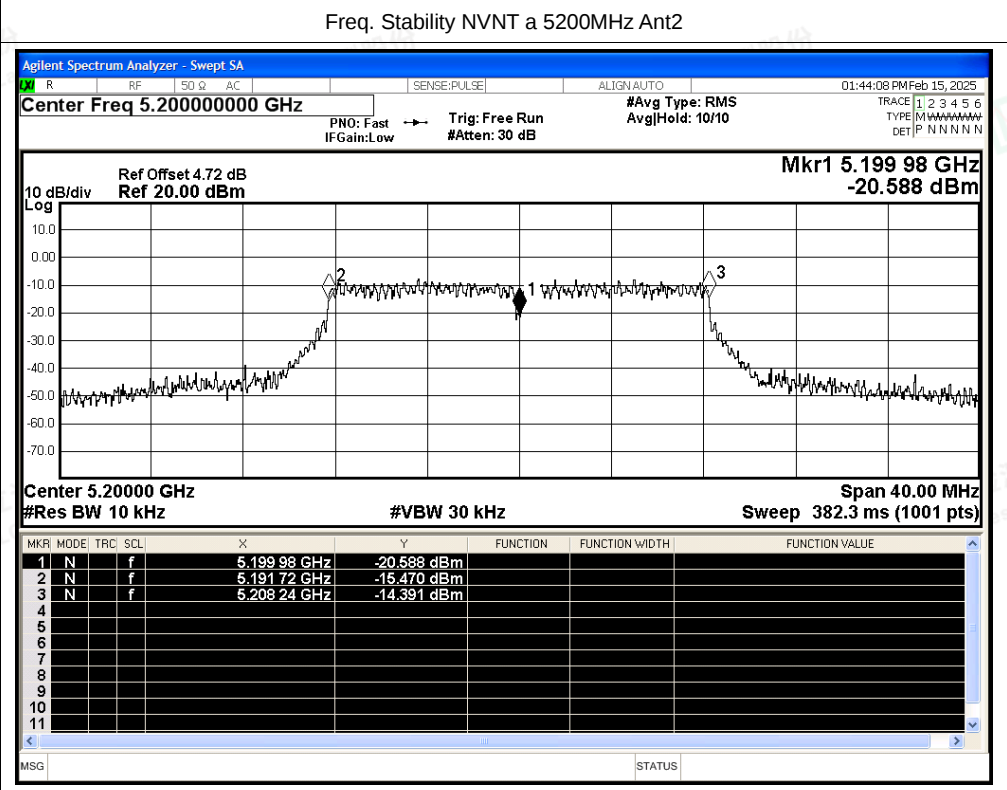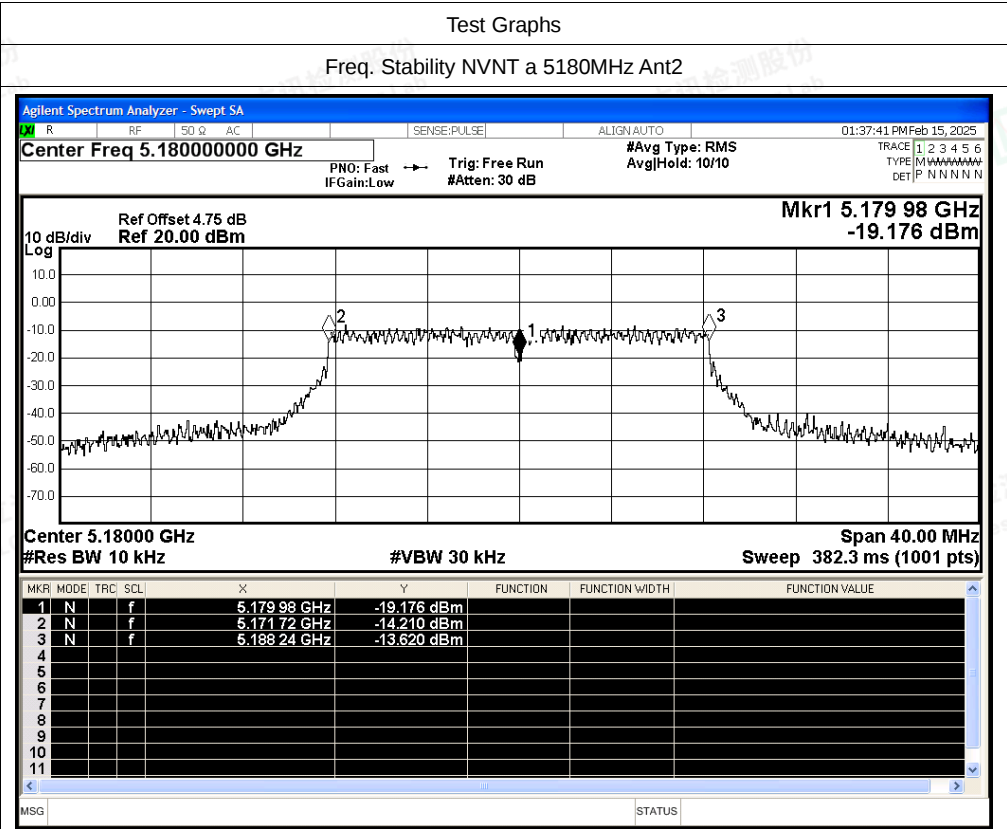




Freq. Stability NVNT a 5240MHz Ant2

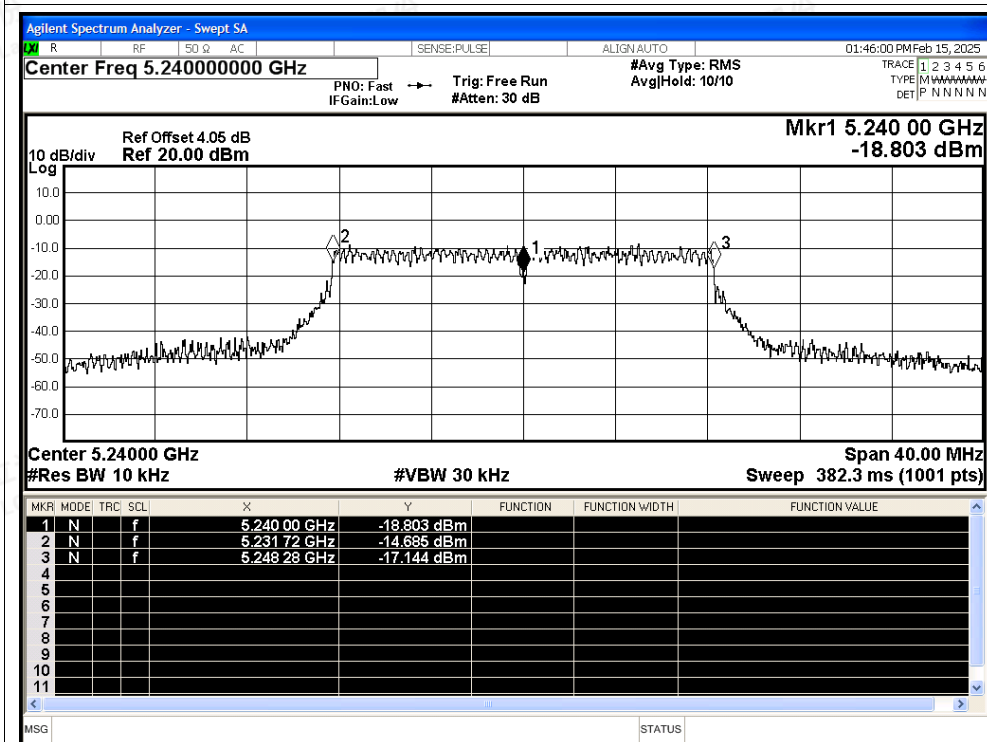

Freq. Stability NVNT n20 5180MHz Ant2


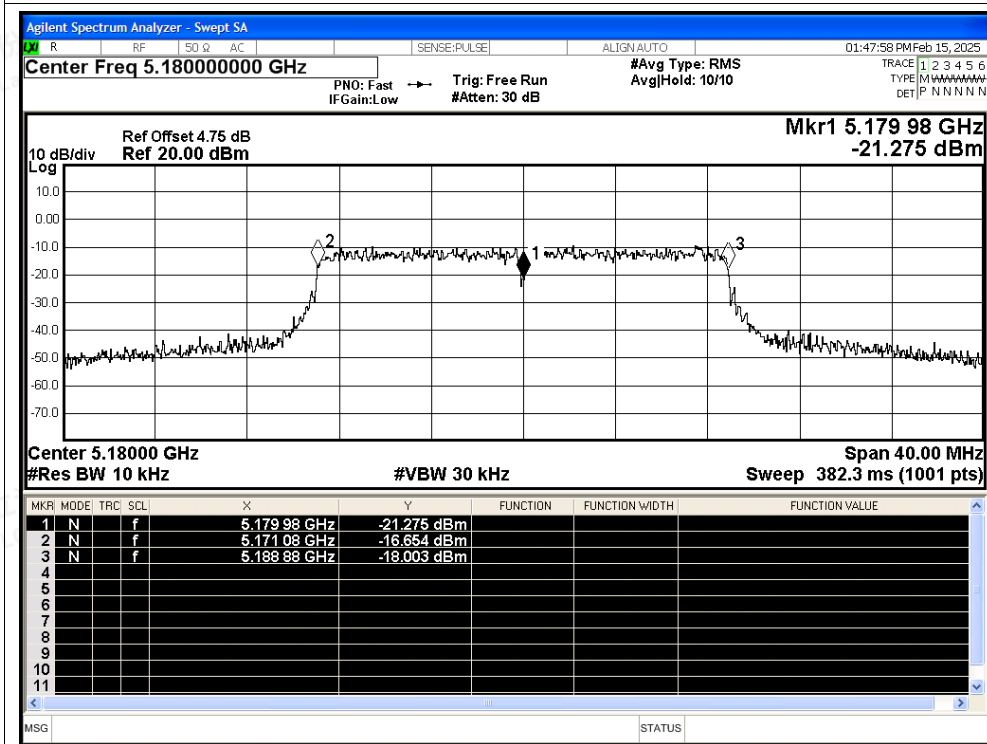


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

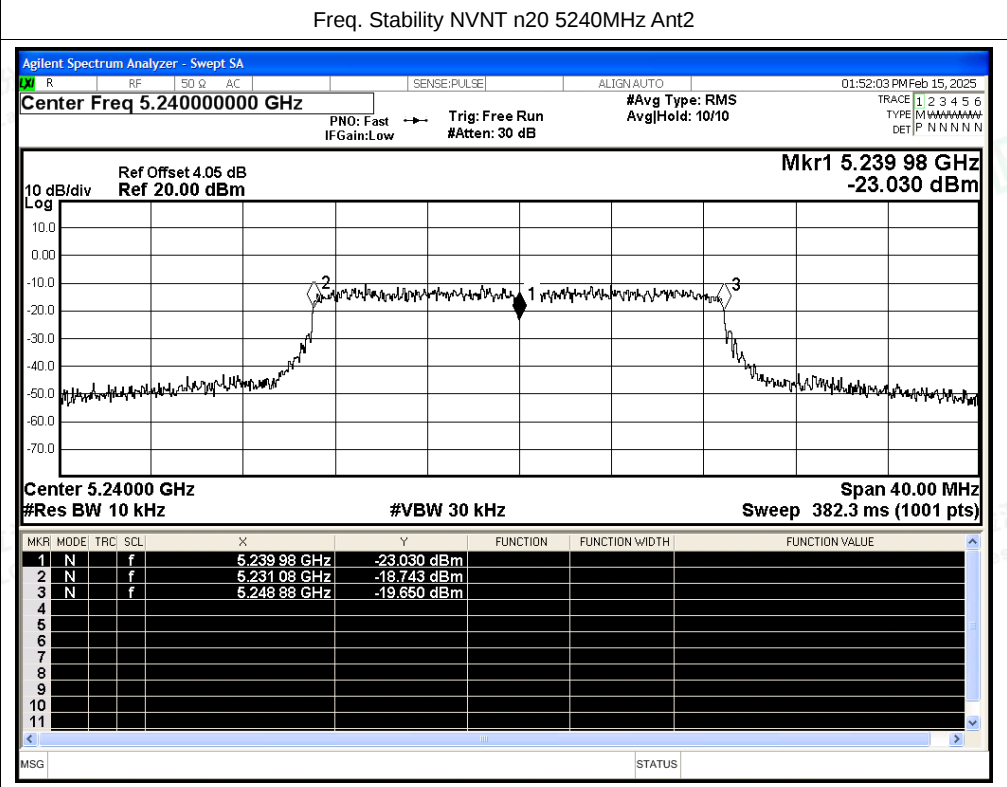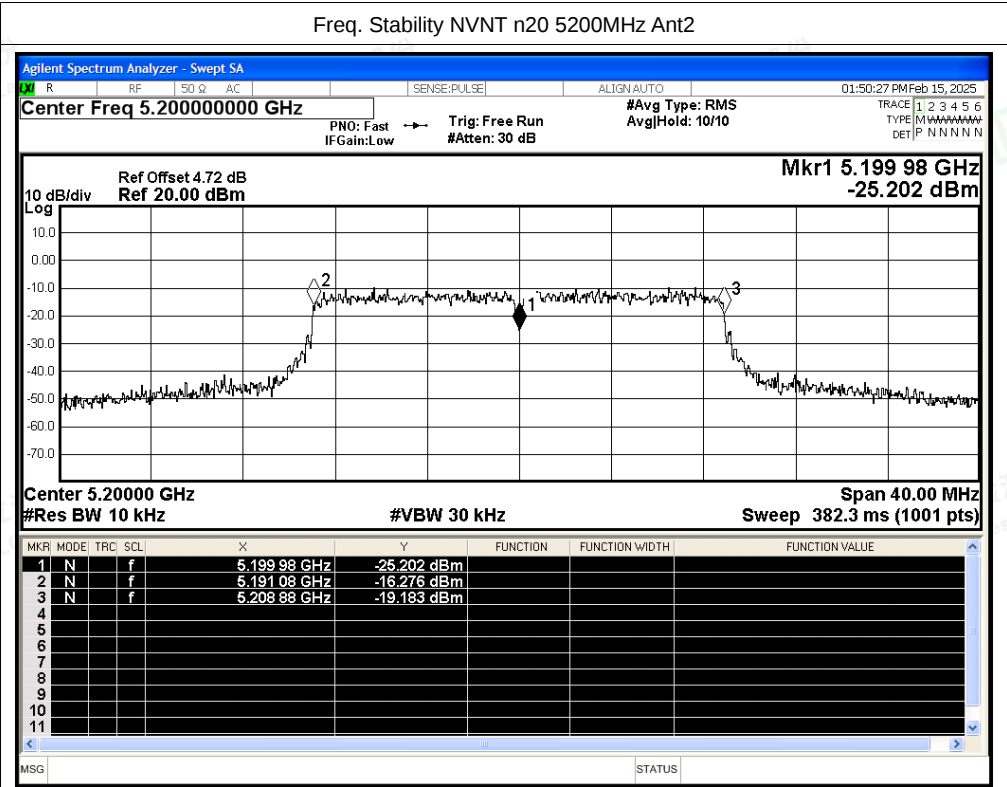




Freq. Stability NVNT n40 5190MHz Ant2

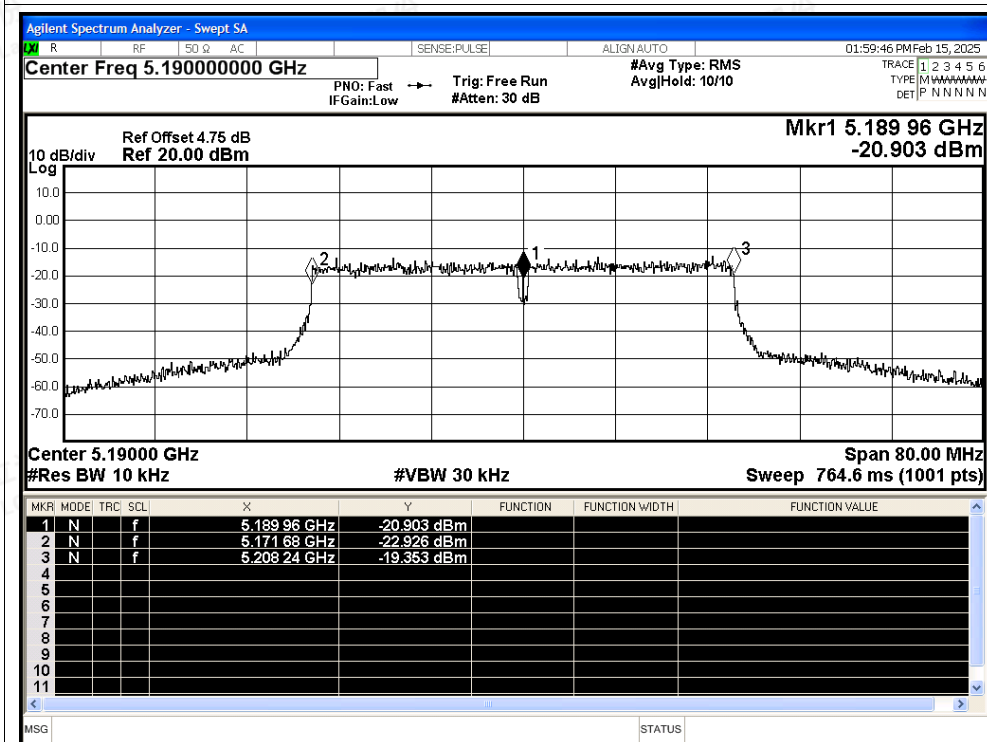

Freq. Stability NVNT n40 5230MHz Ant2


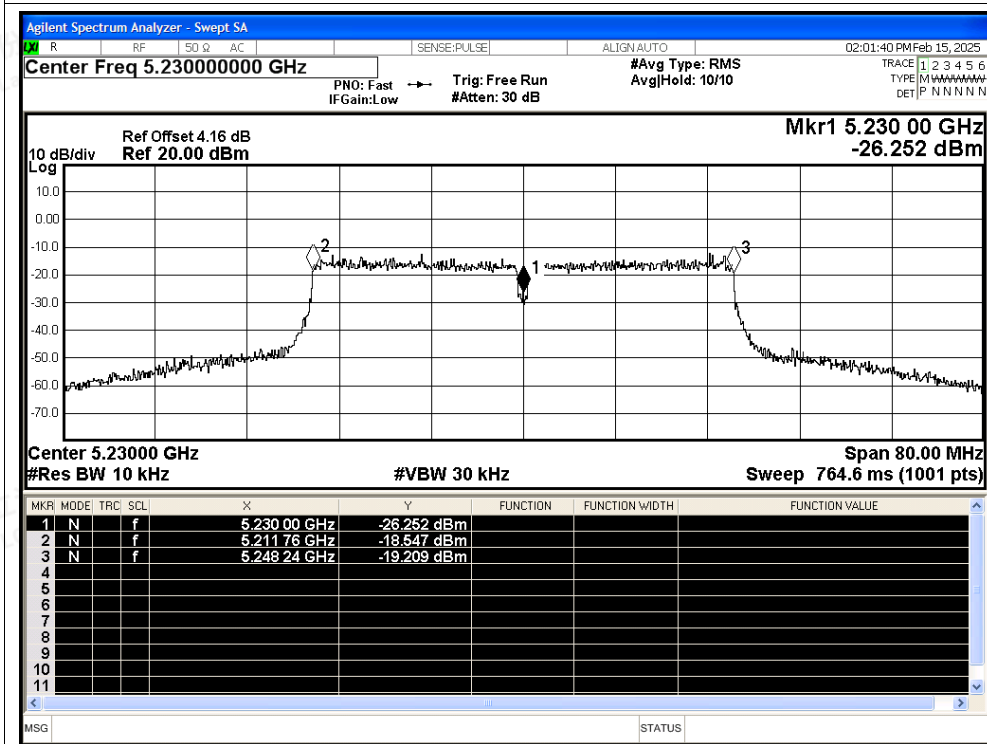


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

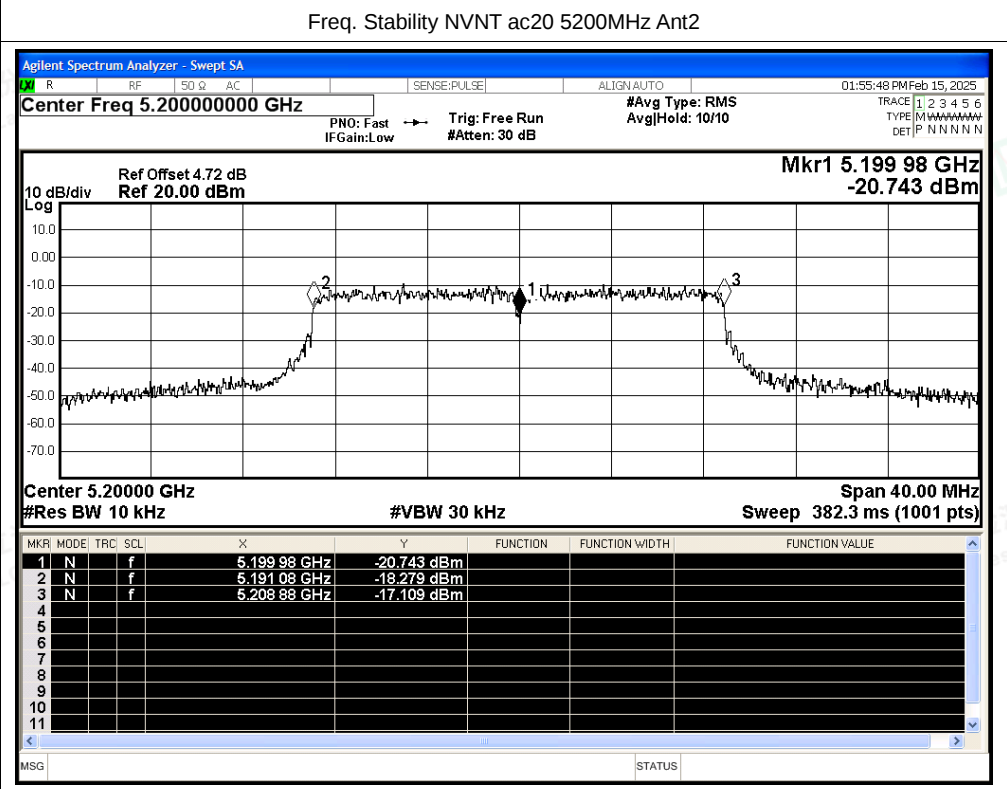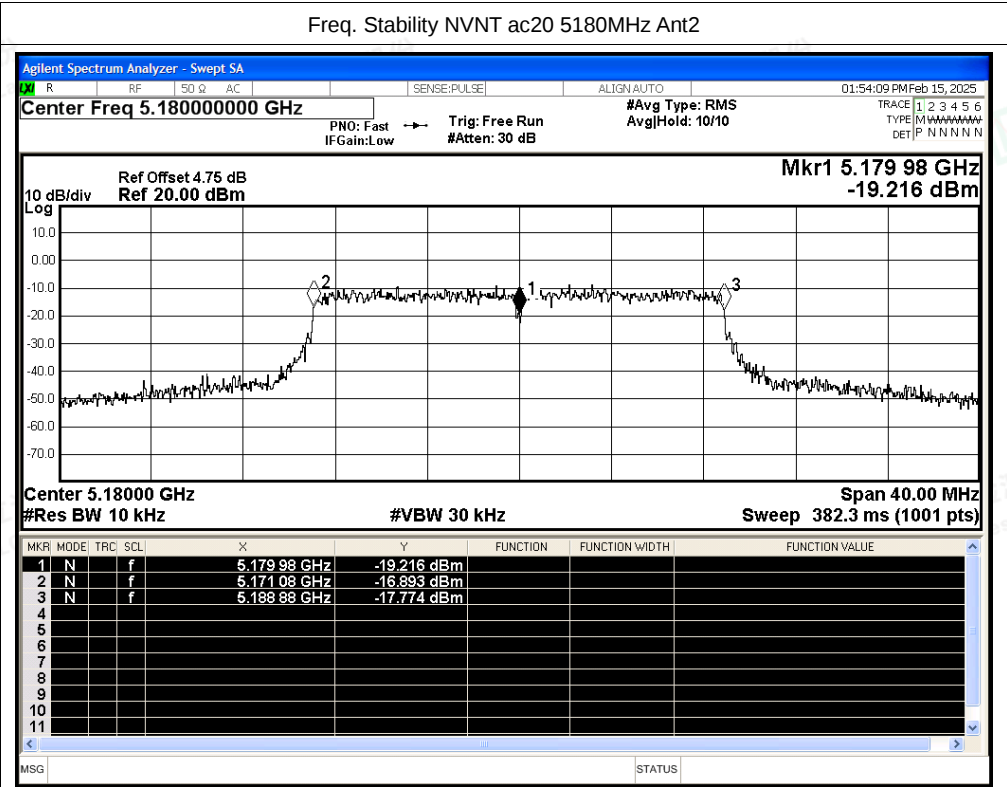




Freq. Stability NVNT ac20 5240MHz Ant2

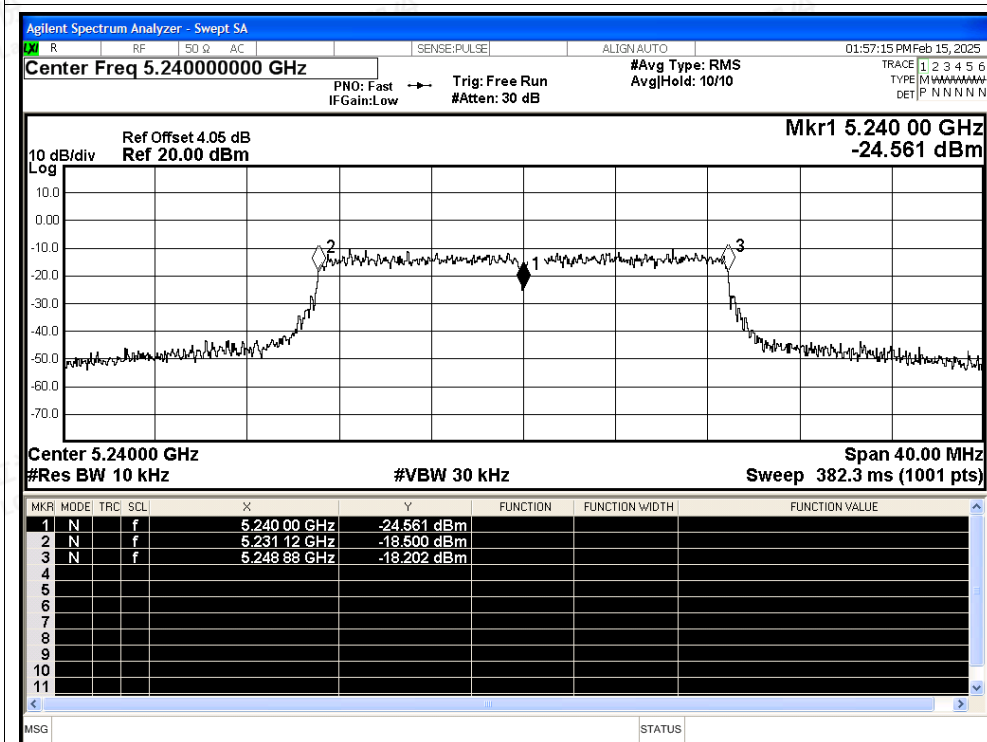

Freq. Stability NVNT ac40 5190MHz Ant2


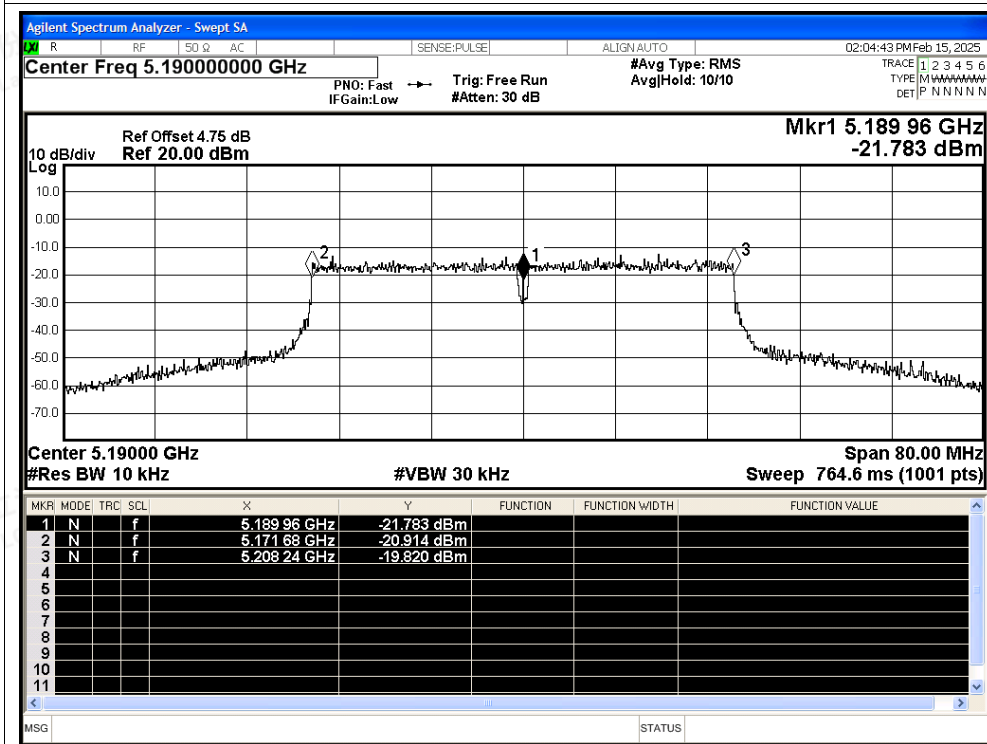



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

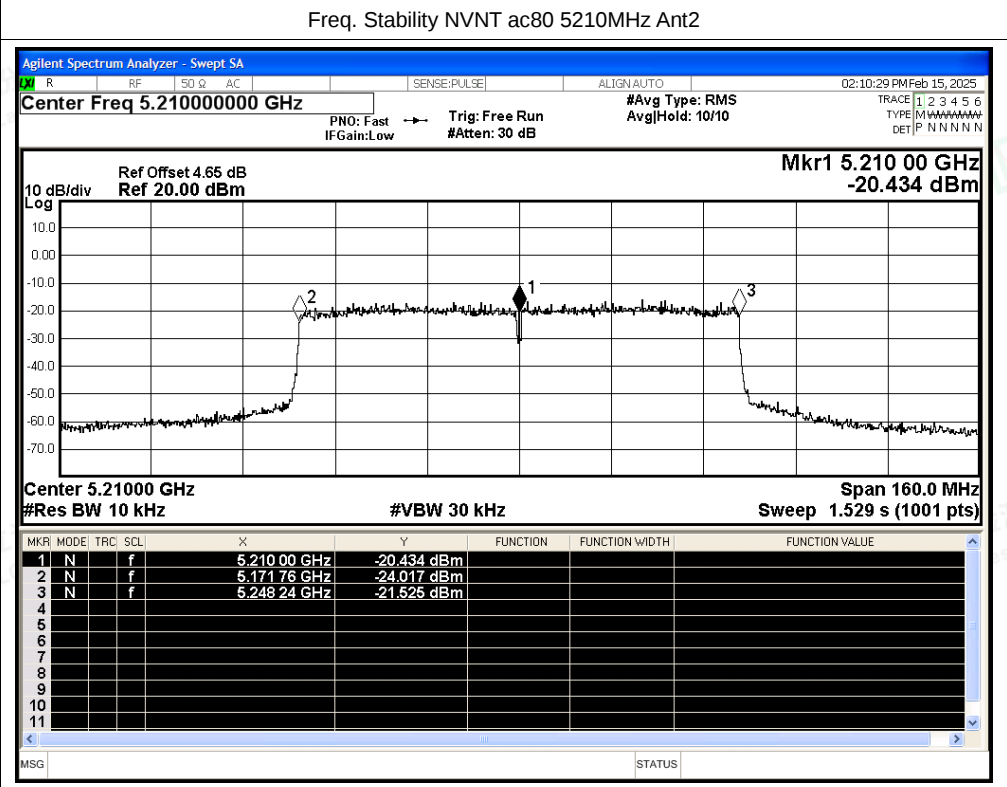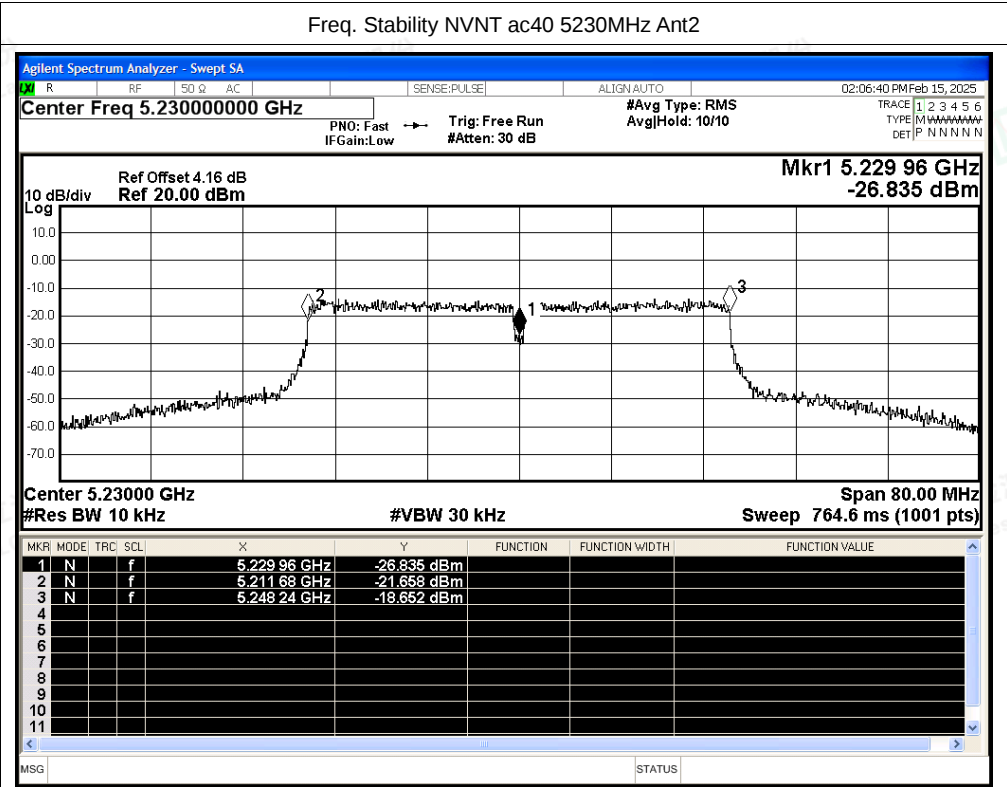

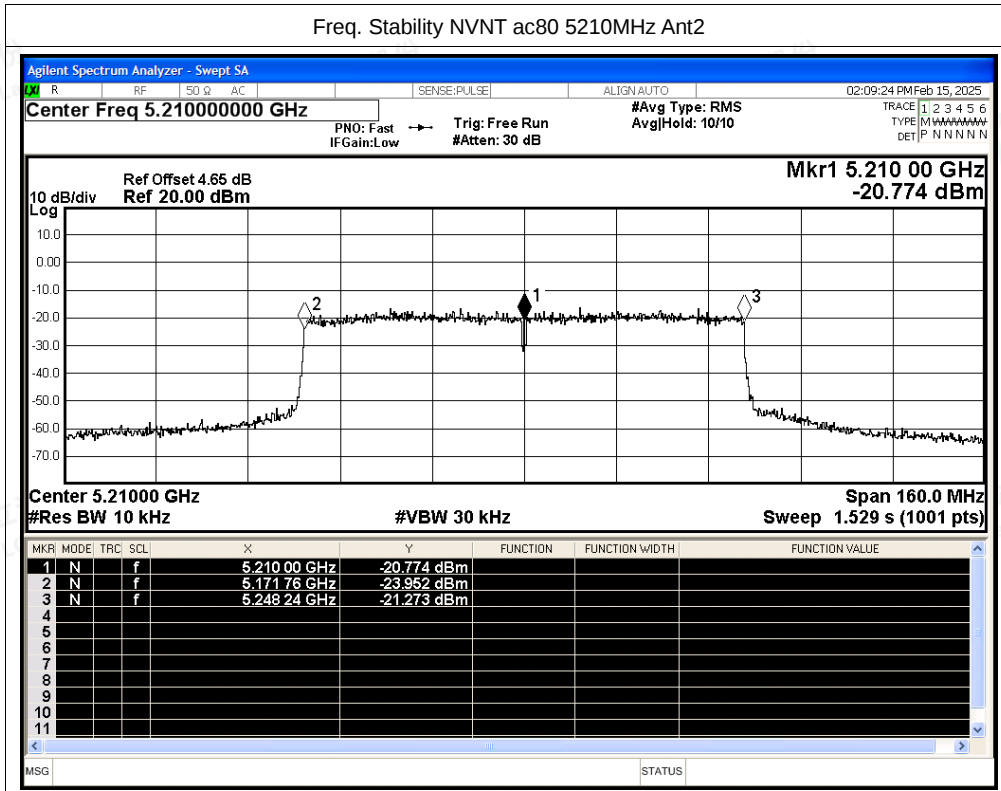

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant3	5240	0	0	25	Pass
NVNT	n20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant3	5190	0	0	25	Pass
NVNT	n40	5230	Ant3	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant3	5200	0	0	25	Pass
NVNT	ac20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant3	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant3	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant3	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant3

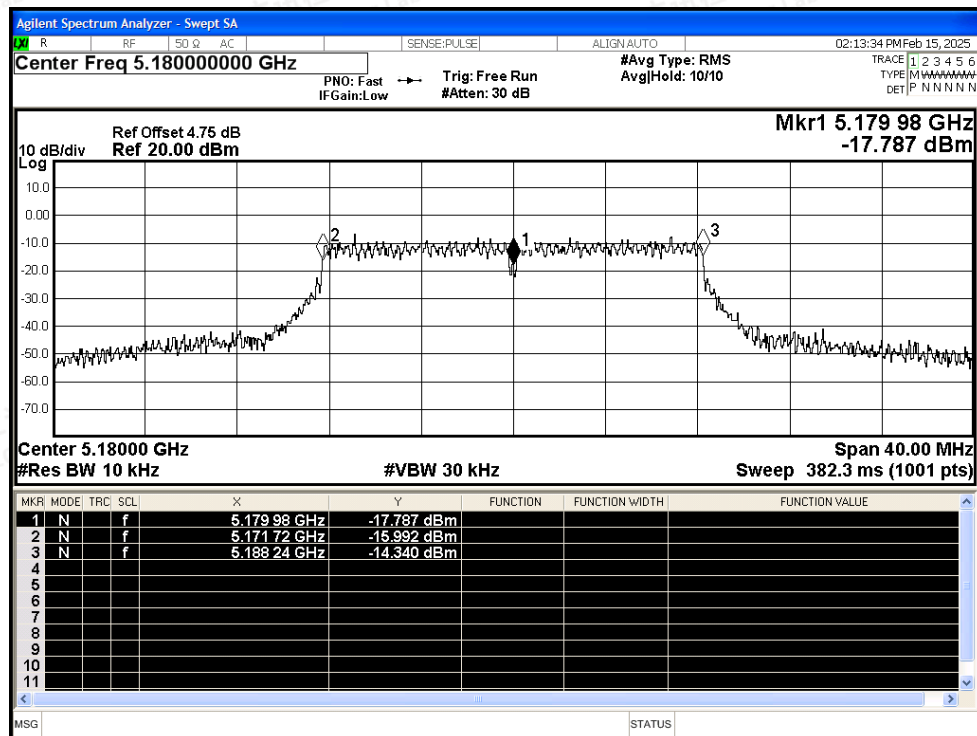

Freq. Stability NVNT a 5200MHz Ant3

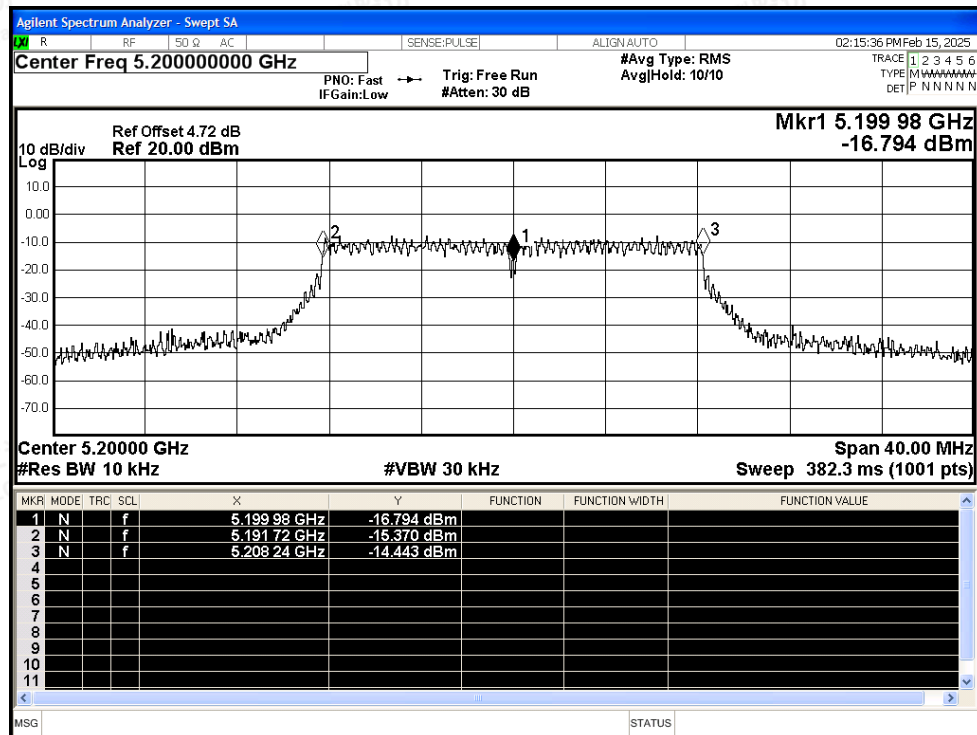

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant3

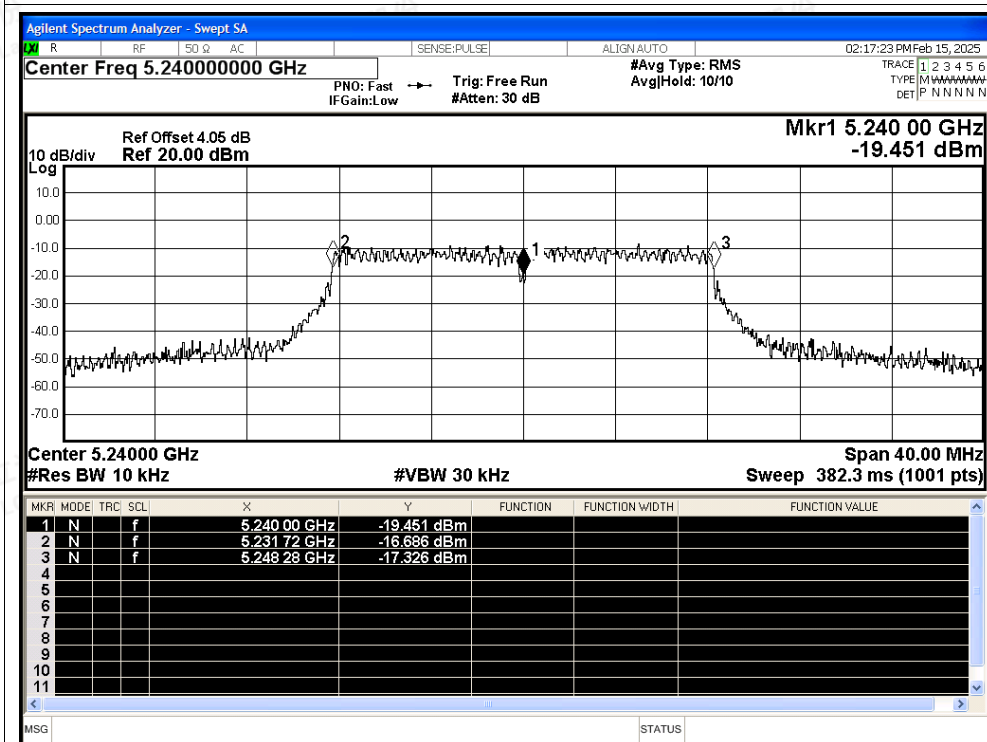

Freq. Stability NVNT n20 5180MHz Ant3


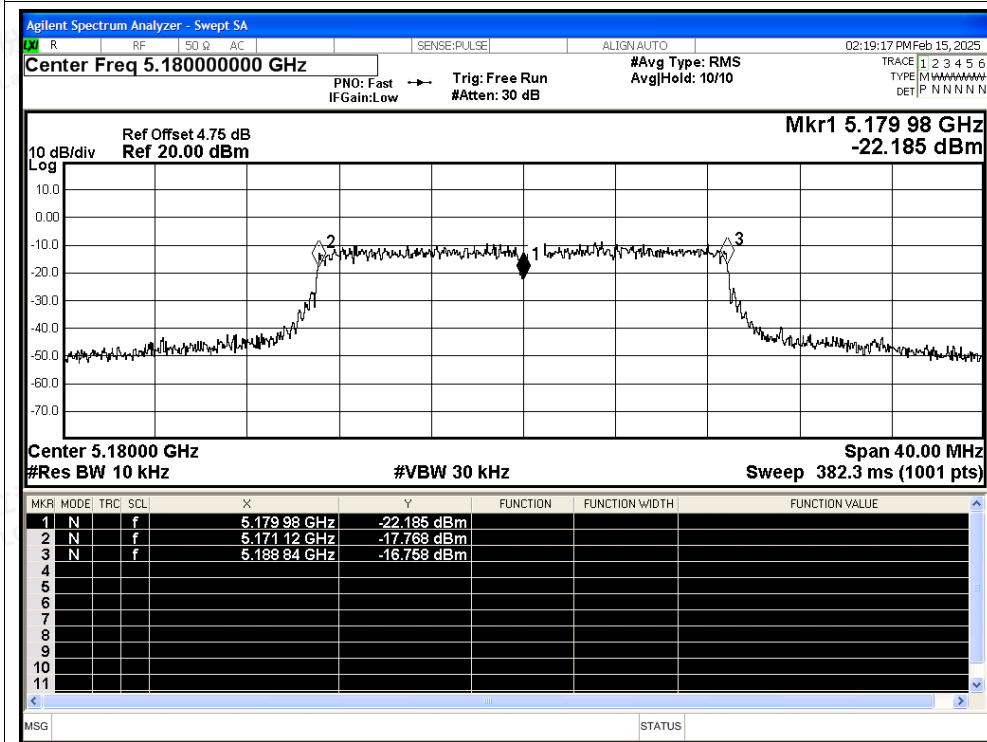




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

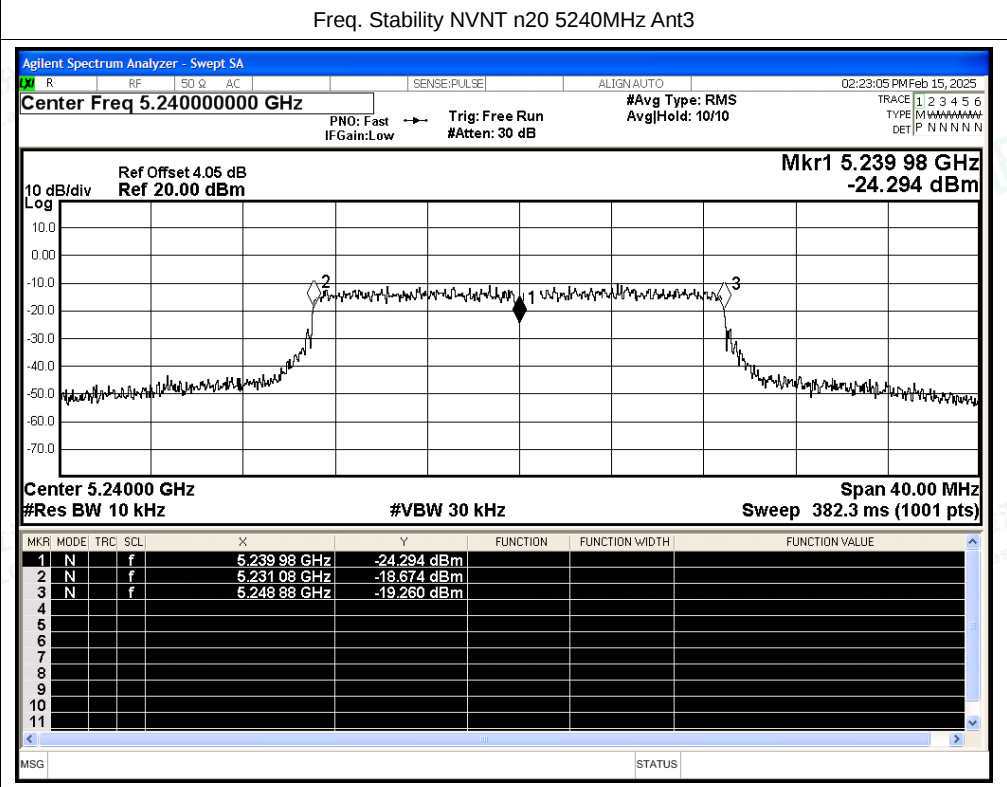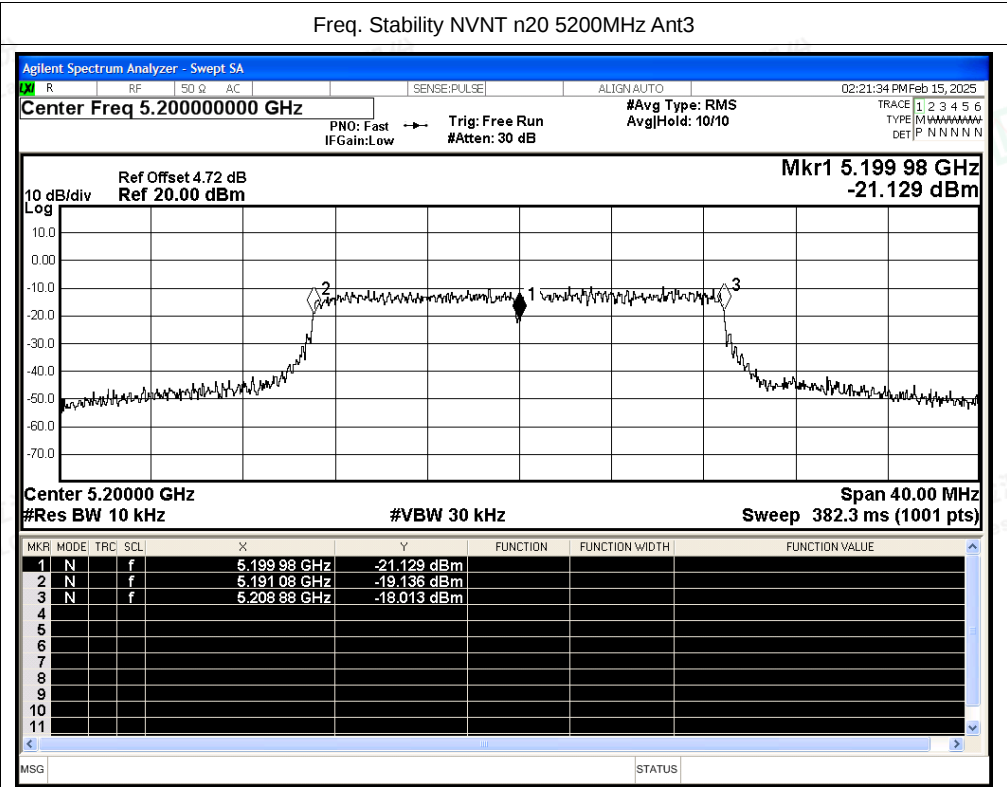

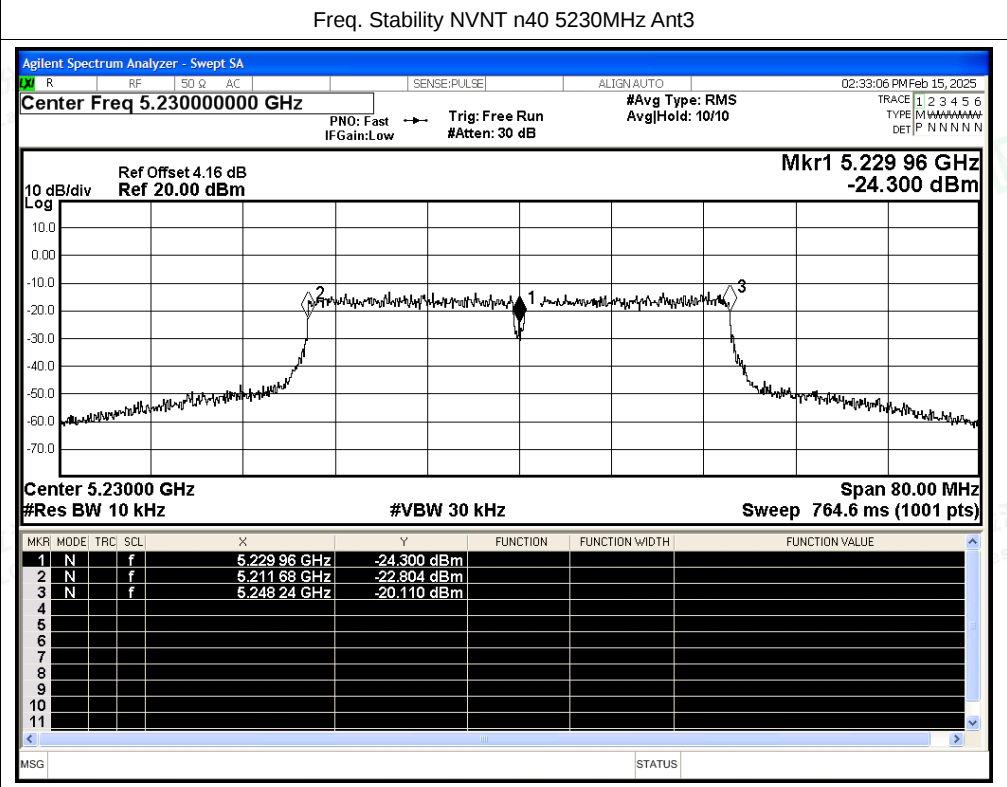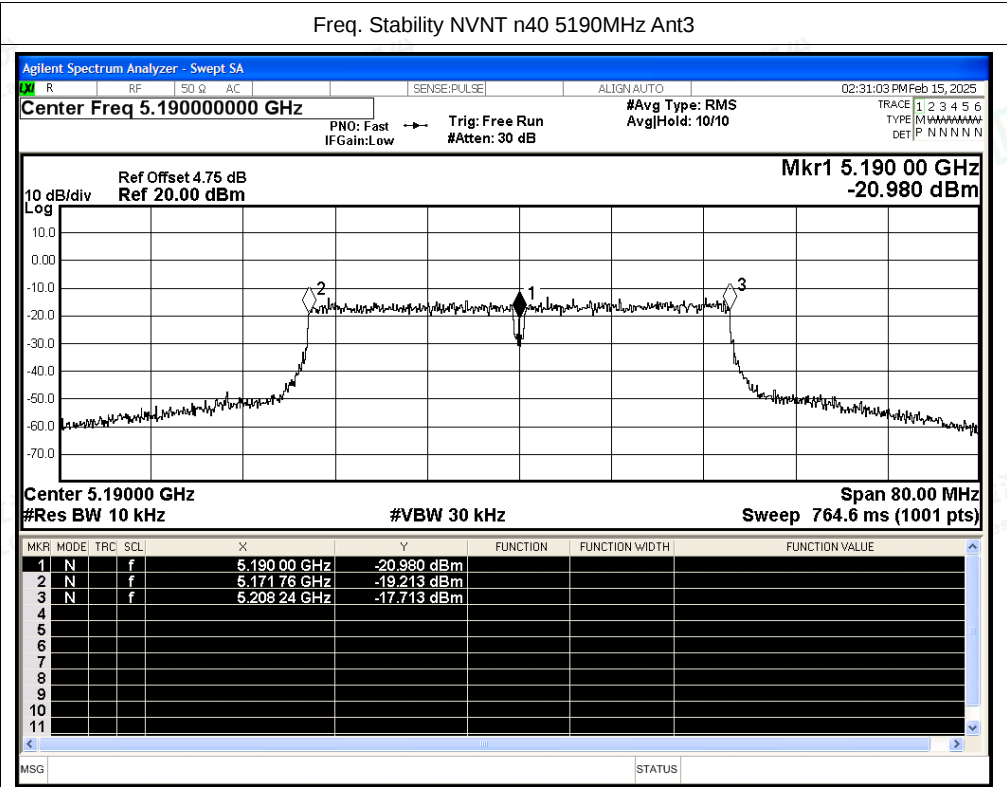




Freq. Stability NVNT ac20 5180MHz Ant3

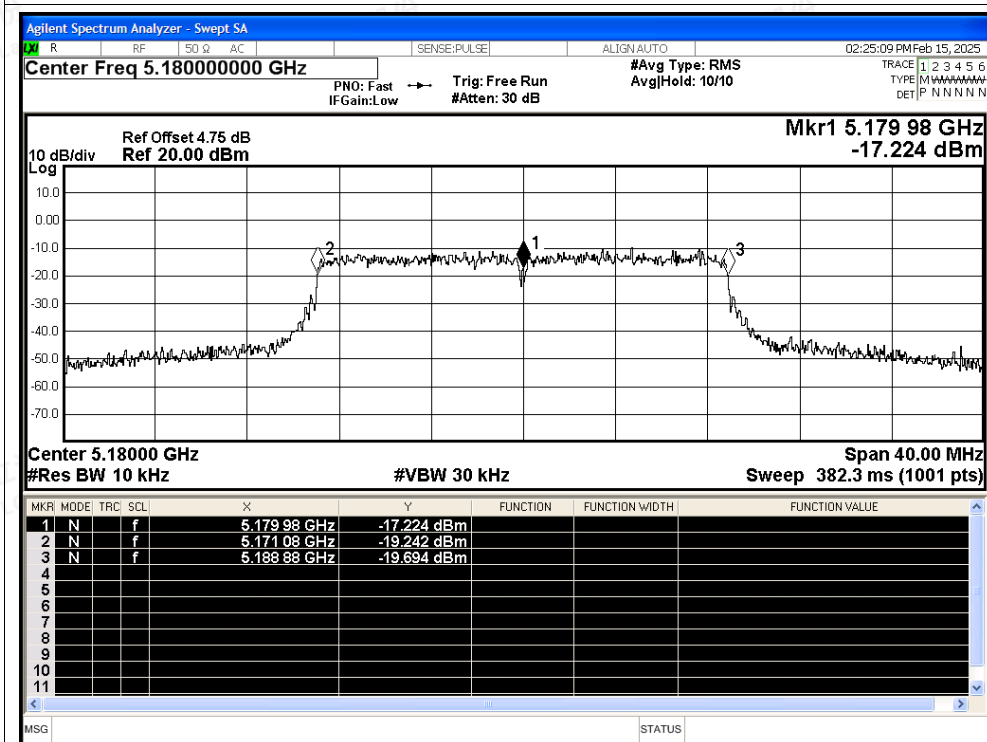

Freq. Stability NVNT ac20 5200MHz Ant3

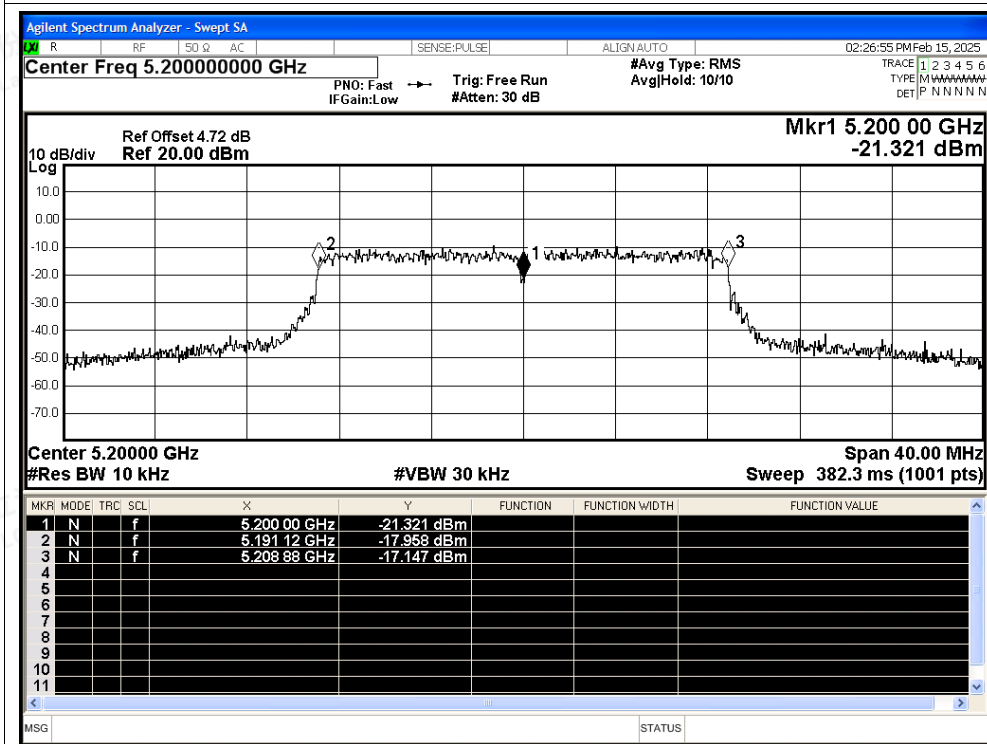

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant3

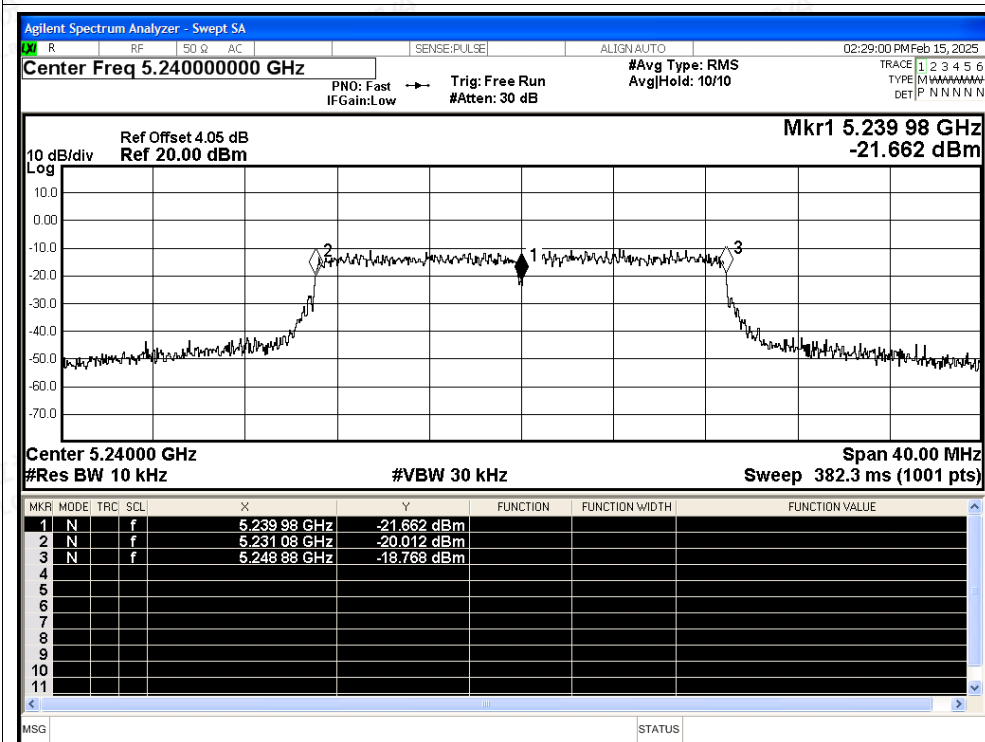

Freq. Stability NVNT ac40 5190MHz Ant3

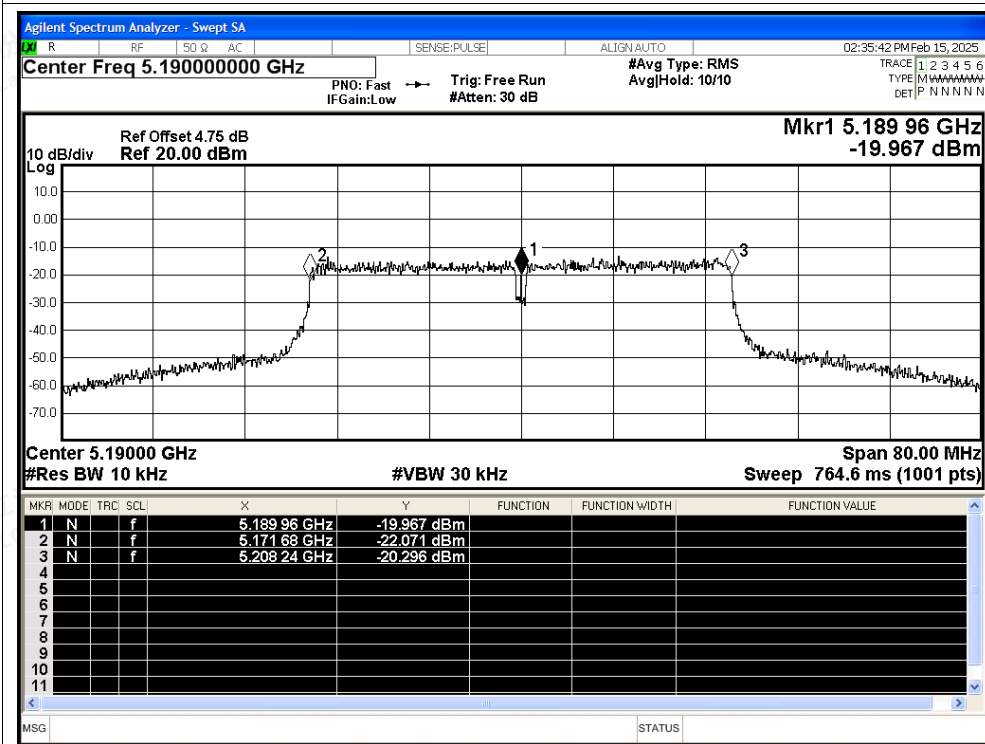

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant3

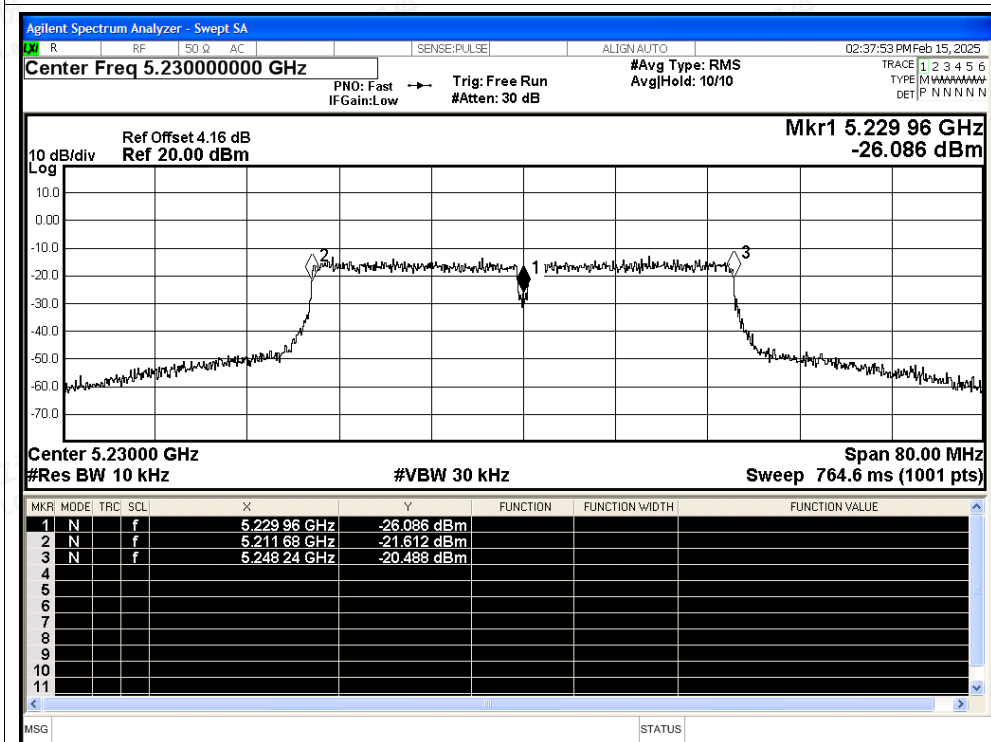

Freq. Stability NVNT ac80 5210MHz Ant3

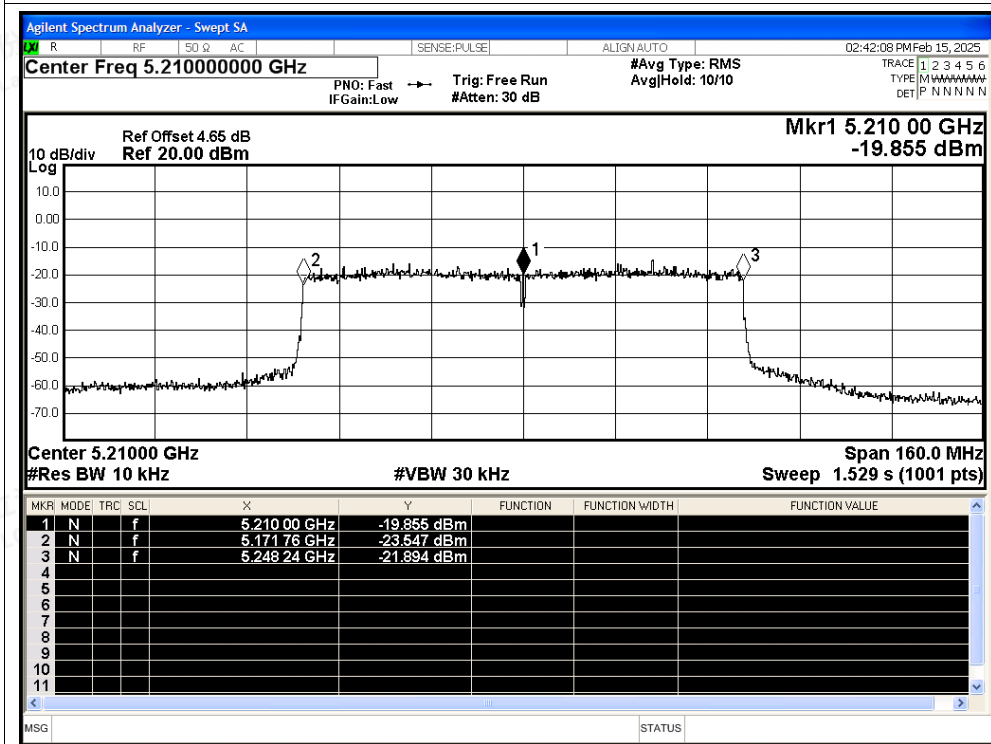


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

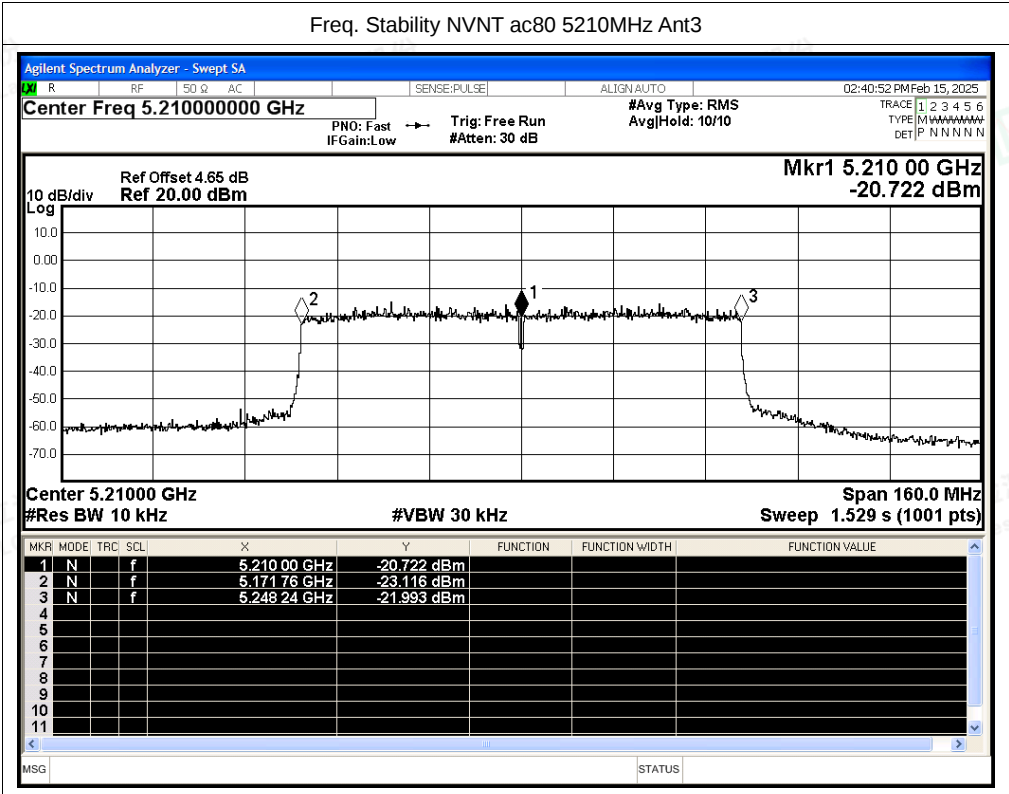




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant4	5180.02	20000	3.86	25	Pass
NVNT	a	5200	Ant4	5200	0	0	25	Pass
NVNT	a	5240	Ant4	5240	0	0	25	Pass
NVNT	n20	5180	Ant4	5180	0	0	25	Pass
NVNT	n20	5200	Ant4	5200	0	0	25	Pass
NVNT	n20	5240	Ant4	5240	0	0	25	Pass
NVNT	n40	5190	Ant4	5190	0	0	25	Pass
NVNT	n40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant4	5240	0	0	25	Pass
NVNT	ac40	5190	Ant4	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant4	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant4	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant4

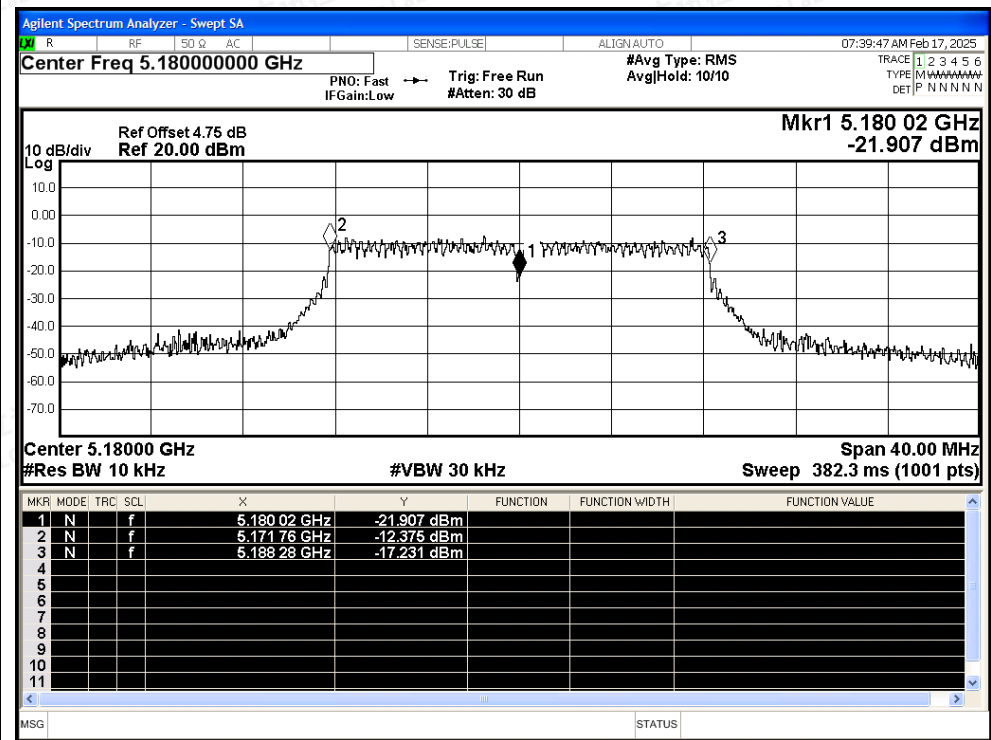


Freq. Stability NVNT a 5200MHz Ant4

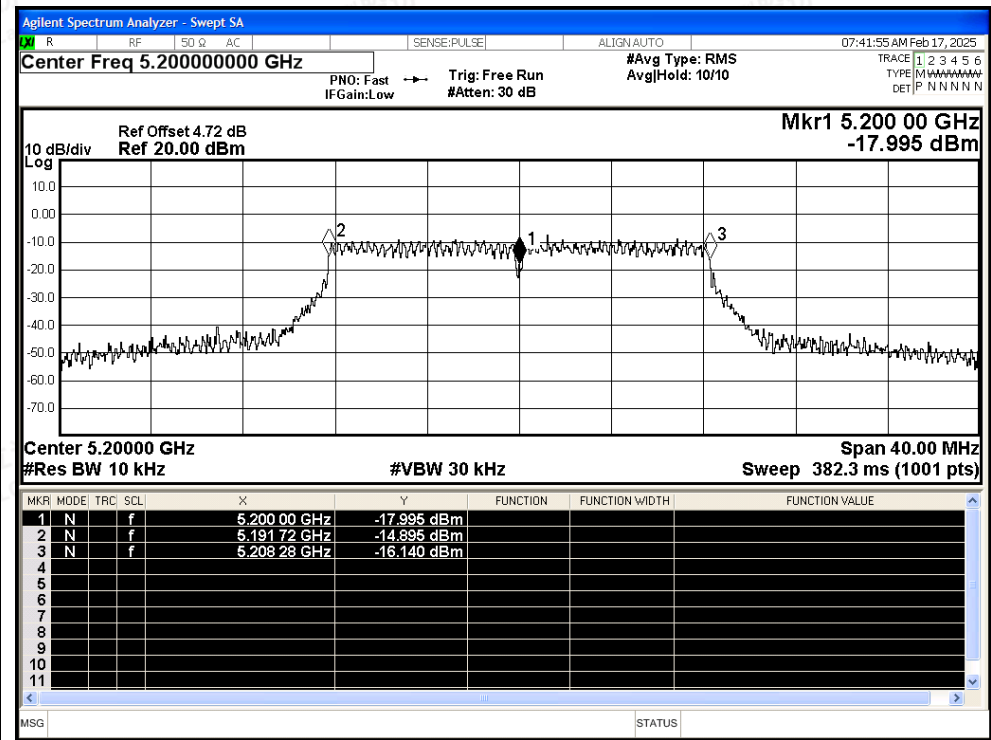




Freq. Stability NVNT a 5240MHz Ant4

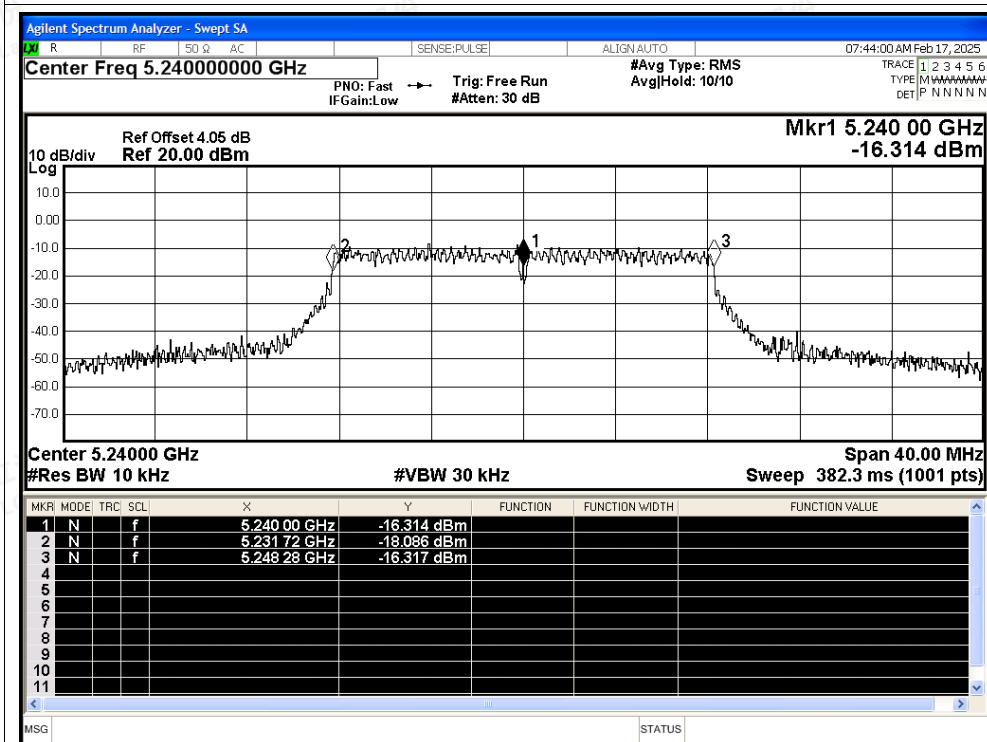

Freq. Stability NVNT n20 5180MHz Ant4

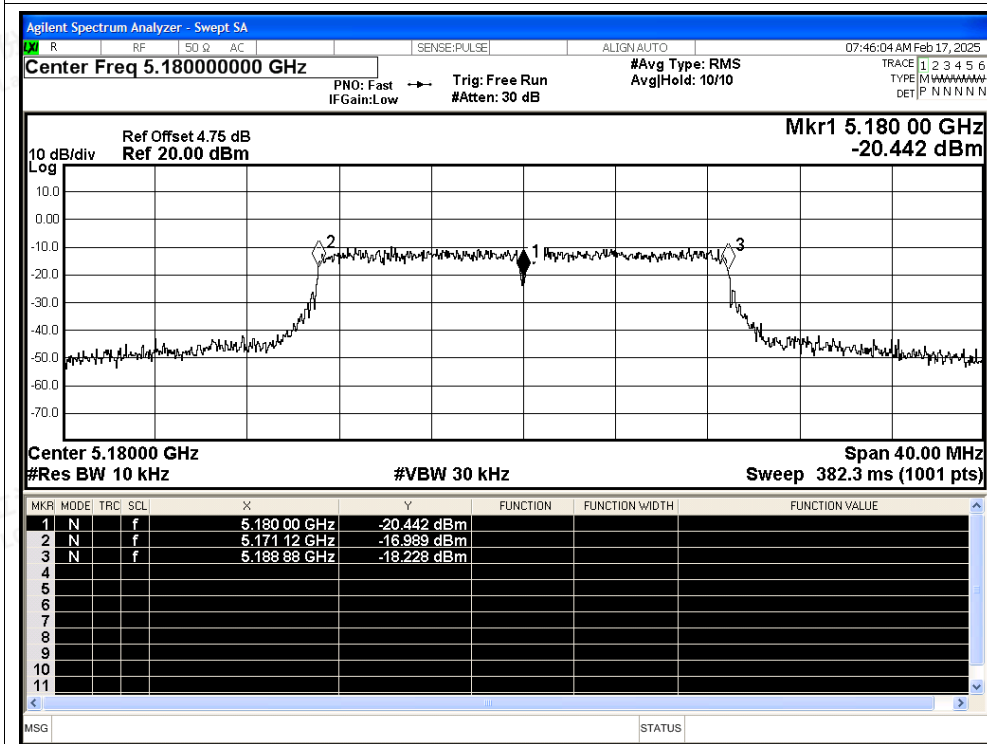

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant4

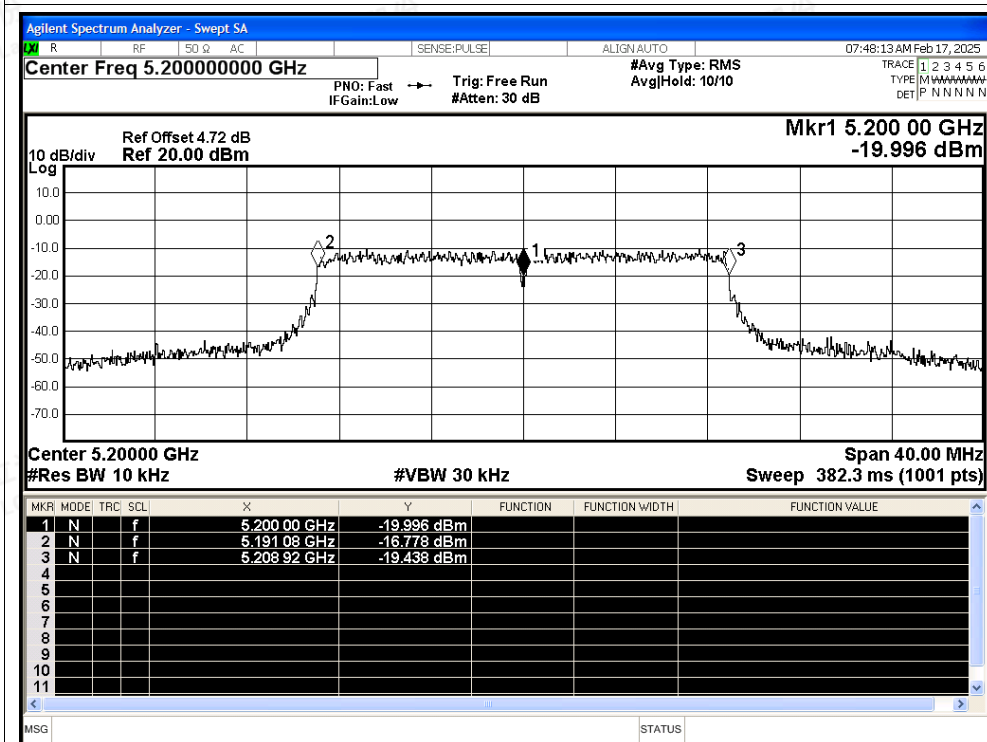

Freq. Stability NVNT n20 5240MHz Ant4


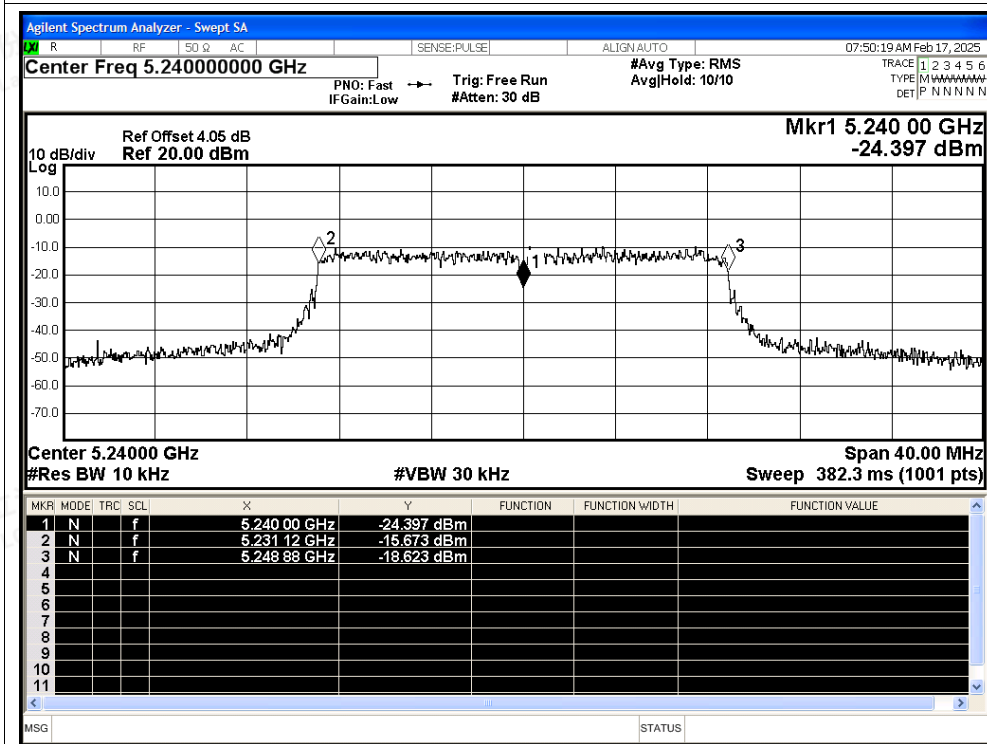




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

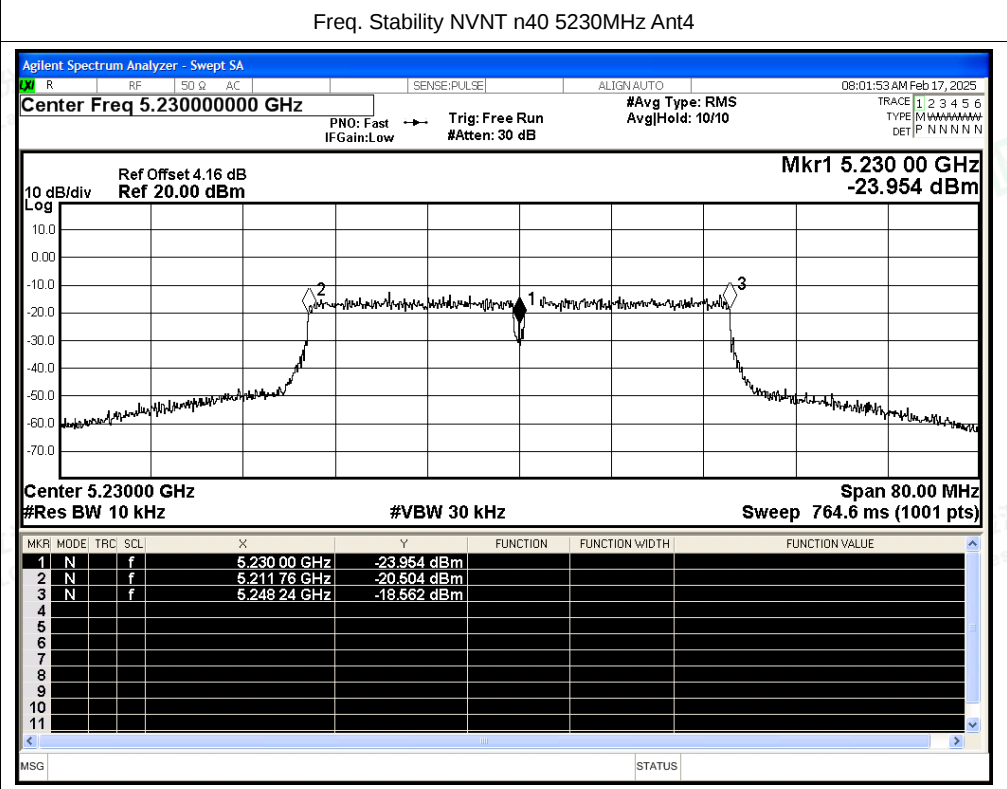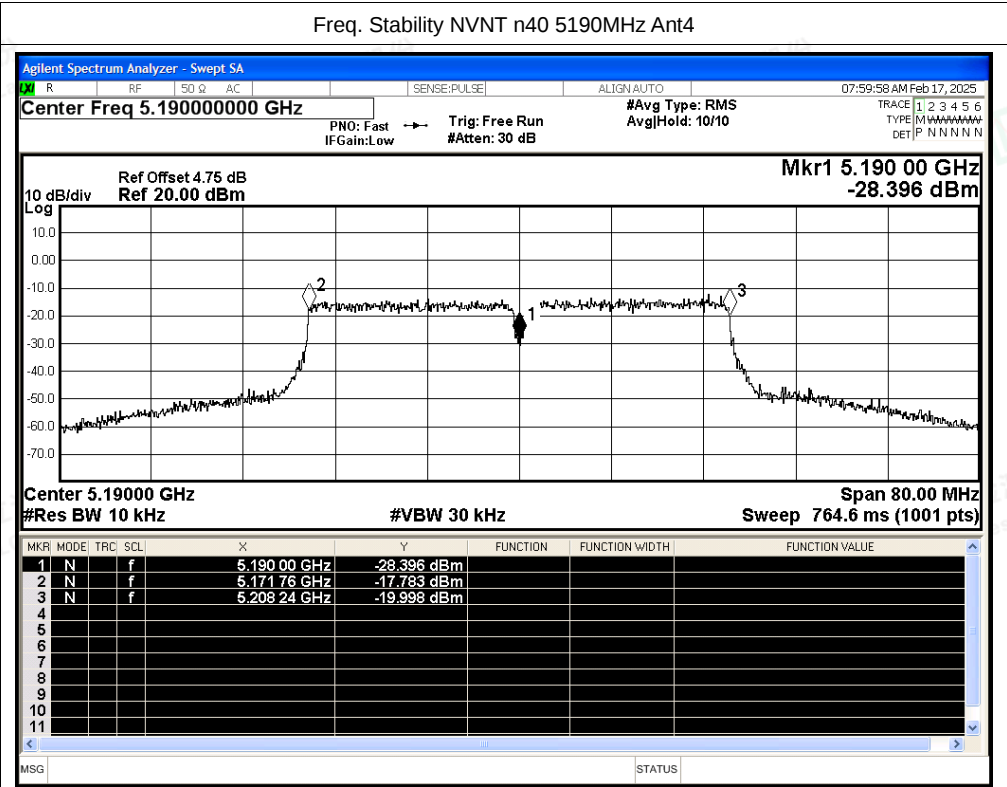

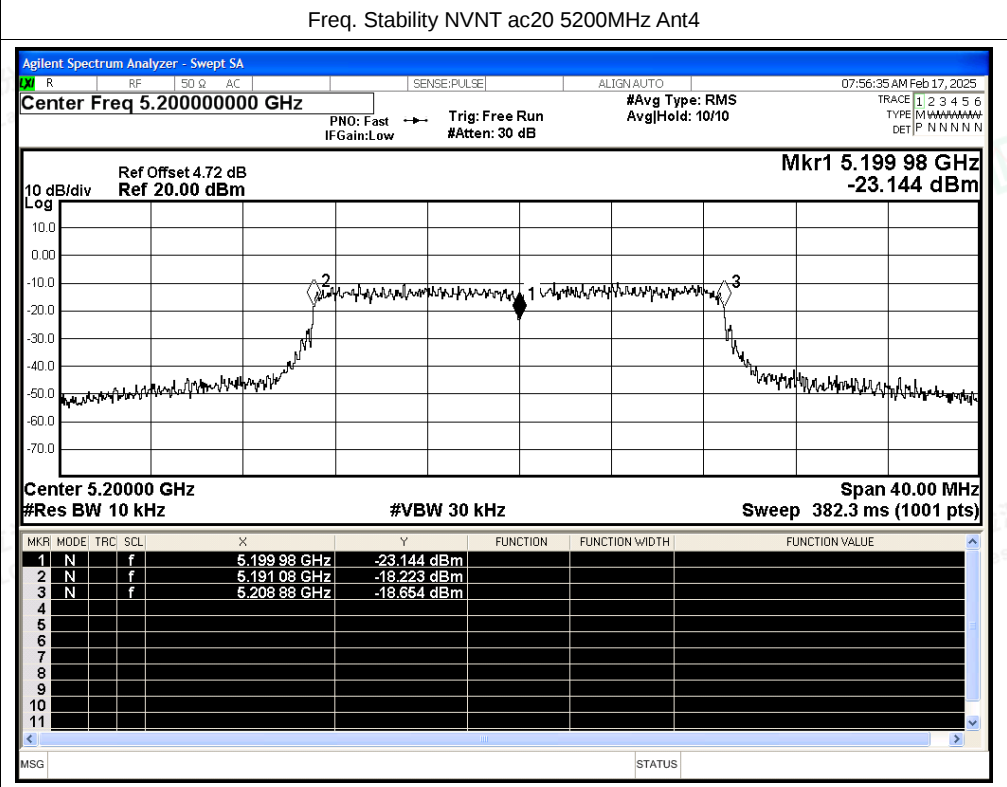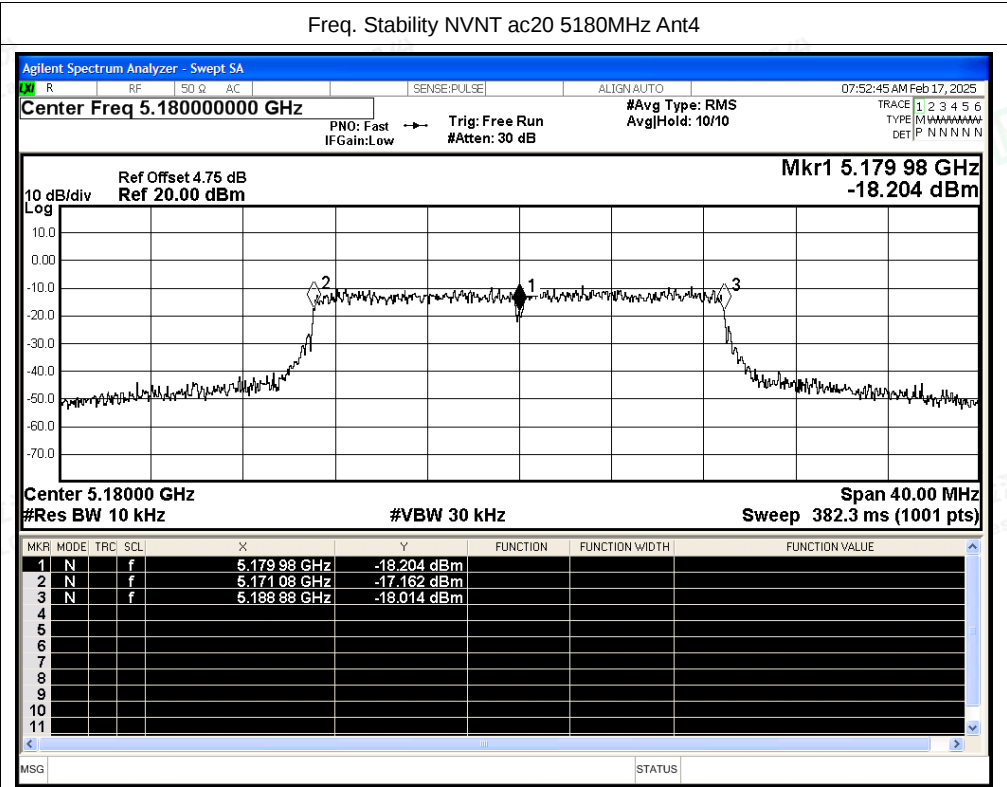




Freq. Stability NVNT ac20 5240MHz Ant4

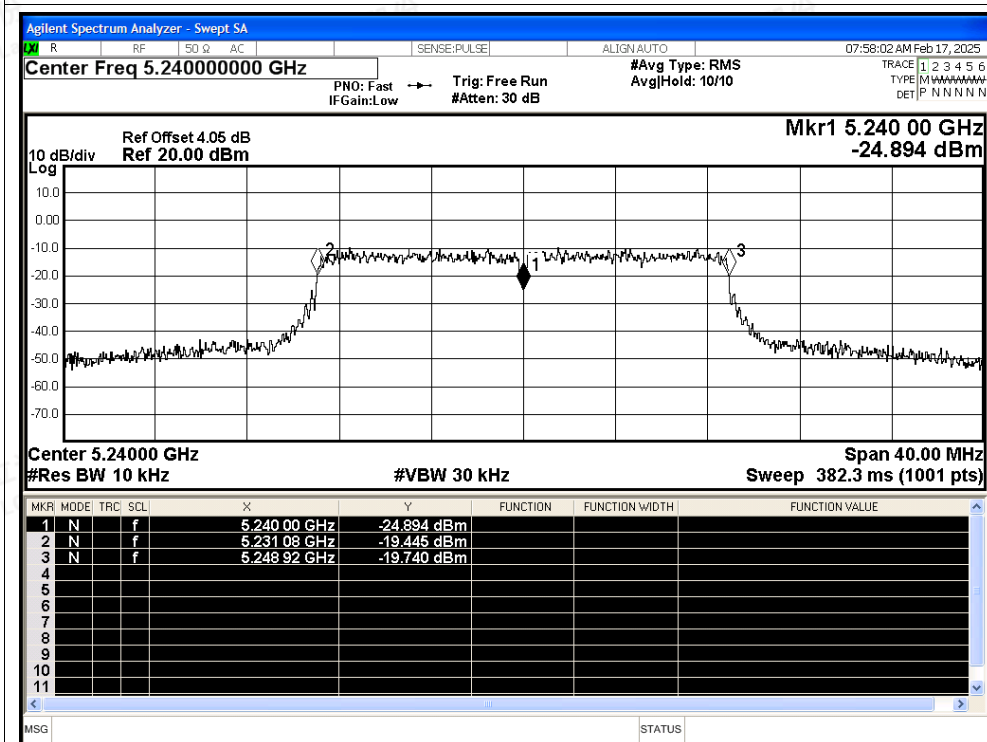

Freq. Stability NVNT ac40 5190MHz Ant4

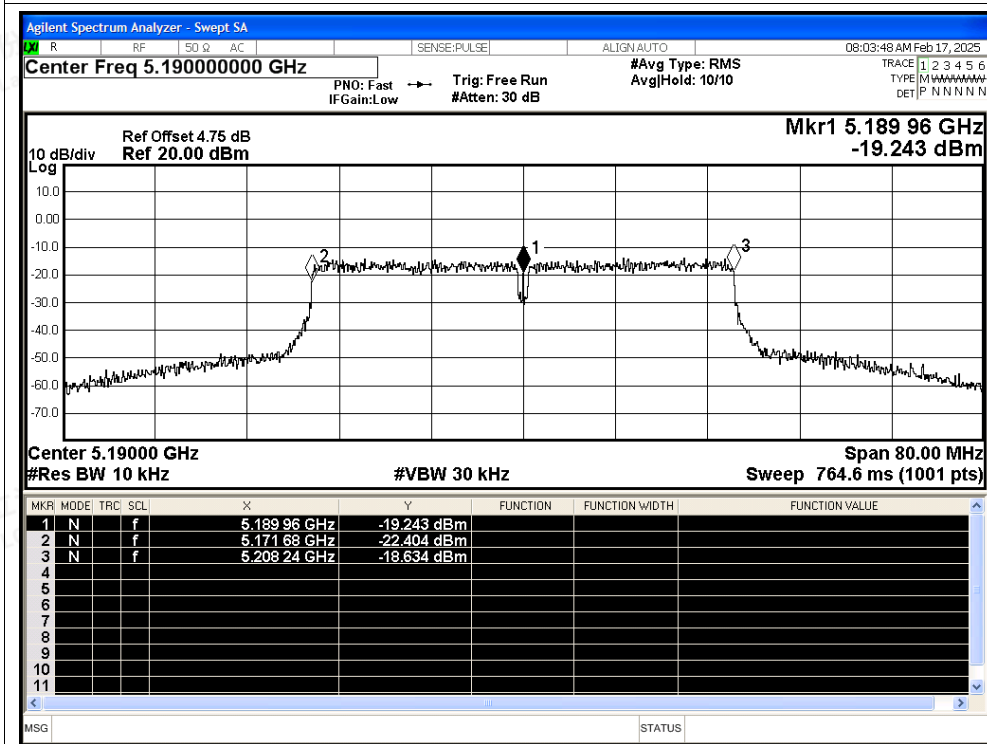

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant4

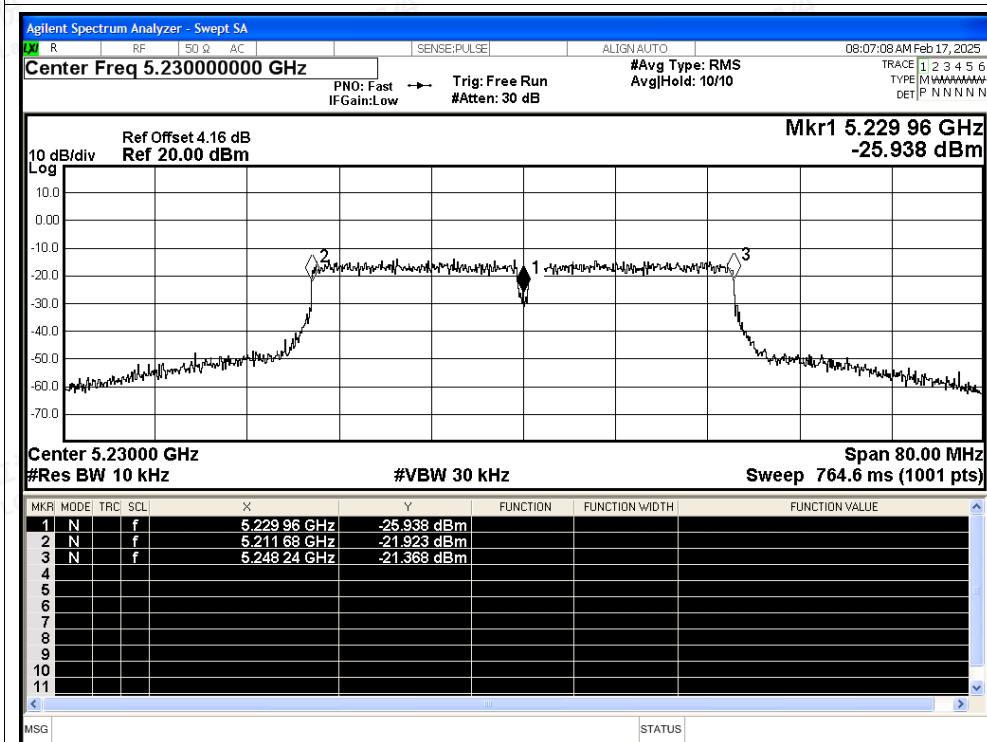

Freq. Stability NVNT ac80 5210MHz Ant4

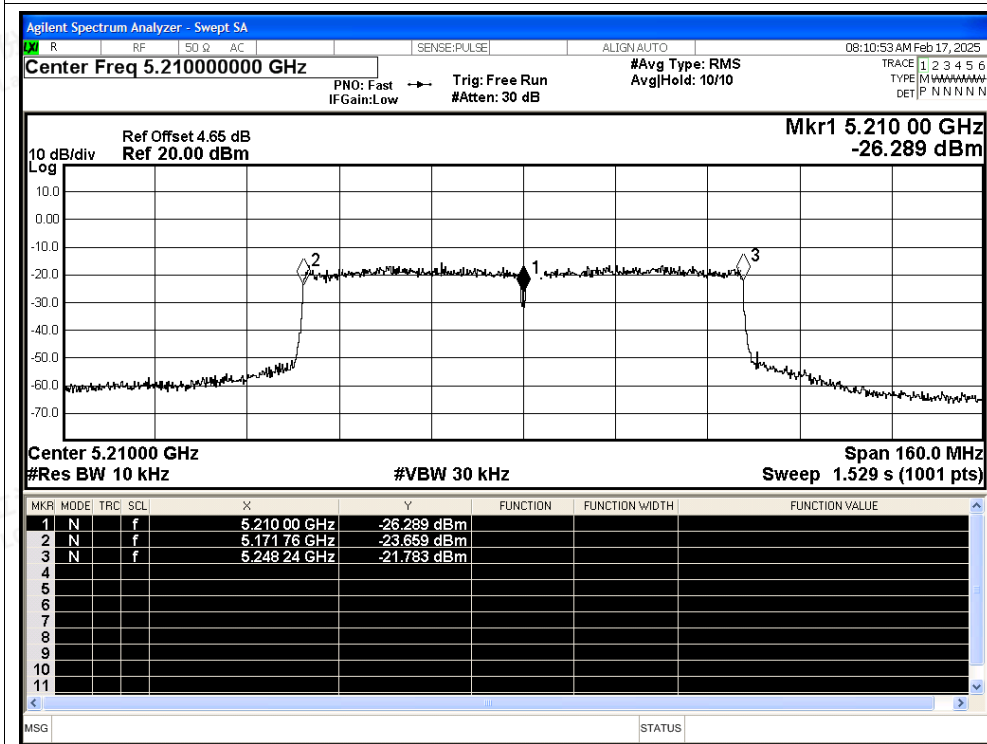


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

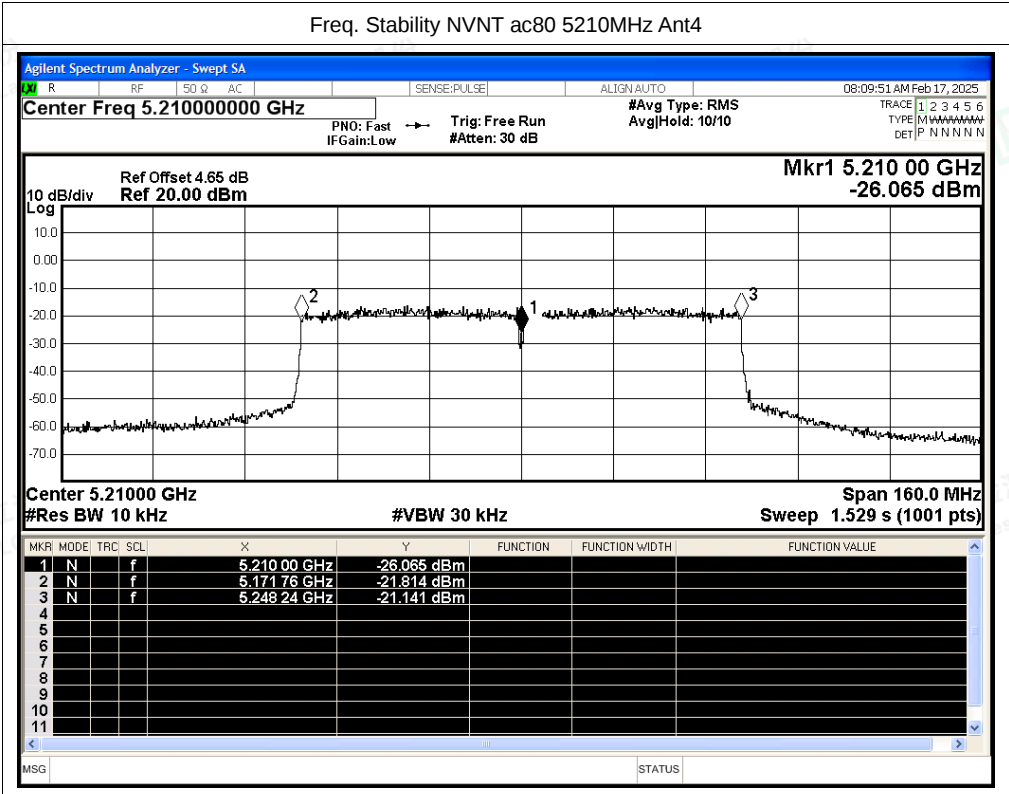



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.65	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.56	0.24	0.91
NVNT	n20	5180	Ant1	97.29	0.12	0.44
NVNT	n20	5200	Ant1	97.29	0.12	0.44
NVNT	n20	5240	Ant1	97.29	0.12	0.44
NVNT	n40	5190	Ant1	94.71	0.24	0.9
NVNT	n40	5230	Ant1	94.71	0.24	0.9
NVNT	ac20	5180	Ant1	97.3	0.12	0.44
NVNT	ac20	5200	Ant1	97.3	0.12	0.44
NVNT	ac20	5240	Ant1	97.34	0.12	0.44
NVNT	ac40	5190	Ant1	94.72	0.24	0.9
NVNT	ac40	5230	Ant1	94.72	0.24	0.9
NVNT	ac80	5210	Ant1	94.41	0.25	0.97






Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

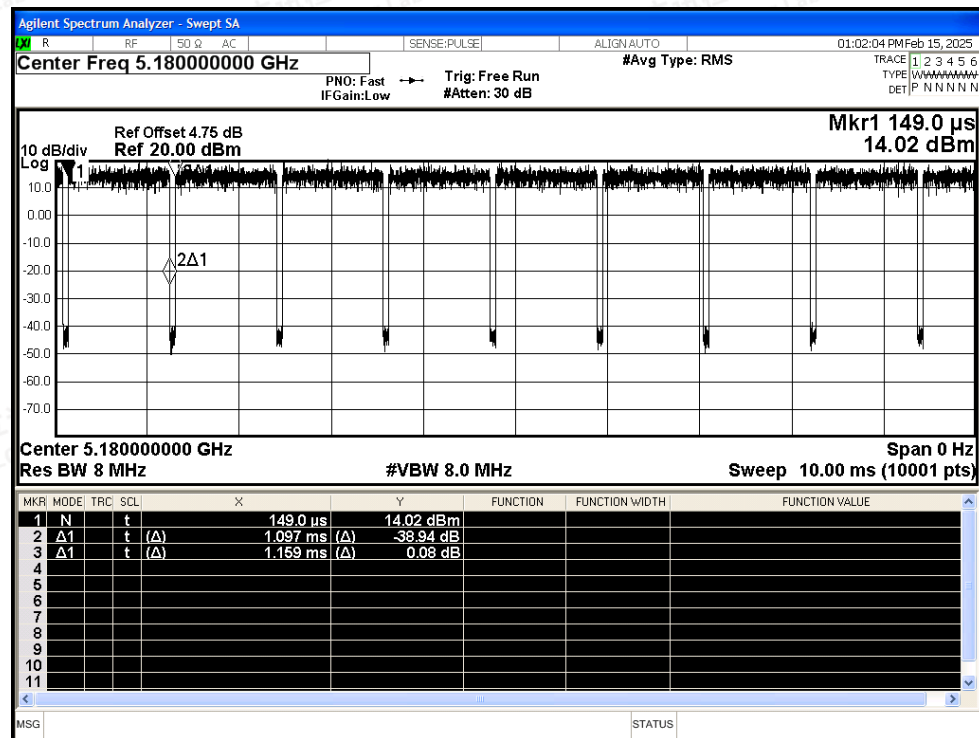

Duty Cycle NVNT a 5200MHz Ant1

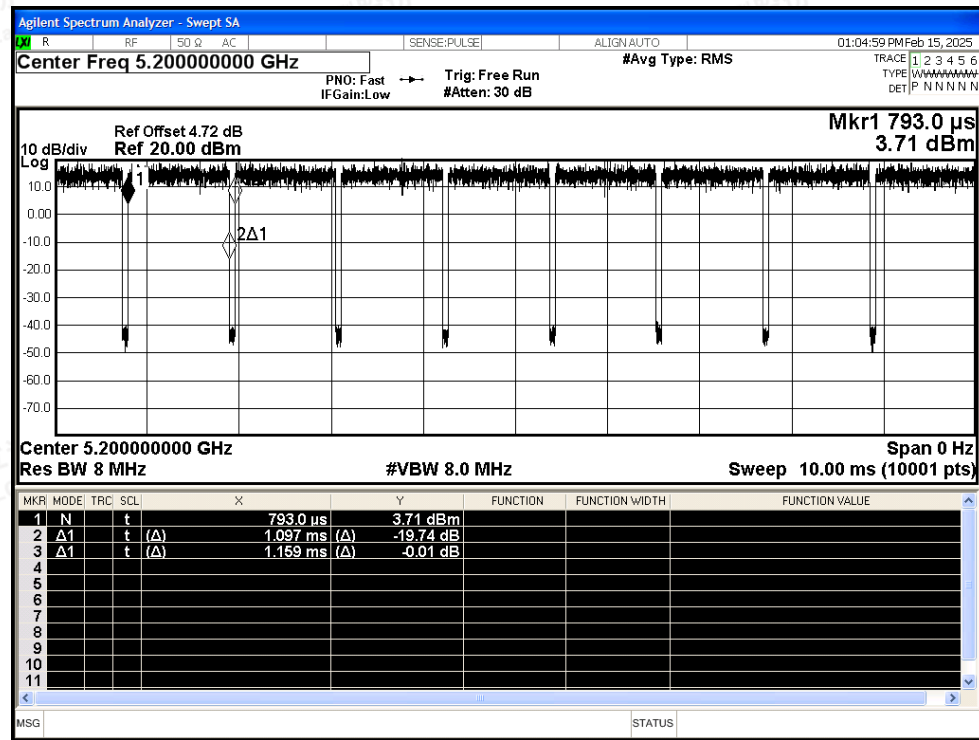

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

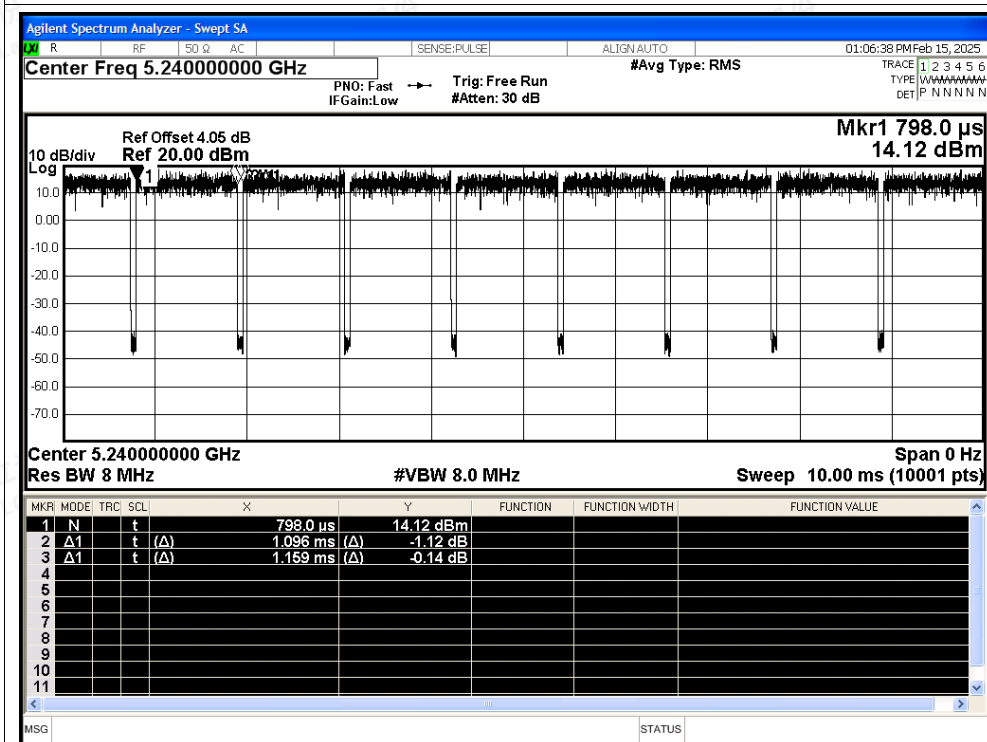

Duty Cycle NVNT n20 5180MHz Ant1

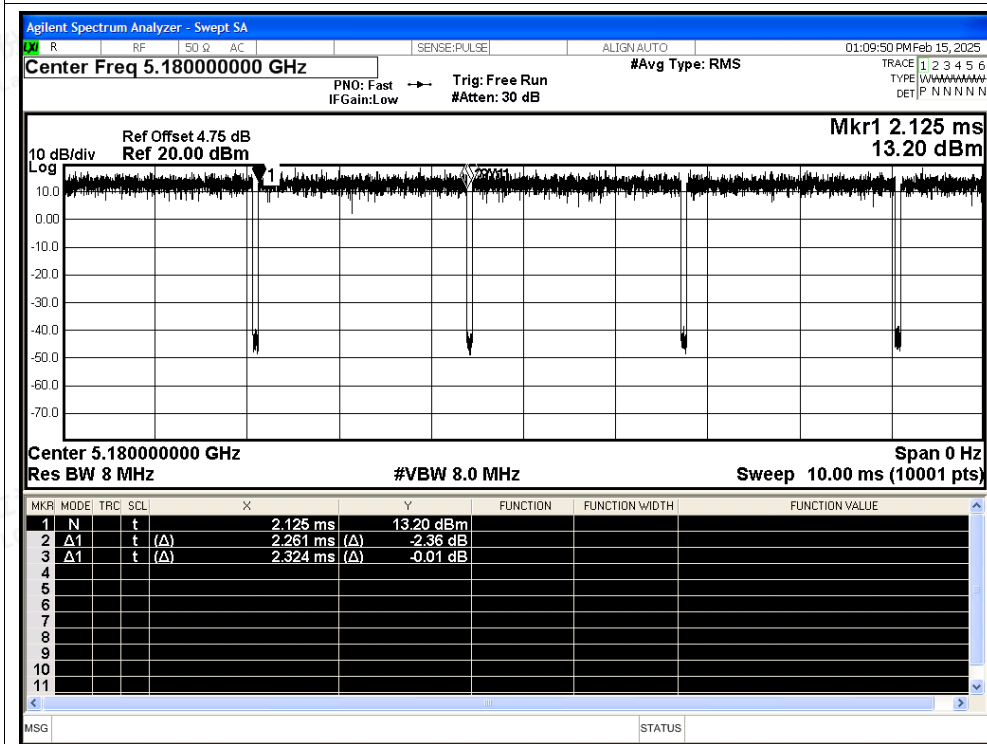

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

