





PSD NVNT a 5700MHz Ant4

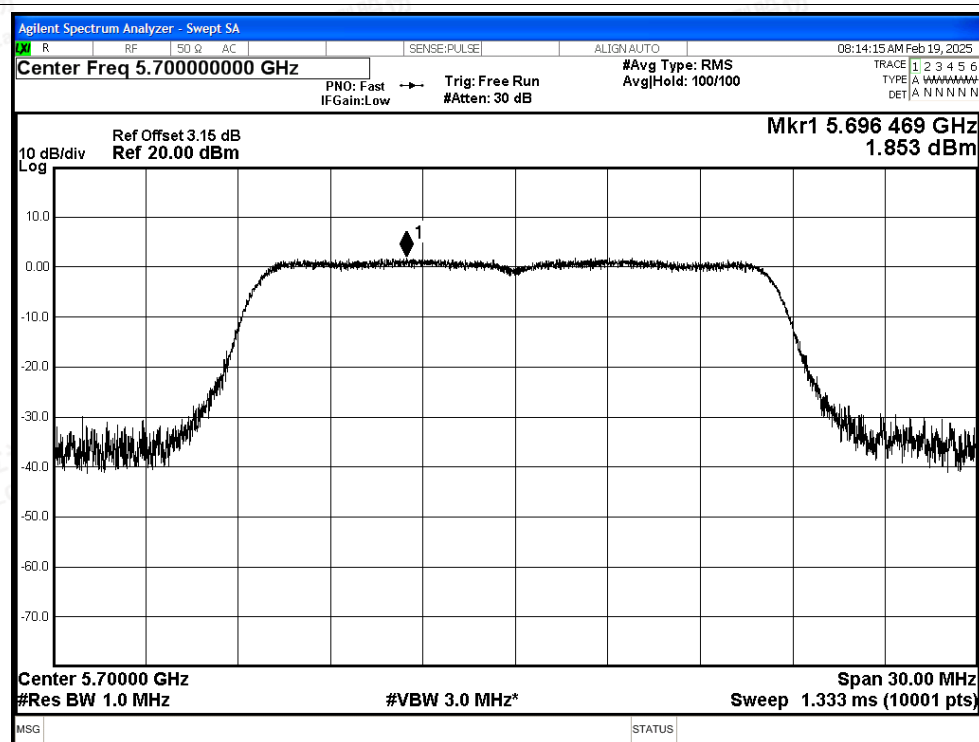

PSD NVNT n20 5500MHz Ant4


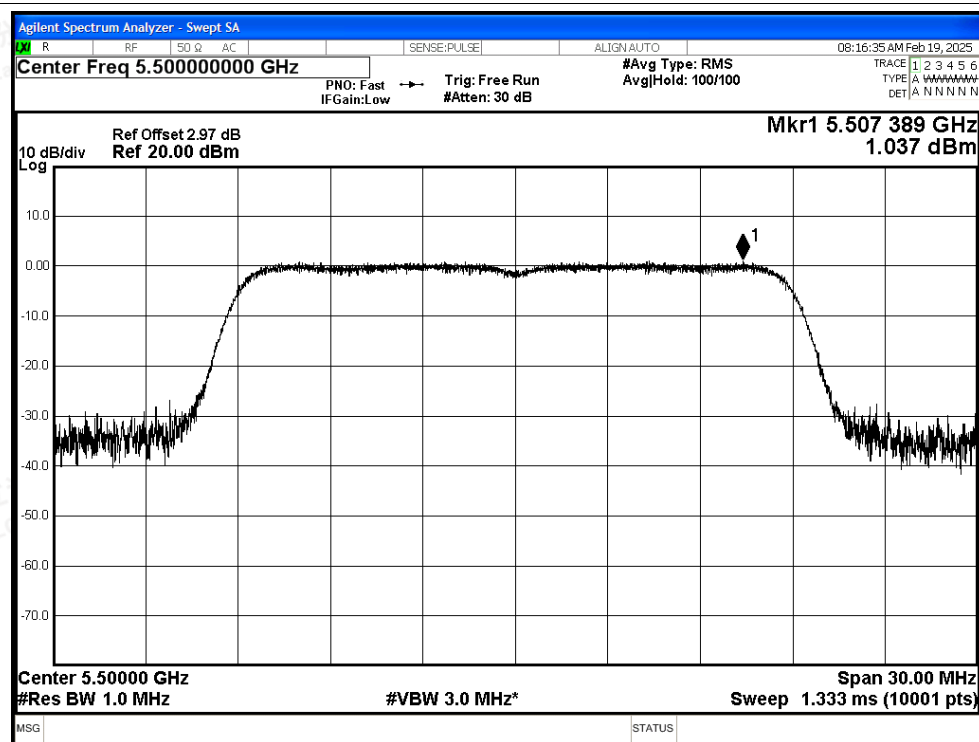


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

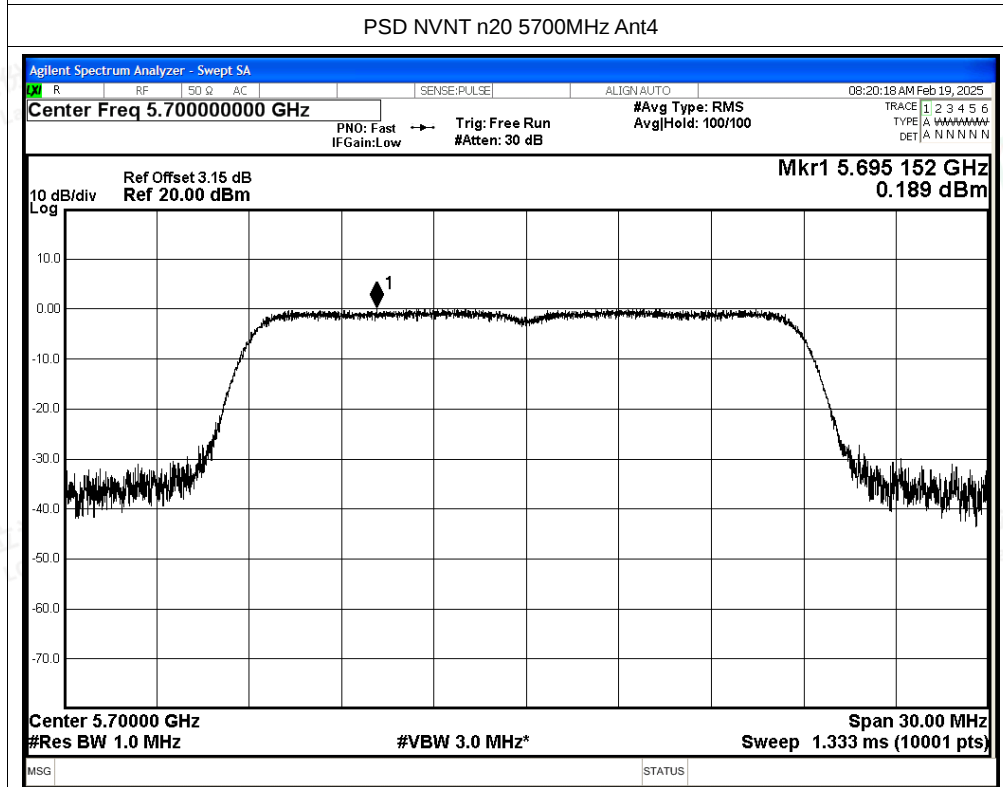
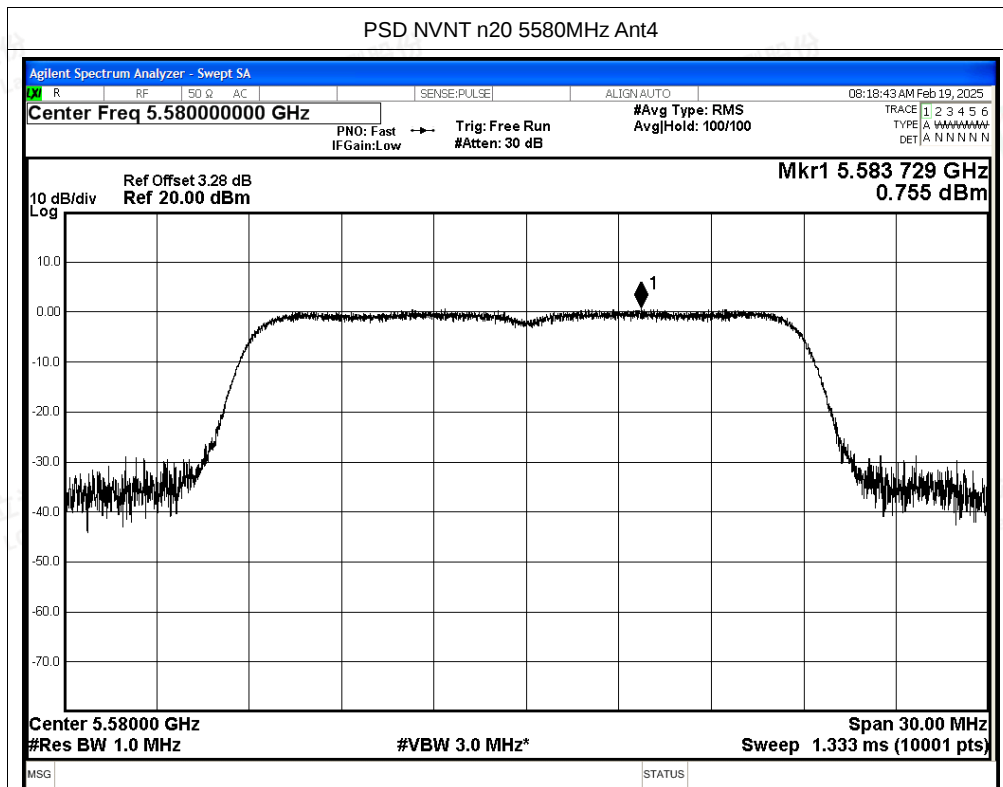


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

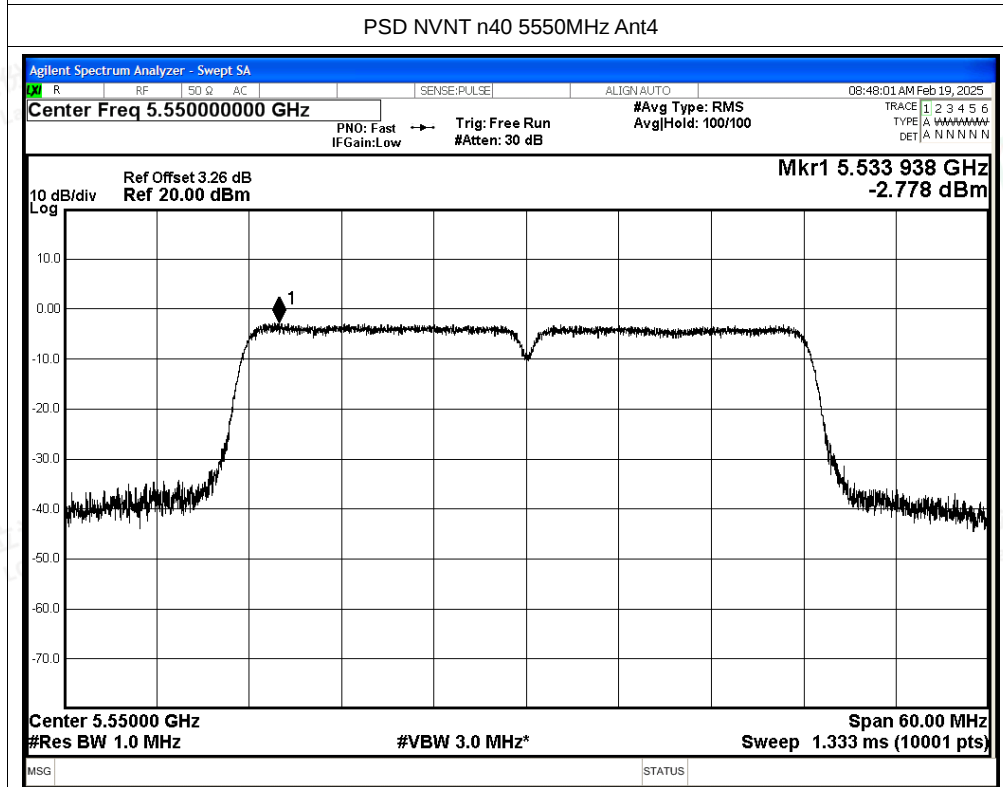
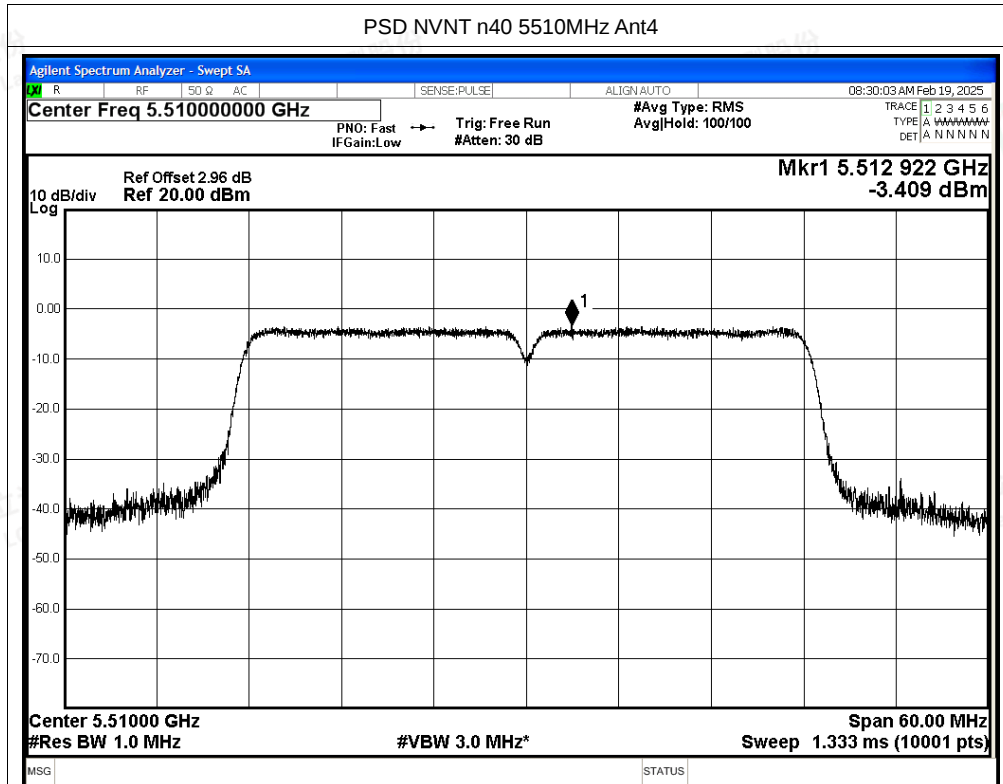


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

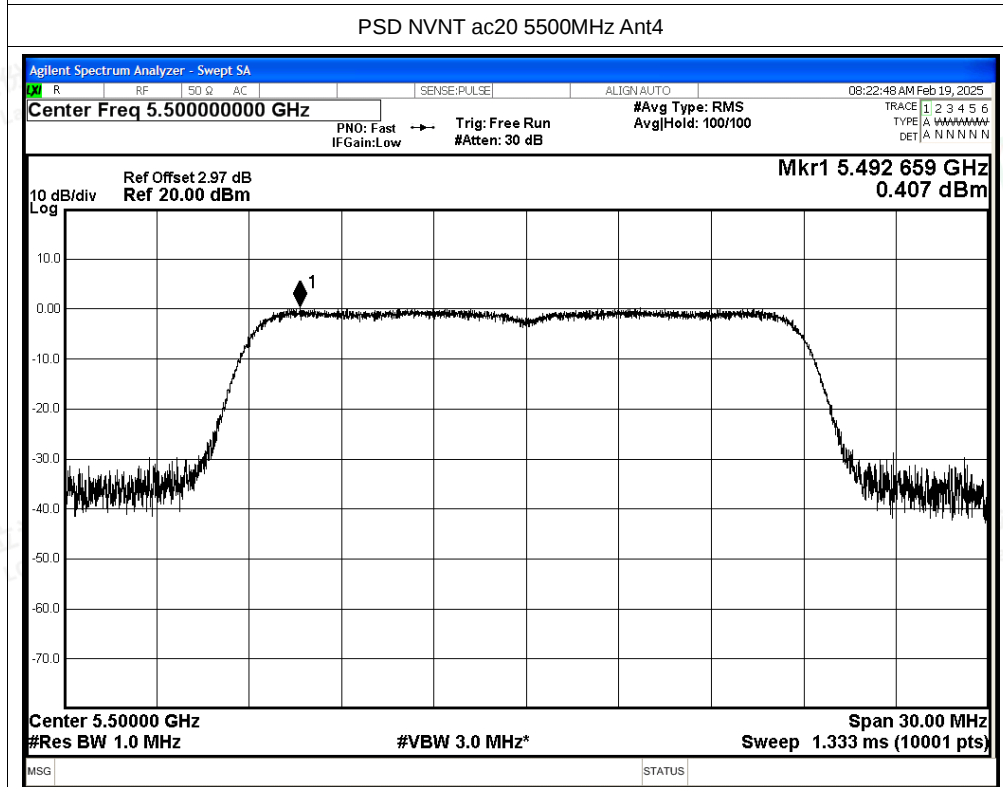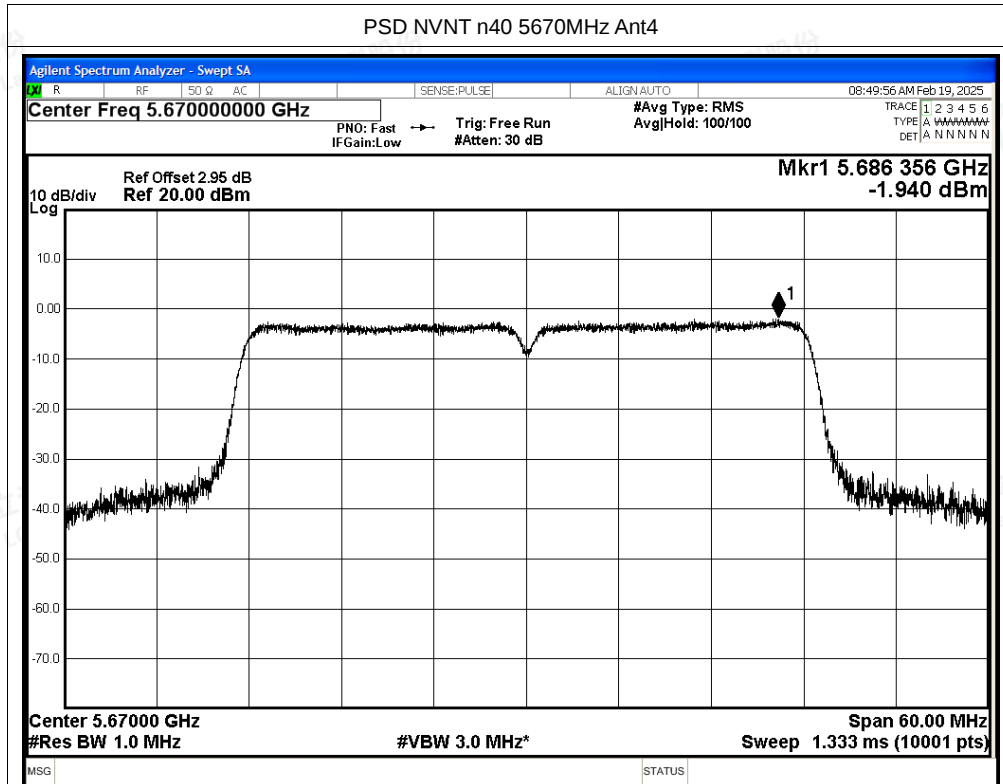

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5580MHz Ant4

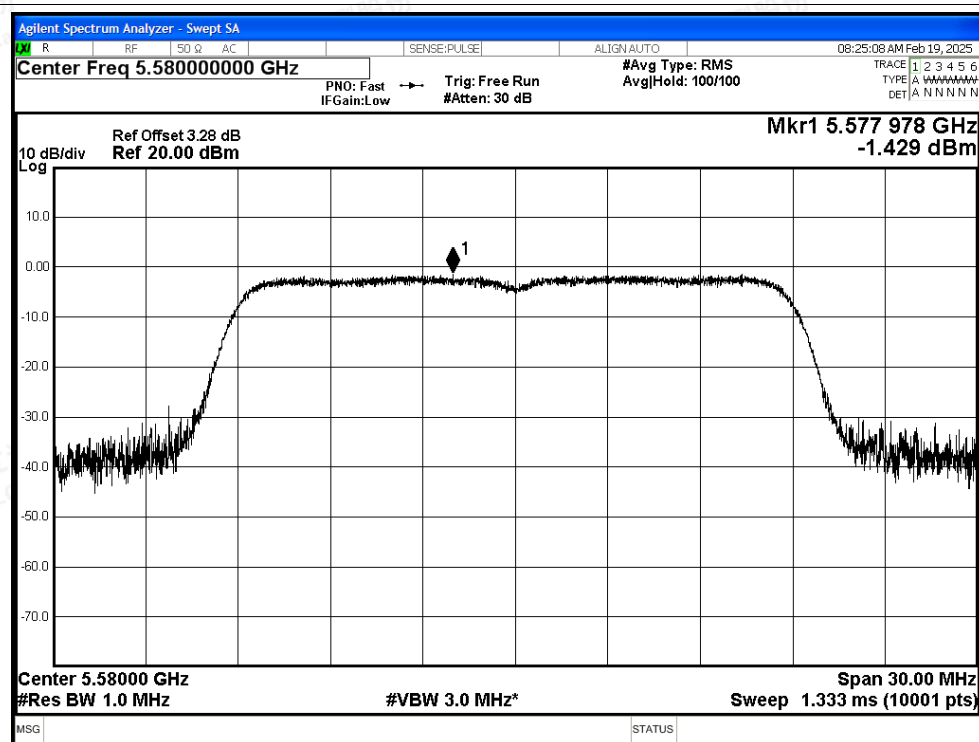

PSD NVNT ac20 5700MHz Ant4

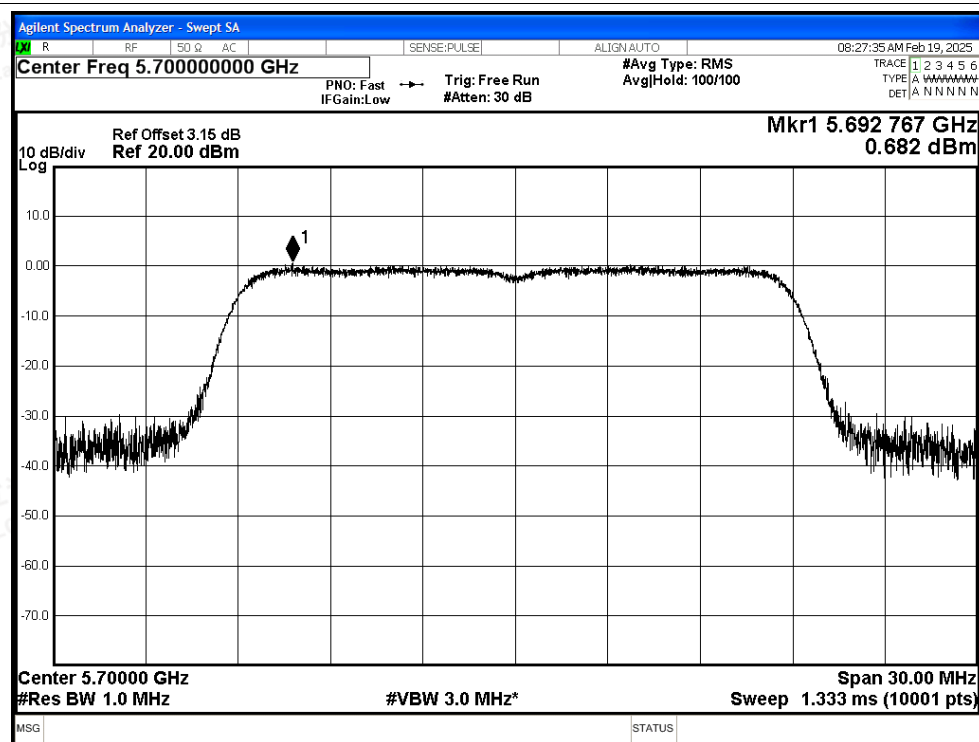

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5510MHz Ant4

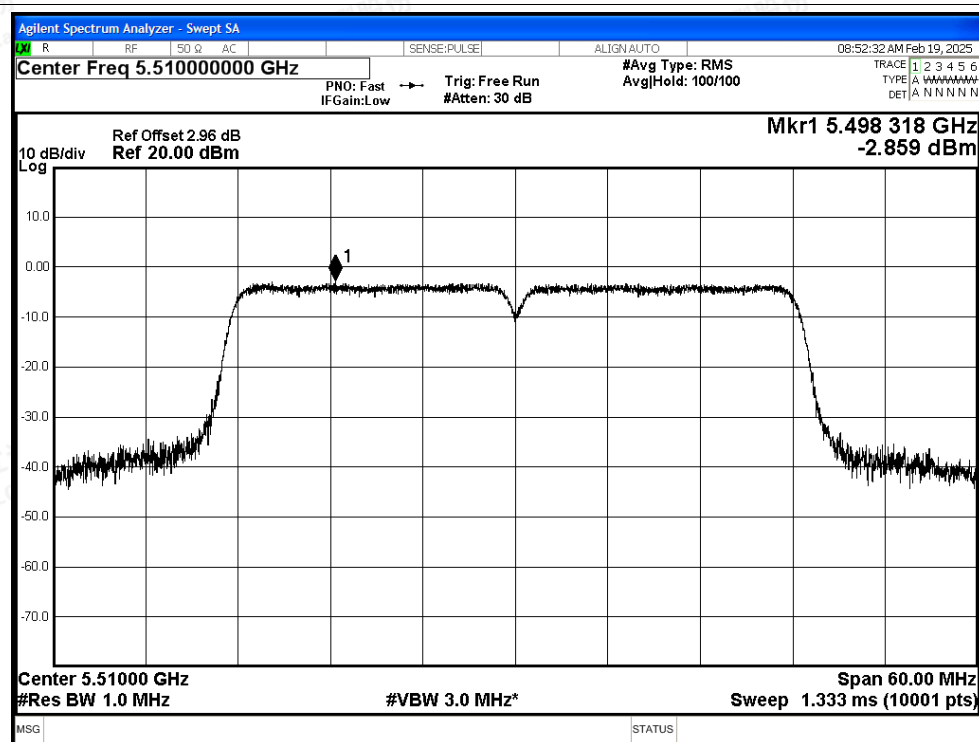

PSD NVNT ac40 5550MHz Ant4

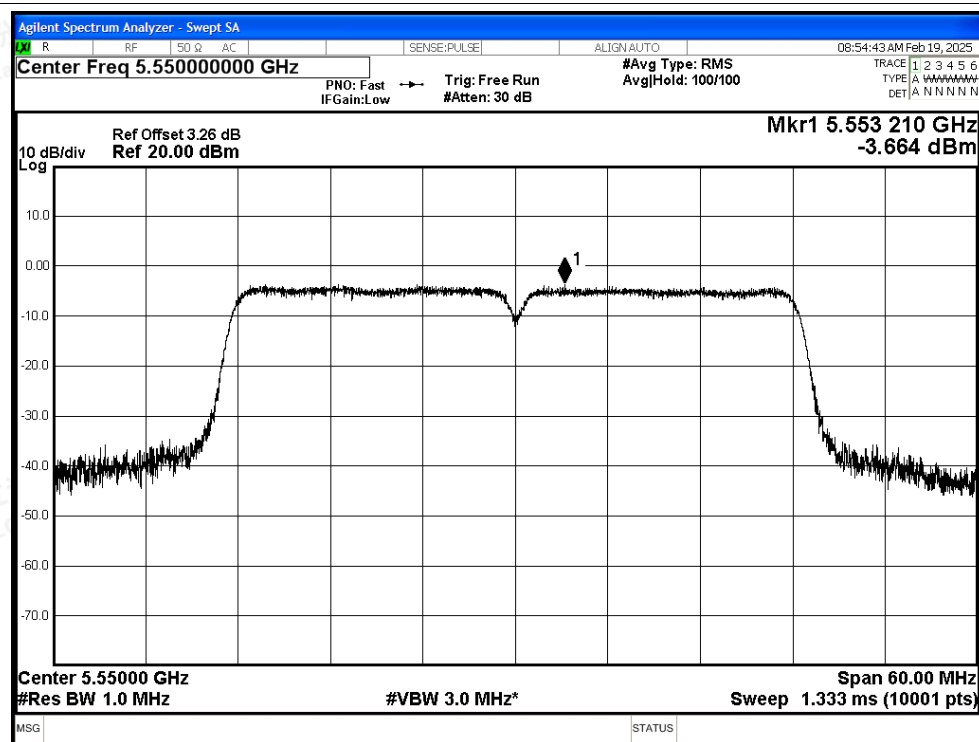

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5670MHz Ant4

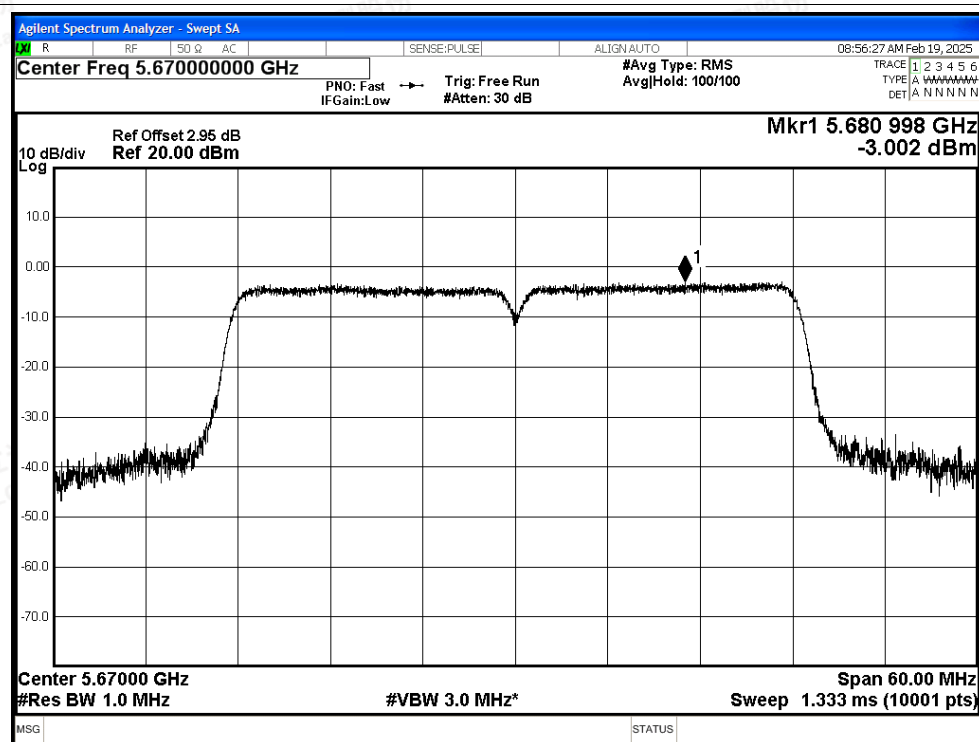

PSD NVNT ac80 5530MHz Ant4

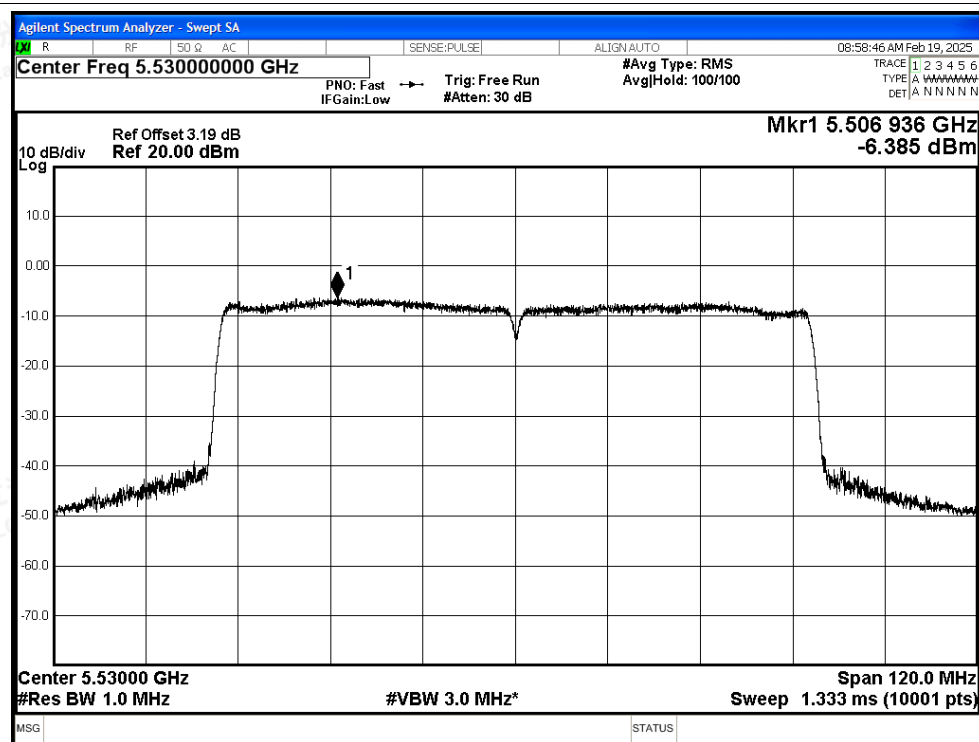


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

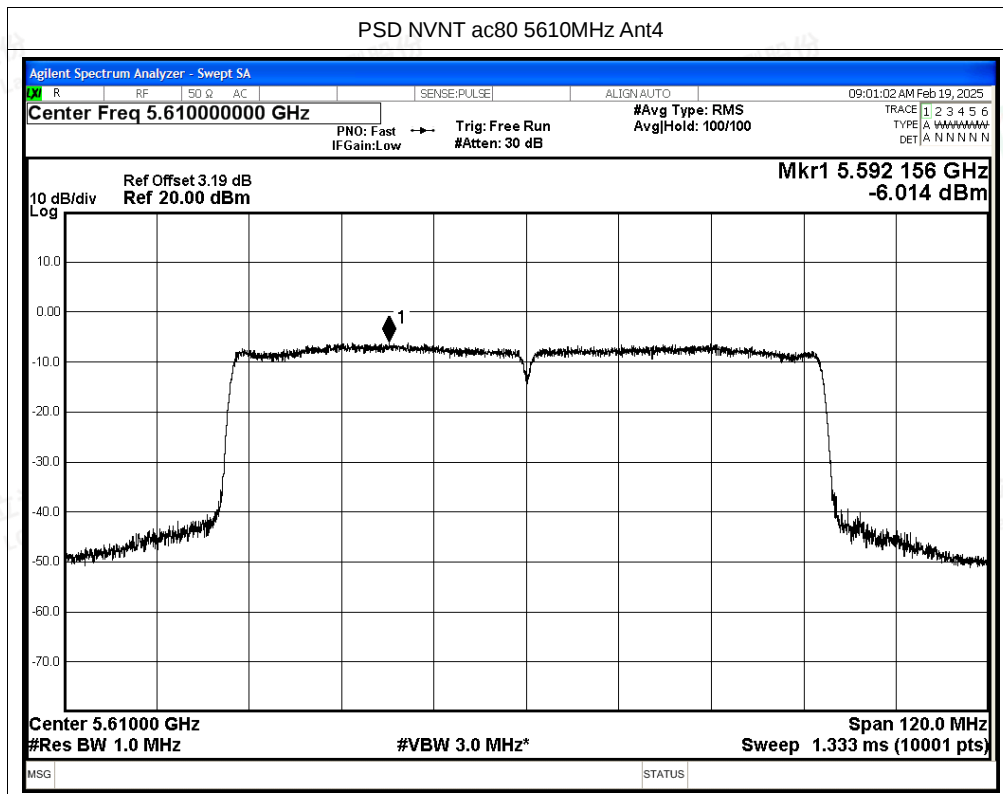

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-48.76	2.88	-	49.35	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-57.8	2.88	0.24	40.55	Average	54	Pass
NVNT	a	5500	Ant1	5469.4	-43.82	2.88	-	54.29	Peak	68.2	Pass
NVNT	a	5500	Ant1	5469	-56.73	2.88	0.24	41.62	Average	54	Pass
NVNT	a	5500	Ant1	5470	-49.38	2.88	-	48.73	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-56.8	2.88	0.24	41.55	Average	54	Pass
NVNT	a	5700	Ant1	5725	-39.29	2.88	-	58.82	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-55.71	2.88	0.24	42.64	Average	54	Pass
NVNT	a	5700	Ant1	5725	-39.29	2.88	-	58.82	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725.2	-53.77	2.88	0.24	44.58	Average	54	Pass
NVNT	a	5700	Ant1	5735	-49.52	2.88	-	48.59	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.91	2.88	0.24	40.44	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-50.64	2.88	-	47.47	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-57.61	2.88	0.12	40.62	Average	54	Pass
NVNT	n20	5500	Ant1	5469.2	-44.46	2.88	-	53.65	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-55.76	2.88	0.12	42.47	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-46.61	2.88	-	51.50	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-55.76	2.88	0.12	42.47	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-40.64	2.88	-	57.47	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.52	2.88	0.12	44.71	Average	54	Pass
NVNT	n20	5700	Ant1	5725.8	-38.78	2.88	-	59.33	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725.4	-53.26	2.88	0.12	44.97	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-47.34	2.88	-	50.77	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-57.79	2.88	0.12	40.44	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-50.26	2.88	-	47.85	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-57.86	2.88	0.23	40.48	Average	54	Pass
NVNT	n40	5510	Ant1	5466.8	-43.52	2.88	-	54.59	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5468	-56.17	2.88	0.23	42.17	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-44.99	2.88	-	53.12	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-56.19	2.88	0.23	42.15	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-48.84	2.88	-	49.27	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-58.38	2.88	0.24	39.97	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-47.83	2.88	-	50.28	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5726	-57.76	2.88	0.24	40.59	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-47.83	2.88	-	50.28	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-58.46	2.88	0.24	39.89	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-49.96	2.88	-	48.15	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5460	-57.77	2.88	0.12	40.46	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant1	5465	-45.13	2.88	-	52.98	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5469	-56.22	2.88	0.12	42.01	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-47.62	2.88	-	50.49	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-56.92	2.88	0.12	41.31	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-42.09	2.88	-	56.02	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-54.27	2.88	0.12	43.96	Average	54	Pass
NVNT	ac20	5700	Ant1	5727.6	-40.92	2.88	-	57.19	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-54.27	2.88	0.12	43.96	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-49.36	2.88	-	48.75	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-57.47	2.88	0.12	40.76	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-47.93	2.88	-	50.18	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-58.44	2.88	0.24	39.91	Average	54	Pass
NVNT	ac40	5510	Ant1	5468.6	-44.29	2.88	-	53.82	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-55.4	2.88	0.24	42.95	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-48.03	2.88	-	50.08	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-55.4	2.88	0.24	42.95	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-50.57	2.88	-	47.54	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-58.13	2.88	0.23	40.21	Average	54	Pass
NVNT	ac40	5670	Ant1	5733.8	-48.43	2.88	-	49.68	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5727.8	-57.75	2.88	0.23	40.59	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-50.22	2.88	-	47.89	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-58.42	2.88	0.23	39.92	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-47.02	2.88	-	51.09	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-56.6	2.88	0.25	41.76	Average	54	Pass
NVNT	ac80	5530	Ant1	5469.4	-44.88	2.88	-	53.23	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5469.8	-54.74	2.88	0.25	43.62	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-46.27	2.88	-	51.84	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-55.68	2.88	0.25	42.68	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-50.41	2.88	-	47.70	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-58.54	2.88	0.25	39.82	Average	54	Pass
NVNT	ac80	5610	Ant1	5727.21	-48.6	2.88	-	49.51	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5731.105	-57.7	2.88	0.25	40.66	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-50.45	2.88	-	47.66	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-58.02	2.88	0.25	40.34	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant1 Peak

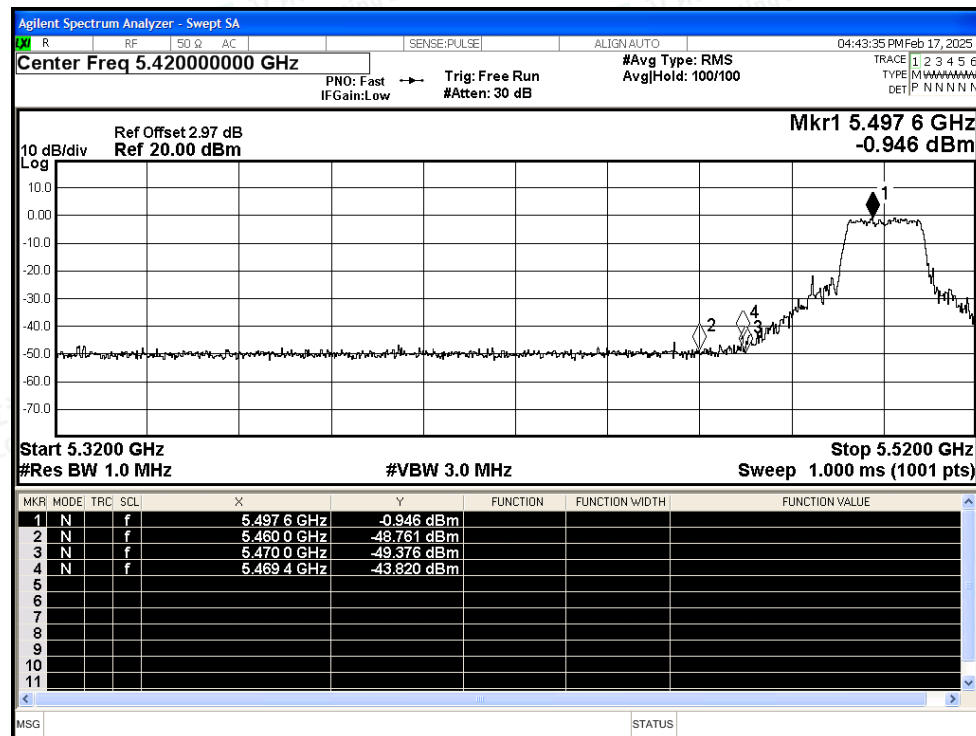

Restrict Band NVNT a 5500MHz Ant1 Average

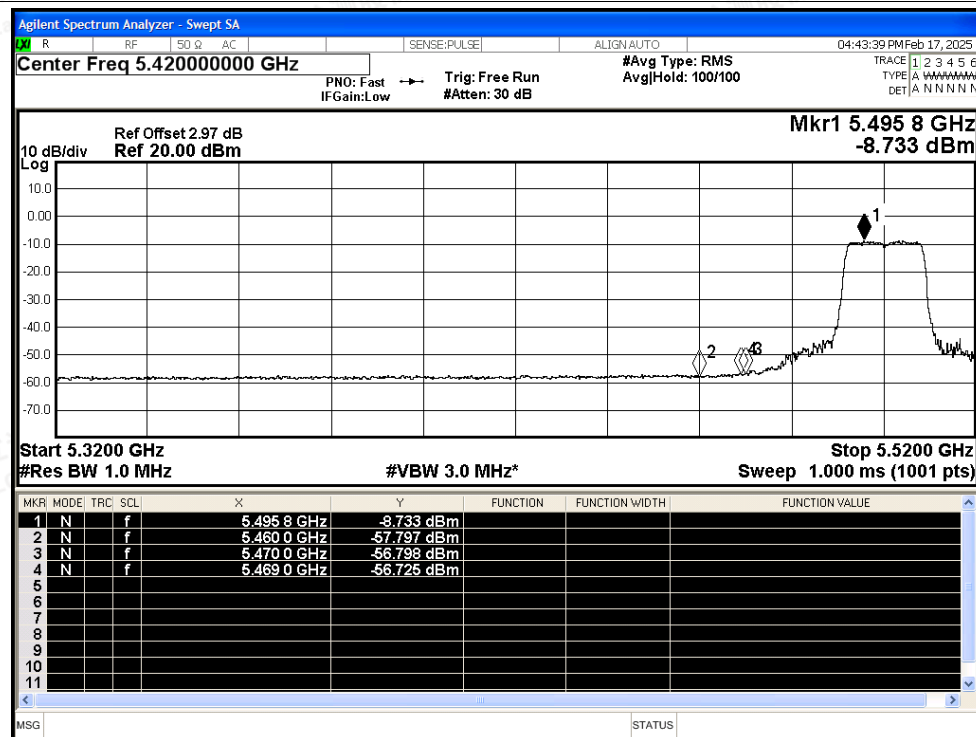

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant1 Peak

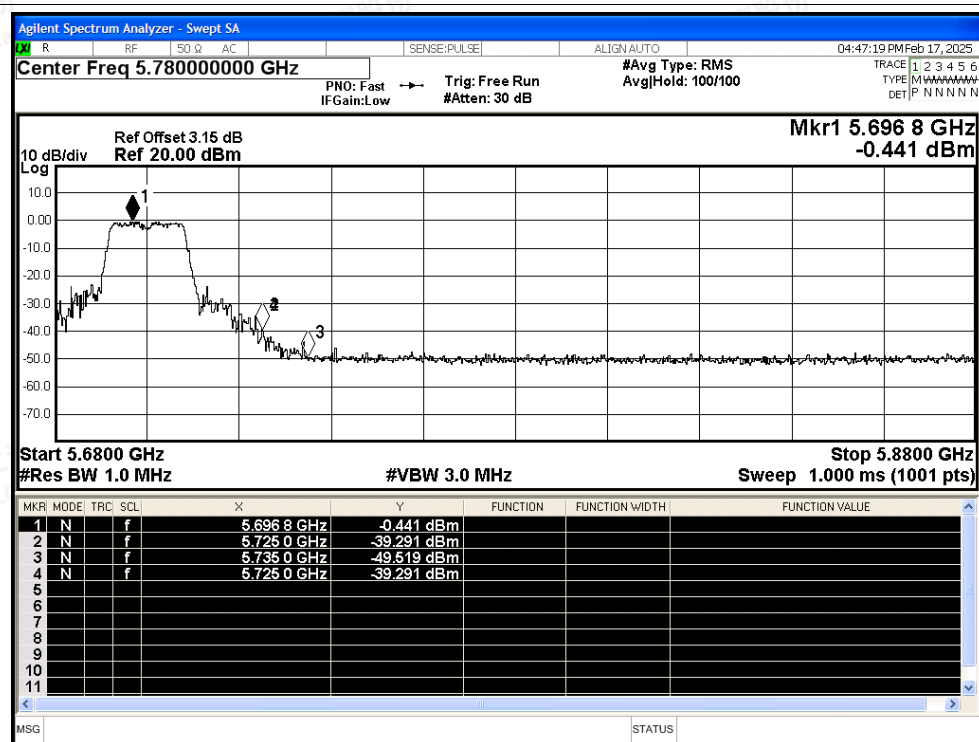

Restrict Band NVNT a 5700MHz Ant1 Average

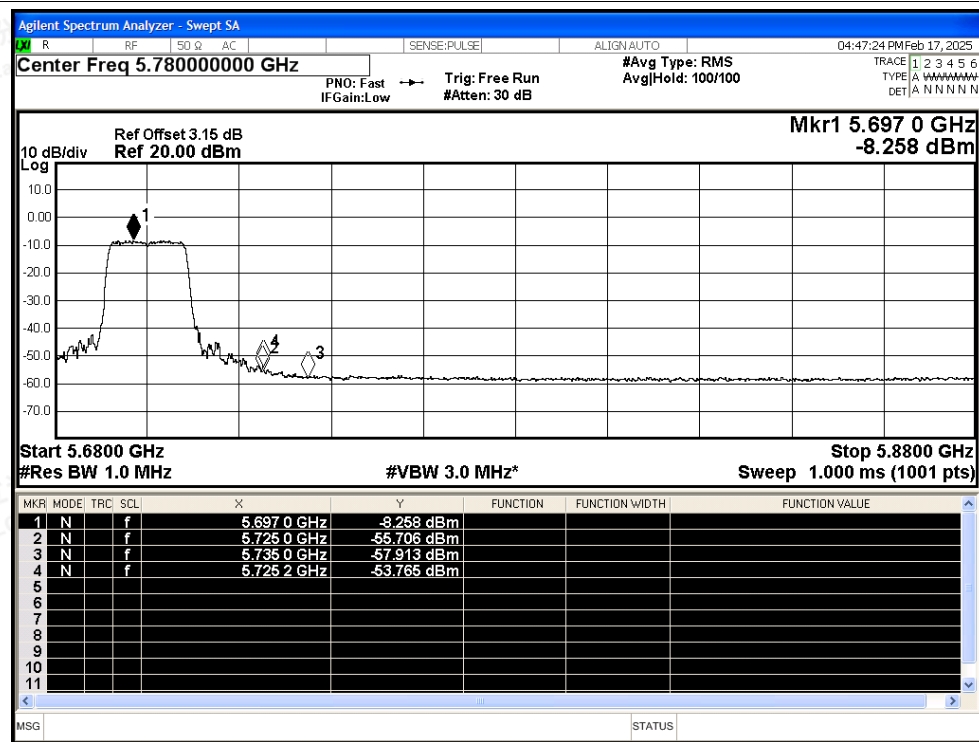

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant1 Peak

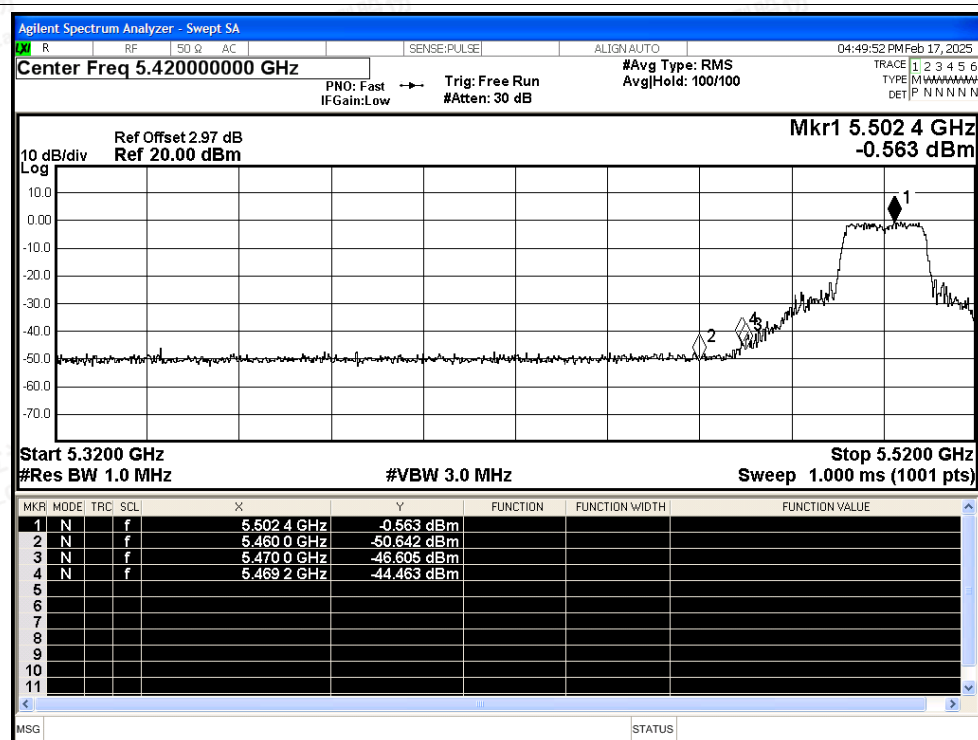

Restrict Band NVNT n20 5500MHz Ant1 Average

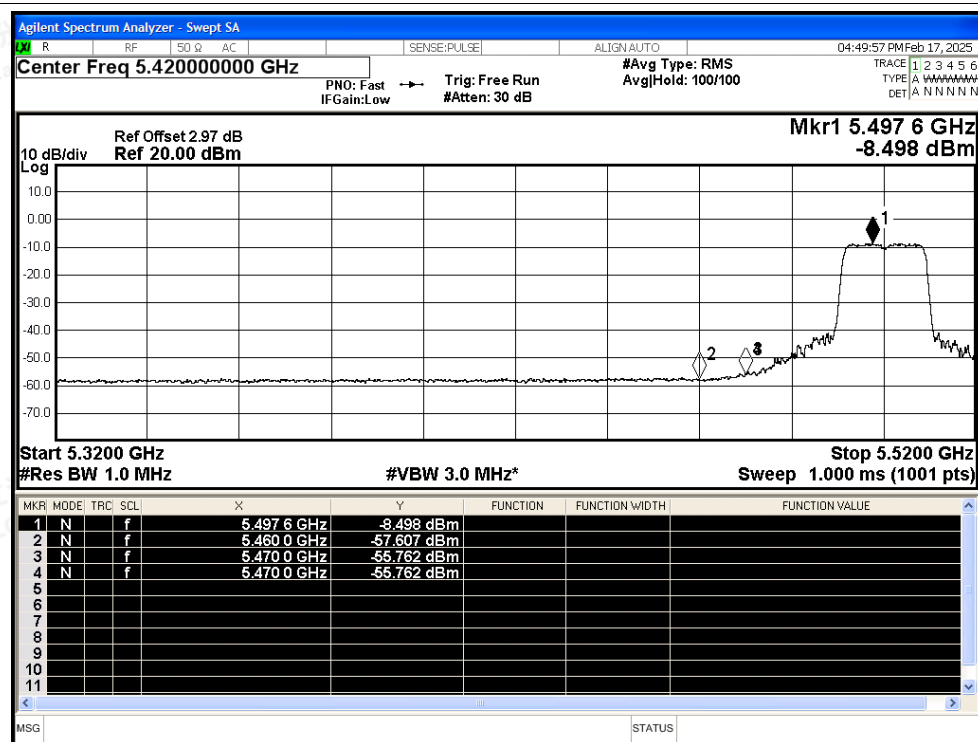

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant1 Peak

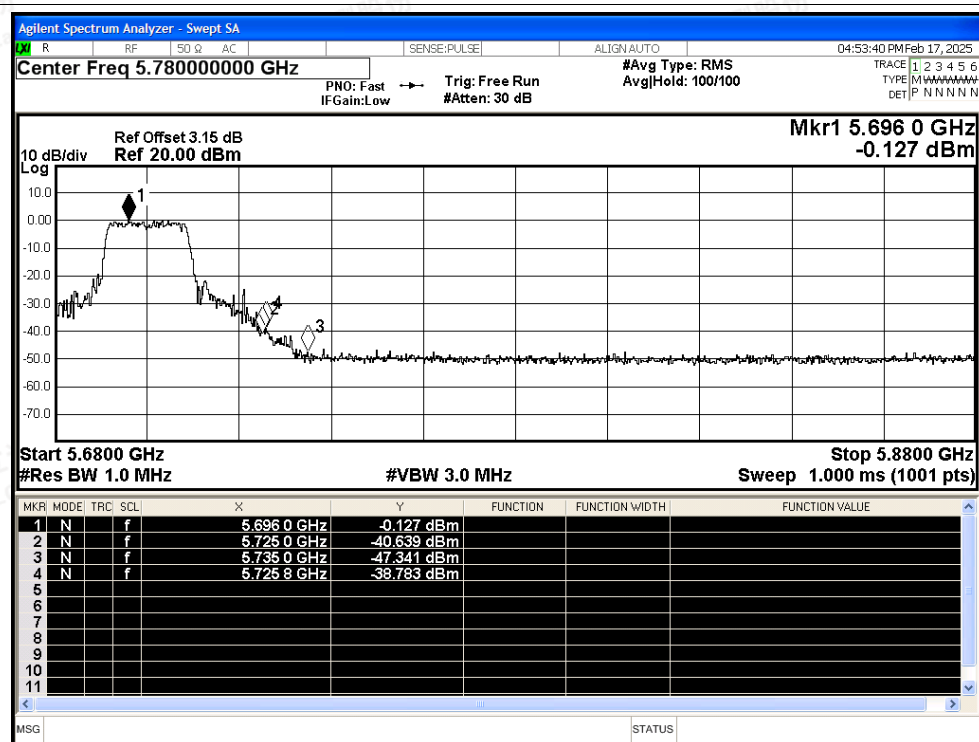

Restrict Band NVNT n20 5700MHz Ant1 Average

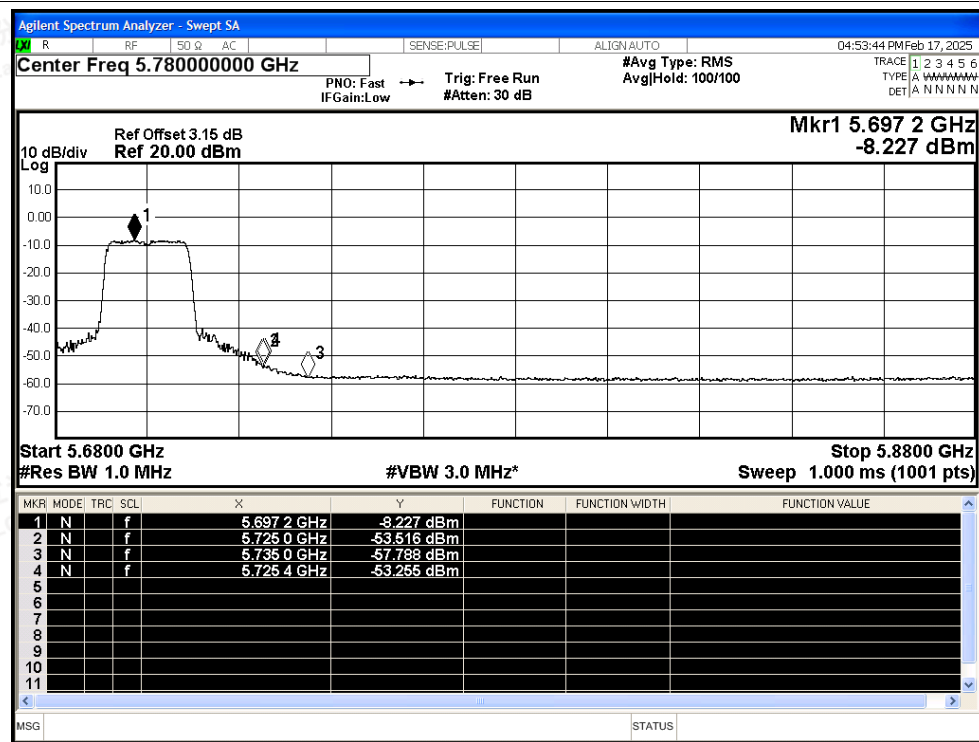

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant1 Peak

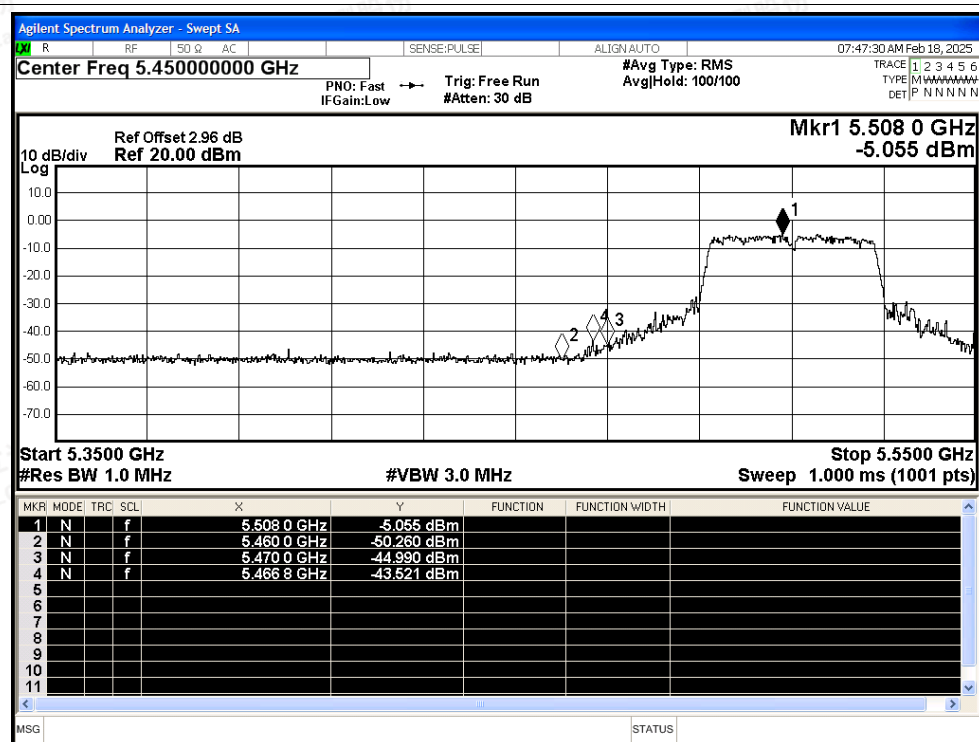

Restrict Band NVNT n40 5510MHz Ant1 Average

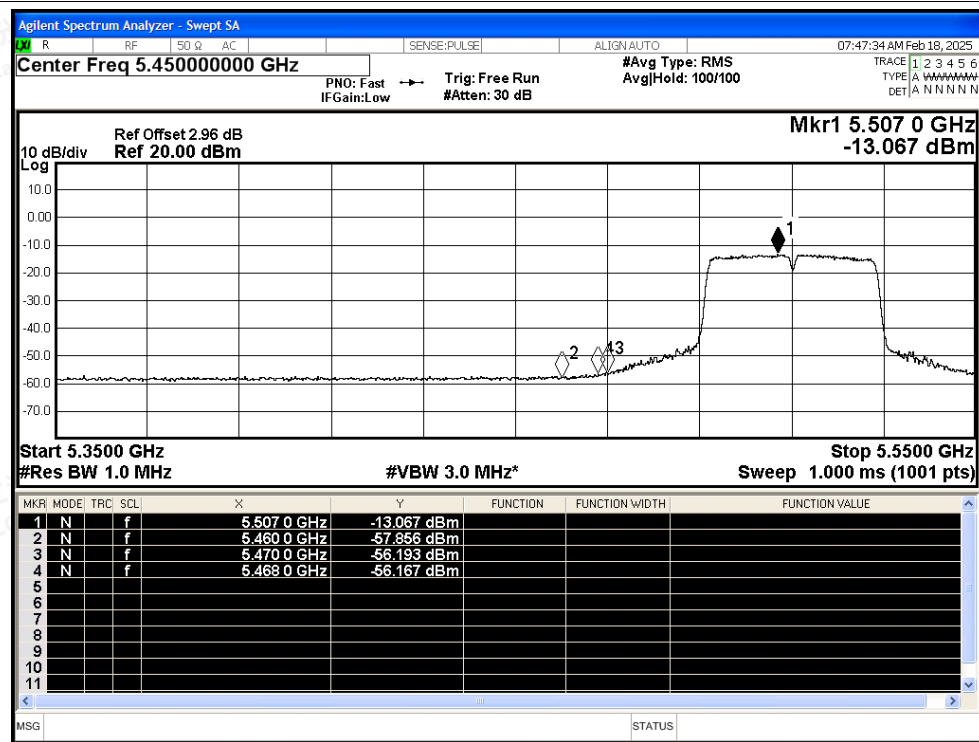

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant1 Peak

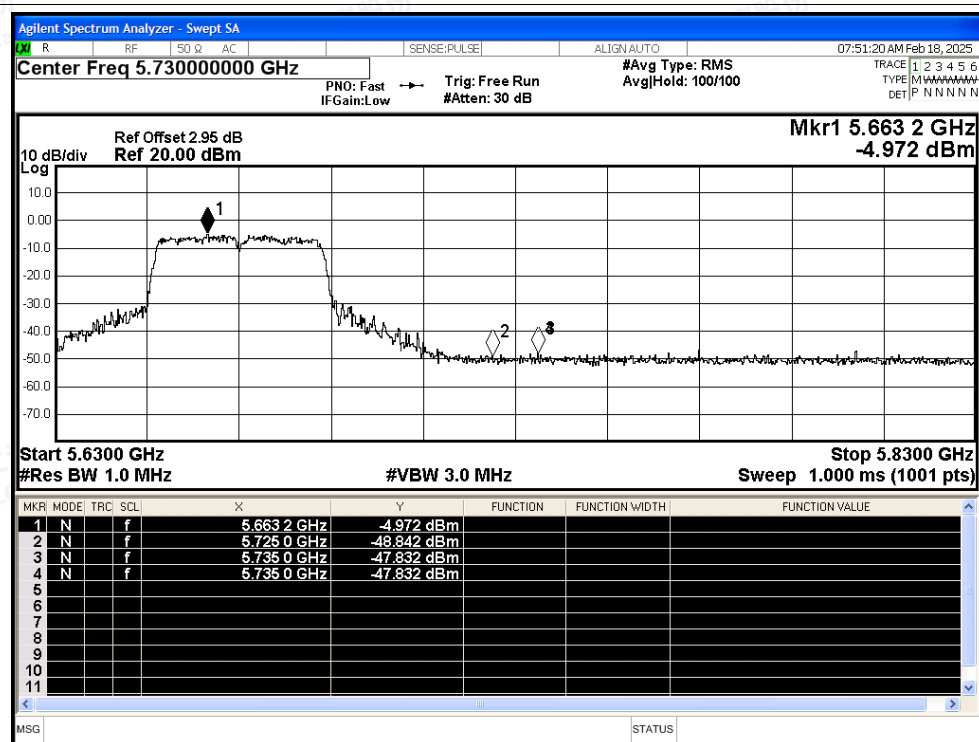

Restrict Band NVNT n40 5670MHz Ant1 Average

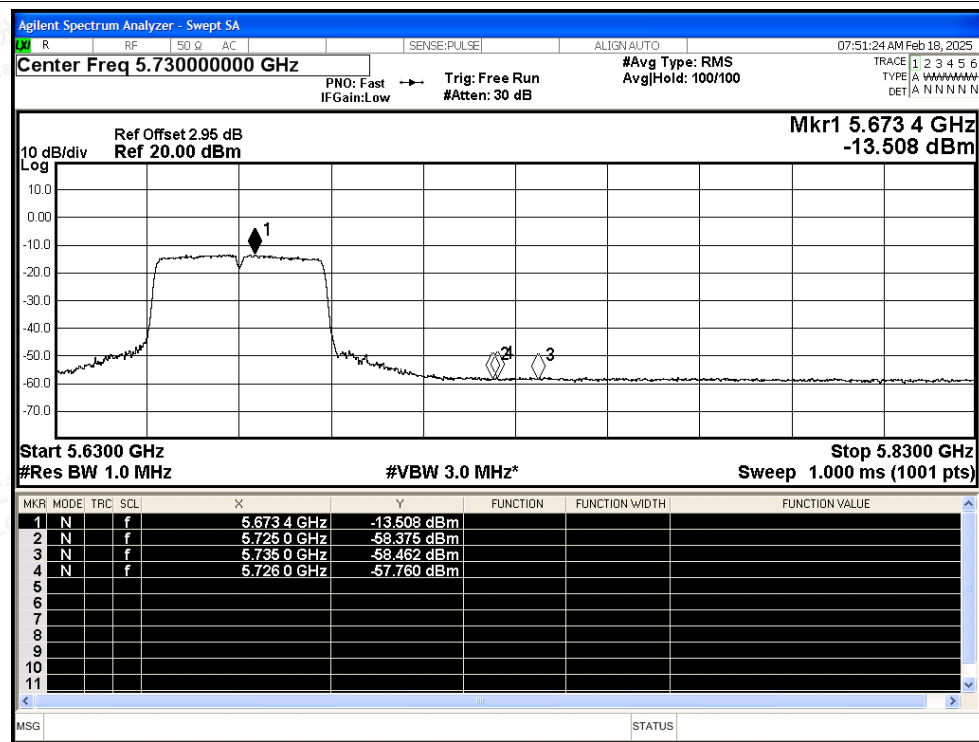

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant1 Peak

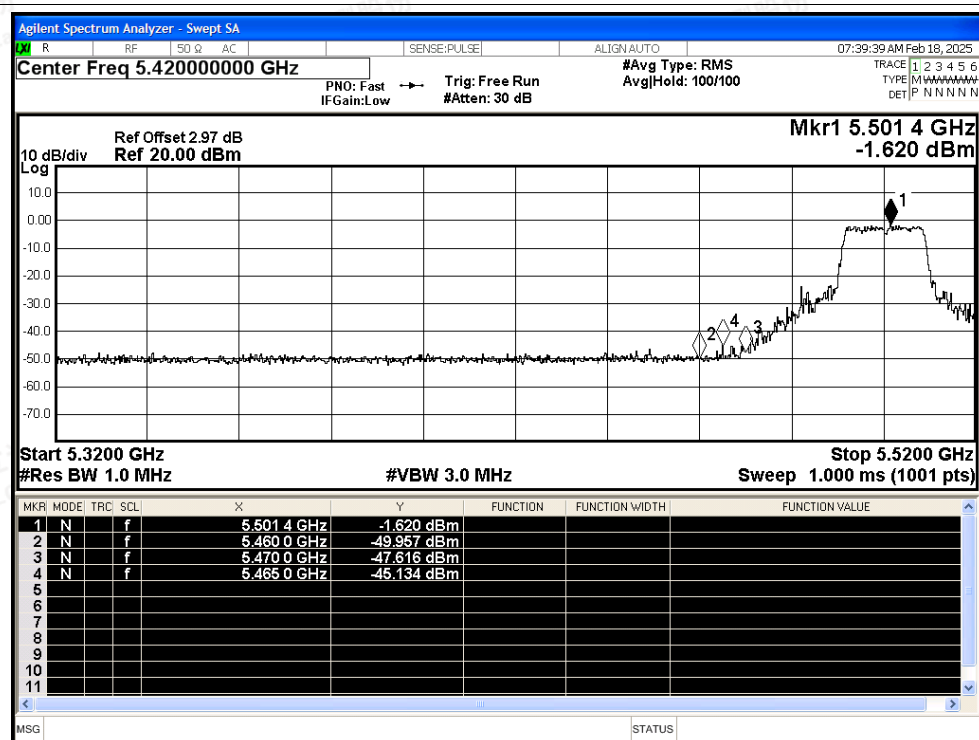

Restrict Band NVNT ac20 5500MHz Ant1 Average

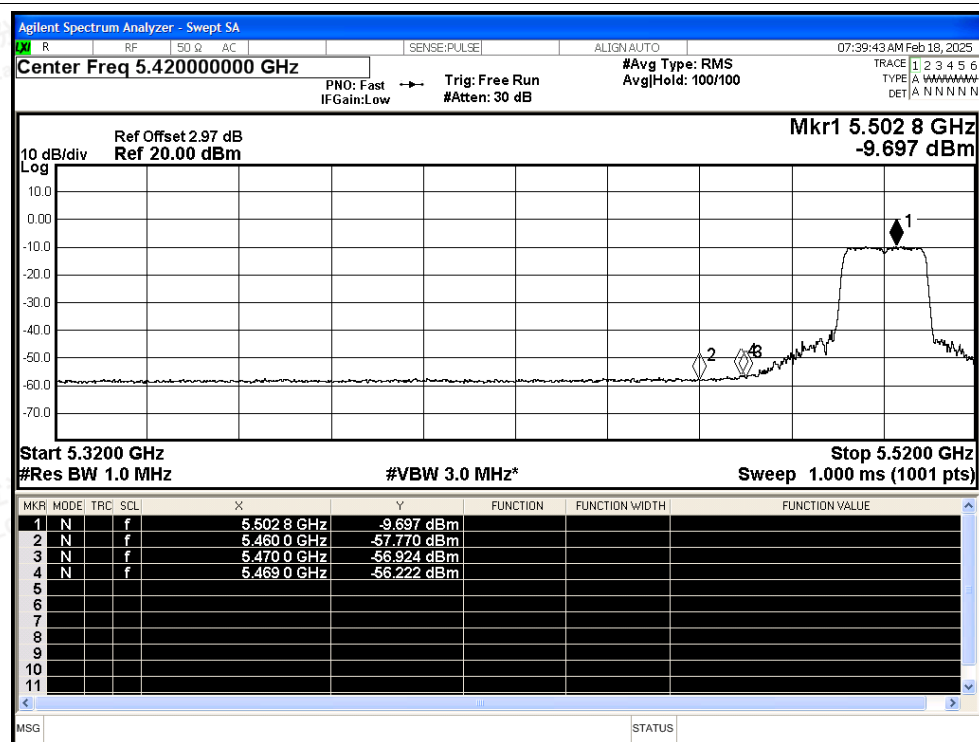

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant1 Peak

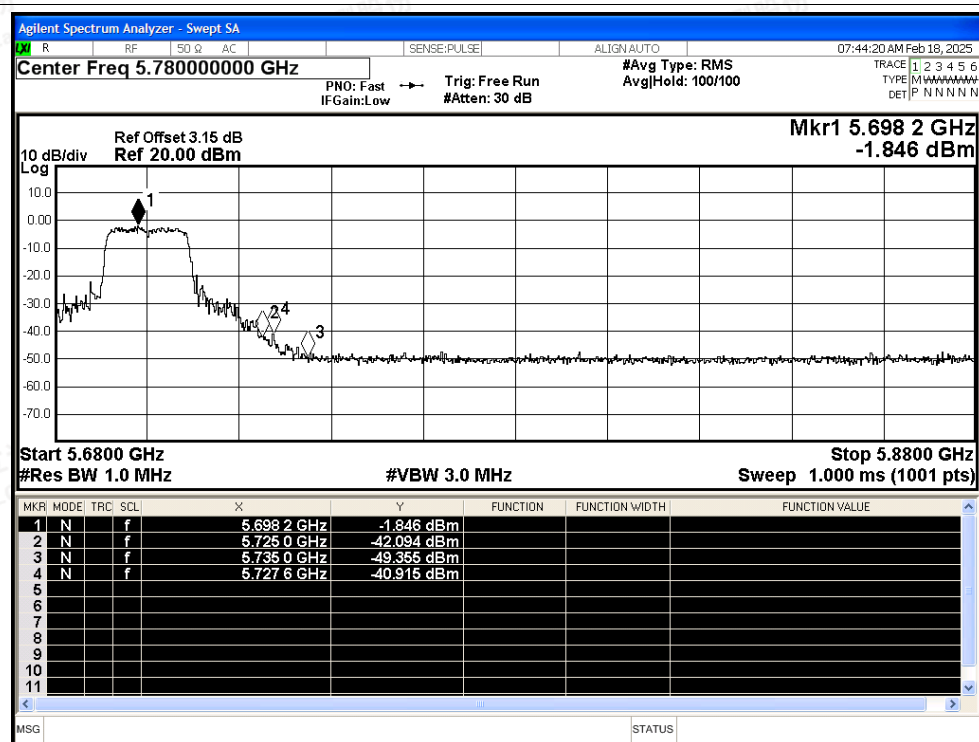

Restrict Band NVNT ac20 5700MHz Ant1 Average

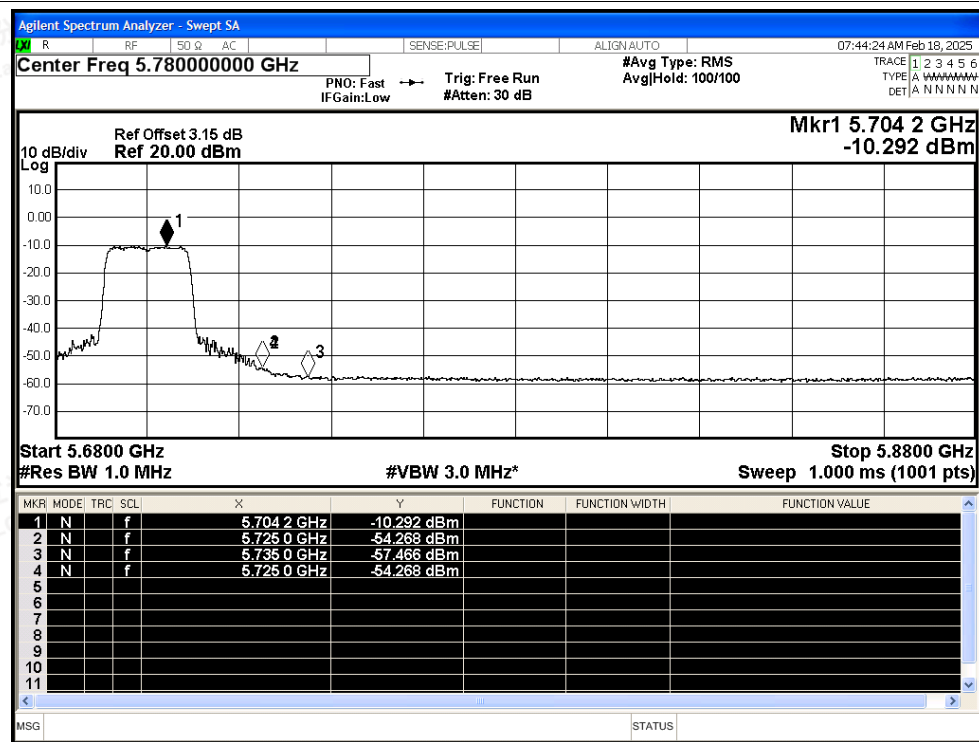

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant1 Peak

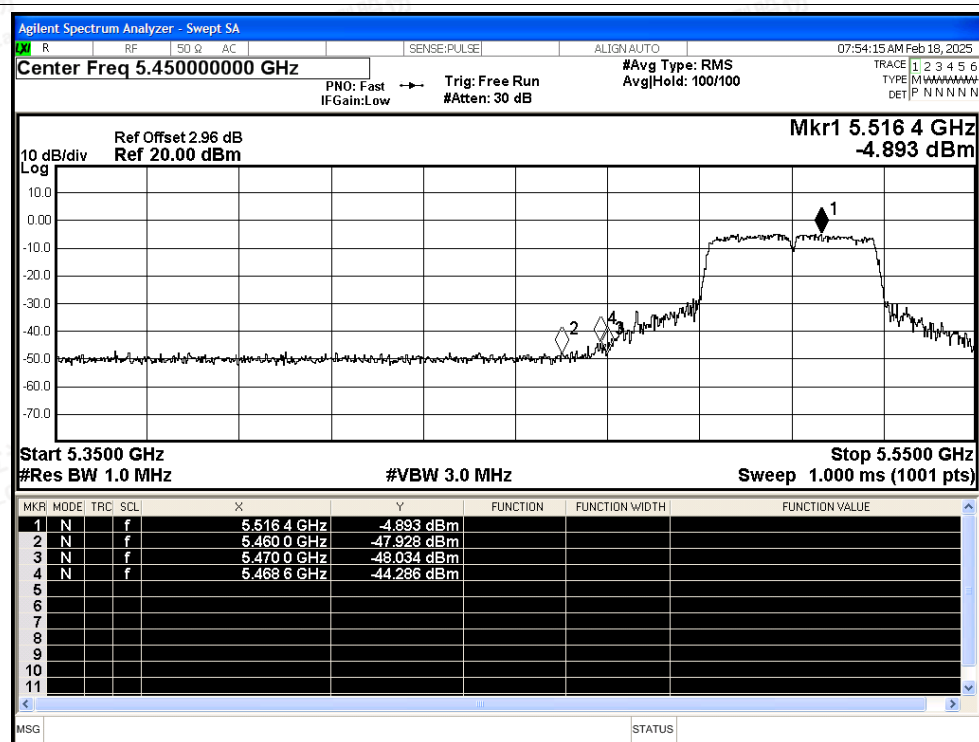

Restrict Band NVNT ac40 5510MHz Ant1 Average

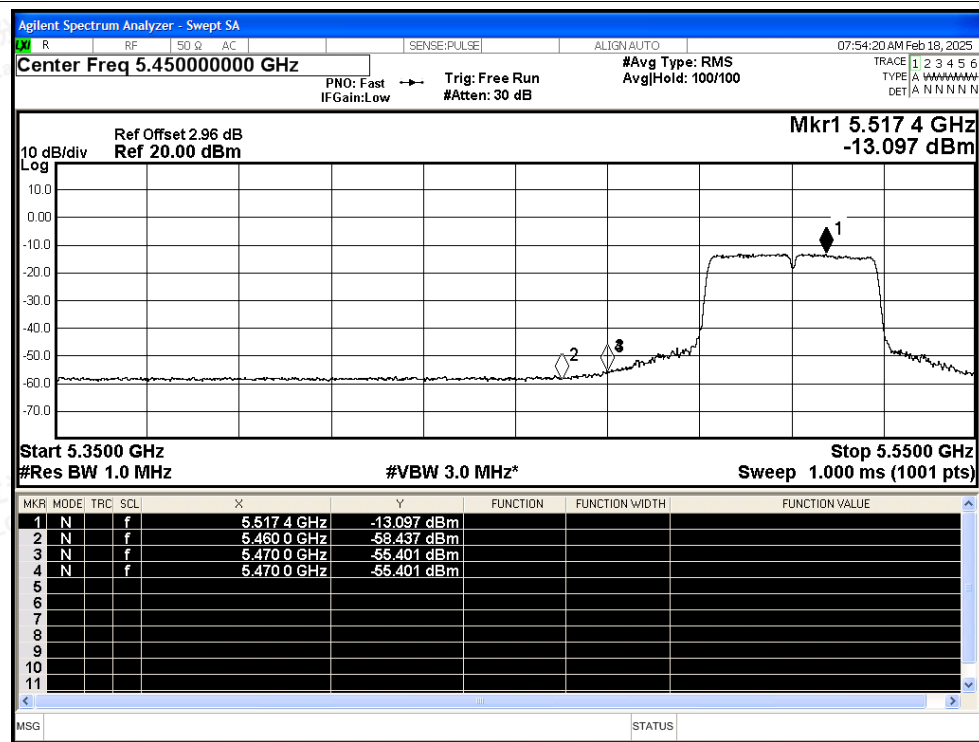

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant1 Peak

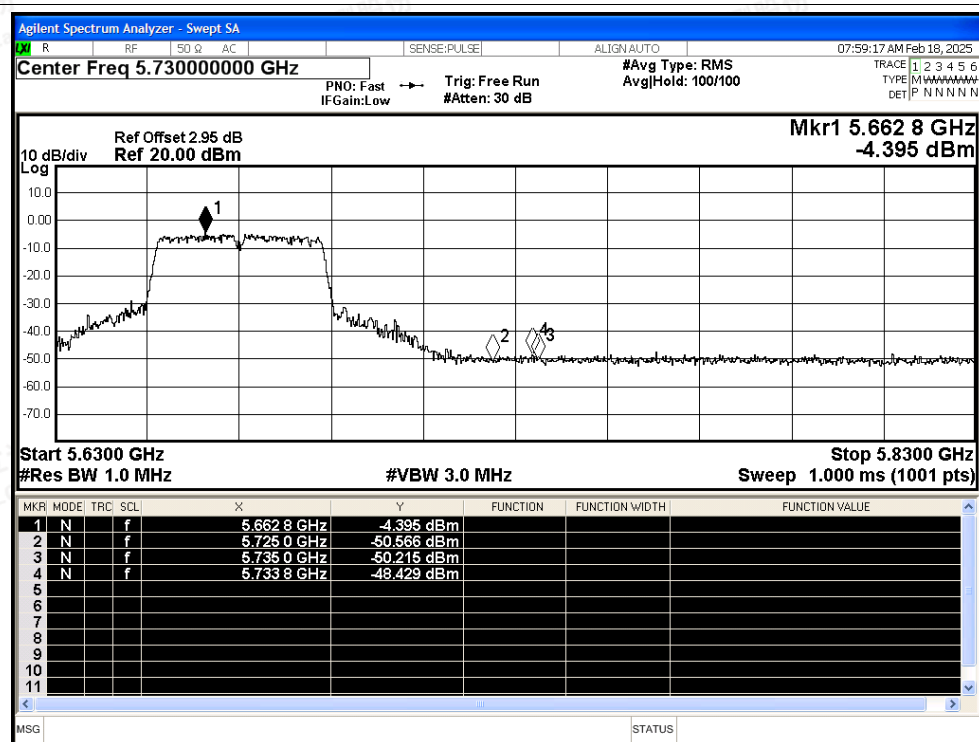

Restrict Band NVNT ac40 5670MHz Ant1 Average

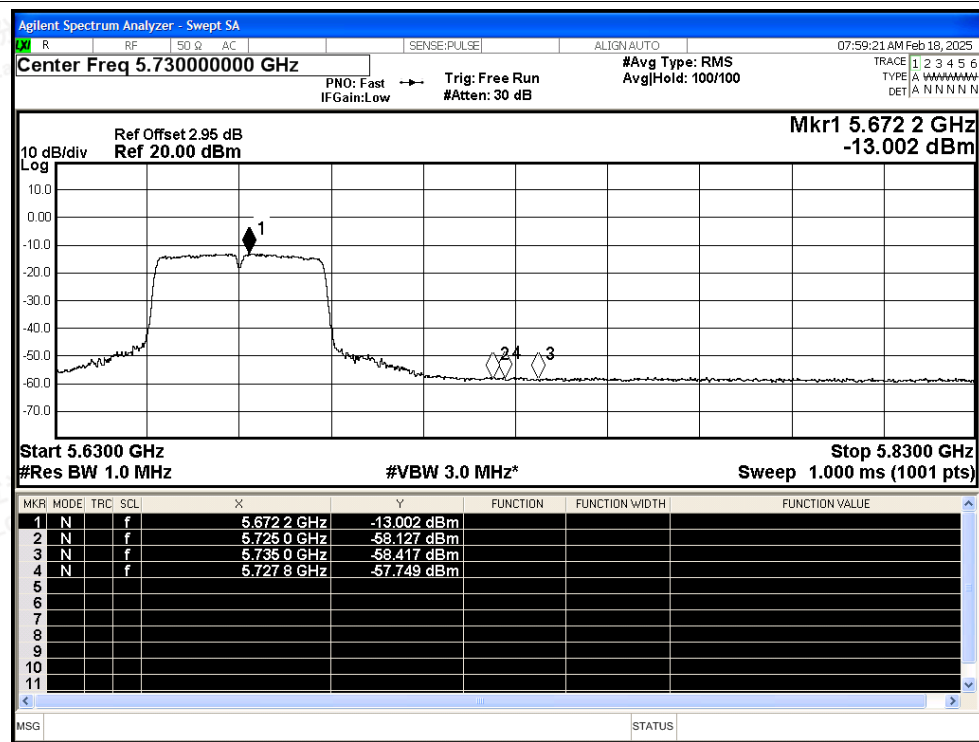

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant1 Peak

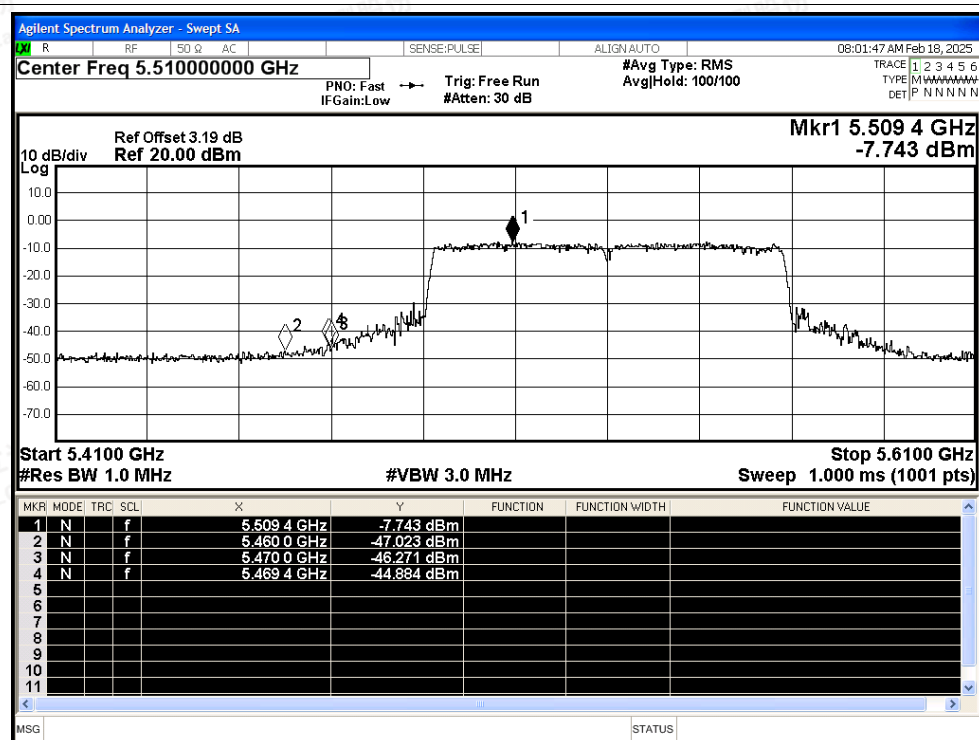

Restrict Band NVNT ac80 5530MHz Ant1 Average

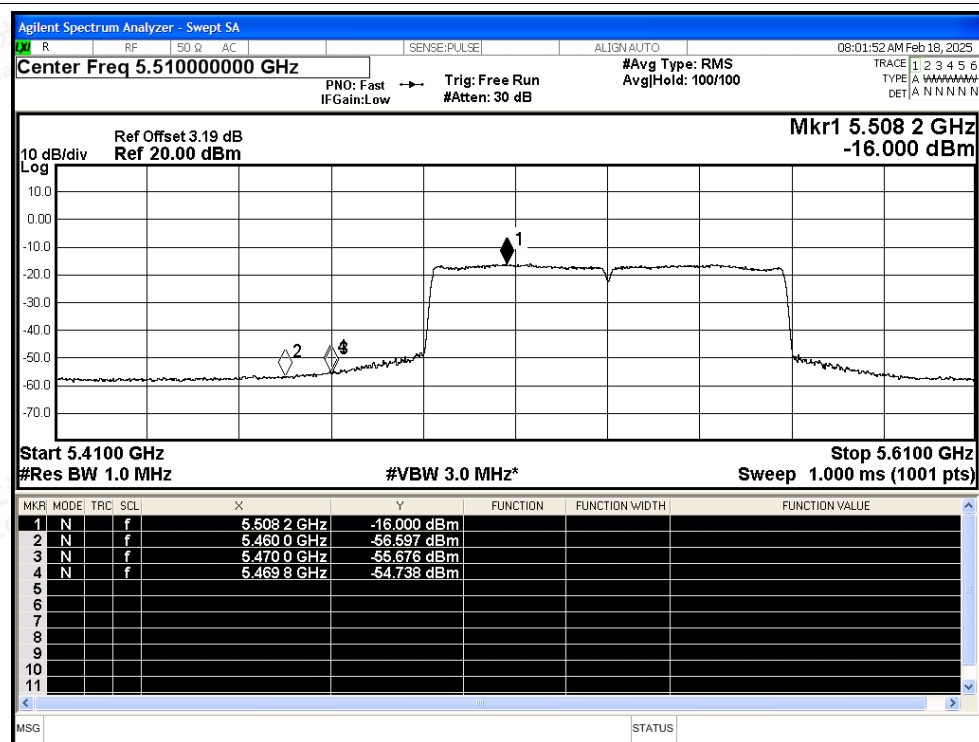

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant1 Peak

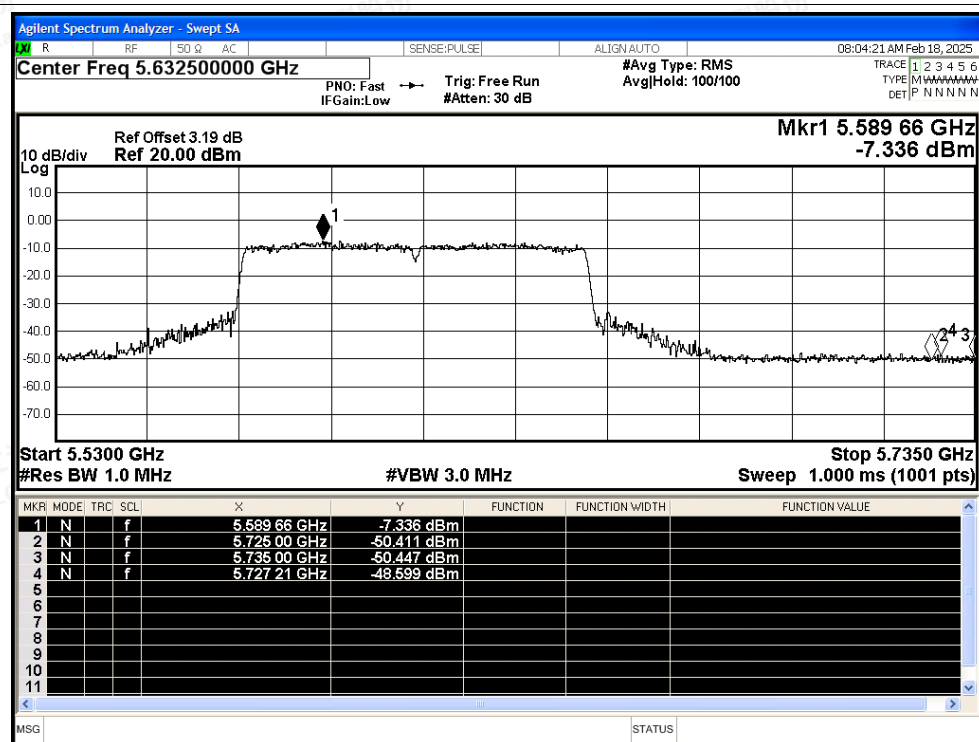

Restrict Band NVNT ac80 5610MHz Ant1 Average

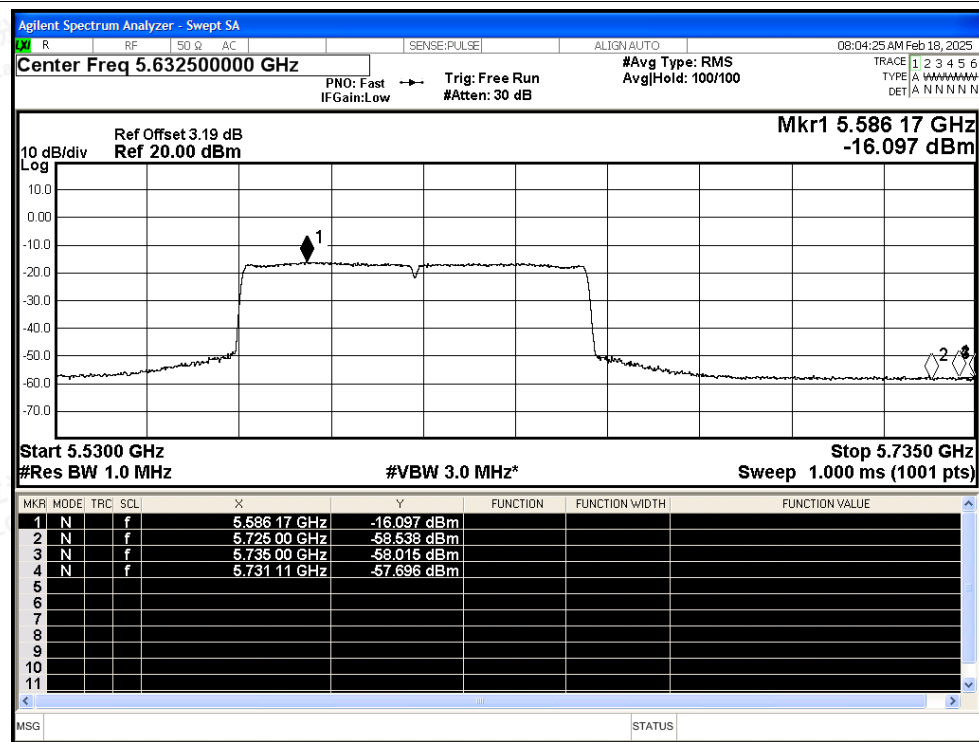

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-50.63	2.88	-	47.48	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-57.35	2.88	0.24	41.00	Average	54	Pass
NVNT	a	5500	Ant2	5469.2	-46.56	2.88	-	51.55	Peak	68.2	Pass
NVNT	a	5500	Ant2	5468.4	-56.99	2.88	0.24	41.36	Average	54	Pass
NVNT	a	5500	Ant2	5470	-48.8	2.88	-	49.31	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-57.38	2.88	0.24	40.97	Average	54	Pass
NVNT	a	5700	Ant2	5725	-46.42	2.88	-	51.69	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-56.58	2.88	0.24	41.77	Average	54	Pass
NVNT	a	5700	Ant2	5726.2	-43	2.88	-	55.11	Peak	68.2	Pass
NVNT	a	5700	Ant2	5726.6	-56.39	2.88	0.24	41.96	Average	54	Pass
NVNT	a	5700	Ant2	5735	-50.55	2.88	-	47.56	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-58.3	2.88	0.24	40.05	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-50.03	2.88	-	48.08	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-57.95	2.88	0.12	40.28	Average	54	Pass
NVNT	n20	5500	Ant2	5469.2	-45.17	2.88	-	52.94	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-56.44	2.88	0.12	41.79	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-46.99	2.88	-	51.12	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-56.44	2.88	0.12	41.79	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-43.32	2.88	-	54.79	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-55.35	2.88	0.12	42.88	Average	54	Pass
NVNT	n20	5700	Ant2	5727.2	-41.28	2.88	-	56.83	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725.2	-54.76	2.88	0.12	43.47	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-50.42	2.88	-	47.69	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-57.73	2.88	0.12	40.50	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-51.06	2.88	-	47.05	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-57.15	2.88	0.24	41.20	Average	54	Pass
NVNT	n40	5510	Ant2	5469.2	-37.76	2.88	-	60.35	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469.8	-55.43	2.88	0.24	42.92	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-43.88	2.88	-	54.23	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-55.82	2.88	0.24	42.53	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-49.97	2.88	-	48.14	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-58.36	2.88	0.24	39.99	Average	54	Pass
NVNT	n40	5670	Ant2	5727.2	-48.7	2.88	-	49.41	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5728	-57.42	2.88	0.24	40.93	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-50.29	2.88	-	47.82	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-58.09	2.88	0.24	40.26	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-47.84	2.88	-	50.27	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-57.71	2.88	0.12	40.52	Average	54	Pass
NVNT	ac20	5500	Ant2	5468.8	-45.78	2.88	-	52.33	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant2	5470	-56.49	2.88	0.12	41.74	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-46.51	2.88	-	51.60	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-56.49	2.88	0.12	41.74	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-42.73	2.88	-	55.38	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-55.52	2.88	0.12	42.71	Average	54	Pass
NVNT	ac20	5700	Ant2	5726.8	-39.74	2.88	-	58.37	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725.2	-53.68	2.88	0.12	44.55	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-49.47	2.88	-	48.64	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-57.59	2.88	0.12	40.64	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-49.27	2.88	-	48.84	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-58.44	2.88	0.24	39.91	Average	54	Pass
NVNT	ac40	5510	Ant2	5467	-41.6	2.88	-	56.51	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5467.2	-55.85	2.88	0.24	42.50	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-42.91	2.88	-	55.20	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-56.14	2.88	0.24	42.21	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-47.56	2.88	-	50.55	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-58.07	2.88	0.24	40.28	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-47.56	2.88	-	50.55	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5727.6	-57.61	2.88	0.24	40.74	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-50.75	2.88	-	47.36	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-57.95	2.88	0.24	40.40	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-48.67	2.88	-	49.44	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-57.22	2.88	0.25	41.14	Average	54	Pass
NVNT	ac80	5530	Ant2	5467.6	-42.38	2.88	-	55.73	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5469.4	-55.25	2.88	0.25	43.11	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-44.05	2.88	-	54.06	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-55.45	2.88	0.25	42.91	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-49.21	2.88	-	48.90	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-58.28	2.88	0.25	40.08	Average	54	Pass
NVNT	ac80	5610	Ant2	5729.875	-47.84	2.88	-	50.27	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5731.925	-57.37	2.88	0.25	40.99	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-49.54	2.88	-	48.57	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-58.24	2.88	0.25	40.12	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant2 Peak

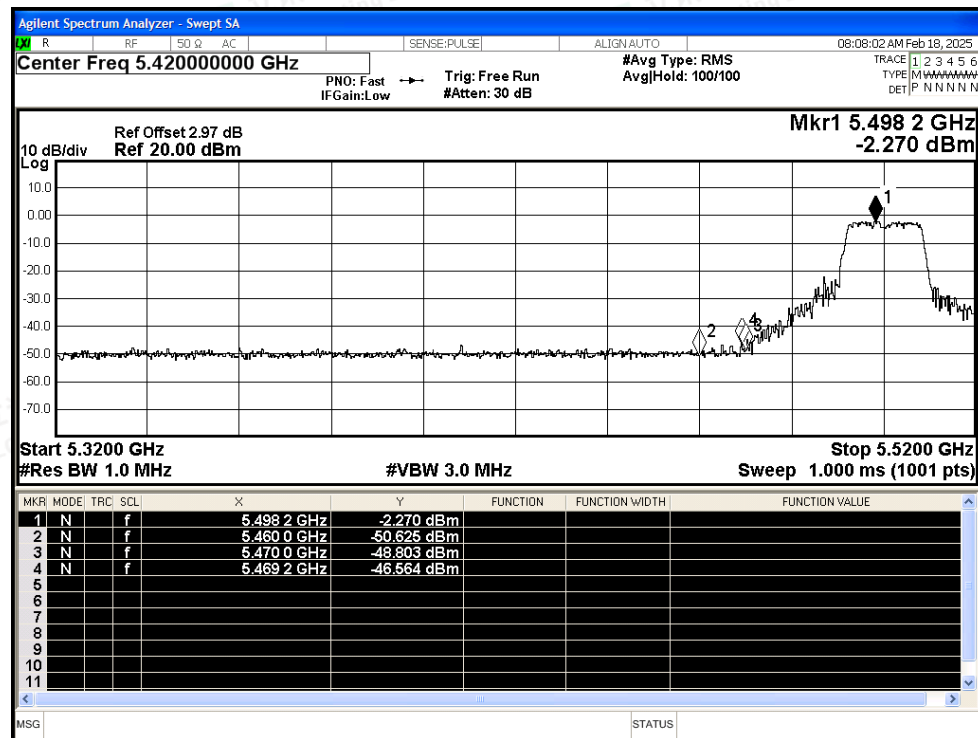

Restrict Band NVNT a 5500MHz Ant2 Average

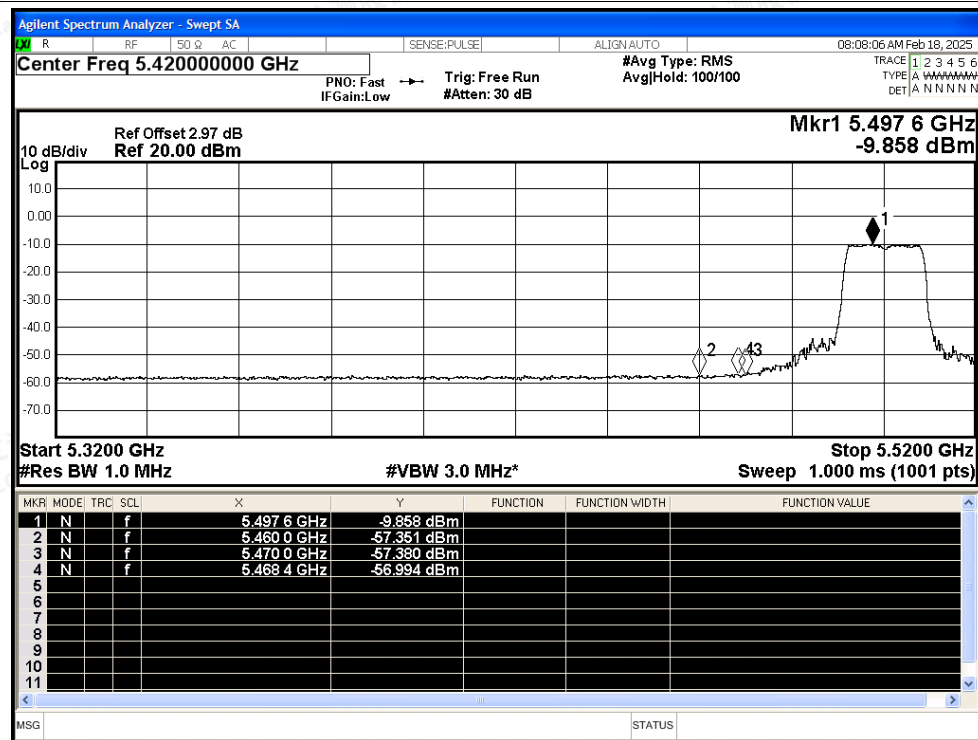

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant2 Peak

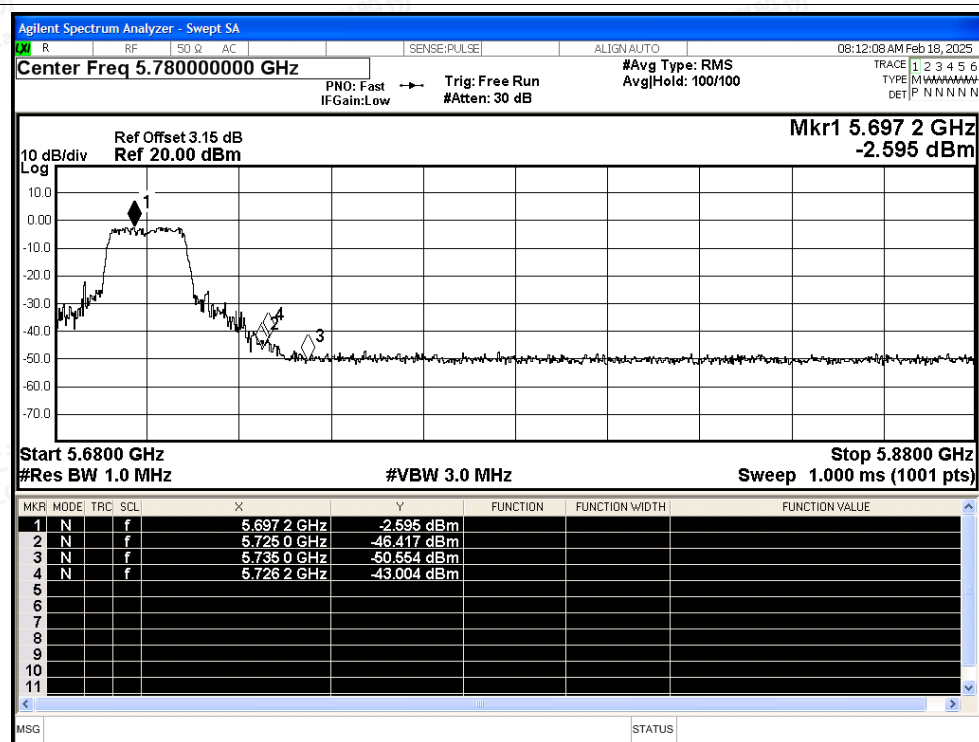

Restrict Band NVNT a 5700MHz Ant2 Average

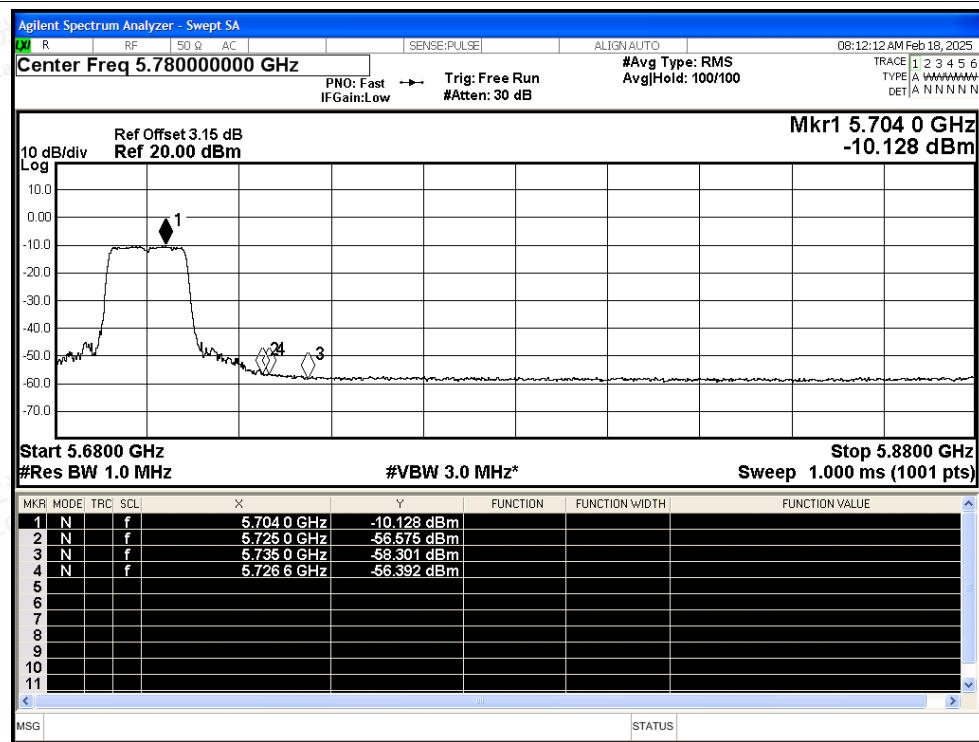

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant2 Peak

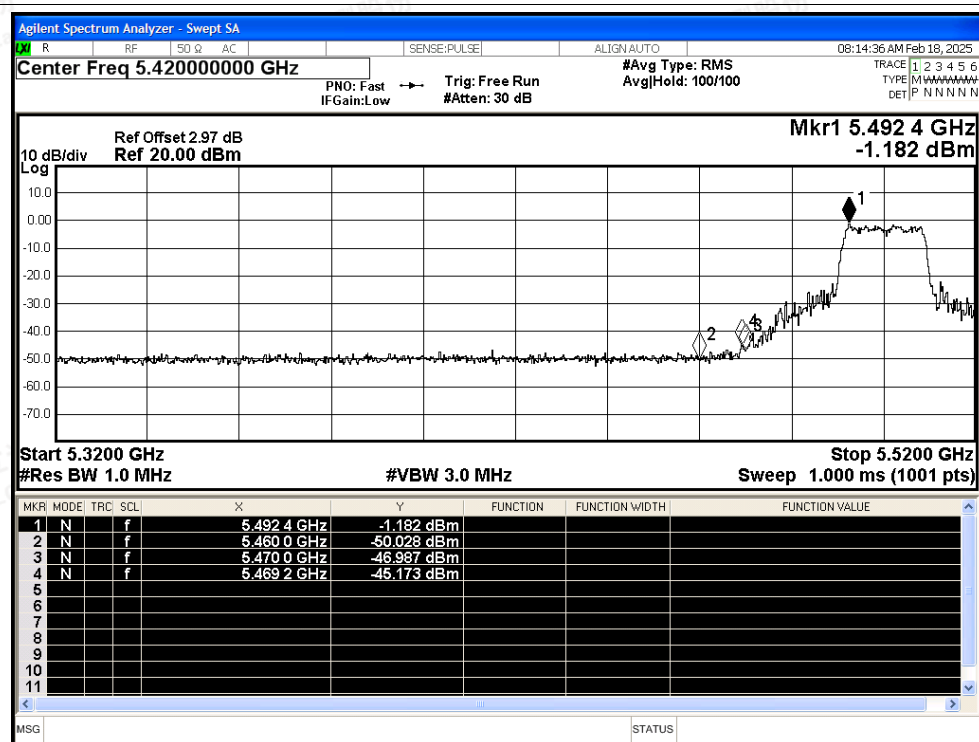

Restrict Band NVNT n20 5500MHz Ant2 Average

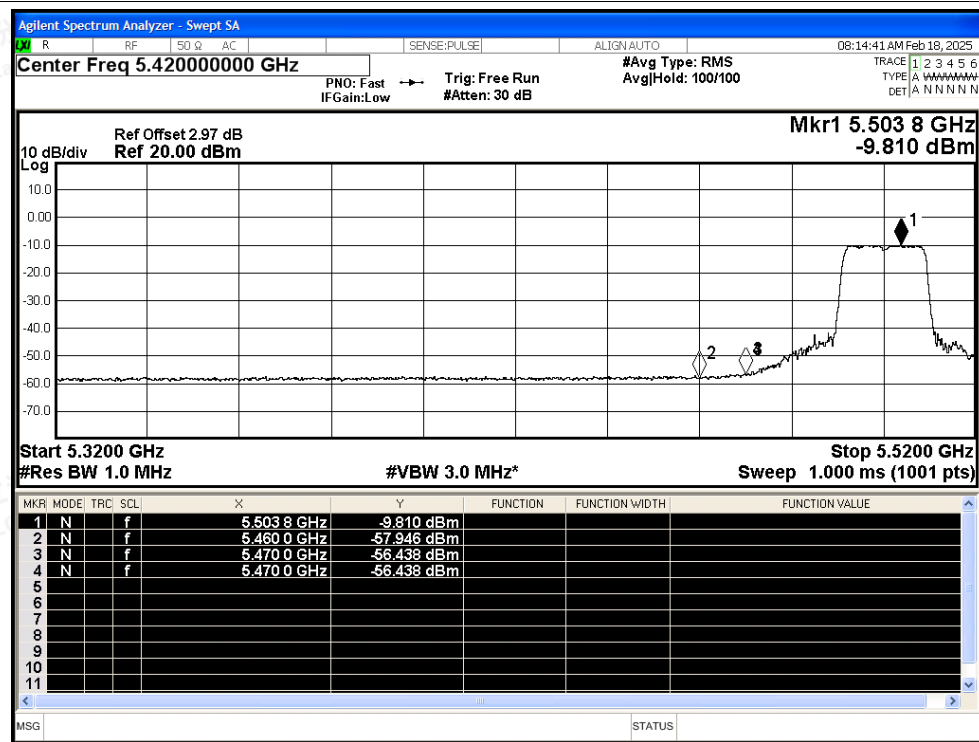

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant2 Peak

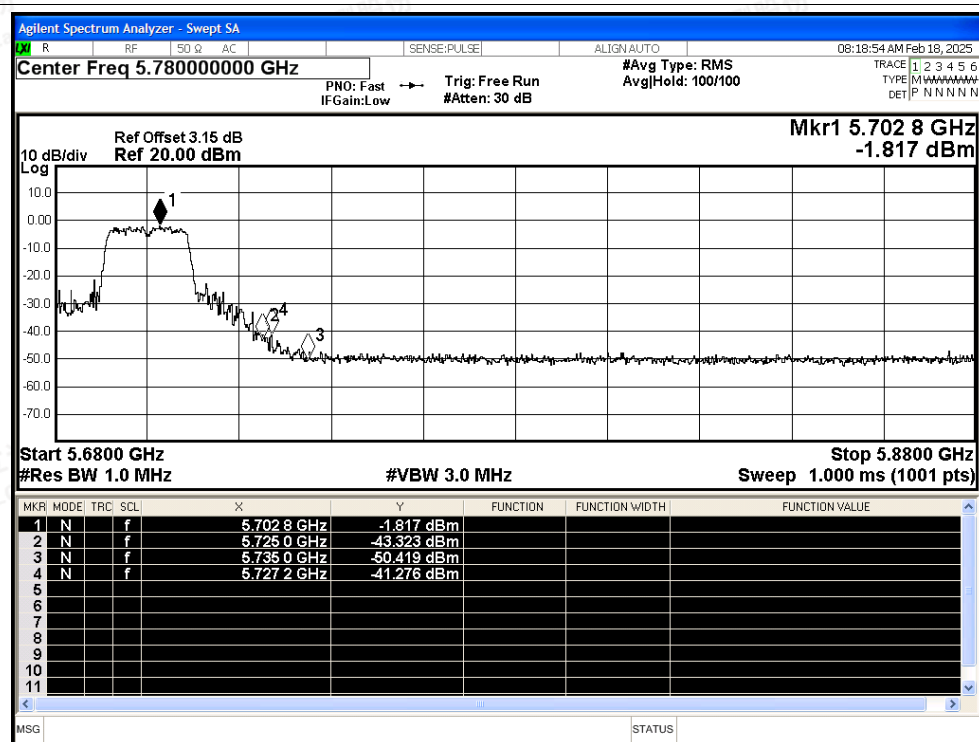

Restrict Band NVNT n20 5700MHz Ant2 Average

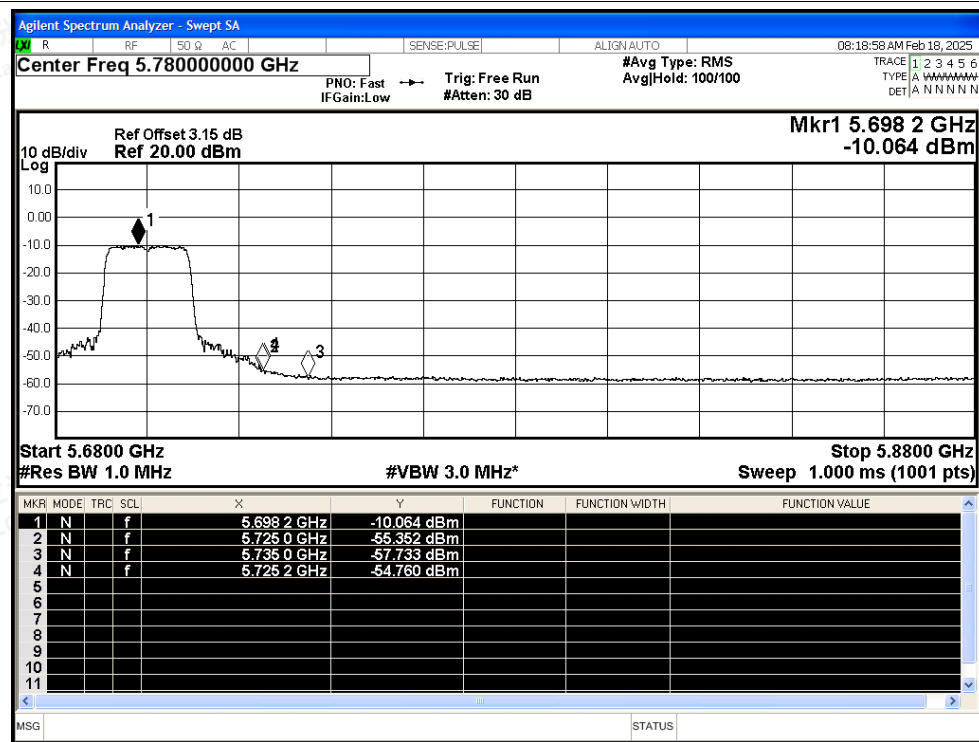

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant2 Peak

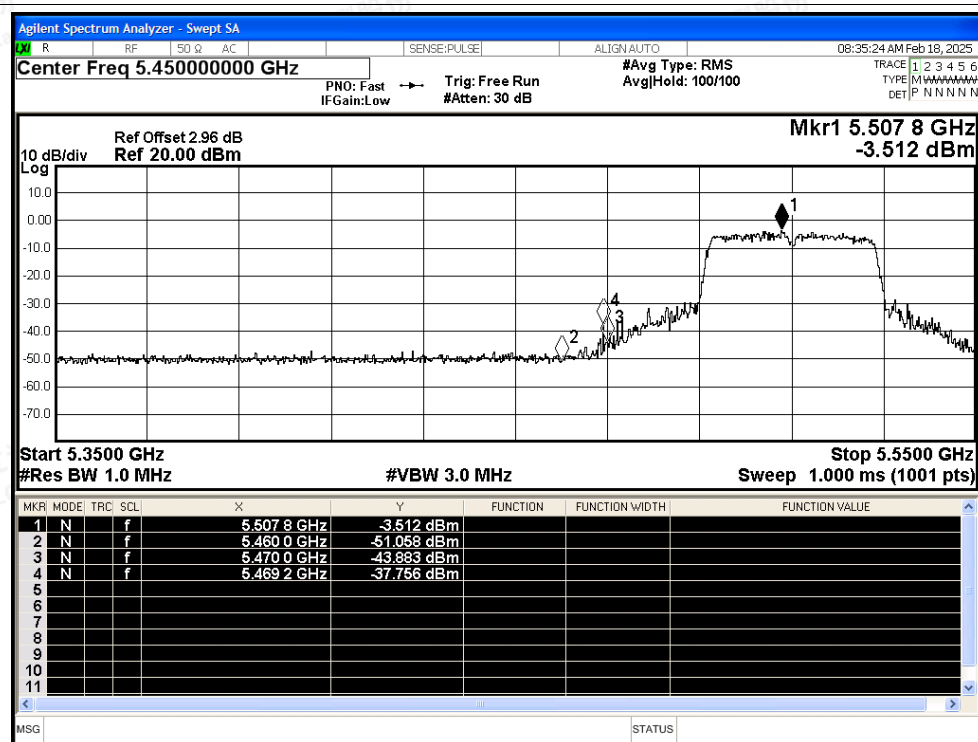

Restrict Band NVNT n40 5510MHz Ant2 Average

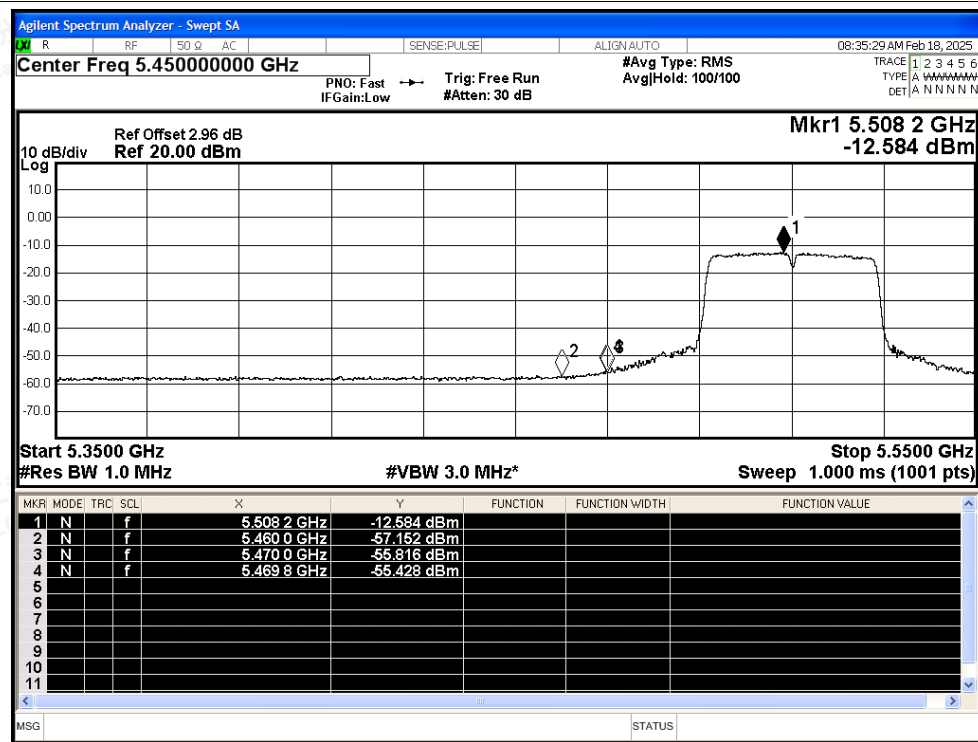

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant2 Peak

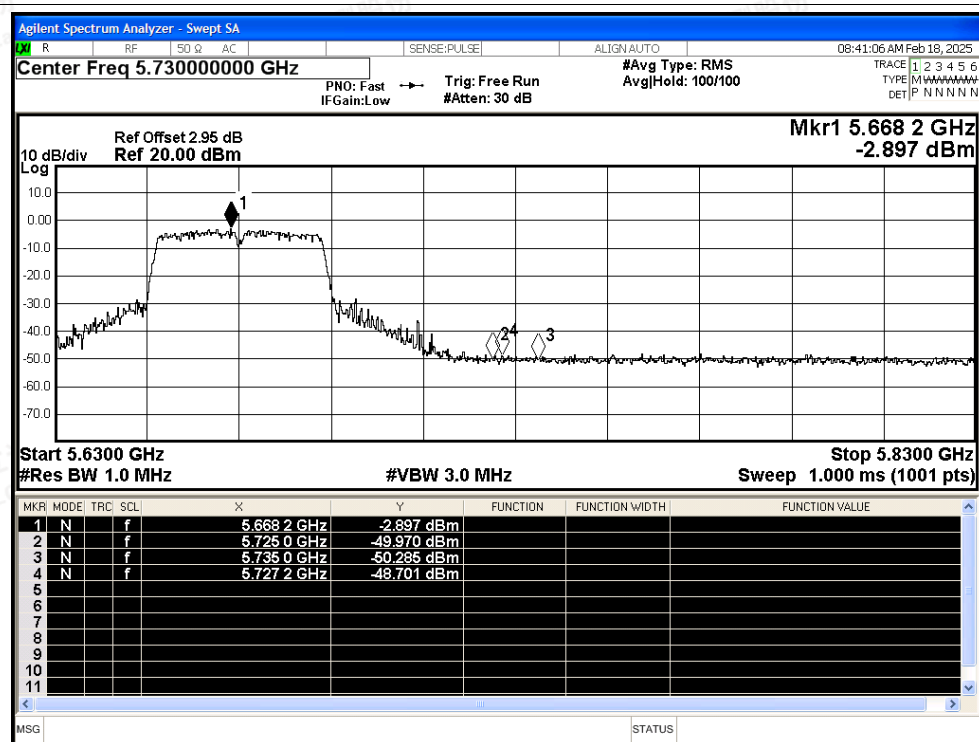

Restrict Band NVNT n40 5670MHz Ant2 Average

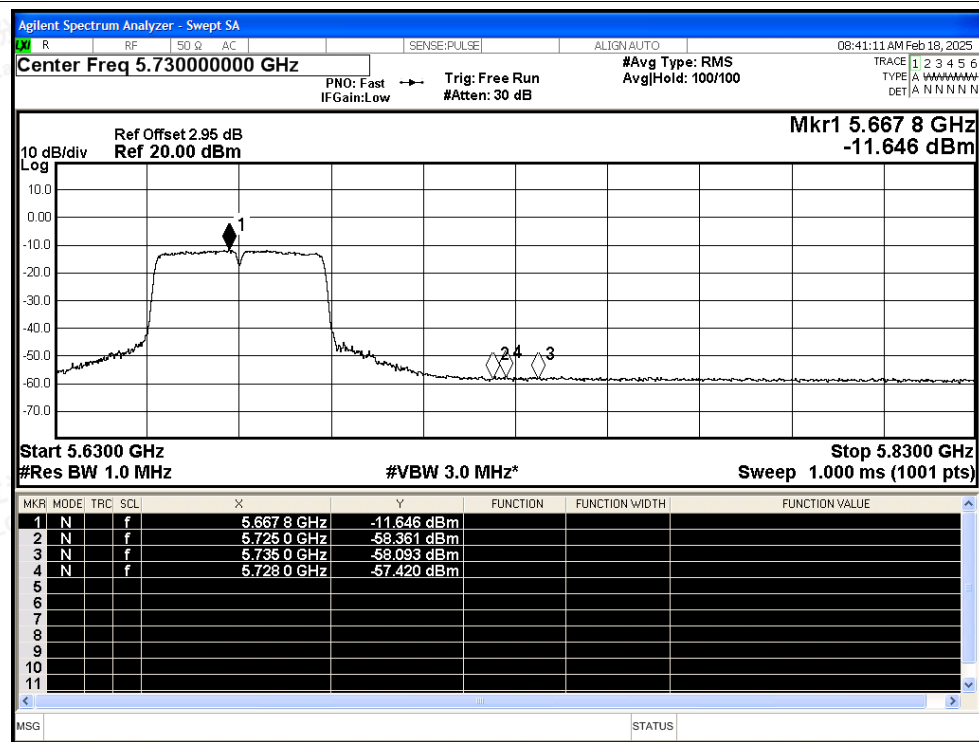

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant2 Peak

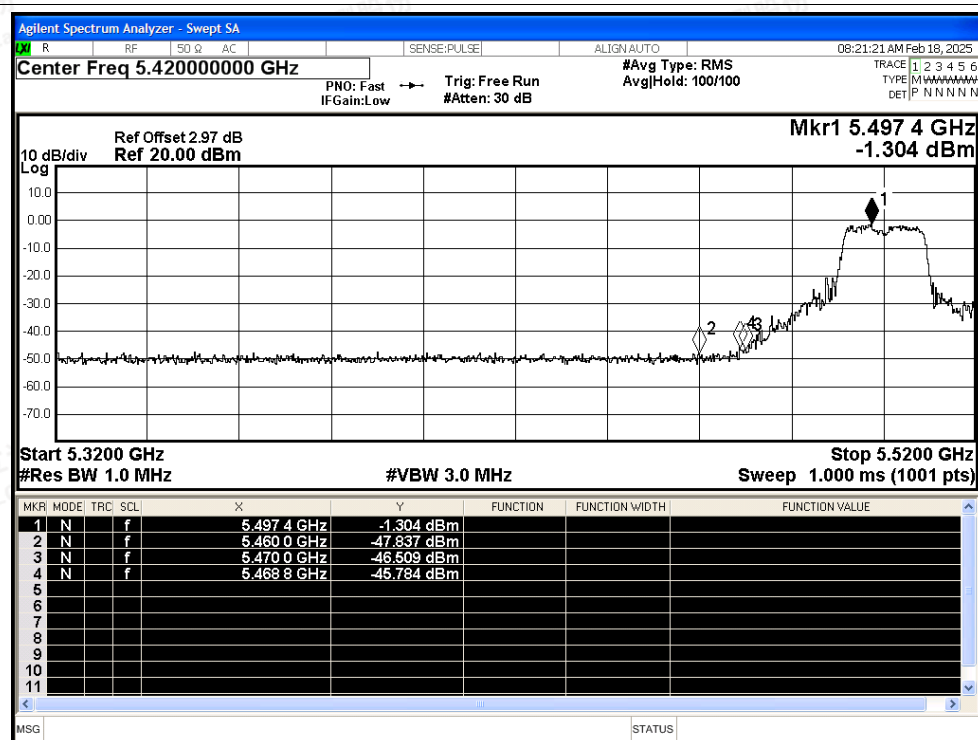

Restrict Band NVNT ac20 5500MHz Ant2 Average

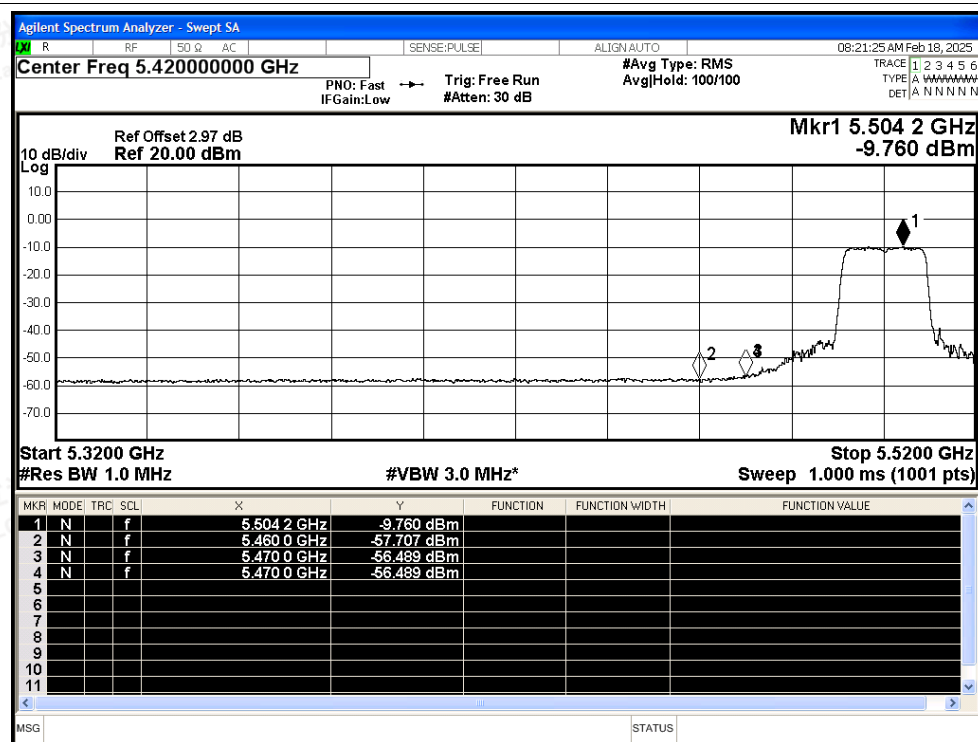

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant2 Peak

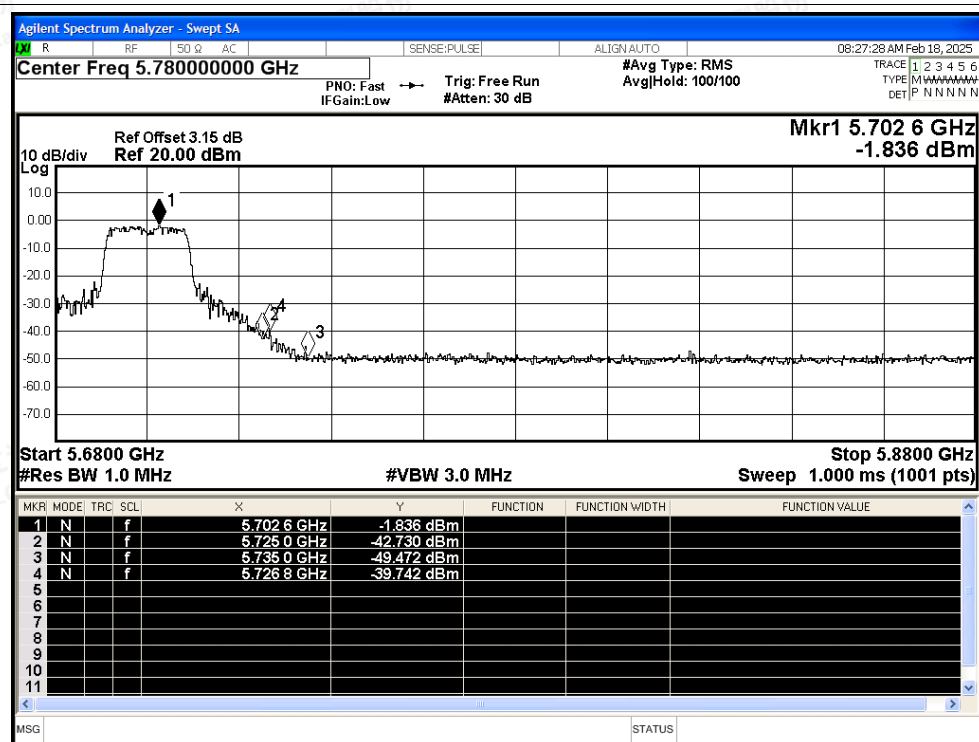

Restrict Band NVNT ac20 5700MHz Ant2 Average

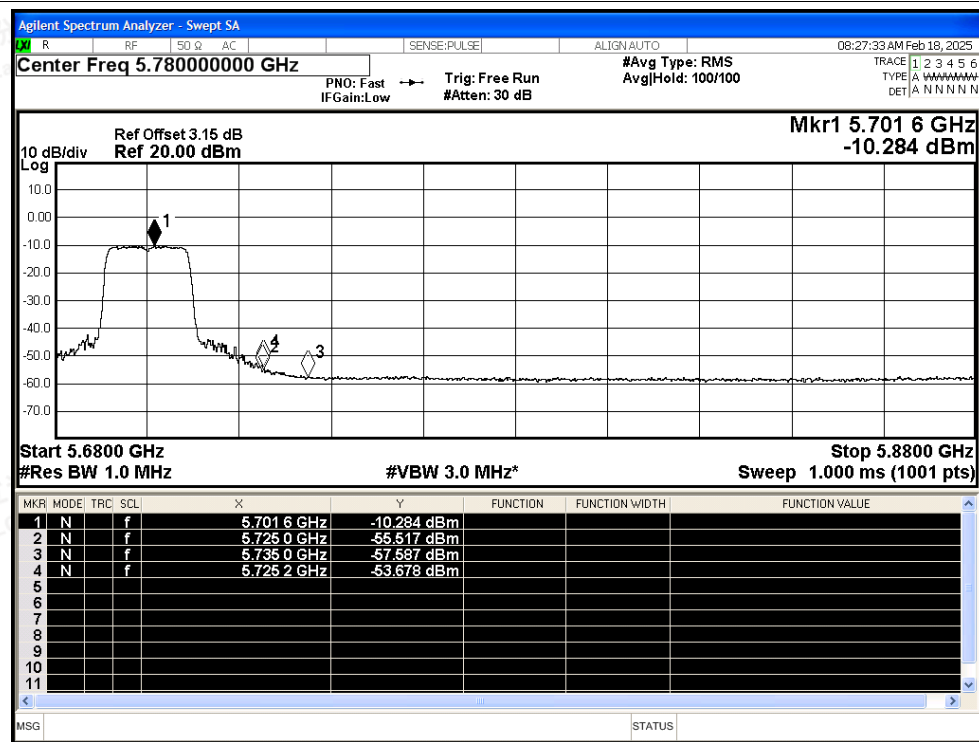

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant2 Peak

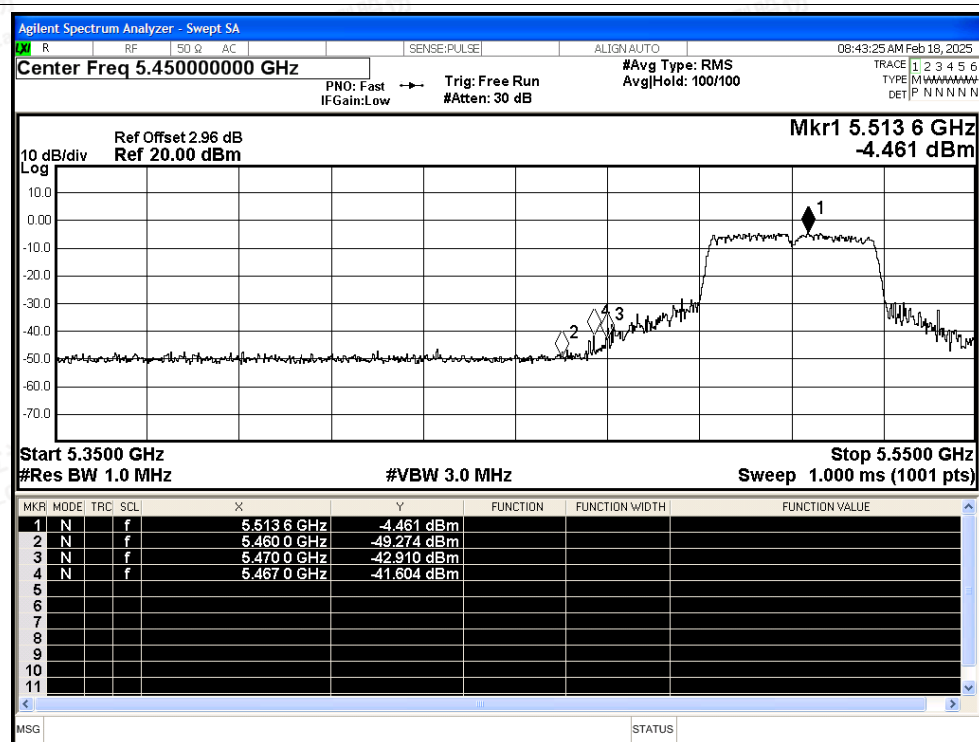

Restrict Band NVNT ac40 5510MHz Ant2 Average

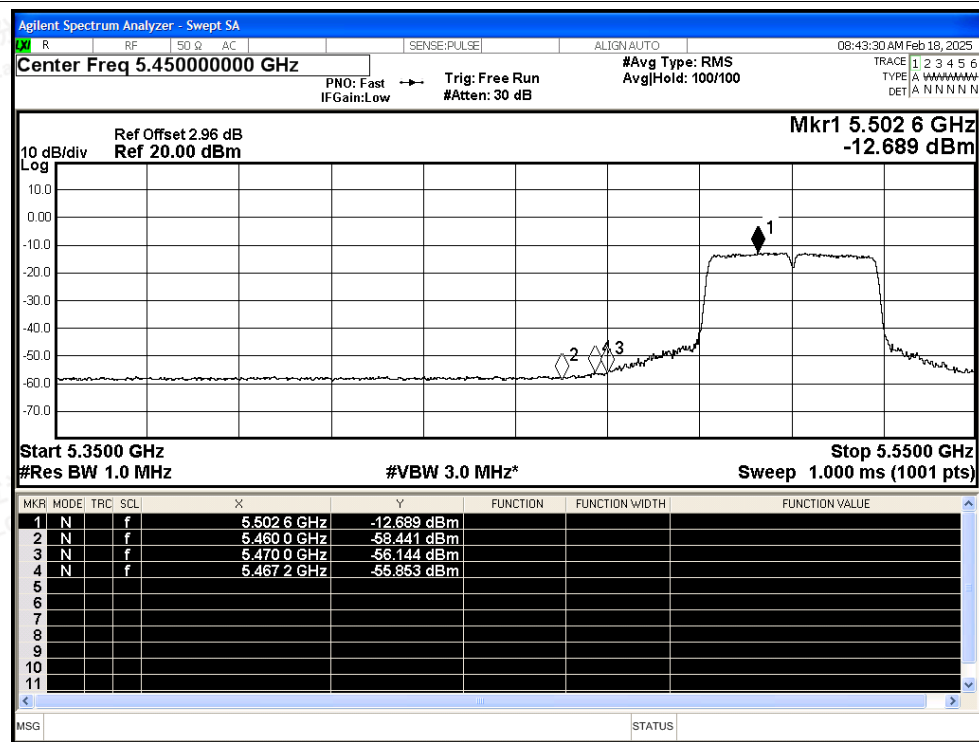

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant2 Peak

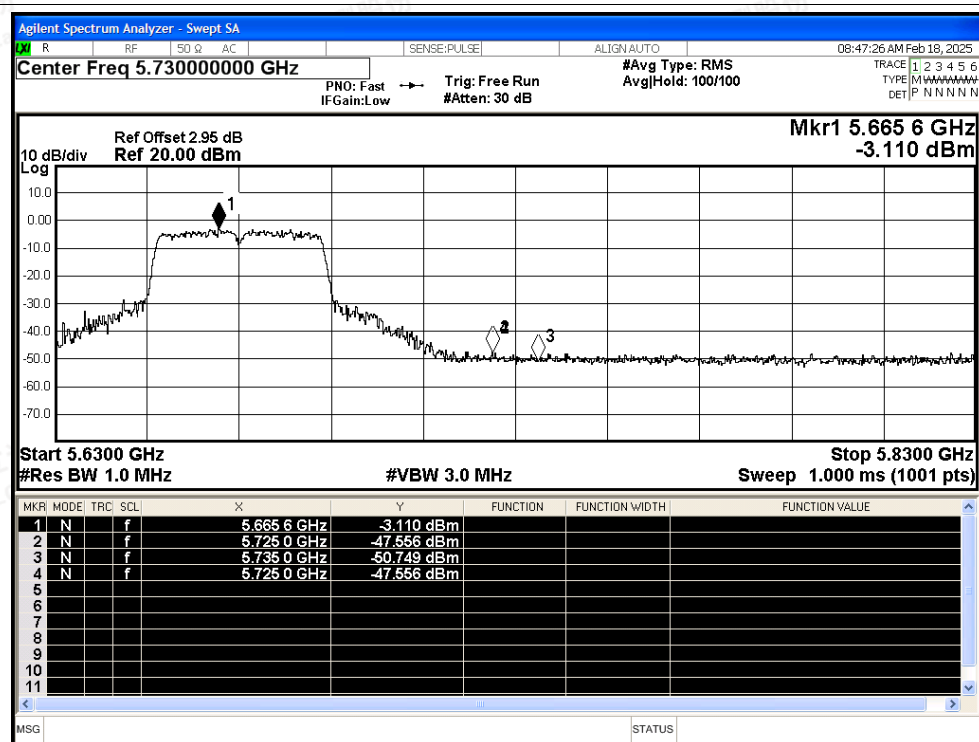

Restrict Band NVNT ac40 5670MHz Ant2 Average

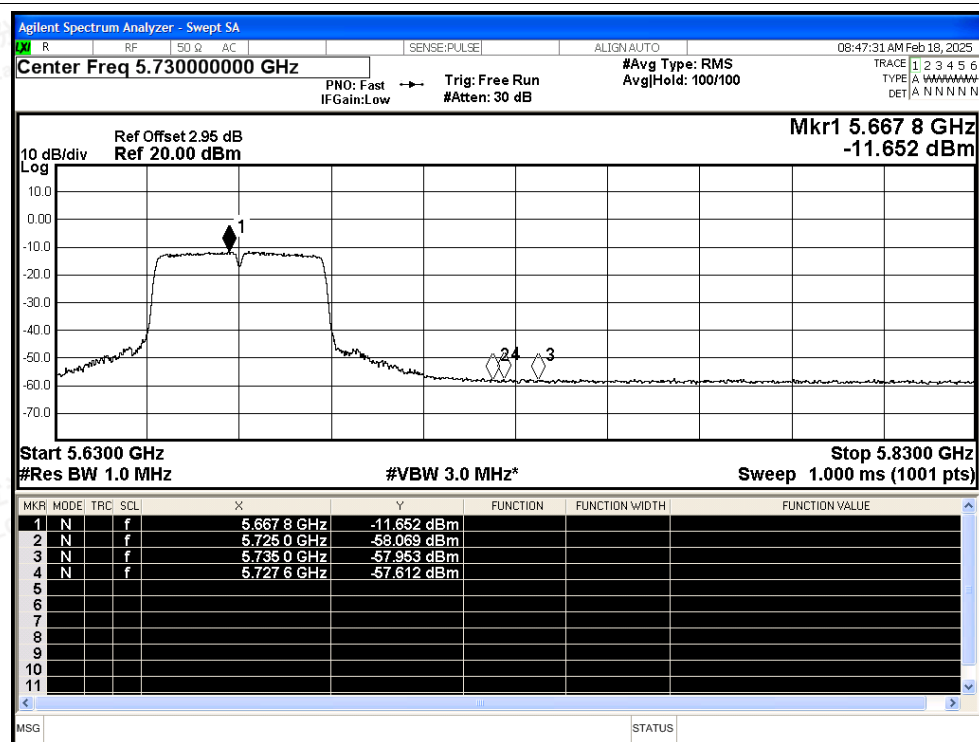

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant2 Peak

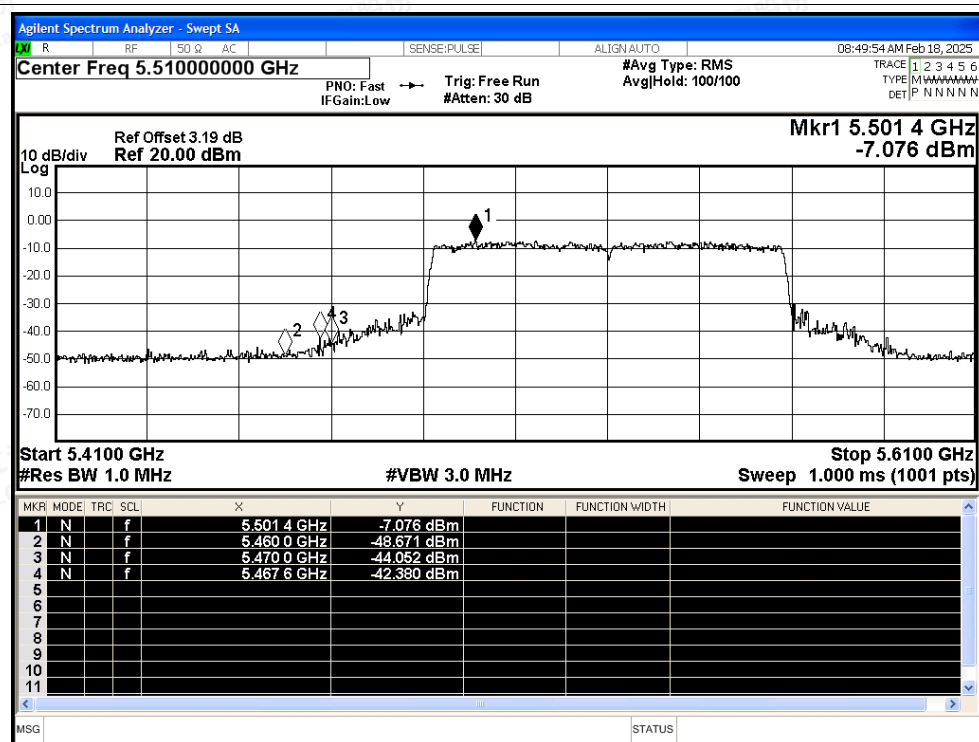

Restrict Band NVNT ac80 5530MHz Ant2 Average

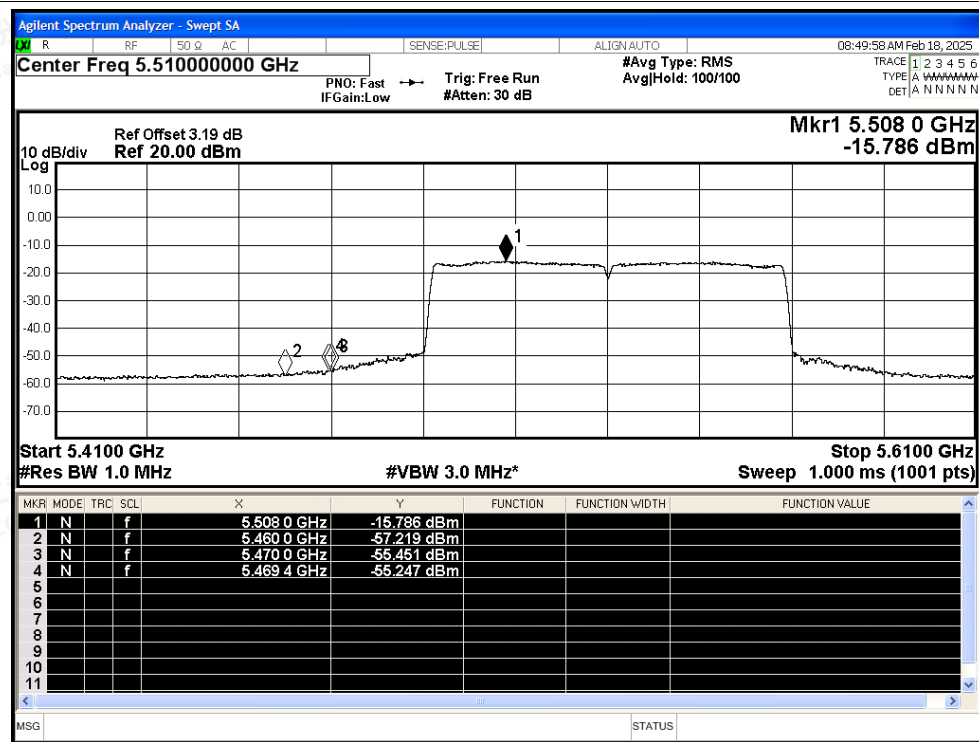

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant2 Peak

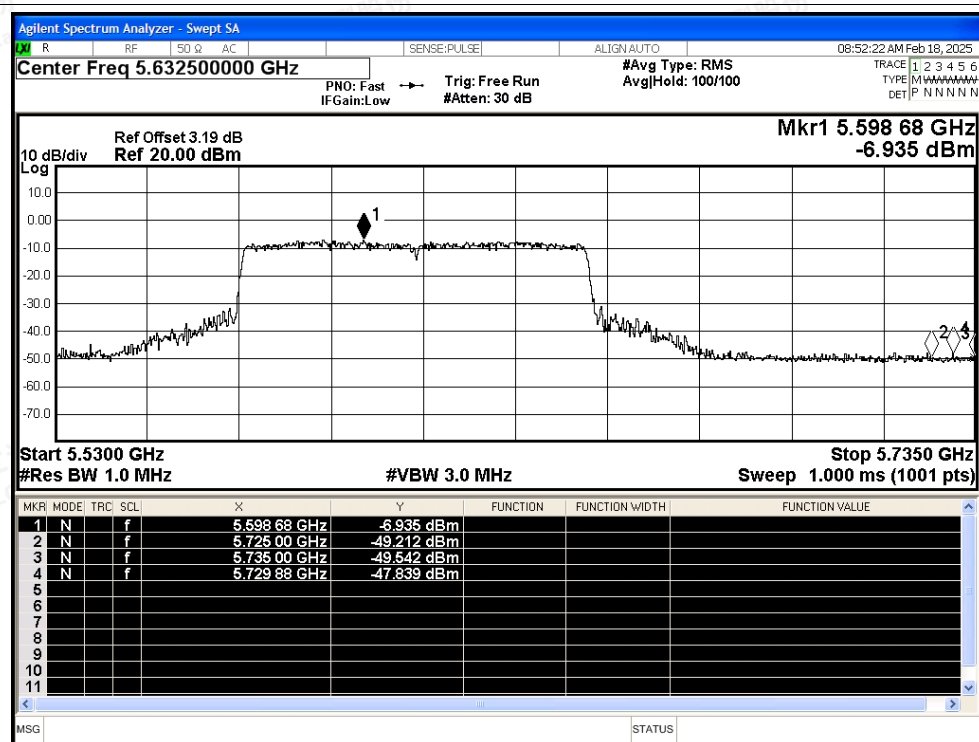

Restrict Band NVNT ac80 5610MHz Ant2 Average

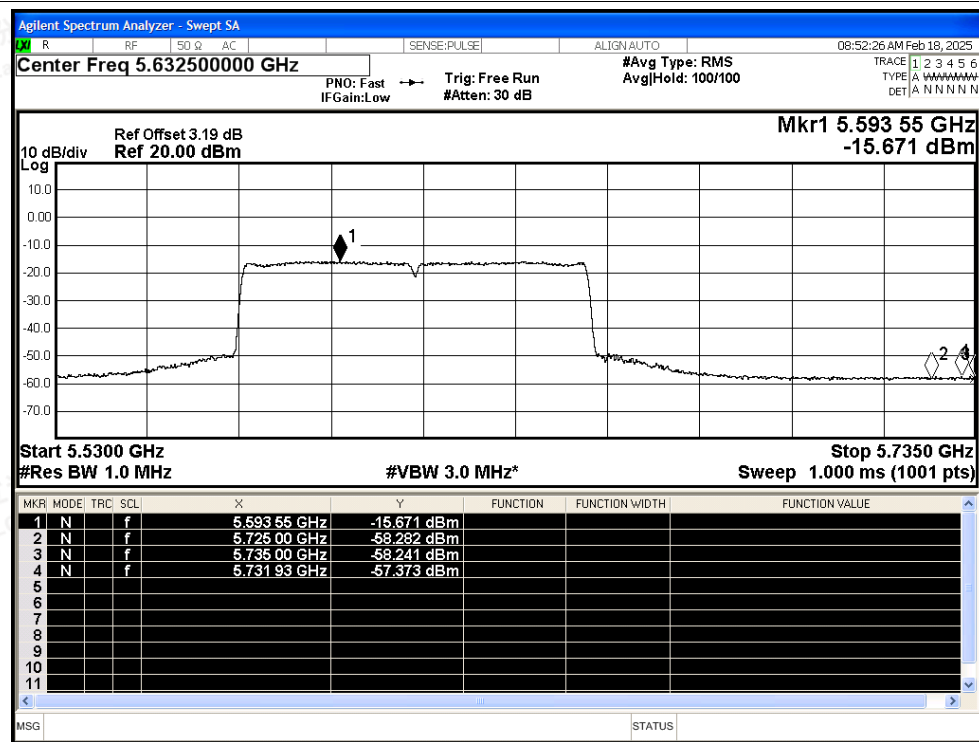

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-50.64	-50.03	6.00	53.91	Peak	68.2	Pass
NVNT	n20	5500	5460	-57.61	-57.95	6.00	46.46	Average	54	Pass
NVNT	n20	5500	5469.2	-44.46	-45.17	6.00	59.44	Peak	68.2	Pass
NVNT	n20	5500	5470	-55.76	-56.44	6.00	48.15	Average	54	Pass
NVNT	n20	5500	5470	-46.61	-46.99	6.00	57.44	Peak	68.2	Pass
NVNT	n20	5500	5470	-55.76	-56.44	6.00	48.15	Average	54	Pass
NVNT	n20	5700	5725	-40.64	-43.32	6.00	62.46	Peak	68.2	Pass
NVNT	n20	5700	5725	-53.52	-55.35	6.00	49.90	Average	54	Pass
NVNT	n20	5700	5725.8	-38.78	-41.28	6.00	64.39	Peak	68.2	Pass
NVNT	n20	5700	5725.4	-53.26	-54.76	6.00	50.29	Average	54	Pass
NVNT	n20	5700	5735	-47.34	-50.42	6.00	55.63	Peak	68.2	Pass
NVNT	n20	5700	5735	-57.79	-57.73	6.00	46.48	Average	54	Pass
NVNT	n40	5510	5460	-50.26	-51.06	6.00	53.60	Peak	68.2	Pass
NVNT	n40	5510	5460	-57.86	-57.15	6.00	46.75	Average	54	Pass
NVNT	n40	5510	5466.8	-43.52	-37.76	6.00	64.49	Peak	68.2	Pass
NVNT	n40	5510	5468	-56.17	-55.43	6.00	48.45	Average	54	Pass
NVNT	n40	5510	5470	-44.99	-43.88	6.00	59.84	Peak	68.2	Pass
NVNT	n40	5510	5470	-56.19	-55.82	6.00	48.24	Average	54	Pass
NVNT	n40	5670	5725	-48.84	-49.97	6.00	54.87	Peak	68.2	Pass
NVNT	n40	5670	5725	-58.38	-58.36	6.00	45.87	Average	54	Pass
NVNT	n40	5670	5735	-47.83	-48.7	6.00	55.99	Peak	68.2	Pass
NVNT	n40	5670	5726	-57.76	-57.42	6.00	46.65	Average	54	Pass
NVNT	n40	5670	5735	-47.83	-50.29	6.00	55.35	Peak	68.2	Pass
NVNT	n40	5670	5735	-58.46	-58.09	6.00	45.97	Average	54	Pass
NVNT	ac20	5500	5460	-49.96	-47.84	6.00	55.47	Peak	68.2	Pass
NVNT	ac20	5500	5460	-57.77	-57.71	6.00	46.50	Average	54	Pass
NVNT	ac20	5500	5465	-45.13	-45.78	6.00	58.80	Peak	68.2	Pass
NVNT	ac20	5500	5469	-56.22	-56.49	6.00	47.88	Average	54	Pass
NVNT	ac20	5500	5470	-47.62	-46.51	6.00	57.21	Peak	68.2	Pass
NVNT	ac20	5500	5470	-56.92	-56.49	6.00	47.54	Average	54	Pass
NVNT	ac20	5700	5725	-42.09	-42.73	6.00	61.84	Peak	68.2	Pass
NVNT	ac20	5700	5725	-54.27	-55.52	6.00	49.39	Average	54	Pass
NVNT	ac20	5700	5727.6	-40.92	-39.74	6.00	63.95	Peak	68.2	Pass
NVNT	ac20	5700	5725	-54.27	-53.68	6.00	50.27	Average	54	Pass
NVNT	ac20	5700	5735	-49.36	-49.47	6.00	54.82	Peak	68.2	Pass
NVNT	ac20	5700	5735	-57.47	-57.59	6.00	46.71	Average	54	Pass
NVNT	ac40	5510	5460	-47.93	-49.27	6.00	55.69	Peak	68.2	Pass
NVNT	ac40	5510	5460	-58.44	-58.44	6.00	45.80	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	5468.6	-44.29	-41.6	6.00	61.50	Peak	68.2	Pass
NVNT	ac40	5510	5470	-55.4	-55.85	6.00	48.62	Average	54	Pass
NVNT	ac40	5510	5470	-48.03	-42.91	6.00	59.48	Peak	68.2	Pass
NVNT	ac40	5510	5470	-55.4	-56.14	6.00	48.48	Average	54	Pass
NVNT	ac40	5670	5725	-50.57	-47.56	6.00	55.43	Peak	68.2	Pass
NVNT	ac40	5670	5725	-58.13	-58.07	6.00	46.14	Average	54	Pass
NVNT	ac40	5670	5733.8	-48.43	-47.56	6.00	56.26	Peak	68.2	Pass
NVNT	ac40	5670	5727.8	-57.75	-57.61	6.00	46.56	Average	54	Pass
NVNT	ac40	5670	5735	-50.22	-50.75	6.00	53.76	Peak	68.2	Pass
NVNT	ac40	5670	5735	-58.42	-57.95	6.00	46.06	Average	54	Pass
NVNT	ac80	5530	5460	-47.02	-48.67	6.00	56.47	Peak	68.2	Pass
NVNT	ac80	5530	5460	-56.6	-57.22	6.00	47.34	Average	54	Pass
NVNT	ac80	5530	5469.4	-44.88	-42.38	6.00	60.79	Peak	68.2	Pass
NVNT	ac80	5530	5469.8	-54.74	-55.25	6.00	49.25	Average	54	Pass
NVNT	ac80	5530	5470	-46.27	-44.05	6.00	59.22	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.68	-55.45	6.00	48.67	Average	54	Pass
NVNT	ac80	5610	5725	-50.41	-49.21	6.00	54.47	Peak	68.2	Pass
NVNT	ac80	5610	5725	-58.54	-58.28	6.00	45.83	Average	54	Pass
NVNT	ac80	5610	5727.21	-48.6	-47.84	6.00	56.03	Peak	68.2	Pass
NVNT	ac80	5610	5731.105	-57.7	-57.37	6.00	46.71	Average	54	Pass
NVNT	ac80	5610	5735	-50.45	-49.54	6.00	54.27	Peak	68.2	Pass
NVNT	ac80	5610	5735	-58.02	-58.24	6.00	46.11	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant3	5460	-50.23	2.88	-	47.88	Peak	68.2	Pass
NVNT	a	5500	Ant3	5460	-57.24	2.88	0.24	41.11	Average	54	Pass
NVNT	a	5500	Ant3	5467.6	-46.58	2.88	-	51.53	Peak	68.2	Pass
NVNT	a	5500	Ant3	5468	-56.79	2.88	0.24	41.56	Average	54	Pass
NVNT	a	5500	Ant3	5470	-50.09	2.88	-	48.02	Peak	68.2	Pass
NVNT	a	5500	Ant3	5470	-57.1	2.88	0.24	41.25	Average	54	Pass
NVNT	a	5700	Ant3	5725	-42.49	2.88	-	55.62	Peak	68.2	Pass
NVNT	a	5700	Ant3	5725	-55.23	2.88	0.24	43.12	Average	54	Pass
NVNT	a	5700	Ant3	5725.8	-41.24	2.88	-	56.87	Peak	68.2	Pass
NVNT	a	5700	Ant3	5726.2	-54.62	2.88	0.24	43.73	Average	54	Pass
NVNT	a	5700	Ant3	5735	-48.35	2.88	-	49.76	Peak	68.2	Pass
NVNT	a	5700	Ant3	5735	-57.59	2.88	0.24	40.76	Average	54	Pass
NVNT	n20	5500	Ant3	5460	-50.57	2.88	-	47.54	Peak	68.2	Pass
NVNT	n20	5500	Ant3	5460	-57.75	2.88	0.12	40.48	Average	54	Pass
NVNT	n20	5500	Ant3	5466.8	-44.77	2.88	-	53.34	Peak	68.2	Pass
NVNT	n20	5500	Ant3	5469.6	-56.22	2.88	0.12	42.01	Average	54	Pass
NVNT	n20	5500	Ant3	5470	-45.32	2.88	-	52.79	Peak	68.2	Pass
NVNT	n20	5500	Ant3	5470	-57.25	2.88	0.12	40.98	Average	54	Pass
NVNT	n20	5700	Ant3	5725	-40.29	2.88	-	57.82	Peak	68.2	Pass
NVNT	n20	5700	Ant3	5725	-54.37	2.88	0.12	43.86	Average	54	Pass
NVNT	n20	5700	Ant3	5726.2	-40.01	2.88	-	58.10	Peak	68.2	Pass
NVNT	n20	5700	Ant3	5726.2	-54.16	2.88	0.12	44.07	Average	54	Pass
NVNT	n20	5700	Ant3	5735	-48.79	2.88	-	49.32	Peak	68.2	Pass
NVNT	n20	5700	Ant3	5735	-57.58	2.88	0.12	40.65	Average	54	Pass
NVNT	n40	5510	Ant3	5460	-50.04	2.88	-	48.07	Peak	68.2	Pass
NVNT	n40	5510	Ant3	5460	-57.96	2.88	0.24	40.39	Average	54	Pass
NVNT	n40	5510	Ant3	5467.6	-43.17	2.88	-	54.94	Peak	68.2	Pass
NVNT	n40	5510	Ant3	5469.8	-55.28	2.88	0.24	43.07	Average	54	Pass
NVNT	n40	5510	Ant3	5470	-43.8	2.88	-	54.31	Peak	68.2	Pass
NVNT	n40	5510	Ant3	5470	-55.72	2.88	0.24	42.63	Average	54	Pass
NVNT	n40	5670	Ant3	5725	-49.52	2.88	-	48.59	Peak	68.2	Pass
NVNT	n40	5670	Ant3	5725	-58.35	2.88	0.24	40.00	Average	54	Pass
NVNT	n40	5670	Ant3	5734.6	-48.12	2.88	-	49.99	Peak	68.2	Pass
NVNT	n40	5670	Ant3	5728.6	-57.56	2.88	0.24	40.79	Average	54	Pass
NVNT	n40	5670	Ant3	5735	-50.73	2.88	-	47.38	Peak	68.2	Pass
NVNT	n40	5670	Ant3	5735	-58.25	2.88	0.24	40.10	Average	54	Pass
NVNT	ac20	5500	Ant3	5460	-49.59	2.88	-	48.52	Peak	68.2	Pass
NVNT	ac20	5500	Ant3	5460	-57.57	2.88	0.12	40.66	Average	54	Pass
NVNT	ac20	5500	Ant3	5466.6	-44.15	2.88	-	53.96	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant3	5469.2	-55.67	2.88	0.12	42.56	Average	54	Pass
NVNT	ac20	5500	Ant3	5470	-46.72	2.88	-	51.39	Peak	68.2	Pass
NVNT	ac20	5500	Ant3	5470	-55.89	2.88	0.12	42.34	Average	54	Pass
NVNT	ac20	5700	Ant3	5725	-41.17	2.88	-	56.94	Peak	68.2	Pass
NVNT	ac20	5700	Ant3	5725	-54.49	2.88	0.12	43.74	Average	54	Pass
NVNT	ac20	5700	Ant3	5726	-40.13	2.88	-	57.98	Peak	68.2	Pass
NVNT	ac20	5700	Ant3	5725.2	-53.56	2.88	0.12	44.67	Average	54	Pass
NVNT	ac20	5700	Ant3	5735	-48.37	2.88	-	49.74	Peak	68.2	Pass
NVNT	ac20	5700	Ant3	5735	-57.57	2.88	0.12	40.66	Average	54	Pass
NVNT	ac40	5510	Ant3	5460	-50.39	2.88	-	47.72	Peak	68.2	Pass
NVNT	ac40	5510	Ant3	5460	-57.89	2.88	0.24	40.46	Average	54	Pass
NVNT	ac40	5510	Ant3	5469.4	-42.64	2.88	-	55.47	Peak	68.2	Pass
NVNT	ac40	5510	Ant3	5469.6	-55.23	2.88	0.24	43.12	Average	54	Pass
NVNT	ac40	5510	Ant3	5470	-45.4	2.88	-	52.71	Peak	68.2	Pass
NVNT	ac40	5510	Ant3	5470	-55.4	2.88	0.24	42.95	Average	54	Pass
NVNT	ac40	5670	Ant3	5725	-49.25	2.88	-	48.86	Peak	68.2	Pass
NVNT	ac40	5670	Ant3	5725	-57.82	2.88	0.23	40.52	Average	54	Pass
NVNT	ac40	5670	Ant3	5729	-47.26	2.88	-	50.85	Peak	68.2	Pass
NVNT	ac40	5670	Ant3	5725.6	-57.62	2.88	0.23	40.72	Average	54	Pass
NVNT	ac40	5670	Ant3	5735	-49.7	2.88	-	48.41	Peak	68.2	Pass
NVNT	ac40	5670	Ant3	5735	-57.85	2.88	0.23	40.49	Average	54	Pass
NVNT	ac80	5530	Ant3	5460	-47.27	2.88	-	50.84	Peak	68.2	Pass
NVNT	ac80	5530	Ant3	5460	-57.04	2.88	0.25	41.32	Average	54	Pass
NVNT	ac80	5530	Ant3	5465.2	-42.18	2.88	-	55.93	Peak	68.2	Pass
NVNT	ac80	5530	Ant3	5469	-54.77	2.88	0.25	43.59	Average	54	Pass
NVNT	ac80	5530	Ant3	5470	-44.58	2.88	-	53.53	Peak	68.2	Pass
NVNT	ac80	5530	Ant3	5470	-55.33	2.88	0.25	43.03	Average	54	Pass
NVNT	ac80	5610	Ant3	5725	-50.45	2.88	-	47.66	Peak	68.2	Pass
NVNT	ac80	5610	Ant3	5725	-58.59	2.88	0.25	39.77	Average	54	Pass
NVNT	ac80	5610	Ant3	5727.21	-47.23	2.88	-	50.88	Peak	68.2	Pass
NVNT	ac80	5610	Ant3	5726.595	-57.47	2.88	0.25	40.89	Average	54	Pass
NVNT	ac80	5610	Ant3	5735	-52.23	2.88	-	45.88	Peak	68.2	Pass
NVNT	ac80	5610	Ant3	5735	-57.85	2.88	0.25	40.51	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant3 Peak

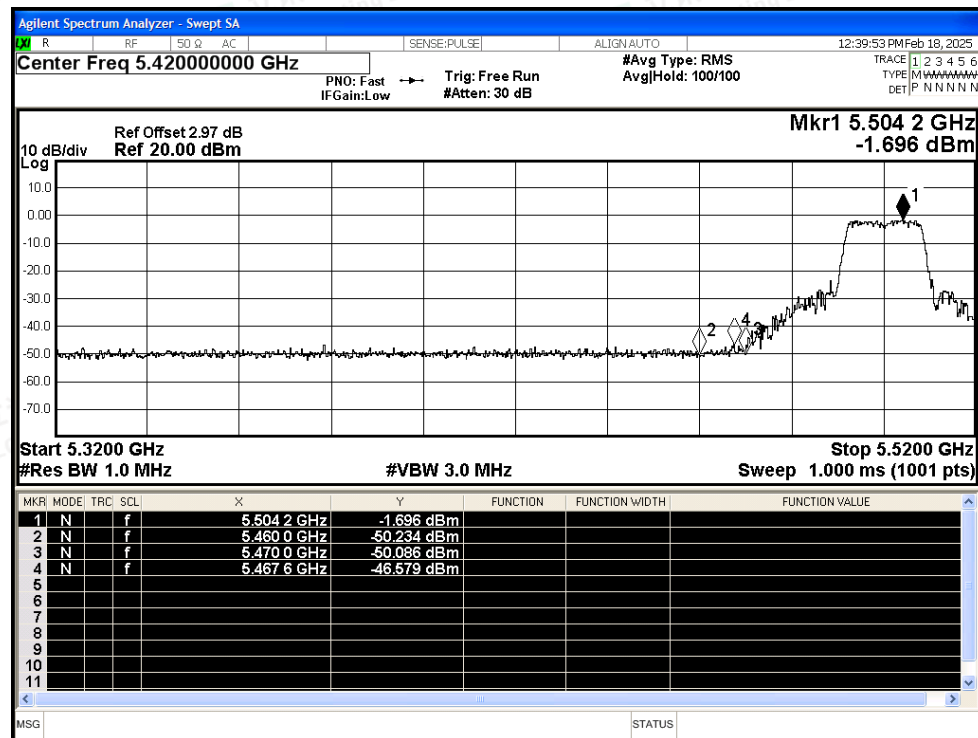

Restrict Band NVNT a 5500MHz Ant3 Average

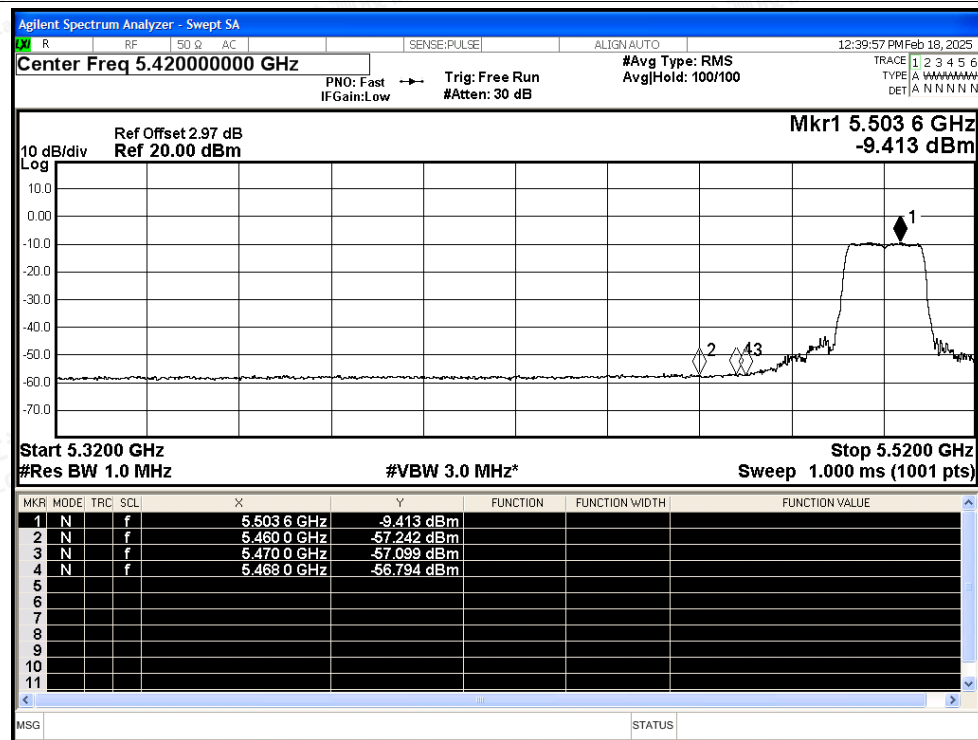

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant3 Peak

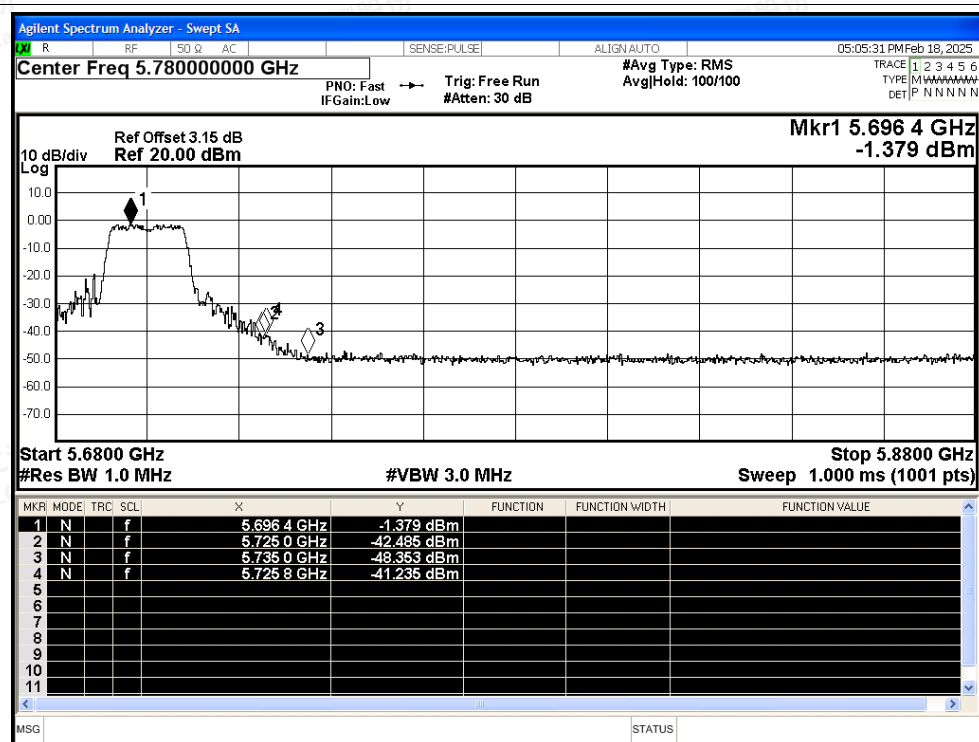

Restrict Band NVNT a 5700MHz Ant3 Average

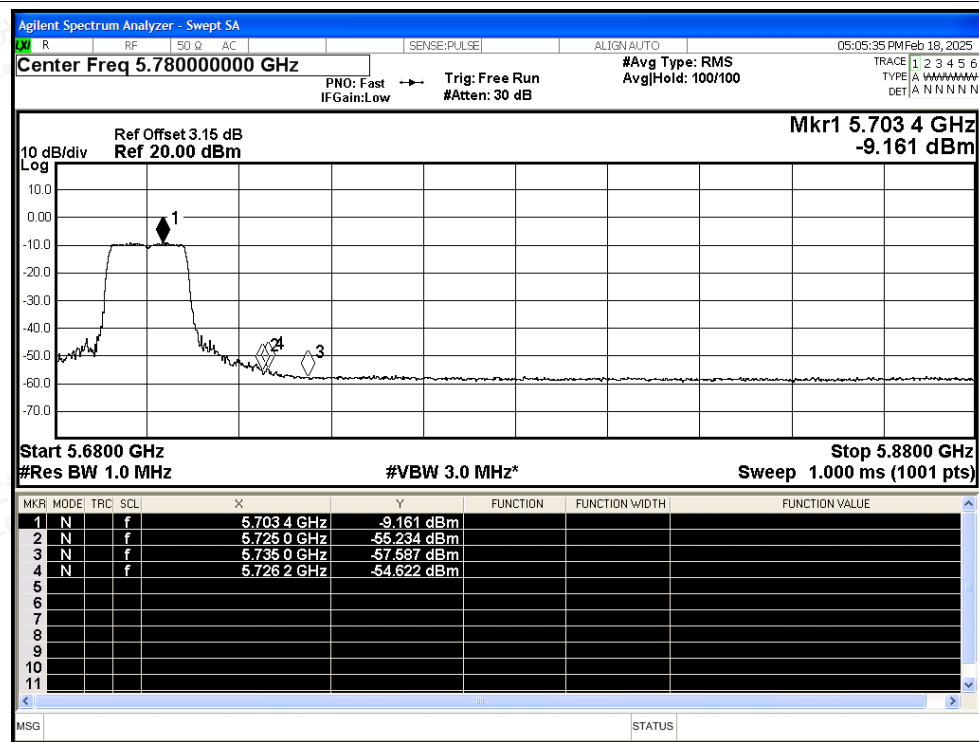

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant3 Peak

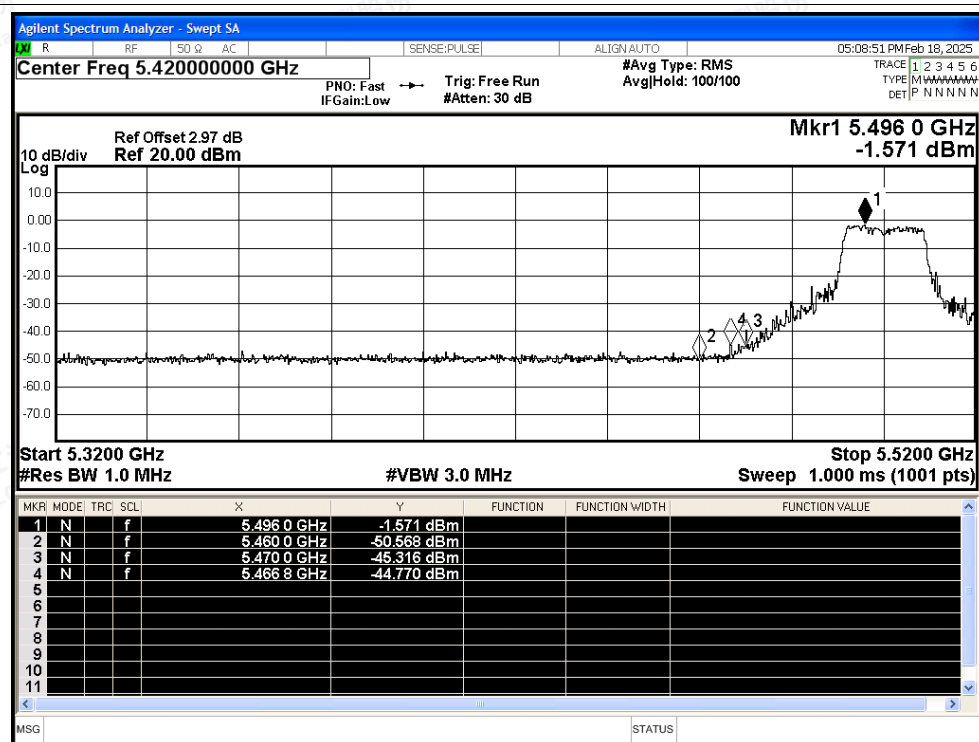

Restrict Band NVNT n20 5500MHz Ant3 Average

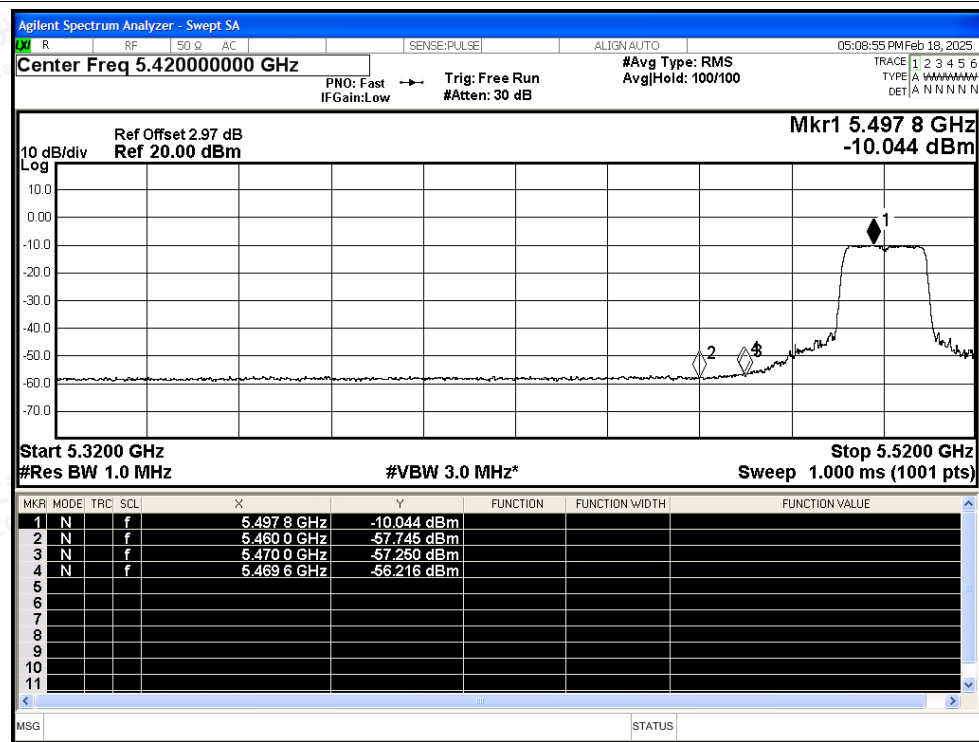

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant3 Peak

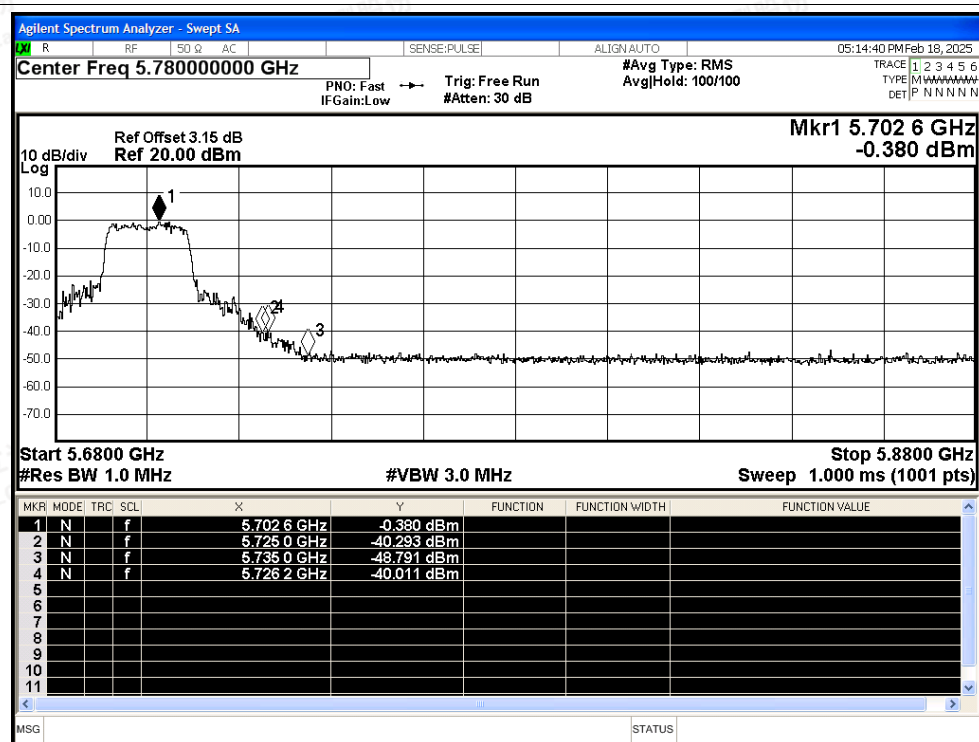

Restrict Band NVNT n20 5700MHz Ant3 Average

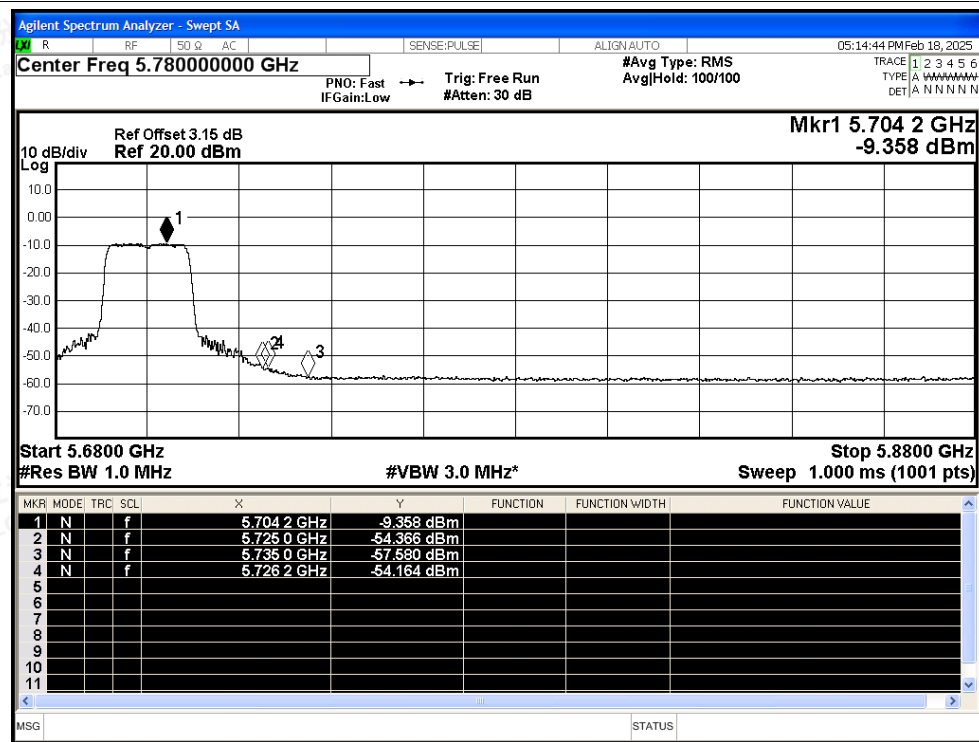

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant3 Peak

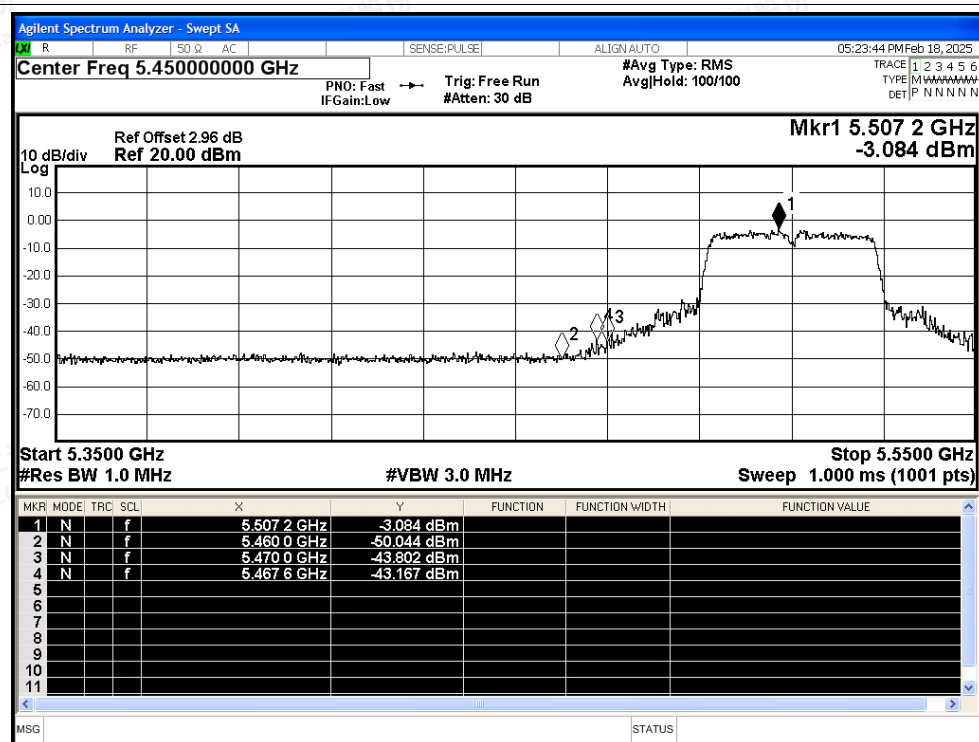

Restrict Band NVNT n40 5510MHz Ant3 Average

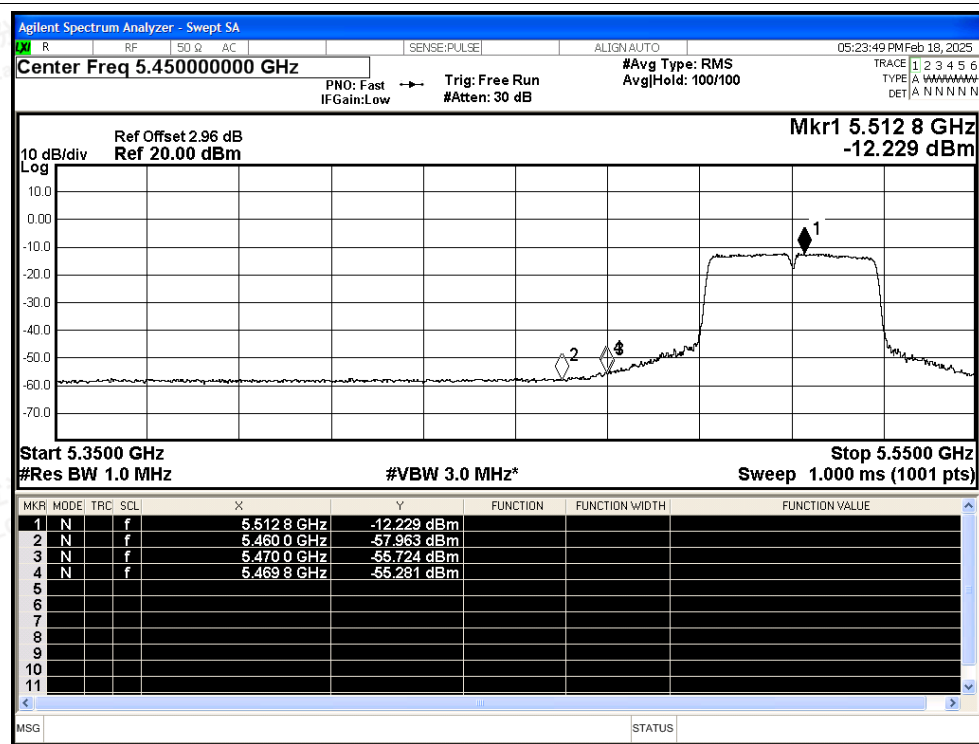

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant3 Peak

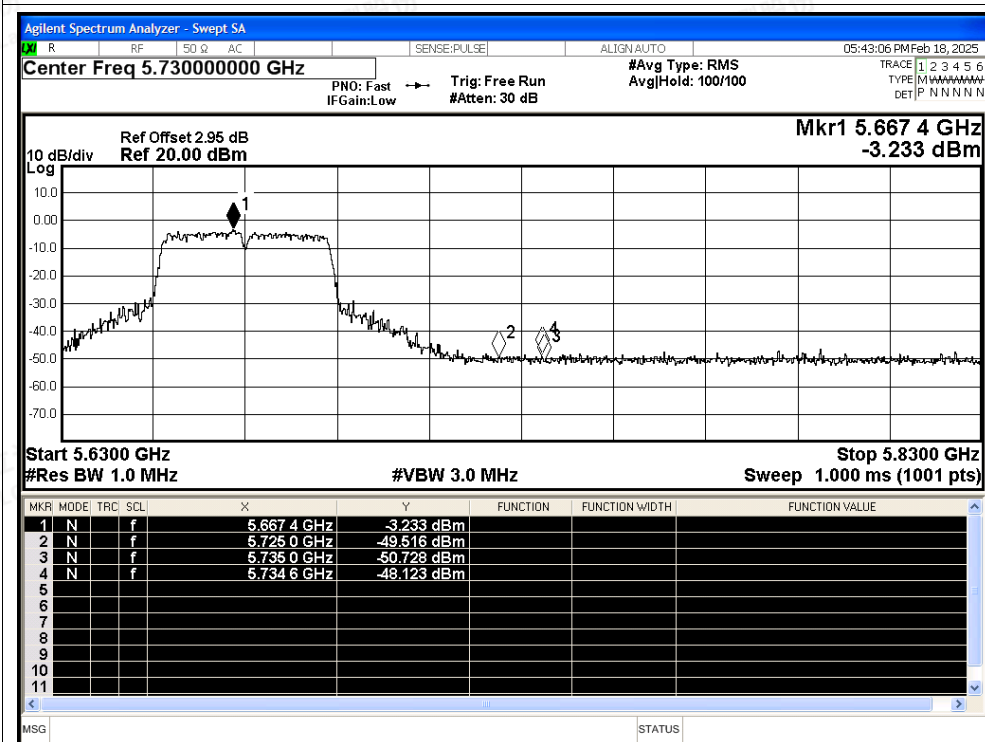

Restrict Band NVNT n40 5670MHz Ant3 Average

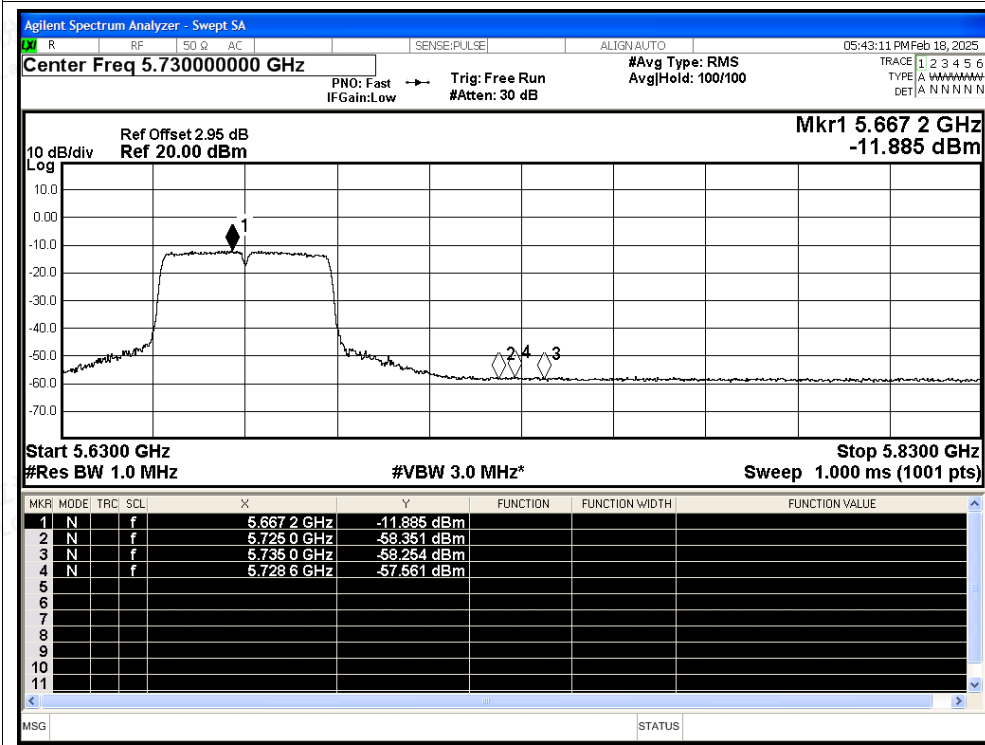

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant3 Peak

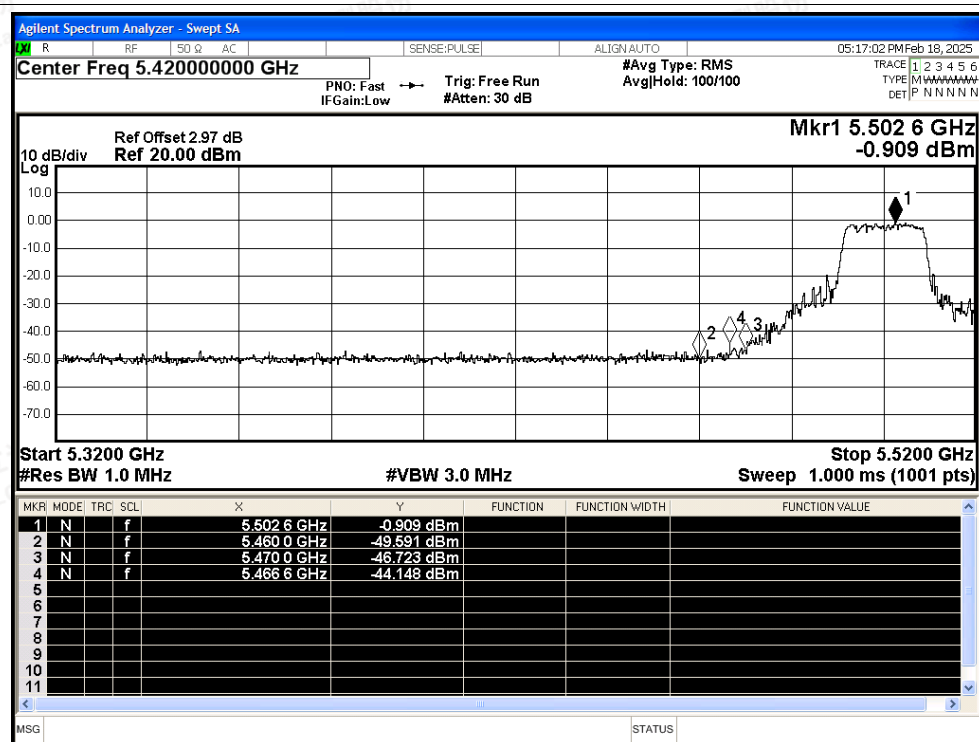

Restrict Band NVNT ac20 5500MHz Ant3 Average

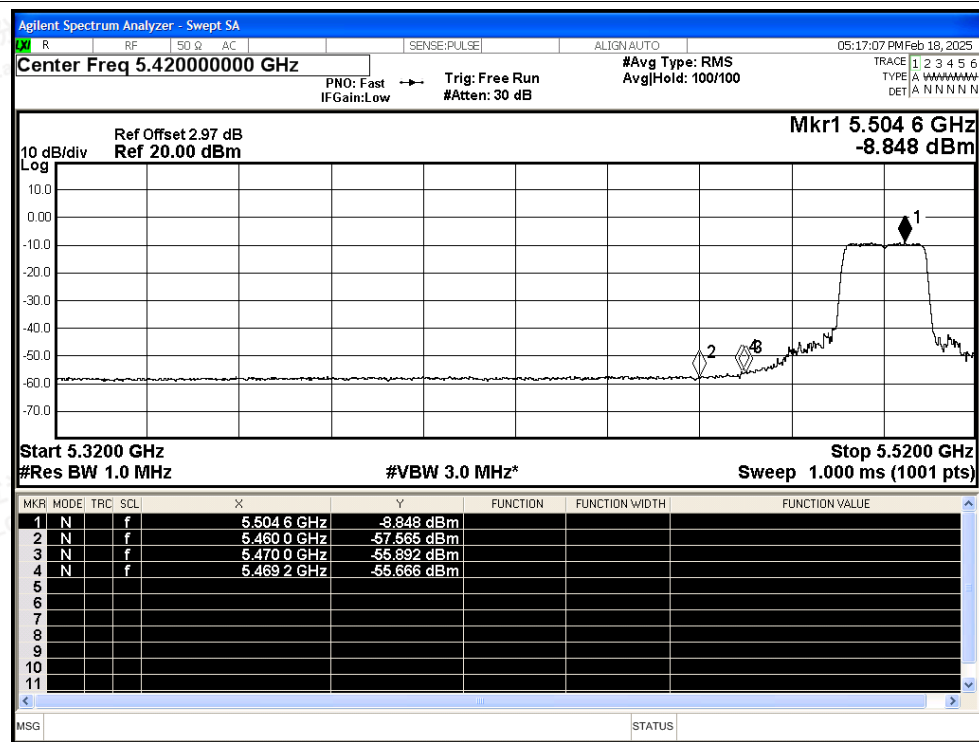

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant3 Peak

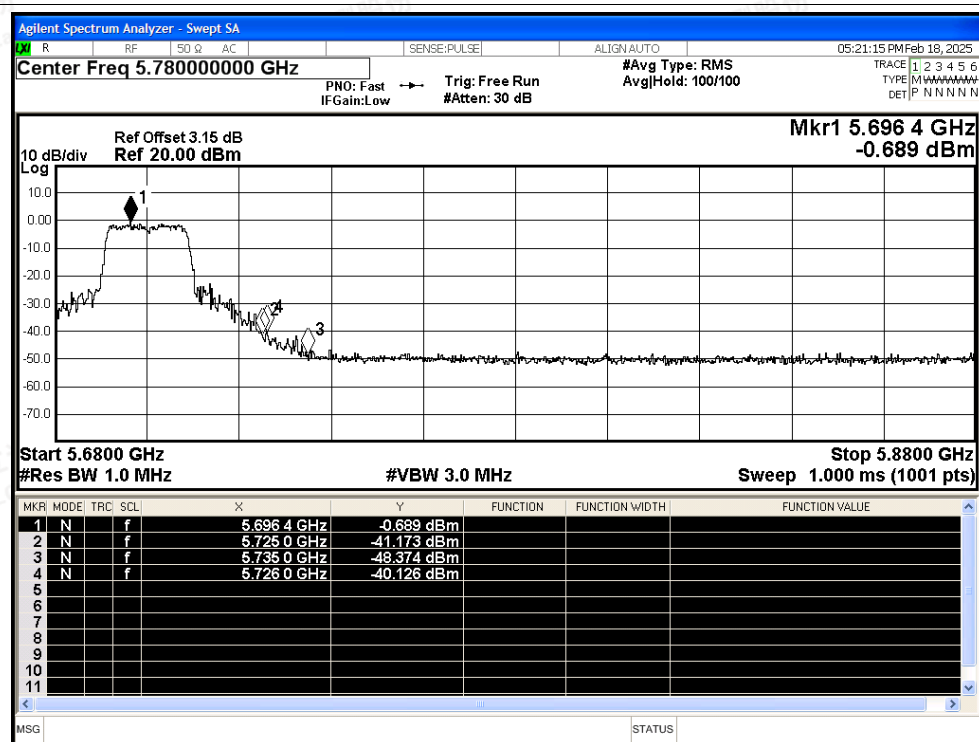

Restrict Band NVNT ac20 5700MHz Ant3 Average

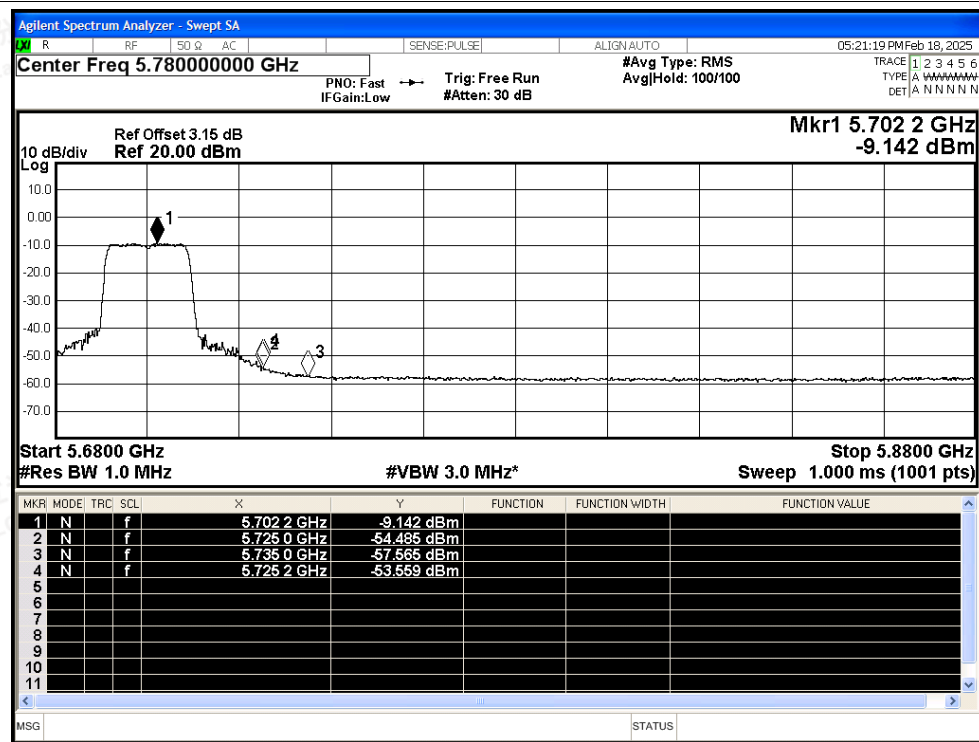

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant3 Peak

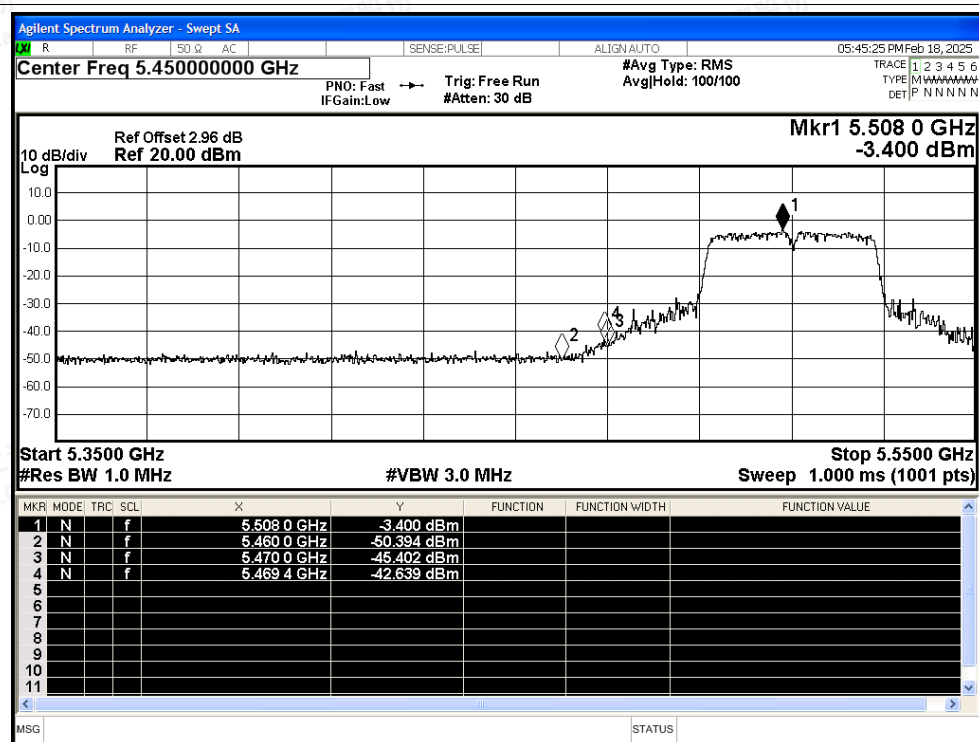

Restrict Band NVNT ac40 5510MHz Ant3 Average

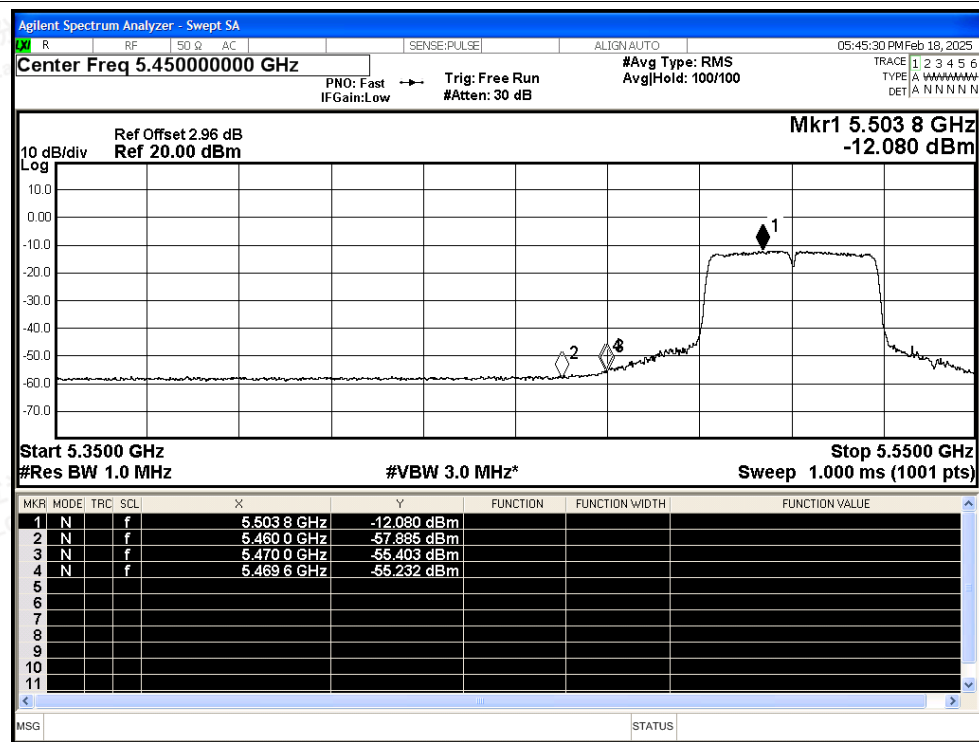

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant3 Peak

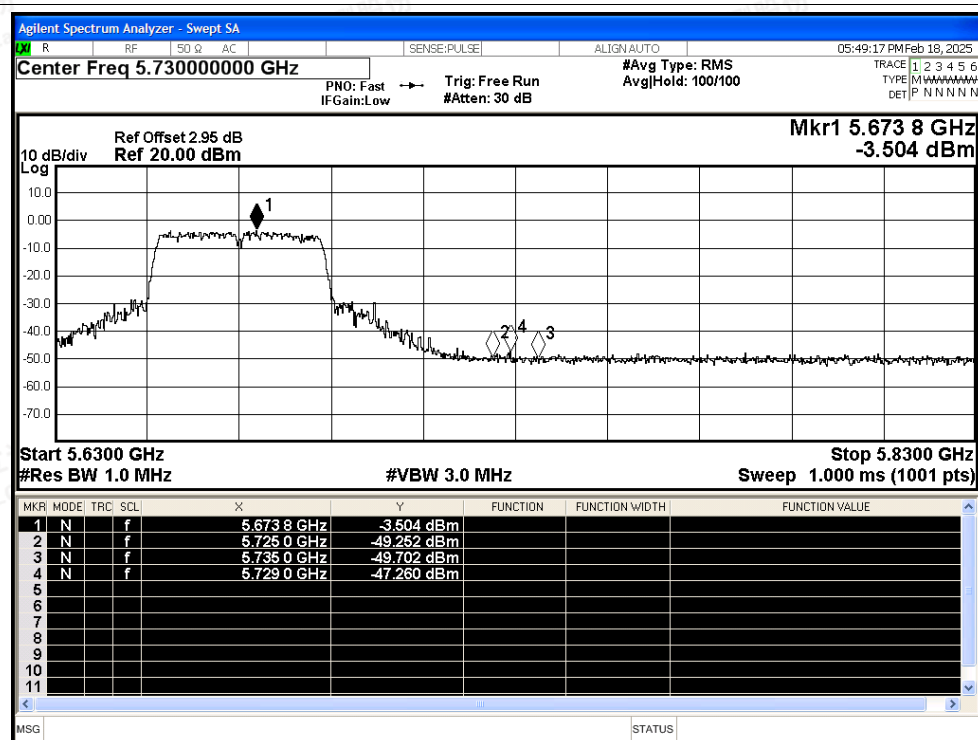

Restrict Band NVNT ac40 5670MHz Ant3 Average

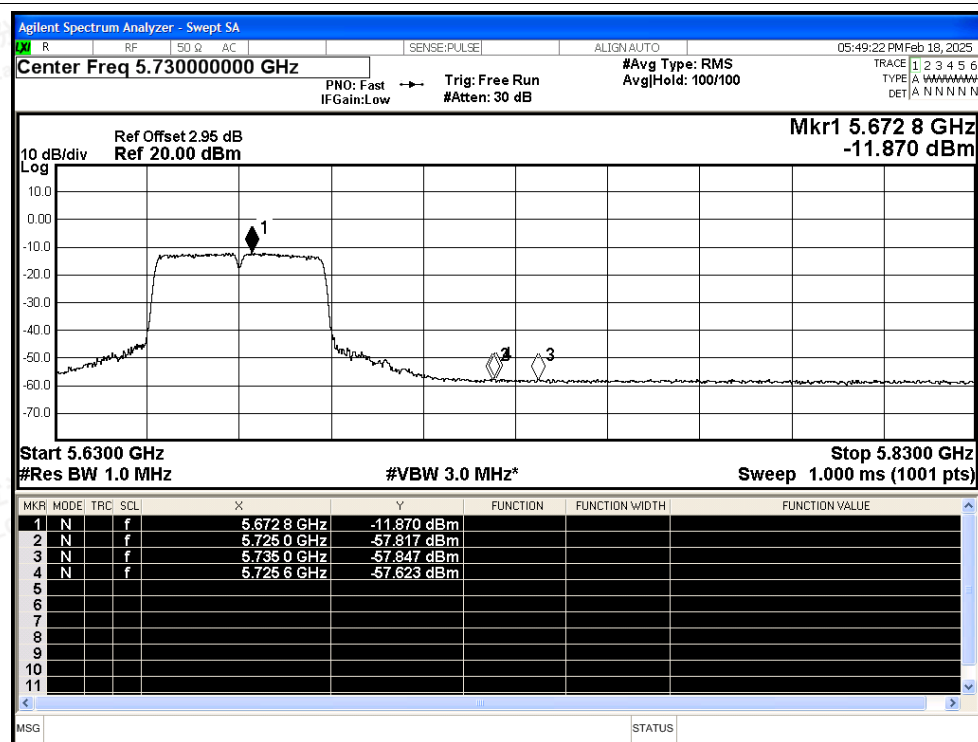

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant3 Peak

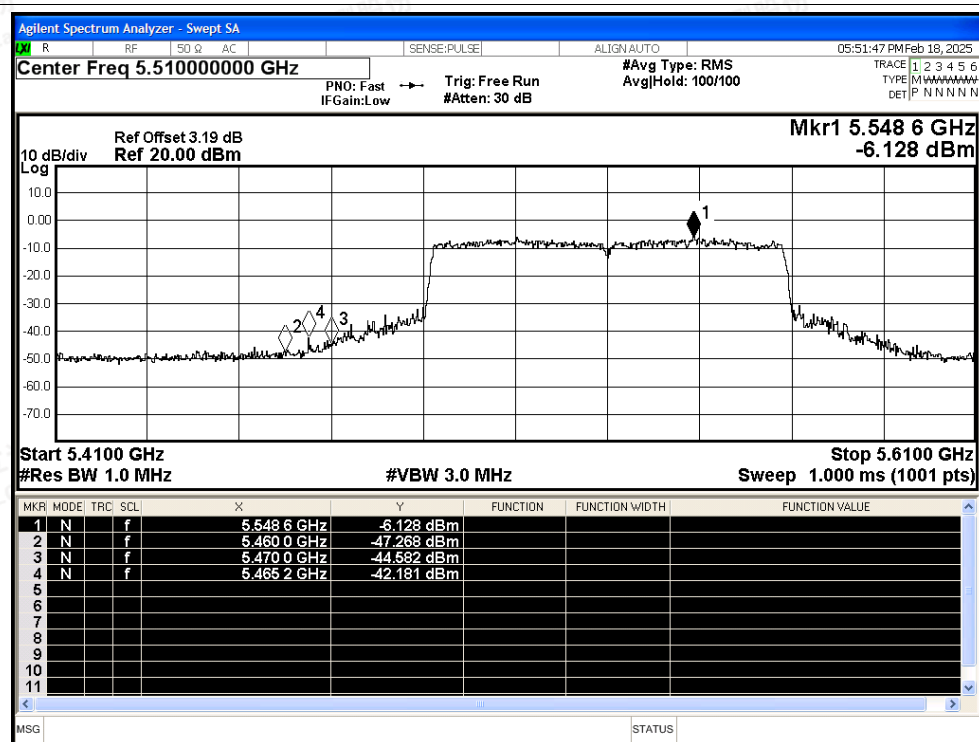

Restrict Band NVNT ac80 5530MHz Ant3 Average

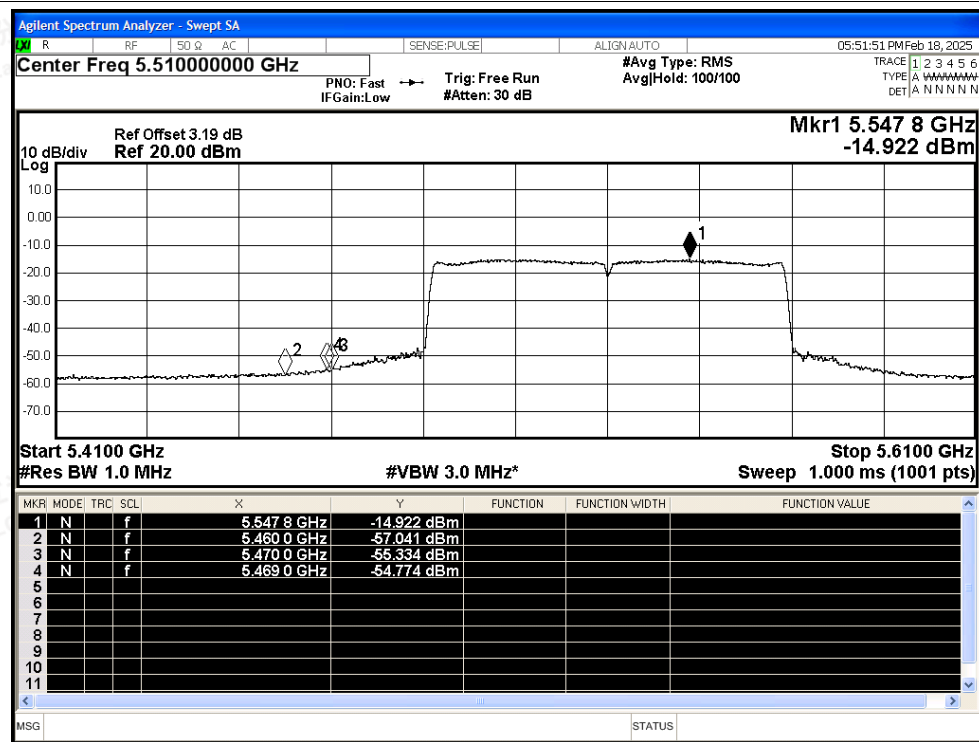

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant3 Peak

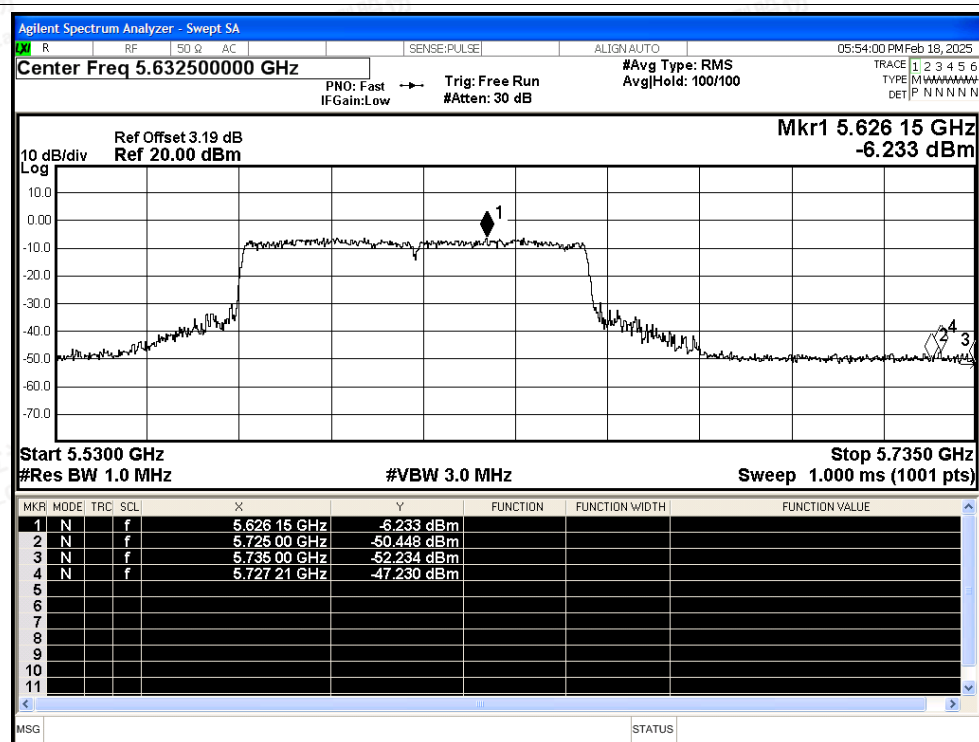

Restrict Band NVNT ac80 5610MHz Ant3 Average

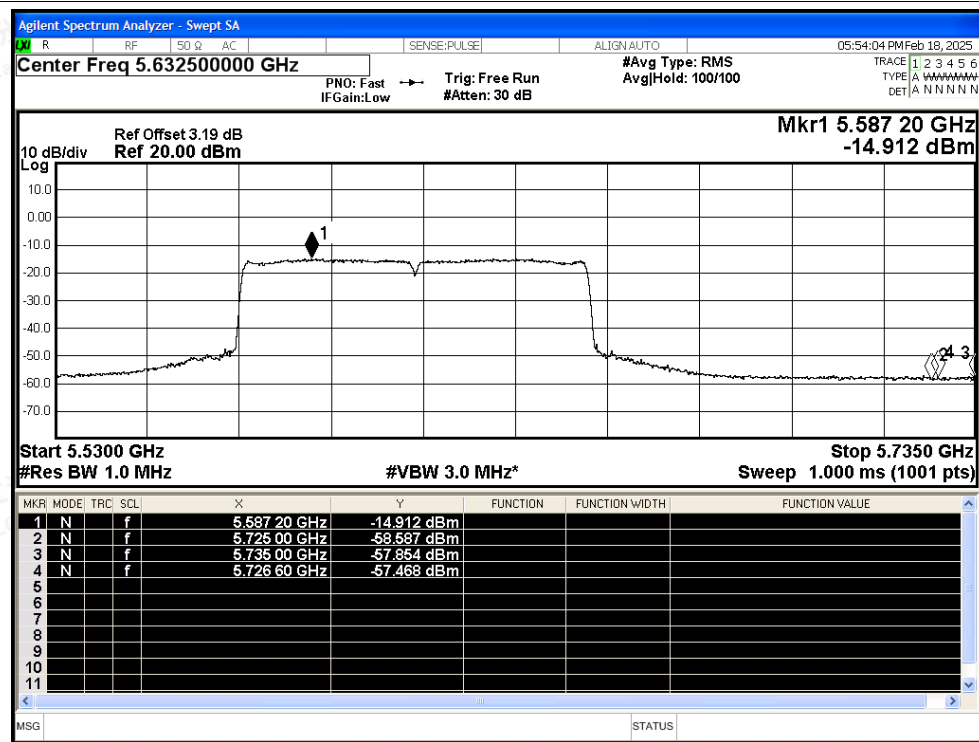

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant4	5460	-50.15	2.88	-	47.96	Peak	68.2	Pass
NVNT	a	5500	Ant4	5460	-57.85	2.88	0.24	40.50	Average	54	Pass
NVNT	a	5500	Ant4	5468.2	-46.52	2.88	-	51.59	Peak	68.2	Pass
NVNT	a	5500	Ant4	5464.8	-56.96	2.88	0.24	41.39	Average	54	Pass
NVNT	a	5500	Ant4	5470	-46.84	2.88	-	51.27	Peak	68.2	Pass
NVNT	a	5500	Ant4	5470	-57.61	2.88	0.24	40.74	Average	54	Pass
NVNT	a	5700	Ant4	5725	-40.49	2.88	-	57.62	Peak	68.2	Pass
NVNT	a	5700	Ant4	5725	-55.74	2.88	0.24	42.61	Average	54	Pass
NVNT	a	5700	Ant4	5725	-40.49	2.88	-	57.62	Peak	68.2	Pass
NVNT	a	5700	Ant4	5725.2	-54.46	2.88	0.24	43.89	Average	54	Pass
NVNT	a	5700	Ant4	5735	-49.91	2.88	-	48.20	Peak	68.2	Pass
NVNT	a	5700	Ant4	5735	-58.18	2.88	0.24	40.17	Average	54	Pass
NVNT	n20	5500	Ant4	5460	-48.78	2.88	-	49.33	Peak	68.2	Pass
NVNT	n20	5500	Ant4	5460	-58.12	2.88	0.12	40.11	Average	54	Pass
NVNT	n20	5500	Ant4	5469	-44.16	2.88	-	53.95	Peak	68.2	Pass
NVNT	n20	5500	Ant4	5469	-55.07	2.88	0.12	43.16	Average	54	Pass
NVNT	n20	5500	Ant4	5470	-46.93	2.88	-	51.18	Peak	68.2	Pass
NVNT	n20	5500	Ant4	5470	-56.21	2.88	0.12	42.02	Average	54	Pass
NVNT	n20	5700	Ant4	5725	-39.5	2.88	-	58.61	Peak	68.2	Pass
NVNT	n20	5700	Ant4	5725	-54.1	2.88	0.12	44.13	Average	54	Pass
NVNT	n20	5700	Ant4	5725.2	-39.16	2.88	-	58.95	Peak	68.2	Pass
NVNT	n20	5700	Ant4	5725.2	-53.22	2.88	0.12	45.01	Average	54	Pass
NVNT	n20	5700	Ant4	5735	-49.42	2.88	-	48.69	Peak	68.2	Pass
NVNT	n20	5700	Ant4	5735	-57.58	2.88	0.12	40.65	Average	54	Pass
NVNT	n40	5510	Ant4	5460	-50.9	2.88	-	47.21	Peak	68.2	Pass
NVNT	n40	5510	Ant4	5460	-58.16	2.88	0.24	40.19	Average	54	Pass
NVNT	n40	5510	Ant4	5469.2	-41.07	2.88	-	57.04	Peak	68.2	Pass
NVNT	n40	5510	Ant4	5467	-56.17	2.88	0.24	42.18	Average	54	Pass
NVNT	n40	5510	Ant4	5470	-46.83	2.88	-	51.28	Peak	68.2	Pass
NVNT	n40	5510	Ant4	5470	-56.42	2.88	0.24	41.93	Average	54	Pass
NVNT	n40	5670	Ant4	5725	-50.7	2.88	-	47.41	Peak	68.2	Pass
NVNT	n40	5670	Ant4	5725	-58.48	2.88	0.24	39.87	Average	54	Pass
NVNT	n40	5670	Ant4	5733.8	-46.48	2.88	-	51.63	Peak	68.2	Pass
NVNT	n40	5670	Ant4	5732.4	-57.28	2.88	0.24	41.07	Average	54	Pass
NVNT	n40	5670	Ant4	5735	-49.77	2.88	-	48.34	Peak	68.2	Pass
NVNT	n40	5670	Ant4	5735	-58.54	2.88	0.24	39.81	Average	54	Pass
NVNT	ac20	5500	Ant4	5460	-50.31	2.88	-	47.80	Peak	68.2	Pass
NVNT	ac20	5500	Ant4	5460	-57.84	2.88	0.12	40.39	Average	54	Pass
NVNT	ac20	5500	Ant4	5469.2	-44.25	2.88	-	53.86	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant4	5469.2	-55.96	2.88	0.12	42.27	Average	54	Pass
NVNT	ac20	5500	Ant4	5470	-44.65	2.88	-	53.46	Peak	68.2	Pass
NVNT	ac20	5500	Ant4	5470	-56.92	2.88	0.12	41.31	Average	54	Pass
NVNT	ac20	5700	Ant4	5725	-37.92	2.88	-	60.19	Peak	68.2	Pass
NVNT	ac20	5700	Ant4	5725	-52.71	2.88	0.12	45.52	Average	54	Pass
NVNT	ac20	5700	Ant4	5725	-37.92	2.88	-	60.19	Peak	68.2	Pass
NVNT	ac20	5700	Ant4	5725	-52.71	2.88	0.12	45.52	Average	54	Pass
NVNT	ac20	5700	Ant4	5735	-48.98	2.88	-	49.13	Peak	68.2	Pass
NVNT	ac20	5700	Ant4	5735	-57.74	2.88	0.12	40.49	Average	54	Pass
NVNT	ac40	5510	Ant4	5460	-48.64	2.88	-	49.47	Peak	68.2	Pass
NVNT	ac40	5510	Ant4	5460	-58.07	2.88	0.24	40.28	Average	54	Pass
NVNT	ac40	5510	Ant4	5467.6	-43.1	2.88	-	55.01	Peak	68.2	Pass
NVNT	ac40	5510	Ant4	5469	-55.92	2.88	0.24	42.43	Average	54	Pass
NVNT	ac40	5510	Ant4	5470	-45.55	2.88	-	52.56	Peak	68.2	Pass
NVNT	ac40	5510	Ant4	5470	-55.94	2.88	0.24	42.41	Average	54	Pass
NVNT	ac40	5670	Ant4	5725	-50.52	2.88	-	47.59	Peak	68.2	Pass
NVNT	ac40	5670	Ant4	5725	-58.76	2.88	0.24	39.59	Average	54	Pass
NVNT	ac40	5670	Ant4	5730	-47.14	2.88	-	50.97	Peak	68.2	Pass
NVNT	ac40	5670	Ant4	5727.6	-57.65	2.88	0.24	40.70	Average	54	Pass
NVNT	ac40	5670	Ant4	5735	-50.5	2.88	-	47.61	Peak	68.2	Pass
NVNT	ac40	5670	Ant4	5735	-59.04	2.88	0.24	39.31	Average	54	Pass
NVNT	ac80	5530	Ant4	5460	-48.05	2.88	-	50.06	Peak	68.2	Pass
NVNT	ac80	5530	Ant4	5460	-56.82	2.88	0.25	41.54	Average	54	Pass
NVNT	ac80	5530	Ant4	5469.8	-44.99	2.88	-	53.12	Peak	68.2	Pass
NVNT	ac80	5530	Ant4	5470	-54.93	2.88	0.25	43.43	Average	54	Pass
NVNT	ac80	5530	Ant4	5470	-47.04	2.88	-	51.07	Peak	68.2	Pass
NVNT	ac80	5530	Ant4	5470	-54.93	2.88	0.25	43.43	Average	54	Pass
NVNT	ac80	5610	Ant4	5725	-49.55	2.88	-	48.56	Peak	68.2	Pass
NVNT	ac80	5610	Ant4	5725	-58.34	2.88	0.25	40.02	Average	54	Pass
NVNT	ac80	5610	Ant4	5732.95	-47.26	2.88	-	50.85	Peak	68.2	Pass
NVNT	ac80	5610	Ant4	5730.9	-57.67	2.88	0.25	40.69	Average	54	Pass
NVNT	ac80	5610	Ant4	5735	-50.94	2.88	-	47.17	Peak	68.2	Pass
NVNT	ac80	5610	Ant4	5735	-58.99	2.88	0.25	39.37	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant4 Peak

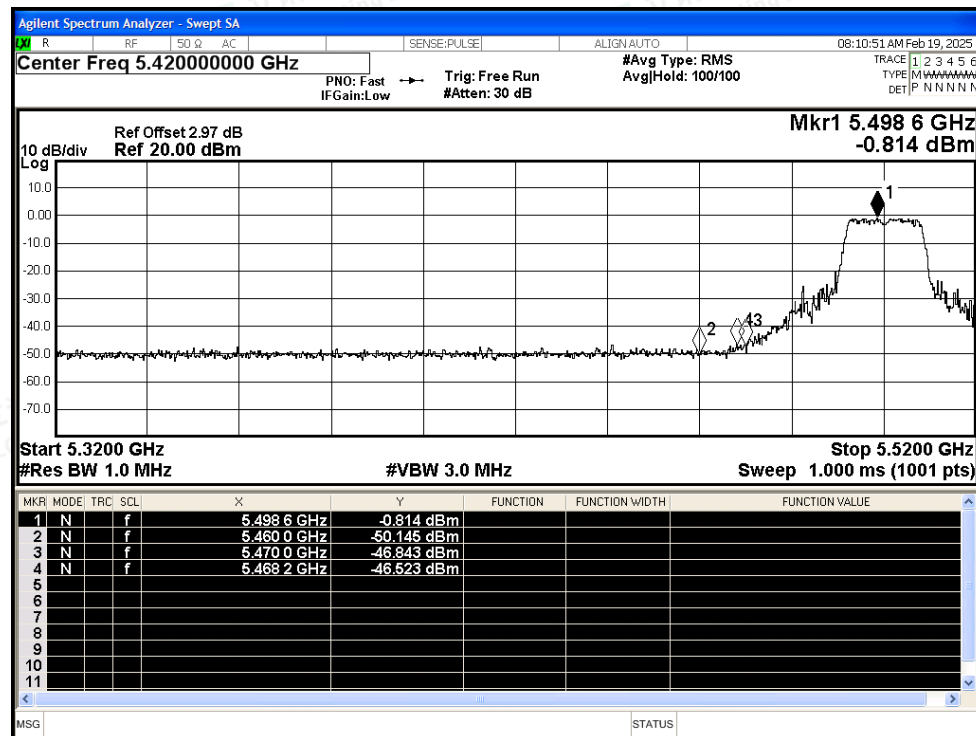

Restrict Band NVNT a 5500MHz Ant4 Average

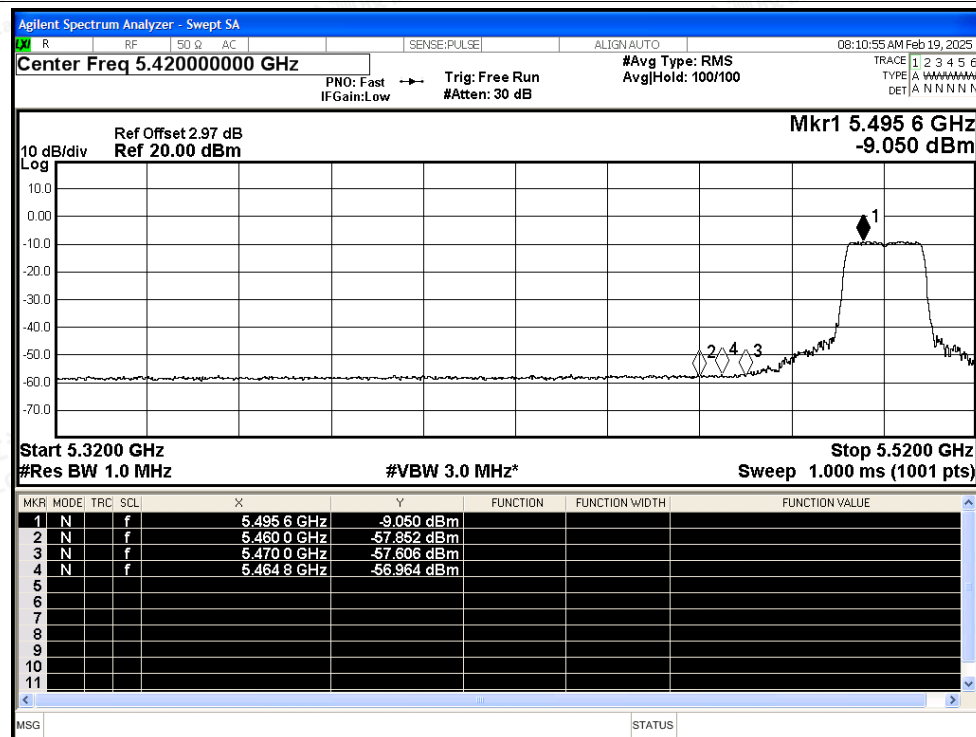

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz Ant4 Peak

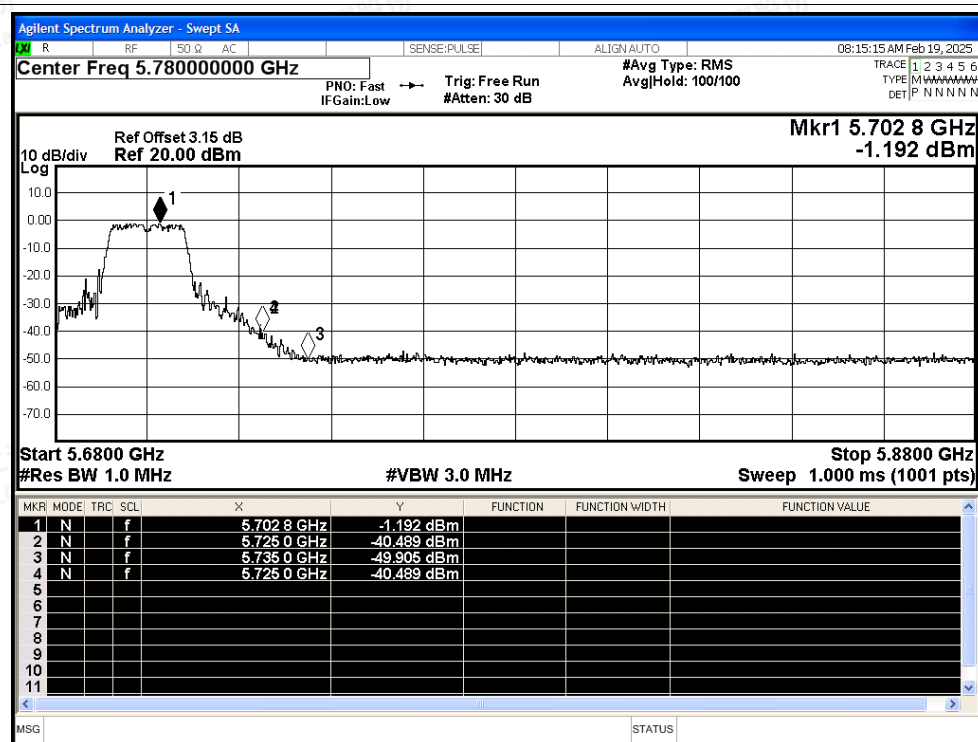

Restrict Band NVNT a 5700MHz Ant4 Average

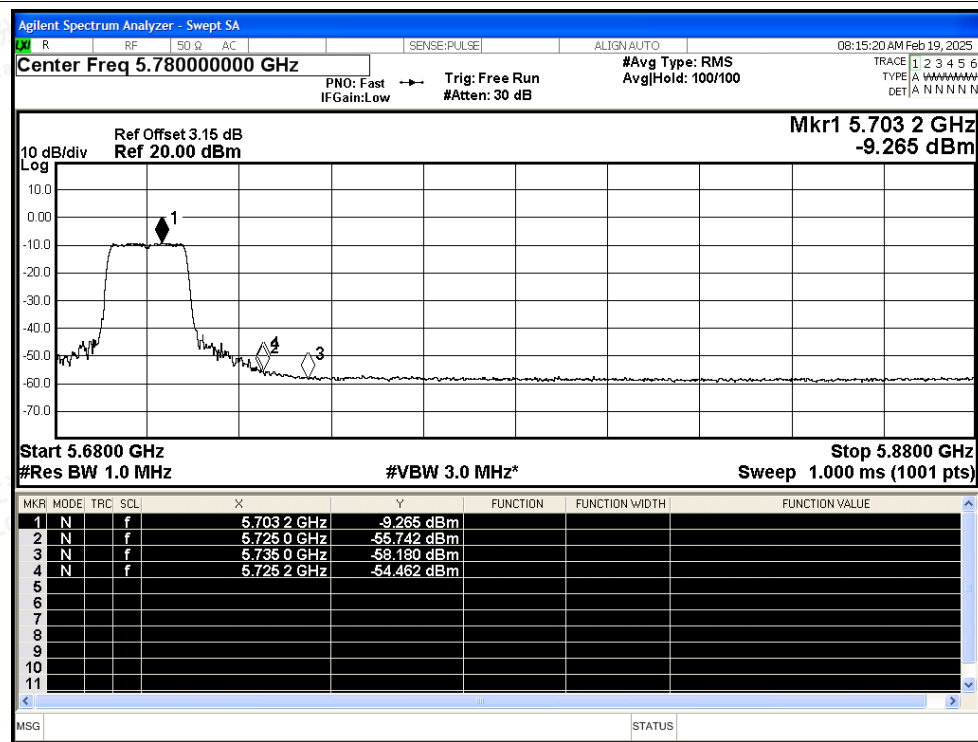

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz Ant4 Peak

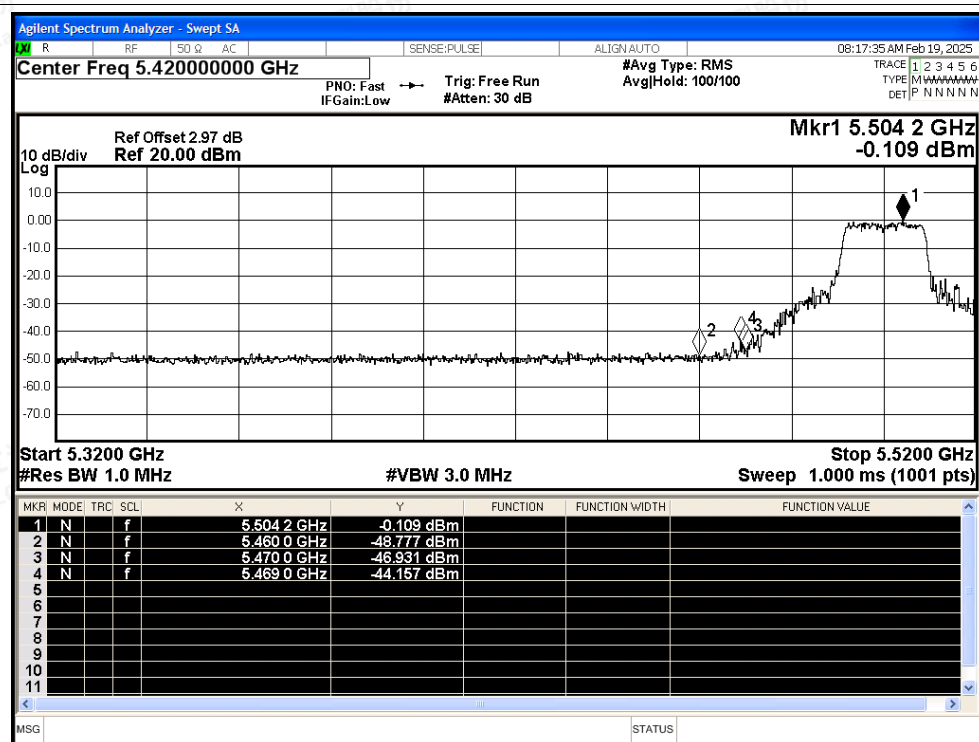

Restrict Band NVNT n20 5500MHz Ant4 Average

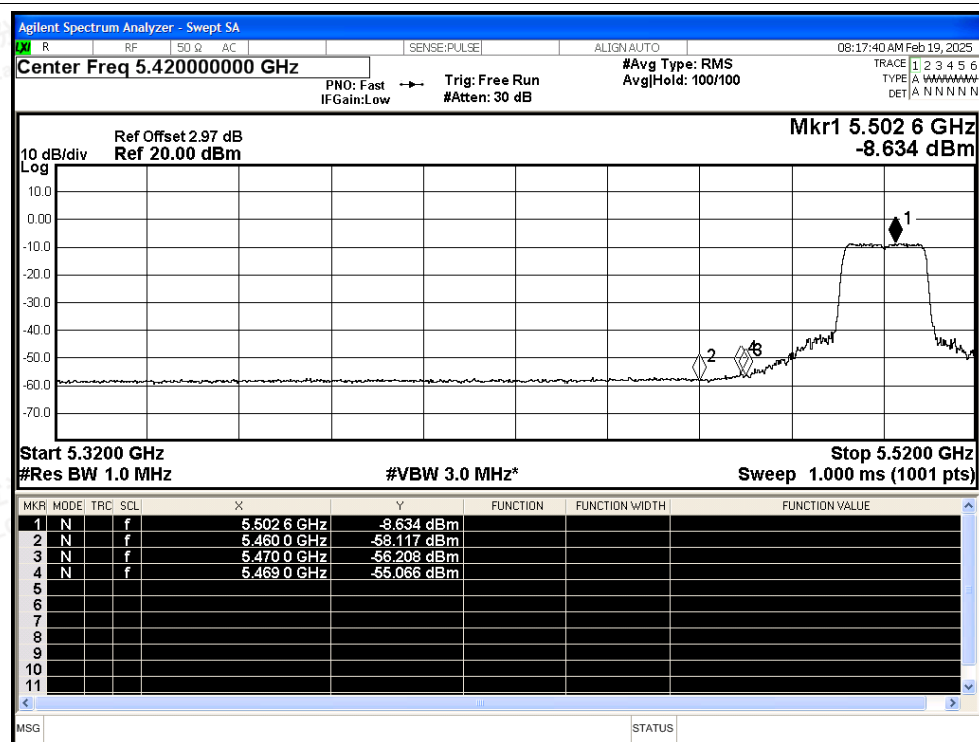

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz Ant4 Peak

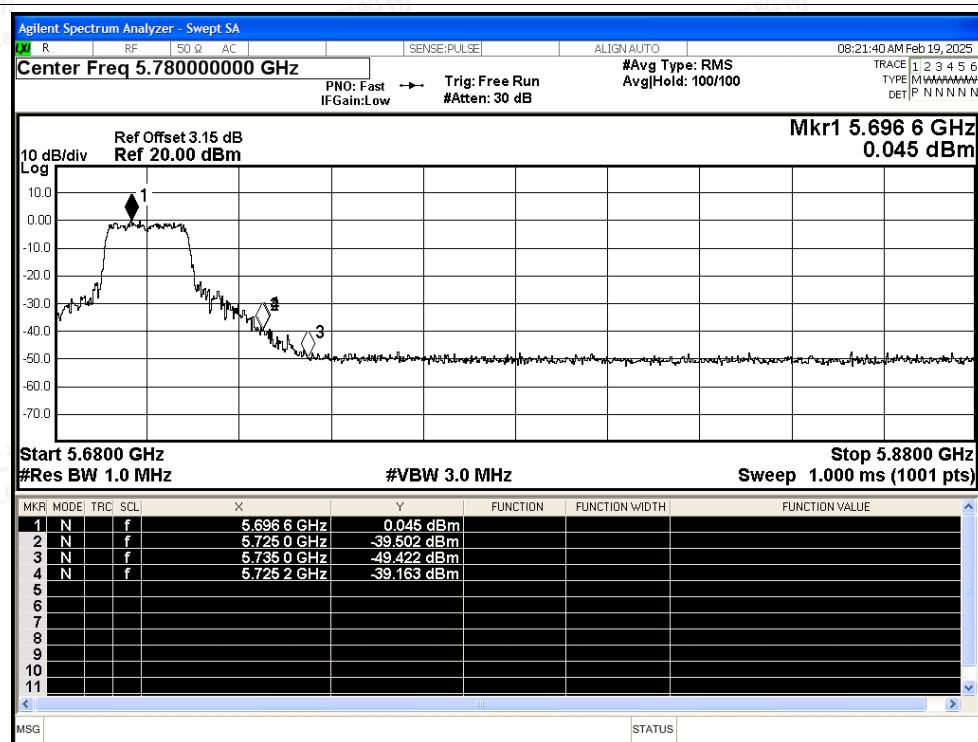

Restrict Band NVNT n20 5700MHz Ant4 Average

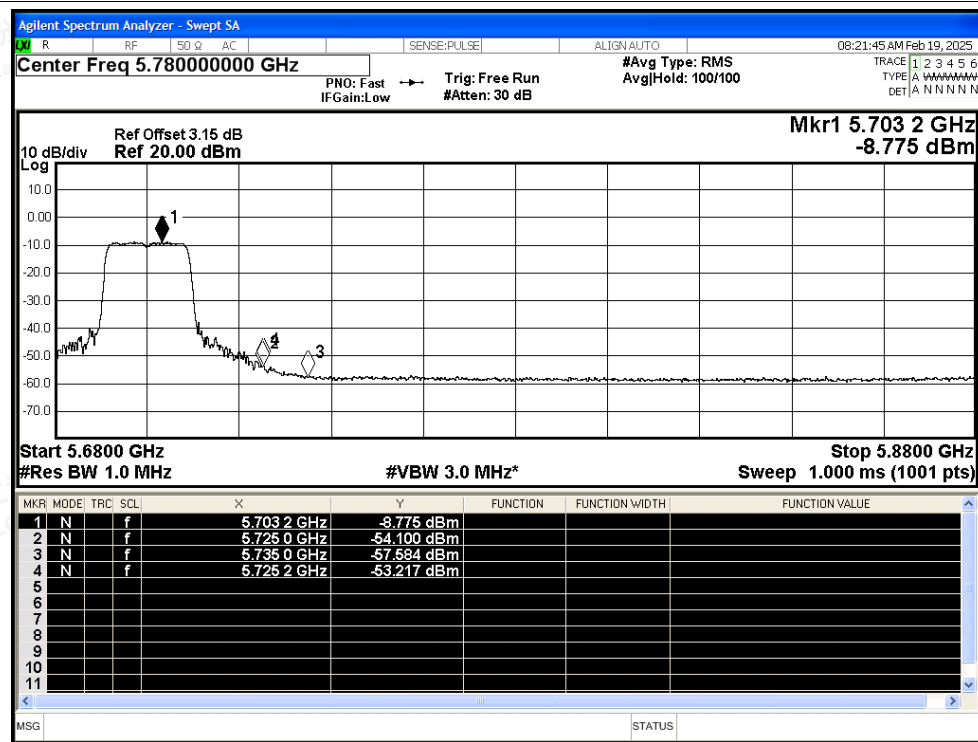

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz Ant4 Peak

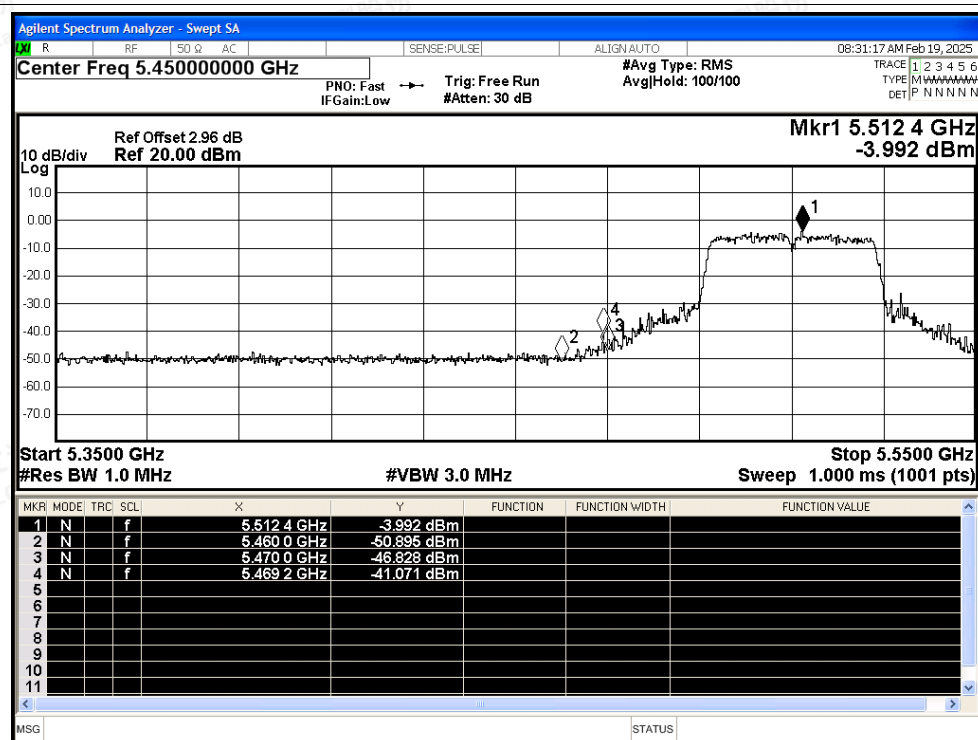

Restrict Band NVNT n40 5510MHz Ant4 Average

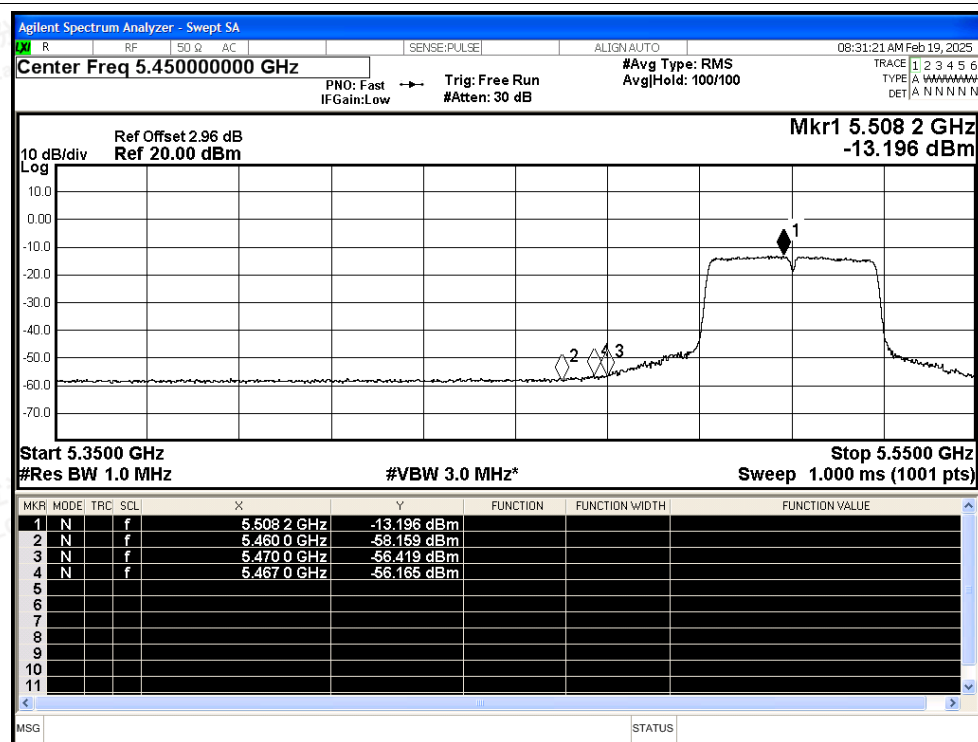

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant4 Peak

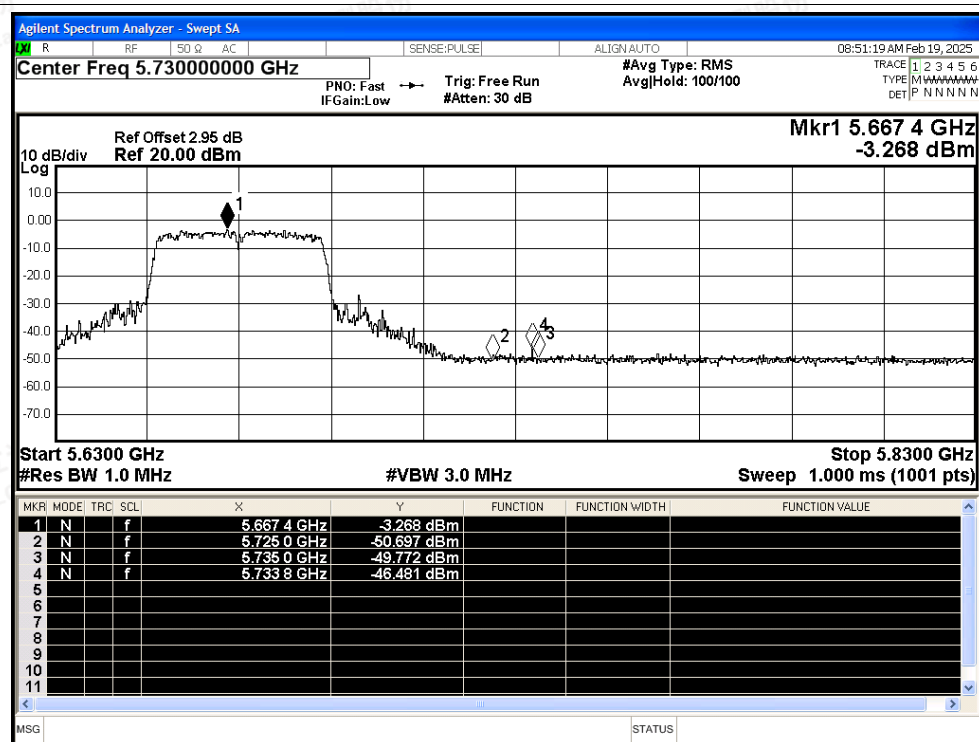

Restrict Band NVNT n40 5670MHz Ant4 Average

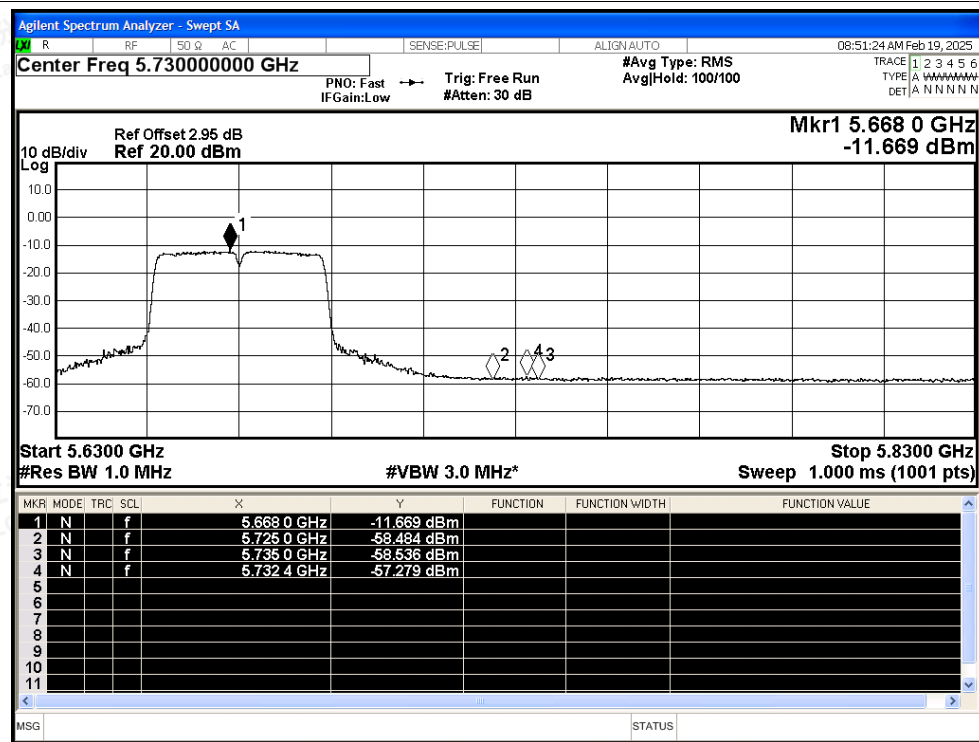

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz Ant4 Peak

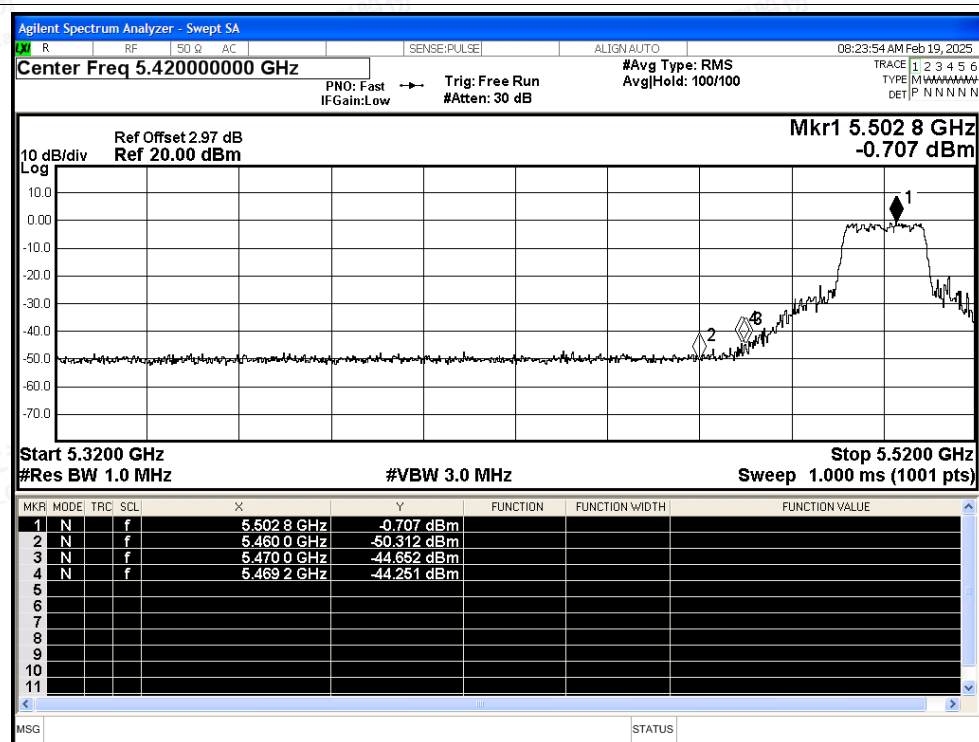

Restrict Band NVNT ac20 5500MHz Ant4 Average

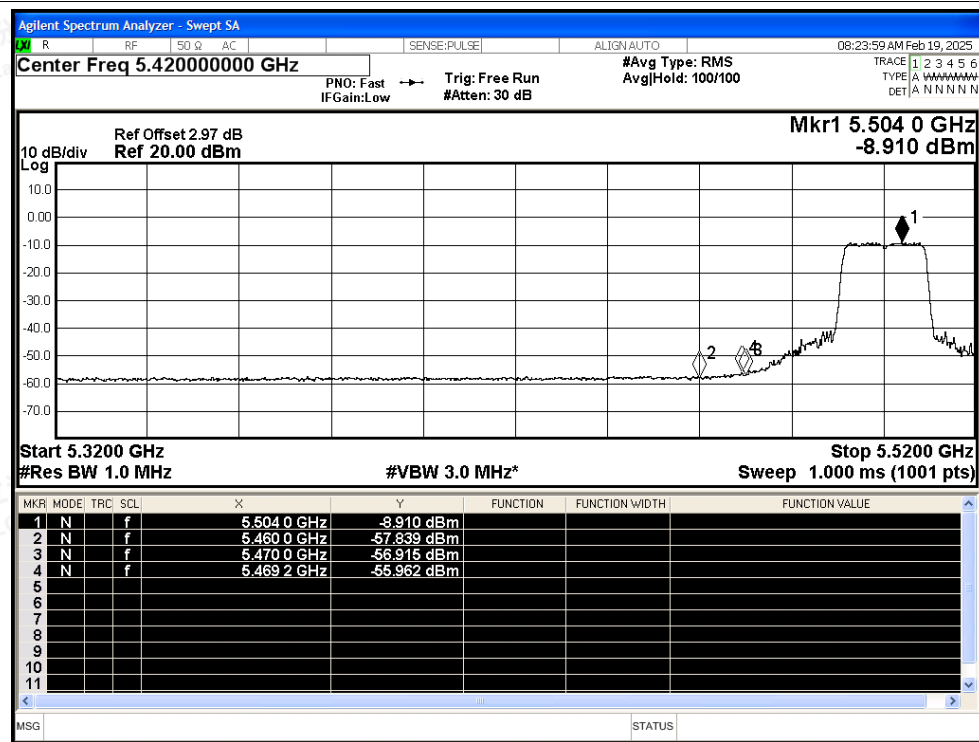

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant4 Peak

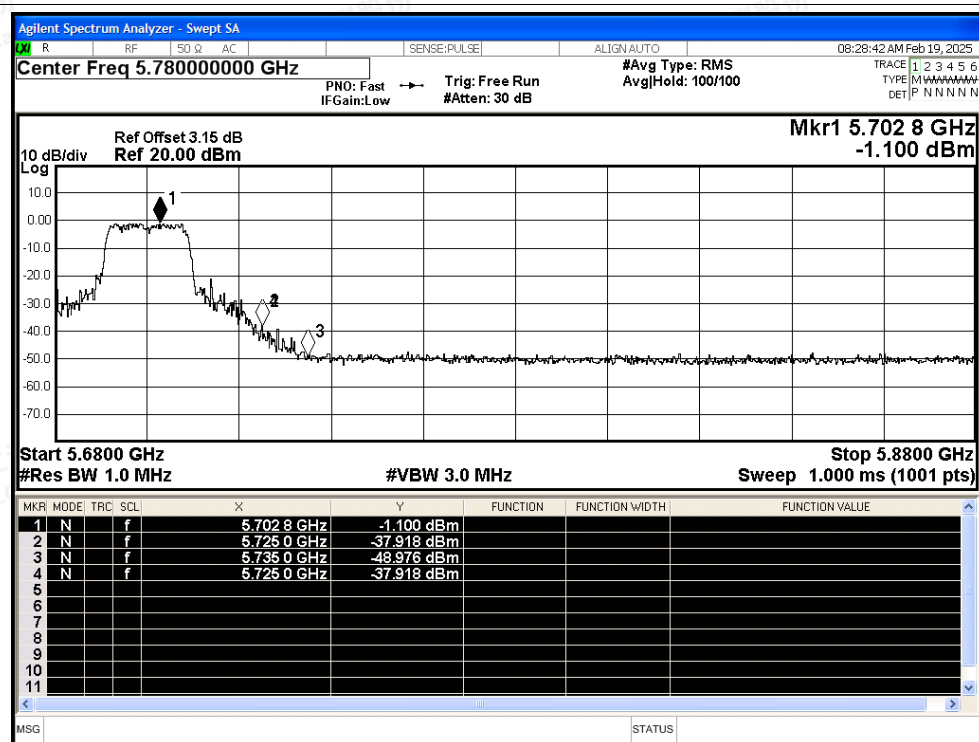

Restrict Band NVNT ac20 5700MHz Ant4 Average

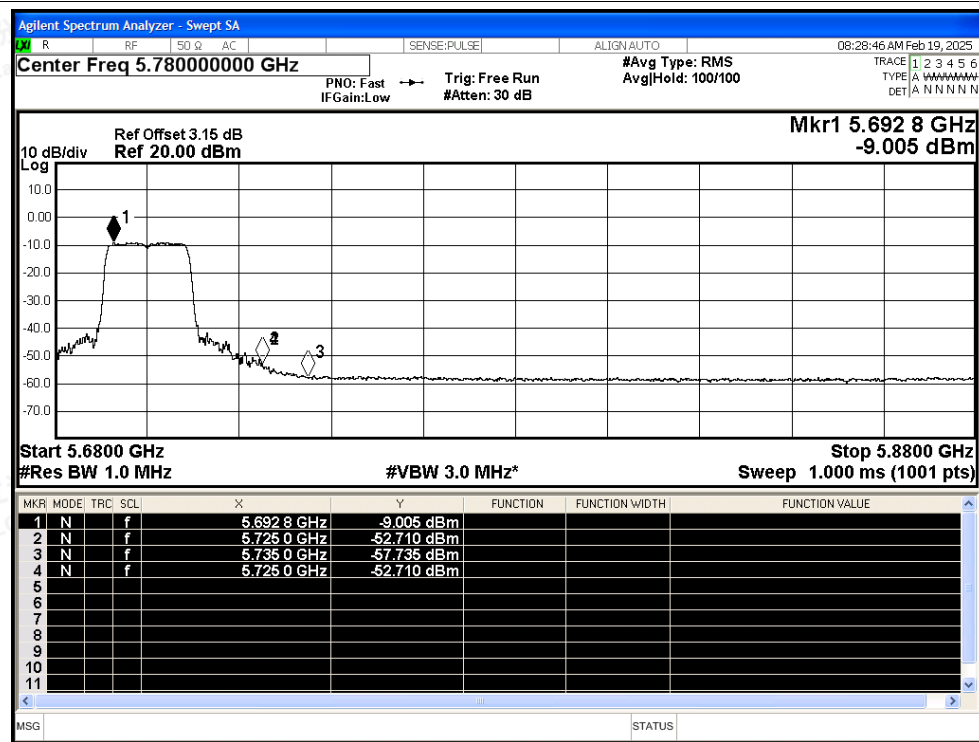

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant4 Peak

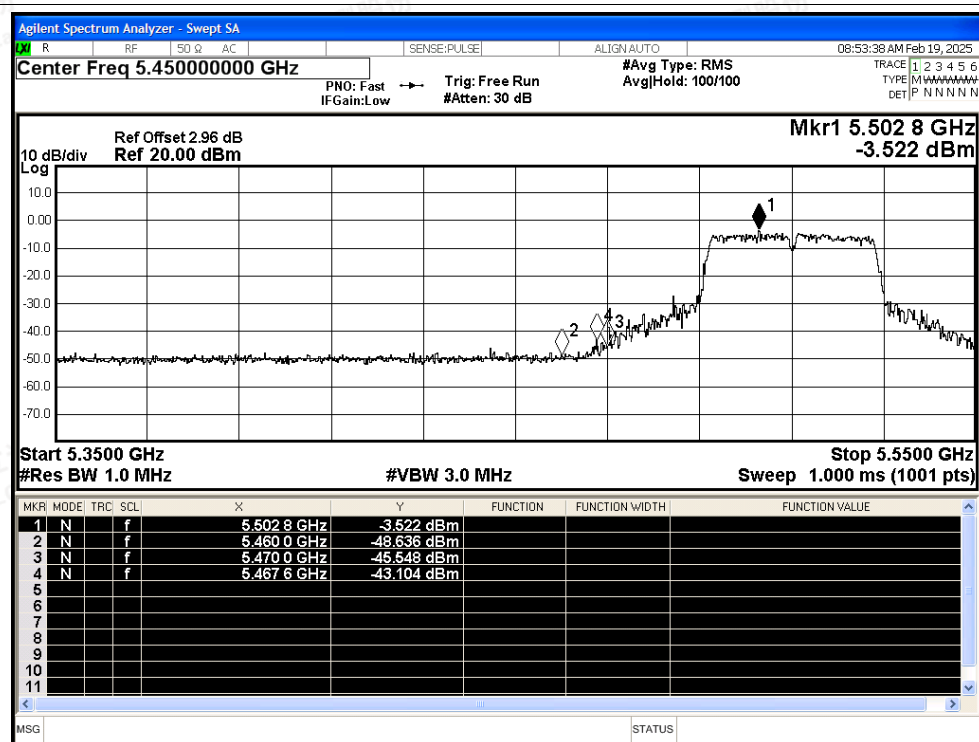

Restrict Band NVNT ac40 5510MHz Ant4 Average

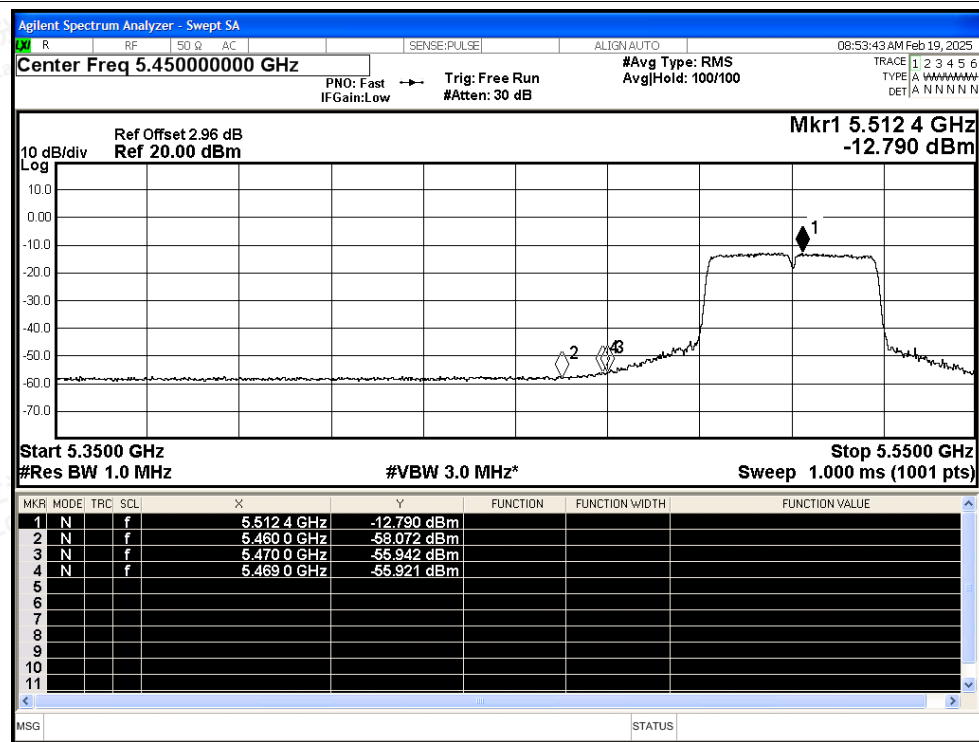

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant4 Peak

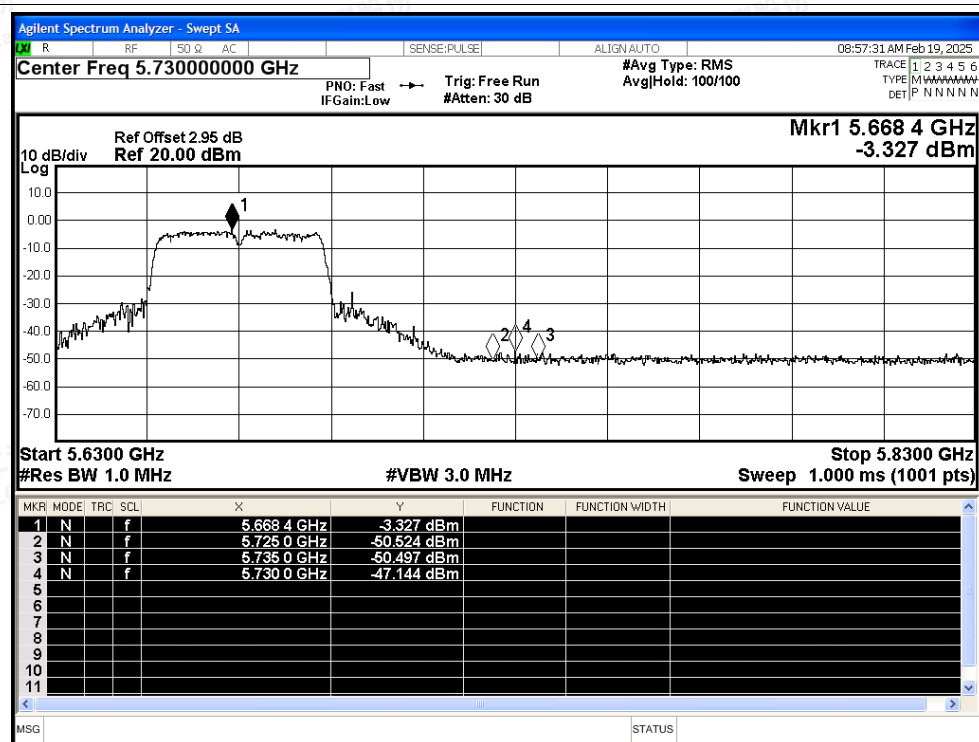

Restrict Band NVNT ac40 5670MHz Ant4 Average

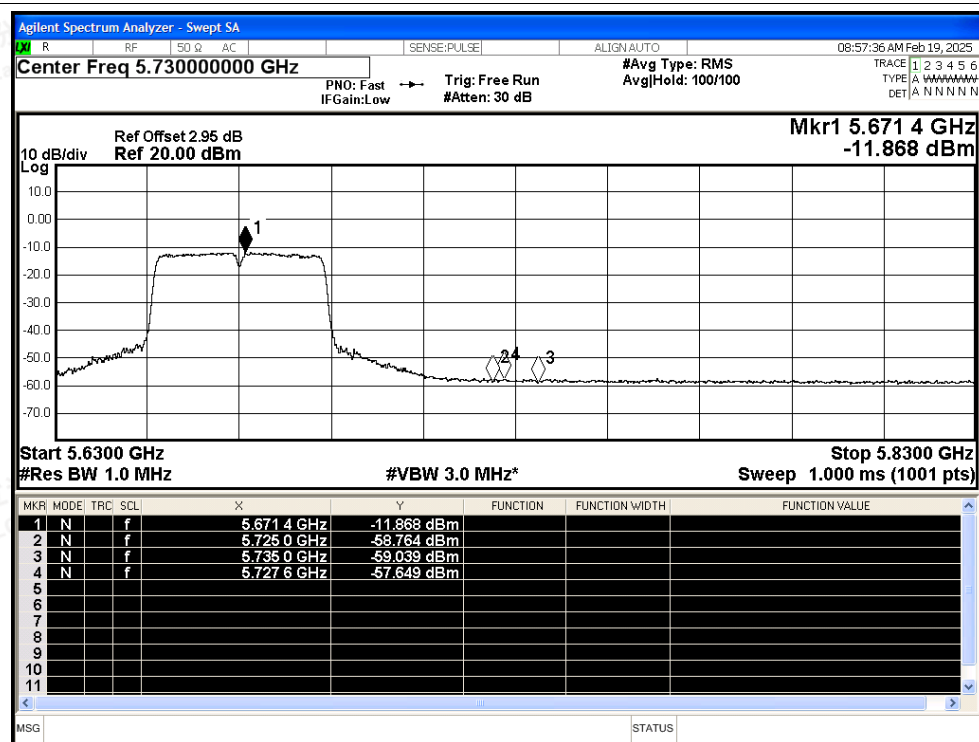

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant4 Peak

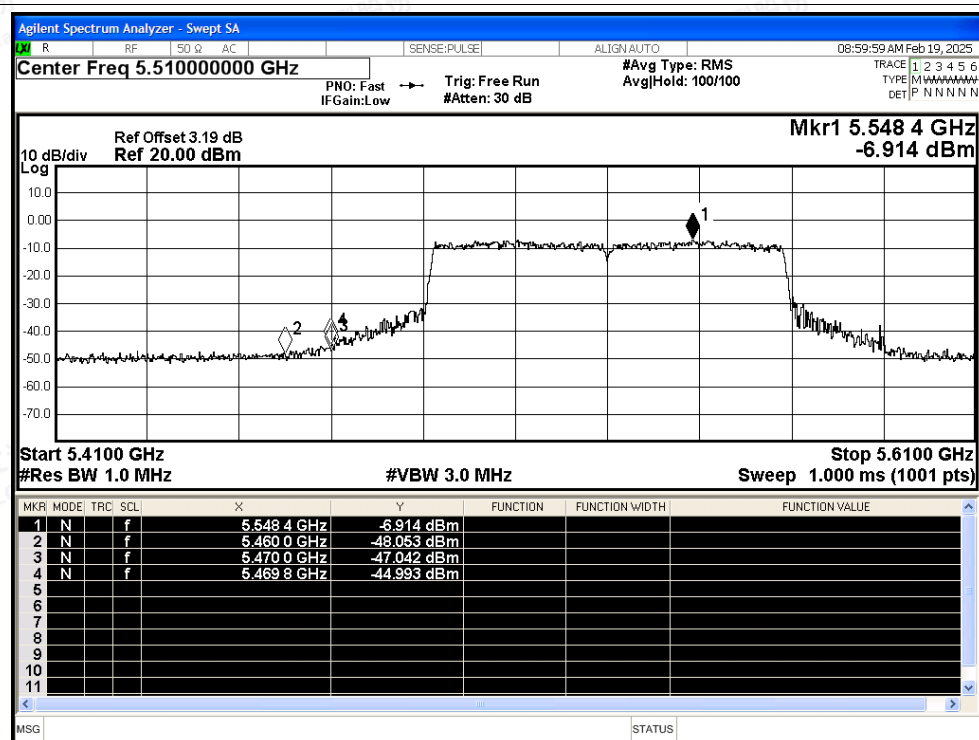

Restrict Band NVNT ac80 5530MHz Ant4 Average

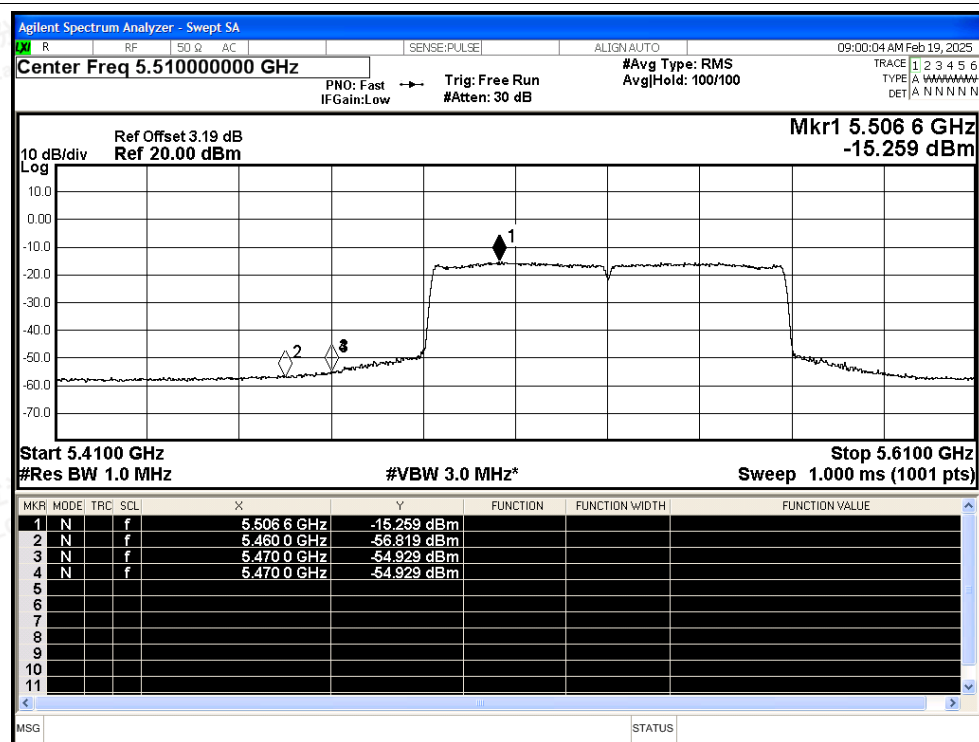

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant4 Peak

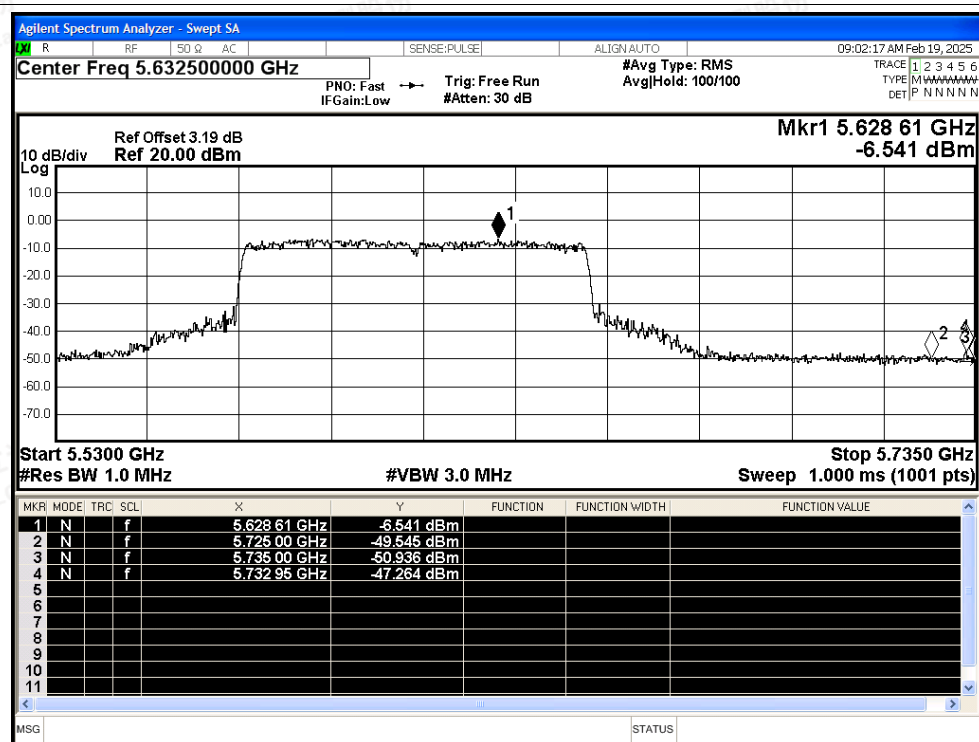

Restrict Band NVNT ac80 5610MHz Ant4 Average

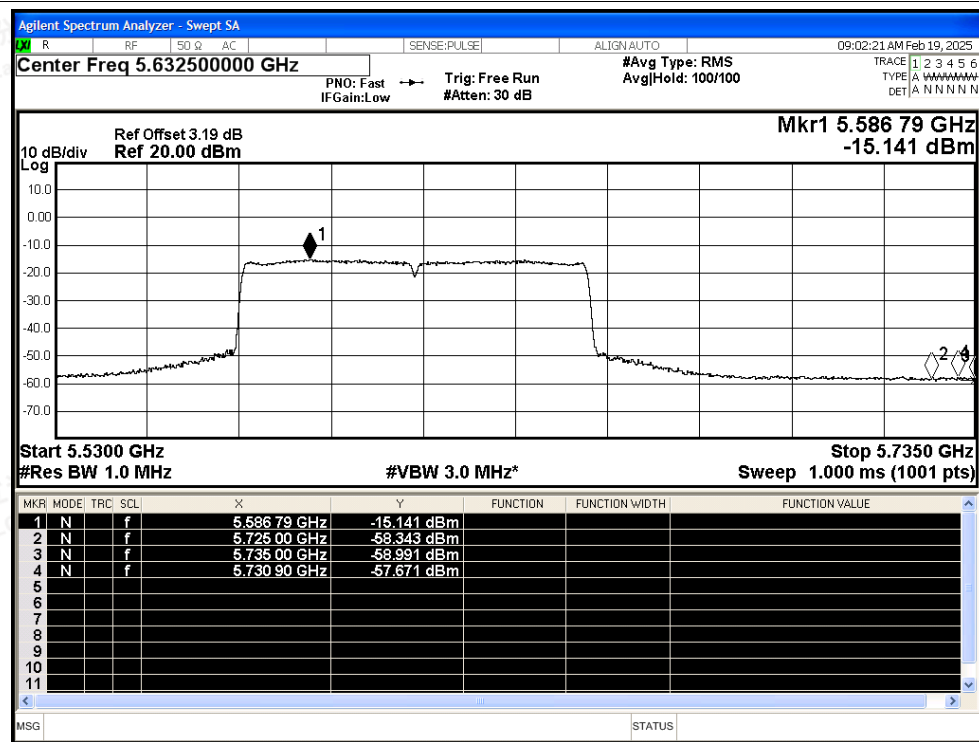

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant3 Power (dBm)	Ant4 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-50.57	-48.78	6.00	54.65	Peak	68.2	Pass
NVNT	n20	5500	5460	-57.75	-58.12	6.00	46.31	Average	54	Pass
NVNT	n20	5500	5469.2	-44.77	-44.16	6.00	59.78	Peak	68.2	Pass
NVNT	n20	5500	5470	-56.22	-55.07	6.00	48.63	Average	54	Pass
NVNT	n20	5500	5470	-45.32	-46.93	6.00	58.19	Peak	68.2	Pass
NVNT	n20	5500	5470	-57.25	-56.21	6.00	47.54	Average	54	Pass
NVNT	n20	5700	5725	-40.29	-39.5	6.00	64.36	Peak	68.2	Pass
NVNT	n20	5700	5725	-54.37	-54.1	6.00	50.00	Average	54	Pass
NVNT	n20	5700	5725.8	-40.01	-39.16	6.00	64.67	Peak	68.2	Pass
NVNT	n20	5700	5725.4	-54.16	-53.22	6.00	50.57	Average	54	Pass
NVNT	n20	5700	5735	-48.79	-49.42	6.00	55.14	Peak	68.2	Pass
NVNT	n20	5700	5735	-57.58	-57.58	6.00	46.66	Average	54	Pass
NVNT	n40	5510	5460	-50.04	-50.9	6.00	53.79	Peak	68.2	Pass
NVNT	n40	5510	5460	-57.96	-58.16	6.00	46.18	Average	54	Pass
NVNT	n40	5510	5466.8	-43.17	-41.07	6.00	62.24	Peak	68.2	Pass
NVNT	n40	5510	5468	-55.28	-56.17	6.00	48.54	Average	54	Pass
NVNT	n40	5510	5470	-43.8	-46.83	6.00	59.18	Peak	68.2	Pass
NVNT	n40	5510	5470	-55.72	-56.42	6.00	48.18	Average	54	Pass
NVNT	n40	5670	5725	-49.52	-50.7	6.00	54.17	Peak	68.2	Pass
NVNT	n40	5670	5725	-58.35	-58.48	6.00	45.82	Average	54	Pass
NVNT	n40	5670	5735	-48.12	-46.48	6.00	57.01	Peak	68.2	Pass
NVNT	n40	5670	5726	-57.56	-57.28	6.00	46.82	Average	54	Pass
NVNT	n40	5670	5735	-50.73	-49.77	6.00	54.01	Peak	68.2	Pass
NVNT	n40	5670	5735	-58.25	-58.54	6.00	45.85	Average	54	Pass
NVNT	ac20	5500	5460	-49.59	-50.31	6.00	54.30	Peak	68.2	Pass
NVNT	ac20	5500	5460	-57.57	-57.84	6.00	46.53	Average	54	Pass
NVNT	ac20	5500	5465	-44.15	-44.25	6.00	60.04	Peak	68.2	Pass
NVNT	ac20	5500	5469	-55.67	-55.96	6.00	48.43	Average	54	Pass
NVNT	ac20	5500	5470	-46.72	-44.65	6.00	58.68	Peak	68.2	Pass
NVNT	ac20	5500	5470	-55.89	-56.92	6.00	47.86	Average	54	Pass
NVNT	ac20	5700	5725	-41.17	-37.92	6.00	64.99	Peak	68.2	Pass
NVNT	ac20	5700	5725	-54.49	-52.71	6.00	50.73	Average	54	Pass
NVNT	ac20	5700	5727.6	-40.13	-37.92	6.00	65.35	Peak	68.2	Pass
NVNT	ac20	5700	5725	-53.56	-52.71	6.00	51.12	Average	54	Pass
NVNT	ac20	5700	5735	-48.37	-48.98	6.00	55.57	Peak	68.2	Pass
NVNT	ac20	5700	5735	-57.57	-57.74	6.00	46.58	Average	54	Pass
NVNT	ac40	5510	5460	-50.39	-48.64	6.00	54.81	Peak	68.2	Pass
NVNT	ac40	5510	5460	-57.89	-58.07	6.00	46.26	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	5468.6	-42.64	-43.1	6.00	61.37	Peak	68.2	Pass
NVNT	ac40	5510	5470	-55.23	-55.92	6.00	48.68	Average	54	Pass
NVNT	ac40	5510	5470	-45.4	-45.55	6.00	58.76	Peak	68.2	Pass
NVNT	ac40	5510	5470	-55.4	-55.94	6.00	48.58	Average	54	Pass
NVNT	ac40	5670	5725	-49.25	-50.52	6.00	54.40	Peak	68.2	Pass
NVNT	ac40	5670	5725	-57.82	-58.76	6.00	45.97	Average	54	Pass
NVNT	ac40	5670	5733.8	-47.26	-47.14	6.00	57.04	Peak	68.2	Pass
NVNT	ac40	5670	5727.8	-57.62	-57.65	6.00	46.60	Average	54	Pass
NVNT	ac40	5670	5735	-49.7	-50.5	6.00	54.16	Peak	68.2	Pass
NVNT	ac40	5670	5735	-57.85	-59.04	6.00	45.83	Average	54	Pass
NVNT	ac80	5530	5460	-47.27	-48.05	6.00	56.60	Peak	68.2	Pass
NVNT	ac80	5530	5460	-57.04	-56.82	6.00	47.31	Average	54	Pass
NVNT	ac80	5530	5469.4	-42.18	-44.99	6.00	60.88	Peak	68.2	Pass
NVNT	ac80	5530	5469.8	-54.77	-54.93	6.00	49.39	Average	54	Pass
NVNT	ac80	5530	5470	-44.58	-47.04	6.00	58.60	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.33	-54.93	6.00	49.11	Average	54	Pass
NVNT	ac80	5610	5725	-50.45	-49.55	6.00	54.26	Peak	68.2	Pass
NVNT	ac80	5610	5725	-58.59	-58.34	6.00	45.77	Average	54	Pass
NVNT	ac80	5610	5727.21	-47.23	-47.26	6.00	56.99	Peak	68.2	Pass
NVNT	ac80	5610	5731.105	-57.47	-57.67	6.00	46.67	Average	54	Pass
NVNT	ac80	5610	5735	-52.23	-50.94	6.00	52.70	Peak	68.2	Pass
NVNT	ac80	5610	5735	-57.85	-58.99	6.00	45.86	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5500	0	0	25	Pass
NVNT	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
NVNT	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant1	5700	0	0	25	Pass
NVNT	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac20	5500	Ant1	5500	0	0	25	Pass
NVNT	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant1	5510	0	0	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant1

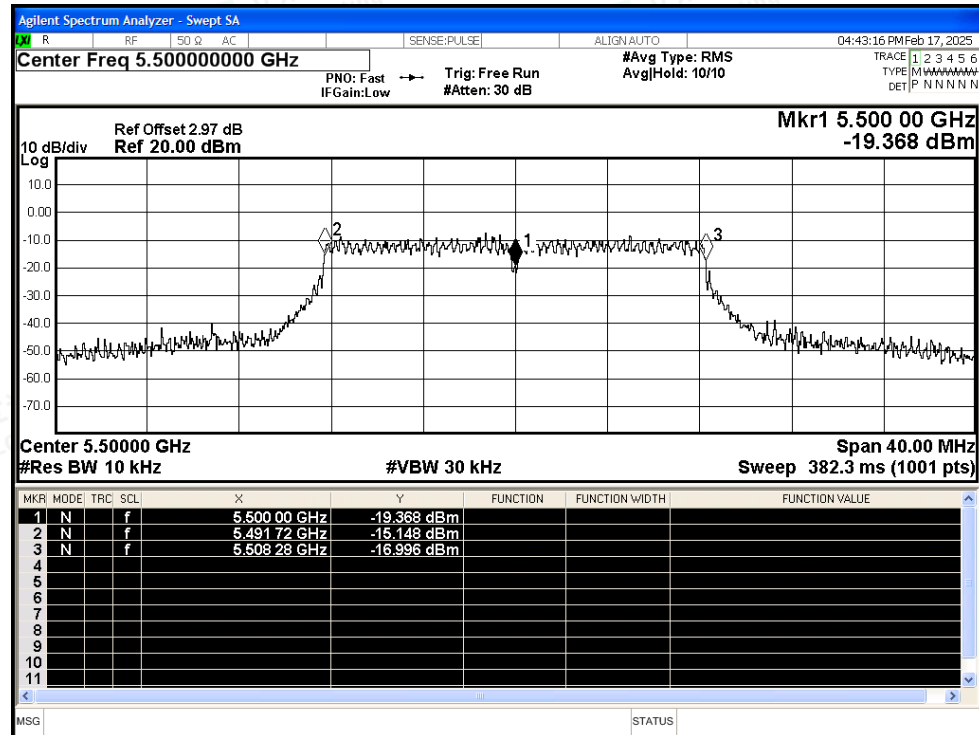

Freq. Stability NVNT a 5580MHz Ant1

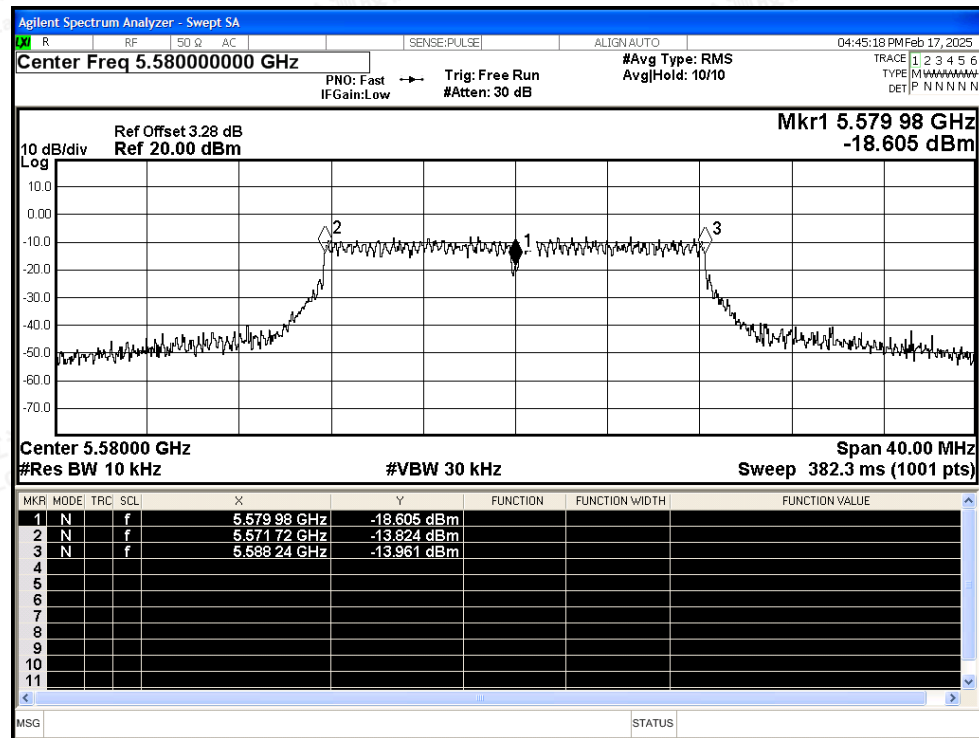

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant1

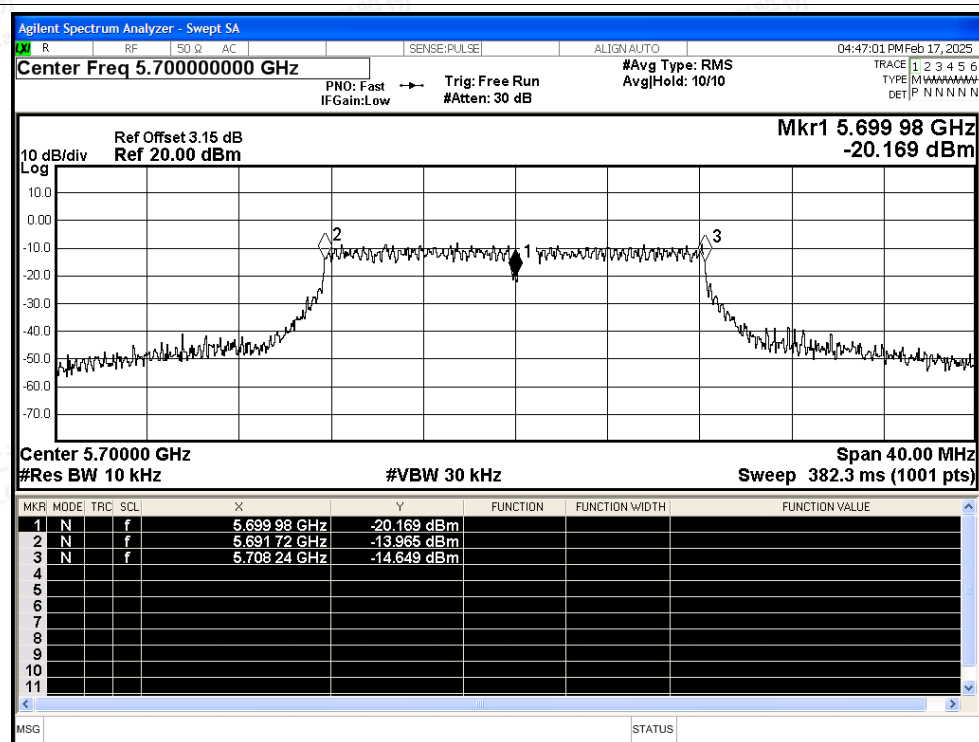

Freq. Stability NVNT n20 5500MHz Ant1

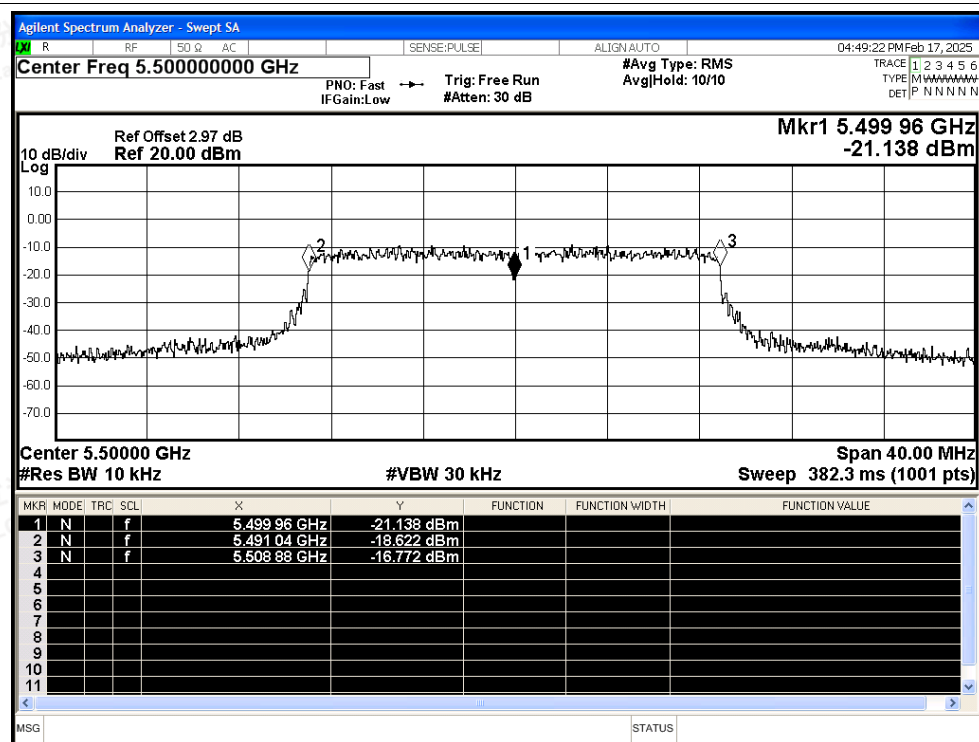

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5580MHz Ant1

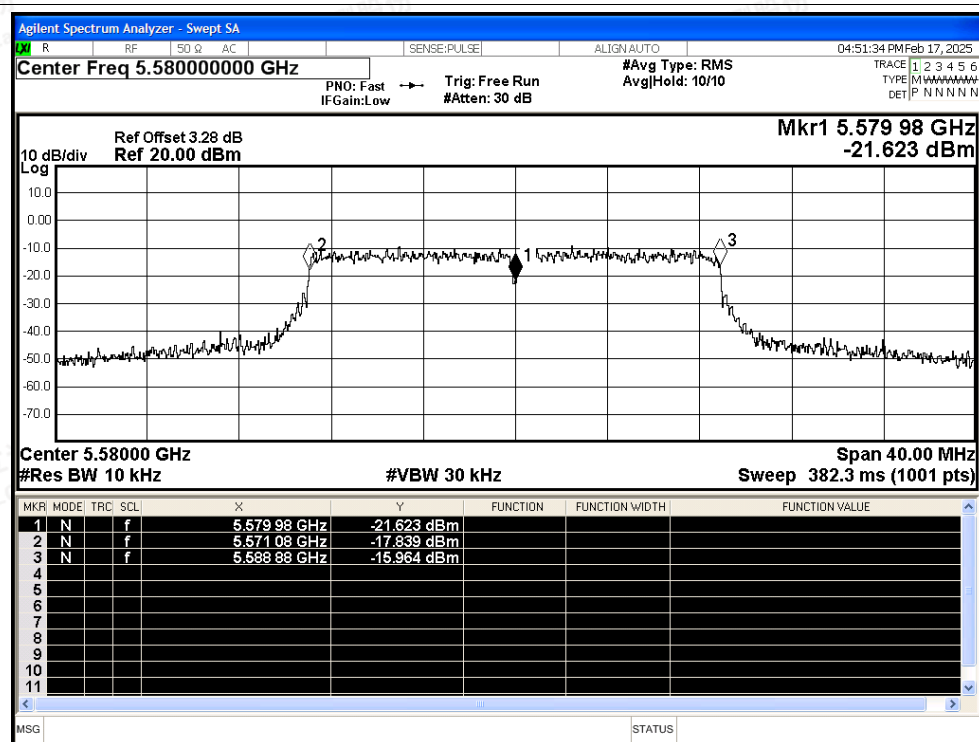

Freq. Stability NVNT n20 5700MHz Ant1

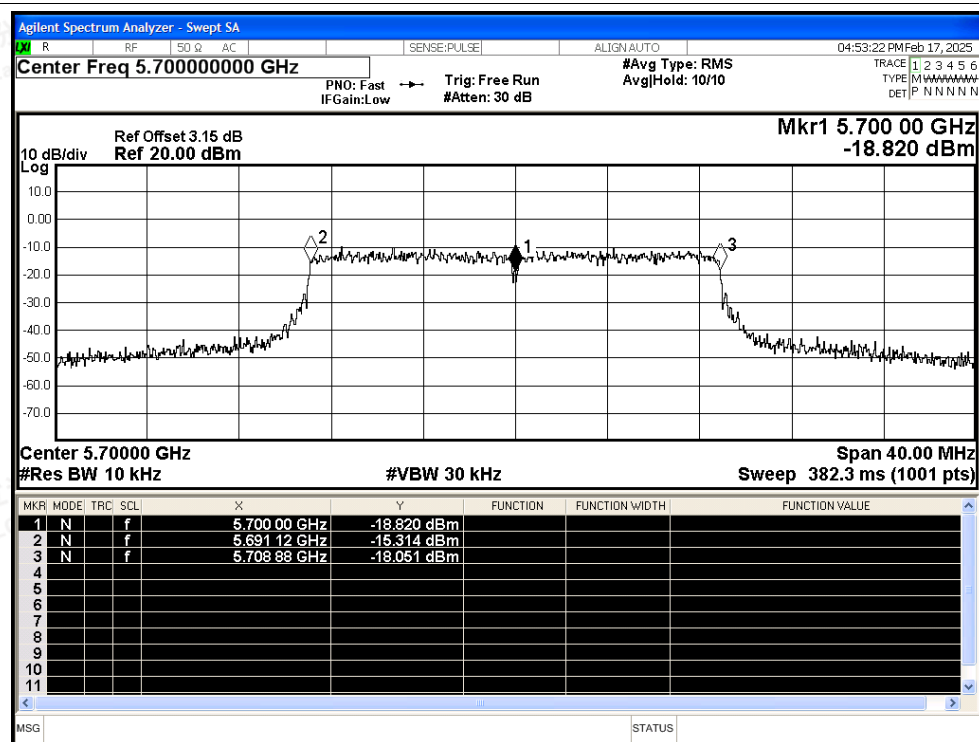

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant1

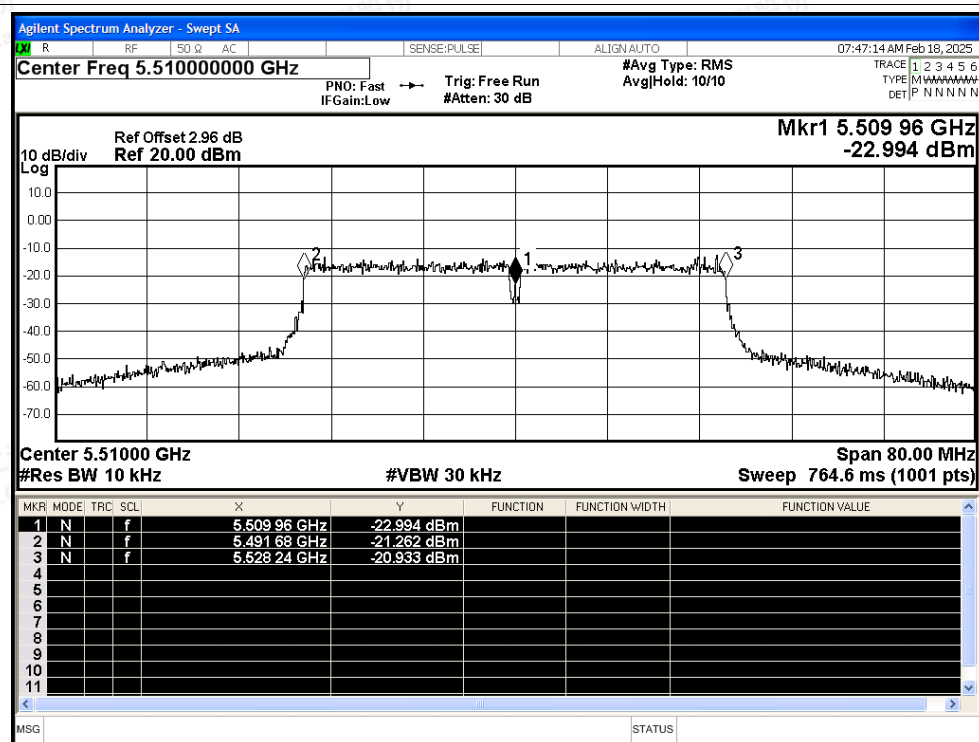

Freq. Stability NVNT n40 5550MHz Ant1

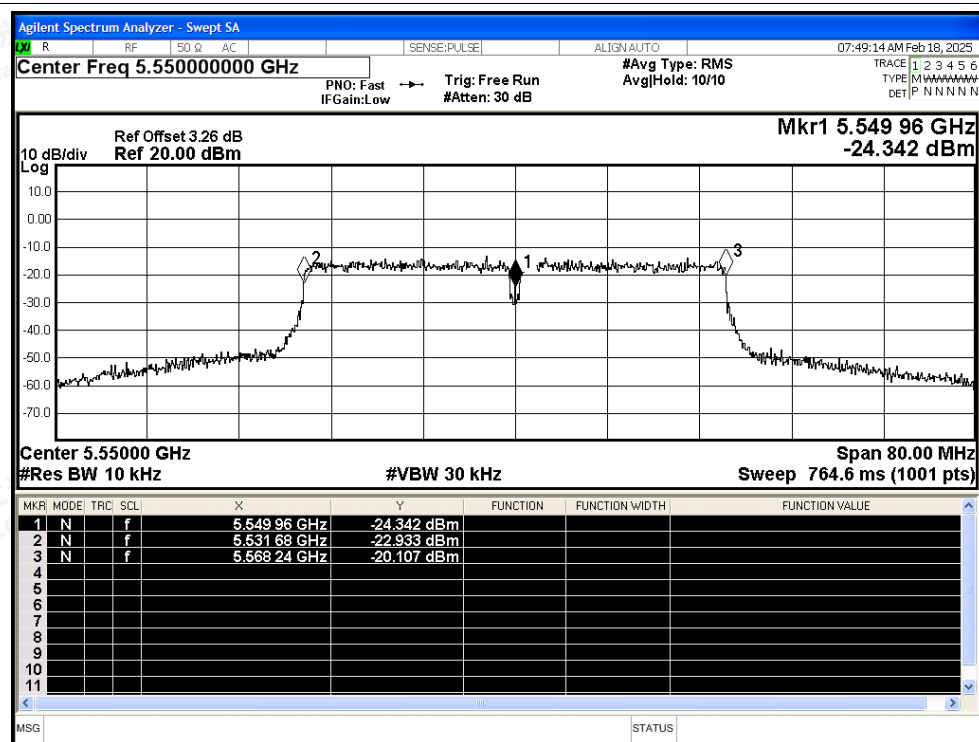

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant1

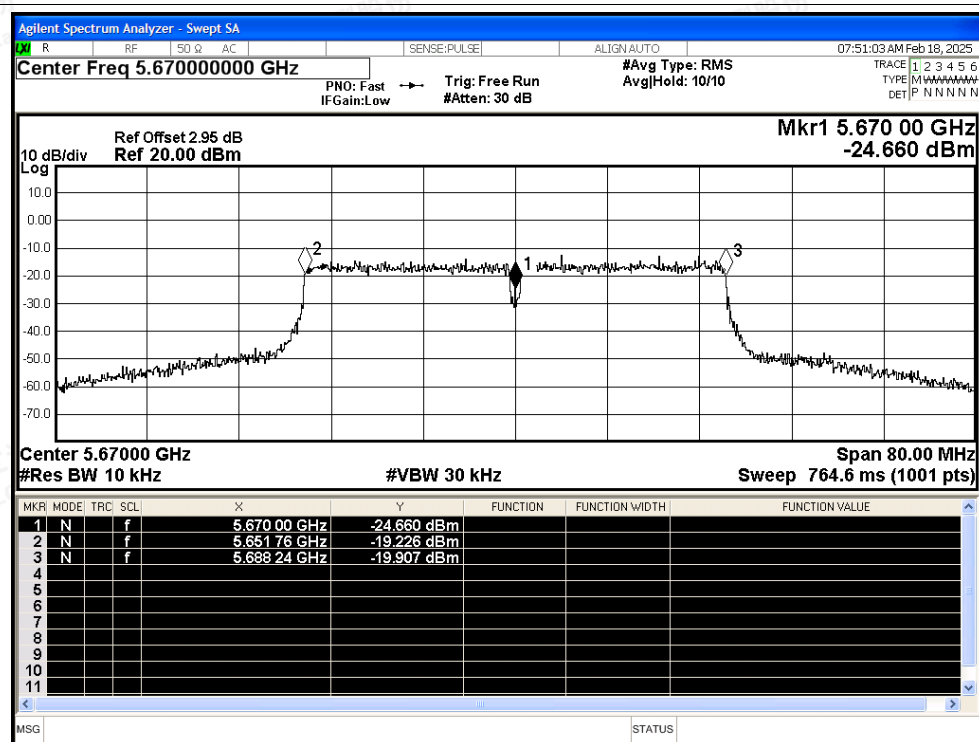

Freq. Stability NVNT ac20 5500MHz Ant1

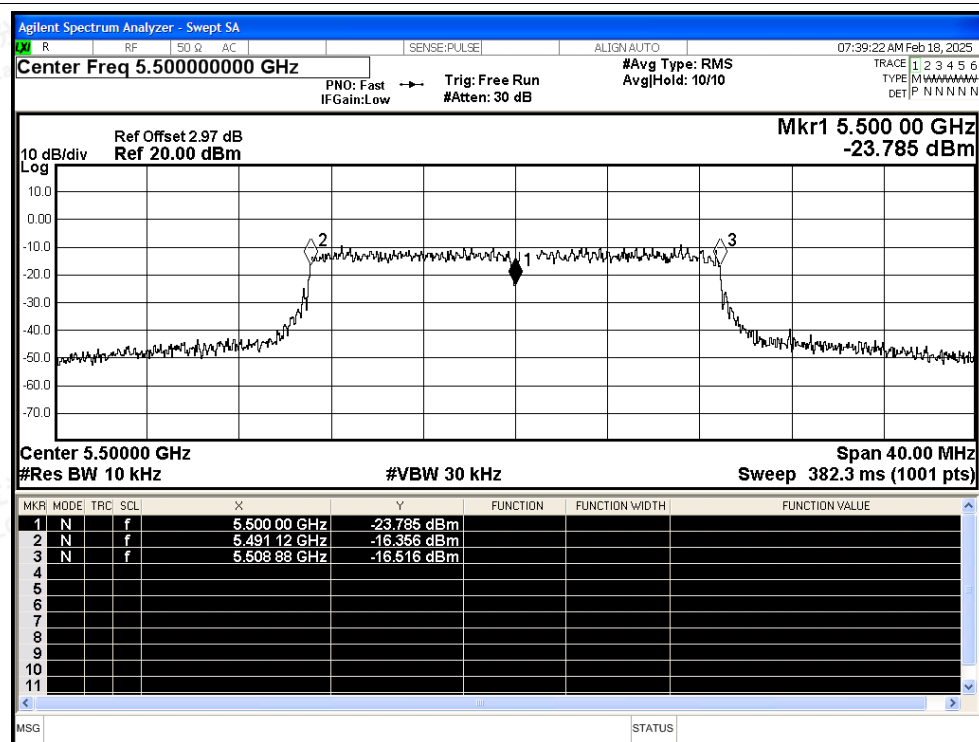

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant1

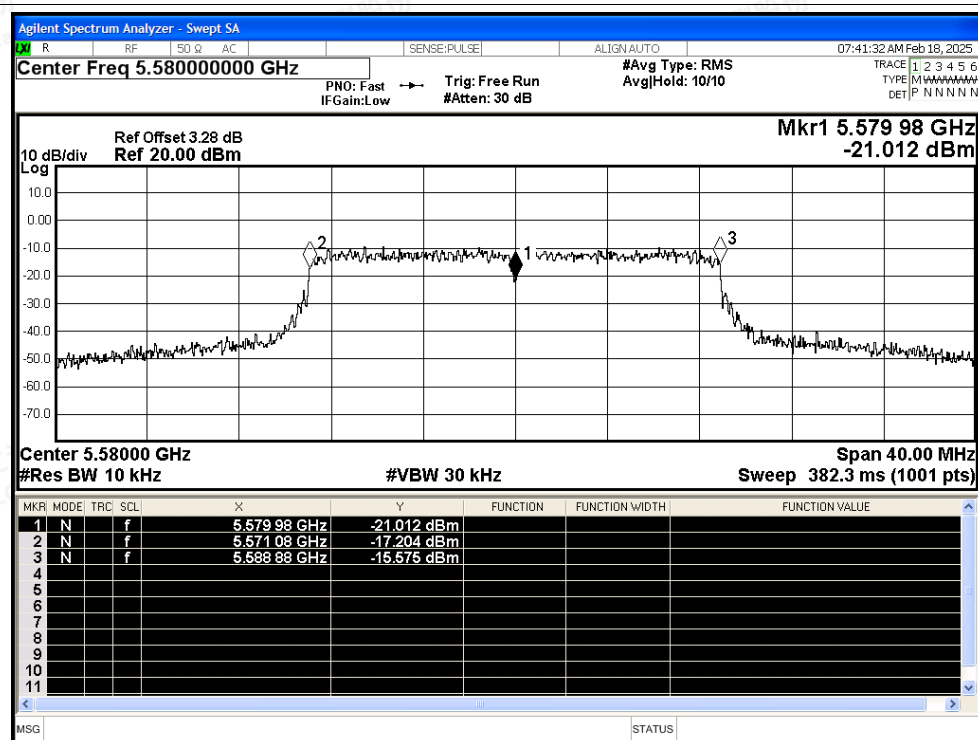

Freq. Stability NVNT ac20 5700MHz Ant1

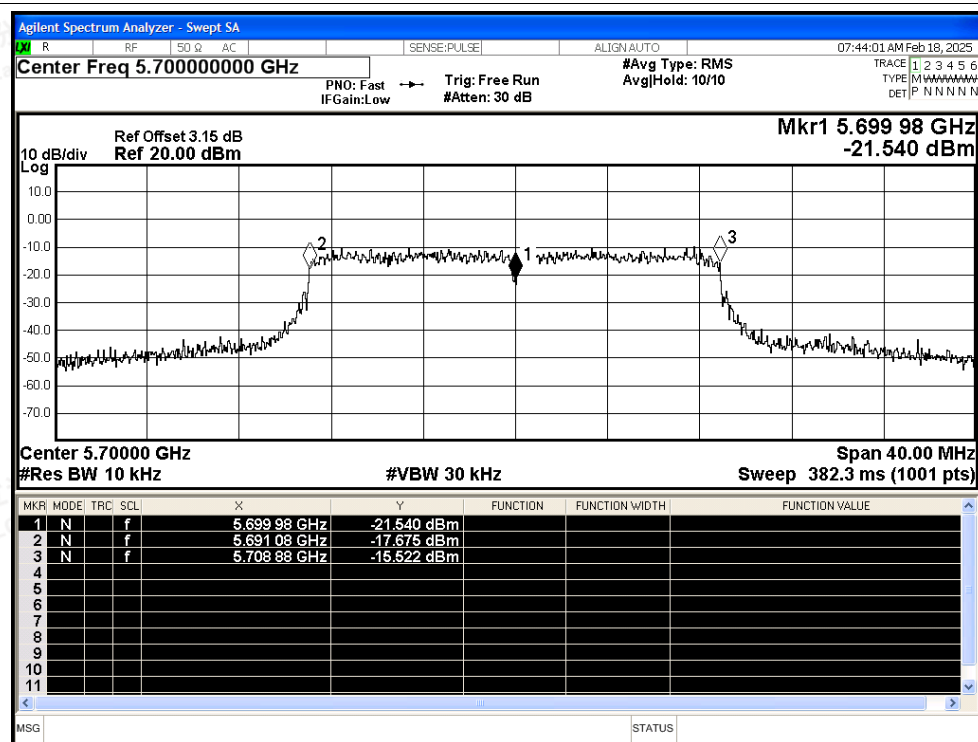

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant1

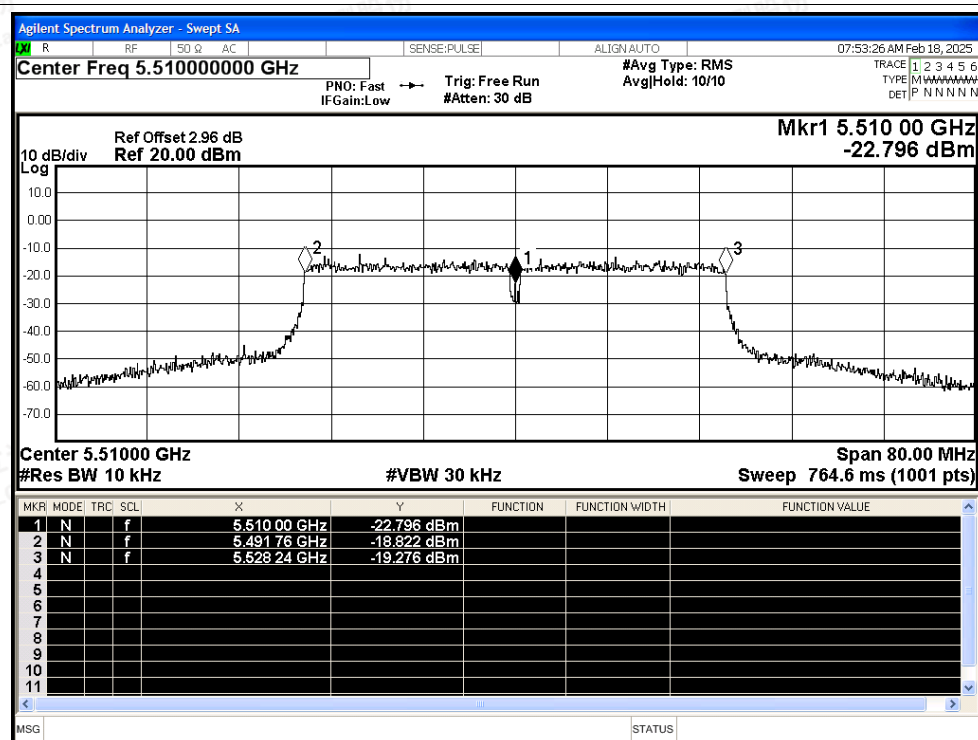

Freq. Stability NVNT ac40 5550MHz Ant1

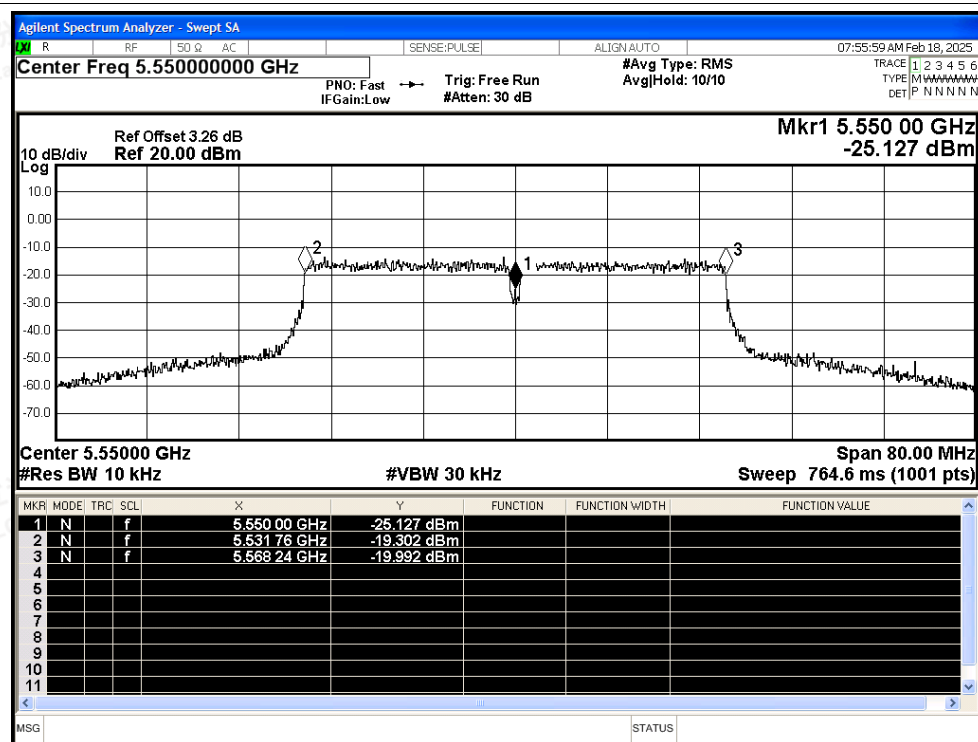

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant1

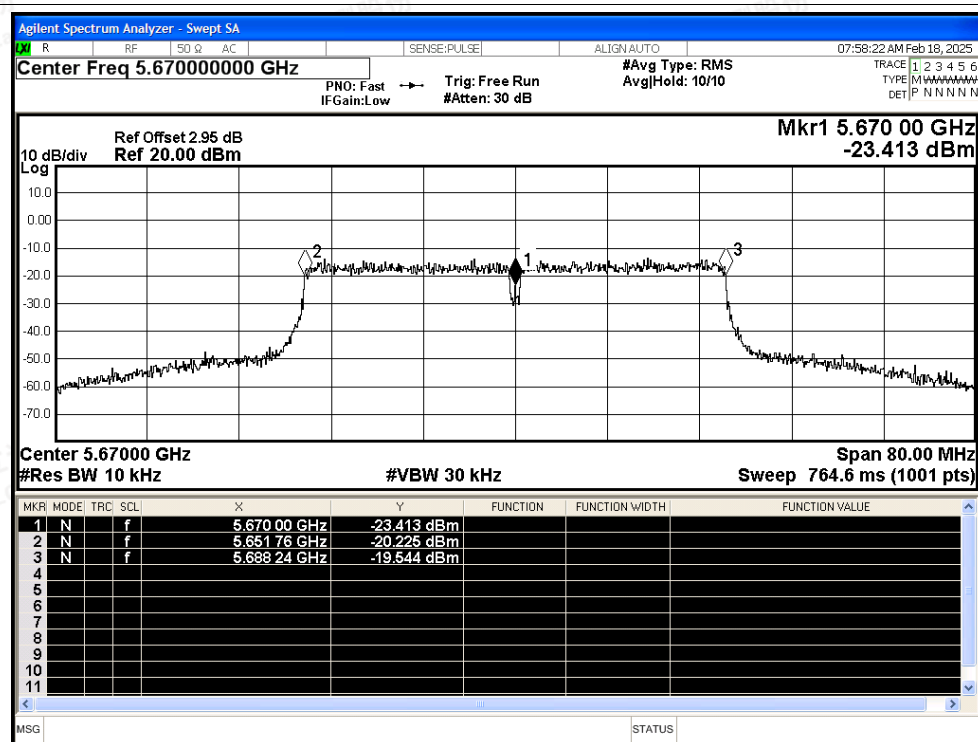

Freq. Stability NVNT ac80 5530MHz Ant1

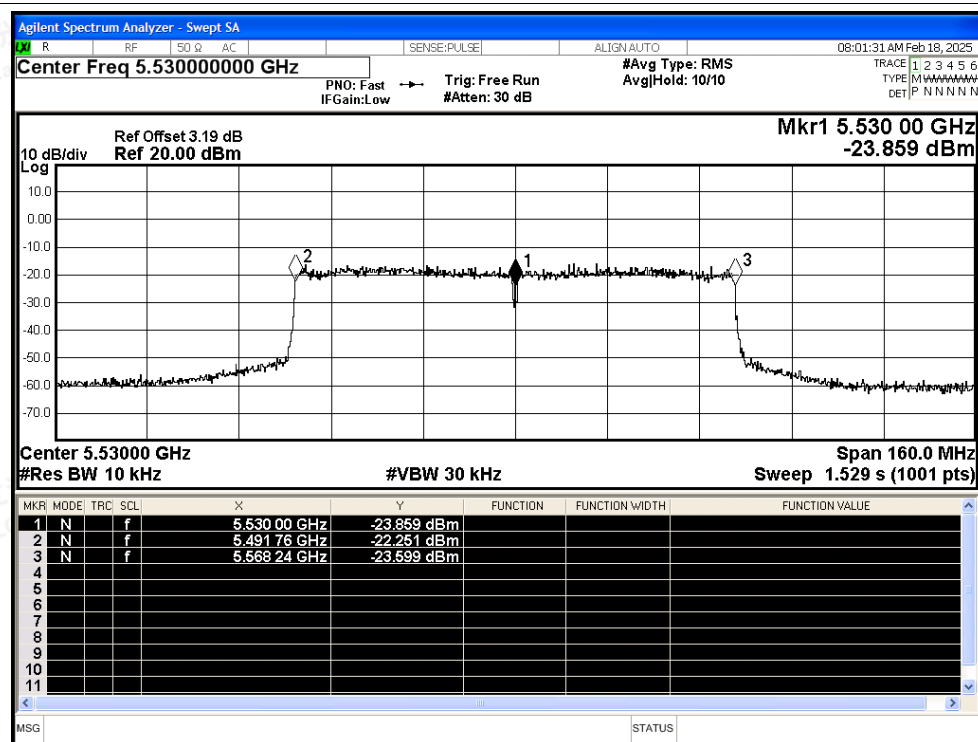


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

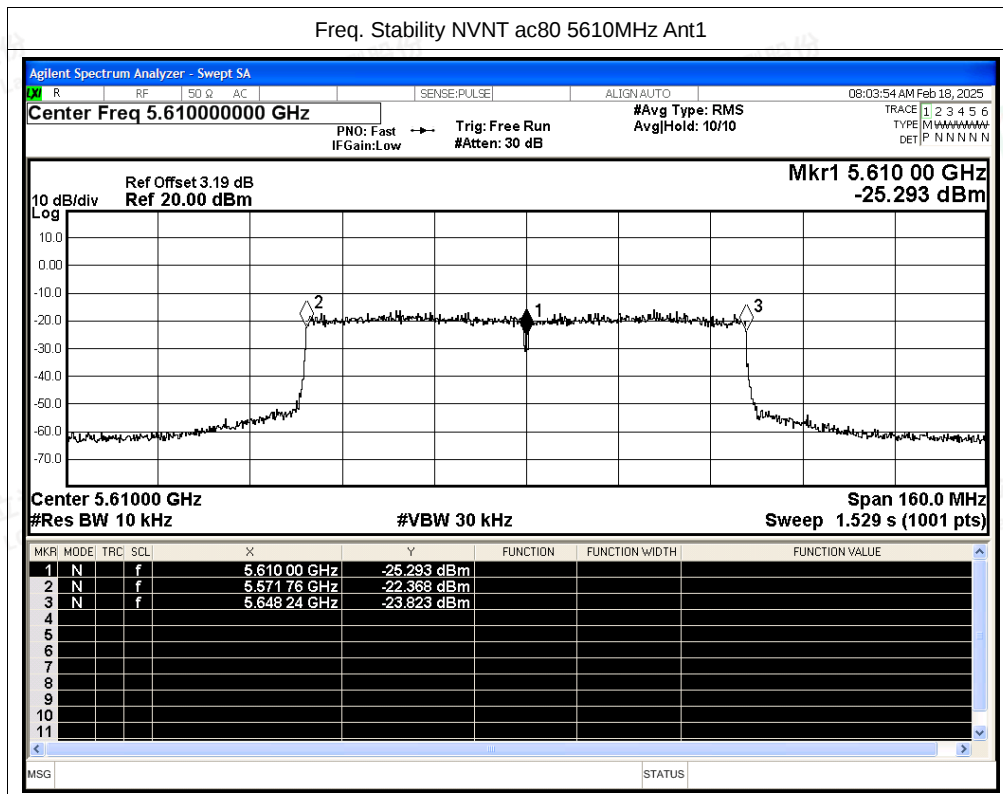

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant2	5700	0	0	25	Pass
NVNT	n20	5500	Ant2	5499.96	-40000	-7.27	25	Pass
NVNT	n20	5580	Ant2	5580	0	0	25	Pass
NVNT	n20	5700	Ant2	5700	0	0	25	Pass
NVNT	n40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac20	5500	Ant2	5499.96	-40000	-7.27	25	Pass
NVNT	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant2	5510	0	0	25	Pass
NVNT	ac40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac80	5530	Ant2	5530	0	0	25	Pass
NVNT	ac80	5610	Ant2	5610	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant2

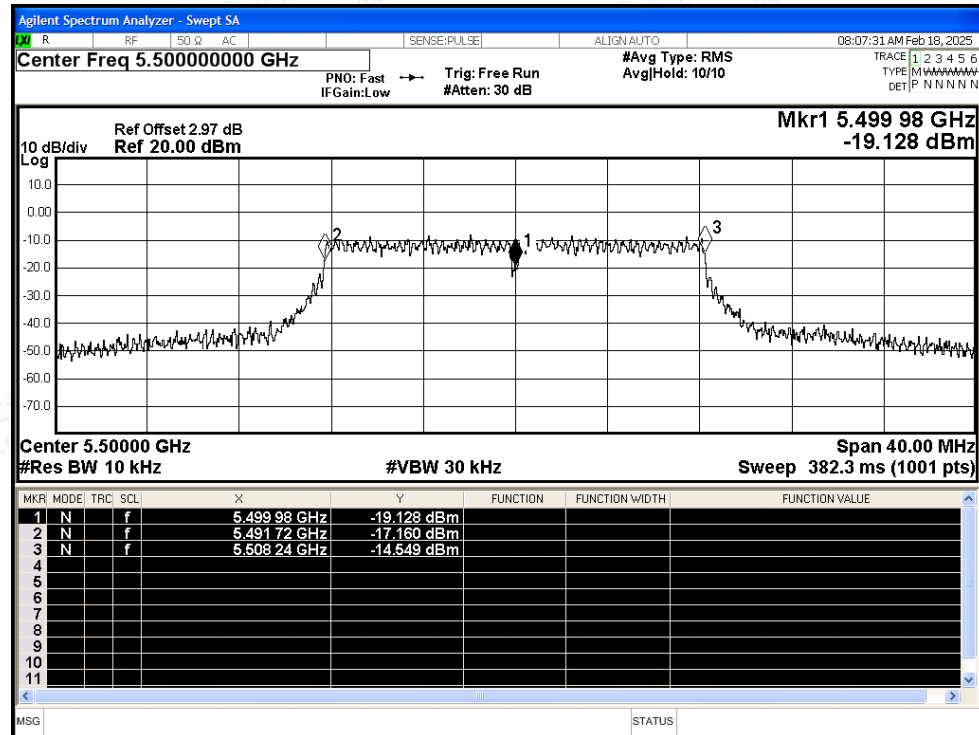

Freq. Stability NVNT a 5580MHz Ant2

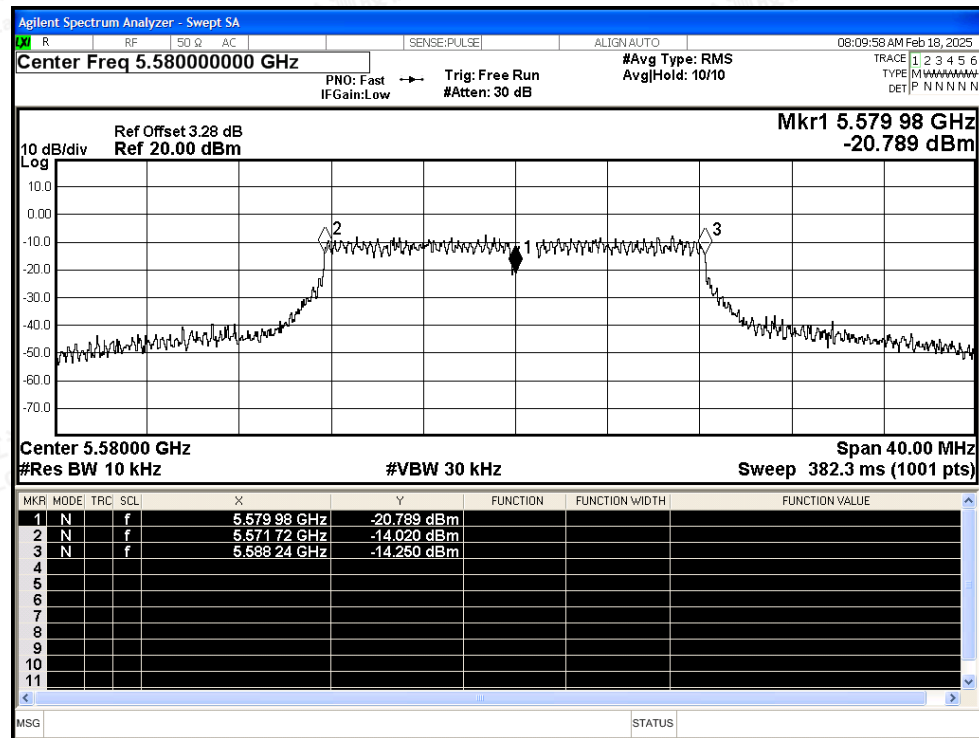

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity