




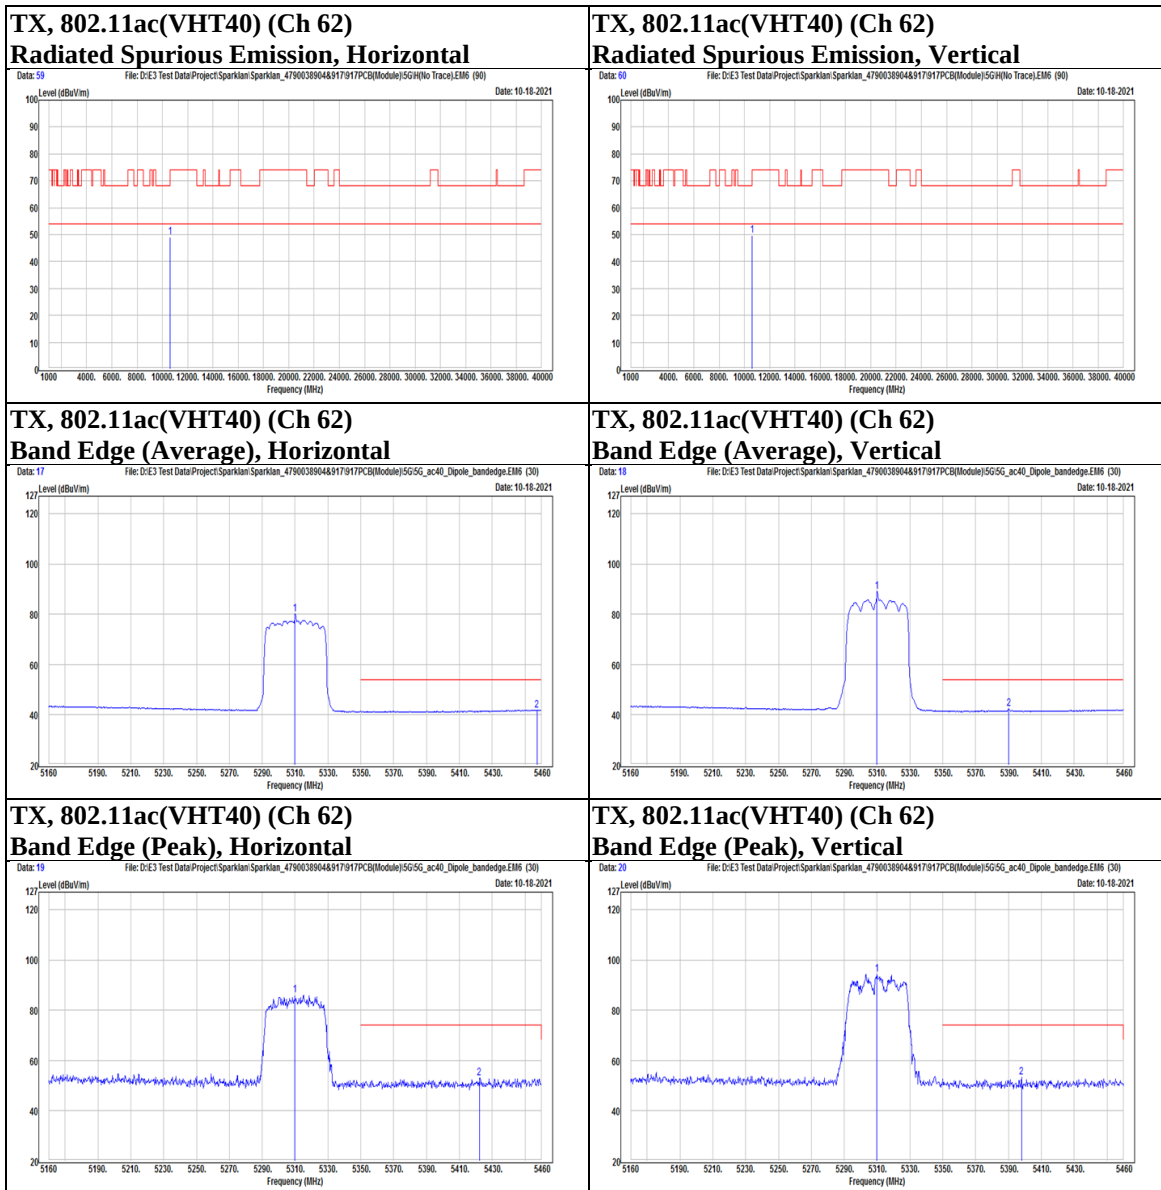

Test report No. : 4790038917A-US-R1-V0
Page : 207 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5429.75	40.31	13.57	53.88	74	-20.12	PK
		5429.75	28	13.57	41.57	54	-12.43	AVG
		5461.6	38.93	13.71	52.64	68.2	-15.56	PK
	@	5510	75.93	13.84	89.77	N/A	N/A	PK
	@	5510	65.8	13.84	79.64	N/A	N/A	AVG
	*	11020	31.33	18.32	49.65	74	-24.35	PK
Vertical		5410.5	40.1	13.47	53.57	74	-20.43	PK
		5410.5	28.2	13.47	41.67	54	-12.33	AVG
		5467.55	39.78	13.73	53.51	68.2	-14.69	PK
	@	5510	83.42	13.84	97.26	N/A	N/A	PK
	@	5510	72.9	13.84	86.74	N/A	N/A	AVG
	*	11020	31.69	18.32	50.01	74	-23.99	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 208 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

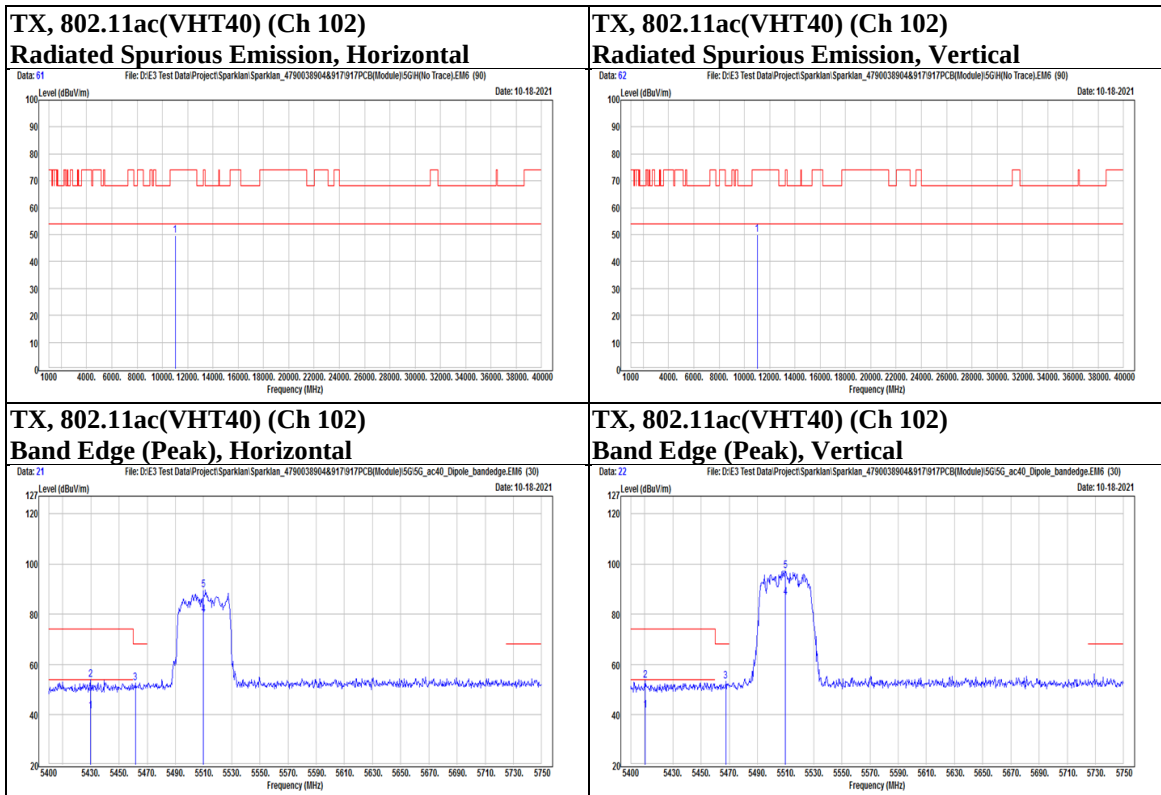

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 209 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT40)	Channel	110
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5449	39.72	13.67	53.39	74	-20.61	PK
		5449	28.1	13.67	41.77	54	-12.23	AVG
		5466.5	38.52	13.72	52.24	68.2	-15.96	PK
	@	5550	87.11	13.88	100.99	N/A	N/A	PK
	@	5550	77.31	13.88	91.19	N/A	N/A	AVG
		5739.15	39.97	14.25	54.22	68.2	-13.98	PK
	*	11100	31.55	18.49	50.04	74	-23.96	PK
Vertical		5452.5	40.4	13.67	54.07	74	-19.93	PK
		5452.5	28.31	13.67	41.98	54	-12.02	AVG
		5461.25	39.88	13.71	53.59	68.2	-14.61	PK
	@	5550	92.65	13.88	106.53	N/A	N/A	PK
	@	5550	82.51	13.88	96.39	N/A	N/A	AVG
		5737.05	40.48	14.24	54.72	68.2	-13.48	PK
	*	11100	31.16	18.49	49.65	74	-24.35	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917A-US-R1-V0
Page : 210 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT


TX, 802.11ac(VHT40) (Ch 110)
Radiated Spurious Emission, Horizontal

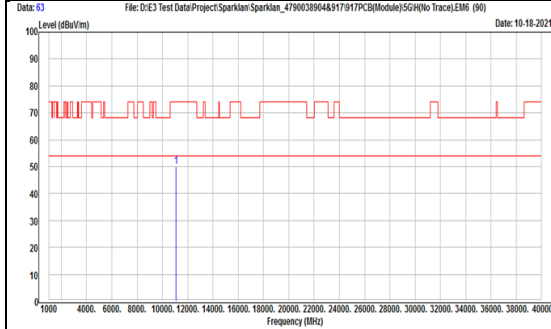


TX, 802.11ac(VHT40) (Ch 110)
Radiated Spurious Emission, Vertical

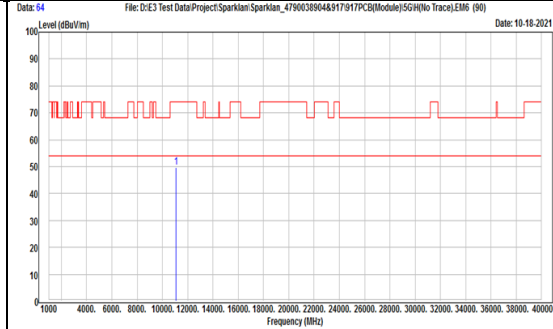

TX, 802.11ac(VHT40) (Ch 110)
Band Edge (Peak), Horizontal

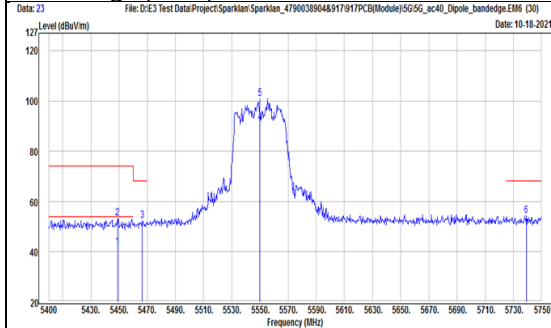

TX, 802.11ac(VHT40) (Ch 110)
Band Edge (Peak), Vertical

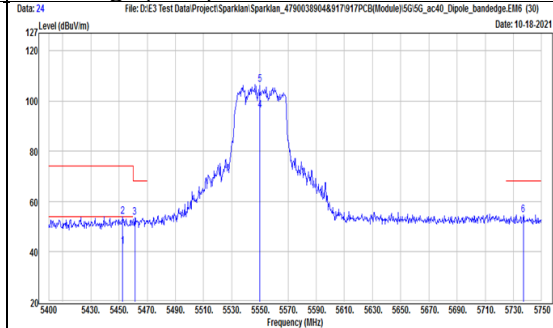

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 211 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT40)	Channel	134
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5670	83.37	14.02	97.39	N/A	N/A	PK
	@	5670	73.1	14.02	87.12	N/A	N/A	AVG
		5743.35	40.43	14.27	54.7	68.2	-13.5	PK
	*	11340	29.7	18.55	48.25	74	-25.75	PK
Vertical	@	5670	89.77	14.02	103.79	N/A	N/A	PK
	@	5670	79.3	14.02	93.32	N/A	N/A	AVG
		5732.5	40.33	14.22	54.55	68.2	-13.65	PK
	*	11340	30.78	18.55	49.33	74	-24.67	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917A-US-R1-V0
Page : 212 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT


TX, 802.11ac(VHT40) (Ch 134)
Radiated Spurious Emission, Horizontal

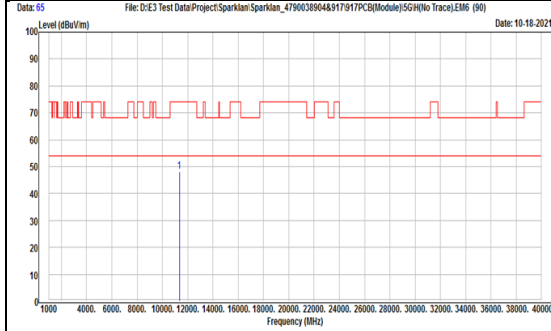


TX, 802.11ac(VHT40) (Ch 134)
Radiated Spurious Emission, Vertical

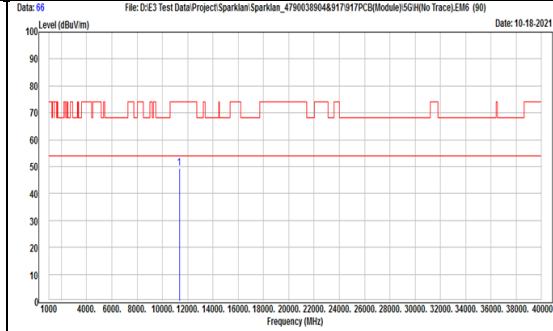

TX, 802.11ac(VHT40) (Ch 134)
Band Edge (Peak), Horizontal

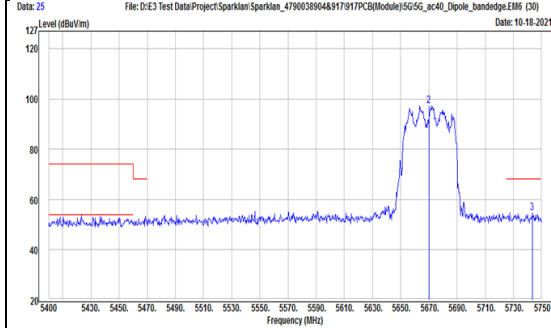

TX, 802.11ac(VHT40) (Ch 134)
Band Edge (Peak), Vertical

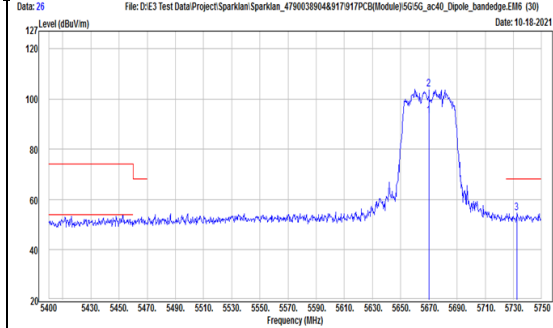

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 213 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT40)	Channel	142
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11420	30.79	18.8	49.59	74	-24.41	PK
Vertical	*	11420	31.03	18.8	49.83	74	-24.17	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 214 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

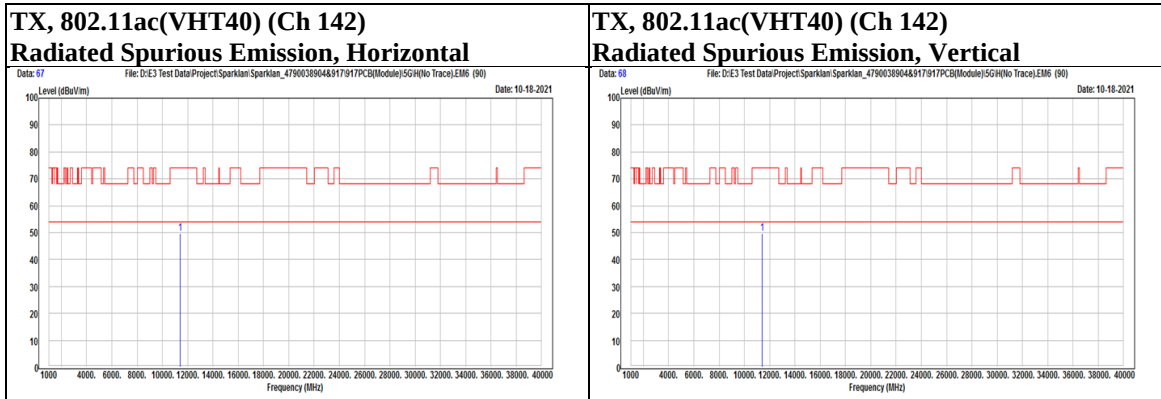

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 215 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT40)	Channel	151
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5579	40.48	13.98	54.46	68.2	-13.74	PK
		5690	40.78	14.04	54.82	97.83	-43.01	PK
	@	5755	86	14.33	100.33	N/A	N/A	PK
	*	11510	31.34	19.03	50.37	74	-23.63	PK
Vertical		5602.5	41.34	14.03	55.37	68.2	-12.83	PK
		5697.5	42.44	14.05	56.49	103.36	-46.87	PK
	@	5755	92.62	14.33	106.95	N/A	N/A	PK
	*	11510	31.73	19.03	50.76	74	-23.24	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917A-US-R1-V0
Page : 216 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT


TX, 802.11ac(VHT40) (Ch 151)
Radiated Spurious Emission, Horizontal

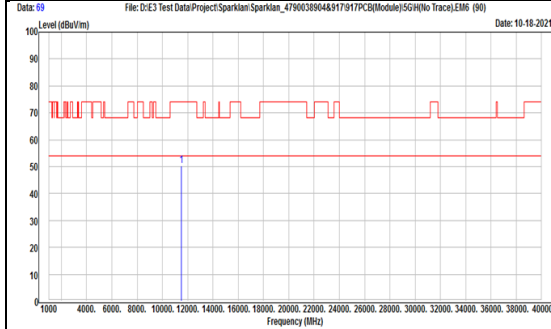


TX, 802.11ac(VHT40) (Ch 151)
Radiated Spurious Emission, Vertical

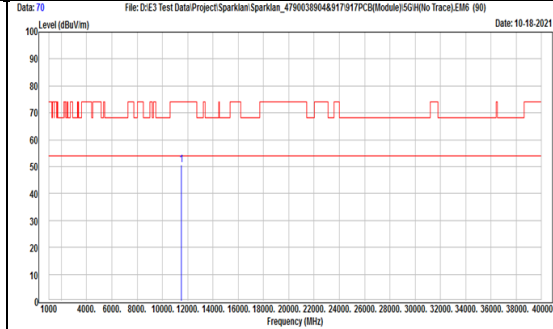

TX, 802.11ac(VHT40) (Ch 151)
Band Edge (Peak), Horizontal

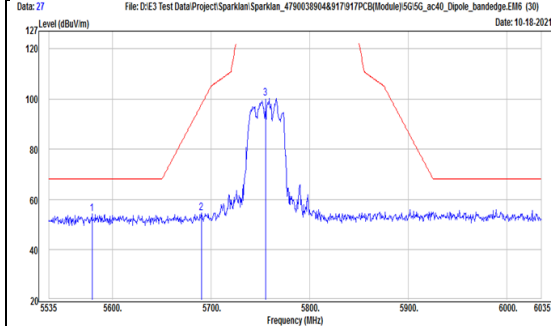

TX, 802.11ac(VHT40) (Ch 151)
Band Edge (Peak), Vertical

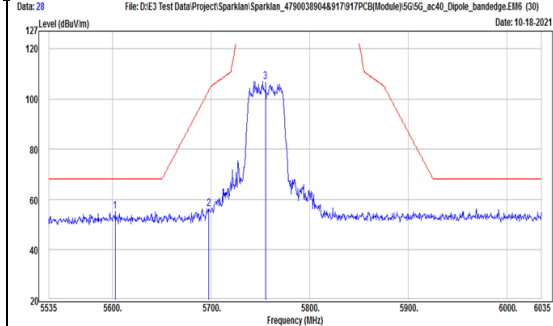

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 217 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT40)	Channel	159
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5795	83.77	14.53	98.3	N/A	N/A	PK
		5906.5	40.22	14.97	55.19	81.85	-26.66	PK
		5930.5	41.39	15	56.39	68.2	-11.81	PK
	*	11590	31.44	18.84	50.28	74	-23.72	PK
Vertical	@	5795	89.9	14.53	104.43	N/A	N/A	PK
		5895	41.75	14.95	56.7	90.36	-33.66	PK
		5931	40.83	15	55.83	68.2	-12.37	PK
	*	11590	30.23	18.84	49.07	74	-24.93	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 218 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

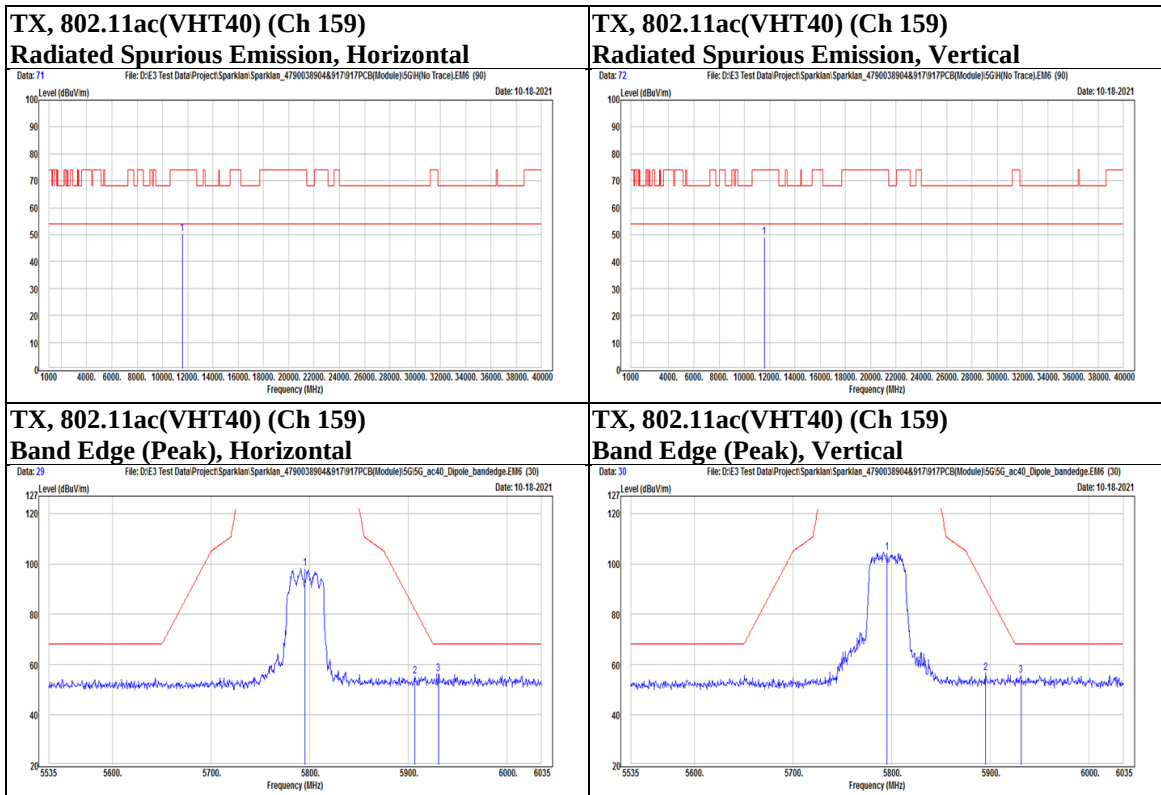

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 219 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT80)	Channel	42
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5090.65	30.26	13.43	43.69	54	-10.31	AVG
		5108.5	42.1	13.45	55.55	74	-18.45	PK
	@	5210	68.46	13.36	81.82	N/A	N/A	PK
	@	5210	63.41	13.36	76.77	N/A	N/A	AVG
	*	10420	31.32	17.6	48.92	68.2	-19.28	PK
Vertical		5058.45	42.53	13.33	55.86	74	-18.14	PK
		5146.3	30.52	13.43	43.95	54	-10.05	AVG
	@	5210	78.99	13.36	92.35	N/A	N/A	PK
	@	5210	72.61	13.36	85.97	N/A	N/A	AVG
	*	10420	31.91	17.6	49.51	68.2	-18.69	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 220 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

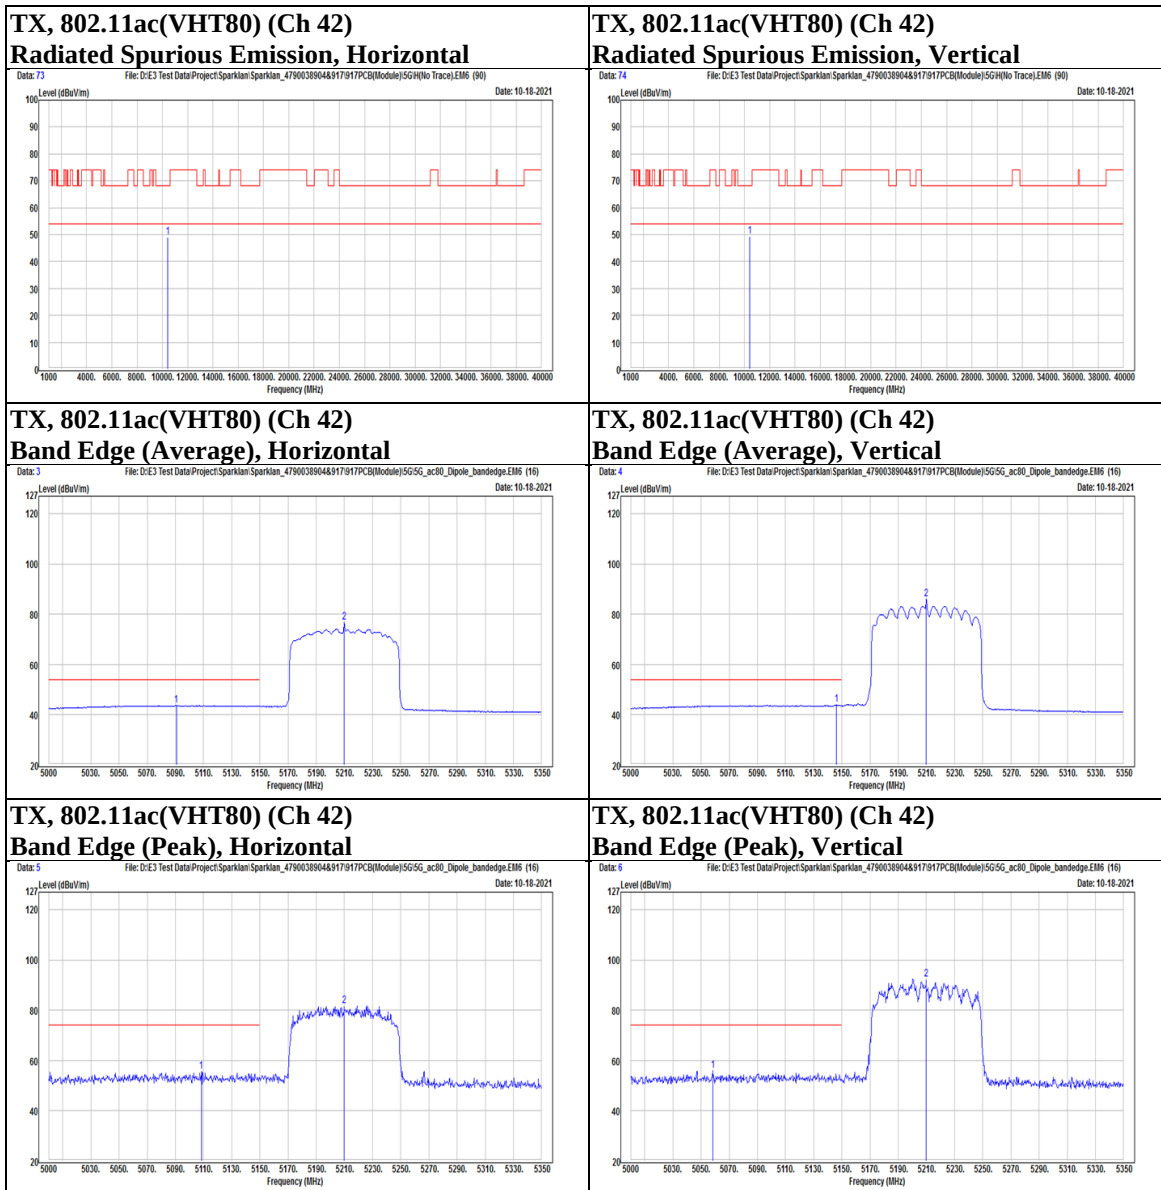

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 221 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT80)	Channel	58
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5290	68.58	13.21	81.79	N/A	N/A	PK
	@	5290	63.52	13.21	76.73	N/A	N/A	AVG
		5352.6	40.33	13.27	53.6	74	-20.4	PK
		5447.4	28.2	13.66	41.86	54	-12.14	AVG
	*	10580	31.28	17.73	49.01	68.2	-19.19	PK
Vertical	@	5290	76.66	13.21	89.87	N/A	N/A	PK
	@	5290	72.16	13.21	85.37	N/A	N/A	AVG
		5447.4	39.79	13.66	53.45	74	-20.55	PK
		5449.8	28.36	13.67	42.03	54	-11.97	AVG
	*	10580	31.29	17.73	49.02	68.2	-19.18	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

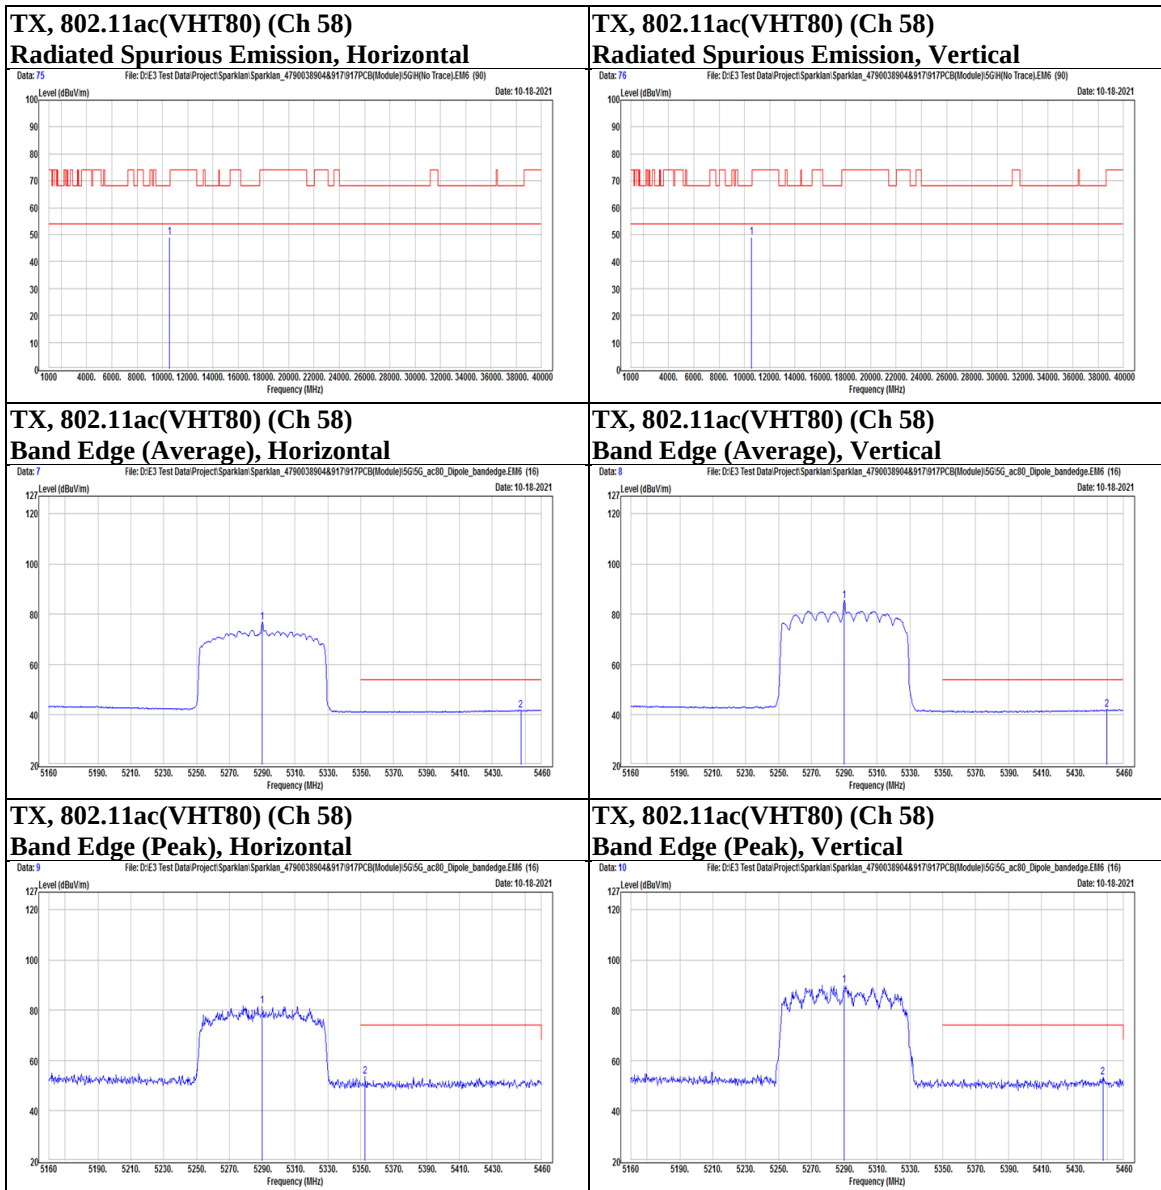



Test report No. : 4790038917A-US-R1-V0
Page : 223 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT80)	Channel	106
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5450.05	39.73	13.67	53.4	74	-20.6	PK
		5450.05	28.2	13.67	41.87	54	-12.13	AVG
		5466.85	38.79	13.72	52.51	68.2	-15.69	PK
	@	5530	75.17	13.87	89.04	N/A	N/A	PK
	@	5530	65.29	13.87	79.16	N/A	N/A	AVG
	*	11060	30.9	18.41	49.31	74	-24.69	PK
Vertical		5430.1	40.1	13.57	53.67	74	-20.33	PK
		5430.1	28.3	13.57	41.87	54	-12.13	AVG
		5469.65	39.77	13.74	53.51	68.2	-14.69	PK
	@	5530	82.45	13.87	96.32	N/A	N/A	PK
	@	5530	72.09	13.87	85.96	N/A	N/A	AVG
	*	11060	31.31	18.41	49.72	74	-24.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 224 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

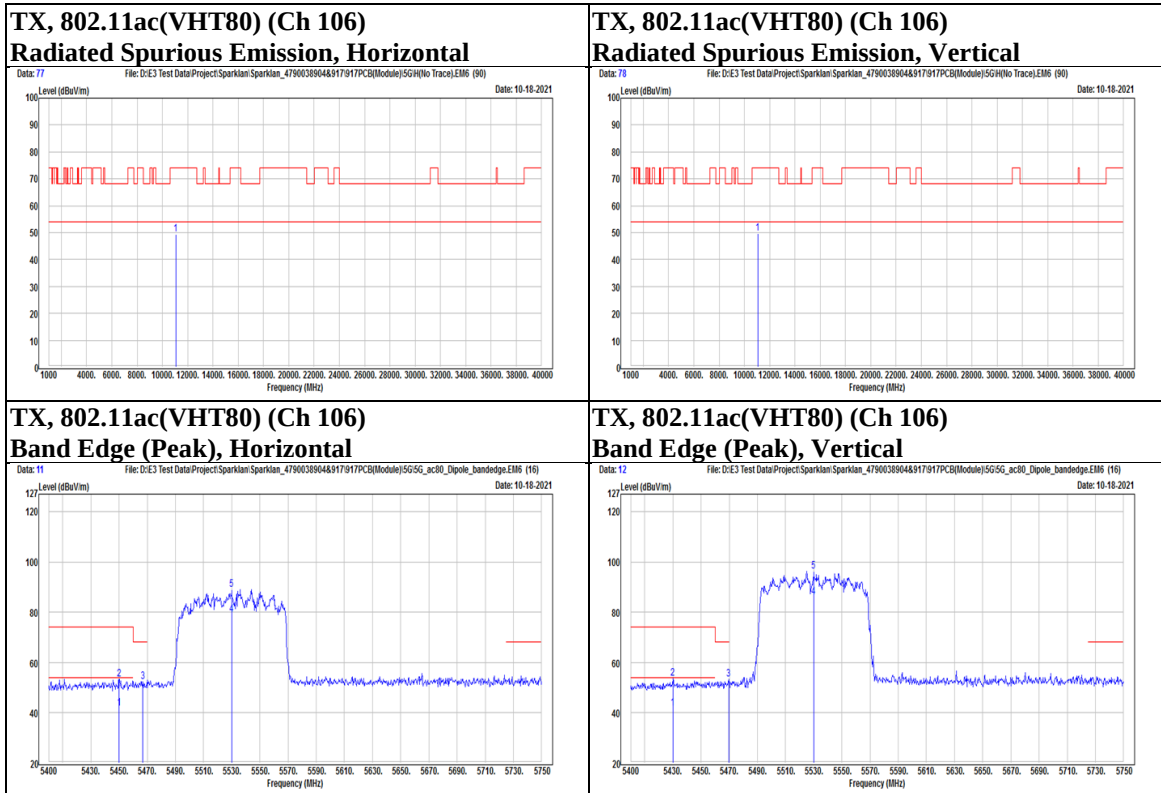

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 225 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT80)	Channel	122
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5421.7	40.31	13.53	53.84	74	-20.16	PK
		5421.7	28.3	13.53	41.83	54	-12.17	AVG
		5467.2	40.15	13.72	53.87	68.2	-14.33	PK
	@	5610	83.79	14.03	97.82	N/A	N/A	PK
	@	5610	73.1	14.03	87.13	N/A	N/A	AVG
		5731.45	41.07	14.21	55.28	68.2	-12.92	PK
	*	11220	30.84	18.25	49.09	74	-24.91	PK
Vertical		5456	40.65	13.69	54.34	74	-19.66	PK
		5456	28.2	13.69	41.89	54	-12.11	AVG
		5466.85	39.99	13.72	53.71	68.2	-14.49	PK
	@	5610	88.67	14.03	102.7	N/A	N/A	PK
	@	5610	78.2	14.03	92.23	N/A	N/A	AVG
		5734.6	41.14	14.23	55.37	68.2	-12.83	PK
	*	11220	31.14	18.25	49.39	74	-24.61	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917A-US-R1-V0
Page : 226 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT


TX, 802.11ac(VHT80) (Ch 122)
Radiated Spurious Emission, Horizontal

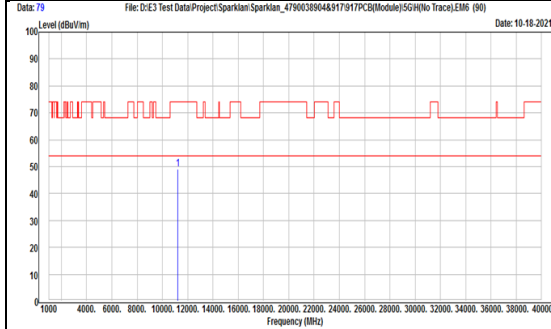


TX, 802.11ac(VHT80) (Ch 122)
Radiated Spurious Emission, Vertical

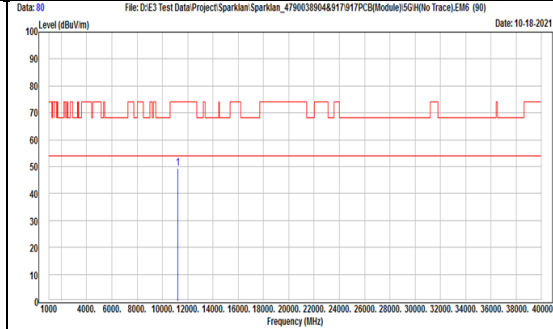

TX, 802.11ac(VHT80) (Ch 122)
Band Edge (Peak), Horizontal

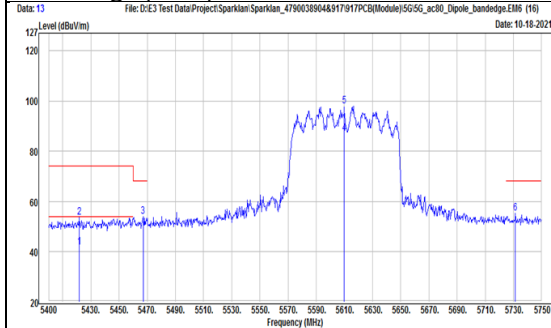

TX, 802.11ac(VHT80) (Ch 122)
Band Edge (Peak), Vertical

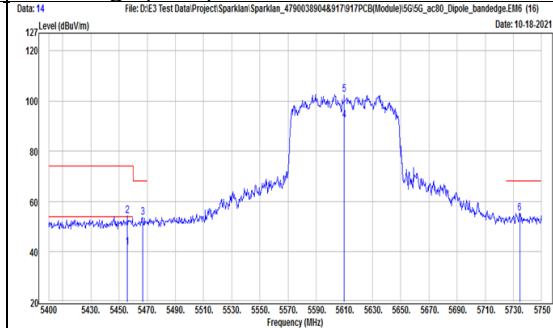

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 227 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT80)	Channel	138
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11380	31.13	18.67	49.8	74	-24.2	PK
Vertical	*	11380	29.89	18.67	48.56	74	-25.44	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 228 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

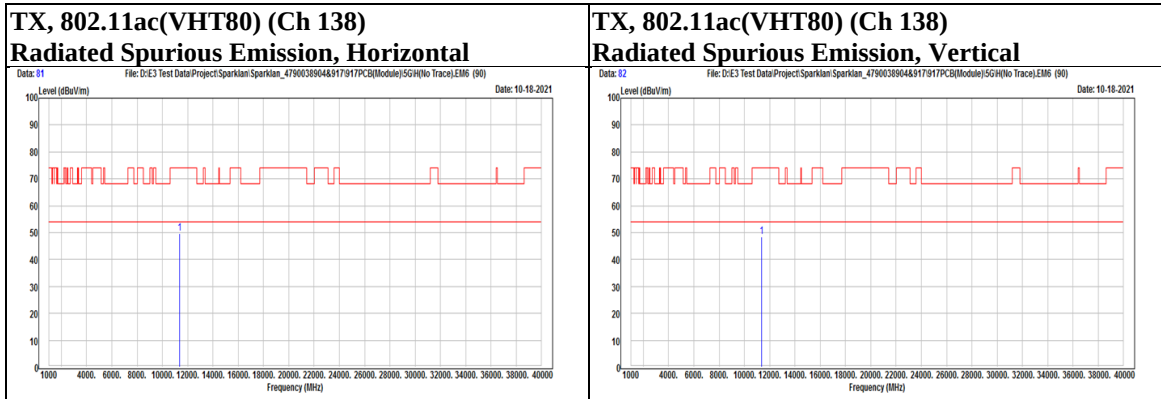

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 229 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	802.11ac(VHT80)	Channel	155
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5581	40.88	13.98	54.86	68.2	-13.34	PK
		5695.5	42.01	14.05	56.06	101.88	-45.82	PK
	@	5775	80.71	14.44	95.15	N/A	N/A	PK
		5921.5	40.43	14.99	55.42	70.78	-15.36	PK
		5940	40.95	15.01	55.96	68.2	-12.24	PK
	*	11550	30.69	18.93	49.62	74	-24.38	PK
Vertical		5643.5	41.17	14	55.17	68.2	-13.03	PK
		5696.5	46.55	14.05	60.6	102.62	-42.02	PK
	@	5775	87.63	14.44	102.07	N/A	N/A	PK
		5881.5	41.78	14.91	56.69	100.37	-43.68	PK
		6024	41.05	15.21	56.26	68.2	-11.94	PK
	*	11550	30.45	18.93	49.38	74	-24.62	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917A-US-R1-V0
Page : 230 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT


TX, 802.11ac(VHT80) (Ch 155)
Radiated Spurious Emission, Horizontal

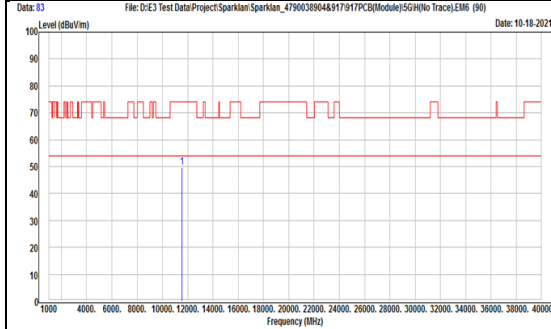


TX, 802.11ac(VHT80) (Ch 155)
Radiated Spurious Emission, Vertical

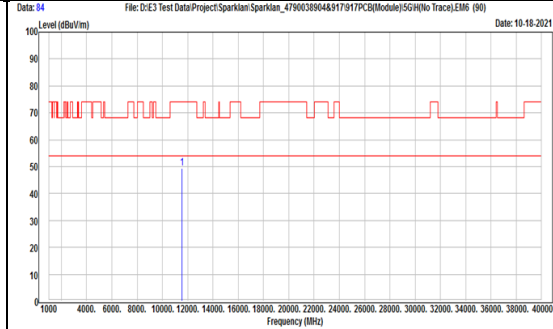

TX, 802.11ac(VHT80) (Ch 155)
Band Edge (Peak), Horizontal

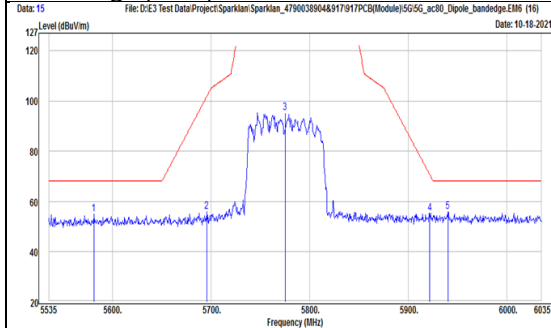

TX, 802.11ac(VHT80) (Ch 155)
Band Edge (Peak), Vertical

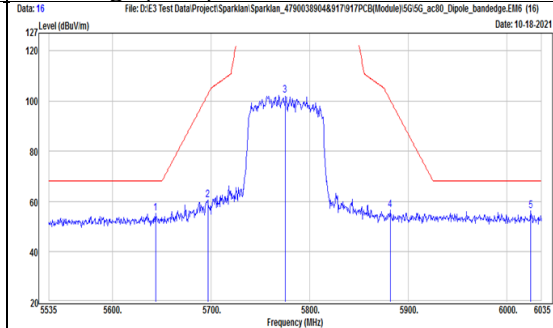

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 231 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Below 1G

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		78.5	41.01	-16	25.01	40	-14.99	PK
		206.54	47.76	-13.89	33.87	43.5	-9.63	PK
		236.61	42.4	-12.2	30.2	46	-15.8	PK
		363.68	39.95	-8.05	31.9	46	-14.1	PK
		482.02	37.68	-5.1	32.58	46	-13.42	PK
		961.2	33.53	3.9	37.43	54	-16.57	PK
Vertical		31.94	38.5	-12.47	26.03	40	-13.97	PK
		78.5	42.59	-16	26.59	40	-13.41	PK
		151.25	35.39	-11.43	23.96	43.5	-19.54	PK
		296.75	38.08	-10.08	28	46	-18	PK
		480.08	42.72	-5.19	37.53	46	-8.47	PK
		960.23	33.72	3.89	37.61	54	-16.39	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 232 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

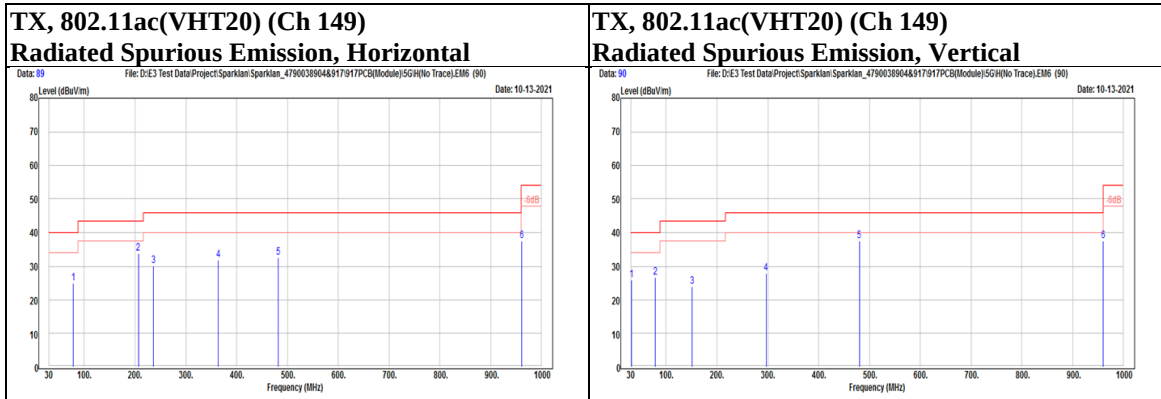

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



9.8. AC Power Line Conducted Emission

Requirements

Frequency (MHz)	Conducted limit (dB μ V)	
	Quasi-peak	Average
0.15 - 0.5	66 - 56	56 - 46
0.50 - 5.0	56	46
5.0 - 30	60	50

Note:

1. The lower limit shall apply at the transition frequencies.
2. The limit decreases in line with the logarithm of the frequency in the range of 0.15 to 0.50MHz.

Test Procedures

- a. The EUT was placed 0.4 meters from the conducting wall of the shielded room with EUT being connected to the power mains through a line impedance stabilization network (LISN). Other support units were connected to the power mains through another LISN. The two LISNs provide 50 ohm/ 50uH of coupling impedance for the measuring instrument.
- b. Both lines of the power mains connected to the EUT were checked for maximum conducted interference.
- c. The frequency range from 150kHz to 30MHz was searched. Emission levels under (Limit - 20dB) was not recorded.

NOTE:

1. The resolution bandwidth and video bandwidth of test receiver is 9kHz for quasi-peak detection (QP) and average detection (AV) at frequency 0.15MHz-30MHz.
2. All modes of operation were investigated (includes all external accessories) and the worst-case emissions are reported, the other emission levels were low against the limit.
3. Test data of Result value (dBuV) = Reading value (dBuV) + Correction Factor (dB).
4. Test data of Margin(dB) = Result value (dBuV) - Limit value (dBuV).
5. Test data of Correction Factor (dB) = Insertion loss(dB) + Cable loss(dB).

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test Setup

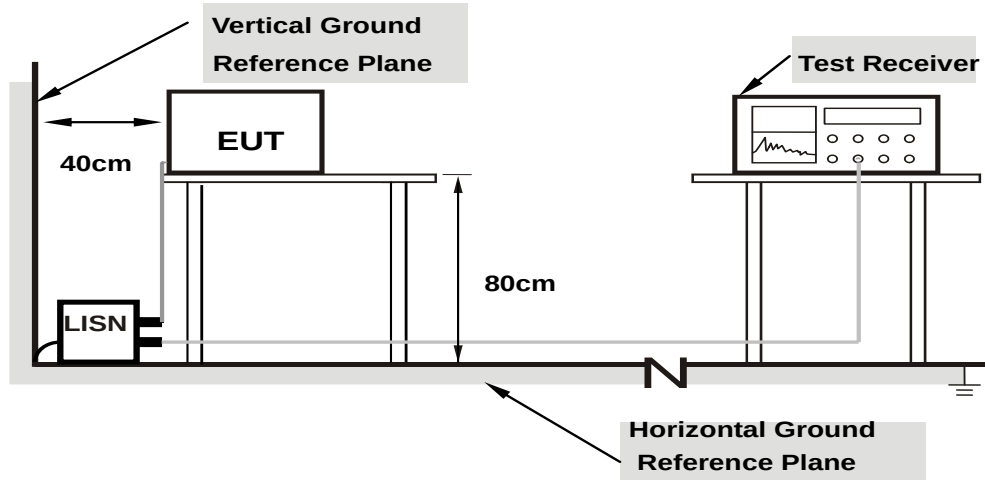

Note: 1.Support units were connected to second LISN.

For the actual test configuration, please refer to the Setup Configurations.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test Data

Mode	TX_WLAN 5G	Channel	149
------	------------	---------	-----

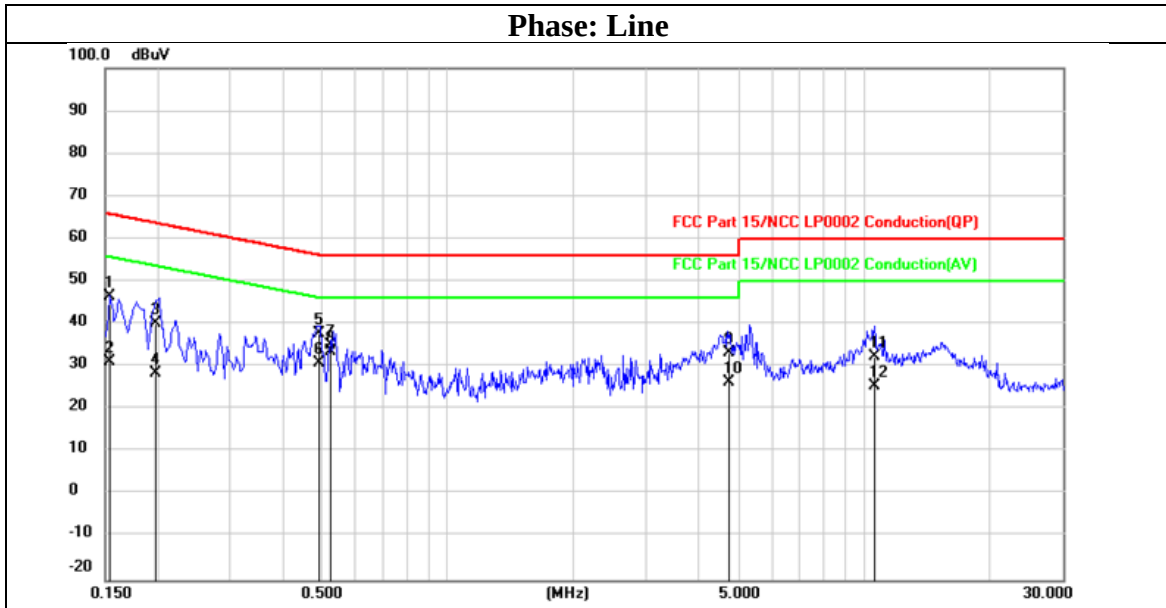

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1530	26.88	19.49	46.37	65.84	-19.47	QP
2	0.1530	11.76	19.49	31.25	55.84	-24.59	AVG
3	0.1983	20.73	19.49	40.22	63.68	-23.46	QP
4	0.1983	8.97	19.49	28.46	53.68	-25.22	AVG
5	0.4905	18.12	19.49	37.61	56.16	-18.55	QP
6	0.4905	11.46	19.49	30.95	46.16	-15.21	AVG
7	0.5221	15.50	19.50	35.00	56.00	-21.00	QP
8	0.5221	13.98	19.50	33.48	46.00	-12.52	AVG
9	4.7514	13.70	19.59	33.29	56.00	-22.71	QP
10	4.7514	6.67	19.59	26.26	46.00	-19.74	AVG
11	10.5480	12.73	19.70	32.43	60.00	-27.57	QP
12	10.5480	5.82	19.70	25.52	50.00	-24.48	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917A-US-R1-V0
Page : 236 of 236
Issued date : 2021/11/23
FCC ID : RYK-WUBT239ACNBT

Mode	TX_WLAN 5G	Channel	149
------	------------	---------	-----

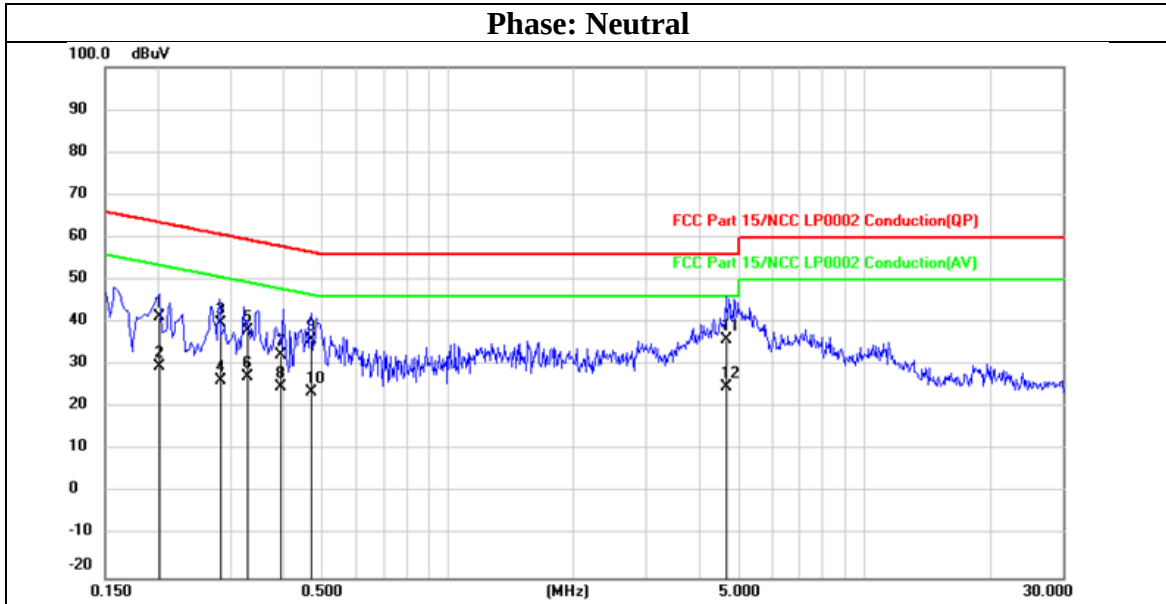

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.2017	22.00	19.49	41.49	63.54	-22.05	QP
2	0.2017	10.14	19.49	29.63	53.54	-23.91	AVG
3	0.2832	20.49	19.49	39.98	60.72	-20.74	QP
4	0.2832	6.87	19.49	26.36	50.72	-24.36	AVG
5	0.3268	18.65	19.49	38.14	59.53	-21.39	QP
6	0.3268	7.62	19.49	27.11	49.53	-22.42	AVG
7	0.3978	12.77	19.49	32.26	57.90	-25.64	QP
8	0.3978	5.37	19.49	24.86	47.90	-23.04	AVG
9	0.4670	16.32	19.49	35.81	56.57	-20.76	QP
10	0.4670	4.02	19.49	23.51	46.57	-23.06	AVG
11	4.6862	16.24	19.60	35.84	56.00	-20.16	QP
12	4.6862	5.20	19.60	24.80	46.00	-21.20	AVG

END OF REPORT

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0