






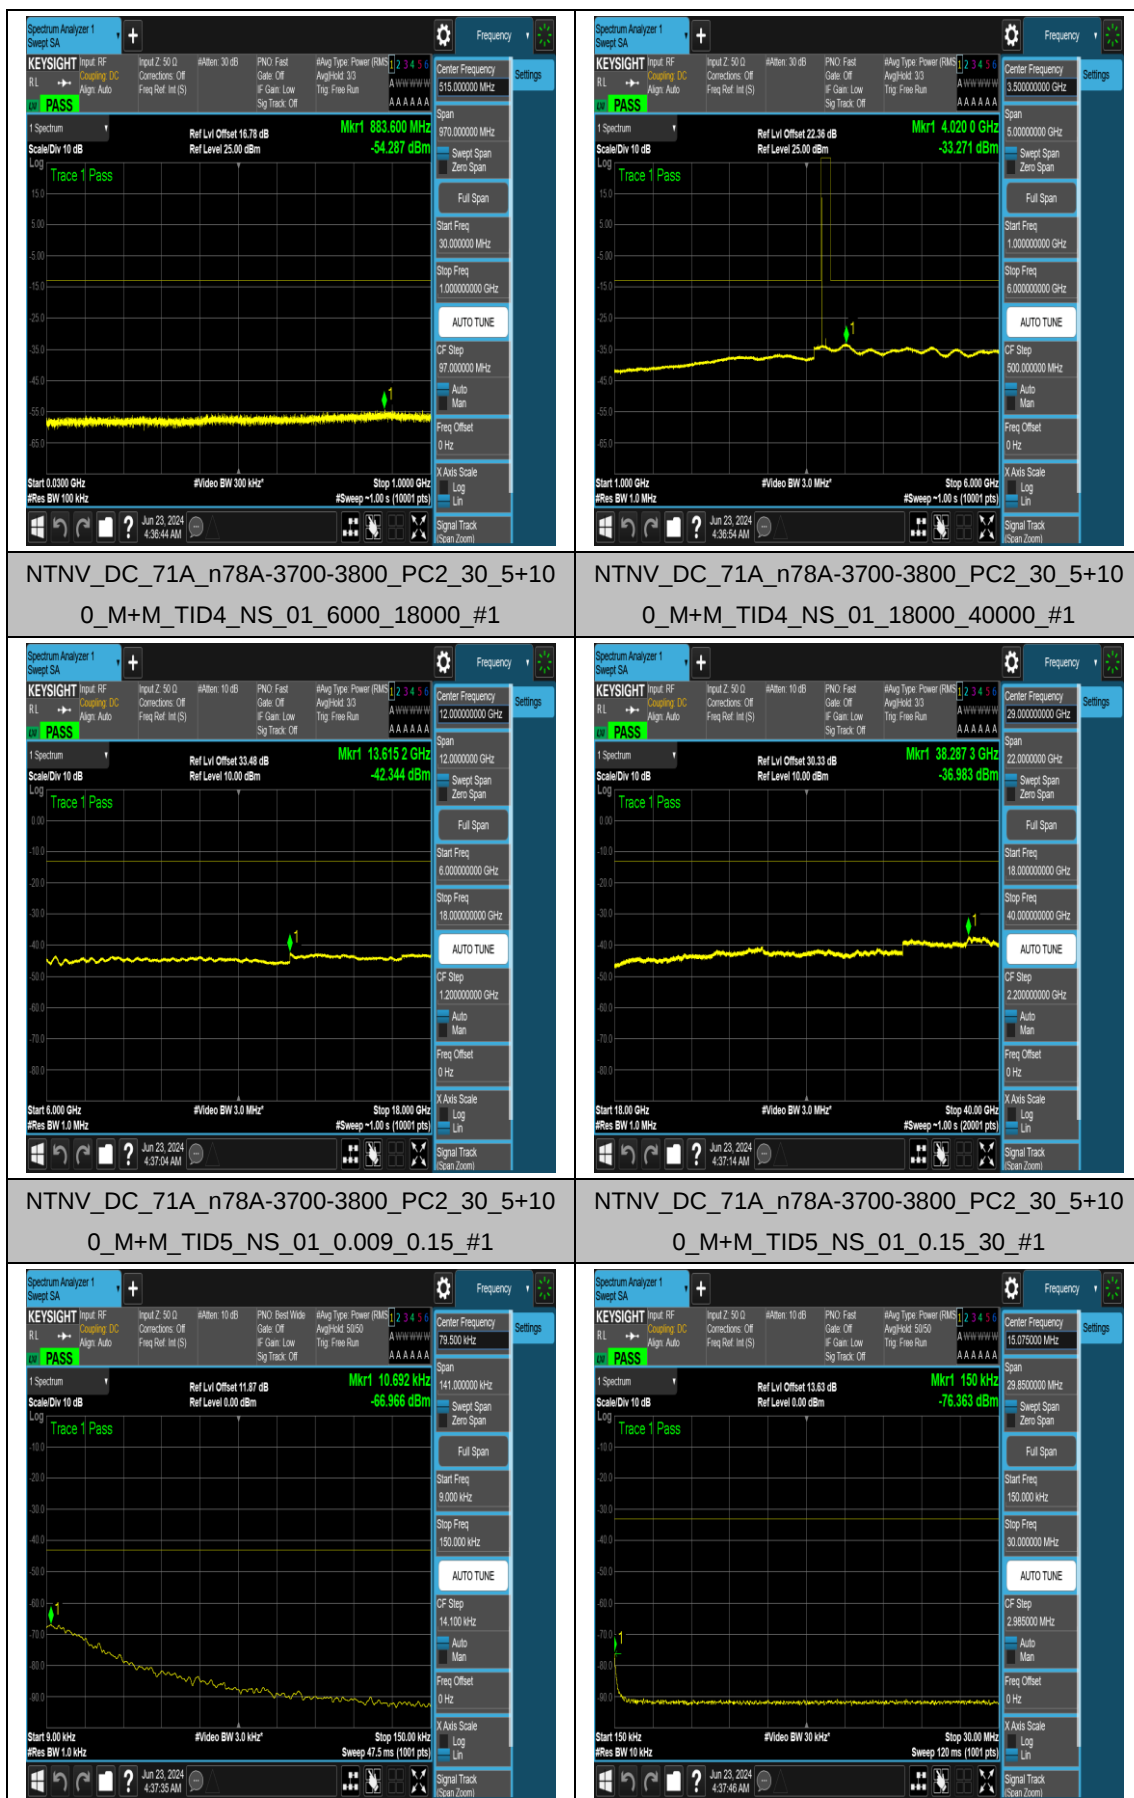

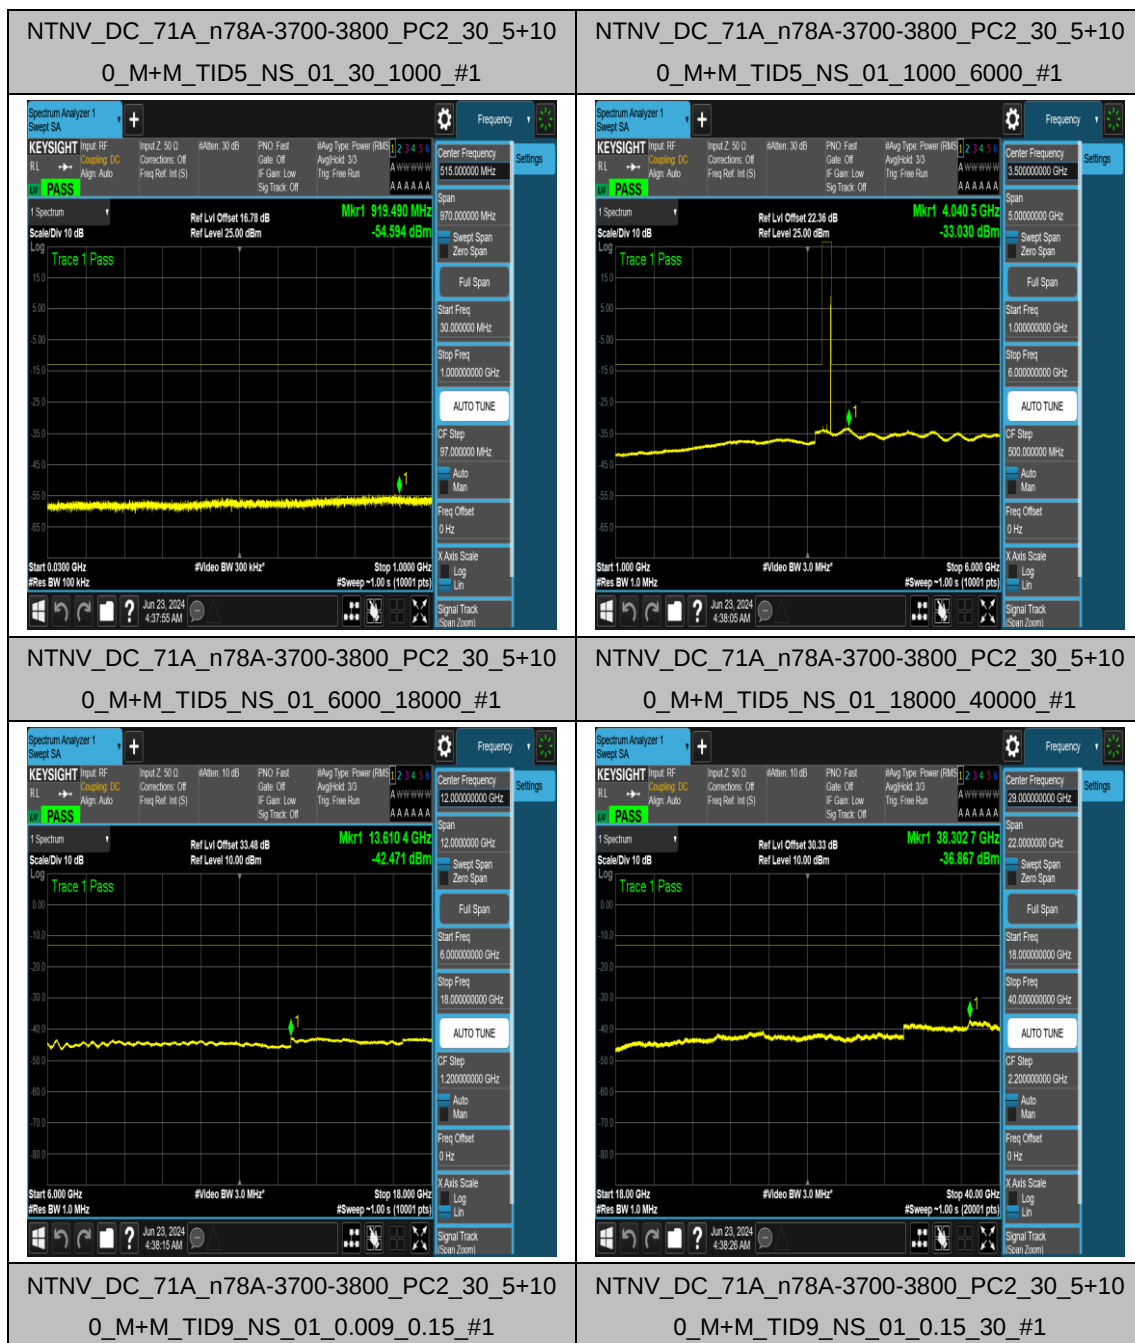


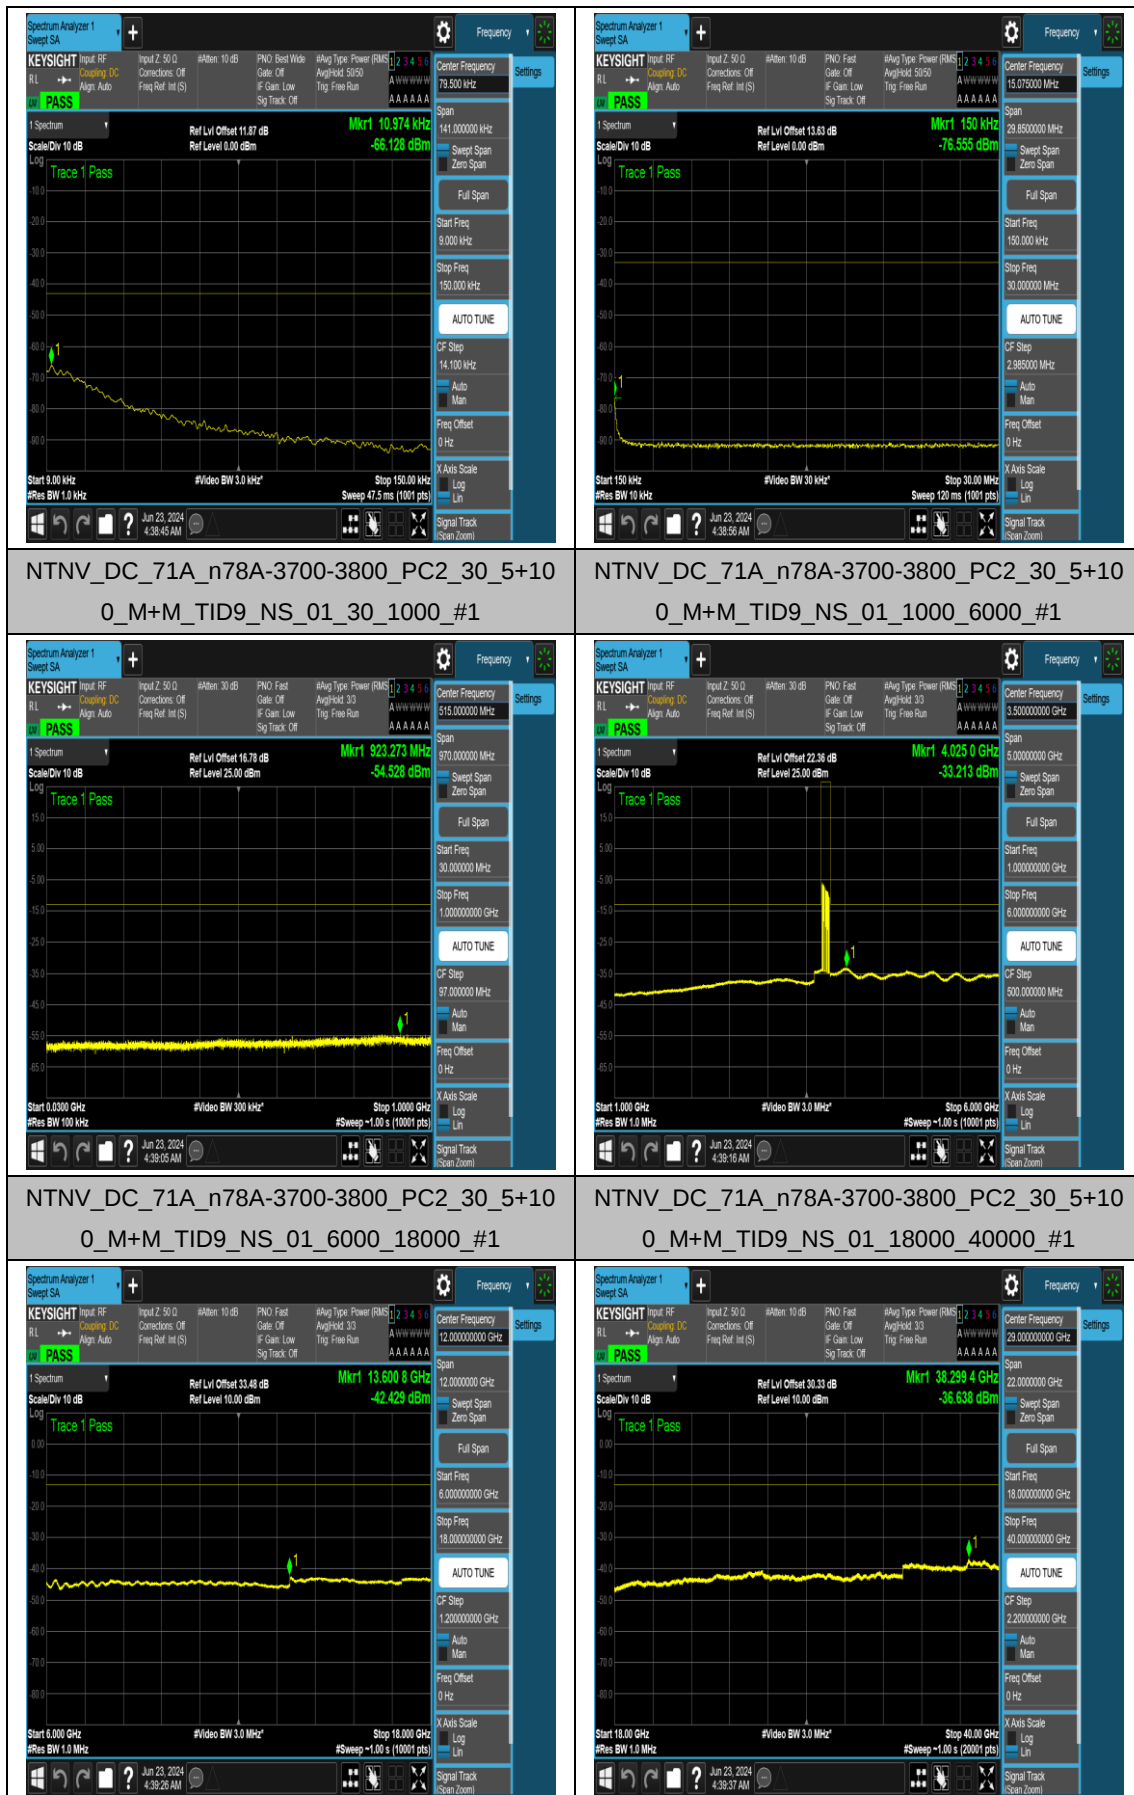


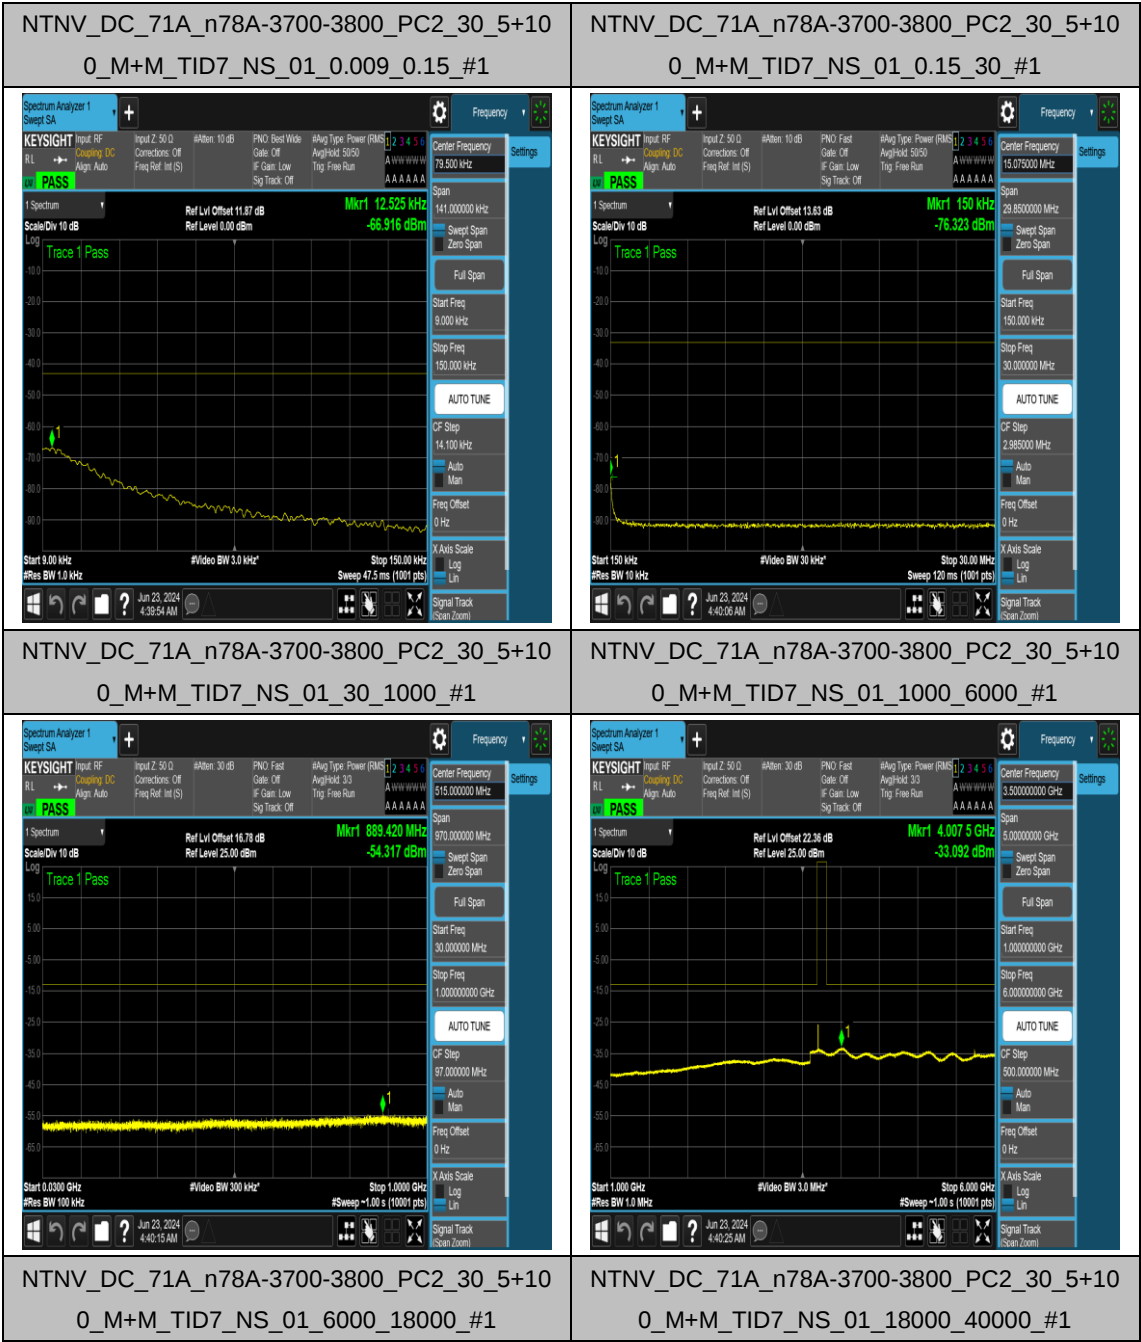


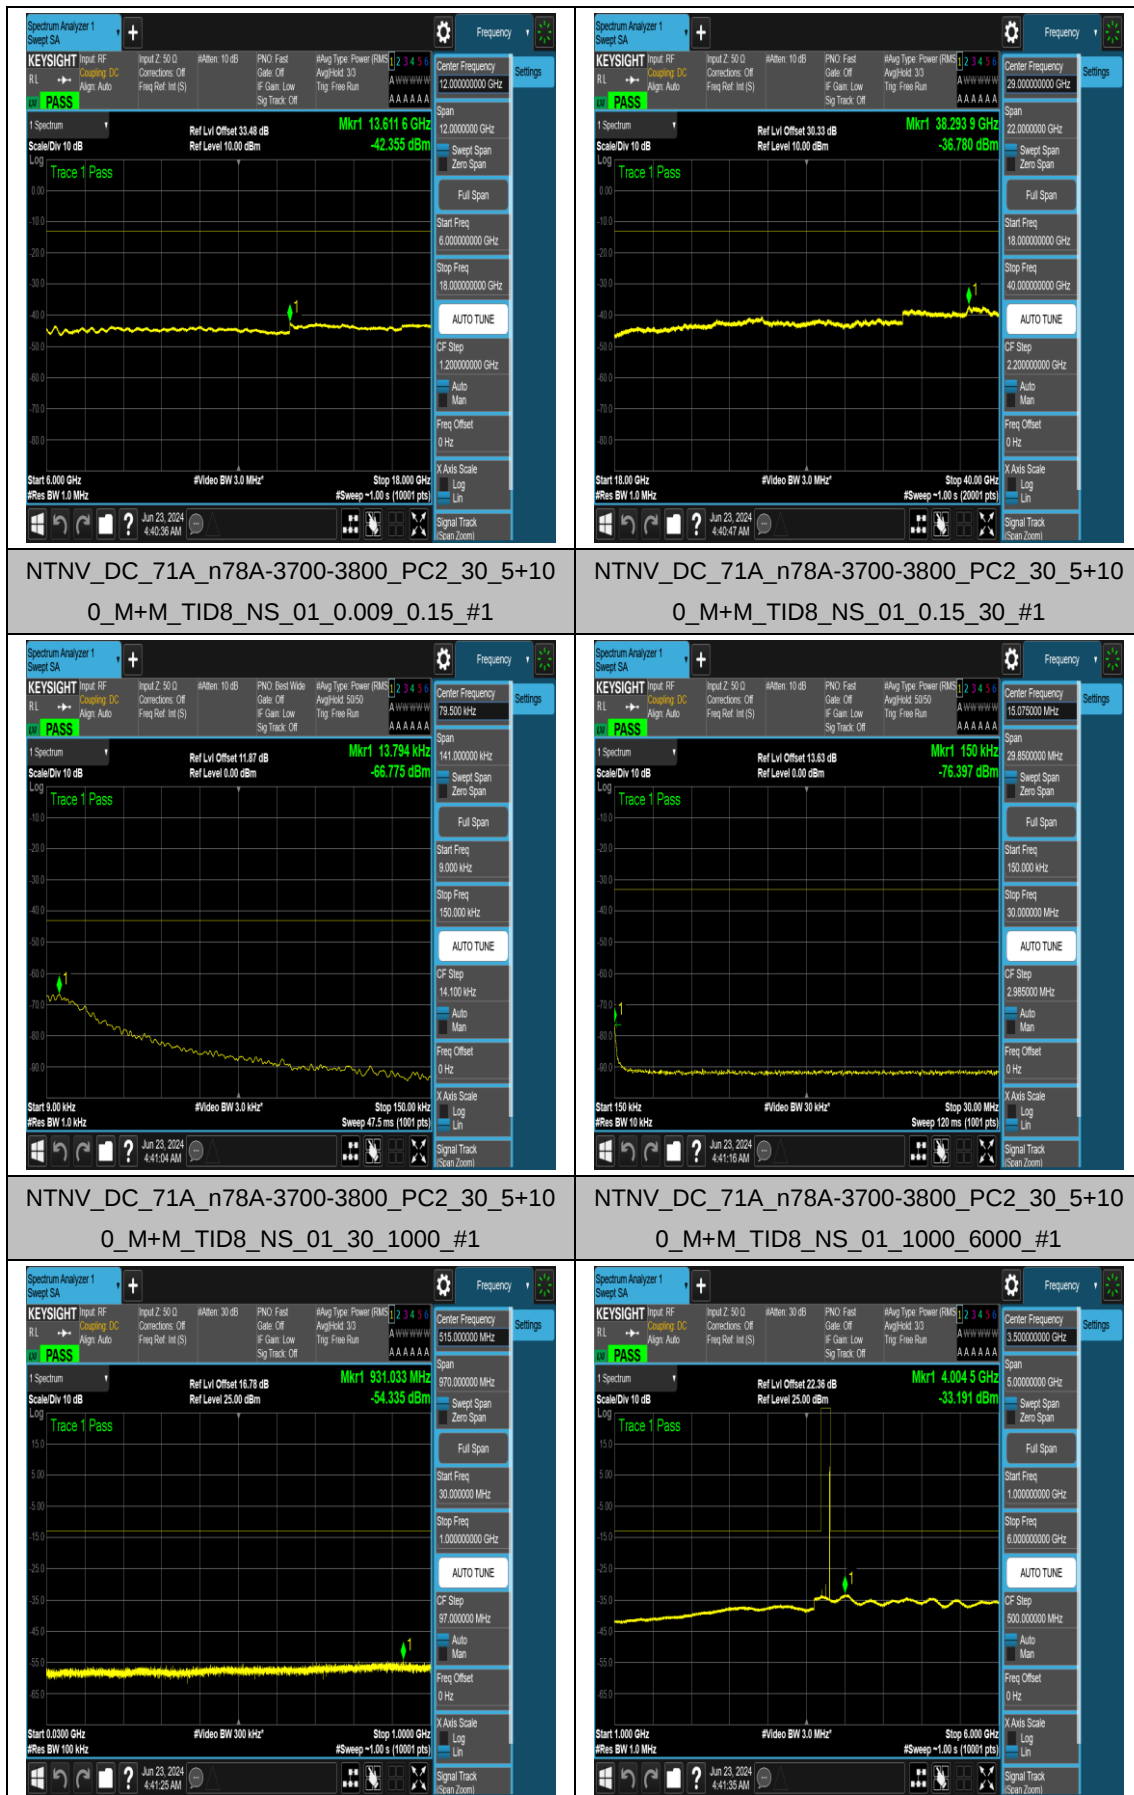





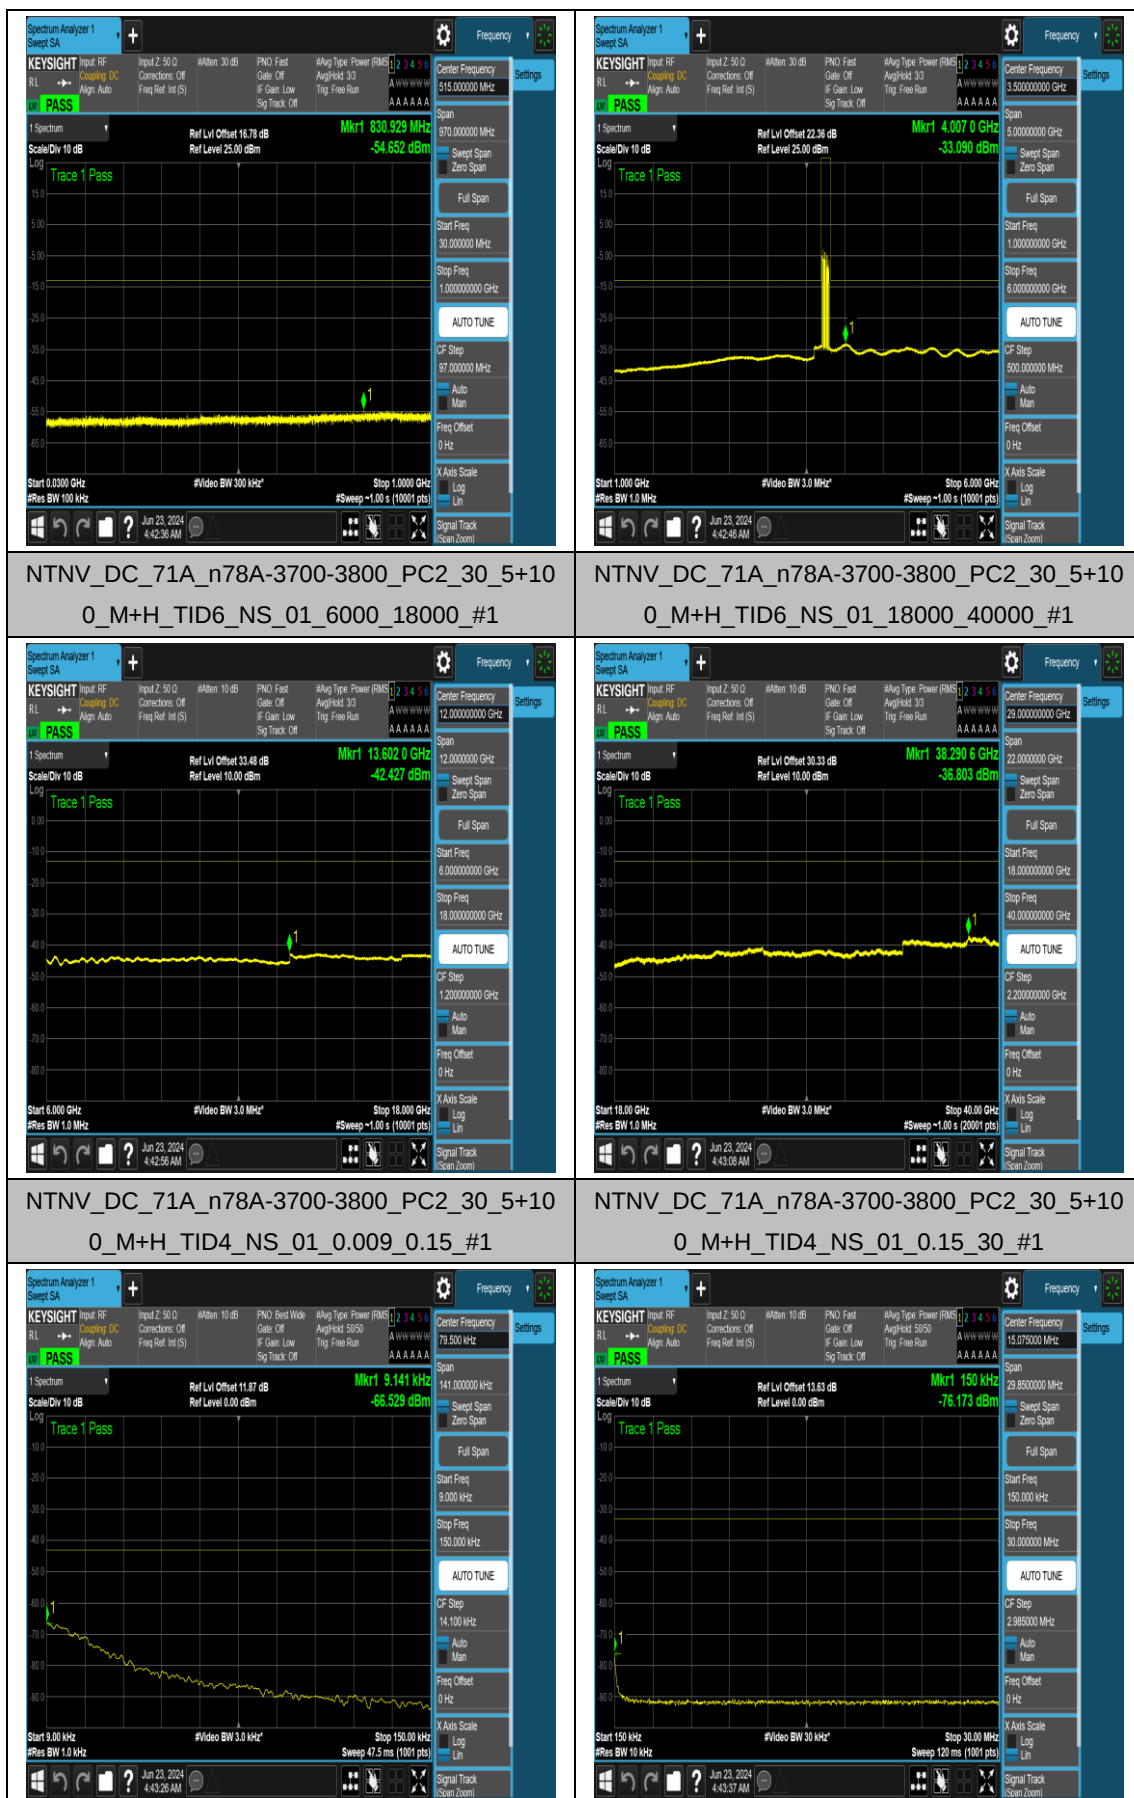

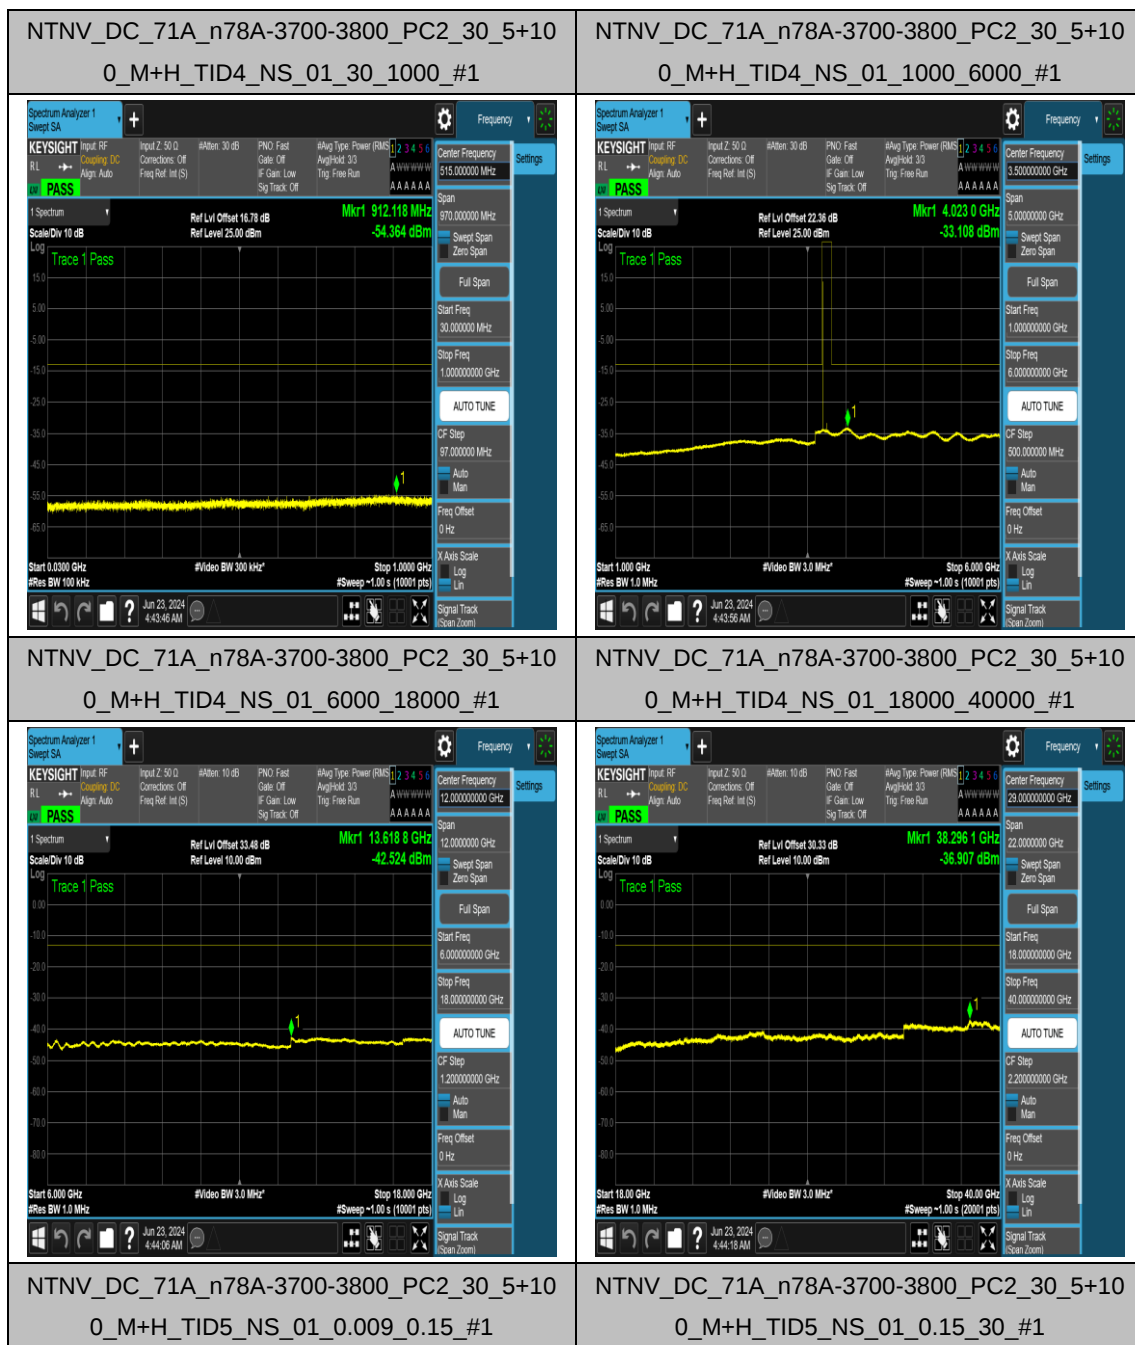


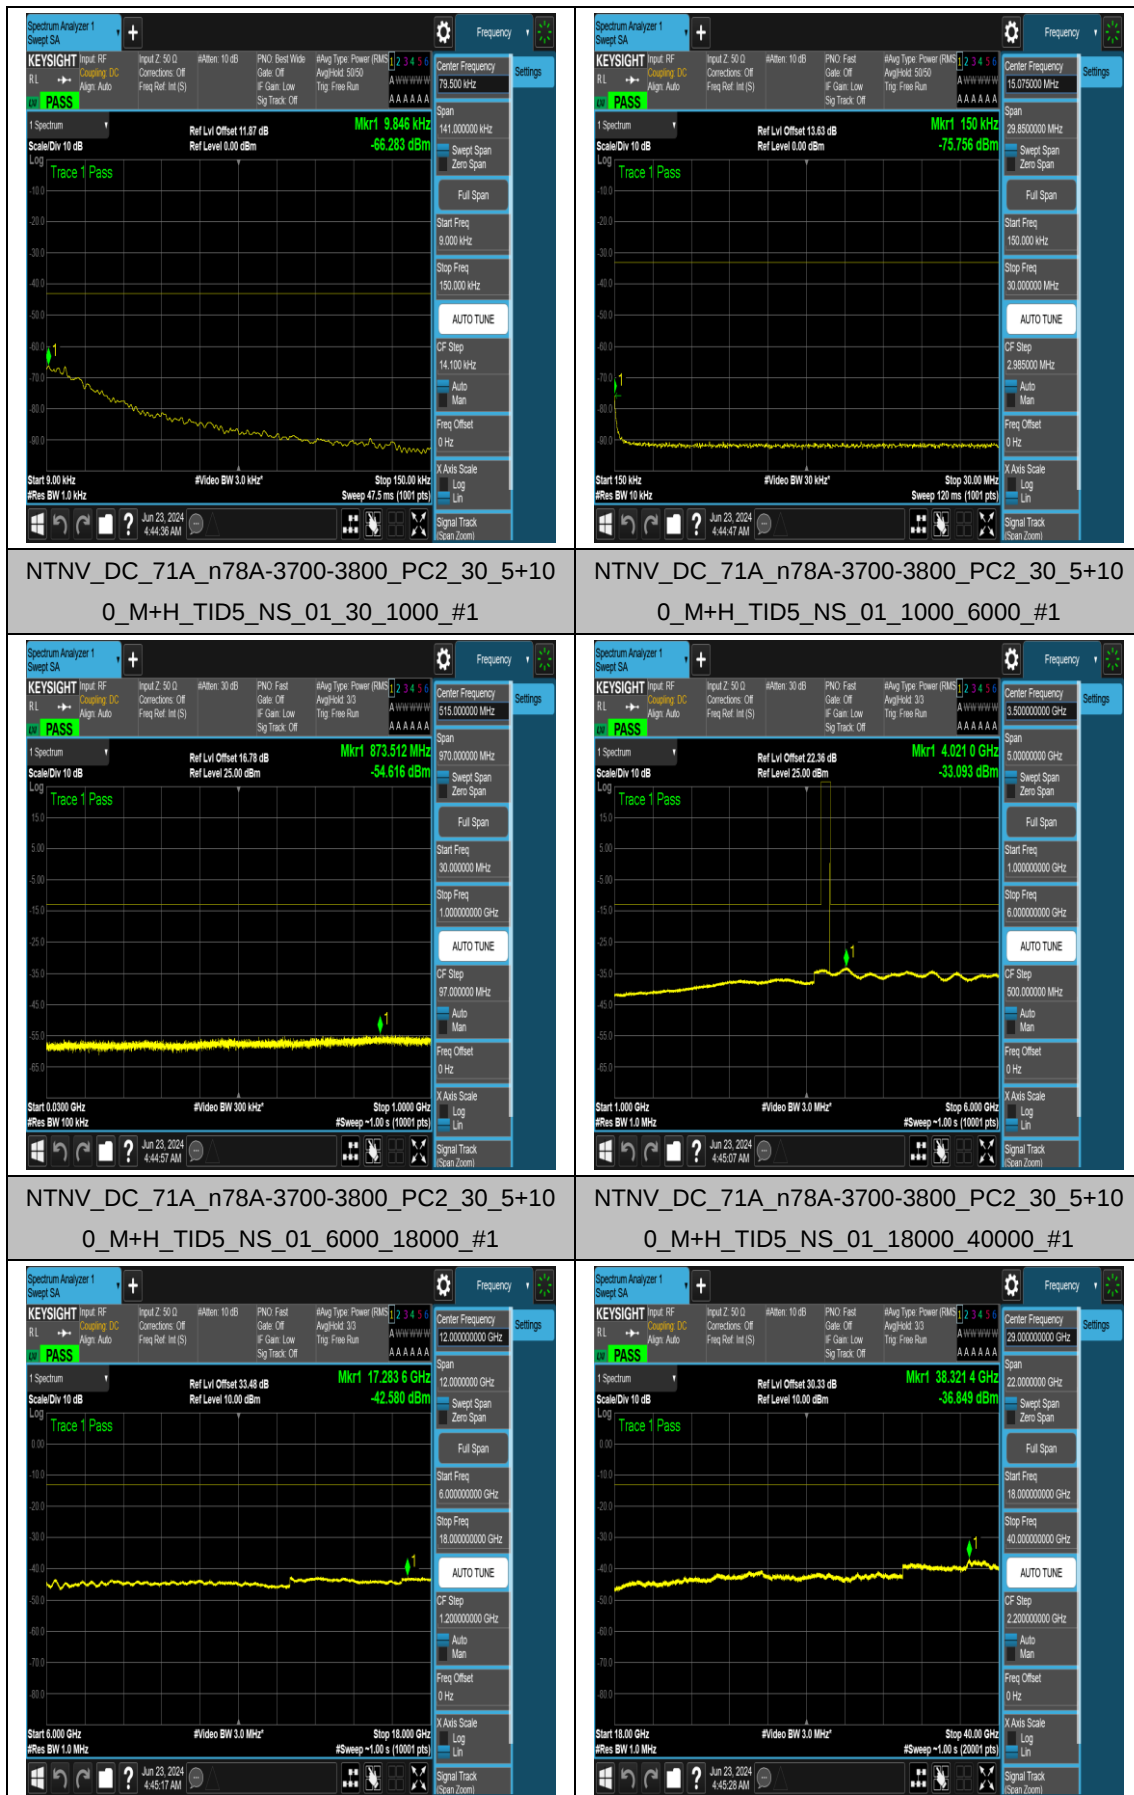

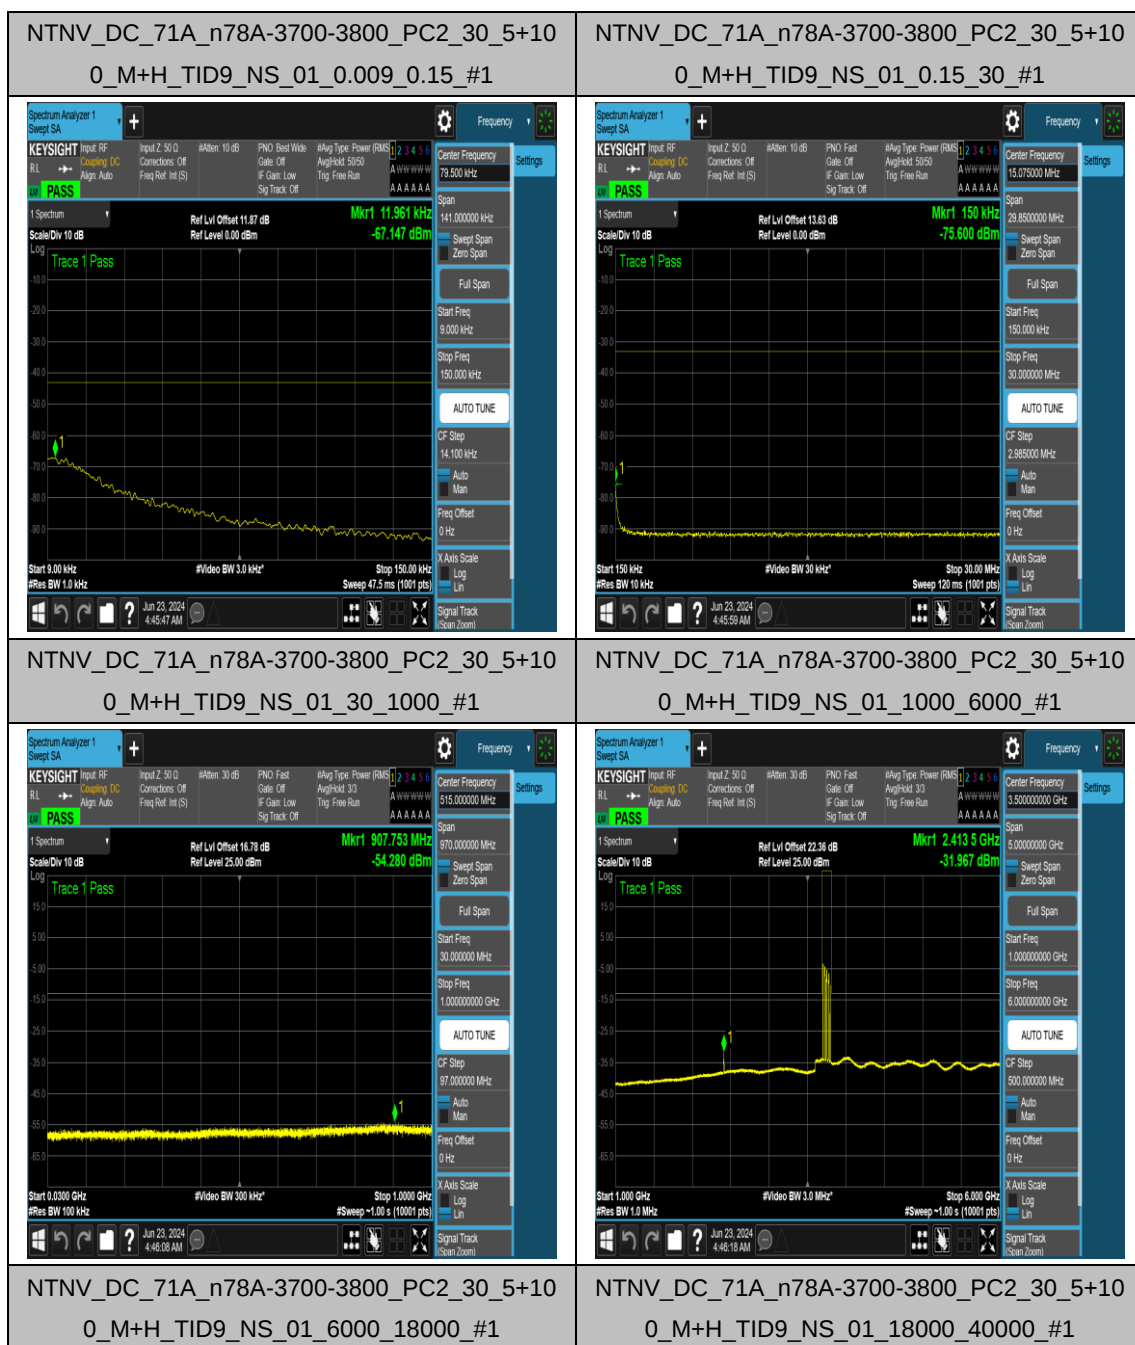

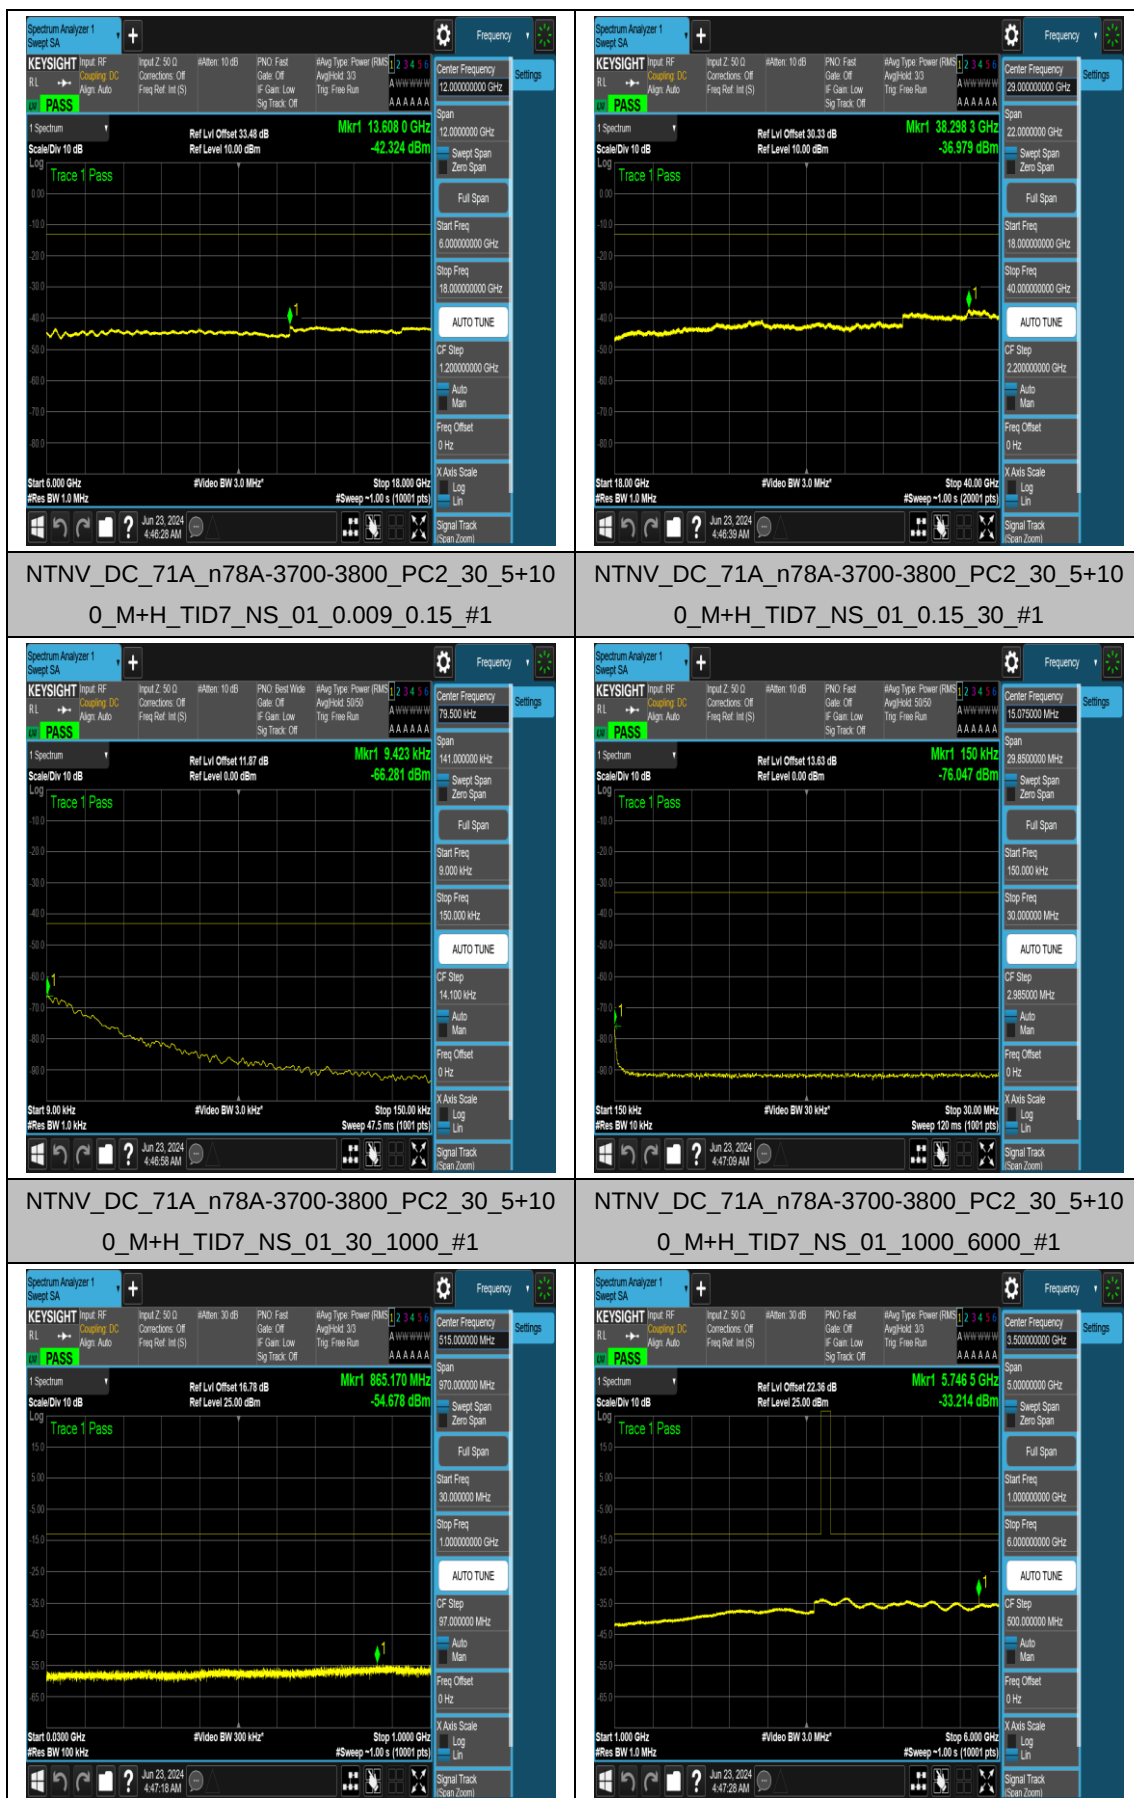



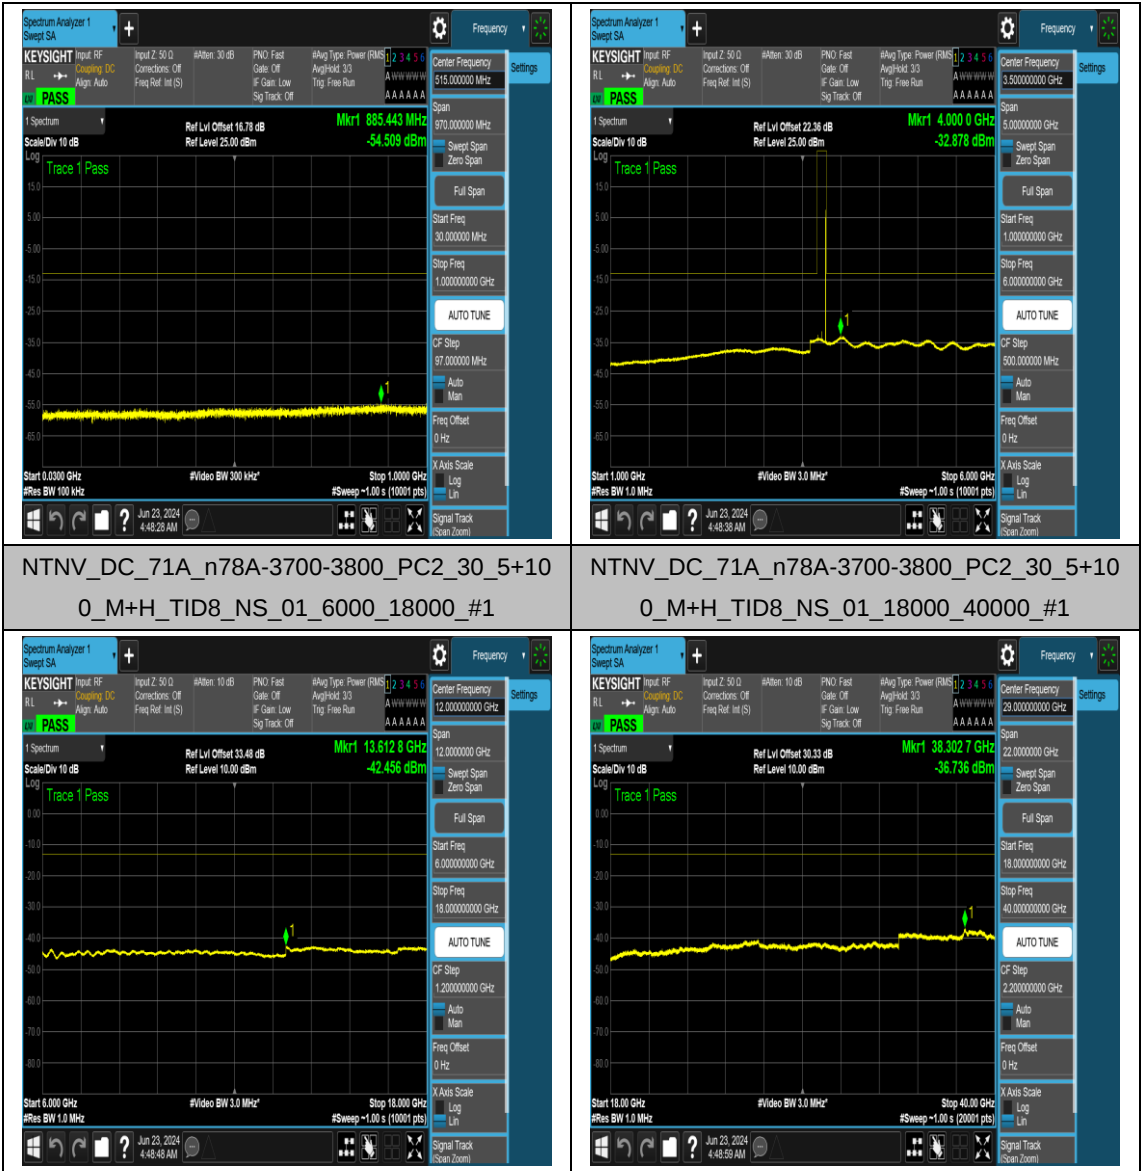

Appendix F: Frequency Stability for NSA

Test Result

Frequency Error VS. Voltage

Band	SCS	Bandwidth	Modulation	Channel	RB Config	Voltage	Temperature	Deviation(Hz)	Deviation (ppm)	Verdict
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	VL	NT	5.000000	0.001350	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	VN	NT	12.000000	0.003239	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	VH	NT	11.000000	0.002969	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	VL	NT	15.000000	0.004048	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	VN	NT	13.000000	0.003509	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	VH	NT	15.000000	0.004048	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	VL	NT	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	VN	NT	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	VH	NT	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	VL	NT	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	VN	NT	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	VH	NT	8.000000	0.002133	PASS

DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	VL	NT	10.000000	0.002635	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	VN	NT	17.000000	0.004480	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	VH	NT	12.000000	0.003162	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	VL	NT	7.000000	0.001845	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	VN	NT	5.000000	0.001318	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	VH	NT	17.000000	0.004480	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	VL	NT	13.000000	0.003506	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	VN	NT	1.000000	0.000270	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	VH	NT	19.000000	0.005125	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	VL	NT	13.000000	0.003506	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	VN	NT	8.000000	0.002158	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	VH	NT	10.000000	0.002697	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	VL	NT	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	VN	NT	16.000000	0.004267	PASS

DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	VH	NT	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	VL	NT	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	VN	NT	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	VH	NT	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	VL	NT	17.000000	0.004483	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	VN	NT	9.000000	0.002373	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	VH	NT	12.000000	0.003164	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	VL	NT	13.000000	0.003428	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	VN	NT	4.000000	0.001055	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	VH	NT	1.000000	0.000264	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	VL	NT	13.000000	0.003504	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	VN	NT	11.000000	0.002965	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	VH	NT	3.000000	0.000809	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	VL	NT	9.000000	0.002426	PASS

DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	VN	NT	9.000000	0.002426	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	VH	NT	11.000000	0.002965	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	VL	NT	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	VN	NT	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	VH	NT	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	VL	NT	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	VN	NT	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	VH	NT	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	VL	NT	8.000000	0.002111	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	VN	NT	10.000000	0.002639	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	VH	NT	19.000000	0.005013	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	VL	NT	12.000000	0.003166	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	VN	NT	4.000000	0.001055	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	VH	NT	1.000000	0.000264	PASS

DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	VL	NT	2.000000	0.000538	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	VN	NT	13.000000	0.003499	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	VH	NT	9.000000	0.002423	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	VL	NT	12.000000	0.003230	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	VN	NT	7.000000	0.001884	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	VH	NT	17.000000	0.004576	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	VL	NT	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	VN	NT	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	VH	NT	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	VL	NT	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	VN	NT	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	VH	NT	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	VL	NT	17.000000	0.004491	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	VN	NT	5.000000	0.001321	PASS

DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	VH	NT	7.000000	0.001849	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	VL	NT	17.000000	0.004491	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	VN	NT	17.000000	0.004491	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	VH	NT	6.000000	0.001585	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	VL	NT	13.000000	0.003495	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	VN	NT	3.000000	0.000806	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	VH	NT	5.000000	0.001344	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	VL	NT	13.000000	0.003495	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	VN	NT	1.000000	0.000269	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	VH	NT	10.000000	0.002688	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	VL	NT	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	VN	NT	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	VH	NT	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	VL	NT	17.000000	0.004533	PASS

DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	VN	NT	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	VH	NT	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	VL	NT	3.000000	0.000794	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	VN	NT	1.000000	0.000265	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	VH	NT	16.000000	0.004233	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	VL	NT	5.000000	0.001323	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	VN	NT	16.000000	0.004233	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	VH	NT	18.000000	0.004762	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	VL	NT	10.000000	0.002685	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	VN	NT	17.000000	0.004564	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	VH	NT	19.000000	0.005101	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	VL	NT	11.000000	0.002953	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	VN	NT	18.000000	0.004832	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	VH	NT	1.000000	0.000268	PASS

DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	VL	NT	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	VN	NT	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	VH	NT	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	VL	NT	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	VN	NT	14.000000	0.003733	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	VH	NT	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	VL	NT	3.000000	0.000795	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	VN	NT	10.000000	0.002649	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	VH	NT	1.000000	0.000265	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	VL	NT	6.000000	0.001589	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	VN	NT	13.000000	0.003444	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	VH	NT	3.000000	0.000795	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	VL	NT	4.000000	0.001072	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	VN	NT	18.000000	0.004826	PASS

DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	VH	NT	2.000000	0.000536	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	VL	NT	4.000000	0.001072	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	VN	NT	18.000000	0.004826	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	VH	NT	6.000000	0.001609	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	VL	NT	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	VN	NT	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	VH	NT	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	VL	NT	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	VN	NT	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	VH	NT	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	VL	NT	7.000000	0.001857	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	VN	NT	12.000000	0.003183	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	VH	NT	2.000000	0.000531	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	VL	NT	19.000000	0.005040	PASS

DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	VN	NT	13.000000	0.003448	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	VH	NT	8.000000	0.002122	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	VL	NT	14.000000	0.003748	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	VN	NT	14.000000	0.003748	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	VH	NT	16.000000	0.004284	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	VL	NT	11.000000	0.002945	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	VN	NT	12.000000	0.003213	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	VH	NT	15.000000	0.004015	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	VL	NT	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	VN	NT	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	VH	NT	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	VL	NT	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	VN	NT	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	VH	NT	19.000000	0.005067	PASS

DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	VL	NT	9.000000	0.002390	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	VN	NT	4.000000	0.001062	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	VH	NT	6.000000	0.001594	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	VL	NT	4.000000	0.001062	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	VN	NT	11.000000	0.002922	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	VH	NT	1.000000	0.000266	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	VL	NT	19.000000	0.005080	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	VN	NT	17.000000	0.004545	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	VH	NT	7.000000	0.001872	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	VL	NT	19.000000	0.005080	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	VN	NT	19.000000	0.005080	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	VH	NT	6.000000	0.001604	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	VL	NT	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	VN	NT	4.000000	0.001067	PASS

DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	VH	NT	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+M	Outer_Full	VL	NT	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+M	Outer_Full	VN	NT	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+M	Outer_Full	VH	NT	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+H	Outer_Full	VL	NT	3.000000	0.000798	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+H	Outer_Full	VN	NT	17.000000	0.004521	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+H	Outer_Full	VH	NT	4.000000	0.001064	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+H	Outer_Full	VL	NT	5.000000	0.001330	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+H	Outer_Full	VN	NT	19.000000	0.005053	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+H	Outer_Full	VH	NT	6.000000	0.001596	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+L	Outer_Full	VL	NT	3.000000	0.000801	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+L	Outer_Full	VN	NT	13.000000	0.003471	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+L	Outer_Full	VH	NT	16.000000	0.004272	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+L	Outer_Full	VL	NT	15.000000	0.004005	PASS

DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+L	Outer_Full	VN	NT	10.000000	0.002670	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+L	Outer_Full	VH	NT	19.000000	0.005073	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+M	Outer_Full	VL	NT	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+M	Outer_Full	VN	NT	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+M	Outer_Full	VH	NT	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+M	Outer_Full	VL	NT	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+M	Outer_Full	VN	NT	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+M	Outer_Full	VH	NT	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+H	Outer_Full	VL	NT	18.000000	0.004794	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+H	Outer_Full	VN	NT	1.000000	0.000266	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-QPSK	M+H	Outer_Full	VH	NT	12.000000	0.003196	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+H	Outer_Full	VL	NT	15.000000	0.003995	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+H	Outer_Full	VN	NT	1.000000	0.000266	PASS
DC_71A _n78A-3 700-3800	30	5+90	DFT-16QAM	M+H	Outer_Full	VH	NT	19.000000	0.005060	PASS

DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+L	Outer_Full	VL	NT	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+L	Outer_Full	VN	NT	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+L	Outer_Full	VH	NT	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+L	Outer_Full	VL	NT	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+L	Outer_Full	VN	NT	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+L	Outer_Full	VH	NT	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+M	Outer_Full	VL	NT	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+M	Outer_Full	VN	NT	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+M	Outer_Full	VH	NT	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+M	Outer_Full	VL	NT	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+M	Outer_Full	VN	NT	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+M	Outer_Full	VH	NT	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+H	Outer_Full	VL	NT	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+H	Outer_Full	VN	NT	16.000000	0.004267	PASS

DC_71A _n78A-3 700-3800	30	5+100	DFT-QPSK	M+H	Outer_Full	VH	NT	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+H	Outer_Full	VL	NT	14.000000	0.003733	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+H	Outer_Full	VN	NT	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+100	DFT-16QAM	M+H	Outer_Full	VH	NT	5.000000	0.001333	PASS

Frequency Error VS. Temperature

Band	SCS	Bandwidth	Modulation	Channel	RB Config	Voltage	Temperature	Deviation(Hz)	Deviation (ppm)	Verdict
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	-30	3.000000	0.000810	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	-20	13.000000	0.003509	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	-10	19.000000	0.005128	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	0	19.000000	0.005128	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	10	16.000000	0.004318	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	20	15.000000	0.004048	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	30	15.000000	0.004048	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	40	9.000000	0.002429	PASS
DC_71A _n78A-3	30	5+10	DFT-QPSK	M+L	Outer_Full	NV	50	12.000000	0.003239	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	-30	17.000000	0.004588	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	-20	17.000000	0.004588	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	-10	7.000000	0.001889	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	0	7.000000	0.001889	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	10	13.000000	0.003509	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	20	16.000000	0.004318	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	30	7.000000	0.001889	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	40	6.000000	0.001619	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+L	Outer_Full	NV	50	9.000000	0.002429	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	-30	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	-20	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	-10	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	0	14.000000	0.003733	PASS
DC_71A _n78A-3	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	10	1.000000	0.000267	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	20	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	30	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	40	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+M	Outer_Full	NV	50	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	-30	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	-20	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	-10	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	0	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	10	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	20	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	30	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	40	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+M	Outer_Full	NV	50	19.000000	0.005067	PASS
DC_71A _n78A-3	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	-30	14.000000	0.003689	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	-20	17.000000	0.004480	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	-10	16.000000	0.004216	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	0	7.000000	0.001845	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	10	7.000000	0.001845	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	20	16.000000	0.004216	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	30	4.000000	0.001054	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	40	9.000000	0.002372	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-QPSK	M+H	Outer_Full	NV	50	9.000000	0.002372	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	-30	19.000000	0.005007	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	-20	6.000000	0.001581	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	-10	15.000000	0.003953	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	0	15.000000	0.003953	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	10	5.000000	0.001318	PASS
DC_71A _n78A-3	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	20	17.000000	0.004480	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	30	7.000000	0.001845	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	40	16.000000	0.004216	PASS
DC_71A _n78A-3 700-3800	30	5+10	DFT-16QAM	M+H	Outer_Full	NV	50	1.000000	0.000264	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	-30	6.000000	0.001618	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	-20	12.000000	0.003237	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	-10	12.000000	0.003237	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	0	11.000000	0.002967	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	10	9.000000	0.002428	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	20	7.000000	0.001888	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	30	13.000000	0.003506	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	40	13.000000	0.003506	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+L	Outer_Full	NV	50	12.000000	0.003237	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	-30	12.000000	0.003237	PASS
DC_71A _n78A-3	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	-20	18.000000	0.004855	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	-10	5.000000	0.001349	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	0	18.000000	0.004855	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	10	16.000000	0.004316	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	20	15.000000	0.004046	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	30	3.000000	0.000809	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	40	15.000000	0.004046	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+L	Outer_Full	NV	50	1.000000	0.000270	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	-30	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	-20	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	-10	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	0	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	10	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	20	19.000000	0.005067	PASS
DC_71A _n78A-3	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	30	16.000000	0.004267	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	40	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+M	Outer_Full	NV	50	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	-30	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	-20	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	-10	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	0	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	10	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	20	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	30	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	40	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+M	Outer_Full	NV	50	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	-30	14.000000	0.003692	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	-20	14.000000	0.003692	PASS
DC_71A _n78A-3	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	-10	4.000000	0.001055	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	0	3.000000	0.000791	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	10	16.000000	0.004219	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	20	11.000000	0.002900	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	30	10.000000	0.002637	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	40	15.000000	0.003955	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-QPSK	M+H	Outer_Full	NV	50	15.000000	0.003955	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	-30	7.000000	0.001846	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	-20	13.000000	0.003428	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	-10	6.000000	0.001582	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	0	4.000000	0.001055	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	10	9.000000	0.002373	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	20	12.000000	0.003164	PASS
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	30	18.000000	0.004746	PASS
DC_71A _n78A-3	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	40	17.000000	0.004483	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+15	DFT-16QAM	M+H	Outer_Full	NV	50	8.000000	0.002109	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	-30	19.000000	0.005121	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	-20	14.000000	0.003774	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	-10	14.000000	0.003774	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	0	4.000000	0.001078	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	10	4.000000	0.001078	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	20	8.000000	0.002156	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	30	16.000000	0.004313	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	40	16.000000	0.004313	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+L	Outer_Full	NV	50	7.000000	0.001887	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	-30	13.000000	0.003504	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	-20	16.000000	0.004313	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	-10	16.000000	0.004313	PASS
DC_71A _n78A-3	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	0	17.000000	0.004582	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	10	17.000000	0.004582	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	20	4.000000	0.001078	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	30	13.000000	0.003504	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	40	1.000000	0.000270	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+L	Outer_Full	NV	50	15.000000	0.004042	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	-30	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	-20	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	-10	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	0	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	10	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	20	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	30	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	40	7.000000	0.001867	PASS
DC_71A _n78A-3	30	5+20	DFT-QPSK	M+M	Outer_Full	NV	50	13.000000	0.003467	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	-30	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	-20	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	-10	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	0	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	10	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	20	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	30	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	40	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+M	Outer_Full	NV	50	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	-30	2.000000	0.000528	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	-20	2.000000	0.000528	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	-10	15.000000	0.003957	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	0	18.000000	0.004749	PASS
DC_71A _n78A-3	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	10	18.000000	0.004749	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	20	5.000000	0.001319	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	30	8.000000	0.002111	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	40	11.000000	0.002902	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-QPSK	M+H	Outer_Full	NV	50	17.000000	0.004486	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	-30	3.000000	0.000792	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	-20	3.000000	0.000792	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	-10	19.000000	0.005013	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	0	6.000000	0.001583	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	10	15.000000	0.003957	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	20	8.000000	0.002111	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	30	8.000000	0.002111	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	40	11.000000	0.002902	PASS
DC_71A _n78A-3 700-3800	30	5+20	DFT-16QAM	M+H	Outer_Full	NV	50	10.000000	0.002639	PASS
DC_71A _n78A-3	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	-30	14.000000	0.003769	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	-20	8.000000	0.002153	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	-10	17.000000	0.004576	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	0	19.000000	0.005114	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	10	6.000000	0.001615	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	20	3.000000	0.000808	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	30	10.000000	0.002692	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	40	16.000000	0.004307	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+L	Outer_Full	NV	50	2.000000	0.000538	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	-30	13.000000	0.003499	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	-20	4.000000	0.001077	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	-10	4.000000	0.001077	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	0	14.000000	0.003769	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	10	14.000000	0.003769	PASS
DC_71A _n78A-3	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	20	5.000000	0.001346	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	30	5.000000	0.001346	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	40	8.000000	0.002153	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+L	Outer_Full	NV	50	18.000000	0.004845	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	-30	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	-20	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	-10	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	0	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	10	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	20	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	30	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	40	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+M	Outer_Full	NV	50	14.000000	0.003733	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	-30	9.000000	0.002400	PASS
DC_71A _n78A-3	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	-20	19.000000	0.005067	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	-10	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	0	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	10	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	20	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	30	14.000000	0.003733	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	40	14.000000	0.003733	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+M	Outer_Full	NV	50	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	-30	4.000000	0.001057	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	-20	9.000000	0.002378	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	-10	9.000000	0.002378	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	0	12.000000	0.003170	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	10	2.000000	0.000528	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	20	2.000000	0.000528	PASS
DC_71A _n78A-3	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	30	12.000000	0.003170	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	40	5.000000	0.001321	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-QPSK	M+H	Outer_Full	NV	50	15.000000	0.003963	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	-30	3.000000	0.000793	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	-20	3.000000	0.000793	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	-10	8.000000	0.002114	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	0	13.000000	0.003435	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	10	19.000000	0.005020	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	20	5.000000	0.001321	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	30	5.000000	0.001321	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	40	12.000000	0.003170	PASS
DC_71A _n78A-3 700-3800	30	5+30	DFT-16QAM	M+H	Outer_Full	NV	50	18.000000	0.004756	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	-30	4.000000	0.001075	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	-20	10.000000	0.002688	PASS
DC_71A _n78A-3	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	-10	9.000000	0.002419	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	0	4.000000	0.001075	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	10	10.000000	0.002688	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	20	5.000000	0.001344	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	30	15.000000	0.004032	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	40	15.000000	0.004032	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+L	Outer_Full	NV	50	2.000000	0.000538	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	-30	9.000000	0.002419	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	-20	11.000000	0.002957	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	-10	2.000000	0.000538	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	0	2.000000	0.000538	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	10	7.000000	0.001882	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	20	13.000000	0.003495	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	30	19.000000	0.005108	PASS
DC_71A _n78A-3	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	40	10.000000	0.002688	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+L	Outer_Full	NV	50	16.000000	0.004301	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	-30	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	-20	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	-10	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	0	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	10	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	20	13.000000	0.003467	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	30	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	40	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+M	Outer_Full	NV	50	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	-30	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	-20	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	-10	14.000000	0.003733	PASS
DC_71A _n78A-3	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	0	8.000000	0.002133	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	10	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	20	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	30	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	40	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+M	Outer_Full	NV	50	6.000000	0.001600	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	-30	18.000000	0.004762	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	-20	18.000000	0.004762	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	-10	6.000000	0.001587	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	0	12.000000	0.003175	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	10	14.000000	0.003704	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	20	5.000000	0.001323	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	30	5.000000	0.001323	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	40	10.000000	0.002646	PASS
DC_71A _n78A-3	30	5+40	DFT-QPSK	M+H	Outer_Full	NV	50	16.000000	0.004233	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	-30	14.000000	0.003704	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	-20	9.000000	0.002381	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	-10	11.000000	0.002910	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	0	5.000000	0.001323	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	10	19.000000	0.005026	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	20	13.000000	0.003439	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	30	19.000000	0.005026	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	40	2.000000	0.000529	PASS
DC_71A _n78A-3 700-3800	30	5+40	DFT-16QAM	M+H	Outer_Full	NV	50	9.000000	0.002381	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	-30	3.000000	0.000805	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	-20	2.000000	0.000537	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	-10	11.000000	0.002953	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	0	17.000000	0.004564	PASS
DC_71A _n78A-3	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	10	9.000000	0.002416	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	20	16.000000	0.004295	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	30	16.000000	0.004295	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	40	7.000000	0.001879	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+L	Outer_Full	NV	50	13.000000	0.003490	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	-30	19.000000	0.005101	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	-20	5.000000	0.001342	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	-10	10.000000	0.002685	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	0	7.000000	0.001879	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	10	7.000000	0.001879	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	20	17.000000	0.004564	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	30	10.000000	0.002685	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	40	16.000000	0.004295	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+L	Outer_Full	NV	50	16.000000	0.004295	PASS
DC_71A _n78A-3	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	-30	6.000000	0.001600	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	-20	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	-10	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	0	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	10	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	20	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	30	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	40	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+M	Outer_Full	NV	50	4.000000	0.001067	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	-30	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	-20	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	-10	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	0	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	10	18.000000	0.004800	PASS
DC_71A _n78A-3	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	20	9.000000	0.002400	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	30	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	40	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+M	Outer_Full	NV	50	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	-30	19.000000	0.005033	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	-20	10.000000	0.002649	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	-10	10.000000	0.002649	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	0	16.000000	0.004238	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	10	14.000000	0.003709	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	20	5.000000	0.001325	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	30	5.000000	0.001325	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	40	14.000000	0.003709	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-QPSK	M+H	Outer_Full	NV	50	1.000000	0.000265	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	-30	15.000000	0.003974	PASS
DC_71A _n78A-3	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	-20	6.000000	0.001589	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	-10	18.000000	0.004768	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	0	14.000000	0.003709	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	10	19.000000	0.005033	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	20	5.000000	0.001325	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	30	5.000000	0.001325	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	40	15.000000	0.003974	PASS
DC_71A _n78A-3 700-3800	30	5+50	DFT-16QAM	M+H	Outer_Full	NV	50	15.000000	0.003974	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	-30	1.000000	0.000268	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	-20	11.000000	0.002949	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	-10	11.000000	0.002949	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	0	17.000000	0.004558	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	10	4.000000	0.001072	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	20	10.000000	0.002681	PASS
DC_71A _n78A-3	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	30	1.000000	0.000268	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	40	7.000000	0.001877	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+L	Outer_Full	NV	50	3.000000	0.000804	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	-30	15.000000	0.004021	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	-20	2.000000	0.000536	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	-10	6.000000	0.001609	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	0	16.000000	0.004290	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	10	16.000000	0.004290	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	20	1.000000	0.000268	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	30	14.000000	0.003753	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	40	5.000000	0.001340	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+L	Outer_Full	NV	50	14.000000	0.003753	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	-30	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	-20	9.000000	0.002400	PASS
DC_71A _n78A-3	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	-10	13.000000	0.003467	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	0	19.000000	0.005067	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	10	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	20	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	30	16.000000	0.004267	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	40	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+M	Outer_Full	NV	50	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	-30	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	-20	18.000000	0.004800	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	-10	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	0	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	10	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	20	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	30	15.000000	0.004000	PASS
DC_71A _n78A-3	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	40	15.000000	0.004000	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+M	Outer_Full	NV	50	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	-30	19.000000	0.005040	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	-20	4.000000	0.001061	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	-10	17.000000	0.004509	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	0	7.000000	0.001857	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	10	14.000000	0.003714	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	20	17.000000	0.004509	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	30	17.000000	0.004509	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	40	15.000000	0.003979	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-QPSK	M+H	Outer_Full	NV	50	3.000000	0.000796	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	-30	6.000000	0.001592	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	-20	13.000000	0.003448	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	-10	10.000000	0.002653	PASS
DC_71A _n78A-3	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	0	1.000000	0.000265	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	10	8.000000	0.002122	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	20	19.000000	0.005040	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	30	14.000000	0.003714	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	40	9.000000	0.002387	PASS
DC_71A _n78A-3 700-3800	30	5+60	DFT-16QAM	M+H	Outer_Full	NV	50	8.000000	0.002122	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	-30	11.000000	0.002945	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	-20	18.000000	0.004819	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	-10	9.000000	0.002410	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	0	9.000000	0.002410	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	10	9.000000	0.002410	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	20	16.000000	0.004284	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	30	1.000000	0.000268	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	40	15.000000	0.004015	PASS
DC_71A _n78A-3	30	5+70	DFT-QPSK	M+L	Outer_Full	NV	50	15.000000	0.004015	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	-30	14.000000	0.003748	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	-20	13.000000	0.003481	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	-10	17.000000	0.004552	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	0	17.000000	0.004552	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	10	19.000000	0.005087	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	20	5.000000	0.001339	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	30	3.000000	0.000803	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	40	2.000000	0.000535	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+L	Outer_Full	NV	50	12.000000	0.003213	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	-30	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	-20	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	-10	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	0	1.000000	0.000267	PASS
DC_71A _n78A-3	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	10	14.000000	0.003733	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	20	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	30	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	40	9.000000	0.002400	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+M	Outer_Full	NV	50	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	-30	17.000000	0.004533	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	-20	5.000000	0.001333	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	-10	11.000000	0.002933	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	0	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	10	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	20	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	30	8.000000	0.002133	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	40	10.000000	0.002667	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+M	Outer_Full	NV	50	4.000000	0.001067	PASS
DC_71A _n78A-3	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	-30	16.000000	0.004250	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	-20	14.000000	0.003718	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	-10	14.000000	0.003718	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	0	2.000000	0.000531	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	10	9.000000	0.002390	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	20	16.000000	0.004250	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	30	15.000000	0.003983	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	40	6.000000	0.001594	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-QPSK	M+H	Outer_Full	NV	50	13.000000	0.003453	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	-30	17.000000	0.004515	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	-20	19.000000	0.005046	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	-10	2.000000	0.000531	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	0	5.000000	0.001328	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	10	9.000000	0.002390	PASS
DC_71A _n78A-3	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	20	16.000000	0.004250	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	30	10.000000	0.002656	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	40	10.000000	0.002656	PASS
DC_71A _n78A-3 700-3800	30	5+70	DFT-16QAM	M+H	Outer_Full	NV	50	17.000000	0.004515	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	-30	7.000000	0.001872	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	-20	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	-10	15.000000	0.004011	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	0	2.000000	0.000535	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	10	2.000000	0.000535	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	20	10.000000	0.002674	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	30	16.000000	0.004278	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	40	11.000000	0.002941	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+L	Outer_Full	NV	50	18.000000	0.004813	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	-30	11.000000	0.002941	PASS
DC_71A _n78A-3	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	-20	3.000000	0.000802	PASS

700-3800										
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	-10	10.000000	0.002674	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	0	8.000000	0.002139	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	10	17.000000	0.004545	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	20	5.000000	0.001337	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	30	18.000000	0.004813	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	40	1.000000	0.000267	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-16QAM	M+L	Outer_Full	NV	50	18.000000	0.004813	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	-30	15.000000	0.004000	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	-20	3.000000	0.000800	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	-10	12.000000	0.003200	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	0	7.000000	0.001867	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	10	2.000000	0.000533	PASS
DC_71A _n78A-3 700-3800	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	20	2.000000	0.000533	PASS
DC_71A _n78A-3	30	5+80	DFT-QPSK	M+M	Outer_Full	NV	30	6.000000	0.001600	PASS