




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

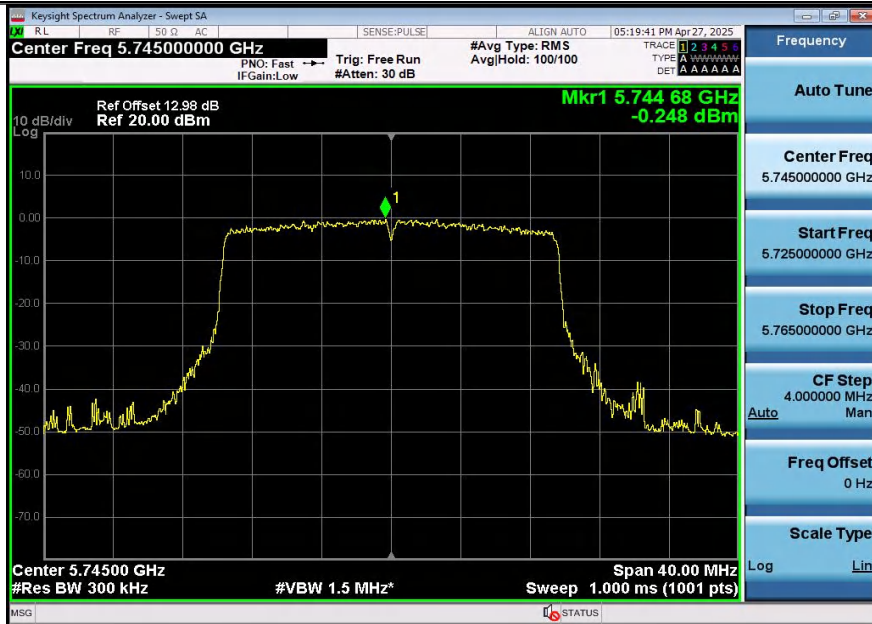

11AX20SISO-Ant2-5745-PASS

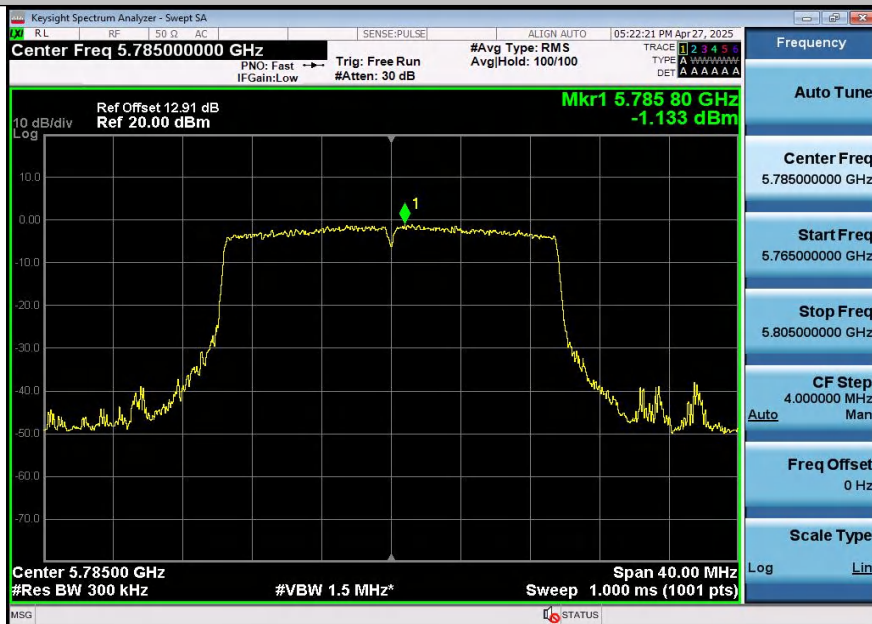

11AX20SISO-Ant2-5785-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

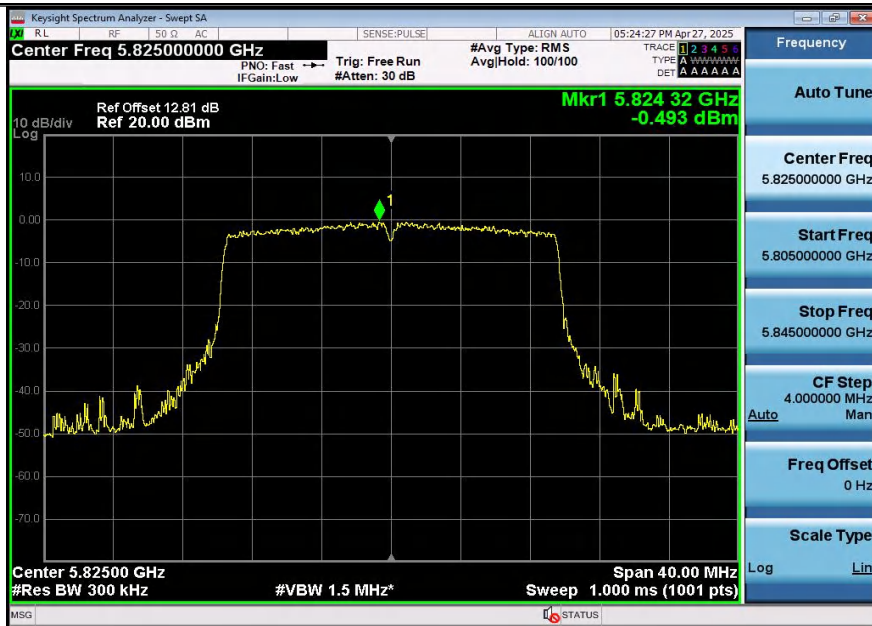

11AX20SISO-Ant2-5825-PASS

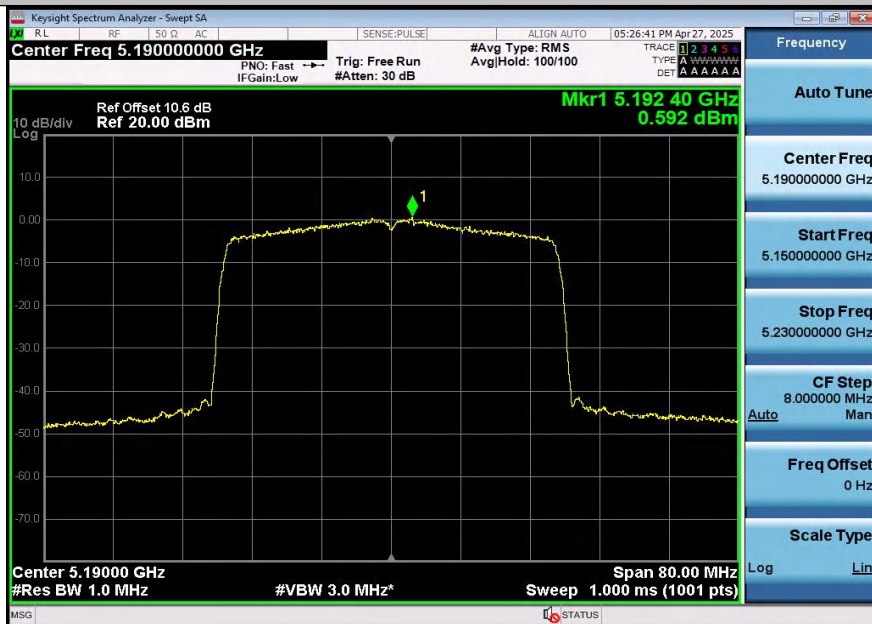

11AX40SISO-Ant2-5190-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

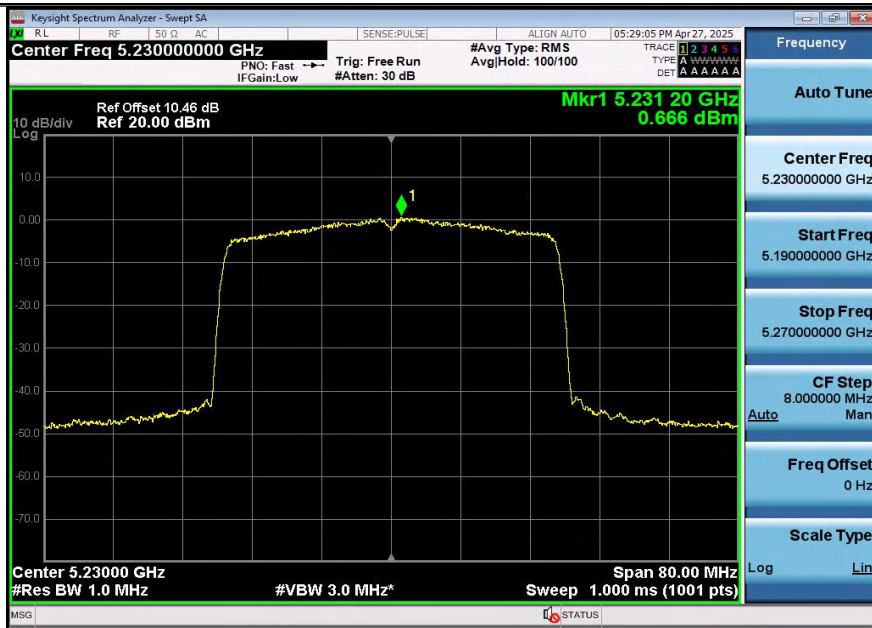

11AX40SISO-Ant2-5230-PASS

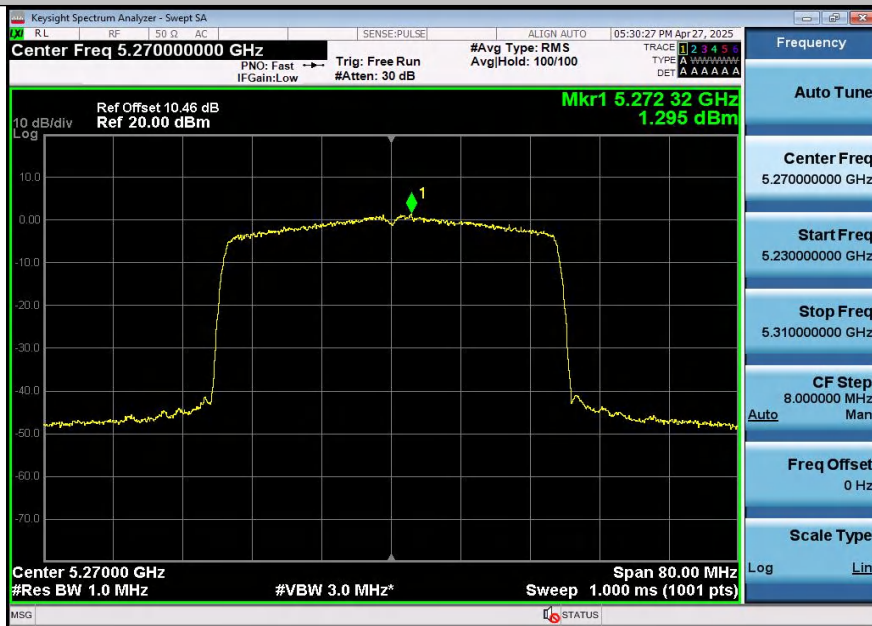

11AX40SISO-Ant2-5270-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

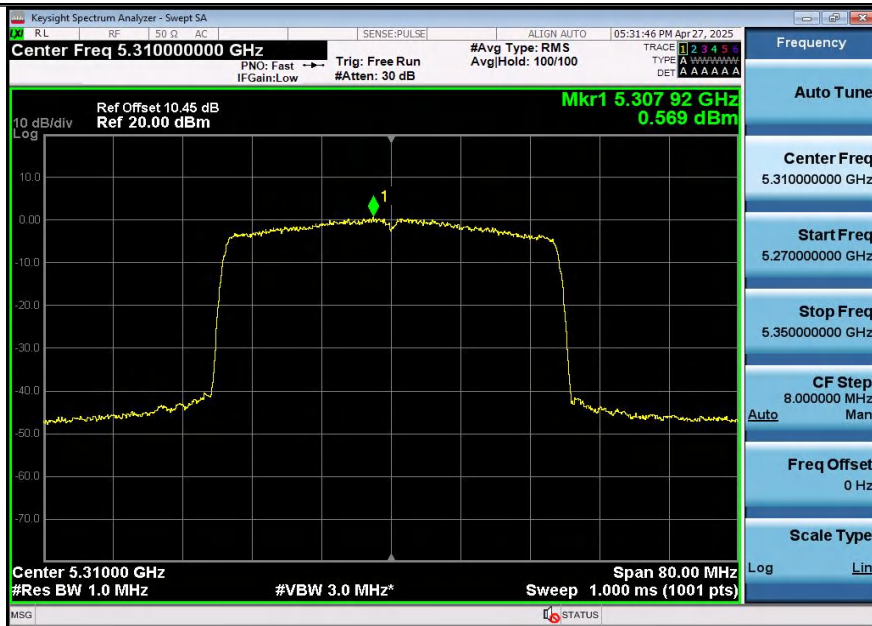

11AX40SISO-Ant2-5310-PASS

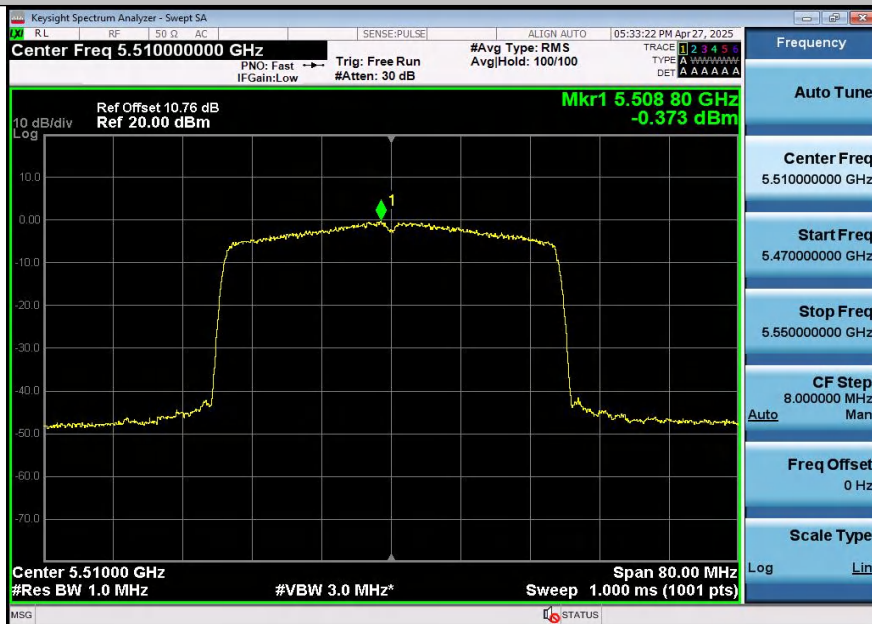

11AX40SISO-Ant2-5510-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

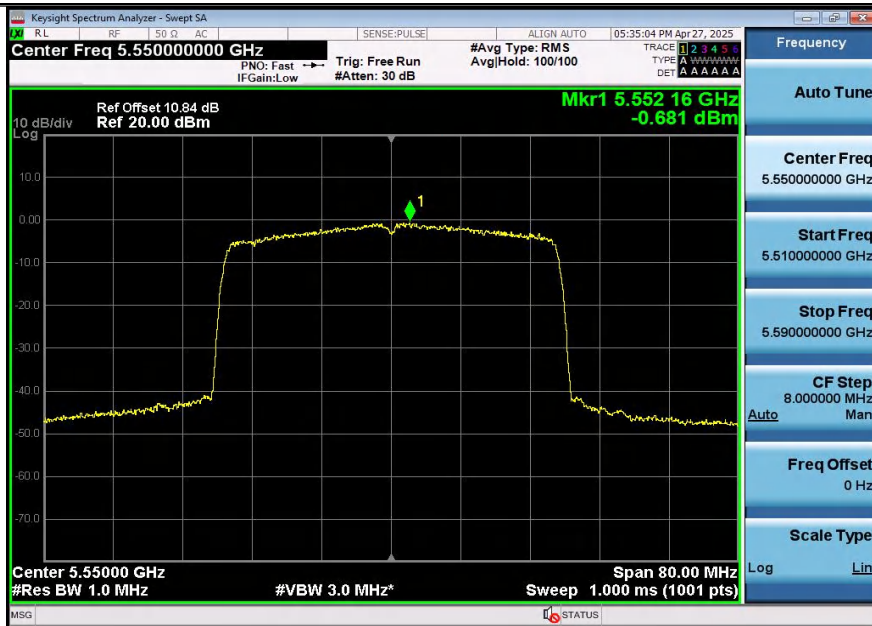

11AX40SISO-Ant2-5550-PASS

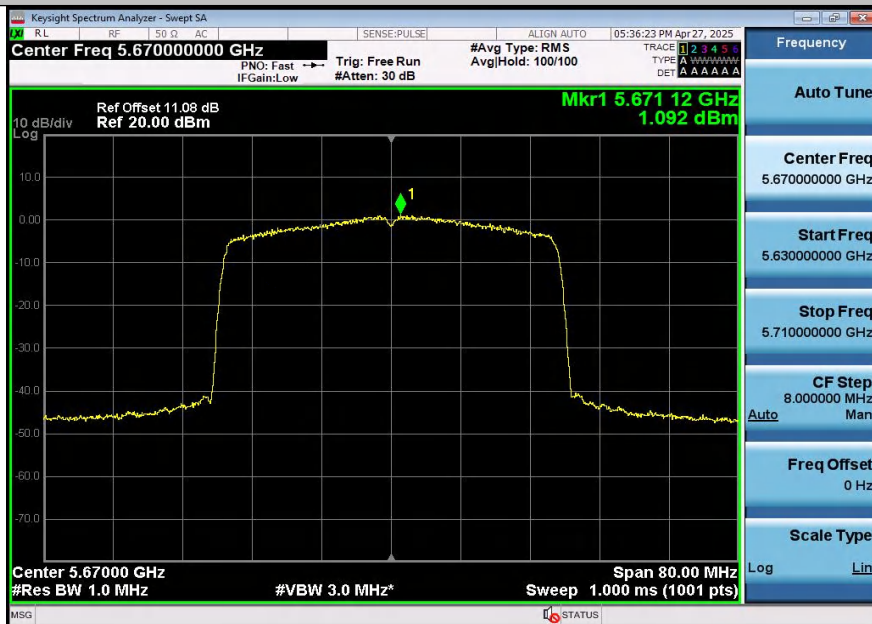

11AX40SISO-Ant2-5670-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

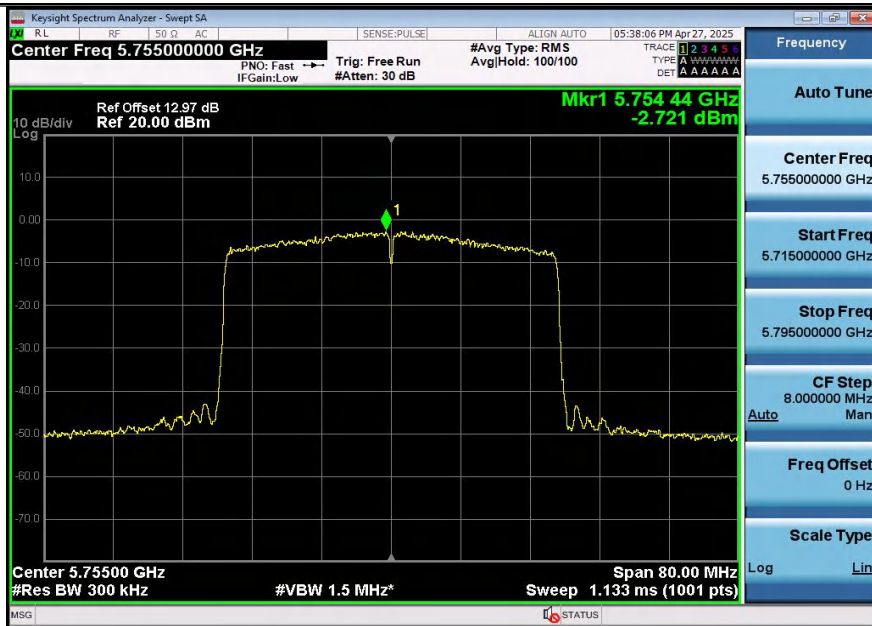

11AX40SISO-Ant2-5755-PASS

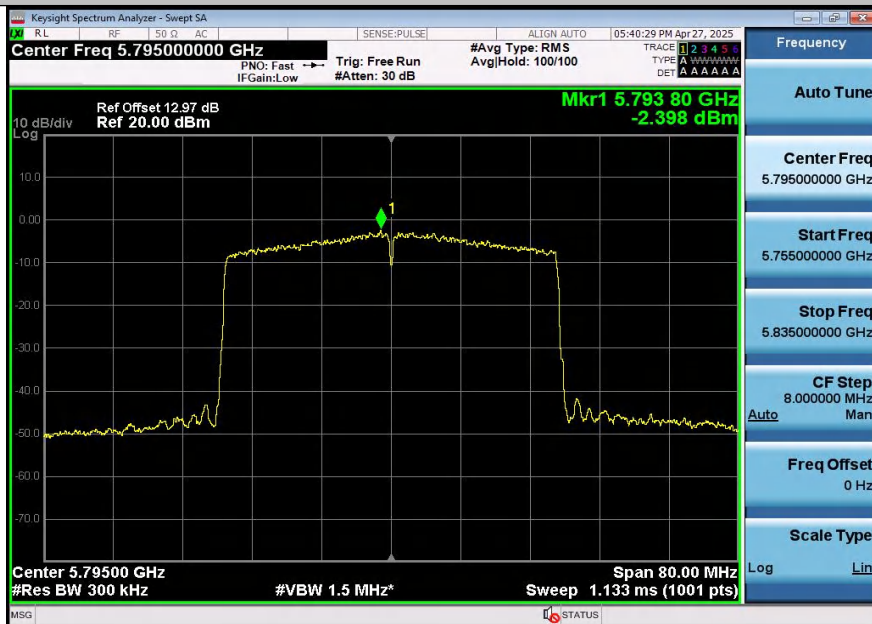

11AX40SISO-Ant2-5795-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

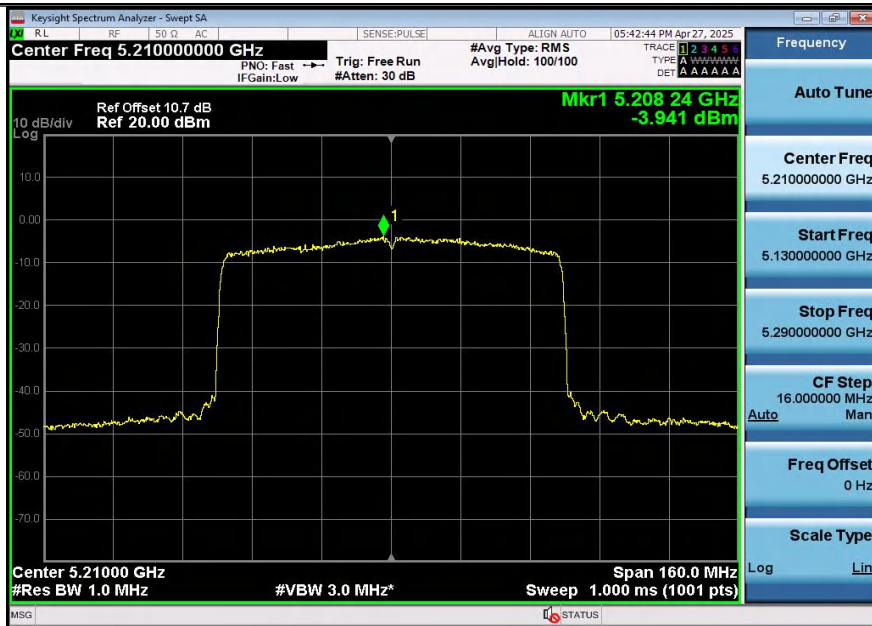

11AX80SISO-Ant2-5210-PASS

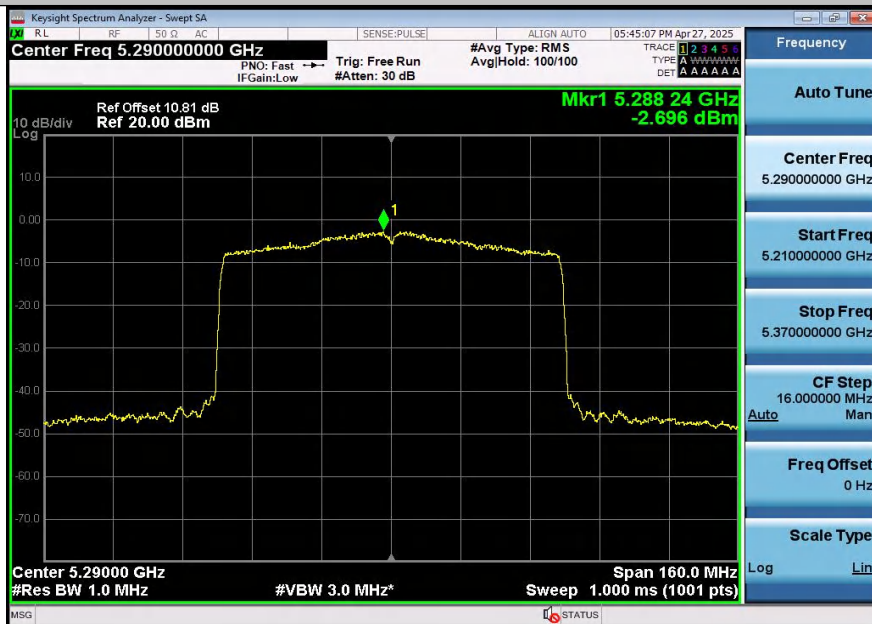

11AX80SISO-Ant2-5290-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

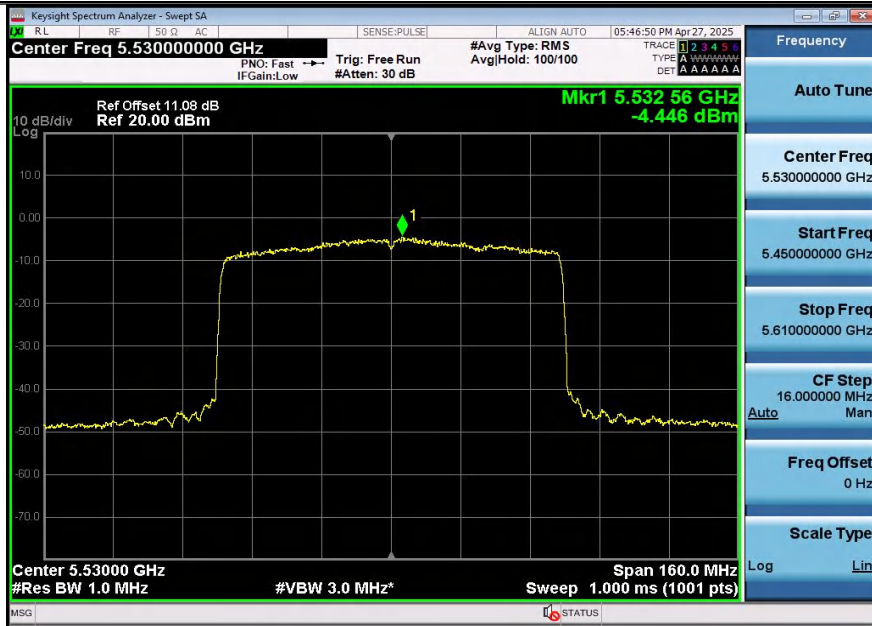

11AX80SISO-Ant2-5530-PASS

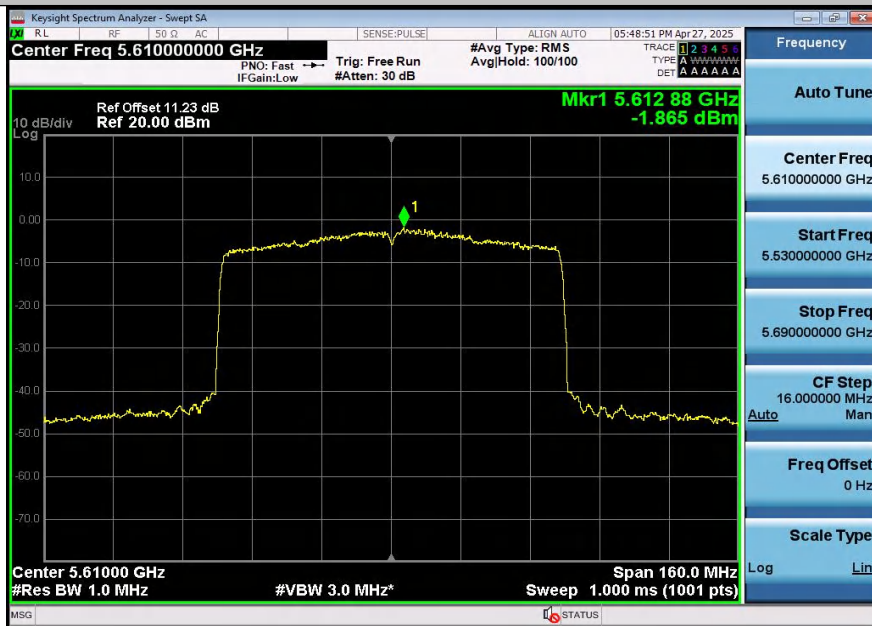

11AX80SISO-Ant2-5610-PASS



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04





MIMO

Test Mode	Frequency [MHz]	Ant 1 Result [dBm/MHz]	Ant 2 Result [dBm/MHz]	MIMO Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11N20SISO	5180	1.31	1.77	4.56	≤9.39	PASS
11N20SISO	5220	1.61	2.47	5.07	≤9.39	PASS
11N20SISO	5240	-0.06	3.64	5.18	≤9.39	PASS
11N20SISO	5260	0.54	2.39	4.57	≤9.39	PASS
11N20SISO	5300	1.27	2.71	5.06	≤9.39	PASS
11N20SISO	5320	0.46	1.79	4.19	≤9.39	PASS
11N20SISO	5500	3.30	0.87	5.26	≤9.39	PASS
11N20SISO	5580	2.55	2.03	5.31	≤9.39	PASS
11N20SISO	5700	1.94	1.78	4.87	≤9.39	PASS
11N20SISO	5745	1.008	1.638	4.34	≤28.39	PASS
11N20SISO	5785	1.178	1.018	4.11	≤28.39	PASS
11N20SISO	5825	0.598	1.458	4.06	≤28.39	PASS
11N40SISO	5190	-0.22	0.21	3.01	≤9.39	PASS
11N40SISO	5230	-1.77	0.78	2.70	≤9.39	PASS
11N40SISO	5270	-0.52	1.22	3.45	≤9.39	PASS
11N40SISO	5310	-2.00	0.54	2.46	≤9.39	PASS
11N40SISO	5510	1.27	-0.08	3.66	≤9.39	PASS
11N40SISO	5550	1.31	-0.31	3.59	≤9.39	PASS
11N40SISO	5670	0.10	1.23	3.71	≤9.39	PASS
11N40SISO	5755	-1.142	-0.152	2.39	≤28.39	PASS
11N40SISO	5795	-1.302	-0.772	1.98	≤28.39	PASS
11AC20SISO	5180	1.43	1.74	4.60	≤9.39	PASS
11AC20SISO	5220	1.81	1.62	4.73	≤9.39	PASS
11AC20SISO	5240	0.28	2.25	4.39	≤9.39	PASS
11AC20SISO	5260	0.86	2.55	4.80	≤9.39	PASS
11AC20SISO	5300	1.43	2.83	5.20	≤9.39	PASS
11AC20SISO	5320	0.14	1.71	4.01	≤9.39	PASS
11AC20SISO	5500	3.24	1.13	5.32	≤9.39	PASS
11AC20SISO	5580	2.50	2.26	5.39	≤9.39	PASS
11AC20SISO	5700	1.95	1.57	4.77	≤9.39	PASS
11AC20SISO	5745	1.308	1.848	4.60	≤28.39	PASS
11AC20SISO	5785	1.258	0.728	4.01	≤28.39	PASS



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

11AC20SISO	5825	0.768	1.228	4.01	≤28.39	PASS
11AC40SISO	5190	-0.15	0.63	3.27	≤9.39	PASS
11AC40SISO	5230	-1.81	0.65	2.60	≤9.39	PASS
11AC40SISO	5270	-0.78	0.44	2.88	≤9.39	PASS
11AC40SISO	5310	-1.88	0.77	2.65	≤9.39	PASS
11AC40SISO	5510	1.12	-0.40	3.44	≤9.39	PASS
11AC40SISO	5550	1.21	-0.77	3.34	≤9.39	PASS
11AC40SISO	5670	0.21	1.29	3.79	≤9.39	PASS
11AC40SISO	5755	-0.842	-0.042	2.59	≤28.39	PASS
11AC40SISO	5795	-0.992	-0.602	2.22	≤28.39	PASS
11AC80SISO	5210	-4.37	-3.44	-0.87	≤9.39	PASS
11AC80SISO	5290	-4.67	-2.46	-0.42	≤9.39	PASS
11AC80SISO	5530	-1.82	-4.34	0.11	≤9.39	PASS
11AC80SISO	5610	-1.14	-1.13	1.88	≤9.39	PASS
11AC80SISO	5775	-3.162	-3.382	-0.26	≤28.39	PASS
11AX20SISO	5180	2.09	2.48	5.30	≤9.39	PASS
11AX20SISO	5220	2.01	1.70	4.87	≤9.39	PASS
11AX20SISO	5240	0.54	2.47	4.62	≤9.39	PASS
11AX20SISO	5260	1.38	2.53	5.00	≤9.39	PASS
11AX20SISO	5300	1.94	3.24	5.65	≤9.39	PASS
11AX20SISO	5320	0.53	2.09	4.39	≤9.39	PASS
11AX20SISO	5500	3.69	1.53	5.75	≤9.39	PASS
11AX20SISO	5580	2.76	2.35	5.57	≤9.39	PASS
11AX20SISO	5700	2.47	2.18	5.34	≤9.39	PASS
11AX20SISO	5745	1.688	1.968	4.84	≤28.39	PASS
11AX20SISO	5785	1.488	1.088	4.30	≤28.39	PASS
11AX20SISO	5825	1.078	1.728	4.43	≤28.39	PASS
11AX40SISO	5190	-0.28	0.59	3.19	≤9.39	PASS
11AX40SISO	5230	-1.82	0.67	2.61	≤9.39	PASS
11AX40SISO	5270	-0.79	1.30	3.39	≤9.39	PASS
11AX40SISO	5310	-1.83	0.57	2.54	≤9.39	PASS
11AX40SISO	5510	1.26	-0.37	3.53	≤9.39	PASS
11AX40SISO	5550	1.07	-0.68	3.29	≤9.39	PASS
11AX40SISO	5670	0.64	1.09	3.88	≤9.39	PASS
11AX40SISO	5755	-0.922	-0.502	2.30	≤28.39	PASS
11AX40SISO	5795	-0.912	-0.182	2.48	≤28.39	PASS
11AX80SISO	5210	-3.93	-3.94	-0.92	≤9.39	PASS
11AX80SISO	5290	-4.98	-2.70	-0.68	≤9.39	PASS
11AX80SISO	5530	-2.05	-4.45	-0.08	≤9.39	PASS
11AX80SISO	5610	-2.24	-1.87	0.96	≤9.39	PASS



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

11AX80SISO	5775	-4.542	-4.642	-1.58	≤28.39	PASS
------------	------	--------	--------	-------	--------	------

Remark:Directional gain= 4.60dBi+10log2=7.61dBi.



Appendix E: Band edge measurements

Ant 1

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-42.93	≤ -27	PASS
11A	Ant1	High	5320	-44.21	≤ -27	PASS
11A	Ant1	Low	5500	-42.81	≤ -27	PASS
11A	Ant1	High	5700	-43.69	≤ -27	PASS
11N20SISO	Ant1	Low	5180	-42.68	≤ -27	PASS
11N20SISO	Ant1	High	5320	-44.31	≤ -27	PASS
11N20SISO	Ant1	Low	5500	-44.25	≤ -27	PASS
11N20SISO	Ant1	High	5700	-42.95	≤ -27	PASS
11N40SISO	Ant1	Low	5190	-42.7	≤ -27	PASS
11N40SISO	Ant1	High	5310	-44.66	≤ -27	PASS
11N40SISO	Ant1	Low	5510	-44.05	≤ -27	PASS
11N40SISO	Ant1	High	5670	-43.71	≤ -27	PASS
11AC20SISO	Ant1	Low	5180	-42.59	≤ -27	PASS
11AC20SISO	Ant1	High	5320	-43.99	≤ -27	PASS
11AC20SISO	Ant1	Low	5500	-43.95	≤ -27	PASS
11AC20SISO	Ant1	High	5700	-44.04	≤ -27	PASS
11AC40SISO	Ant1	Low	5190	-42.87	≤ -27	PASS
11AC40SISO	Ant1	High	5310	-44.34	≤ -27	PASS
11AC40SISO	Ant1	Low	5510	-43.26	≤ -27	PASS
11AC40SISO	Ant1	High	5670	-43.53	≤ -27	PASS
11AC80SISO	Ant1	Low	5210	-42.41	≤ -27	PASS
11AC80SISO	Ant1	High	5290	-42.8	≤ -27	PASS
11AC80SISO	Ant1	Low	5530	-43.45	≤ -27	PASS
11AC80SISO	Ant1	High	5610	-44.21	≤ -27	PASS
11AX20SISO	Ant1	Low	5180	-43.14	≤ -27	PASS
11AX20SISO	Ant1	High	5320	-43.93	≤ -27	PASS
11AX20SISO	Ant1	Low	5500	-43.38	≤ -27	PASS
11AX20SISO	Ant1	High	5700	-43.59	≤ -27	PASS
11AX40SISO	Ant1	Low	5190	-42.67	≤ -27	PASS
11AX40SISO	Ant1	High	5310	-43.32	≤ -27	PASS
11AX40SISO	Ant1	Low	5510	-43.65	≤ -27	PASS
11AX40SISO	Ant1	High	5670	-44.1	≤ -27	PASS
11AX80SISO	Ant1	Low	5210	-42.86	≤ -27	PASS



11AX80SISO	Ant1	High	5290	-43.49	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-44.04	≤-27	PASS
11AX80SISO	Ant1	High	5610	-44	≤-27	PASS

Remark:The cable loss and antenna gain is compensated in the graph.

Test Result B4

Test Mode	Antenna	ChName	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-46.2	≤16.34	PASS
11A	Ant1	Low	5745	5700~5720	-47.64	≤10.09	PASS
11A	Ant1	Low	5745	5650~5700	-48.69	≤-26.45	PASS
11A	Ant1	Low	5745	5760~5650	-48.49	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-47.33	≤16.34	PASS
11A	Ant1	High	5825	5855~5875	-48.14	≤10.13	PASS
11A	Ant1	High	5825	5875~5925	-48.62	≤-26.11	PASS
11A	Ant1	High	5825	5925~5935	-48.1	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-48.6	≤15.82	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-46.78	≤10.57	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-49.71	≤-26.79	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-48.63	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-48.2	≤16.03	PASS
11N20SISO	Ant1	High	5825	5855~5875	-48.69	≤10.55	PASS
11N20SISO	Ant1	High	5825	5875~5925	-49.89	≤-26.81	PASS
11N20SISO	Ant1	High	5825	5925~5935	-48.52	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-47.71	≤16.04	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-47.61	≤10.78	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-49.39	≤-26.50	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-48.48	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-48.97	≤15.66	PASS
11N40SISO	Ant1	High	5795	5855~5875	-48.14	≤10.11	PASS
11N40SISO	Ant1	High	5795	5875~5925	-48.8	≤-26.22	PASS
11N40SISO	Ant1	High	5795	5925~5935	-48.6	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-47.89	≤15.82	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-48.06	≤10.35	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-50.02	≤-26.96	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-48.81	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-49.08	≤15.73	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-49.19	≤10.59	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-47.74	≤-26.11	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-46.15	≤-27	PASS



11AC40SISO	Ant1	Low	5755	5720~5725	-45.09	≤18.51	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-45.74	≤12.93	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-49.43	≤-26.60	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-48.31	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-48.77	≤16.41	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-48.49	≤10.48	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-49.81	≤-26.95	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-48.6	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-48	≤15.65	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-47.31	≤11.27	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-49.4	≤-26.91	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-48.61	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-46.64	≤17.53	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-49.4	≤10.19	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-48.09	≤-25.50	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-47.02	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-46.83	≤15.82	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-47.76	≤10.18	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-49.3	≤-26.96	PASS
11AX20SISO	Ant1	Low	5745	5760~5650	-47.76	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-48.61	≤16.03	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-47.71	≤10.81	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-48.64	≤-26.41	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-48.11	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-48.11	≤16.04	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-47.63	≤10.67	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-47.96	≤-26.30	PASS
11AX40SISO	Ant1	Low	5755	5780~5650	-49.06	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-47.74	≤16.03	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-49	≤10.29	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-48.32	≤-26.59	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-48.64	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-48.34	≤16.00	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-47.84	≤11.05	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-49.85	≤-26.34	PASS
11AX80SISO	Ant1	Low	5775	5800~5650	-48.12	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-48.48	≤17.10	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-48.79	≤10.35	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-49.11	≤-26.73	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-48.56	≤-27	PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

Test Graphs B1/2/3

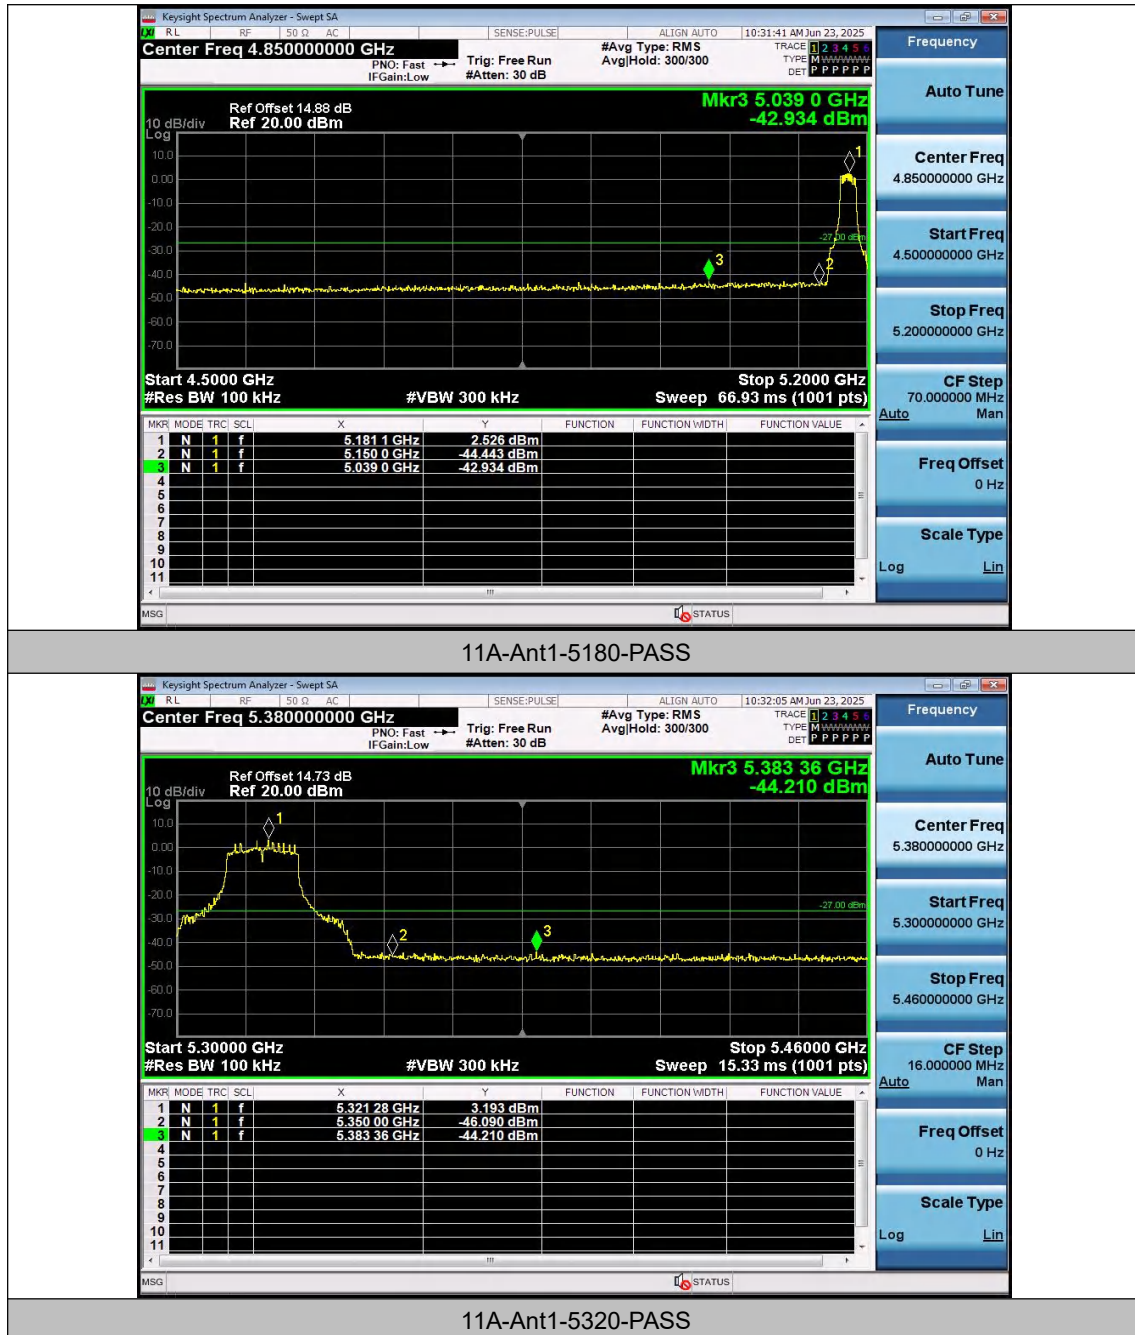




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

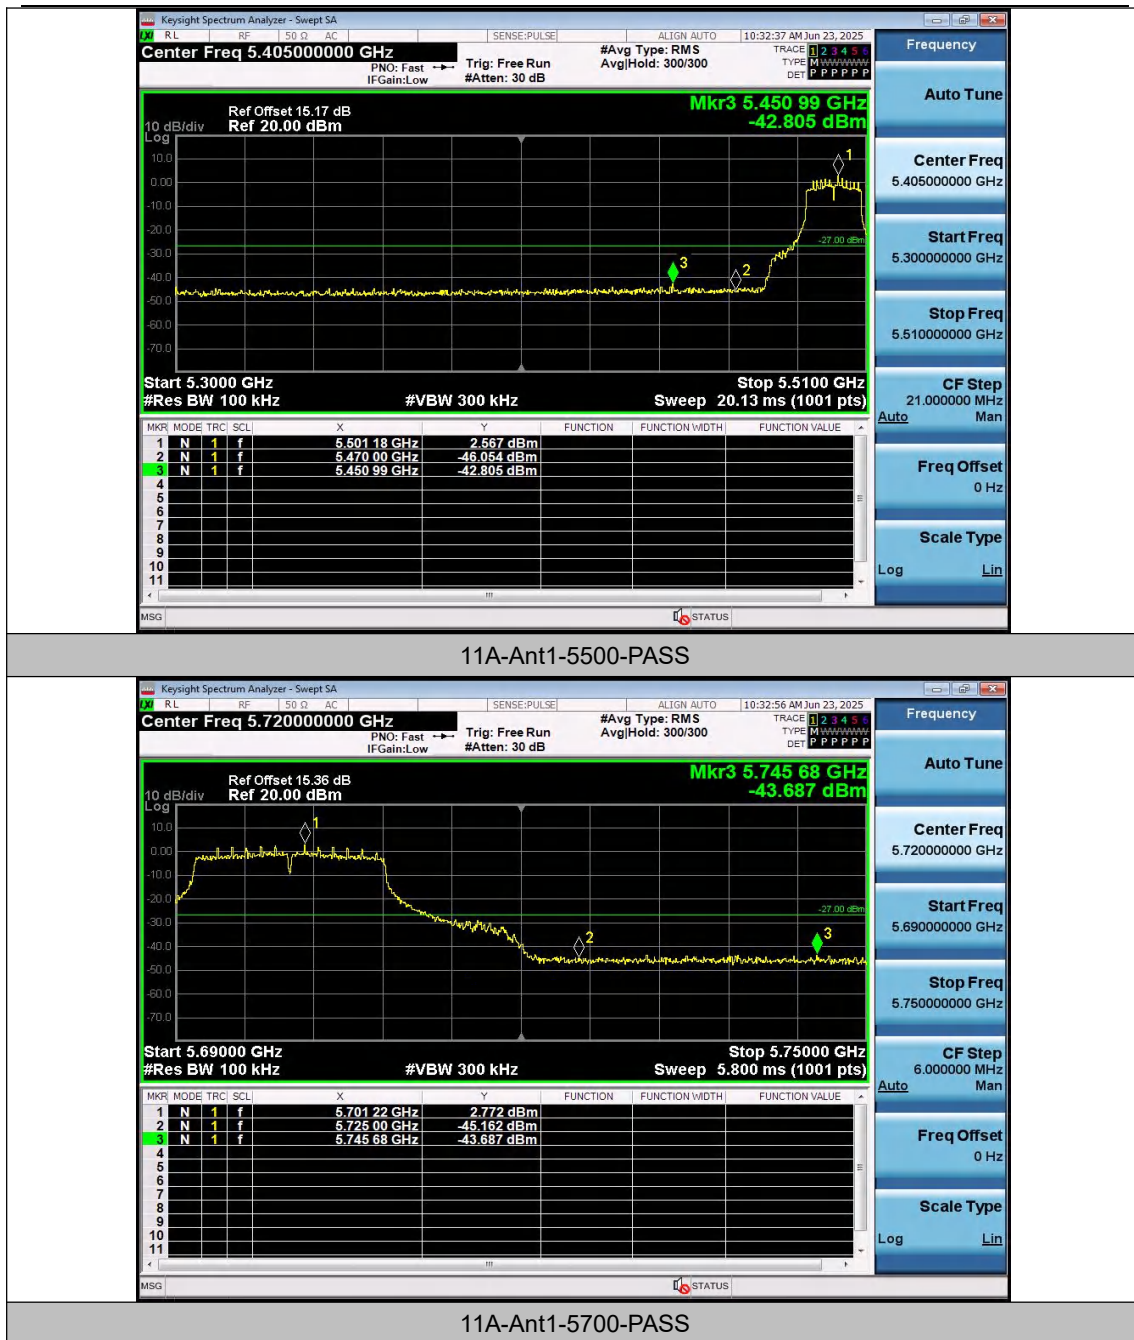




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

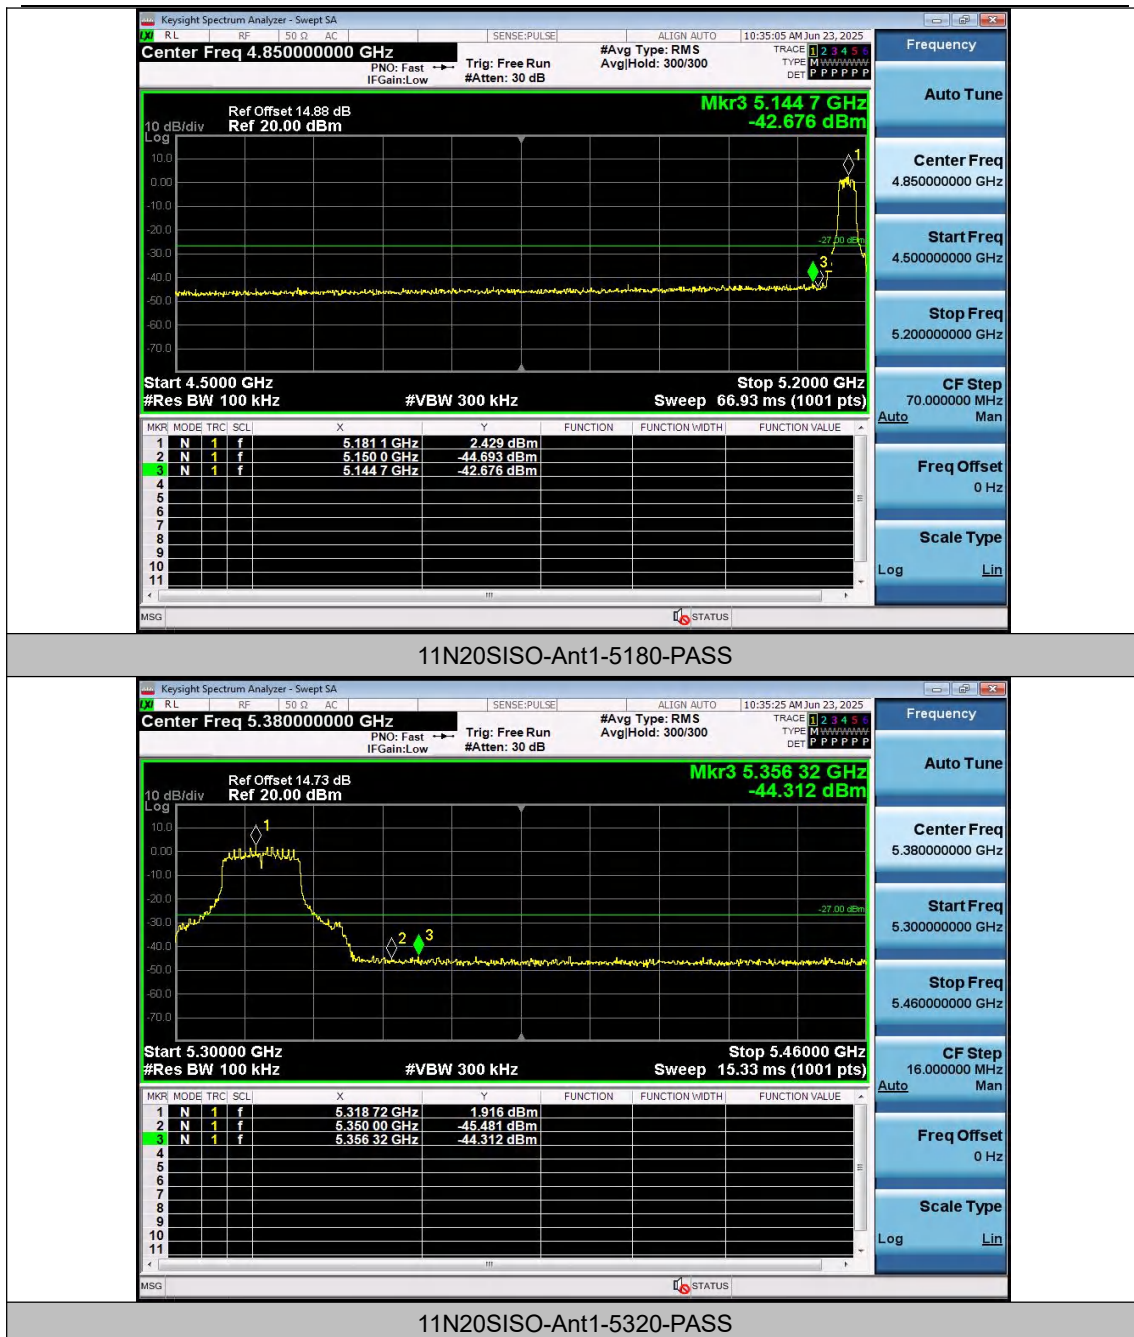




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

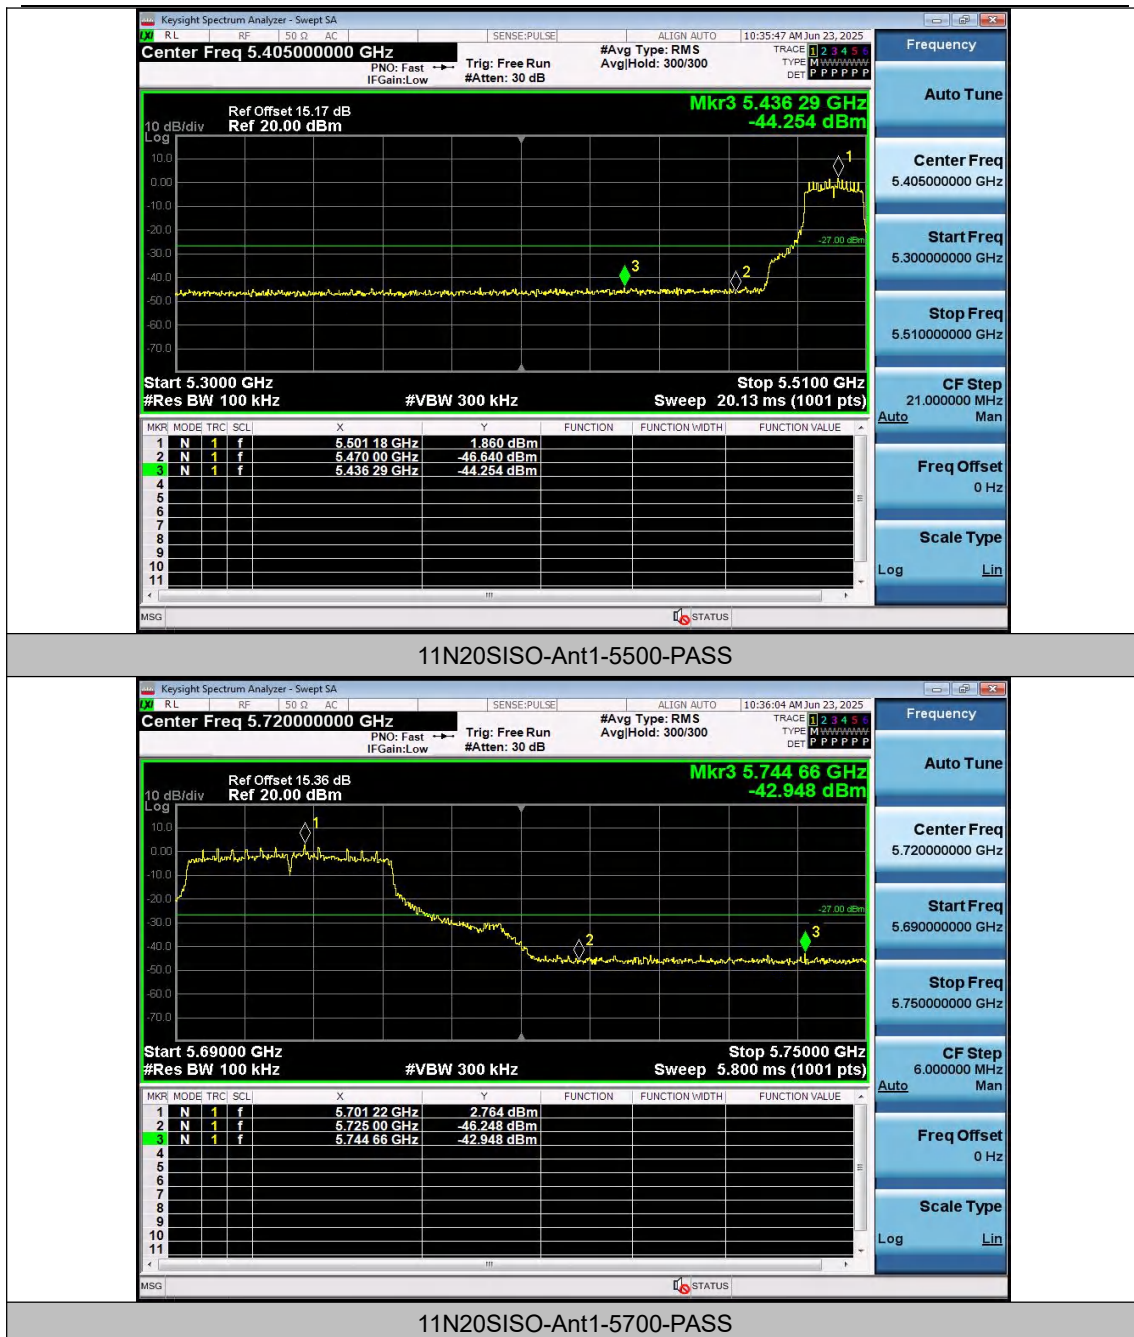




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

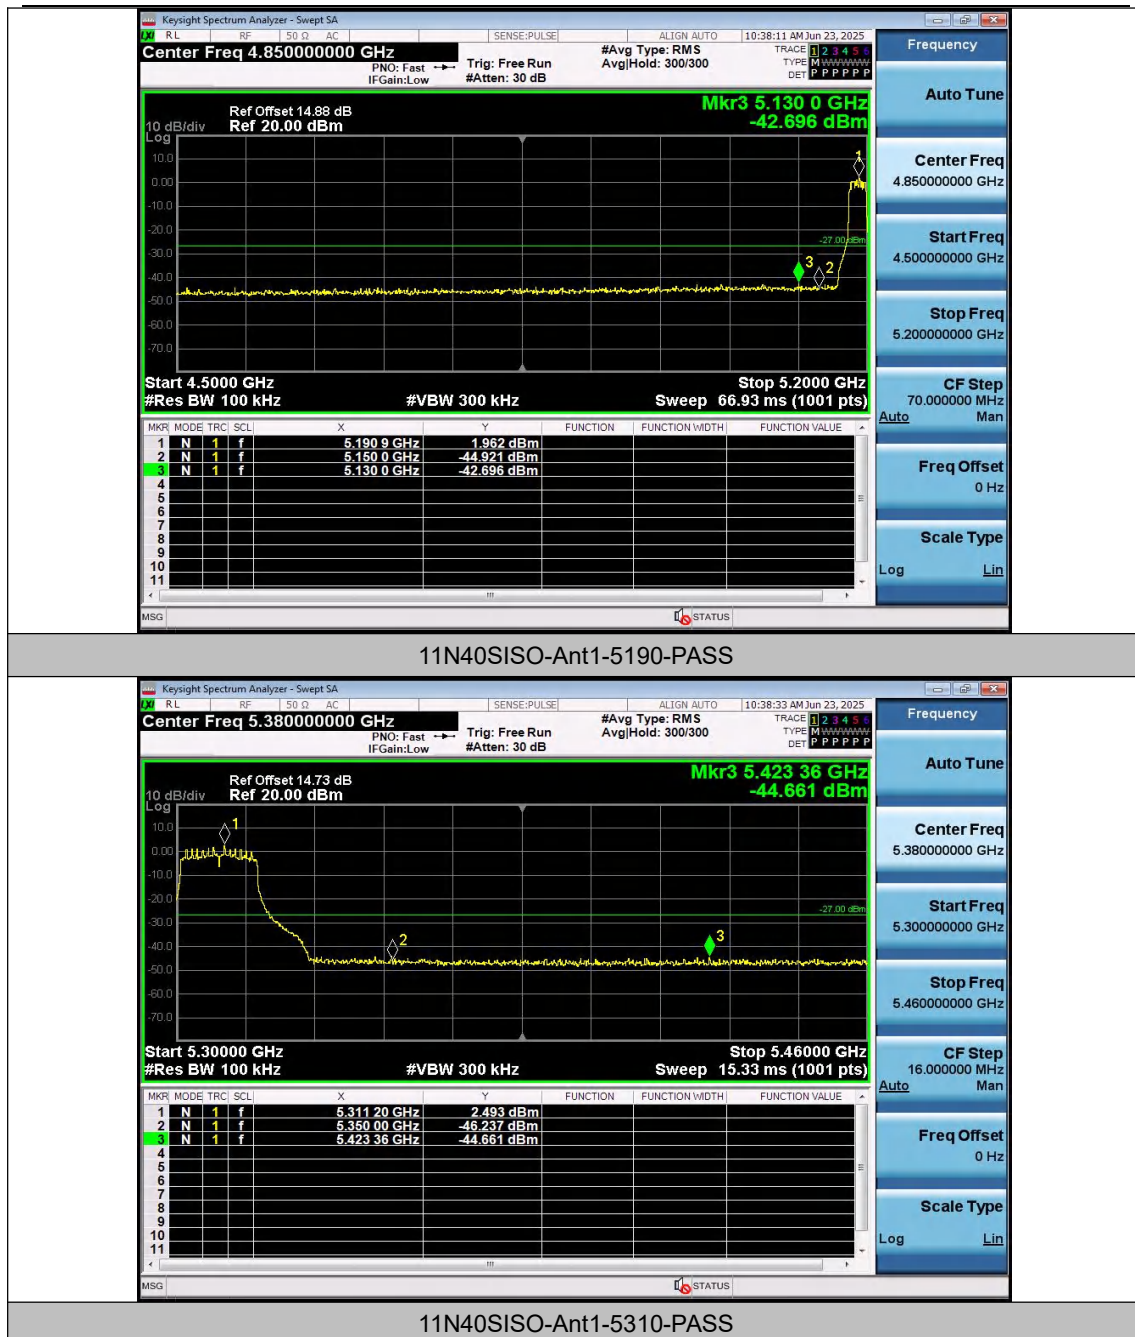




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

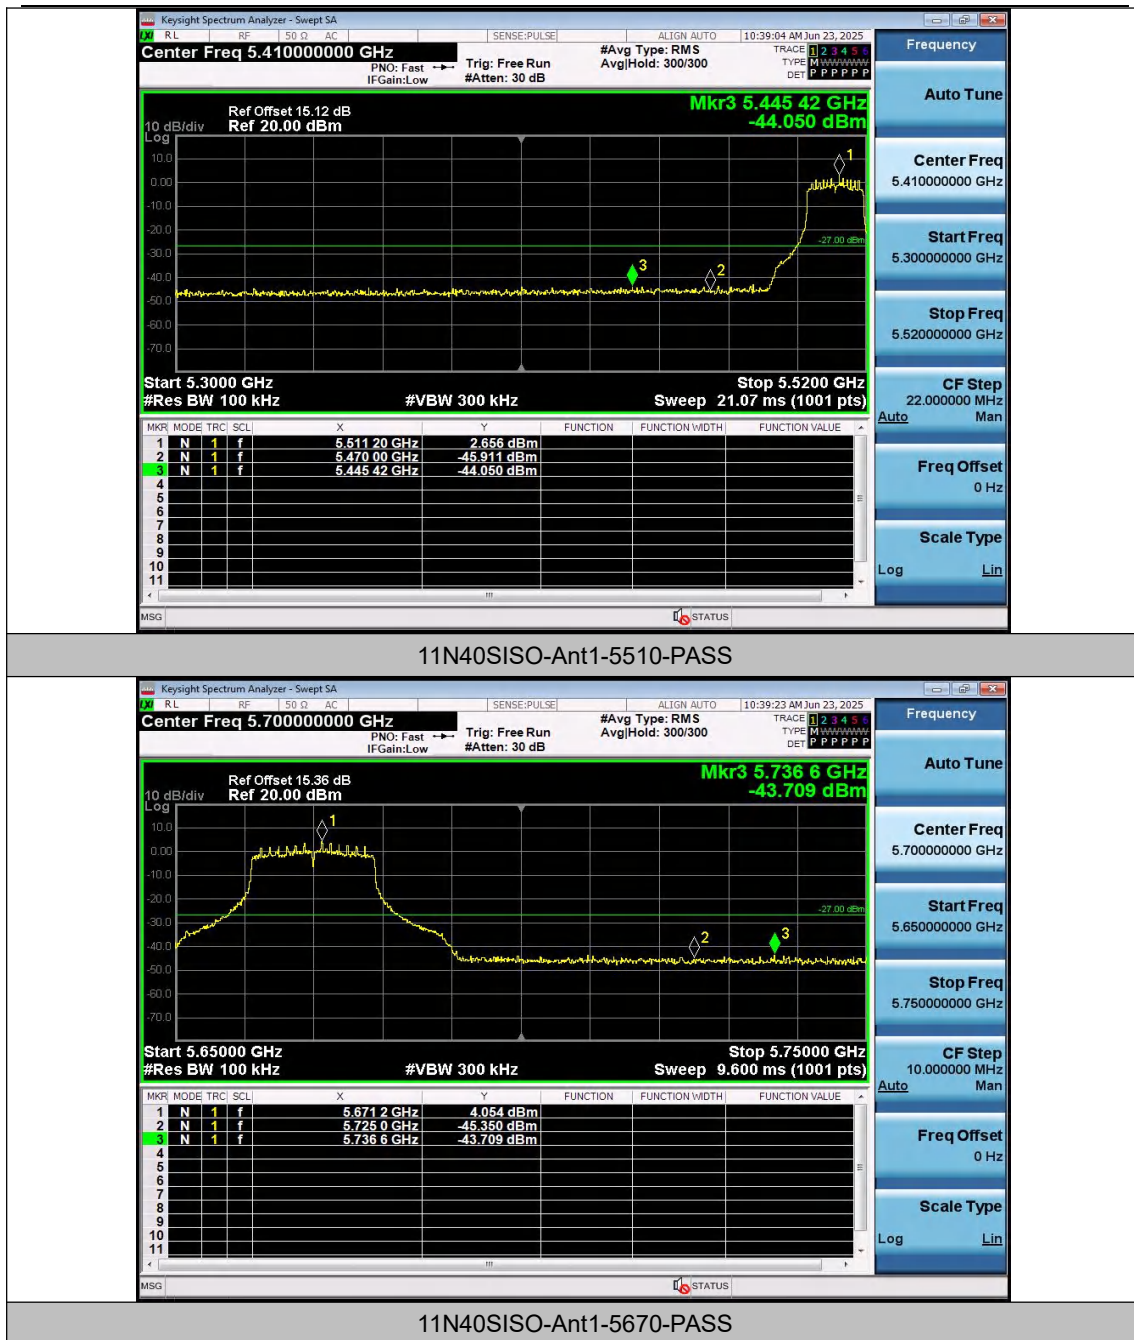




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

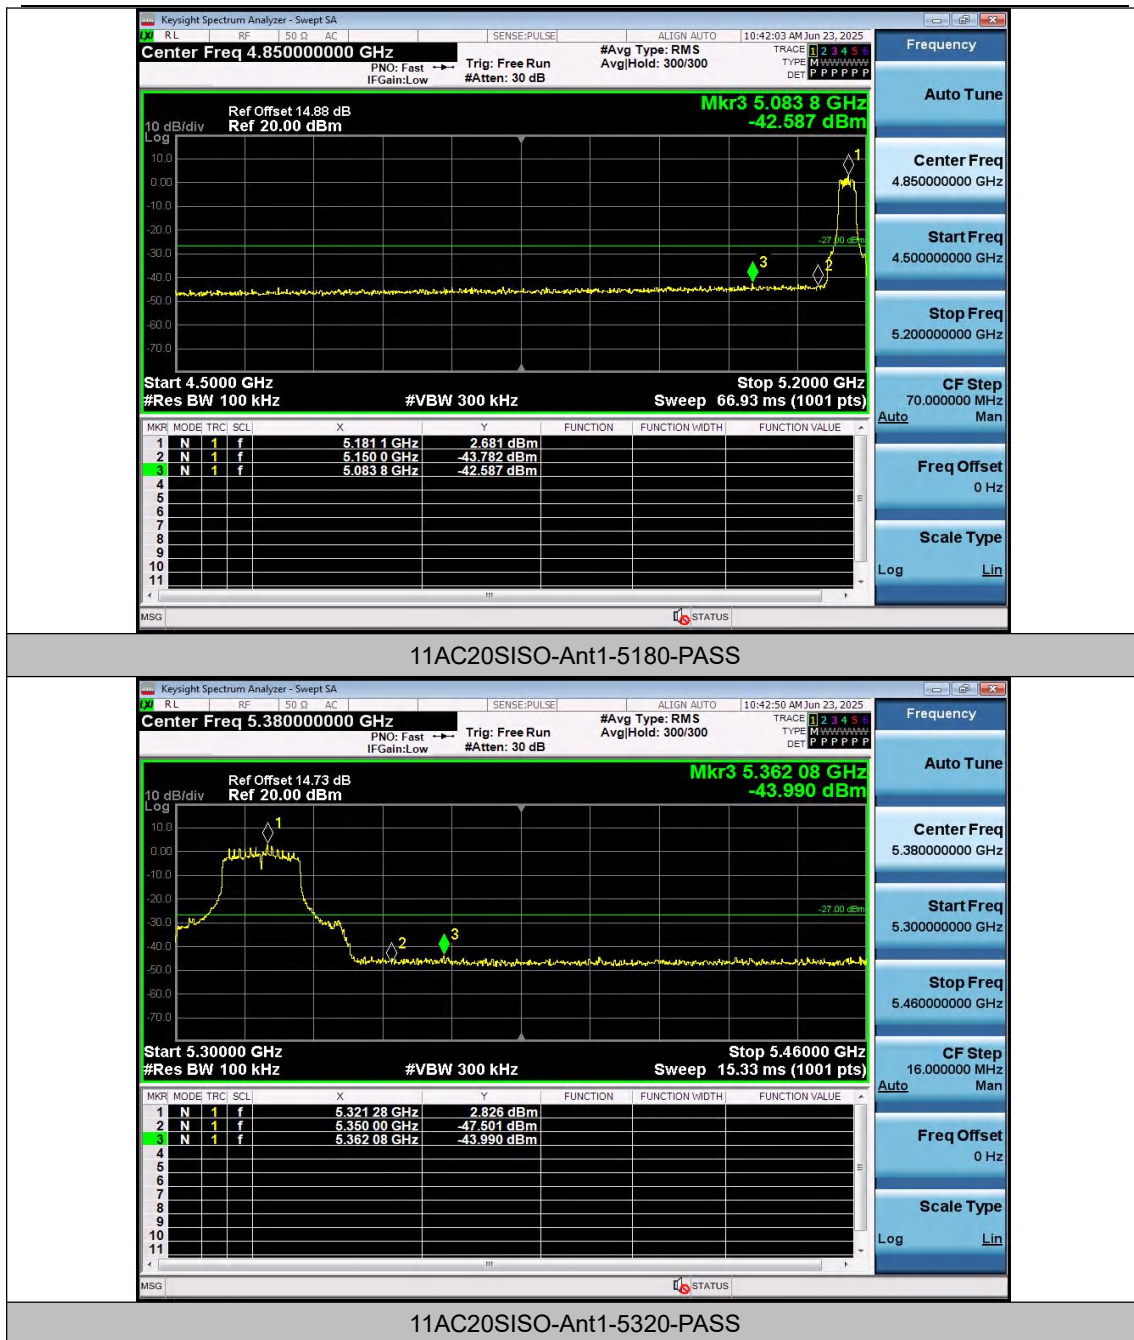




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

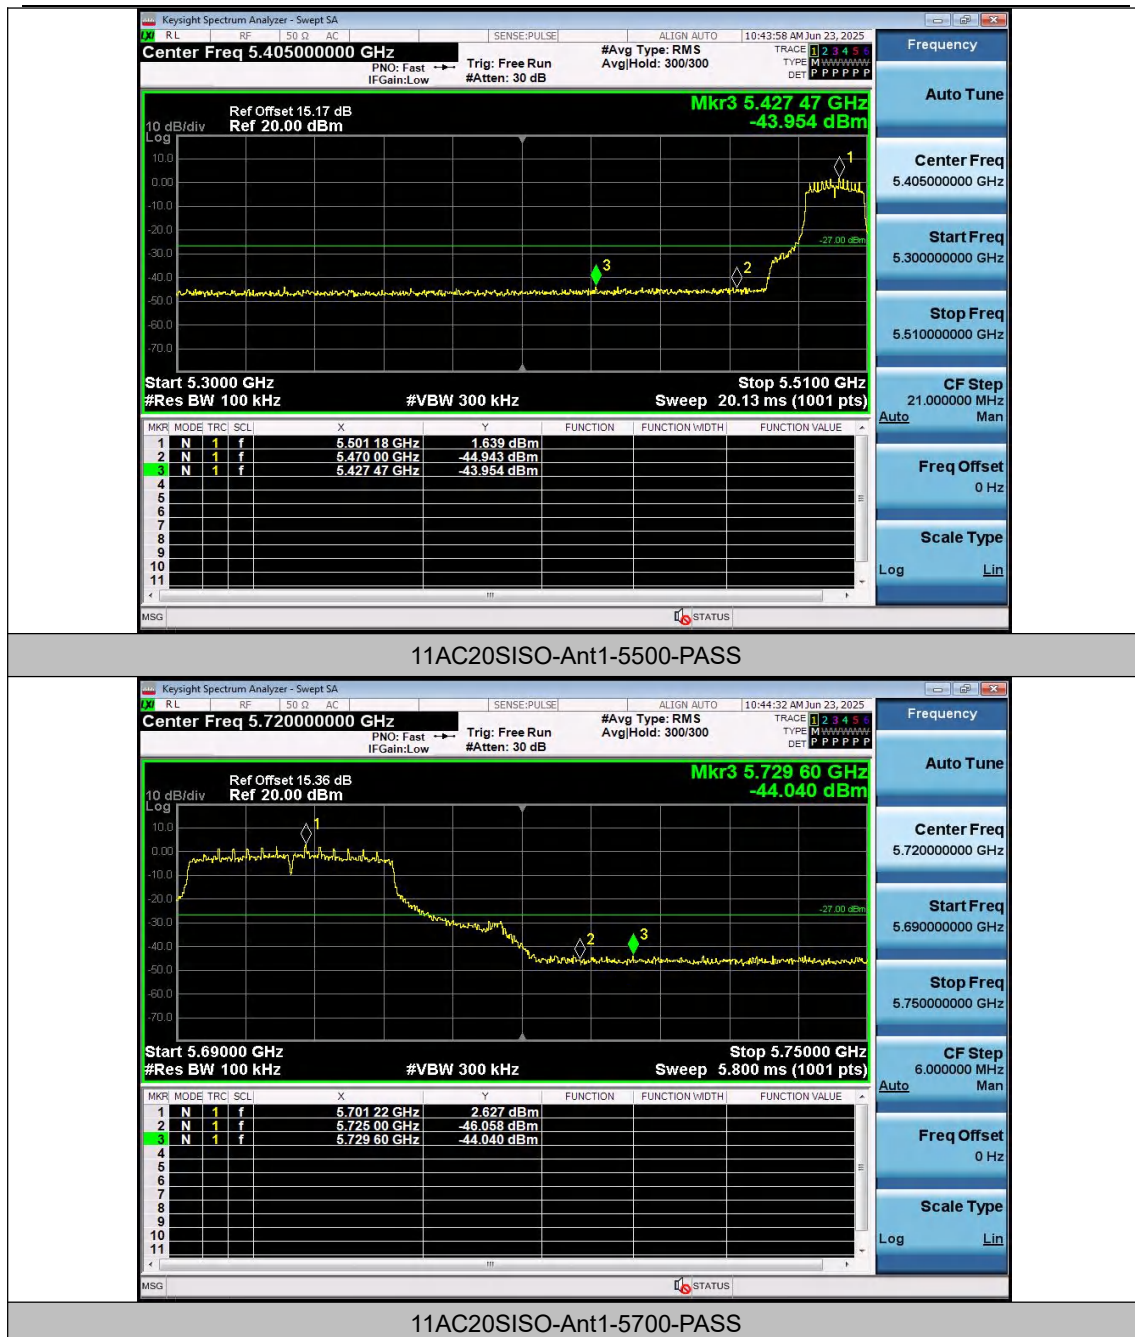




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

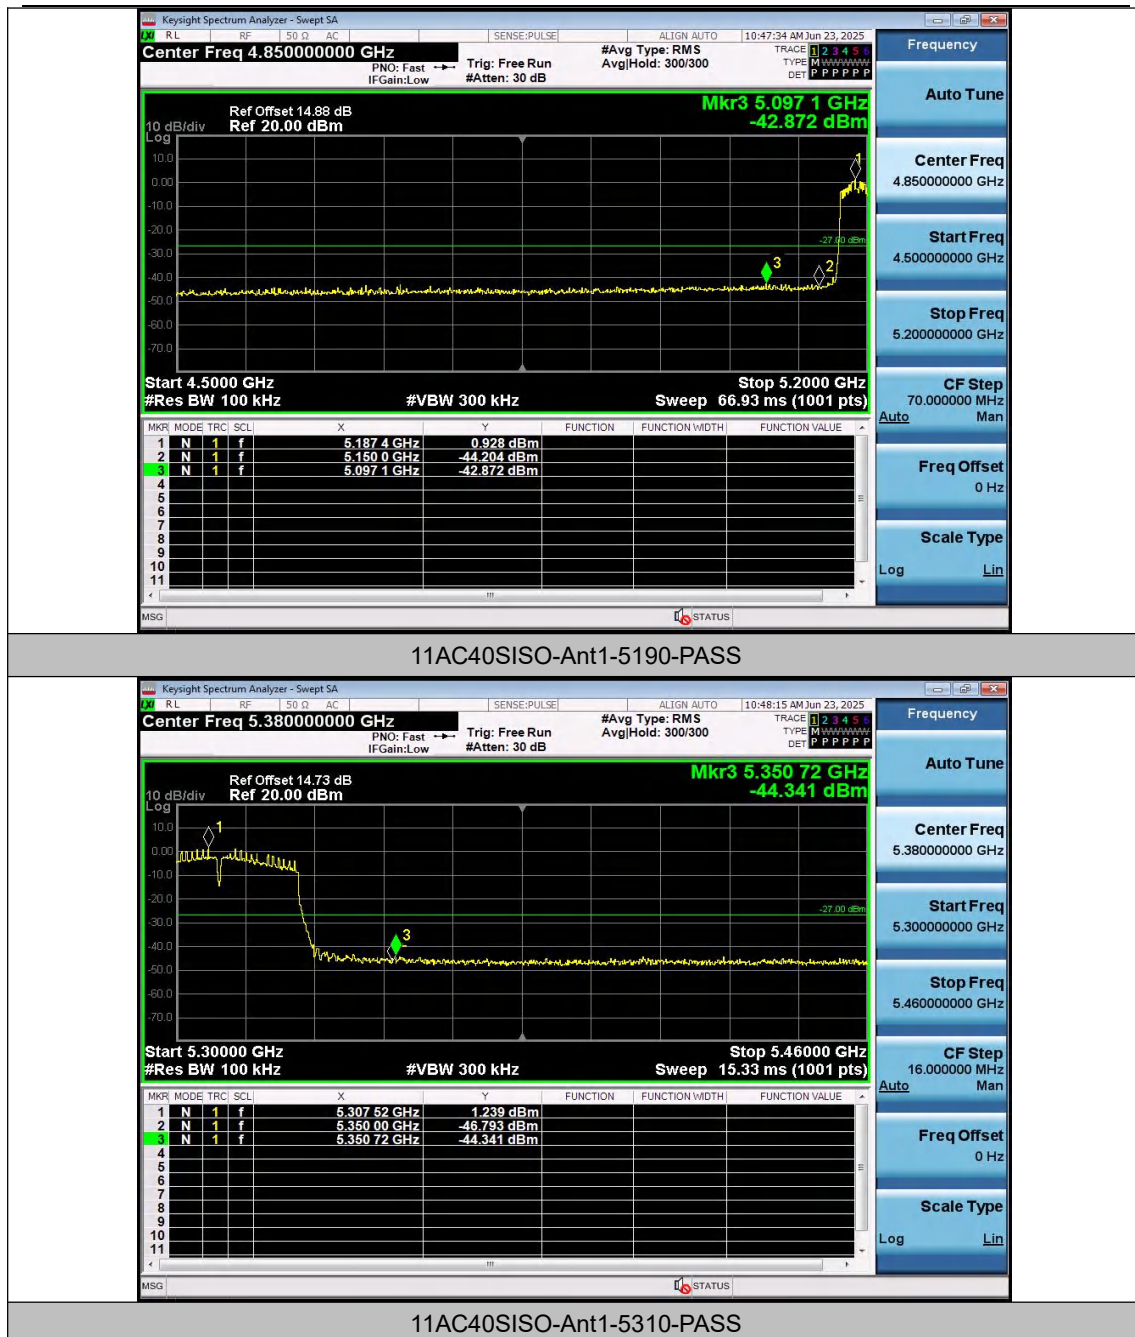




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

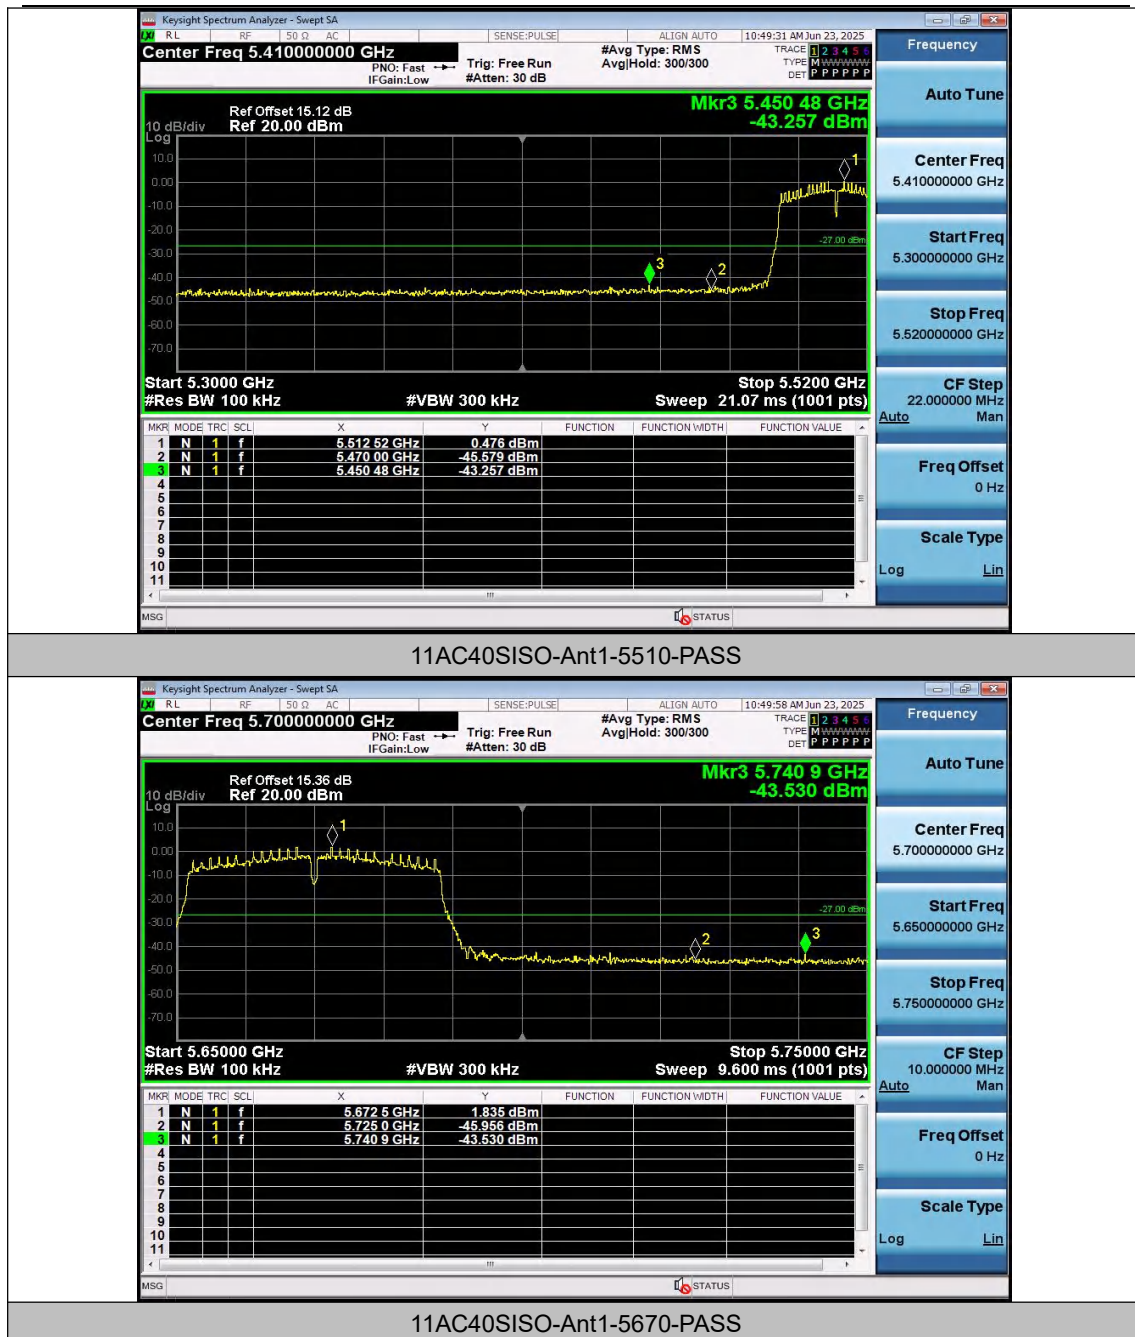




Shenzhen GUOREN Certification Technology Service Co., Ltd.


101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

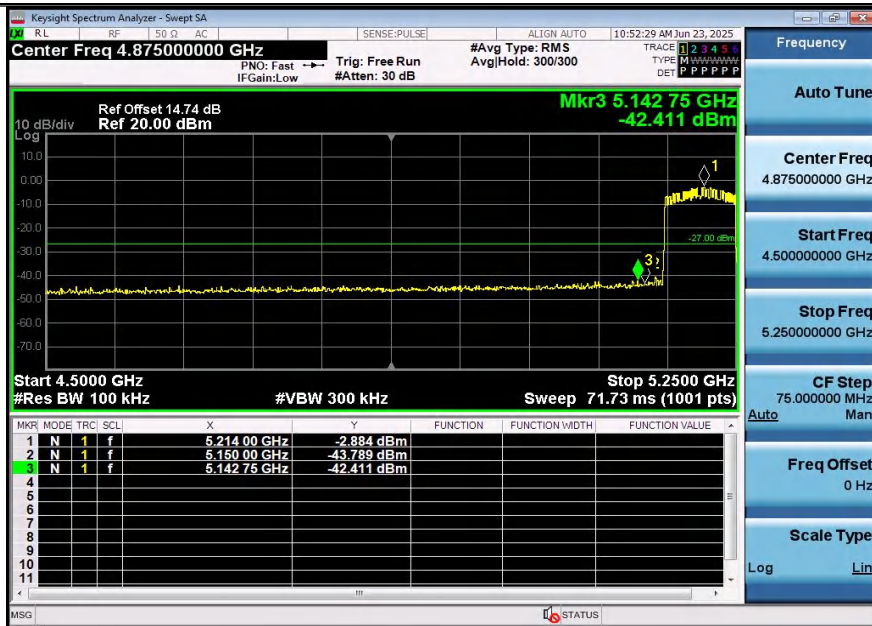

11AC80SISO-Ant1-5210-PASS

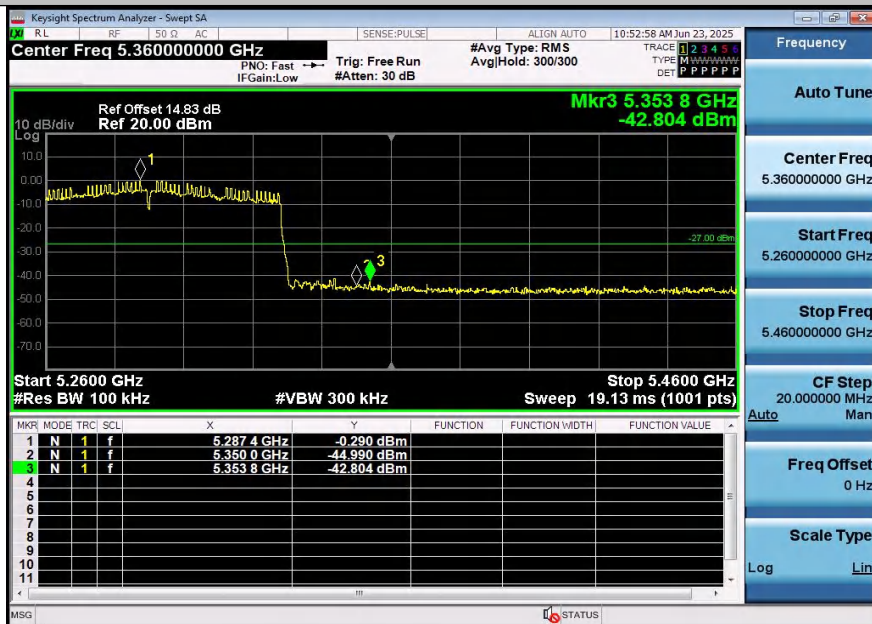

11AC80SISO-Ant1-5290-PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

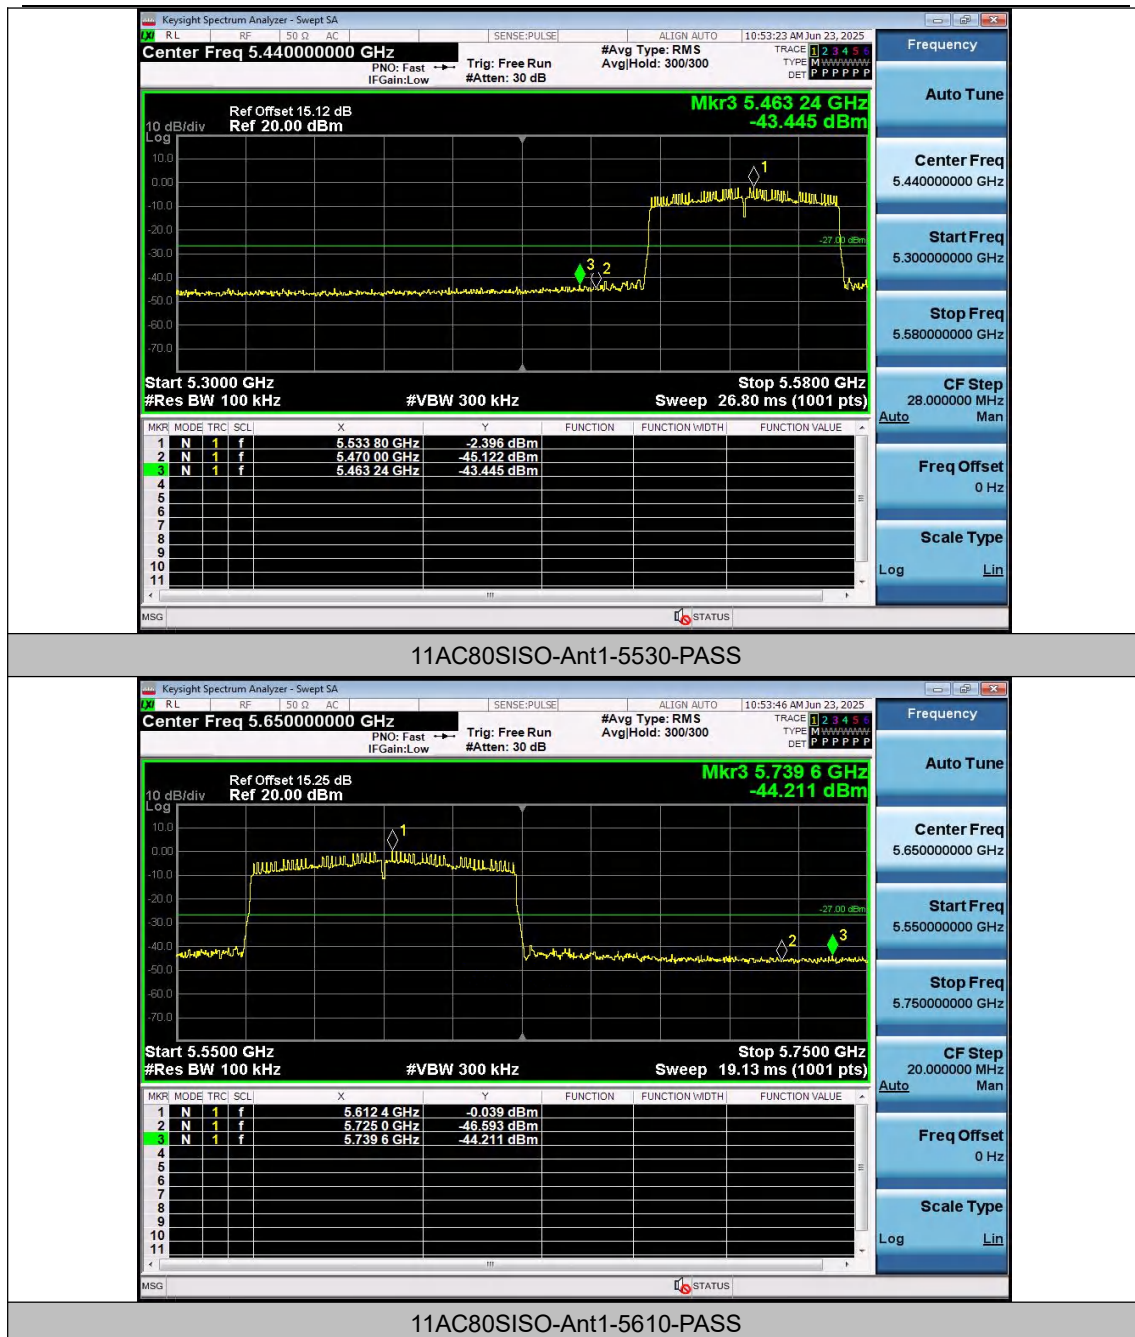




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

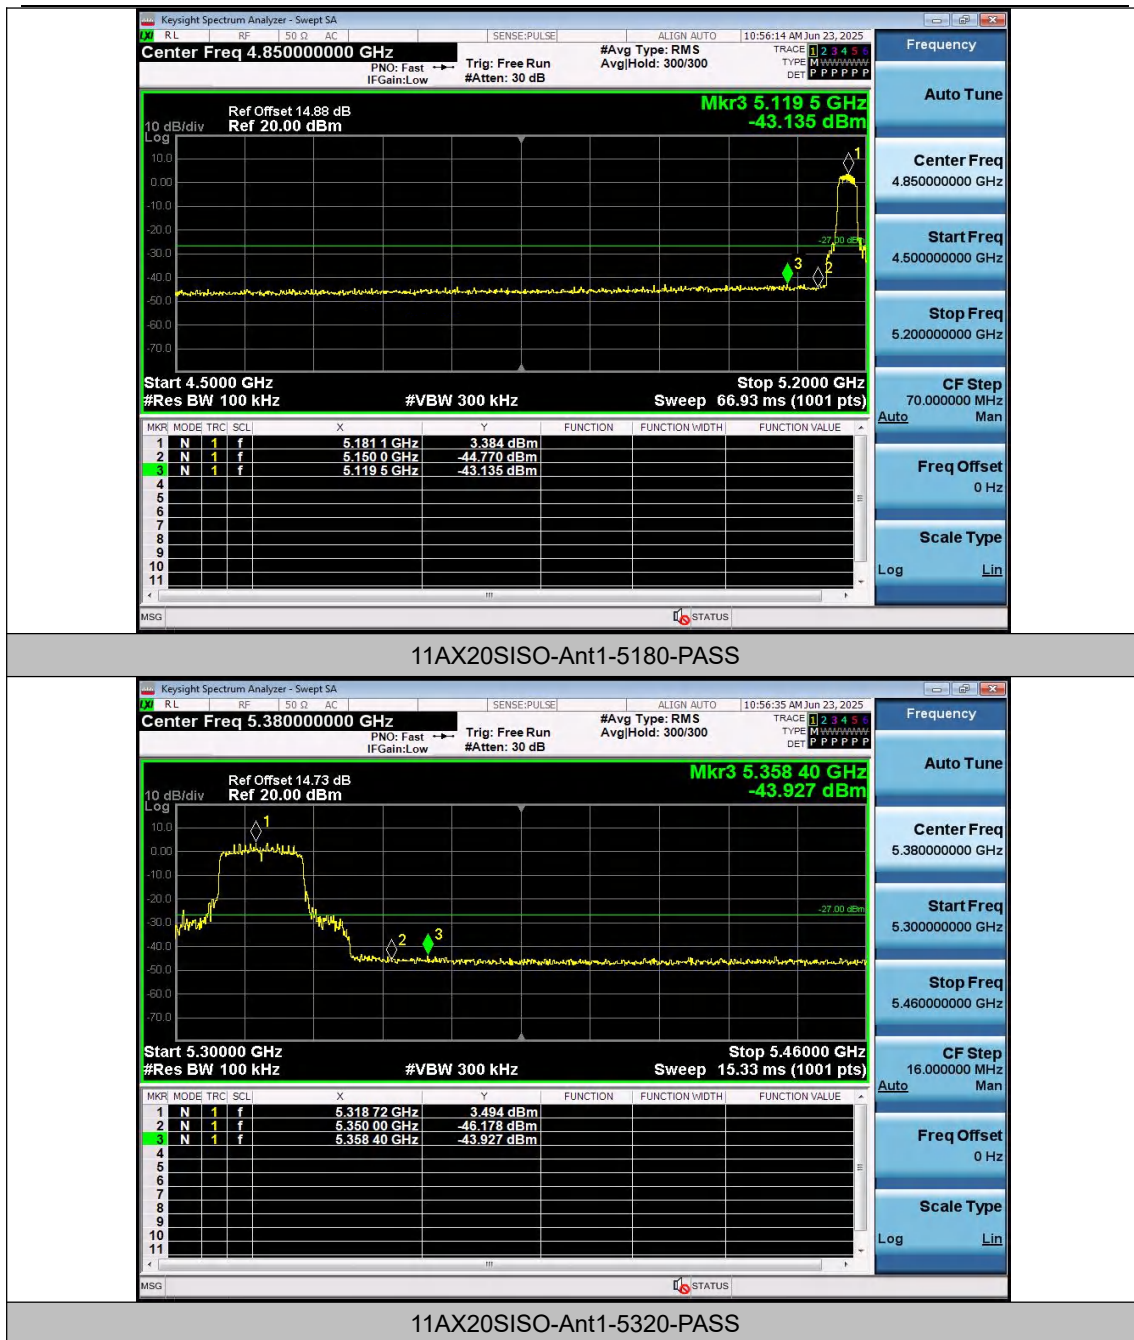




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

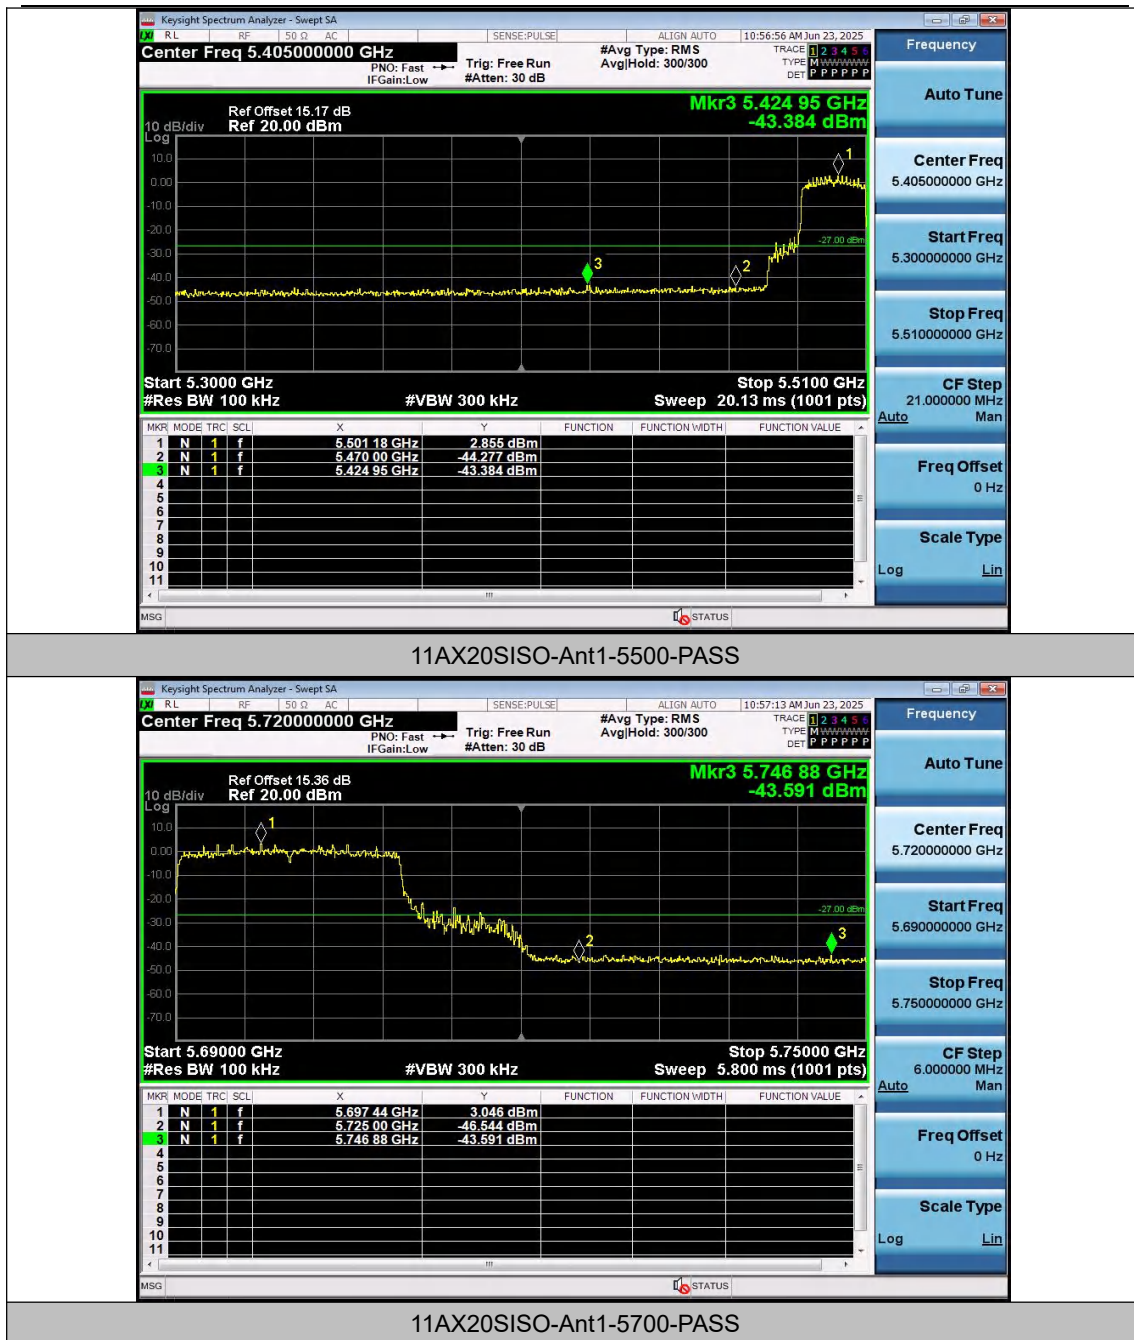



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

FCC ID:SMC-T91A

GRCTR250302048-04

