





OBW NVNT ac20 5180MHz Ant3

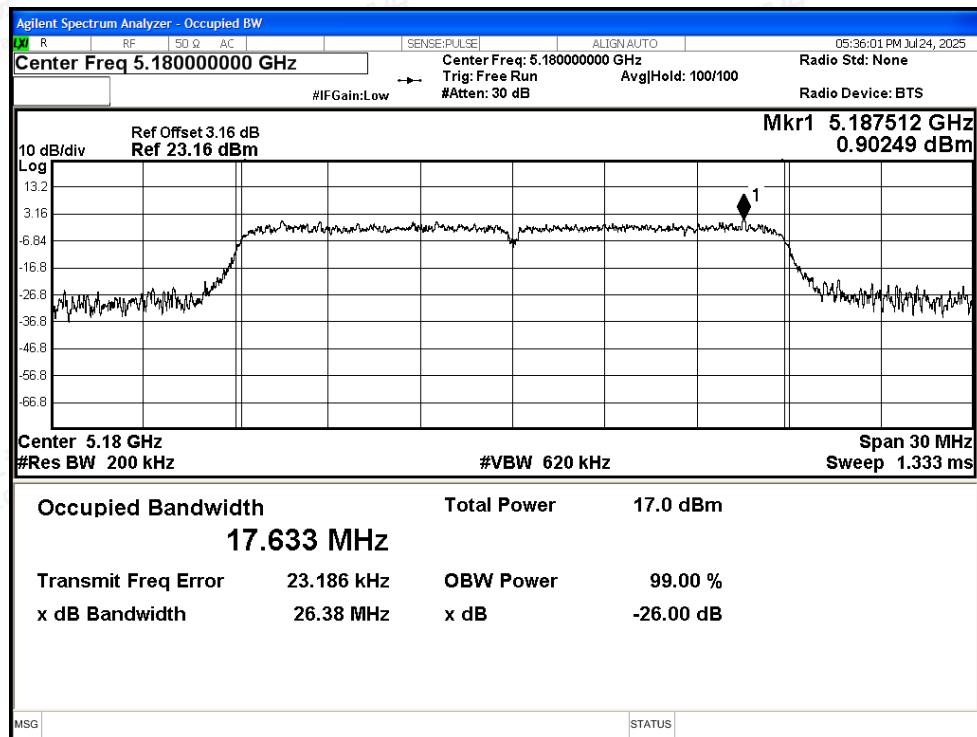

OBW NVNT ac20 5200MHz Ant3

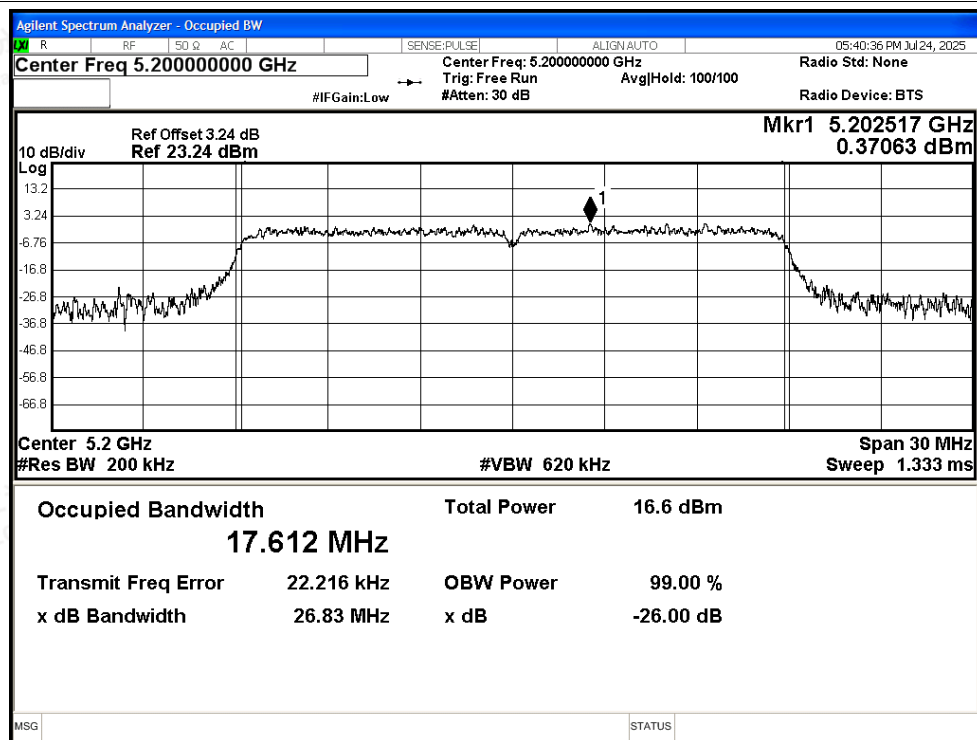

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ac20 5240MHz Ant3

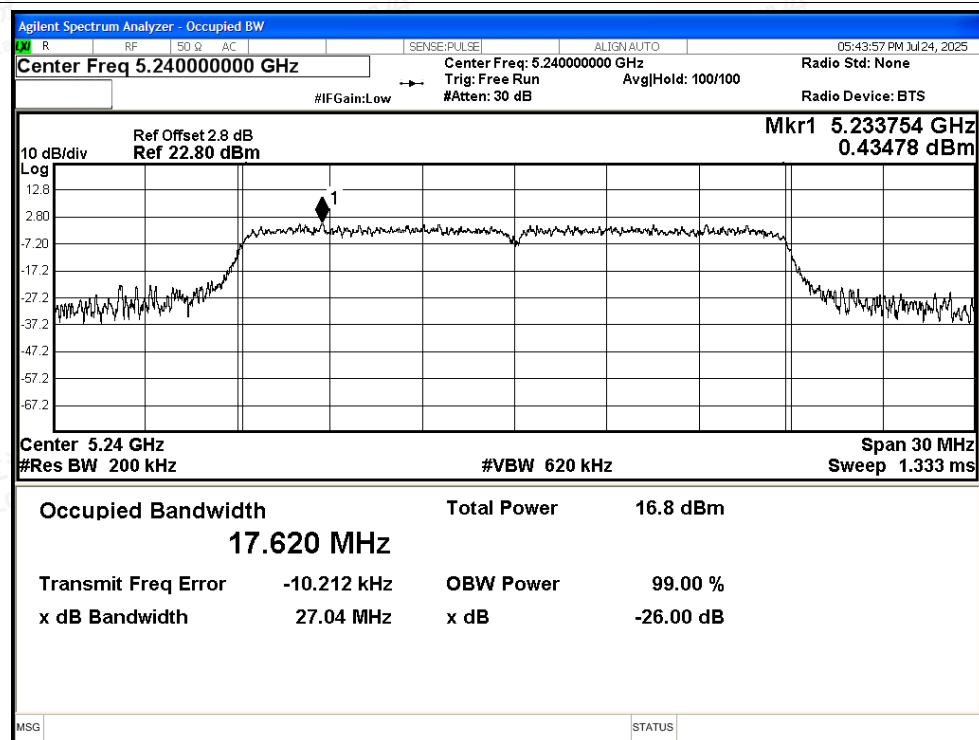

OBW NVNT ac40 5190MHz Ant3

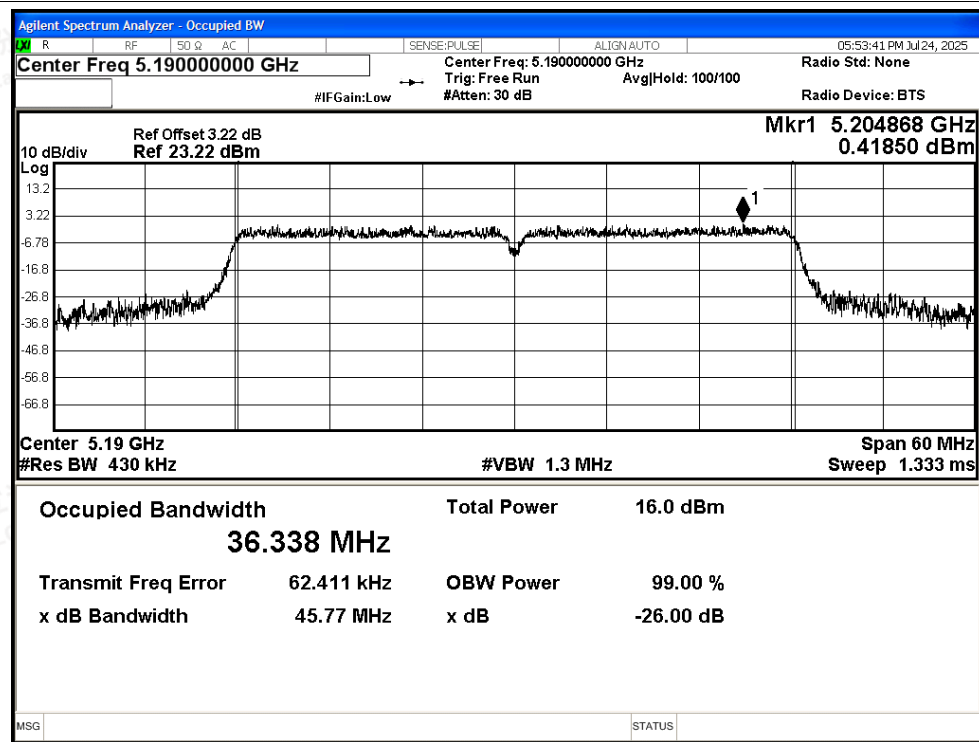

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ac40 5230MHz Ant3

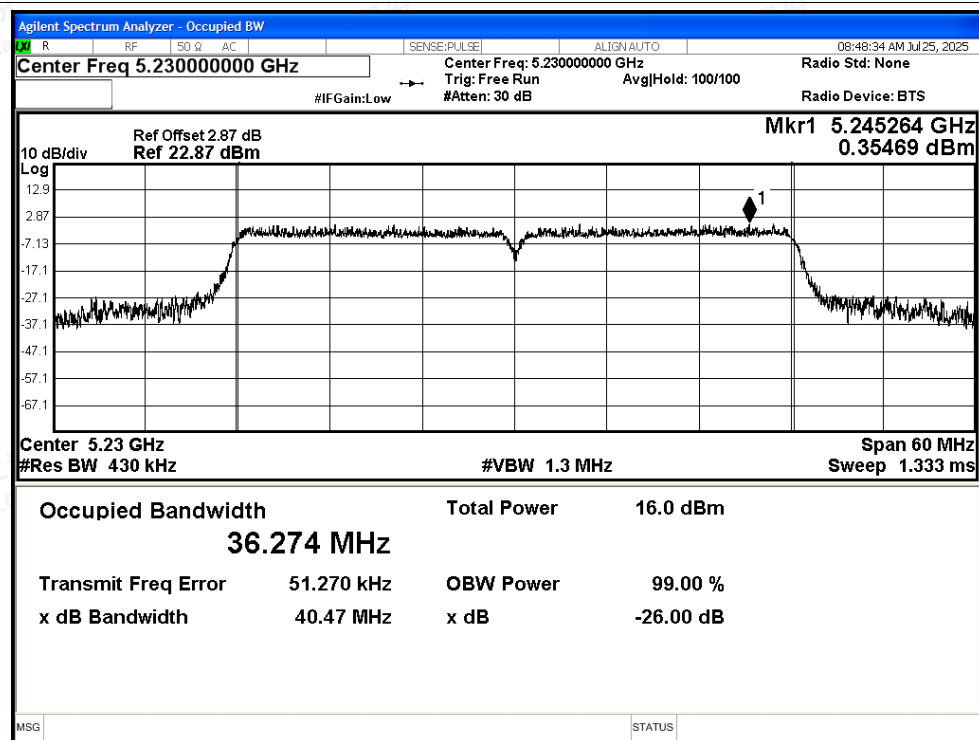

OBW NVNT ac80 5210MHz Ant3

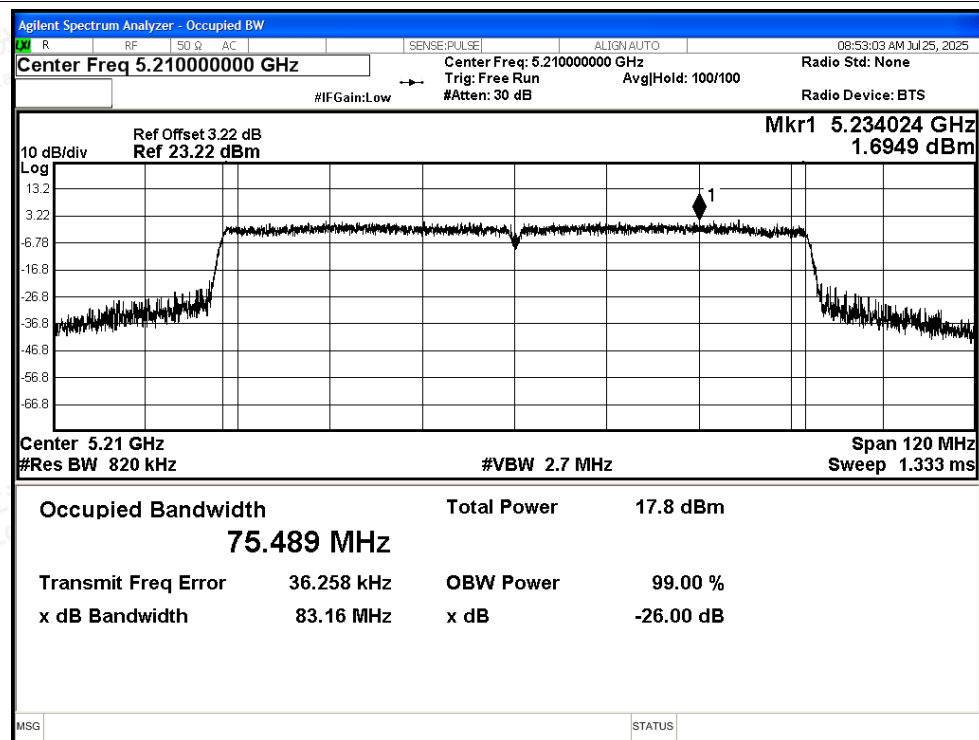

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ax20 5180MHz Ant3

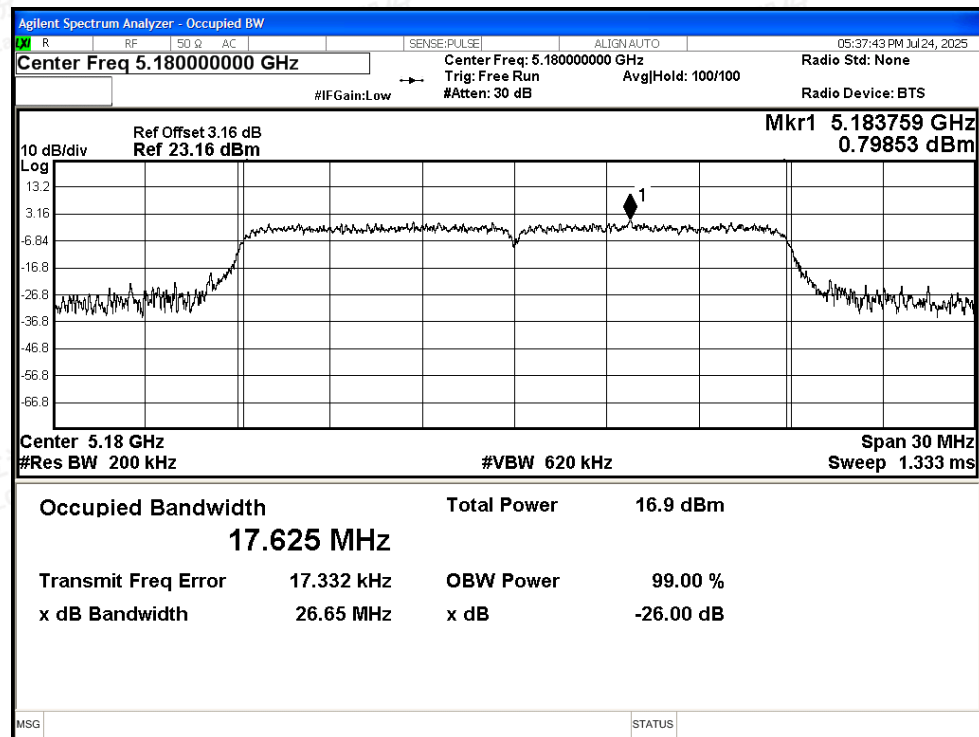

OBW NVNT ax20 5200MHz Ant3

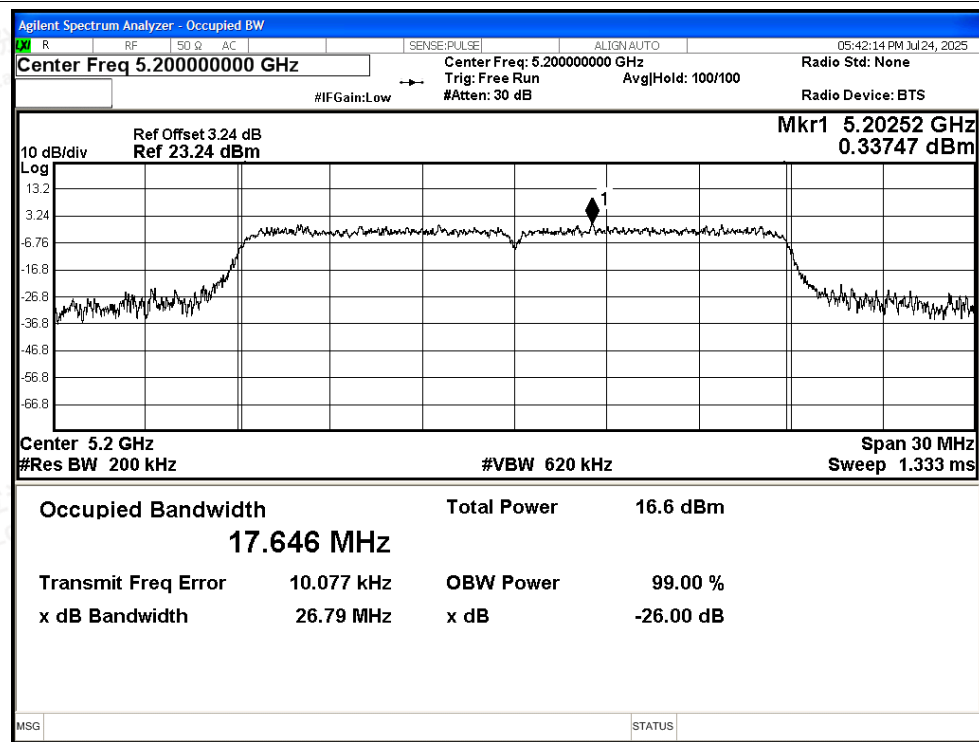

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ax20 5240MHz Ant3

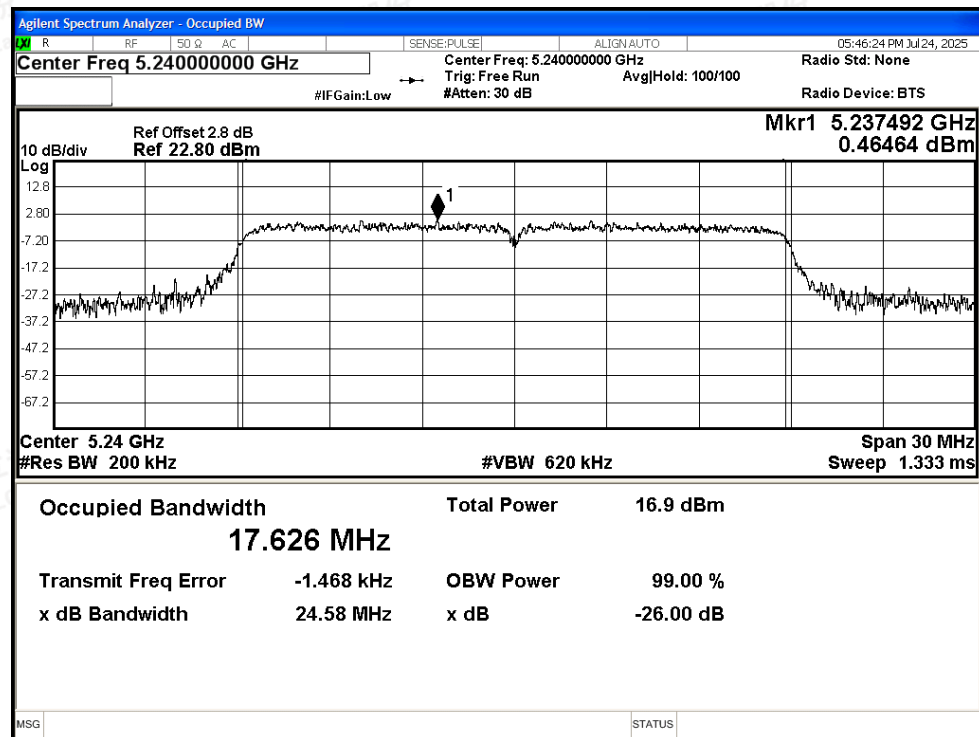

OBW NVNT ax40 5190MHz Ant3

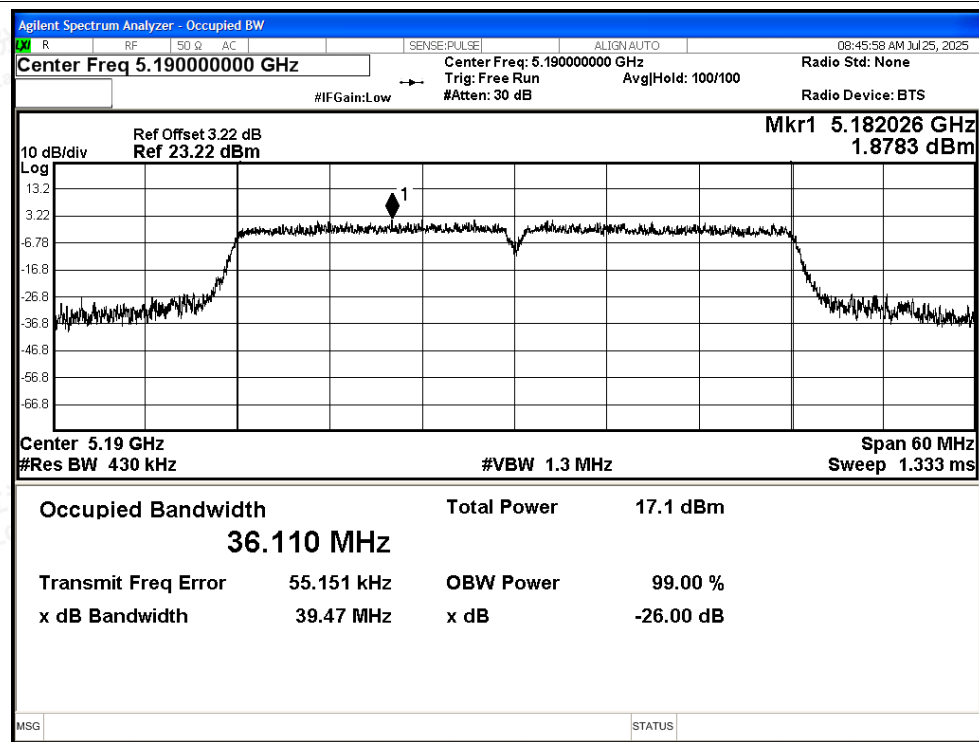

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ax40 5230MHz Ant3

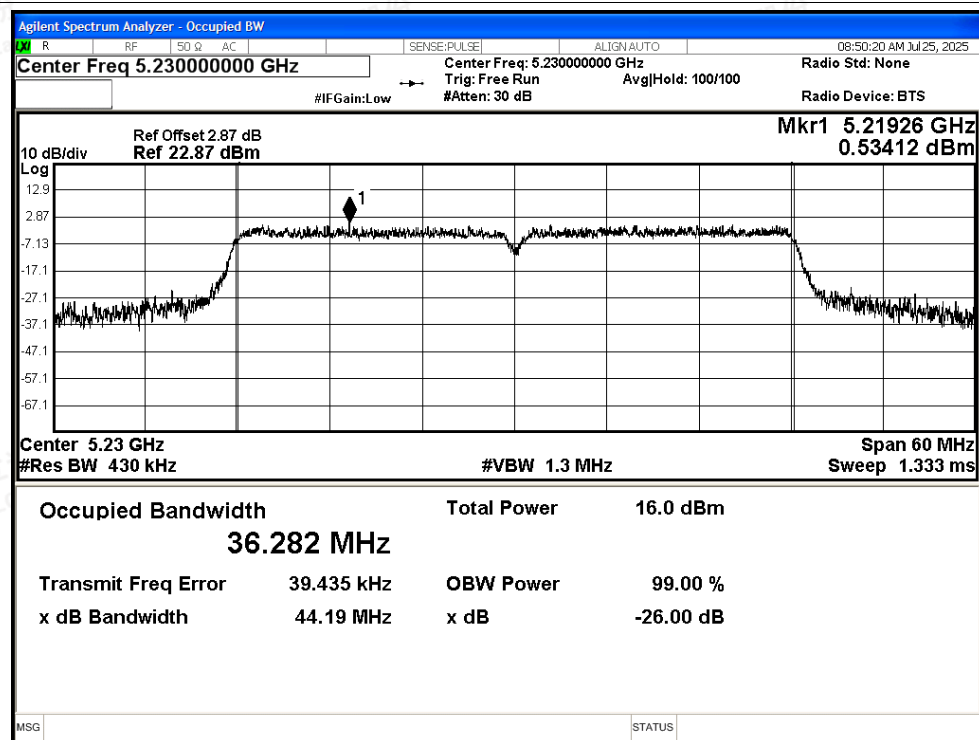

OBW NVNT ax80 5210MHz Ant3

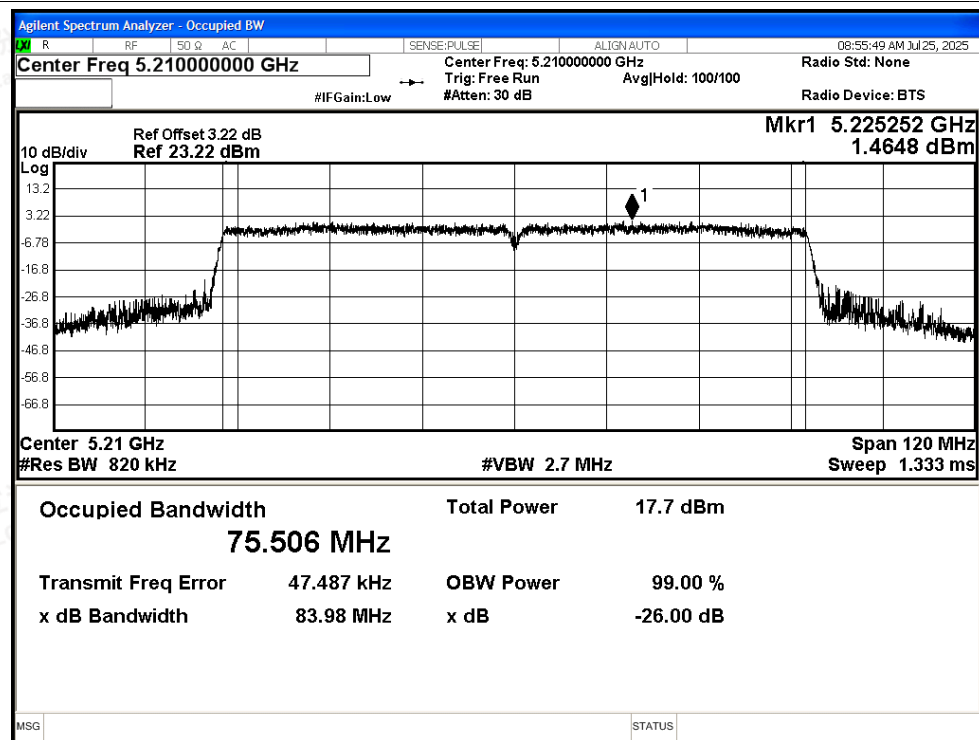

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT be20 5180MHz Ant3

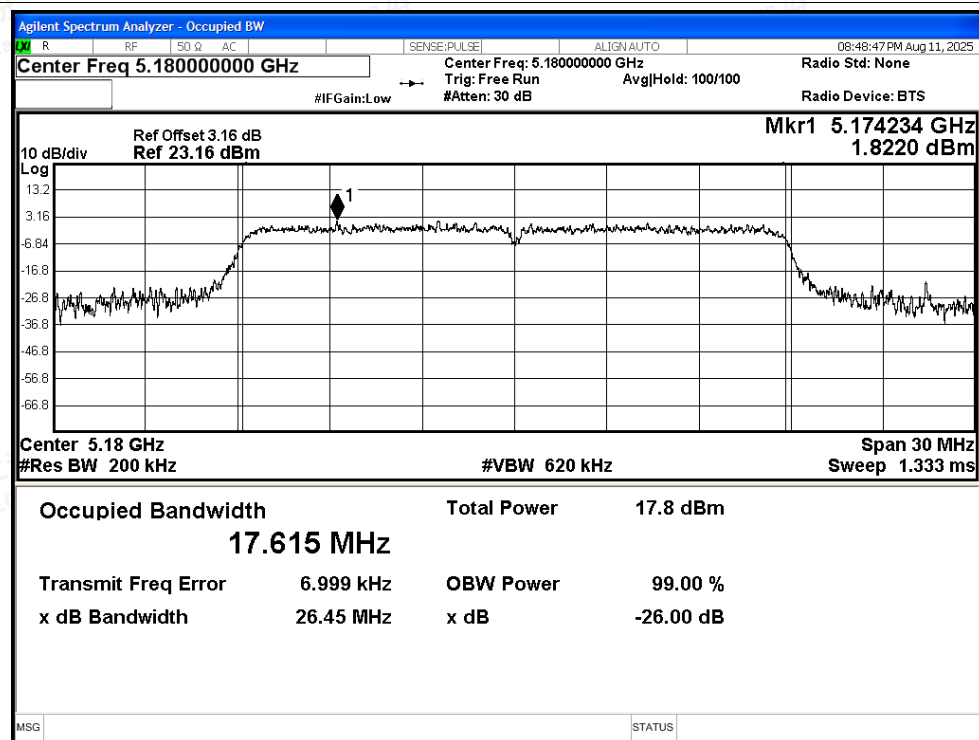

OBW NVNT be20 5200MHz Ant3

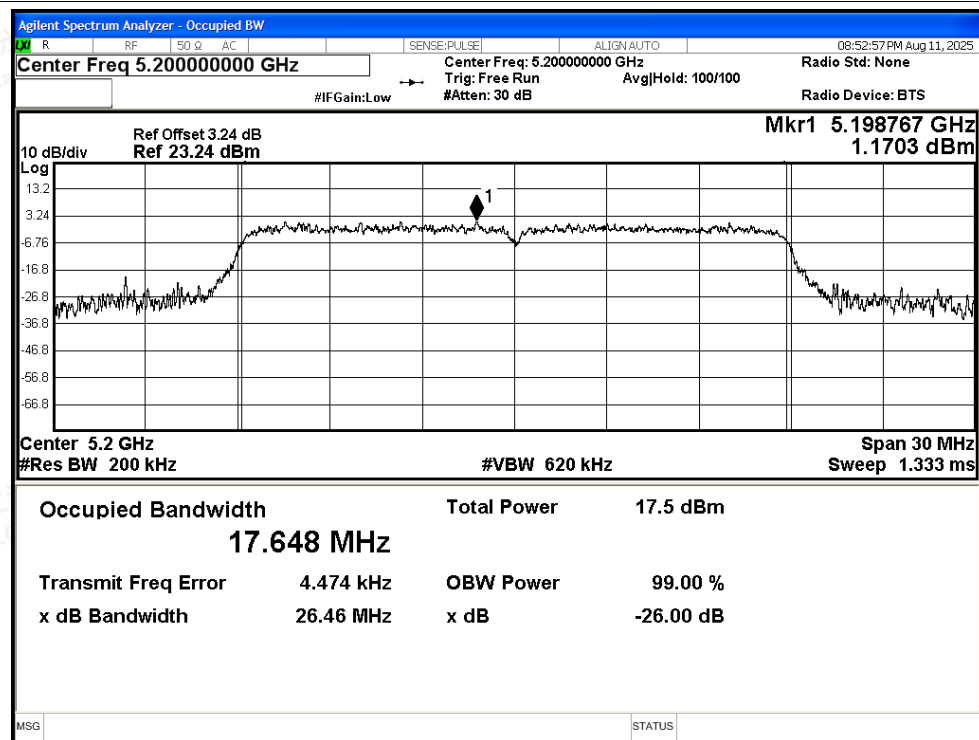

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT be20 5240MHz Ant3

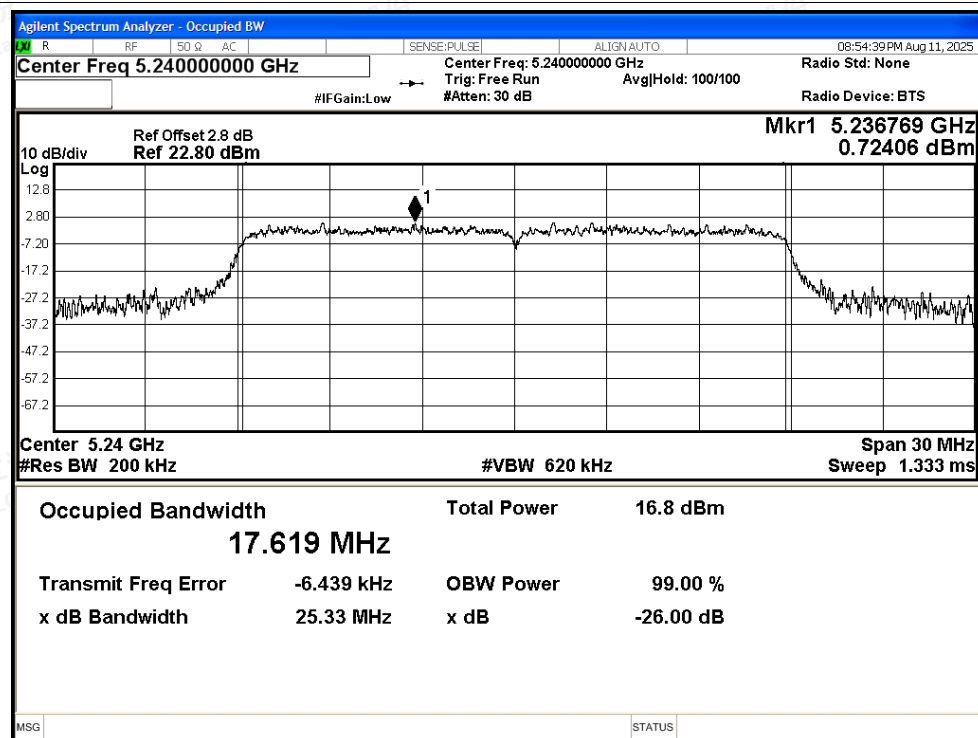

OBW NVNT be40 5190MHz Ant3

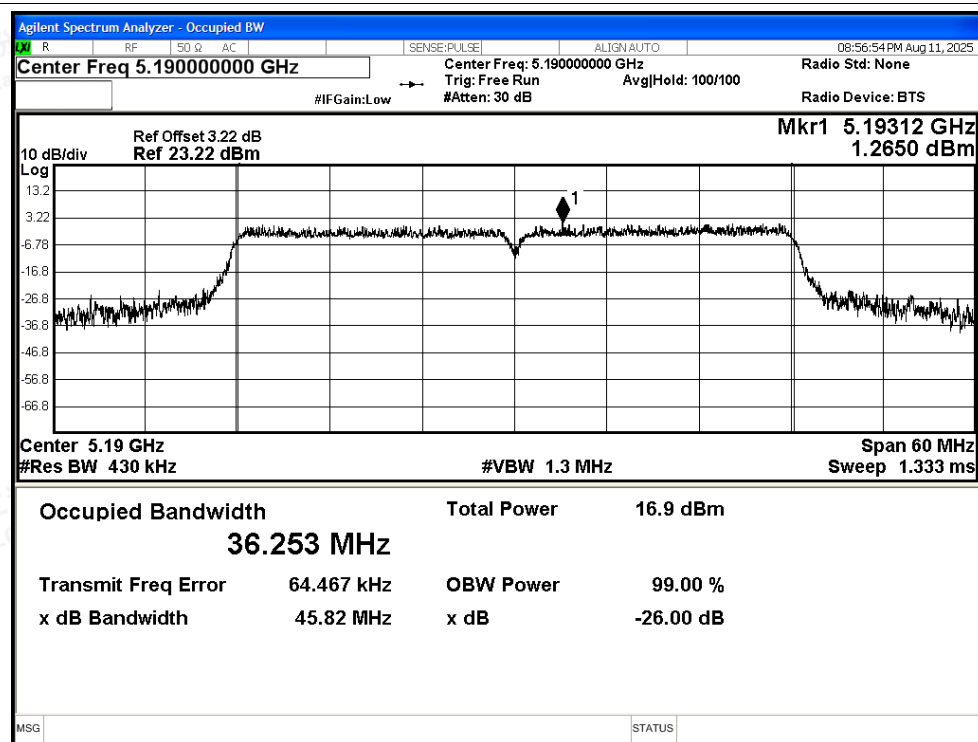

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT be40 5230MHz Ant3

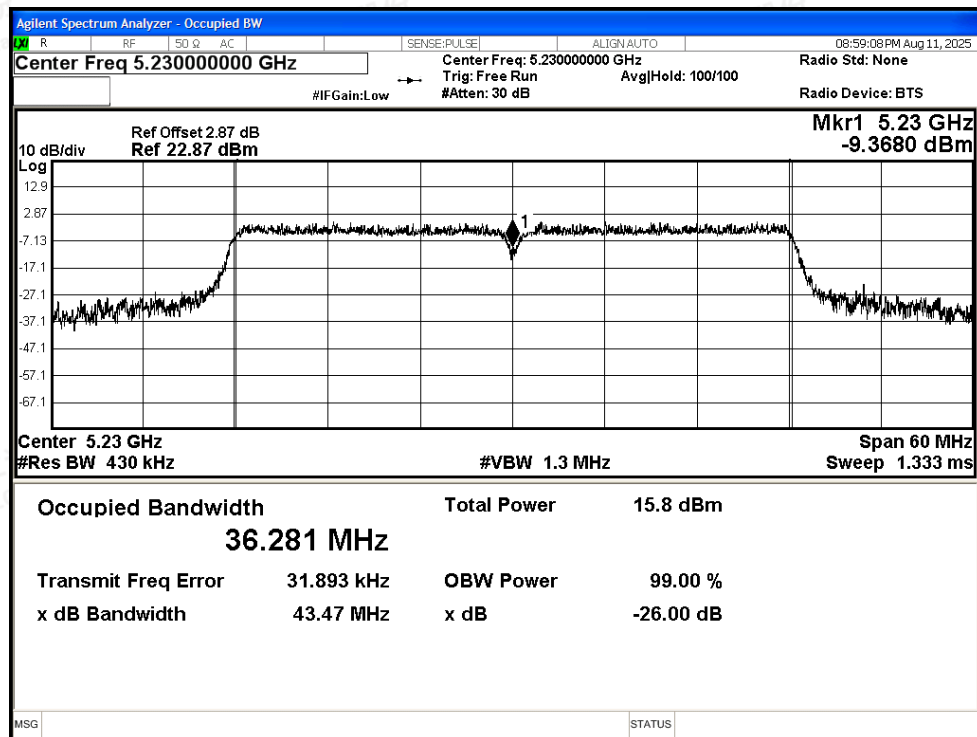

OBW NVNT be80 5210MHz Ant3

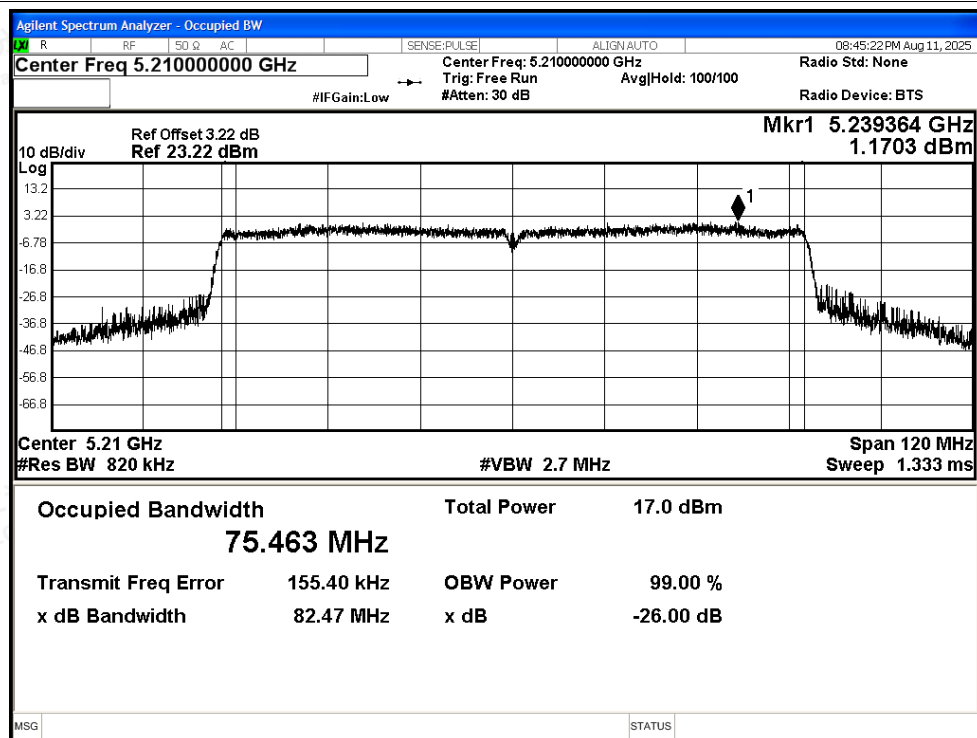

OBW NVNT ac160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

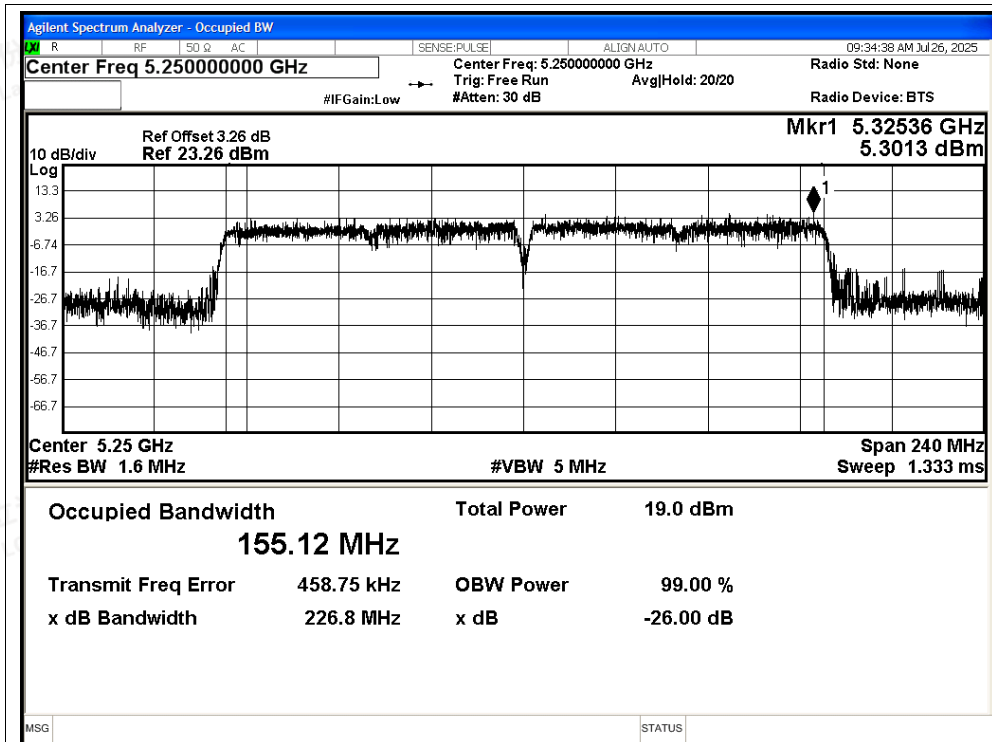

OBW NVNT ax160 5250MHz Ant3

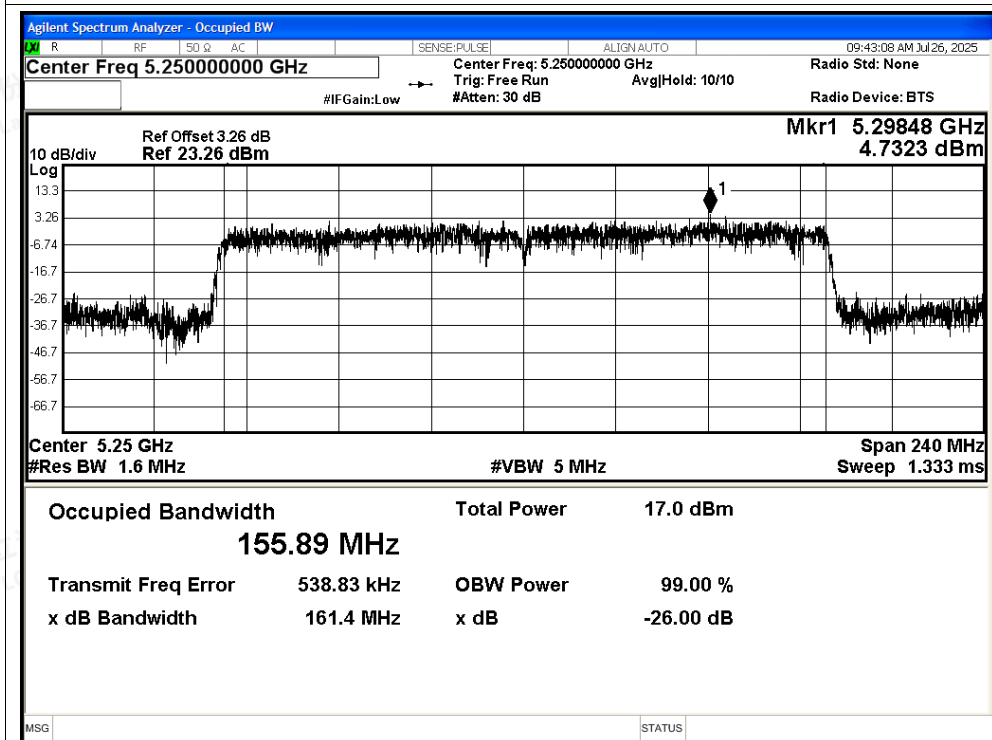

OBW NVNT be160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

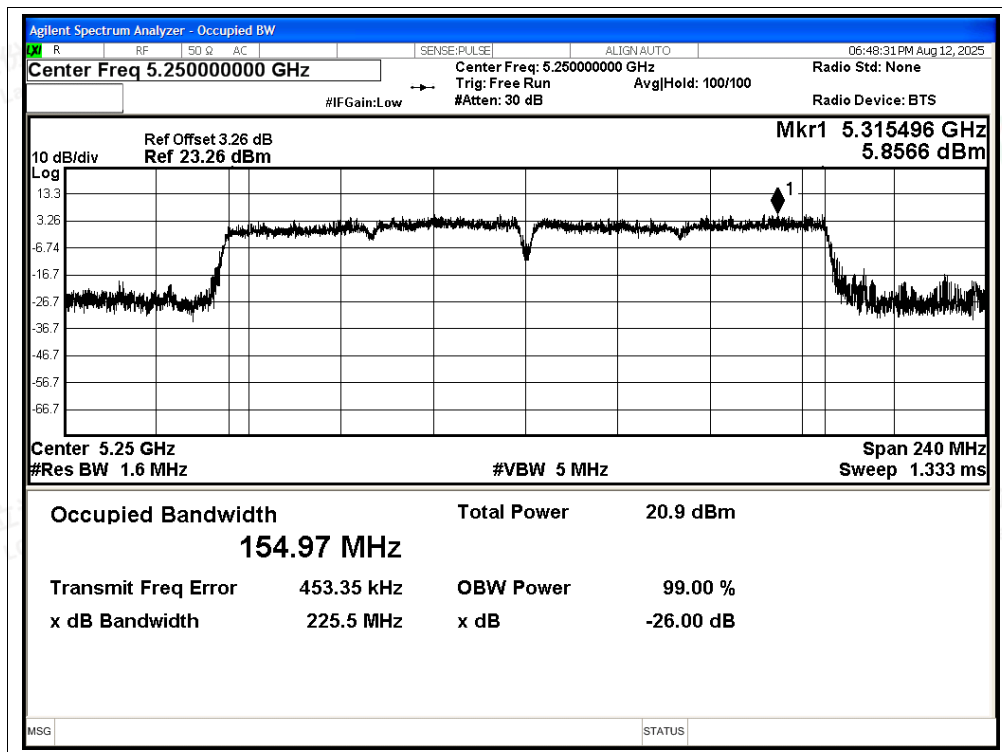



B.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	11.9	0.24	12.14	24	Pass
NVNT	a	5200	Ant1	11.6	0.24	11.84	24	Pass
NVNT	a	5240	Ant1	11.43	0.24	11.67	24	Pass
NVNT	n20	5180	Ant1	11.29	0.12	11.41	24	Pass
NVNT	n20	5200	Ant1	10.98	0.12	11.1	24	Pass
NVNT	n20	5240	Ant1	11.1	0.12	11.22	24	Pass
NVNT	n40	5190	Ant1	11.01	0.23	11.24	24	Pass
NVNT	n40	5230	Ant1	10.94	0.24	11.18	24	Pass
NVNT	ac20	5180	Ant1	11.28	0.12	11.4	24	Pass
NVNT	ac20	5200	Ant1	11.06	0.12	11.18	24	Pass
NVNT	ac20	5240	Ant1	11.11	0.12	11.23	24	Pass
NVNT	ac40	5190	Ant1	10.96	0.24	11.2	24	Pass
NVNT	ac40	5230	Ant1	10.3	0.24	10.54	24	Pass
NVNT	ac80	5210	Ant1	10.29	0.47	10.76	24	Pass
NVNT	ac160	5250	Ant1	10.87	3.98	14.85	24	Pass
NVNT	ax20	5180	Ant1	11.23	0.12	11.35	24	Pass
NVNT	ax20	5200	Ant1	10.99	0.12	11.11	24	Pass
NVNT	ax20	5240	Ant1	11.11	0.12	11.23	24	Pass
NVNT	ax40	5190	Ant1	10.88	0.23	11.11	24	Pass
NVNT	ax40	5230	Ant1	9.98	0.24	10.22	24	Pass
NVNT	ax80	5210	Ant1	10.29	0.47	10.76	24	Pass
NVNT	ax160	5250	Ant1	10.87	3.98	14.85	24	Pass
NVNT	be20	5180	Ant1	11.2	0.12	11.32	24	Pass
NVNT	be20	5200	Ant1	11.73	0.12	11.85	24	Pass
NVNT	be20	5240	Ant1	11.1	0.12	11.22	24	Pass
NVNT	be40	5190	Ant1	10.68	0.24	10.92	24	Pass
NVNT	be40	5230	Ant1	10.06	0.24	10.3	24	Pass
NVNT	be80	5210	Ant1	10.19	0.47	10.66	24	Pass
NVNT	be160	5250	Ant1	11.55	3.77	15.32	24	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant2	11.89	0.24	12.13	24	Pass
NVNT	a	5200	Ant2	11.51	0.24	11.75	24	Pass
NVNT	a	5240	Ant2	11.87	0.24	12.11	24	Pass
NVNT	n20	5180	Ant2	11.36	0.12	11.48	24	Pass
NVNT	n20	5200	Ant2	11.11	0.12	11.23	24	Pass
NVNT	n20	5240	Ant2	11.27	0.12	11.39	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5190	Ant2	10.11	0.24	10.35	24	Pass
NVNT	n40	5230	Ant2	10.38	0.24	10.62	24	Pass
NVNT	ac20	5180	Ant2	11.42	0.12	11.54	24	Pass
NVNT	ac20	5200	Ant2	11.05	0.12	11.17	24	Pass
NVNT	ac20	5240	Ant2	11.28	0.12	11.4	24	Pass
NVNT	ac40	5190	Ant2	10.08	0.24	10.32	24	Pass
NVNT	ac40	5230	Ant2	10.37	0.24	10.61	24	Pass
NVNT	ac80	5210	Ant2	10.39	0.47	10.86	24	Pass
NVNT	ac160	5250	Ant2	10.05	3.99	14.04	24	Pass
NVNT	ax20	5180	Ant2	11.39	0.12	11.51	24	Pass
NVNT	ax20	5200	Ant2	11.07	0.12	11.19	24	Pass
NVNT	ax20	5240	Ant2	11.36	0.12	11.48	24	Pass
NVNT	ax40	5190	Ant2	10.06	0.24	10.3	24	Pass
NVNT	ax40	5230	Ant2	10.25	0.24	10.49	24	Pass
NVNT	ax80	5210	Ant2	10.39	0.47	10.86	24	Pass
NVNT	ax160	5250	Ant2	10.08	3.98	14.06	24	Pass
NVNT	be20	5180	Ant2	11.69	0.12	11.81	24	Pass
NVNT	be20	5200	Ant2	11.28	0.12	11.4	24	Pass
NVNT	be20	5240	Ant2	11.4	0.12	11.52	24	Pass
NVNT	be40	5190	Ant2	10.22	0.24	10.46	24	Pass
NVNT	be40	5230	Ant2	10.08	0.24	10.32	24	Pass
NVNT	be80	5210	Ant2	10.15	0.47	10.62	24	Pass
NVNT	be160	5250	Ant2	10.38	3.77	14.15	24	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant3	11.92	0.24	12.16	24	Pass
NVNT	a	5200	Ant3	11.68	0.24	11.92	24	Pass
NVNT	a	5240	Ant3	10.91	0.24	11.15	24	Pass
NVNT	n20	5180	Ant3	11.34	0.28	11.62	24	Pass
NVNT	n20	5200	Ant3	11.04	0.28	11.32	24	Pass
NVNT	n20	5240	Ant3	11.22	0.28	11.5	24	Pass
NVNT	n40	5190	Ant3	10.08	0.24	10.32	24	Pass
NVNT	n40	5230	Ant3	10.4	0.24	10.64	24	Pass
NVNT	ac20	5180	Ant3	11.44	0.12	11.56	24	Pass
NVNT	ac20	5200	Ant3	11.15	0.12	11.27	24	Pass
NVNT	ac20	5240	Ant3	11.26	0.12	11.38	24	Pass
NVNT	ac40	5190	Ant3	10.14	0.24	10.38	24	Pass
NVNT	ac40	5230	Ant3	10.15	0.24	10.39	24	Pass
NVNT	ac80	5210	Ant3	10.61	0.47	11.08	24	Pass
NVNT	ac160	5250	Ant3	10.86	3.77	14.63	24	Pass
NVNT	ax20	5180	Ant3	11.41	0.12	11.53	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5200	Ant3	11.08	0.12	11.2	24	Pass
NVNT	ax20	5240	Ant3	11.29	0.12	11.41	24	Pass
NVNT	ax40	5190	Ant3	10.72	0.24	10.96	24	Pass
NVNT	ax40	5230	Ant3	10.02	0.24	10.26	24	Pass
NVNT	ax80	5210	Ant3	10.57	0.47	11.04	24	Pass
NVNT	ax160	5250	Ant3	10.07	3.52	13.59	24	Pass
NVNT	be20	5180	Ant3	11.86	0.12	11.98	24	Pass
NVNT	be20	5200	Ant3	12.08	0.12	12.2	24	Pass
NVNT	be20	5240	Ant3	11.36	0.12	11.48	24	Pass
NVNT	be40	5190	Ant3	10.95	0.24	11.19	24	Pass
NVNT	be40	5230	Ant3	9.86	0.24	10.1	24	Pass
NVNT	be80	5210	Ant3	9.86	0.47	10.33	24	Pass
NVNT	be160	5250	Ant3	11.07	3.77	14.84	24	Pass





MIMO

Condition	Mode	Frequency (MHz)	Total Power (dBm)				Limit (dBm)	Verdict
			Ant1	Ant2	Ant3	Ant1+Ant2+ Ant3		
NVNT	n20	5180	11.41	11.48	11.62	16.28	30	Pass
NVNT	n20	5200	11.1	11.23	11.32	15.99	30	Pass
NVNT	n20	5240	11.22	11.39	11.5	16.14	30	Pass
NVNT	n40	5190	11.24	10.35	10.32	15.43	30	Pass
NVNT	n40	5230	11.18	10.62	10.64	15.59	30	Pass
NVNT	ac20	5180	11.4	11.54	11.56	16.27	30	Pass
NVNT	ac20	5200	11.18	11.17	11.27	15.98	30	Pass
NVNT	ac20	5240	11.23	11.4	11.38	16.11	30	Pass
NVNT	ac40	5190	11.2	10.32	10.38	15.42	30	Pass
NVNT	ac40	5230	10.54	10.61	10.39	15.29	30	Pass
NVNT	ac80	5210	10.76	10.86	11.08	15.67	30	Pass
NVNT	ac160	5250	14.85	14.04	14.63	19.29	30	Pass
NVNT	ax20	5180	11.35	11.51	11.53	16.24	30	Pass
NVNT	ax20	5200	11.11	11.19	11.2	15.94	30	Pass
NVNT	ax20	5240	11.23	11.48	11.41	16.15	30	Pass
NVNT	ax40	5190	11.11	10.3	10.96	15.58	30	Pass
NVNT	ax40	5230	10.22	10.49	10.26	15.10	30	Pass
NVNT	ax80	5210	10.76	10.86	11.04	15.66	30	Pass
NVNT	ax160	5250	14.85	14.06	13.59	18.97	30	Pass
NVNT	be20	5180	11.32	11.81	11.98	16.48	30	Pass
NVNT	be20	5200	11.85	11.4	12.2	16.60	30	Pass
NVNT	be20	5240	11.22	11.52	11.48	16.18	30	Pass
NVNT	be40	5190	19.71	10.46	11.19	20.71	30	Pass
NVNT	be40	5230	19.09	10.32	10.1	20.09	30	Pass
NVNT	be80	5210	10.19	10.62	10.33	15.15	30	Pass
NVNT	be160	5250	15.32	14.15	14.84	19.57	30	Pass





B.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant1	1.12	0.24	1.36	11	Pass
NVNT	a	5200	Ant1	1.13	0.24	1.37	11	Pass
NVNT	a	5240	Ant1	1.39	0.24	1.63	11	Pass
NVNT	n20	5180	Ant1	0.56	0.12	0.68	11	Pass
NVNT	n20	5200	Ant1	0.12	0.12	0.24	11	Pass
NVNT	n20	5240	Ant1	0.56	0.12	0.68	11	Pass
NVNT	n40	5190	Ant1	-2.08	0.23	-1.85	11	Pass
NVNT	n40	5230	Ant1	-2.62	0.24	-2.38	11	Pass
NVNT	ac20	5180	Ant1	0.33	0.12	0.45	11	Pass
NVNT	ac20	5200	Ant1	0.07	0.12	0.19	11	Pass
NVNT	ac20	5240	Ant1	0.49	0.12	0.61	11	Pass
NVNT	ac40	5190	Ant1	-2.74	0.24	-2.5	11	Pass
NVNT	ac40	5230	Ant1	-3.42	0.24	-3.18	11	Pass
NVNT	ac80	5210	Ant1	-6.18	0.47	-5.71	11	Pass
NVNT	ax20	5180	Ant1	0.7	0.12	0.82	11	Pass
NVNT	ax20	5200	Ant1	0.2	0.12	0.32	11	Pass
NVNT	ax20	5240	Ant1	0.18	0.12	0.3	11	Pass
NVNT	ax40	5190	Ant1	-2.65	0.23	-2.42	11	Pass
NVNT	ax40	5230	Ant1	-3.61	0.24	-3.37	11	Pass
NVNT	ax80	5210	Ant1	-6.16	0.47	-5.69	11	Pass
NVNT	be20	5180	Ant1	2.73	0.12	2.85	11	Pass
NVNT	be20	5200	Ant1	3.66	0.12	3.78	11	Pass
NVNT	be20	5240	Ant1	2.28	0.12	2.4	11	Pass
NVNT	be40	5190	Ant1	-0.33	0.24	-0.09	11	Pass
NVNT	be40	5230	Ant1	-0.85	0.24	-0.61	11	Pass
NVNT	be80	5210	Ant1	-4.55	0.47	-4.08	11	Pass
NVNT	ac160	5250	Ant1	-8.01	3.98	-4.03	11	Pass
NVNT	ax160	5250	Ant1	-8.35	3.98	-4.37	11	Pass
NVNT	be160	5250	Ant1	-4.87	3.77	-1.1	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant2	1.28	0.24	1.52	11	Pass
NVNT	a	5200	Ant2	0.94	0.24	1.18	11	Pass
NVNT	a	5240	Ant2	1.43	0.24	1.67	11	Pass
NVNT	n20	5180	Ant2	0.46	0.12	0.58	11	Pass
NVNT	n20	5200	Ant2	0.27	0.12	0.39	11	Pass
NVNT	n20	5240	Ant2	0.3	0.12	0.42	11	Pass
NVNT	n40	5190	Ant2	-3.34	0.24	-3.1	11	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5230	Ant2	-3.35	0.24	-3.11	11	Pass
NVNT	ac20	5180	Ant2	0.44	0.12	0.56	11	Pass
NVNT	ac20	5200	Ant2	0.39	0.12	0.51	11	Pass
NVNT	ac20	5240	Ant2	0.38	0.12	0.5	11	Pass
NVNT	ac40	5190	Ant2	-3.75	0.24	-3.51	11	Pass
NVNT	ac40	5230	Ant2	-3.09	0.24	-2.85	11	Pass
NVNT	ac80	5210	Ant2	-6.07	0.47	-5.6	11	Pass
NVNT	ax20	5180	Ant2	0.82	0.12	0.94	11	Pass
NVNT	ax20	5200	Ant2	0.39	0.12	0.51	11	Pass
NVNT	ax20	5240	Ant2	0.52	0.12	0.64	11	Pass
NVNT	ax40	5190	Ant2	-3.6	0.24	-3.36	11	Pass
NVNT	ax40	5230	Ant2	-3.03	0.24	-2.79	11	Pass
NVNT	ax80	5210	Ant2	-6.07	0.47	-5.6	11	Pass
NVNT	be20	5180	Ant2	1.08	0.12	1.2	11	Pass
NVNT	be20	5200	Ant2	0.45	0.12	0.57	11	Pass
NVNT	be20	5240	Ant2	0.54	0.12	0.66	11	Pass
NVNT	be40	5190	Ant2	-3.11	0.24	-2.87	11	Pass
NVNT	be40	5230	Ant2	-3.61	0.24	-3.37	11	Pass
NVNT	be80	5210	Ant2	-6.34	0.47	-5.87	11	Pass
NVNT	ac160	5250	Ant2	-8.89	3.99	-4.9	11	Pass
NVNT	ax160	5250	Ant2	-10.39	3.98	-6.41	11	Pass
NVNT	be160	5250	Ant2	-8.23	3.77	-4.46	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant3	1.26	0.24	1.5	11	Pass
NVNT	a	5200	Ant3	1.38	0.24	1.62	11	Pass
NVNT	a	5240	Ant3	0.39	0.24	0.63	11	Pass
NVNT	n20	5180	Ant3	0.73	0.28	1.01	11	Pass
NVNT	n20	5200	Ant3	0.36	0.28	0.64	11	Pass
NVNT	n20	5240	Ant3	0.68	0.28	0.96	11	Pass
NVNT	n40	5190	Ant3	-3.53	0.24	-3.29	11	Pass
NVNT	n40	5230	Ant3	-3.19	0.24	-2.95	11	Pass
NVNT	ac20	5180	Ant3	0.68	0.12	0.8	11	Pass
NVNT	ac20	5200	Ant3	0.33	0.12	0.45	11	Pass
NVNT	ac20	5240	Ant3	0.58	0.12	0.7	11	Pass
NVNT	ac40	5190	Ant3	-3.42	0.24	-3.18	11	Pass
NVNT	ac40	5230	Ant3	-3.56	0.24	-3.32	11	Pass
NVNT	ac80	5210	Ant3	-5.94	0.47	-5.47	11	Pass
NVNT	ax20	5180	Ant3	0.71	0.12	0.83	11	Pass
NVNT	ax20	5200	Ant3	0.48	0.12	0.6	11	Pass
NVNT	ax20	5240	Ant3	0.36	0.12	0.48	11	Pass
NVNT	ax40	5190	Ant3	-1.99	0.24	-1.75	11	Pass
NVNT	ax40	5230	Ant3	-3.59	0.24	-3.35	11	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5210	Ant3	-5.63	0.47	-5.16	11	Pass
NVNT	be20	5180	Ant3	1.68	0.12	1.8	11	Pass
NVNT	be20	5200	Ant3	1.34	0.12	1.46	11	Pass
NVNT	be20	5240	Ant3	0.53	0.12	0.65	11	Pass
NVNT	be40	5190	Ant3	-2.38	0.24	-2.14	11	Pass
NVNT	be40	5230	Ant3	-3.71	0.24	-3.47	11	Pass
NVNT	be80	5210	Ant3	-6.59	0.47	-6.12	11	Pass
NVNT	ac160	5250	Ant3	-7.88	3.77	-4.11	11	Pass
NVNT	ax160	5250	Ant3	-8.07	3.52	-4.55	11	Pass
NVNT	be160	5250	Ant3	-7.43	3.77	-3.66	11	Pass

MIMO


Condition	Mode	Frequency (MHz)	Total PSD (dBm/MHz)				Limit dBm/MHz)	Verdict
			Ant1	Ant2	Ant3	Ant1+Ant2+ Ant3		
NVNT	n20	5180	0.68	0.58	1.01	5.53	8.08	Pass
NVNT	n20	5200	0.24	0.39	0.64	5.20	8.08	Pass
NVNT	n20	5240	0.68	0.42	0.96	5.46	8.08	Pass
NVNT	n40	5190	-1.85	-3.1	-3.29	2.07	8.08	Pass
NVNT	n40	5230	-2.38	-3.11	-2.95	1.97	8.08	Pass
NVNT	ac20	5180	0.45	0.56	0.8	5.38	8.08	Pass
NVNT	ac20	5200	0.19	0.51	0.45	5.16	8.08	Pass
NVNT	ac20	5240	0.61	0.5	0.7	5.38	8.08	Pass
NVNT	ac40	5190	-2.5	-3.51	-3.18	1.73	8.08	Pass
NVNT	ac40	5230	-3.18	-2.85	-3.32	1.66	8.08	Pass
NVNT	ac80	5210	-5.71	-5.6	-5.47	-0.82	8.08	Pass
NVNT	ax20	5180	0.82	0.94	0.83	5.63	8.08	Pass
NVNT	ax20	5200	0.32	0.51	0.6	5.25	8.08	Pass
NVNT	ax20	5240	0.3	0.64	0.48	5.25	8.08	Pass
NVNT	ax40	5190	-2.42	-3.36	-1.75	2.31	8.08	Pass
NVNT	ax40	5230	-3.37	-2.79	-3.35	1.61	8.08	Pass
NVNT	ax80	5210	-5.69	-5.6	-5.16	-0.71	8.08	Pass
NVNT	be20	5180	2.85	1.2	1.8	6.78	8.08	Pass
NVNT	be20	5200	3.78	0.57	1.46	6.93	8.08	Pass
NVNT	be20	5240	2.4	0.66	0.65	6.09	8.08	Pass
NVNT	be40	5190	-0.09	-2.87	-2.14	3.24	8.08	Pass
NVNT	be40	5230	-0.61	-3.37	-3.47	2.50	8.08	Pass
NVNT	be80	5210	-4.08	-5.87	-6.12	-0.49	8.08	Pass
NVNT	ac160	5250	-4.03	-4.9	-4.11	0.44	8.08	Pass
NVNT	ax160	5250	-4.37	-6.41	-4.55	-0.25	8.08	Pass
NVNT	be160	5250	-1.1	-4.46	-3.66	1.94	8.08	Pass






Test Graphs

PSD NVNT a 5180MHz Ant1

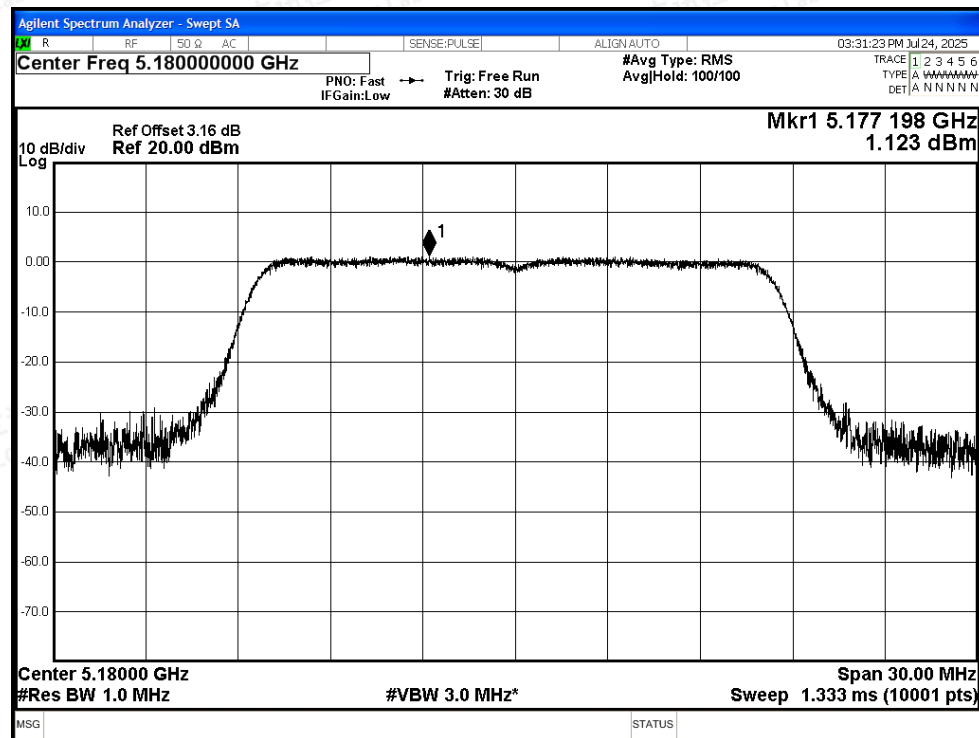

PSD NVNT a 5200MHz Ant1


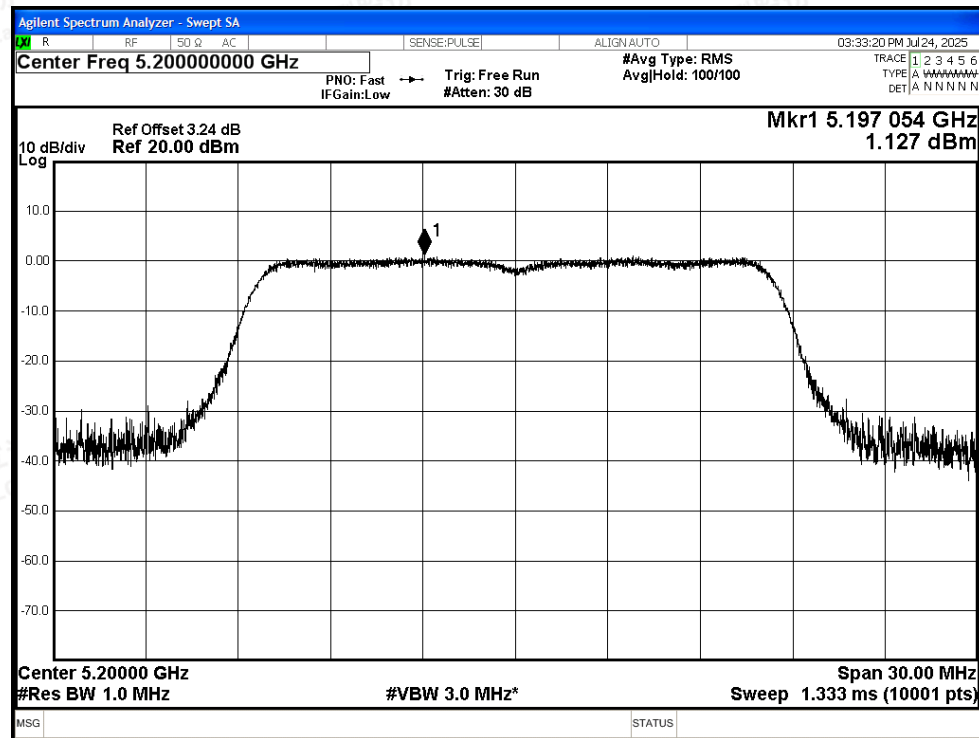


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

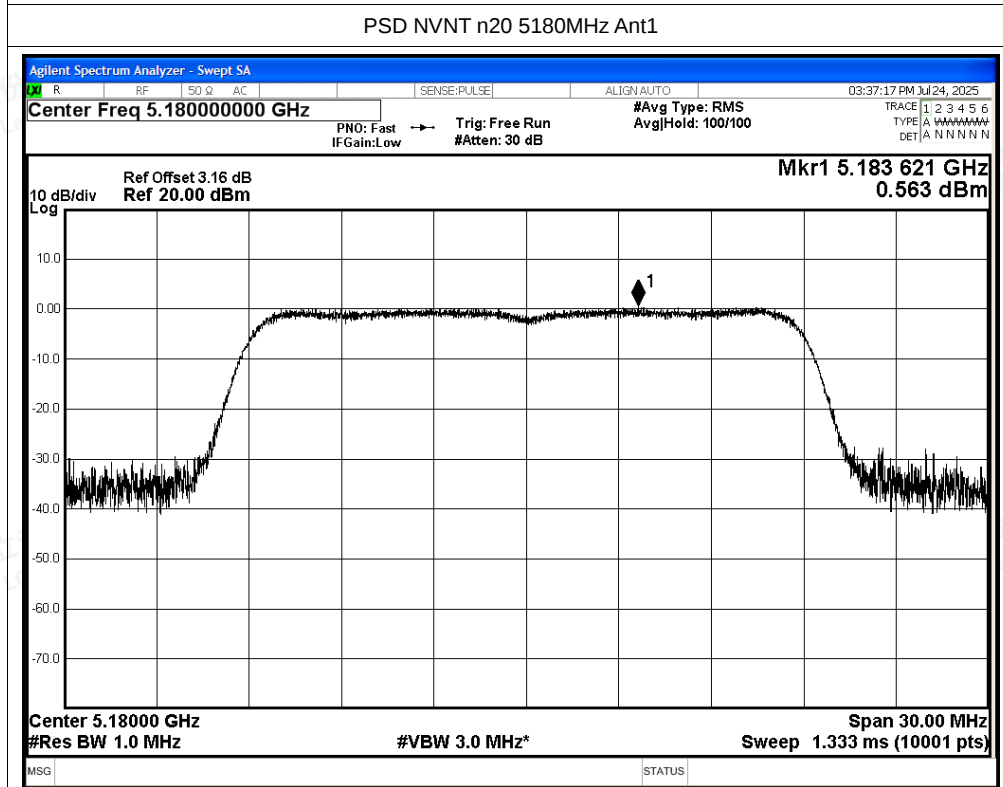
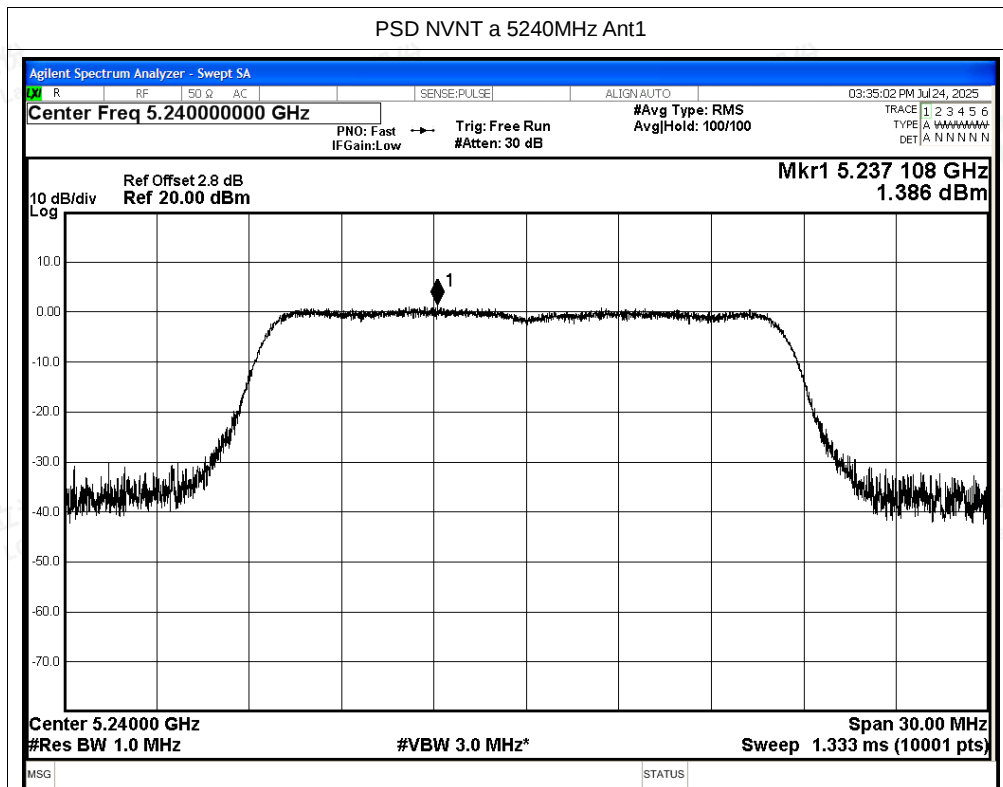




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

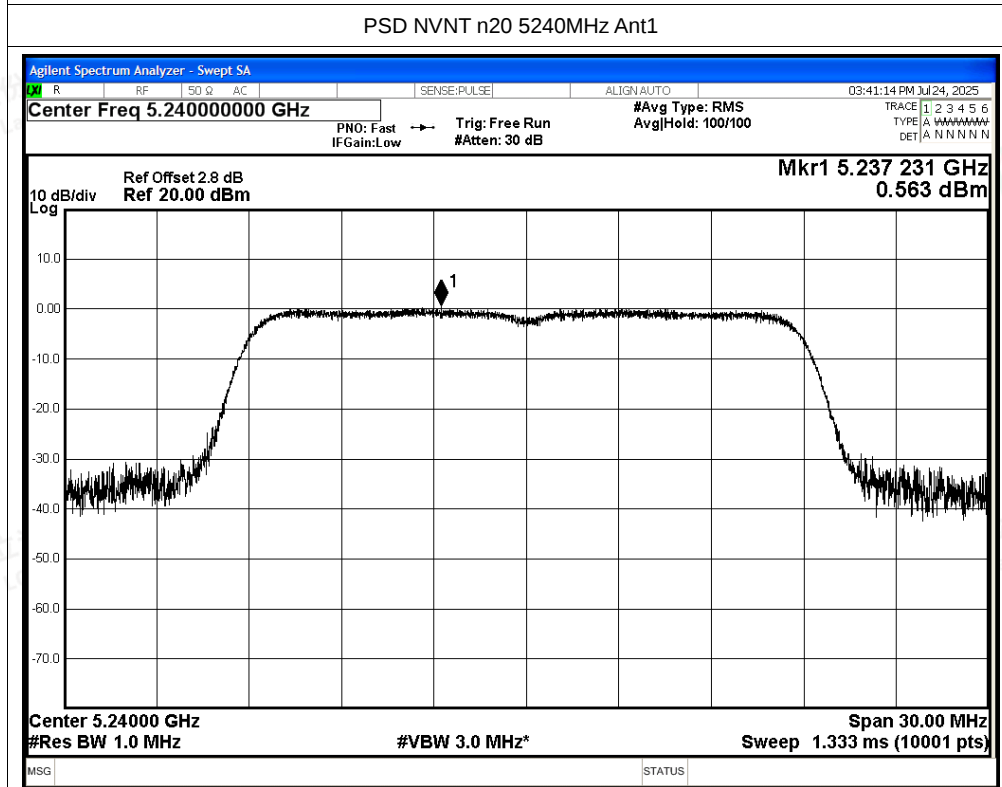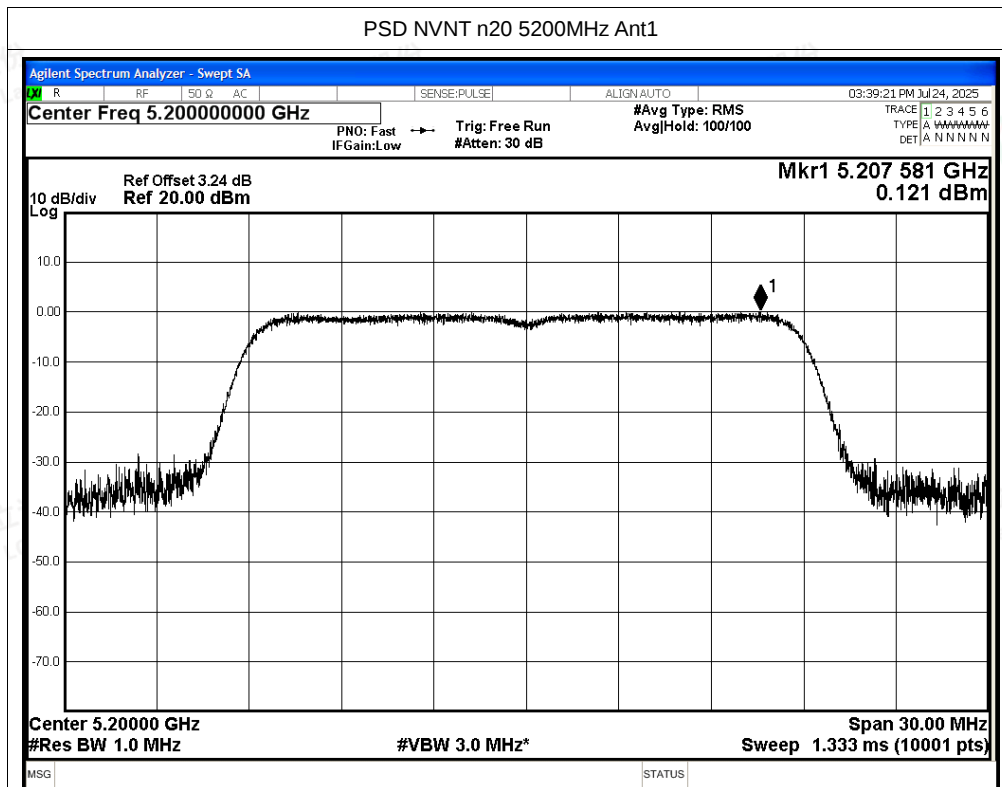

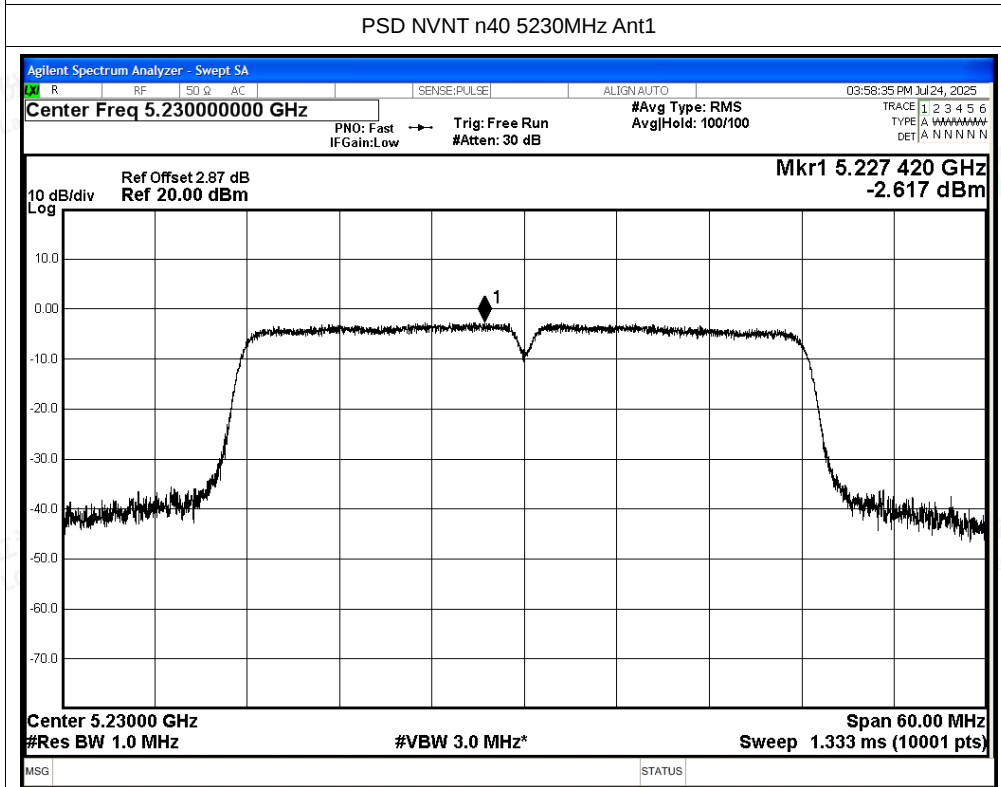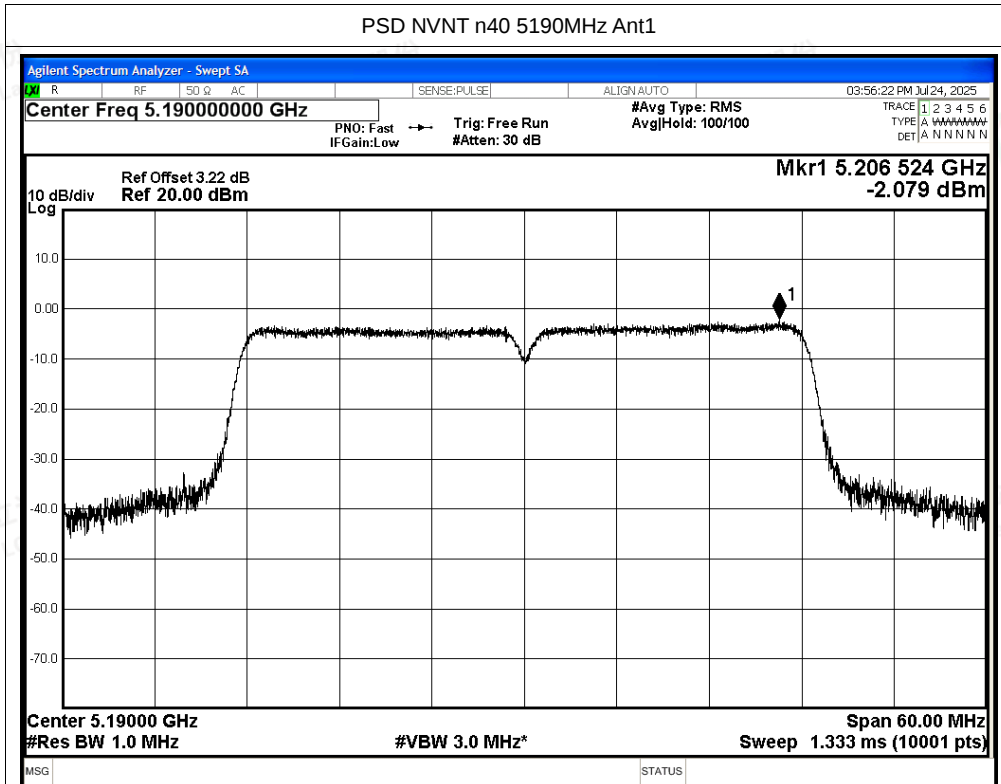




PSD NVNT ac20 5180MHz Ant1

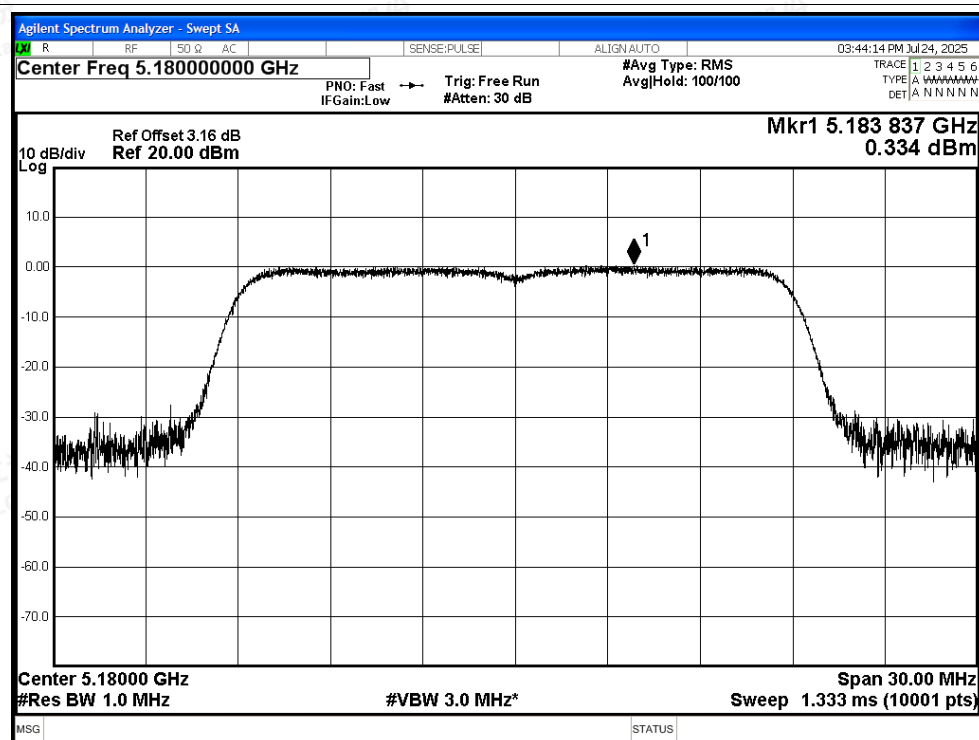

PSD NVNT ac20 5200MHz Ant1

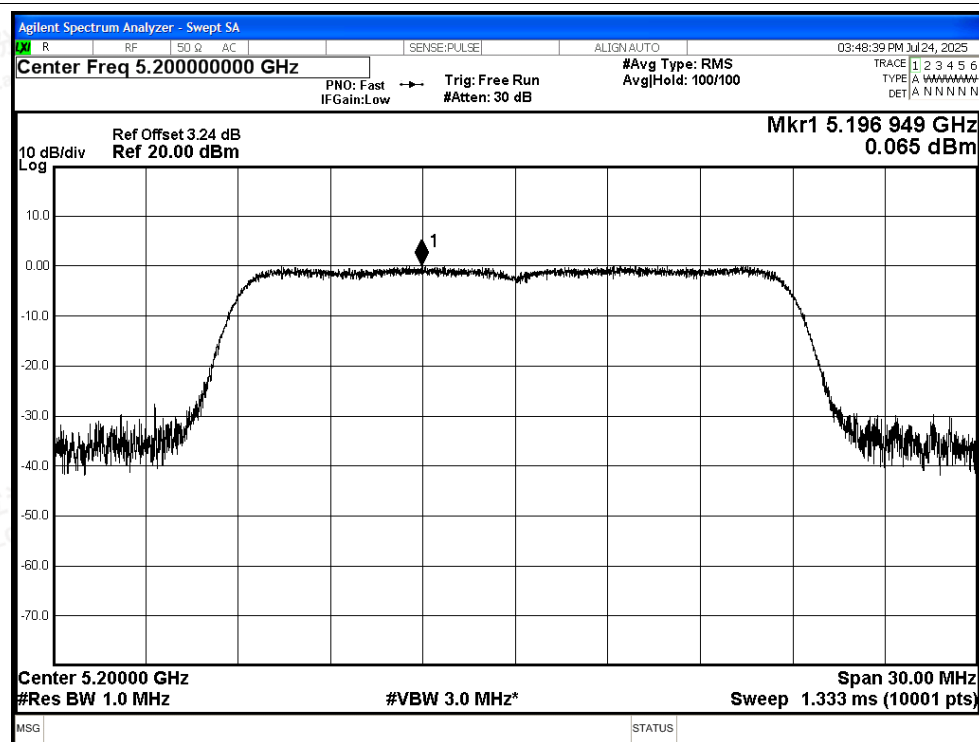

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant1

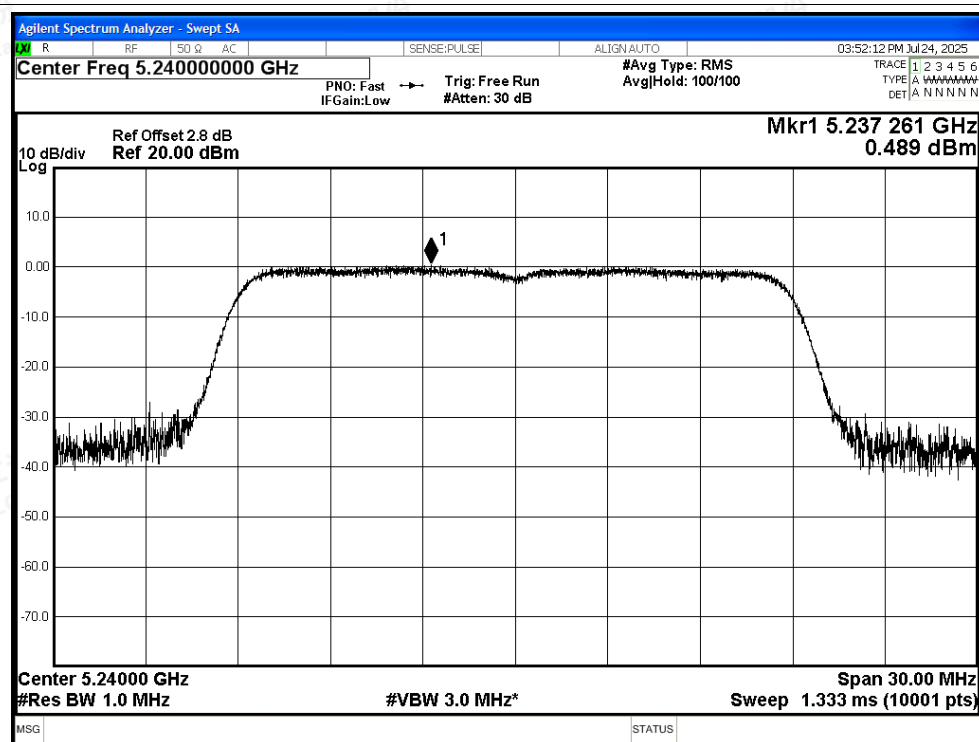

PSD NVNT ac40 5190MHz Ant1

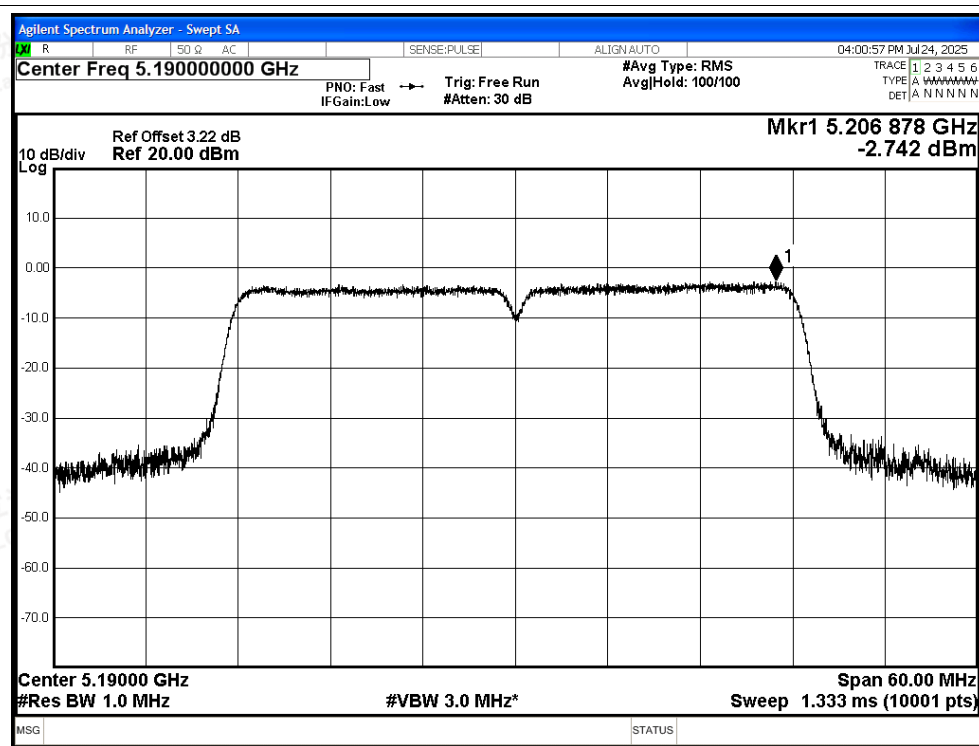

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant1

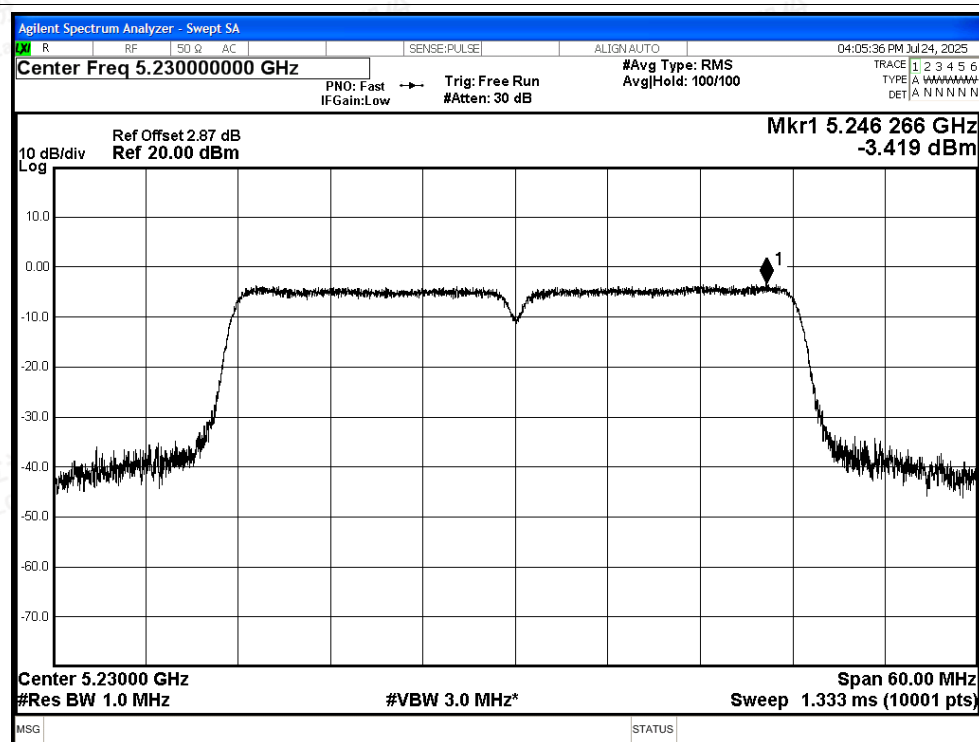

PSD NVNT ac80 5210MHz Ant1

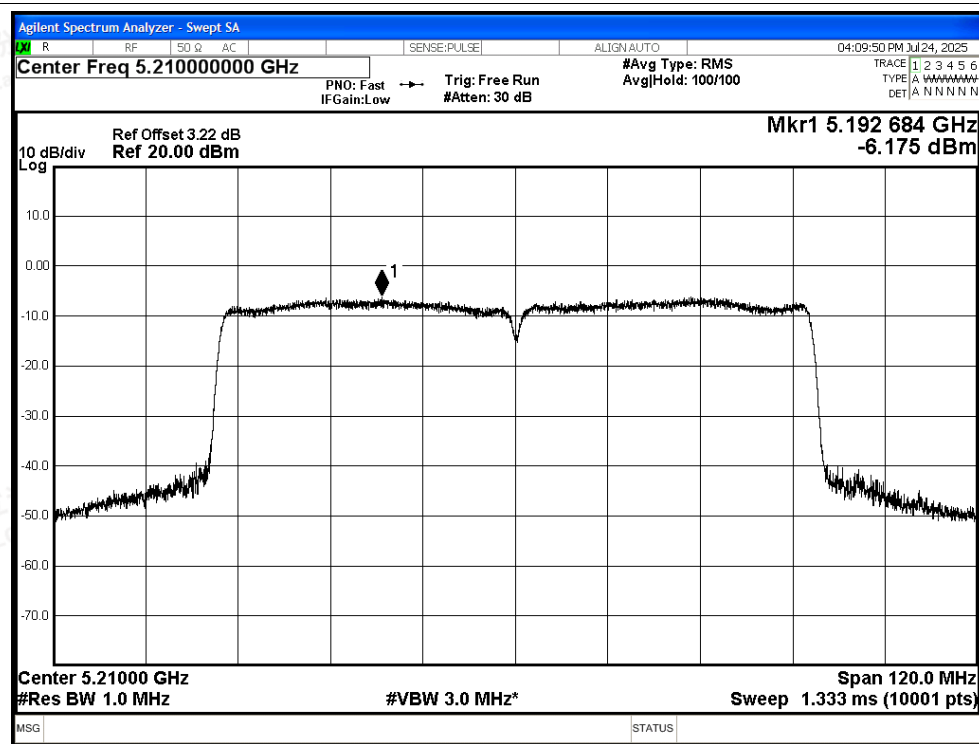

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5180MHz Ant1

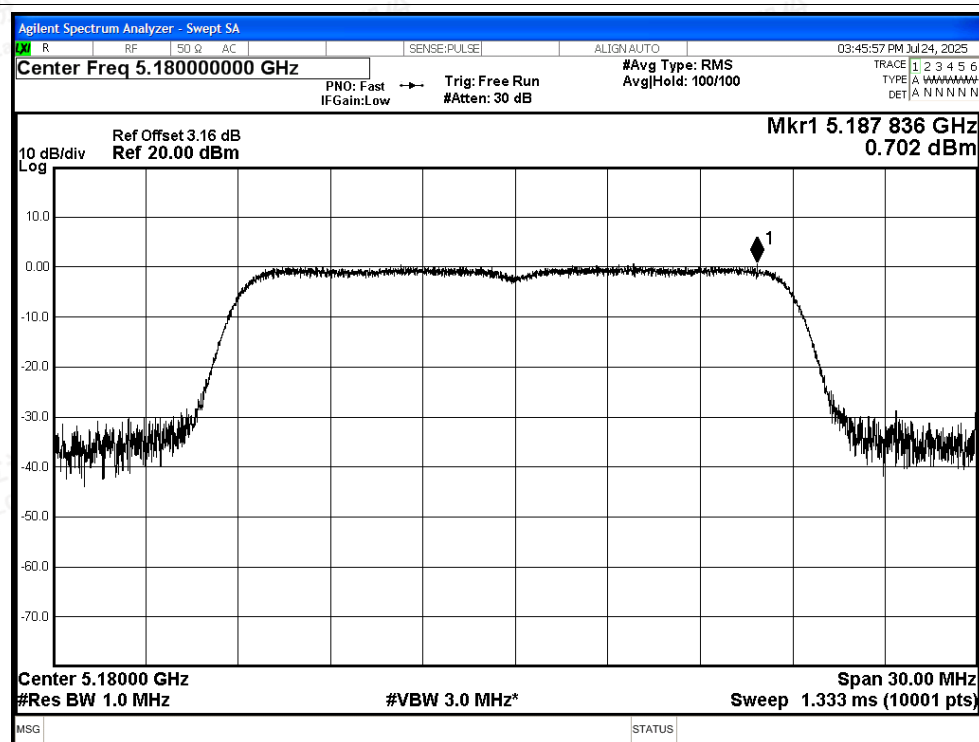


PSD NVNT ax20 5200MHz Ant1

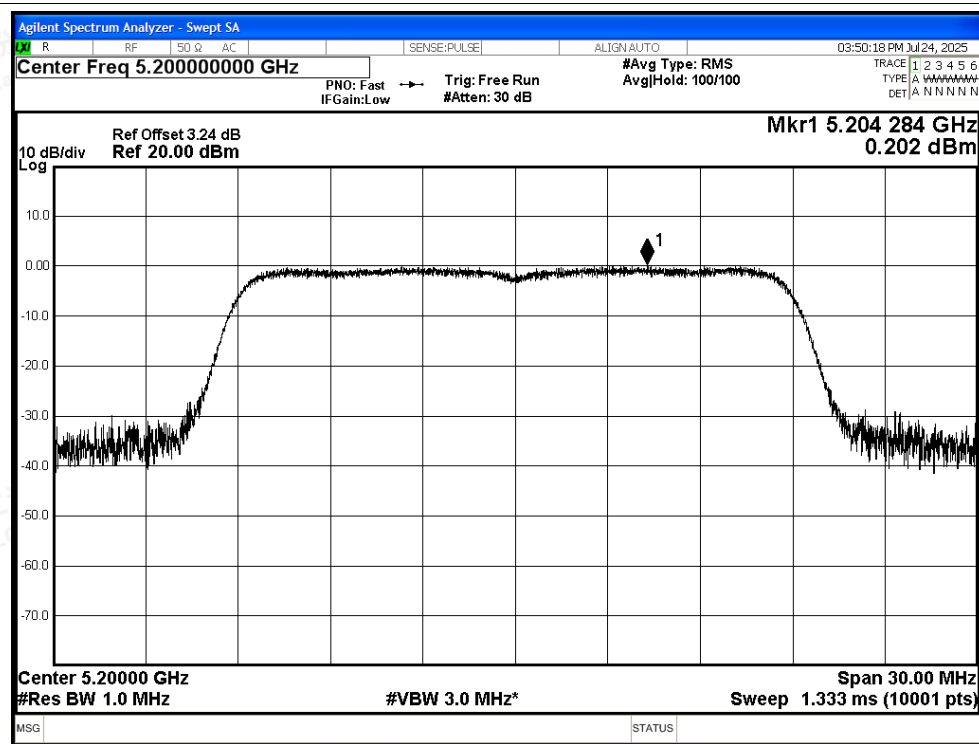




PSD NVNT ax20 5240MHz Ant1

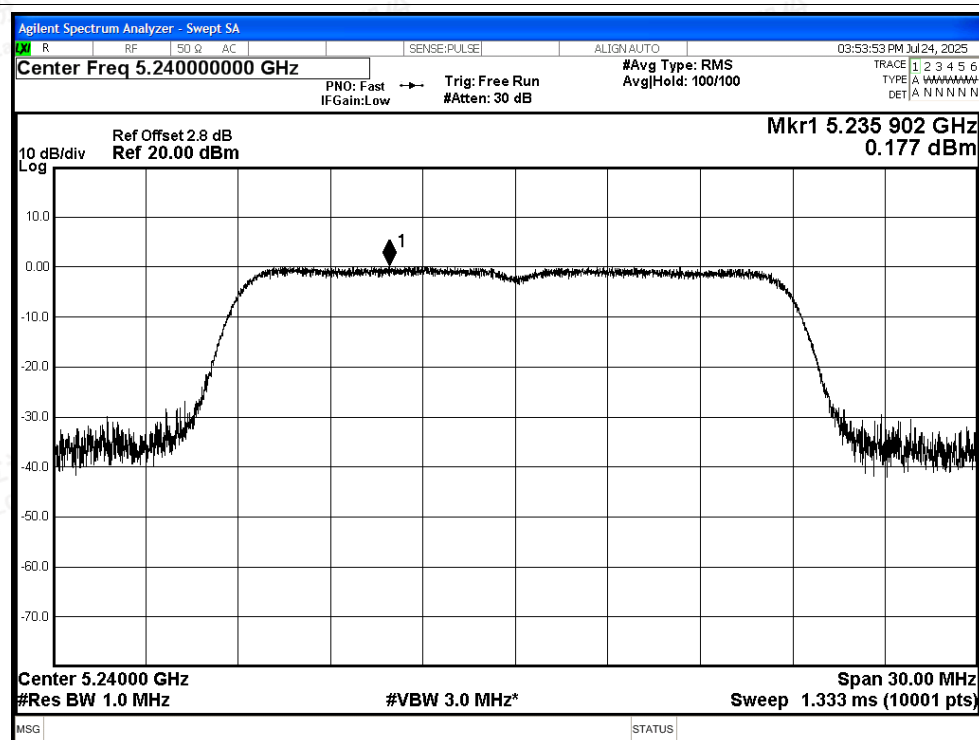

PSD NVNT ax40 5190MHz Ant1

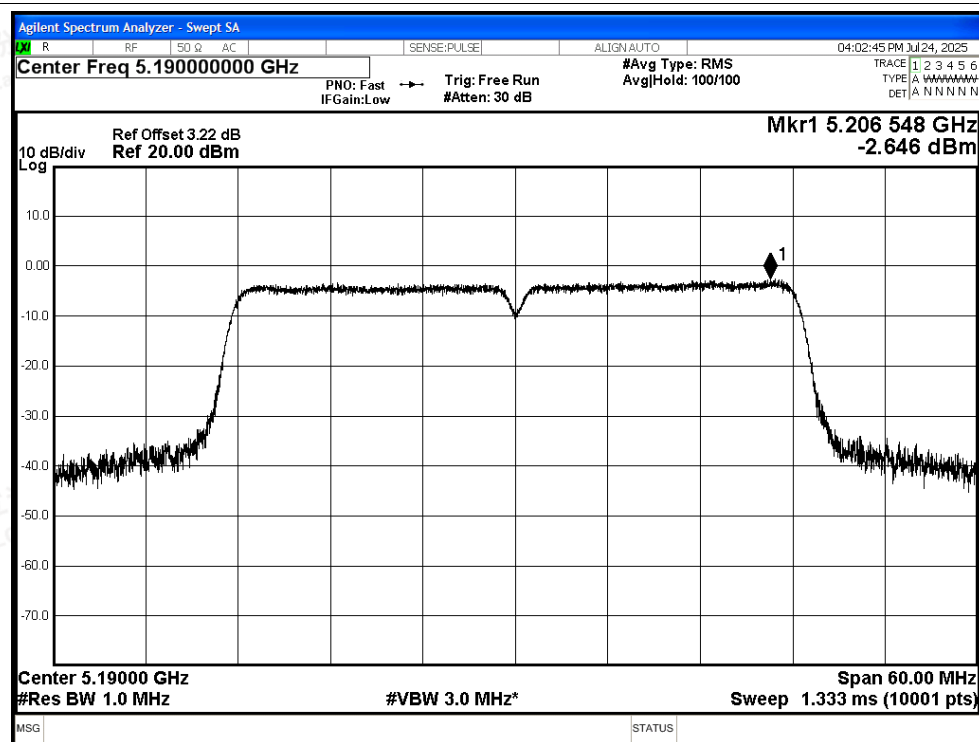

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant1

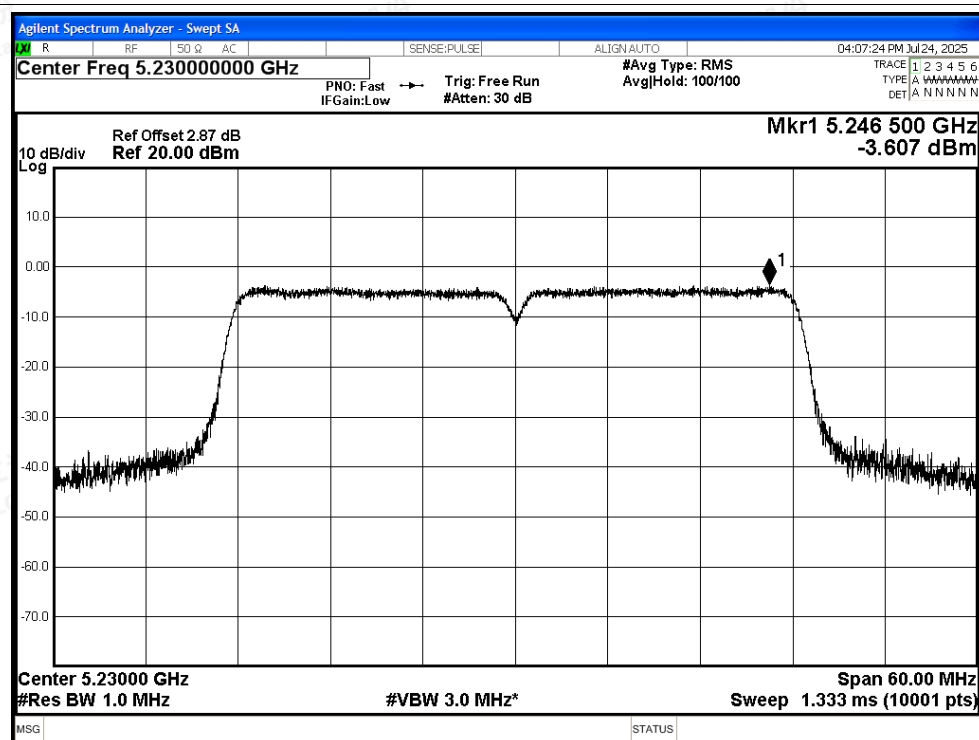

PSD NVNT ax80 5210MHz Ant1

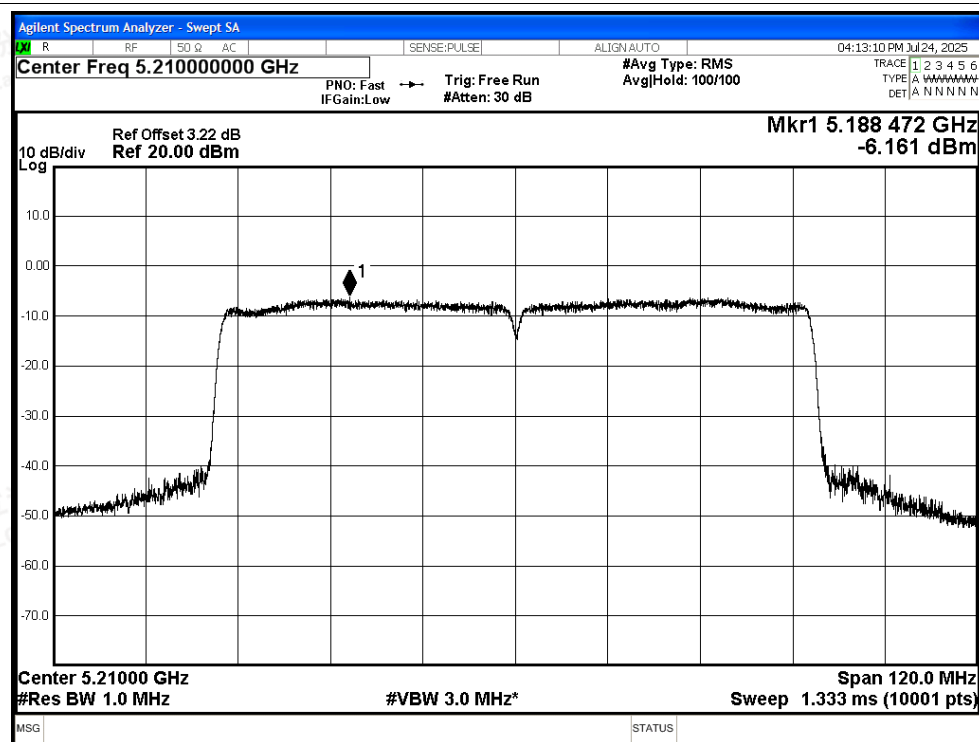

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5180MHz Ant1

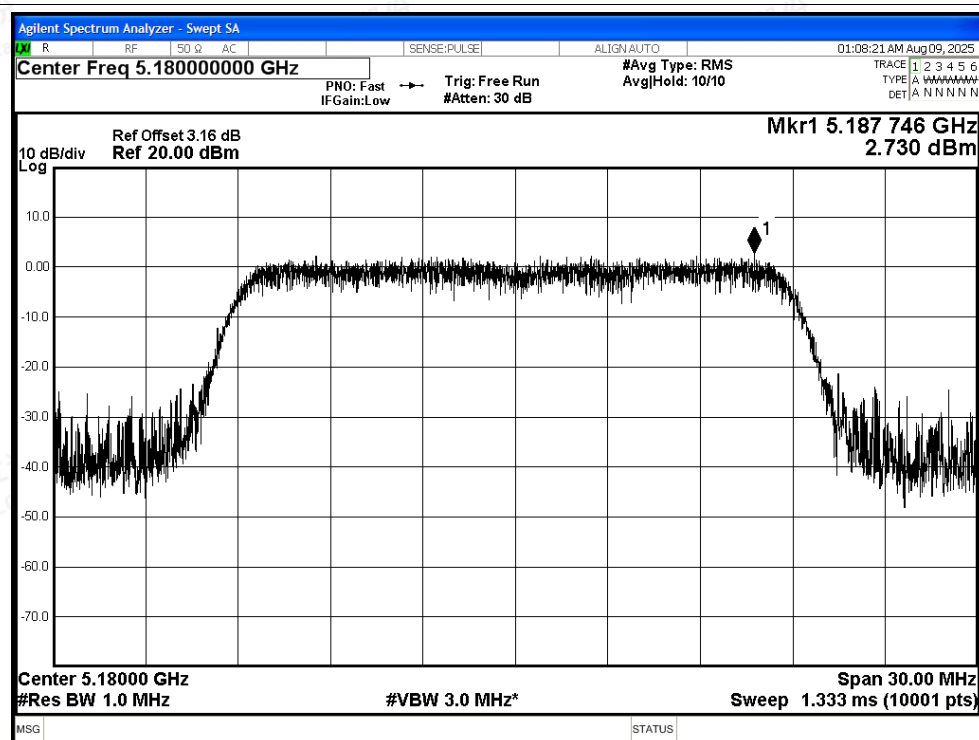

PSD NVNT be20 5200MHz Ant1

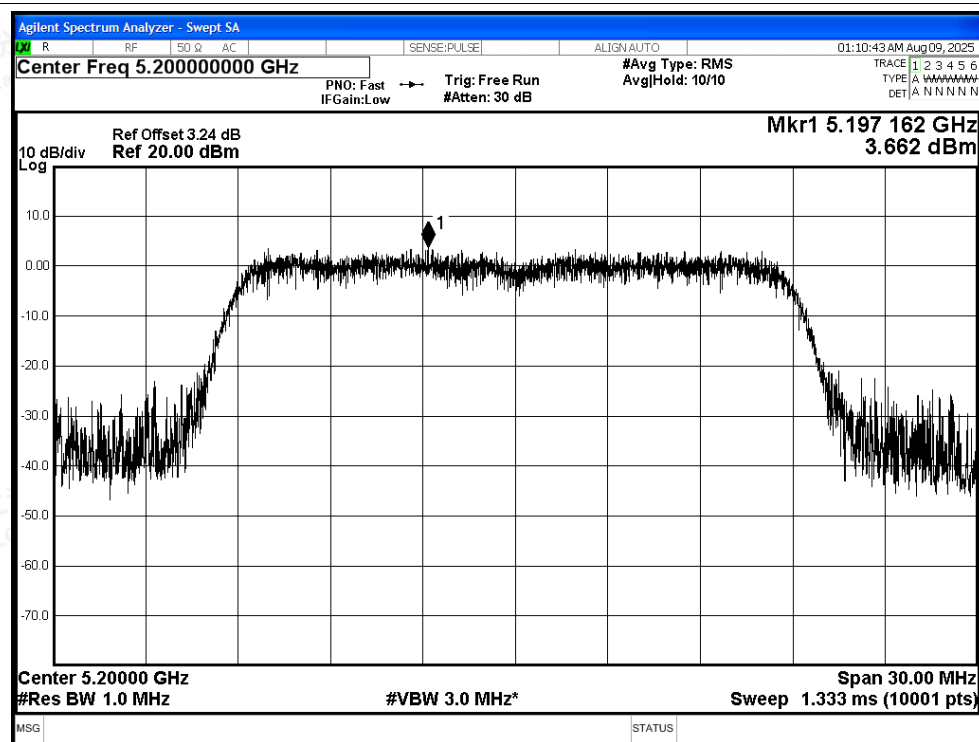

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5240MHz Ant1

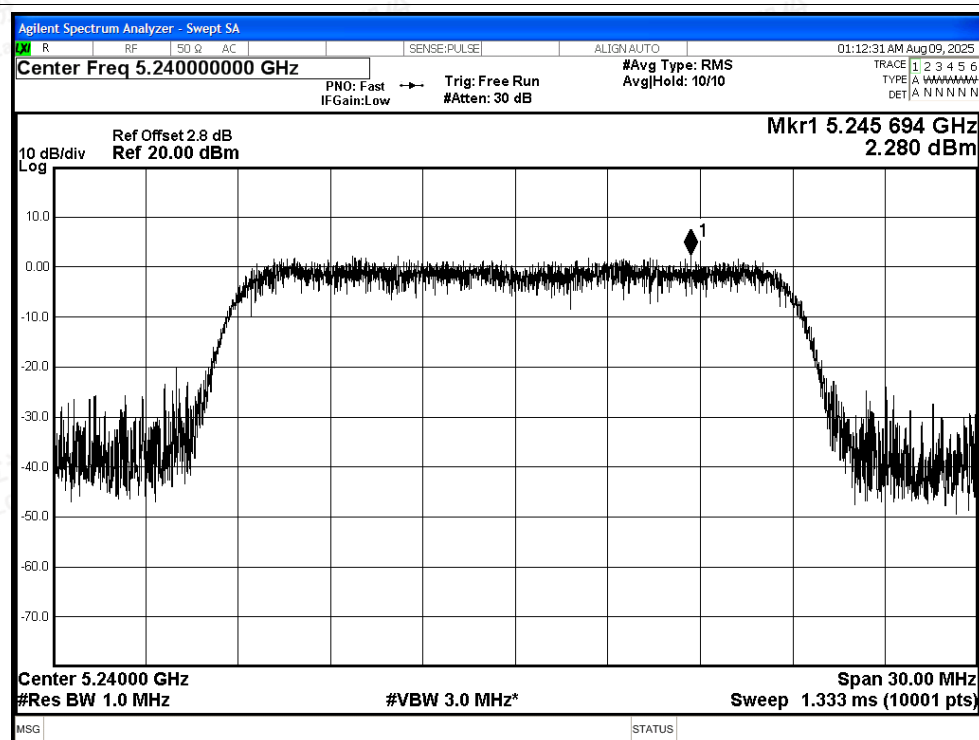

PSD NVNT be40 5190MHz Ant1

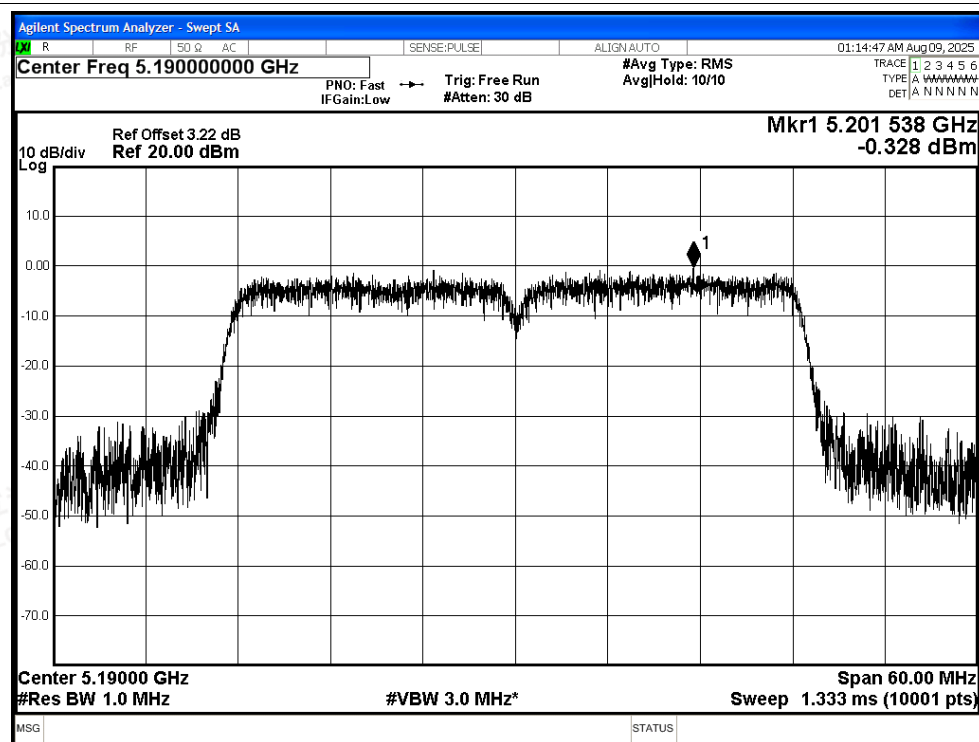

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5230MHz Ant1

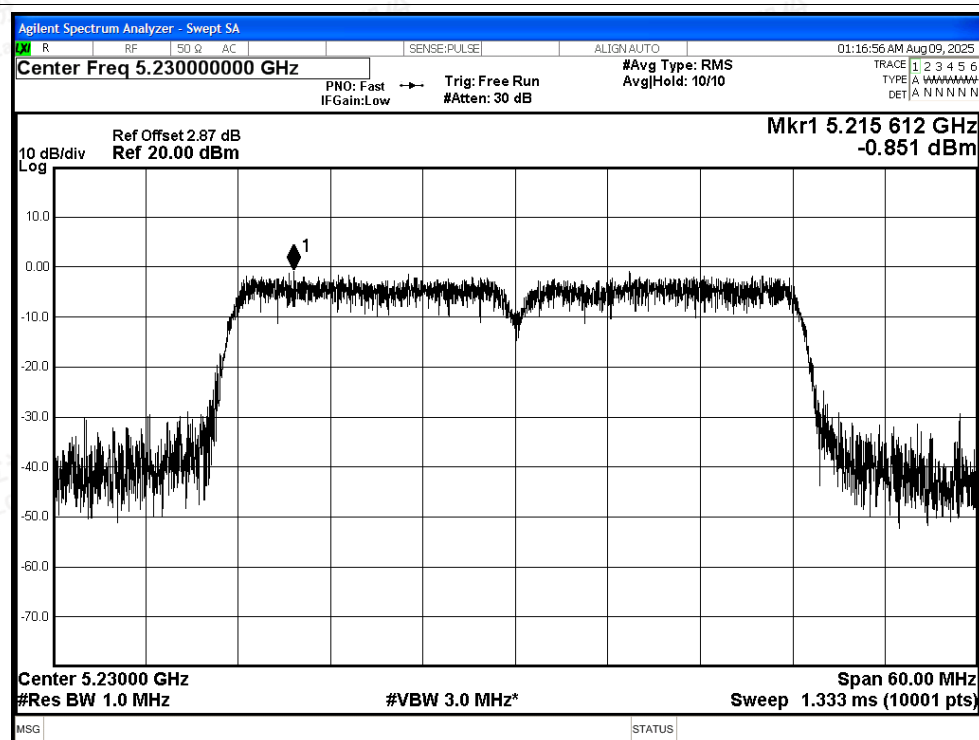

PSD NVNT be80 5210MHz Ant1

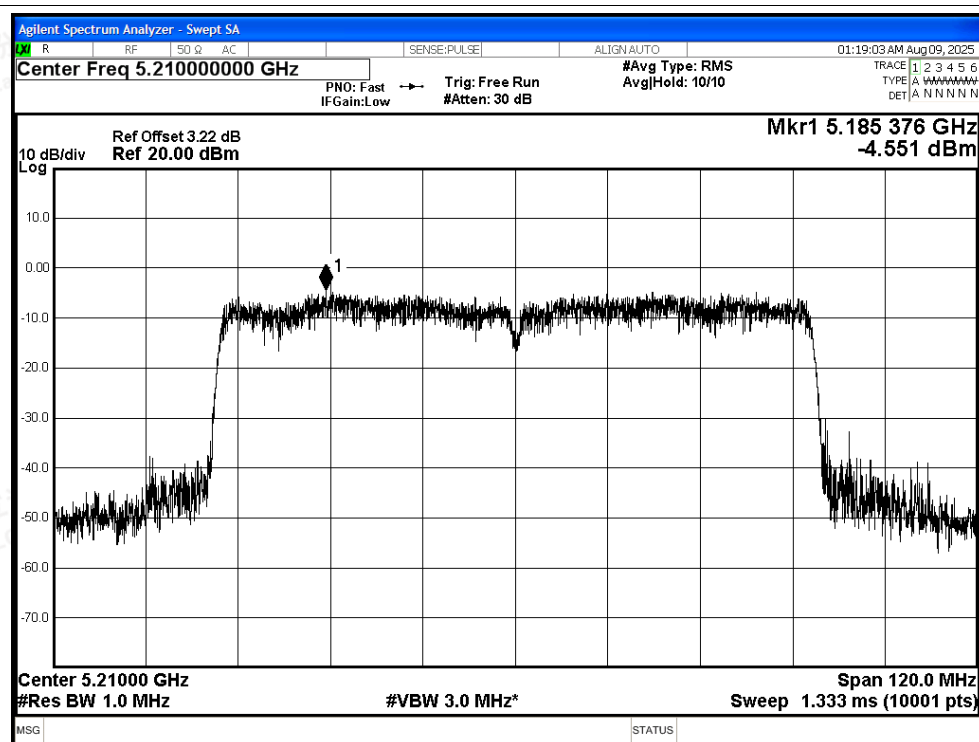

PSD NVNT ac160 5250MHz Ant1






Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

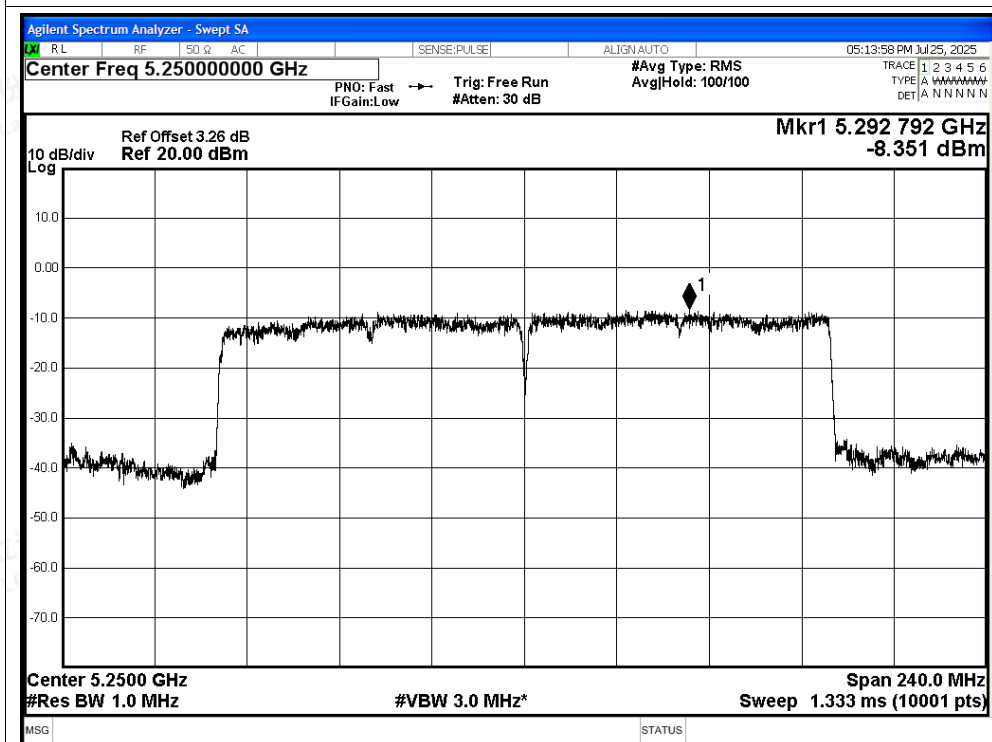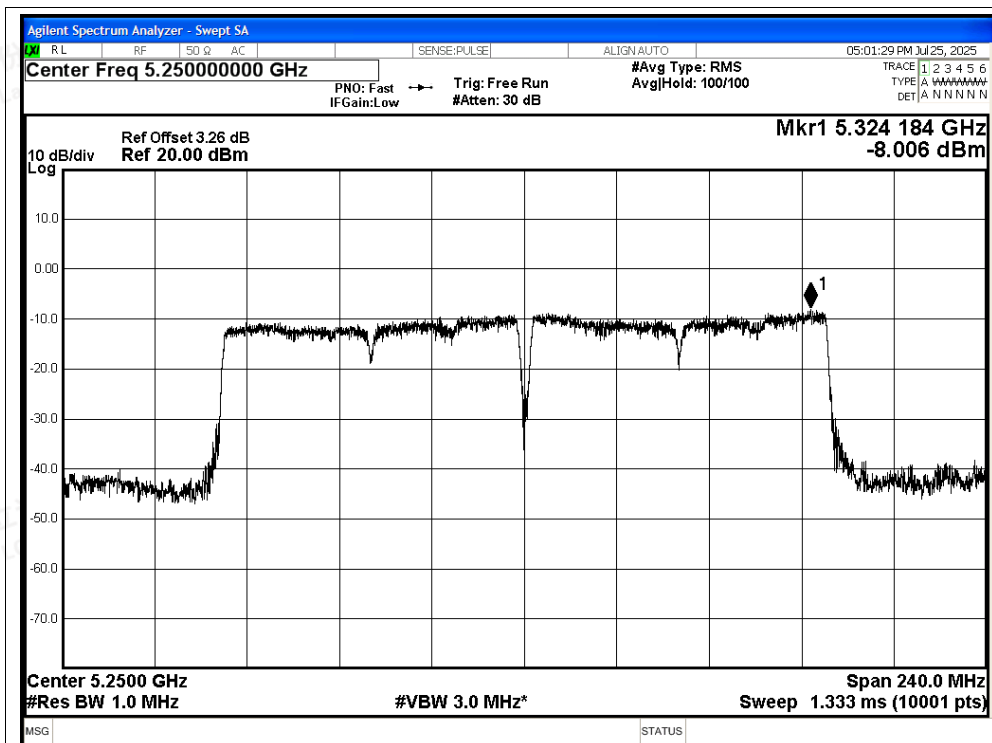


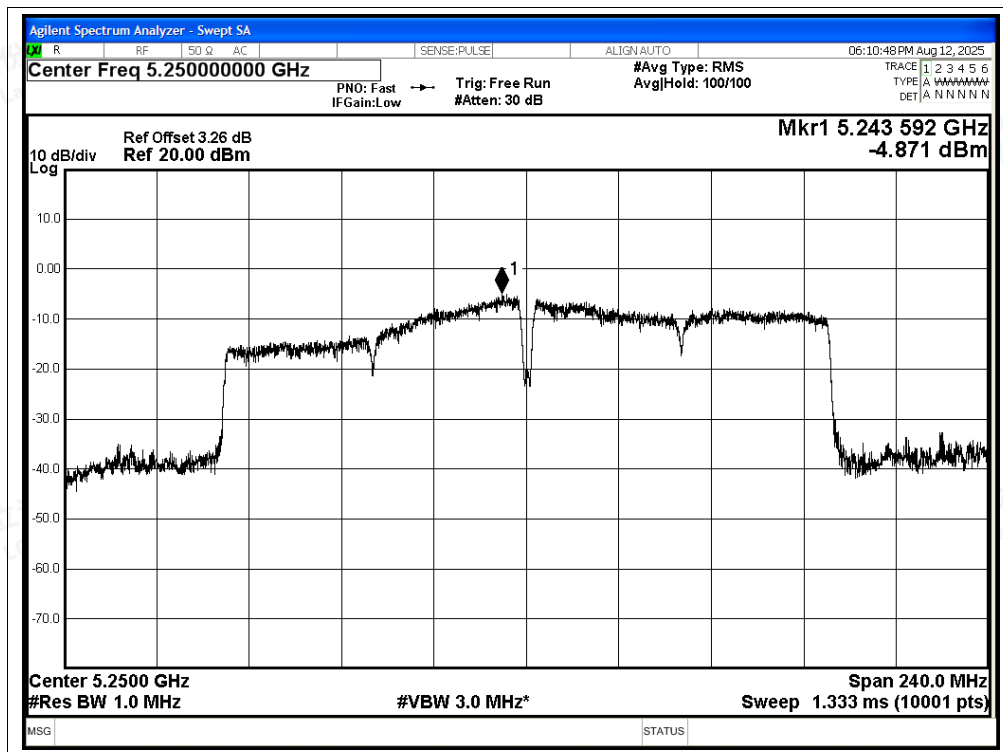




Test Graphs

PSD NVNT a 5180MHz Ant2

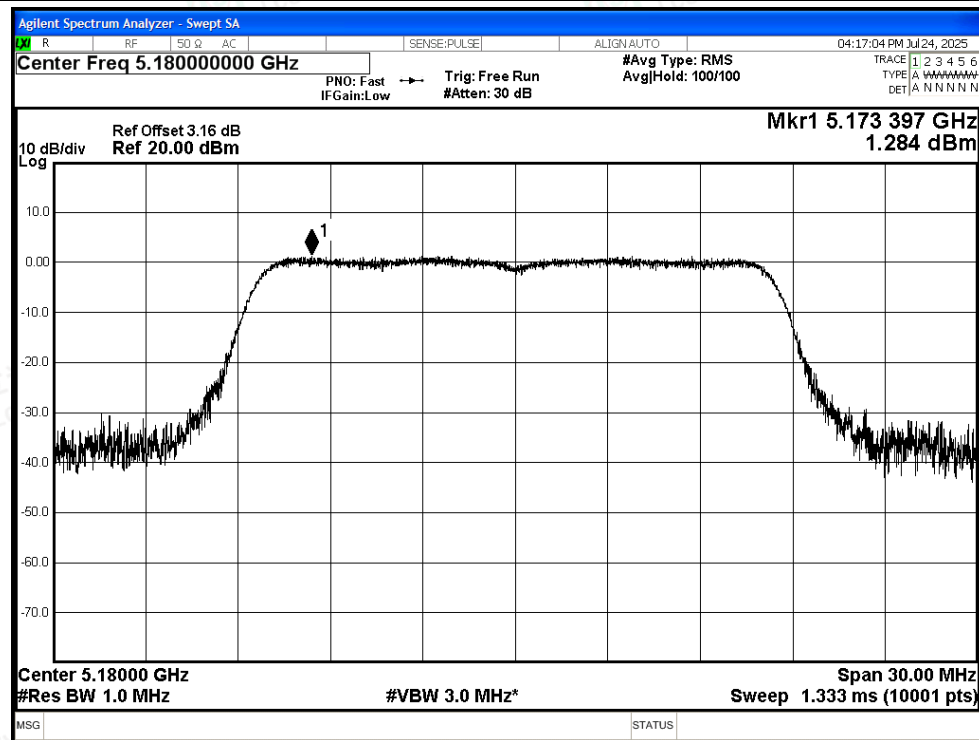

PSD NVNT a 5200MHz Ant2

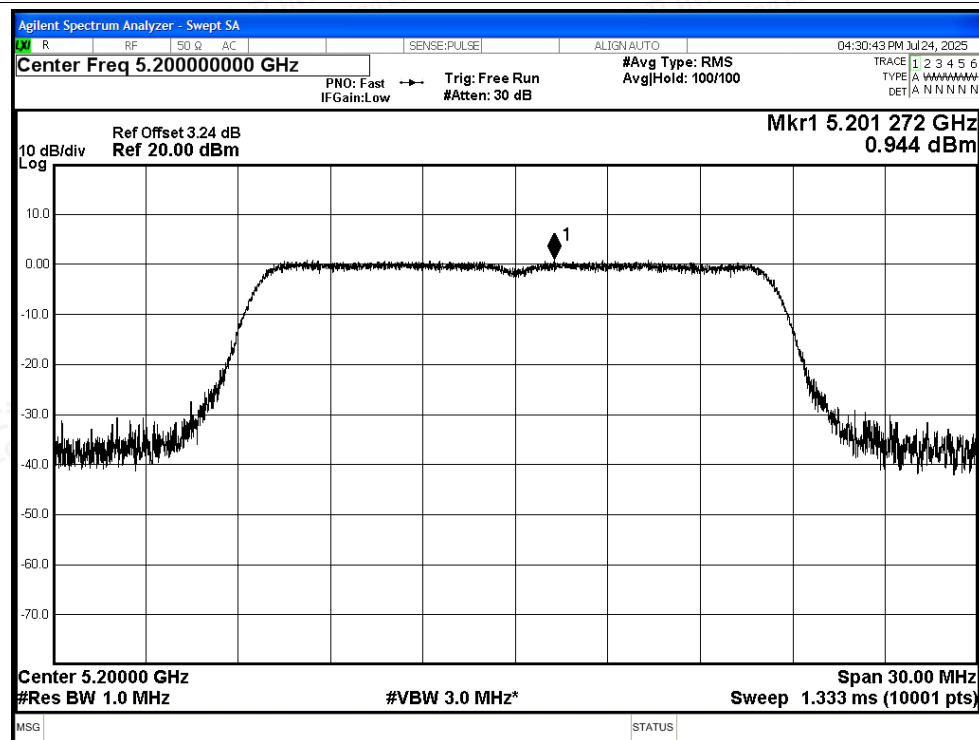

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5240MHz Ant2

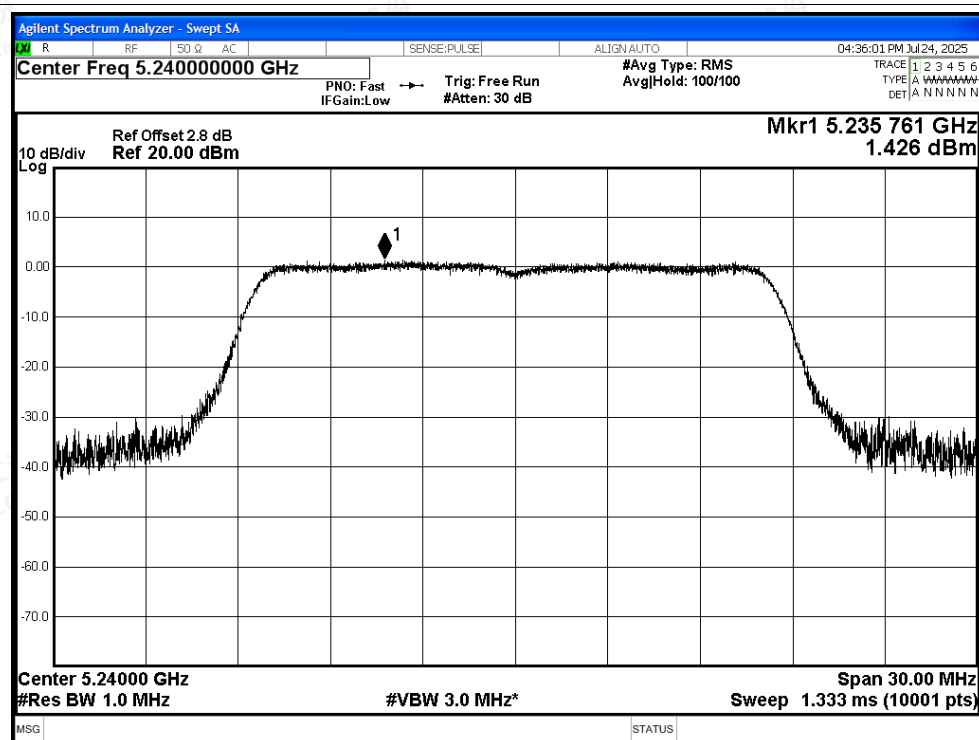

PSD NVNT n20 5180MHz Ant2


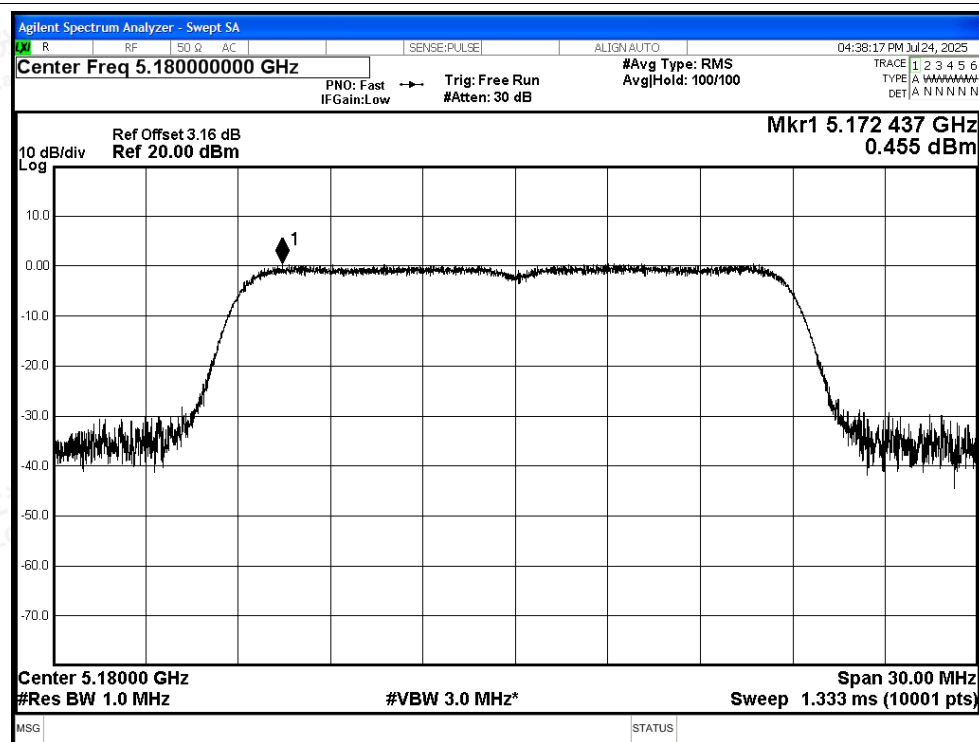




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

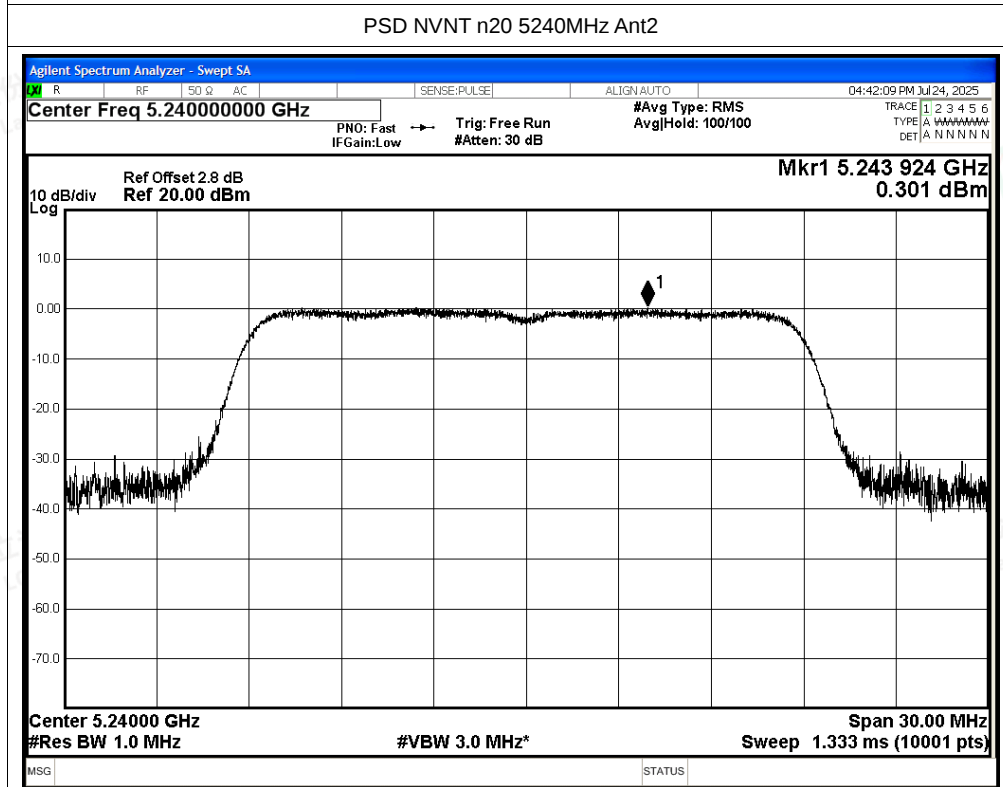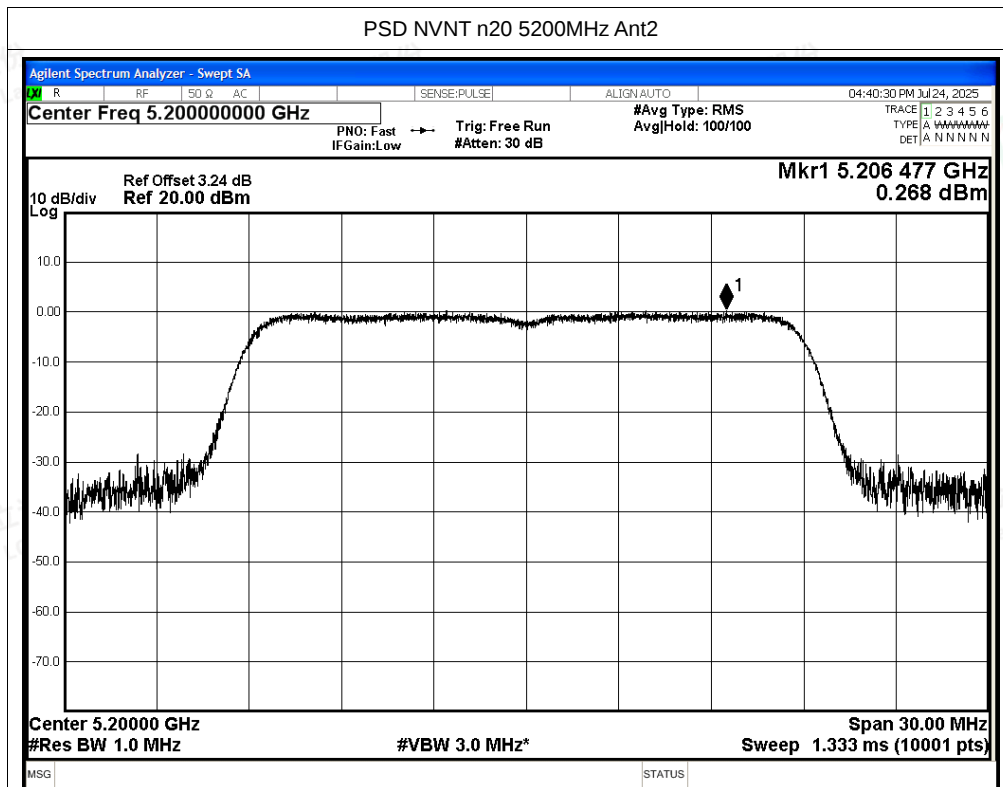

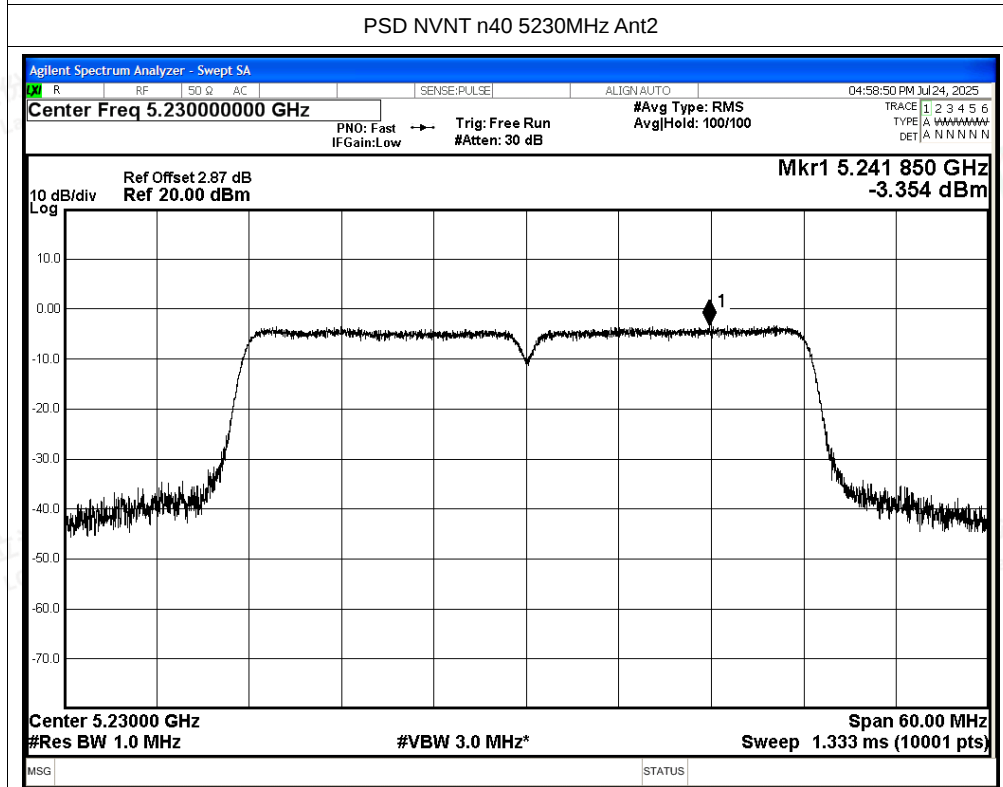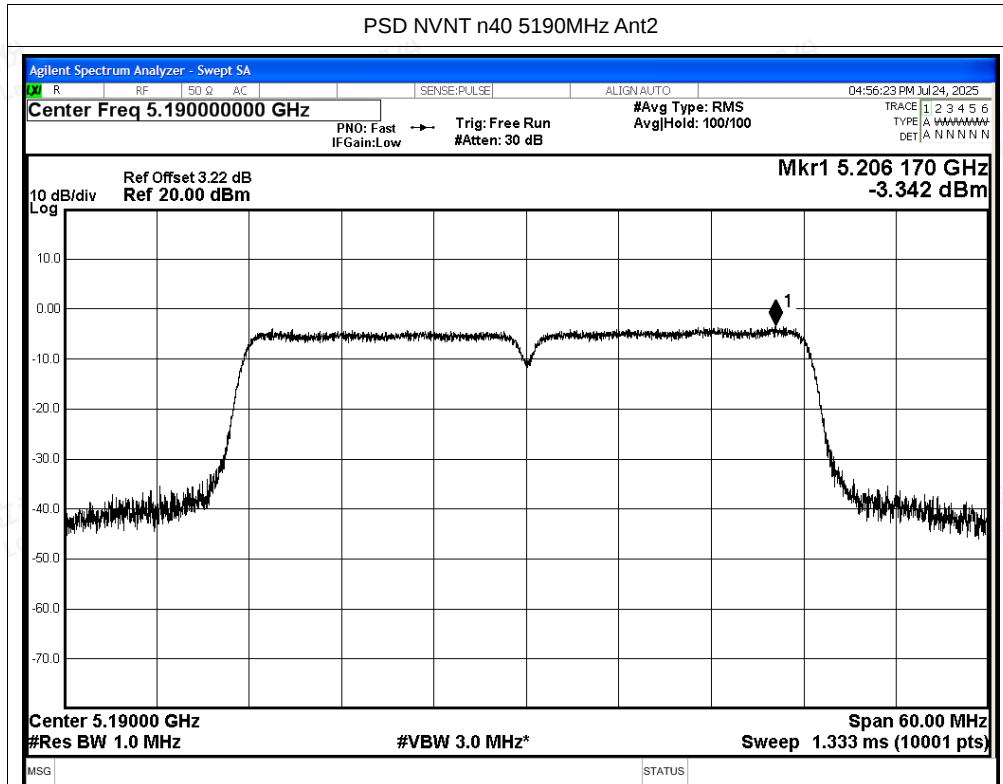

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant2

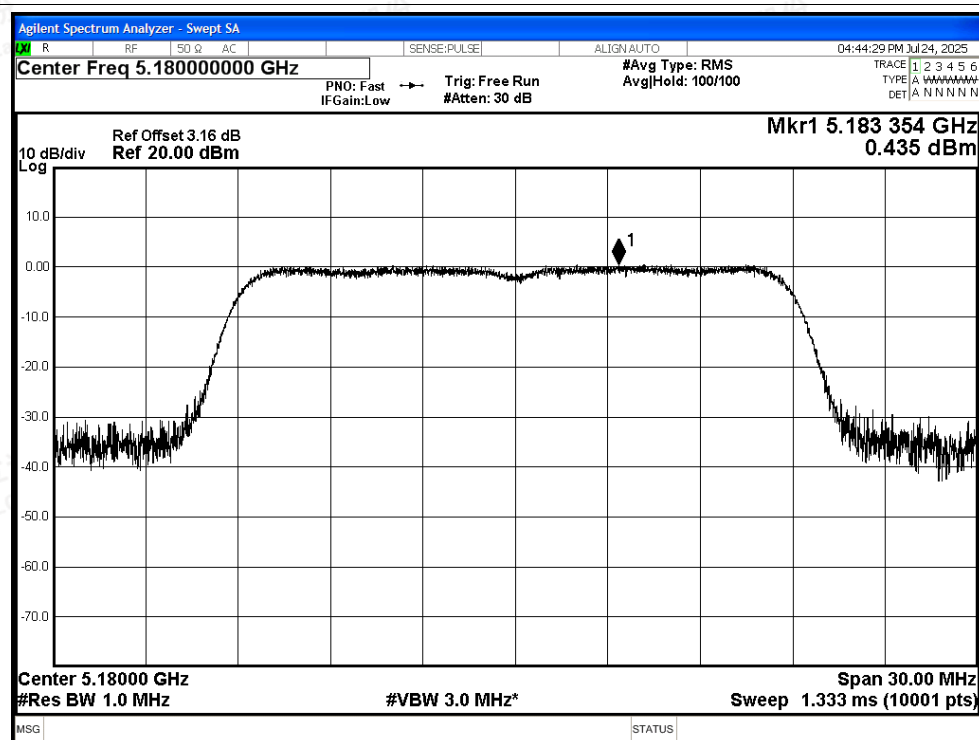

PSD NVNT ac20 5200MHz Ant2

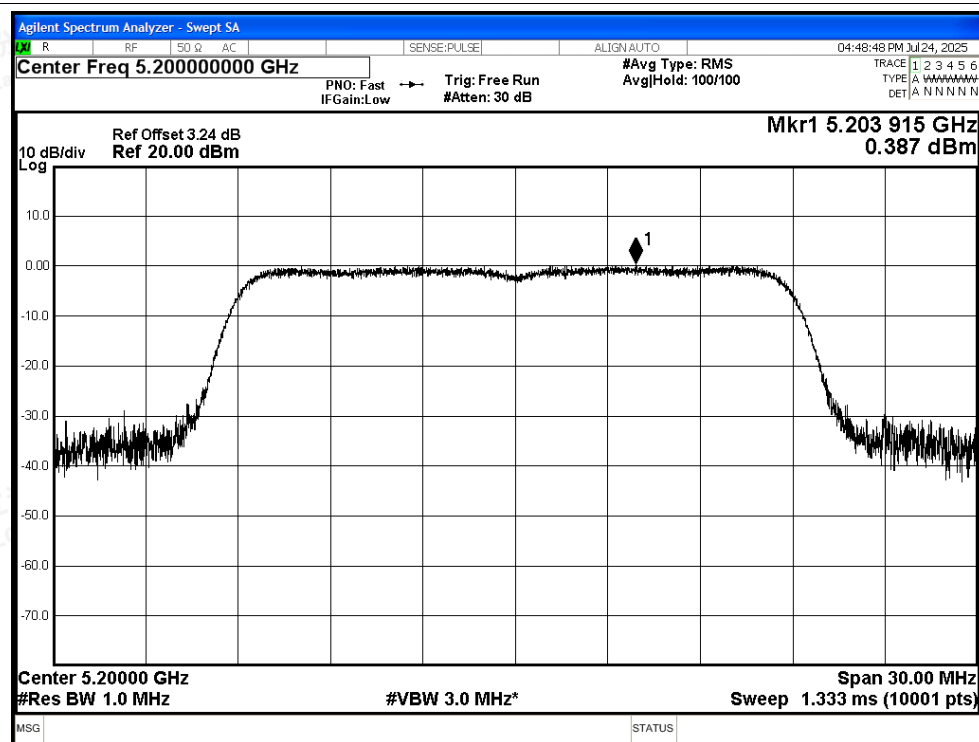

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant2

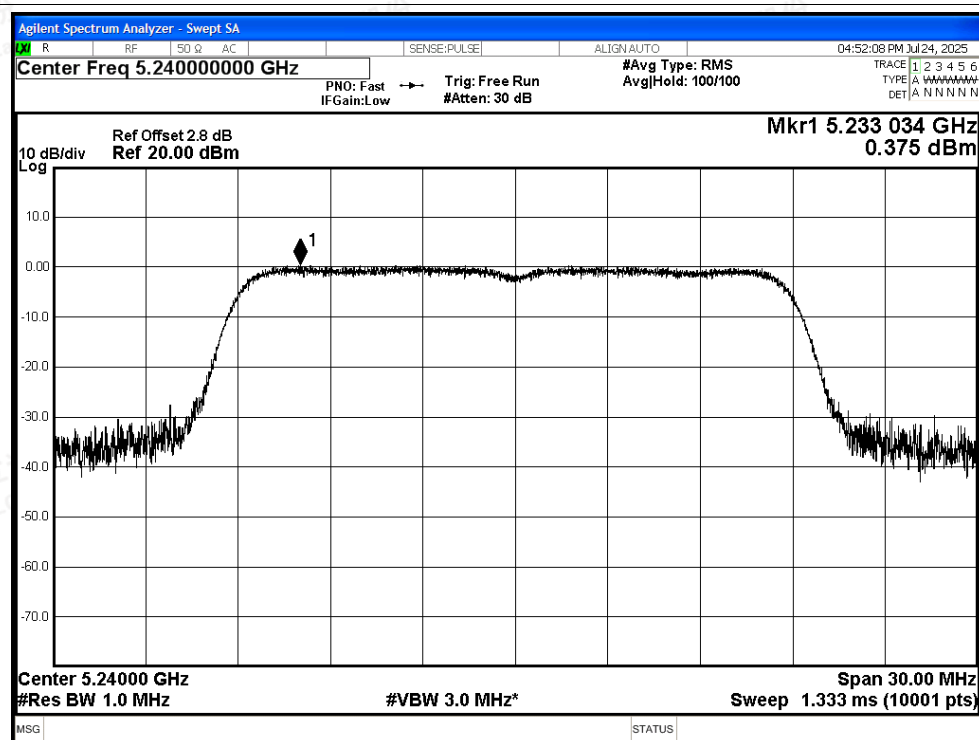

PSD NVNT ac40 5190MHz Ant2

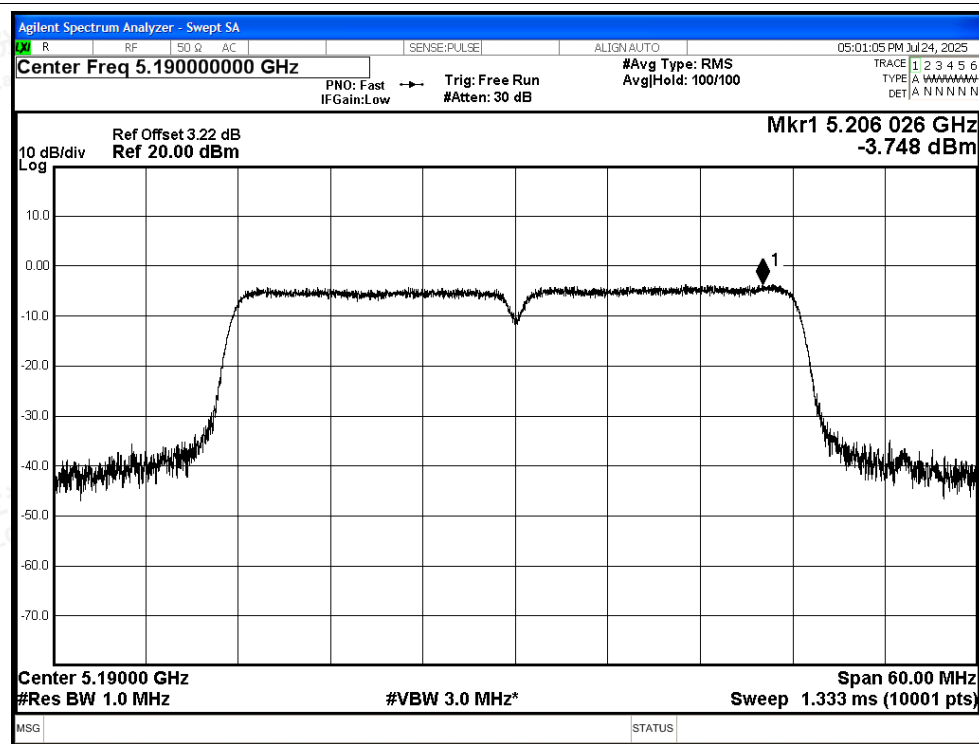

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




PSD NVNT ac40 5230MHz Ant2

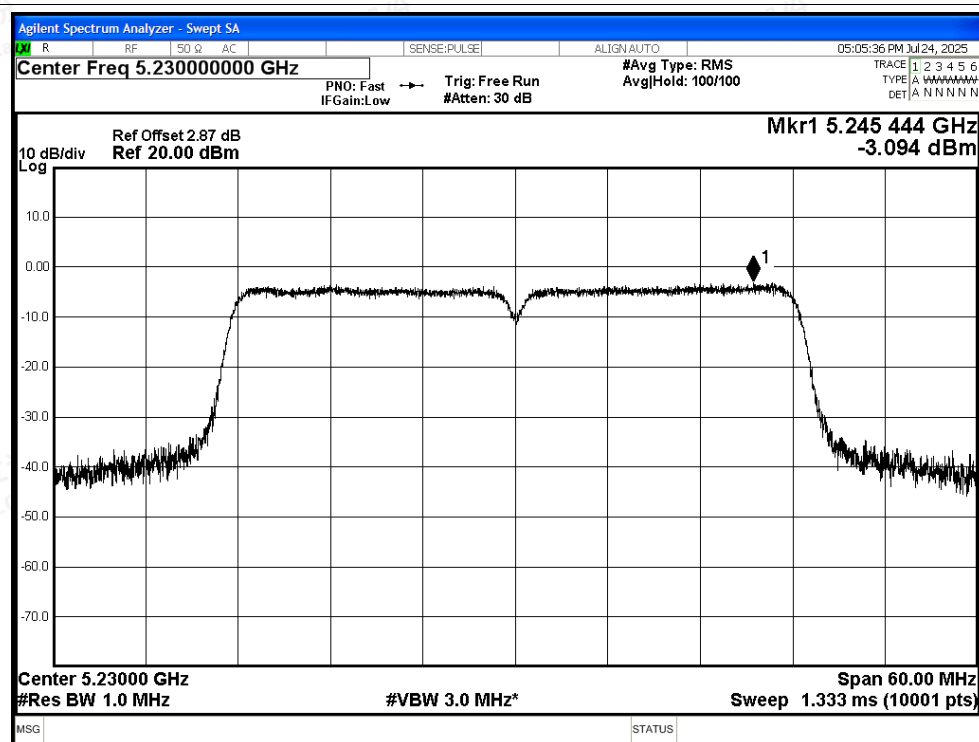

PSD NVNT ac80 5210MHz Ant2

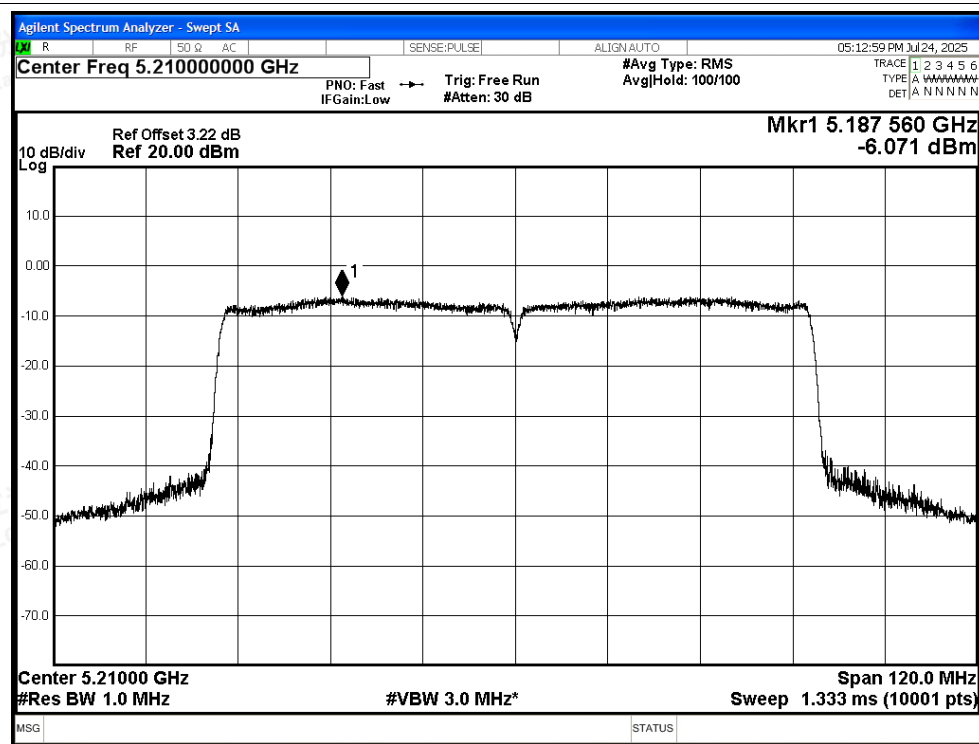





Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant2

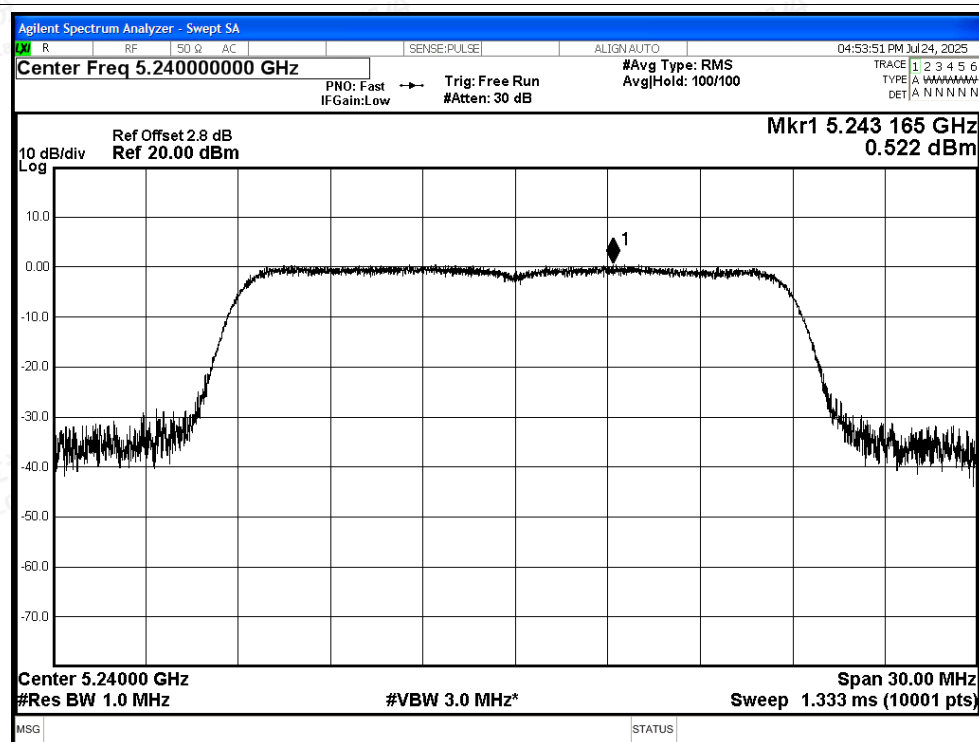

PSD NVNT ax40 5190MHz Ant2

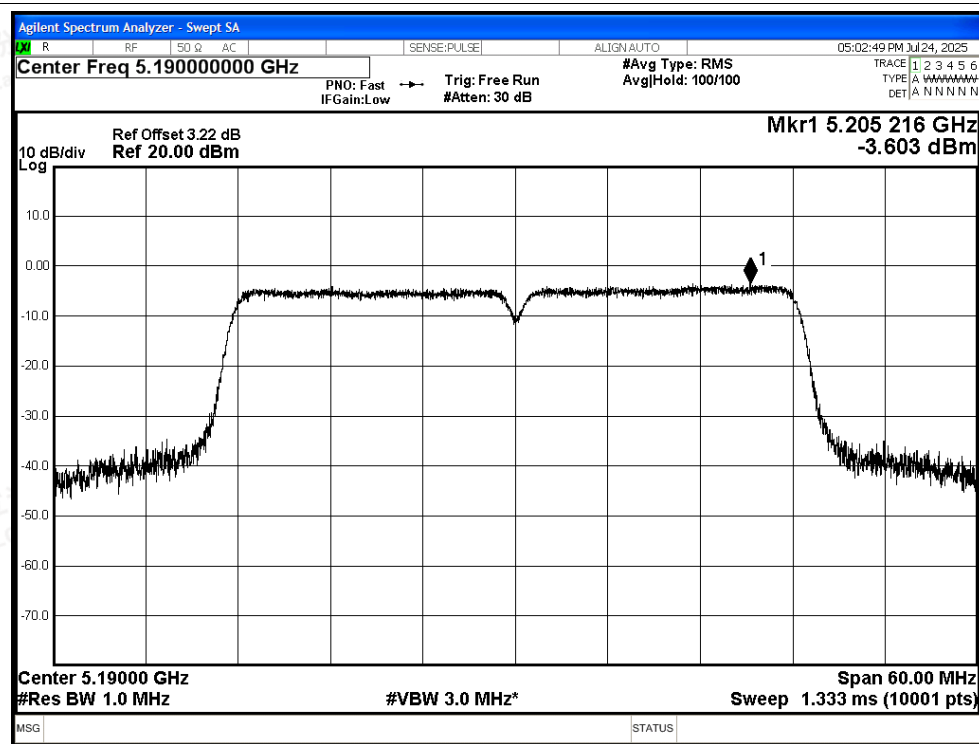

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant2

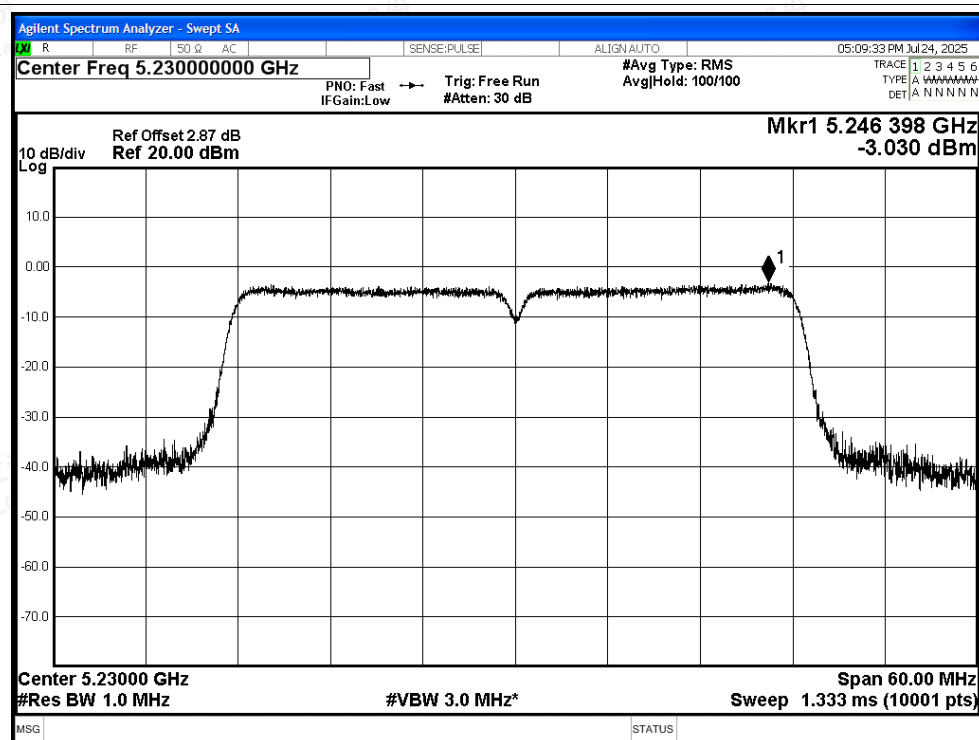

PSD NVNT ax80 5210MHz Ant2


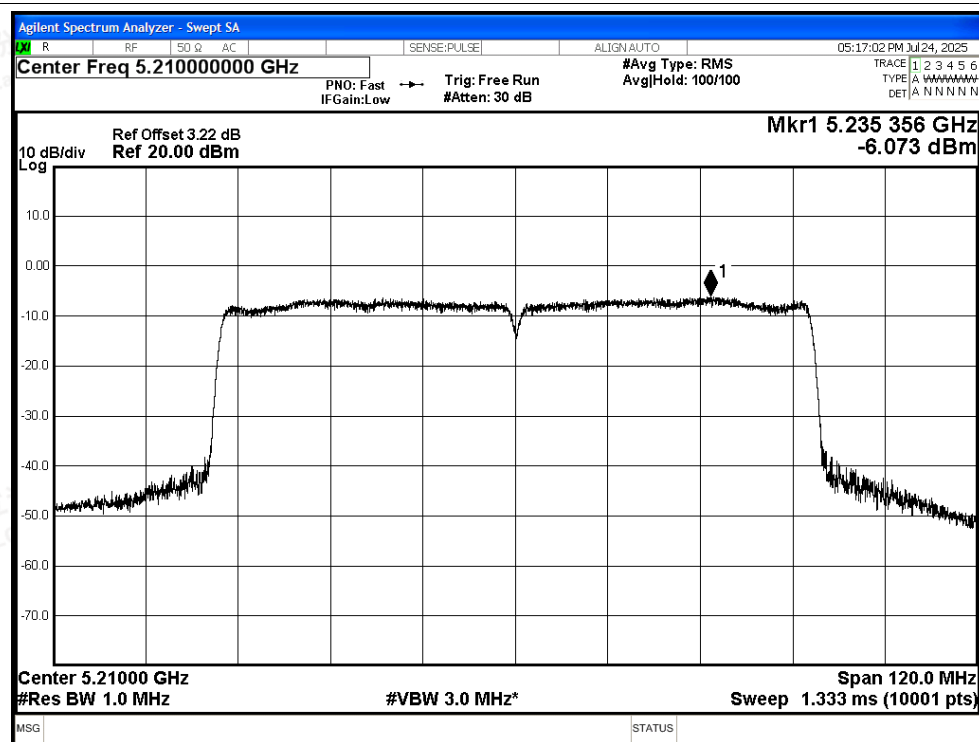


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

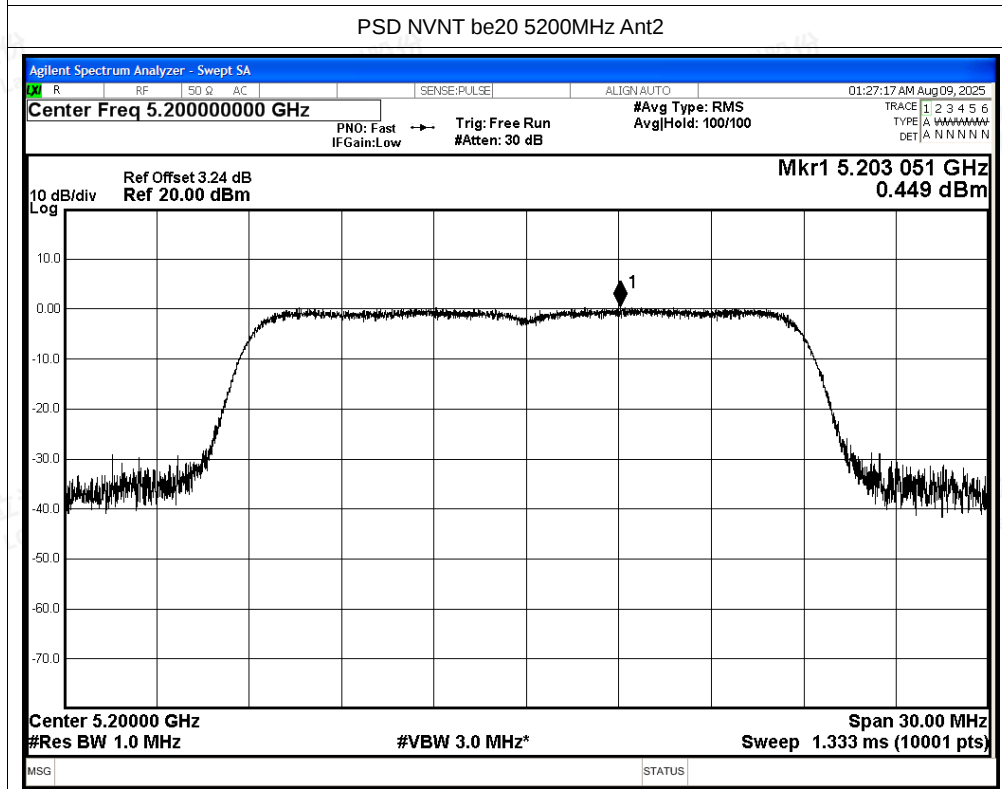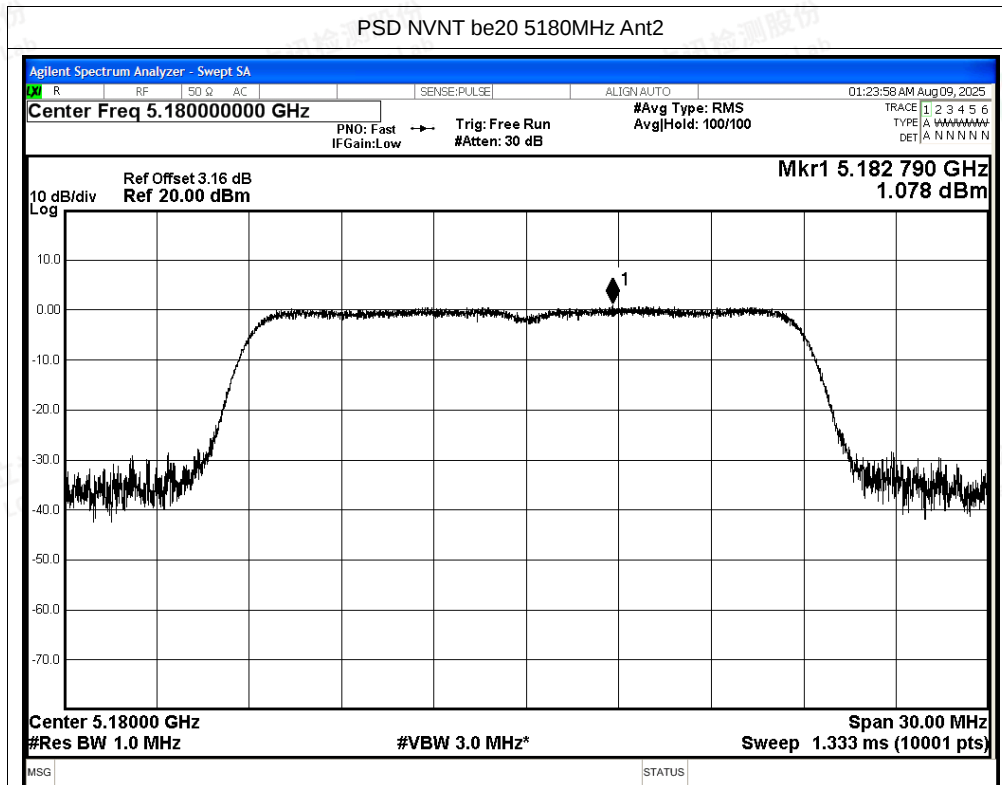

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5240MHz Ant2

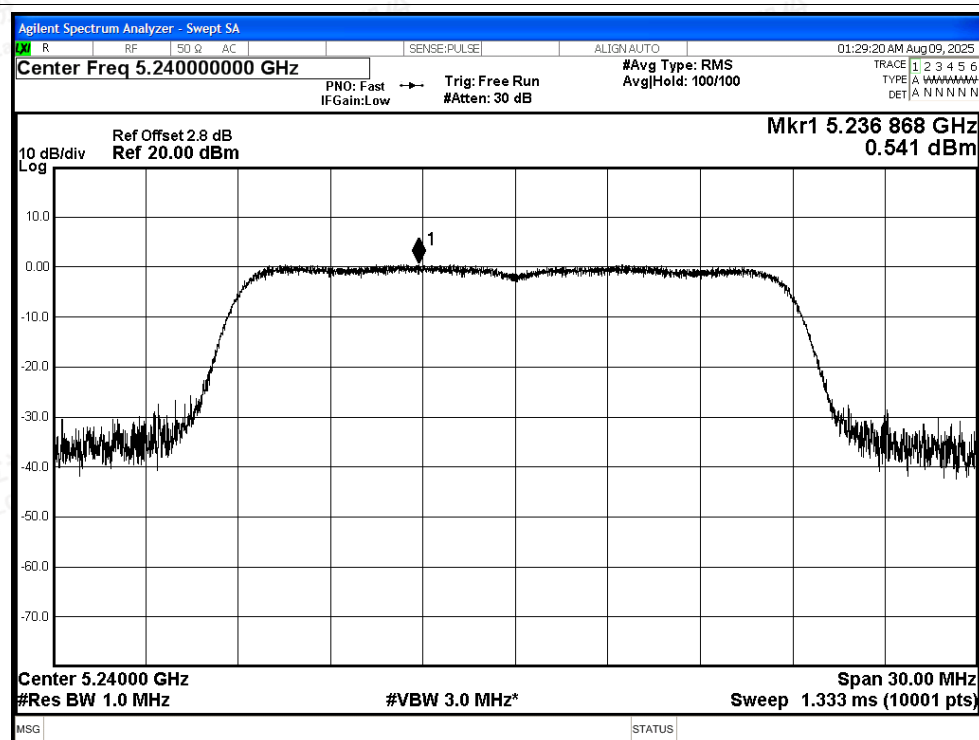

PSD NVNT be40 5190MHz Ant2

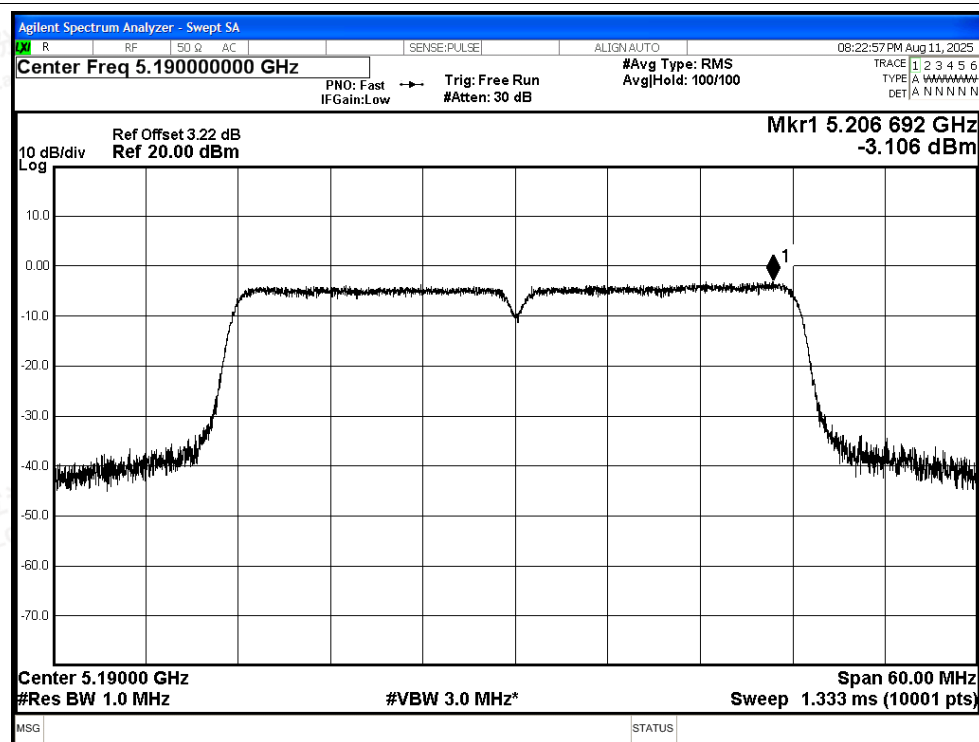

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5230MHz Ant2

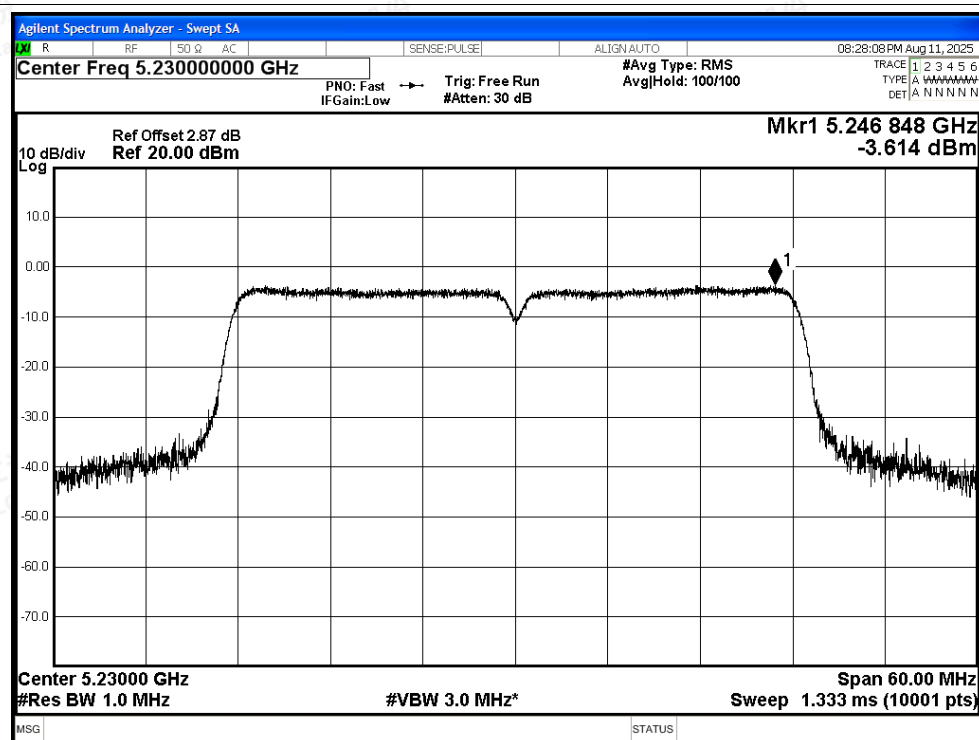

PSD NVNT be80 5210MHz Ant2

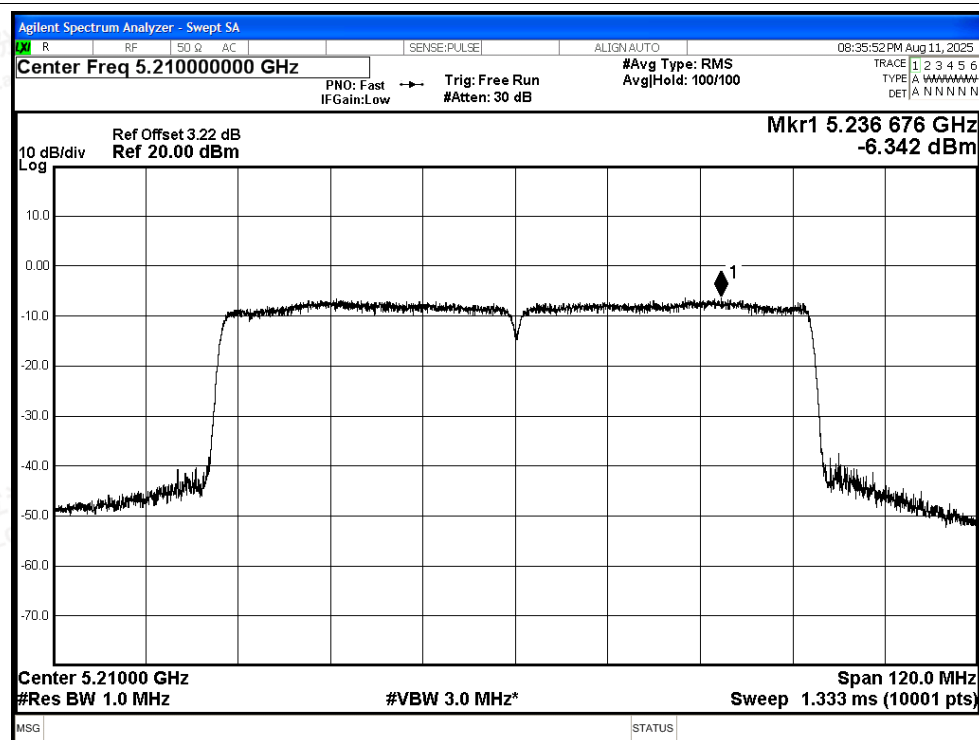

PSD NVNT ac160 5250MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

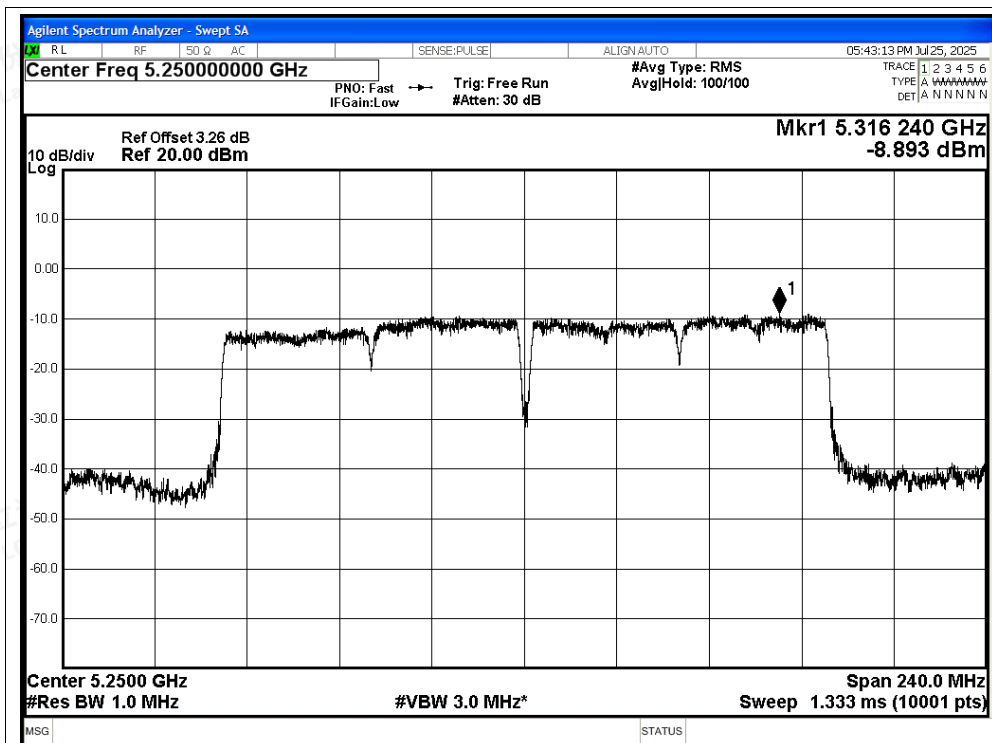

PSD NVNT ax160 5250MHz Ant2

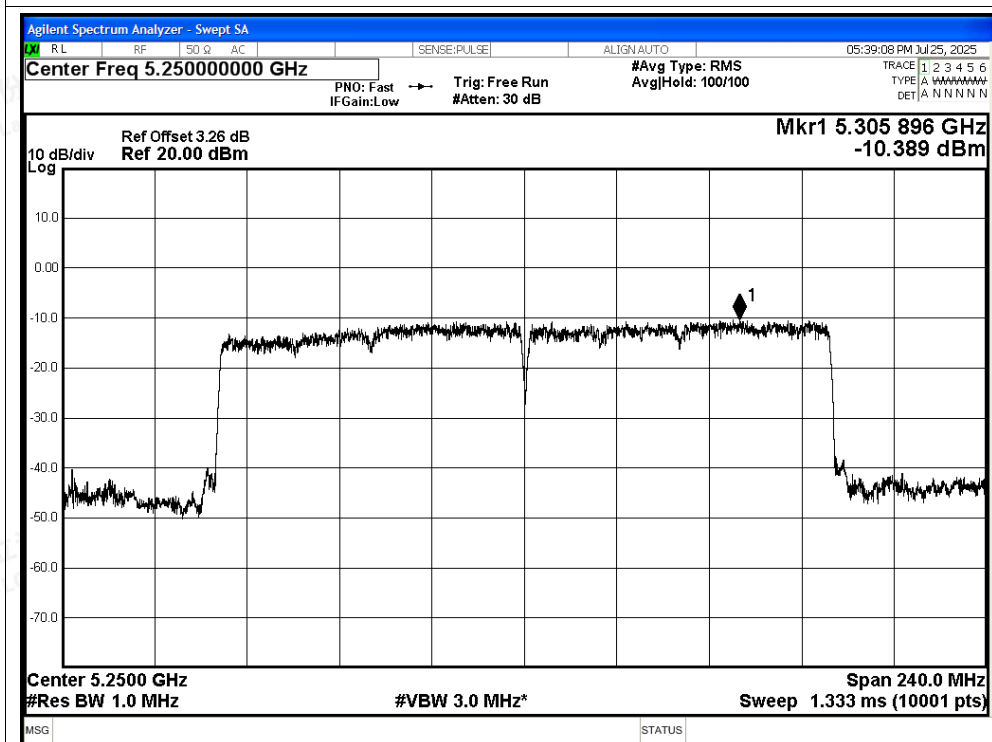

PSD NVNT be160 5250MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

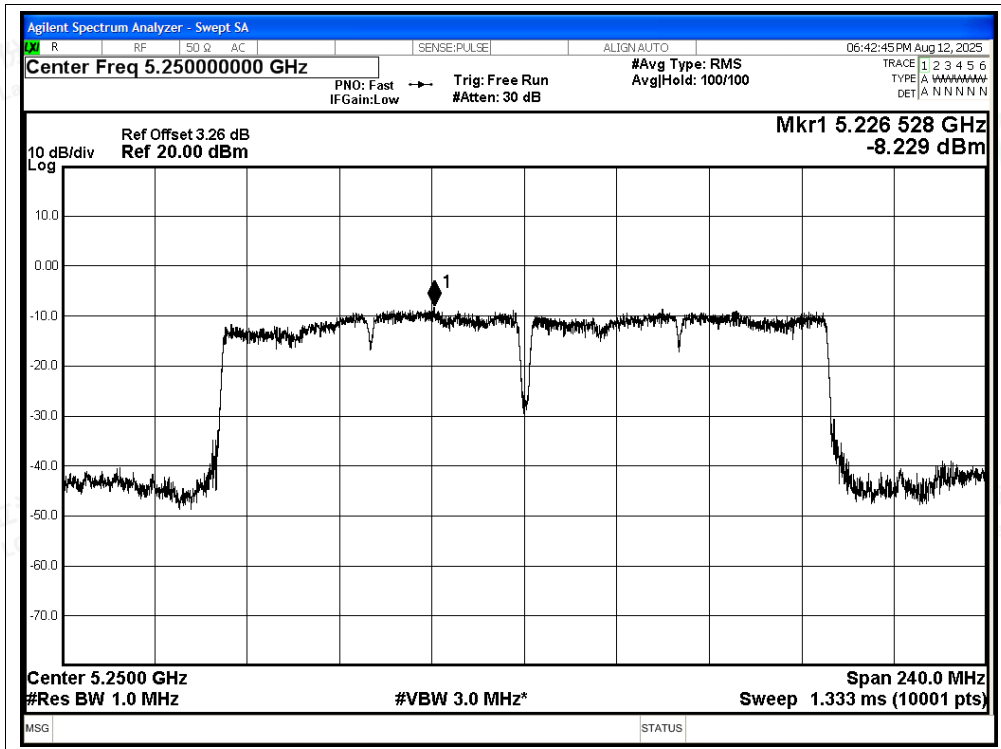




Test Graphs

PSD NVNT a 5180MHz Ant3

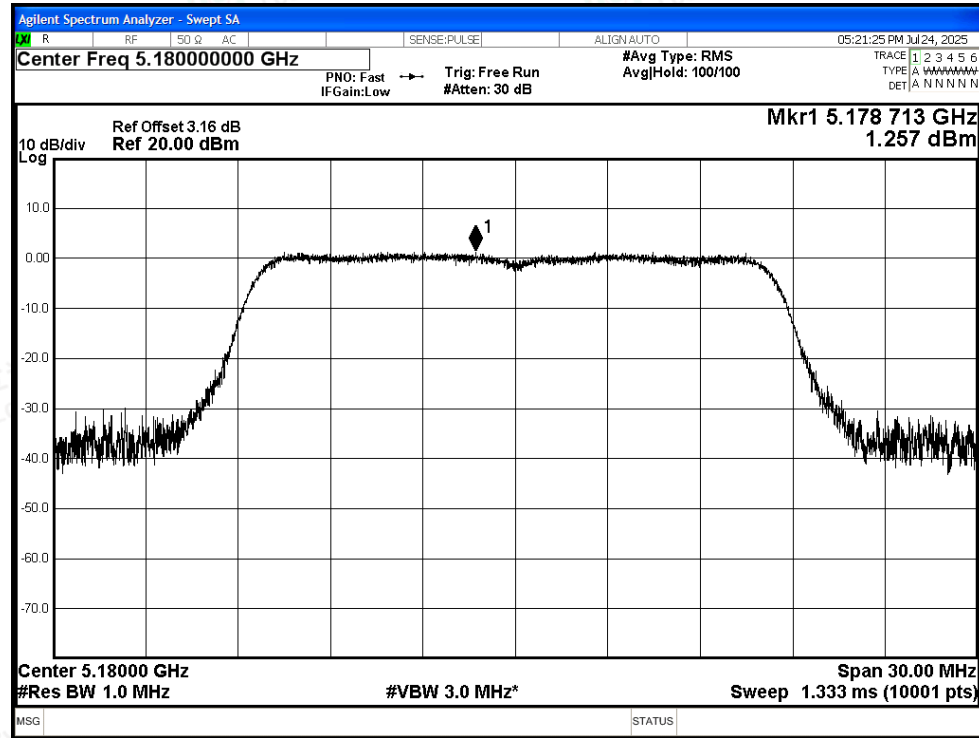

PSD NVNT a 5200MHz Ant3


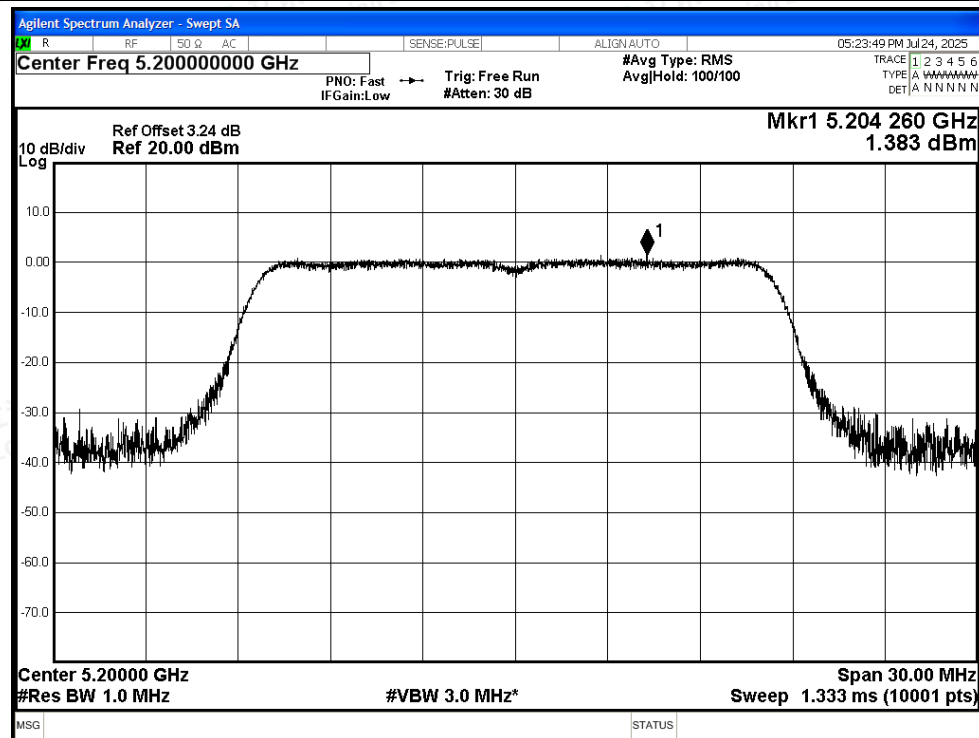




Shenzhen LCS Compliance Testing Laboratory Ltd.



Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

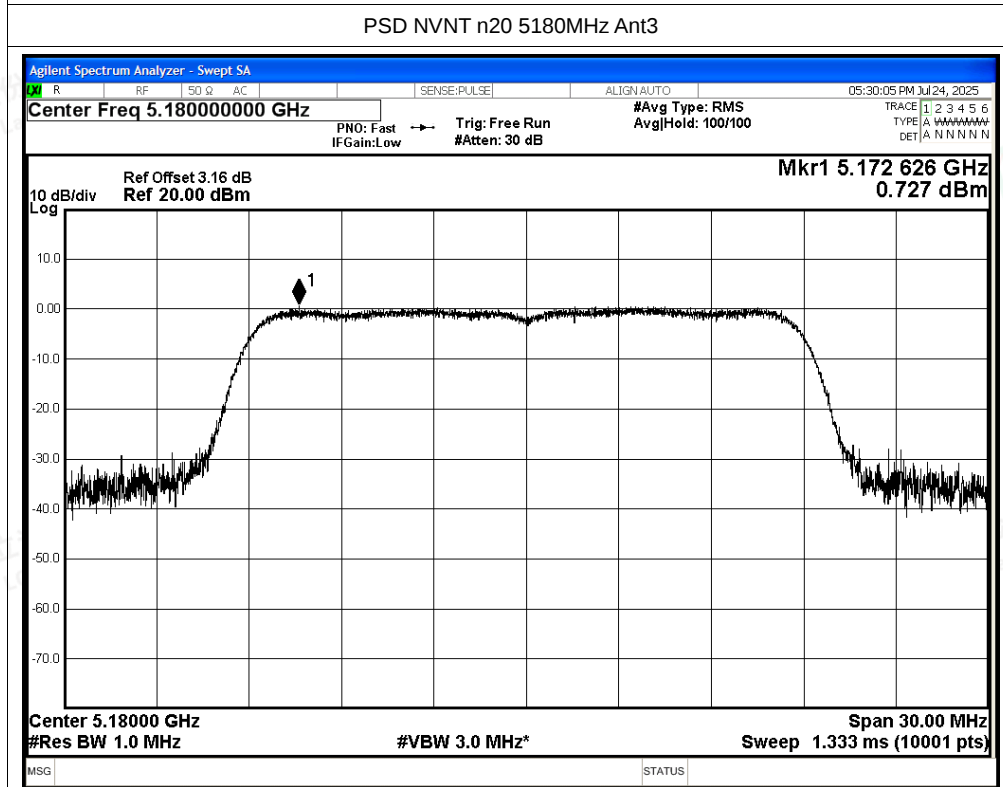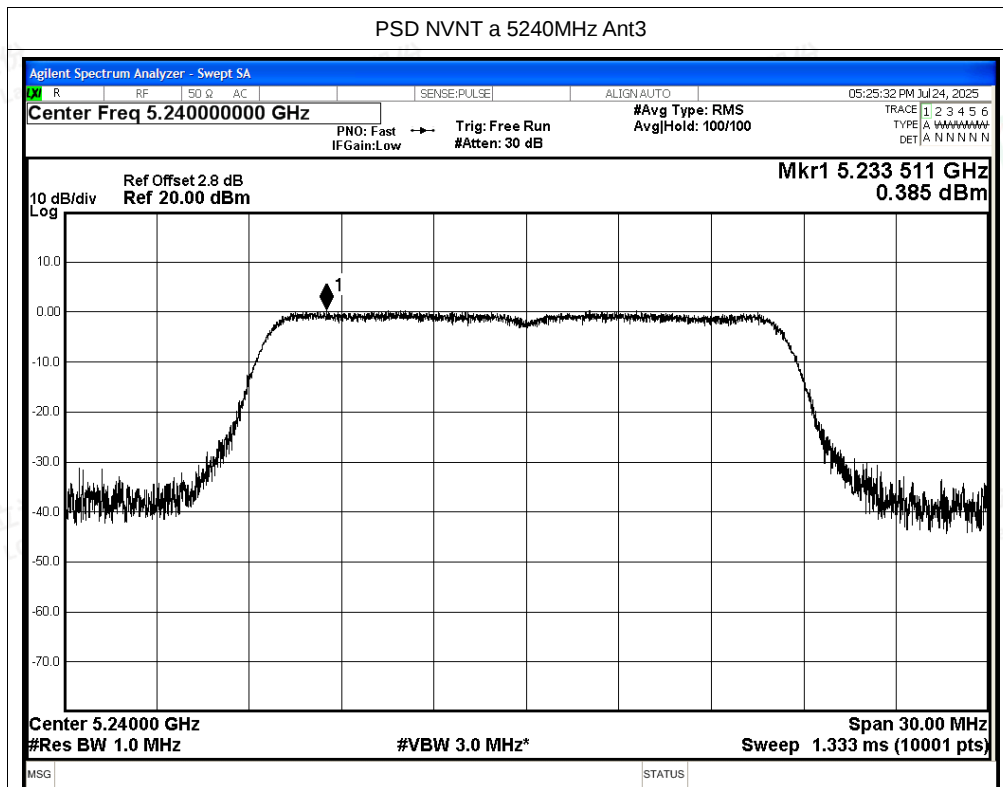

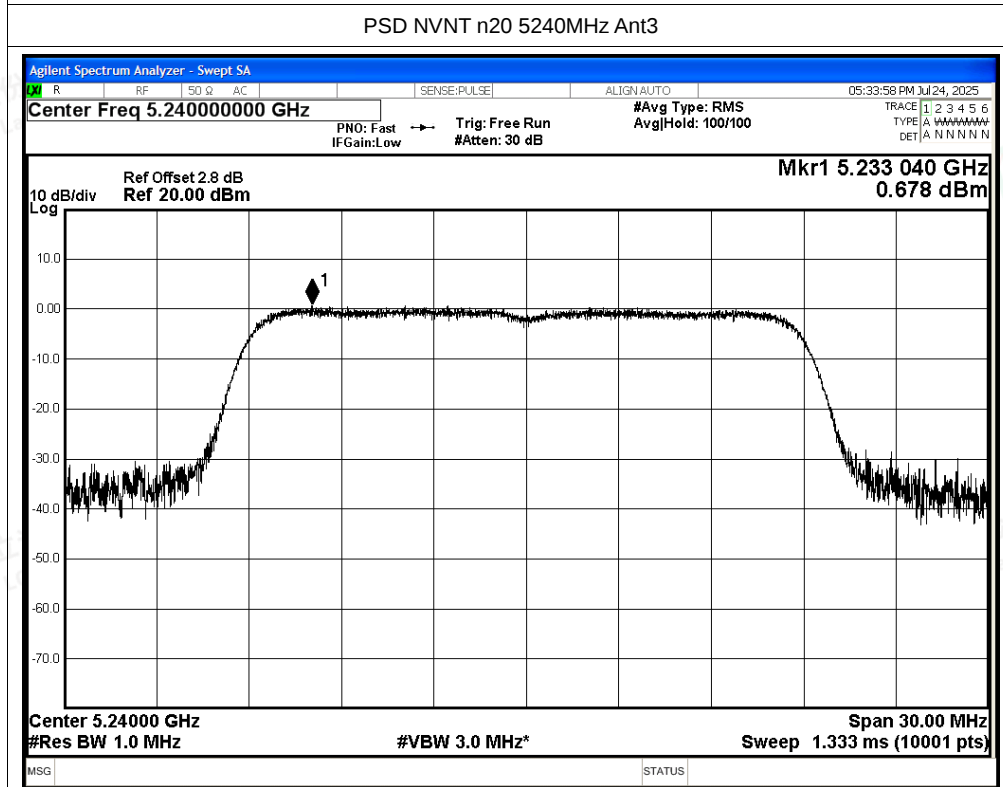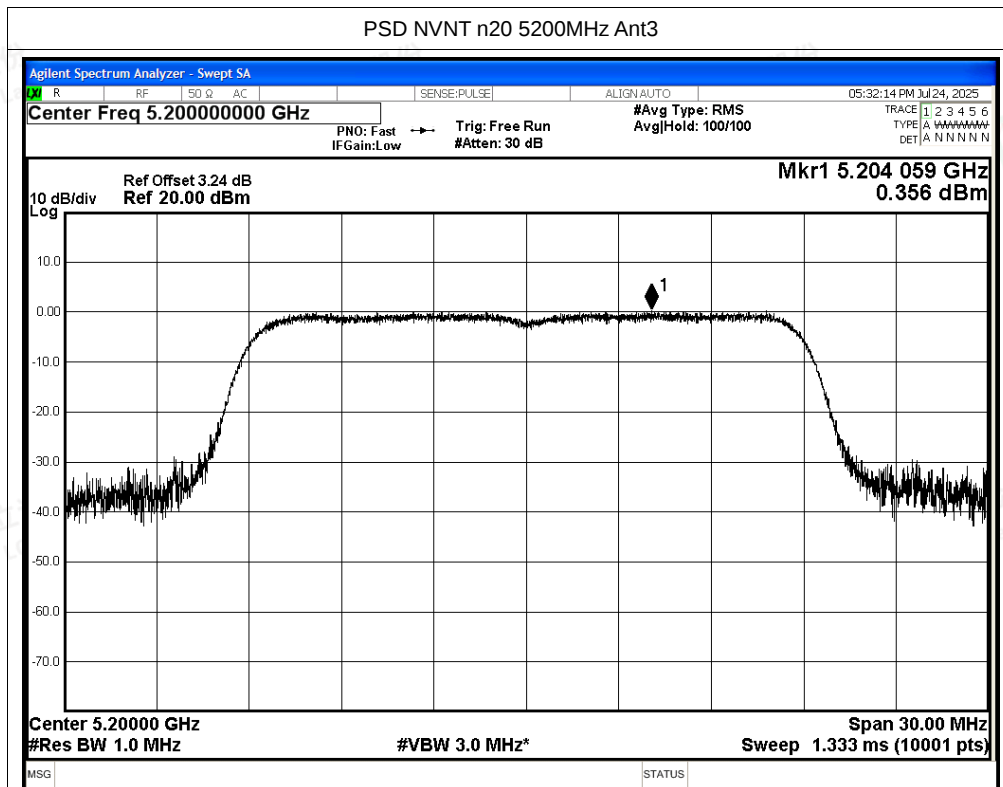

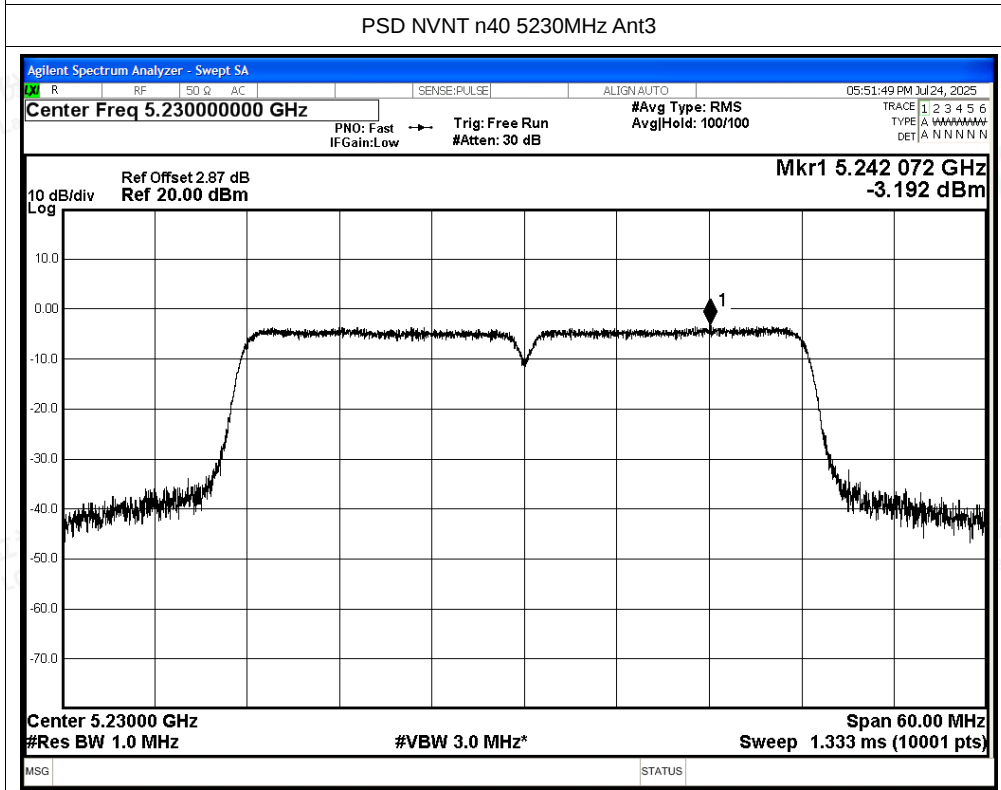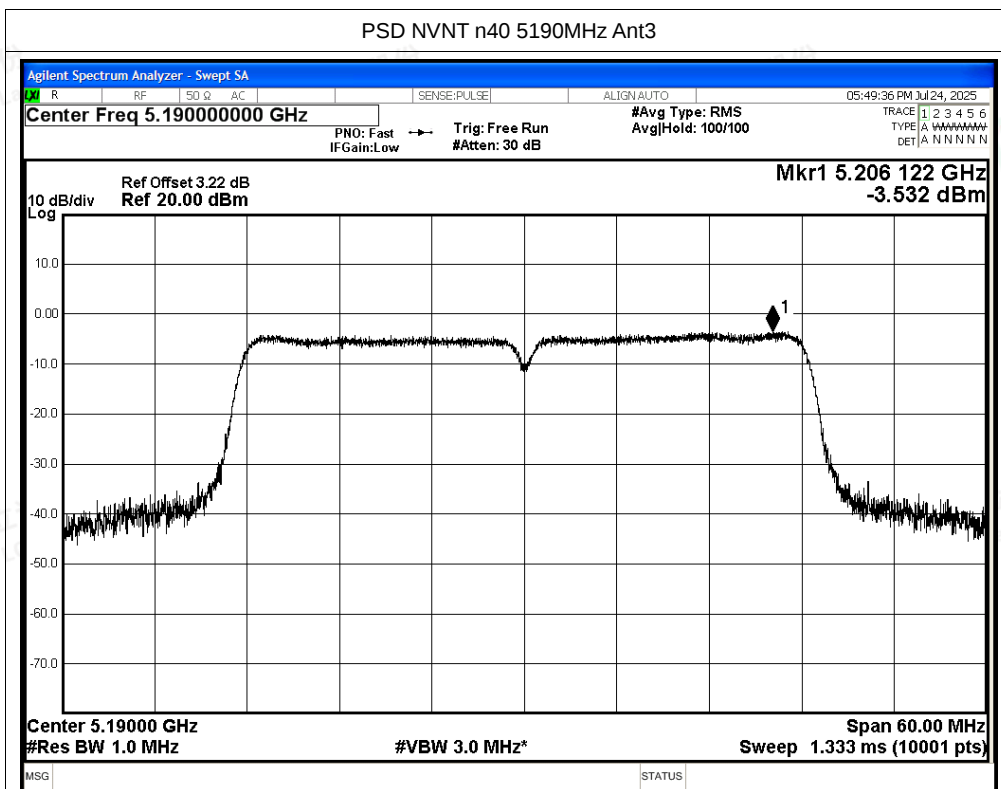

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant3

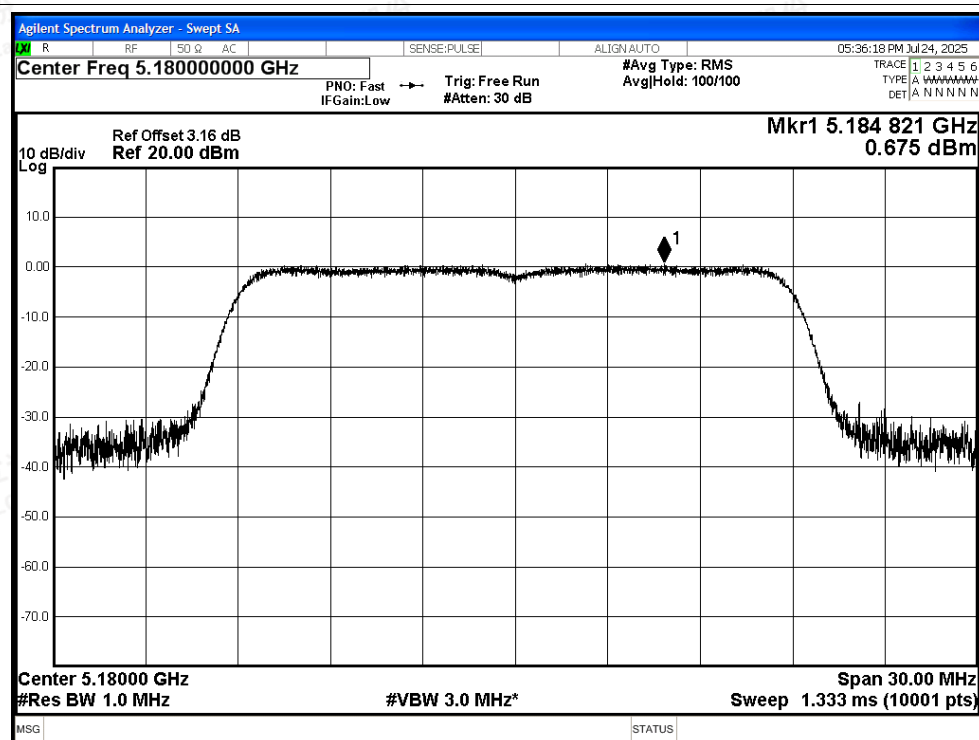

PSD NVNT ac20 5200MHz Ant3

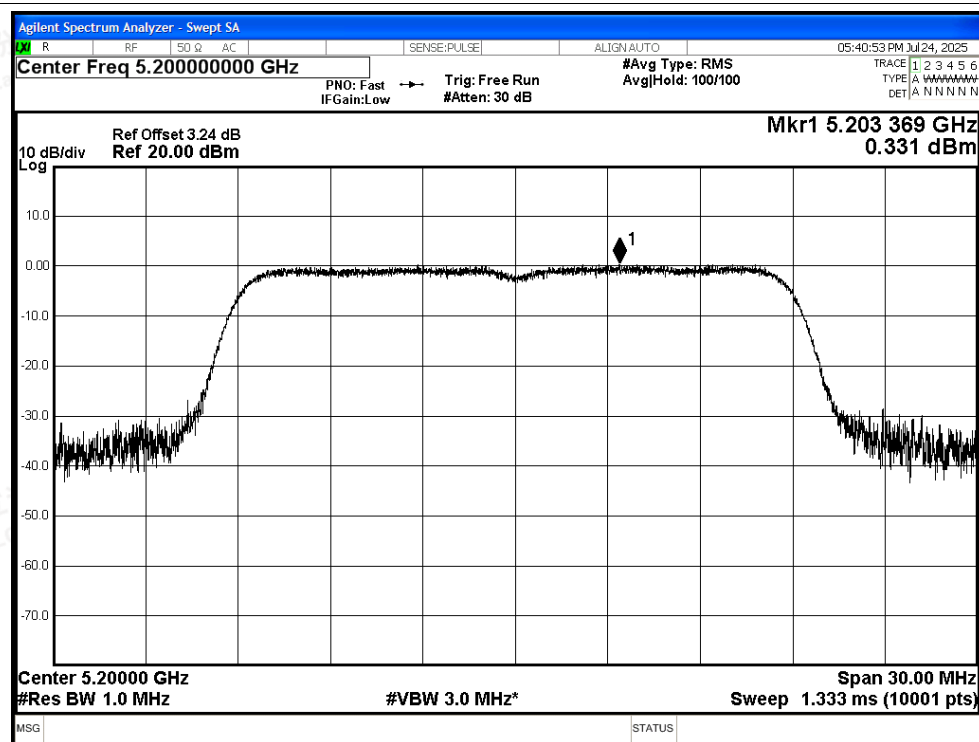

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant3

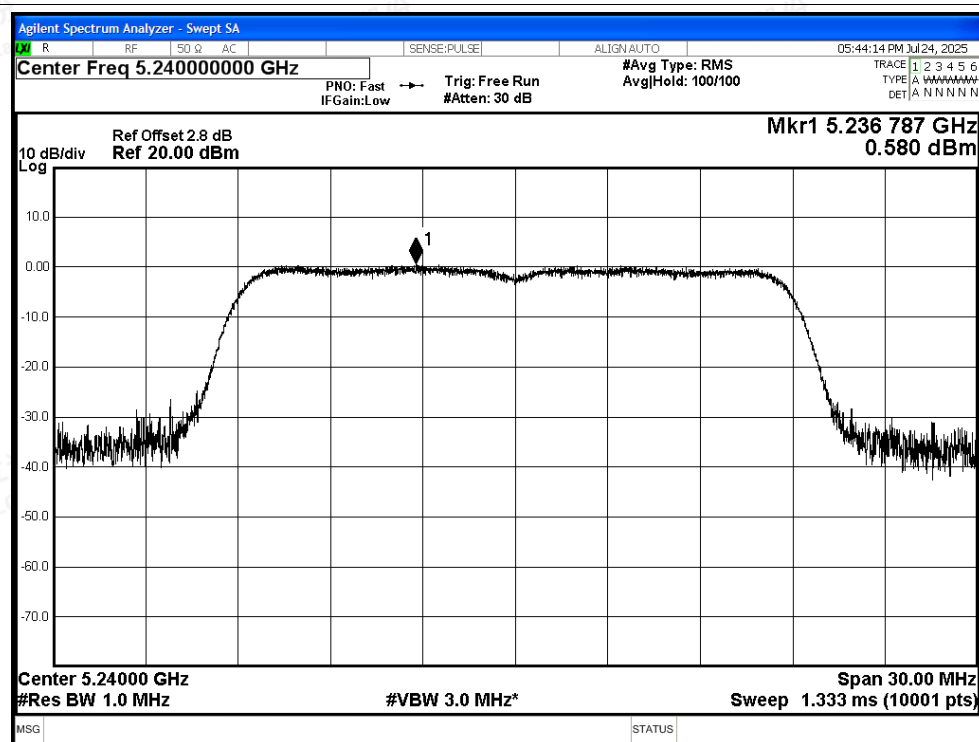

PSD NVNT ac40 5190MHz Ant3

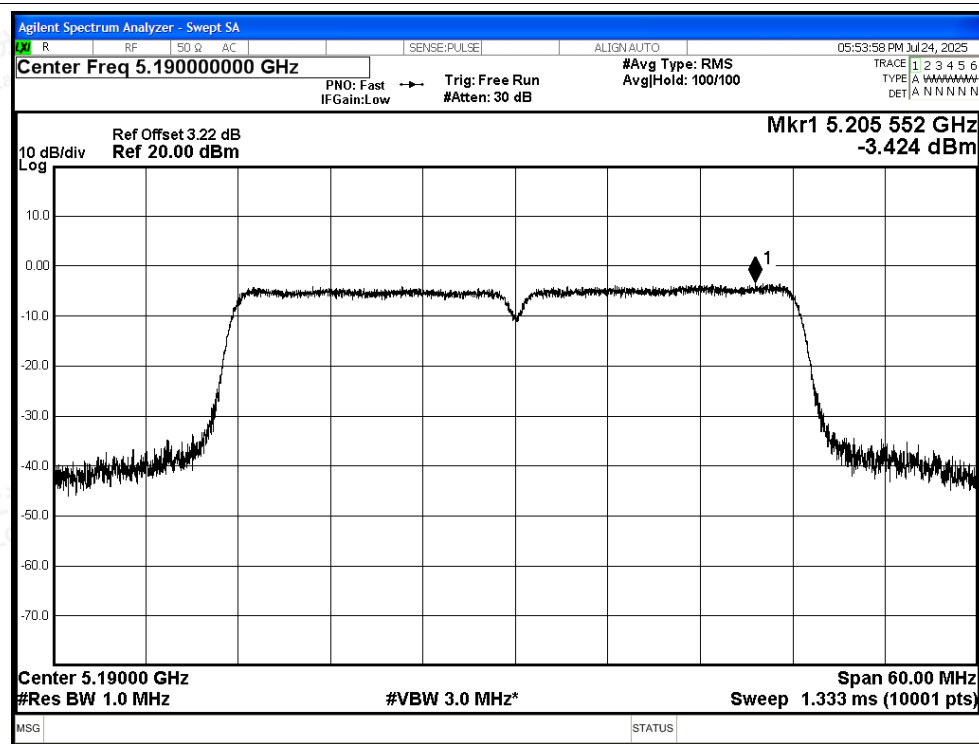

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant3

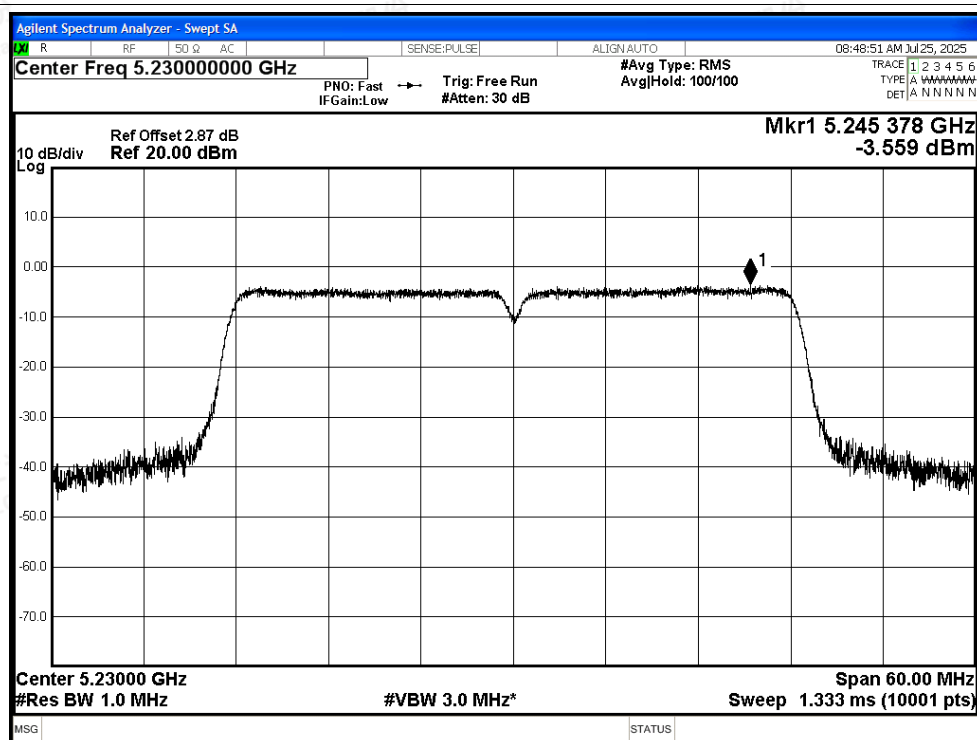

PSD NVNT ac80 5210MHz Ant3

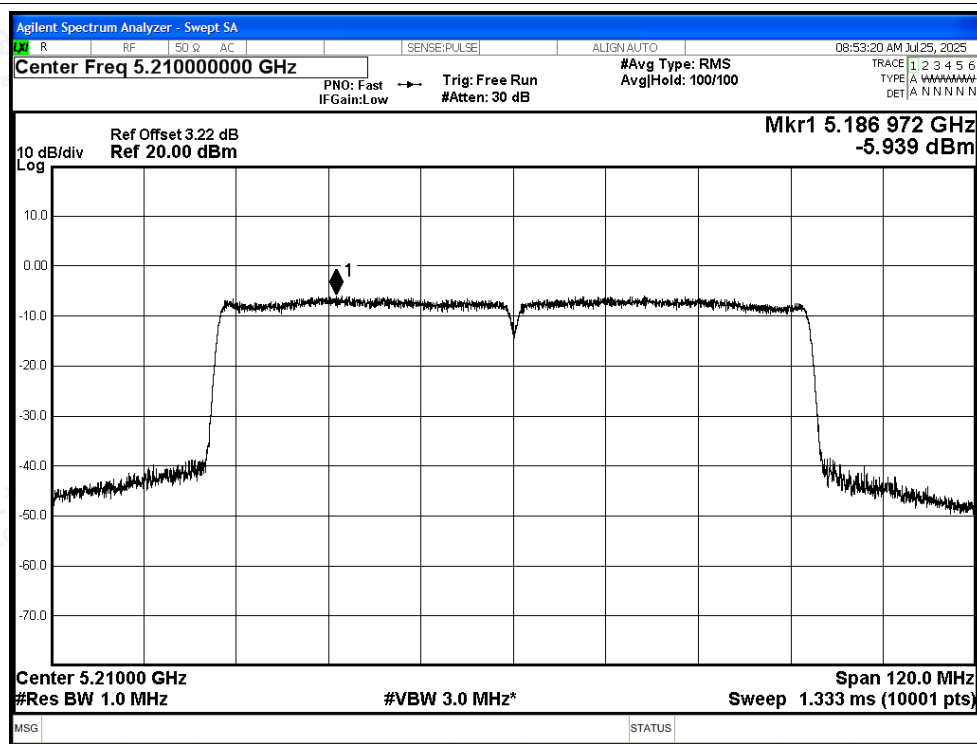

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5180MHz Ant3

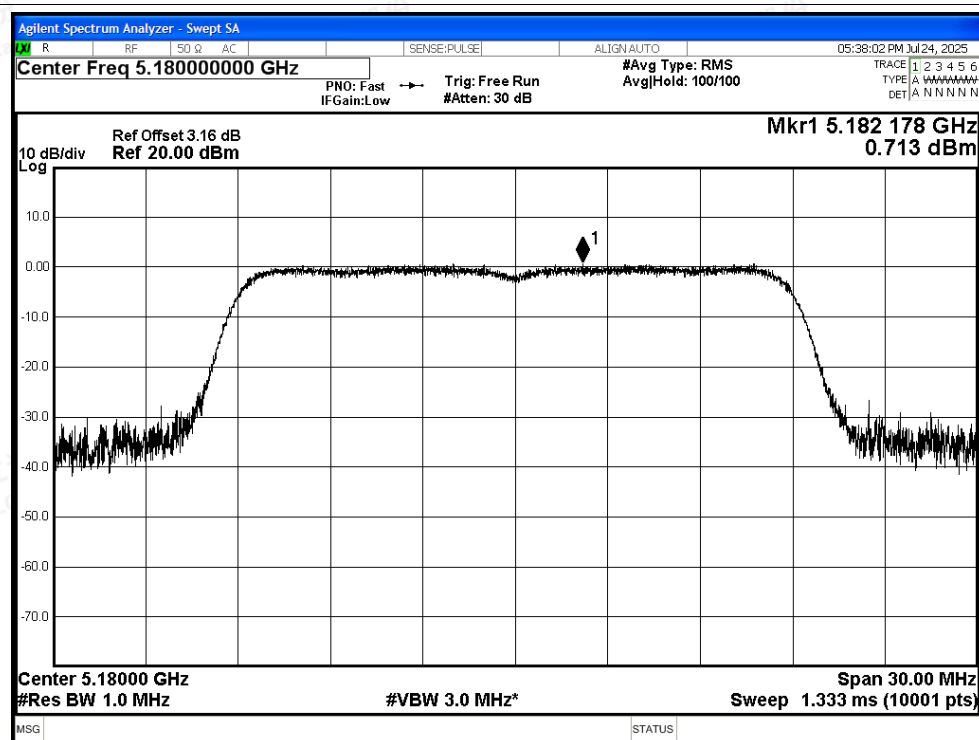

PSD NVNT ax20 5200MHz Ant3

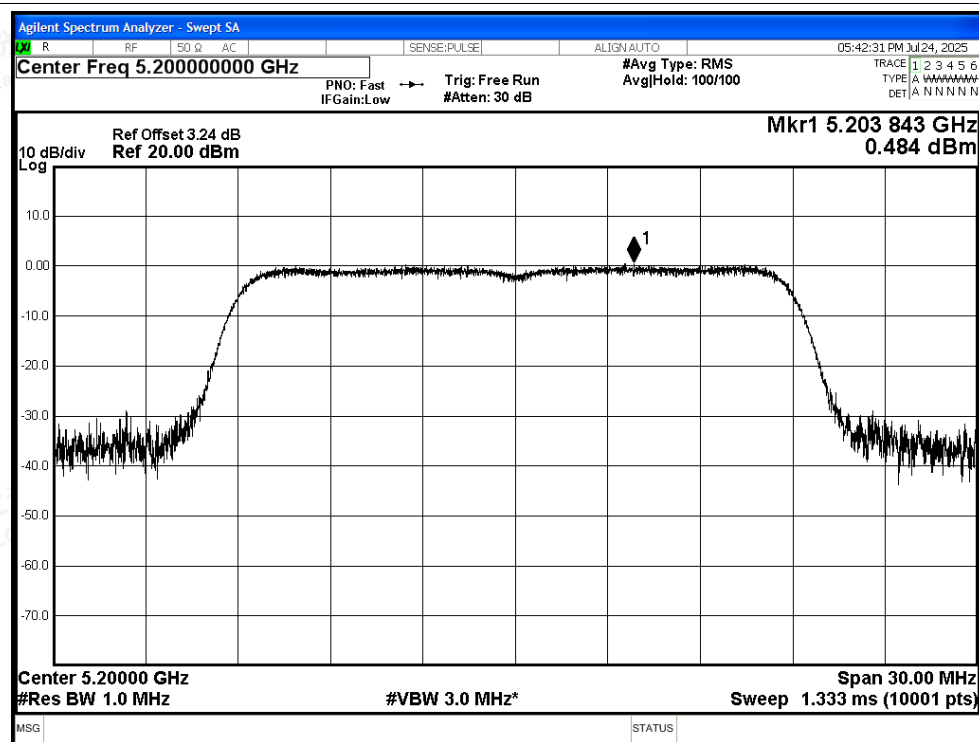

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant3

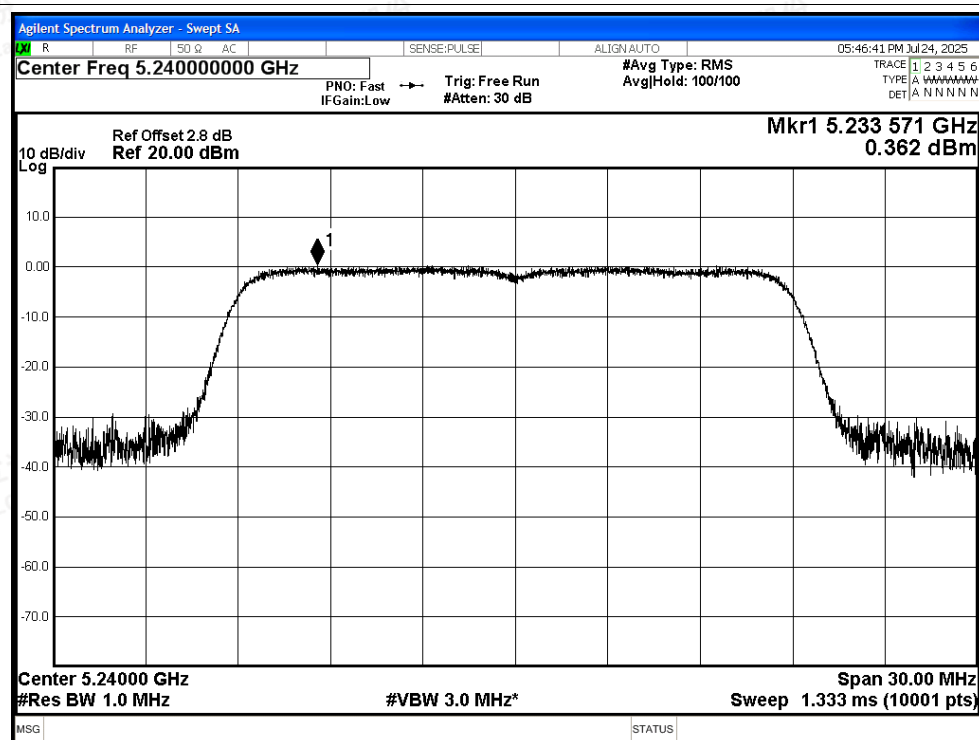

PSD NVNT ax40 5190MHz Ant3

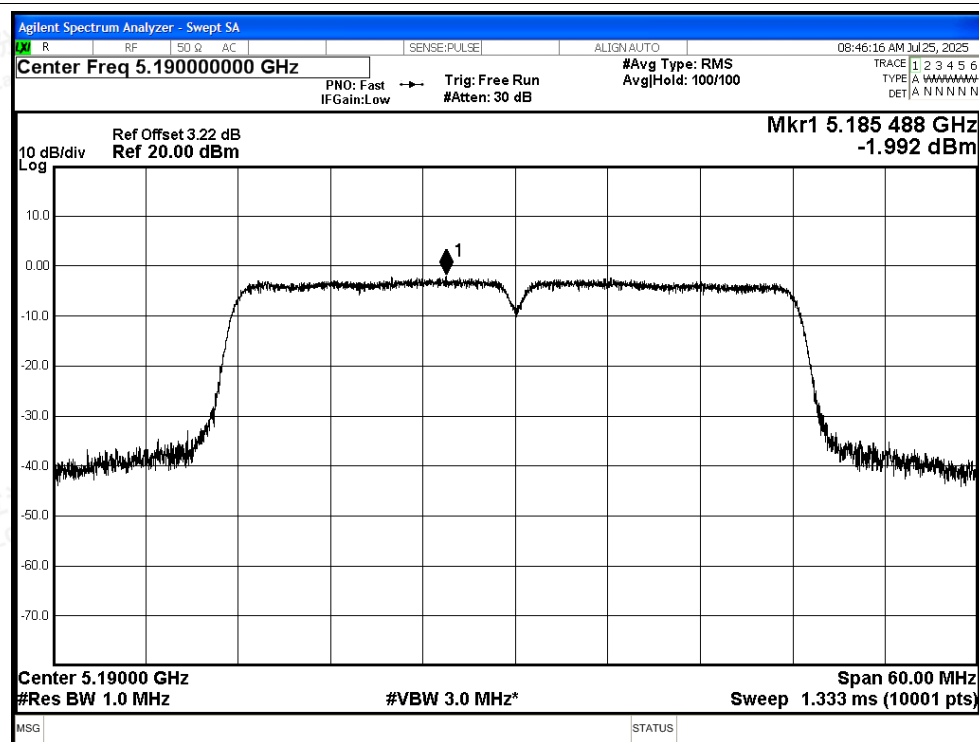

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant3

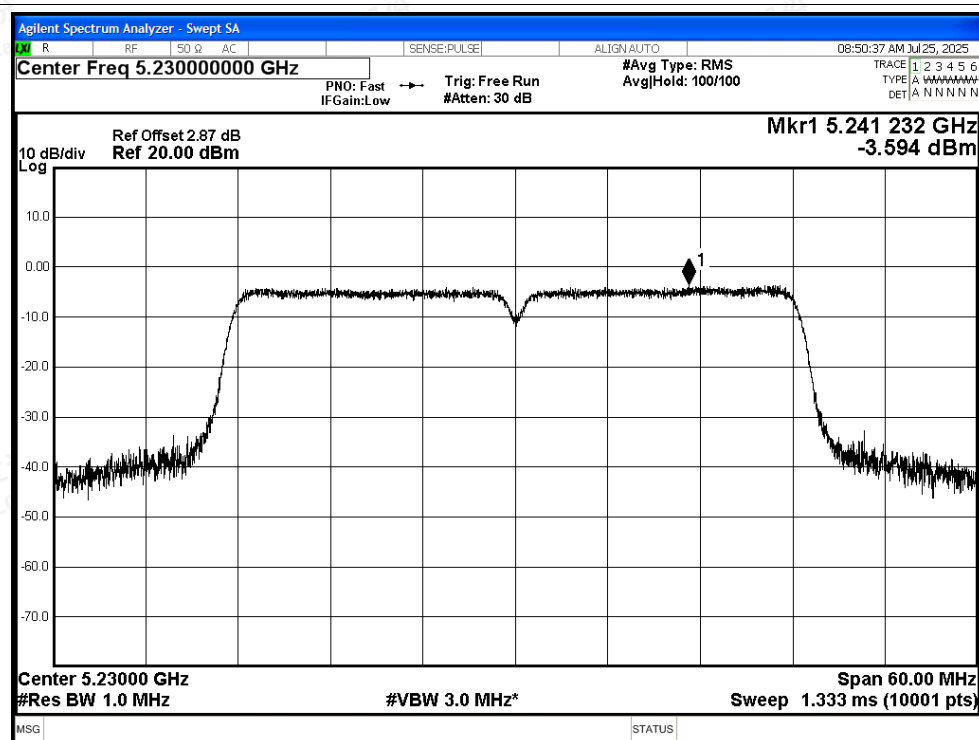

PSD NVNT ax80 5210MHz Ant3

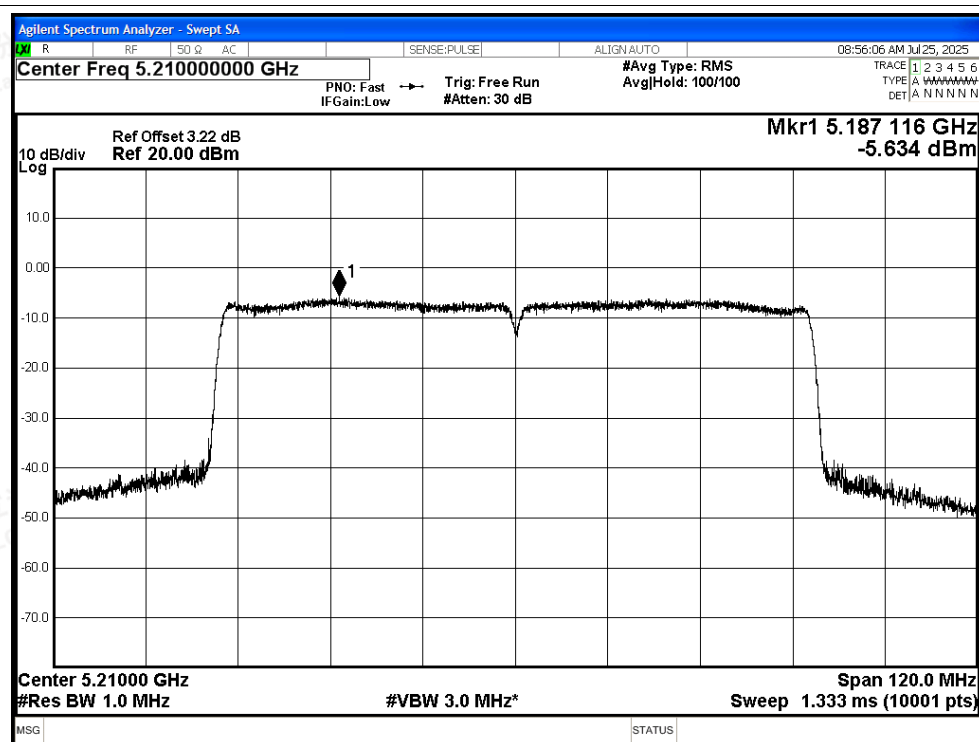

PSD NVNT be20 5180MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

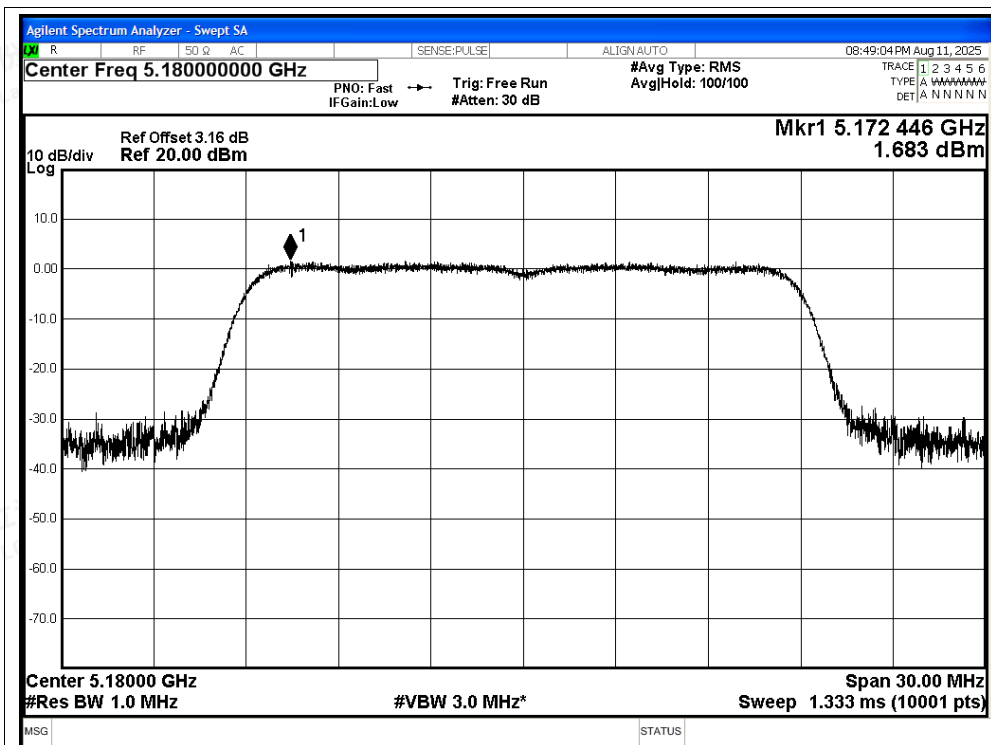

PSD NVNT be20 5200MHz Ant3

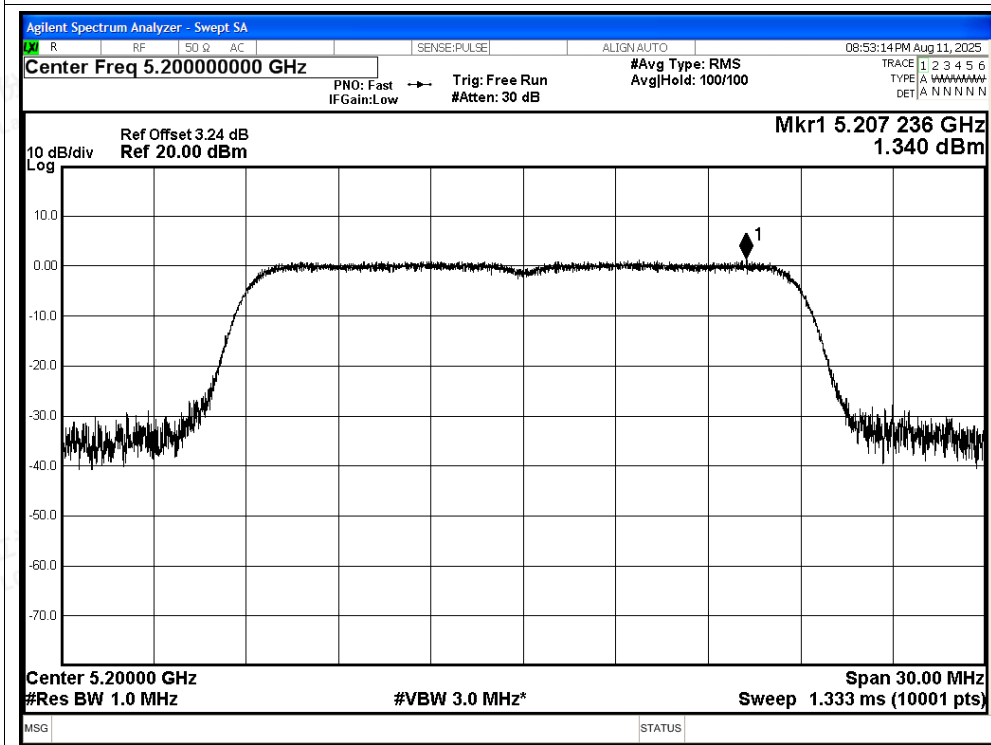

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5240MHz Ant3

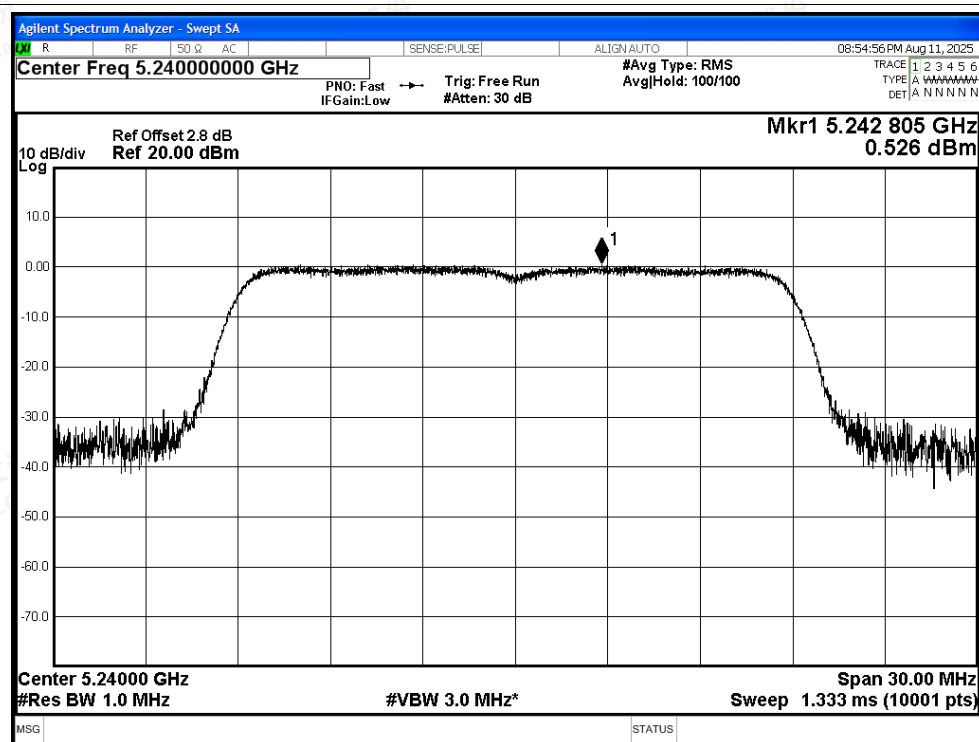

PSD NVNT be40 5190MHz Ant3

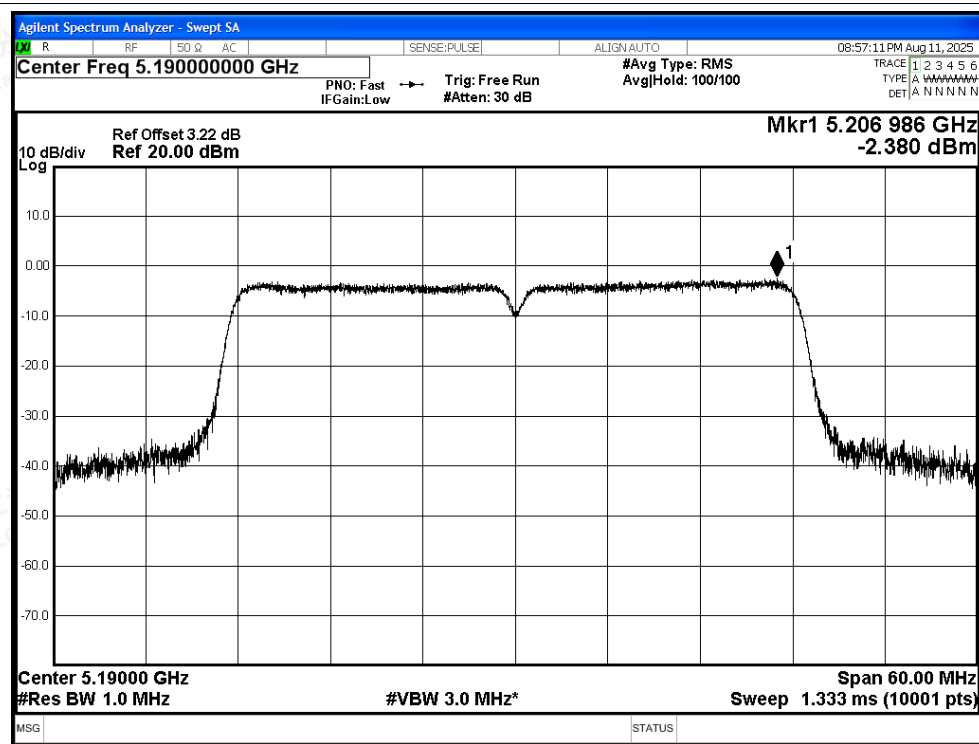

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5230MHz Ant3


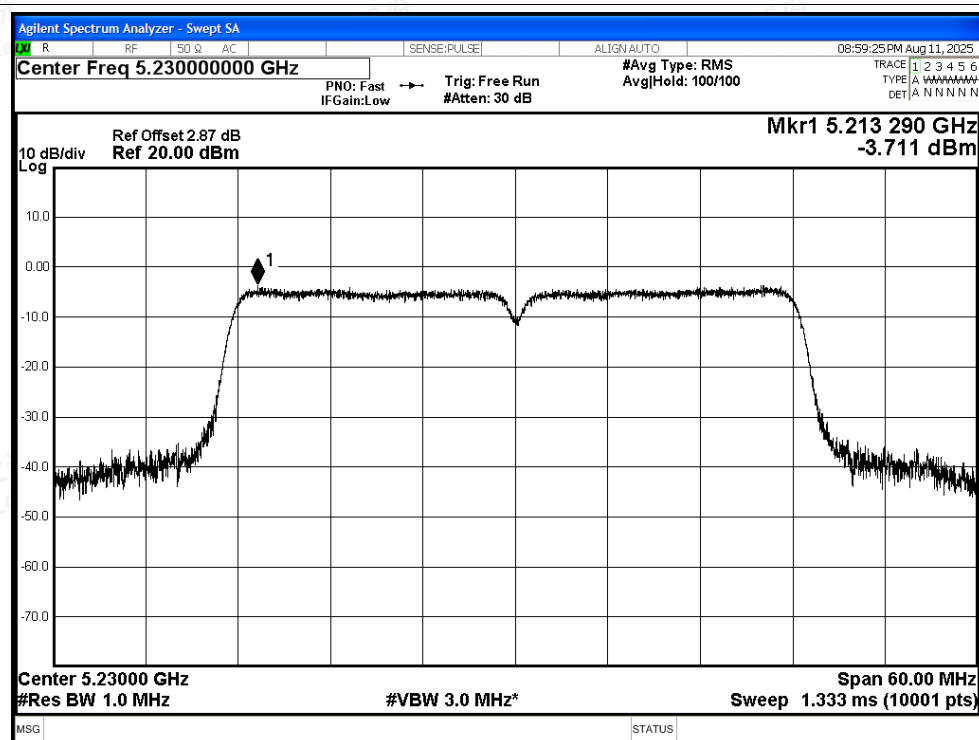



PSD NVNT be80 5210MHz Ant3

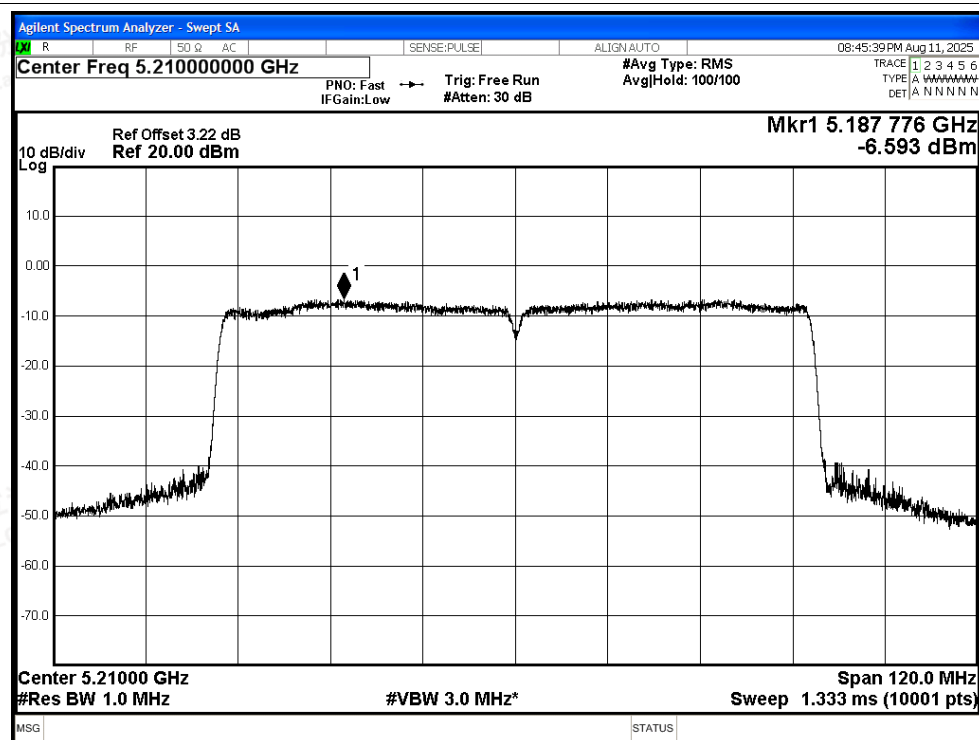

PSD NVNT ac160 5250MHz Ant3



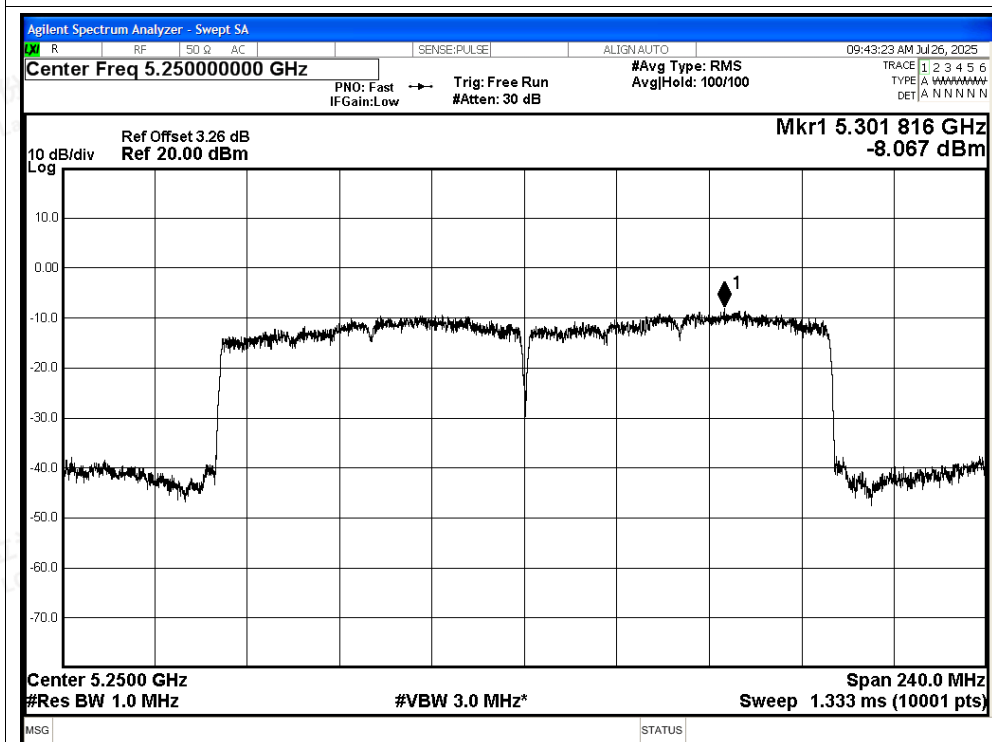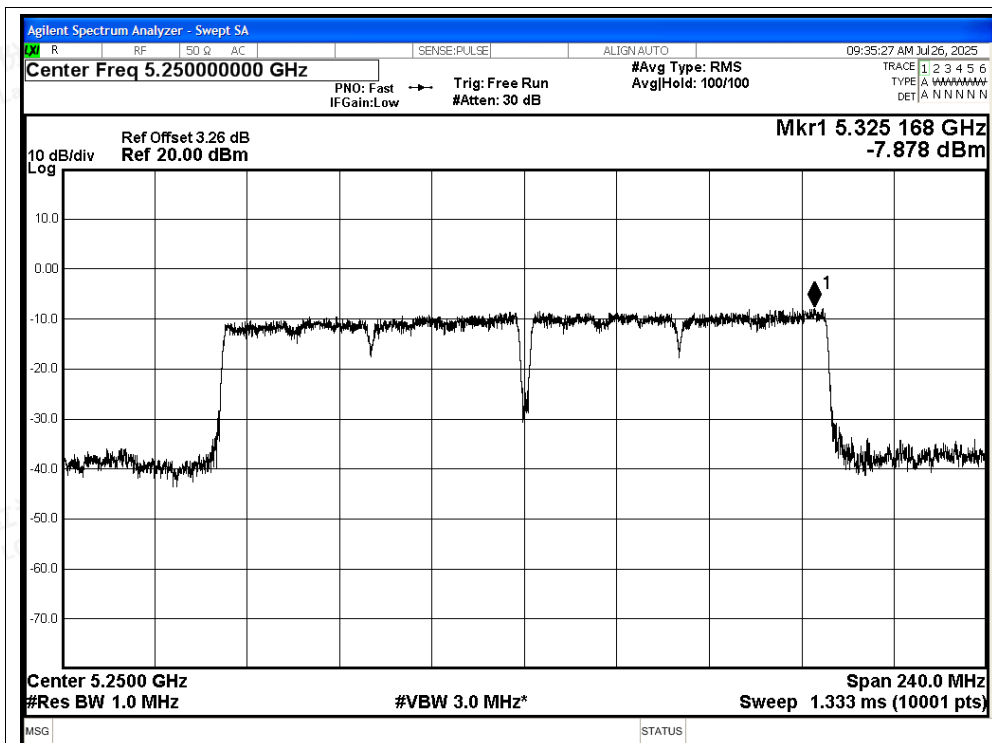

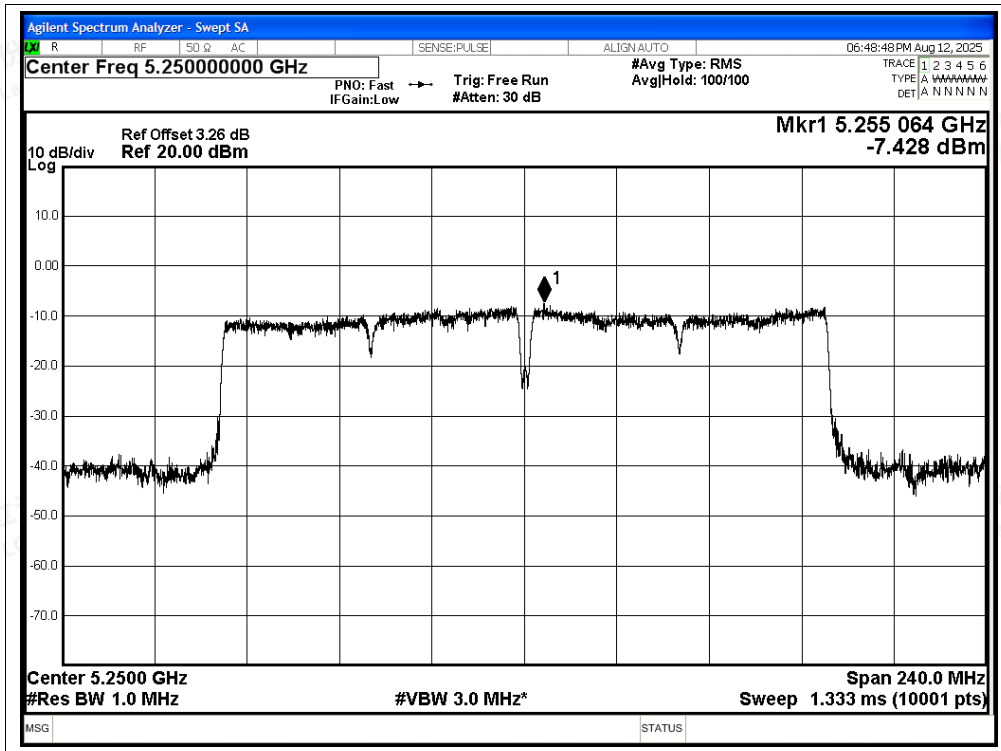

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-49.3	4.15	-	50.08	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-58.42	4.15	0.24	41.20	Average	54	Pass
NVNT	a	5180	Ant1	5056.5	-46.3	4.15	-	53.08	Peak	68.2	Pass
NVNT	a	5180	Ant1	5147.5	-56.32	4.15	0.24	43.30	Average	54	Pass
NVNT	a	5180	Ant1	5150	-47.67	4.15	-	51.71	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-56.28	4.15	0.24	43.34	Average	54	Pass
NVNT	a	5240	Ant1	5350	-51.42	4.15	-	47.96	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-57.96	4.15	0.24	41.66	Average	54	Pass
NVNT	a	5240	Ant1	5372.64	-46.65	4.15	-	52.73	Peak	68.2	Pass
NVNT	a	5240	Ant1	5421.36	-57.47	4.15	0.24	42.15	Average	54	Pass
NVNT	a	5240	Ant1	5460	-50.73	4.15	-	48.65	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-58.44	4.15	0.24	41.18	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-51.16	4.15	-	48.22	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-58.28	4.15	0.12	41.22	Average	54	Pass
NVNT	n20	5180	Ant1	5146.8	-44.27	4.15	-	55.11	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5149.6	-56.03	4.15	0.12	43.47	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-45.85	4.15	-	53.53	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-55.75	4.15	0.12	43.75	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-50.73	4.15	-	48.65	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-58.16	4.15	0.12	41.34	Average	54	Pass
NVNT	n20	5240	Ant1	5406	-46.87	4.15	-	52.51	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5390.4	-57.39	4.15	0.12	42.11	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-50.13	4.15	-	49.25	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-58.14	4.15	0.12	41.36	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-51.08	4.15	-	48.30	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-58.71	4.15	0.23	40.90	Average	54	Pass
NVNT	n40	5190	Ant1	5148.24	-39.98	4.15	-	59.40	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-55.43	4.15	0.23	44.18	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-41.96	4.15	-	57.42	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-55.43	4.15	0.23	44.18	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-47.7	4.15	-	51.68	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-57.91	4.15	0.24	41.71	Average	54	Pass
NVNT	n40	5230	Ant1	5350.11	-47.7	4.15	-	51.68	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5432.46	-57.38	4.15	0.24	42.24	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-48.71	4.15	-	50.67	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-58.38	4.15	0.24	41.24	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-50.7	4.15	-	48.68	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-59.16	4.15	0.12	40.34	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant1	5145.4	-45	4.15	-	54.38	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5148.9	-55.5	4.15	0.12	44.00	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-47.09	4.15	-	52.29	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-56.01	4.15	0.12	43.49	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-48.07	4.15	-	51.31	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-58.19	4.15	0.12	41.31	Average	54	Pass
NVNT	ac20	5240	Ant1	5403.12	-47.17	4.15	-	52.21	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5377.44	-57.34	4.15	0.12	42.16	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-47.51	4.15	-	51.87	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-58.19	4.15	0.12	41.31	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-49.46	4.15	-	49.92	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.49	4.15	0.24	41.13	Average	54	Pass
NVNT	ac40	5190	Ant1	5149.7	-44.56	4.15	-	54.82	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-55.52	4.15	0.24	44.10	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-44.56	4.15	-	54.82	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-55.52	4.15	0.24	44.10	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-49.82	4.15	-	49.56	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-58.74	4.15	0.24	40.88	Average	54	Pass
NVNT	ac40	5230	Ant1	5437.86	-47.84	4.15	-	51.54	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5371.71	-56.94	4.15	0.24	42.68	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-50.37	4.15	-	49.01	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-58.31	4.15	0.24	41.31	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-48.32	4.15	-	51.06	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-56.92	4.15	0.47	42.93	Average	54	Pass
NVNT	ac80	5210	Ant1	5374.53	-46.28	4.15	-	53.10	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5352.42	-56.2	4.15	0.47	43.65	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-51.16	4.15	-	48.22	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-57.81	4.15	0.47	42.04	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-51.33	4.15	-	48.05	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-58.68	4.15	0.47	41.17	Average	54	Pass
NVNT	ac80	5210	Ant1	5146.22	-45.24	4.15	-	54.14	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5149.38	-55.19	4.15	0.47	44.66	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-46.38	4.15	-	53.00	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-55.46	4.15	0.47	44.39	Average	54	Pass
NVNT	ax20	5180	Ant1	4500	-50.99	4.15	-	48.39	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-59.12	4.15	0.12	40.38	Average	54	Pass
NVNT	ax20	5180	Ant1	5148.9	-42.54	4.15	-	56.84	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5149.6	-55.93	4.15	0.12	43.57	Average	54	Pass
NVNT	ax20	5180	Ant1	5150	-46.22	4.15	-	53.16	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-56.03	4.15	0.12	43.47	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-49.38	4.15	-	50.00	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-57.74	4.15	0.12	41.76	Average	54	Pass
NVNT	ax20	5240	Ant1	5444.4	-47.61	4.15	-	51.77	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant1	5402.4	-57.47	4.15	0.12	42.03	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-48.91	4.15	-	50.47	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-58.61	4.15	0.12	40.89	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-51.02	4.15	-	48.36	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-58.89	4.15	0.23	40.72	Average	54	Pass
NVNT	ax40	5190	Ant1	5147.51	-45.41	4.15	-	53.97	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-54.95	4.15	0.23	44.66	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-48.17	4.15	-	51.21	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-54.95	4.15	0.23	44.66	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-50.34	4.15	-	49.04	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-58.17	4.15	0.24	41.45	Average	54	Pass
NVNT	ax40	5230	Ant1	5401.41	-47.25	4.15	-	52.13	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5400.33	-57.24	4.15	0.24	42.38	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-49.6	4.15	-	49.78	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-57.93	4.15	0.24	41.69	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-48.37	4.15	-	51.01	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-56.71	4.15	0.47	43.14	Average	54	Pass
NVNT	ax80	5210	Ant1	5437.23	-46.13	4.15	-	53.25	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5378.82	-56.42	4.15	0.47	43.43	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-49.63	4.15	-	49.75	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-57.82	4.15	0.47	42.03	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-51.2	4.15	-	48.18	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-59.02	4.15	0.47	40.83	Average	54	Pass
NVNT	ax80	5210	Ant1	5149.38	-43.45	4.15	-	55.93	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5147.01	-55.31	4.15	0.47	44.54	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-47.56	4.15	-	51.82	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-55.35	4.15	0.47	44.50	Average	54	Pass
NVNT	be20	5180	Ant1	4500	-48.99	4.15	-	50.39	Peak	68.2	Pass
NVNT	be20	5180	Ant1	4500	-58.66	4.15	0.12	40.84	Average	54	Pass
NVNT	be20	5180	Ant1	5148.9	-45.72	4.15	-	53.66	Peak	68.2	Pass
NVNT	be20	5180	Ant1	5148.2	-55.35	4.15	0.12	44.15	Average	54	Pass
NVNT	be20	5180	Ant1	5150	-46.31	4.15	-	53.07	Peak	68.2	Pass
NVNT	be20	5180	Ant1	5150	-55.49	4.15	0.12	44.01	Average	54	Pass
NVNT	be20	5240	Ant1	5350	-51.06	4.15	-	48.32	Peak	68.2	Pass
NVNT	be20	5240	Ant1	5350	-58.32	4.15	0.12	41.18	Average	54	Pass
NVNT	be20	5240	Ant1	5407.92	-46.34	4.15	-	53.04	Peak	68.2	Pass
NVNT	be20	5240	Ant1	5394.72	-57.47	4.15	0.12	42.03	Average	54	Pass
NVNT	be20	5240	Ant1	5460	-50.3	4.15	-	49.08	Peak	68.2	Pass
NVNT	be20	5240	Ant1	5460	-58.29	4.15	0.12	41.21	Average	54	Pass
NVNT	be40	5190	Ant1	4500	-51.21	4.15	-	48.17	Peak	68.2	Pass
NVNT	be40	5190	Ant1	4500	-58.73	4.15	0.24	40.89	Average	54	Pass
NVNT	be40	5190	Ant1	5146.05	-43.69	4.15	-	55.69	Peak	68.2	Pass
NVNT	be40	5190	Ant1	5149.7	-55.18	4.15	0.24	44.44	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5190	Ant1	5150	-47.05	4.15	-	52.33	Peak	68.2	Pass
NVNT	be40	5190	Ant1	5150	-55.18	4.15	0.24	44.44	Average	54	Pass
NVNT	be40	5230	Ant1	5350	-50.75	4.15	-	48.63	Peak	68.2	Pass
NVNT	be40	5230	Ant1	5350	-57.68	4.15	0.24	41.94	Average	54	Pass
NVNT	be40	5230	Ant1	5454.6	-47.05	4.15	-	52.33	Peak	68.2	Pass
NVNT	be40	5230	Ant1	5415.99	-57.25	4.15	0.24	42.37	Average	54	Pass
NVNT	be40	5230	Ant1	5460	-49.59	4.15	-	49.79	Peak	68.2	Pass
NVNT	be40	5230	Ant1	5460	-58.15	4.15	0.24	41.47	Average	54	Pass
NVNT	be80	5210	Ant1	5350	-49.29	4.15	-	50.09	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5350	-56.65	4.15	0	42.73	Average	54	Pass
NVNT	be80	5210	Ant1	5377.17	-46.38	4.15	-	53.00	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5375.85	-56.27	4.15	0	43.11	Average	54	Pass
NVNT	be80	5210	Ant1	5460	-48.78	4.15	-	50.60	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5460	-57.51	4.15	0	41.87	Average	54	Pass
NVNT	be80	5210	Ant1	4500	-51.64	4.15	-	47.74	Peak	68.2	Pass
NVNT	be80	5210	Ant1	4500	-58.74	4.15	0.47	41.11	Average	54	Pass
NVNT	be80	5210	Ant1	5149.38	-44.62	4.15	-	54.76	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5149.38	-55.32	4.15	0.47	44.53	Average	54	Pass
NVNT	be80	5210	Ant1	5150	-44.88	4.15	-	54.50	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5150	-55.51	4.15	0.47	44.34	Average	54	Pass
NVNT	ac160	5250	Ant1	5350	-42.65	4.15	-	56.73	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350	-65.66	4.15	3.98	37.70	Average	54	Pass
NVNT	ac160	5250	Ant1	5350.11	-42.65	4.15	-	56.73	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350.48	-61.89	4.15	3.98	41.47	Average	54	Pass
NVNT	ac160	5250	Ant1	5460	-57.72	4.15	-	41.66	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5460	-66.55	4.15	3.98	36.81	Average	54	Pass
NVNT	ac160	5250	Ant1	4500	-60.77	4.15	-	38.61	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4500	-68.98	4.15	3.98	34.38	Average	54	Pass
NVNT	ac160	5250	Ant1	5121.53	-52.09	4.15	-	47.29	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5107.88	-64.96	4.15	3.98	38.40	Average	54	Pass
NVNT	ac160	5250	Ant1	5150	-56.96	4.15	-	42.42	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5150	-65.83	4.15	3.98	37.53	Average	54	Pass
NVNT	ax160	5250	Ant1	5350	-54.42	4.15	-	44.96	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5350	-64.16	4.15	3.98	39.20	Average	54	Pass
NVNT	ax160	5250	Ant1	5393.4	-44.24	4.15	-	55.14	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5402.28	-61.68	4.15	3.98	41.68	Average	54	Pass
NVNT	ax160	5250	Ant1	5460	-57.84	4.15	-	41.54	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5460	-66.81	4.15	3.98	36.55	Average	54	Pass
NVNT	ax160	5250	Ant1	4500	-60.94	4.15	-	38.44	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4500	-68.12	4.15	3.98	35.24	Average	54	Pass
NVNT	ax160	5250	Ant1	5133.36	-52.38	4.15	-	47.00	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5141.55	-63.99	4.15	3.98	39.37	Average	54	Pass
NVNT	ax160	5250	Ant1	5150	-55.23	4.15	-	44.15	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax160	5250	Ant1	5150	-65.16	4.15	3.98	38.20	Average	54	Pass
NVNT	be160	5250	Ant1	5350	-51.77	4.15	-	47.61	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5350	-57.62	4.15	3.77	45.53	Average	54	Pass
NVNT	be160	5250	Ant1	5351.59	-45.66	4.15	-	53.72	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5435.21	-56.97	4.15	3.77	46.18	Average	54	Pass
NVNT	be160	5250	Ant1	5460	-50.42	4.15	-	48.96	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5460	-57.63	4.15	3.77	45.52	Average	54	Pass
NVNT	be160	5250	Ant1	4500	-51.11	4.15	-	48.27	Peak	68.2	Pass
NVNT	be160	5250	Ant1	4500	-58.13	4.15	3.77	45.02	Average	54	Pass
NVNT	be160	5250	Ant1	5022.34	-46.21	4.15	-	53.17	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5077.85	-56.35	4.15	3.77	46.80	Average	54	Pass
NVNT	be160	5250	Ant1	5150	-48.16	4.15	-	51.22	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5150	-57.39	4.15	3.77	45.76	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

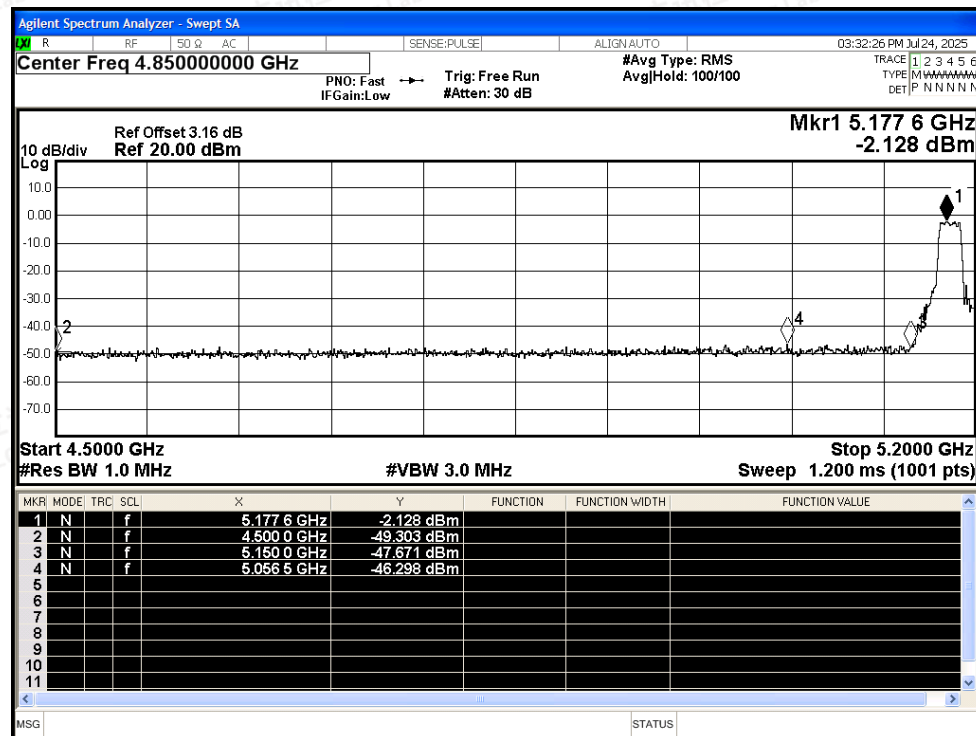

Restrict Band NVNT a 5180MHz Ant1 Average

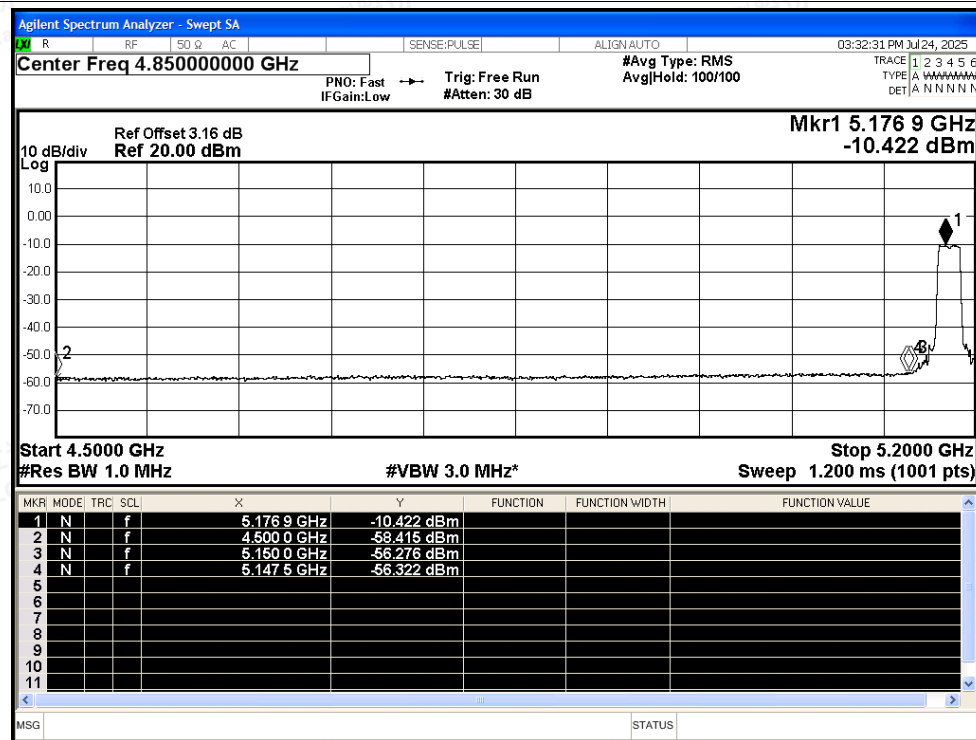

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

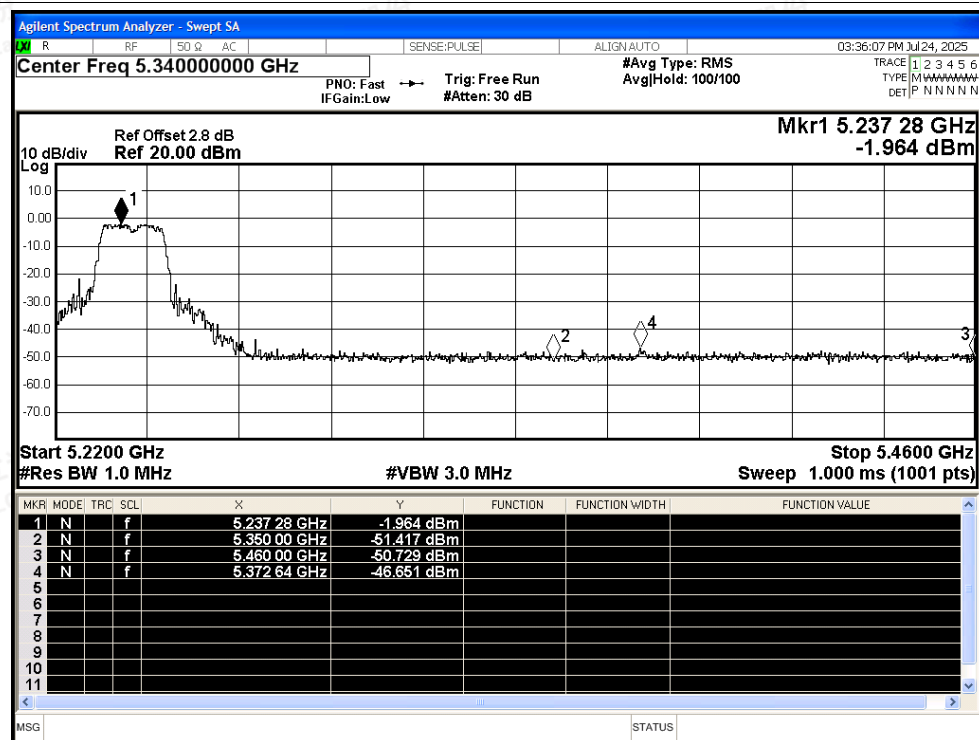

Restrict Band NVNT a 5240MHz Ant1 Average

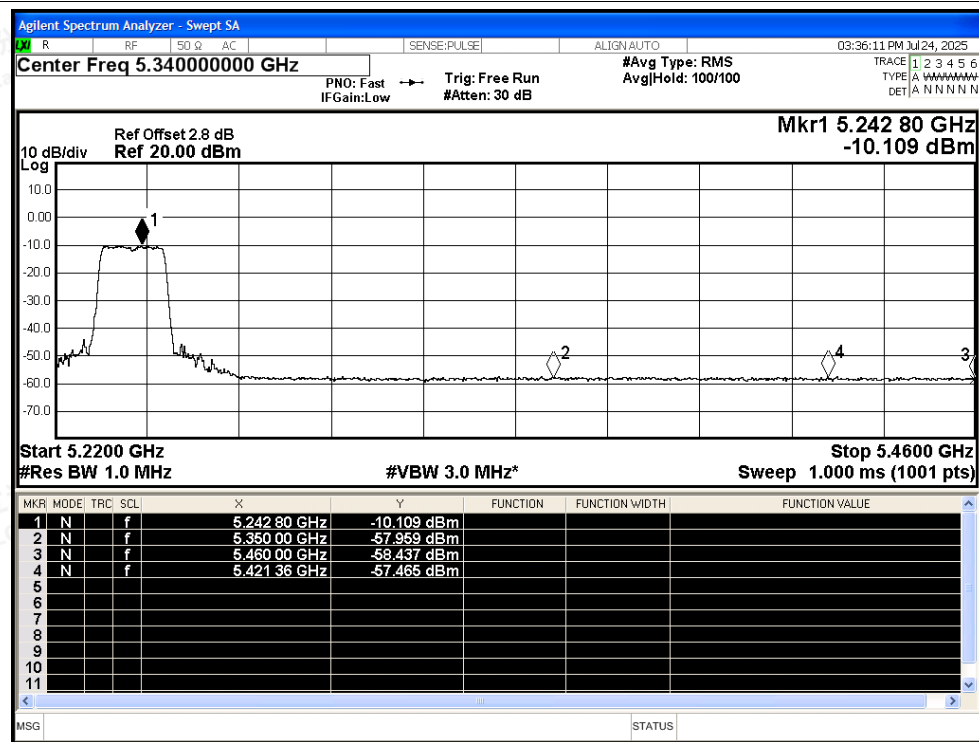

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

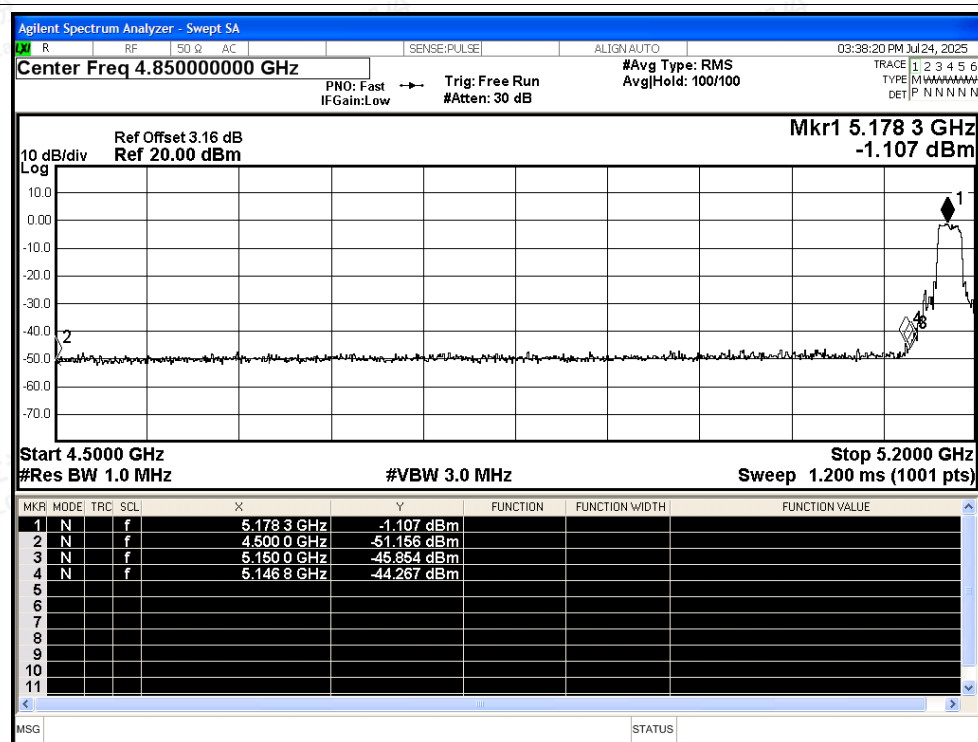

Restrict Band NVNT n20 5180MHz Ant1 Average

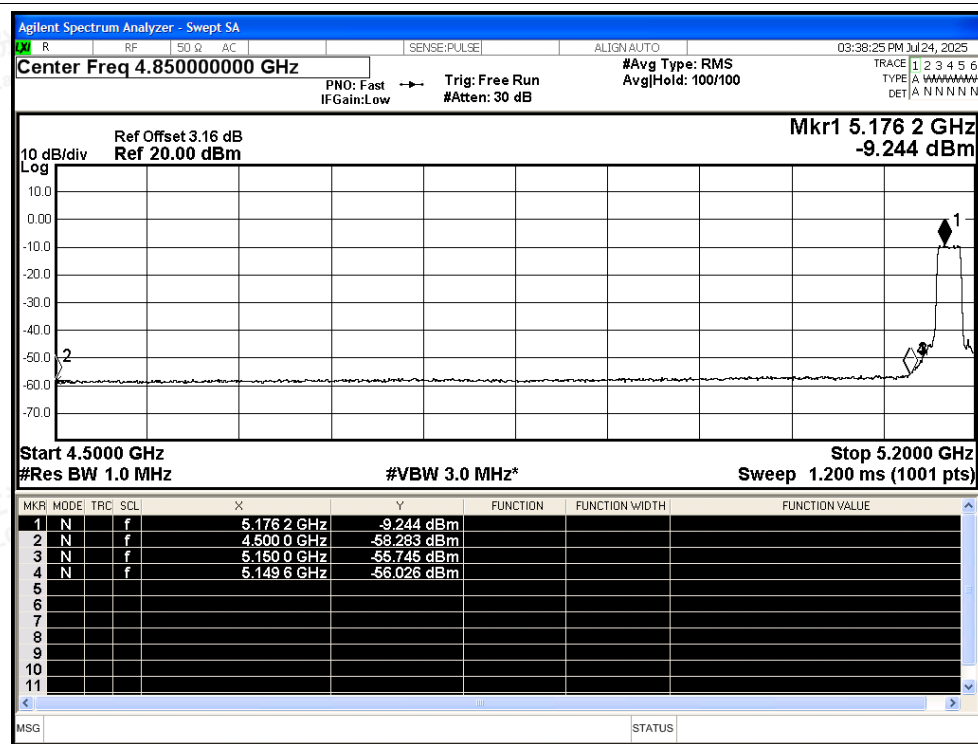

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

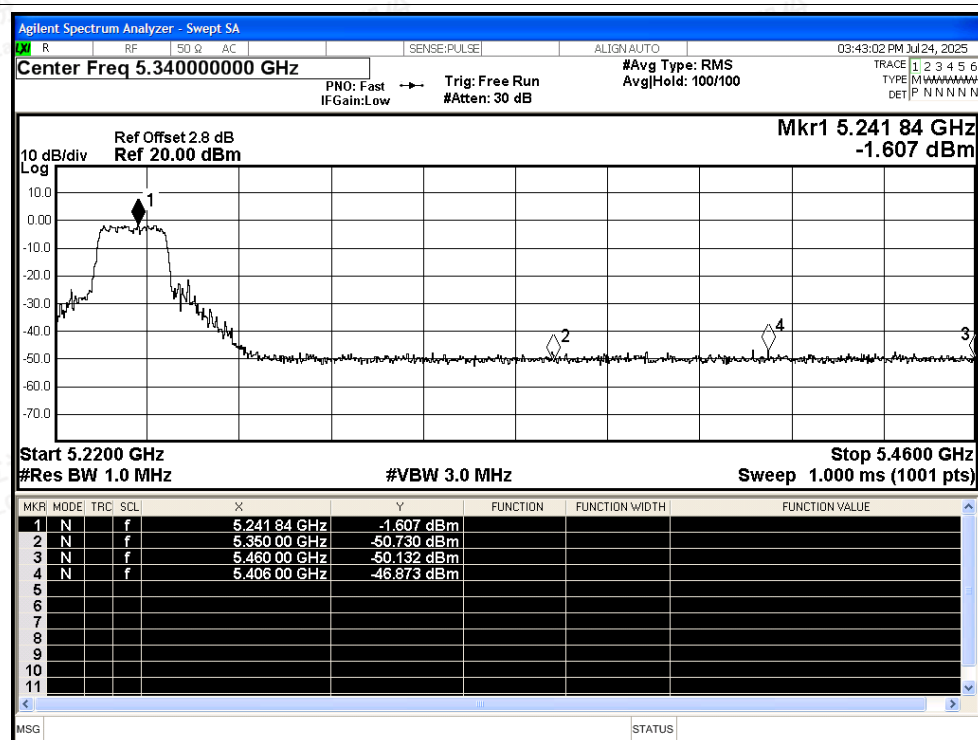

Restrict Band NVNT n20 5240MHz Ant1 Average

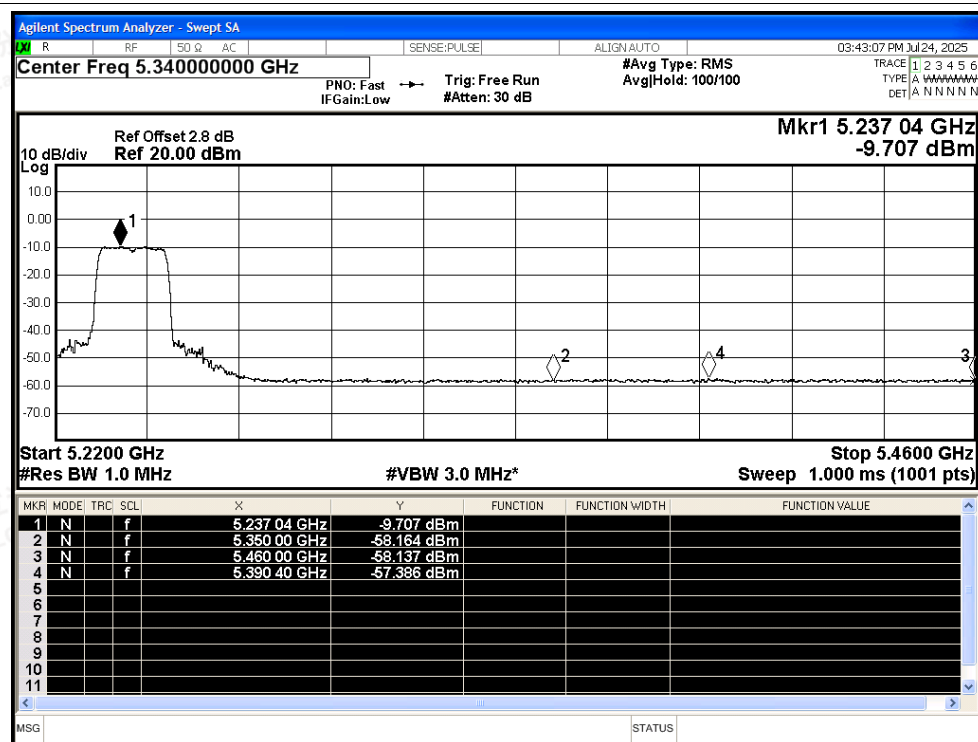

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

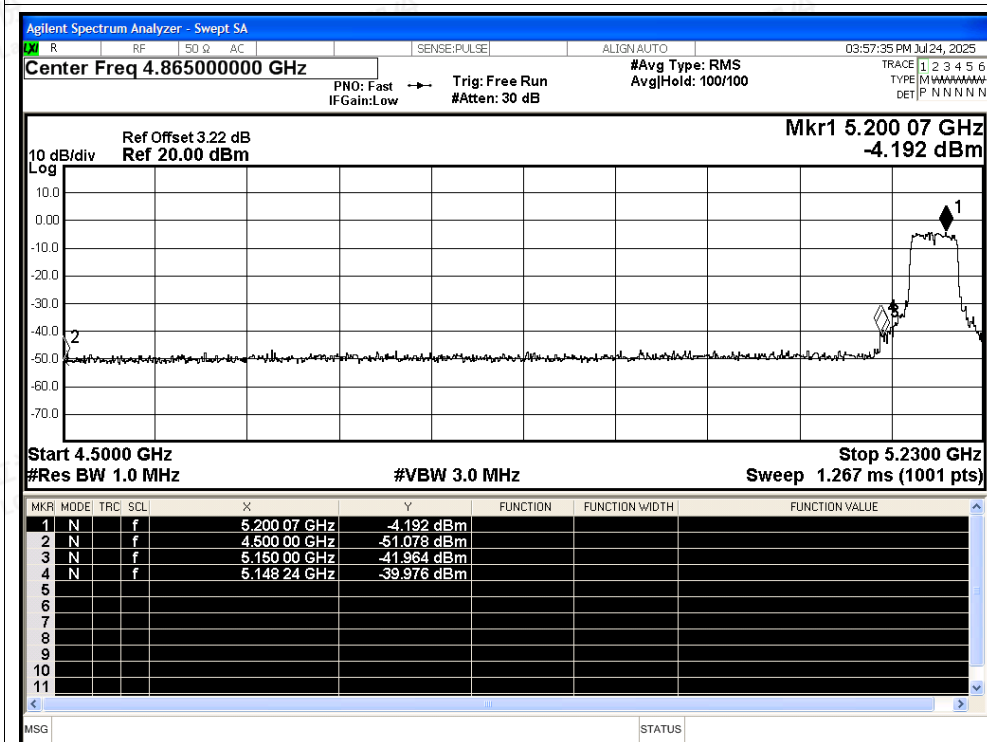

Restrict Band NVNT n40 5190MHz Ant1 Average

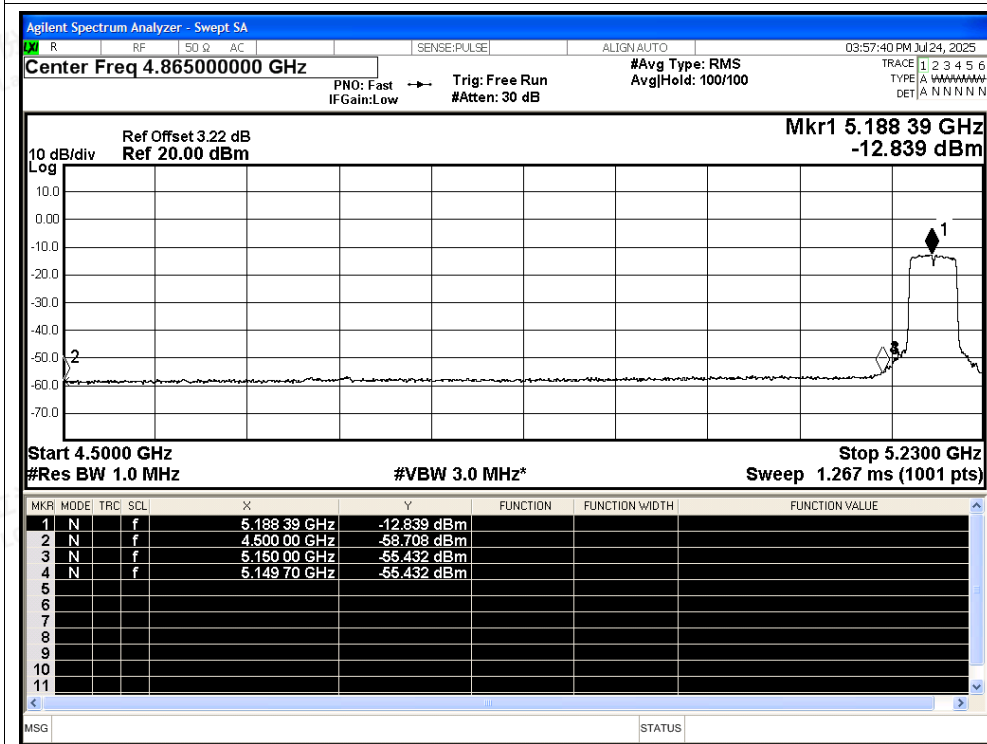

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

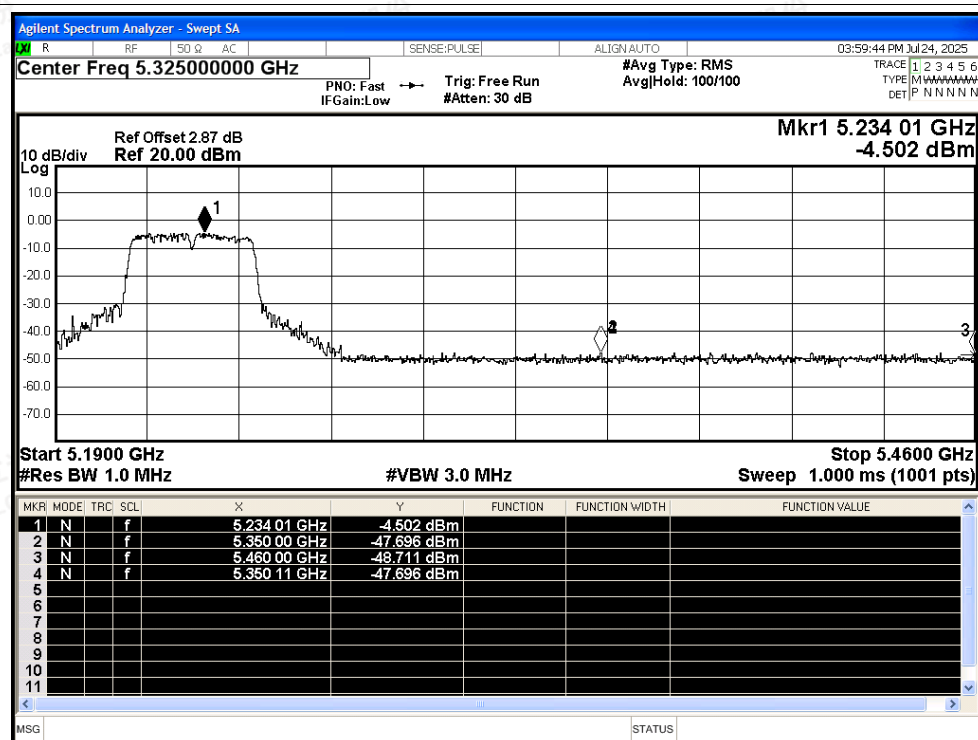

Restrict Band NVNT n40 5230MHz Ant1 Average

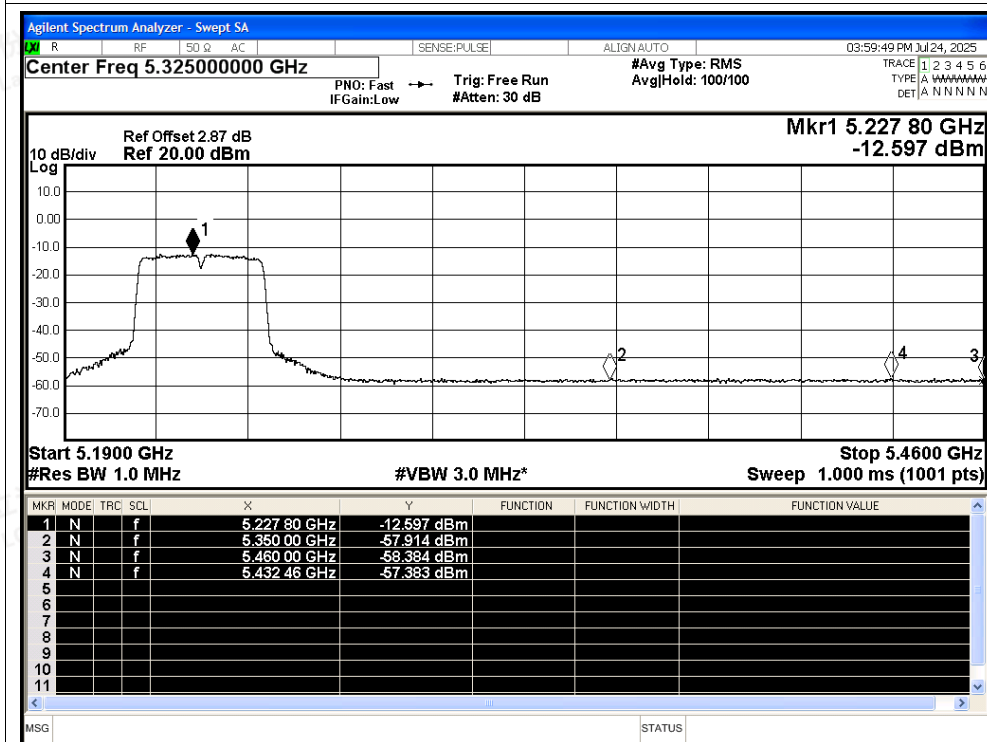

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

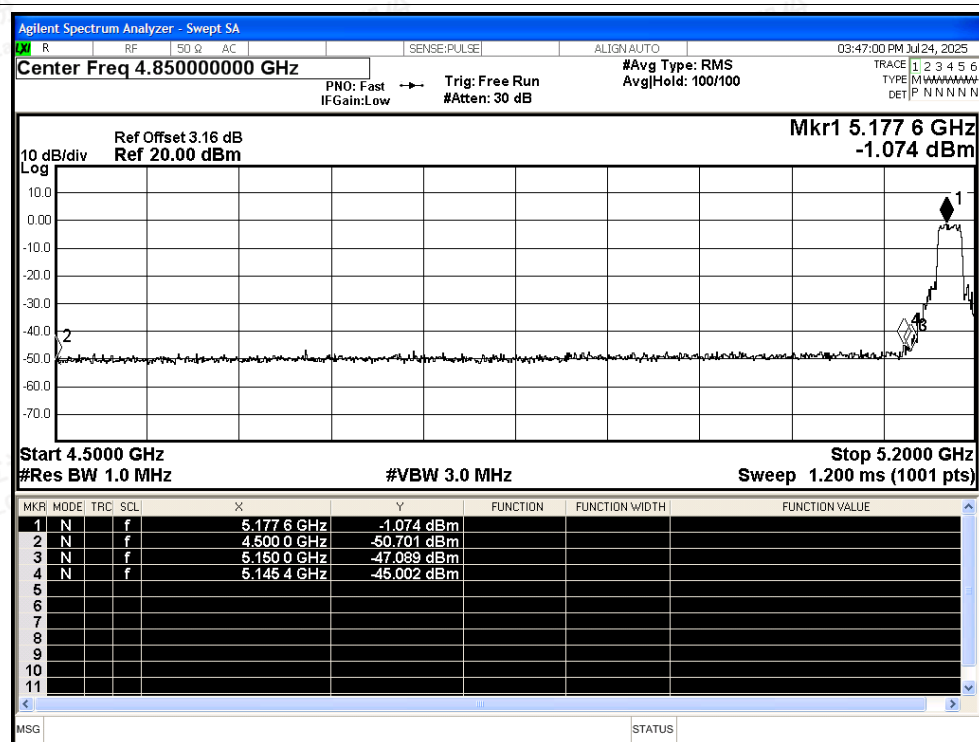

Restrict Band NVNT ac20 5180MHz Ant1 Average

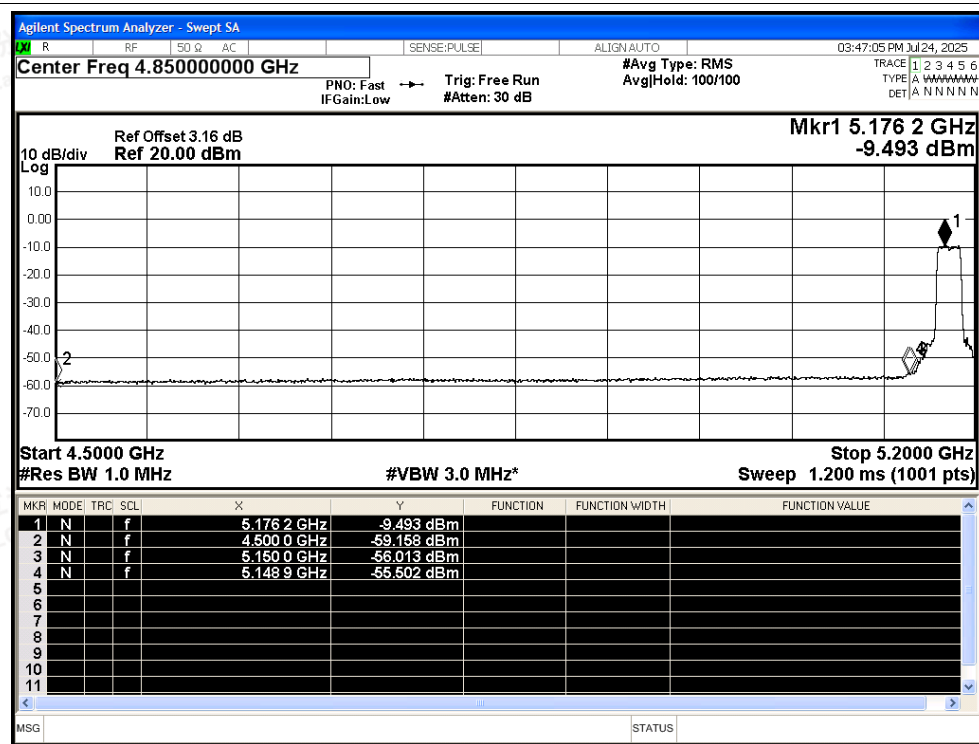

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

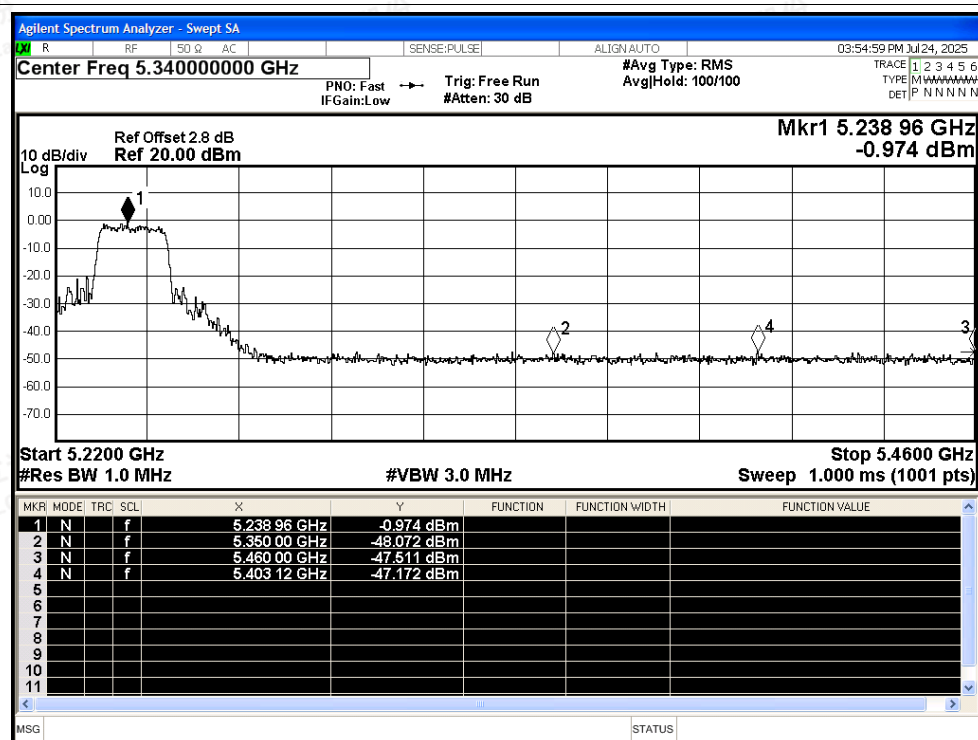

Restrict Band NVNT ac20 5240MHz Ant1 Average

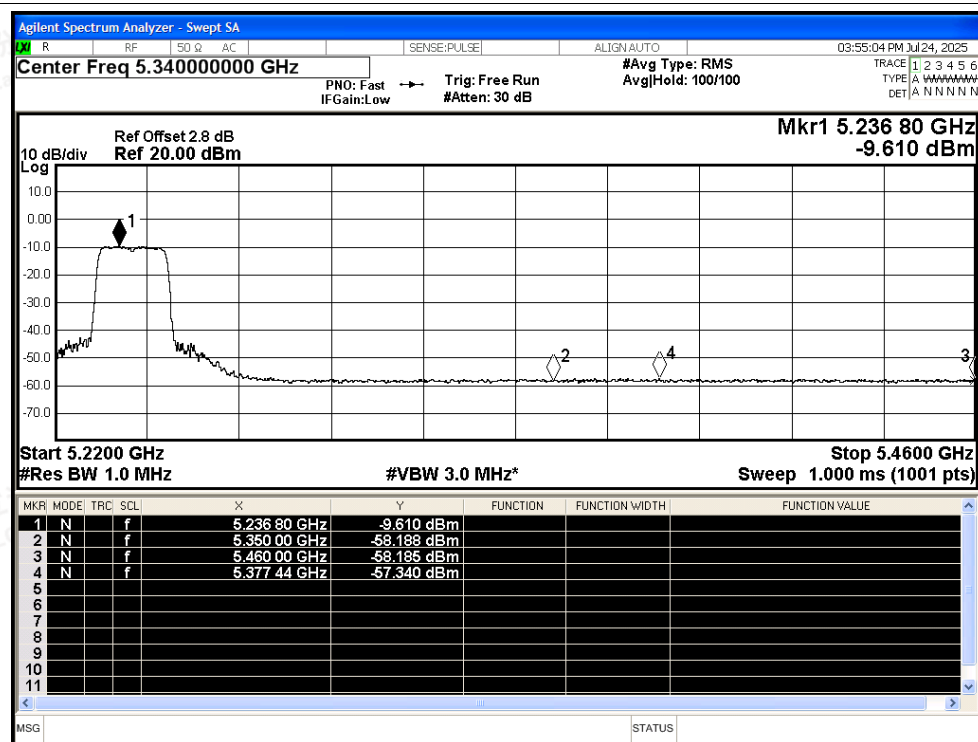

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

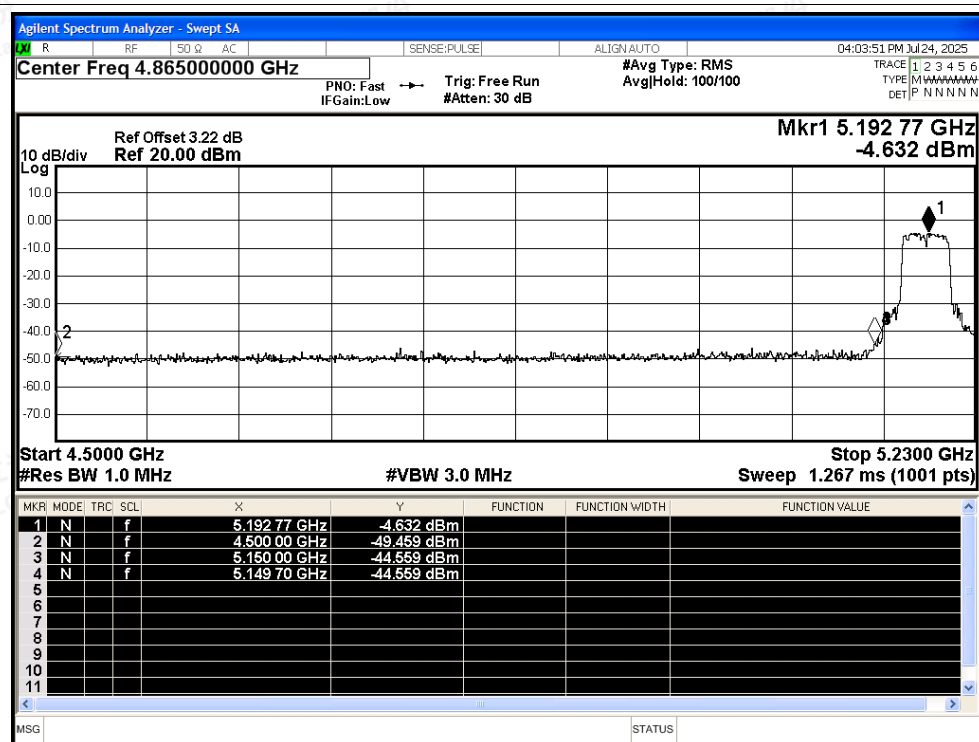

Restrict Band NVNT ac40 5190MHz Ant1 Average

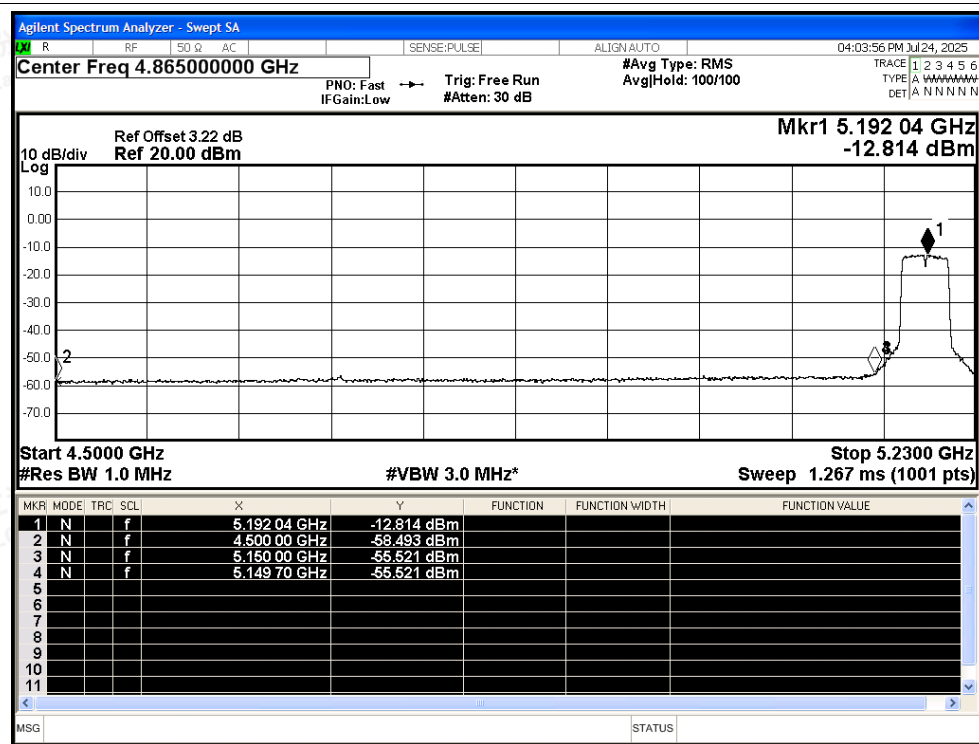

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

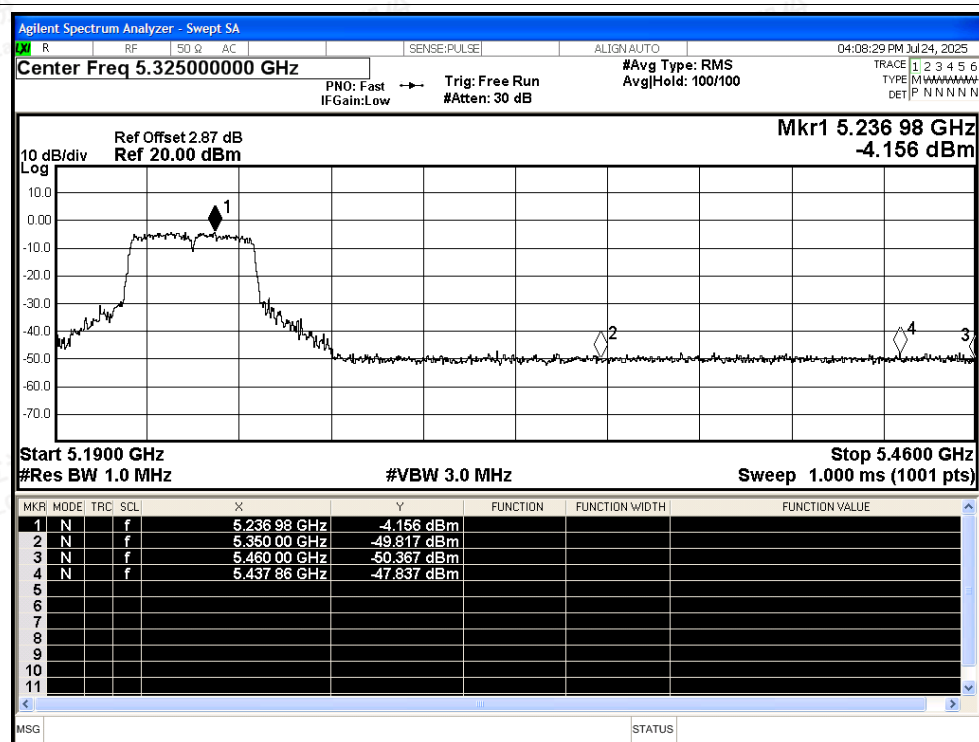

Restrict Band NVNT ac40 5230MHz Ant1 Average

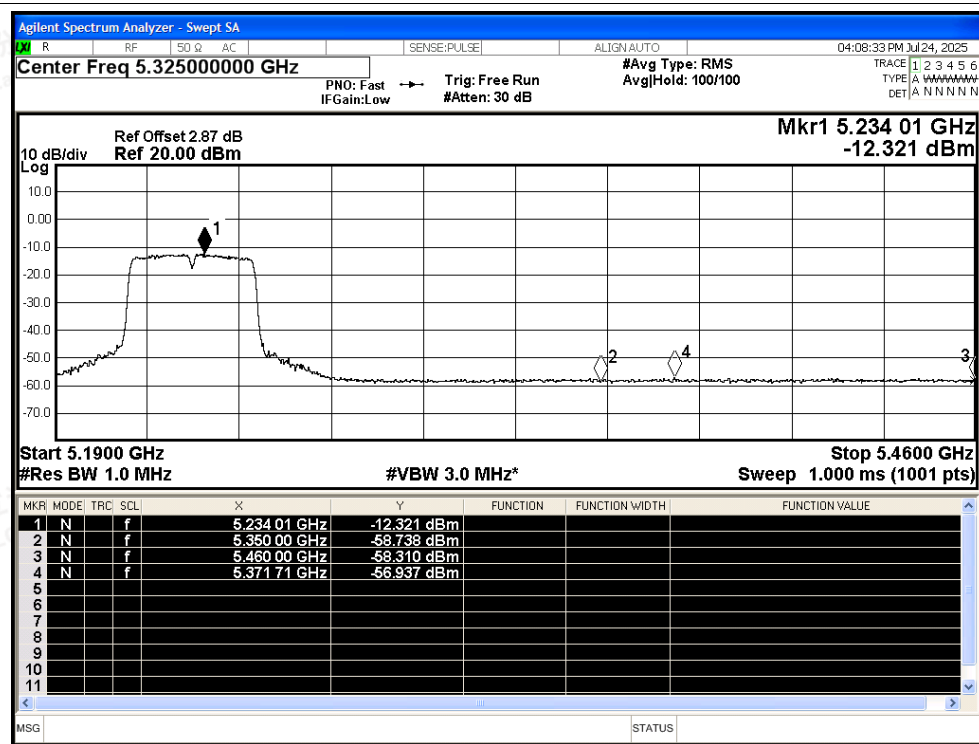

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

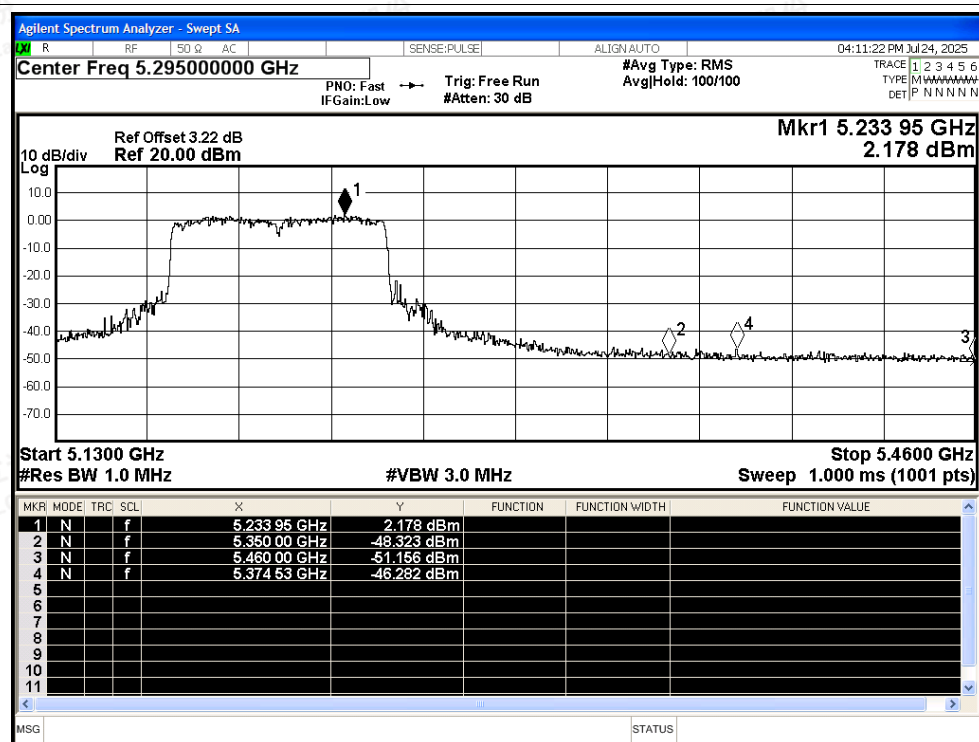

Restrict Band NVNT ac80 5210MHz Ant1 Average

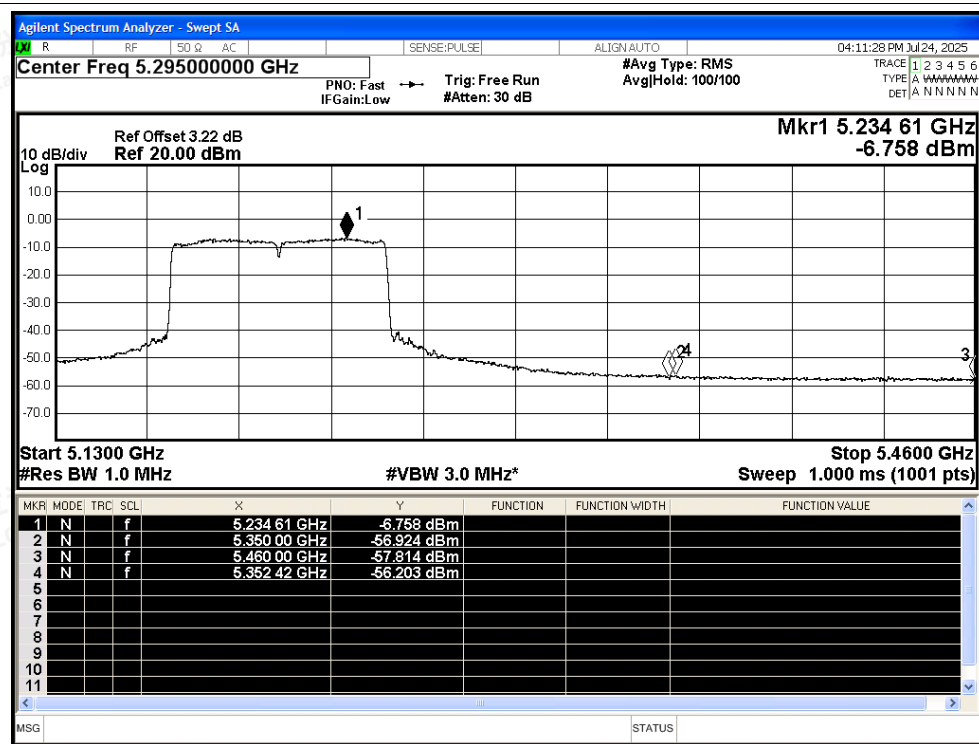

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

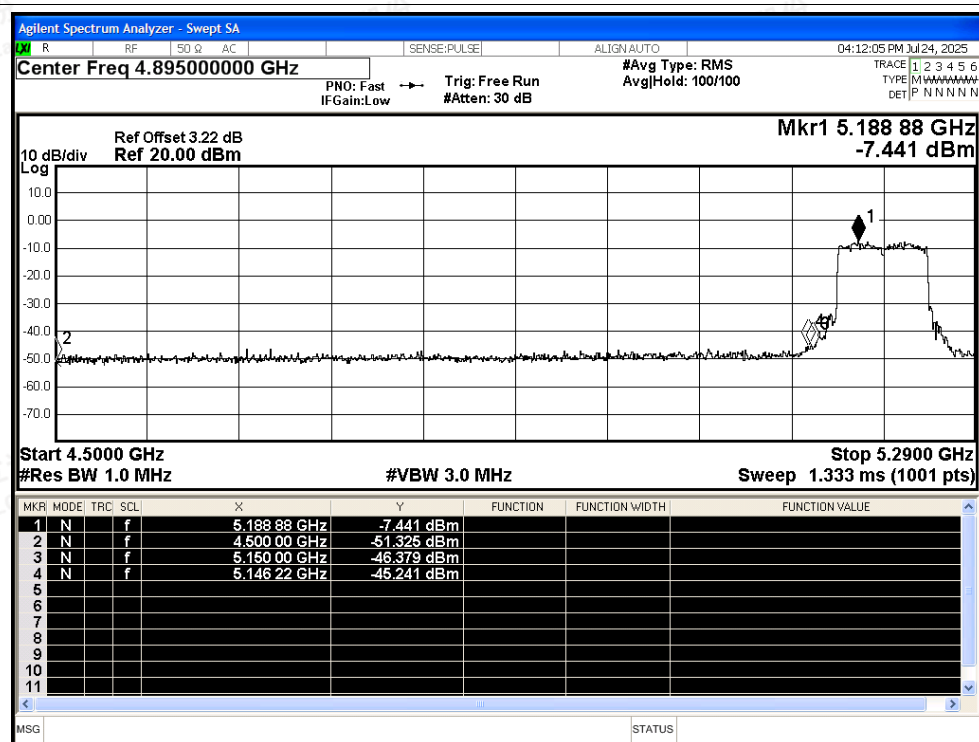

Restrict Band NVNT ac80 5210MHz Ant1 Average

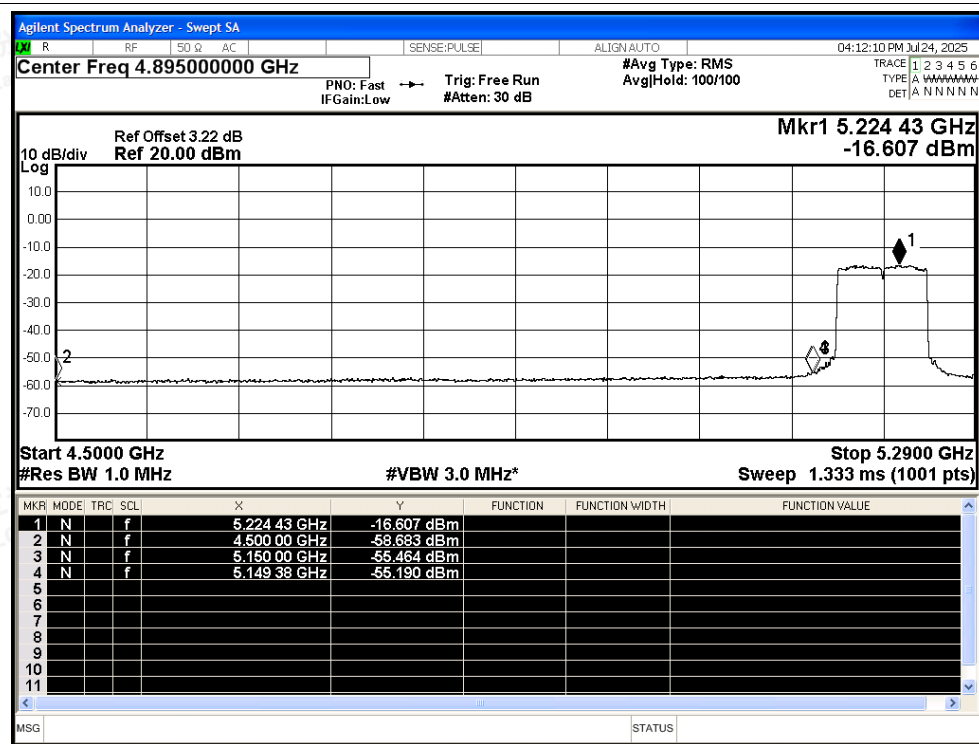

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant1 Peak

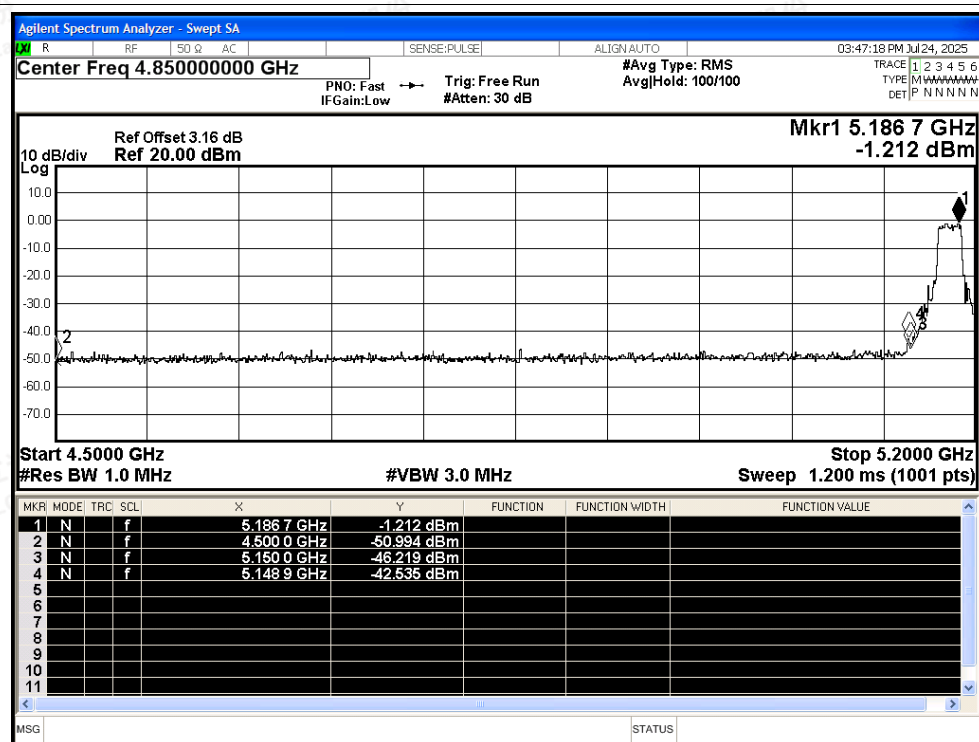

Restrict Band NVNT ax20 5180MHz Ant1 Average

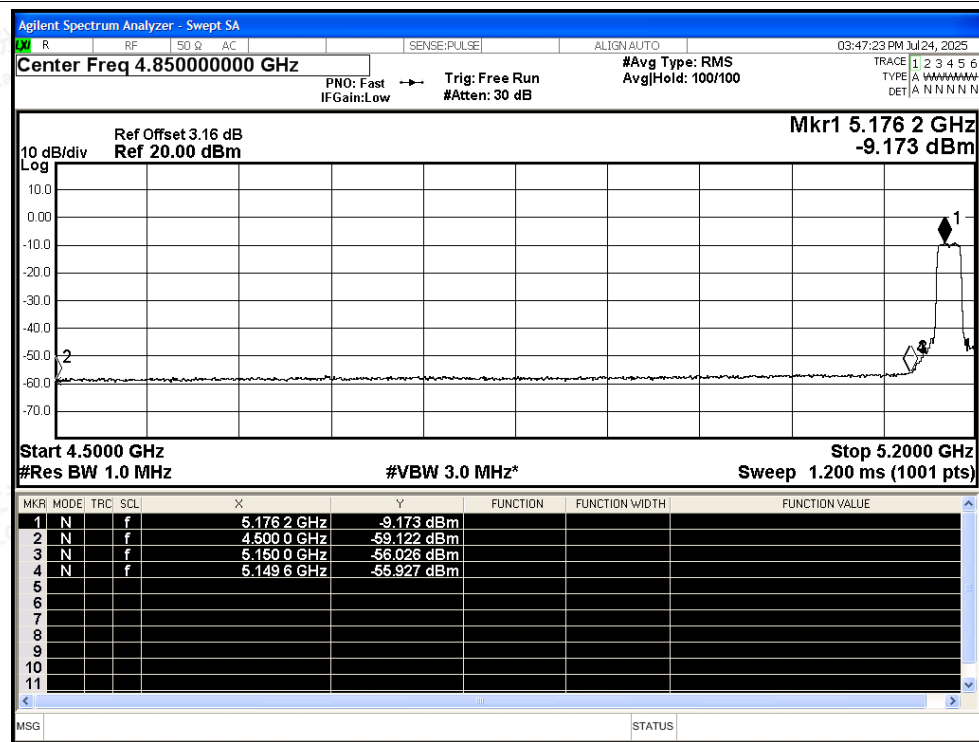

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

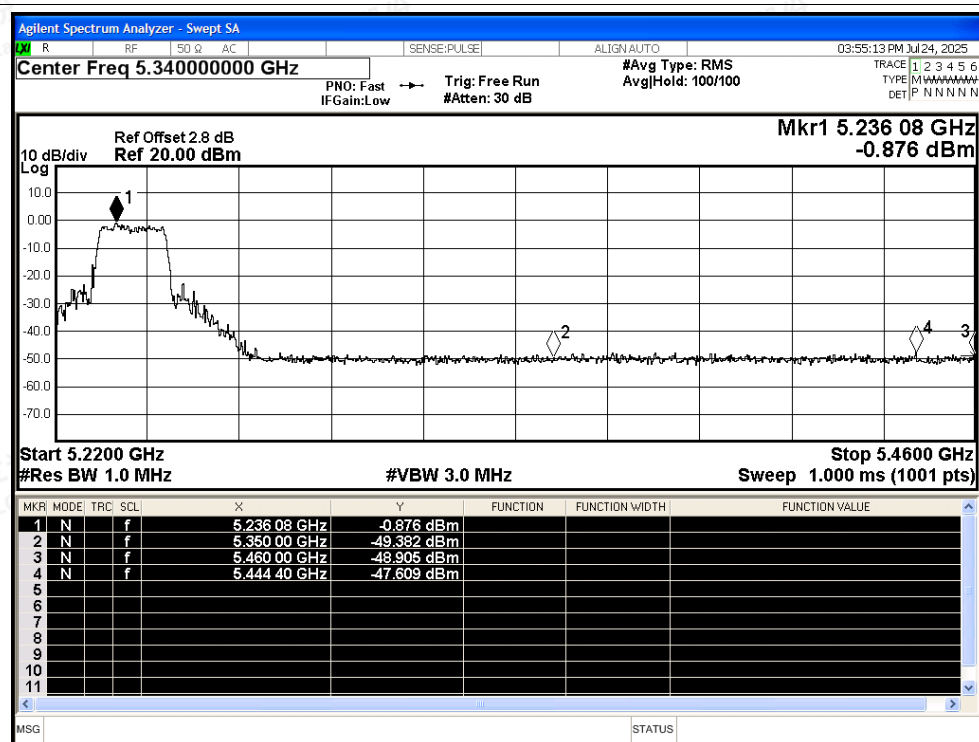

Restrict Band NVNT ax20 5240MHz Ant1 Average

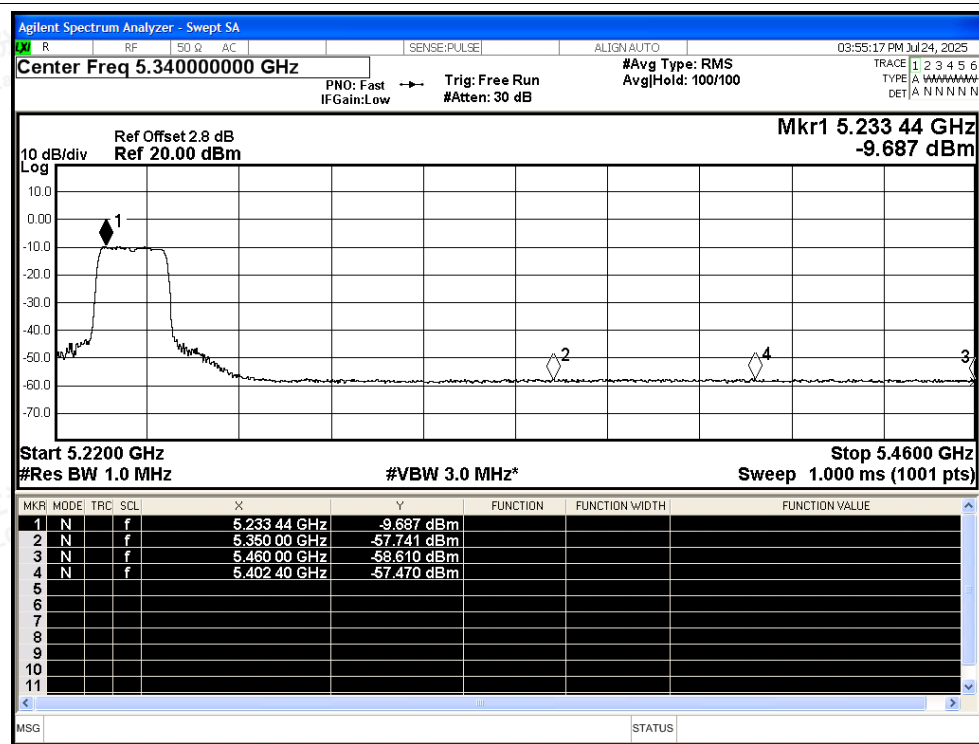

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

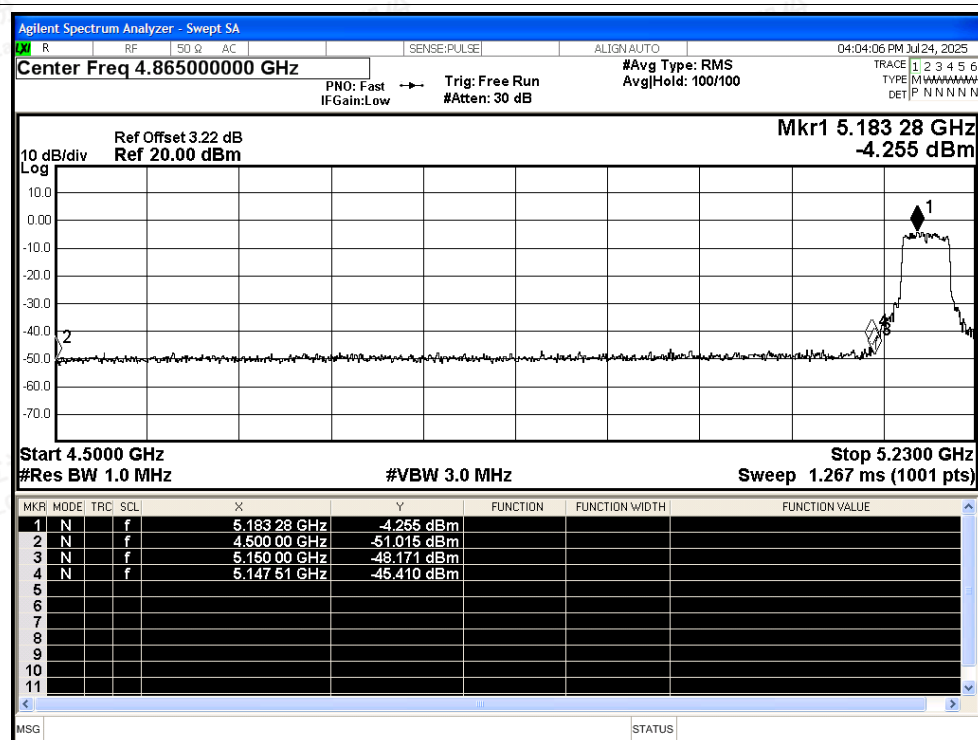

Restrict Band NVNT ax40 5190MHz Ant1 Average

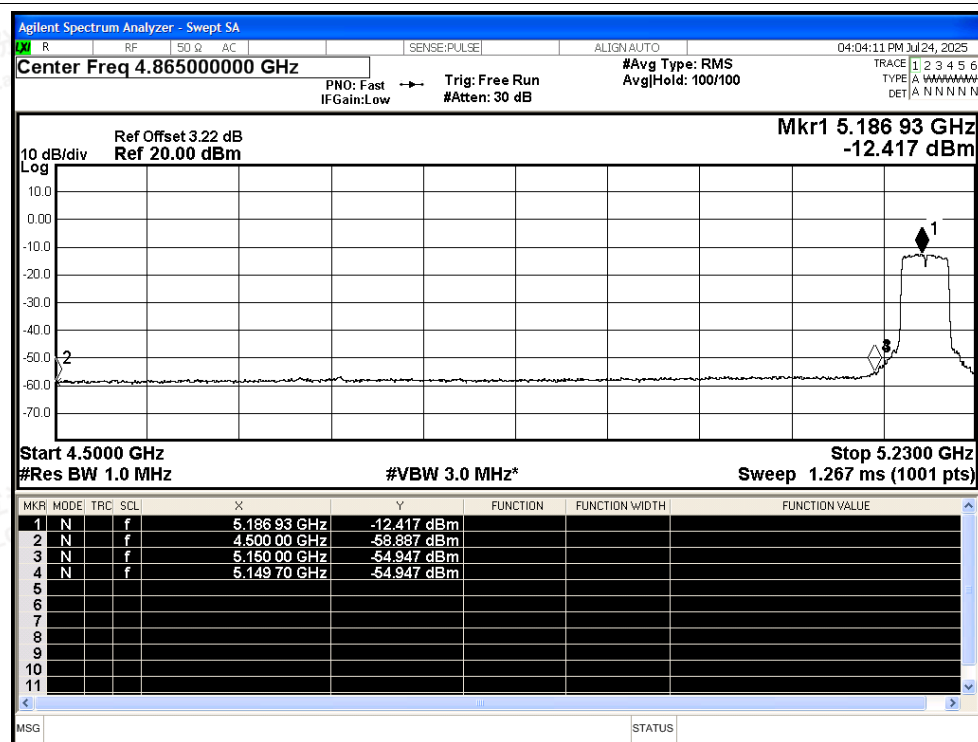

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

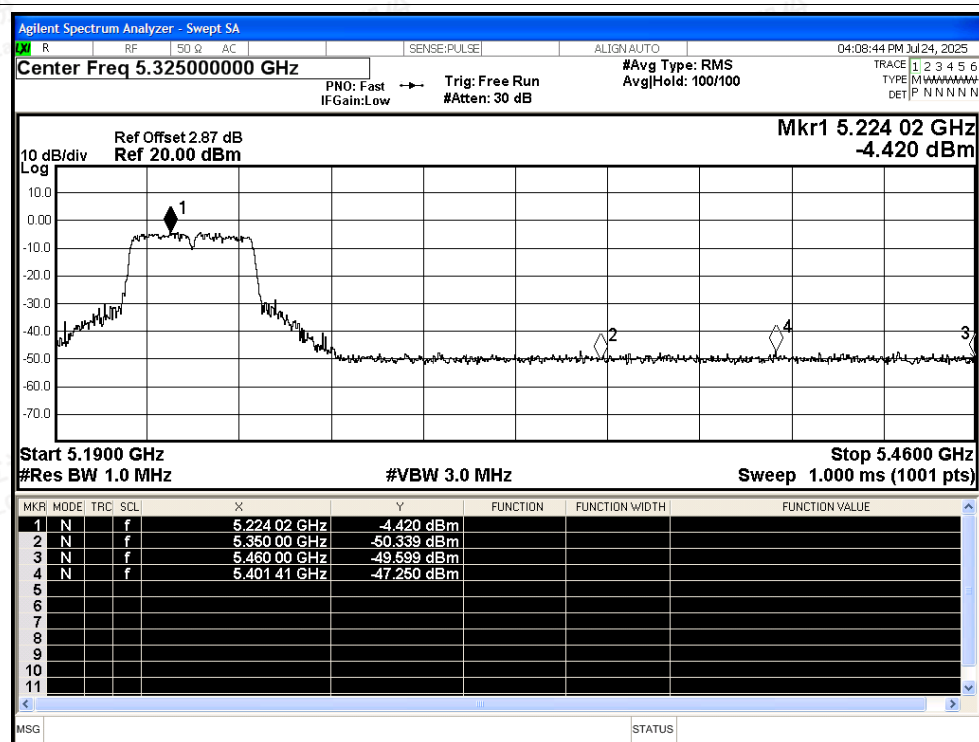

Restrict Band NVNT ax40 5230MHz Ant1 Average

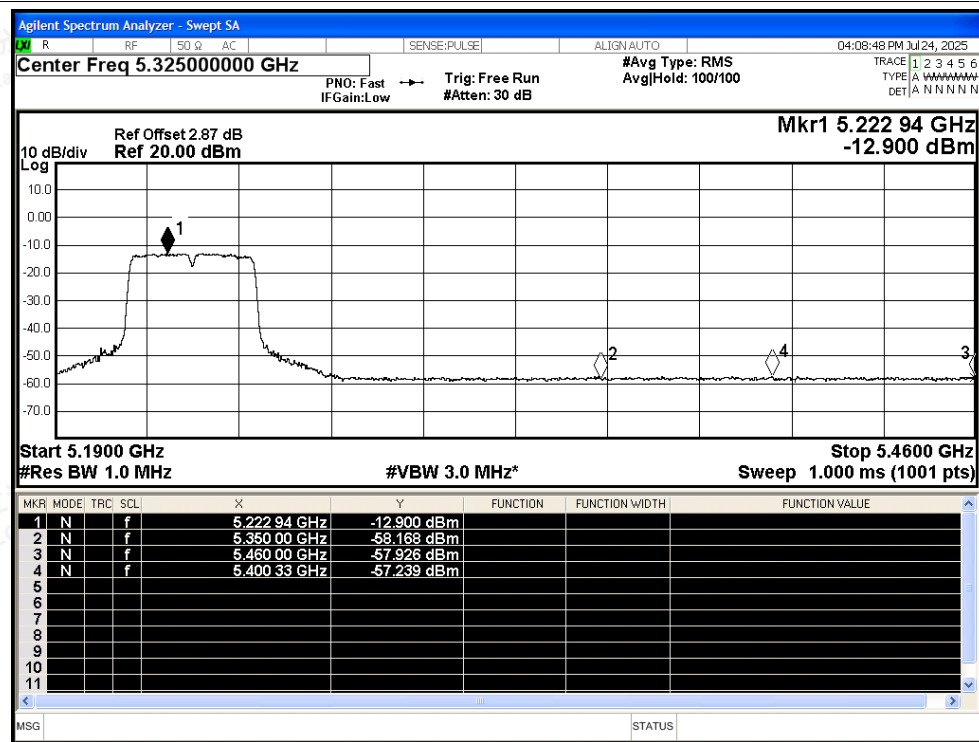

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

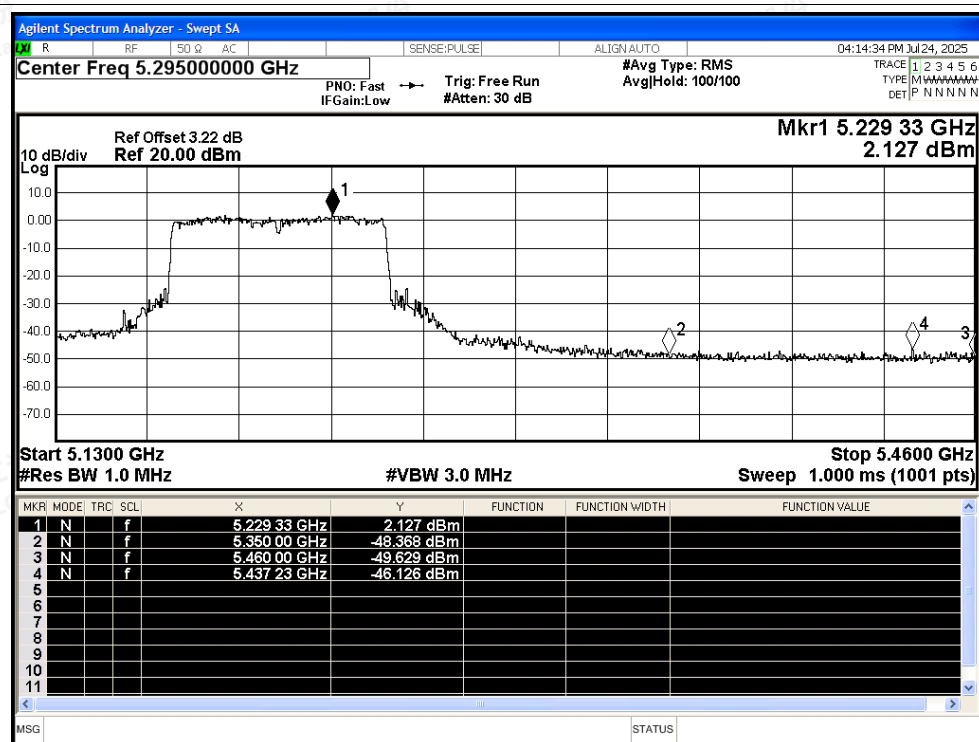

Restrict Band NVNT ax80 5210MHz Ant1 Average

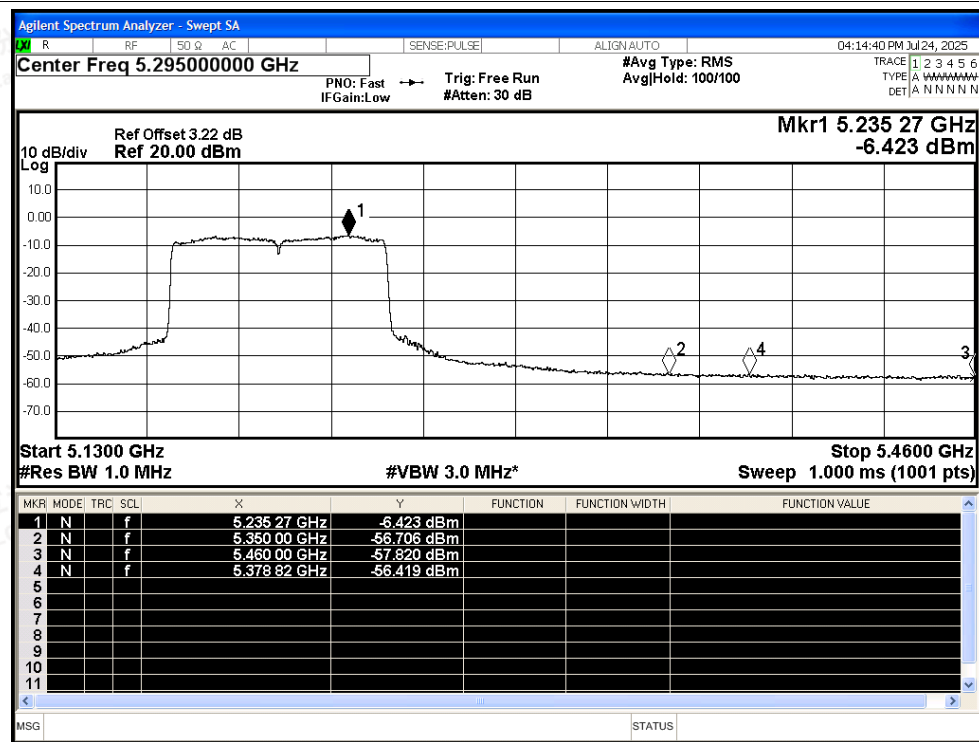

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

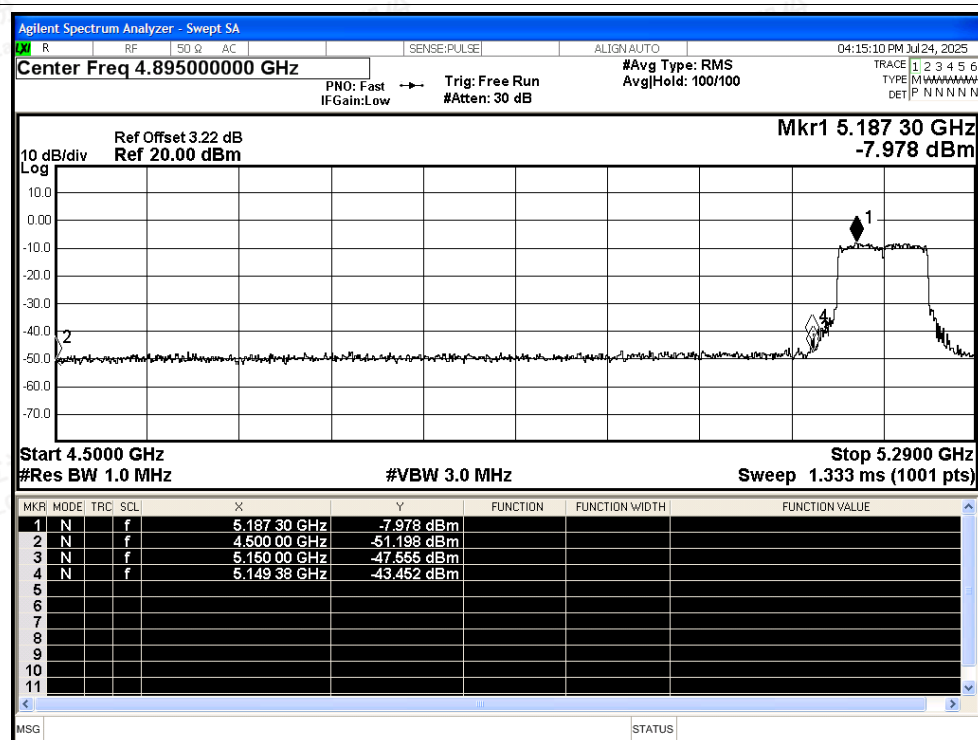

Restrict Band NVNT ax80 5210MHz Ant1 Average

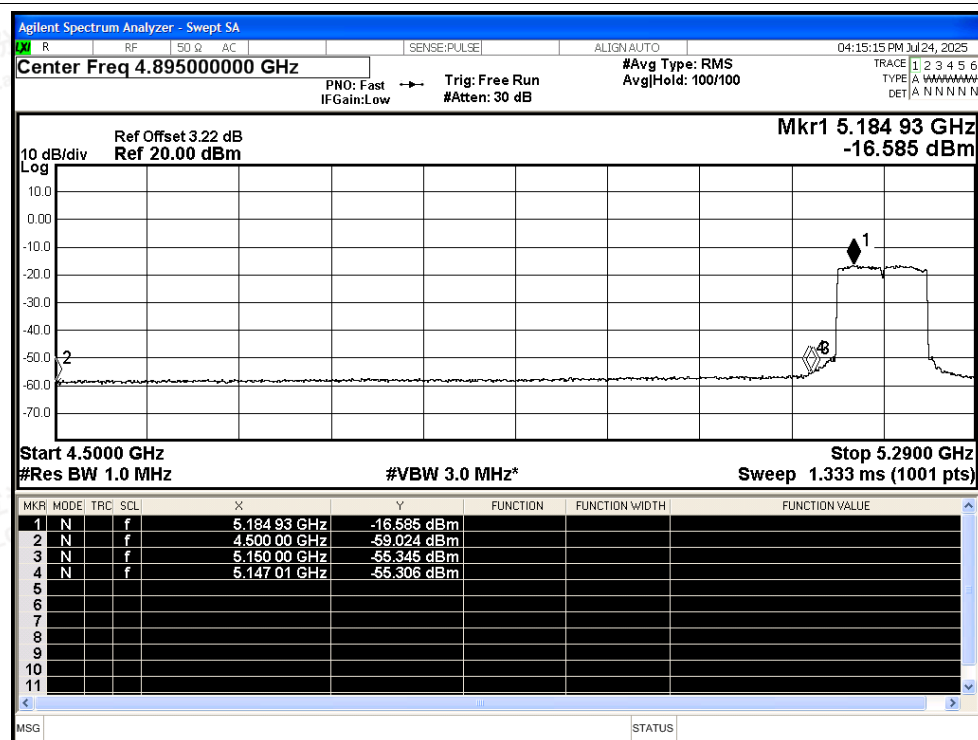

Restrict Band NVNT be20 5180MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity