



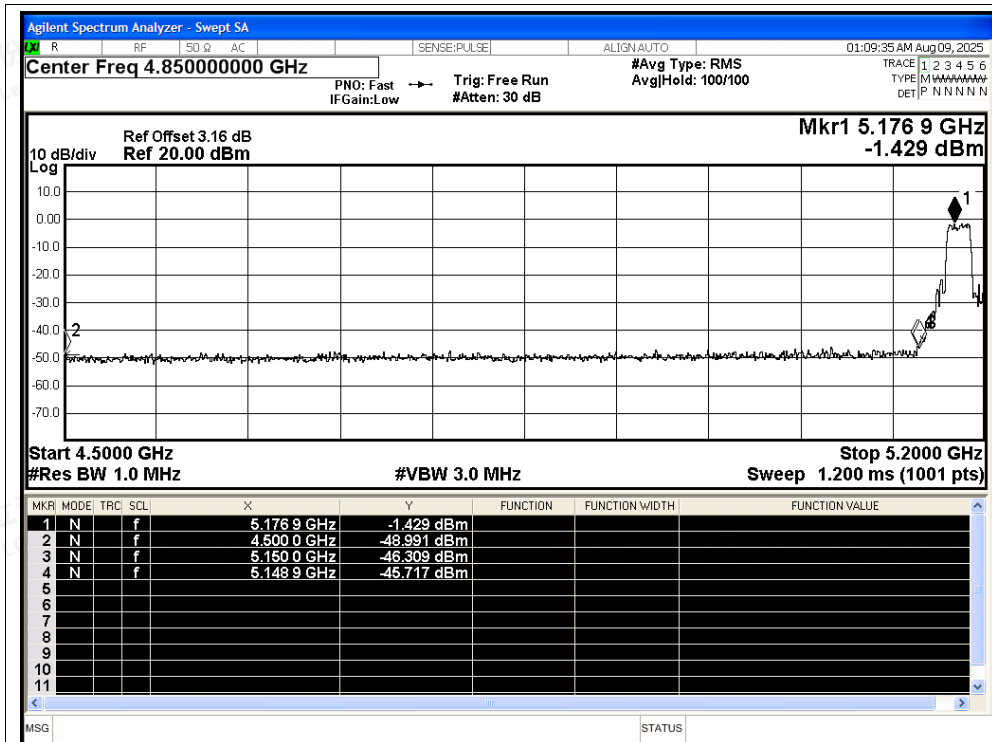

Restrict Band NVNT be20 5180MHz Ant1 Average

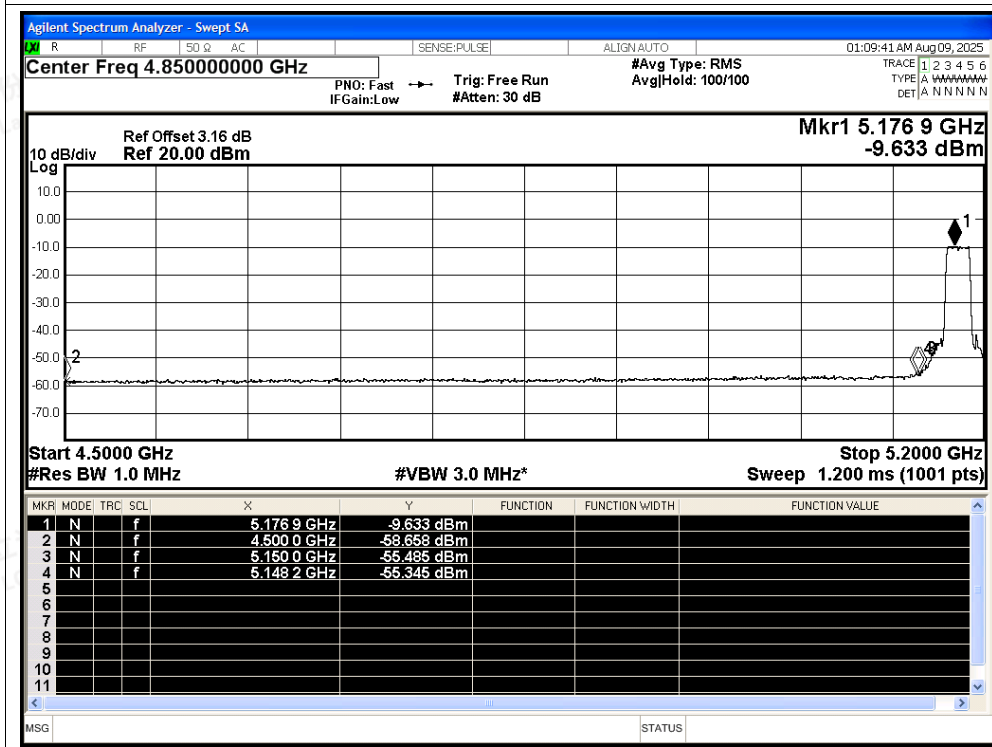

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5240MHz Ant1 Peak

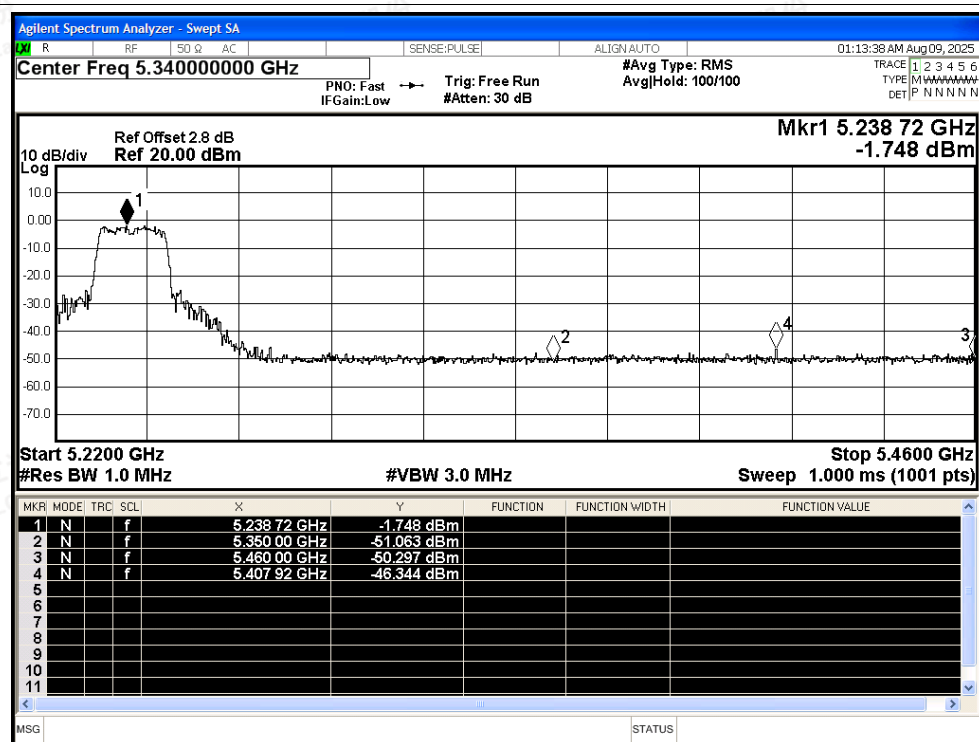

Restrict Band NVNT be20 5240MHz Ant1 Average

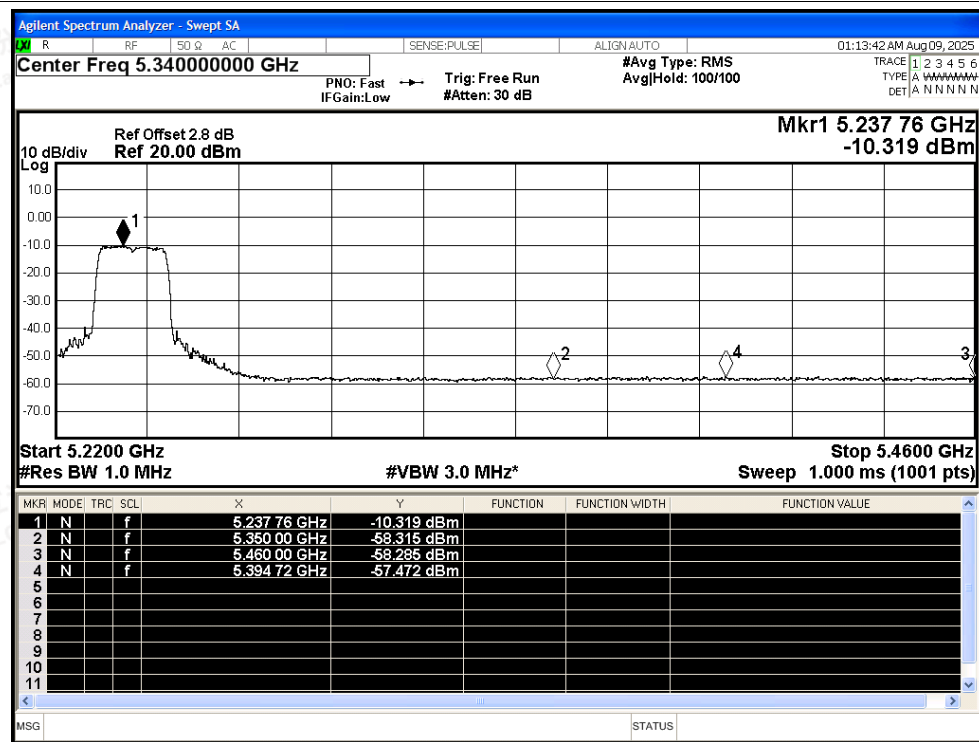

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5190MHz Ant1 Peak

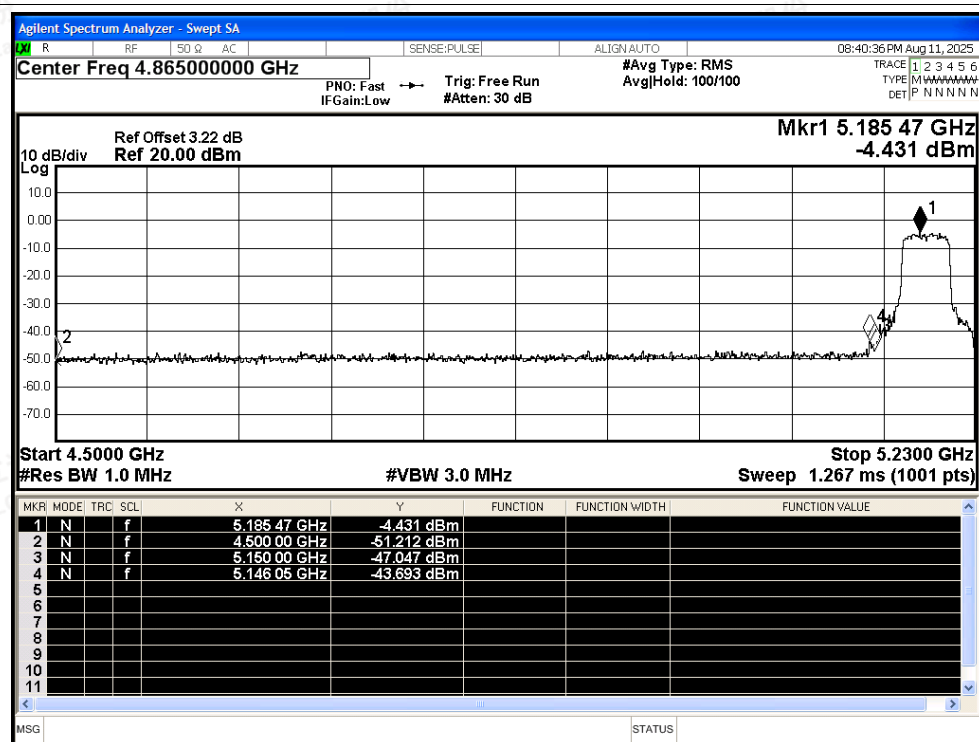

Restrict Band NVNT be40 5190MHz Ant1 Average

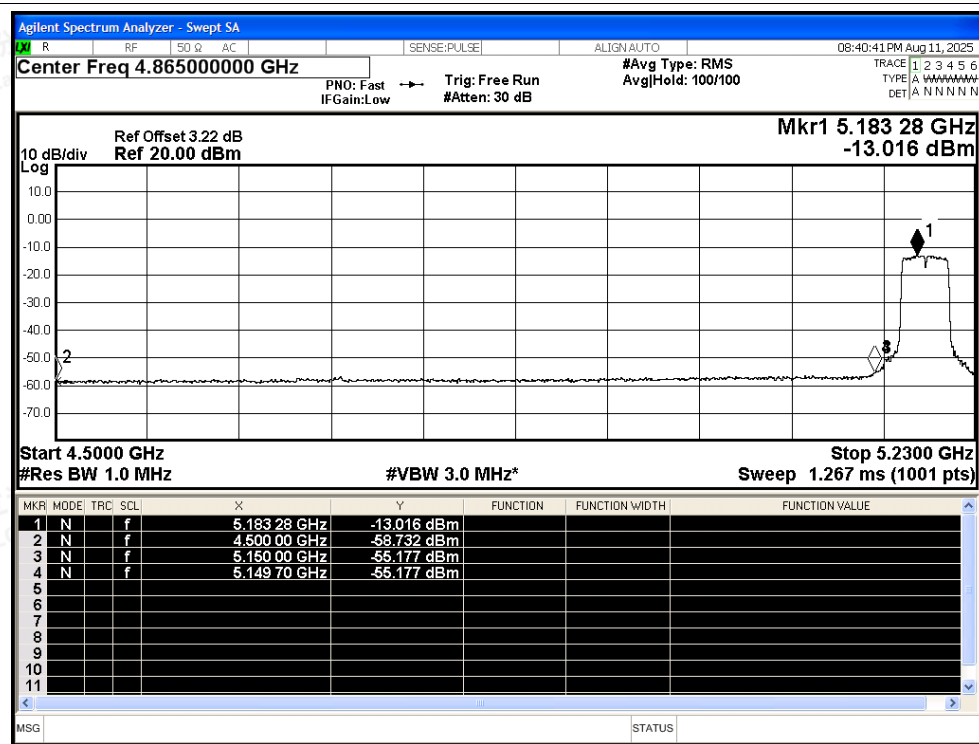

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5230MHz Ant1 Peak

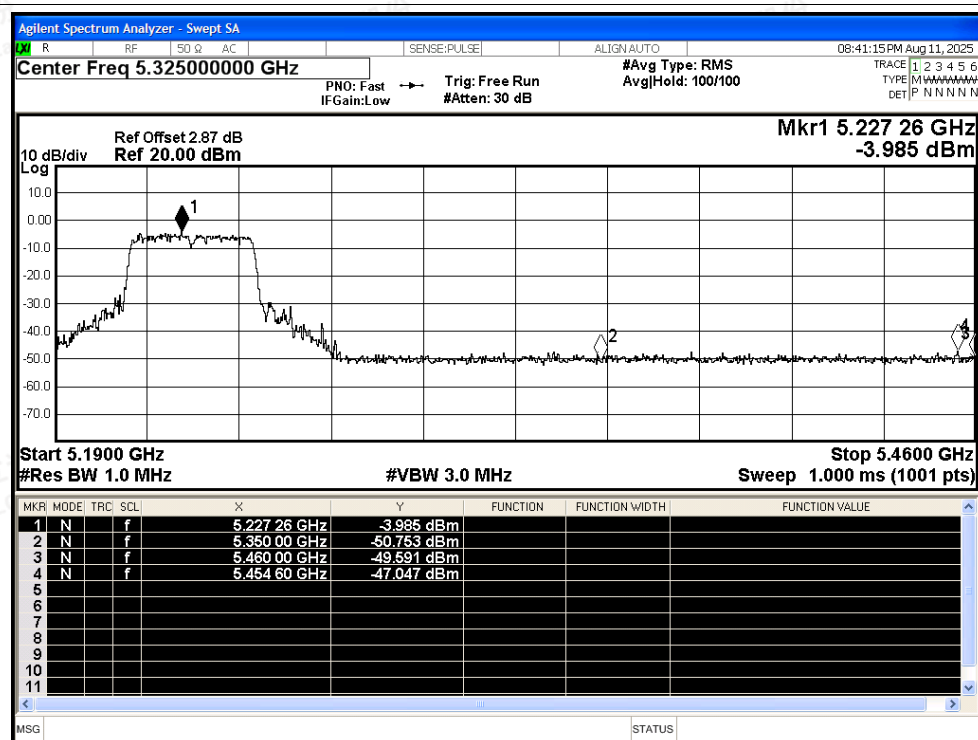

Restrict Band NVNT be40 5230MHz Ant1 Average

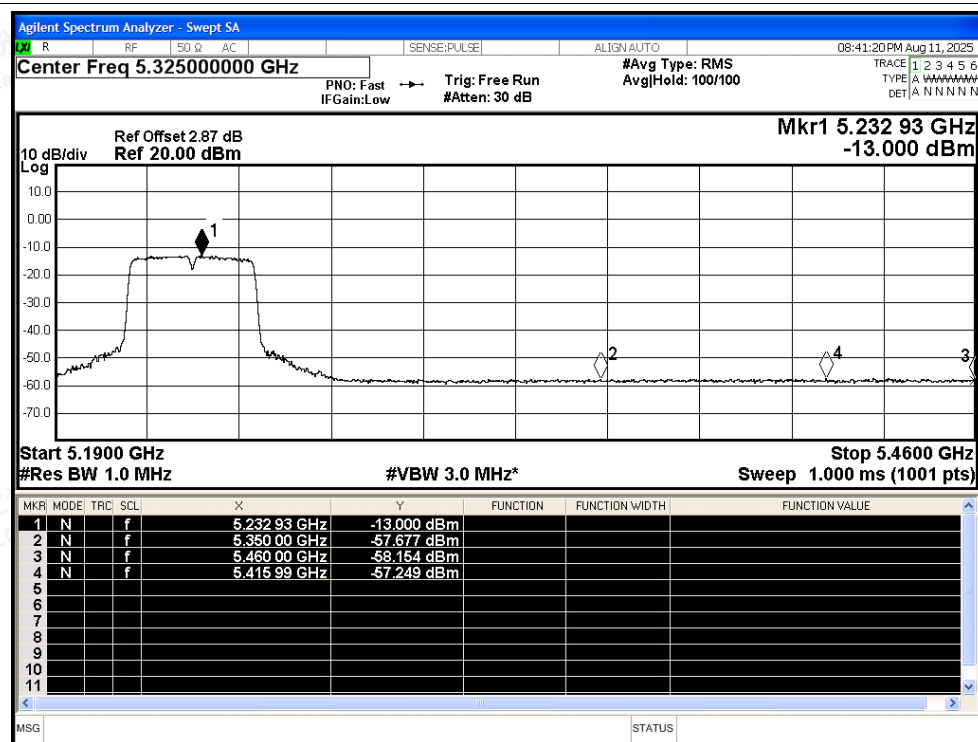

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant1 Peak

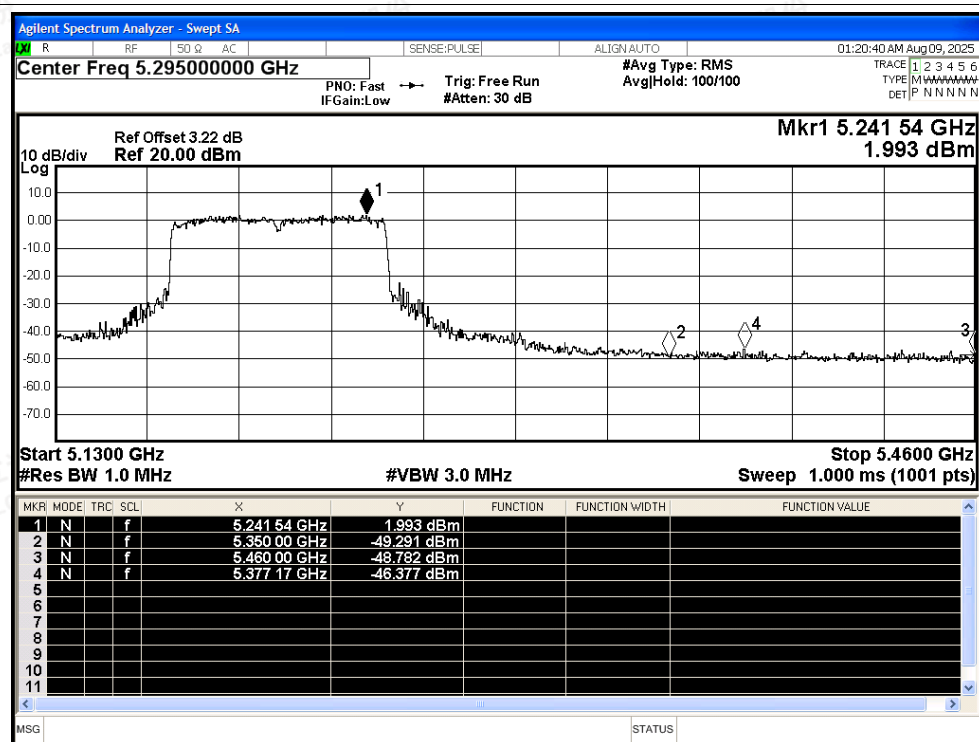

Restrict Band NVNT be80 5210MHz Ant1 Average

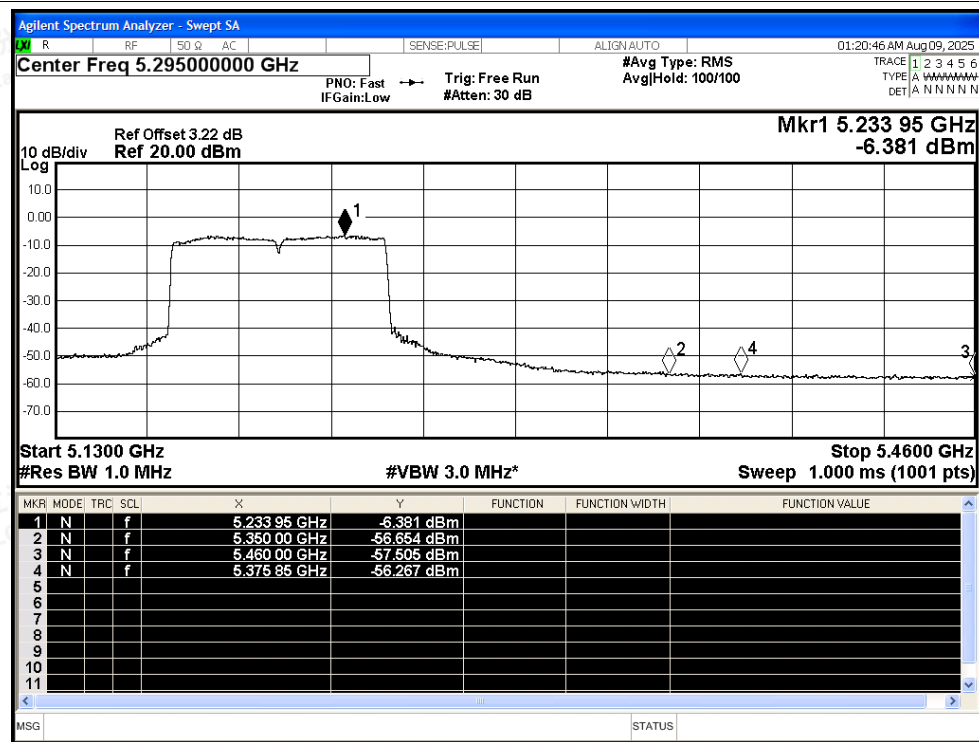

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant1 Peak

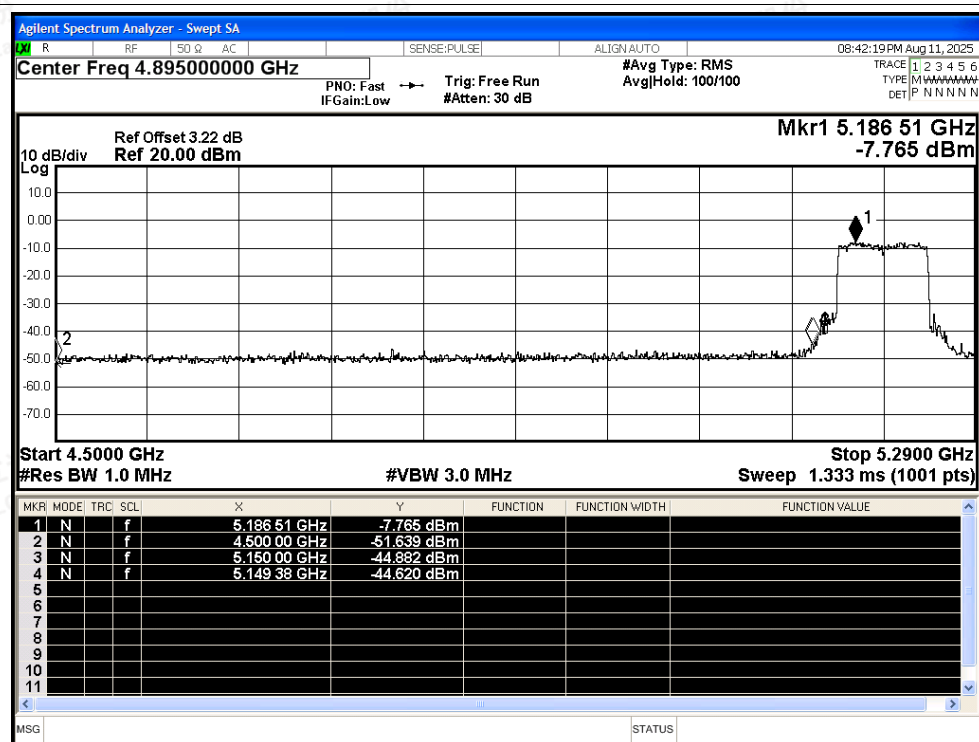

Restrict Band NVNT be80 5210MHz Ant1 Average

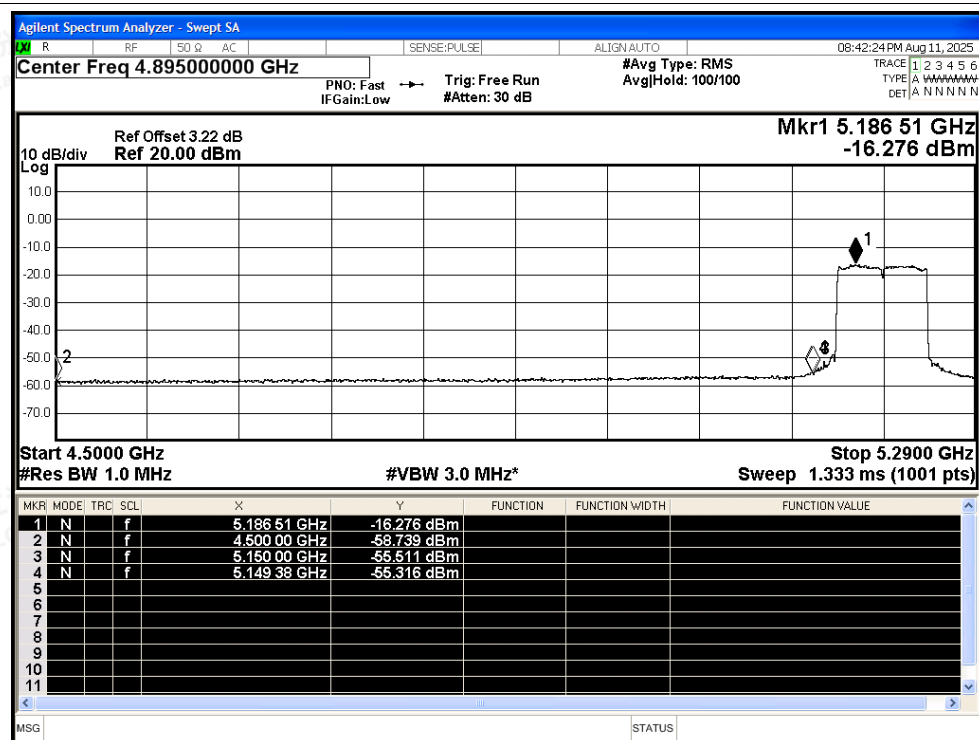

Restrict Band NVNT ac160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

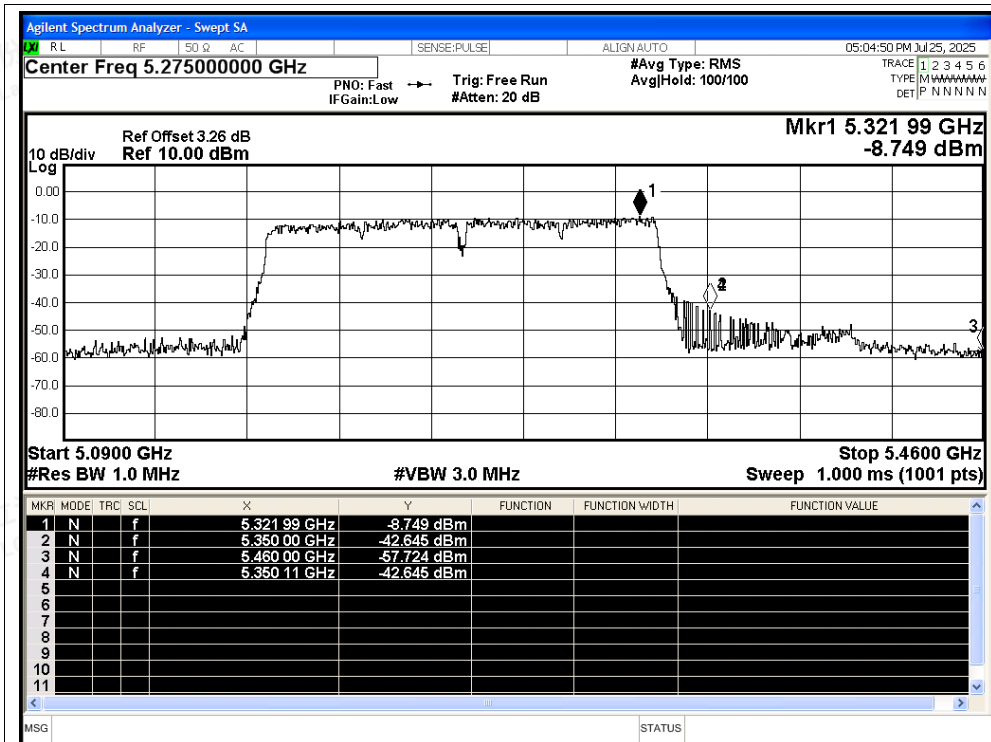

Restrict Band NVNT ac160 5250MHz Ant1 Average

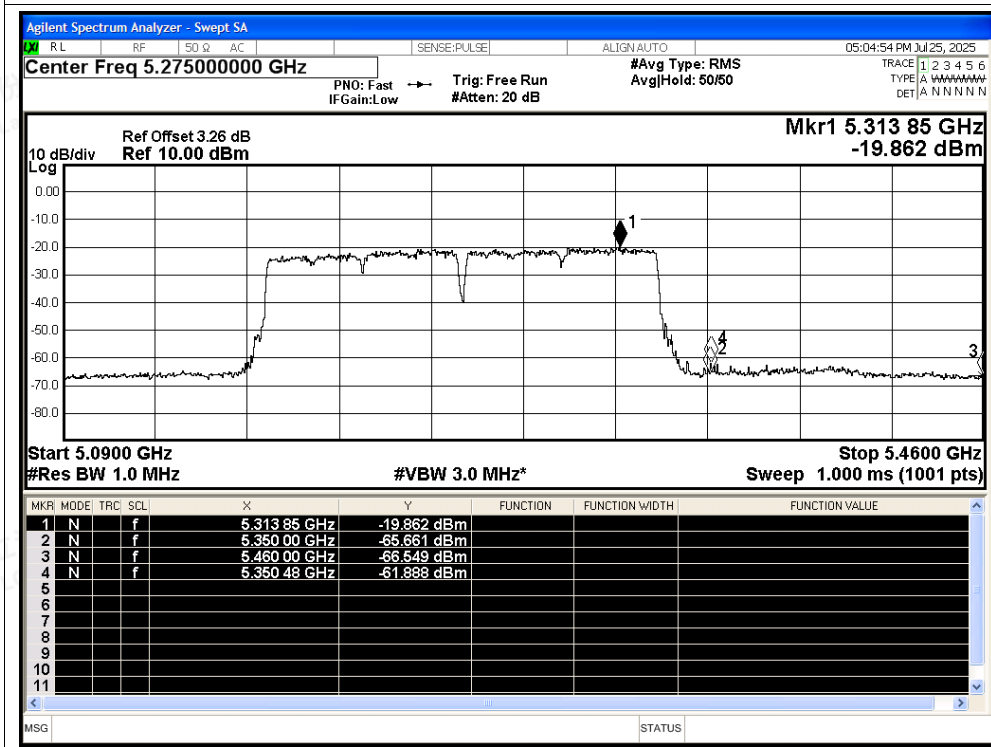

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant1 Peak

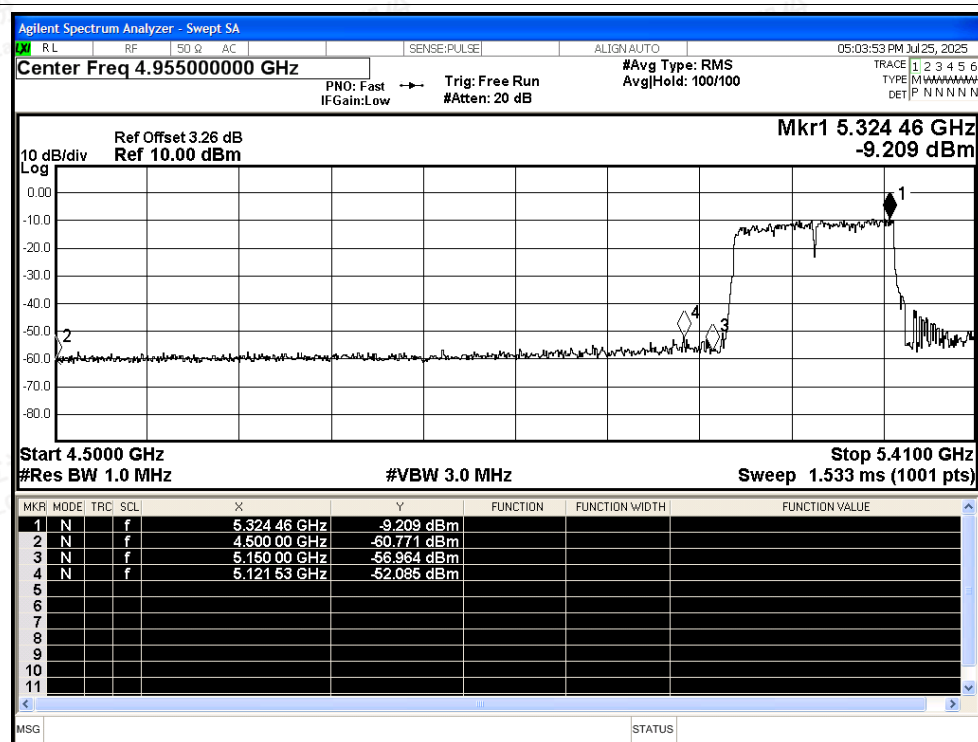

Restrict Band NVNT ac160 5250MHz Ant1 Average

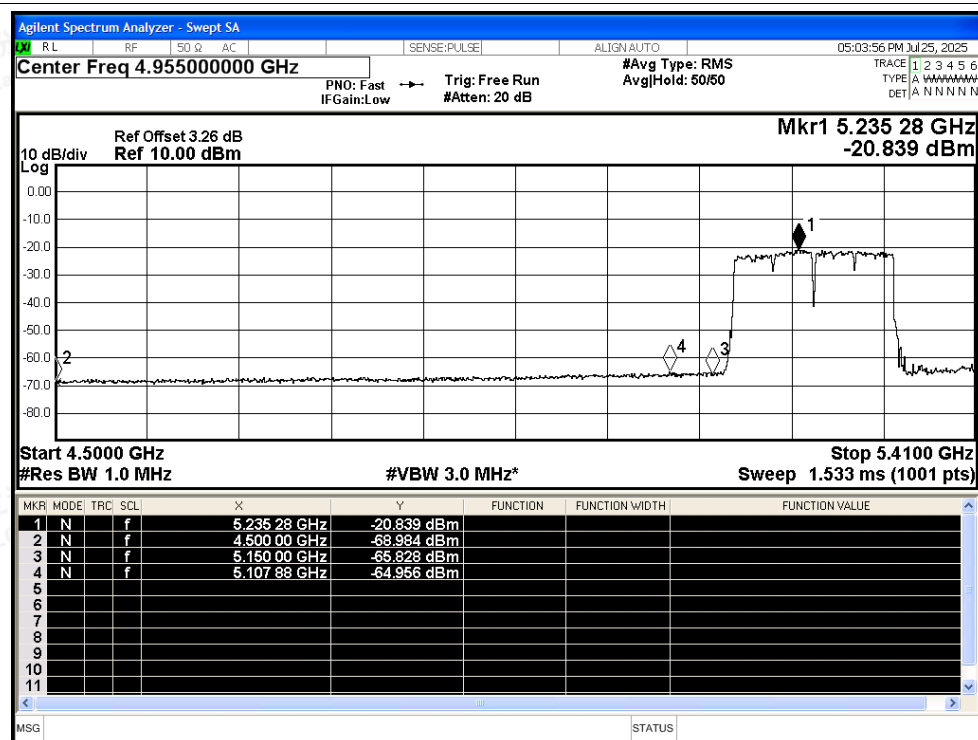

Restrict Band NVNT ax160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

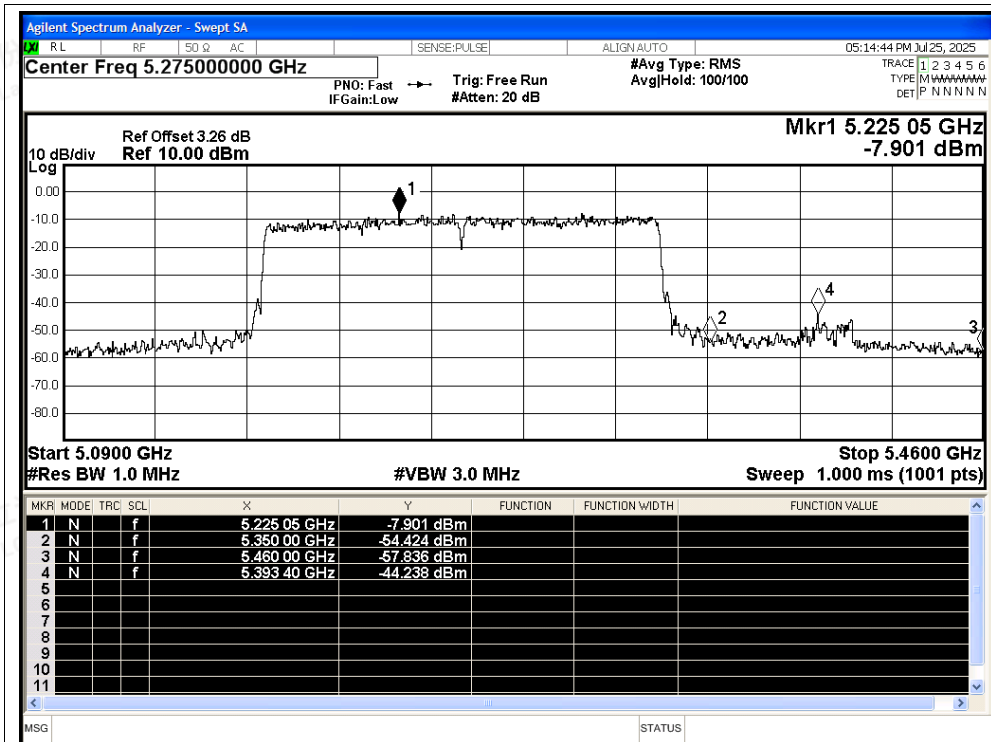

Restrict Band NVNT ax160 5250MHz Ant1 Average

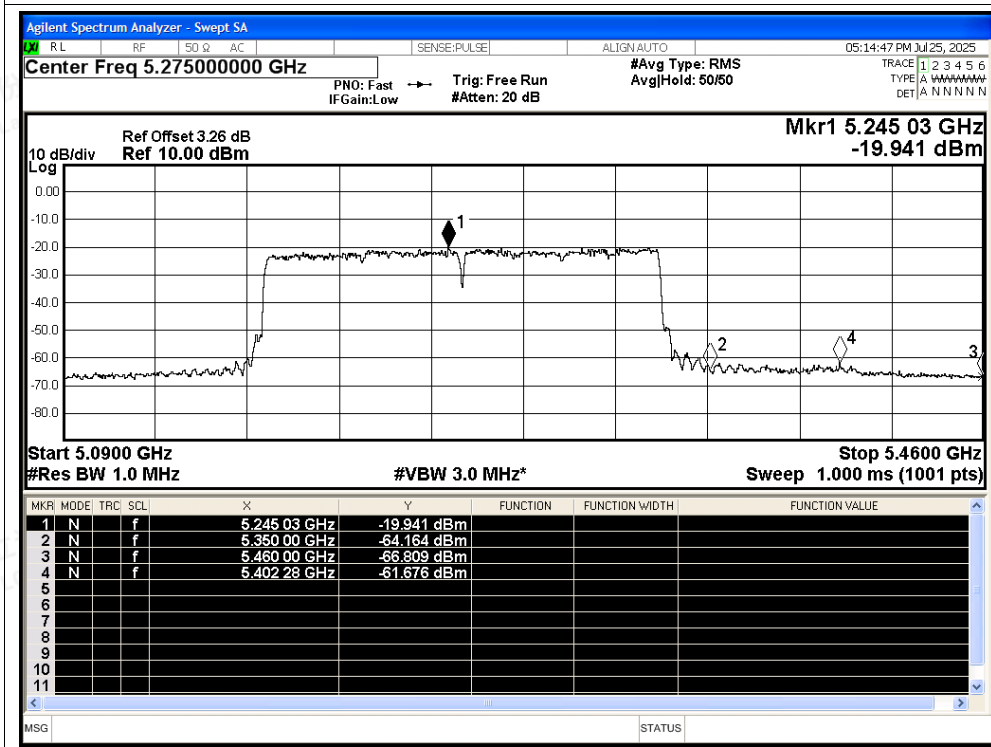

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant1 Peak

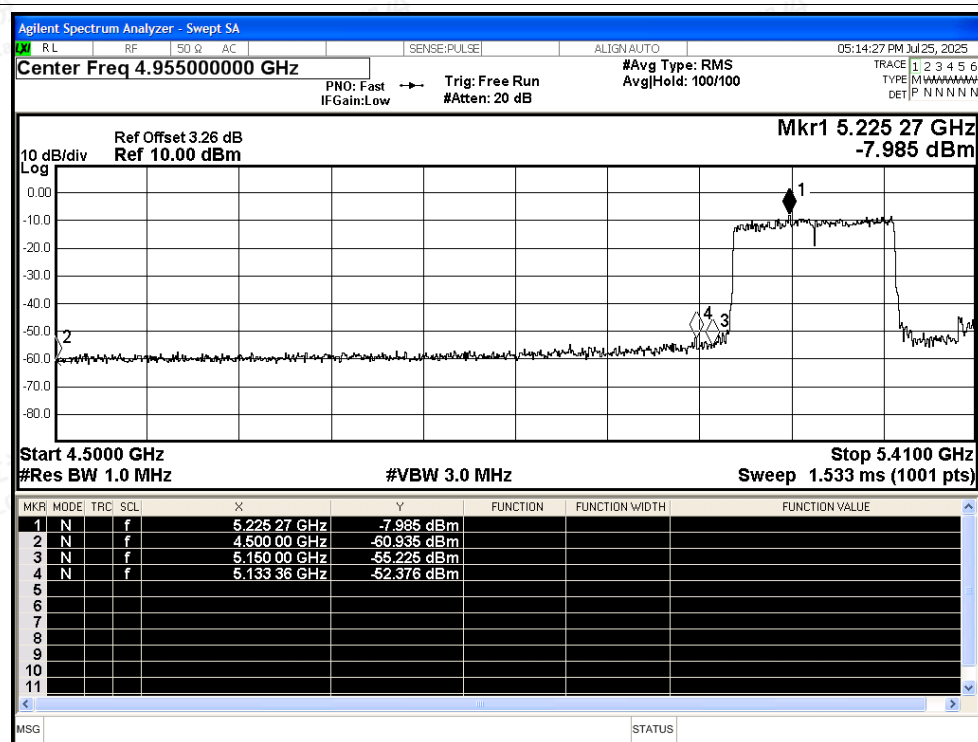

Restrict Band NVNT ax160 5250MHz Ant1 Average

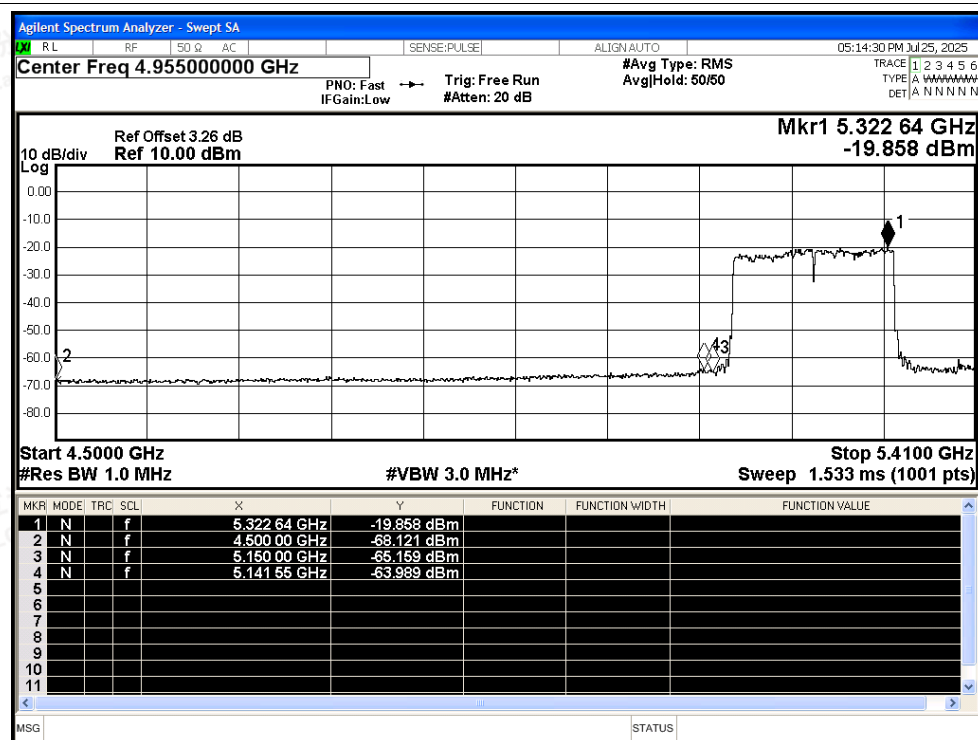

Restrict Band NVNT be160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

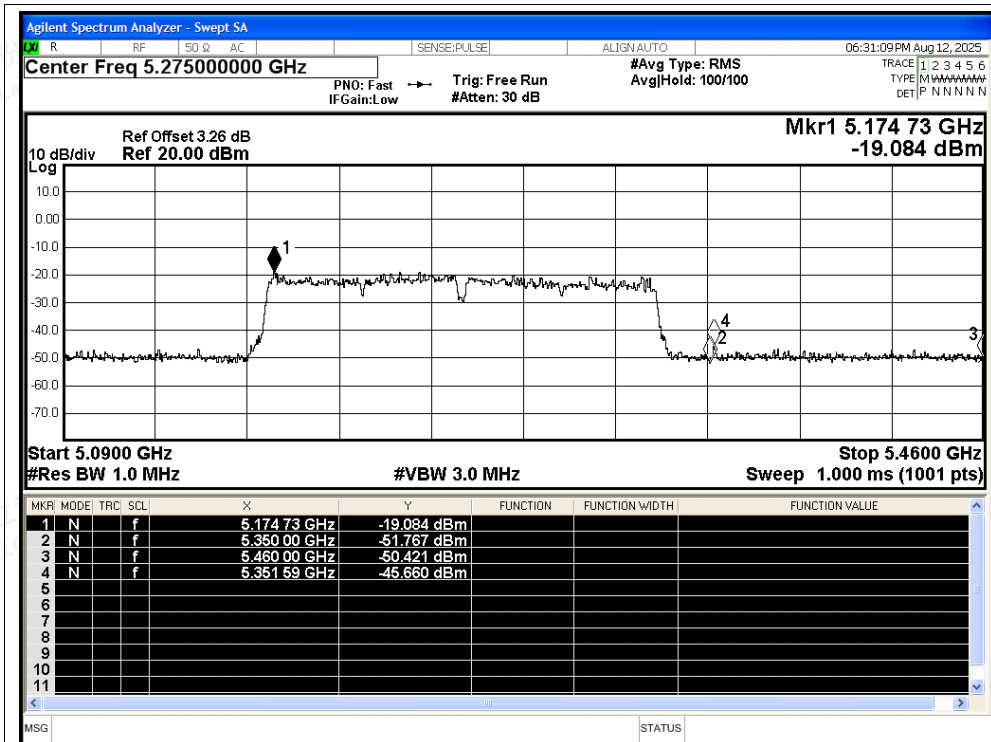

Restrict Band NVNT be160 5250MHz Ant1 Average

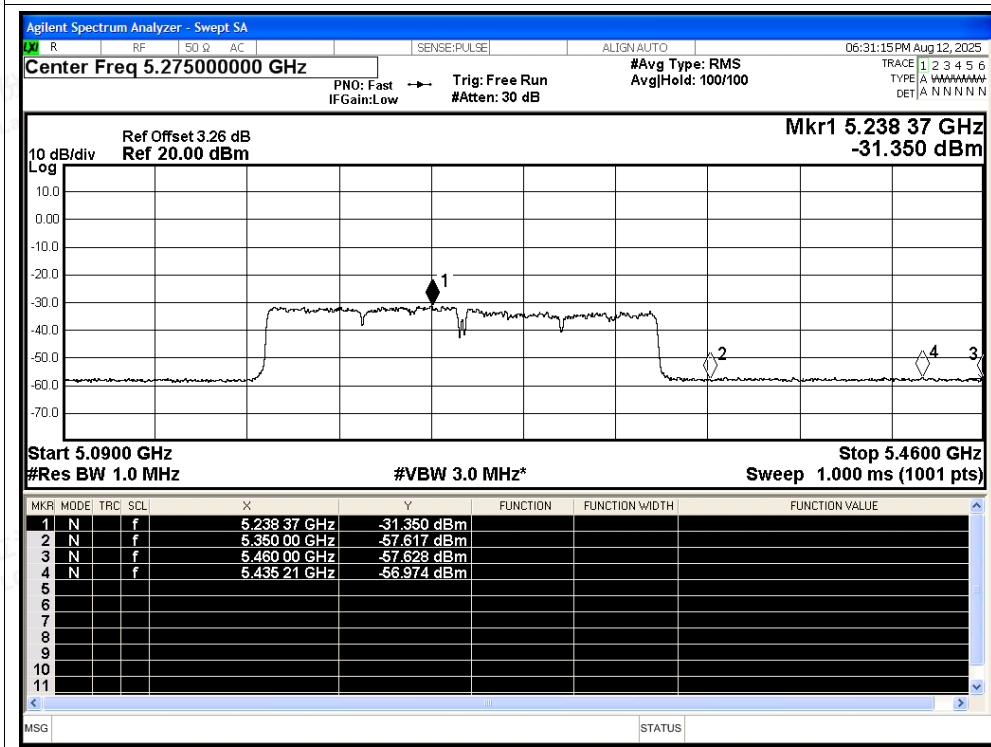

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be160 5250MHz Ant1 Peak

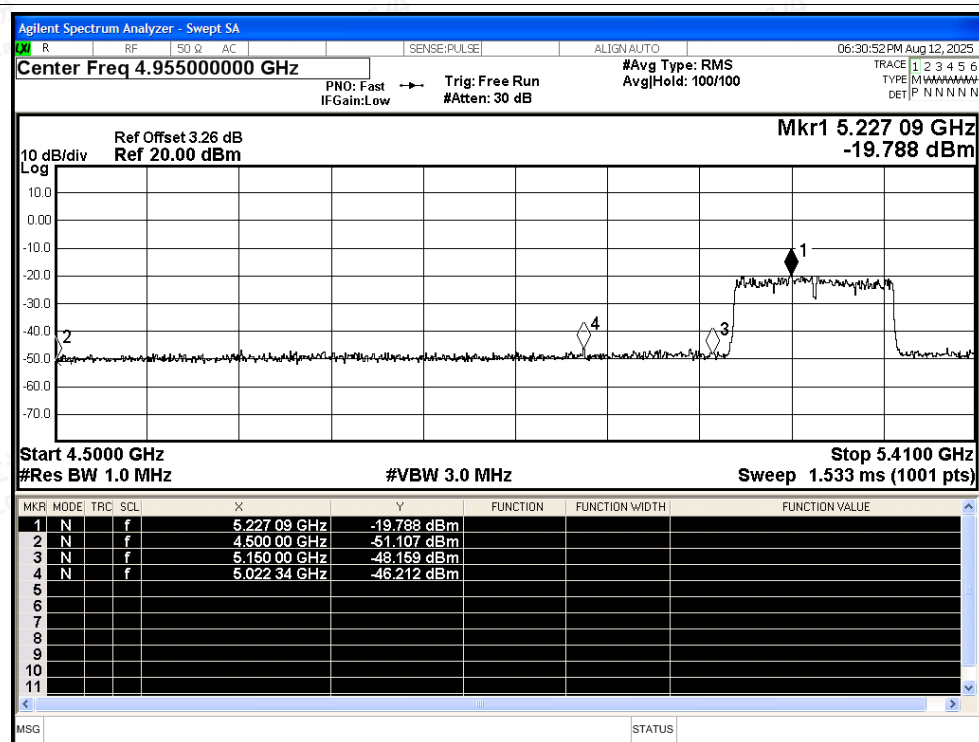

Restrict Band NVNT be160 5250MHz Ant1 Average

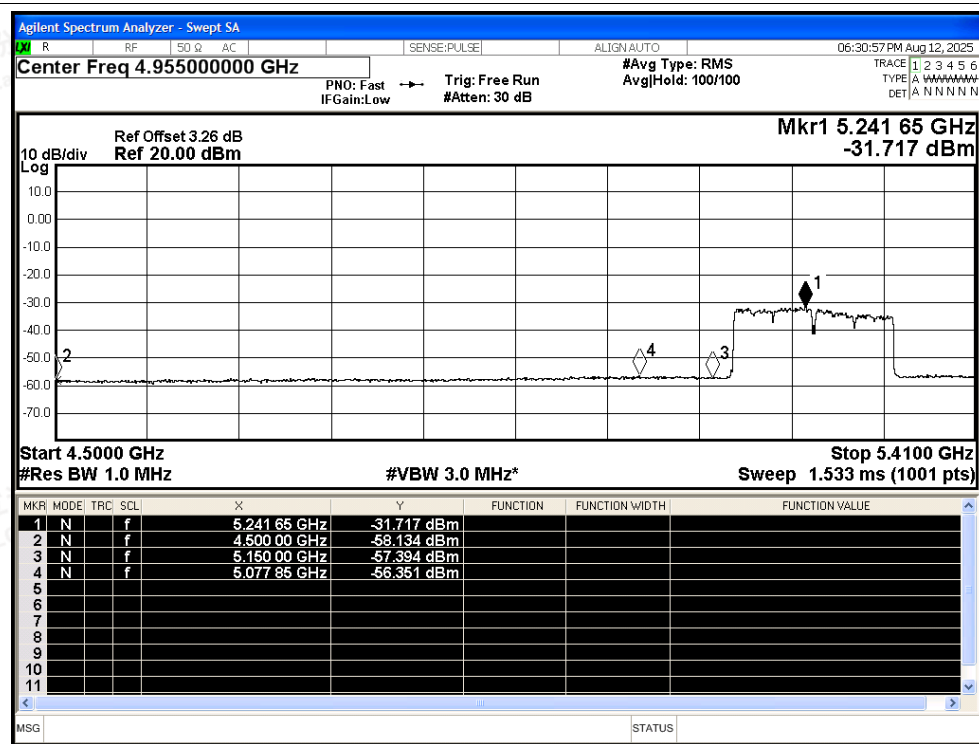

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-51.66	3.67	-	47.24	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58.9	3.67	0.24	40.24	Average	54	Pass
NVNT	a	5180	Ant2	5130.7	-45.94	3.67	-	52.96	Peak	68.2	Pass
NVNT	a	5180	Ant2	5148.2	-55.97	3.67	0.24	43.17	Average	54	Pass
NVNT	a	5180	Ant2	5150	-46.62	3.67	-	52.28	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-56.56	3.67	0.24	42.58	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50.86	3.67	-	48.04	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-58.26	3.67	0.24	40.88	Average	54	Pass
NVNT	a	5240	Ant2	5436.72	-47.57	3.67	-	51.33	Peak	68.2	Pass
NVNT	a	5240	Ant2	5436.24	-57.37	3.67	0.24	41.77	Average	54	Pass
NVNT	a	5240	Ant2	5460	-48.96	3.67	-	49.94	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-58.86	3.67	0.24	40.28	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-51.81	3.67	-	47.09	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.57	3.67	0.12	40.45	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-44.5	3.67	-	54.40	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5121.6	-56.29	3.67	0.12	42.73	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-45.46	3.67	-	53.44	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-55.85	3.67	0.12	43.17	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-49.29	3.67	-	49.61	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-58.34	3.67	0.12	40.68	Average	54	Pass
NVNT	n20	5240	Ant2	5429.76	-47.56	3.67	-	51.34	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5438.88	-57.5	3.67	0.12	41.52	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-51.37	3.67	-	47.53	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57.98	3.67	0.12	41.04	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-49.97	3.67	-	48.93	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.95	3.67	0.24	40.19	Average	54	Pass
NVNT	n40	5190	Ant2	5149.7	-39.7	3.67	-	59.20	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-55.72	3.67	0.24	43.42	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-39.7	3.67	-	59.20	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-55.72	3.67	0.24	43.42	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-49.99	3.67	-	48.91	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-58.13	3.67	0.24	41.01	Average	54	Pass
NVNT	n40	5230	Ant2	5373.6	-47.02	3.67	-	51.88	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5452.71	-57.38	3.67	0.24	41.76	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-50.18	3.67	-	48.72	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-58.28	3.67	0.24	40.86	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-50.59	3.67	-	48.31	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-59.18	3.67	0.12	39.84	Average	54	Pass
NVNT	ac20	5180	Ant2	5145.4	-45.55	3.67	-	53.35	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5149.6	-55.97	3.67	0.12	43.05	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-45.71	3.67	-	53.19	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-55.93	3.67	0.12	43.09	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-50.85	3.67	-	48.05	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-58.31	3.67	0.12	40.71	Average	54	Pass
NVNT	ac20	5240	Ant2	5391.12	-47.26	3.67	-	51.64	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5396.64	-57.48	3.67	0.12	41.54	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-49.98	3.67	-	48.92	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.53	3.67	0.12	40.49	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.03	3.67	-	48.87	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.31	3.67	0.24	40.83	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-39.96	3.67	-	58.94	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-55.67	3.67	0.24	43.47	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-39.96	3.67	-	58.94	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-55.67	3.67	0.24	43.47	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-48.86	3.67	-	50.04	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-58.69	3.67	0.24	40.45	Average	54	Pass
NVNT	ac40	5230	Ant2	5441.37	-47.77	3.67	-	51.13	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5361.99	-57.45	3.67	0.24	41.69	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-48.64	3.67	-	50.26	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-57.58	3.67	0.24	41.56	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-47.92	3.67	-	50.98	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.78	3.67	0.47	42.59	Average	54	Pass
NVNT	ac80	5210	Ant2	5383.11	-46.32	3.67	-	52.58	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350.77	-56.19	3.67	0.47	43.18	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-50.24	3.67	-	48.66	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-57.85	3.67	0.47	41.52	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-50.37	3.67	-	48.53	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.89	3.67	0.47	40.48	Average	54	Pass
NVNT	ac80	5210	Ant2	5148.59	-44.34	3.67	-	54.56	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-55.23	3.67	0.47	44.14	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-44.86	3.67	-	54.04	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-55.6	3.67	0.47	43.77	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-50.62	3.67	-	48.28	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.4	3.67	0.12	40.62	Average	54	Pass
NVNT	ax20	5180	Ant2	5146.1	-45.6	3.67	-	53.30	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5148.9	-55.37	3.67	0.12	43.65	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-45.46	3.67	-	53.44	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-55.38	3.67	0.12	43.64	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-51	3.67	-	47.90	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-58.84	3.67	0.12	40.18	Average	54	Pass
NVNT	ax20	5240	Ant2	5435.04	-47.86	3.67	-	51.04	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5367.36	-57.47	3.67	0.12	41.55	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant2	5460	-51.14	3.67	-	47.76	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-58.44	3.67	0.12	40.58	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-48.74	3.67	-	50.16	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-59.23	3.67	0.24	39.91	Average	54	Pass
NVNT	ax40	5190	Ant2	5148.24	-44.56	3.67	-	54.34	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-55.29	3.67	0.24	43.85	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-45.03	3.67	-	53.87	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-55.29	3.67	0.24	43.85	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-49.75	3.67	-	49.15	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-58.18	3.67	0.24	40.96	Average	54	Pass
NVNT	ax40	5230	Ant2	5370.9	-46.61	3.67	-	52.29	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5395.2	-57.44	3.67	0.24	41.70	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-49.94	3.67	-	48.96	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-57.91	3.67	0.24	41.23	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-47.59	3.67	-	51.31	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-56.81	3.67	0.47	42.56	Average	54	Pass
NVNT	ax80	5210	Ant2	5373.87	-46.29	3.67	-	52.61	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5356.05	-56.26	3.67	0.47	43.11	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-49.76	3.67	-	49.14	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-58.08	3.67	0.47	41.29	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-50.2	3.67	-	48.70	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.87	3.67	0.47	40.50	Average	54	Pass
NVNT	ax80	5210	Ant2	5148.59	-45.35	3.67	-	53.55	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-55.37	3.67	0.47	44.00	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-47.15	3.67	-	51.75	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-55.01	3.67	0.47	44.36	Average	54	Pass
NVNT	be20	5180	Ant2	4500	-49.91	3.67	-	48.99	Peak	68.2	Pass
NVNT	be20	5180	Ant2	4500	-59.1	3.67	0.12	39.92	Average	54	Pass
NVNT	be20	5180	Ant2	5097.8	-45.77	3.67	-	53.13	Peak	68.2	Pass
NVNT	be20	5180	Ant2	5146.1	-56.18	3.67	0.12	42.84	Average	54	Pass
NVNT	be20	5180	Ant2	5150	-47.66	3.67	-	51.24	Peak	68.2	Pass
NVNT	be20	5180	Ant2	5150	-56.58	3.67	0.12	42.44	Average	54	Pass
NVNT	be20	5240	Ant2	5350	-51.82	3.67	-	47.08	Peak	68.2	Pass
NVNT	be20	5240	Ant2	5350	-57.89	3.67	0.12	41.13	Average	54	Pass
NVNT	be20	5240	Ant2	5390.4	-47.23	3.67	-	51.67	Peak	68.2	Pass
NVNT	be20	5240	Ant2	5455.92	-57.47	3.67	0.12	41.55	Average	54	Pass
NVNT	be20	5240	Ant2	5460	-50.92	3.67	-	47.98	Peak	68.2	Pass
NVNT	be20	5240	Ant2	5460	-58.03	3.67	0.12	40.99	Average	54	Pass
NVNT	be40	5190	Ant2	4500	-50.28	3.67	-	48.62	Peak	68.2	Pass
NVNT	be40	5190	Ant2	4500	-58.3	3.67	0.24	40.84	Average	54	Pass
NVNT	be40	5190	Ant2	5148.24	-44.86	3.67	-	54.04	Peak	68.2	Pass
NVNT	be40	5190	Ant2	5149.7	-54.92	3.67	0.24	44.22	Average	54	Pass
NVNT	be40	5190	Ant2	5150	-45.81	3.67	-	53.09	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5190	Ant2	5150	-54.92	3.67	0.24	44.22	Average	54	Pass
NVNT	be40	5230	Ant2	5350	-50.1	3.67	-	48.80	Peak	68.2	Pass
NVNT	be40	5230	Ant2	5350	-58.39	3.67	0.24	40.75	Average	54	Pass
NVNT	be40	5230	Ant2	5370.63	-47.33	3.67	-	51.57	Peak	68.2	Pass
NVNT	be40	5230	Ant2	5357.4	-57.38	3.67	0.24	41.76	Average	54	Pass
NVNT	be40	5230	Ant2	5460	-50.27	3.67	-	48.63	Peak	68.2	Pass
NVNT	be40	5230	Ant2	5460	-58.65	3.67	0.24	40.49	Average	54	Pass
NVNT	be80	5210	Ant2	5350	-48.12	3.67	-	50.78	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5350	-56.7	3.67	0.47	42.67	Average	54	Pass
NVNT	be80	5210	Ant2	5416.44	-45.54	3.67	-	53.36	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5353.74	-56.6	3.67	0.47	42.77	Average	54	Pass
NVNT	be80	5210	Ant2	5460	-49.83	3.67	-	49.07	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5460	-58.24	3.67	0.47	41.13	Average	54	Pass
NVNT	be80	5210	Ant2	4500	-50.52	3.67	-	48.38	Peak	68.2	Pass
NVNT	be80	5210	Ant2	4500	-58.99	3.67	0.47	40.38	Average	54	Pass
NVNT	be80	5210	Ant2	5149.38	-44.64	3.67	-	54.26	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5149.38	-55.42	3.67	0.47	43.95	Average	54	Pass
NVNT	be80	5210	Ant2	5150	-46.68	3.67	-	52.22	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5150	-55.91	3.67	0.47	43.46	Average	54	Pass
NVNT	ac160	5250	Ant2	5350	-54.66	3.67	-	44.24	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5350	-63.9	3.67	3.99	38.99	Average	54	Pass
NVNT	ac160	5250	Ant2	5353.07	-42.81	3.67	-	56.09	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5353.44	-60.94	3.67	3.99	41.95	Average	54	Pass
NVNT	ac160	5250	Ant2	5460	-58.89	3.67	-	40.01	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5460	-67.38	3.67	3.99	35.51	Average	54	Pass
NVNT	ac160	5250	Ant2	4500	-60.22	3.67	-	38.68	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	4500	-68.57	3.67	3.99	34.32	Average	54	Pass
NVNT	ac160	5250	Ant2	5143.37	-50.24	3.67	-	48.66	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5142.46	-63.87	3.67	3.99	39.02	Average	54	Pass
NVNT	ac160	5250	Ant2	5150	-56.26	3.67	-	42.64	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5150	-66.26	3.67	3.99	36.63	Average	54	Pass
NVNT	ax160	5250	Ant2	5350	-51.53	3.67	-	47.37	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5350	-63.93	3.67	3.98	38.95	Average	54	Pass
NVNT	ax160	5250	Ant2	5406.72	-43.98	3.67	-	54.92	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5352.7	-61.72	3.67	3.98	41.16	Average	54	Pass
NVNT	ax160	5250	Ant2	5460	-59.17	3.67	-	39.73	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5460	-66.72	3.67	3.98	36.16	Average	54	Pass
NVNT	ax160	5250	Ant2	4500	-61.48	3.67	-	37.42	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	4500	-68.5	3.67	3.98	34.38	Average	54	Pass
NVNT	ax160	5250	Ant2	5132.45	-50.69	3.67	-	48.21	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5143.37	-63.05	3.67	3.98	39.83	Average	54	Pass
NVNT	ax160	5250	Ant2	5150	-55.59	3.67	-	43.31	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5150	-65.03	3.67	3.98	37.85	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	be160	5250	Ant2	5350	-48.55	3.67	-	50.35	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5350	-57.18	3.67	3.77	45.49	Average	54	Pass
NVNT	be160	5250	Ant2	5354.92	-41.72	3.67	-	57.18	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5374.9	-56.33	3.67	3.77	46.34	Average	54	Pass
NVNT	be160	5250	Ant2	5460	-48.83	3.67	-	50.07	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5460	-57.63	3.67	3.77	45.04	Average	54	Pass
NVNT	be160	5250	Ant2	4500	-48.62	3.67	-	50.28	Peak	68.2	Pass
NVNT	be160	5250	Ant2	4500	-59.09	3.67	3.77	43.58	Average	54	Pass
NVNT	be160	5250	Ant2	5143.37	-46.02	3.67	-	52.88	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5085.13	-56.26	3.67	3.77	46.41	Average	54	Pass
NVNT	be160	5250	Ant2	5150	-48.07	3.67	-	50.83	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5150	-57.36	3.67	3.77	45.31	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

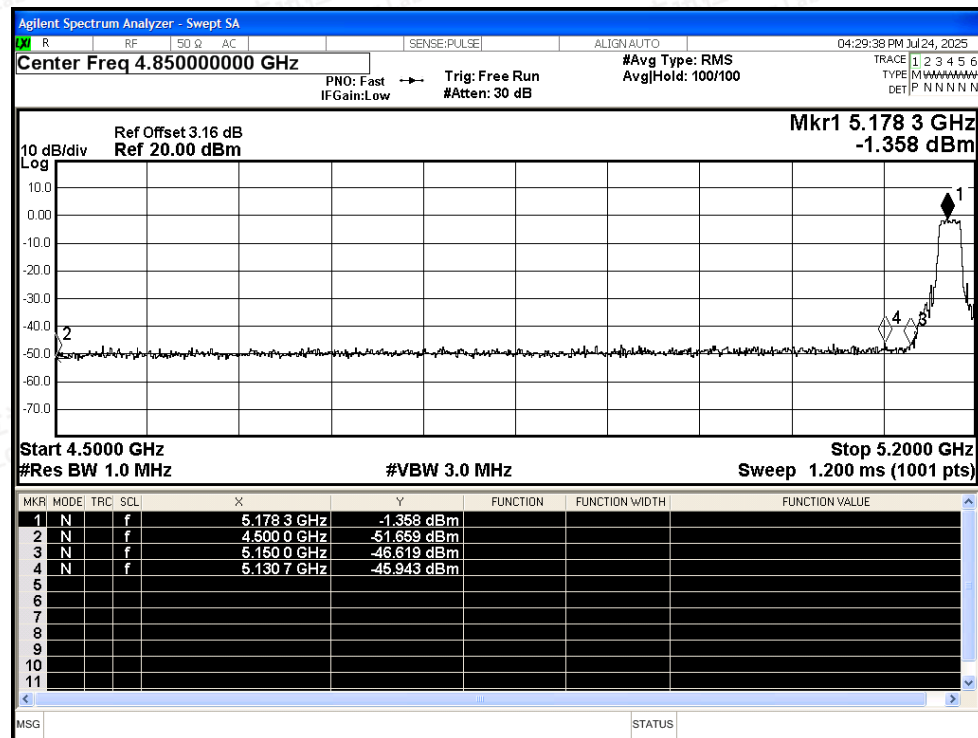

Restrict Band NVNT a 5180MHz Ant2 Average

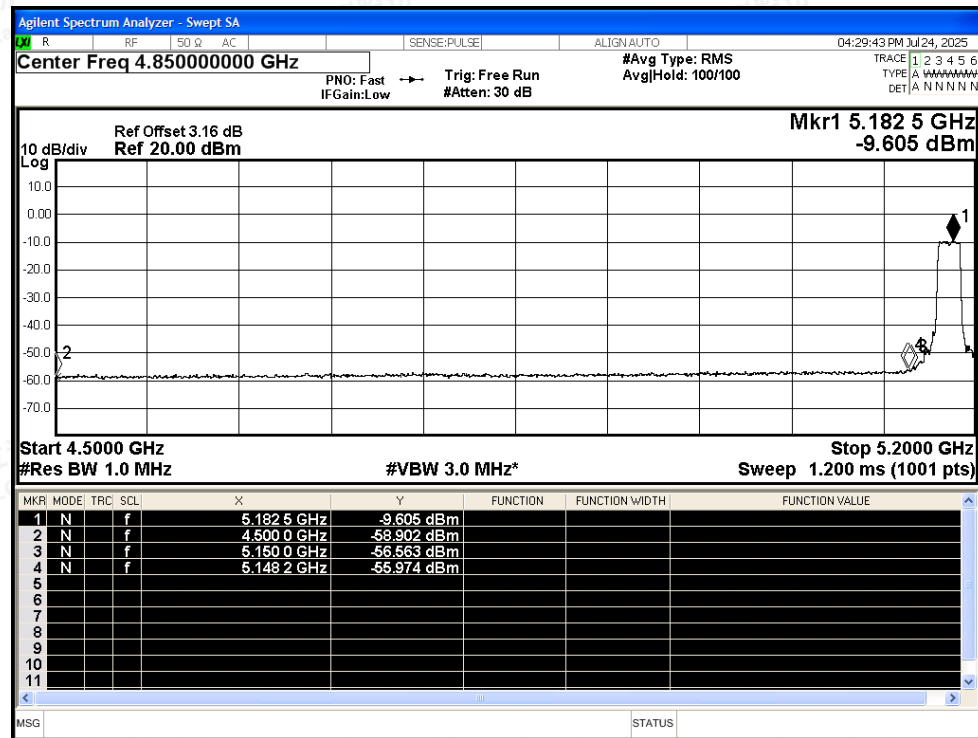

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

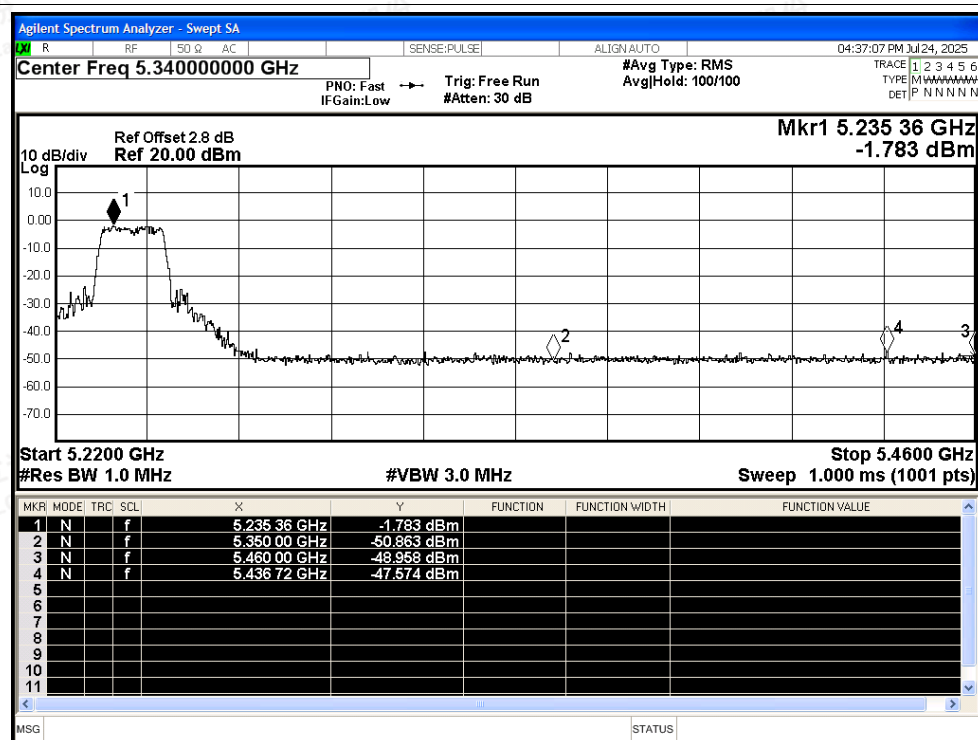

Restrict Band NVNT a 5240MHz Ant2 Average

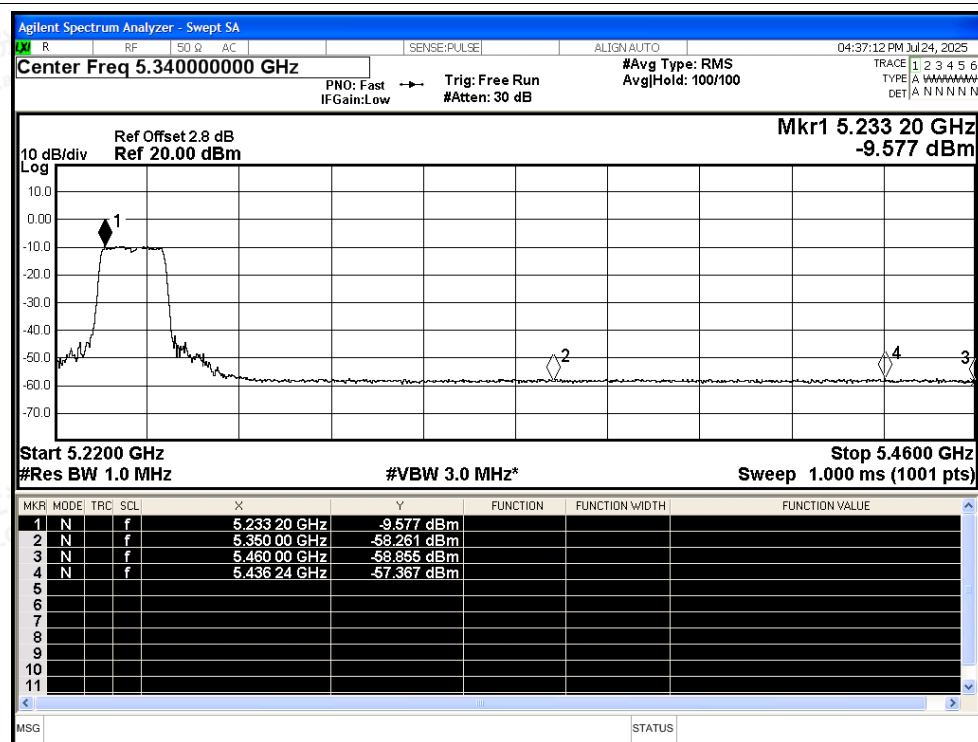

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

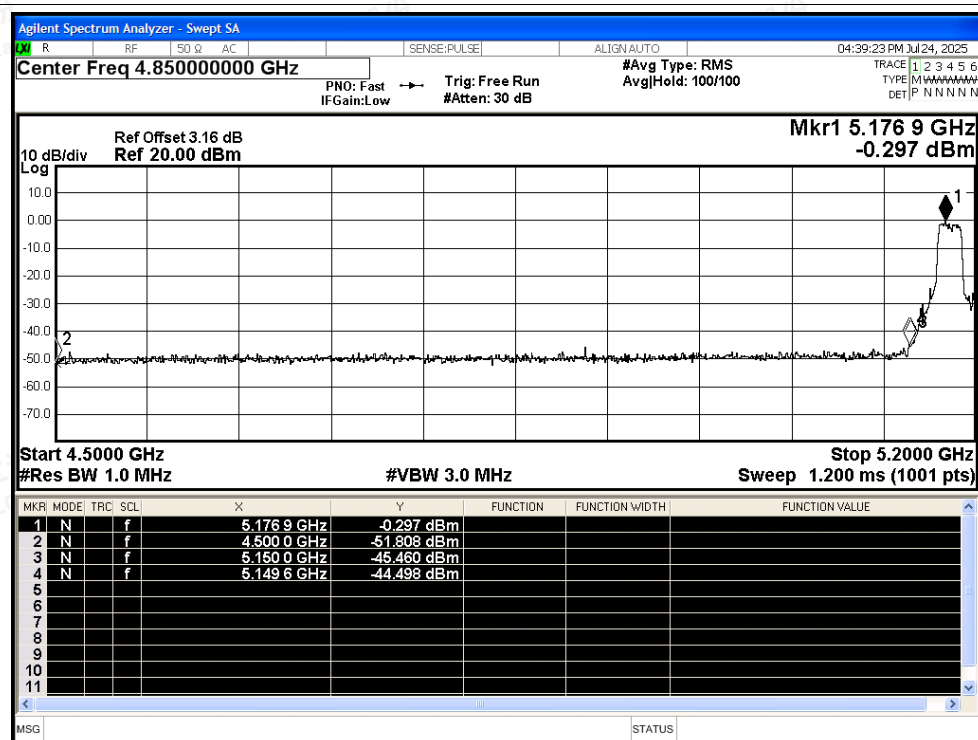

Restrict Band NVNT n20 5180MHz Ant2 Average

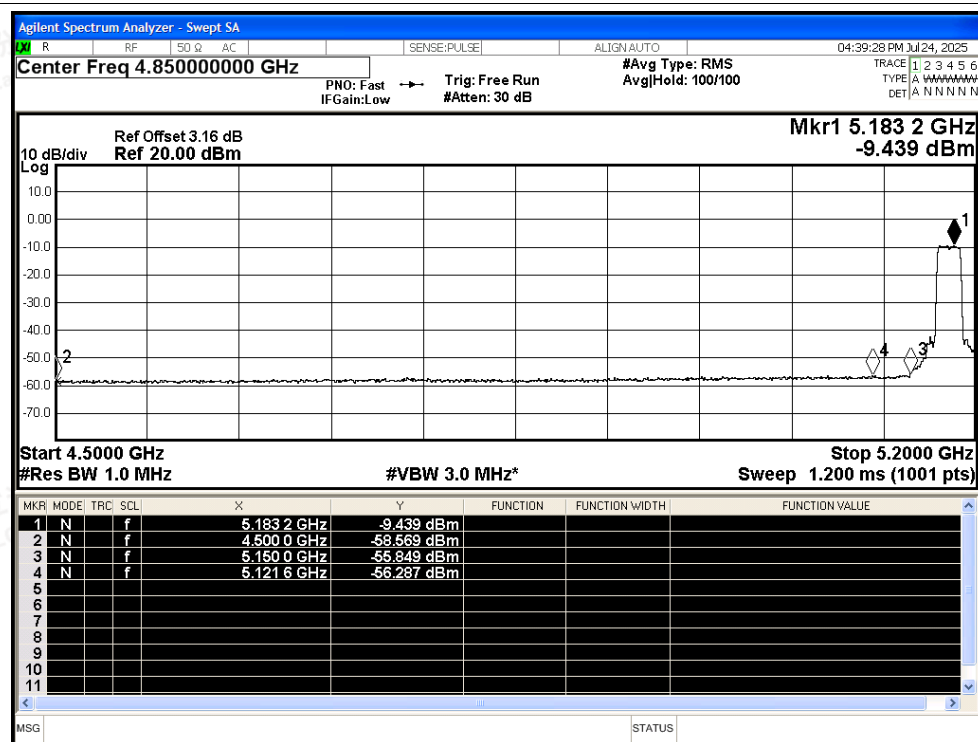

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

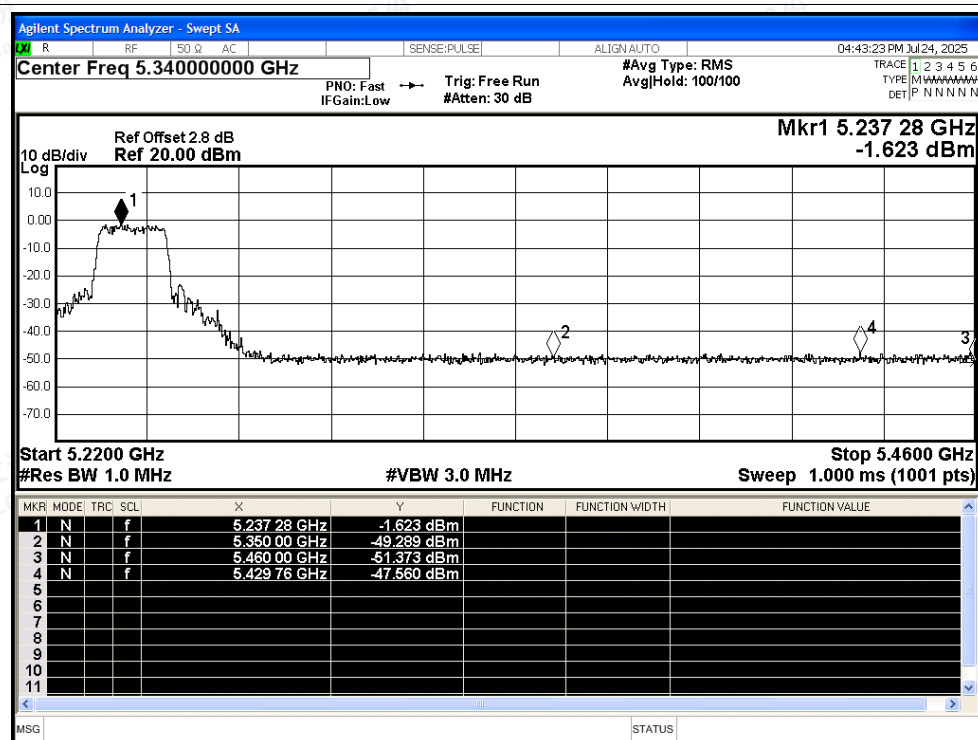

Restrict Band NVNT n20 5240MHz Ant2 Average

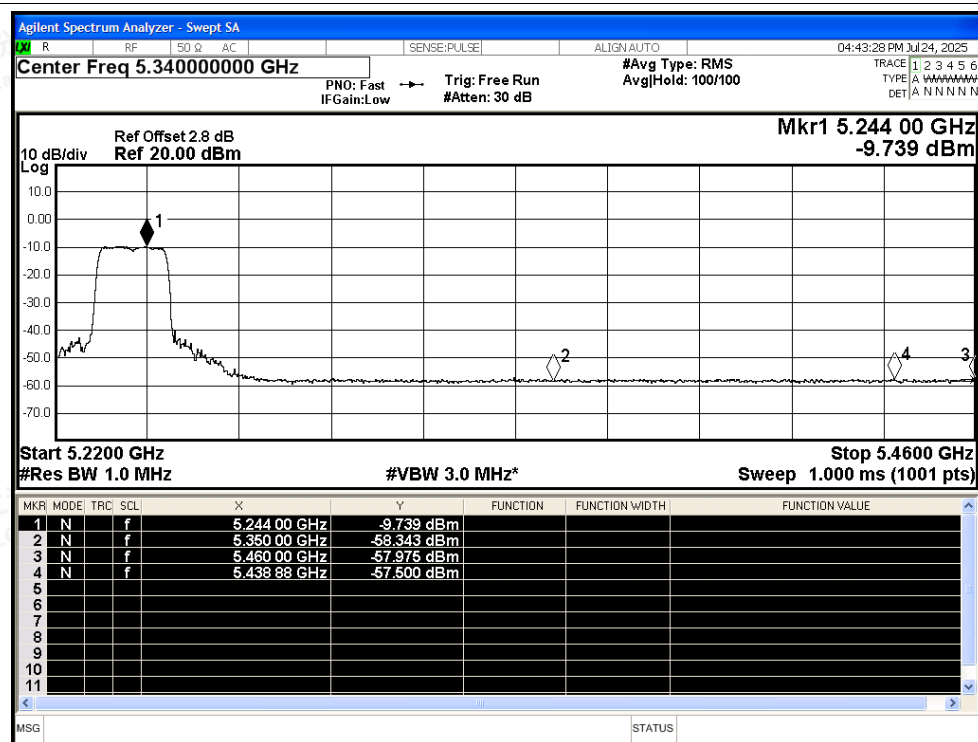

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

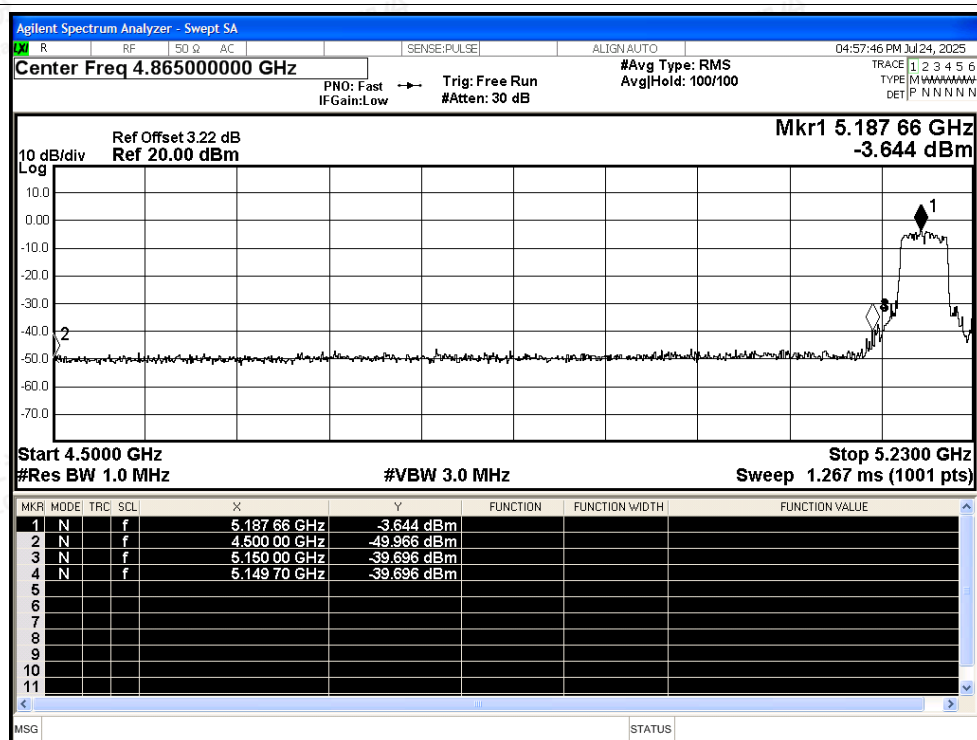

Restrict Band NVNT n40 5190MHz Ant2 Average

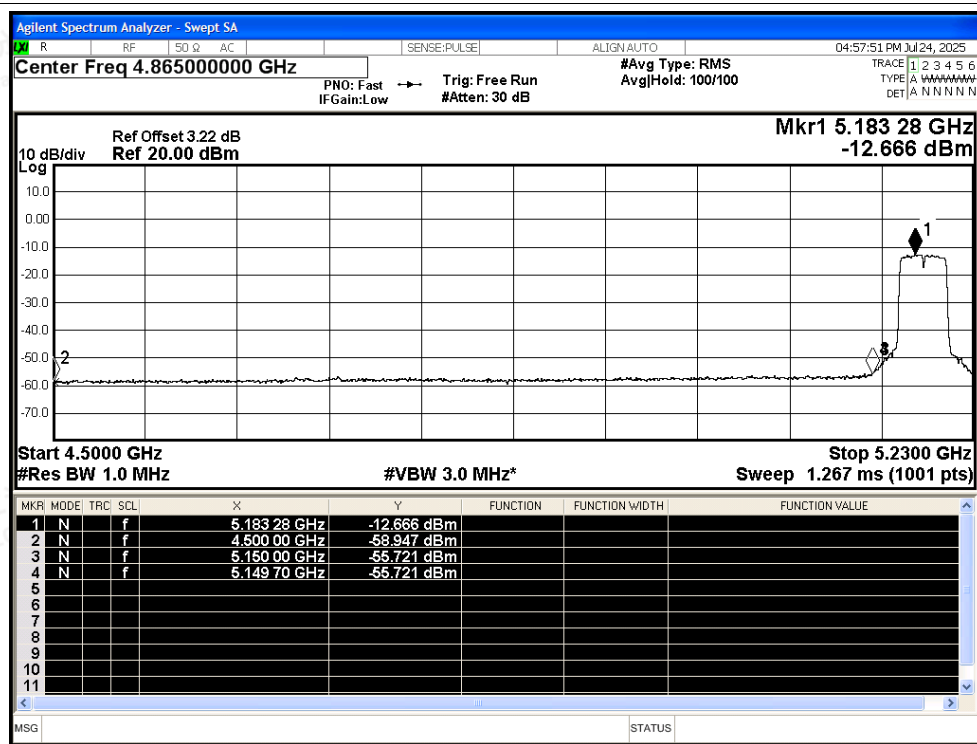

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

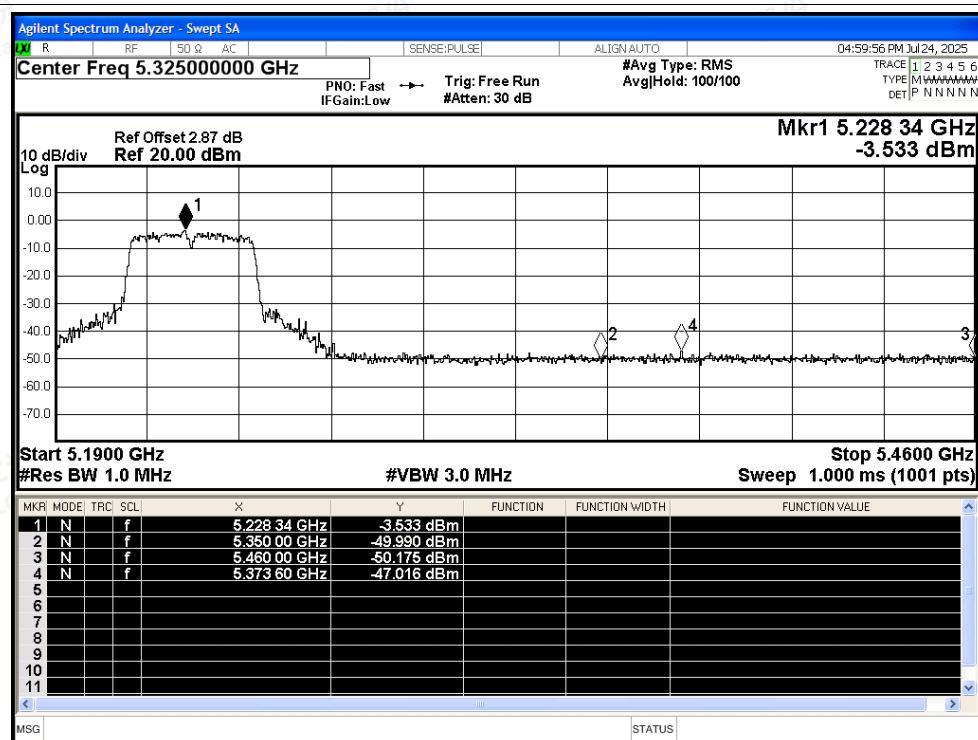

Restrict Band NVNT n40 5230MHz Ant2 Average

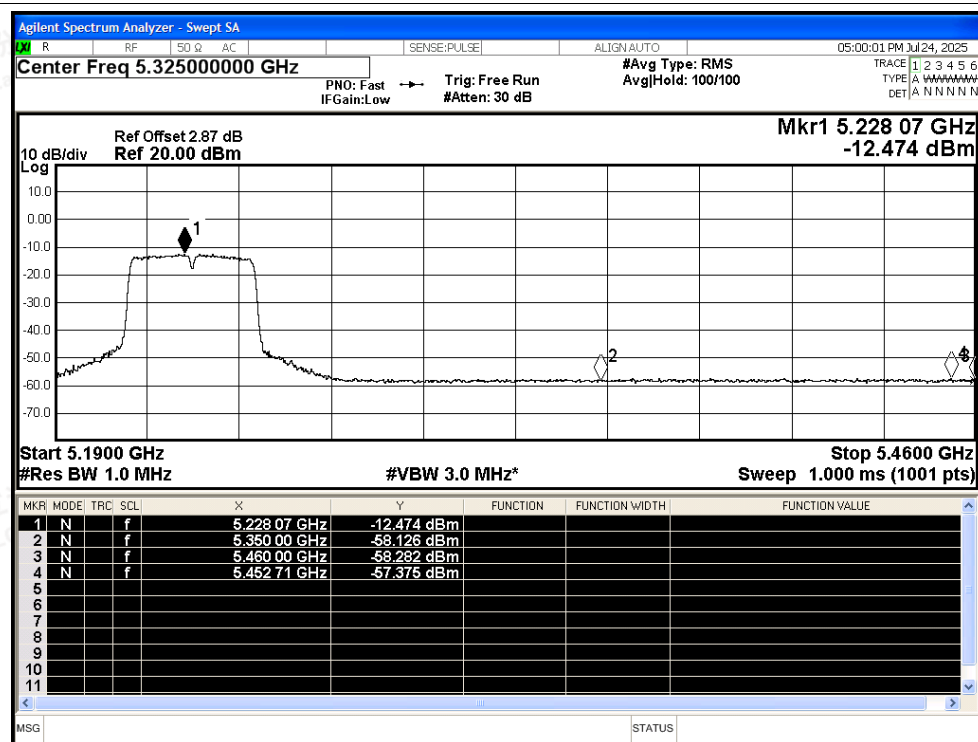

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

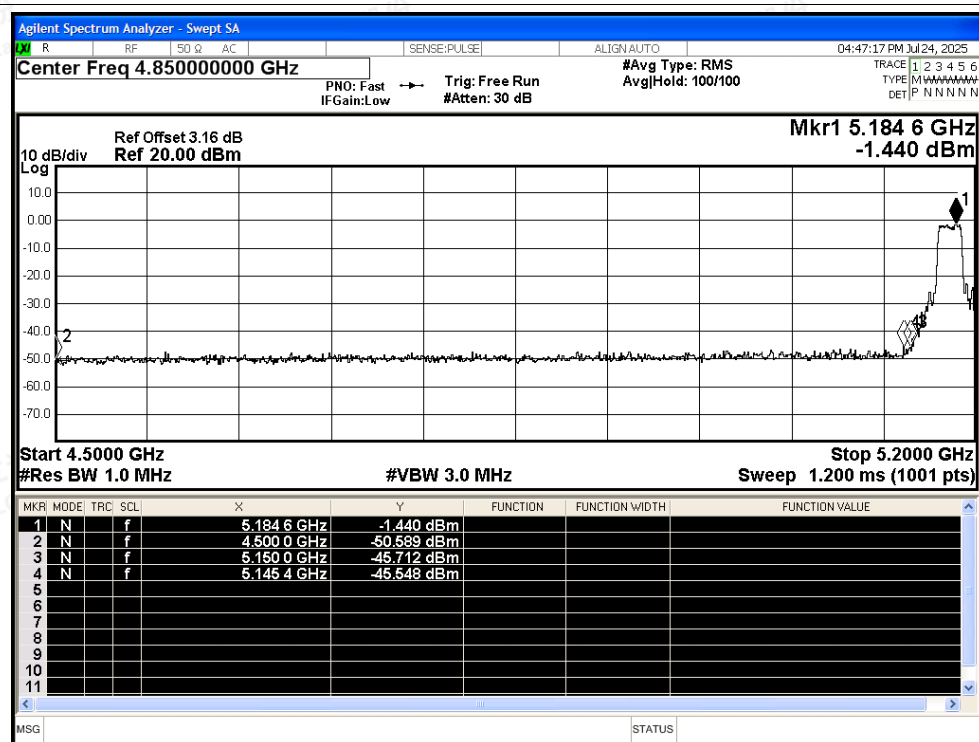

Restrict Band NVNT ac20 5180MHz Ant2 Average

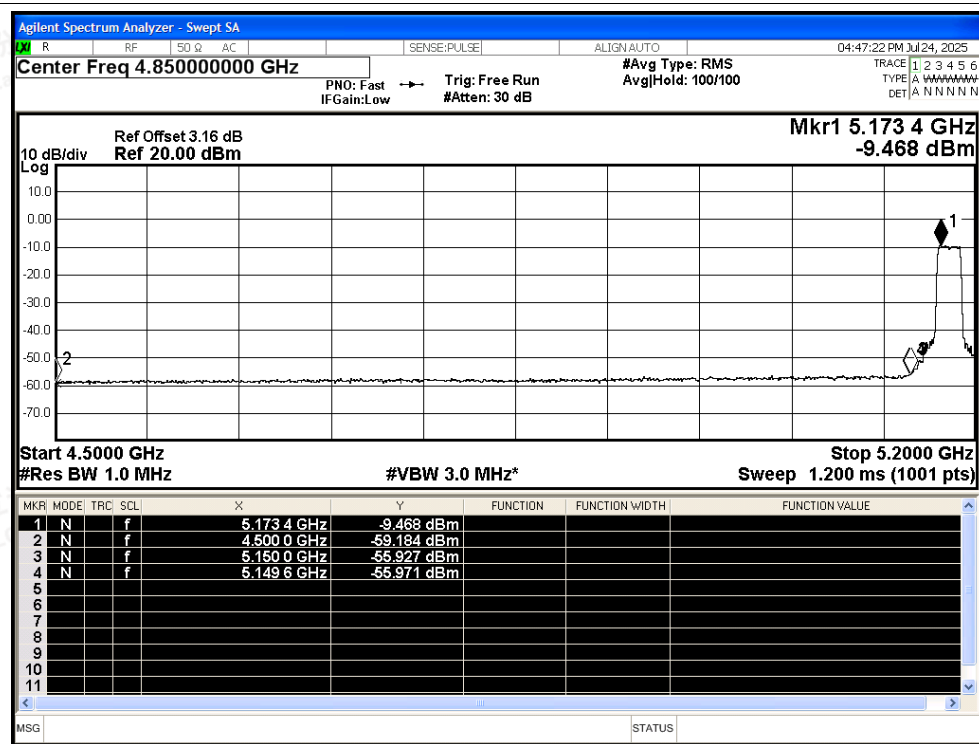

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

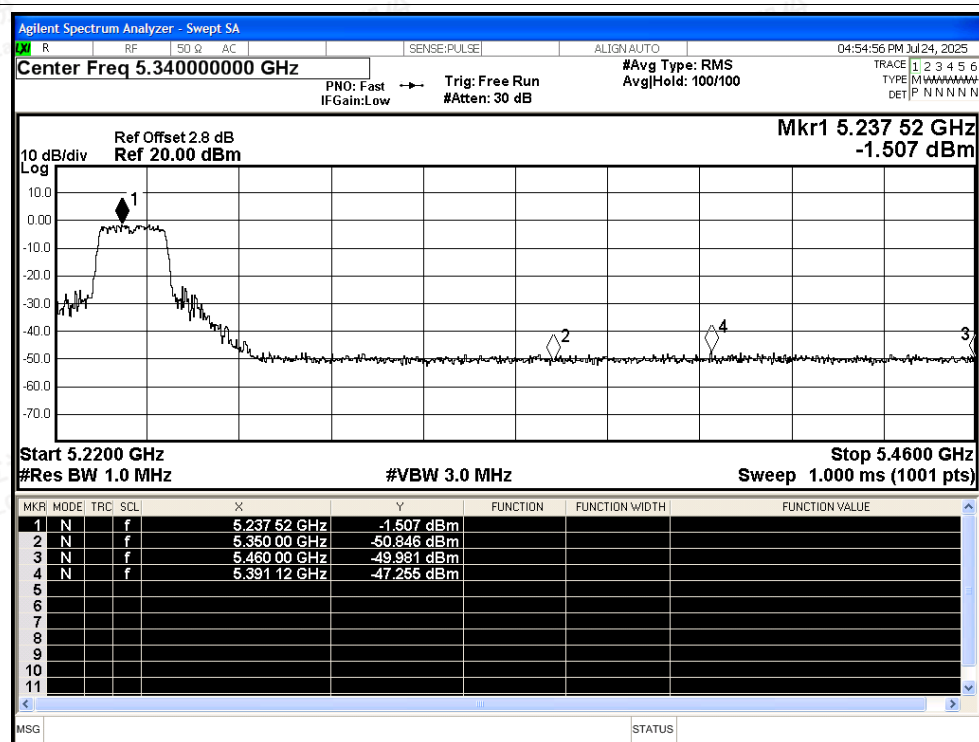

Restrict Band NVNT ac20 5240MHz Ant2 Average

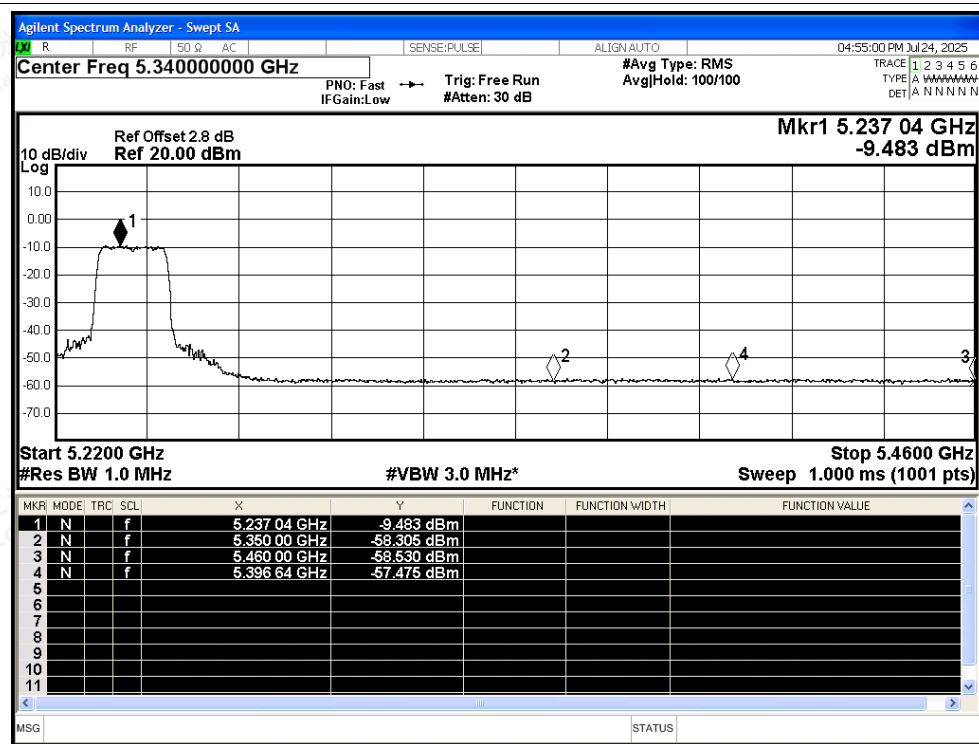

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

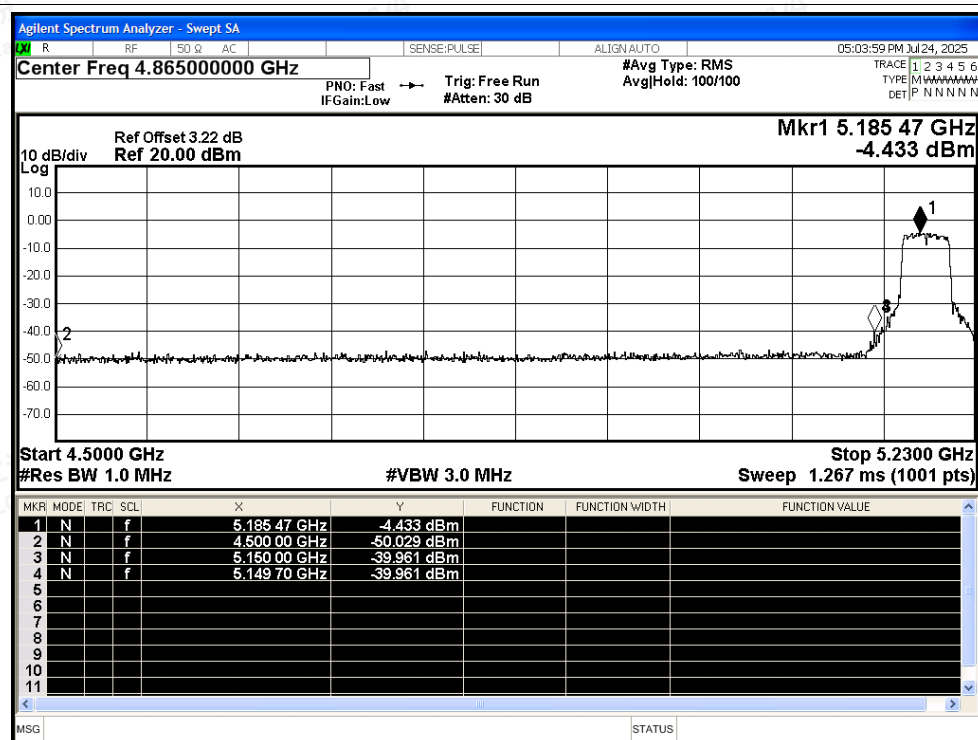

Restrict Band NVNT ac40 5190MHz Ant2 Average

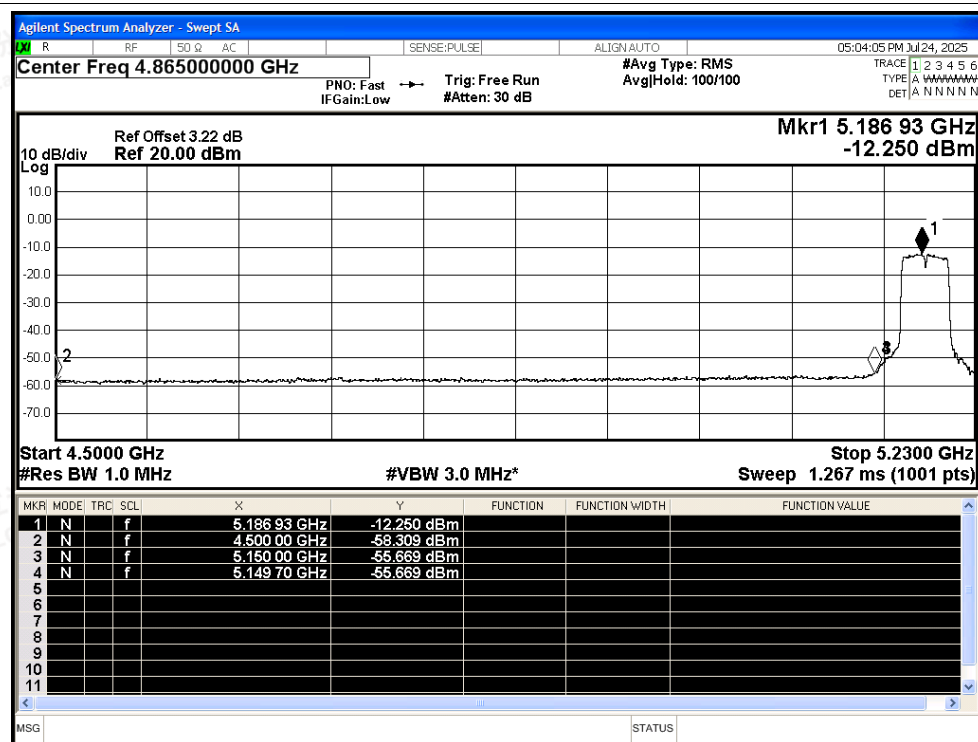

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

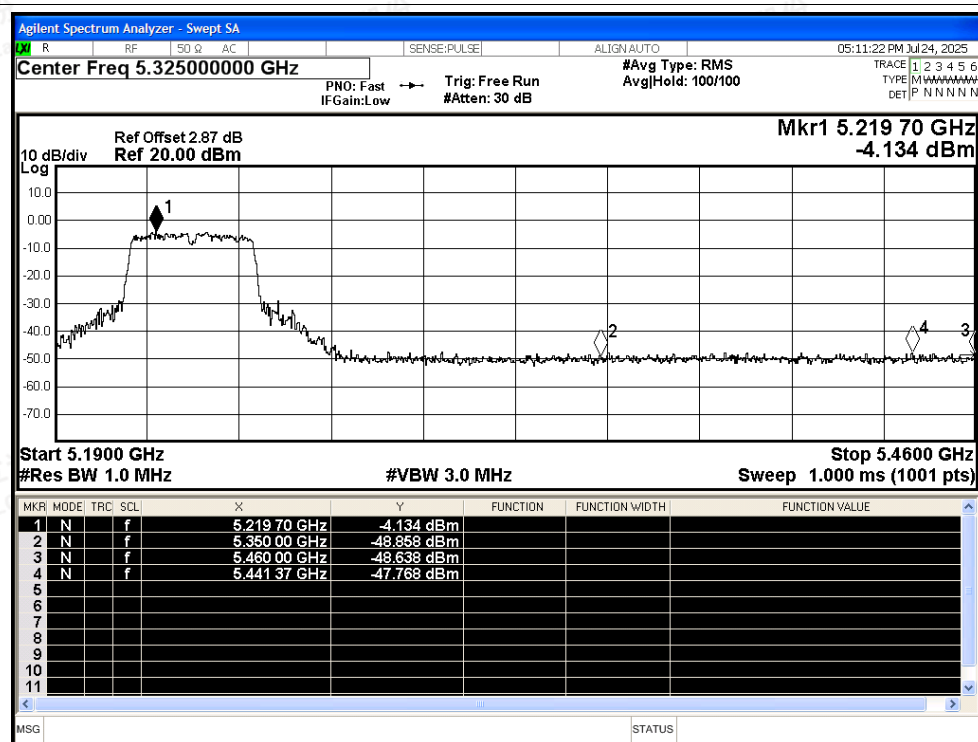

Restrict Band NVNT ac40 5230MHz Ant2 Average

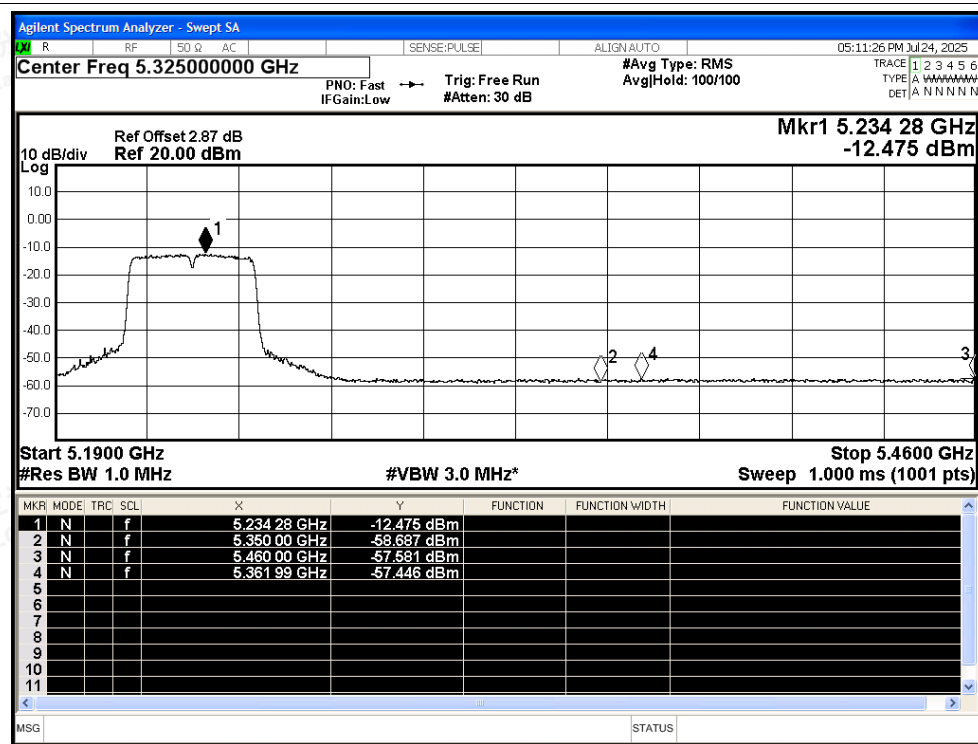

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

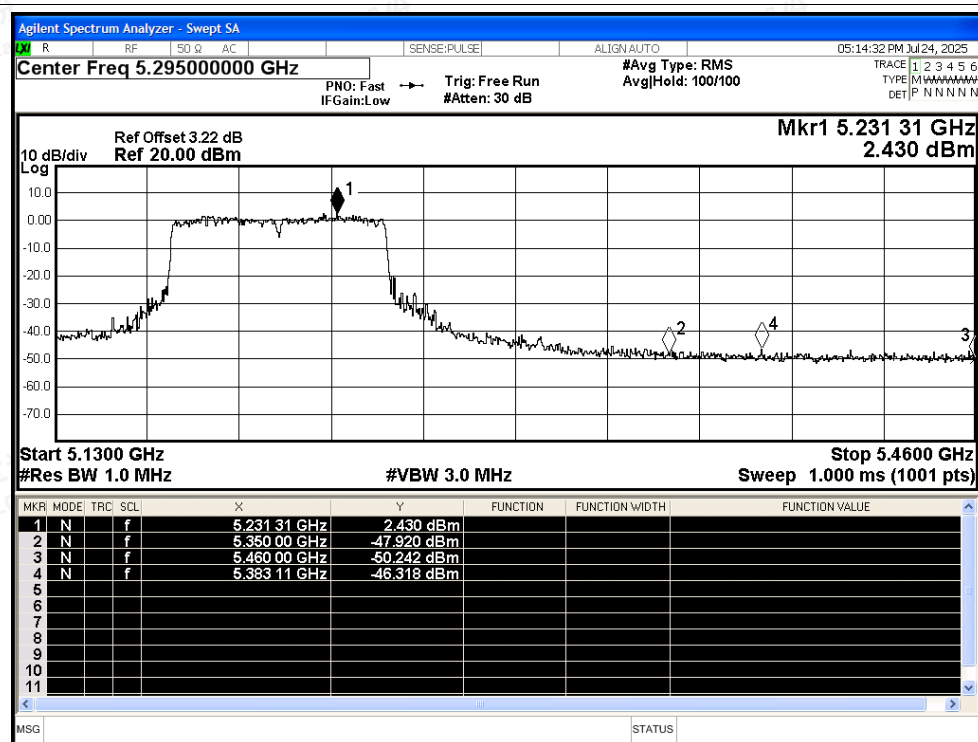

Restrict Band NVNT ac80 5210MHz Ant2 Average

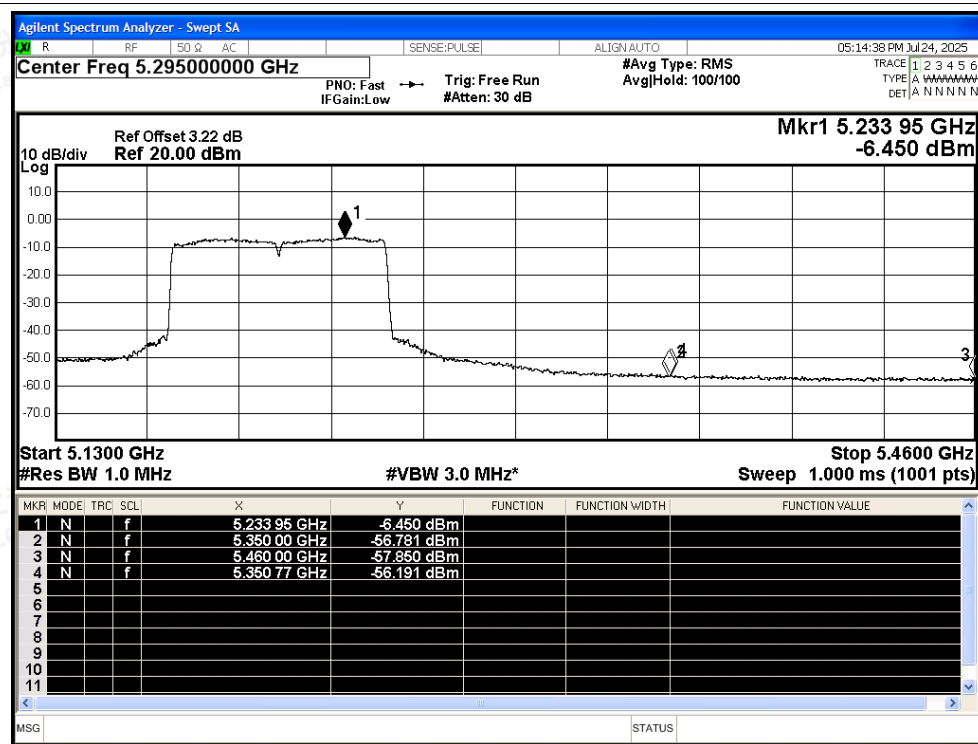

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

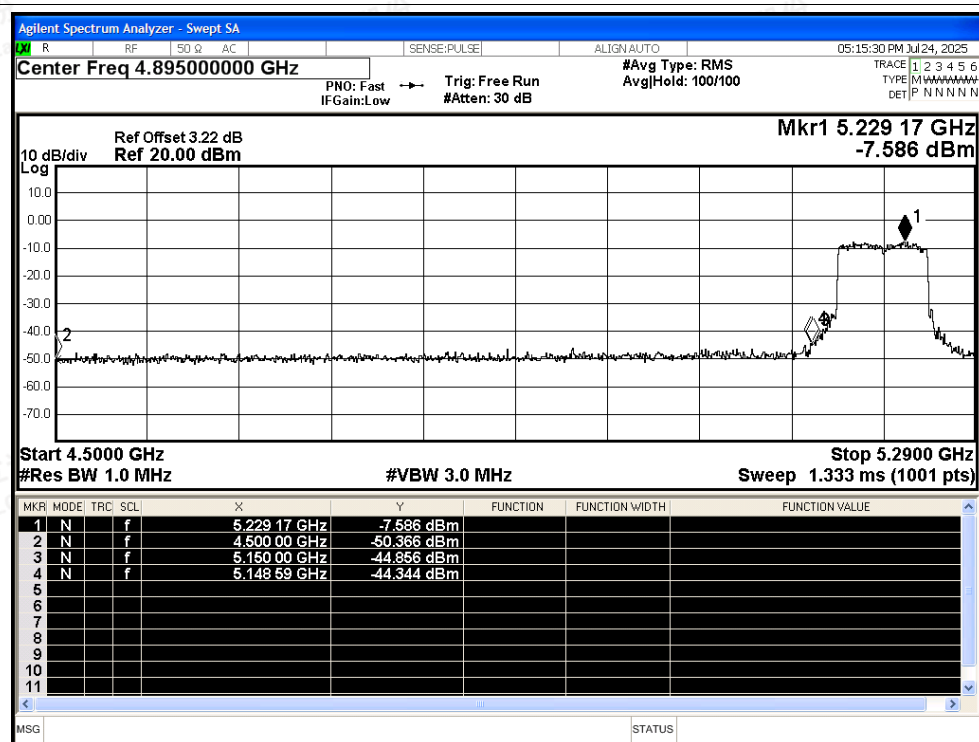

Restrict Band NVNT ac80 5210MHz Ant2 Average

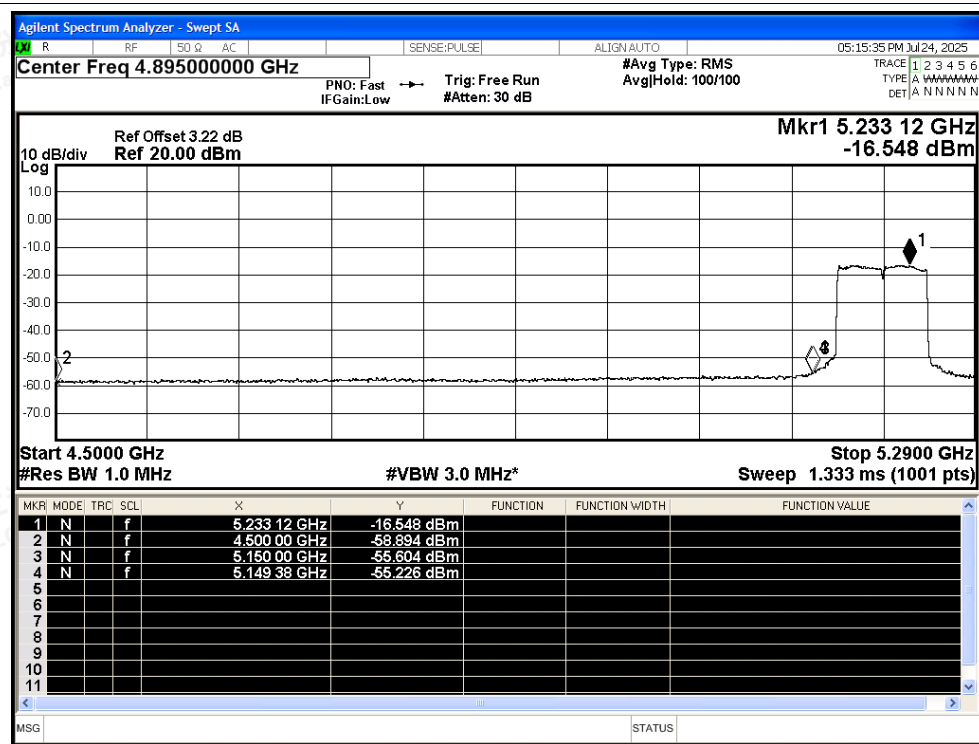

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

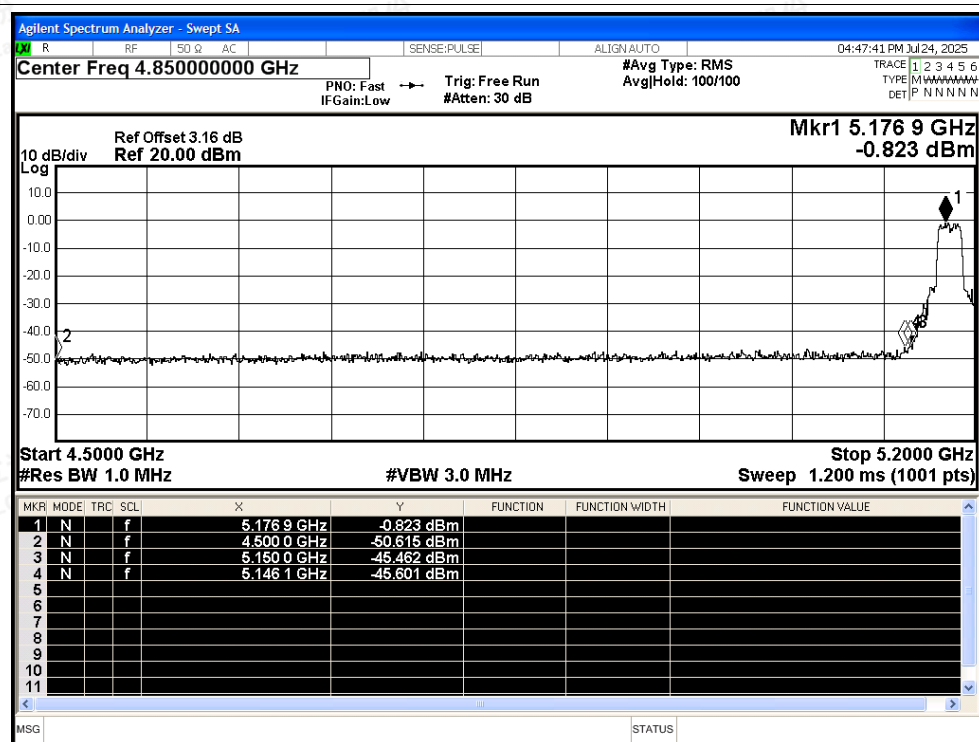

Restrict Band NVNT ax20 5180MHz Ant2 Average

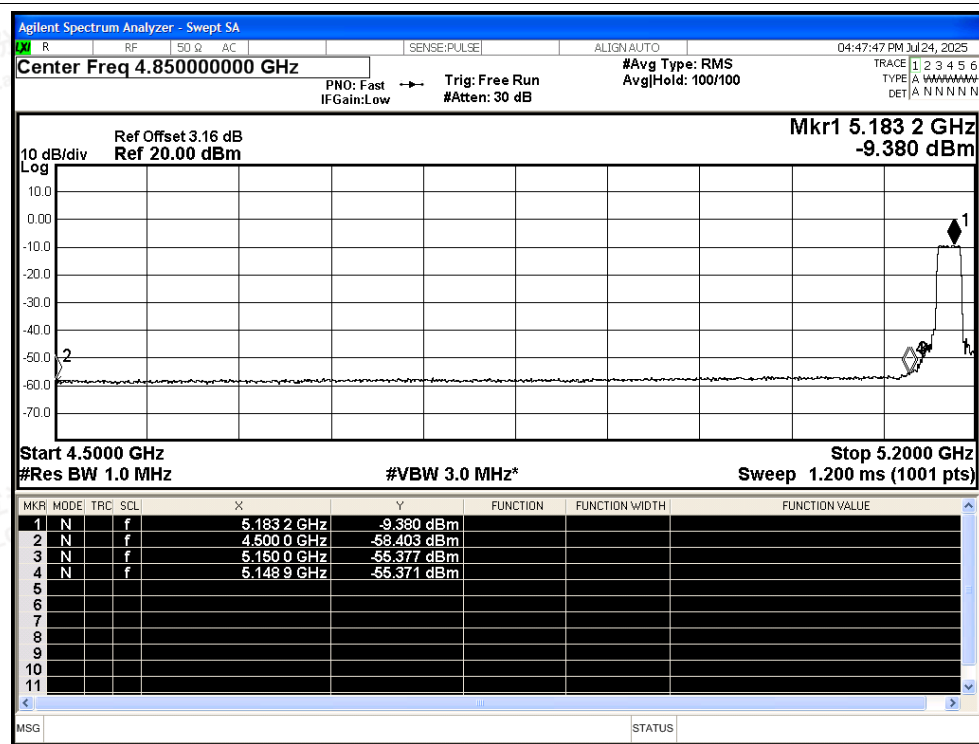

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant2 Peak

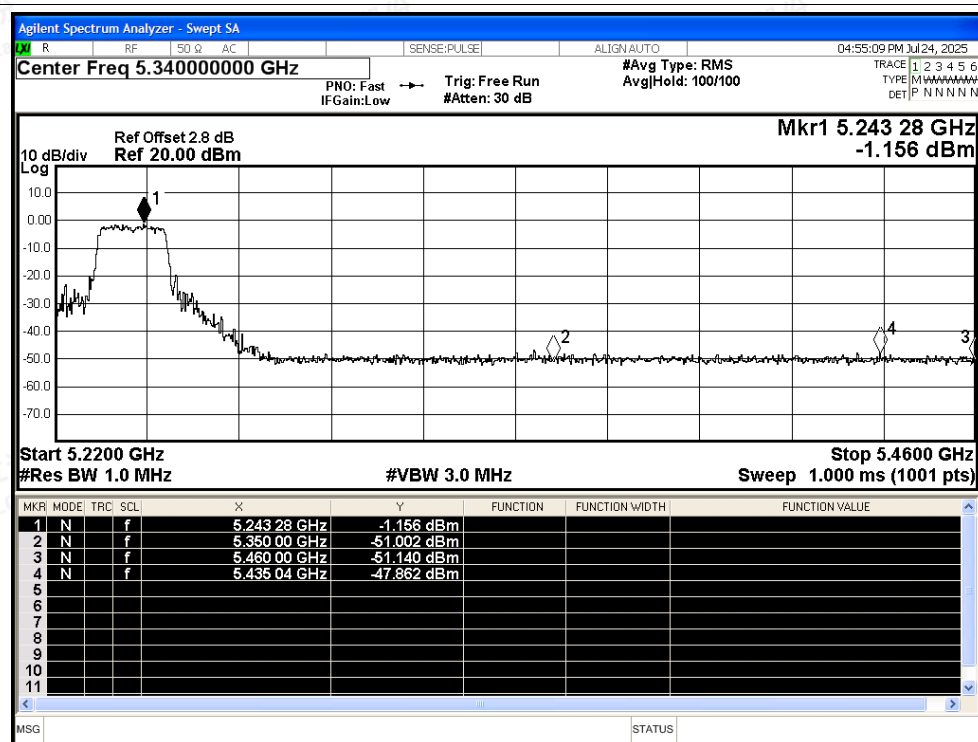

Restrict Band NVNT ax20 5240MHz Ant2 Average

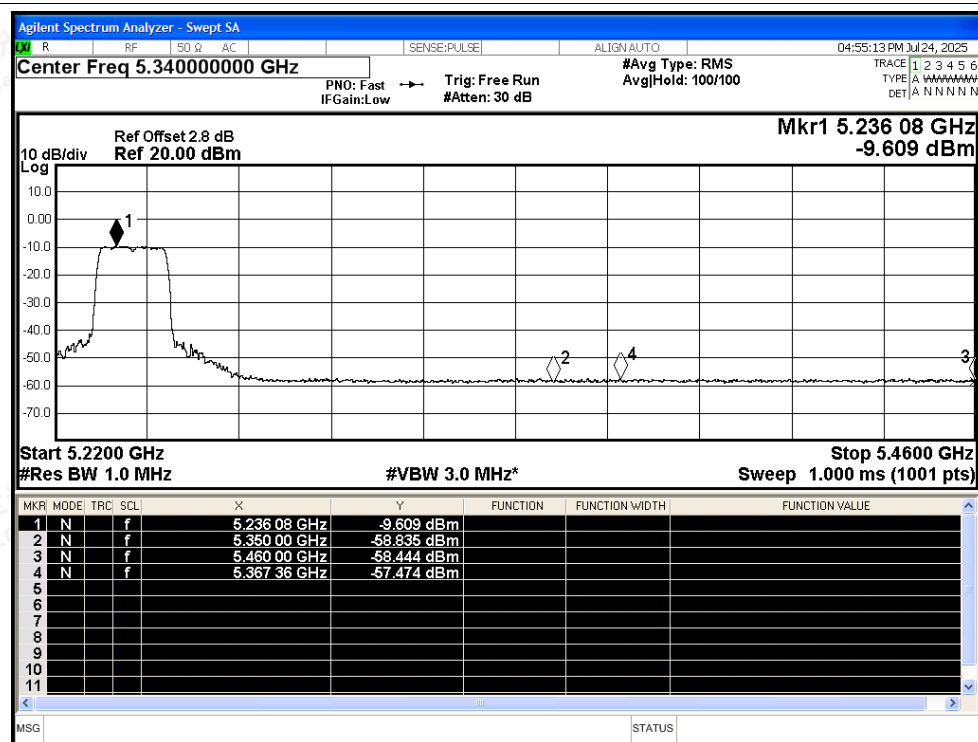

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

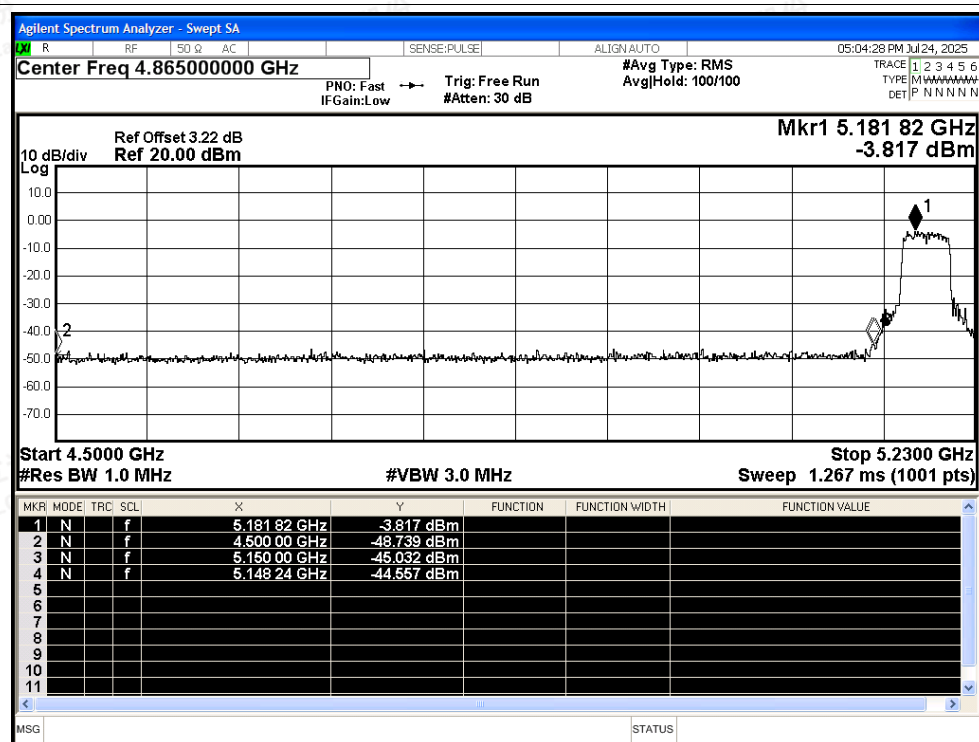

Restrict Band NVNT ax40 5190MHz Ant2 Average

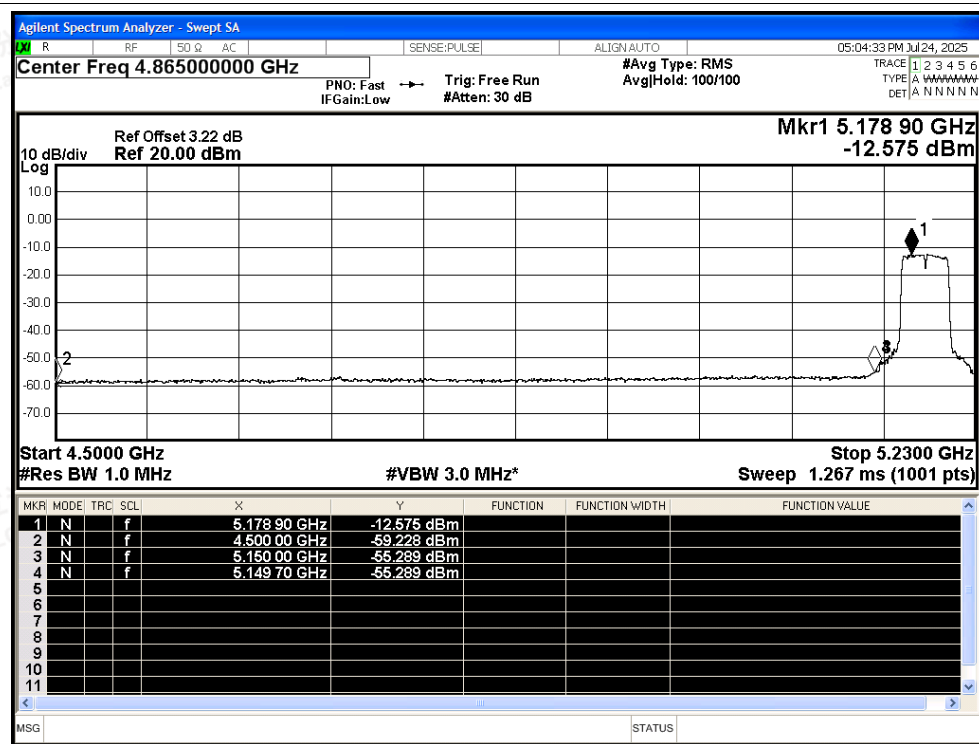

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

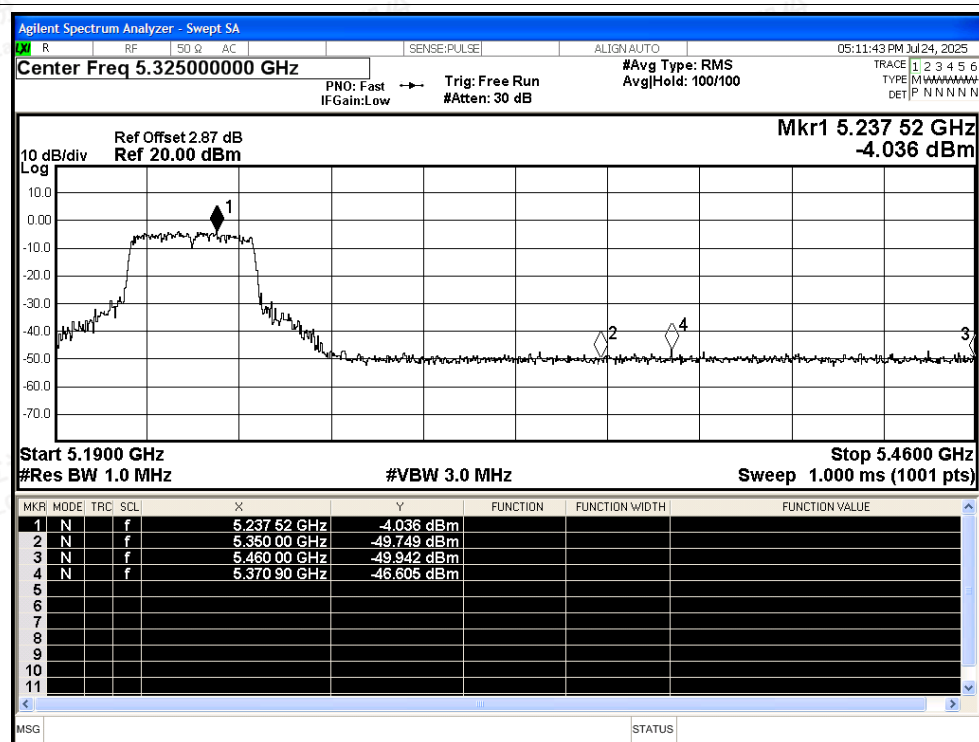

Restrict Band NVNT ax40 5230MHz Ant2 Average

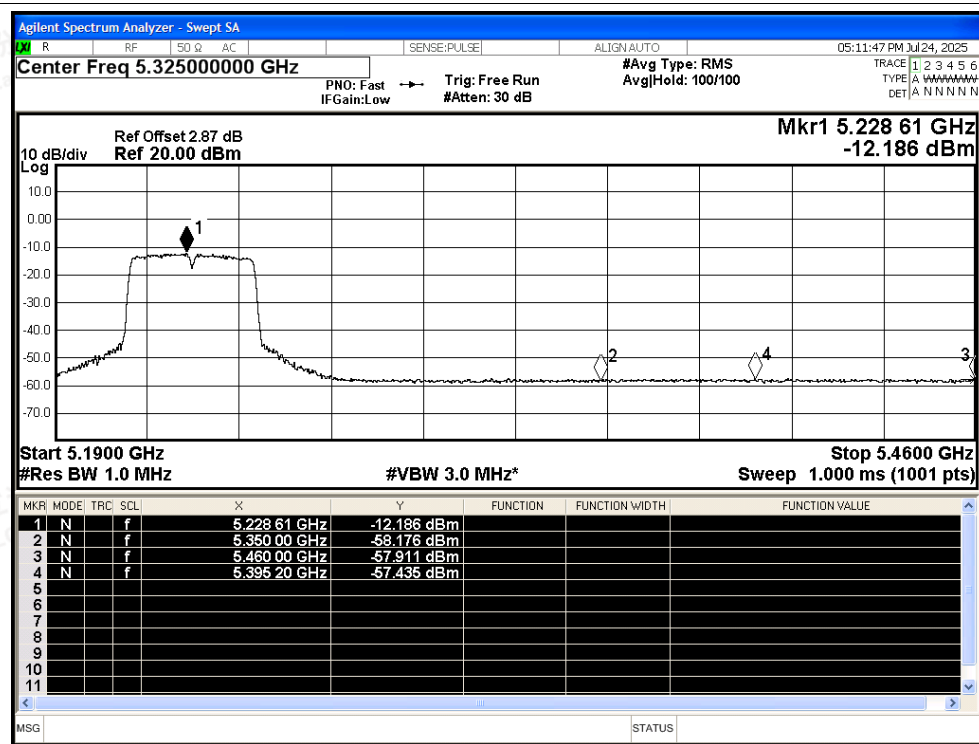

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

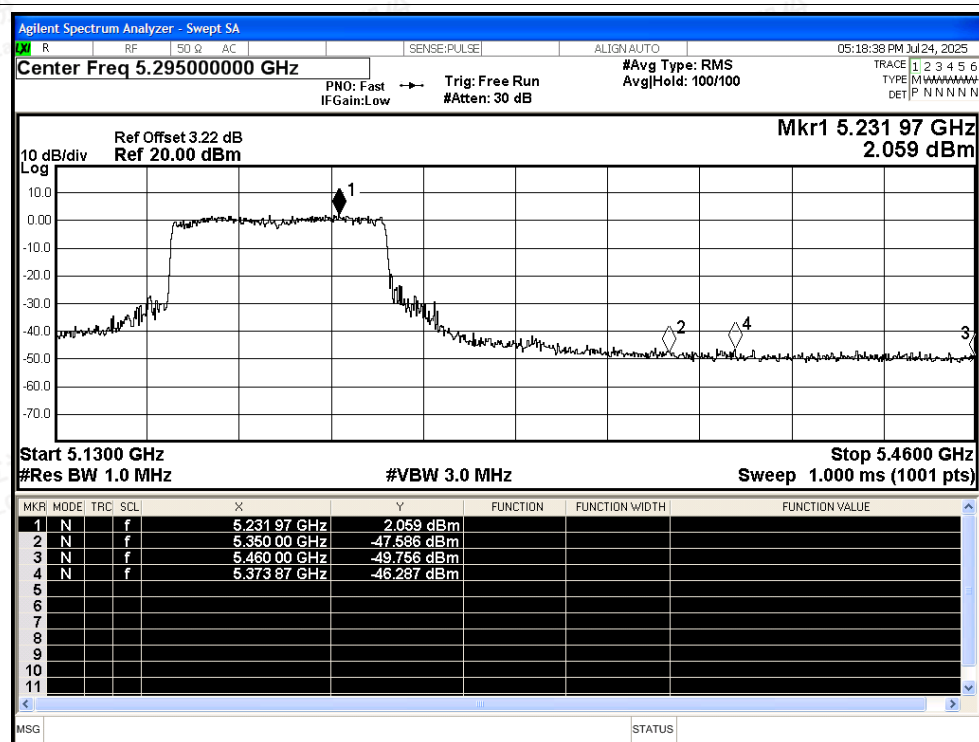

Restrict Band NVNT ax80 5210MHz Ant2 Average

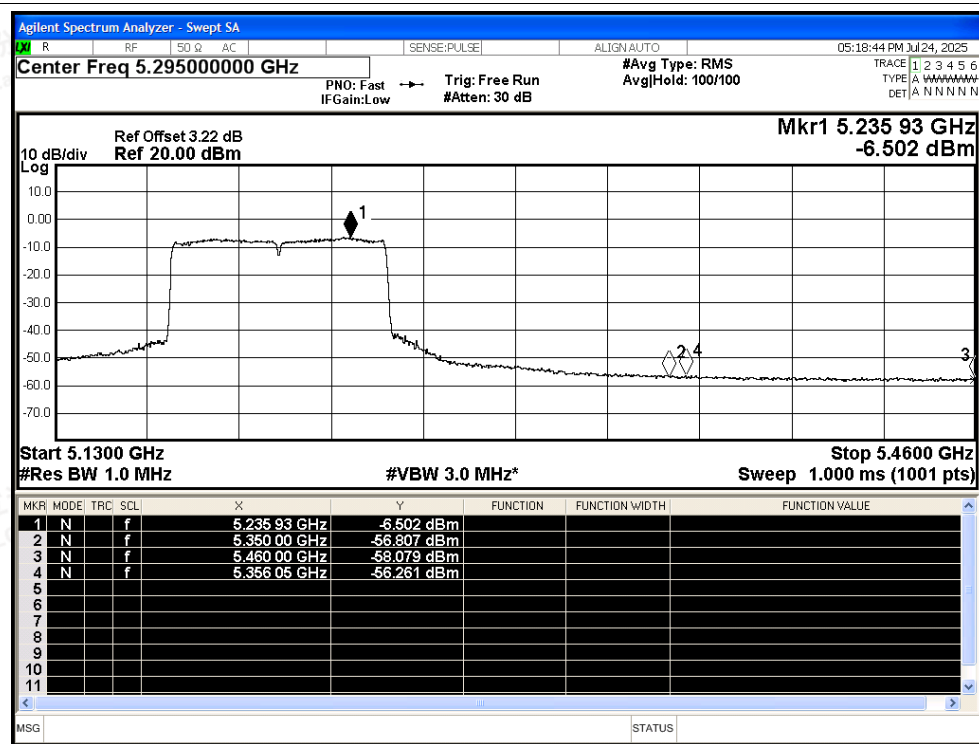

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

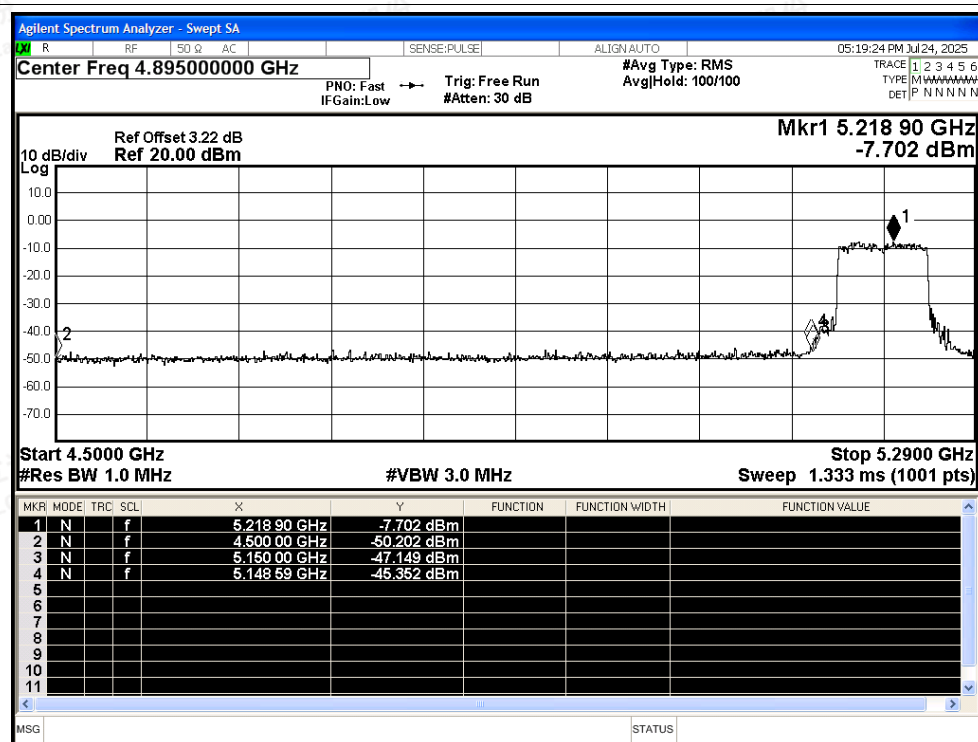

Restrict Band NVNT ax80 5210MHz Ant2 Average

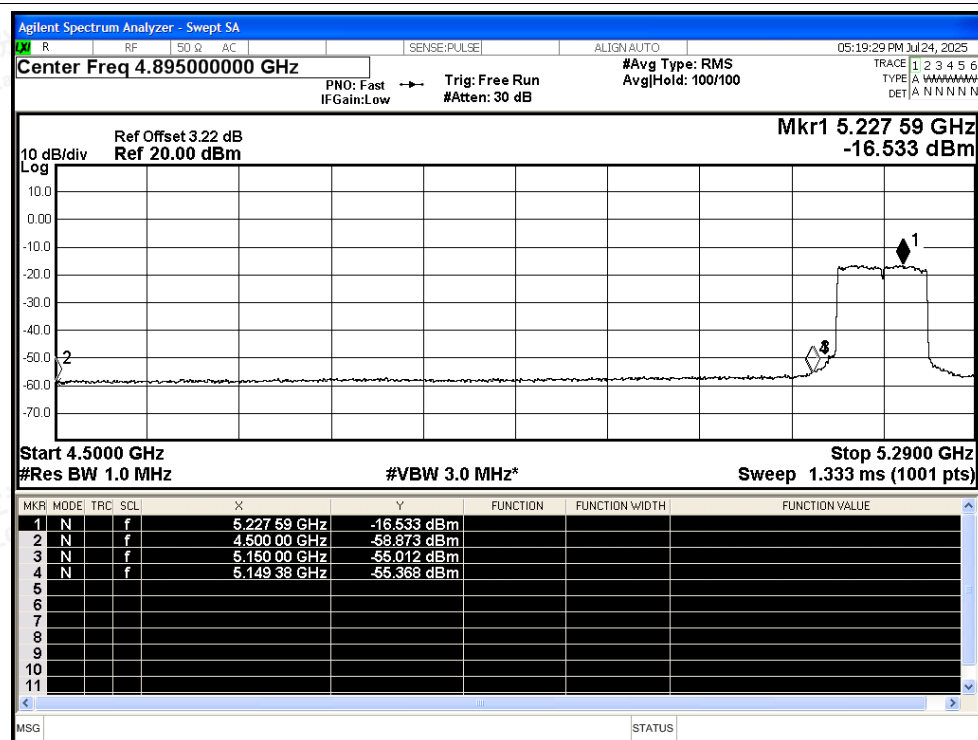

Restrict Band NVNT be20 5180MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

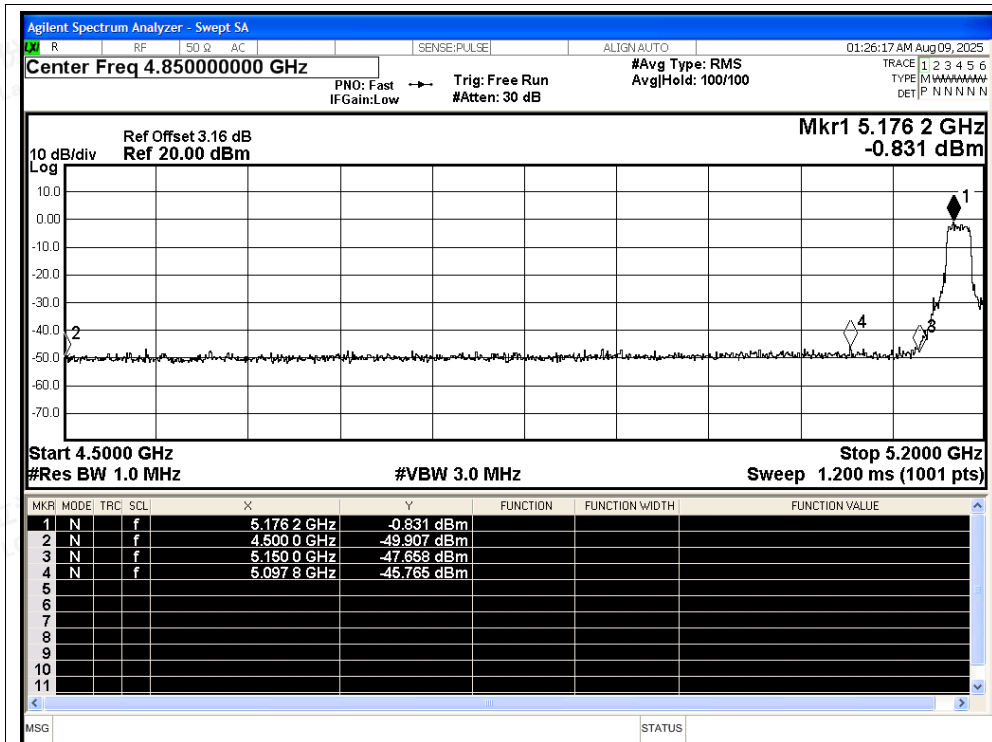

Restrict Band NVNT be20 5180MHz Ant2 Average

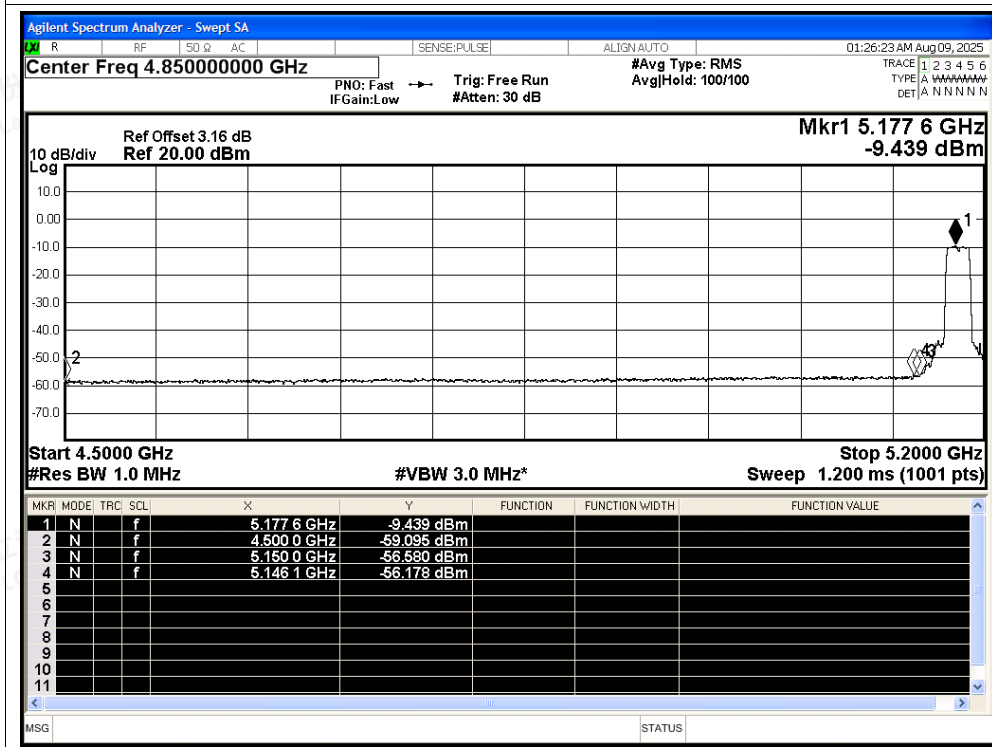

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5240MHz Ant2 Peak

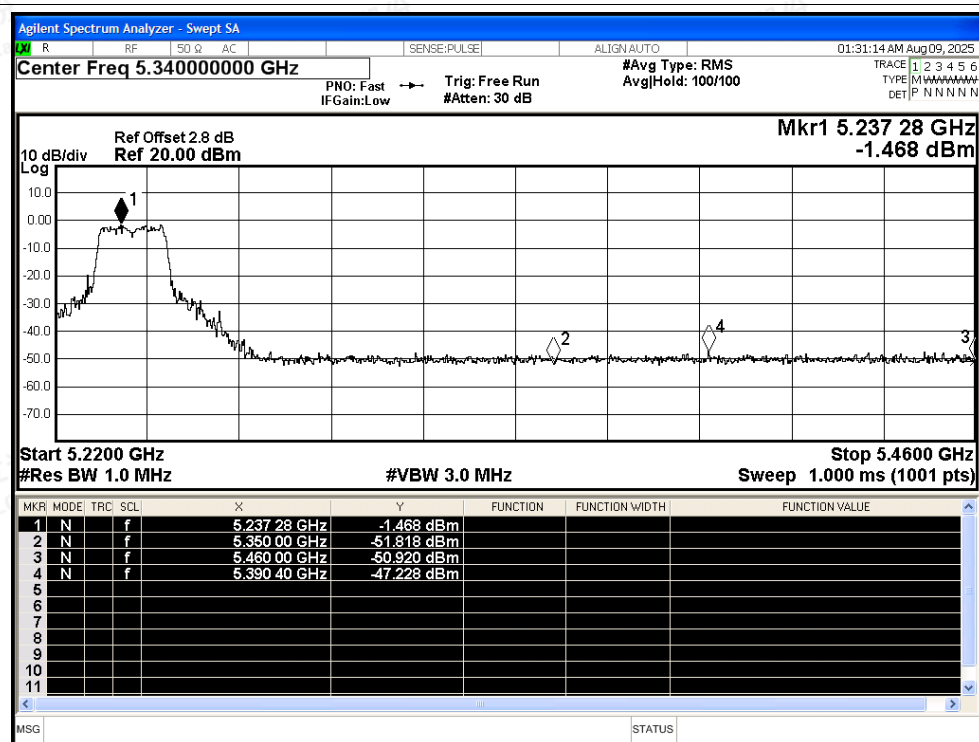

Restrict Band NVNT be20 5240MHz Ant2 Average

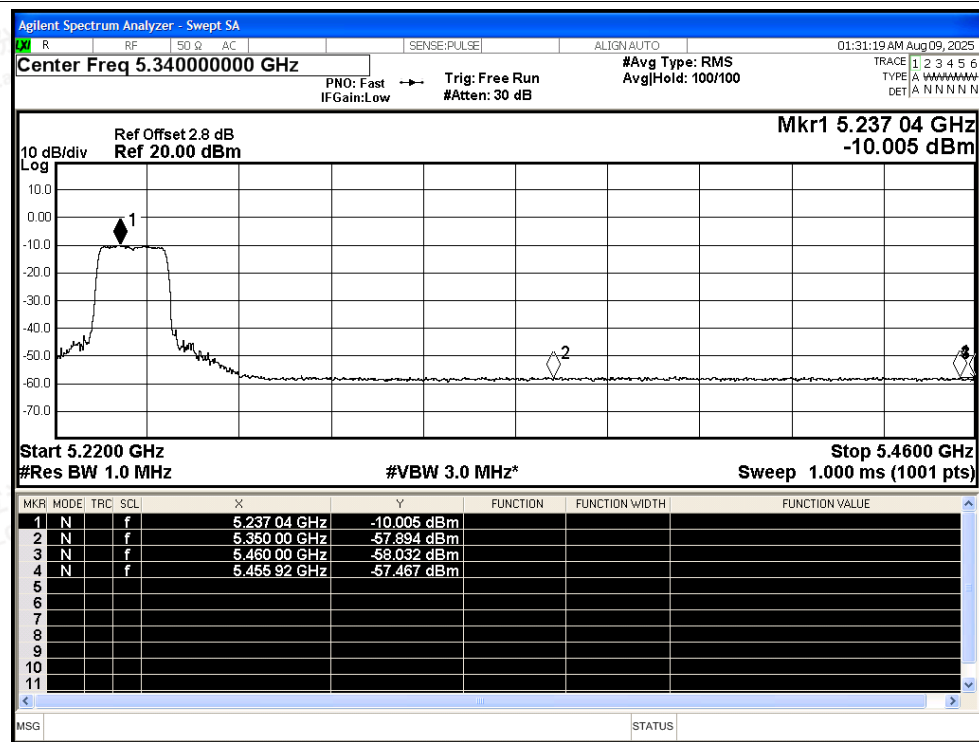

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5190MHz Ant2 Peak

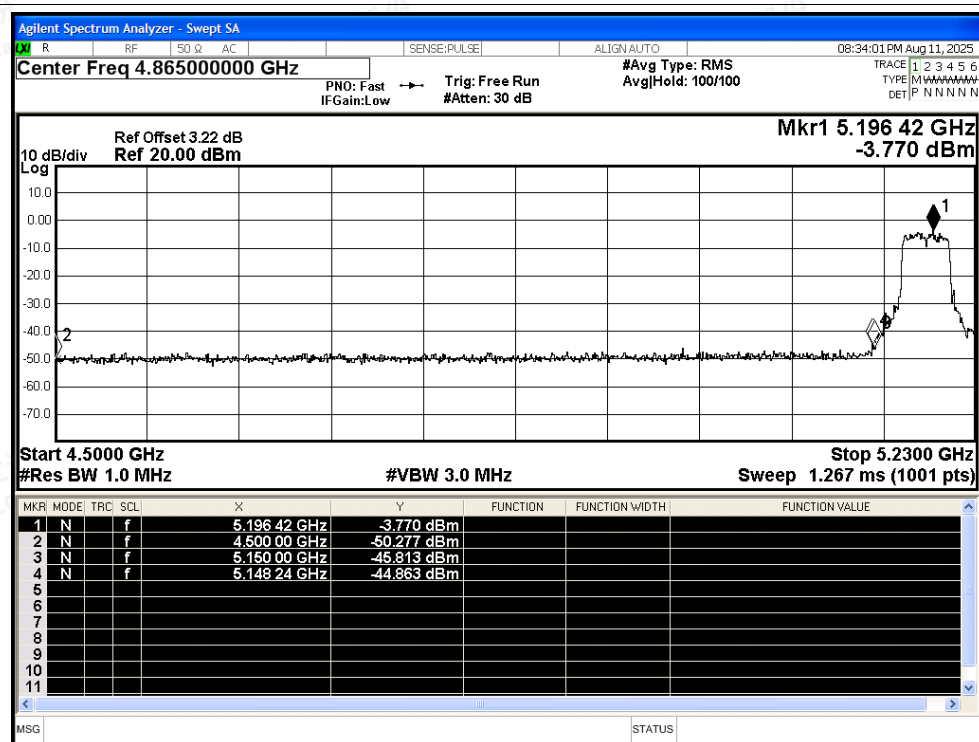

Restrict Band NVNT be40 5190MHz Ant2 Average

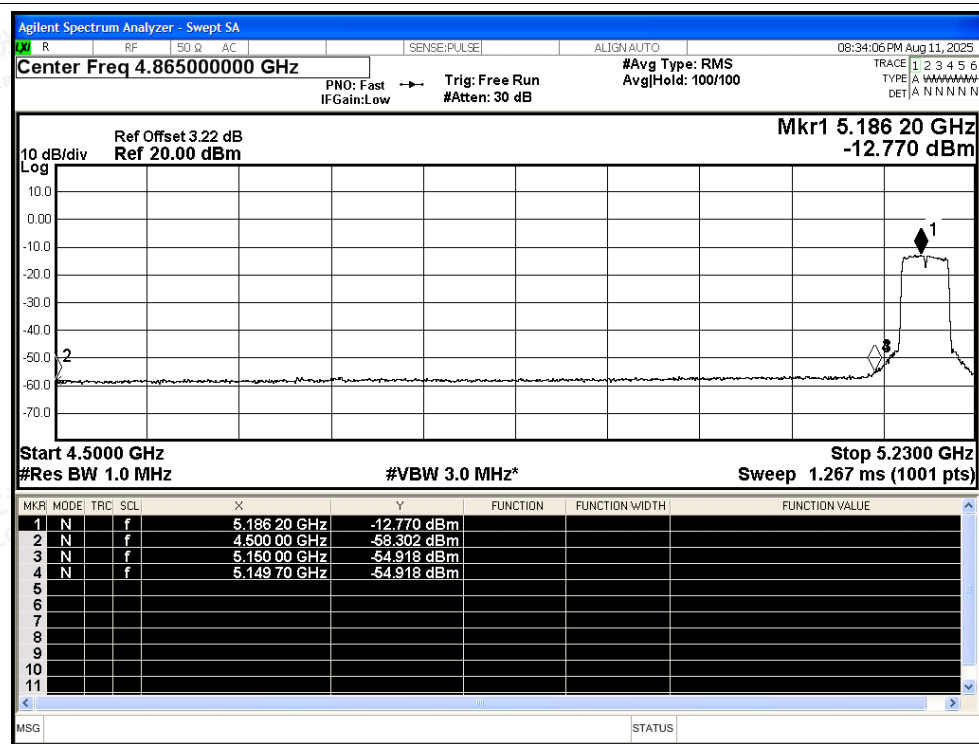

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5230MHz Ant2 Peak

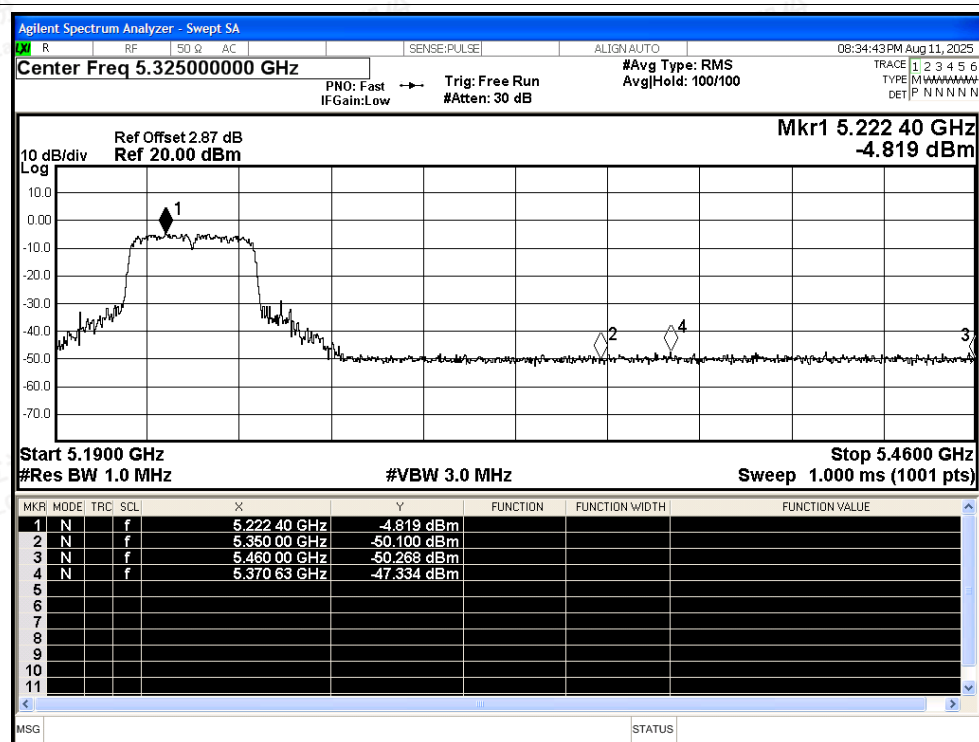

Restrict Band NVNT be40 5230MHz Ant2 Average

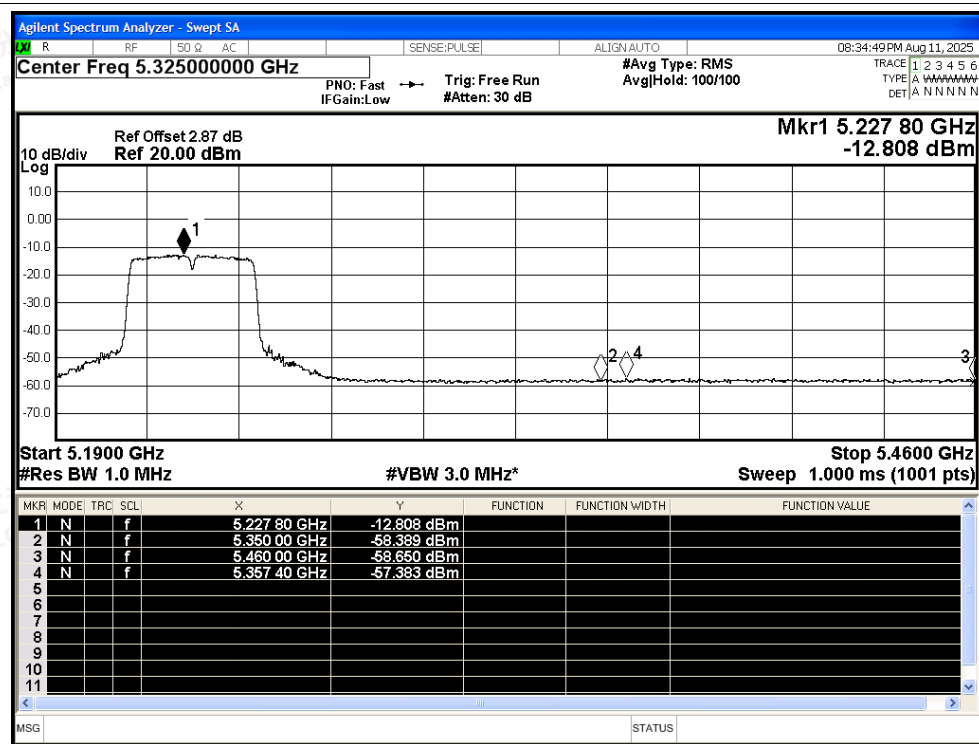

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant2 Peak

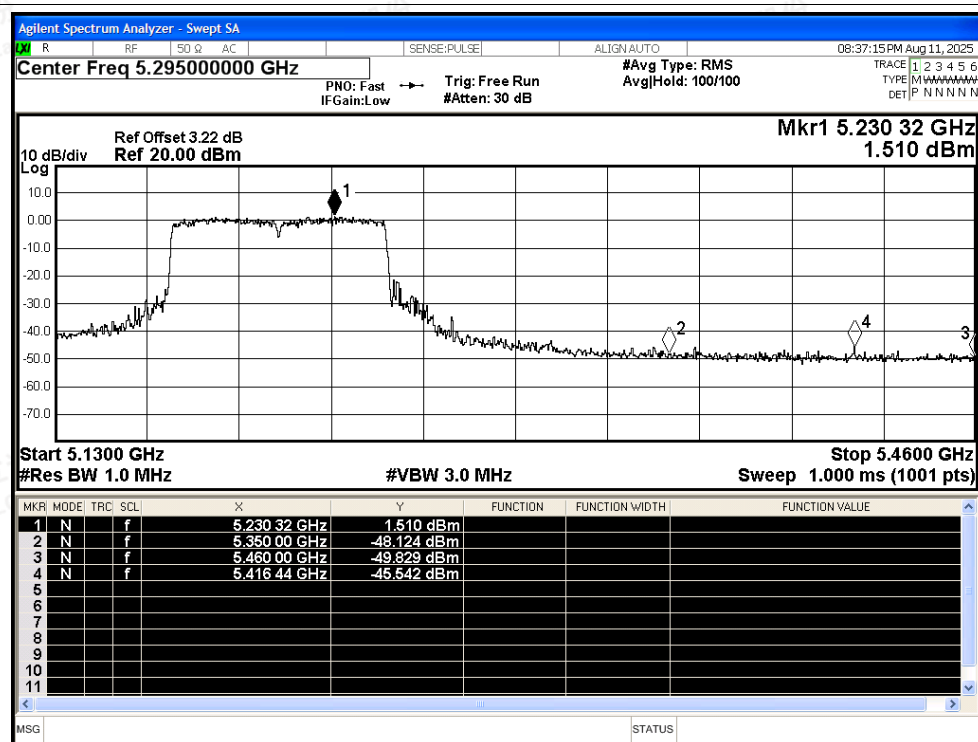

Restrict Band NVNT be80 5210MHz Ant2 Average

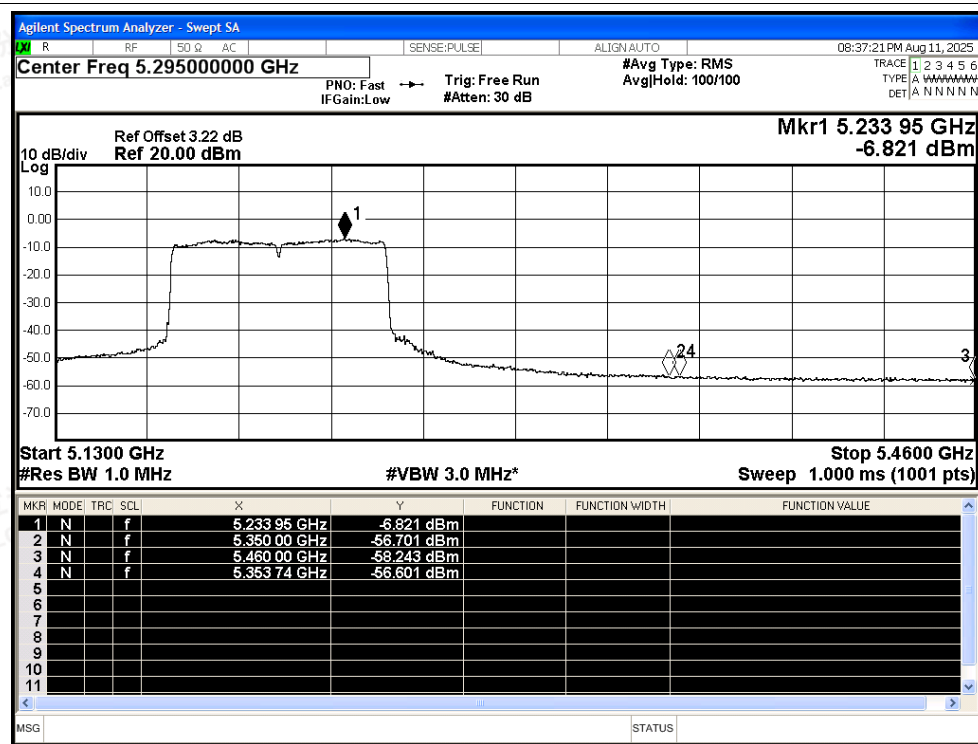

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant2 Peak

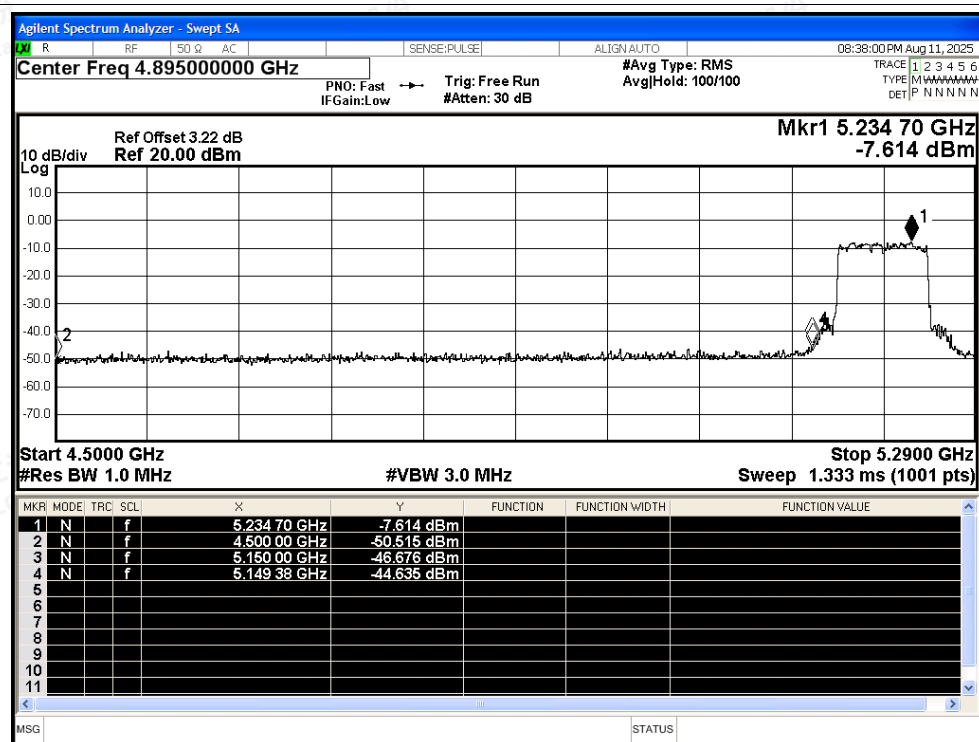

Restrict Band NVNT be80 5210MHz Ant2 Average

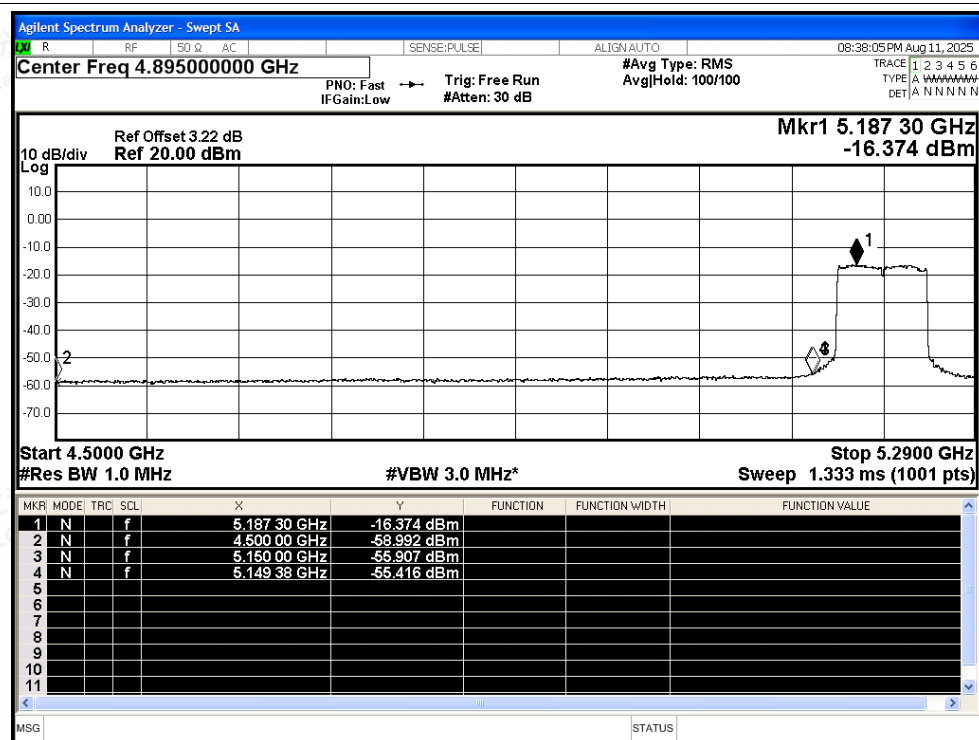

Restrict Band NVNT ac160 5250MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

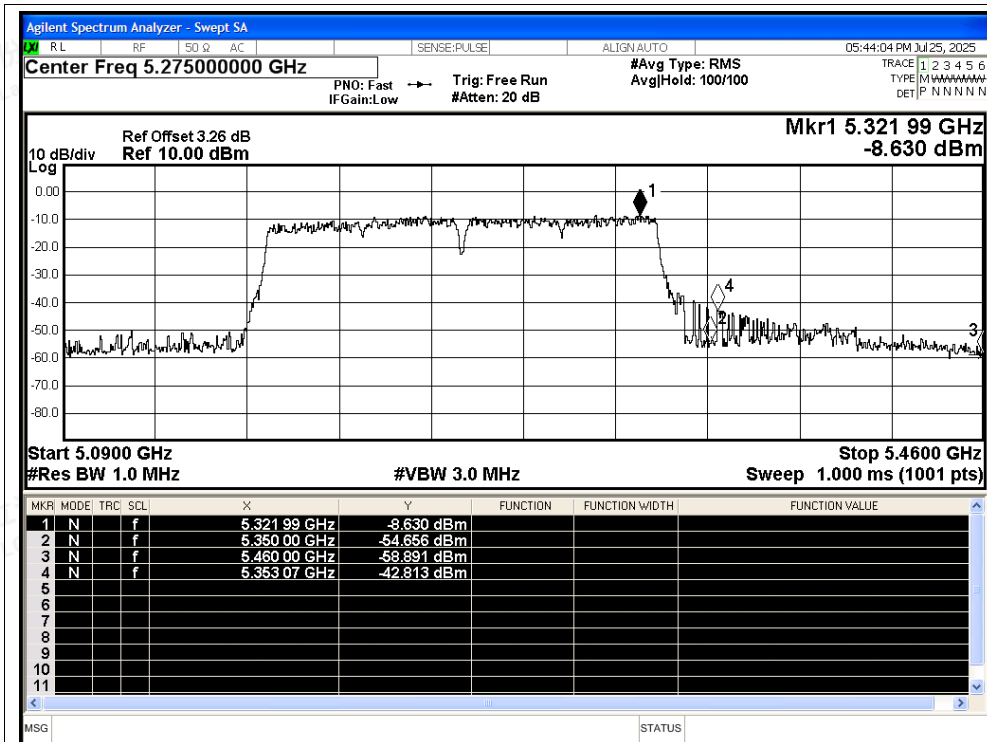

Restrict Band NVNT ac160 5250MHz Ant2 Average

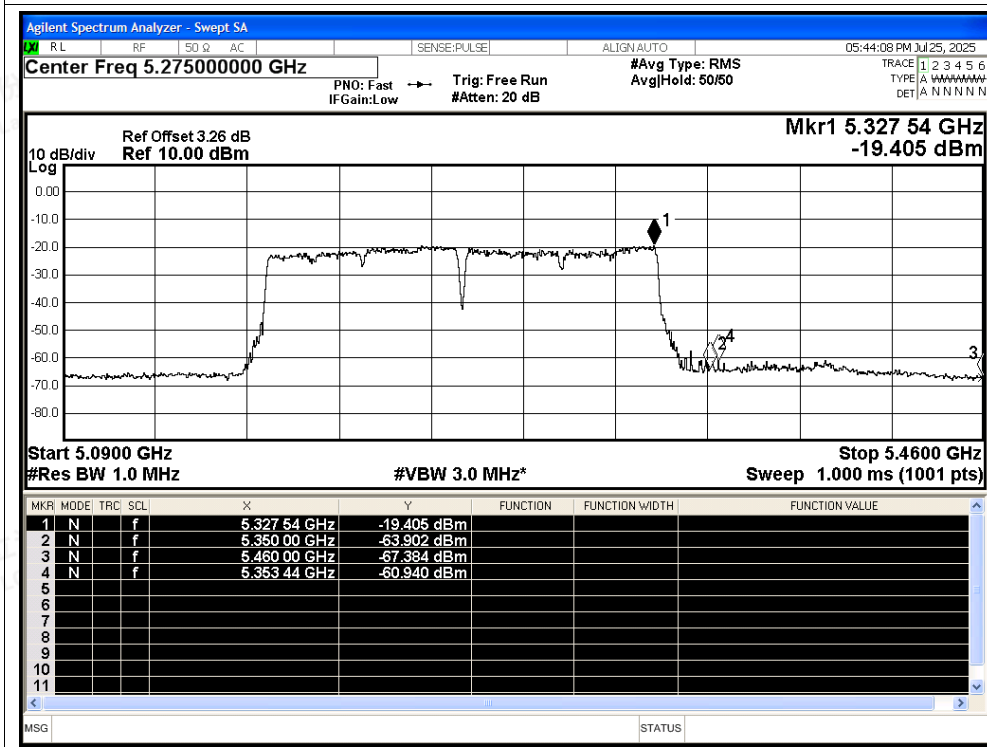

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant2 Peak

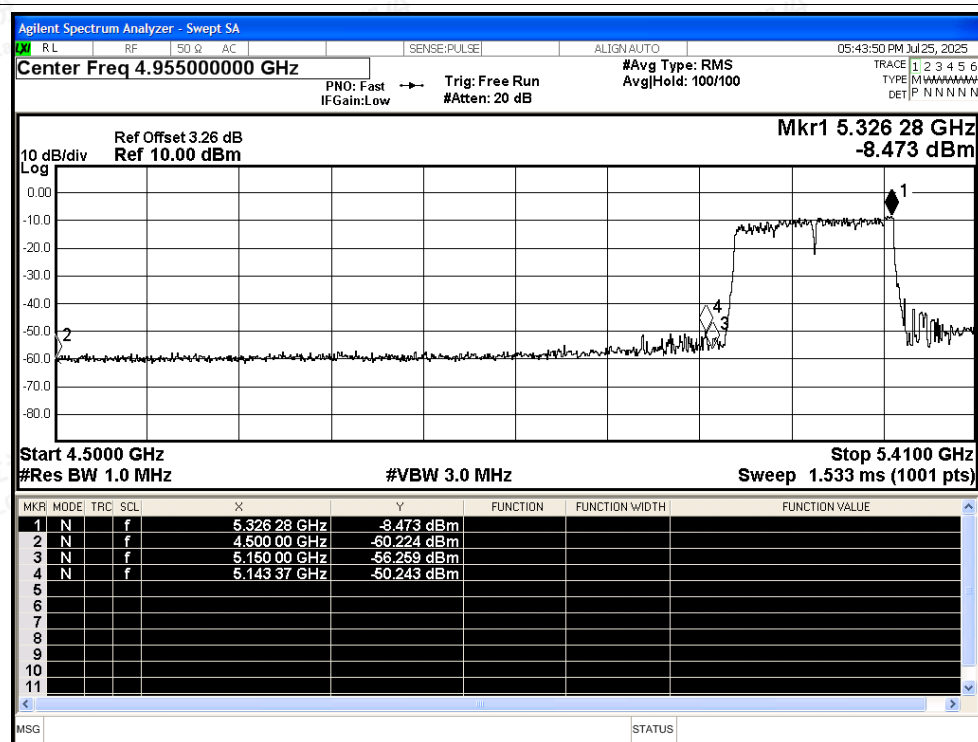

Restrict Band NVNT ac160 5250MHz Ant2 Average

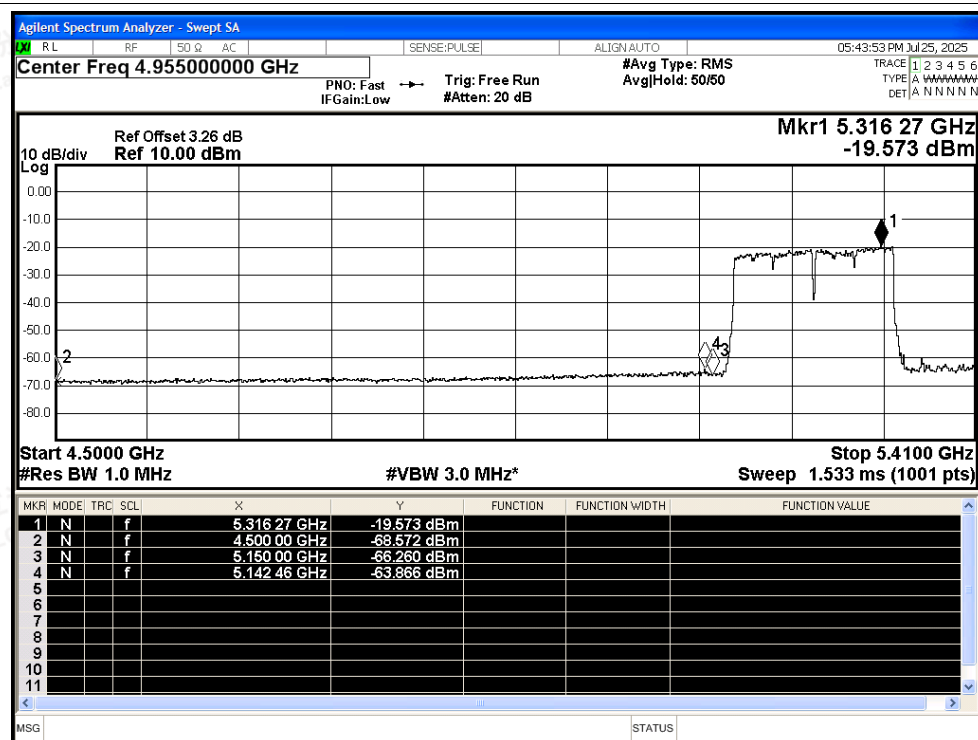

Restrict Band NVNT ax160 5250MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

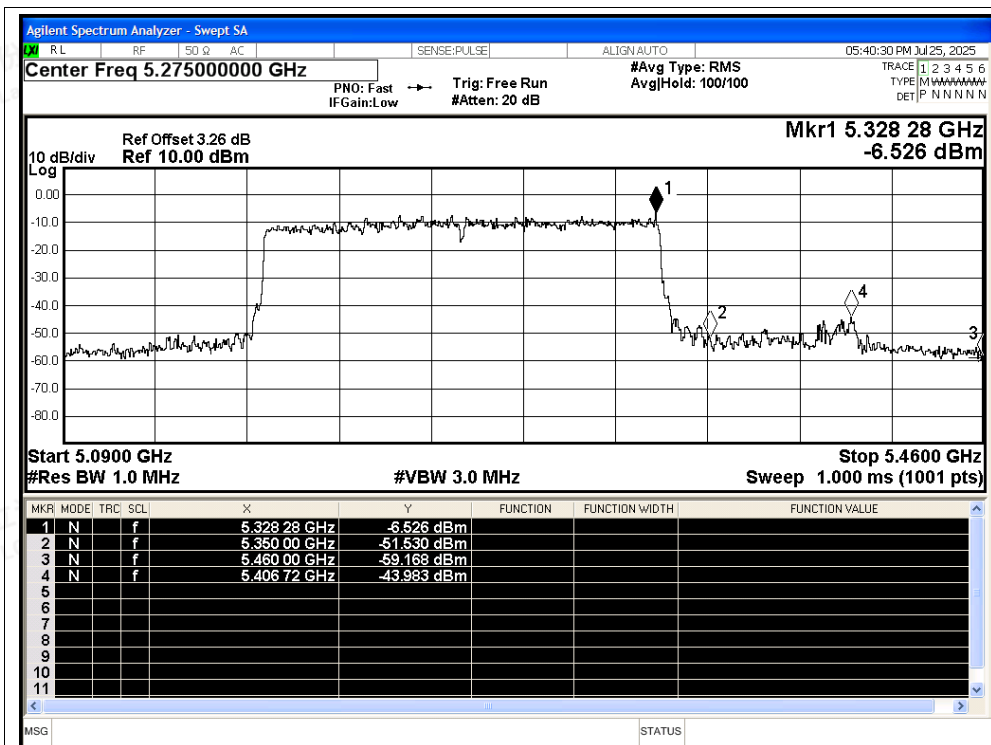

Restrict Band NVNT ax160 5250MHz Ant2 Average

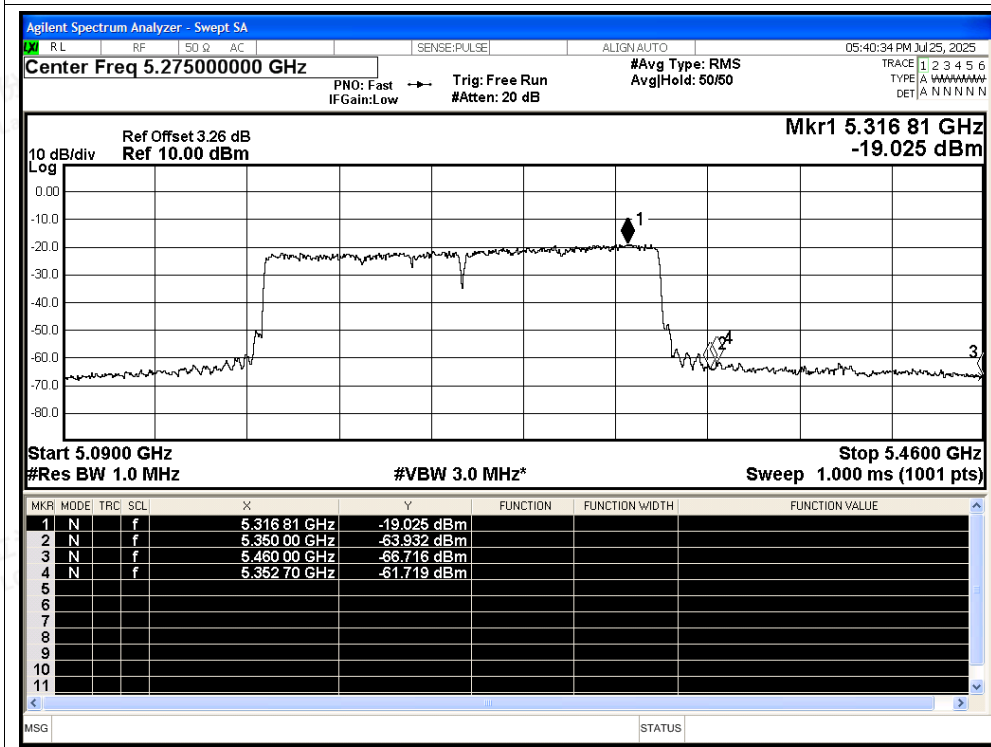

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant2 Peak

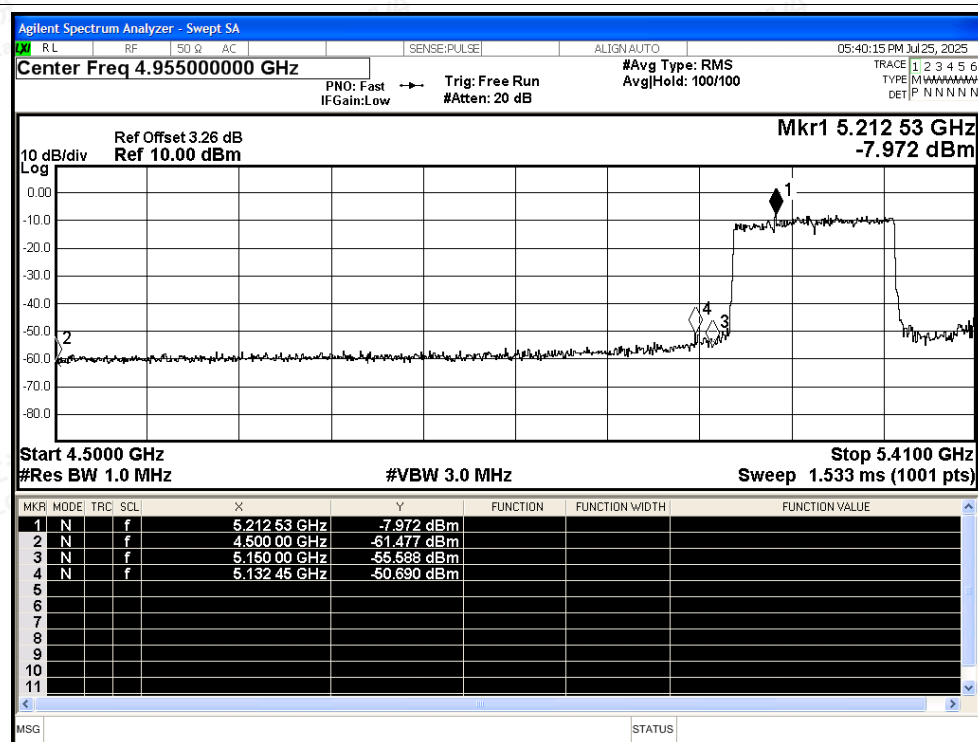

Restrict Band NVNT ax160 5250MHz Ant2 Average

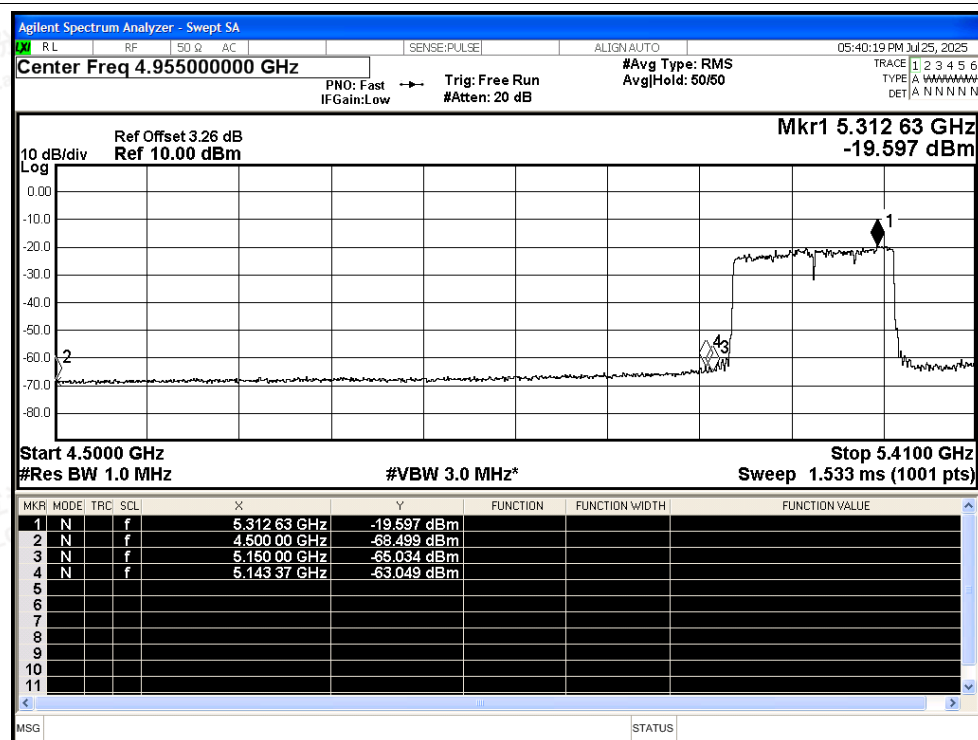

Restrict Band NVNT be160 5250MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

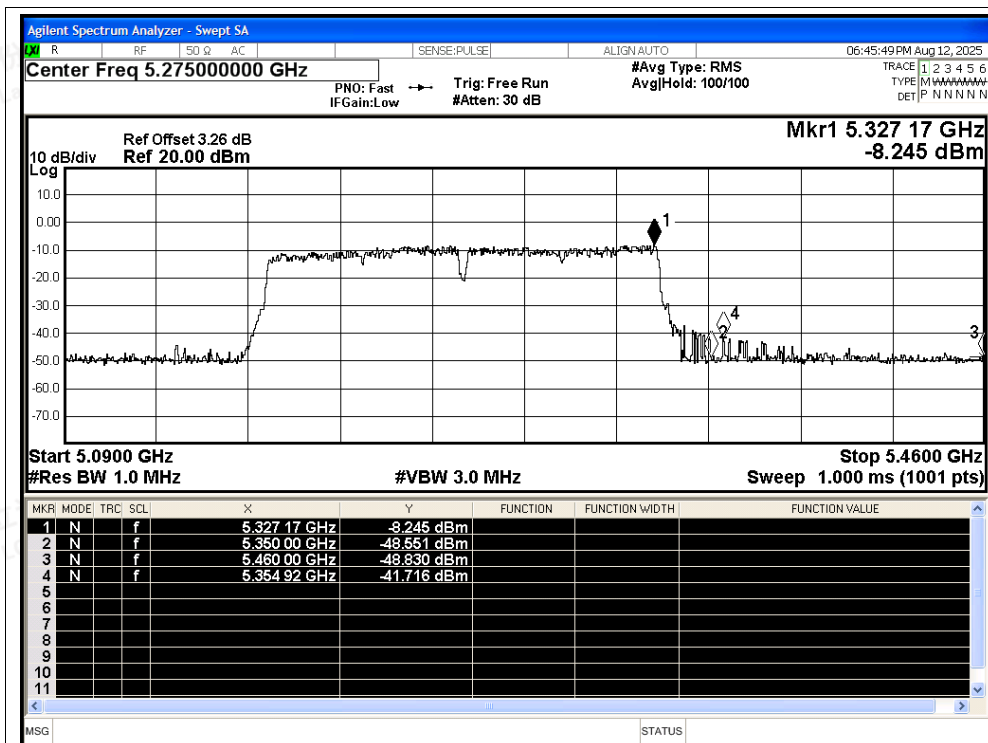

Restrict Band NVNT be160 5250MHz Ant2 Average

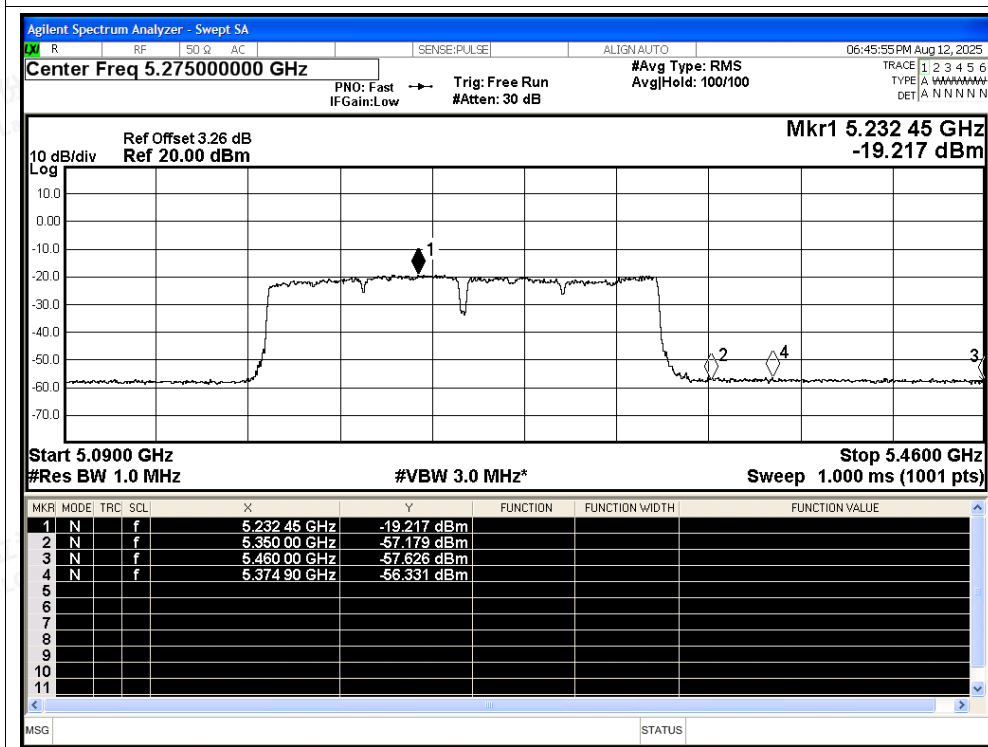

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be160 5250MHz Ant2 Peak

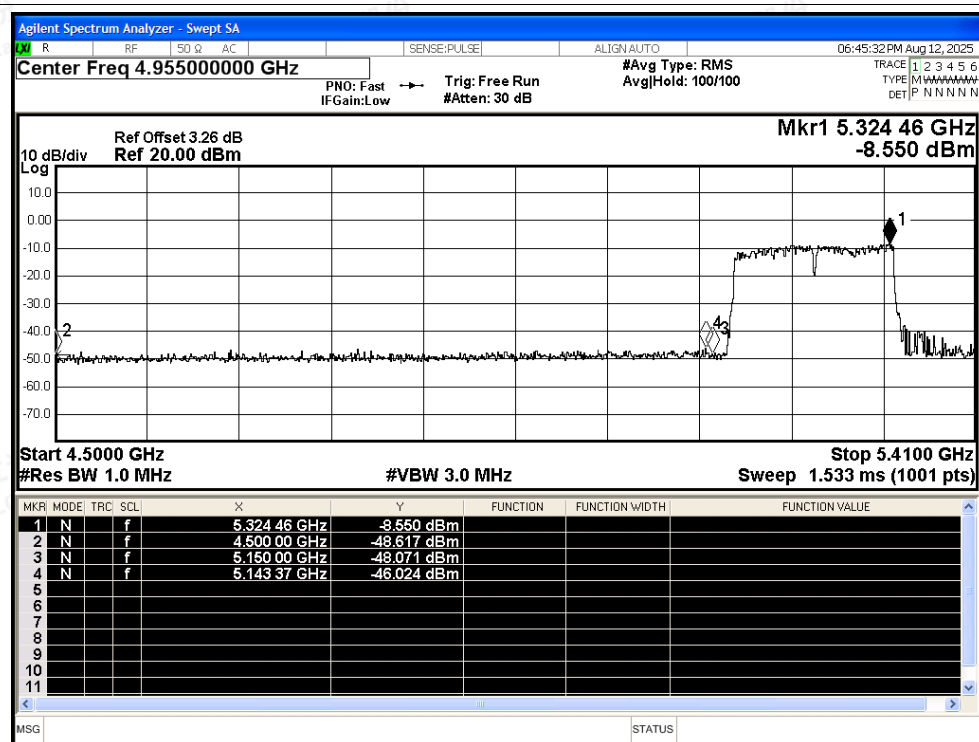

Restrict Band NVNT be160 5250MHz Ant2 Average

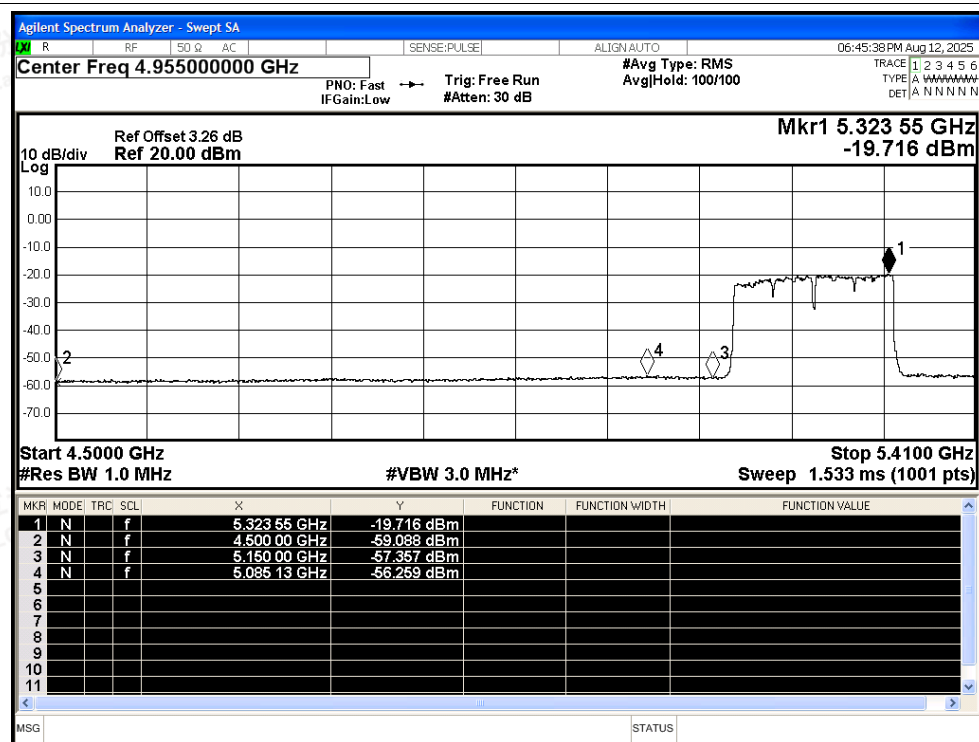

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-50.54	3.77	-	48.46	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-59.06	3.77	0.24	40.18	Average	54	Pass
NVNT	a	5180	Ant3	5069.8	-44.85	3.77	-	54.15	Peak	68.2	Pass
NVNT	a	5180	Ant3	5146.1	-56.3	3.77	0.24	42.94	Average	54	Pass
NVNT	a	5180	Ant3	5150	-47.29	3.77	-	51.71	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-57.04	3.77	0.24	42.20	Average	54	Pass
NVNT	a	5240	Ant3	5350	-48.21	3.77	-	50.79	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-58.15	3.77	0.24	41.09	Average	54	Pass
NVNT	a	5240	Ant3	5439.84	-46.97	3.77	-	52.03	Peak	68.2	Pass
NVNT	a	5240	Ant3	5399.52	-57.45	3.77	0.24	41.79	Average	54	Pass
NVNT	a	5240	Ant3	5460	-50.19	3.77	-	48.81	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-57.89	3.77	0.24	41.35	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-49.66	3.77	-	49.34	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-58.89	3.77	0.28	40.39	Average	54	Pass
NVNT	n20	5180	Ant3	5139.8	-46.38	3.77	-	52.62	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5149.6	-55.66	3.77	0.28	43.62	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-45.7	3.77	-	53.30	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-55.73	3.77	0.28	43.55	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-50.32	3.77	-	48.68	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-58.47	3.77	0.28	40.81	Average	54	Pass
NVNT	n20	5240	Ant3	5392.08	-47.27	3.77	-	51.73	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5365.92	-57.34	3.77	0.28	41.94	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-50.51	3.77	-	48.49	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-58.13	3.77	0.28	41.15	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-51.02	3.77	-	47.98	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-58.65	3.77	0.24	40.59	Average	54	Pass
NVNT	n40	5190	Ant3	5149.7	-42.46	3.77	-	56.54	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5148.97	-55.32	3.77	0.24	43.92	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-42.46	3.77	-	56.54	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-55.79	3.77	0.24	43.45	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-51.18	3.77	-	47.82	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-58.14	3.77	0.24	41.10	Average	54	Pass
NVNT	n40	5230	Ant3	5416.53	-47.09	3.77	-	51.91	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5391.69	-57.56	3.77	0.24	41.68	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-50.82	3.77	-	48.18	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-57.78	3.77	0.24	41.46	Average	54	Pass
NVNT	ac20	5180	Ant3	4500	-49.49	3.77	-	49.51	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	4500	-58.55	3.77	0.12	40.57	Average	54	Pass
NVNT	ac20	5180	Ant3	5149.6	-42.37	3.77	-	56.63	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	5148.9	-56.09	3.77	0.12	43.03	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-46.19	3.77	-	52.81	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-55.58	3.77	0.12	43.54	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-50.11	3.77	-	48.89	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-58.03	3.77	0.12	41.09	Average	54	Pass
NVNT	ac20	5240	Ant3	5422.32	-47.98	3.77	-	51.02	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5437.92	-57.24	3.77	0.12	41.88	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-49.62	3.77	-	49.38	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-58.46	3.77	0.12	40.66	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-51.72	3.77	-	47.28	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-58.75	3.77	0	40.25	Average	54	Pass
NVNT	ac40	5190	Ant3	5149.7	-41.72	3.77	-	57.28	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5149.7	-55.74	3.77	0	43.26	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-41.72	3.77	-	57.28	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-55.74	3.77	0	43.26	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-50.38	3.77	-	48.62	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-58.48	3.77	0.24	40.76	Average	54	Pass
NVNT	ac40	5230	Ant3	5397.63	-47.07	3.77	-	51.93	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5355.24	-57.26	3.77	0.24	41.98	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-50.46	3.77	-	48.54	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-58.26	3.77	0.24	40.98	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-48.36	3.77	-	50.64	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-56.67	3.77	0.47	42.80	Average	54	Pass
NVNT	ac80	5210	Ant3	5355.06	-46.7	3.77	-	52.30	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5352.09	-55.74	3.77	0.47	43.73	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-50.93	3.77	-	48.07	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-57.76	3.77	0.47	41.71	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-50.19	3.77	-	48.81	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-58.57	3.77	0.47	40.90	Average	54	Pass
NVNT	ac80	5210	Ant3	5149.38	-42.45	3.77	-	56.55	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5149.38	-55	3.77	0.47	44.47	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-43.21	3.77	-	55.79	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-55.12	3.77	0.47	44.35	Average	54	Pass
NVNT	ax20	5180	Ant3	4500	-49	3.77	-	50.00	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	4500	-58.8	3.77	0.12	40.32	Average	54	Pass
NVNT	ax20	5180	Ant3	5148.2	-44.02	3.77	-	54.98	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5148.9	-55.75	3.77	0.12	43.37	Average	54	Pass
NVNT	ax20	5180	Ant3	5150	-46.16	3.77	-	52.84	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5150	-55.95	3.77	0.12	43.17	Average	54	Pass
NVNT	ax20	5240	Ant3	5350	-50.45	3.77	-	48.55	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5350	-57.87	3.77	0.12	41.25	Average	54	Pass
NVNT	ax20	5240	Ant3	5399.04	-47.83	3.77	-	51.17	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5361.6	-57.45	3.77	0.12	41.67	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant3	5460	-50.37	3.77	-	48.63	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5460	-57.75	3.77	0.12	41.37	Average	54	Pass
NVNT	ax40	5190	Ant3	4500	-49.76	3.77	-	49.24	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	4500	-59.27	3.77	0.24	39.97	Average	54	Pass
NVNT	ax40	5190	Ant3	5146.78	-45.43	3.77	-	53.57	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5149.7	-55.93	3.77	0.24	43.31	Average	54	Pass
NVNT	ax40	5190	Ant3	5150	-46.78	3.77	-	52.22	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5150	-55.93	3.77	0.24	43.31	Average	54	Pass
NVNT	ax40	5230	Ant3	5350	-50.92	3.77	-	48.08	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350	-58.6	3.77	0.24	40.64	Average	54	Pass
NVNT	ax40	5230	Ant3	5384.13	-47.72	3.77	-	51.28	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5445.96	-57.47	3.77	0.24	41.77	Average	54	Pass
NVNT	ax40	5230	Ant3	5460	-51.18	3.77	-	47.82	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5460	-58.28	3.77	0.24	40.96	Average	54	Pass
NVNT	ax80	5210	Ant3	5350	-48.45	3.77	-	50.55	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5350	-56.83	3.77	0.47	42.64	Average	54	Pass
NVNT	ax80	5210	Ant3	5365.62	-46.39	3.77	-	52.61	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5353.08	-56.22	3.77	0.47	43.25	Average	54	Pass
NVNT	ax80	5210	Ant3	5460	-50.59	3.77	-	48.41	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5460	-57.69	3.77	0.47	41.78	Average	54	Pass
NVNT	ax80	5210	Ant3	4500	-50.69	3.77	-	48.31	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	4500	-58.82	3.77	0.47	40.65	Average	54	Pass
NVNT	ax80	5210	Ant3	5148.59	-44	3.77	-	55.00	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5147.01	-55.44	3.77	0.47	44.03	Average	54	Pass
NVNT	ax80	5210	Ant3	5150	-44.84	3.77	-	54.16	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5150	-55.41	3.77	0.47	44.06	Average	54	Pass
NVNT	be20	5180	Ant3	4500	-50.95	3.77	-	48.05	Peak	68.2	Pass
NVNT	be20	5180	Ant3	4500	-59.09	3.77	0.12	40.03	Average	54	Pass
NVNT	be20	5180	Ant3	5148.2	-45.04	3.77	-	53.96	Peak	68.2	Pass
NVNT	be20	5180	Ant3	5149.6	-55.69	3.77	0.12	43.43	Average	54	Pass
NVNT	be20	5180	Ant3	5150	-45.54	3.77	-	53.46	Peak	68.2	Pass
NVNT	be20	5180	Ant3	5150	-55.91	3.77	0.12	43.21	Average	54	Pass
NVNT	be20	5240	Ant3	5350	-49.05	3.77	-	49.95	Peak	68.2	Pass
NVNT	be20	5240	Ant3	5350	-58.73	3.77	0.12	40.39	Average	54	Pass
NVNT	be20	5240	Ant3	5422.32	-46.46	3.77	-	52.54	Peak	68.2	Pass
NVNT	be20	5240	Ant3	5397.12	-57.42	3.77	0.12	41.70	Average	54	Pass
NVNT	be20	5240	Ant3	5460	-50.75	3.77	-	48.25	Peak	68.2	Pass
NVNT	be20	5240	Ant3	5460	-58.69	3.77	0.12	40.43	Average	54	Pass
NVNT	be40	5190	Ant3	4500	-49.72	3.77	-	49.28	Peak	68.2	Pass
NVNT	be40	5190	Ant3	4500	-58.73	3.77	0.24	40.51	Average	54	Pass
NVNT	be40	5190	Ant3	5149.7	-41.5	3.77	-	57.50	Peak	68.2	Pass
NVNT	be40	5190	Ant3	5148.97	-55.75	3.77	0.24	43.49	Average	54	Pass
NVNT	be40	5190	Ant3	5150	-41.5	3.77	-	57.50	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5190	Ant3	5150	-55.8	3.77	0.24	43.44	Average	54	Pass
NVNT	be40	5230	Ant3	5350	-49.54	3.77	-	49.46	Peak	68.2	Pass
NVNT	be40	5230	Ant3	5350	-58.86	3.77	0.24	40.38	Average	54	Pass
NVNT	be40	5230	Ant3	5396.82	-47.16	3.77	-	51.84	Peak	68.2	Pass
NVNT	be40	5230	Ant3	5352	-57.5	3.77	0.24	41.74	Average	54	Pass
NVNT	be40	5230	Ant3	5460	-51.26	3.77	-	47.74	Peak	68.2	Pass
NVNT	be40	5230	Ant3	5460	-58.34	3.77	0.24	40.90	Average	54	Pass
NVNT	be80	5210	Ant3	5350	-48.92	3.77	-	50.08	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5350	-57.12	3.77	0.47	42.35	Average	54	Pass
NVNT	be80	5210	Ant3	5389.38	-46.73	3.77	-	52.27	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5352.75	-56.65	3.77	0.47	42.82	Average	54	Pass
NVNT	be80	5210	Ant3	5460	-50.67	3.77	-	48.33	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5460	-58	3.77	0.47	41.47	Average	54	Pass
NVNT	be80	5210	Ant3	4500	-49.91	3.77	-	49.09	Peak	68.2	Pass
NVNT	be80	5210	Ant3	4500	-58.62	3.77	0.47	40.85	Average	54	Pass
NVNT	be80	5210	Ant3	5147.01	-43.43	3.77	-	55.57	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5148.59	-55.53	3.77	0.47	43.94	Average	54	Pass
NVNT	be80	5210	Ant3	5150	-47.73	3.77	-	51.27	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5150	-55.11	3.77	0.47	44.36	Average	54	Pass
NVNT	ac160	5250	Ant3	5350	-47.58	3.77	-	51.42	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5350	-62.79	3.77	3.77	39.98	Average	54	Pass
NVNT	ac160	5250	Ant3	5350.48	-42.18	3.77	-	56.82	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5407.83	-60.23	3.77	3.77	42.54	Average	54	Pass
NVNT	ac160	5250	Ant3	5460	-57.25	3.77	-	41.75	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5460	-66.76	3.77	3.77	36.01	Average	54	Pass
NVNT	ac160	5250	Ant3	4500	-60.01	3.77	-	38.99	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	4500	-68.55	3.77	3.77	34.22	Average	54	Pass
NVNT	ac160	5250	Ant3	5132.45	-51.77	3.77	-	47.23	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5137	-64.91	3.77	3.77	37.86	Average	54	Pass
NVNT	ac160	5250	Ant3	5150	-55.86	3.77	-	43.14	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5150	-66.12	3.77	3.77	36.65	Average	54	Pass
NVNT	ax160	5250	Ant3	5350	-49.79	3.77	-	49.21	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5350	-60.69	3.77	3.52	41.83	Average	54	Pass
NVNT	ax160	5250	Ant3	5392.29	-41.01	3.77	-	57.99	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5406.35	-56.87	3.77	3.52	45.65	Average	54	Pass
NVNT	ax160	5250	Ant3	5460	-54.82	3.77	-	44.18	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5460	-66.17	3.77	3.52	36.35	Average	54	Pass
NVNT	ax160	5250	Ant3	4500	-60.67	3.77	-	38.33	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	4500	-68.88	3.77	3.52	33.64	Average	54	Pass
NVNT	ax160	5250	Ant3	5126.08	-48.5	3.77	-	50.50	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5134.27	-62.78	3.77	3.52	39.74	Average	54	Pass
NVNT	ax160	5250	Ant3	5150	-53.79	3.77	-	45.21	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5150	-63.81	3.77	3.52	38.71	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	be160	5250	Ant3	5350	-37.64	3.77	-	61.36	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5350	-57.39	3.77	3.77	45.38	Average	54	Pass
NVNT	be160	5250	Ant3	5350.11	-37.64	3.77	-	61.36	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5397.1	-55.7	3.77	3.77	47.07	Average	54	Pass
NVNT	be160	5250	Ant3	5460	-49.36	3.77	-	49.64	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5460	-57.65	3.77	3.77	45.12	Average	54	Pass
NVNT	be160	5250	Ant3	4500	-50.01	3.77	-	48.99	Peak	68.2	Pass
NVNT	be160	5250	Ant3	4500	-59.23	3.77	3.77	43.54	Average	54	Pass
NVNT	be160	5250	Ant3	5134.27	-41.51	3.77	-	57.49	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5143.37	-55.74	3.77	3.77	47.03	Average	54	Pass
NVNT	be160	5250	Ant3	5150	-44.85	3.77	-	54.15	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5150	-57.04	3.77	3.77	45.73	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant3 Peak

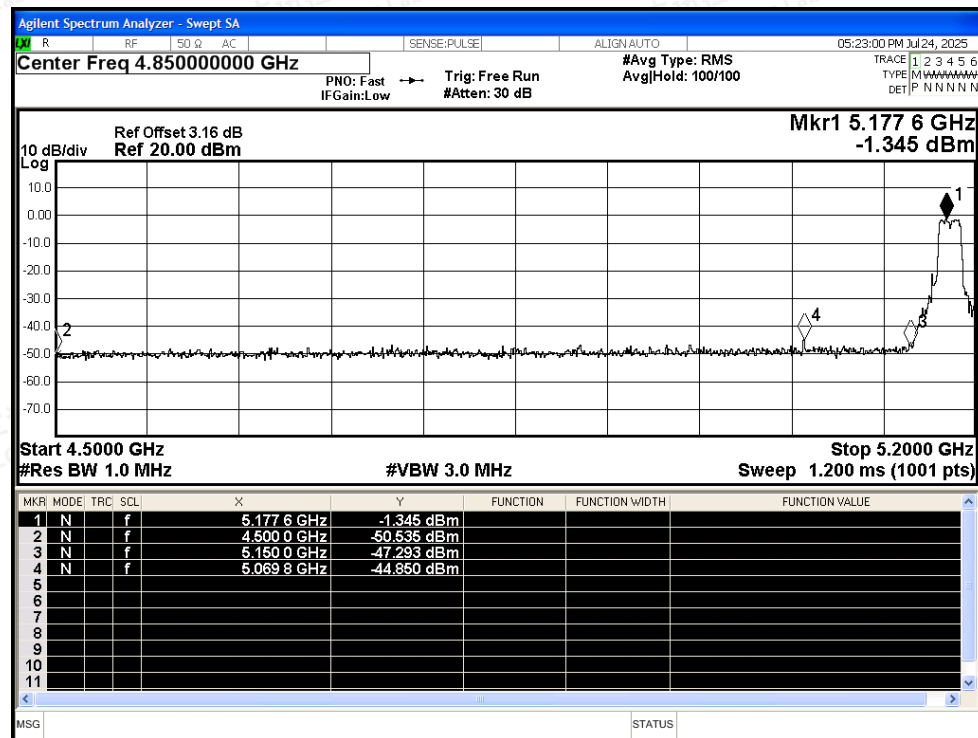

Restrict Band NVNT a 5180MHz Ant3 Average

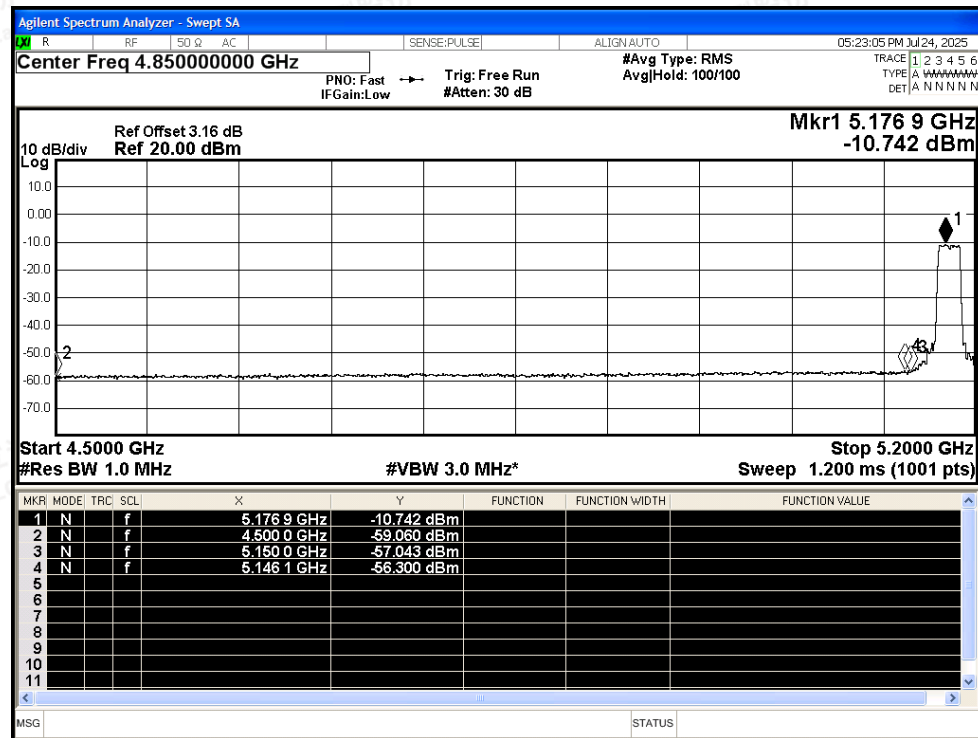

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant3 Peak

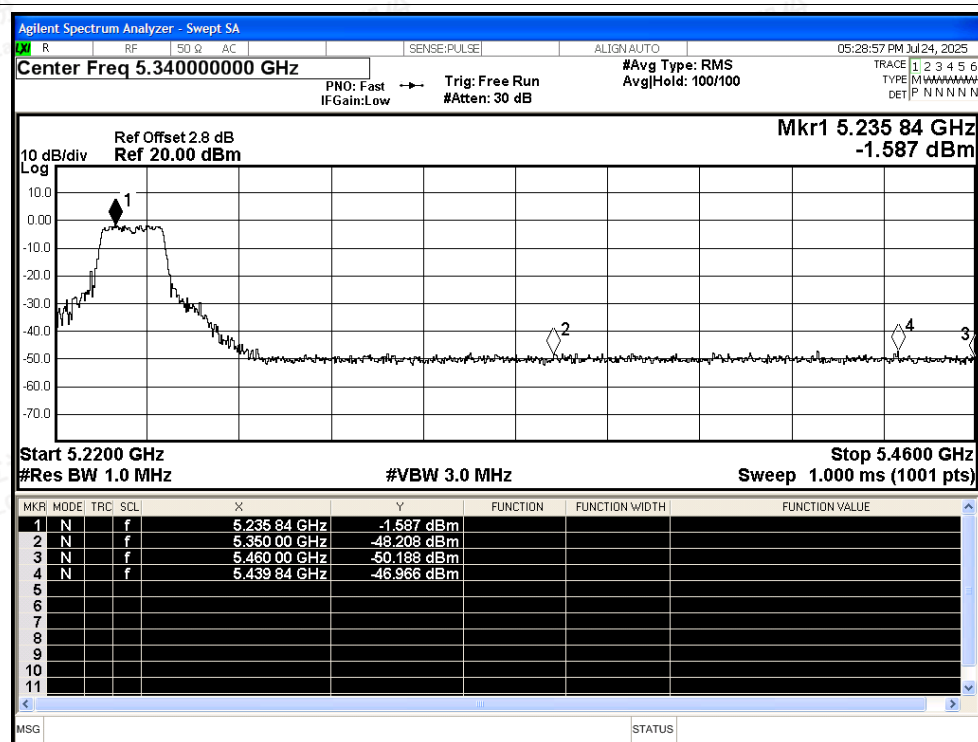

Restrict Band NVNT a 5240MHz Ant3 Average

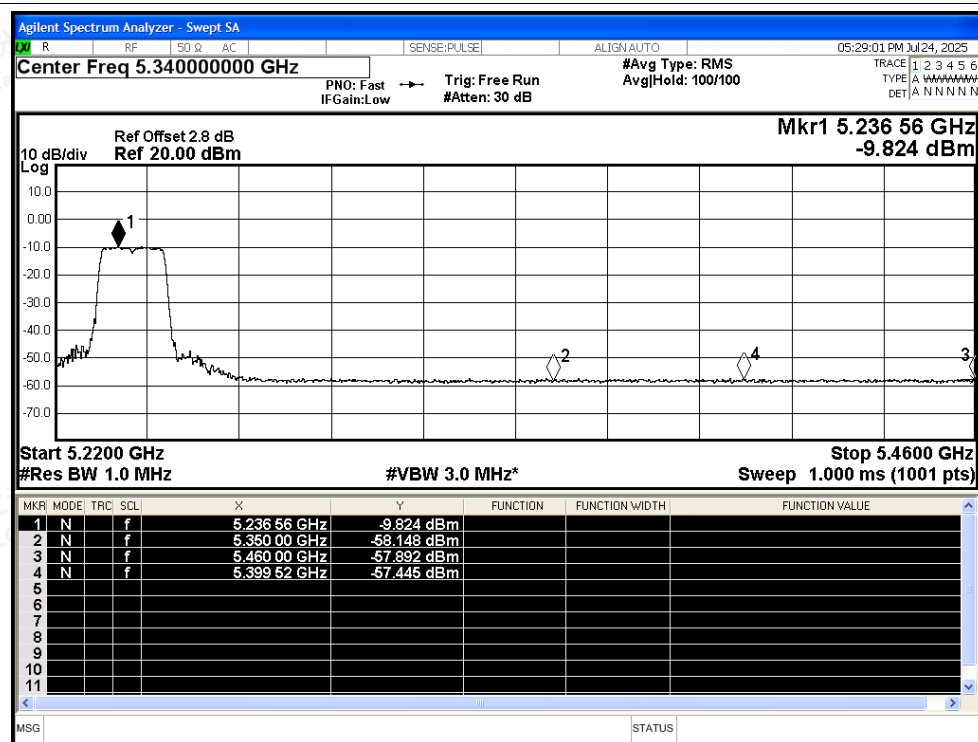

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant3 Peak

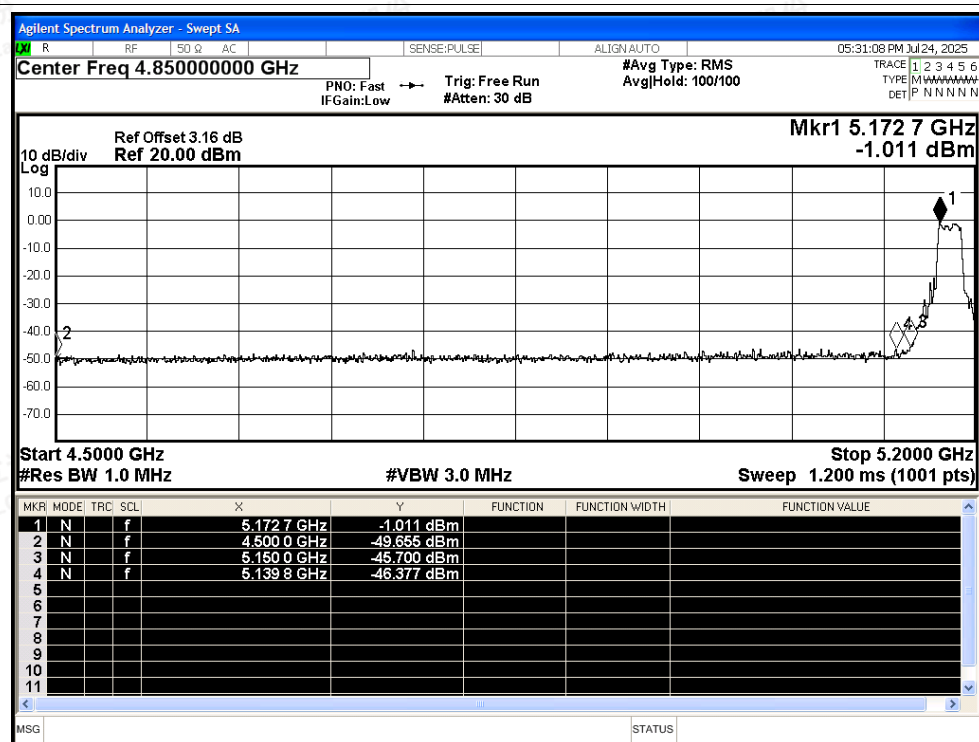

Restrict Band NVNT n20 5180MHz Ant3 Average

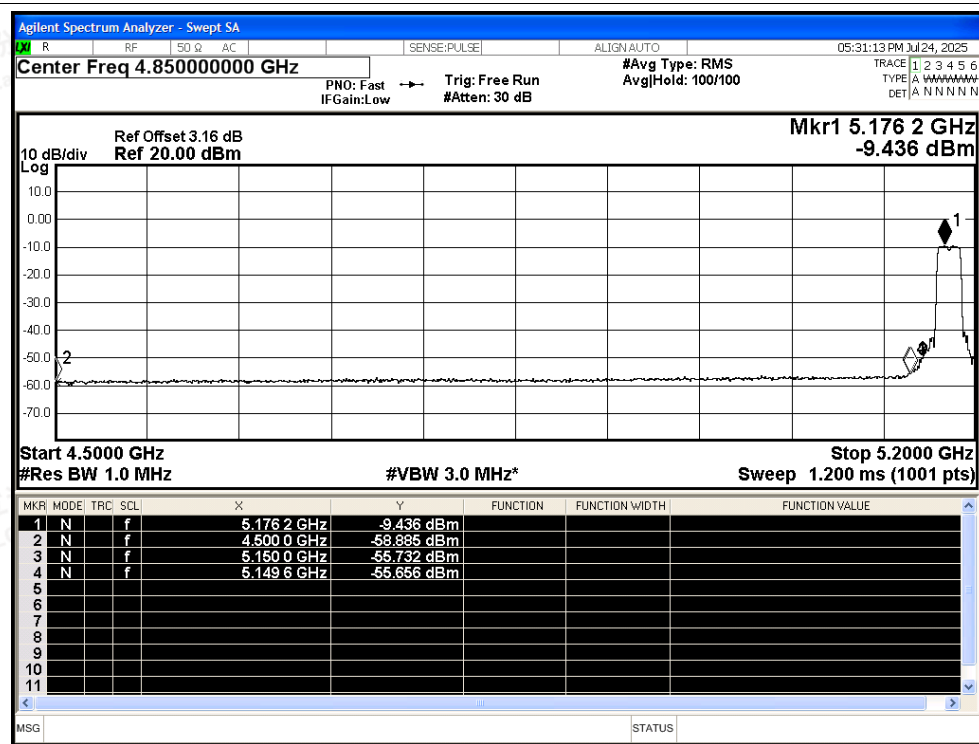

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant3 Peak

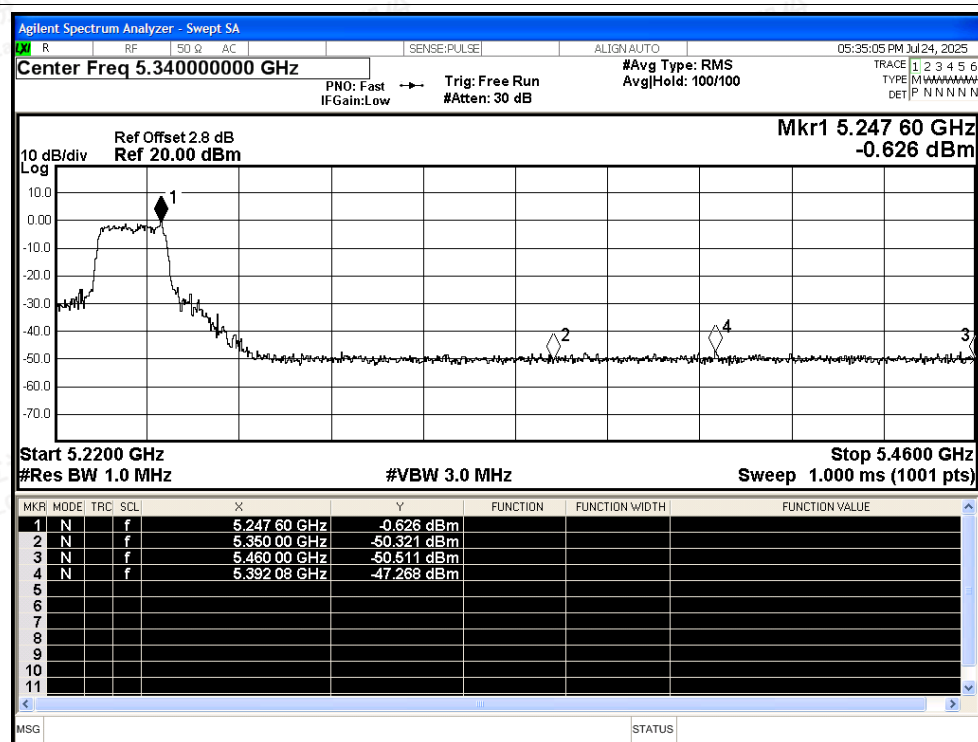

Restrict Band NVNT n20 5240MHz Ant3 Average

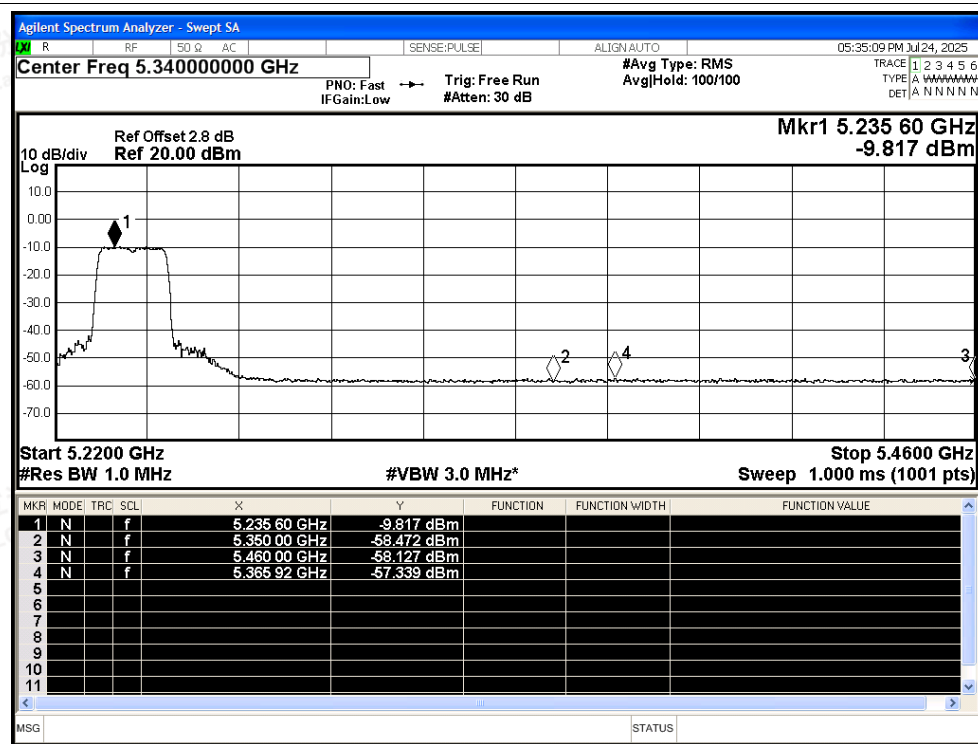

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant3 Peak

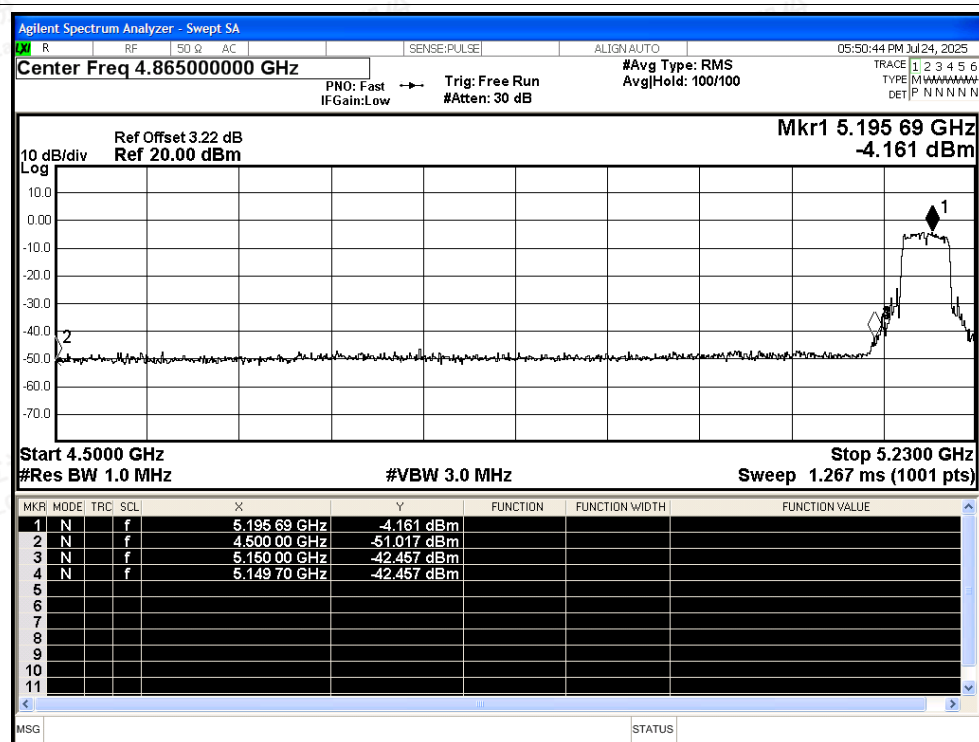

Restrict Band NVNT n40 5190MHz Ant3 Average

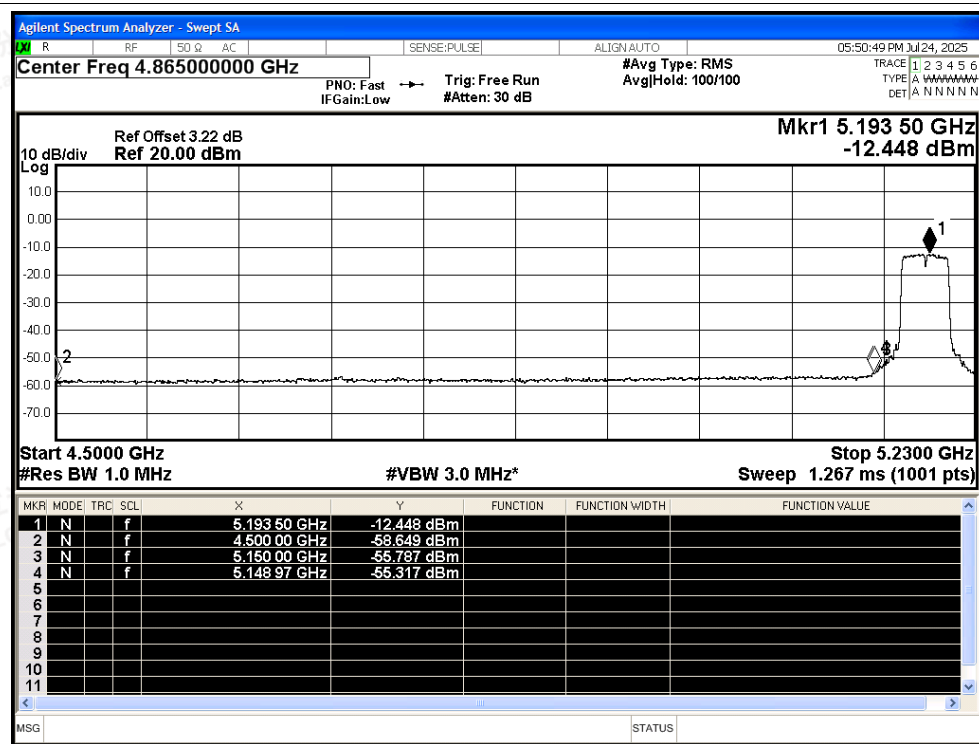

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant3 Peak

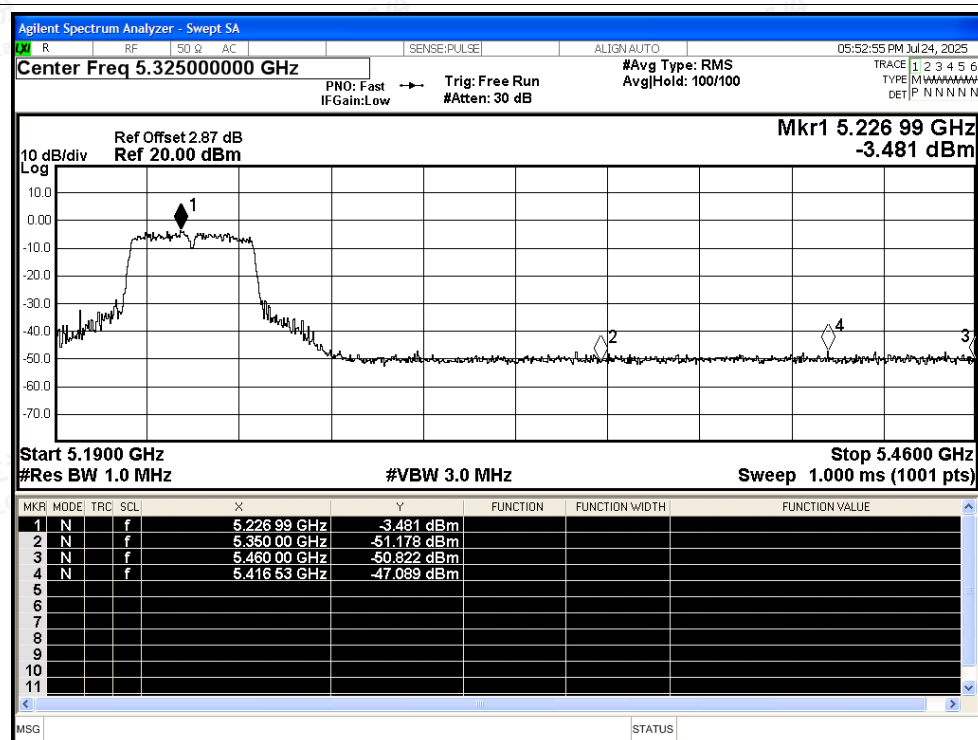

Restrict Band NVNT n40 5230MHz Ant3 Average

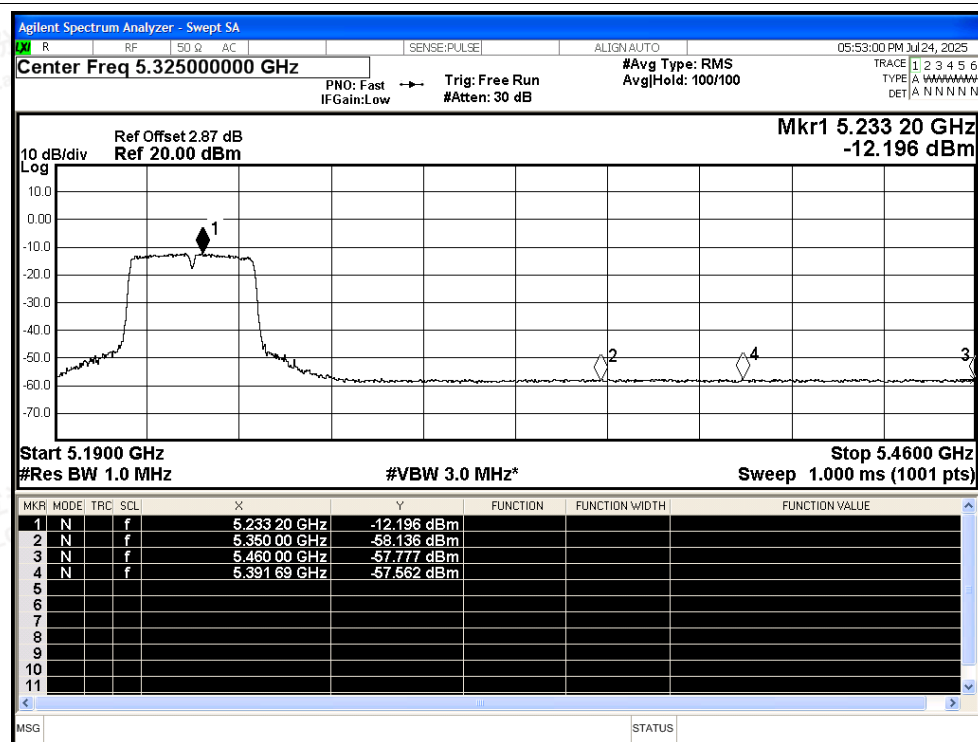

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant3 Peak

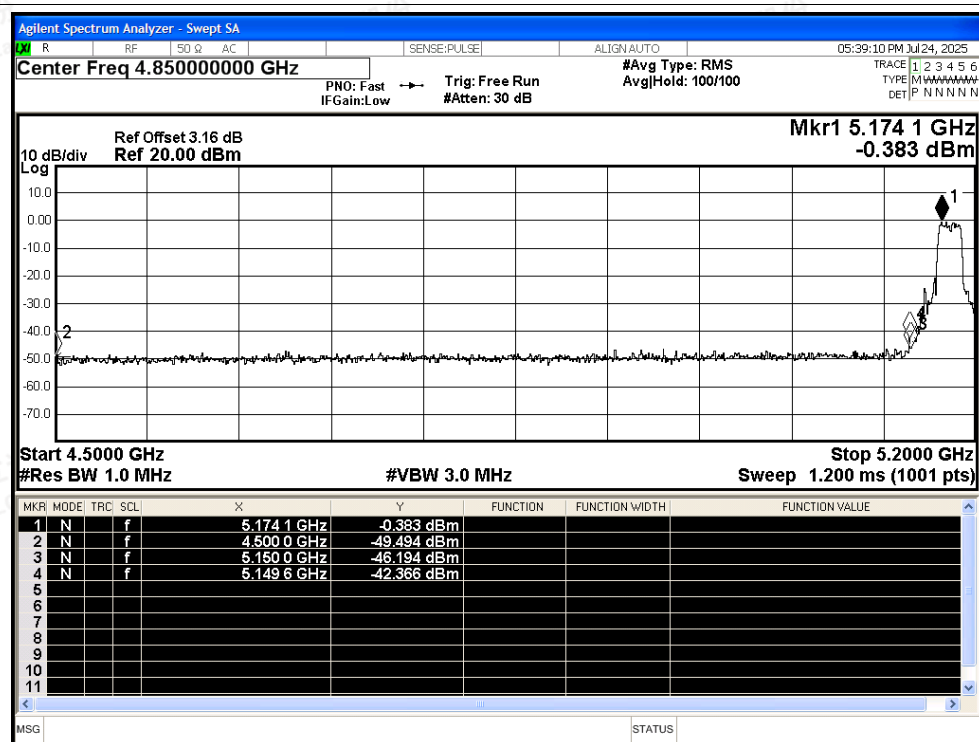

Restrict Band NVNT ac20 5180MHz Ant3 Average

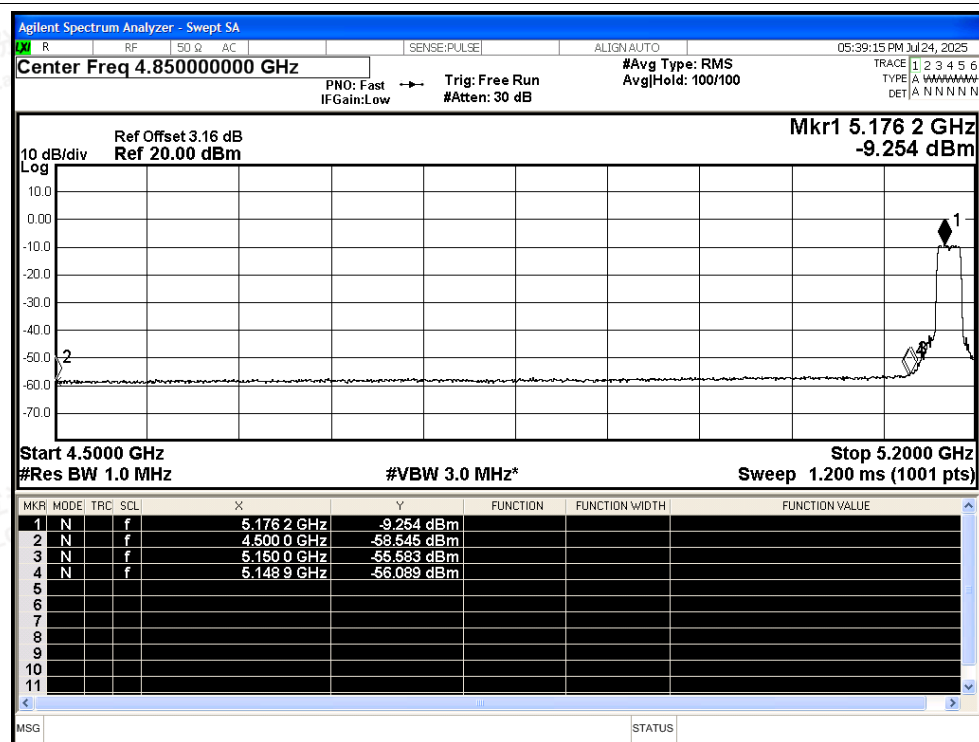

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant3 Peak

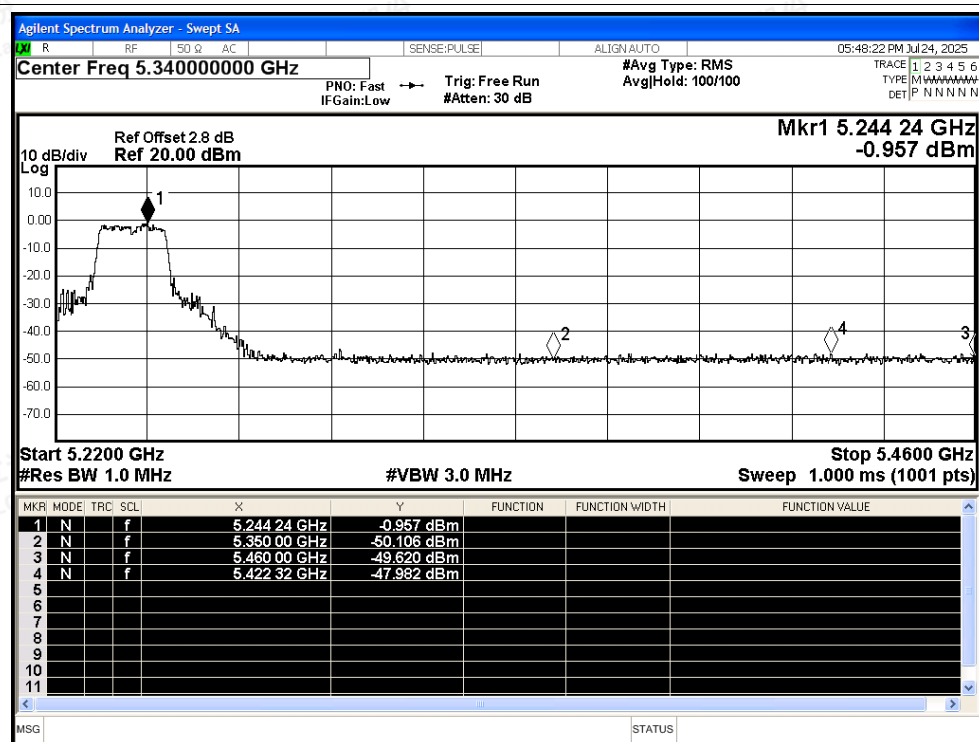

Restrict Band NVNT ac20 5240MHz Ant3 Average

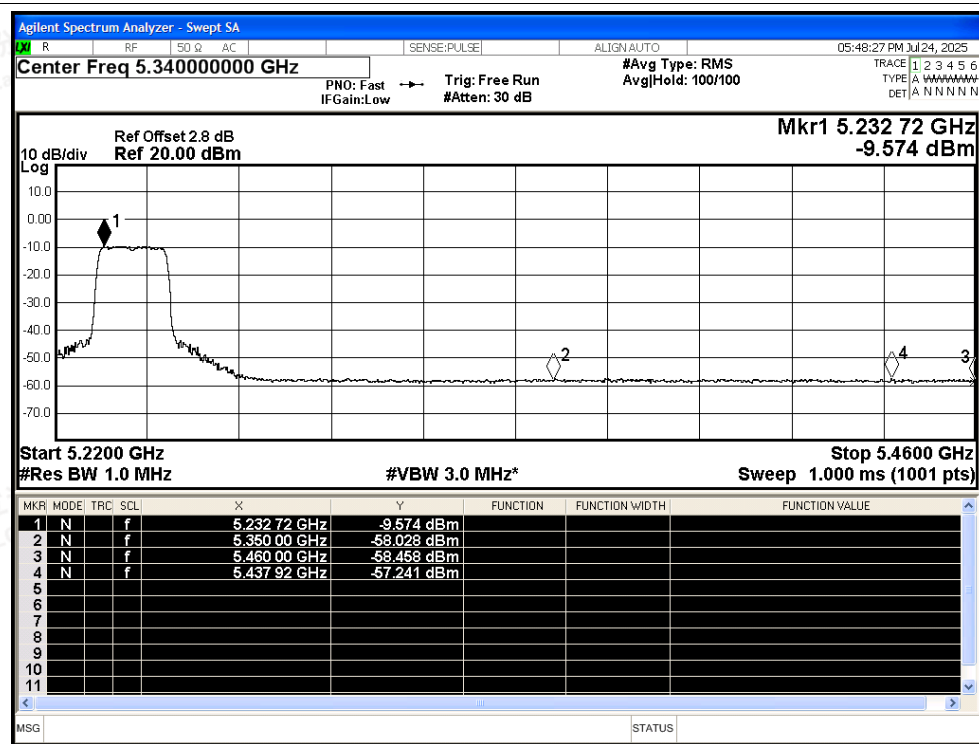

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant3 Peak

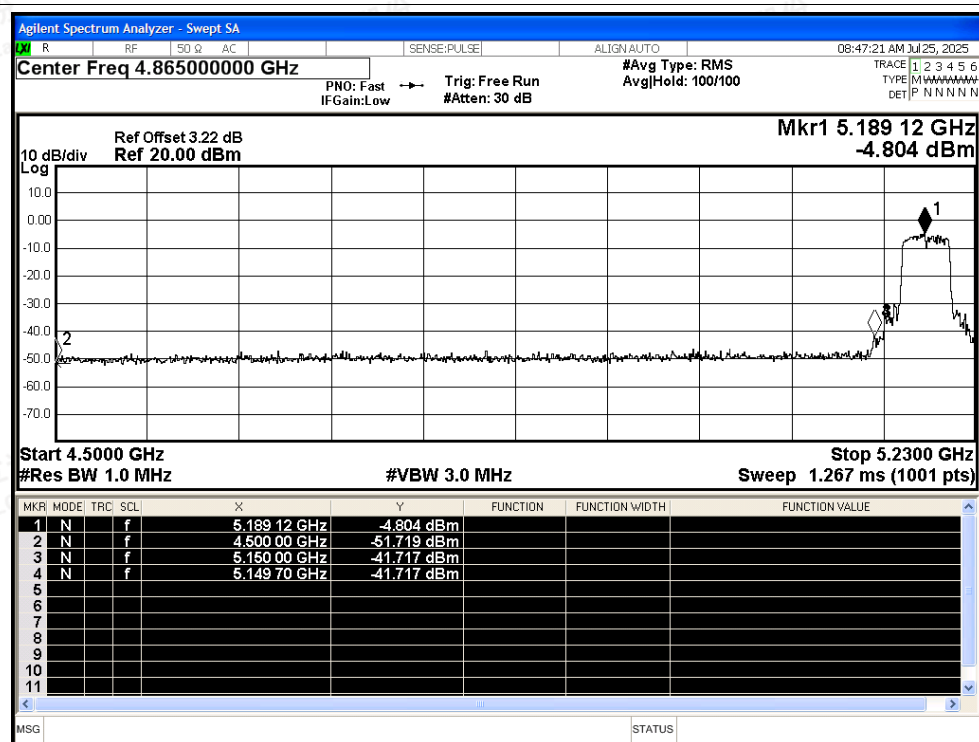

Restrict Band NVNT ac40 5190MHz Ant3 Average

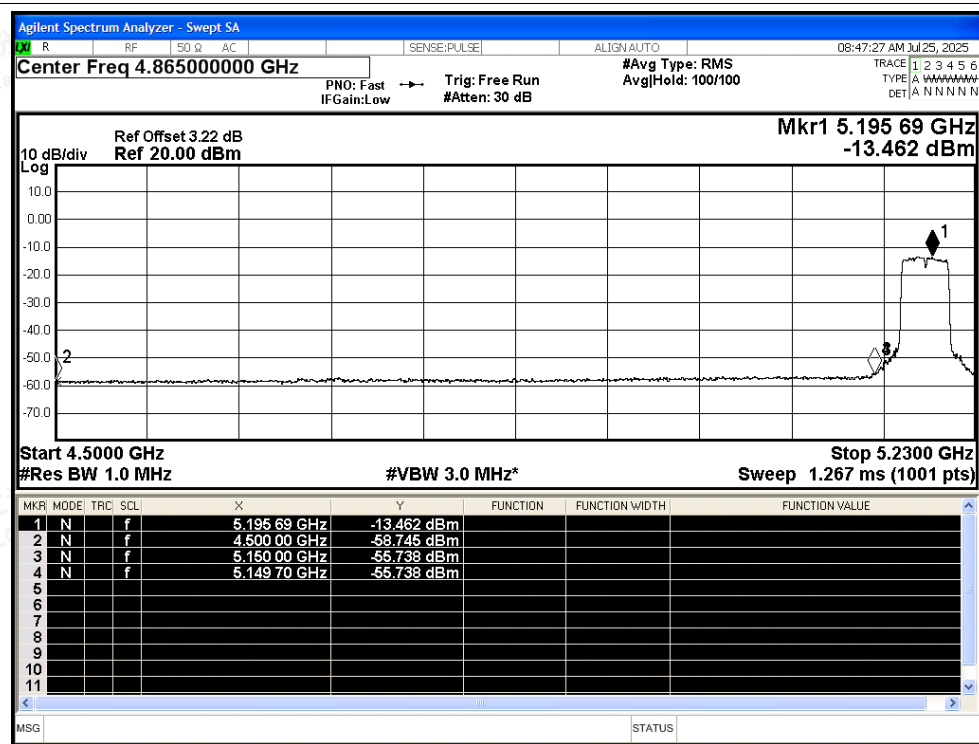

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant3 Peak

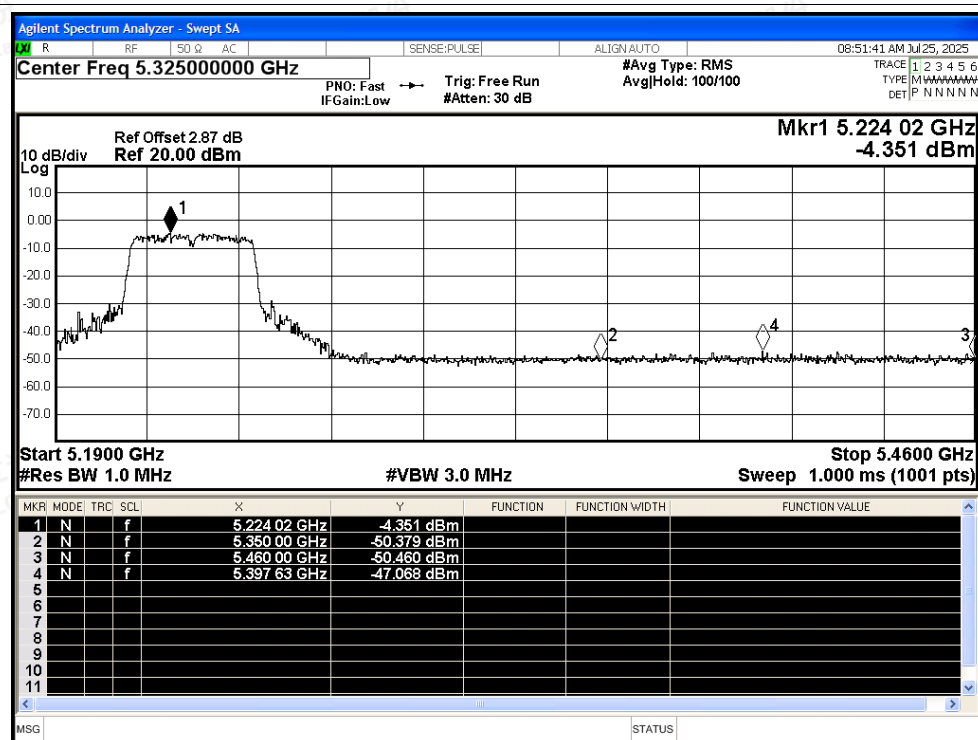

Restrict Band NVNT ac40 5230MHz Ant3 Average

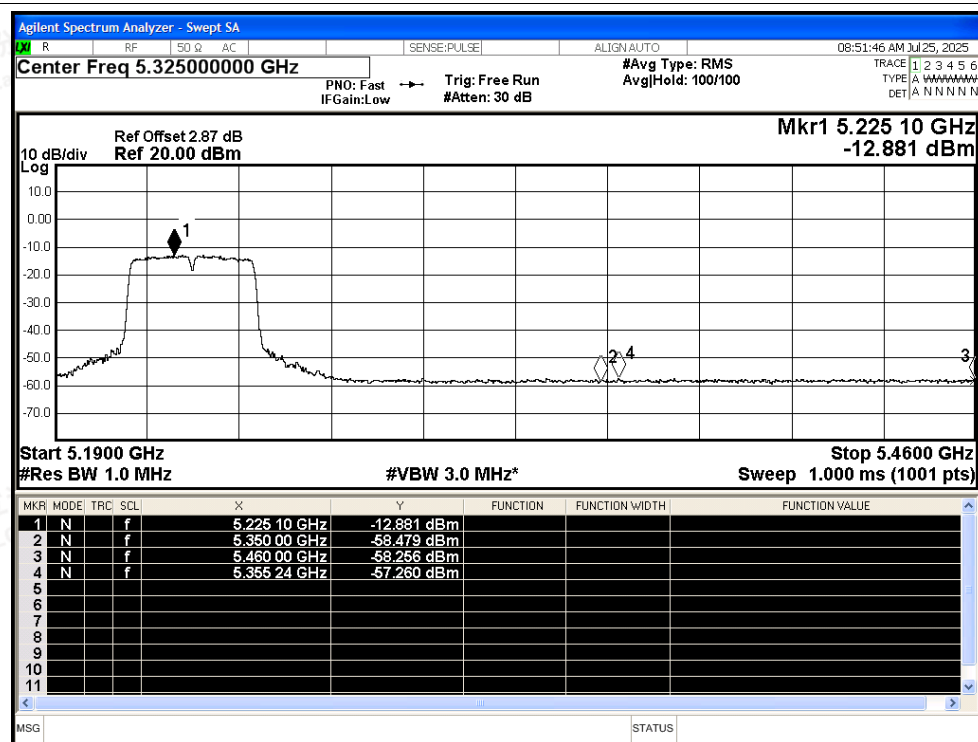

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

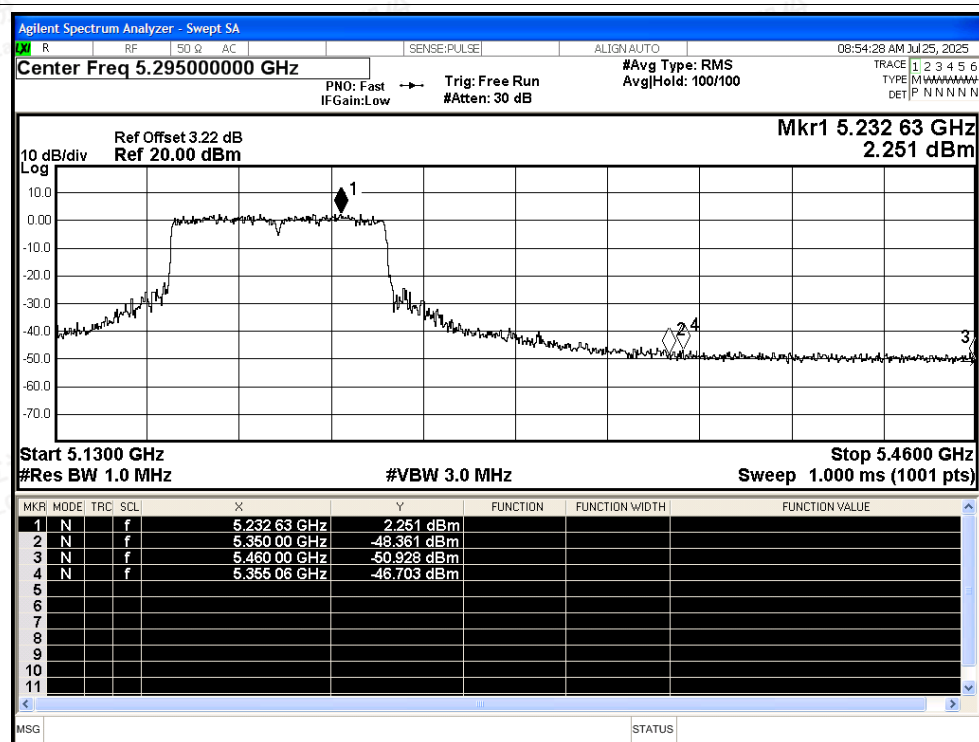

Restrict Band NVNT ac80 5210MHz Ant3 Average

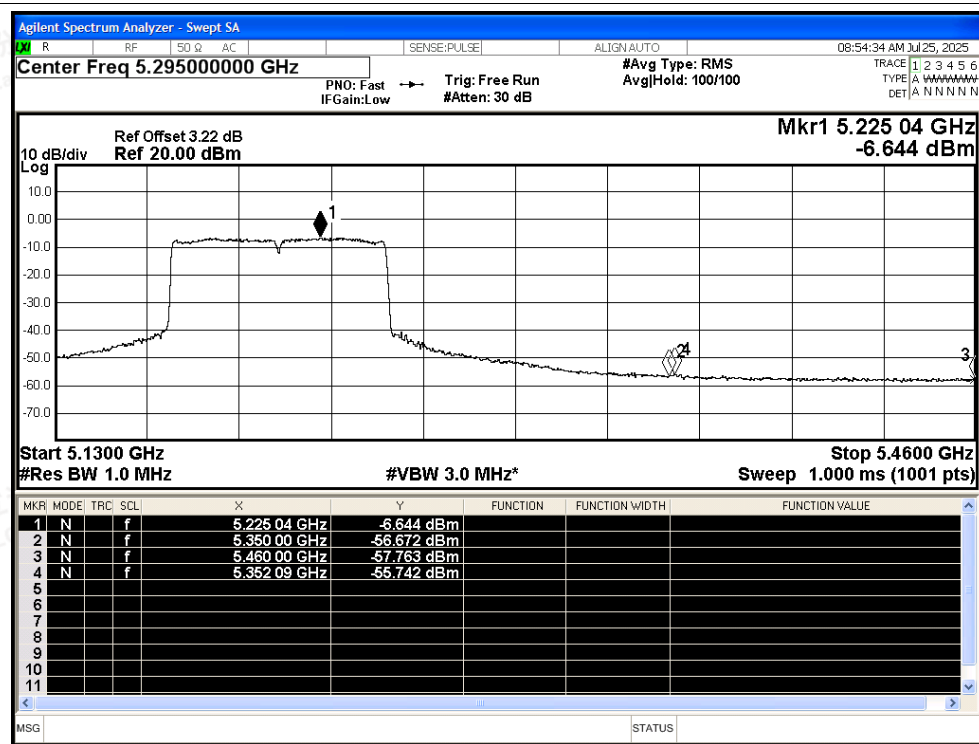

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

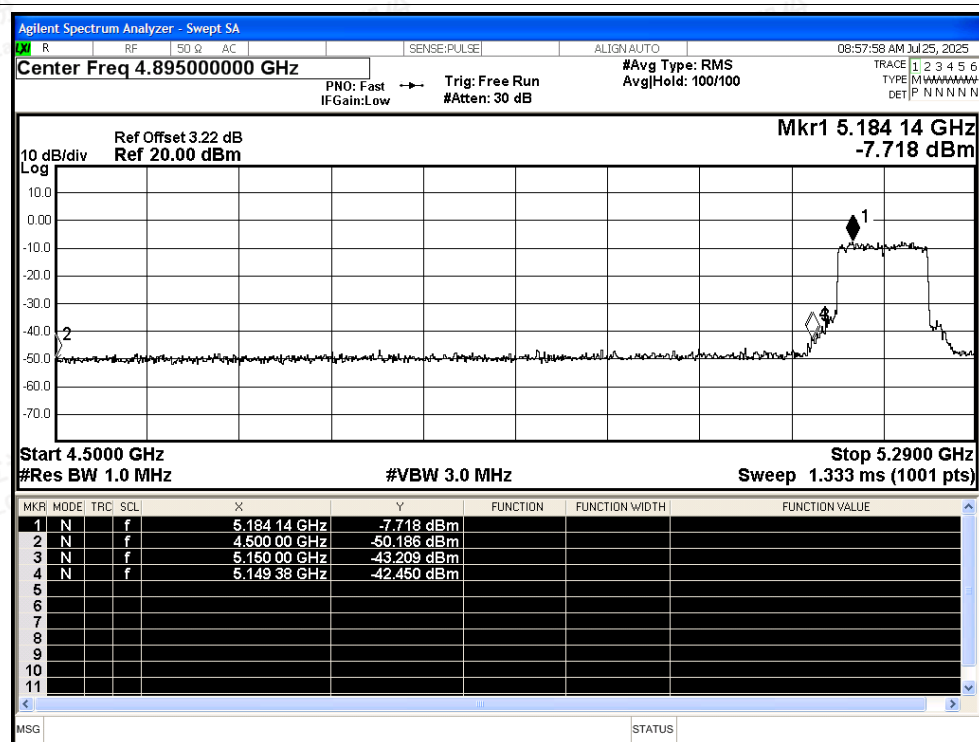

Restrict Band NVNT ac80 5210MHz Ant3 Average

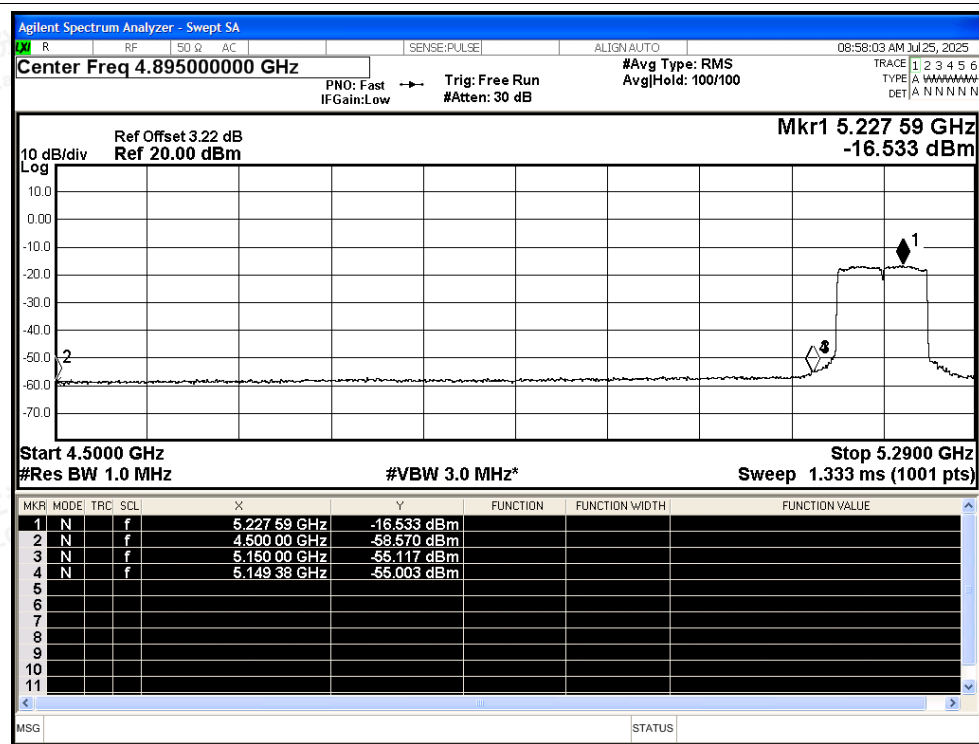

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant3 Peak

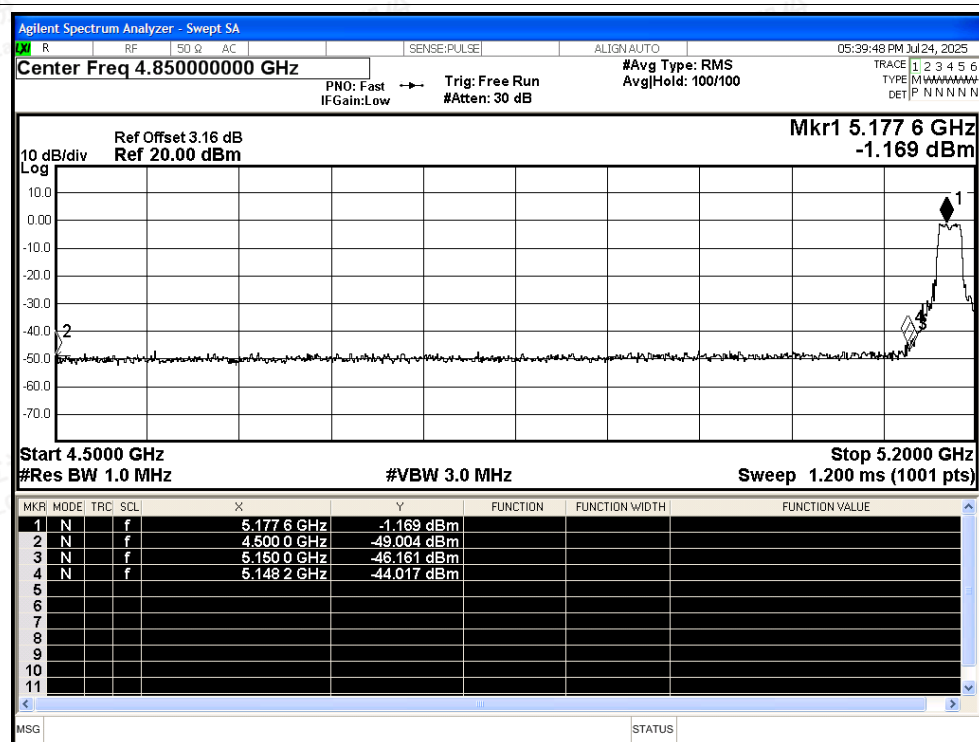

Restrict Band NVNT ax20 5180MHz Ant3 Average

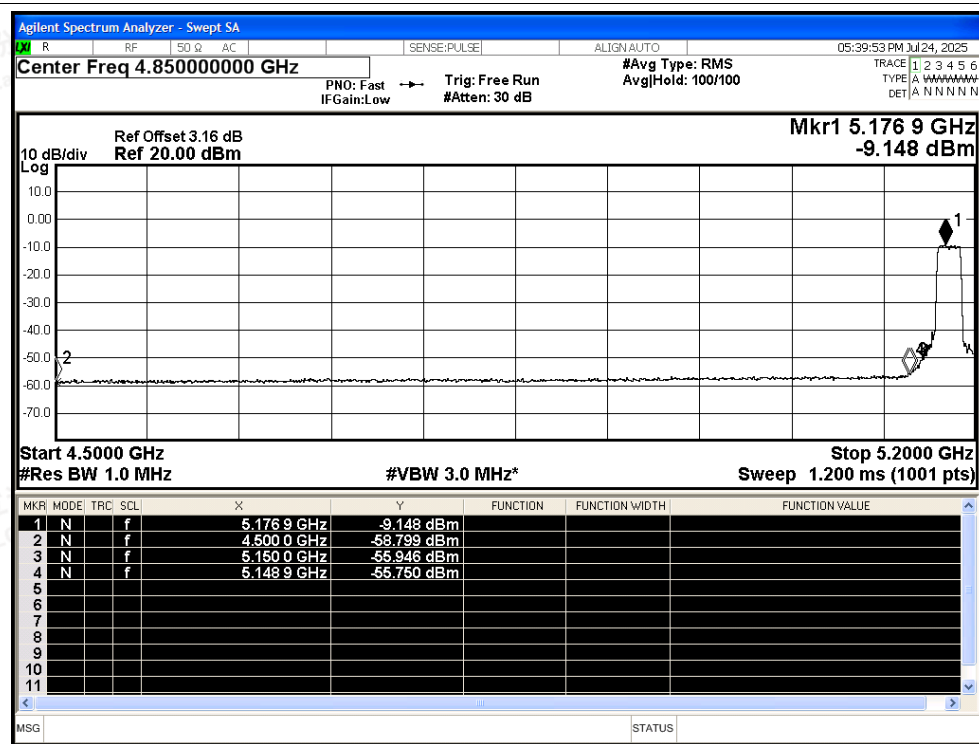

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant3 Peak

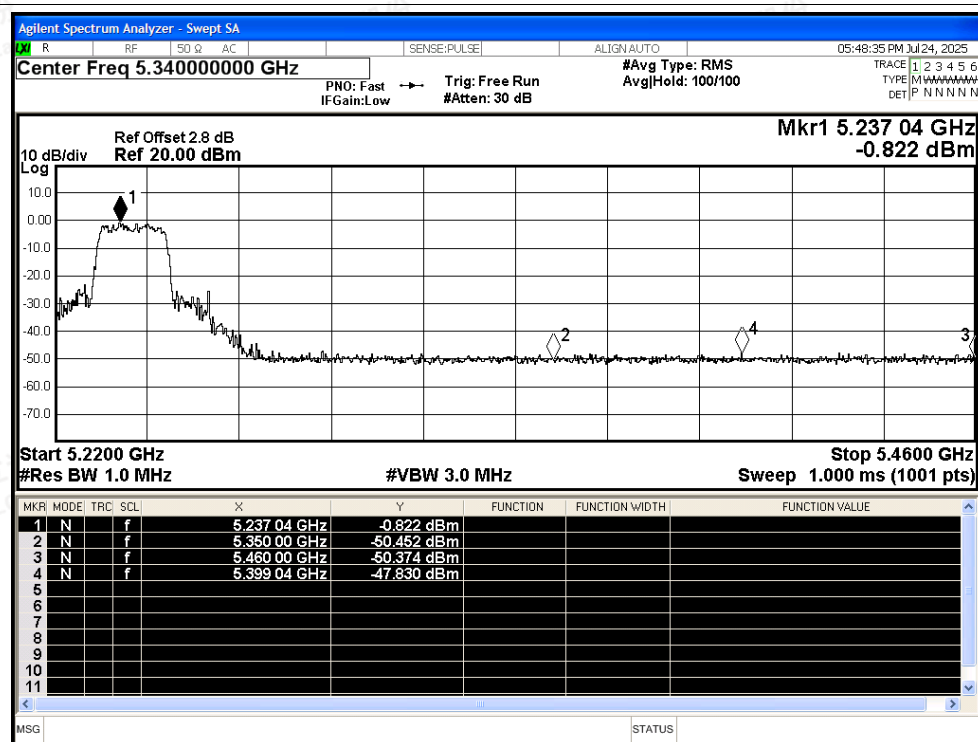

Restrict Band NVNT ax20 5240MHz Ant3 Average

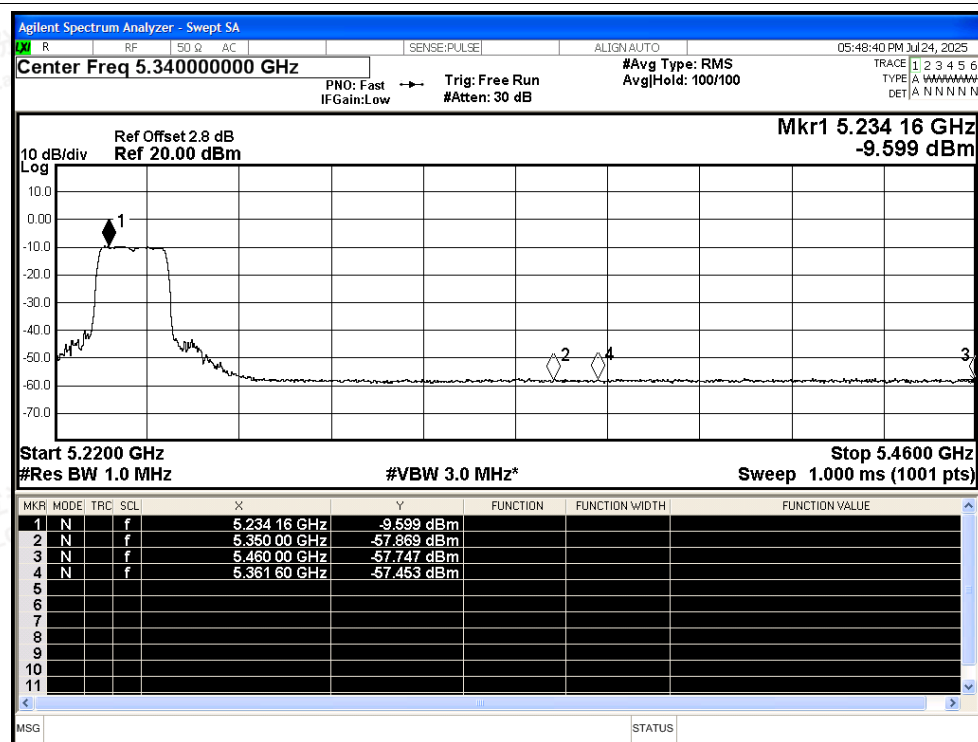

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant3 Peak

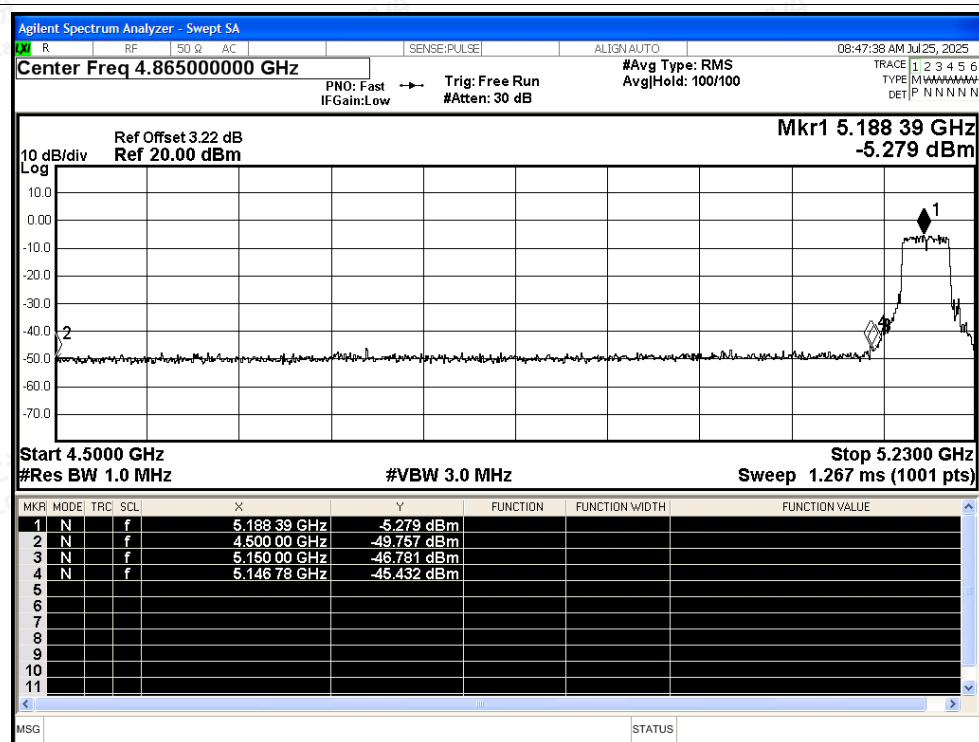

Restrict Band NVNT ax40 5190MHz Ant3 Average

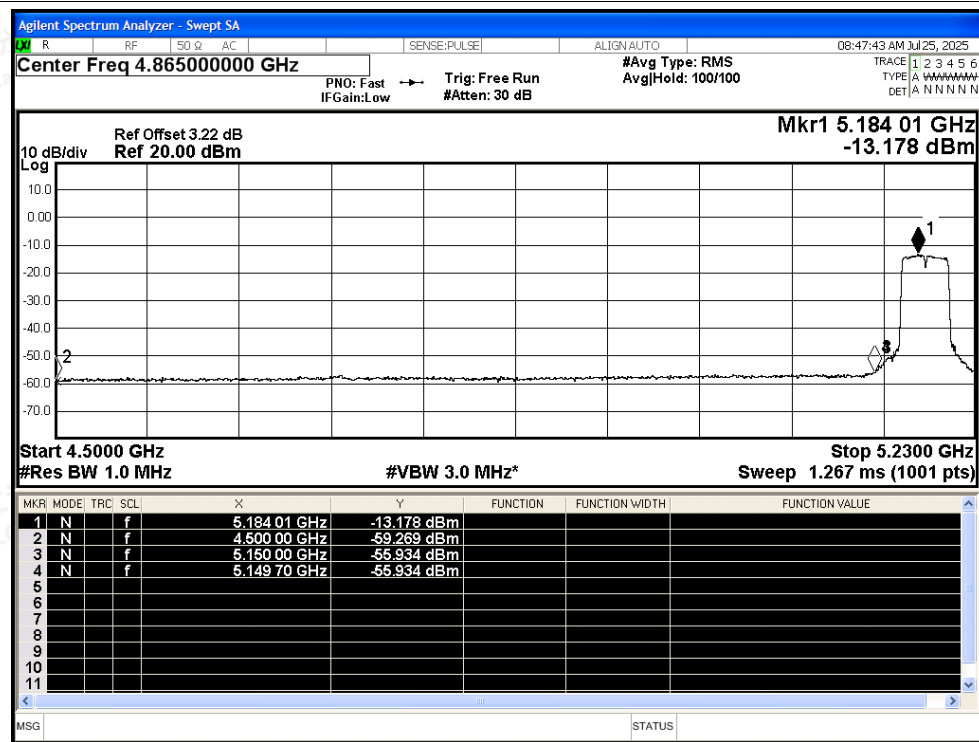

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant3 Peak

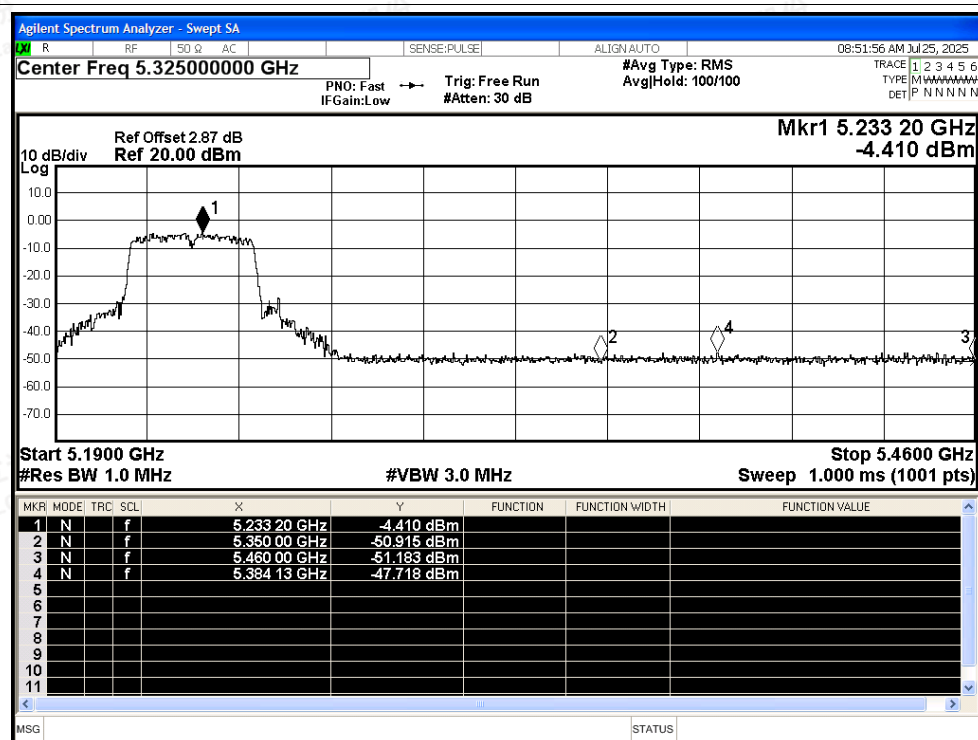

Restrict Band NVNT ax40 5230MHz Ant3 Average

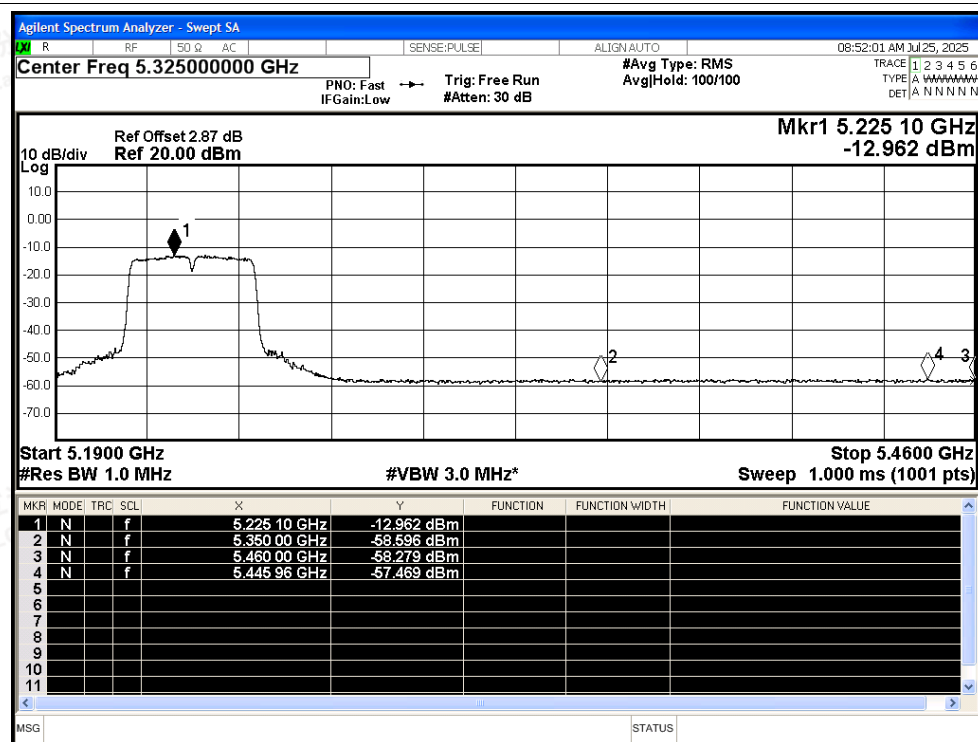

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

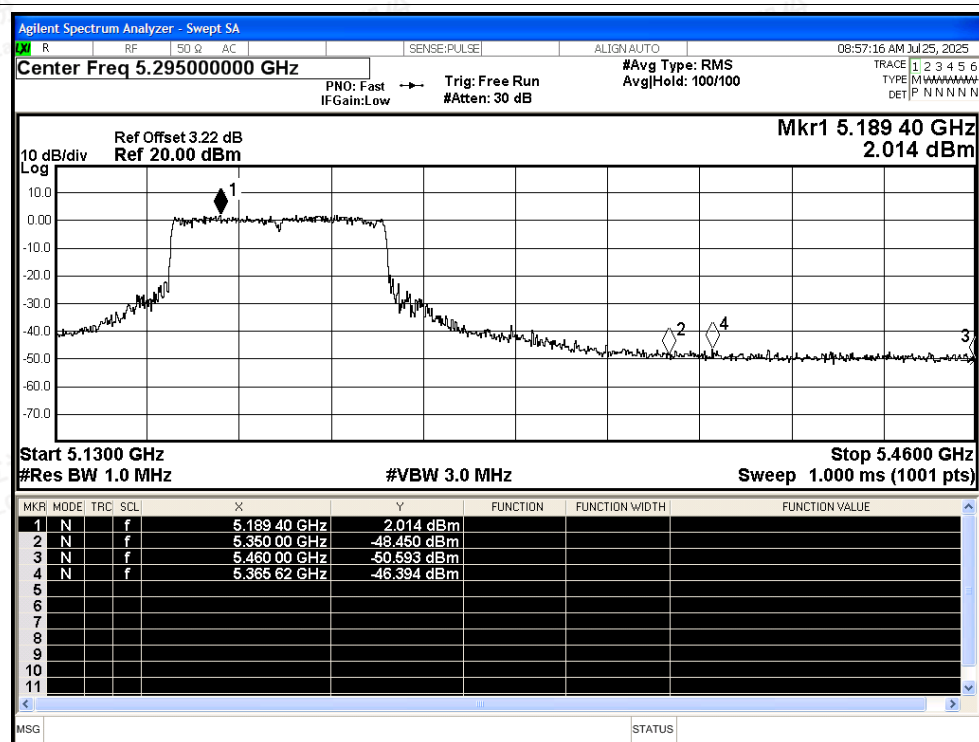

Restrict Band NVNT ax80 5210MHz Ant3 Average

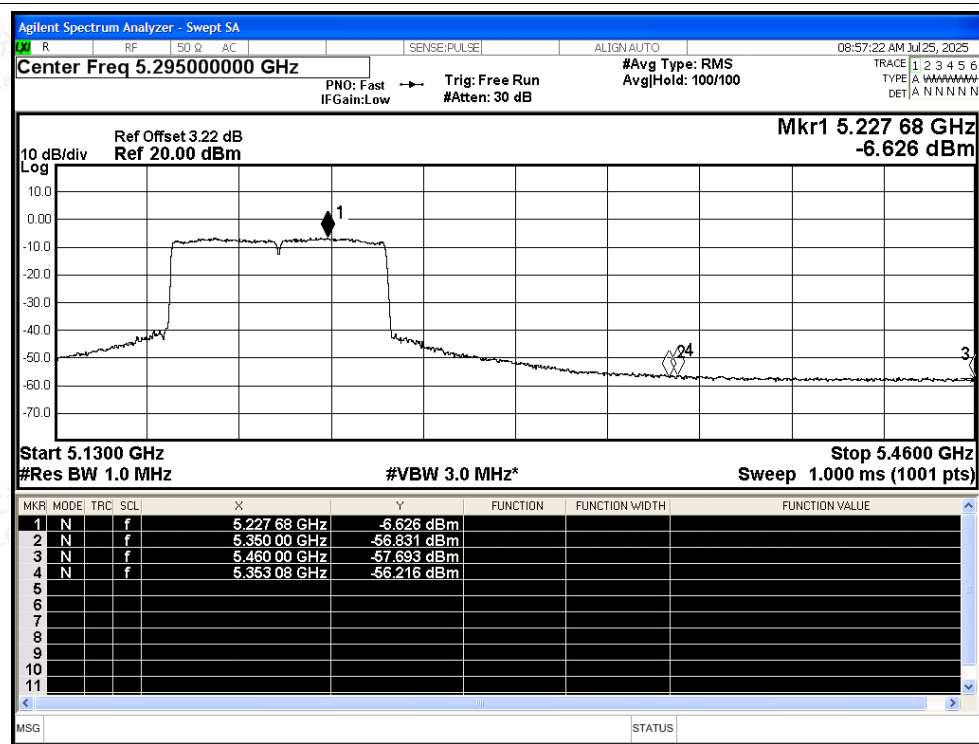

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

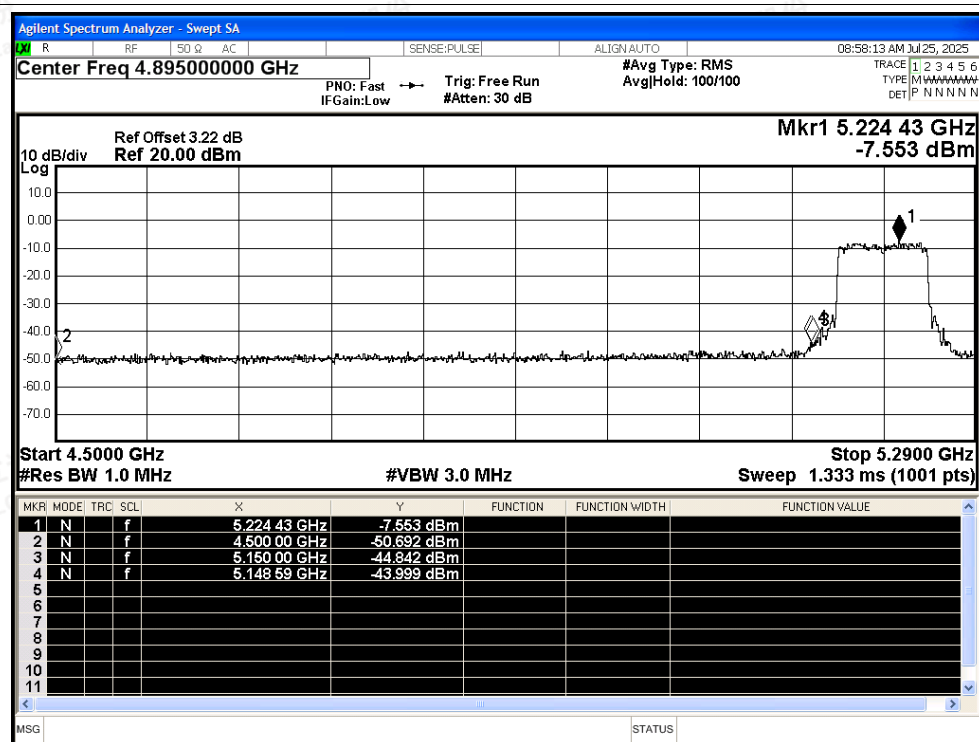

Restrict Band NVNT ax80 5210MHz Ant3 Average

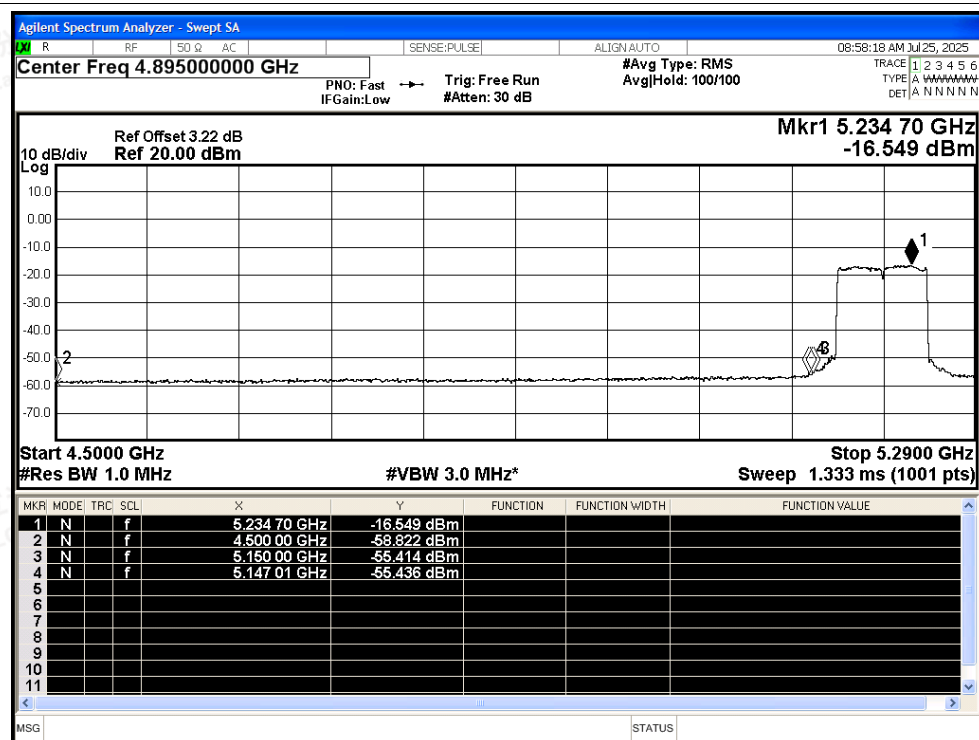

Restrict Band NVNT be20 5180MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

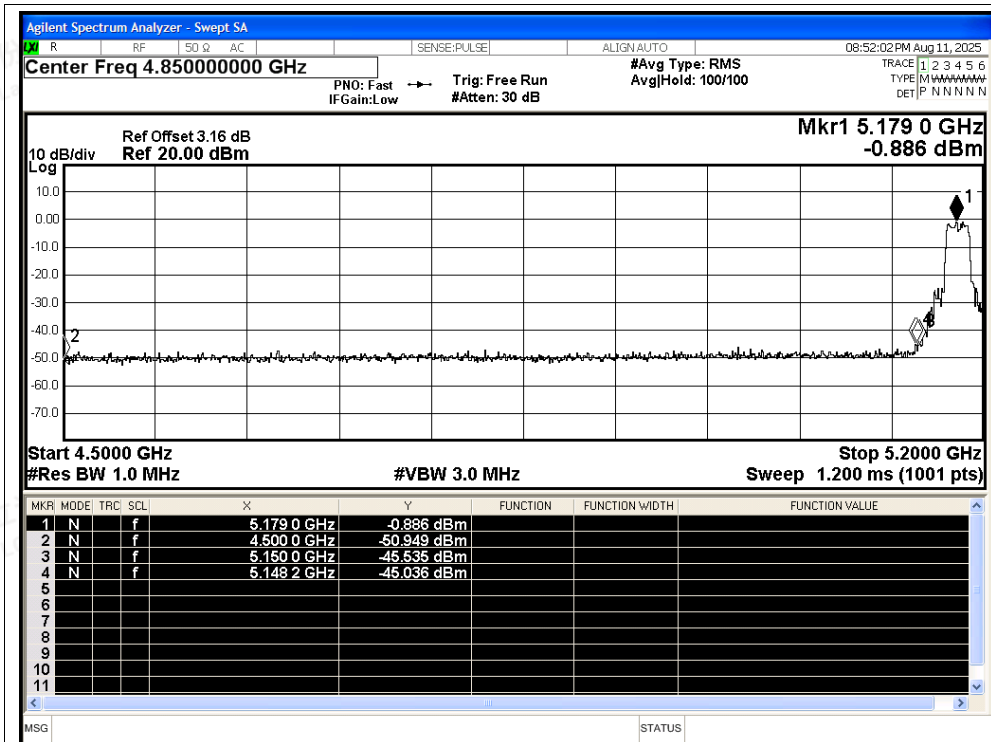

Restrict Band NVNT be20 5180MHz Ant3 Average

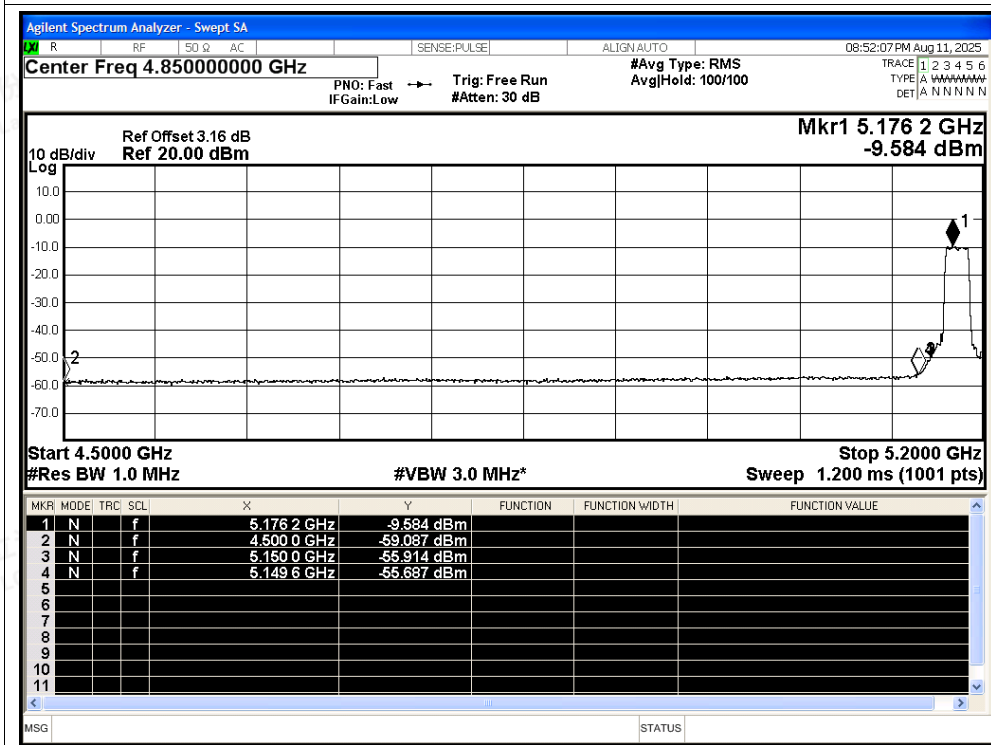

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5240MHz Ant3 Peak

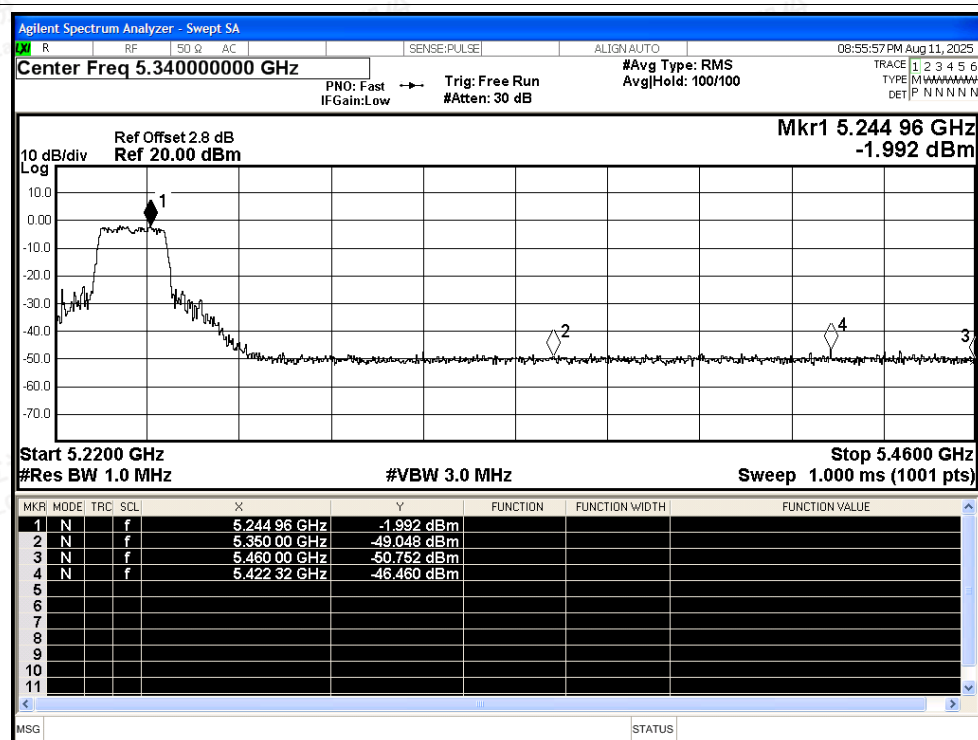

Restrict Band NVNT be20 5240MHz Ant3 Average

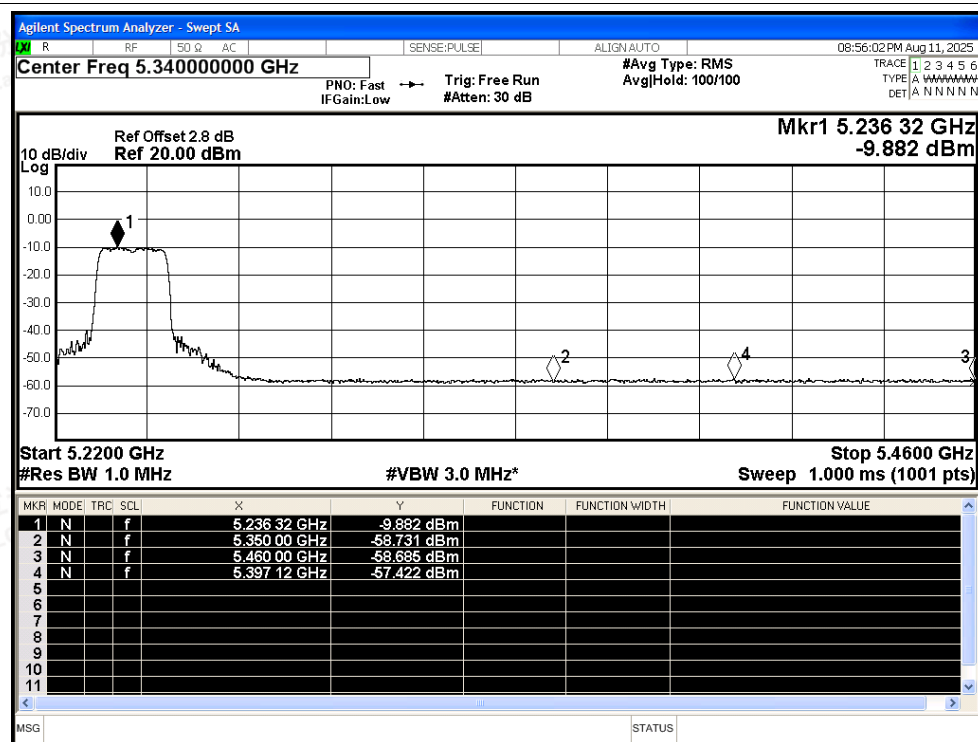

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5190MHz Ant3 Peak

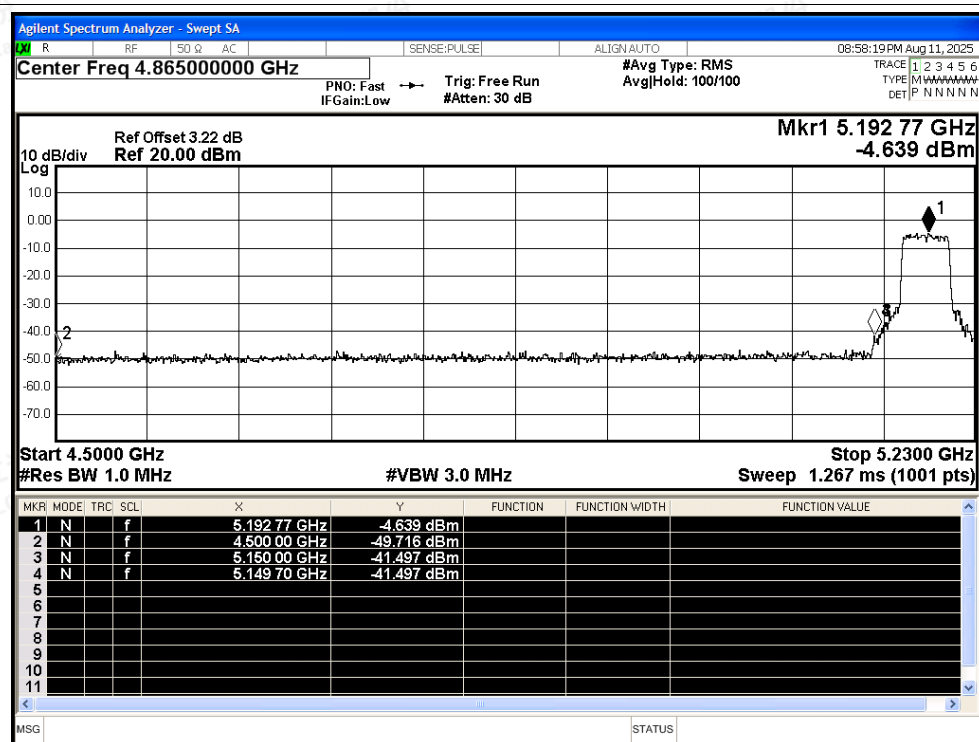

Restrict Band NVNT be40 5190MHz Ant3 Average

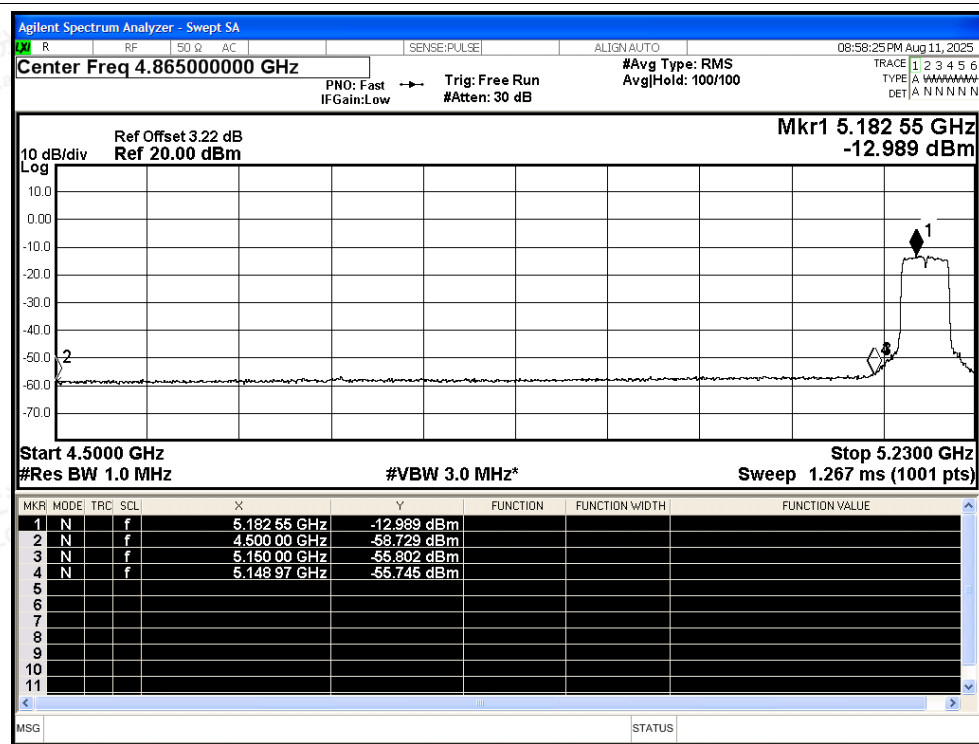

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5230MHz Ant3 Peak

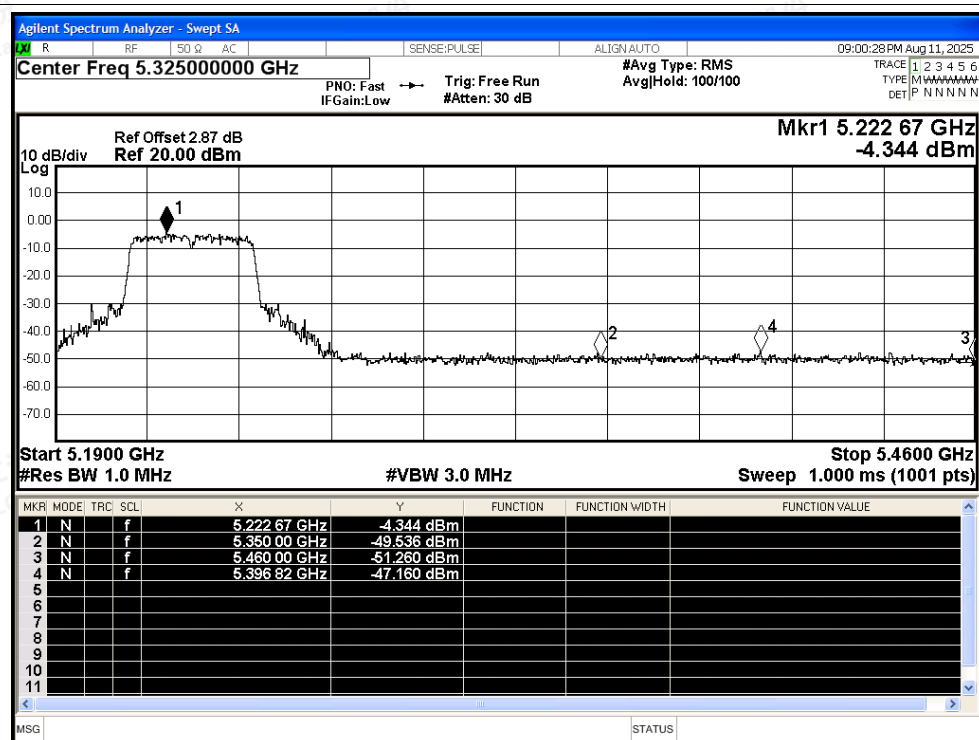

Restrict Band NVNT be40 5230MHz Ant3 Average

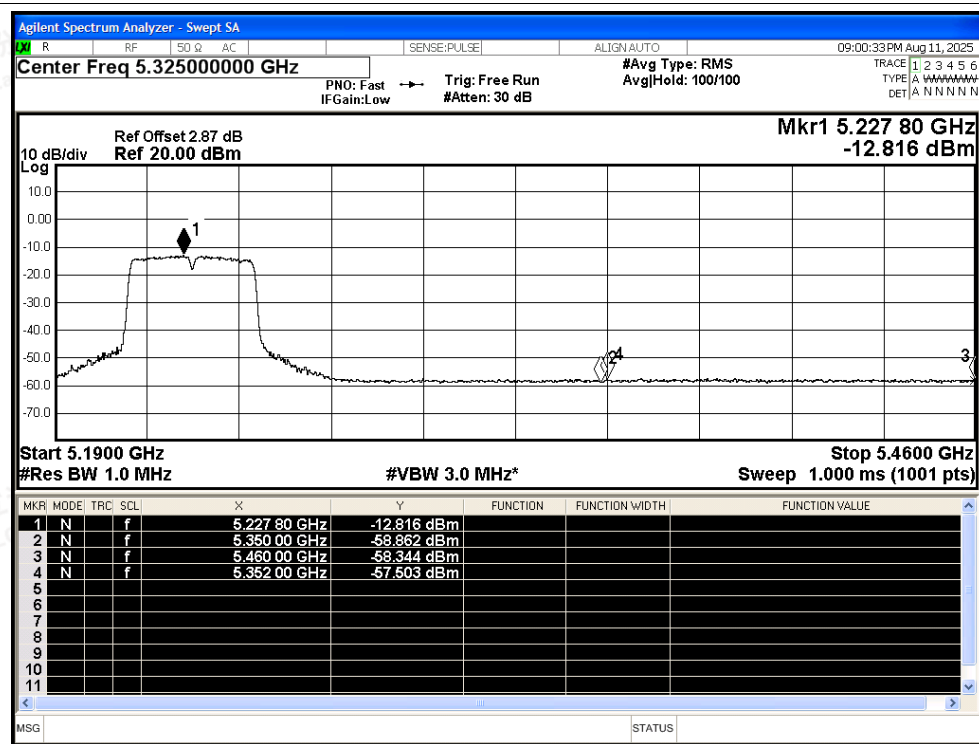

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant3 Peak

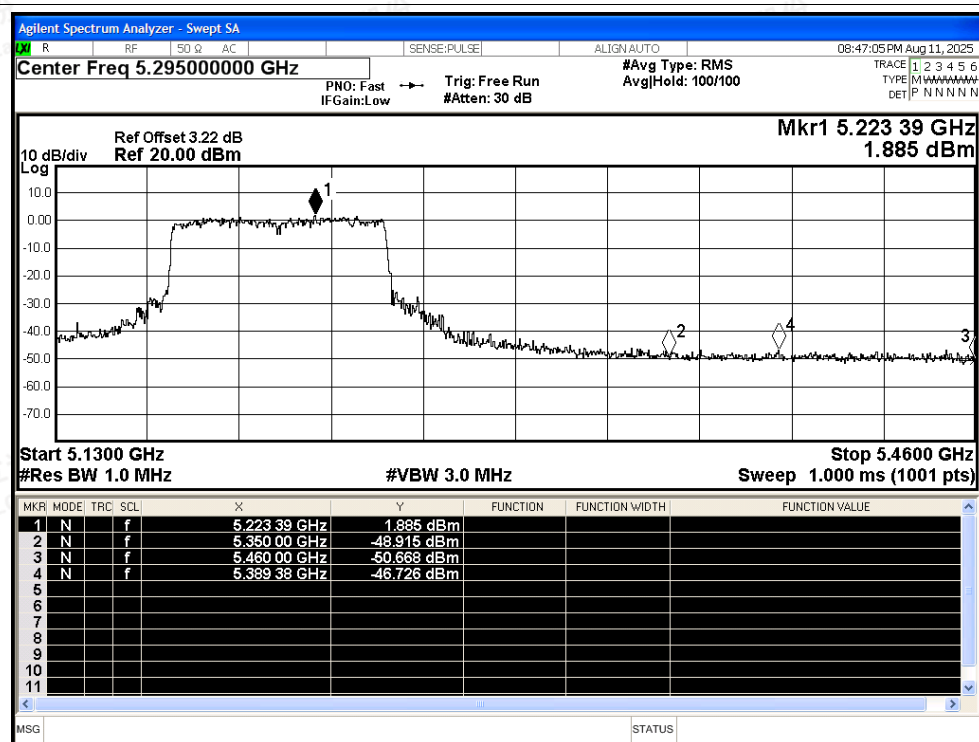

Restrict Band NVNT be80 5210MHz Ant3 Average

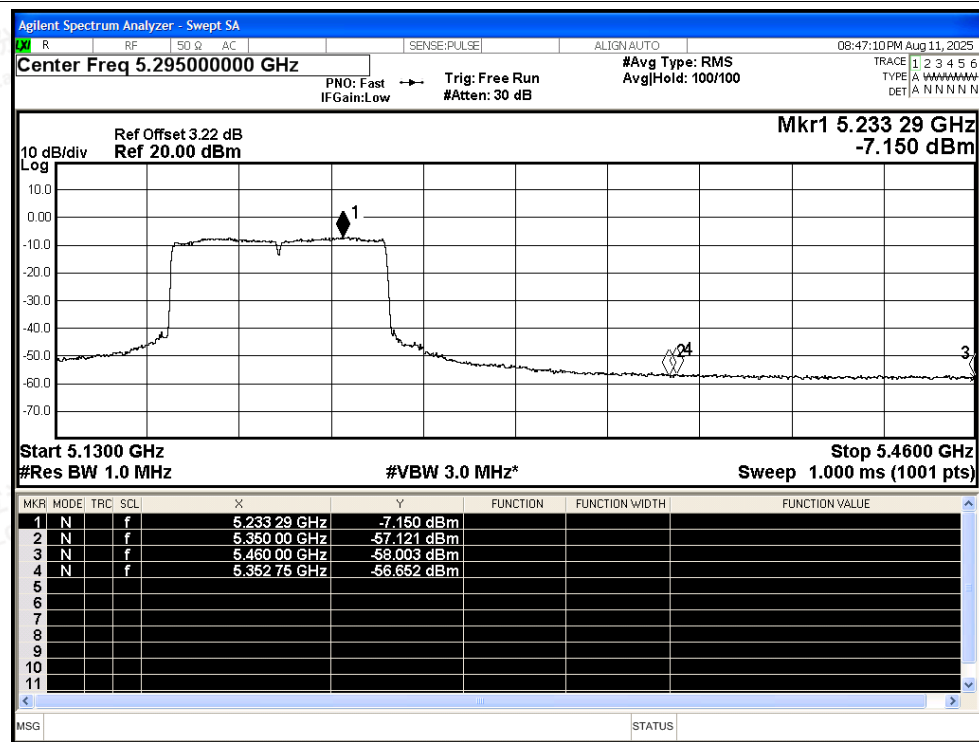

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant3 Peak

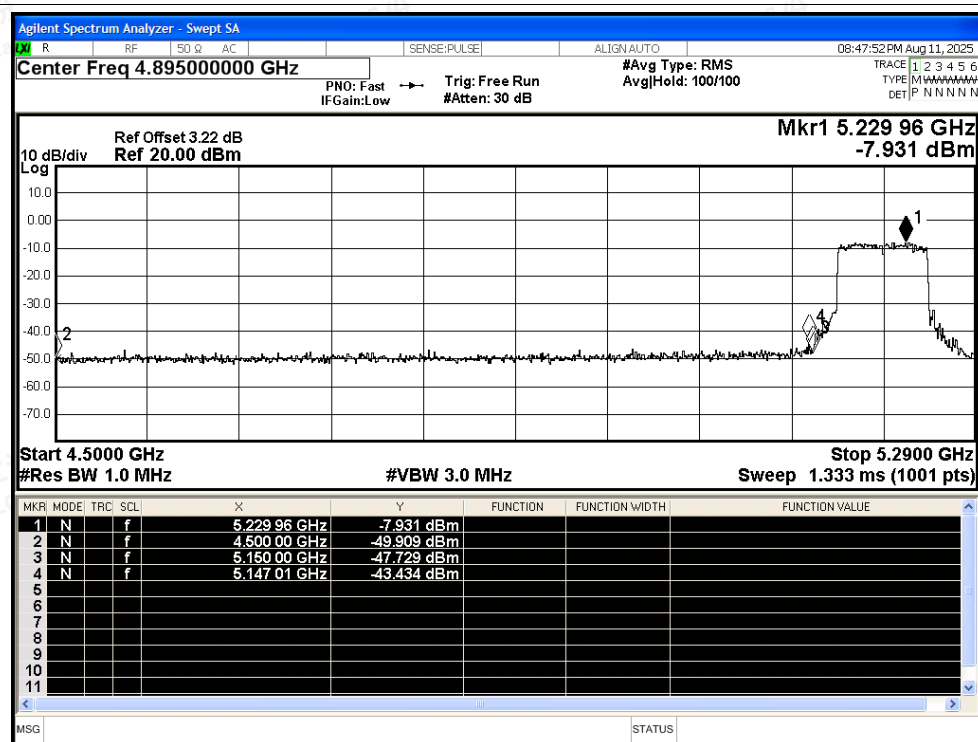

Restrict Band NVNT be80 5210MHz Ant3 Average

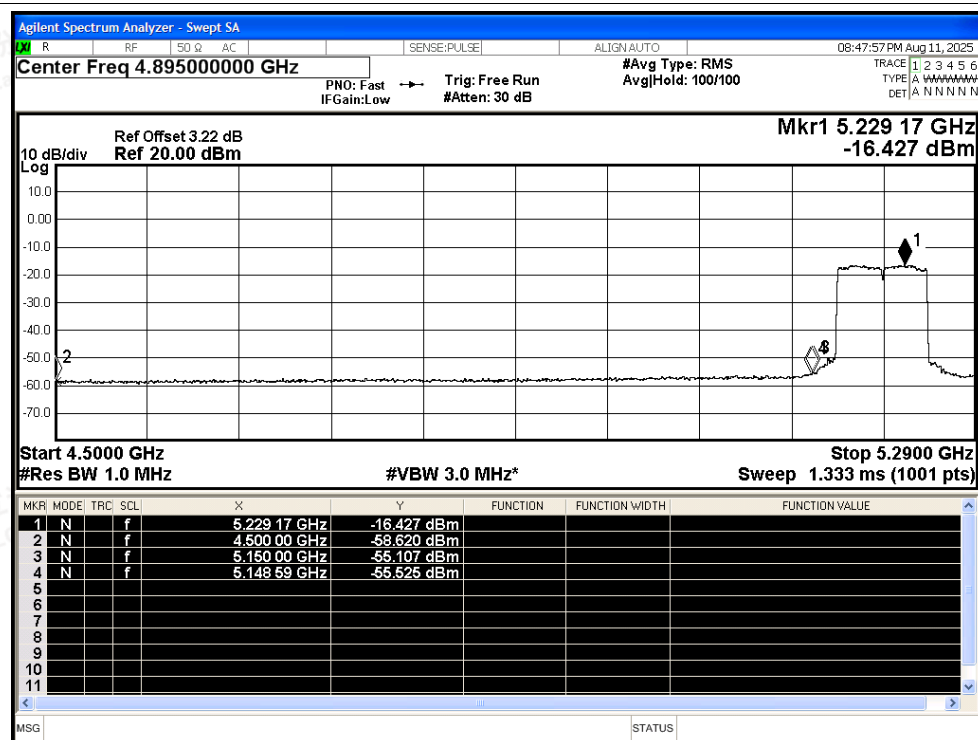

Restrict Band NVNT ac160 5250MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

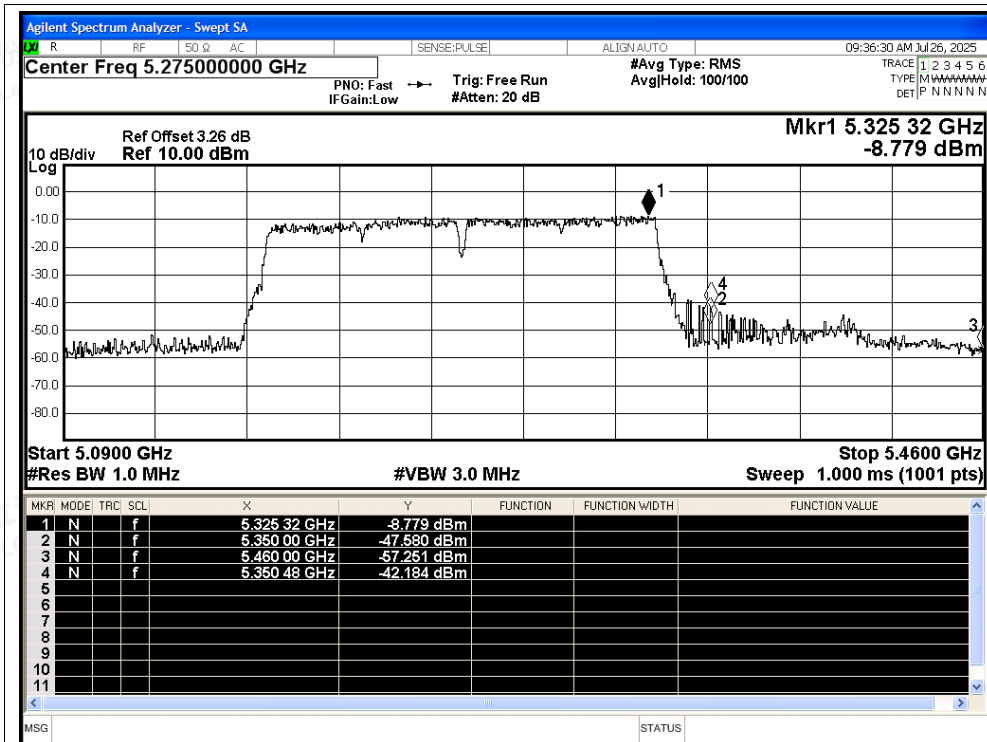

Restrict Band NVNT ac160 5250MHz Ant3 Average

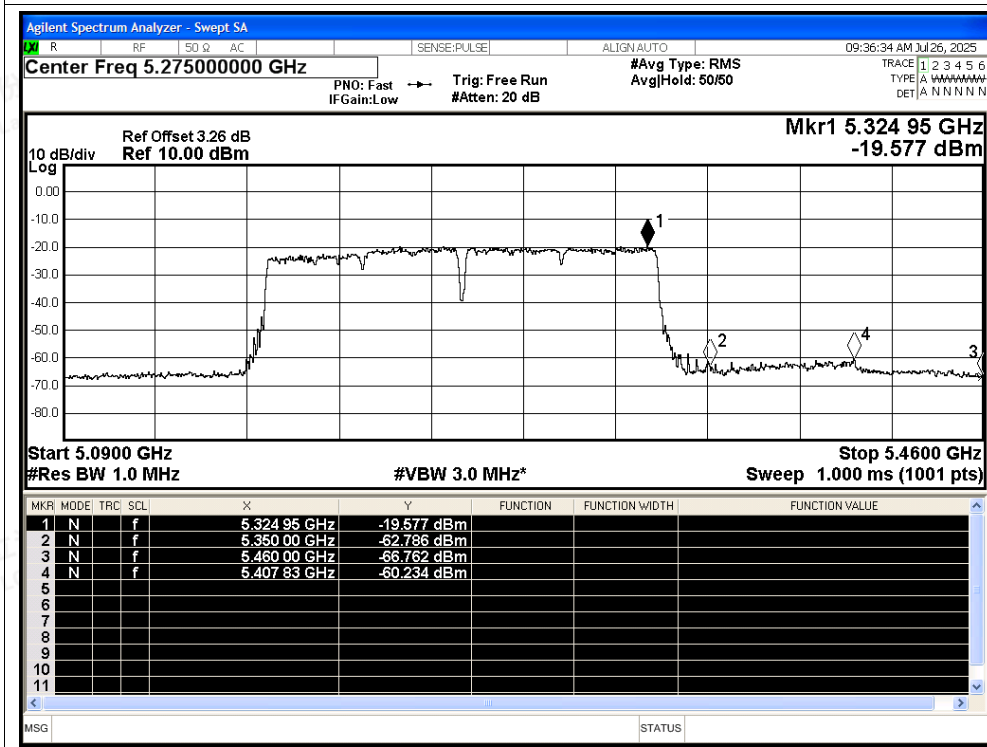

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant3 Peak

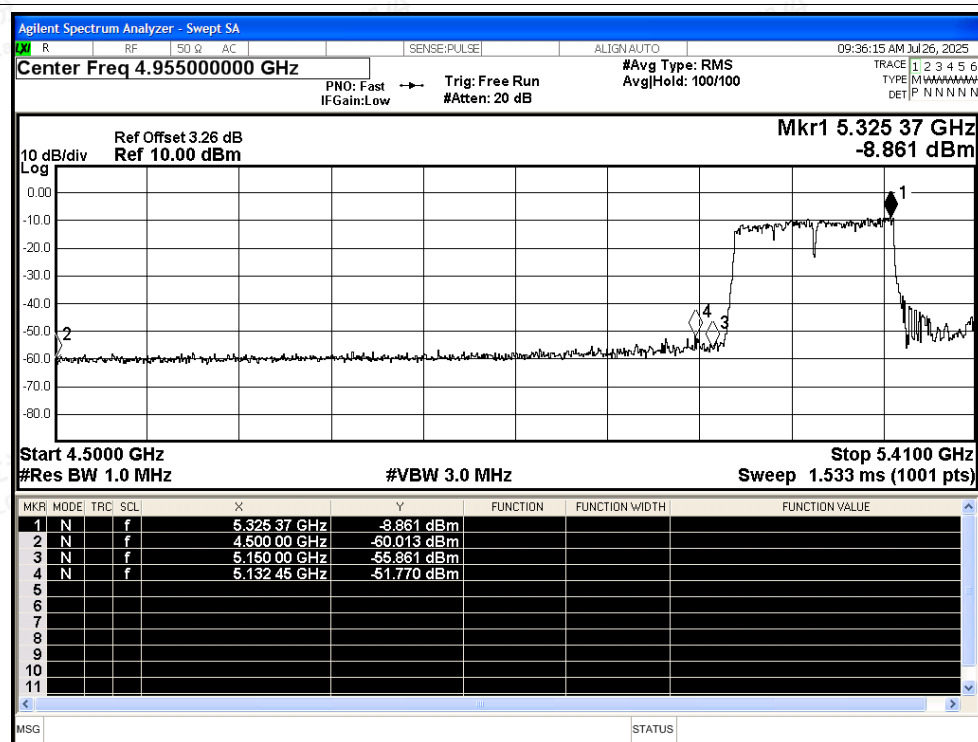

Restrict Band NVNT ac160 5250MHz Ant3 Average

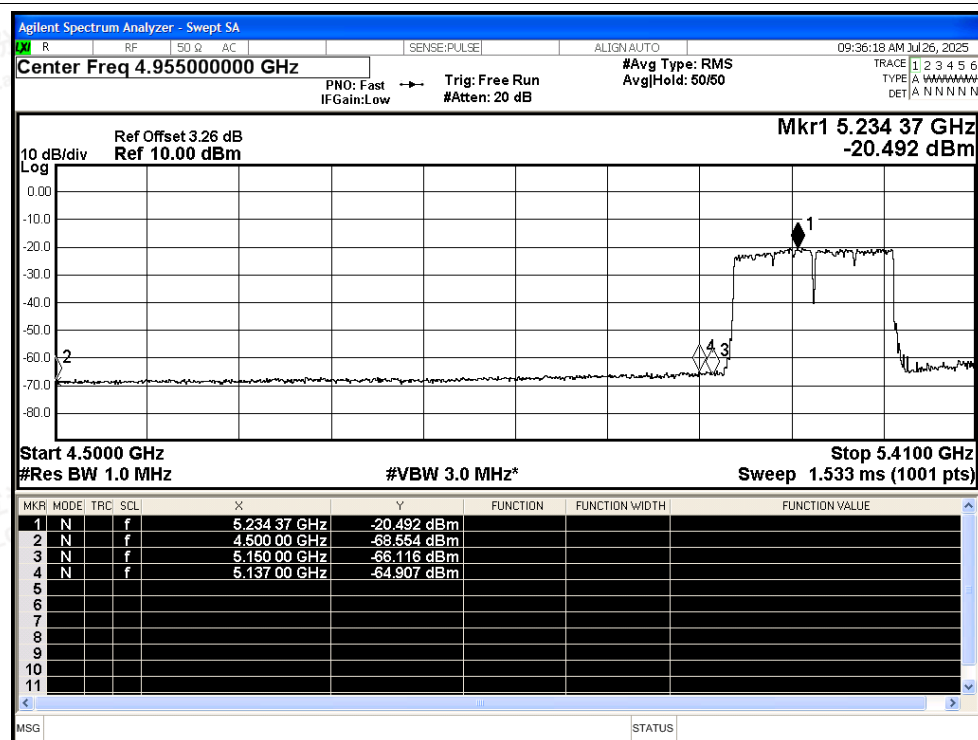

Restrict Band NVNT ax160 5250MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

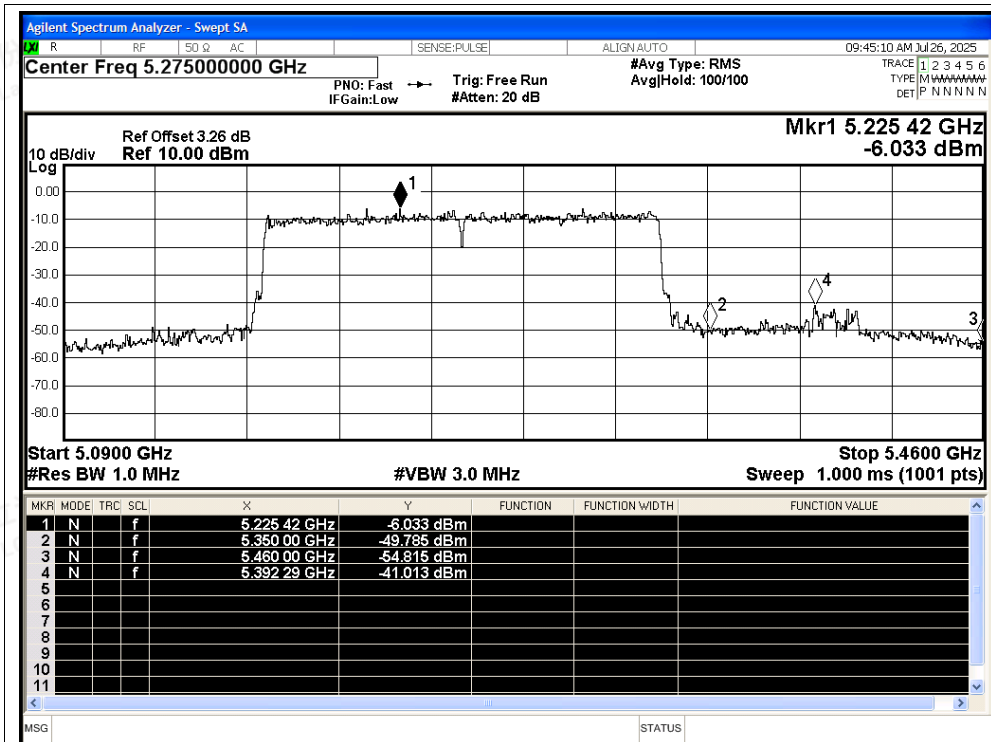

Restrict Band NVNT ax160 5250MHz Ant3 Average

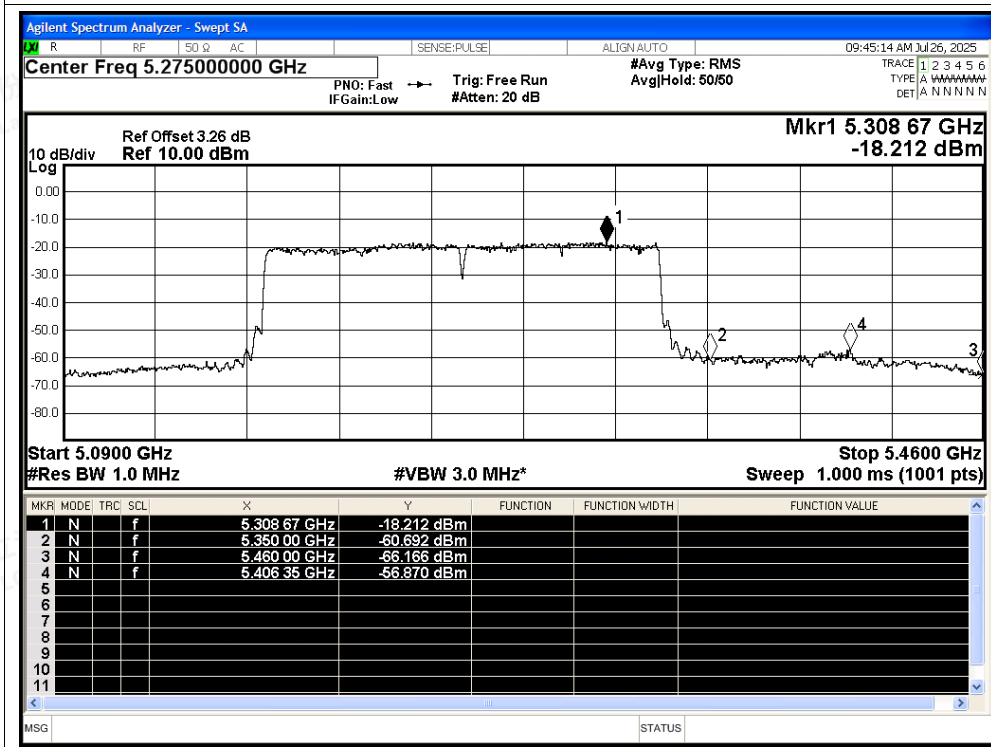

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity