





OBW NVNT ac20 5260MHz Ant3

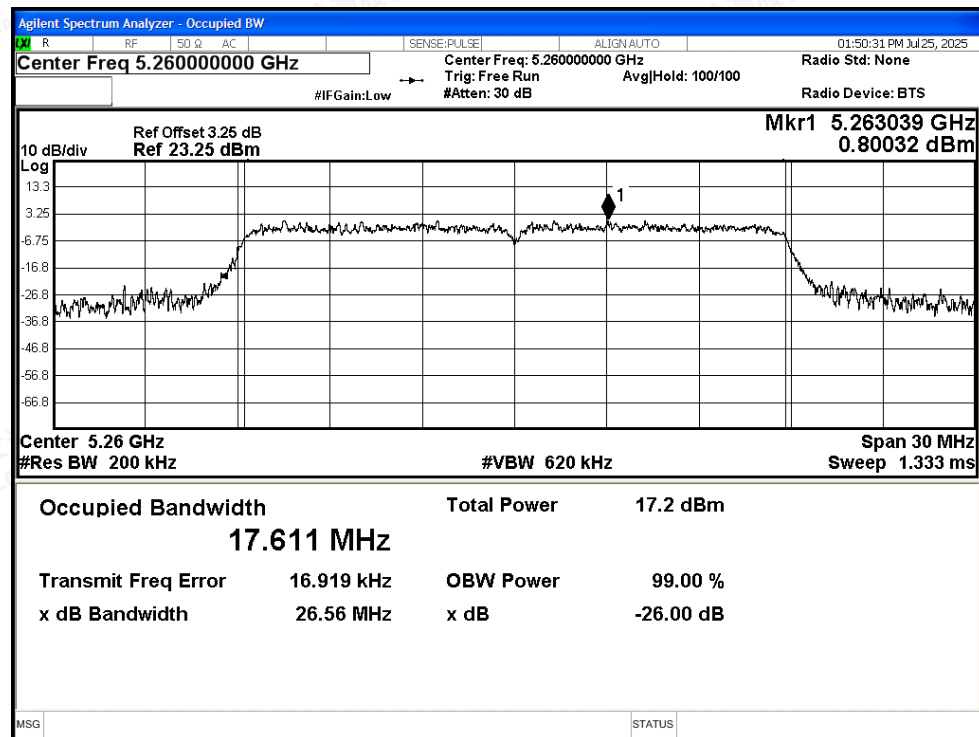

OBW NVNT ac20 5300MHz Ant3

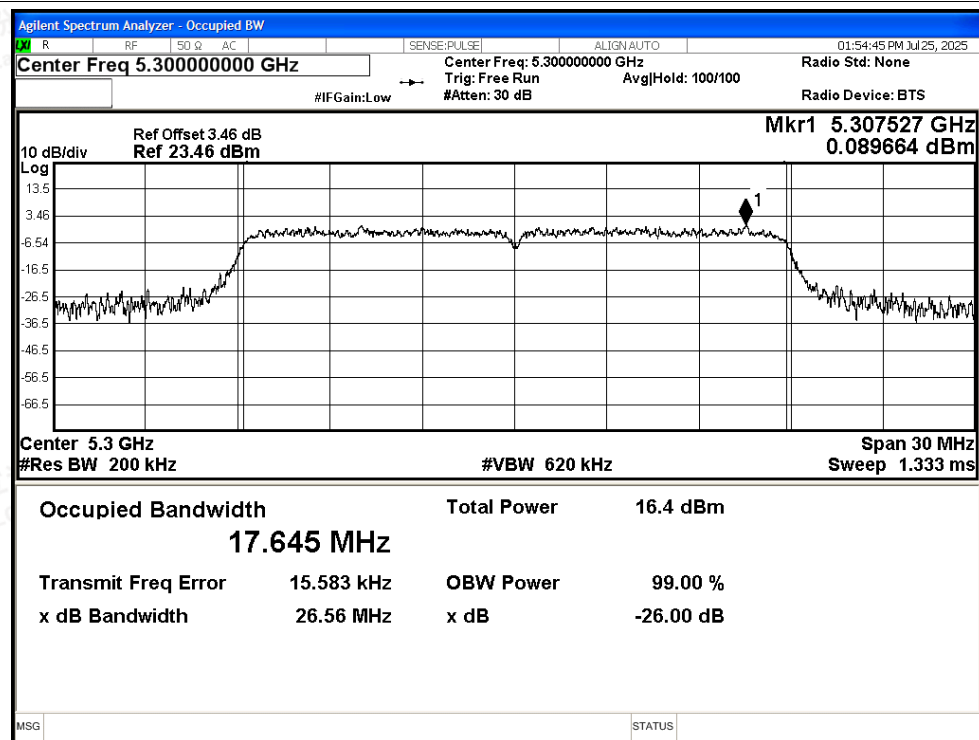

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ac20 5320MHz Ant3

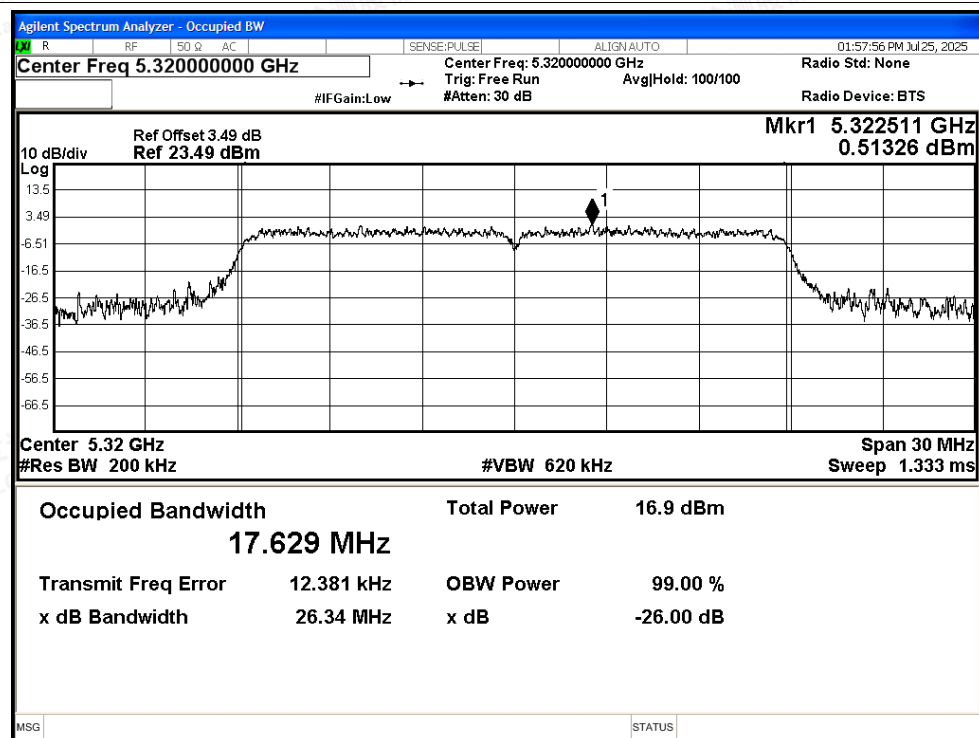

OBW NVNT ac40 5270MHz Ant3

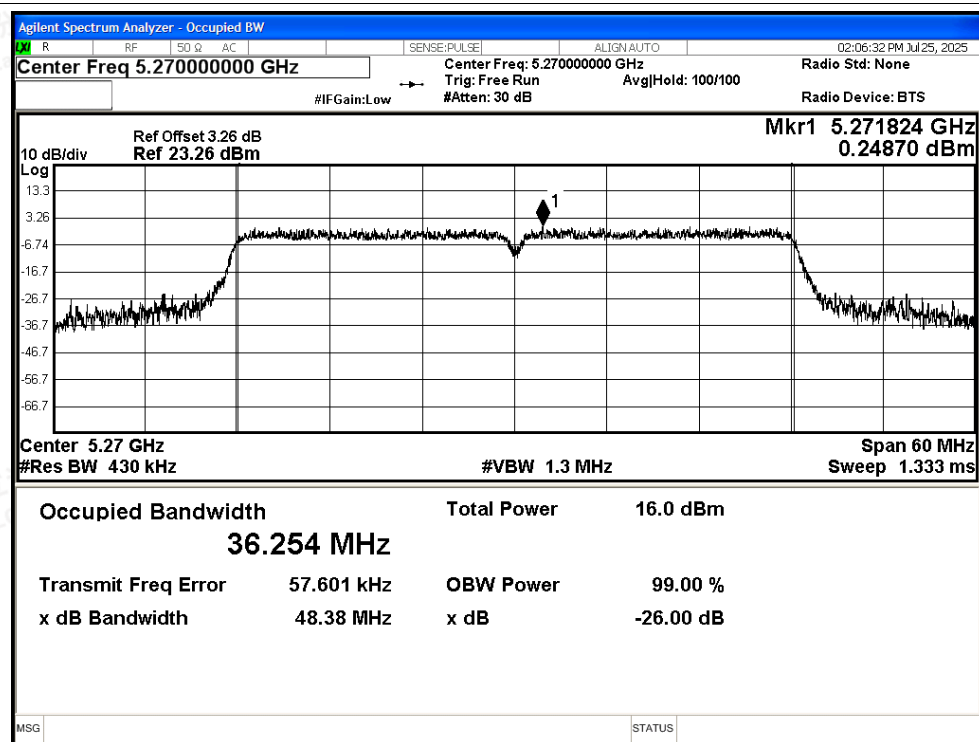

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ac40 5310MHz Ant3

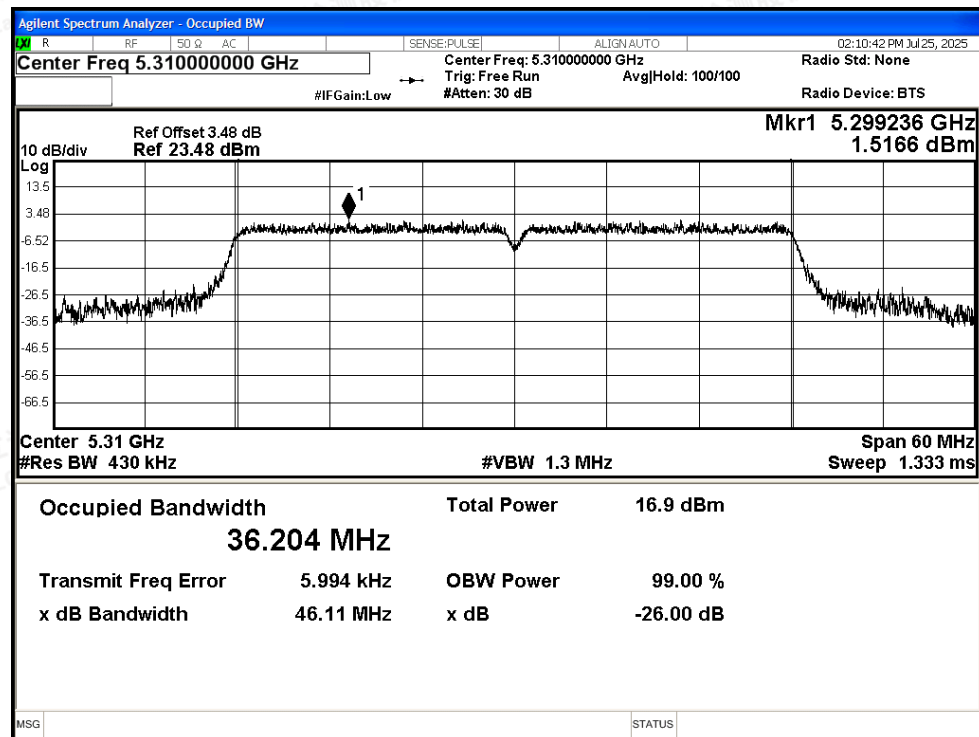

OBW NVNT ac80 5290MHz Ant3

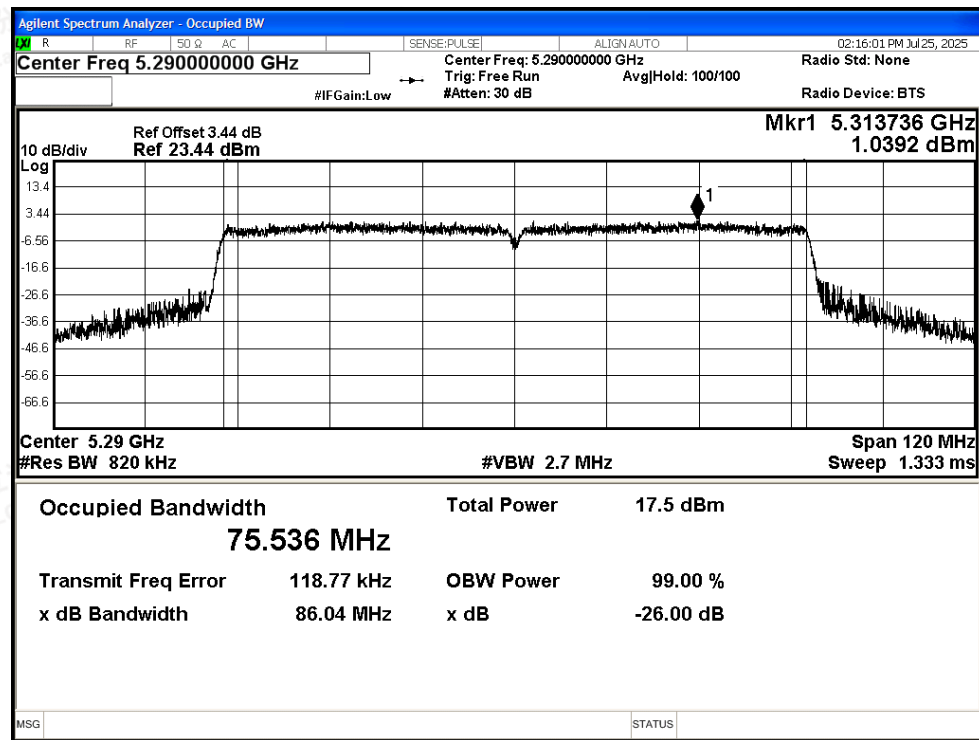

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ax20 5260MHz Ant3

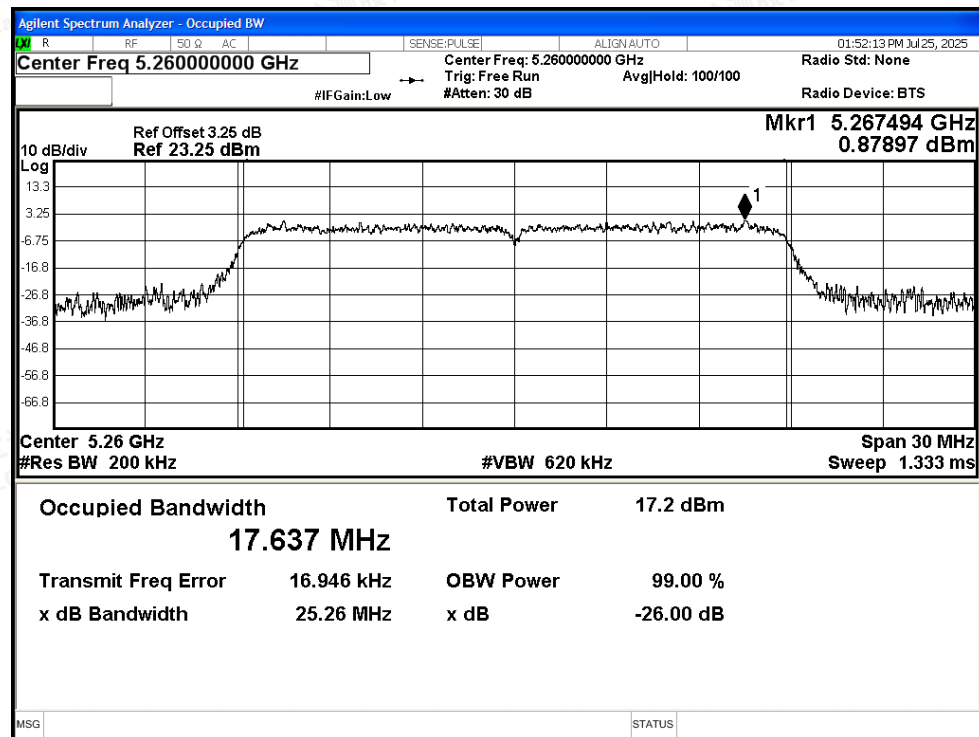

OBW NVNT ax20 5300MHz Ant3

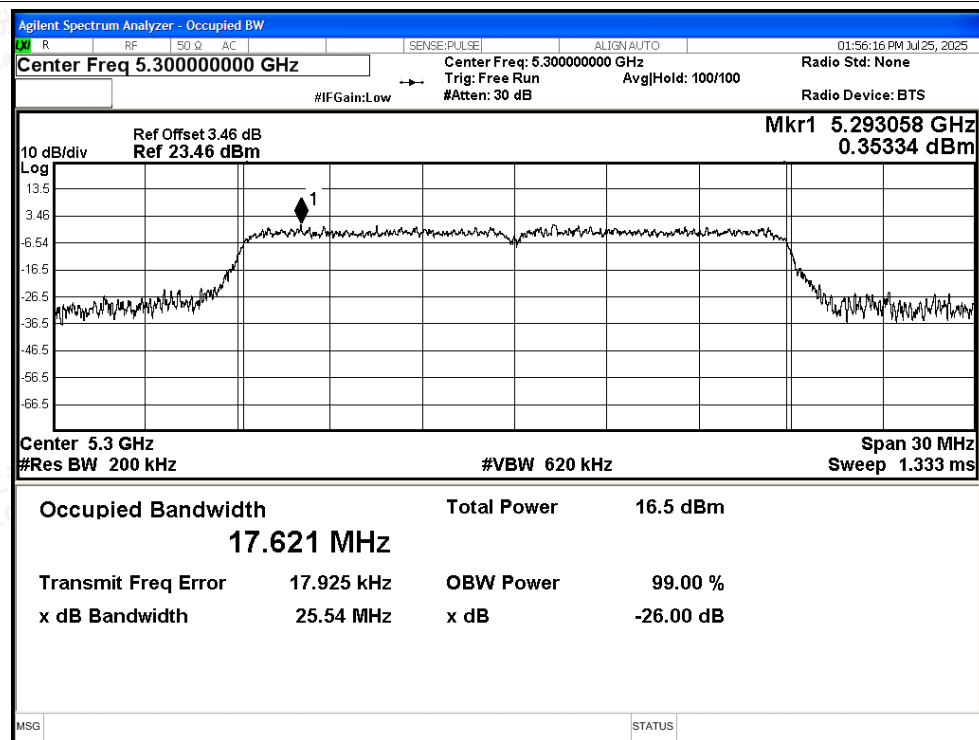

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ax20 5320MHz Ant3

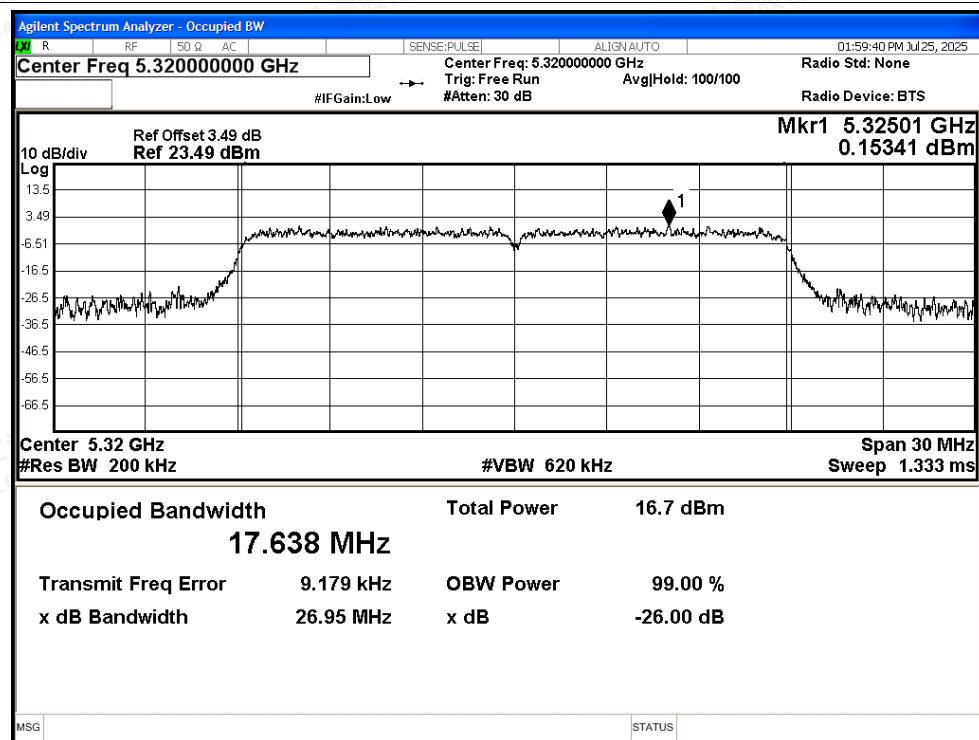

OBW NVNT ax40 5270MHz Ant3

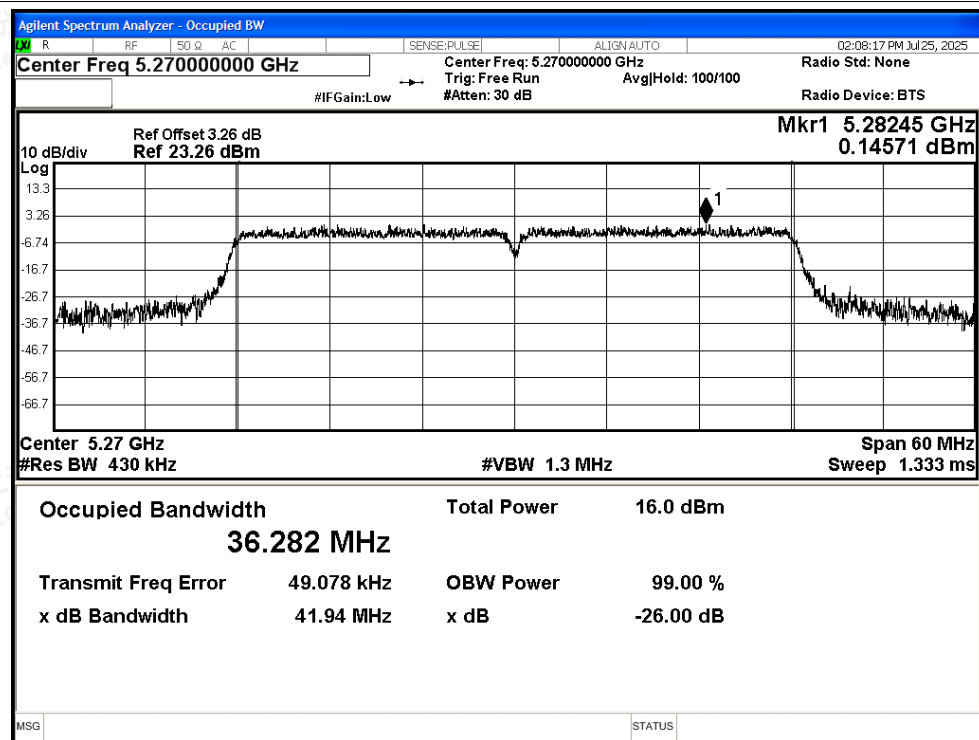

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT ax40 5310MHz Ant3

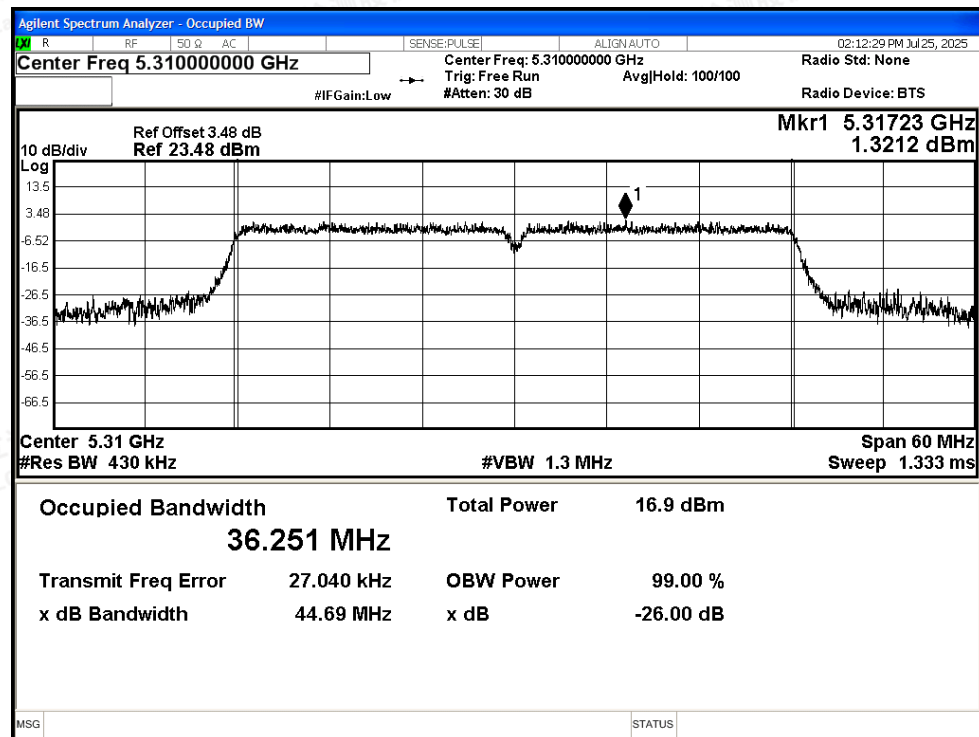

OBW NVNT ax80 5290MHz Ant3

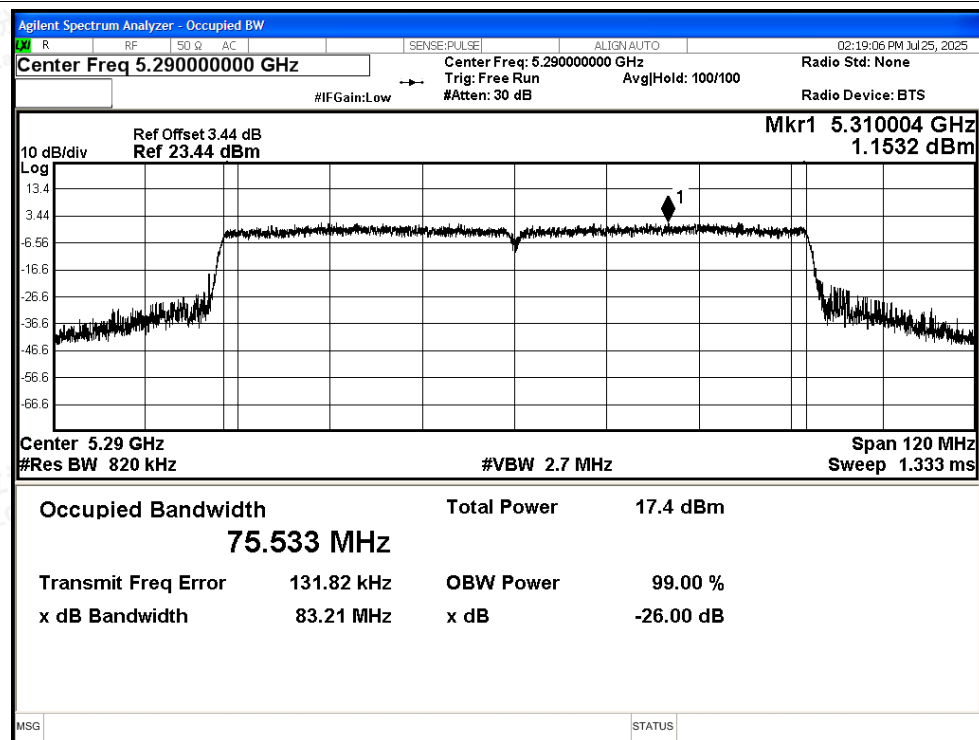

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT be20 5260MHz Ant3

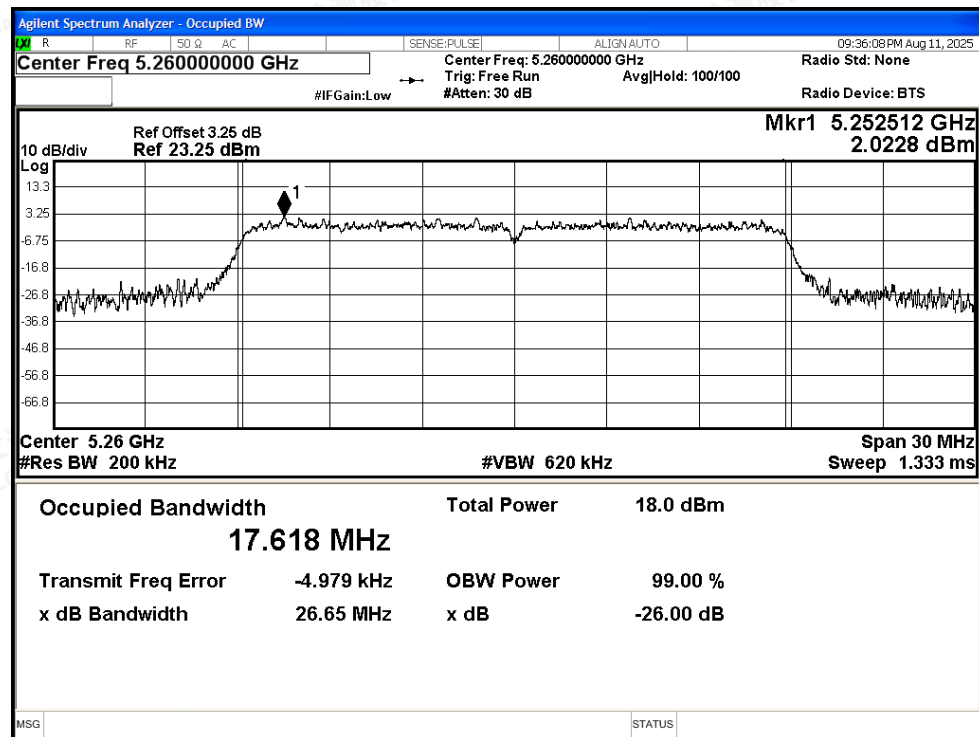

OBW NVNT be20 5300MHz Ant3

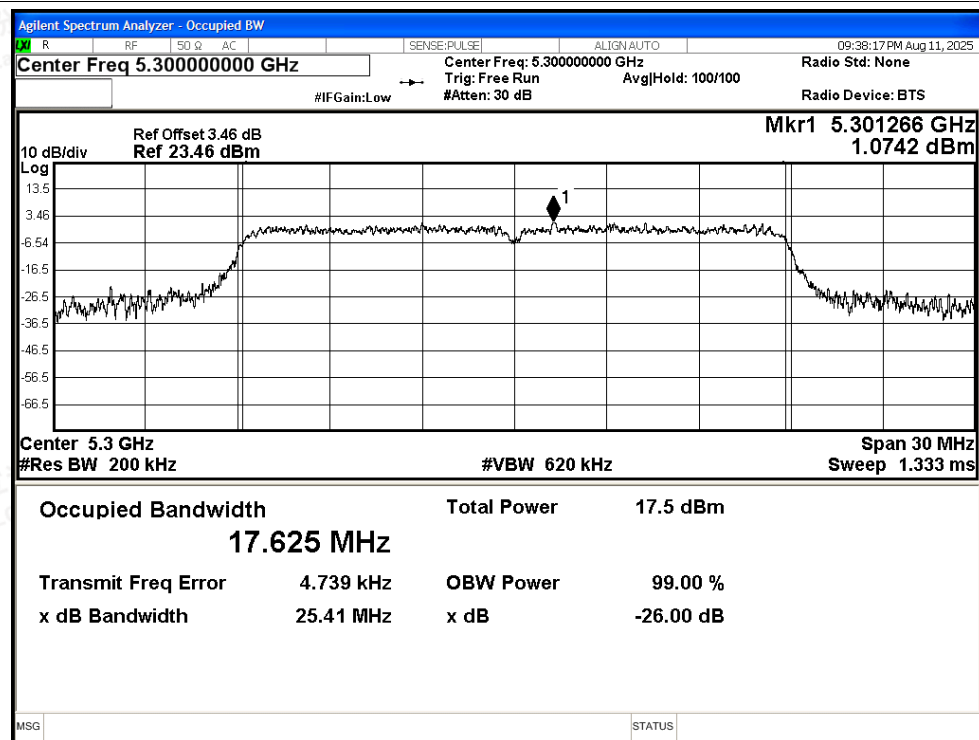

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT be20 5320MHz Ant3

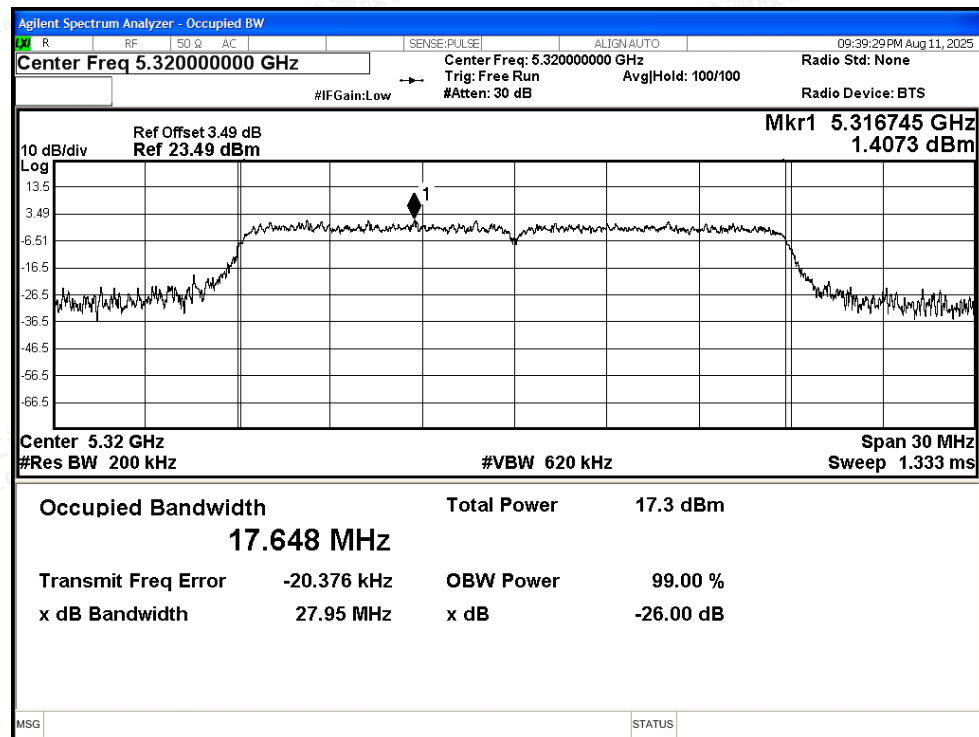

OBW NVNT be40 5270MHz Ant3

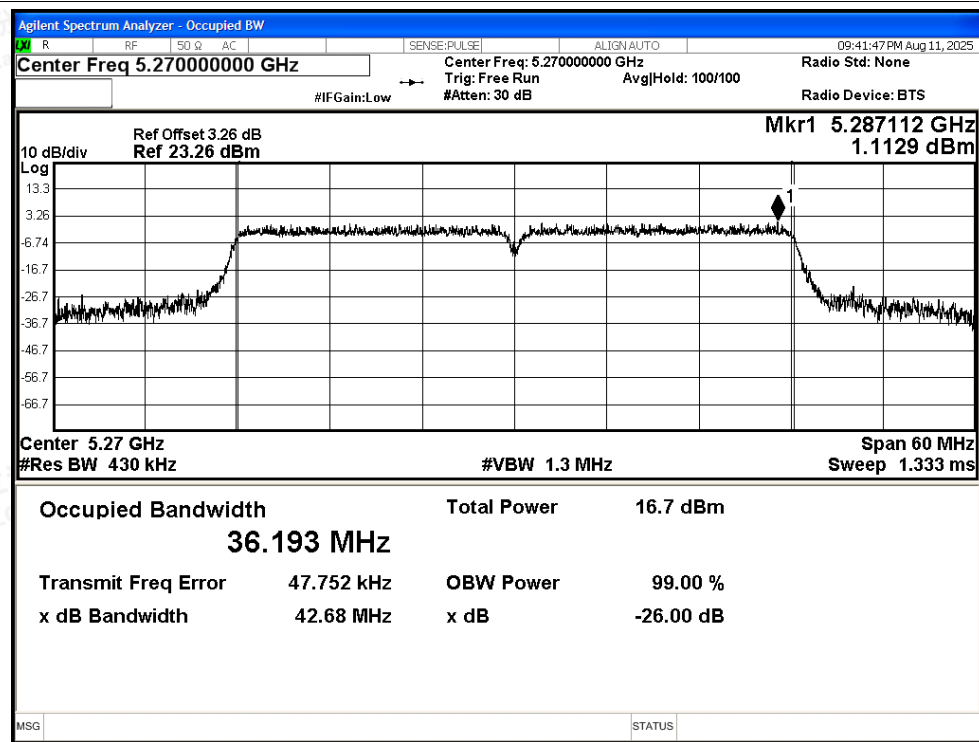

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



OBW NVNT be40 5310MHz Ant3

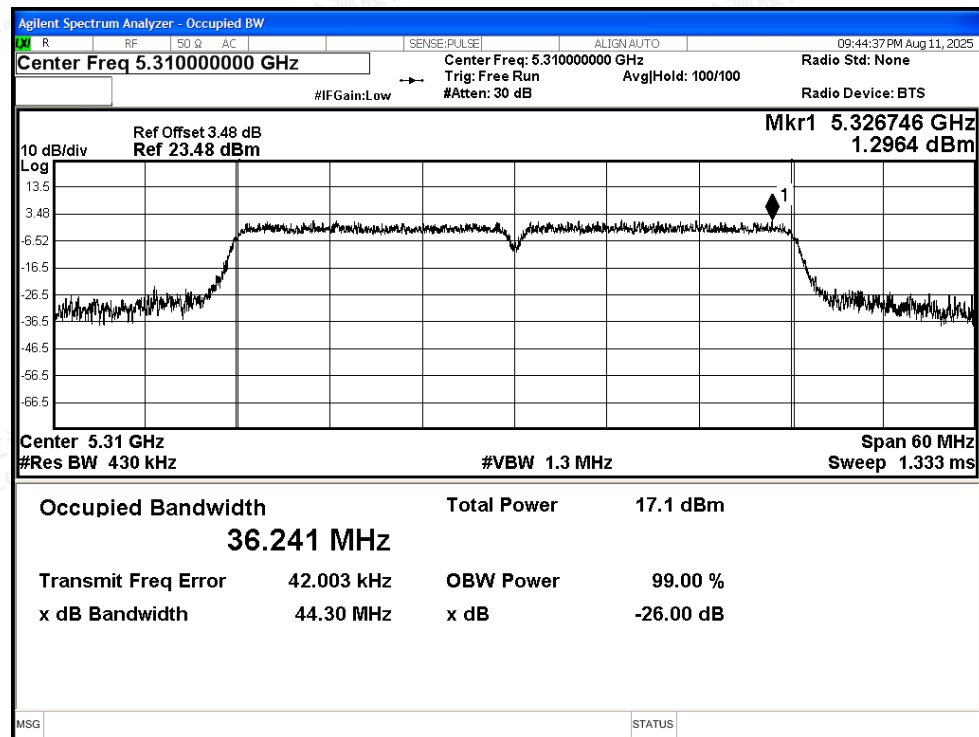

OBW NVNT be80 5290MHz Ant3

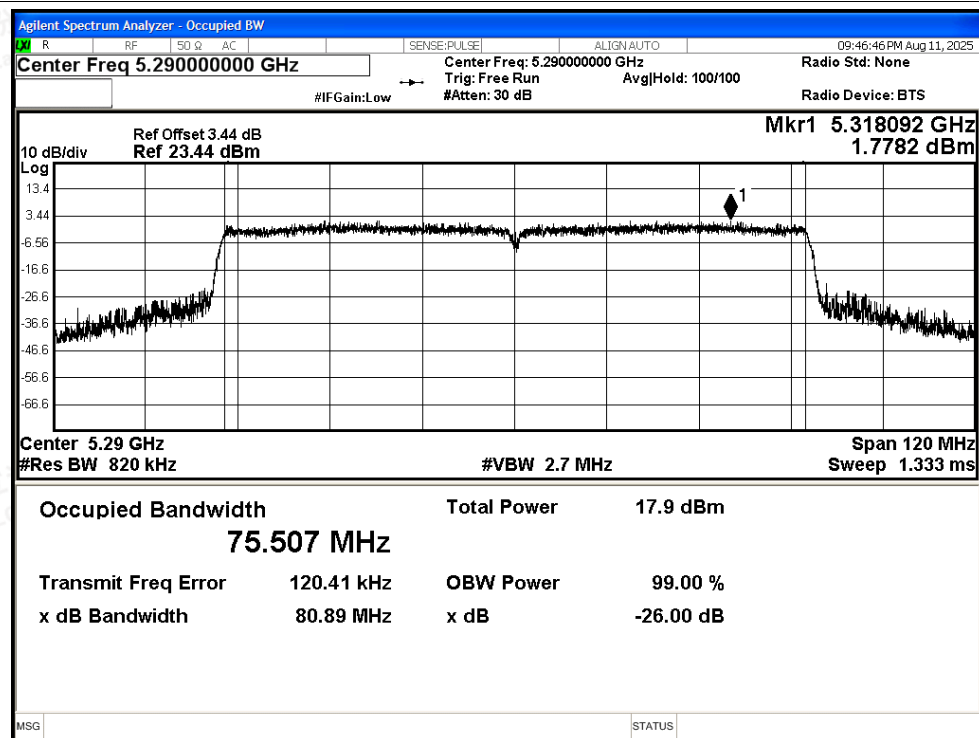

OBW NVNT ac160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

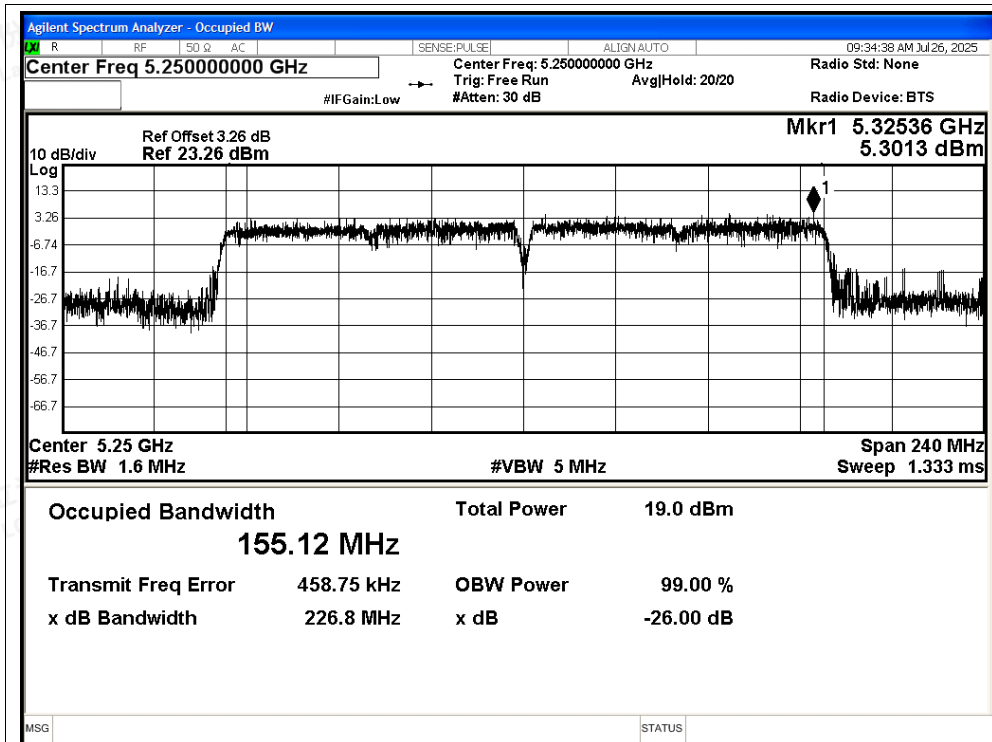

OBW NVNT ax160 5250MHz Ant3

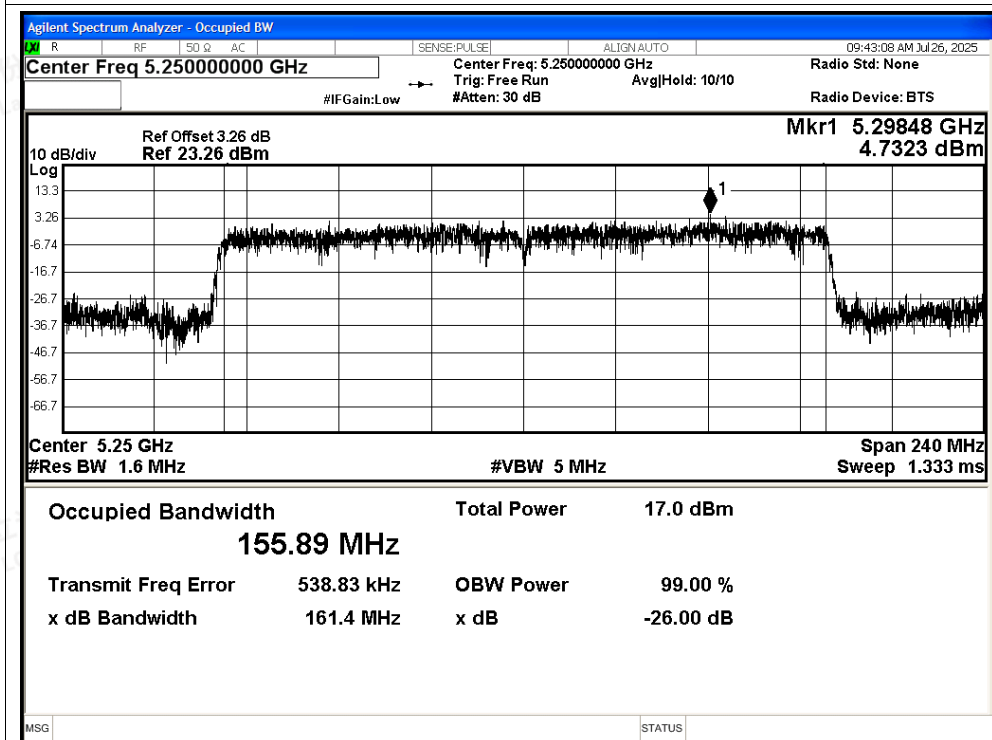

OBW NVNT be160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

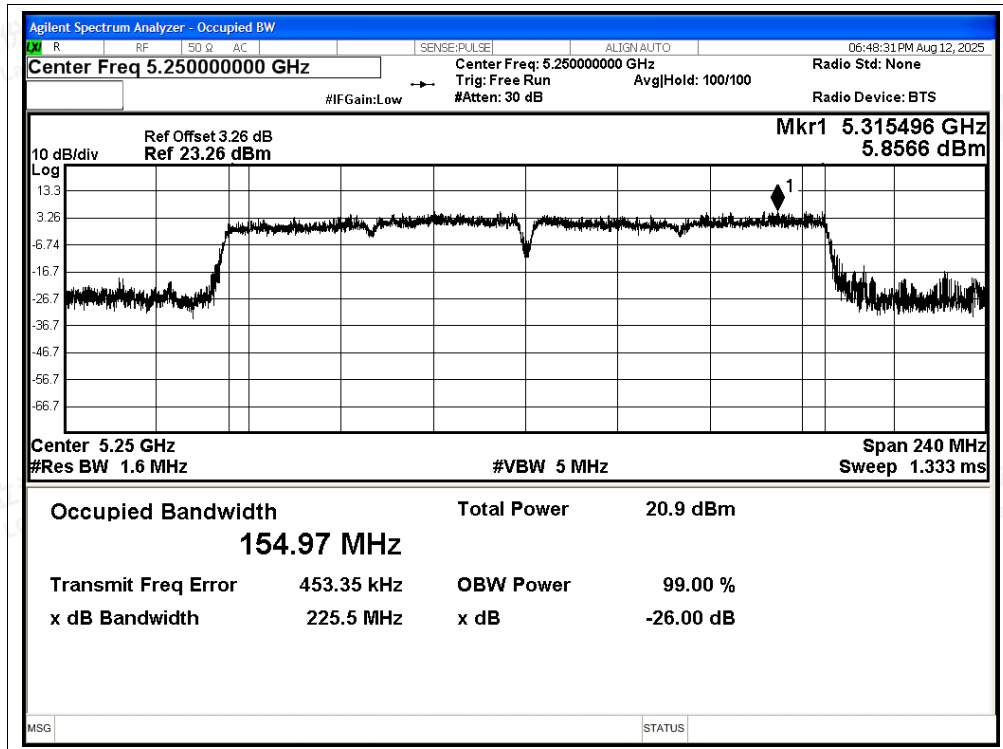

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5260	Ant1	12.11	0.24	12.35	24	Pass
NVNT	a	5300	Ant1	13.13	0.24	13.37	24	Pass
NVNT	a	5320	Ant1	12.43	0.24	12.67	24	Pass
NVNT	n20	5260	Ant1	11.65	0.12	11.77	24	Pass
NVNT	n20	5300	Ant1	11.48	0.12	11.6	24	Pass
NVNT	n20	5320	Ant1	11.78	0.12	11.9	24	Pass
NVNT	n40	5270	Ant1	10.59	0.24	10.83	24	Pass
NVNT	n40	5310	Ant1	11.14	0.23	11.37	24	Pass
NVNT	ac20	5260	Ant1	10.95	0.12	11.07	24	Pass
NVNT	ac20	5300	Ant1	11.71	0.12	11.83	24	Pass
NVNT	ac20	5320	Ant1	11.63	0.12	11.75	24	Pass
NVNT	ac40	5270	Ant1	10.55	0.24	10.79	24	Pass
NVNT	ac40	5310	Ant1	11.35	0.24	11.59	24	Pass
NVNT	ac80	5290	Ant1	10.9	0.47	11.37	24	Pass
NVNT	ac160	5250	Ant1	10.87	3.98	14.85	24	Pass
NVNT	ax20	5260	Ant1	10.89	0.12	11.01	24	Pass
NVNT	ax20	5300	Ant1	11.24	0.12	11.36	24	Pass
NVNT	ax20	5320	Ant1	11.62	0.12	11.74	24	Pass
NVNT	ax40	5270	Ant1	10.5	0.23	10.73	24	Pass
NVNT	ax40	5310	Ant1	11.28	0.24	11.52	24	Pass
NVNT	ax80	5290	Ant1	10.96	0.47	11.43	24	Pass
NVNT	ax160	5250	Ant1	10.87	3.98	14.85	24	Pass
NVNT	be20	5260	Ant1	12.61	0.12	12.73	24	Pass
NVNT	be20	5300	Ant1	12.19	0.12	12.31	24	Pass
NVNT	be20	5320	Ant1	11.93	0.12	12.05	24	Pass
NVNT	be40	5270	Ant1	11.13	0.23	11.36	24	Pass
NVNT	be40	5310	Ant1	11.77	0.24	12.01	24	Pass
NVNT	be80	5290	Ant1	11.37	0.47	11.84	24	Pass
NVNT	be160	5250	Ant1	11.55	3.77	15.32	24	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5260	Ant2	11.75	0.24	11.99	24	Pass
NVNT	a	5300	Ant2	12.19	0.24	12.43	24	Pass
NVNT	a	5320	Ant2	12.94	0.24	13.18	24	Pass
NVNT	n20	5260	Ant2	11.86	0.12	11.98	24	Pass
NVNT	n20	5300	Ant2	11.07	0.12	11.19	24	Pass
NVNT	n20	5320	Ant2	11.49	0.12	11.61	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5270	Ant2	10.4	0.24	10.64	24	Pass
NVNT	n40	5310	Ant2	11.15	0.24	11.39	24	Pass
NVNT	ac20	5260	Ant2	10.85	0.12	10.97	24	Pass
NVNT	ac20	5300	Ant2	11.02	0.12	11.14	24	Pass
NVNT	ac20	5320	Ant2	11.42	0.12	11.54	24	Pass
NVNT	ac40	5270	Ant2	10.5	0.24	10.74	24	Pass
NVNT	ac40	5310	Ant2	11.18	0.23	11.41	24	Pass
NVNT	ac80	5290	Ant2	10.76	0.47	11.23	24	Pass
NVNT	ac160	5250	Ant2	10.05	3.99	14.04	24	Pass
NVNT	ax20	5260	Ant2	10.77	0.12	10.89	24	Pass
NVNT	ax20	5300	Ant2	11.07	0.12	11.19	24	Pass
NVNT	ax20	5320	Ant2	11.41	0.12	11.53	24	Pass
NVNT	ax40	5270	Ant2	10.42	0.23	10.65	24	Pass
NVNT	ax40	5310	Ant2	11.18	0.24	11.42	24	Pass
NVNT	ax80	5290	Ant2	10.47	0.47	10.94	24	Pass
NVNT	ax160	5250	Ant2	10.08	3.98	14.06	24	Pass
NVNT	be20	5260	Ant2	11.68	0.12	11.8	24	Pass
NVNT	be20	5300	Ant2	10.69	0.12	10.81	24	Pass
NVNT	be20	5320	Ant2	11.75	0.12	11.87	24	Pass
NVNT	be40	5270	Ant2	11.04	0.24	11.28	24	Pass
NVNT	be40	5310	Ant2	11.61	0.24	11.85	24	Pass
NVNT	be80	5290	Ant2	11.33	0.47	11.8	24	Pass
NVNT	be160	5250	Ant2	10.38	3.77	14.15	24	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5260	Ant3	12.48	0.24	12.72	24	Pass
NVNT	a	5300	Ant3	11.68	0.24	11.92	24	Pass
NVNT	a	5320	Ant3	11.87	0.24	12.11	24	Pass
NVNT	n20	5260	Ant3	11.65	0.12	11.77	24	Pass
NVNT	n20	5300	Ant3	10.85	0.12	10.97	24	Pass
NVNT	n20	5320	Ant3	11.26	0.12	11.38	24	Pass
NVNT	n40	5270	Ant3	10.39	0.24	10.63	24	Pass
NVNT	n40	5310	Ant3	11.09	0.24	11.33	24	Pass
NVNT	ac20	5260	Ant3	11.58	0.12	11.7	24	Pass
NVNT	ac20	5300	Ant3	10.98	0.12	11.1	24	Pass
NVNT	ac20	5320	Ant3	11.36	0.12	11.48	24	Pass
NVNT	ac40	5270	Ant3	10.3	0.23	10.53	24	Pass
NVNT	ac40	5310	Ant3	11.13	0.24	11.37	24	Pass
NVNT	ac80	5290	Ant3	10.65	0.47	11.12	24	Pass
NVNT	ac160	5250	Ant3	10.86	3.77	14.63	24	Pass
NVNT	ax20	5260	Ant3	11.54	0.12	11.66	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5300	Ant3	11.04	0.12	11.16	24	Pass
NVNT	ax20	5320	Ant3	11.27	0.12	11.39	24	Pass
NVNT	ax40	5270	Ant3	10.36	0.24	10.6	24	Pass
NVNT	ax40	5310	Ant3	11.13	0.24	11.37	24	Pass
NVNT	ax80	5290	Ant3	10.71	0.47	11.18	24	Pass
NVNT	ax160	5250	Ant3	10.07	3.52	13.59	24	Pass
NVNT	be20	5260	Ant3	12.42	0.12	12.54	24	Pass
NVNT	be20	5300	Ant3	11.87	0.12	11.99	24	Pass
NVNT	be20	5320	Ant3	11.85	0.12	11.97	24	Pass
NVNT	be40	5270	Ant3	10.88	0.24	11.12	24	Pass
NVNT	be40	5310	Ant3	11.37	0.24	11.61	24	Pass
NVNT	be80	5290	Ant3	11.13	0.47	11.6	24	Pass
NVNT	be160	5250	Ant3	11.07	3.77	14.84	24	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total Power (dBm)				Limit (dBm)	Verdict
			Ant1	Ant2	Ant3	Ant1+Ant2+ Ant3		
NVNT	n20	5260	11.77	11.98	11.77	16.61	24	Pass
NVNT	n20	5300	11.6	11.19	10.97	16.03	24	Pass
NVNT	n20	5320	11.9	11.61	11.38	16.41	24	Pass
NVNT	n40	5270	10.83	10.64	10.63	15.47	24	Pass
NVNT	n40	5310	11.37	11.39	11.33	16.13	24	Pass
NVNT	ac20	5260	11.07	10.97	11.7	16.03	24	Pass
NVNT	ac20	5300	11.83	11.14	11.1	16.14	24	Pass
NVNT	ac20	5320	11.75	11.54	11.48	16.36	24	Pass
NVNT	ac40	5270	10.79	10.74	10.53	15.46	24	Pass
NVNT	ac40	5310	11.59	11.41	11.37	16.23	24	Pass
NVNT	ac80	5290	11.37	11.23	11.12	16.01	24	Pass
NVNT	ac160	5250	14.85	14.04	14.63	19.29	24	Pass
NVNT	ax20	5260	11.01	10.89	11.66	15.97	24	Pass
NVNT	ax20	5300	11.36	11.19	11.16	16.01	24	Pass
NVNT	ax20	5320	11.74	11.53	11.39	16.33	24	Pass
NVNT	ax40	5270	10.73	10.65	10.6	15.43	24	Pass
NVNT	ax40	5310	11.52	11.42	11.37	16.21	24	Pass
NVNT	ax80	5290	11.43	10.94	11.18	15.96	24	Pass
NVNT	ax160	5250	14.85	14.06	13.59	18.97	24	Pass
NVNT	be20	5260	12.73	11.8	12.54	17.15	24	Pass
NVNT	be20	5300	12.31	10.81	11.99	16.52	24	Pass
NVNT	be20	5320	12.05	11.87	11.97	16.74	24	Pass
NVNT	be40	5270	11.36	11.28	11.12	16.03	24	Pass
NVNT	be40	5310	12.01	11.85	11.61	16.60	24	Pass
NVNT	be80	5290	11.84	11.8	11.6	16.52	24	Pass
NVNT	be160	5250	15.32	14.15	14.84	19.57	24	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5260	Ant1	1.53	0.24	1.77	11	Pass
NVNT	a	5300	Ant1	2.61	0.24	2.85	11	Pass
NVNT	a	5320	Ant1	2.04	0.24	2.28	11	Pass
NVNT	n20	5260	Ant1	0.94	0.12	1.06	11	Pass
NVNT	n20	5300	Ant1	0.58	0.12	0.7	11	Pass
NVNT	n20	5320	Ant1	0.98	0.12	1.1	11	Pass
NVNT	n40	5270	Ant1	-3.43	0.24	-3.19	11	Pass
NVNT	n40	5310	Ant1	-2.9	0.23	-2.67	11	Pass
NVNT	ac20	5260	Ant1	0.16	0.12	0.28	11	Pass
NVNT	ac20	5300	Ant1	0.9	0.12	1.02	11	Pass
NVNT	ac20	5320	Ant1	0.91	0.12	1.03	11	Pass
NVNT	ac40	5270	Ant1	-3.38	0.24	-3.14	11	Pass
NVNT	ac40	5310	Ant1	-2.69	0.24	-2.45	11	Pass
NVNT	ac80	5290	Ant1	-5.68	0.47	-5.21	11	Pass
NVNT	ax20	5260	Ant1	-0.01	0.12	0.11	11	Pass
NVNT	ax20	5300	Ant1	0.77	0.12	0.89	11	Pass
NVNT	ax20	5320	Ant1	0.83	0.12	0.95	11	Pass
NVNT	ax40	5270	Ant1	-3.44	0.23	-3.21	11	Pass
NVNT	ax40	5310	Ant1	-2.73	0.24	-2.49	11	Pass
NVNT	ax80	5290	Ant1	-5.92	0.47	-5.45	11	Pass
NVNT	be20	5260	Ant1	2.08	0.12	2.2	11	Pass
NVNT	be20	5300	Ant1	1.43	0.12	1.55	11	Pass
NVNT	be20	5320	Ant1	1.12	0.12	1.24	11	Pass
NVNT	be40	5270	Ant1	-2.55	0.23	-2.32	11	Pass
NVNT	be40	5310	Ant1	-2.53	0.24	-2.29	11	Pass
NVNT	be80	5290	Ant1	-5.33	0.47	-4.86	11	Pass
NVNT	ac160	5250	Ant1	-8.01	3.98	-4.03	11	Pass
NVNT	ax160	5250	Ant1	-8.35	3.98	-4.37	11	Pass
NVNT	be160	5250	Ant1	-4.87	3.77	-1.1	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5260	Ant2	1.45	0.24	1.69	11	Pass
NVNT	a	5300	Ant2	1.5	0.24	1.74	11	Pass
NVNT	a	5320	Ant2	2.87	0.24	3.11	11	Pass
NVNT	n20	5260	Ant2	1.07	0.12	1.19	11	Pass
NVNT	n20	5300	Ant2	0.21	0.12	0.33	11	Pass
NVNT	n20	5320	Ant2	0.72	0.12	0.84	11	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5270	Ant2	-3.64	0.24	-3.4	11	Pass
NVNT	n40	5310	Ant2	-2.89	0.24	-2.65	11	Pass
NVNT	ac20	5260	Ant2	-0.05	0.12	0.07	11	Pass
NVNT	ac20	5300	Ant2	0.2	0.12	0.32	11	Pass
NVNT	ac20	5320	Ant2	0.69	0.12	0.81	11	Pass
NVNT	ac40	5270	Ant2	-3.48	0.24	-3.24	11	Pass
NVNT	ac40	5310	Ant2	-2.78	0.23	-2.55	11	Pass
NVNT	ac80	5290	Ant2	-6.04	0.47	-5.57	11	Pass
NVNT	ax20	5260	Ant2	0.01	0.12	0.13	11	Pass
NVNT	ax20	5300	Ant2	0.35	0.12	0.47	11	Pass
NVNT	ax20	5320	Ant2	0.65	0.12	0.77	11	Pass
NVNT	ax40	5270	Ant2	-3.35	0.23	-3.12	11	Pass
NVNT	ax40	5310	Ant2	-2.74	0.24	-2.5	11	Pass
NVNT	ax80	5290	Ant2	-6.58	0.47	-6.11	11	Pass
NVNT	be20	5260	Ant2	0.8	0.12	0.92	11	Pass
NVNT	be20	5300	Ant2	-0.11	0.12	0.01	11	Pass
NVNT	be20	5320	Ant2	1.01	0.12	1.13	11	Pass
NVNT	be40	5270	Ant2	-3.07	0.24	-2.83	11	Pass
NVNT	be40	5310	Ant2	-2.51	0.24	-2.27	11	Pass
NVNT	be80	5290	Ant2	-5.45	0.47	-4.98	11	Pass
NVNT	ac160	5250	Ant2	-8.89	3.99	-4.9	11	Pass
NVNT	ax160	5250	Ant2	-10.39	3.98	-6.41	11	Pass
NVNT	be160	5250	Ant2	-8.23	3.77	-4.46	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5260	Ant3	1.74	0.24	1.98	11	Pass
NVNT	a	5300	Ant3	0.95	0.24	1.19	11	Pass
NVNT	a	5320	Ant3	1.29	0.24	1.53	11	Pass
NVNT	n20	5260	Ant3	0.78	0.12	0.9	11	Pass
NVNT	n20	5300	Ant3	-0.16	0.12	-0.04	11	Pass
NVNT	n20	5320	Ant3	0.35	0.12	0.47	11	Pass
NVNT	n40	5270	Ant3	-3.54	0.24	-3.3	11	Pass
NVNT	n40	5310	Ant3	-2.94	0.24	-2.7	11	Pass
NVNT	ac20	5260	Ant3	0.84	0.12	0.96	11	Pass
NVNT	ac20	5300	Ant3	-0.07	0.12	0.05	11	Pass
NVNT	ac20	5320	Ant3	0.46	0.12	0.58	11	Pass
NVNT	ac40	5270	Ant3	-3.85	0.23	-3.62	11	Pass
NVNT	ac40	5310	Ant3	-2.79	0.24	-2.55	11	Pass
NVNT	ac80	5290	Ant3	-6.21	0.47	-5.74	11	Pass
NVNT	ax20	5260	Ant3	0.73	0.12	0.85	11	Pass
NVNT	ax20	5300	Ant3	0.17	0.12	0.29	11	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant3	0.43	0.12	0.55	11	Pass
NVNT	ax40	5270	Ant3	-3.51	0.24	-3.27	11	Pass
NVNT	ax40	5310	Ant3	-2.96	0.24	-2.72	11	Pass
NVNT	ax80	5290	Ant3	-5.76	0.47	-5.29	11	Pass
NVNT	be20	5260	Ant3	1.7	0.12	1.82	11	Pass
NVNT	be20	5300	Ant3	1.18	0.12	1.3	11	Pass
NVNT	be20	5320	Ant3	1.08	0.12	1.2	11	Pass
NVNT	be40	5270	Ant3	-3.06	0.24	-2.82	11	Pass
NVNT	be40	5310	Ant3	-2.64	0.24	-2.4	11	Pass
NVNT	be80	5290	Ant3	-5.52	0.47	-5.05	11	Pass
NVNT	ac160	5250	Ant3	-7.88	3.77	-4.11	11	Pass
NVNT	ax160	5250	Ant3	-8.07	3.52	-4.55	11	Pass
NVNT	be160	5250	Ant3	-7.43	3.77	-3.66	11	Pass

MIMO

Condition	Mode	Frequency (MHz)	PSD(dBm/MHz)				Limit (dBm/MHz)	Verdict
			Ant1	Ant2	Ant3	Ant1+Ant2+ Ant3		
NVNT	n20	5260	1.06	1.19	0.9	5.82	8.08	Pass
NVNT	n20	5300	0.7	0.33	-0.04	5.11	8.08	Pass
NVNT	n20	5320	1.1	0.84	0.47	5.58	8.08	Pass
NVNT	n40	5270	-3.19	-3.4	-3.3	1.48	8.08	Pass
NVNT	n40	5310	-2.67	-2.65	-2.7	2.10	8.08	Pass
NVNT	ac20	5260	0.28	0.07	0.96	5.22	8.08	Pass
NVNT	ac20	5300	1.02	0.32	0.05	5.25	8.08	Pass
NVNT	ac20	5320	1.03	0.81	0.58	5.58	8.08	Pass
NVNT	ac40	5270	-3.14	-3.24	-3.62	1.44	8.08	Pass
NVNT	ac40	5310	-2.45	-2.55	-2.55	2.25	8.08	Pass
NVNT	ac80	5290	-5.21	-5.57	-5.74	-0.73	8.08	Pass
NVNT	ax20	5260	0.11	0.13	0.85	5.15	8.08	Pass
NVNT	ax20	5300	0.89	0.47	0.29	5.33	8.08	Pass
NVNT	ax20	5320	0.95	0.77	0.55	5.53	8.08	Pass
NVNT	ax40	5270	-3.21	-3.12	-3.27	1.57	8.08	Pass
NVNT	ax40	5310	-2.49	-2.5	-2.72	2.20	8.08	Pass
NVNT	ax80	5290	-5.45	-6.11	-5.29	-0.83	8.08	Pass
NVNT	be20	5260	2.2	0.92	1.82	6.45	8.08	Pass
NVNT	be20	5300	1.55	0.01	1.3	5.78	8.08	Pass
NVNT	be20	5320	1.24	1.13	1.2	5.96	8.08	Pass
NVNT	be40	5270	-2.32	-2.83	-2.82	2.12	8.08	Pass
NVNT	be40	5310	-2.29	-2.27	-2.4	2.45	8.08	Pass
NVNT	be80	5290	-4.86	-4.98	-5.05	-0.19	8.08	Pass
NVNT	ac160	5250	-4.03	-4.9	-4.11	0.44	8.08	Pass
NVNT	ax160	5250	-4.37	-6.41	-4.55	-0.25	8.08	Pass
NVNT	be160	5250	-1.1	-4.46	-3.66	1.94	8.08	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5260MHz Ant1

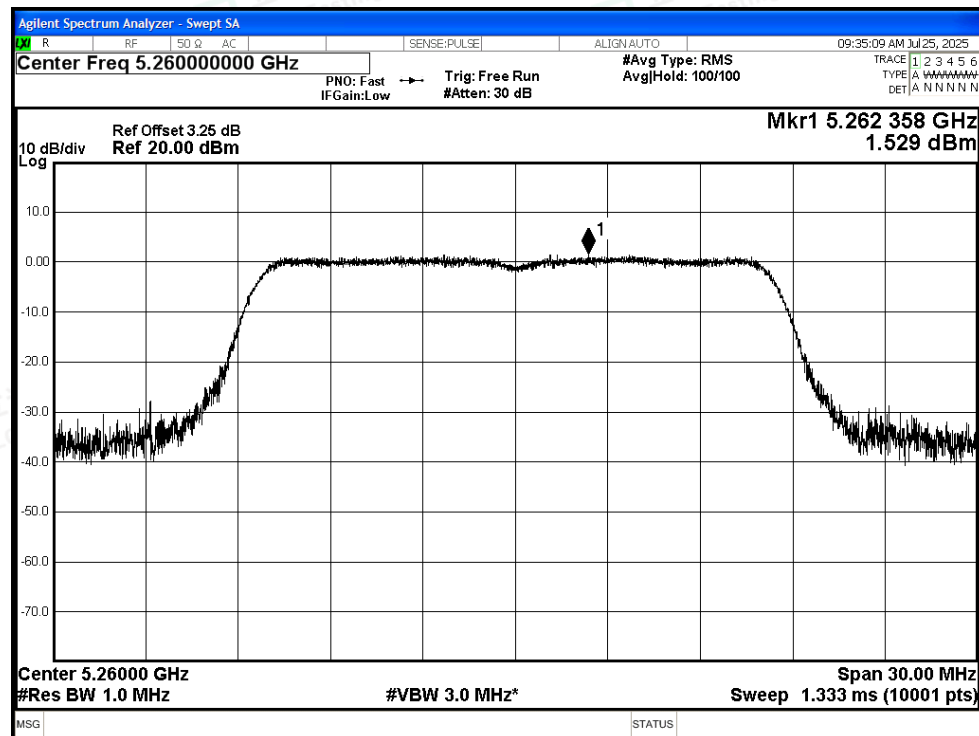

PSD NVNT a 5300MHz Ant1


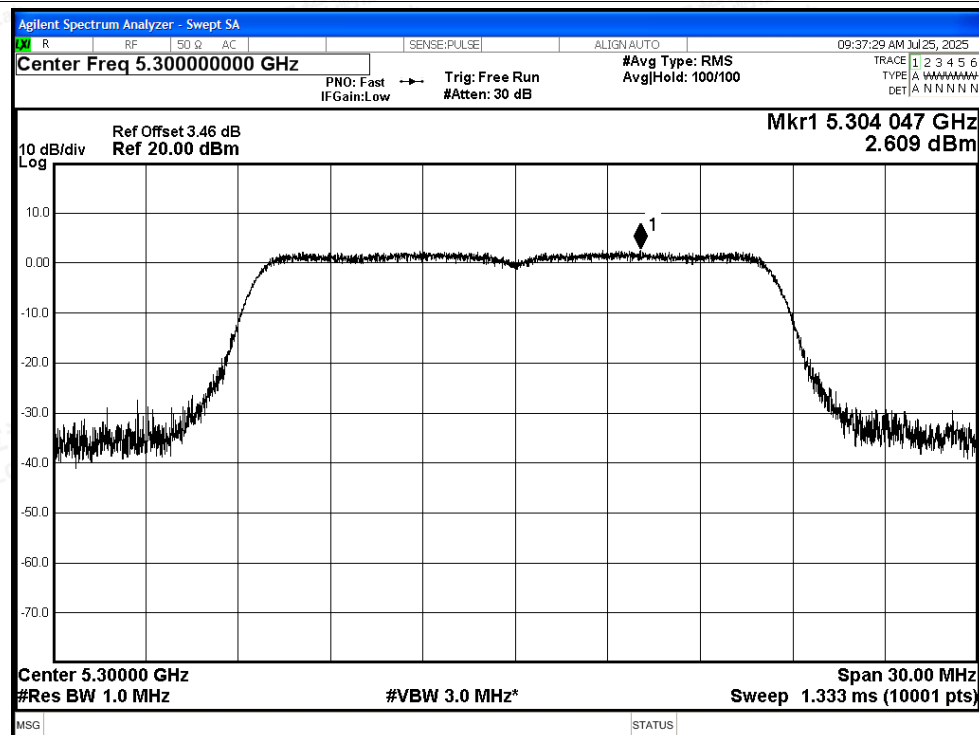


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

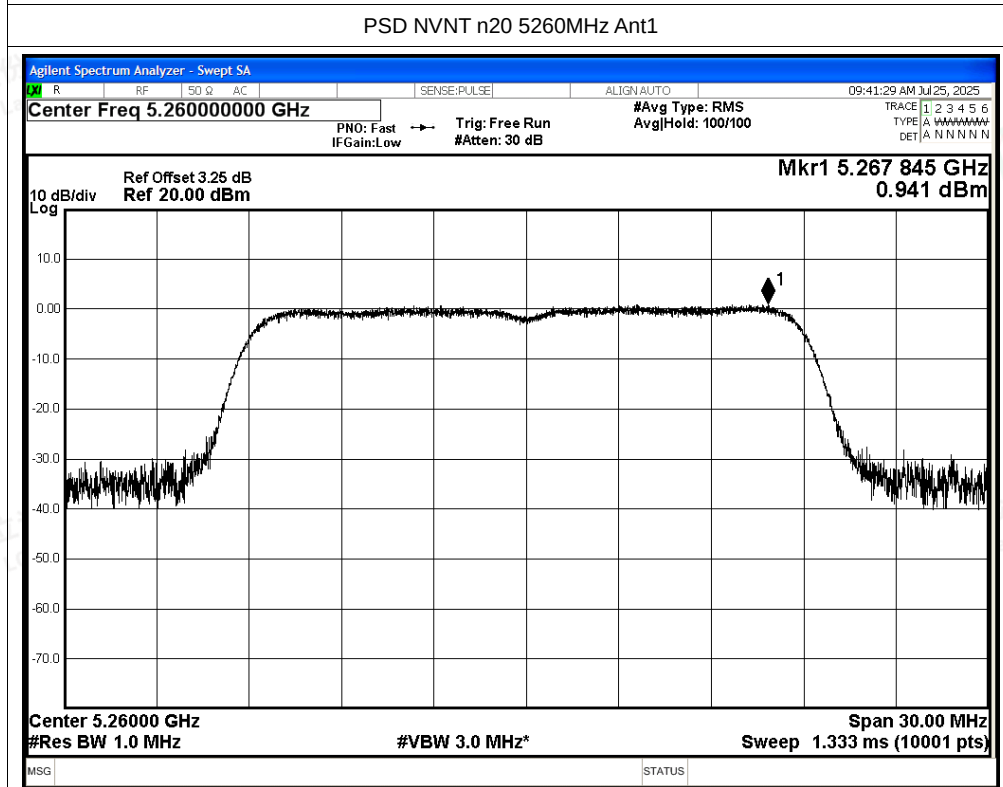
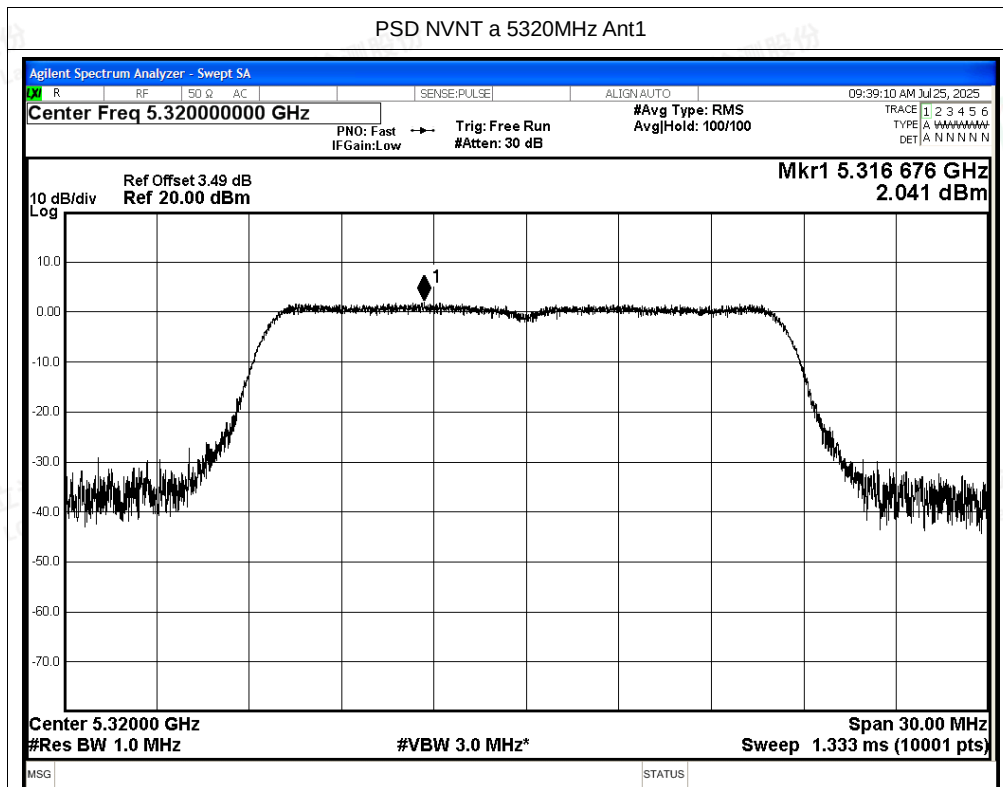


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

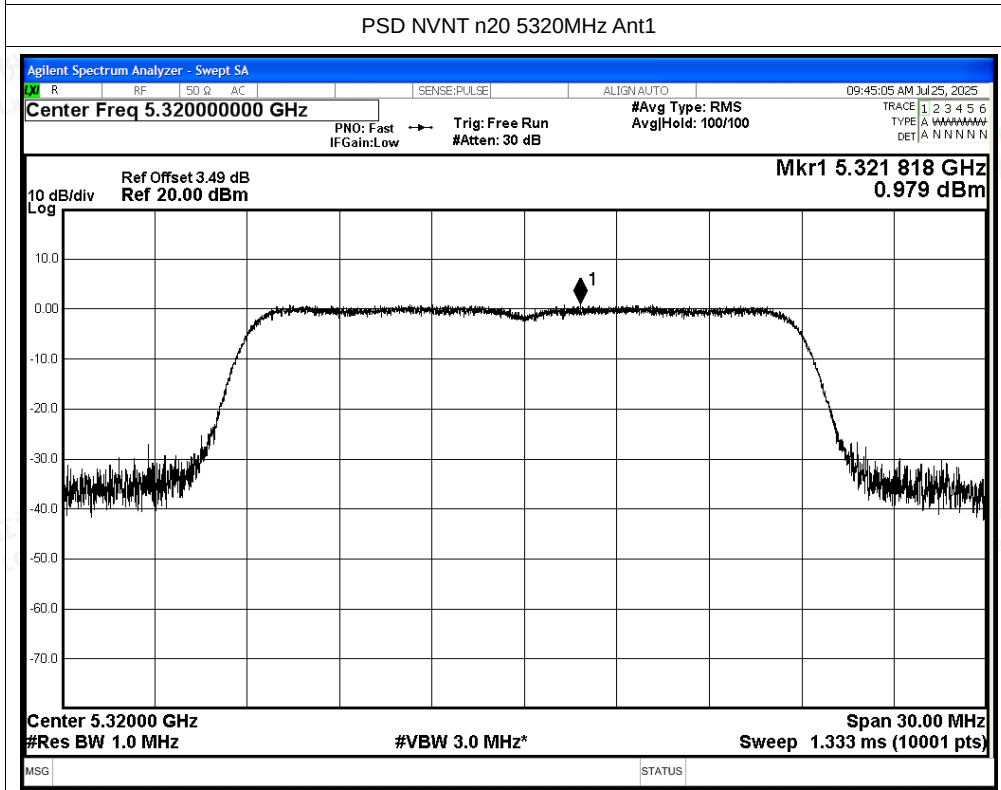
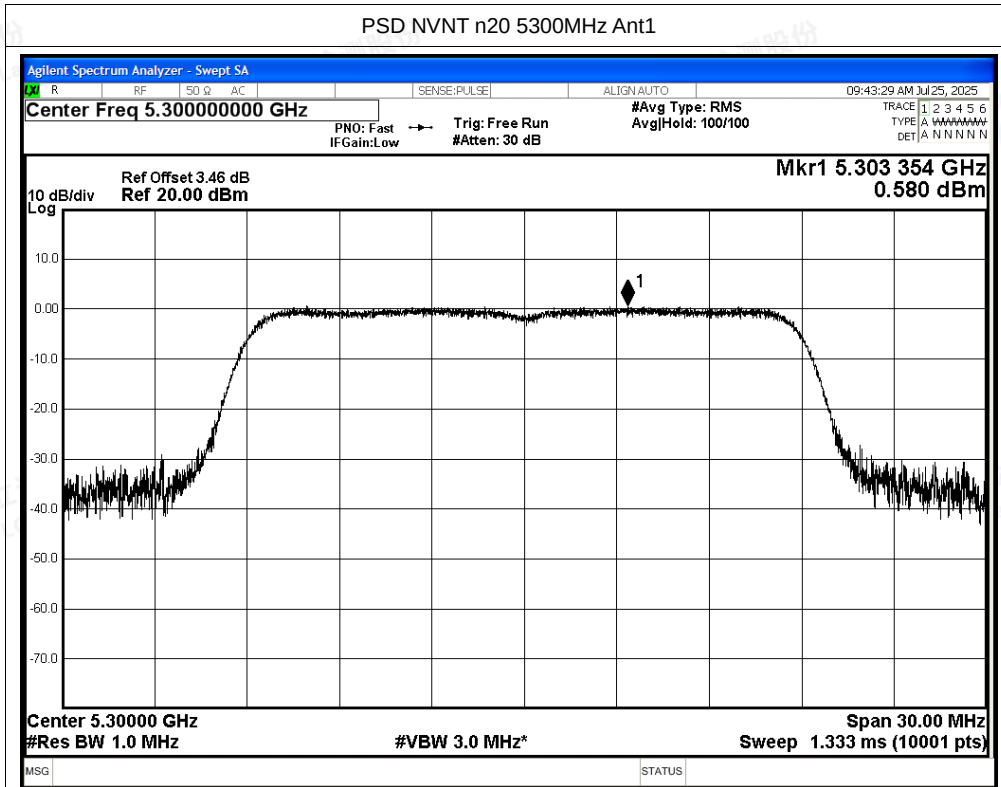


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

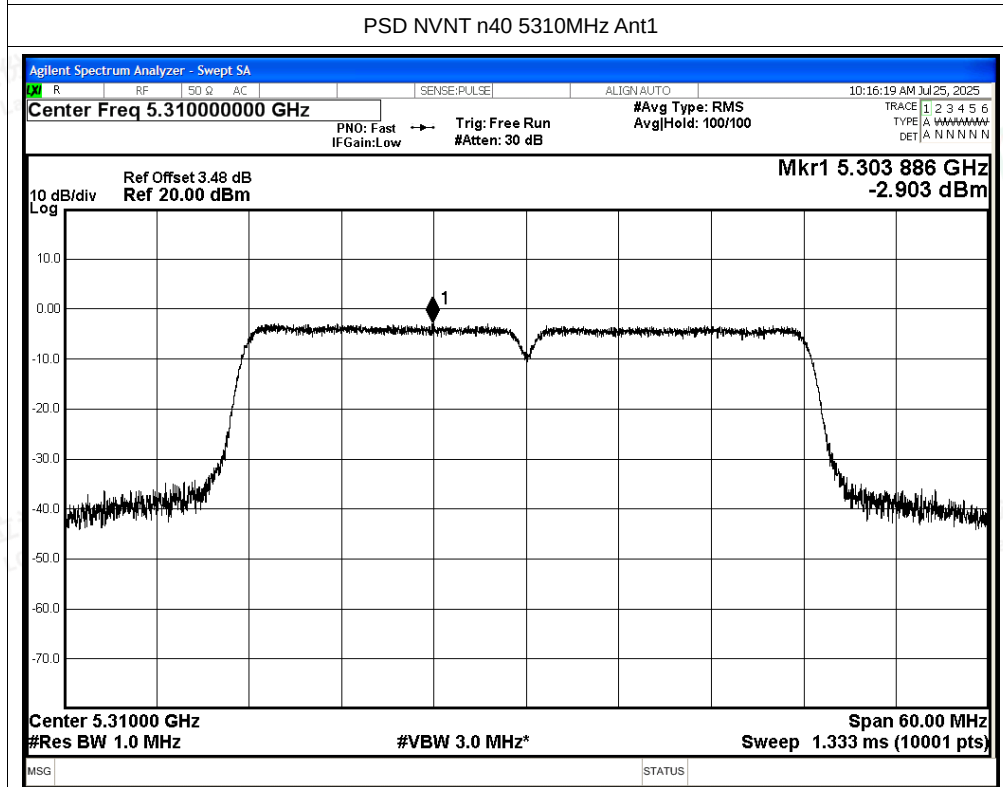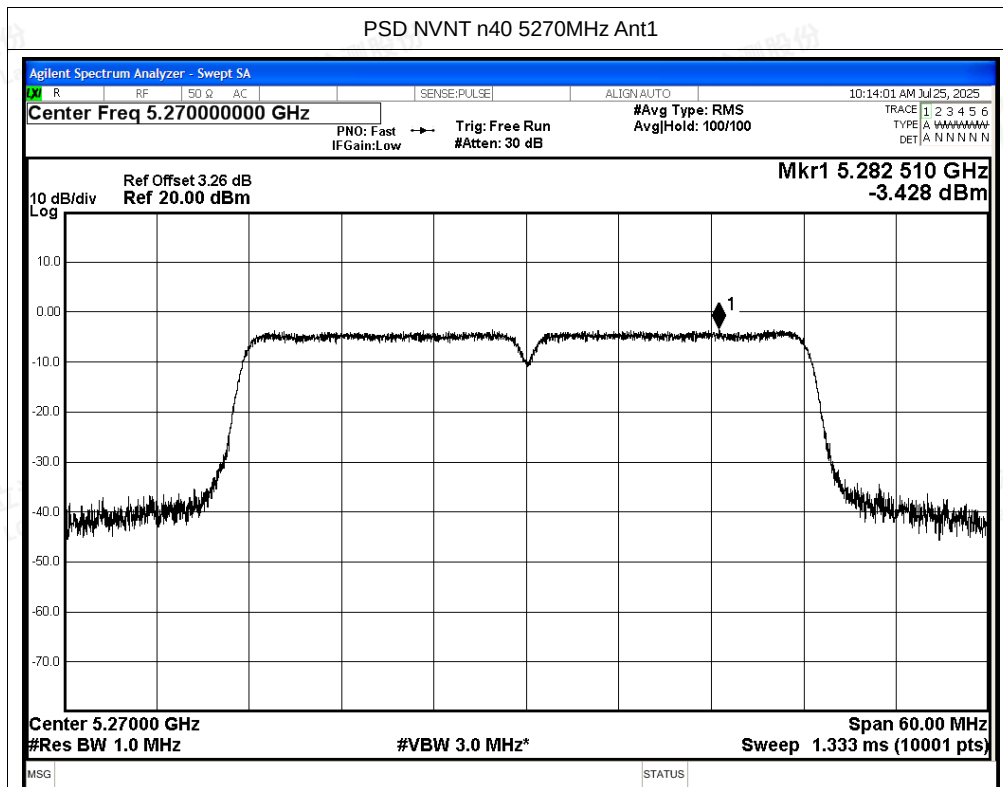

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5260MHz Ant1

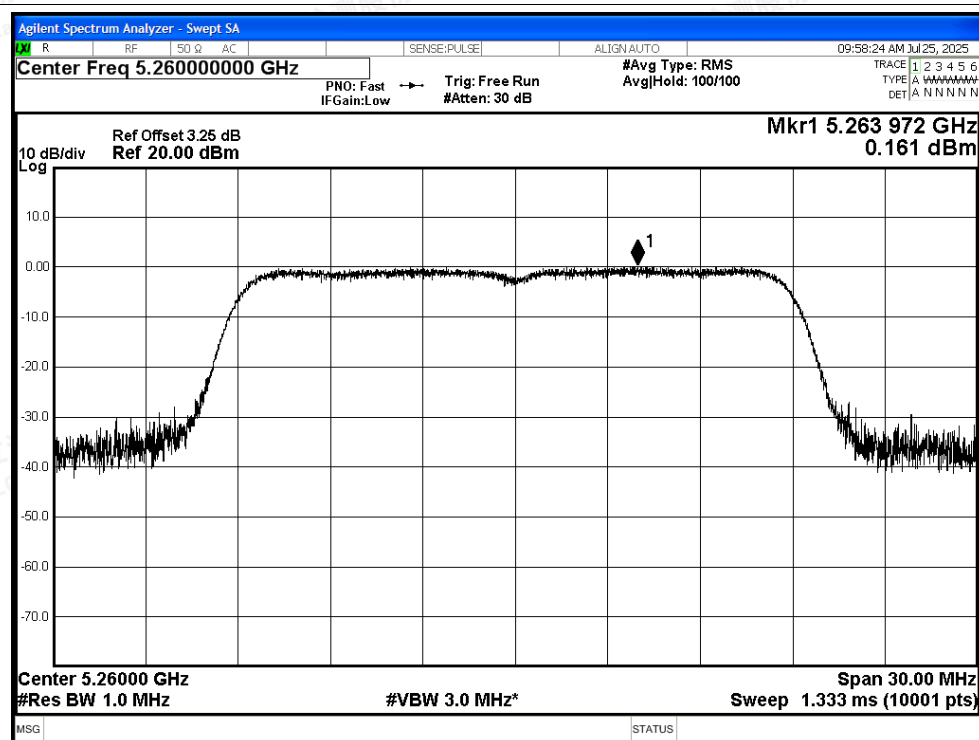

PSD NVNT ac20 5300MHz Ant1

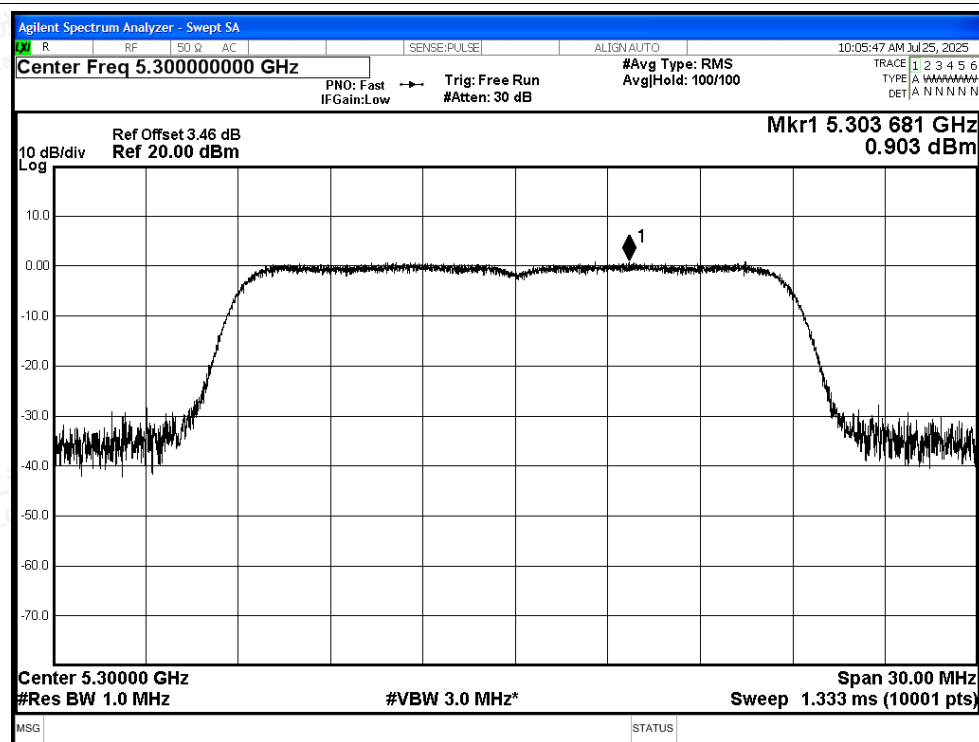

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5320MHz Ant1

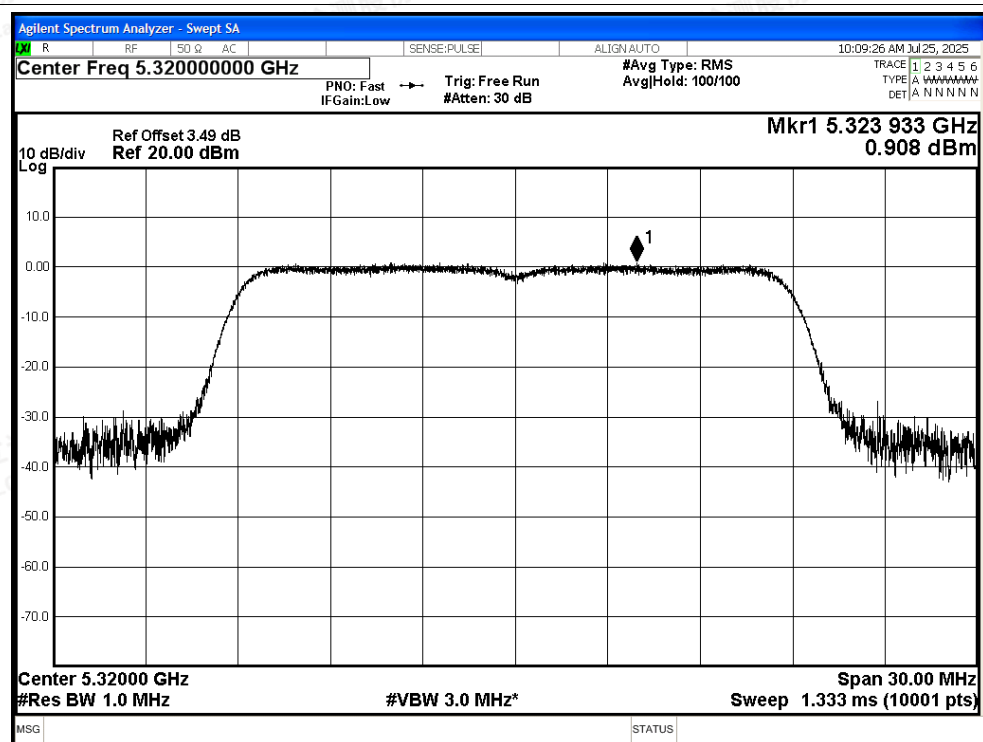

PSD NVNT ac40 5270MHz Ant1


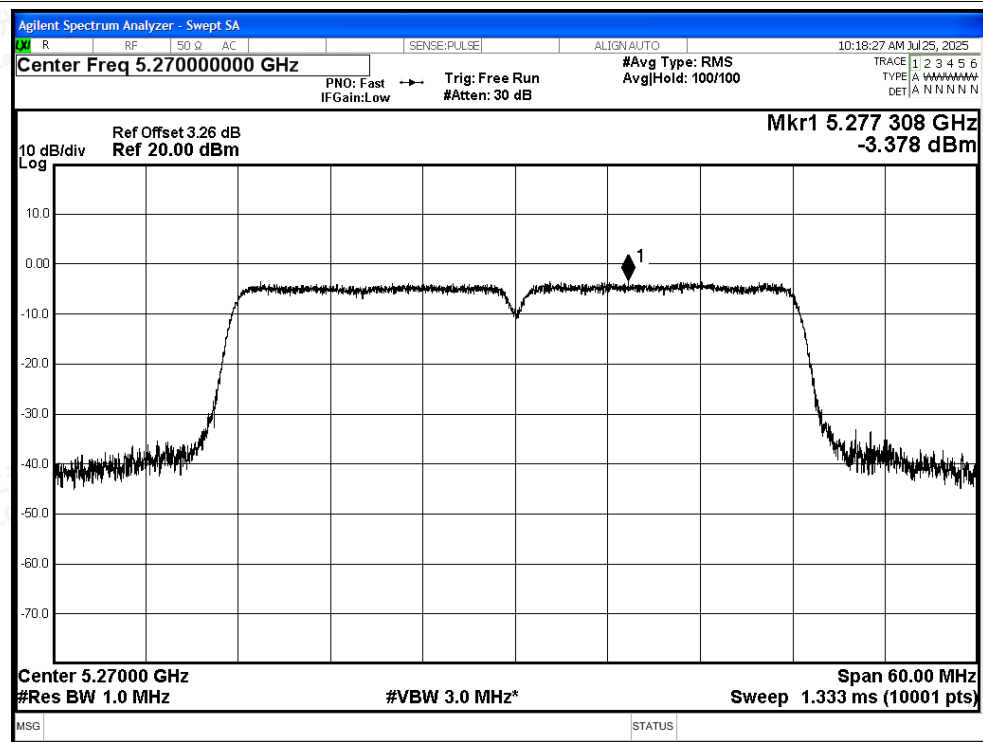




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

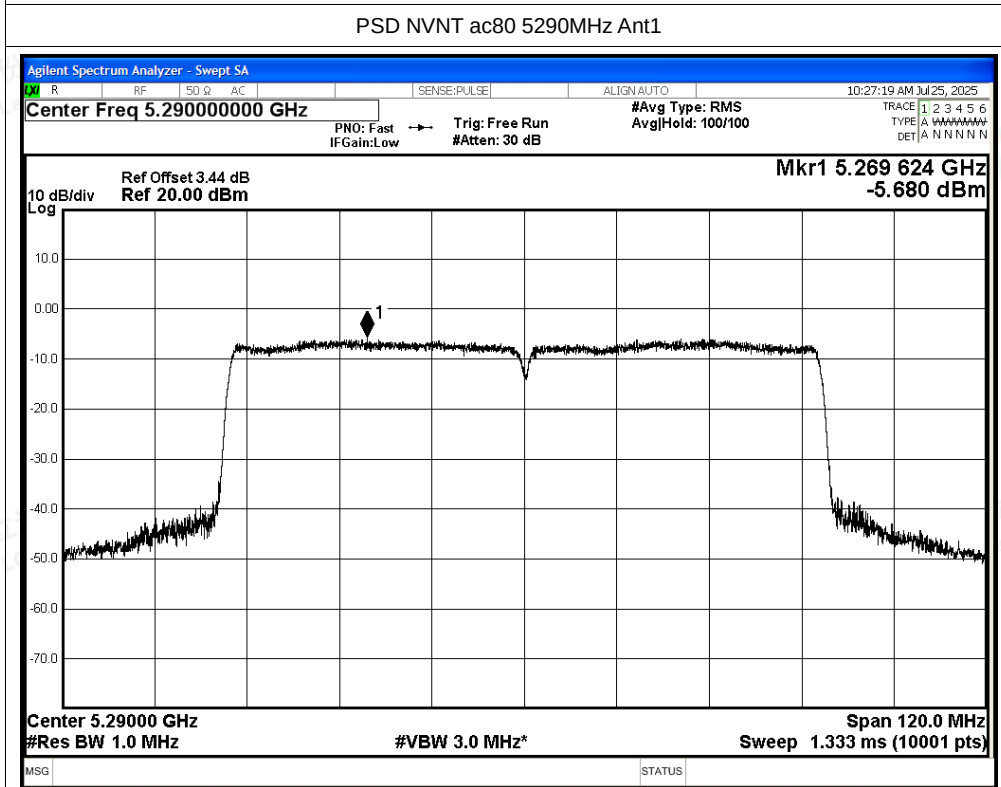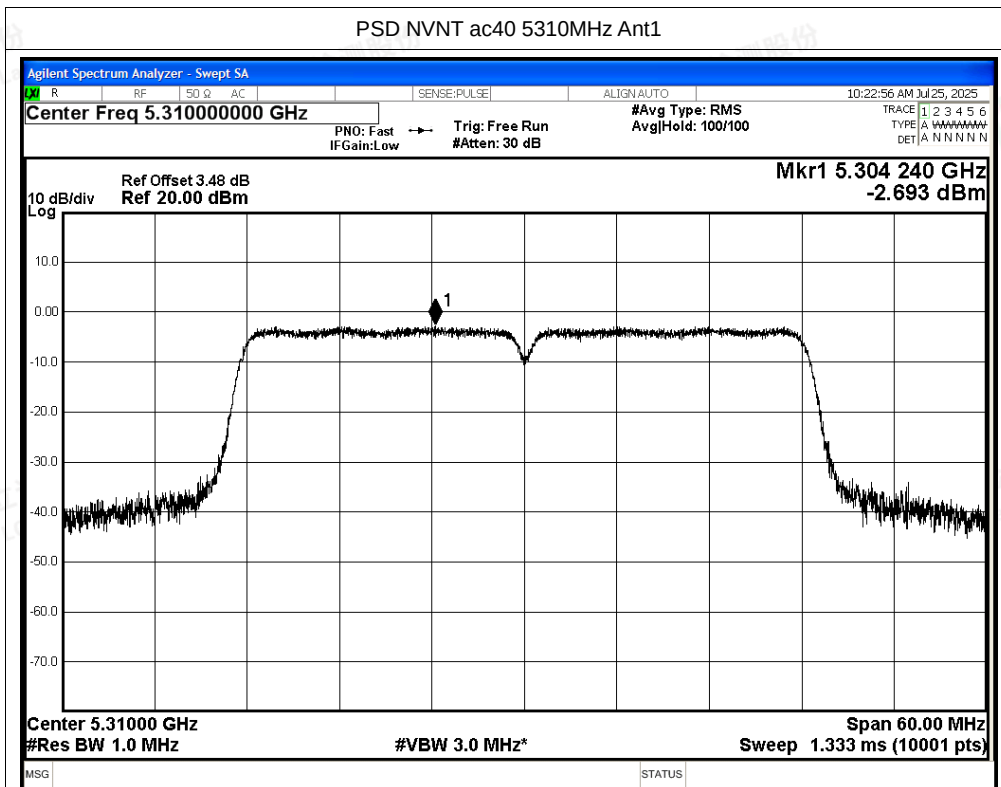

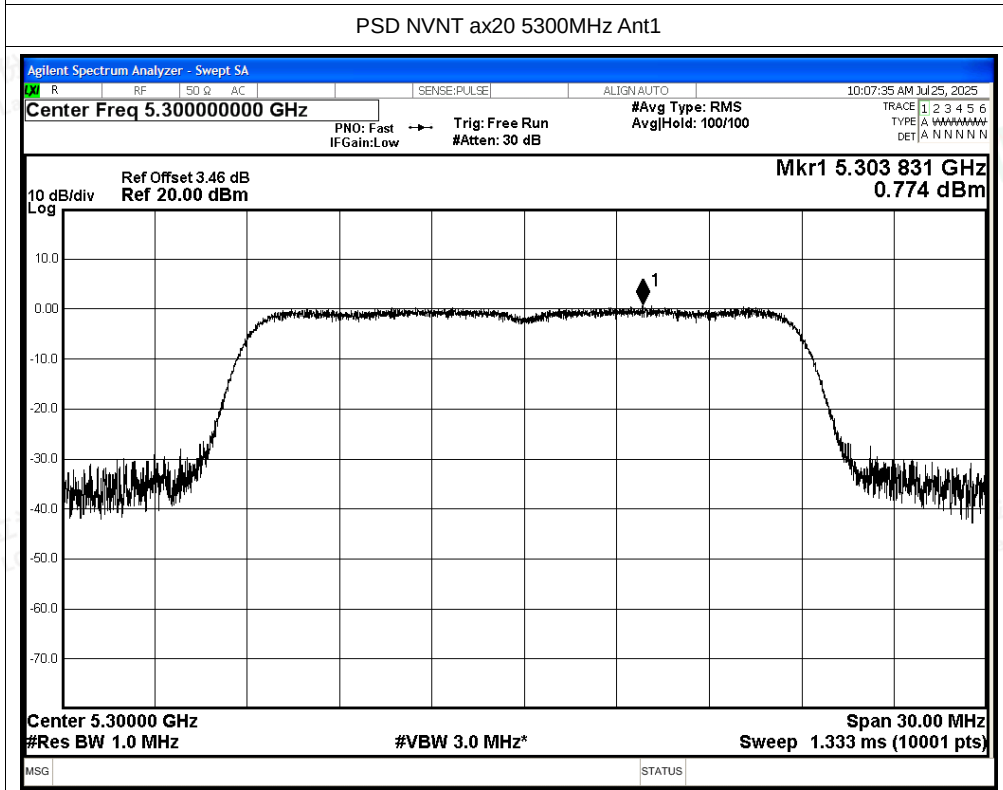
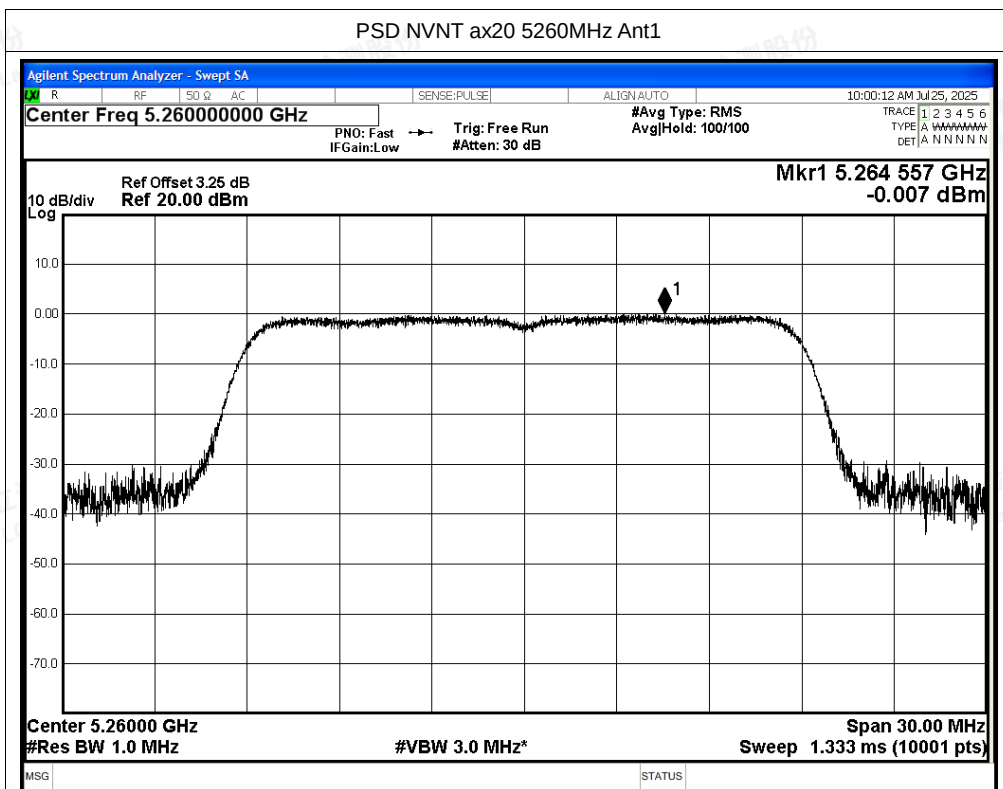


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

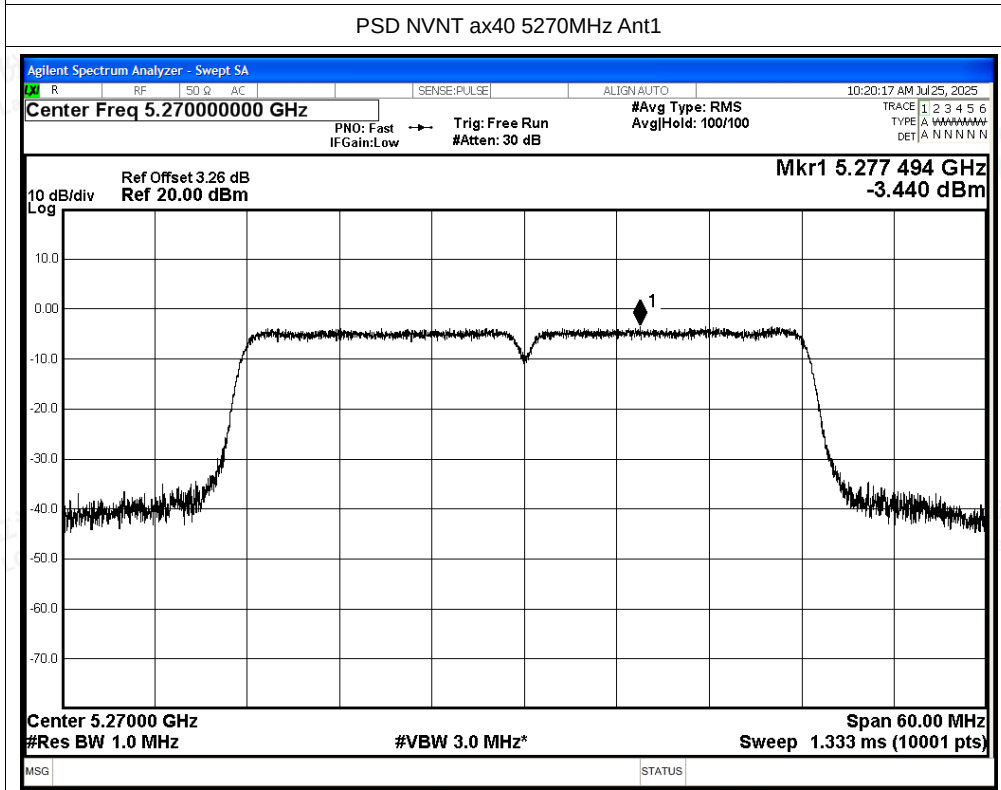
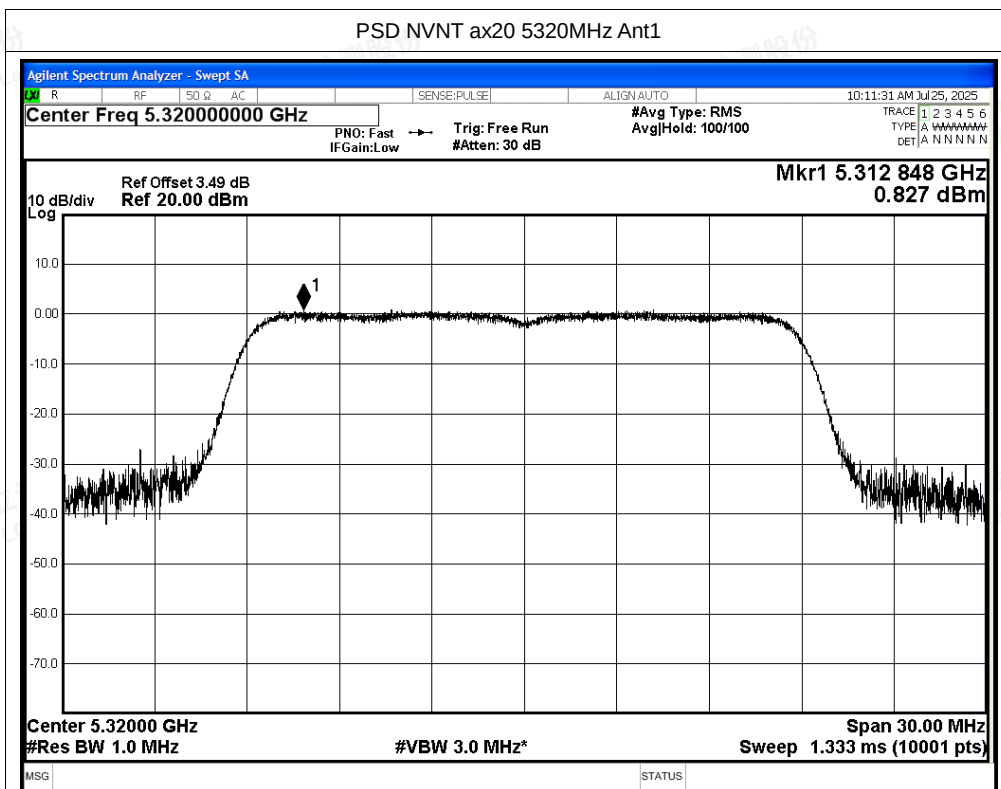


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

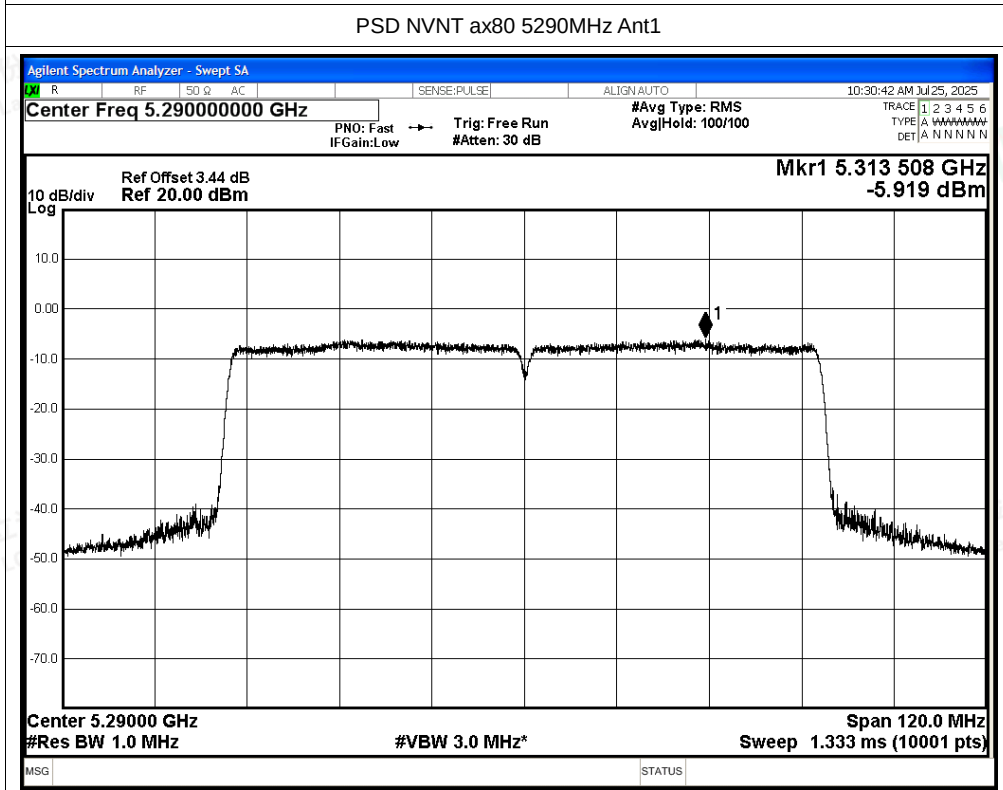
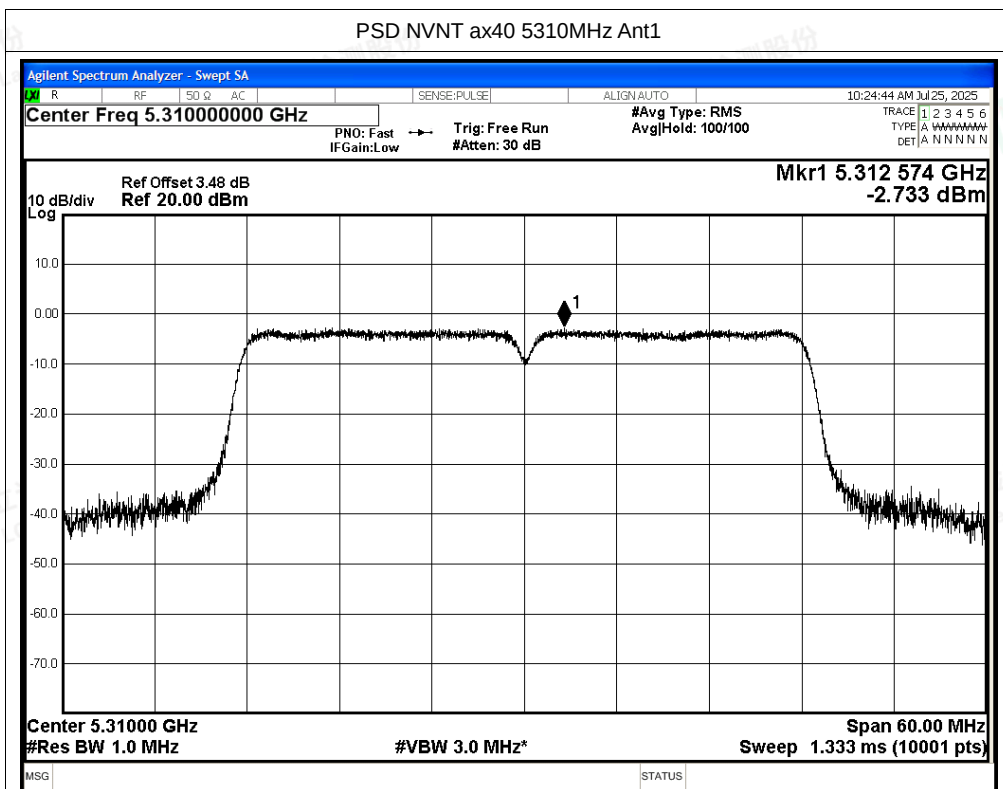


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

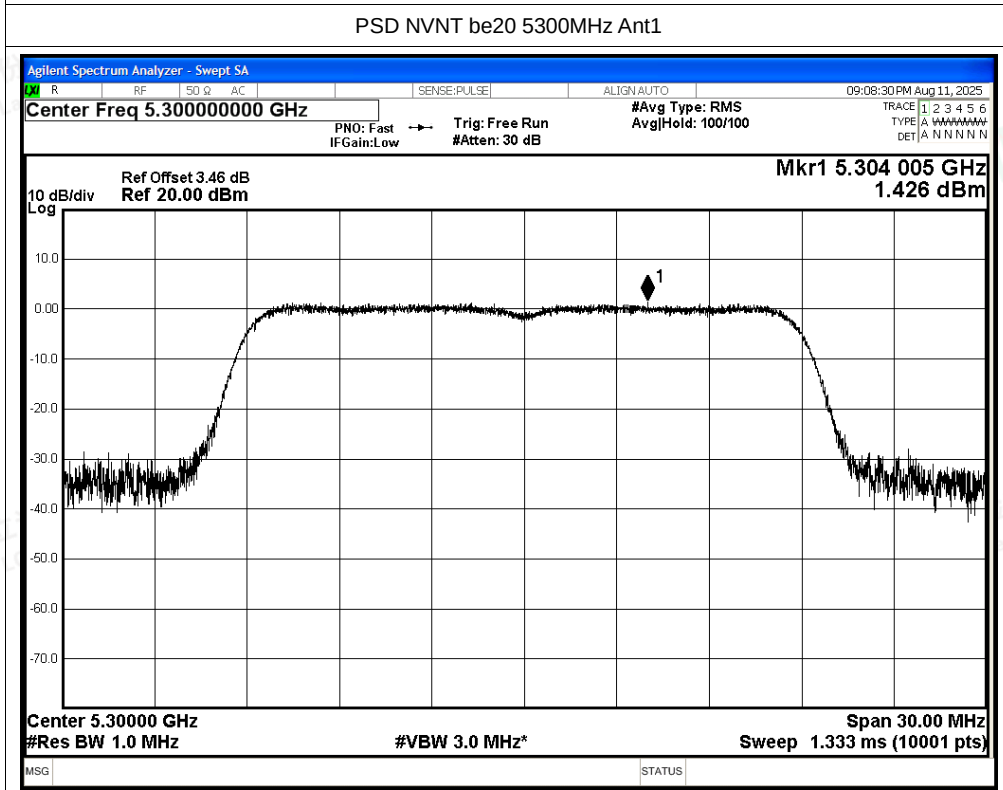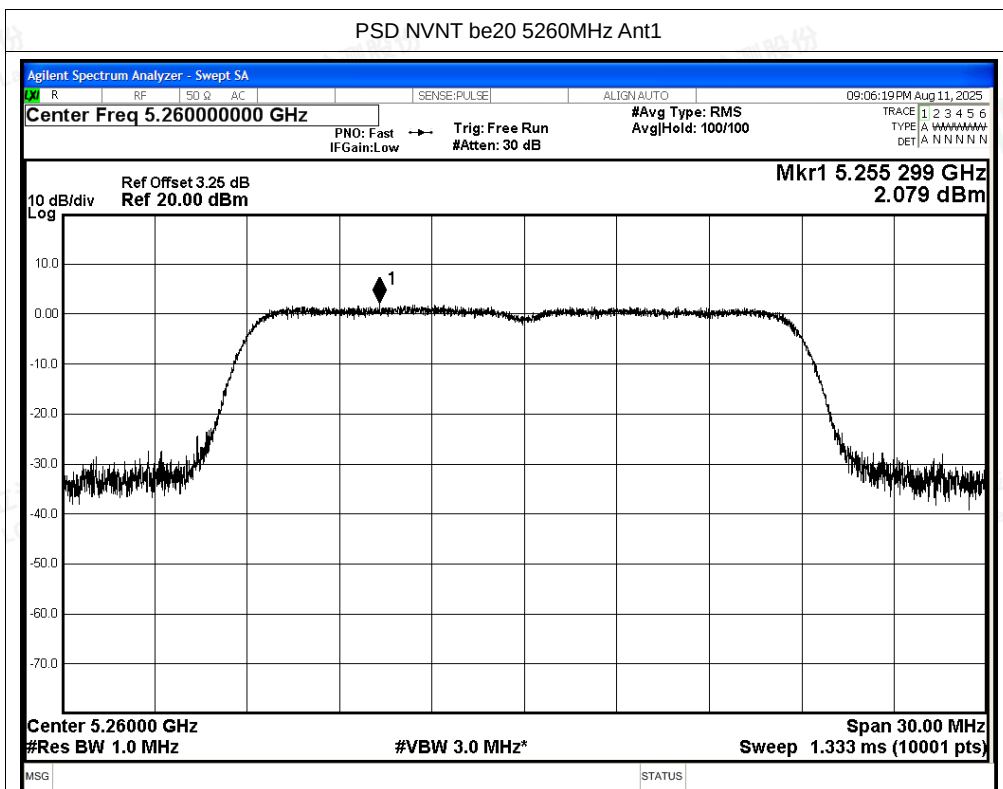

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5320MHz Ant1

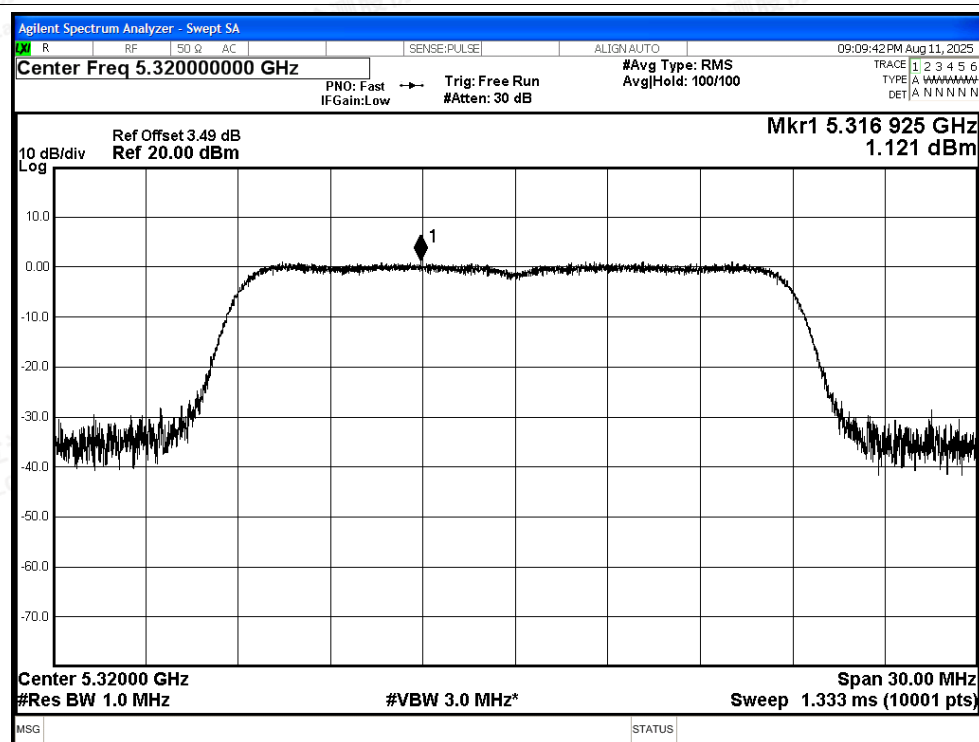

PSD NVNT be40 5270MHz Ant1

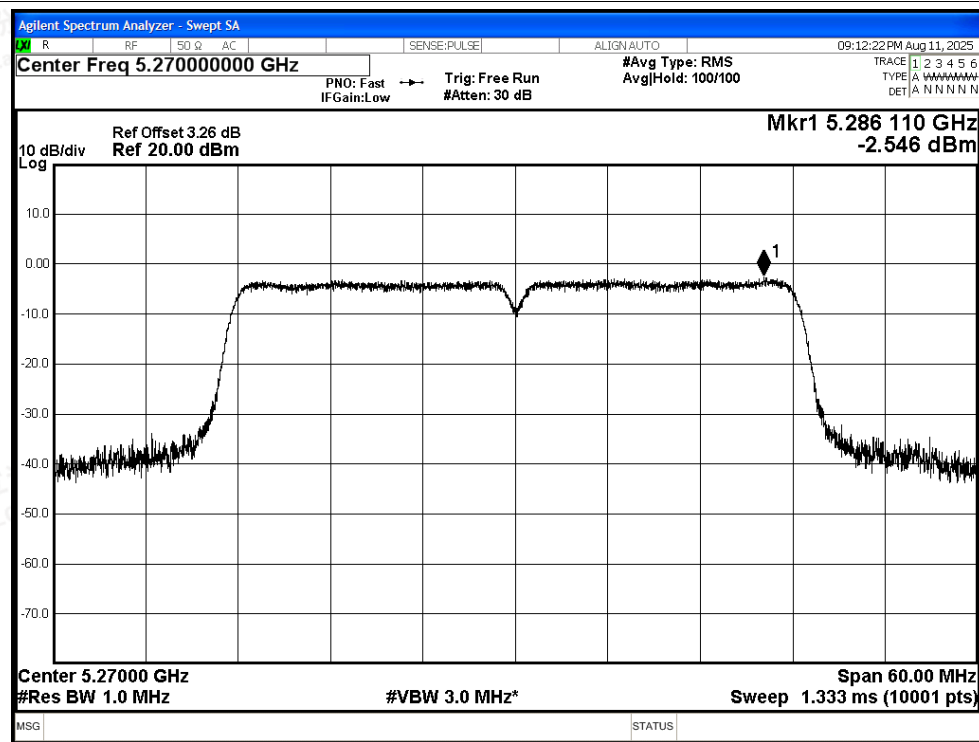

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5310MHz Ant1

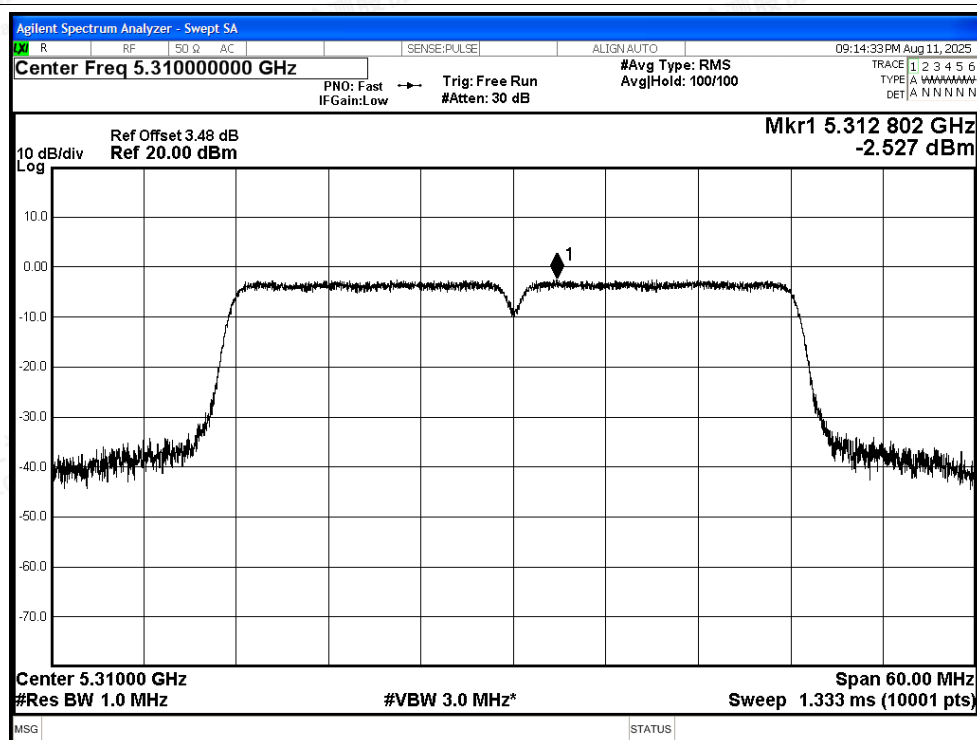

PSD NVNT be80 5290MHz Ant1

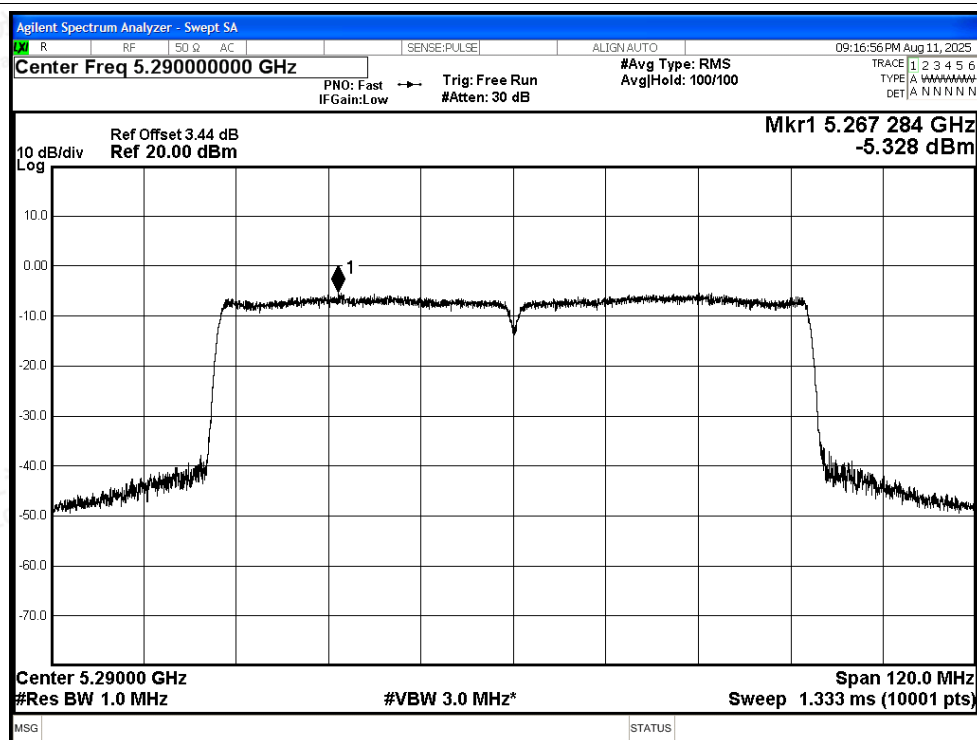

PSD NVNT ac160 5250MHz Ant1





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

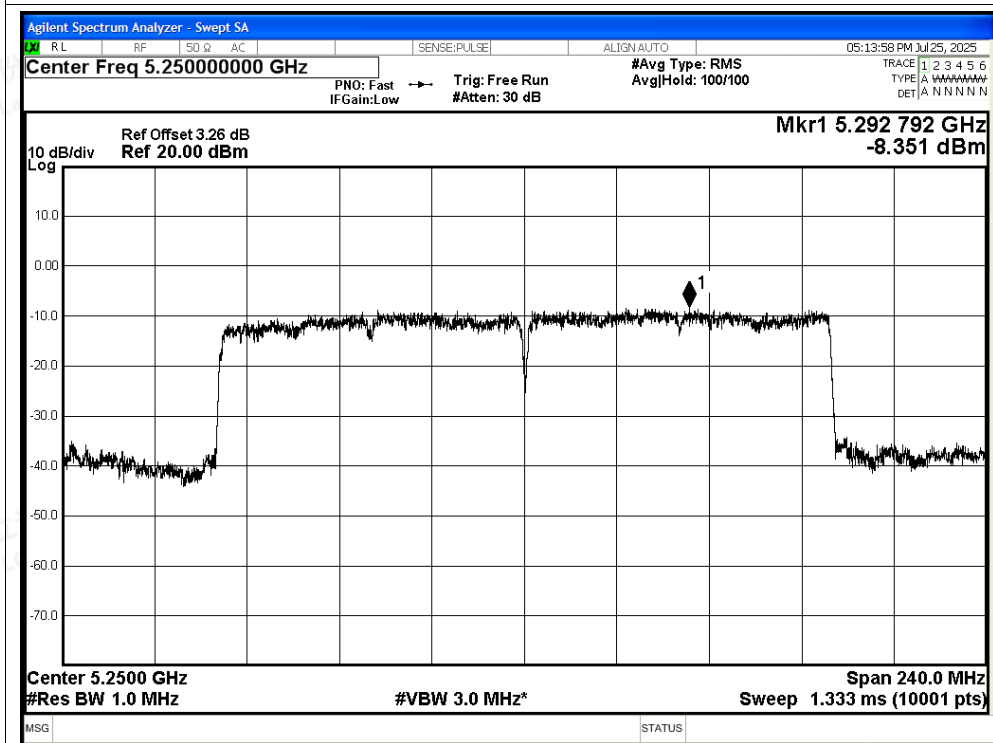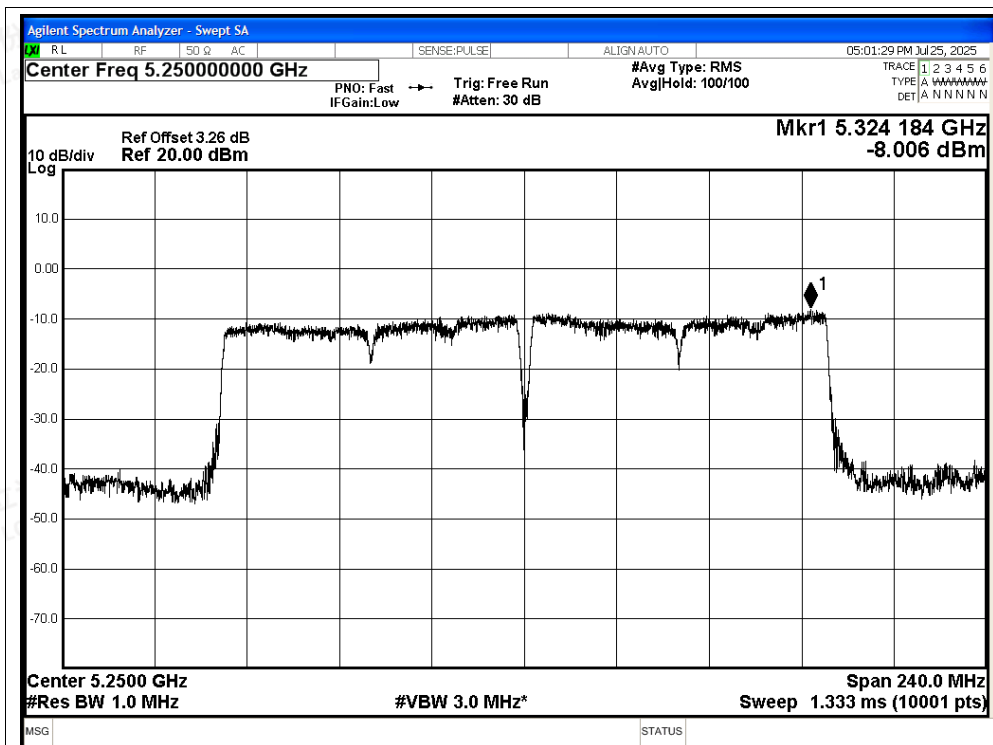


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

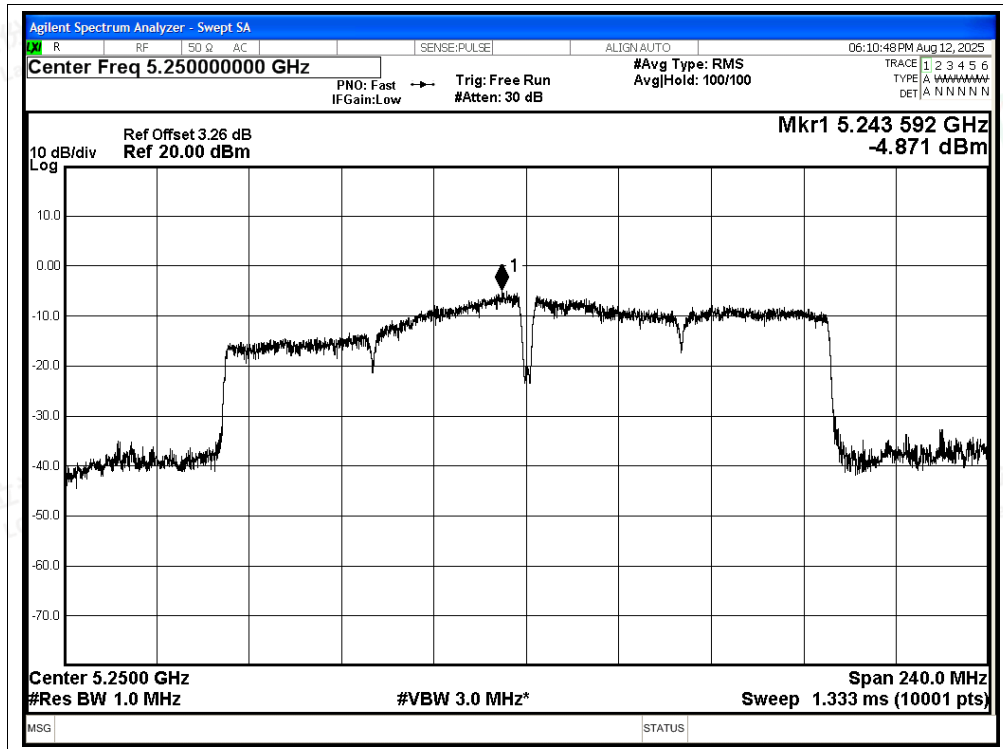

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5260MHz Ant2

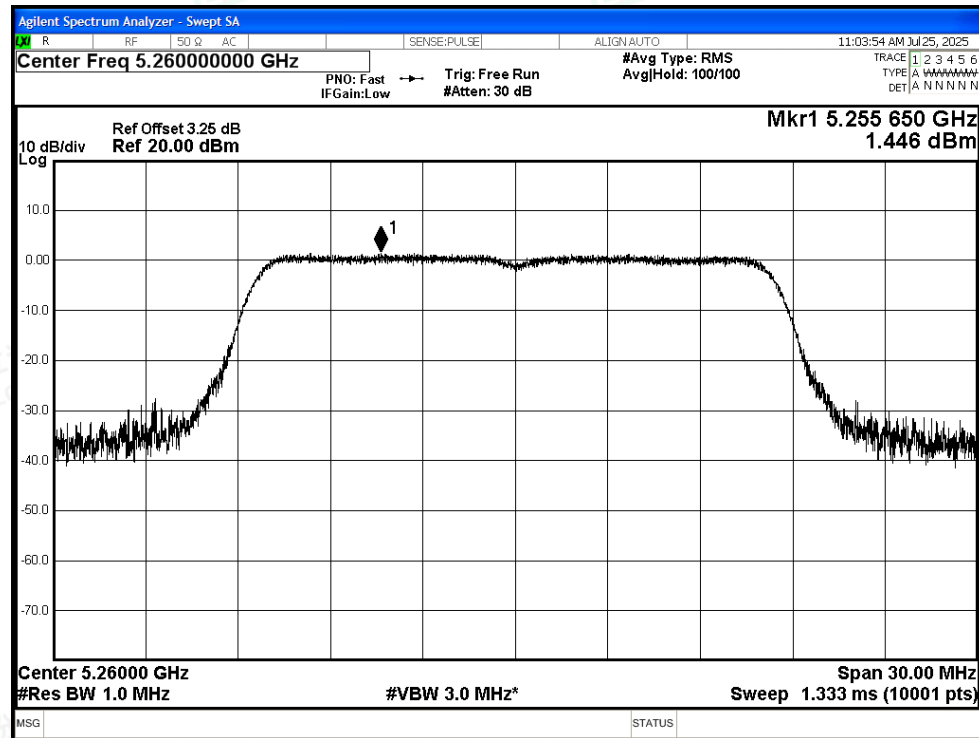

PSD NVNT a 5300MHz Ant2


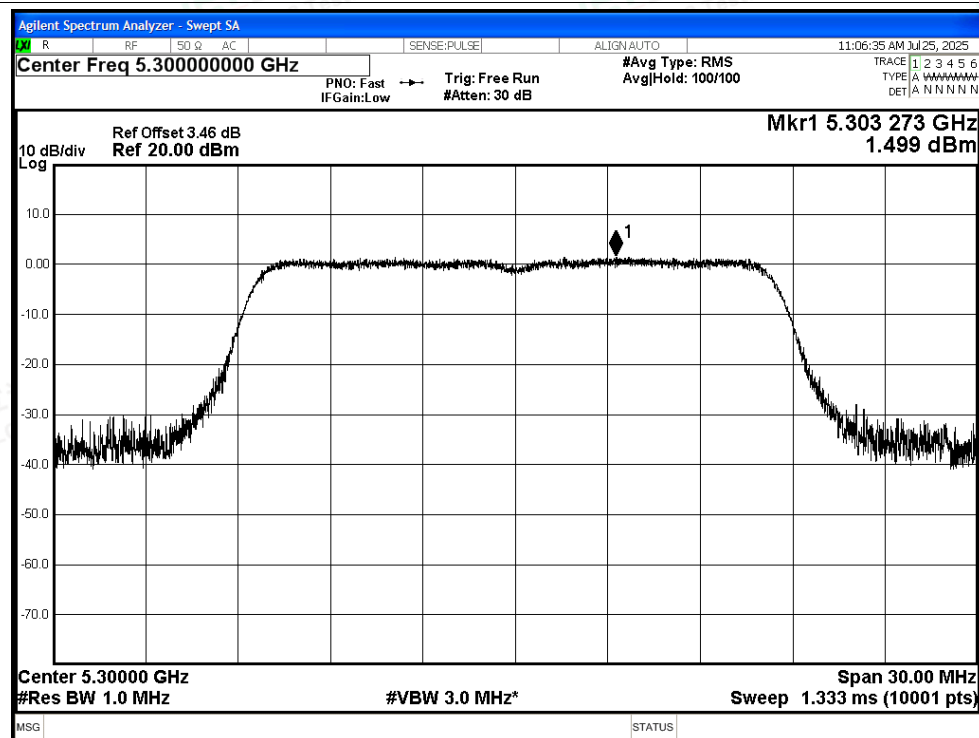


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

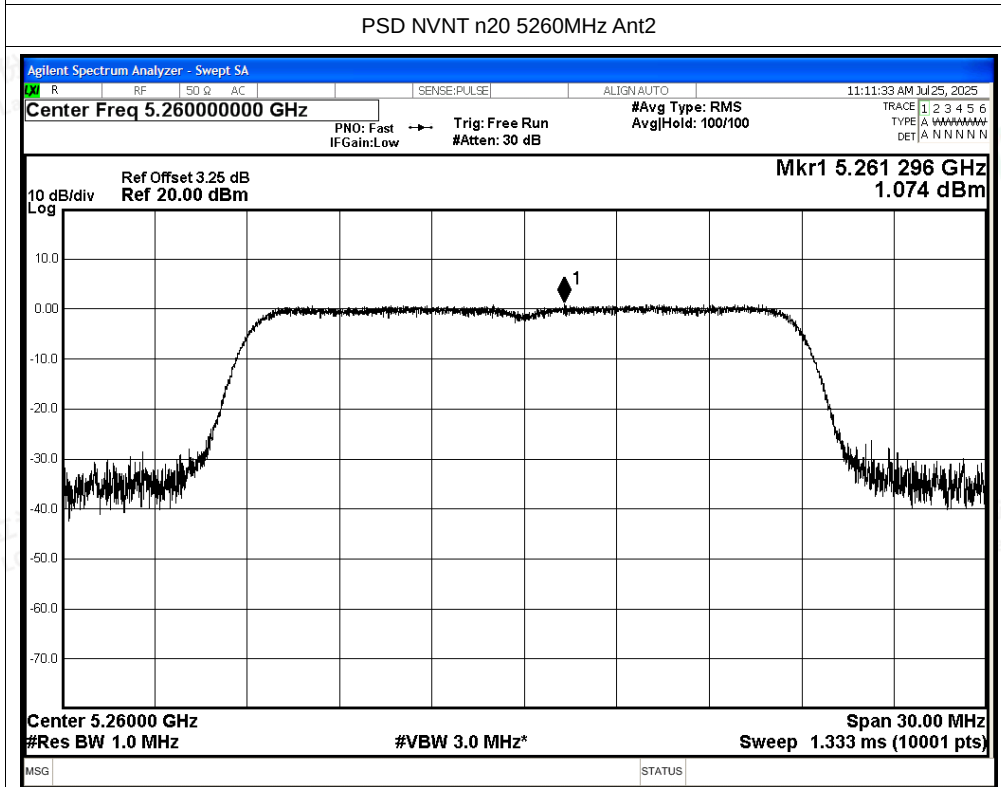
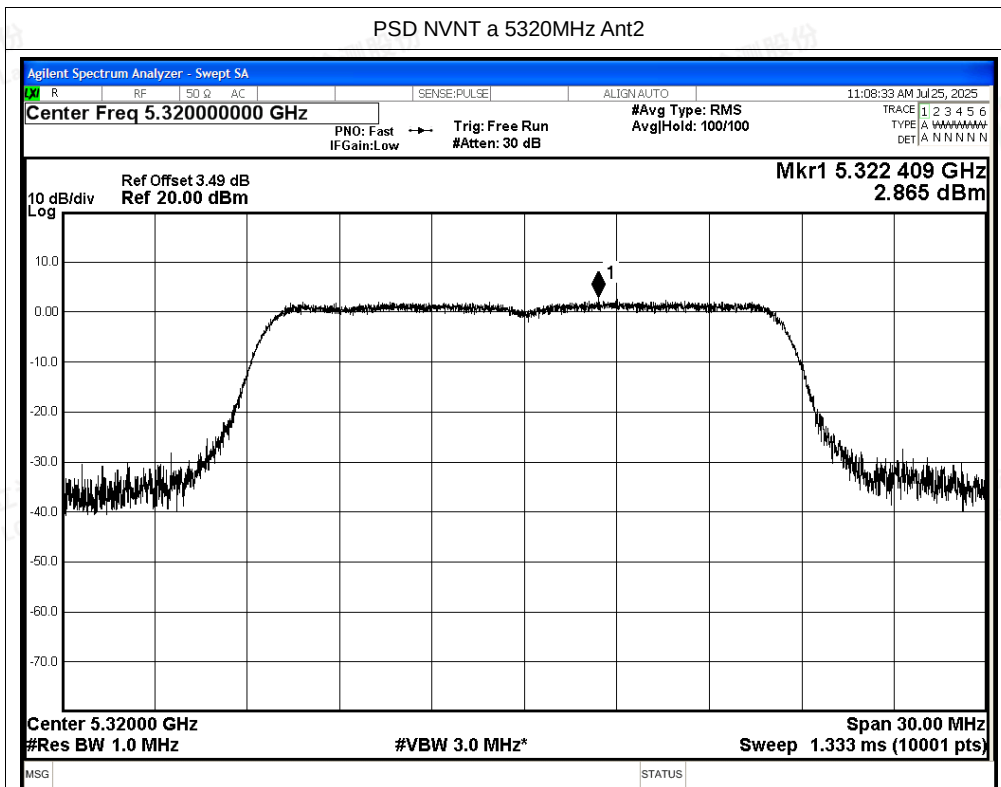


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

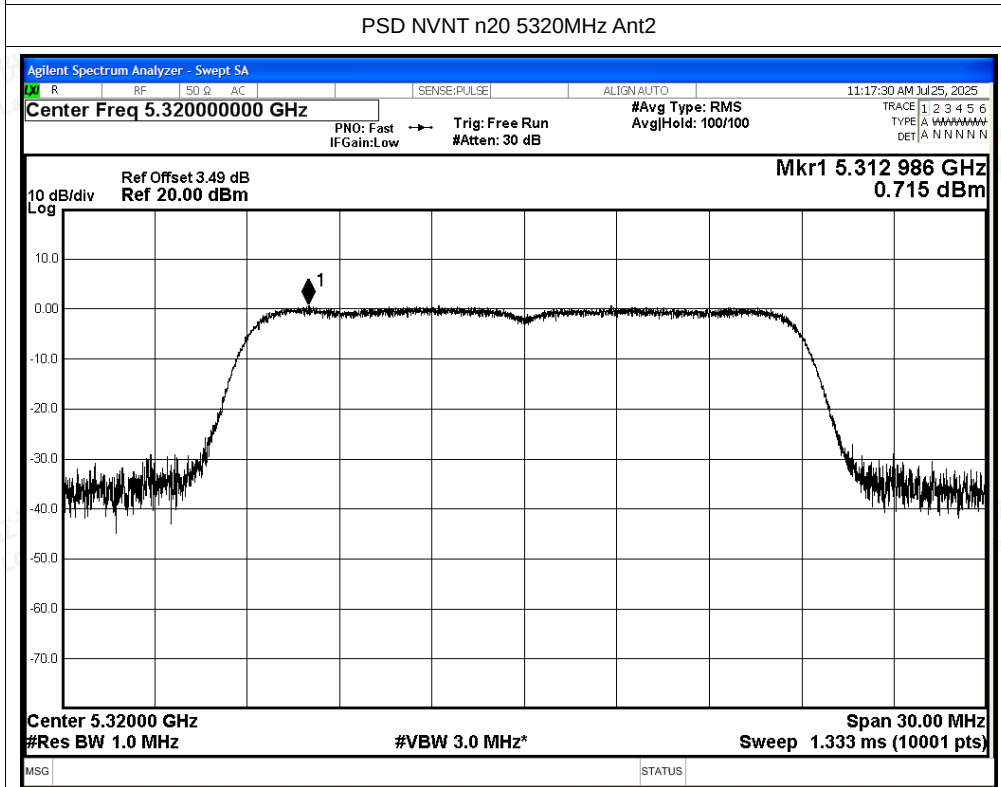
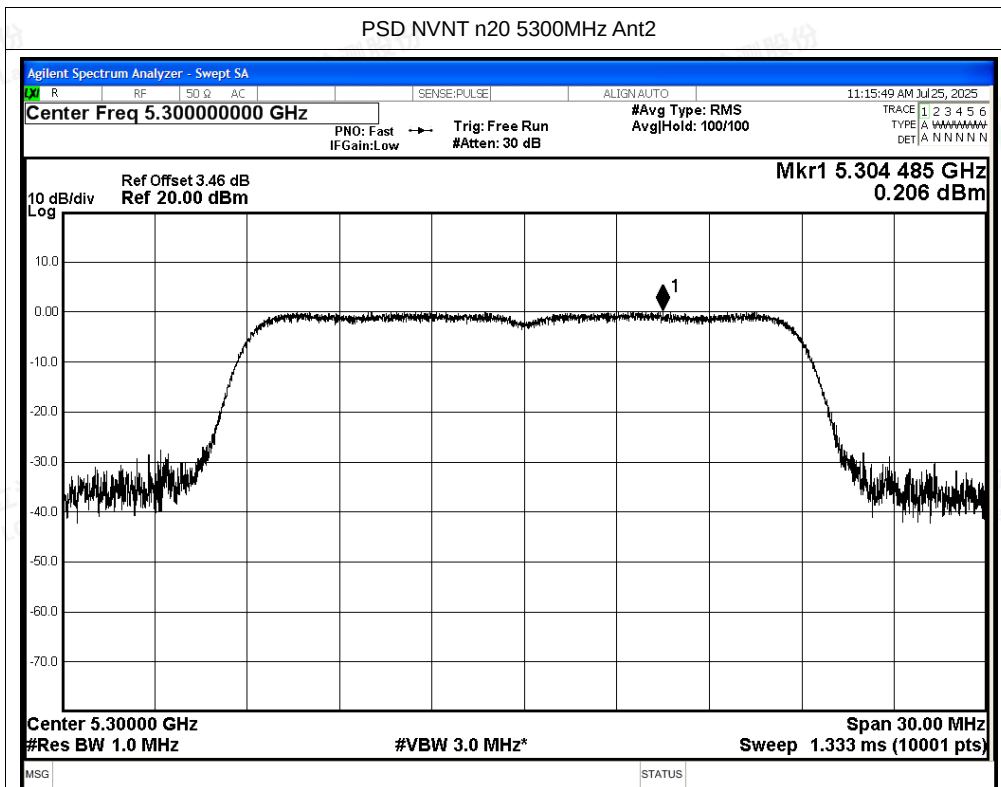




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

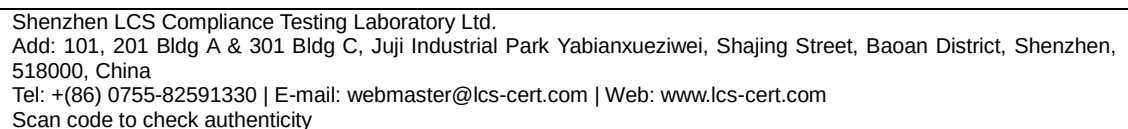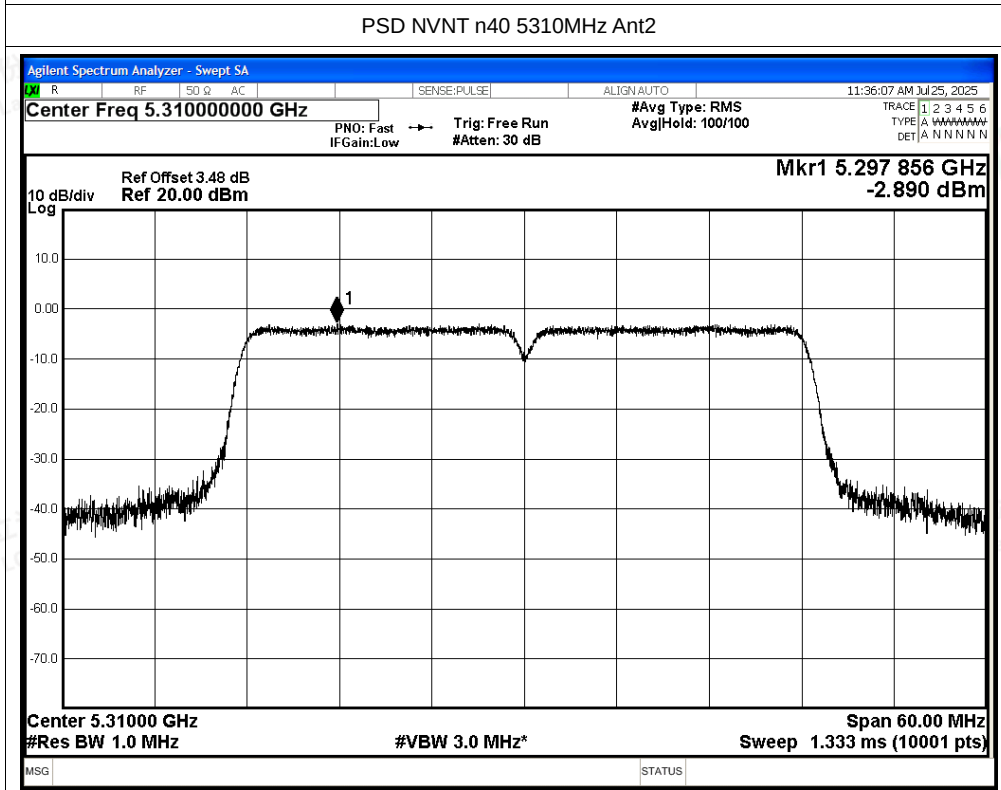

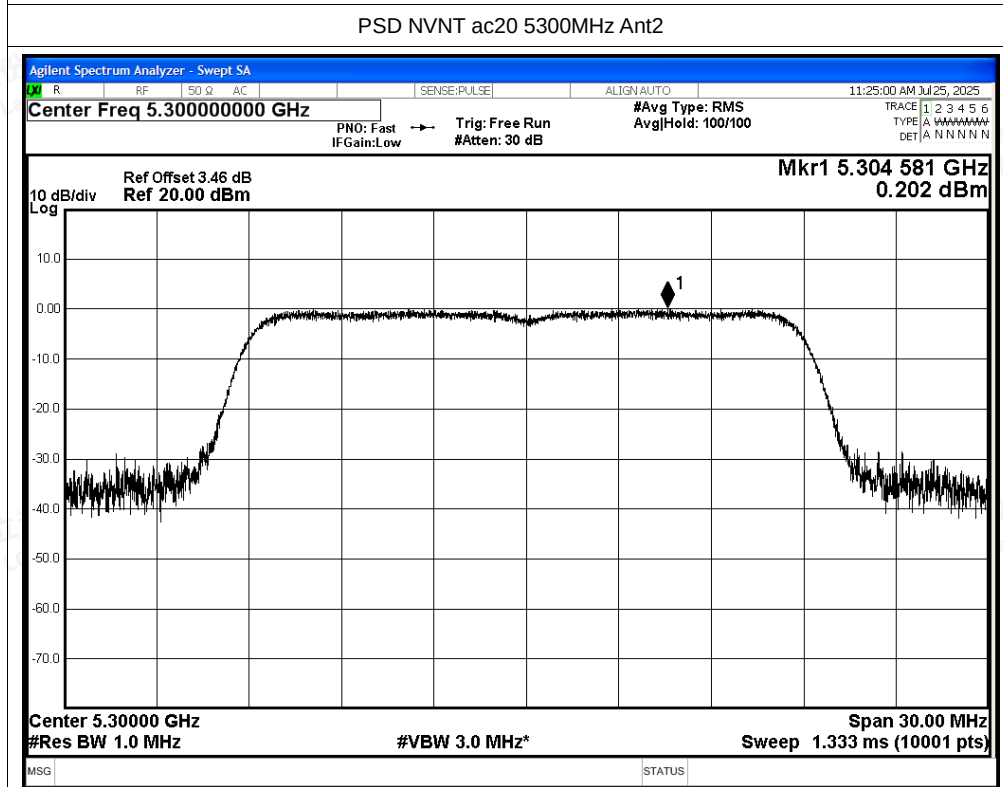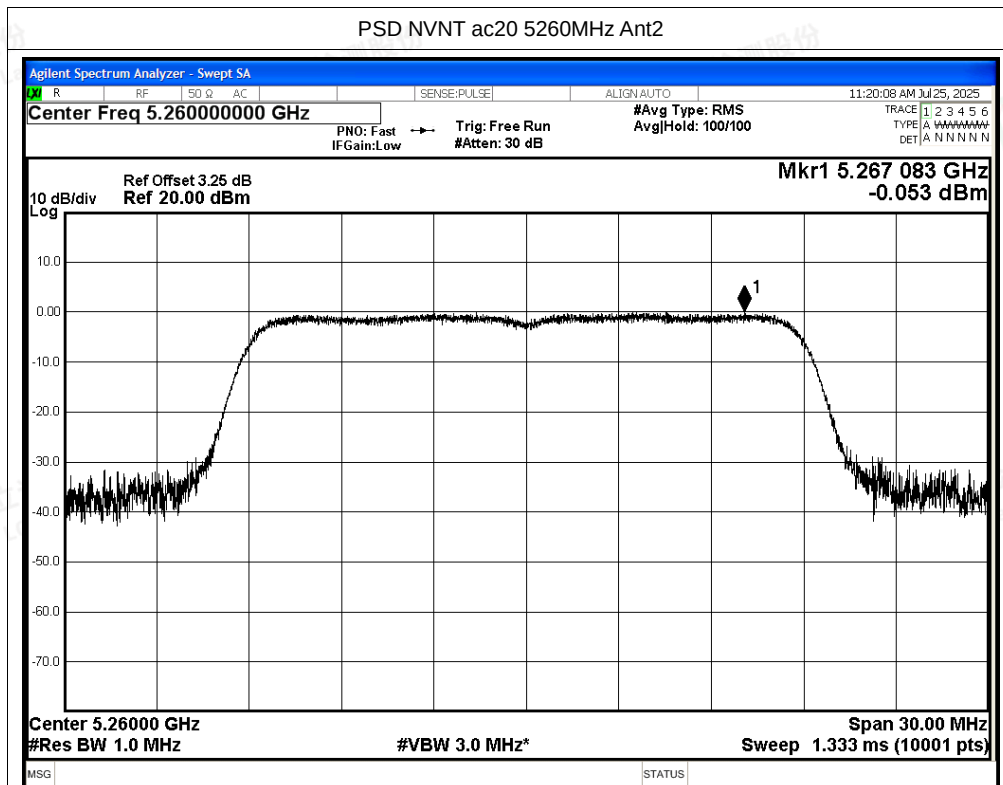




PSD NVNT ac20 5320MHz Ant2

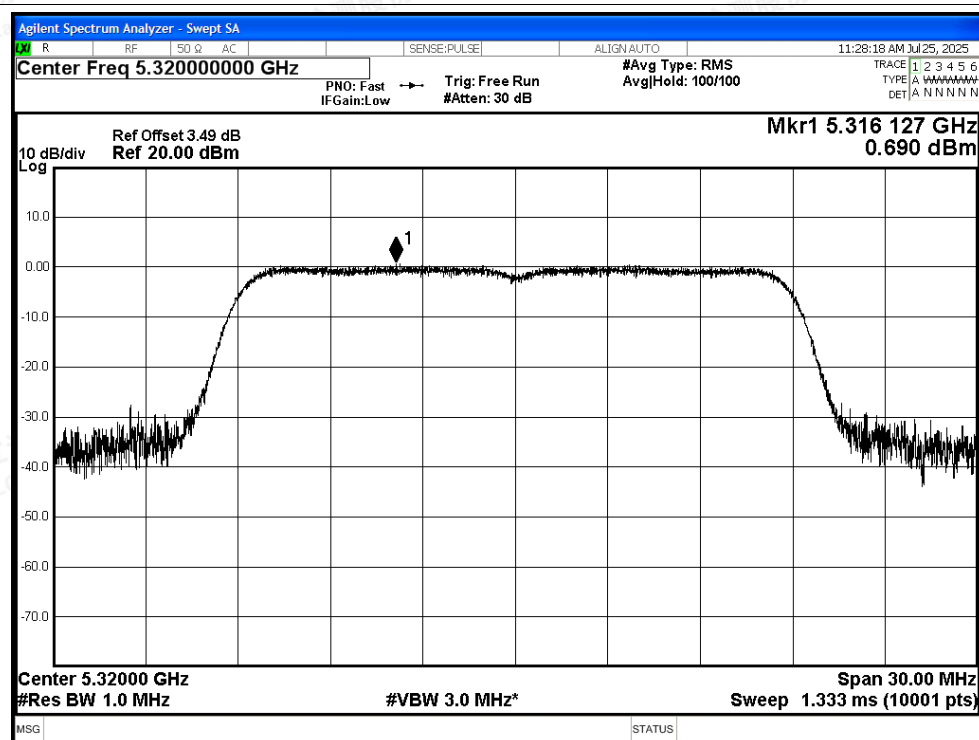

PSD NVNT ac40 5270MHz Ant2

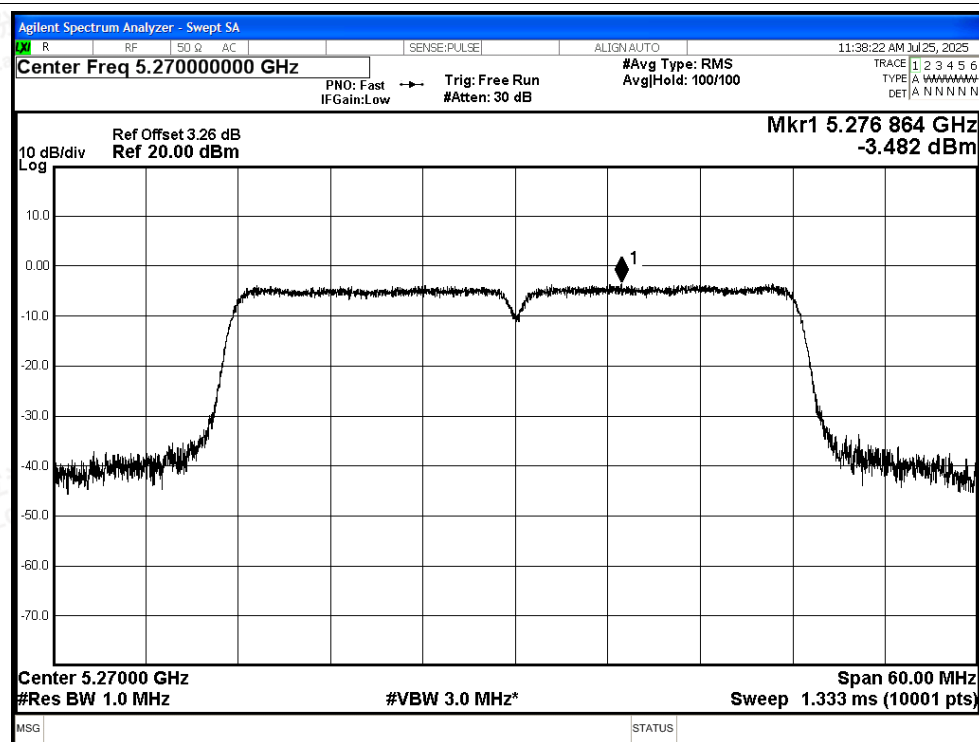


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



PSD NVNT ax20 5260MHz Ant2

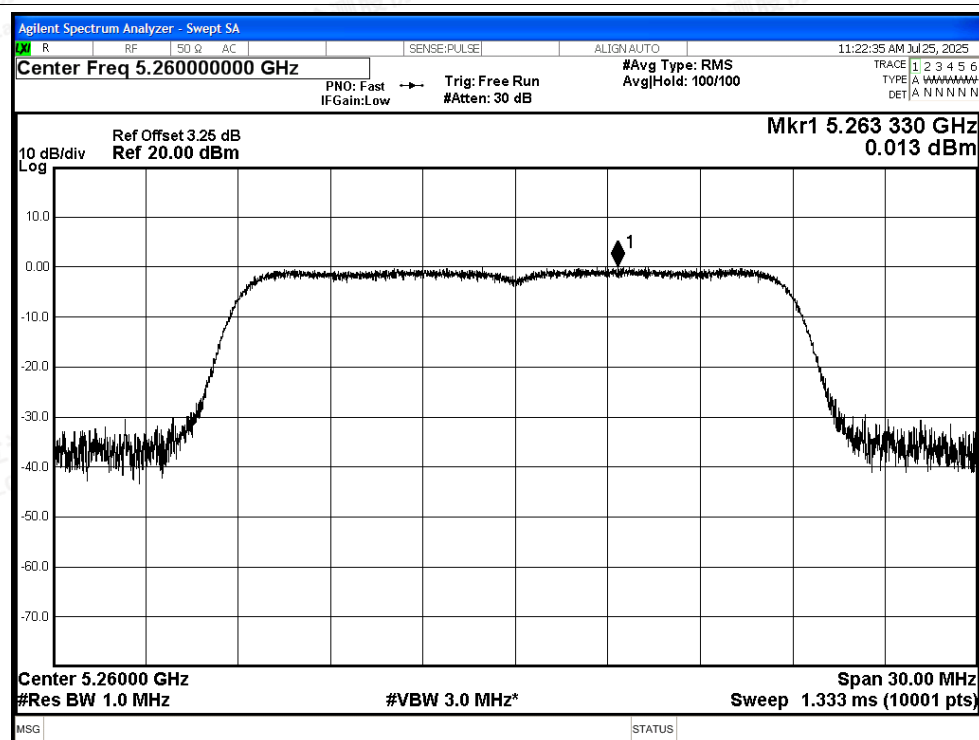

PSD NVNT ax20 5300MHz Ant2

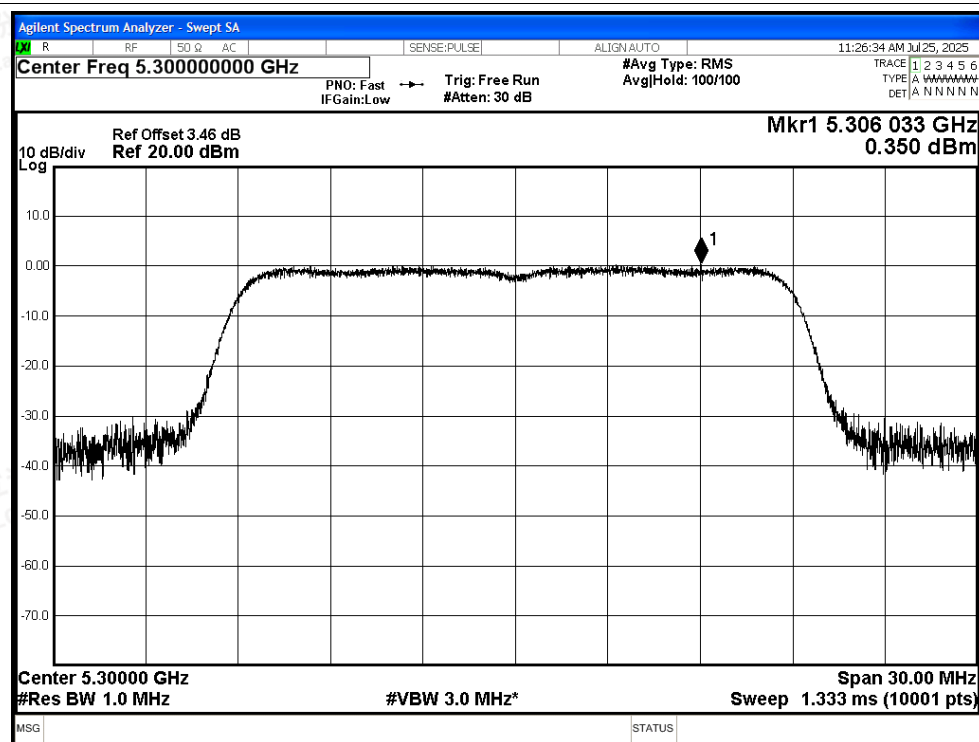

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5320MHz Ant2

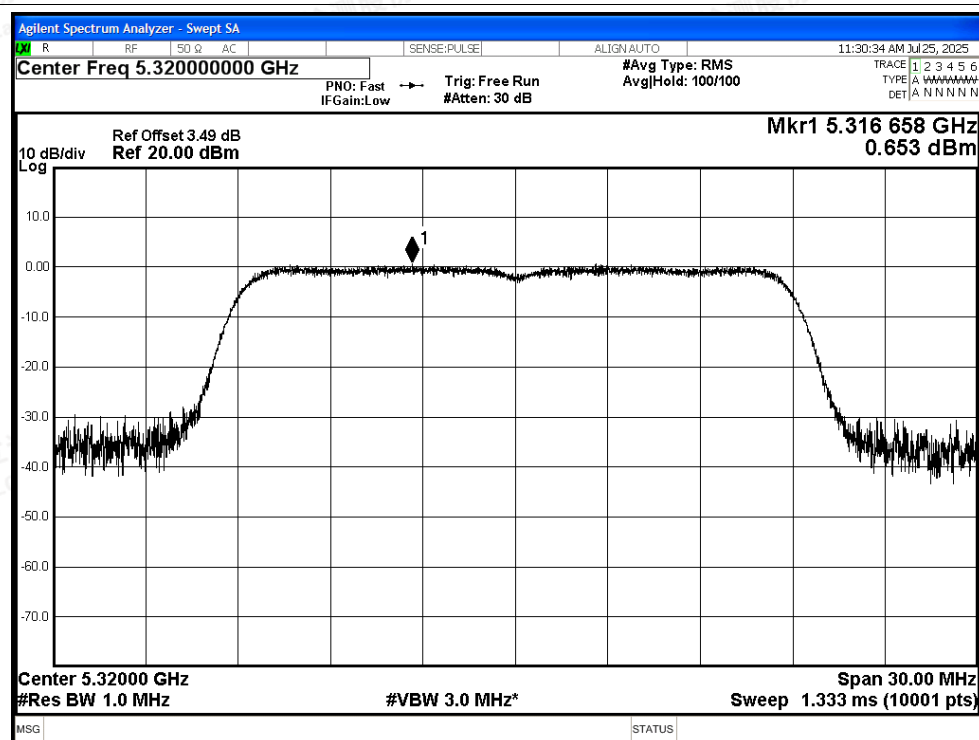

PSD NVNT ax40 5270MHz Ant2

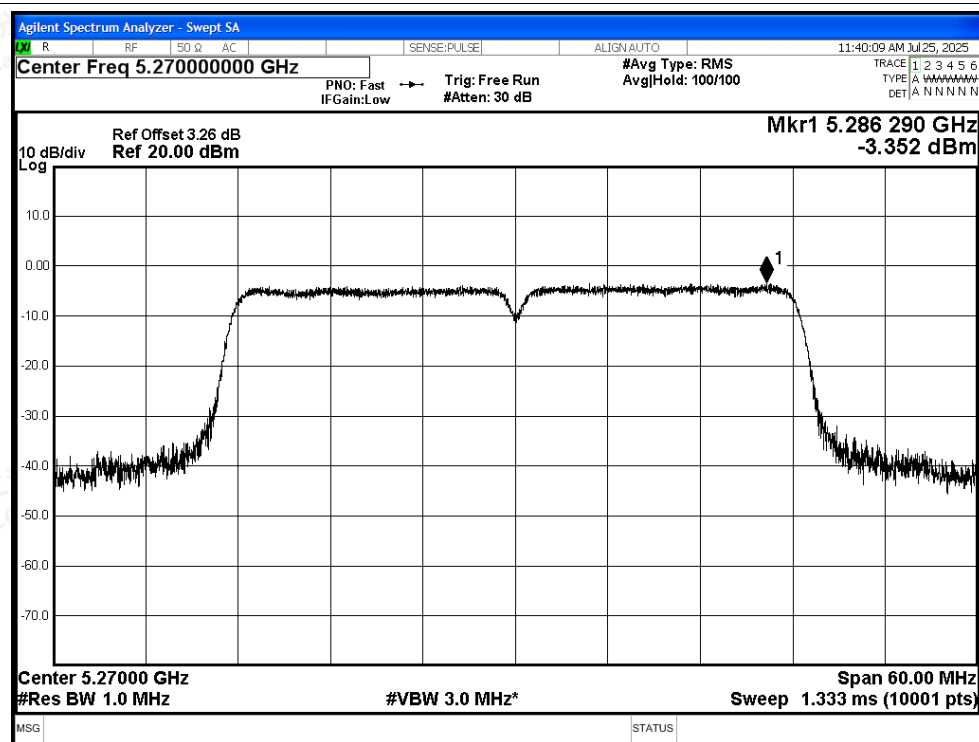

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5310MHz Ant2

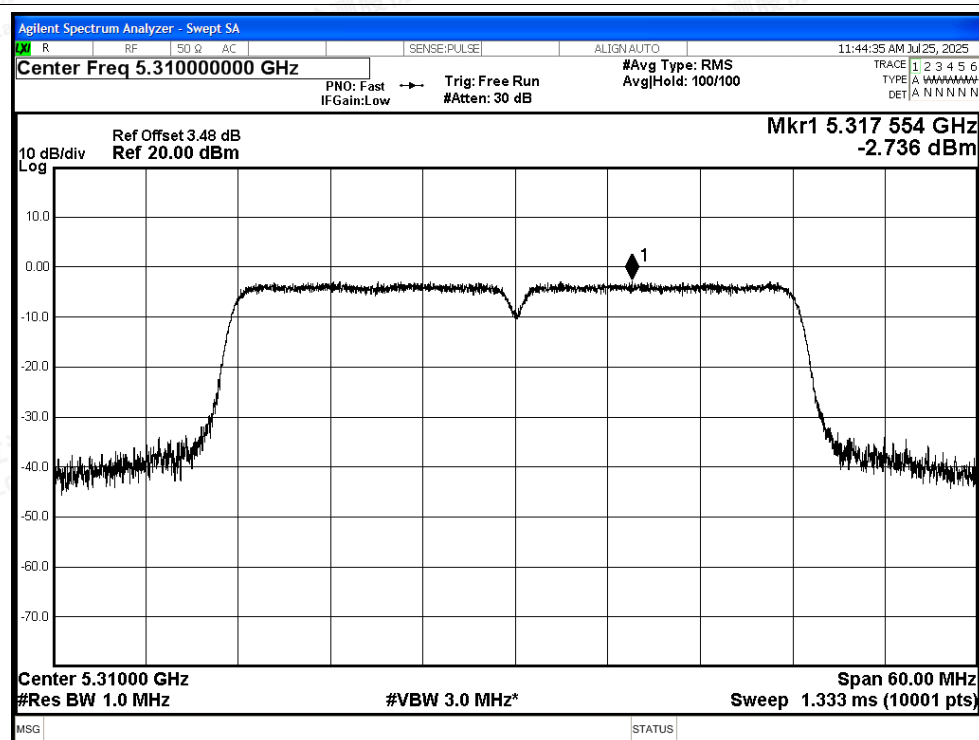

PSD NVNT ax80 5290MHz Ant2

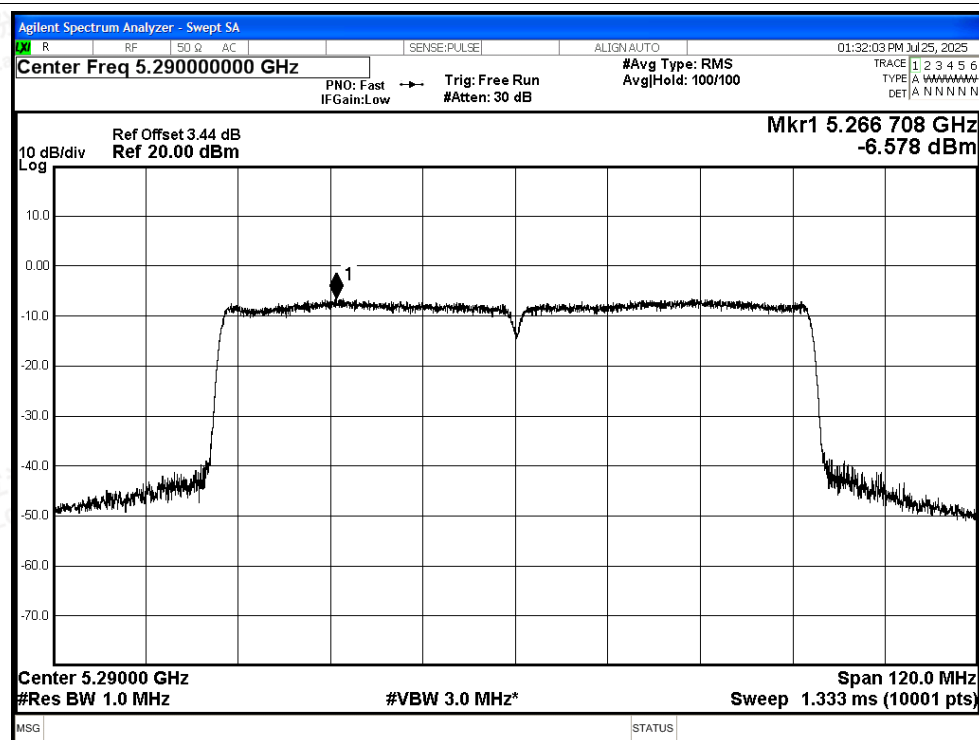

PSD NVNT be20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

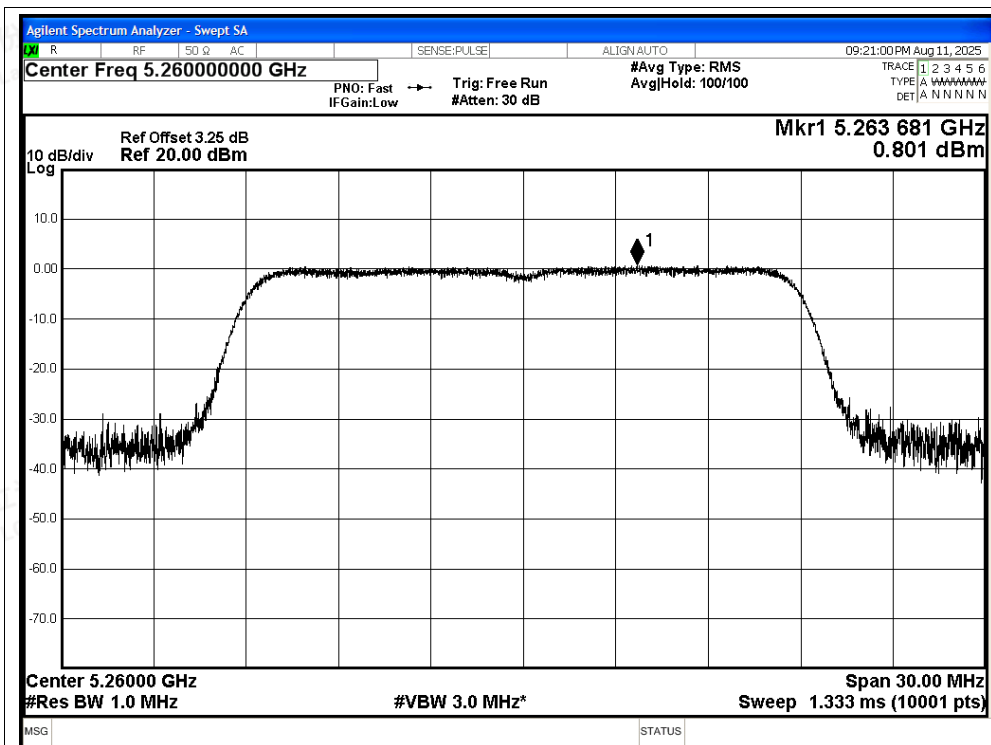

PSD NVNT be20 5300MHz Ant2

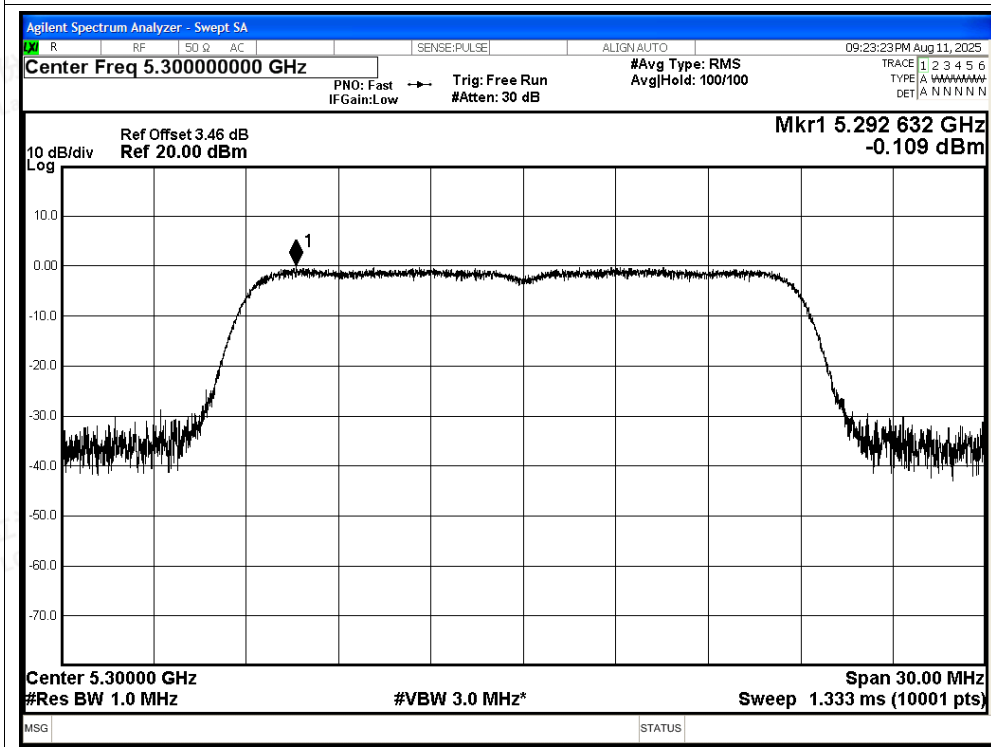

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5320MHz Ant2

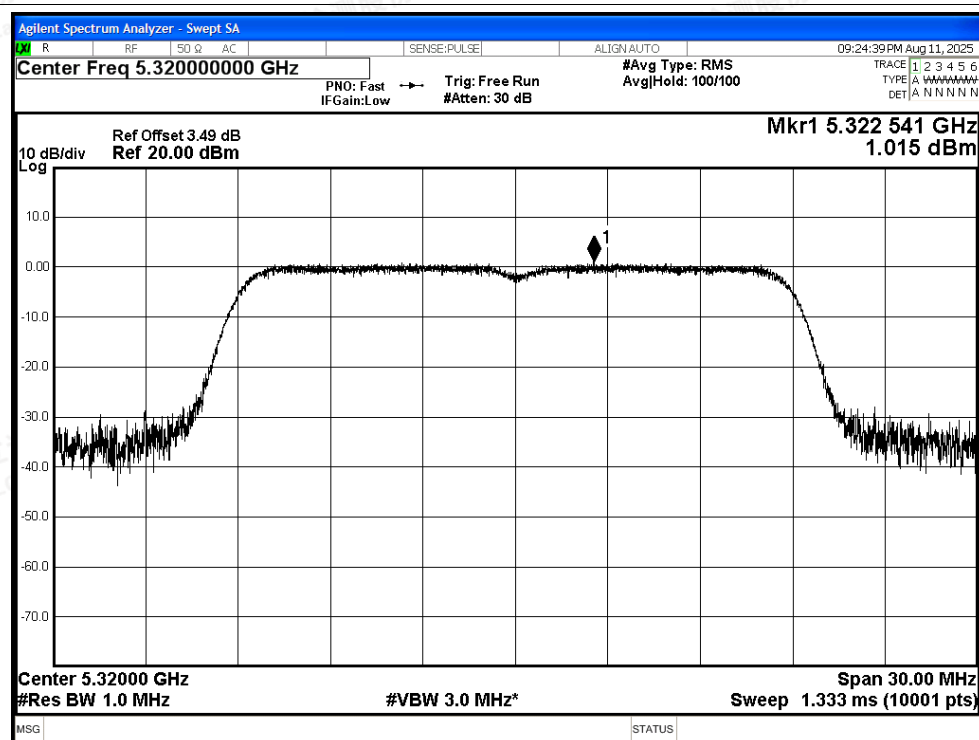

PSD NVNT be40 5270MHz Ant2

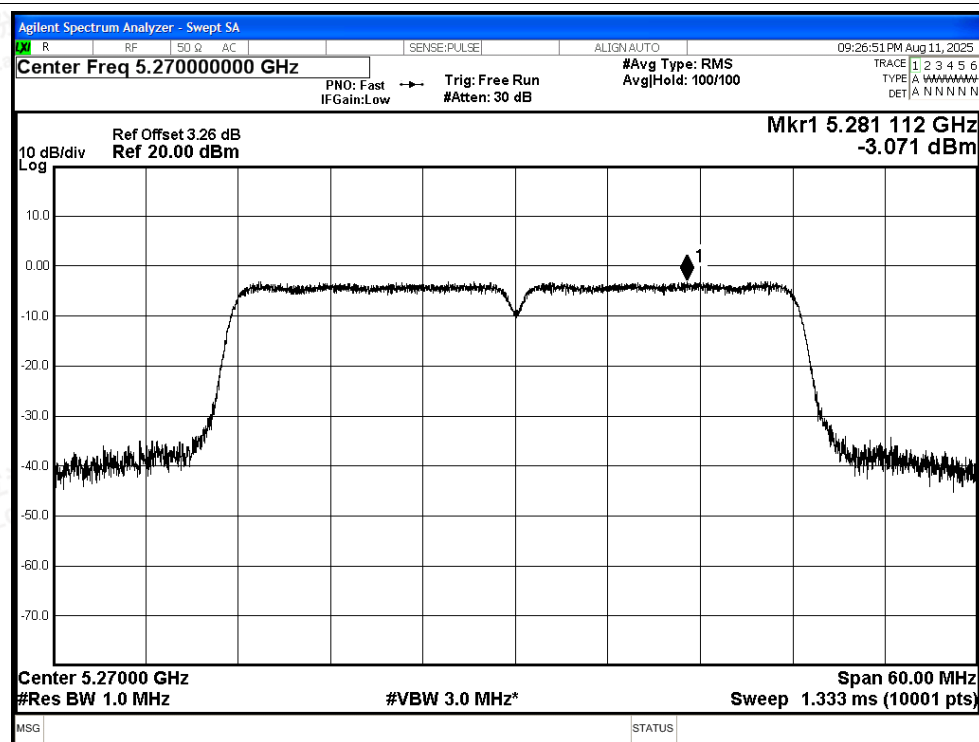

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5310MHz Ant2

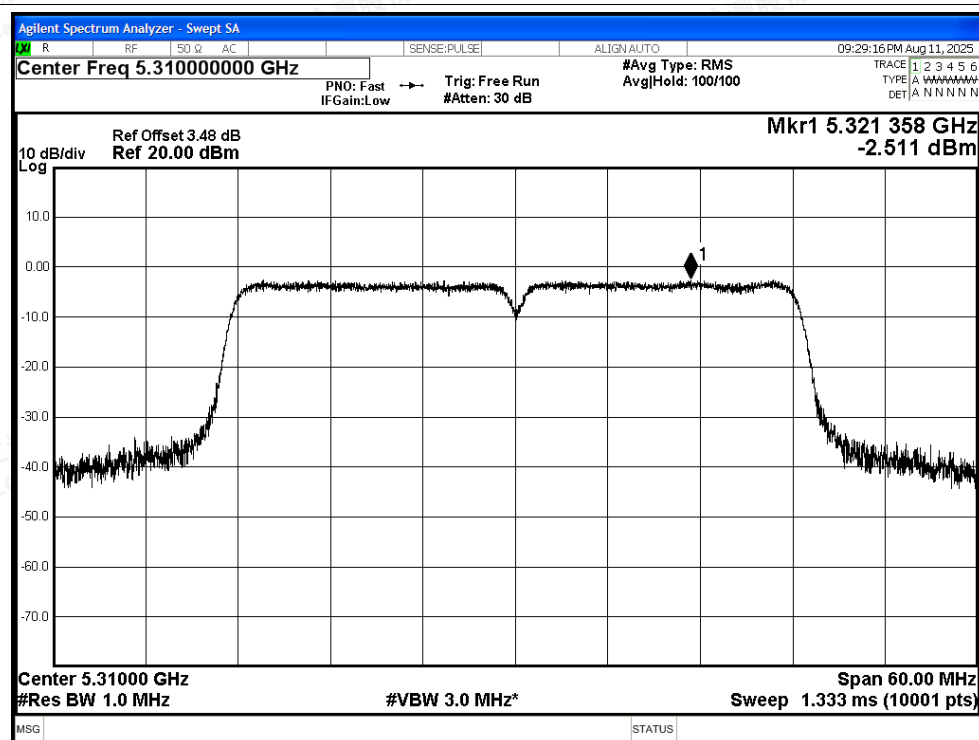

PSD NVNT be80 5290MHz Ant2

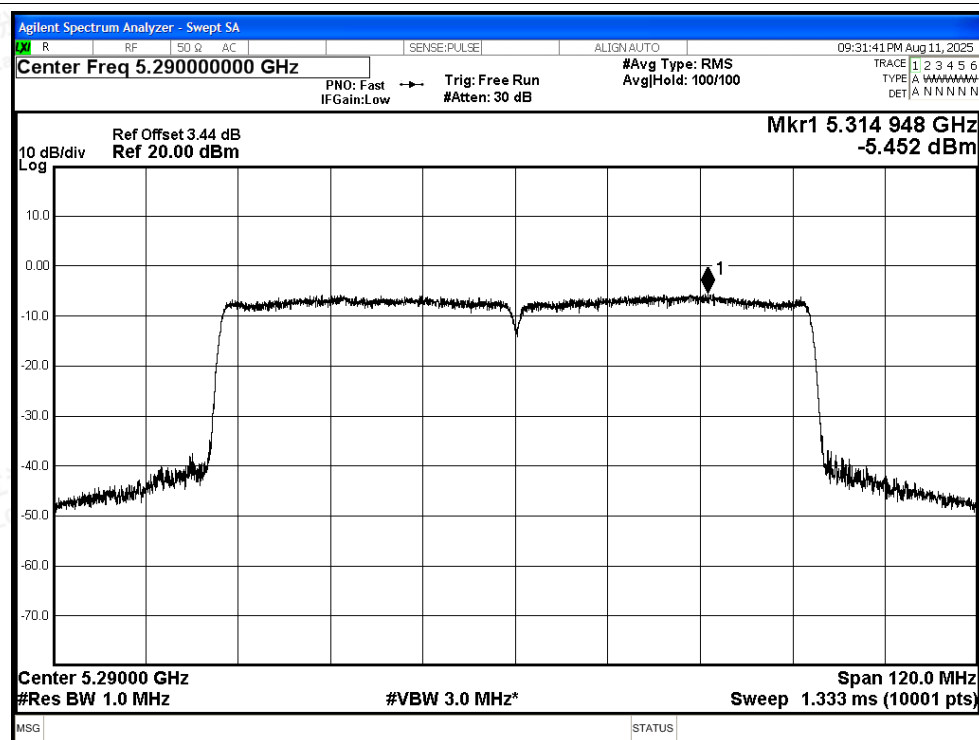

PSD NVNT ac160 5250MHz Ant2





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

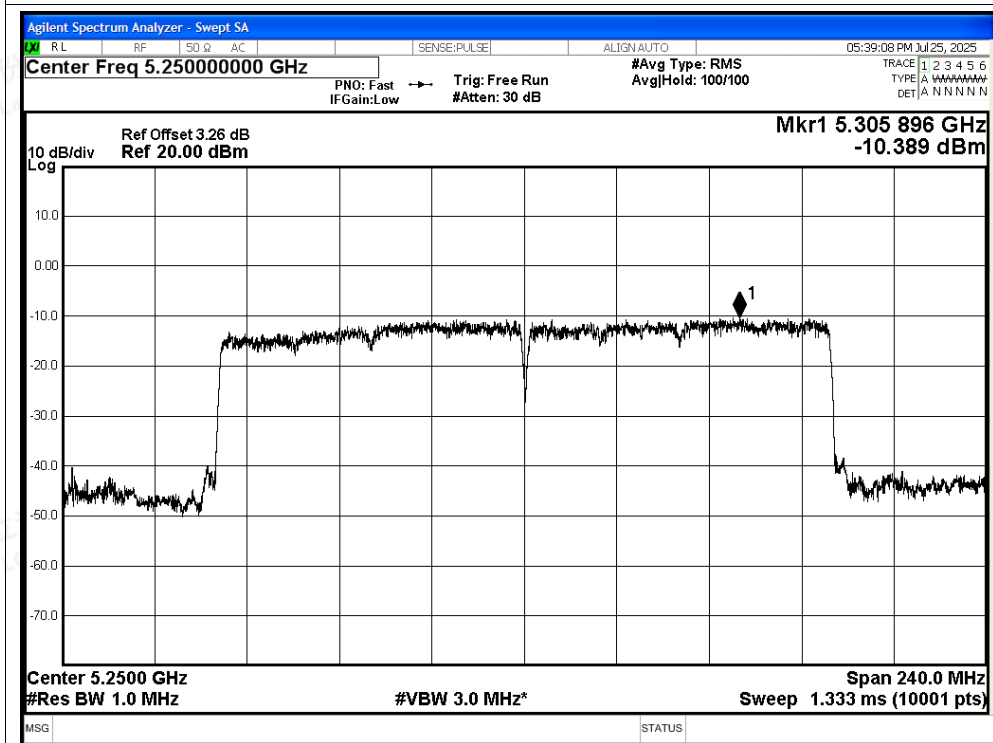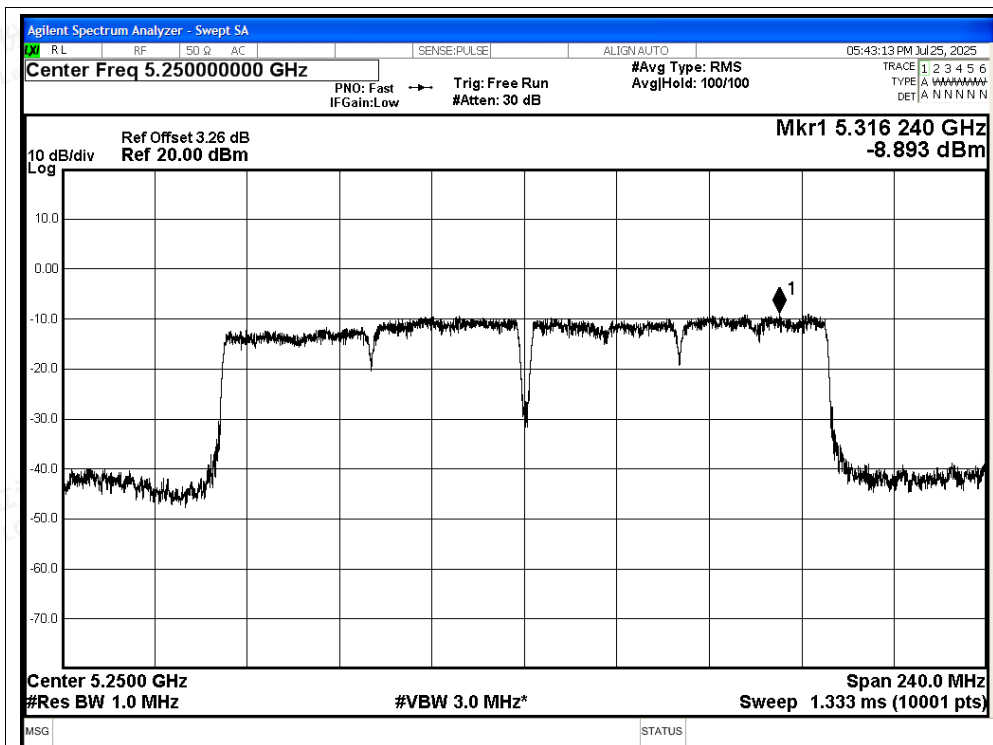


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

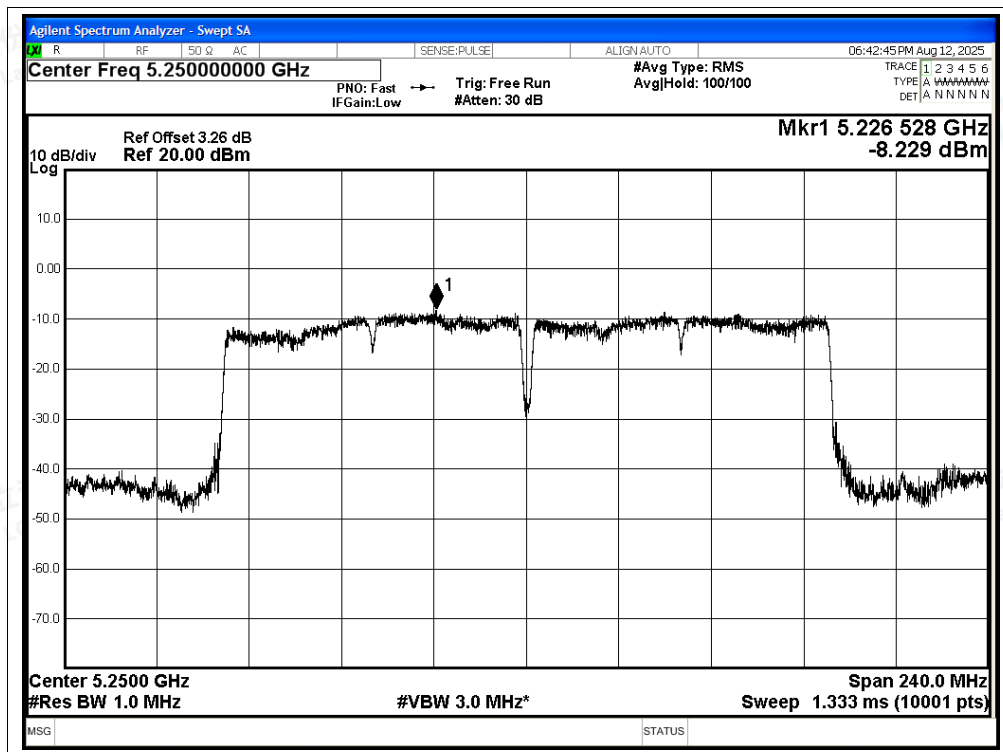




Test Graphs

PSD NVNT a 5260MHz Ant3

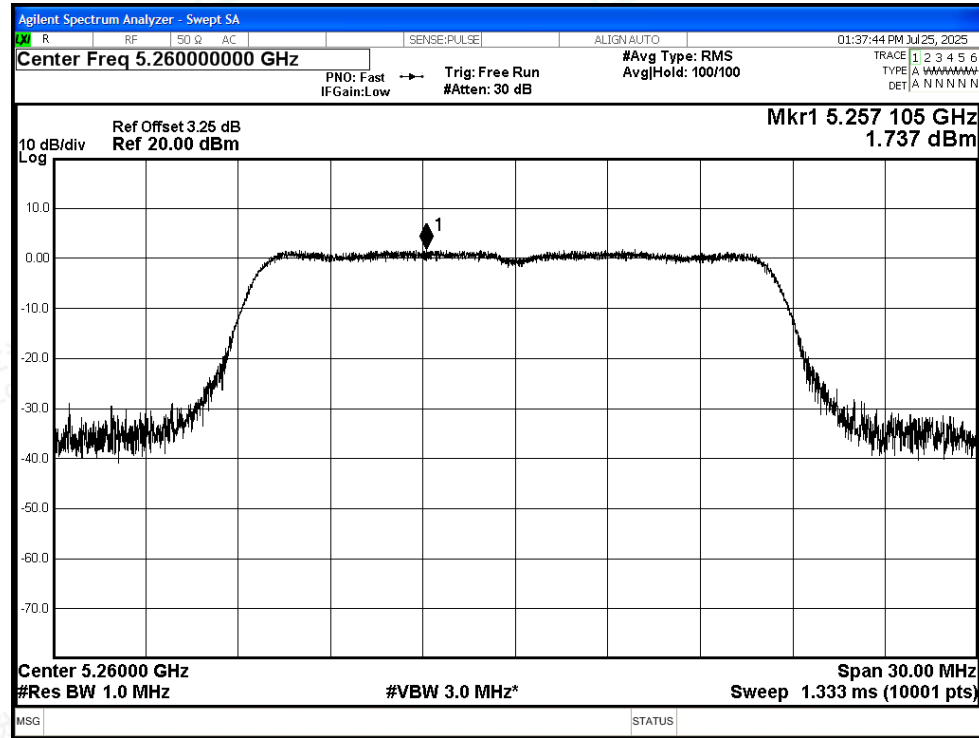

PSD NVNT a 5300MHz Ant3


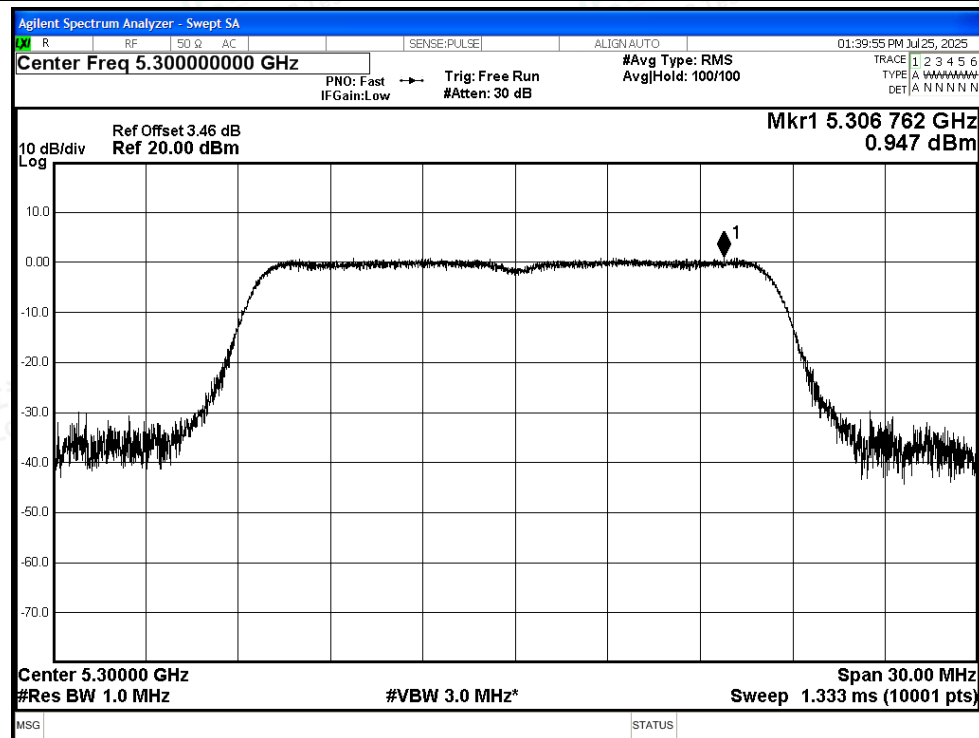


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

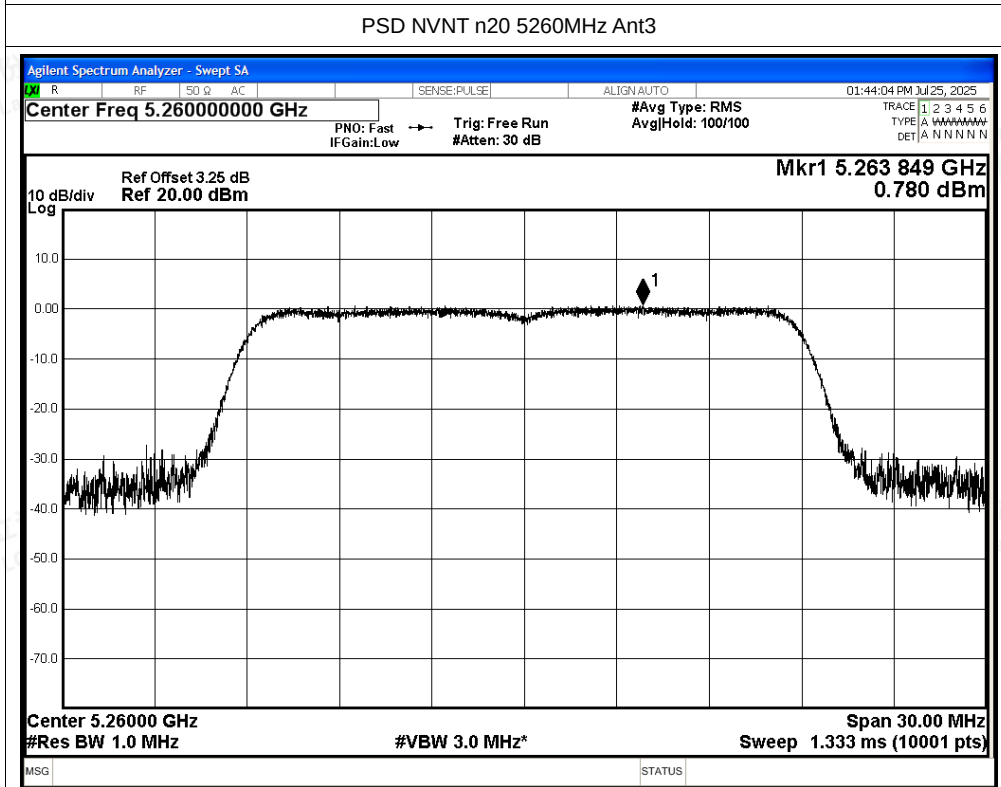
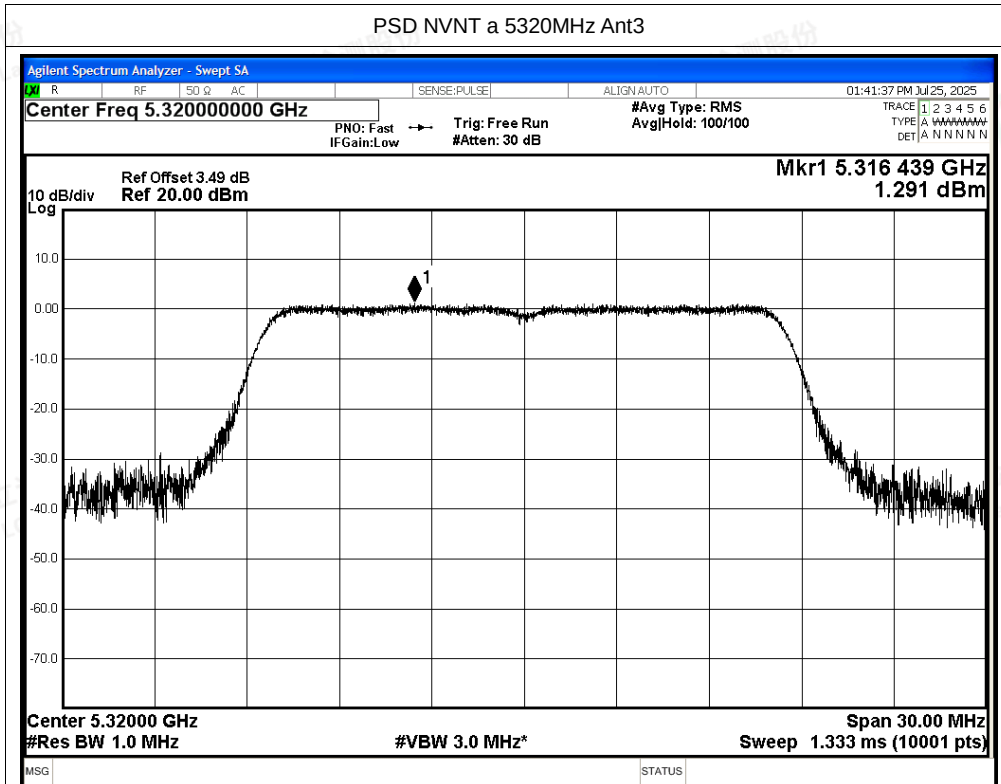




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

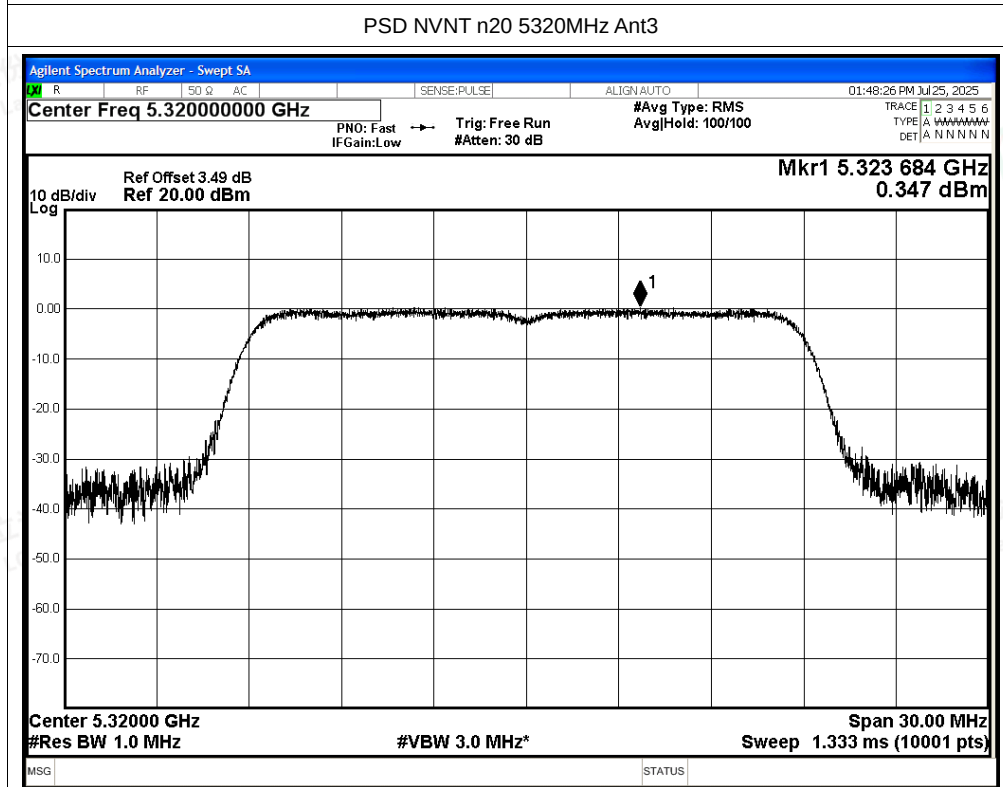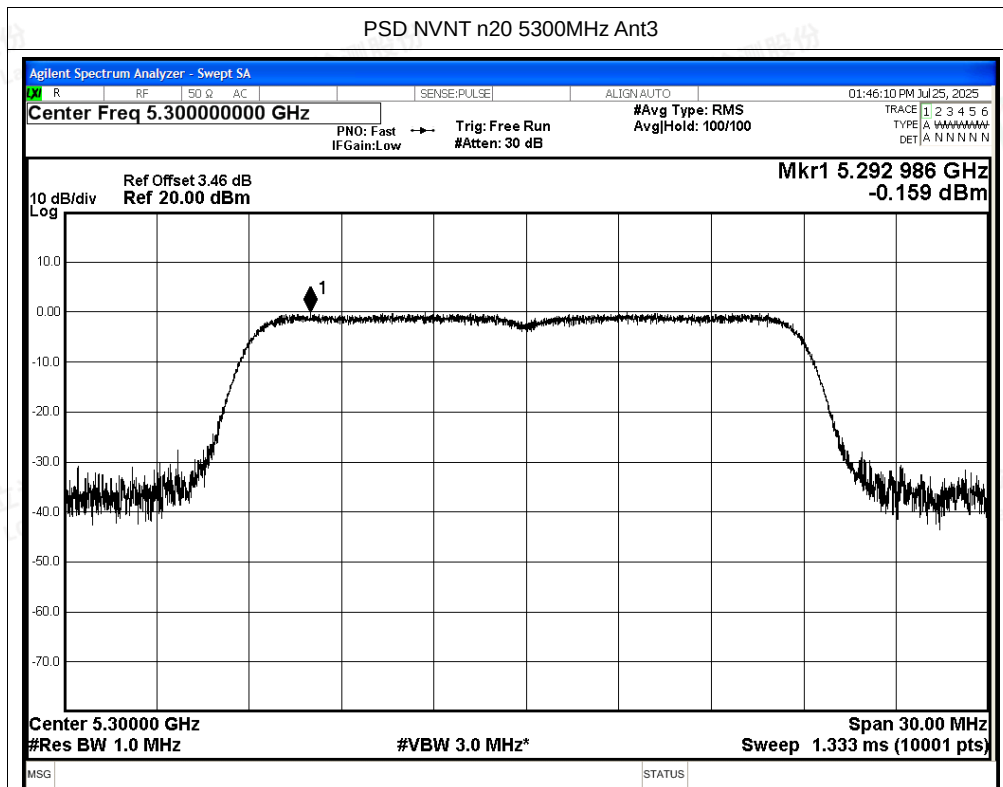

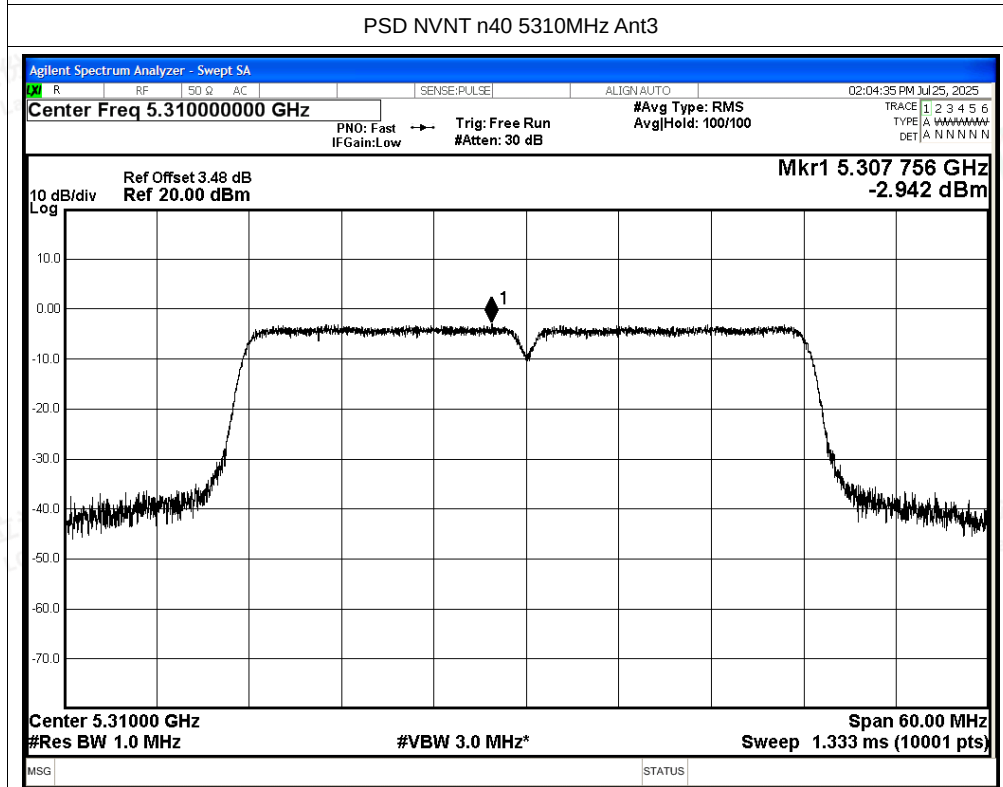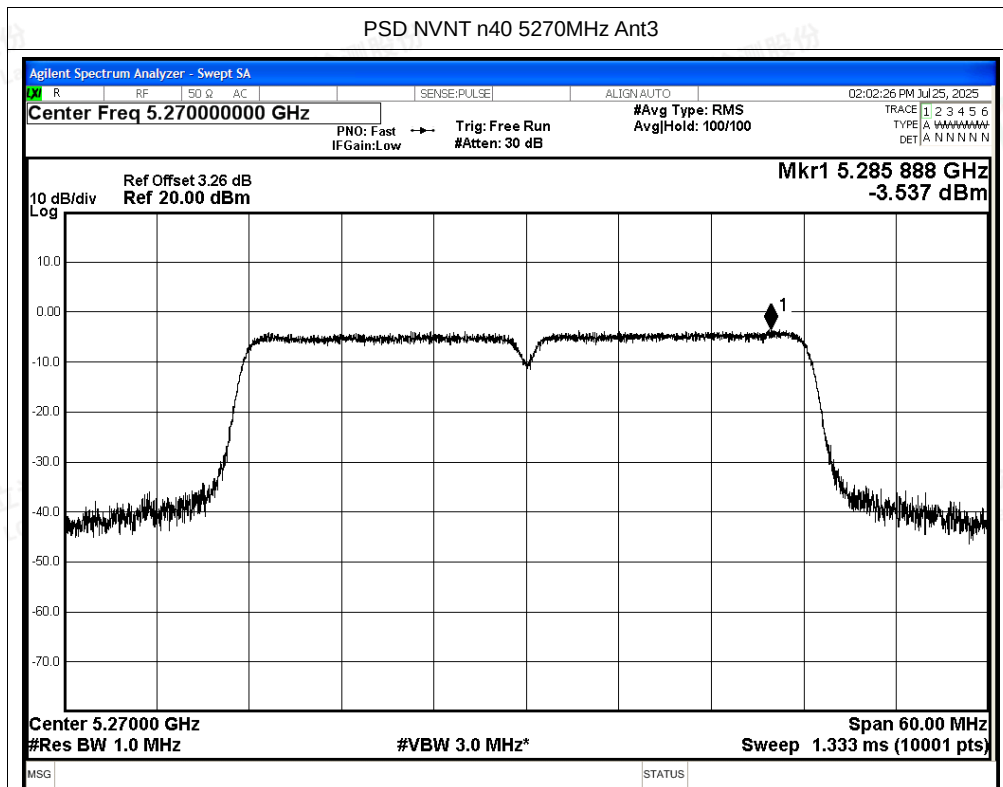

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5260MHz Ant3

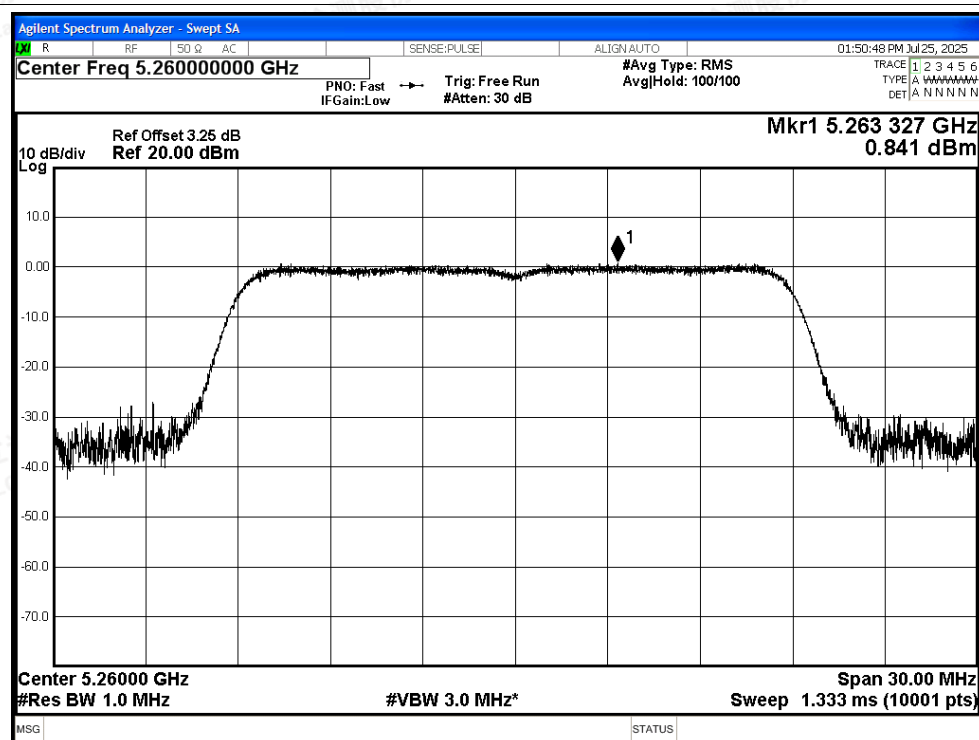

PSD NVNT ac20 5300MHz Ant3


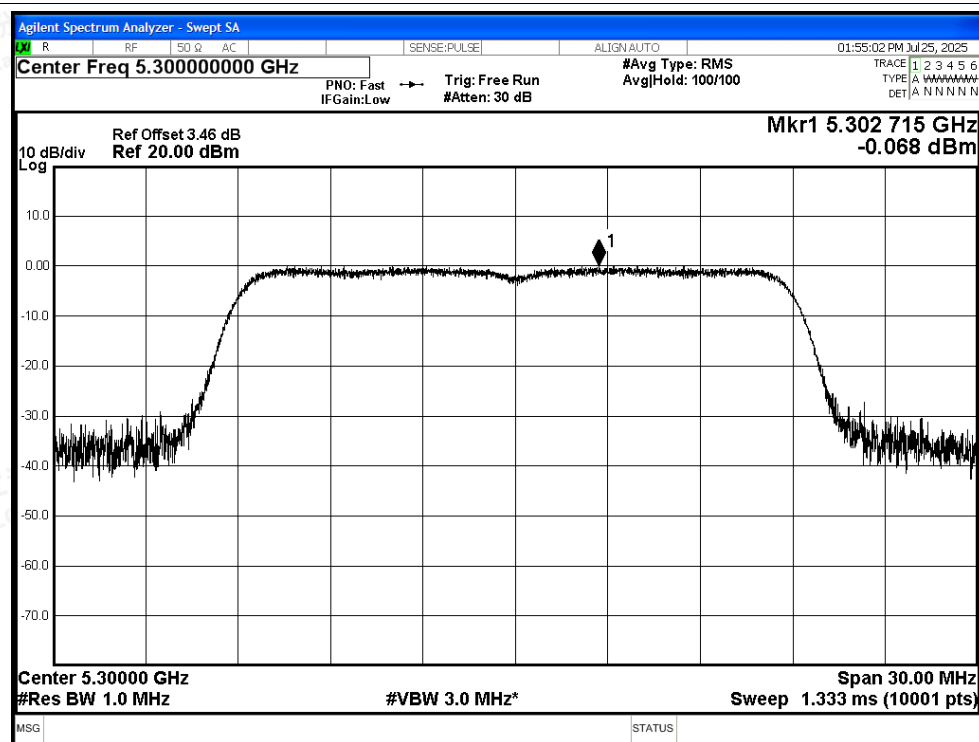


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

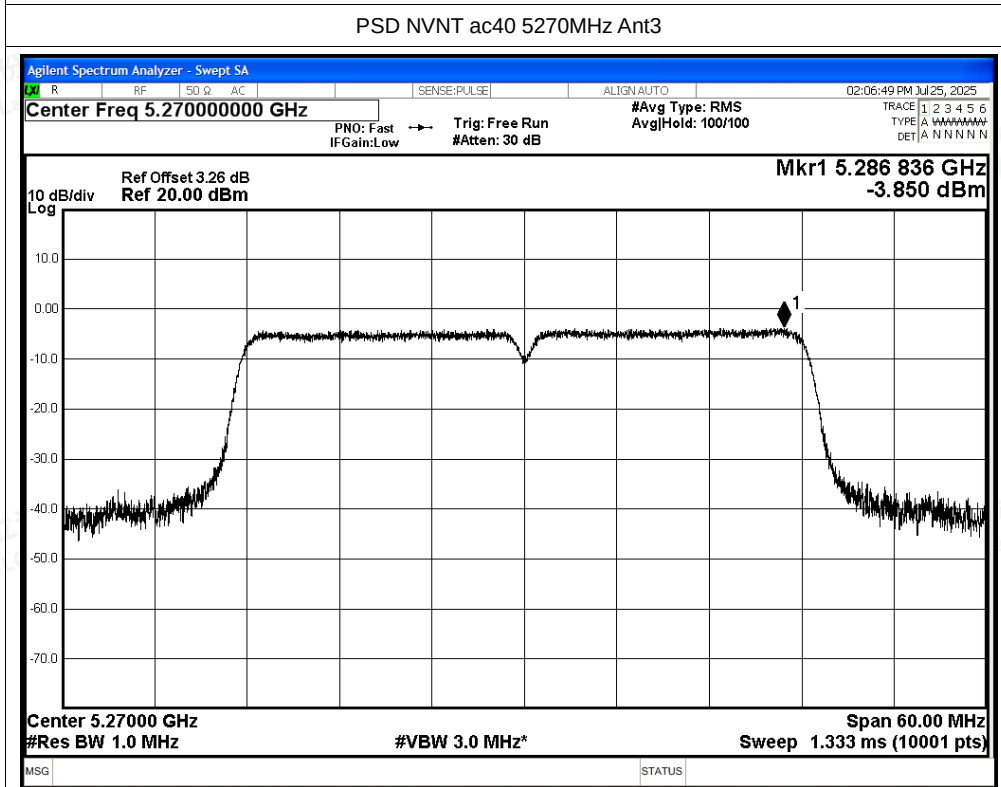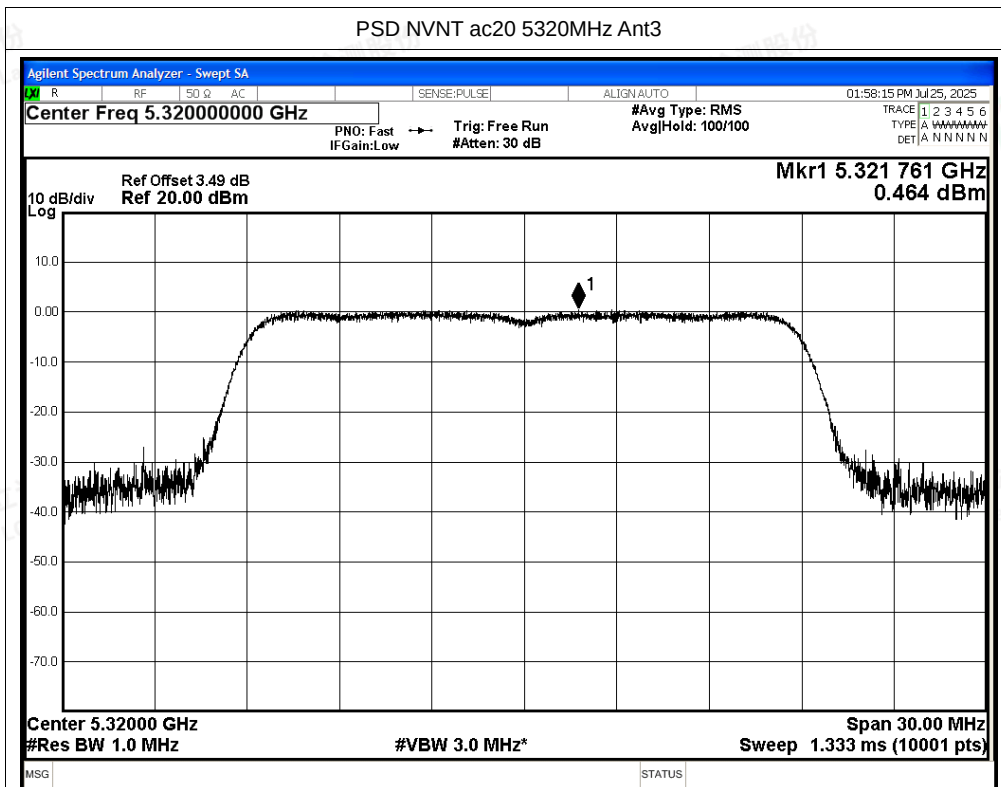




PSD NVNT ac40 5310MHz Ant3

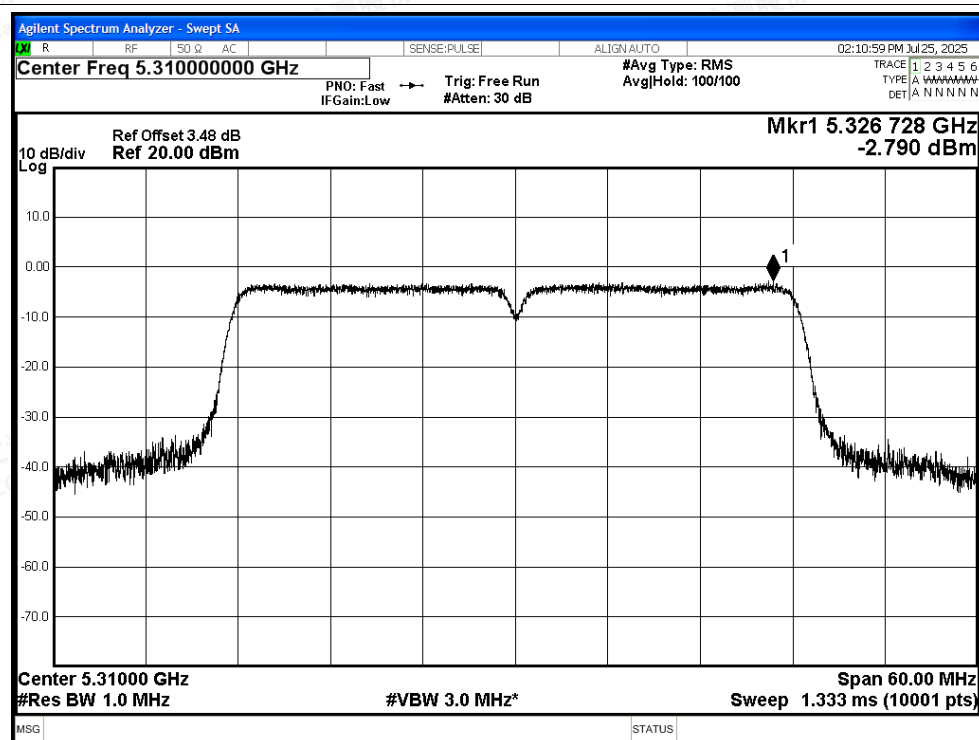

PSD NVNT ac80 5290MHz Ant3


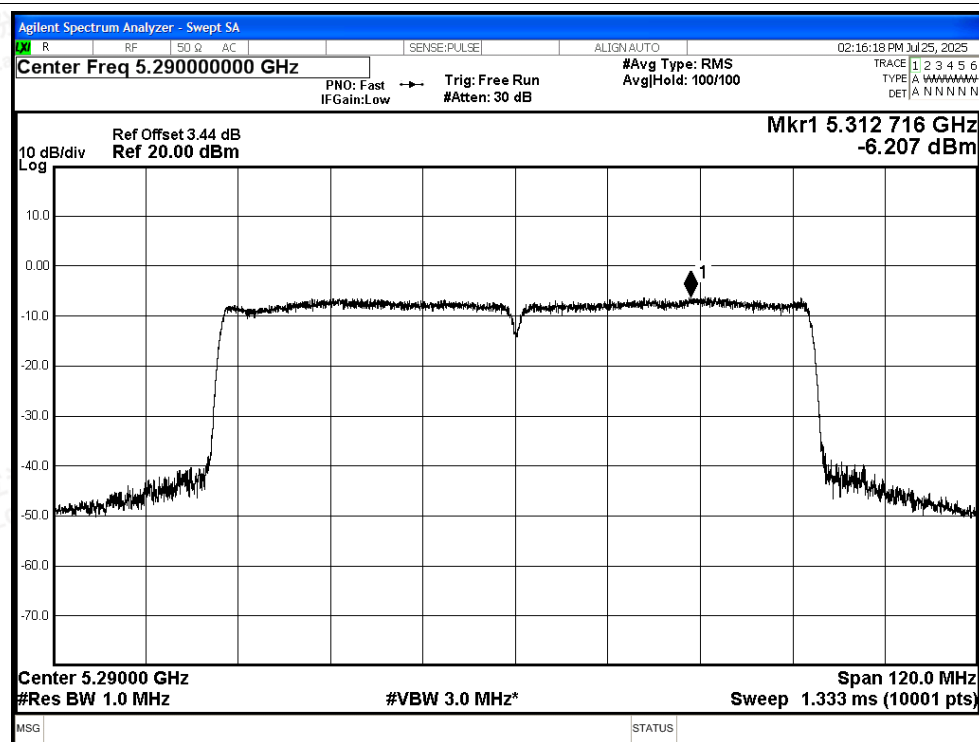




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

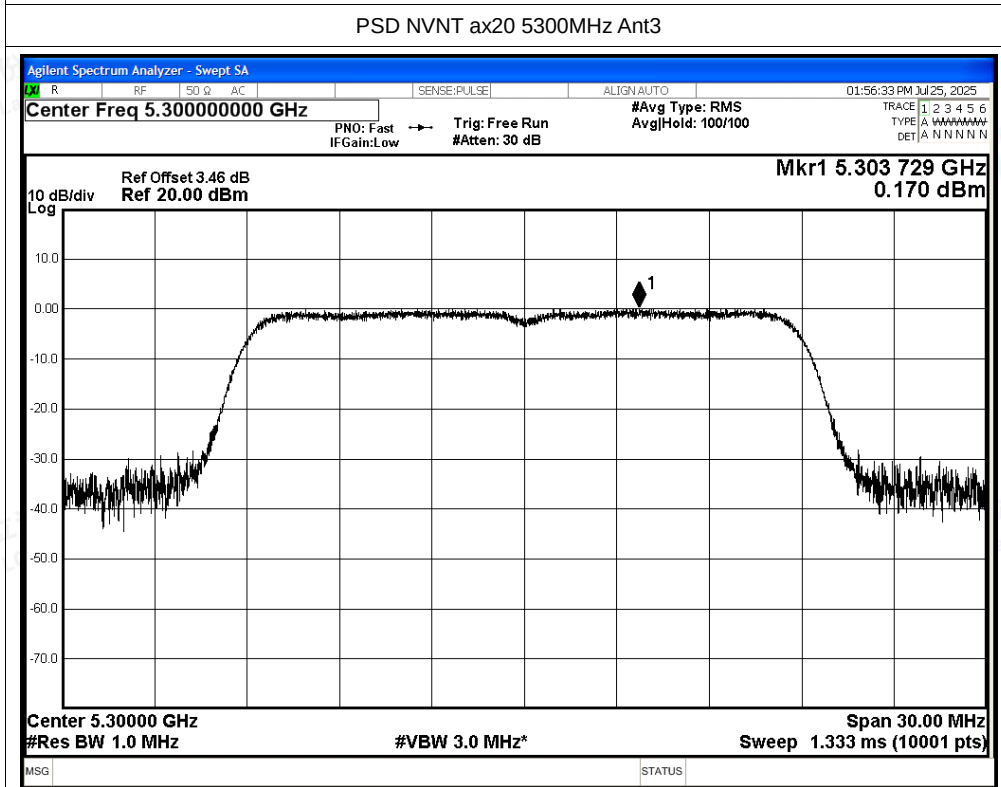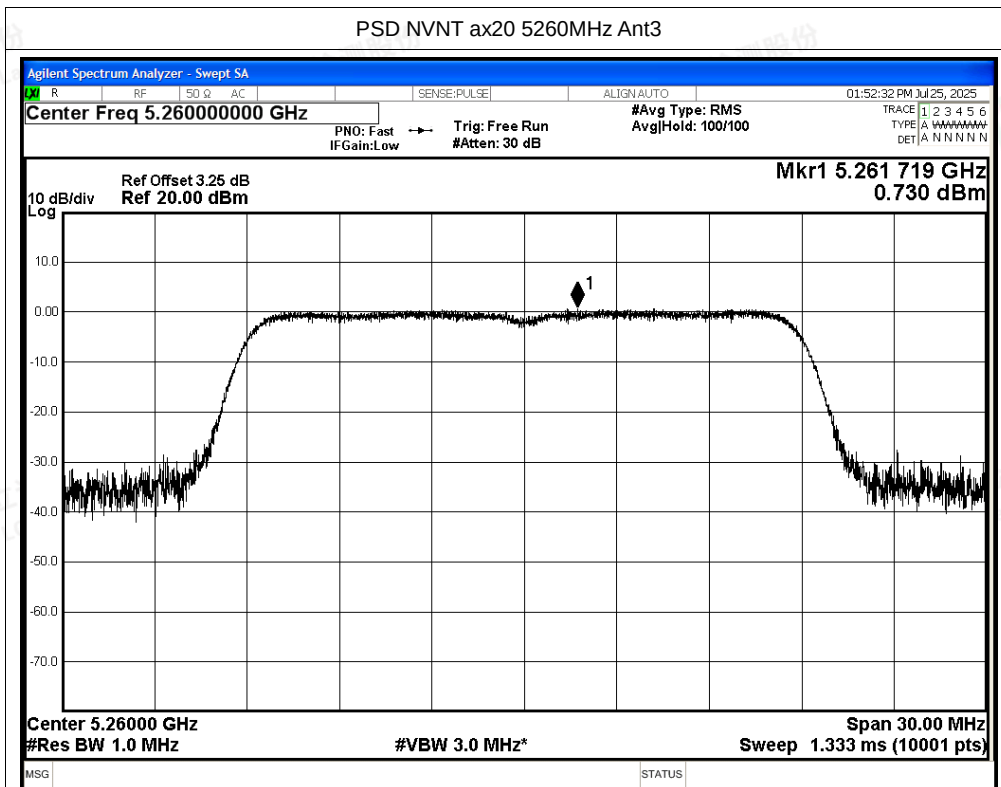

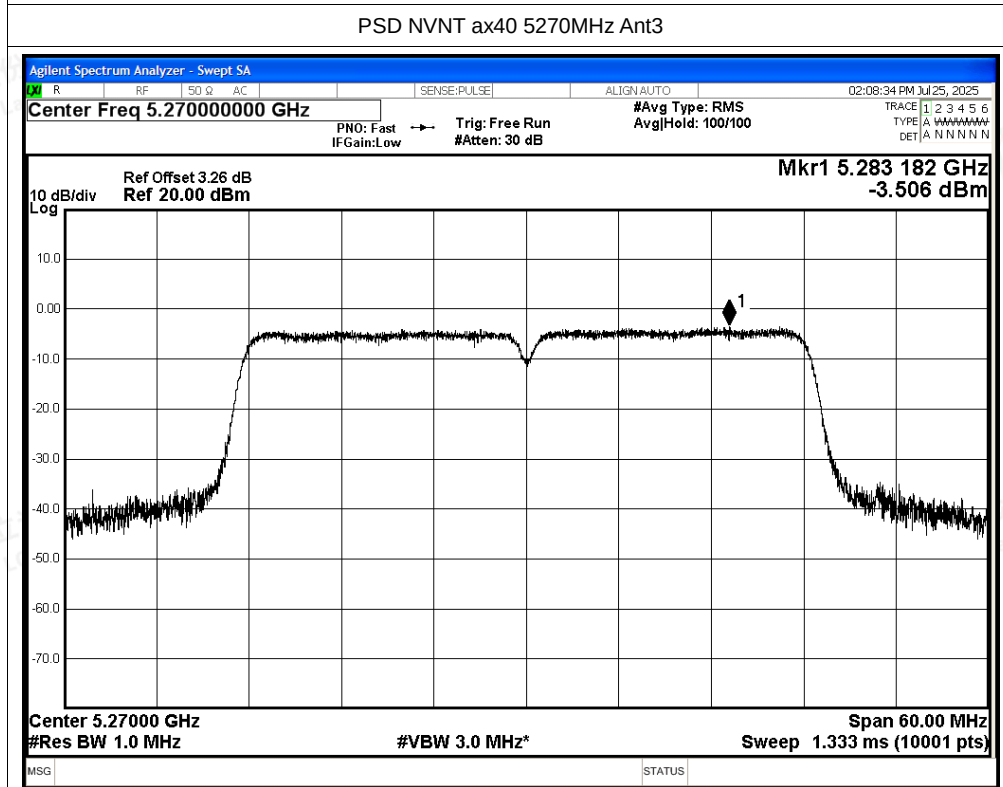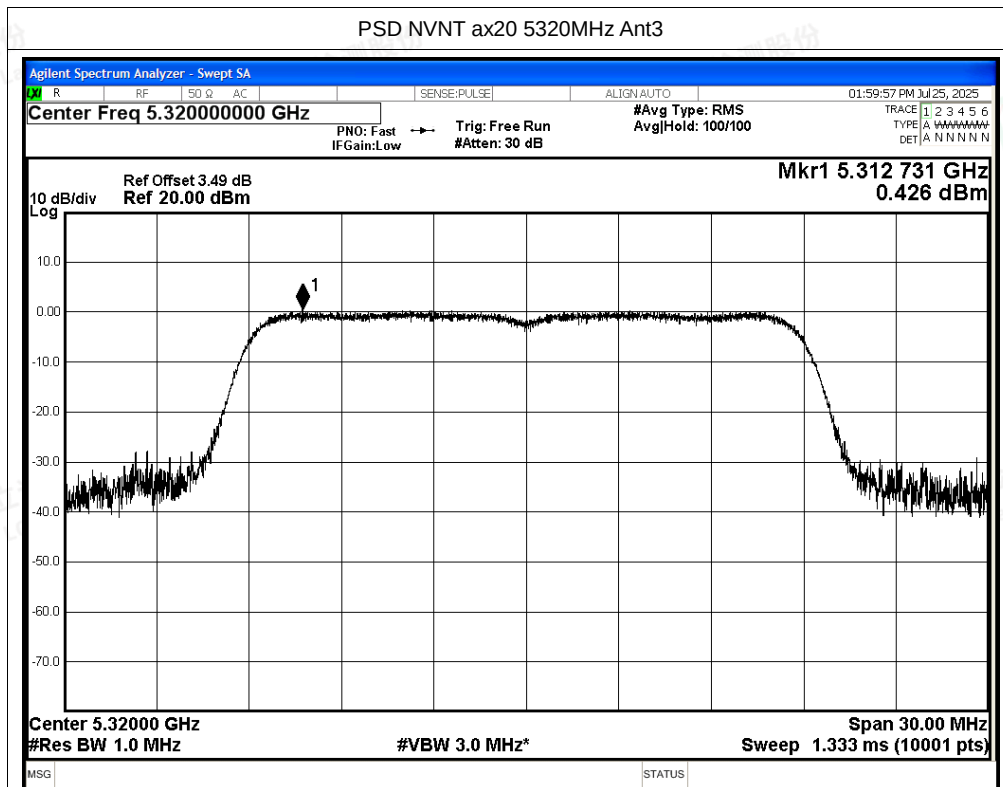

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5310MHz Ant3

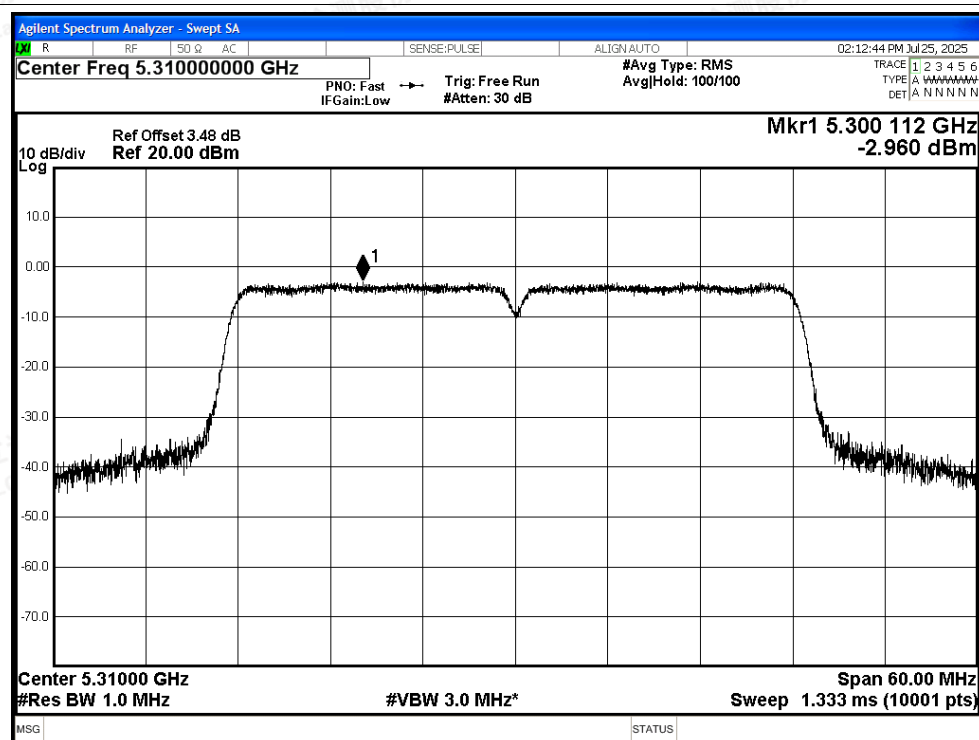

PSD NVNT ax80 5290MHz Ant3

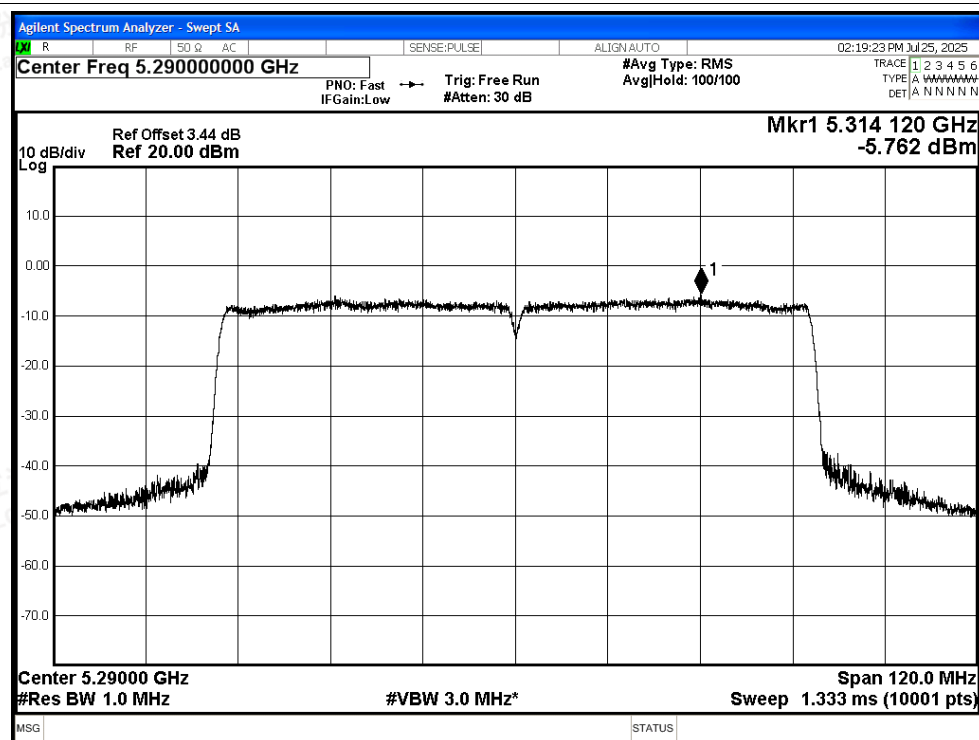

PSD NVNT be20 5260MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

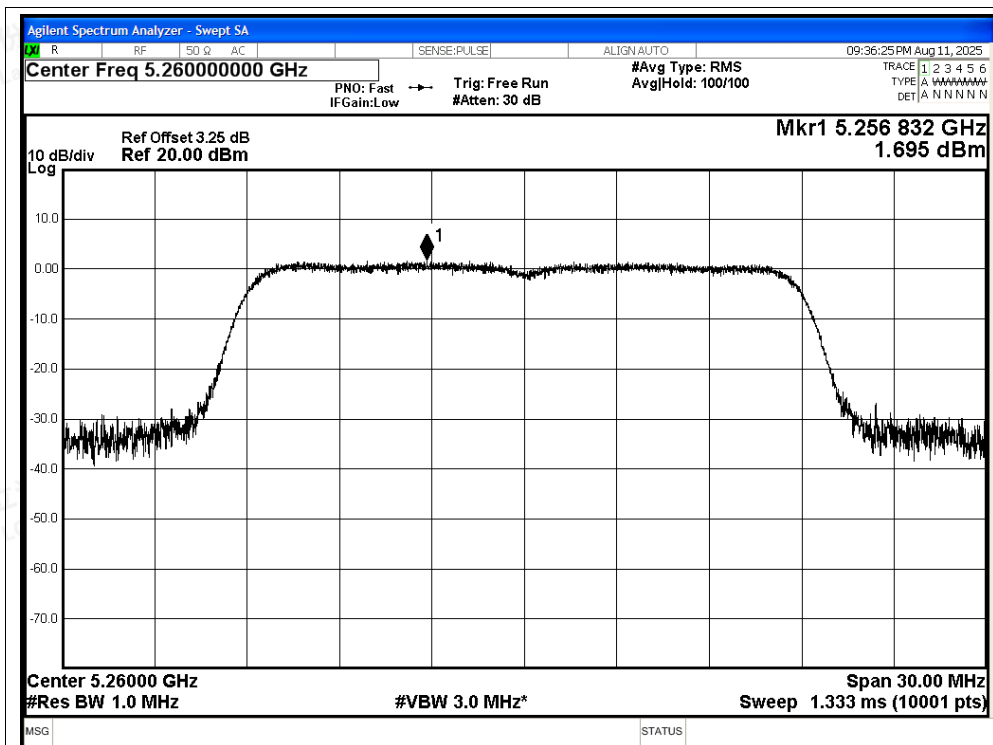

PSD NVNT be20 5300MHz Ant3

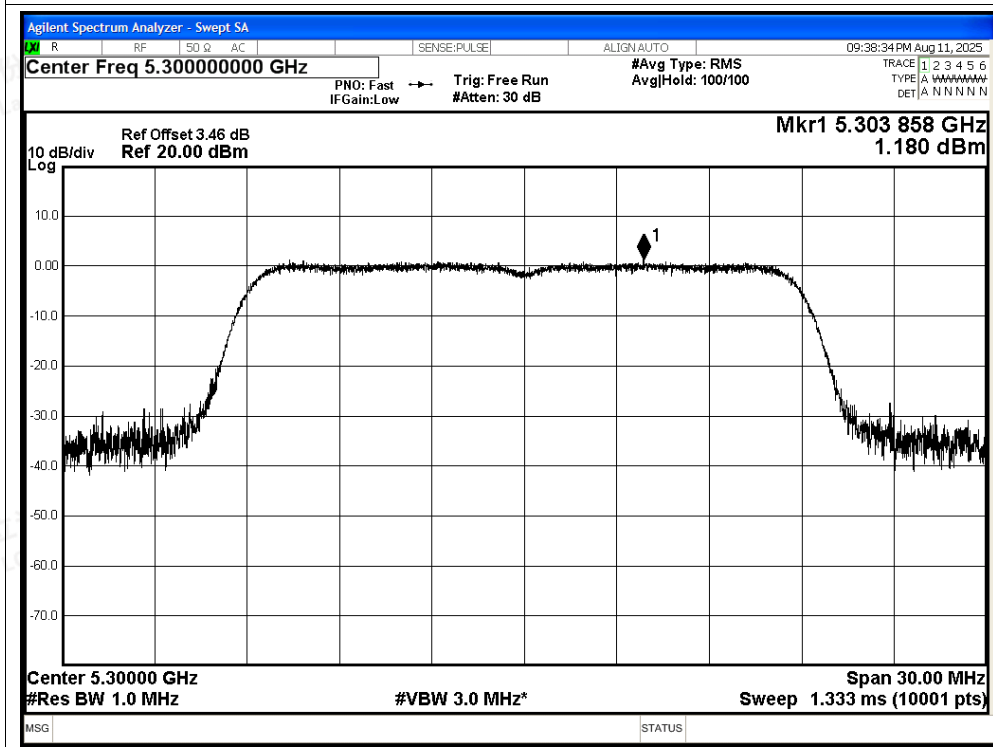

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5320MHz Ant3

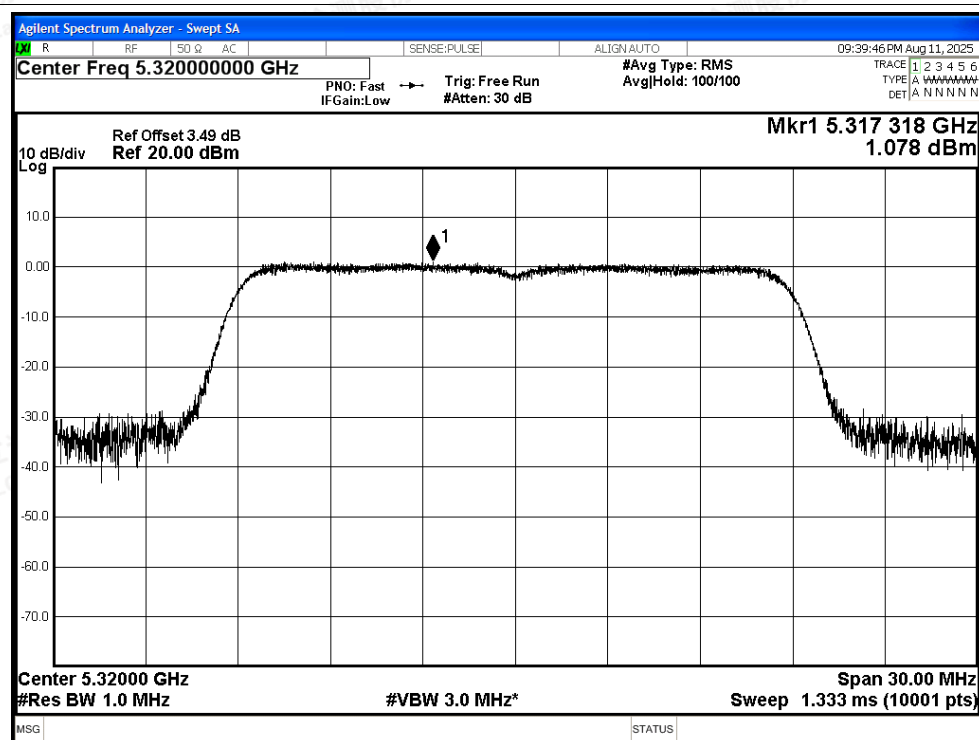

PSD NVNT be40 5270MHz Ant3

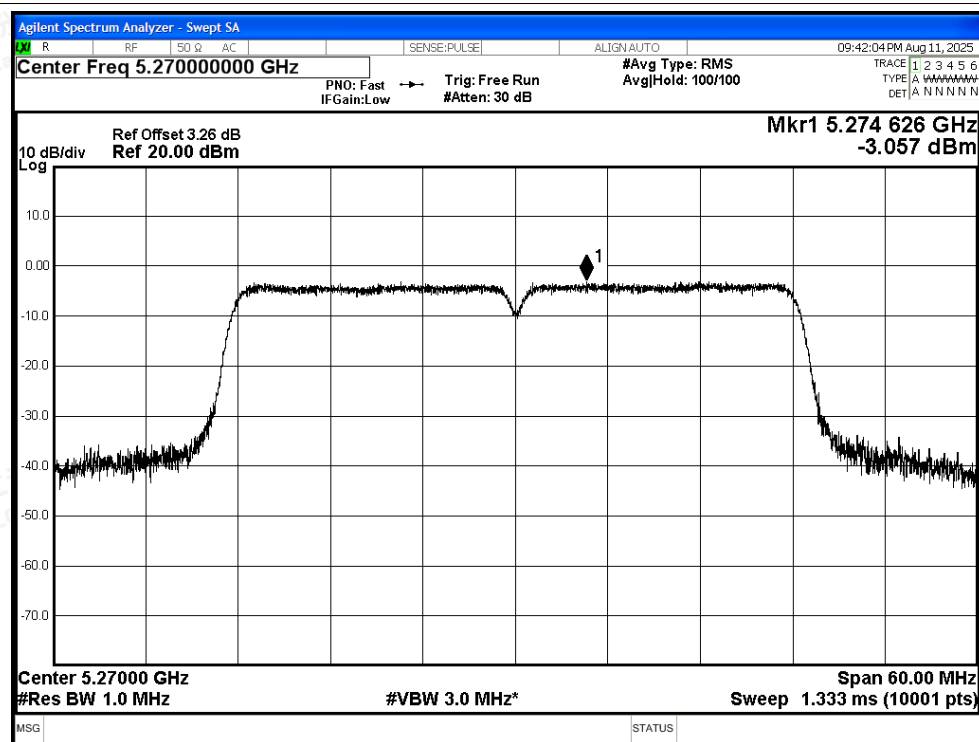

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5310MHz Ant3

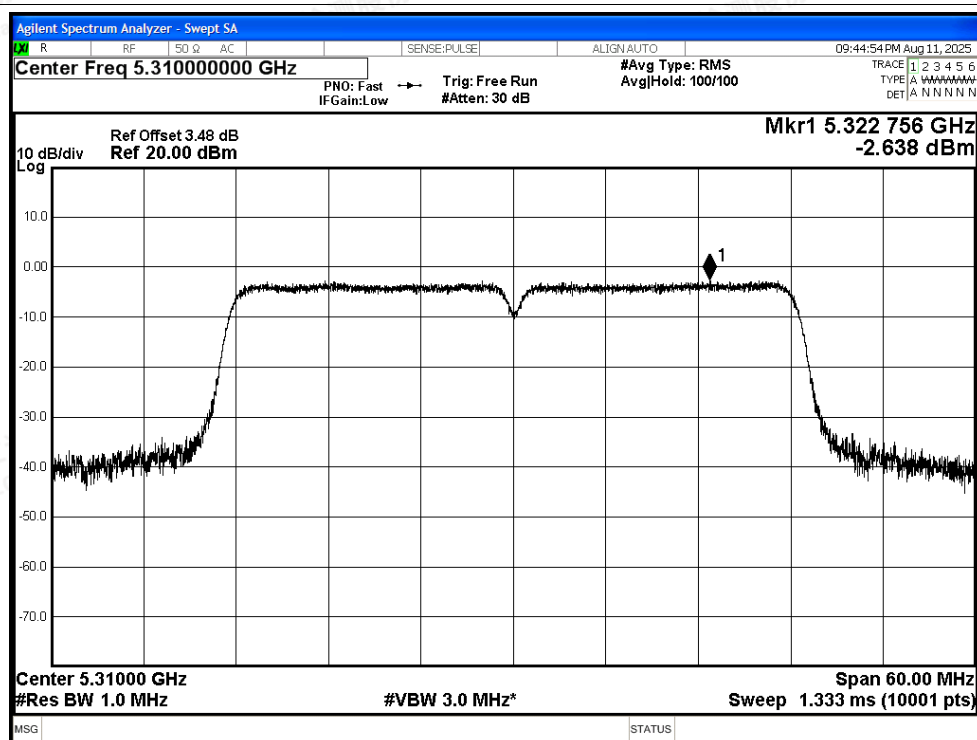

PSD NVNT be80 5290MHz Ant3

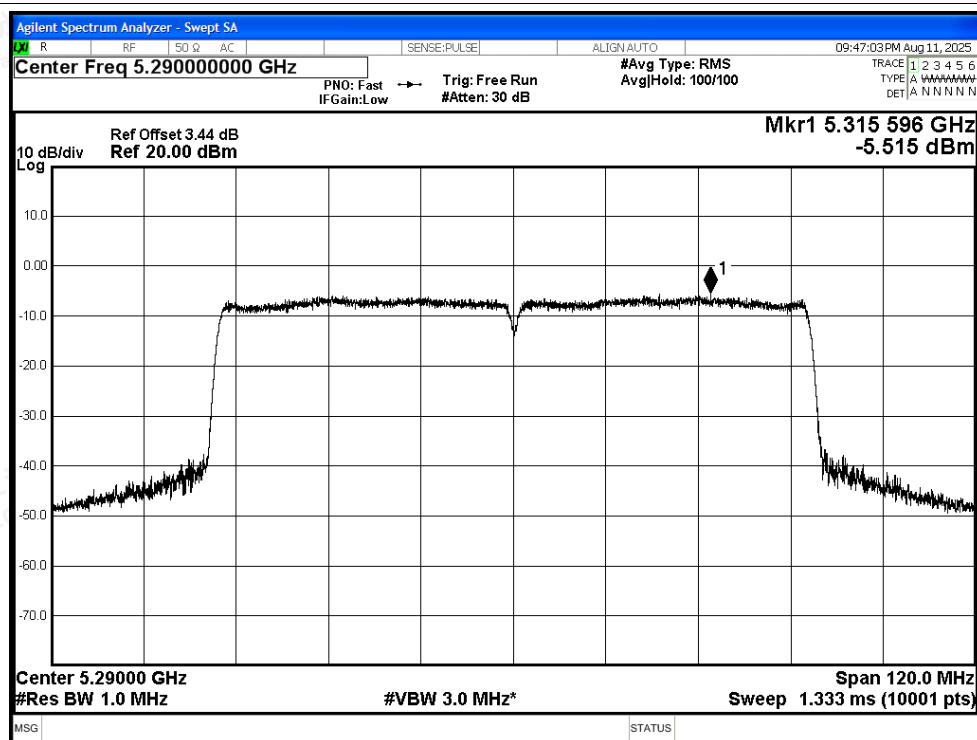

PSD NVNT ac160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

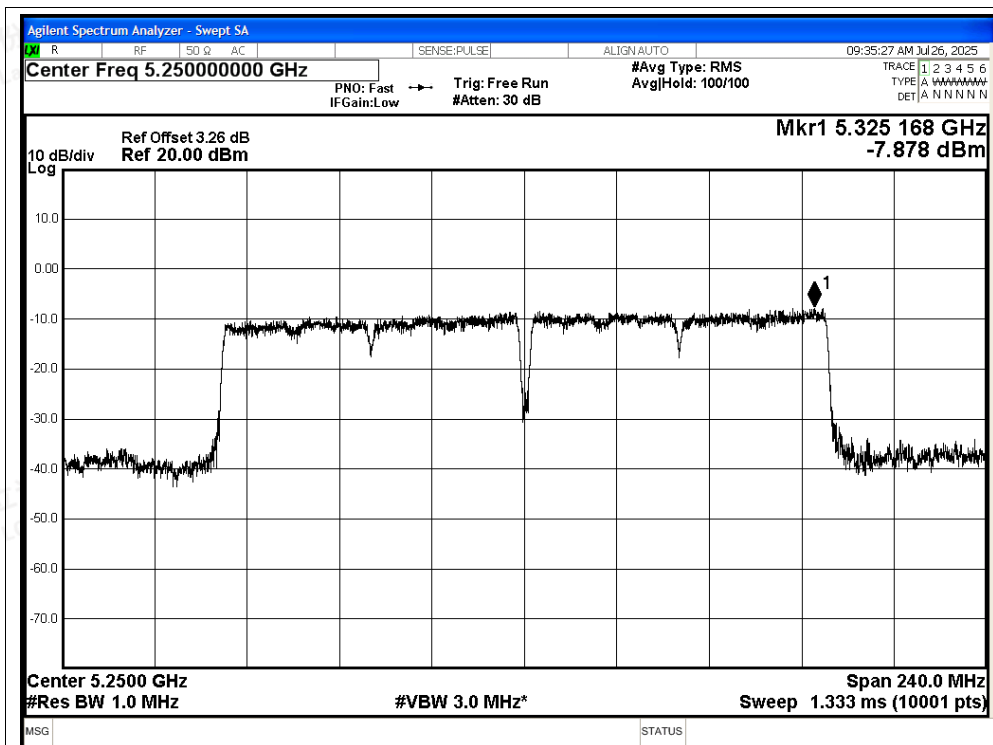

PSD NVNT ax160 5250MHz Ant3

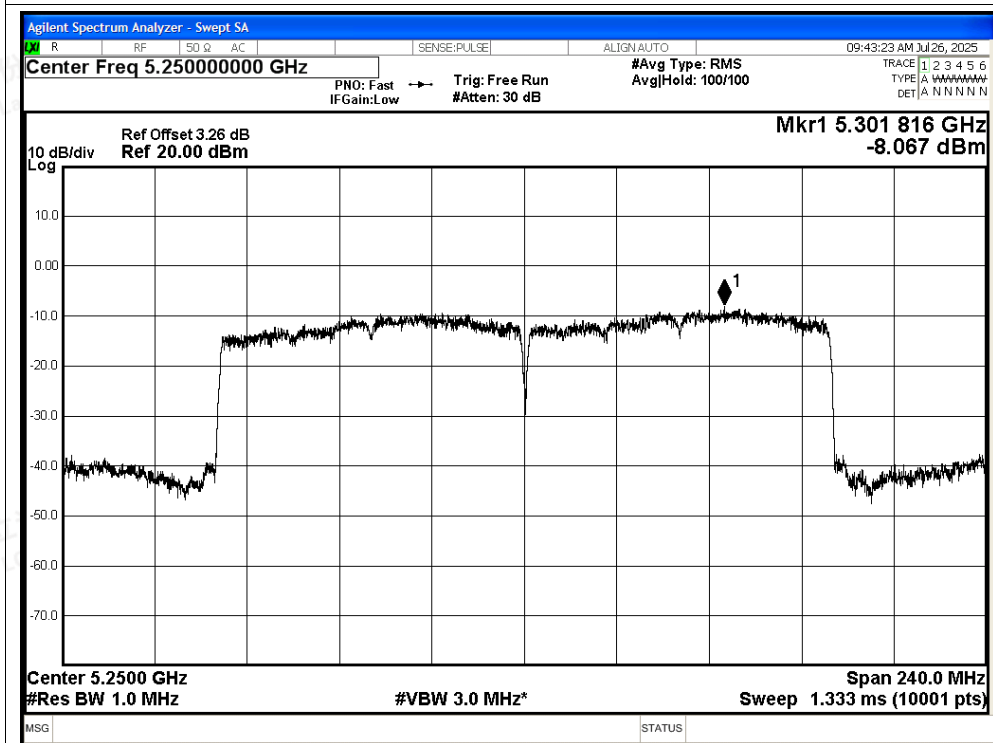

PSD NVNT be160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

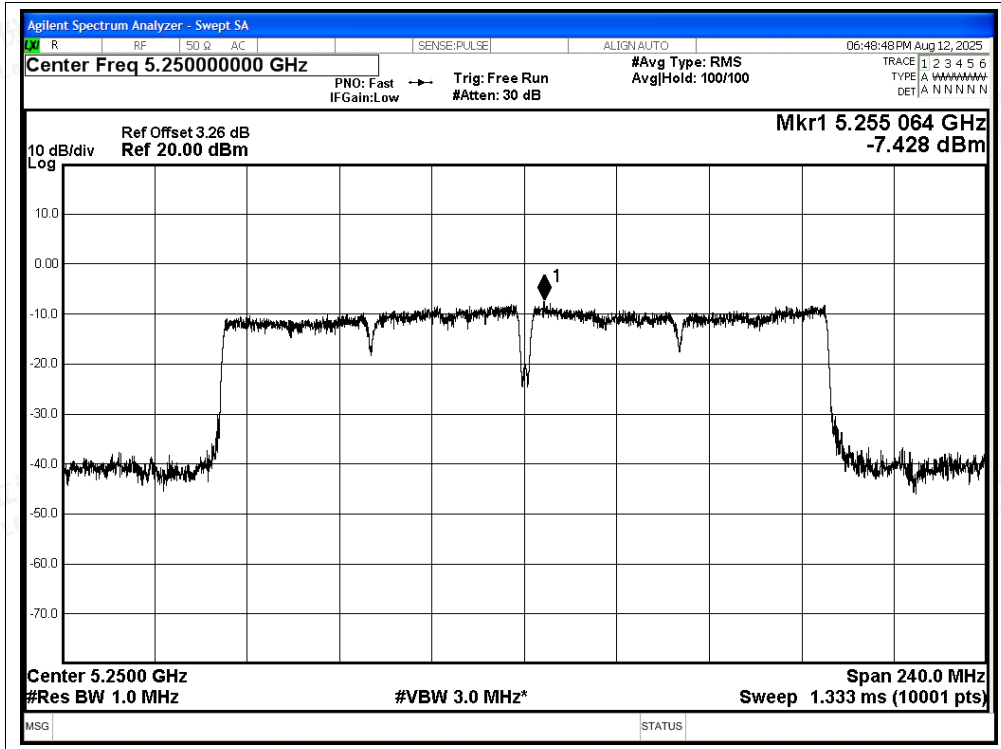

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant1	4500	-50.78	4.15	-	48.60	Peak	68.2	Pass
NVNT	a	5260	Ant1	4500	-58.76	4.15	0.24	40.86	Average	54	Pass
NVNT	a	5260	Ant1	5024.16	-45.59	4.15	-	53.79	Peak	68.2	Pass
NVNT	a	5260	Ant1	5092.02	-56.3	4.15	0.24	43.32	Average	54	Pass
NVNT	a	5260	Ant1	5150	-49.34	4.15	-	50.04	Peak	68.2	Pass
NVNT	a	5260	Ant1	5150	-57.33	4.15	0.24	42.29	Average	54	Pass
NVNT	a	5320	Ant1	5350	-47.74	4.15	-	51.64	Peak	68.2	Pass
NVNT	a	5320	Ant1	5350	-56.67	4.15	0.24	42.95	Average	54	Pass
NVNT	a	5320	Ant1	5410.6	-45.53	4.15	-	53.85	Peak	68.2	Pass
NVNT	a	5320	Ant1	5368.4	-56.17	4.15	0.24	43.45	Average	54	Pass
NVNT	a	5320	Ant1	5460	-50.11	4.15	-	49.27	Peak	68.2	Pass
NVNT	a	5320	Ant1	5460	-57.43	4.15	0.24	42.19	Average	54	Pass
NVNT	n20	5260	Ant1	4500	-50.2	4.15	-	49.18	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4500	-58.97	4.15	0.12	40.53	Average	54	Pass
NVNT	n20	5260	Ant1	5085.78	-45.28	4.15	-	54.10	Peak	68.2	Pass
NVNT	n20	5260	Ant1	5064.72	-56.46	4.15	0.12	43.04	Average	54	Pass
NVNT	n20	5260	Ant1	5150	-49.72	4.15	-	49.66	Peak	68.2	Pass
NVNT	n20	5260	Ant1	5150	-56.93	4.15	0.12	42.57	Average	54	Pass
NVNT	n20	5320	Ant1	5350	-45.95	4.15	-	53.43	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5350	-55.29	4.15	0.12	44.21	Average	54	Pass
NVNT	n20	5320	Ant1	5350.4	-42.27	4.15	-	57.11	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5350	-55.29	4.15	0.12	44.21	Average	54	Pass
NVNT	n20	5320	Ant1	5460	-49.48	4.15	-	49.90	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5460	-57.37	4.15	0.12	42.13	Average	54	Pass
NVNT	n40	5270	Ant1	4500	-50.42	4.15	-	48.96	Peak	68.2	Pass
NVNT	n40	5270	Ant1	4500	-58.47	4.15	0.24	41.15	Average	54	Pass
NVNT	n40	5270	Ant1	5021.64	-46.03	4.15	-	53.35	Peak	68.2	Pass
NVNT	n40	5270	Ant1	4773.78	-56.46	4.15	0.24	43.16	Average	54	Pass
NVNT	n40	5270	Ant1	5150	-48.39	4.15	-	50.99	Peak	68.2	Pass
NVNT	n40	5270	Ant1	5150	-57.52	4.15	0.24	42.10	Average	54	Pass
NVNT	n40	5310	Ant1	5350	-45.08	4.15	-	54.30	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350	-56.54	4.15	0.23	43.07	Average	54	Pass
NVNT	n40	5310	Ant1	5351	-43.66	4.15	-	55.72	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350.8	-55.58	4.15	0.23	44.03	Average	54	Pass
NVNT	n40	5310	Ant1	5460	-48.03	4.15	-	51.35	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5460	-57.12	4.15	0.23	42.49	Average	54	Pass
NVNT	ac20	5260	Ant1	4500	-50.65	4.15	-	48.73	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant1	4500	-58.56	4.15	0.12	40.94	Average	54	Pass
NVNT	ac20	5260	Ant1	5133.36	-45.53	4.15	-	53.85	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5081.88	-56.58	4.15	0.12	42.92	Average	54	Pass
NVNT	ac20	5260	Ant1	5150	-47.67	4.15	-	51.71	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5150	-57.06	4.15	0.12	42.44	Average	54	Pass
NVNT	ac20	5320	Ant1	5350	-45.33	4.15	-	54.05	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5350	-56.65	4.15	0.12	42.85	Average	54	Pass
NVNT	ac20	5320	Ant1	5351.4	-42.15	4.15	-	57.23	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5352	-55.86	4.15	0.12	43.64	Average	54	Pass
NVNT	ac20	5320	Ant1	5460	-48.94	4.15	-	50.44	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5460	-57.86	4.15	0.12	41.64	Average	54	Pass
NVNT	ac40	5270	Ant1	4500	-49.88	4.15	-	49.50	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4500	-58.66	4.15	0.24	40.96	Average	54	Pass
NVNT	ac40	5270	Ant1	5106.69	-45.3	4.15	-	54.08	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5110.74	-56.5	4.15	0.24	43.12	Average	54	Pass
NVNT	ac40	5270	Ant1	5150	-49.01	4.15	-	50.37	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5150	-57.52	4.15	0.24	42.10	Average	54	Pass
NVNT	ac40	5310	Ant1	5350	-44.12	4.15	-	55.26	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350	-55.49	4.15	0.24	44.13	Average	54	Pass
NVNT	ac40	5310	Ant1	5350.8	-42.15	4.15	-	57.23	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350.2	-55.39	4.15	0.24	44.23	Average	54	Pass
NVNT	ac40	5310	Ant1	5460	-49.12	4.15	-	50.26	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5460	-57.98	4.15	0.24	41.64	Average	54	Pass
NVNT	ac80	5290	Ant1	4500	-49.75	4.15	-	49.63	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	4500	-58.23	4.15	0.47	41.62	Average	54	Pass
NVNT	ac80	5290	Ant1	5033.31	-45.53	4.15	-	53.85	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5146.41	-55.22	4.15	0.47	44.63	Average	54	Pass
NVNT	ac80	5290	Ant1	5150	-47.09	4.15	-	52.29	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5150	-56.02	4.15	0.47	43.83	Average	54	Pass
NVNT	ac80	5290	Ant1	5350	-46.15	4.15	-	53.23	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5350	-55.79	4.15	0.47	44.06	Average	54	Pass
NVNT	ac80	5290	Ant1	5352.25	-41.39	4.15	-	57.99	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5350.75	-55.22	4.15	0.47	44.63	Average	54	Pass
NVNT	ac80	5290	Ant1	5460	-49.95	4.15	-	49.43	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5460	-57.58	4.15	0.47	42.27	Average	54	Pass
NVNT	ax20	5260	Ant1	4500	-50.62	4.15	-	48.76	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	4500	-58.9	4.15	0.12	40.60	Average	54	Pass
NVNT	ax20	5260	Ant1	5017.92	-46.32	4.15	-	53.06	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	5092.8	-56.59	4.15	0.12	42.91	Average	54	Pass
NVNT	ax20	5260	Ant1	5150	-48	4.15	-	51.38	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	5150	-57.77	4.15	0.12	41.73	Average	54	Pass
NVNT	ax20	5320	Ant1	5350	-47.75	4.15	-	51.63	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant1	5350	-56.06	4.15	0.12	43.44	Average	54	Pass
NVNT	ax20	5320	Ant1	5350.8	-44.21	4.15	-	55.17	Peak	68.2	Pass
NVNT	ax20	5320	Ant1	5352.2	-55.48	4.15	0.12	44.02	Average	54	Pass
NVNT	ax20	5320	Ant1	5460	-48.93	4.15	-	50.45	Peak	68.2	Pass
NVNT	ax20	5320	Ant1	5460	-57.34	4.15	0.12	42.16	Average	54	Pass
NVNT	ax40	5270	Ant1	4500	-50.36	4.15	-	49.02	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	4500	-58.48	4.15	0.23	41.13	Average	54	Pass
NVNT	ax40	5270	Ant1	5068.62	-46.52	4.15	-	52.86	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	5143.95	-56.34	4.15	0.23	43.27	Average	54	Pass
NVNT	ax40	5270	Ant1	5150	-48.81	4.15	-	50.57	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	5150	-56.89	4.15	0.23	42.72	Average	54	Pass
NVNT	ax40	5310	Ant1	5350	-47.04	4.15	-	52.34	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5350	-55.02	4.15	0.24	44.60	Average	54	Pass
NVNT	ax40	5310	Ant1	5351	-43.7	4.15	-	55.68	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5350	-55.02	4.15	0.24	44.60	Average	54	Pass
NVNT	ax40	5310	Ant1	5460	-48.93	4.15	-	50.45	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5460	-57.4	4.15	0.24	42.22	Average	54	Pass
NVNT	ax80	5290	Ant1	5350	-45.33	4.15	-	54.05	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5350	-55.91	4.15	0.47	43.94	Average	54	Pass
NVNT	ax80	5290	Ant1	5351.5	-45.16	4.15	-	54.22	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5351	-55.51	4.15	0.47	44.34	Average	54	Pass
NVNT	ax80	5290	Ant1	5460	-48.58	4.15	-	50.80	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5460	-57.64	4.15	0.47	42.21	Average	54	Pass
NVNT	ax80	5290	Ant1	4500	-50.97	4.15	-	48.41	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	4500	-58.57	4.15	0.47	41.28	Average	54	Pass
NVNT	ax80	5290	Ant1	5147.28	-44.7	4.15	-	54.68	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5148.15	-55.23	4.15	0.47	44.62	Average	54	Pass
NVNT	ax80	5290	Ant1	5150	-47.58	4.15	-	51.80	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5150	-55.63	4.15	0.47	44.22	Average	54	Pass
NVNT	be20	5260	Ant1	4500	-49.19	4.15	-	50.19	Peak	68.2	Pass
NVNT	be20	5260	Ant1	4500	-58.51	4.15	0.12	40.99	Average	54	Pass
NVNT	be20	5260	Ant1	4957.08	-46.45	4.15	-	52.93	Peak	68.2	Pass
NVNT	be20	5260	Ant1	5071.74	-56.58	4.15	0.12	42.92	Average	54	Pass
NVNT	be20	5260	Ant1	5150	-49.67	4.15	-	49.71	Peak	68.2	Pass
NVNT	be20	5260	Ant1	5150	-57.32	4.15	0.12	42.18	Average	54	Pass
NVNT	be20	5320	Ant1	5350	-46.11	4.15	-	53.27	Peak	68.2	Pass
NVNT	be20	5320	Ant1	5350	-56.18	4.15	0.12	43.32	Average	54	Pass
NVNT	be20	5320	Ant1	5350.2	-43.31	4.15	-	56.07	Peak	68.2	Pass
NVNT	be20	5320	Ant1	5350.2	-55.67	4.15	0.12	43.83	Average	54	Pass
NVNT	be20	5320	Ant1	5460	-48.38	4.15	-	51.00	Peak	68.2	Pass
NVNT	be20	5320	Ant1	5460	-57.39	4.15	0.12	42.11	Average	54	Pass
NVNT	be40	5270	Ant1	4500	-50.93	4.15	-	48.45	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5270	Ant1	4500	-58.92	4.15	0.23	40.69	Average	54	Pass
NVNT	be40	5270	Ant1	4974.66	-45.57	4.15	-	53.81	Peak	68.2	Pass
NVNT	be40	5270	Ant1	5086.44	-56.65	4.15	0.23	42.96	Average	54	Pass
NVNT	be40	5270	Ant1	5150	-47.98	4.15	-	51.40	Peak	68.2	Pass
NVNT	be40	5270	Ant1	5150	-57.67	4.15	0.23	41.94	Average	54	Pass
NVNT	be40	5310	Ant1	5350	-45.39	4.15	-	53.99	Peak	68.2	Pass
NVNT	be40	5310	Ant1	5350	-55.94	4.15	0.24	43.68	Average	54	Pass
NVNT	be40	5310	Ant1	5350.2	-43.68	4.15	-	55.70	Peak	68.2	Pass
NVNT	be40	5310	Ant1	5350	-55.94	4.15	0.24	43.68	Average	54	Pass
NVNT	be40	5310	Ant1	5460	-48.21	4.15	-	51.17	Peak	68.2	Pass
NVNT	be40	5310	Ant1	5460	-57.43	4.15	0.24	42.19	Average	54	Pass
NVNT	be80	5290	Ant1	5350	-44.37	4.15	-	55.01	Peak	68.2	Pass
NVNT	be80	5290	Ant1	5350	-55.76	4.15	0.47	44.09	Average	54	Pass
NVNT	be80	5290	Ant1	5350.5	-44.18	4.15	-	55.20	Peak	68.2	Pass
NVNT	be80	5290	Ant1	5351.25	-55.45	4.15	0.47	44.40	Average	54	Pass
NVNT	be80	5290	Ant1	5460	-50.47	4.15	-	48.91	Peak	68.2	Pass
NVNT	be80	5290	Ant1	5460	-57.83	4.15	0.47	42.02	Average	54	Pass
NVNT	be80	5290	Ant1	4500	-50.85	4.15	-	48.53	Peak	68.2	Pass
NVNT	be80	5290	Ant1	4500	-58.9	4.15	0.47	40.95	Average	54	Pass
NVNT	be80	5290	Ant1	5142.06	-43.73	4.15	-	55.65	Peak	68.2	Pass
NVNT	be80	5290	Ant1	5149.02	-54.94	4.15	0.47	44.91	Average	54	Pass
NVNT	be80	5290	Ant1	5150	-46.13	4.15	-	53.25	Peak	68.2	Pass
NVNT	be80	5290	Ant1	5150	-55.14	4.15	0.47	44.71	Average	54	Pass
NVNT	ac160	5250	Ant1	5350	-42.65	4.15	-	56.73	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350	-65.66	4.15	3.98	37.70	Average	54	Pass
NVNT	ac160	5250	Ant1	5350.11	-42.65	4.15	-	56.73	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350.48	-61.89	4.15	3.98	41.47	Average	54	Pass
NVNT	ac160	5250	Ant1	5460	-57.72	4.15	-	41.66	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5460	-66.55	4.15	3.98	36.81	Average	54	Pass
NVNT	ac160	5250	Ant1	4500	-60.77	4.15	-	38.61	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4500	-68.98	4.15	3.98	34.38	Average	54	Pass
NVNT	ac160	5250	Ant1	5121.53	-52.09	4.15	-	47.29	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5107.88	-64.96	4.15	3.98	38.40	Average	54	Pass
NVNT	ac160	5250	Ant1	5150	-56.96	4.15	-	42.42	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5150	-65.83	4.15	3.98	37.53	Average	54	Pass
NVNT	ax160	5250	Ant1	5350	-54.42	4.15	-	44.96	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5350	-64.16	4.15	3.98	39.20	Average	54	Pass
NVNT	ax160	5250	Ant1	5393.4	-44.24	4.15	-	55.14	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5402.28	-61.68	4.15	3.98	41.68	Average	54	Pass
NVNT	ax160	5250	Ant1	5460	-57.84	4.15	-	41.54	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5460	-66.81	4.15	3.98	36.55	Average	54	Pass
NVNT	ax160	5250	Ant1	4500	-60.94	4.15	-	38.44	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	Ant1	4500	-68.12	4.15	3.98	35.24	Average	54	Pass
NVNT	ax160	5250	Ant1	5133.36	-52.38	4.15	-	47.00	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5141.55	-63.99	4.15	3.98	39.37	Average	54	Pass
NVNT	ax160	5250	Ant1	5150	-55.23	4.15	-	44.15	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5150	-65.16	4.15	3.98	38.20	Average	54	Pass
NVNT	be160	5250	Ant1	5350	-51.77	4.15	-	47.61	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5350	-57.62	4.15	3.77	45.53	Average	54	Pass
NVNT	be160	5250	Ant1	5351.59	-45.66	4.15	-	53.72	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5435.21	-56.97	4.15	3.77	46.18	Average	54	Pass
NVNT	be160	5250	Ant1	5460	-50.42	4.15	-	48.96	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5460	-57.63	4.15	3.77	45.52	Average	54	Pass
NVNT	be160	5250	Ant1	4500	-51.11	4.15	-	48.27	Peak	68.2	Pass
NVNT	be160	5250	Ant1	4500	-58.13	4.15	3.77	45.02	Average	54	Pass
NVNT	be160	5250	Ant1	5022.34	-46.21	4.15	-	53.17	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5077.85	-56.35	4.15	3.77	46.80	Average	54	Pass
NVNT	be160	5250	Ant1	5150	-48.16	4.15	-	51.22	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5150	-57.39	4.15	3.77	45.76	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant1 Peak

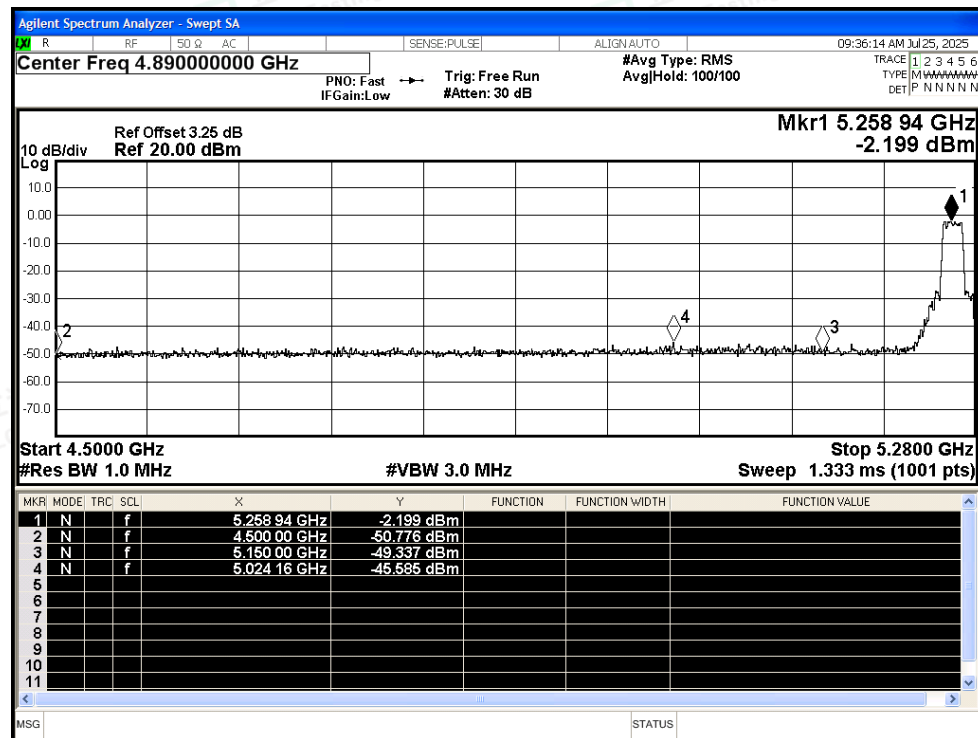

Restrict Band NVNT a 5260MHz Ant1 Average

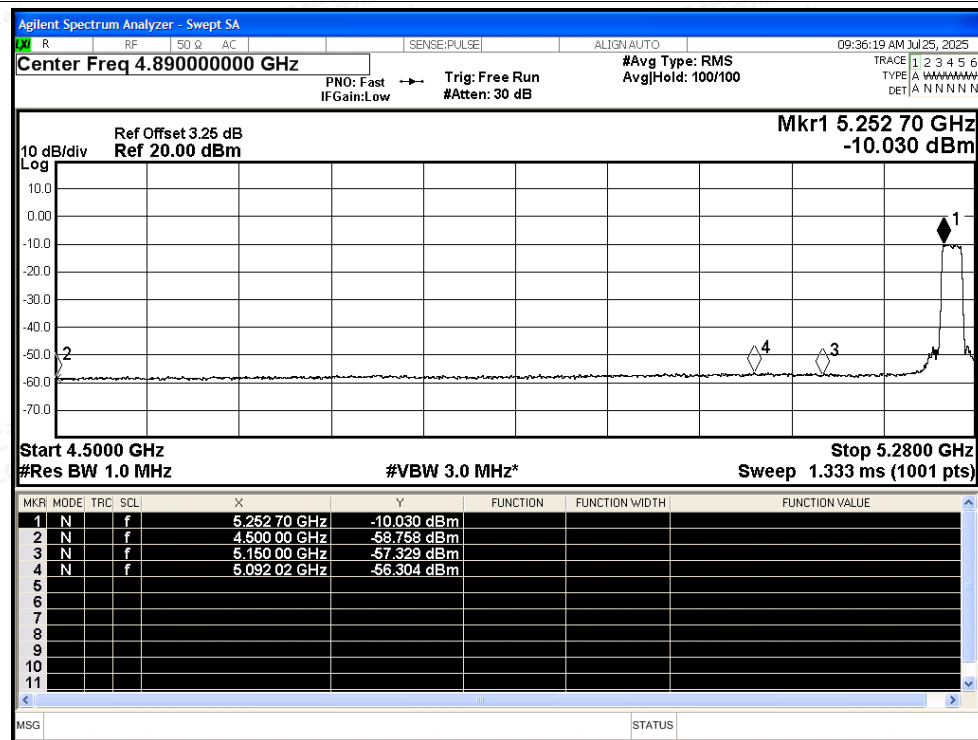

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant1 Peak

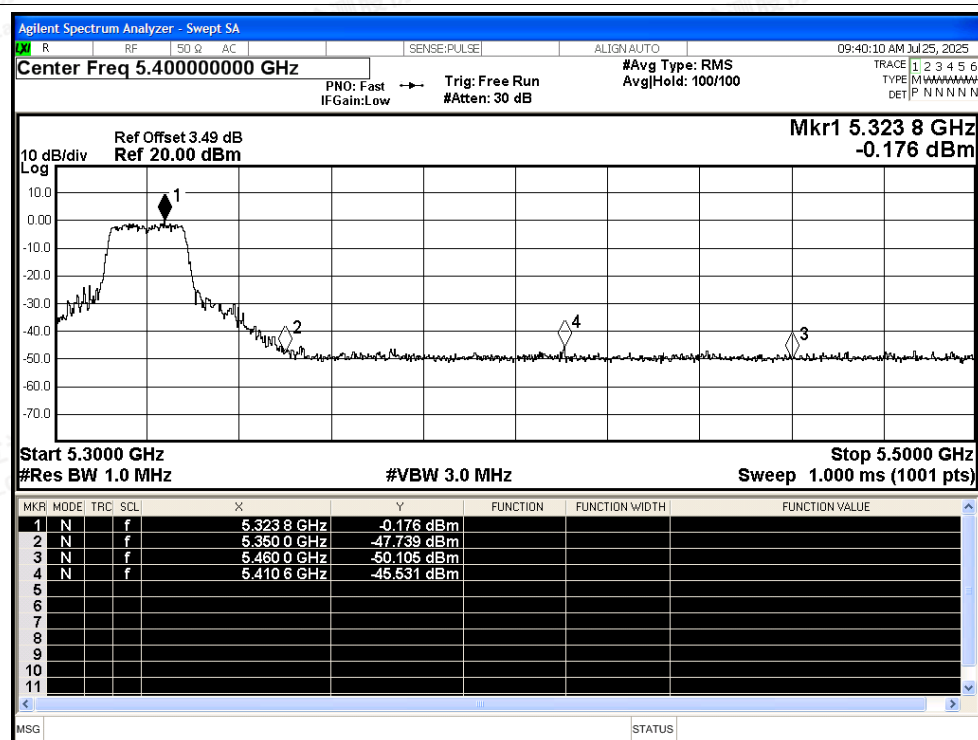

Restrict Band NVNT a 5320MHz Ant1 Average

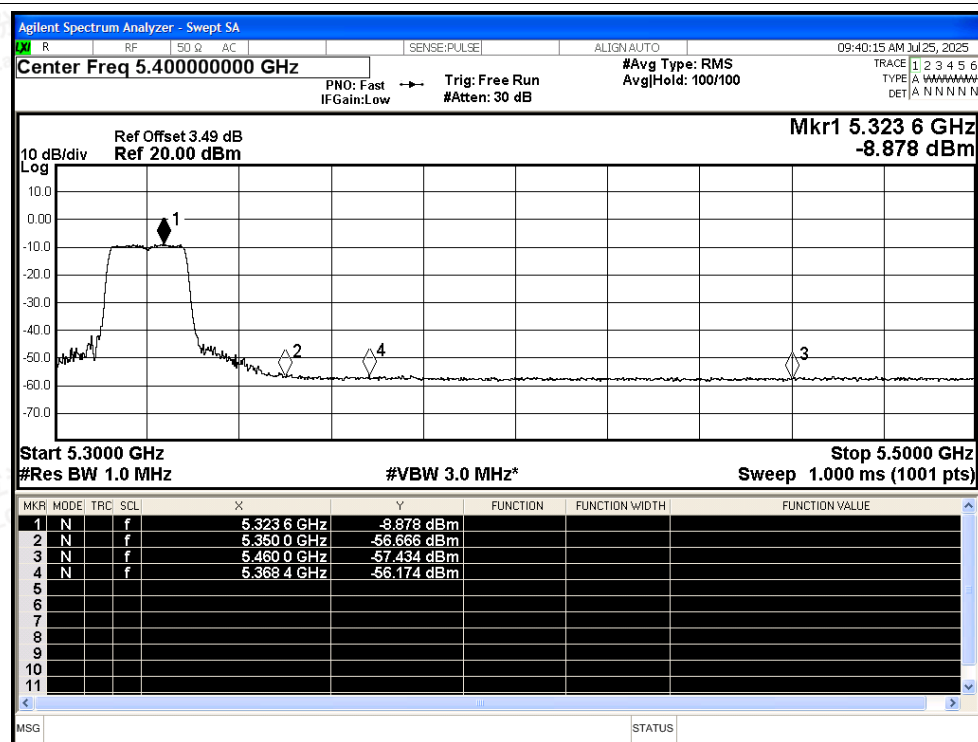

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant1 Peak

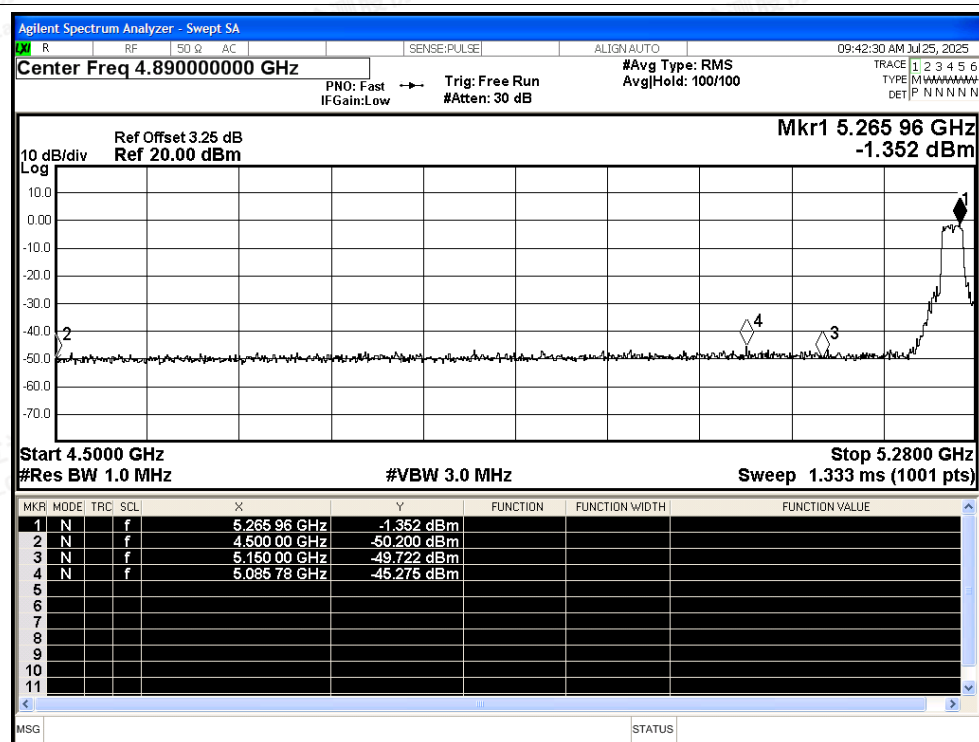

Restrict Band NVNT n20 5260MHz Ant1 Average

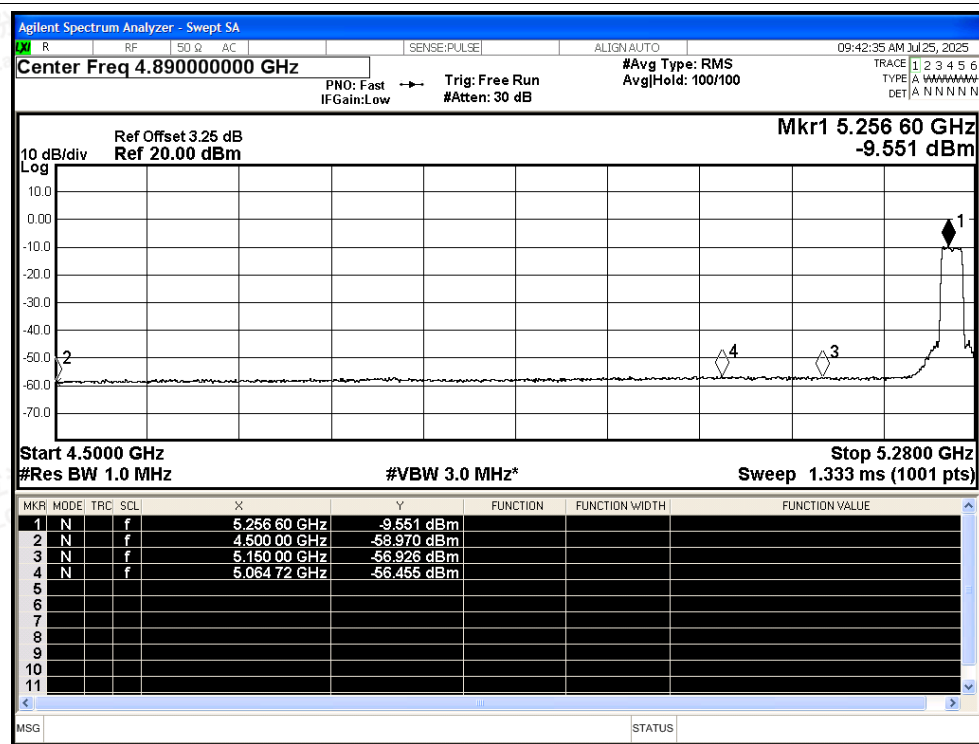

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant1 Peak

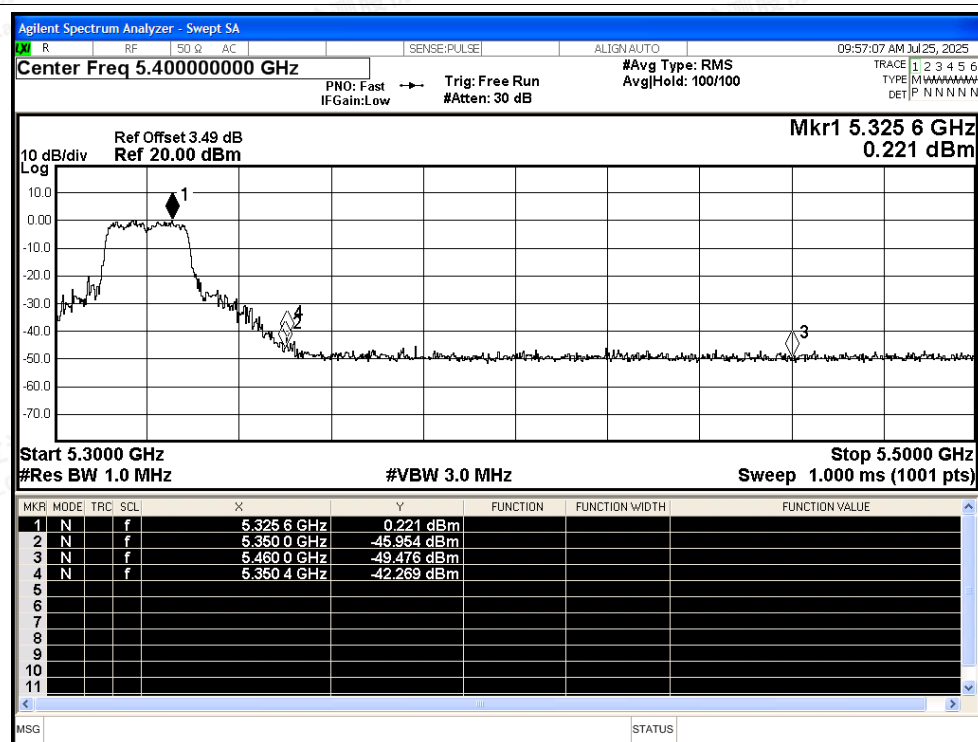

Restrict Band NVNT n20 5320MHz Ant1 Average

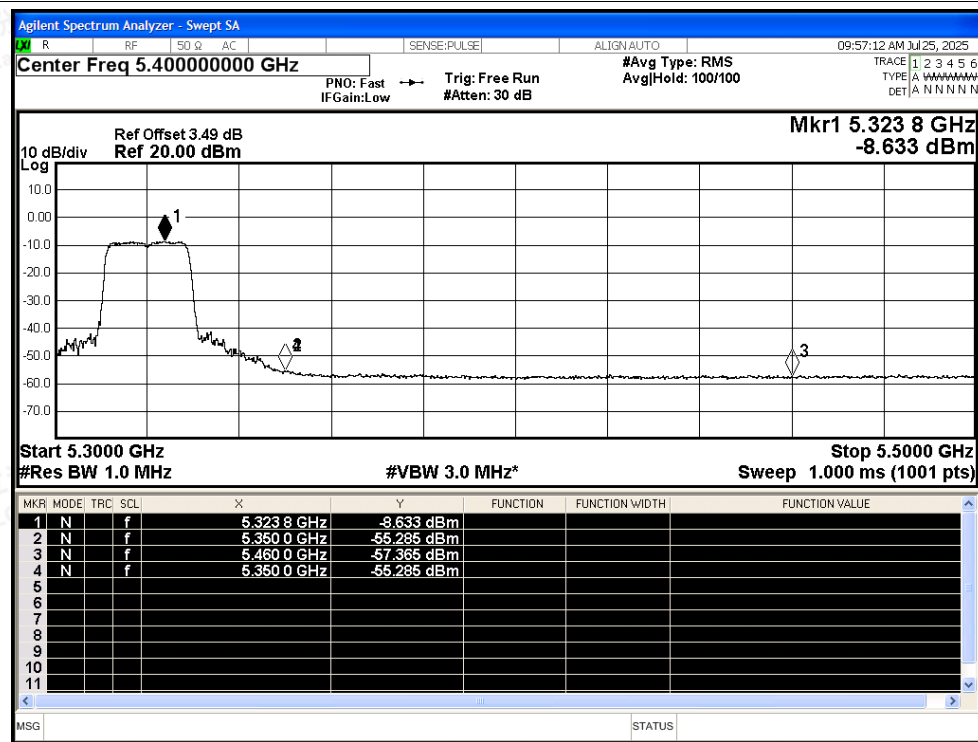

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant1 Peak

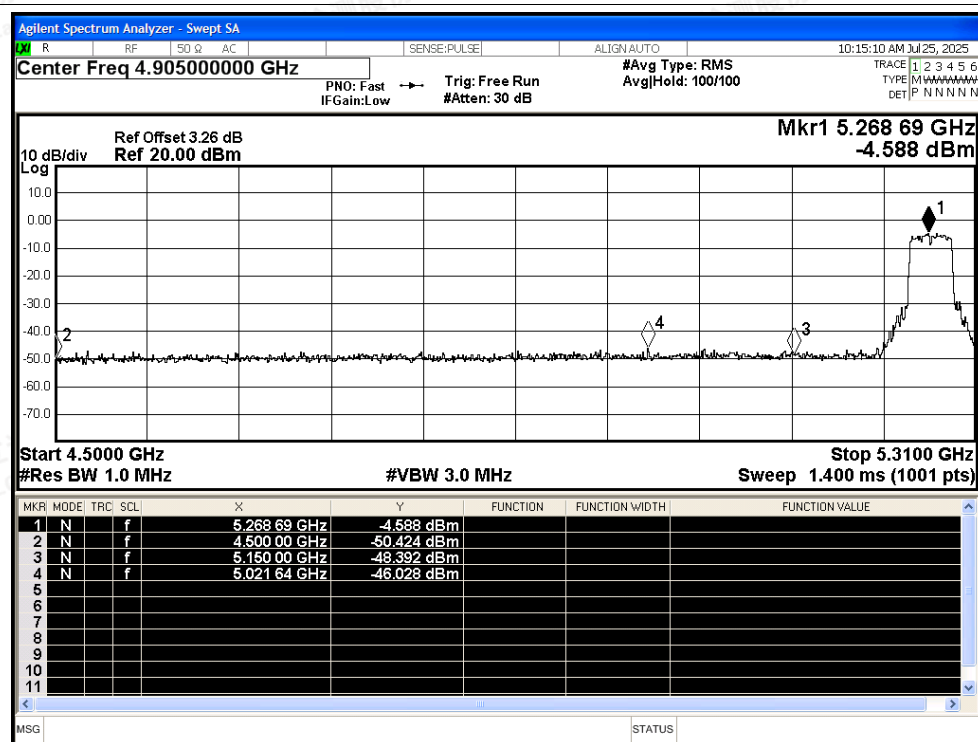

Restrict Band NVNT n40 5270MHz Ant1 Average

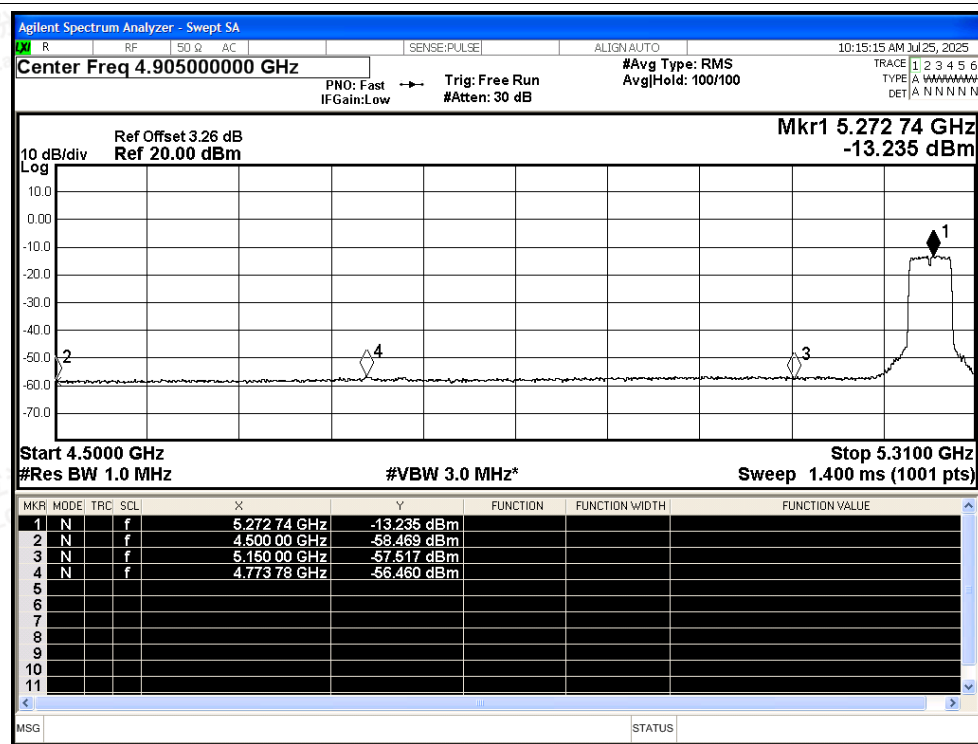

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant1 Peak

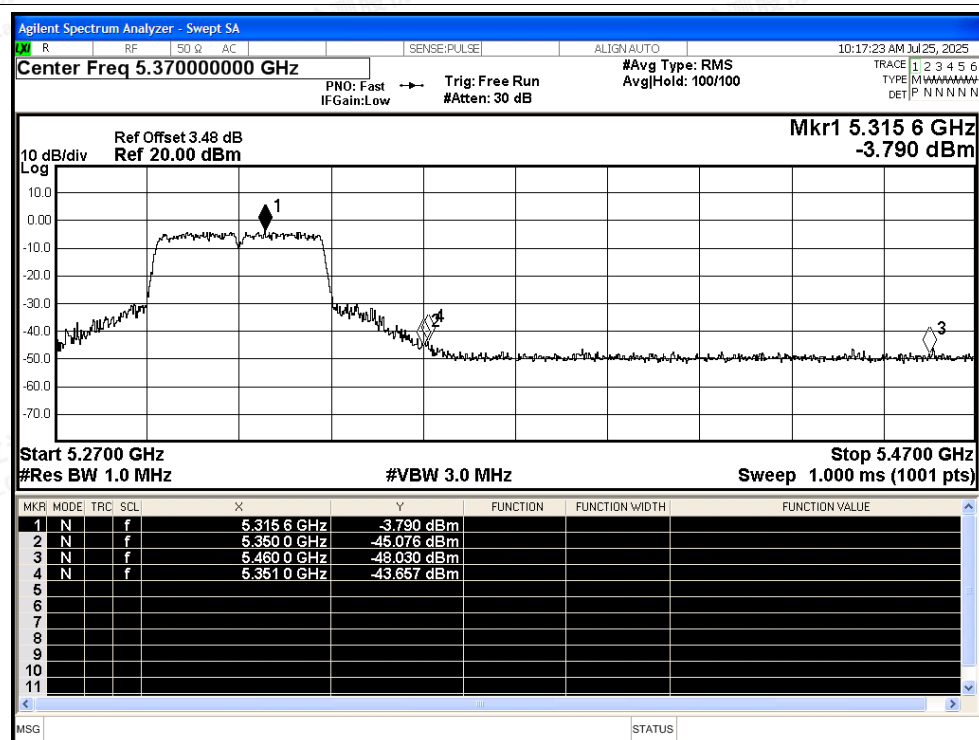

Restrict Band NVNT n40 5310MHz Ant1 Average

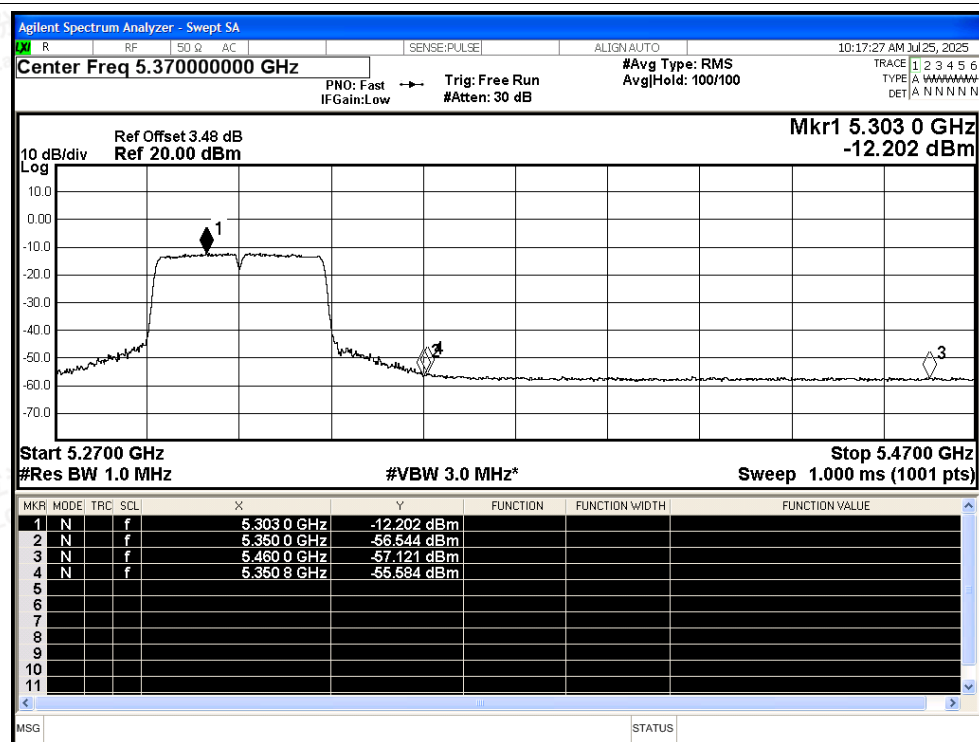

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant1 Peak

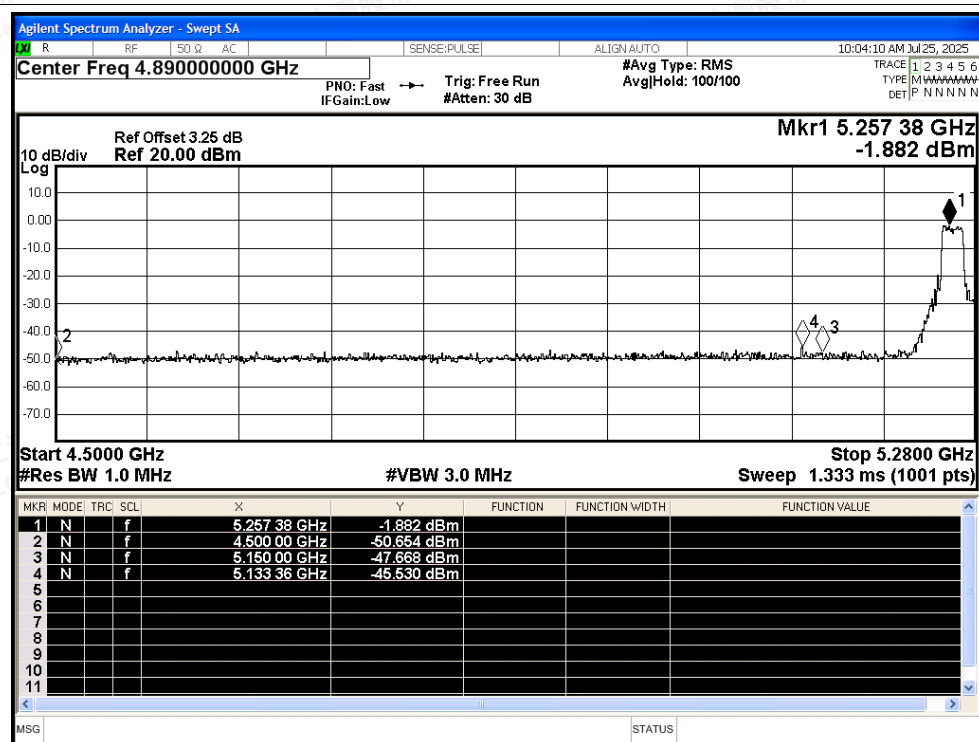

Restrict Band NVNT ac20 5260MHz Ant1 Average

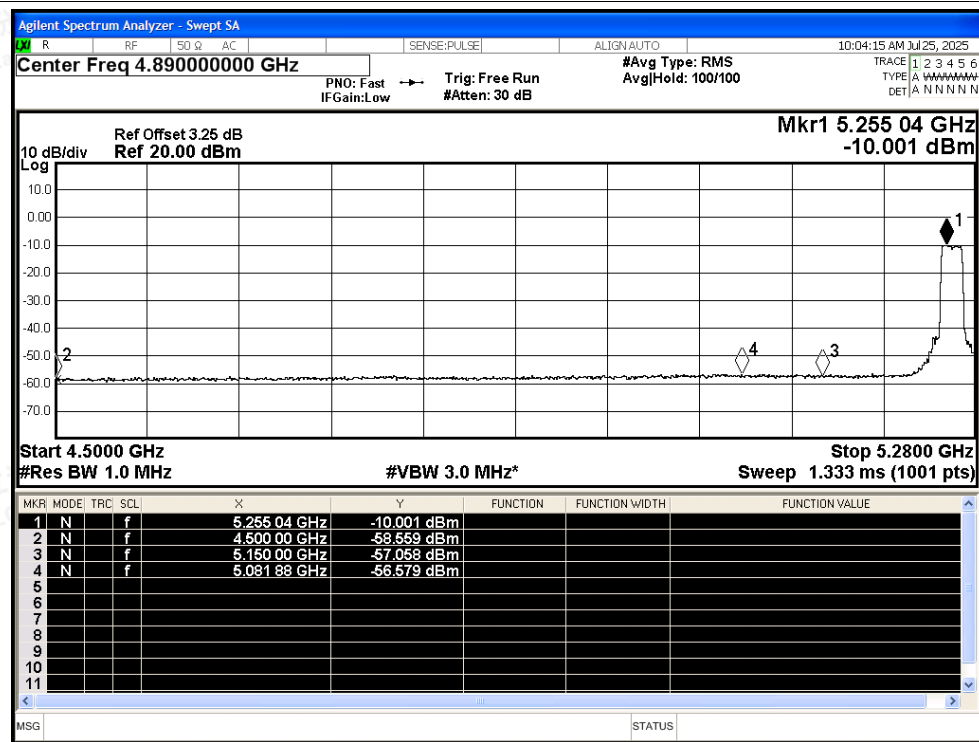

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant1 Peak

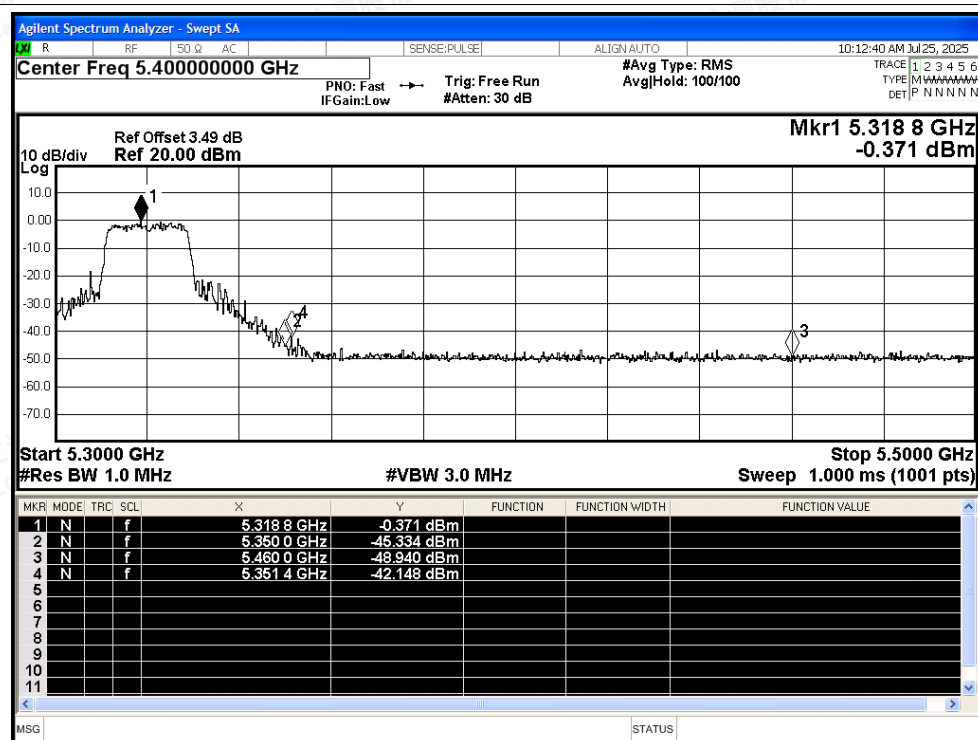

Restrict Band NVNT ac20 5320MHz Ant1 Average

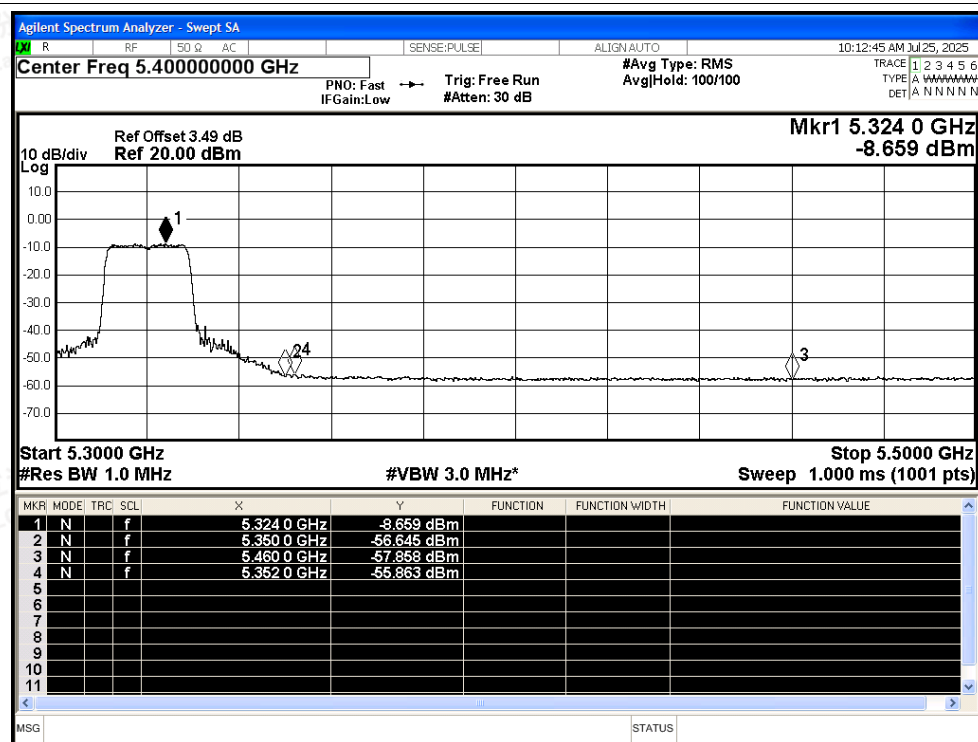

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant1 Peak

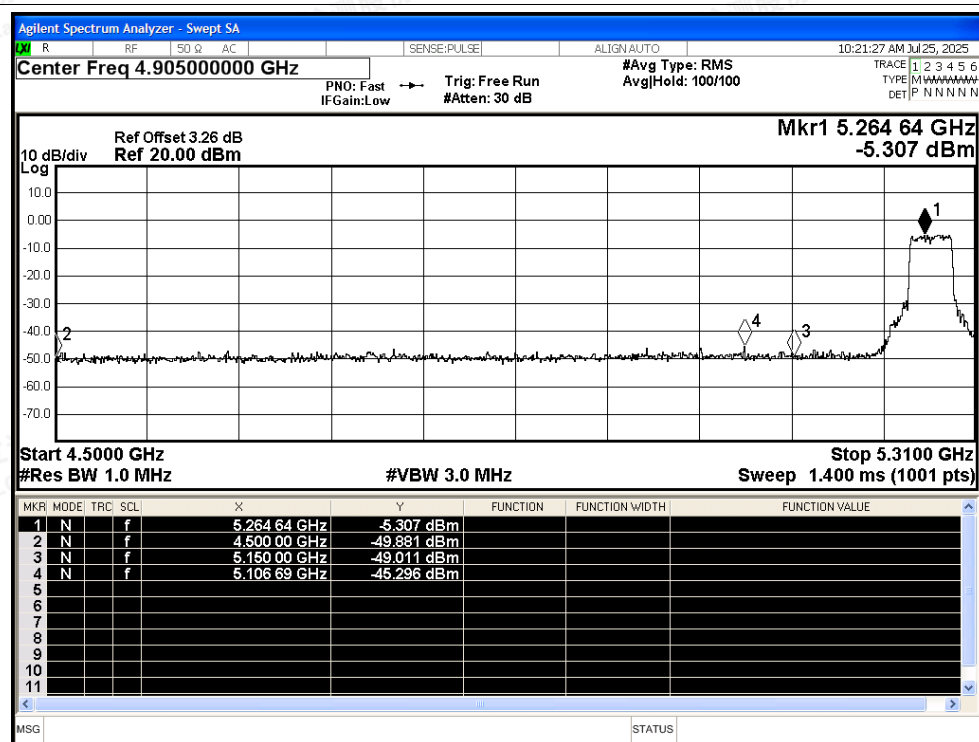

Restrict Band NVNT ac40 5270MHz Ant1 Average

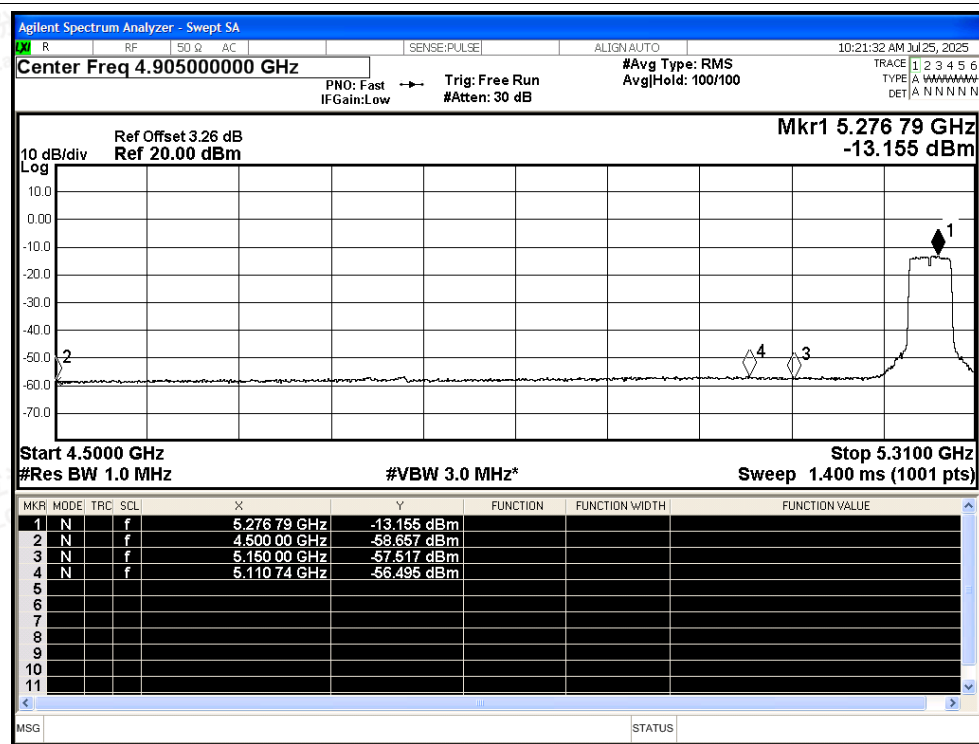

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant1 Peak

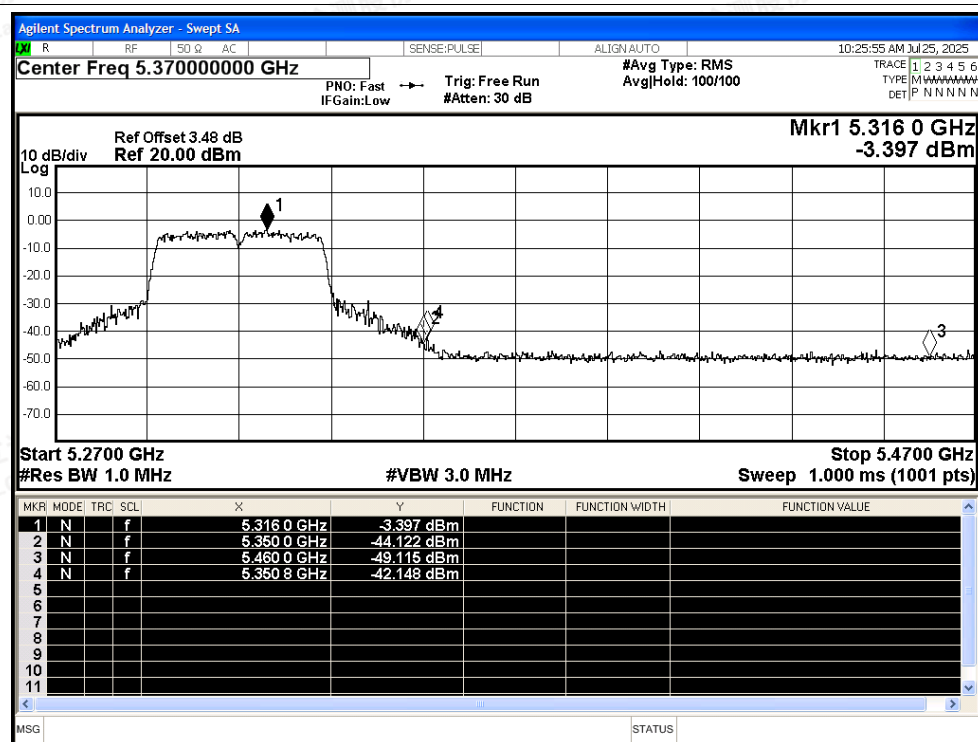

Restrict Band NVNT ac40 5310MHz Ant1 Average

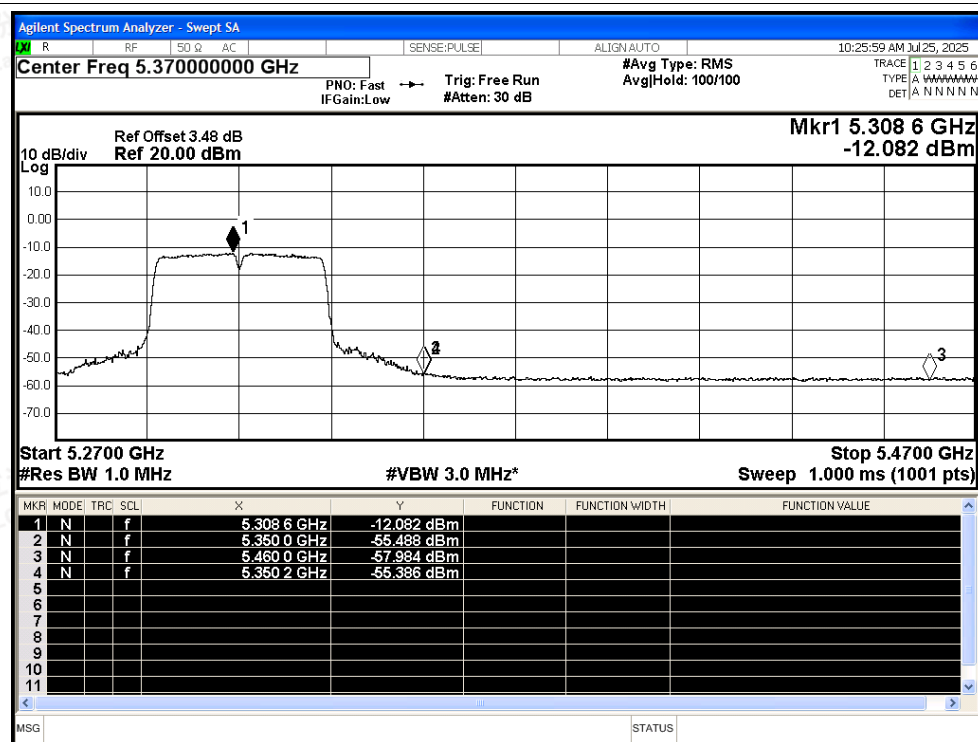

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

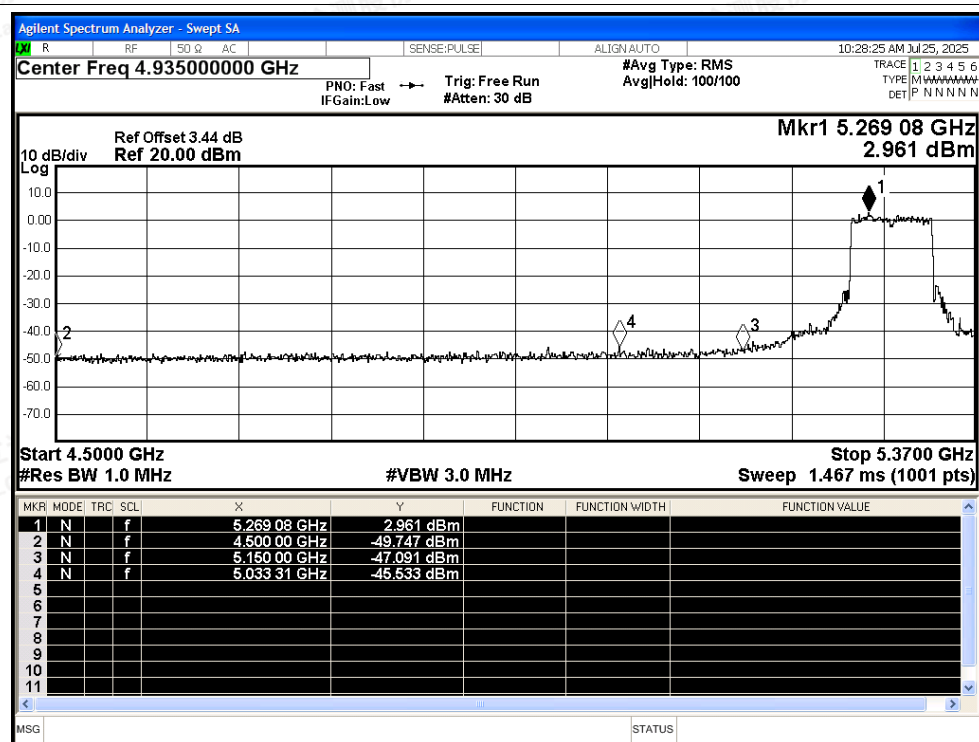

Restrict Band NVNT ac80 5290MHz Ant1 Average

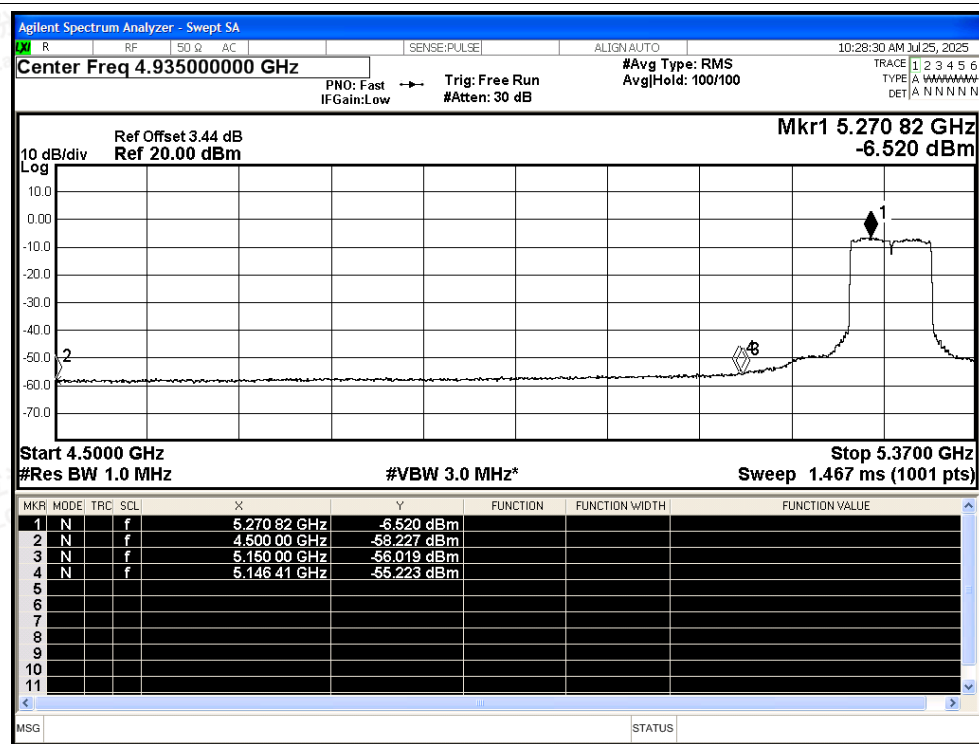

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

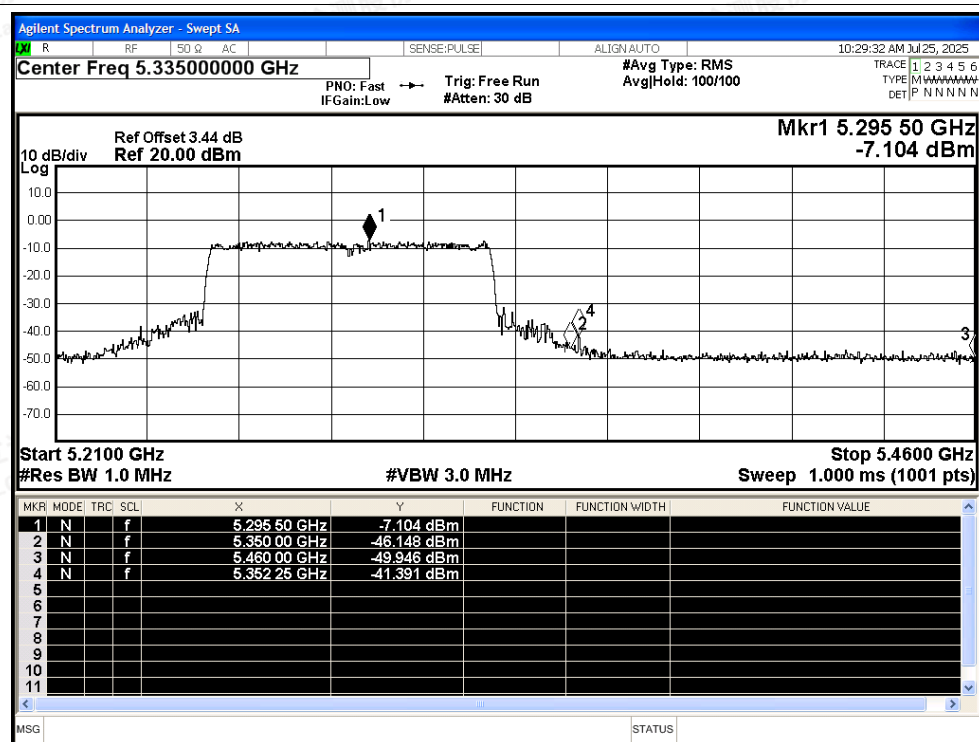

Restrict Band NVNT ac80 5290MHz Ant1 Average

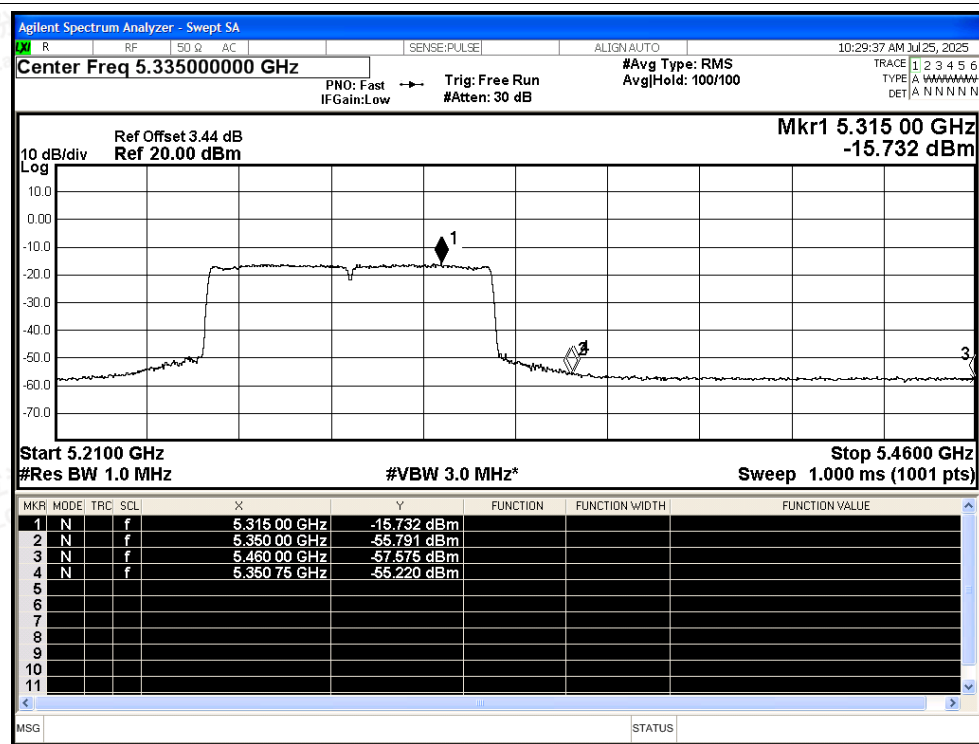

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant1 Peak

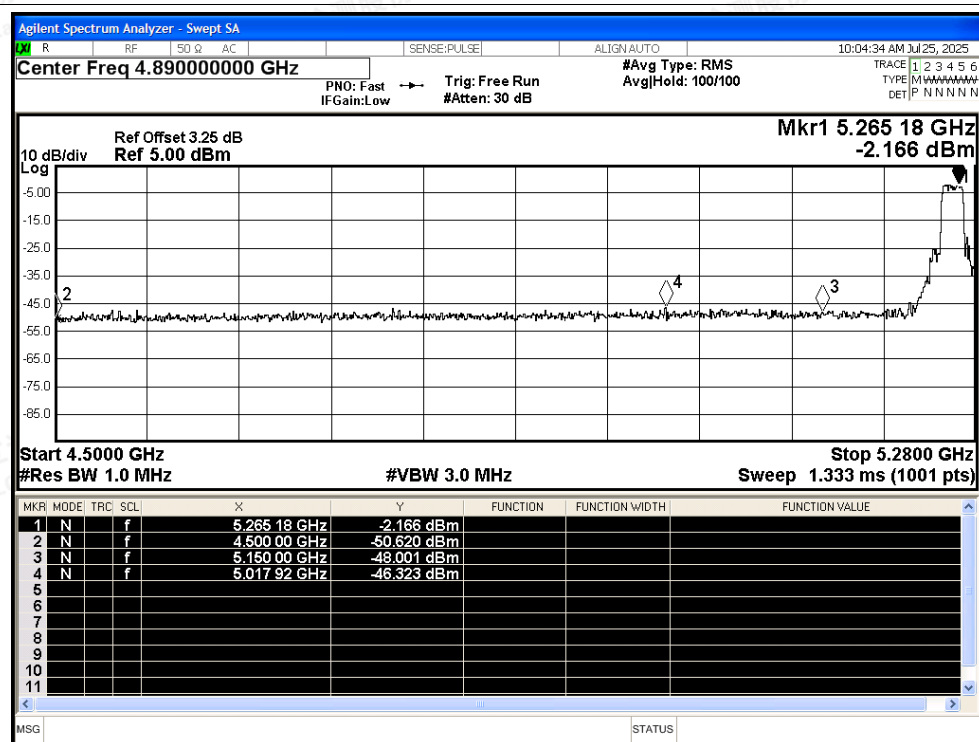

Restrict Band NVNT ax20 5260MHz Ant1 Average

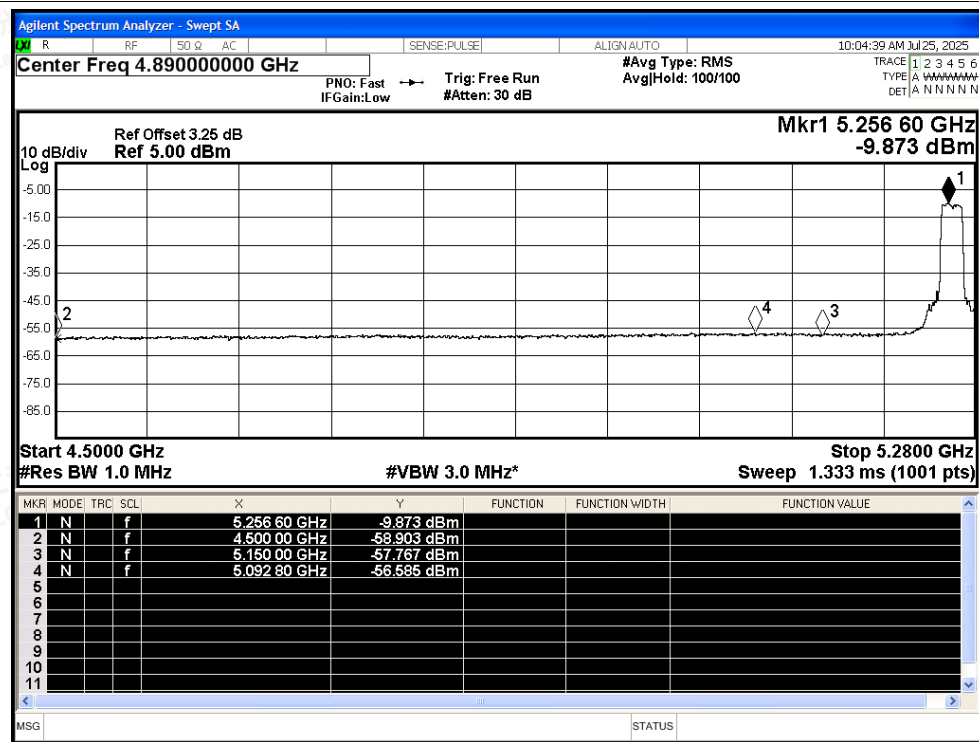

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant1 Peak

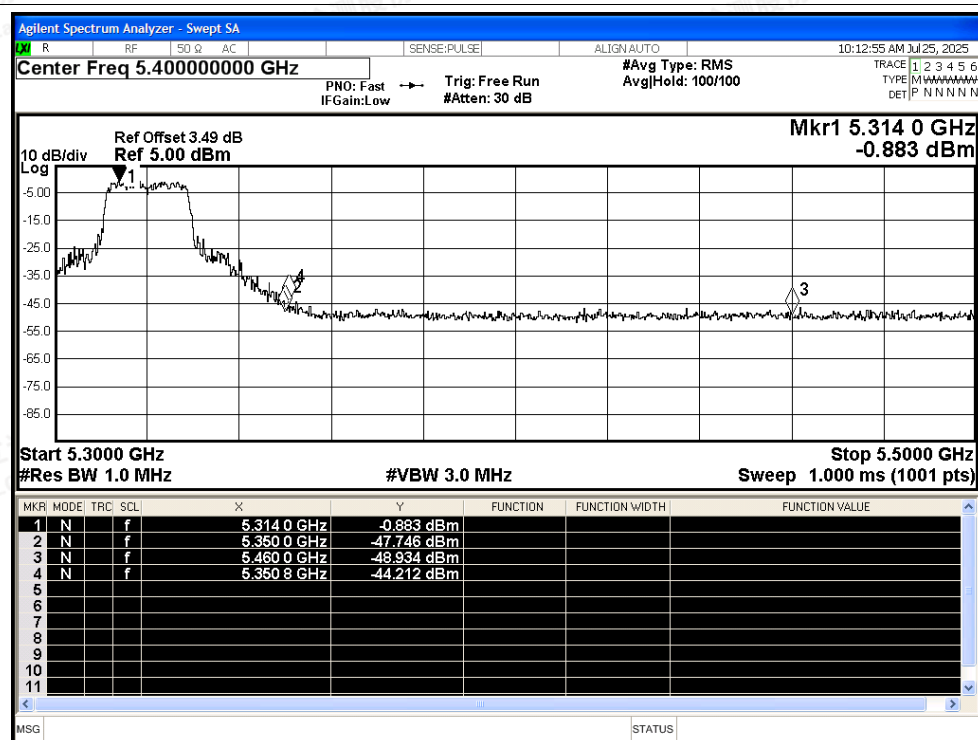

Restrict Band NVNT ax20 5320MHz Ant1 Average

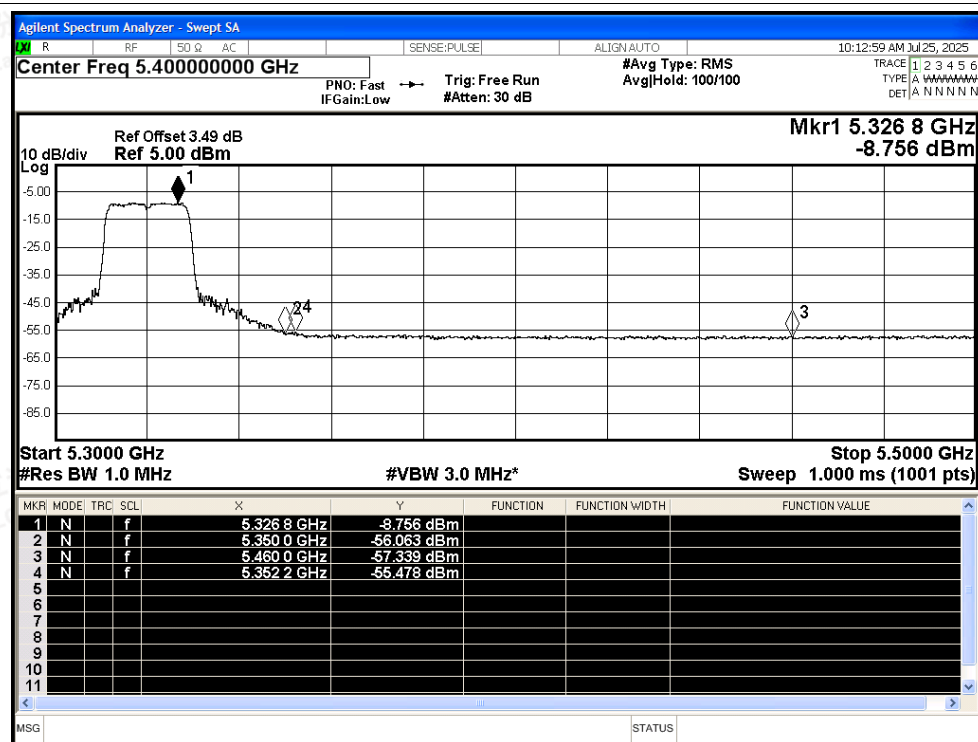

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant1 Peak

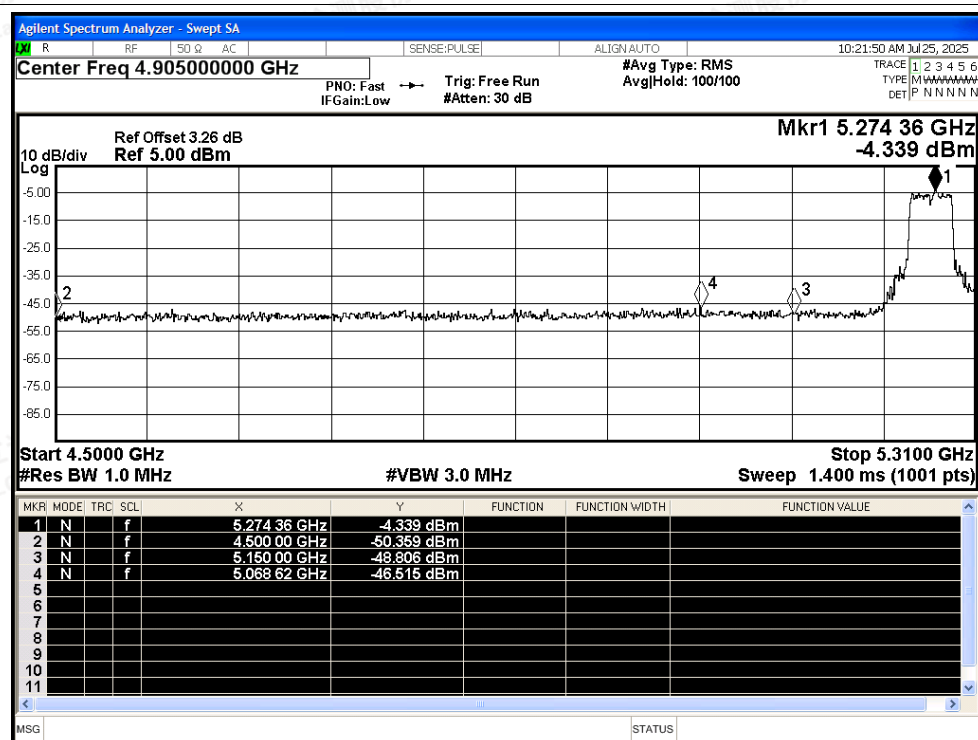

Restrict Band NVNT ax40 5270MHz Ant1 Average

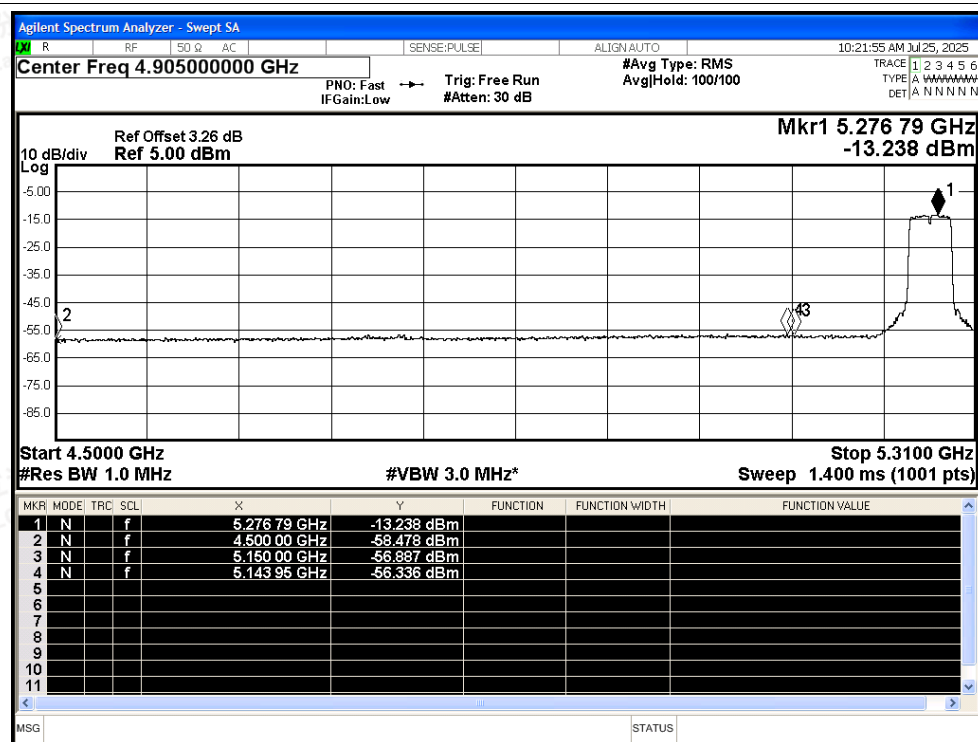

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant1 Peak

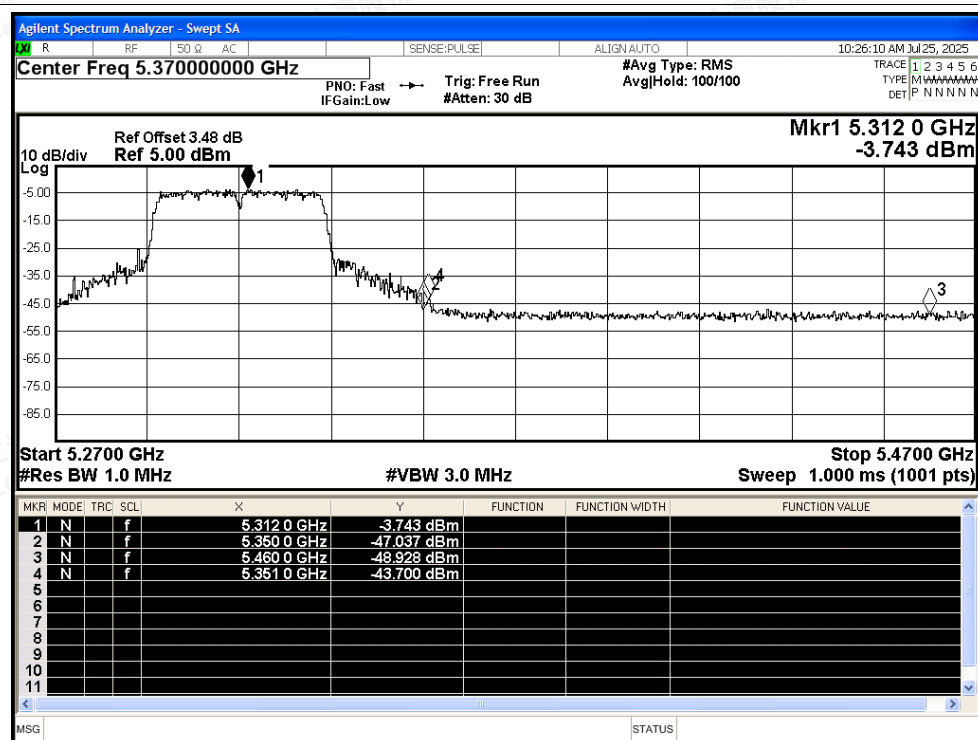

Restrict Band NVNT ax40 5310MHz Ant1 Average

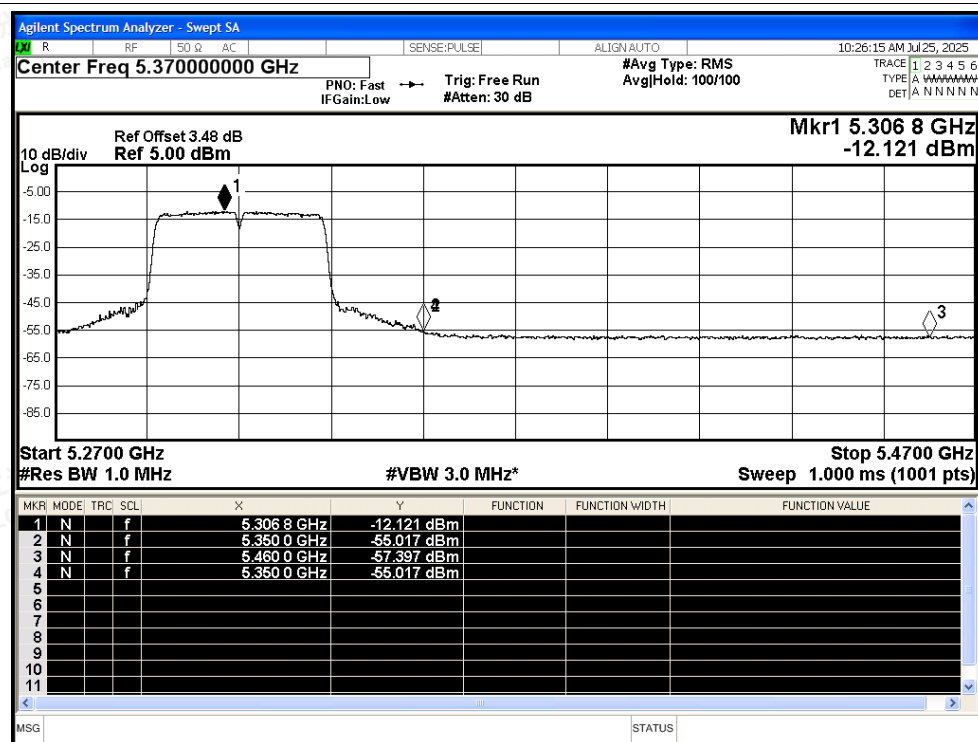

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

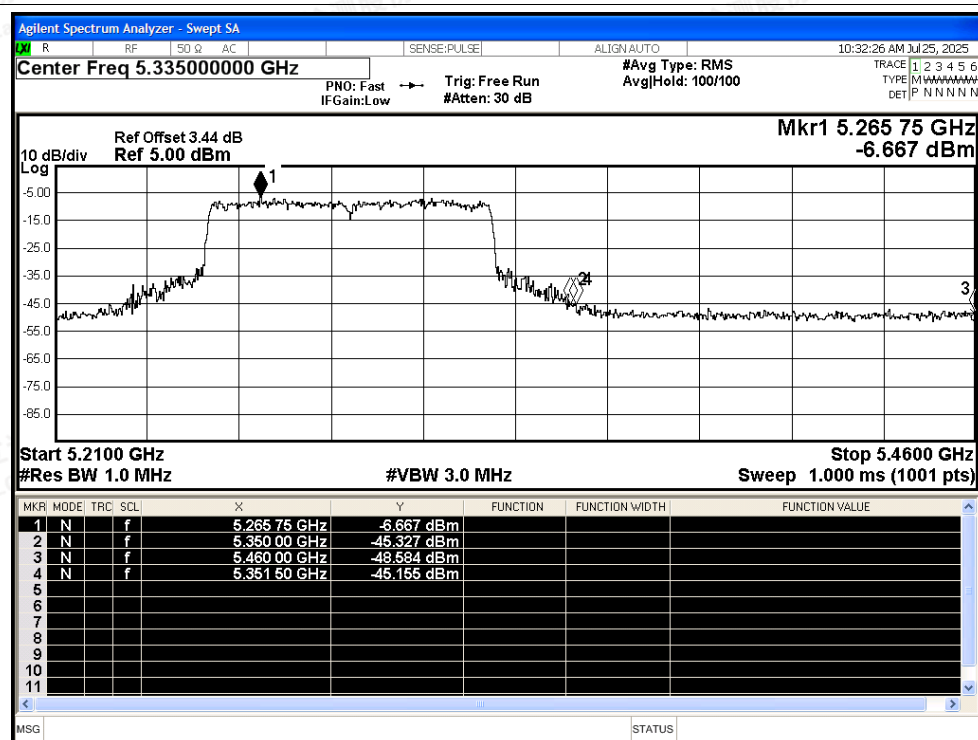

Restrict Band NVNT ax80 5290MHz Ant1 Average

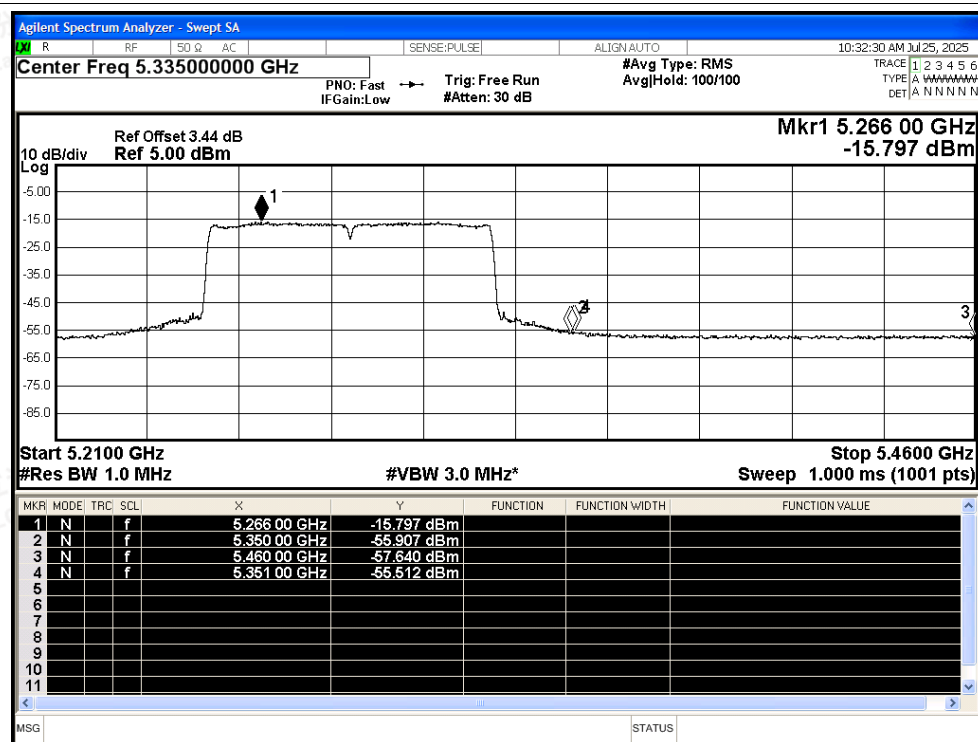

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

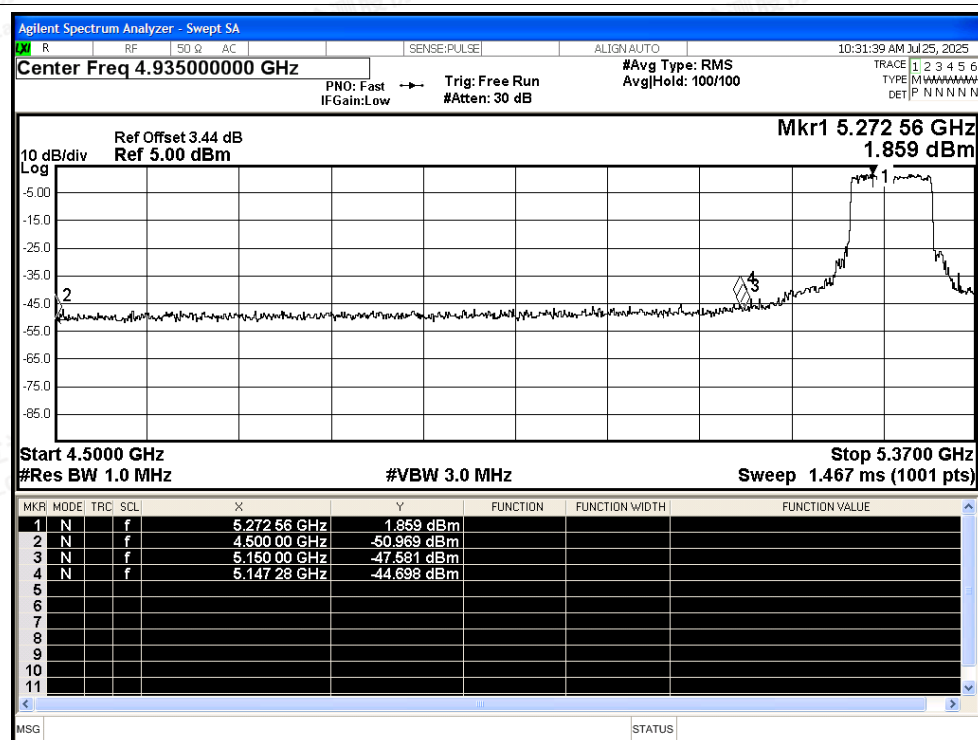

Restrict Band NVNT ax80 5290MHz Ant1 Average

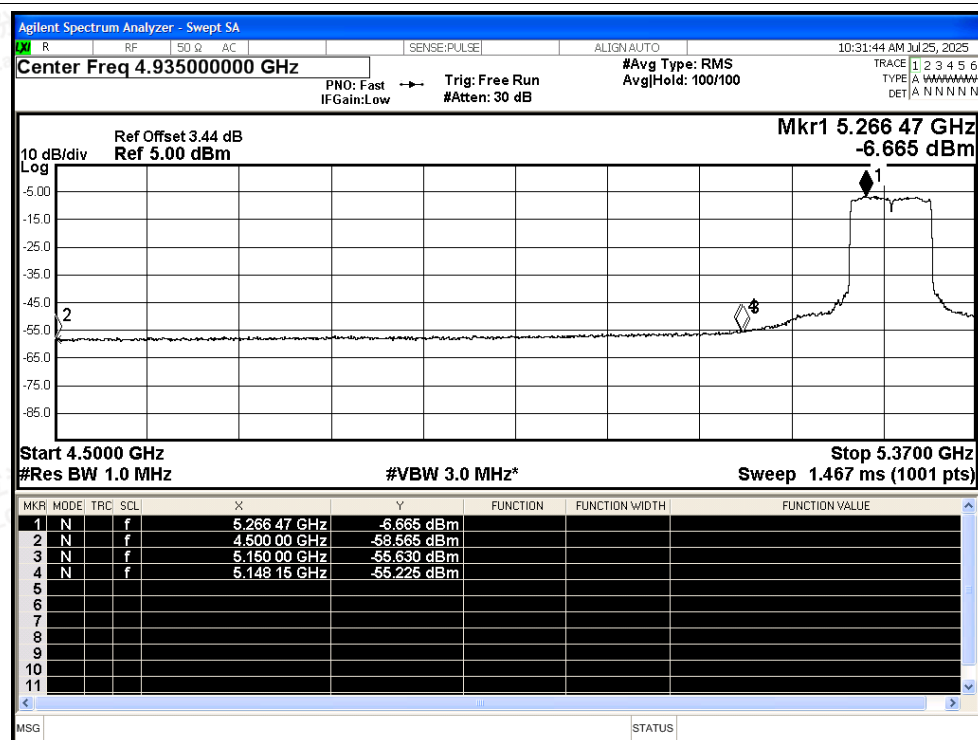

Restrict Band NVNT be20 5260MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

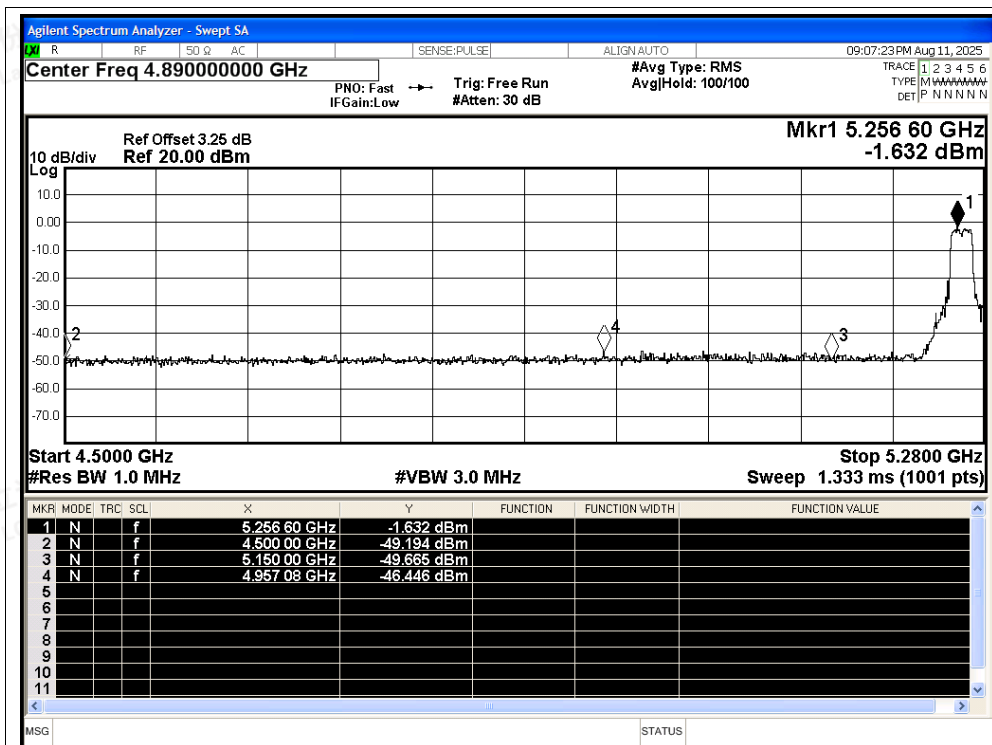

Restrict Band NVNT be20 5260MHz Ant1 Average

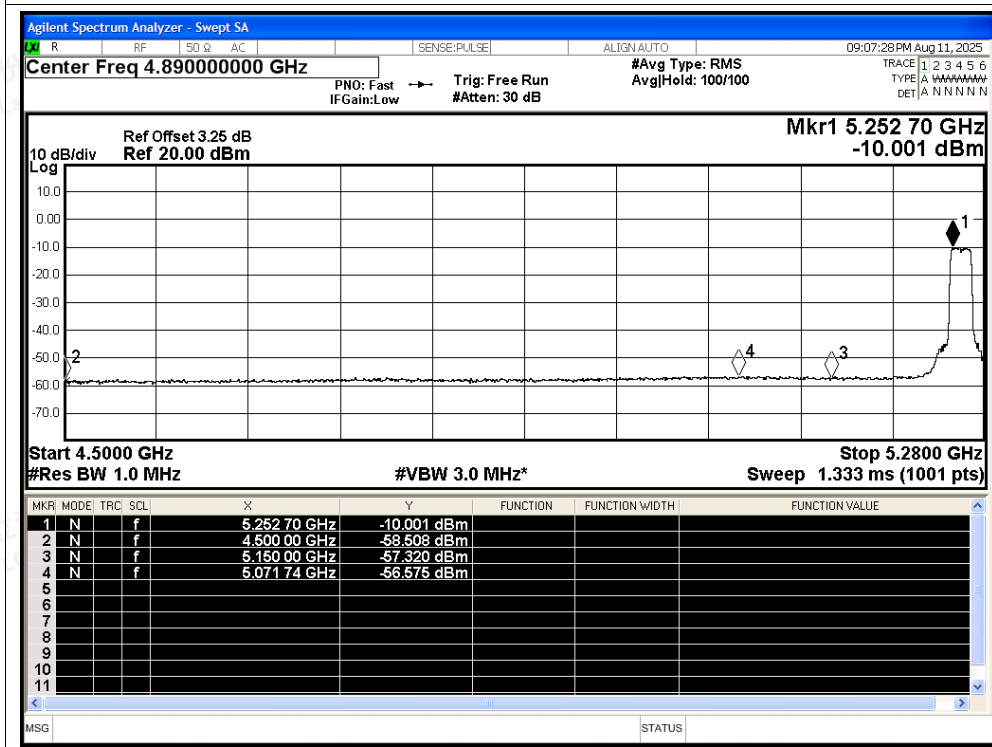

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity