





Restrict Band NVNT be160 5250MHz Ant3 Peak

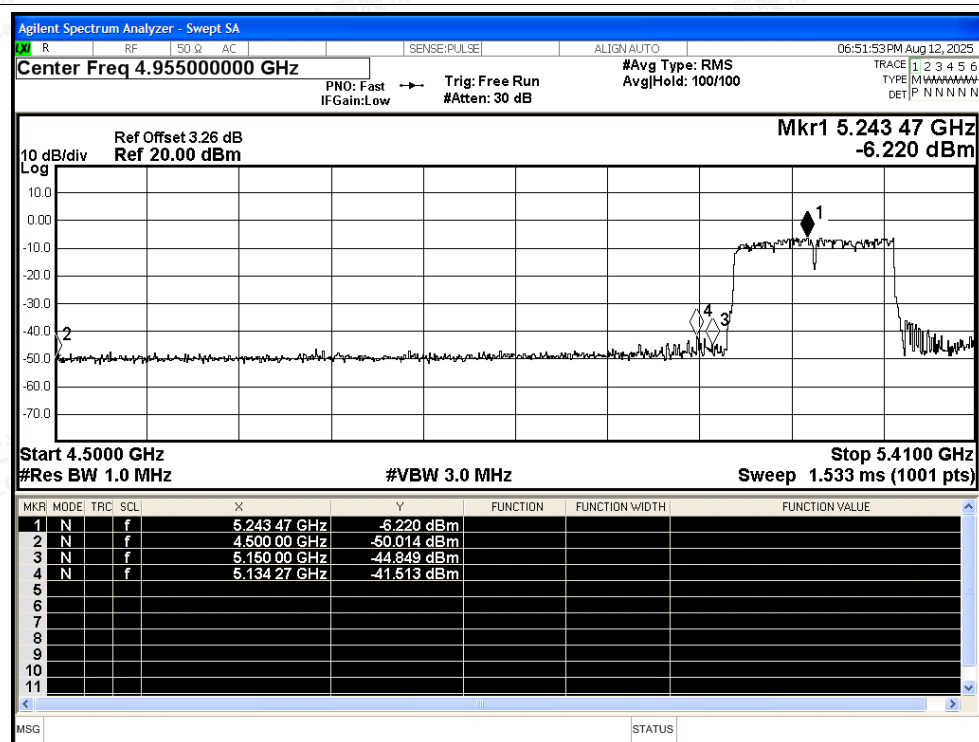

Restrict Band NVNT be160 5250MHz Ant3 Average

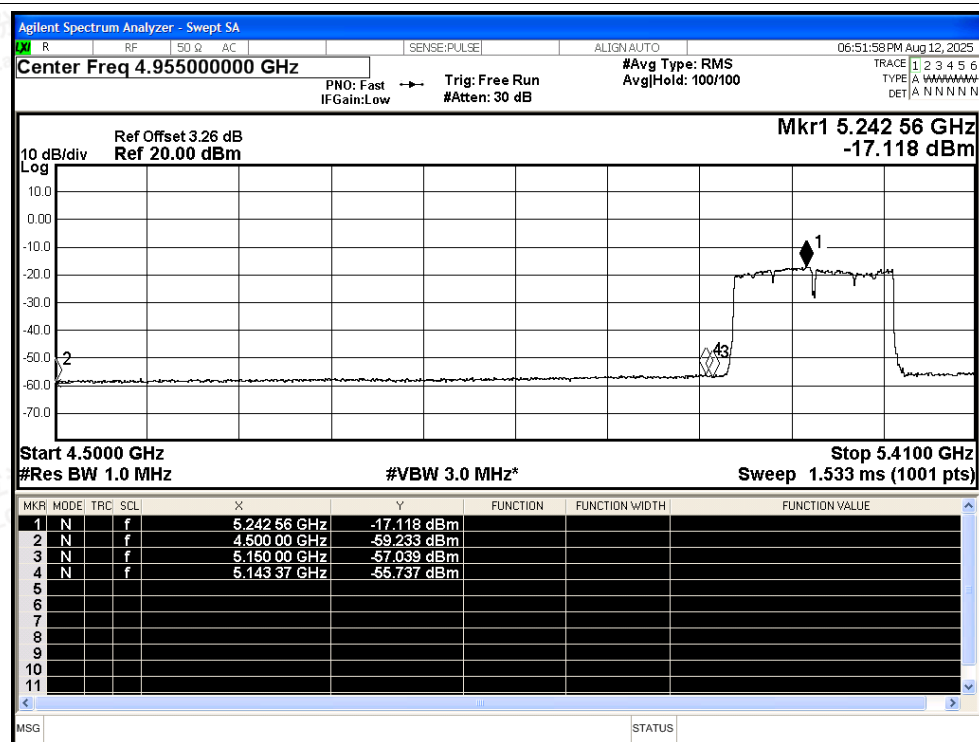

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Ant3 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	4500	-50.2	-51.46	-50.85	8.92	56.37	Peak	68.2	Pass
NVNT	n20	5260	4500	-58.97	-58.51	-58.62	8.92	48.42	Average	54	Pass
NVNT	n20	5260	5085.78	-45.28	-46.47	-45.53	8.92	61.32	Peak	68.2	Pass
NVNT	n20	5260	5064.72	-56.46	-56.34	-56.59	8.92	50.76	Average	54	Pass
NVNT	n20	5260	5150	-49.72	-47.28	-49.3	8.92	58.83	Peak	68.2	Pass
NVNT	n20	5260	5150	-56.93	-56.97	-56.86	8.92	50.21	Average	54	Pass
NVNT	n20	5320	5350	-45.95	-43.87	-46	8.92	62.37	Peak	68.2	Pass
NVNT	n20	5320	5350	-55.29	-55.56	-56.01	8.92	51.73	Average	54	Pass
NVNT	n20	5320	5350.4	-42.27	-43.37	-44.41	8.92	64.37	Peak	68.2	Pass
NVNT	n20	5320	5350	-55.29	-55.29	-55.29	8.92	51.87	Average	54	Pass
NVNT	n20	5320	5460	-49.48	-47.22	-50.35	8.92	58.95	Peak	68.2	Pass
NVNT	n20	5320	5460	-57.37	-57.3	-57.73	8.92	49.82	Average	54	Pass
NVNT	n40	5270	4500	-50.42	-48.06	-50.88	8.92	58.08	Peak	68.2	Pass
NVNT	n40	5270	4500	-58.47	-58.21	-58.61	8.92	48.82	Average	54	Pass
NVNT	n40	5270	5021.64	-46.03	-46.41	-44.89	8.92	60.94	Peak	68.2	Pass
NVNT	n40	5270	4773.78	-56.46	-56.51	-56.3	8.92	50.67	Average	54	Pass
NVNT	n40	5270	5150	-48.39	-49.07	-49.92	8.92	58.44	Peak	68.2	Pass
NVNT	n40	5270	5150	-57.52	-57.19	-57.59	8.92	49.81	Average	54	Pass
NVNT	n40	5310	5350	-45.08	-47.32	-41.85	8.92	61.10	Peak	68.2	Pass
NVNT	n40	5310	5350	-56.54	-55.31	-55.82	8.92	51.28	Average	54	Pass
NVNT	n40	5310	5351	-43.66	-42.24	-41.85	8.92	64.27	Peak	68.2	Pass
NVNT	n40	5310	5350.8	-55.58	-55.15	-55.59	8.92	51.80	Average	54	Pass
NVNT	n40	5310	5460	-48.03	-49.17	-49.85	8.92	58.60	Peak	68.2	Pass
NVNT	n40	5310	5460	-57.12	-57.69	-58.05	8.92	49.76	Average	54	Pass
NVNT	ac20	5260	4500	-50.65	-50.2	-50.51	8.92	56.74	Peak	68.2	Pass
NVNT	ac20	5260	4500	-58.56	-58.88	-58.77	8.92	48.44	Average	54	Pass
NVNT	ac20	5260	5133.36	-45.53	-46.58	-45.91	8.92	61.13	Peak	68.2	Pass
NVNT	ac20	5260	5081.88	-56.58	-56.47	-56.58	8.92	50.63	Average	54	Pass
NVNT	ac20	5260	5150	-47.67	-48.14	-48.09	8.92	59.26	Peak	68.2	Pass
NVNT	ac20	5260	5150	-57.06	-57.45	-56.81	8.92	49.91	Average	54	Pass
NVNT	ac20	5320	5350	-45.33	-44.14	-43.94	8.92	62.46	Peak	68.2	Pass
NVNT	ac20	5320	5350	-56.65	-55.38	-55.62	8.92	51.19	Average	54	Pass
NVNT	ac20	5320	5351.4	-42.15	-44.14	-43.94	8.92	64.13	Peak	68.2	Pass
NVNT	ac20	5320	5352	-55.86	-55.01	-55.25	8.92	51.74	Average	54	Pass
NVNT	ac20	5320	5460	-48.94	-50.67	-50.38	8.92	57.44	Peak	68.2	Pass
NVNT	ac20	5320	5460	-57.86	-58.36	-57.24	8.92	49.06	Average	54	Pass
NVNT	ac40	5270	4500	-49.88	-49.51	-49.57	8.92	57.47	Peak	68.2	Pass
NVNT	ac40	5270	4500	-58.66	-58.89	-58.27	8.92	48.38	Average	54	Pass
NVNT	ac40	5270	5106.69	-45.3	-45.73	-46.16	8.92	61.65	Peak	68.2	Pass
NVNT	ac40	5270	5110.74	-56.5	-56.48	-56.58	8.92	50.67	Average	54	Pass
NVNT	ac40	5270	5150	-49.01	-49.15	-49.28	8.92	58.08	Peak	68.2	Pass
NVNT	ac40	5270	5150	-57.52	-56.99	-57.45	8.92	49.91	Average	54	Pass
NVNT	ac40	5310	5350	-44.12	-45.55	-45.22	8.92	62.38	Peak	68.2	Pass
NVNT	ac40	5310	5350	-55.49	-55.86	-55.79	8.92	51.49	Average	54	Pass
NVNT	ac40	5310	5350.8	-42.15	-42.4	-39.41	8.92	64.88	Peak	68.2	Pass
NVNT	ac40	5310	5350.2	-55.39	-55.62	-55.06	8.92	51.65	Average	54	Pass
NVNT	ac40	5310	5460	-49.12	-49.91	-50.21	8.92	57.66	Peak	68.2	Pass
NVNT	ac40	5310	5460	-57.98	-57.66	-57.96	8.92	49.34	Average	54	Pass
NVNT	ac80	5290	4500	-49.75	-49.04	-50.92	8.92	57.78	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5290	4500	-58.23	-58.52	-58.61	8.92	48.79	Average	54	Pass
NVNT	ac80	5290	5033.31	-45.53	-46.5	-44.72	8.92	61.17	Peak	68.2	Pass
NVNT	ac80	5290	5146.41	-55.22	-55.08	-55.65	8.92	52.01	Average	54	Pass
NVNT	ac80	5290	5150	-47.09	-48.49	-47.22	8.92	59.42	Peak	68.2	Pass
NVNT	ac80	5290	5150	-56.02	-55.87	-55.7	8.92	51.21	Average	54	Pass
NVNT	ac80	5290	5350	-46.15	-39.78	-50.92	8.92	65.27	Peak	68.2	Pass
NVNT	ac80	5290	5350	-55.79	-59.92	-58.61	8.92	49.78	Average	54	Pass
NVNT	ac80	5290	5352.25	-41.39	-38.97	-44.72	8.92	67.14	Peak	68.2	Pass
NVNT	ac80	5290	5350.75	-55.22	-59.29	-55.65	8.92	50.36	Average	54	Pass
NVNT	ac80	5290	5460	-49.95	-48.92	-47.22	8.92	57.75	Peak	68.2	Pass
NVNT	ac80	5290	5460	-57.58	-57.27	-55.7	8.92	49.74	Average	54	Pass
NVNT	ax20	5260	4500	-50.62	-49.5	-49.28	8.92	57.13	Peak	68.2	Pass
NVNT	ax20	5260	4500	-58.9	-58.31	-58.59	8.92	48.56	Average	54	Pass
NVNT	ax20	5260	5017.92	-46.32	-46.03	-46.3	8.92	60.99	Peak	68.2	Pass
NVNT	ax20	5260	5092.8	-56.59	-56.48	-56.41	8.92	50.62	Average	54	Pass
NVNT	ax20	5260	5150	-48	-48.65	-49.65	8.92	58.85	Peak	68.2	Pass
NVNT	ax20	5260	5150	-57.77	-56.97	-56.94	8.92	49.81	Average	54	Pass
NVNT	ax20	5320	5350	-47.75	-43.26	-46.07	8.92	62.21	Peak	68.2	Pass
NVNT	ax20	5320	5350	-56.06	-55.92	-55.58	8.92	51.17	Average	54	Pass
NVNT	ax20	5320	5350.8	-44.21	-50.37	-43.25	8.92	60.88	Peak	68.2	Pass
NVNT	ax20	5320	5352.2	-55.48	-57.41	-55.07	8.92	50.82	Average	54	Pass
NVNT	ax20	5320	5460	-48.93	-50.37	-49.44	8.92	57.57	Peak	68.2	Pass
NVNT	ax20	5320	5460	-57.34	-57.41	-57.84	8.92	49.78	Average	54	Pass
NVNT	ax40	5270	4500	-50.36	-50.18	-49.98	8.92	56.89	Peak	68.2	Pass
NVNT	ax40	5270	4500	-58.48	-58.73	-58.29	8.92	48.55	Average	54	Pass
NVNT	ax40	5270	5068.62	-46.52	-46.26	-45.76	8.92	60.77	Peak	68.2	Pass
NVNT	ax40	5270	5143.95	-56.34	-56.69	-56.57	8.92	50.65	Average	54	Pass
NVNT	ax40	5270	5150	-48.81	-48.76	-49.43	8.92	58.37	Peak	68.2	Pass
NVNT	ax40	5270	5150	-56.89	-56.99	-57.33	8.92	50.22	Average	54	Pass
NVNT	ax40	5310	5350	-47.04	-45.34	-44.65	8.92	61.05	Peak	68.2	Pass
NVNT	ax40	5310	5350	-55.02	-55.87	-55.72	8.92	51.73	Average	54	Pass
NVNT	ax40	5310	5351	-43.7	-40.5	-43.61	8.92	65.35	Peak	68.2	Pass
NVNT	ax40	5310	5350	-55.02	-55.25	-55.27	8.92	52.02	Average	54	Pass
NVNT	ax40	5310	5460	-48.93	-49.72	-49.73	8.92	57.85	Peak	68.2	Pass
NVNT	ax40	5310	5460	-57.4	-58.07	-57.58	8.92	49.44	Average	54	Pass
NVNT	ax80	5290	5350	-45.33	-45.63	-45.16	8.92	61.68	Peak	68.2	Pass
NVNT	ax80	5290	5350	-55.91	-55.37	-56.01	8.92	51.53	Average	54	Pass
NVNT	ax80	5290	5351.5	-45.16	-44.66	-44.48	8.92	62.26	Peak	68.2	Pass
NVNT	ax80	5290	5351	-55.51	-55.37	-55.66	8.92	51.72	Average	54	Pass
NVNT	ax80	5290	5460	-48.58	-49.92	-49.78	8.92	57.96	Peak	68.2	Pass
NVNT	ax80	5290	5460	-57.64	-57.18	-58.18	8.92	49.75	Average	54	Pass
NVNT	ax80	5290	4500	-50.97	-49.38	-50.53	8.92	57.06	Peak	68.2	Pass
NVNT	ax80	5290	4500	-58.57	-58.14	-58.6	8.92	48.81	Average	54	Pass
NVNT	ax80	5290	5147.28	-44.7	-46.12	-44.81	8.92	61.81	Peak	68.2	Pass
NVNT	ax80	5290	5148.15	-55.23	-55.03	-55.54	8.92	52.03	Average	54	Pass
NVNT	ax80	5290	5150	-47.58	-48.14	-47.47	8.92	59.31	Peak	68.2	Pass
NVNT	ax80	5290	5150	-55.63	-55.44	-55.79	8.92	51.62	Average	54	Pass
NVNT	be20	5260	4500	-49.19	-50.63	-50.3	8.92	57.31	Peak	68.2	Pass
NVNT	be20	5260	4500	-58.51	-58.13	-58.87	8.92	48.84	Average	54	Pass
NVNT	be20	5260	4957.08	-46.45	-45.66	-46.33	8.92	61.12	Peak	68.2	Pass
NVNT	be20	5260	5071.74	-56.58	-56.52	-56.58	8.92	50.61	Average	54	Pass
NVNT	be20	5260	5150	-49.67	-48.56	-46.43	8.92	58.08	Peak	68.2	Pass
NVNT	be20	5260	5150	-57.32	-57.37	-57.52	8.92	49.81	Average	54	Pass
NVNT	be20	5320	5350	-46.11	-43.15	-48.71	8.92	62.78	Peak	68.2	Pass
NVNT	be20	5320	5350	-56.18	-56.71	-55.29	8.92	50.72	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be20	5320	5350.2	-43.31	-41.81	-44.11	8.92	64.66	Peak	68.2	Pass
NVNT	be20	5320	5350.2	-55.67	-55.53	-55.29	8.92	51.56	Average	54	Pass
NVNT	be20	5320	5460	-48.38	-49.22	-49.09	8.92	58.38	Peak	68.2	Pass
NVNT	be20	5320	5460	-57.39	-57.86	-57.57	8.92	49.54	Average	54	Pass
NVNT	be40	5270	4500	-50.93	-50.15	-51.11	8.92	56.64	Peak	68.2	Pass
NVNT	be40	5270	4500	-58.92	-58.52	-58.7	8.92	48.44	Average	54	Pass
NVNT	be40	5270	4974.66	-45.57	-46.08	-46.39	8.92	61.34	Peak	68.2	Pass
NVNT	be40	5270	5086.44	-56.65	-56.49	-56.65	8.92	50.59	Average	54	Pass
NVNT	be40	5270	5150	-47.98	-47.99	-49.22	8.92	59.17	Peak	68.2	Pass
NVNT	be40	5270	5150	-57.67	-57	-57.62	8.92	49.84	Average	54	Pass
NVNT	be40	5310	5350	-45.39	-44.1	-43.62	8.92	62.46	Peak	68.2	Pass
NVNT	be40	5310	5350	-55.94	-55.59	-55.82	8.92	51.40	Average	54	Pass
NVNT	be40	5310	5350.2	-43.68	-44.1	-50.03	8.92	63.27	Peak	68.2	Pass
NVNT	be40	5310	5350	-55.94	-55.48	-57.9	8.92	51.45	Average	54	Pass
NVNT	be40	5310	5460	-48.21	-49.63	-50.03	8.92	58.30	Peak	68.2	Pass
NVNT	be40	5310	5460	-57.43	-58.22	-57.9	8.92	49.35	Average	54	Pass
NVNT	be80	5290	5350	-44.37	-44.5	-48.58	8.92	62.72	Peak	68.2	Pass
NVNT	be80	5290	5350	-55.76	-56.26	-55.34	8.92	51.16	Average	54	Pass
NVNT	be80	5290	5350.5	-44.18	-42.98	-44.66	8.92	63.62	Peak	68.2	Pass
NVNT	be80	5290	5351.25	-55.45	-55.93	-55.34	8.92	51.47	Average	54	Pass
NVNT	be80	5290	5460	-50.47	-48.42	-49.24	8.92	57.83	Peak	68.2	Pass
NVNT	be80	5290	5460	-57.83	-58.15	-57.84	8.92	49.17	Average	54	Pass
NVNT	be80	5290	4500	-50.85	-50.72	-50.08	8.92	56.37	Peak	68.2	Pass
NVNT	be80	5290	4500	-58.9	-58.76	-58.79	8.92	48.33	Average	54	Pass
NVNT	be80	5290	5142.06	-43.73	-45.34	-45.22	8.92	62.70	Peak	68.2	Pass
NVNT	be80	5290	5149.02	-54.94	-54.71	-55.04	8.92	52.33	Average	54	Pass
NVNT	be80	5290	5150	-46.13	-46.49	-46.7	8.92	60.85	Peak	68.2	Pass
NVNT	be80	5290	5150	-55.14	-55.06	-55.08	8.92	52.06	Average	54	Pass
NVNT	ac160	5250	5350	-42.65	-54.66	-47.58	8.92	61.76	Peak	68.2	Pass
NVNT	ac160	5250	5350	-65.66	-63.9	-62.79	8.92	42.47	Average	54	Pass
NVNT	ac160	5250	5350.11	-42.65	-42.81	-42.18	8.92	64.43	Peak	68.2	Pass
NVNT	ac160	5250	5350.48	-61.89	-60.94	-60.23	8.92	45.77	Average	54	Pass
NVNT	ac160	5250	5460	-57.72	-58.89	-57.25	8.92	48.89	Peak	68.2	Pass
NVNT	ac160	5250	5460	-66.55	-67.38	-66.76	8.92	40.21	Average	54	Pass
NVNT	ac160	5250	4500	-60.77	-60.22	-60.01	8.92	46.67	Peak	68.2	Pass
NVNT	ac160	5250	4500	-68.98	-68.57	-68.55	8.92	38.39	Average	54	Pass
NVNT	ac160	5250	5121.53	-52.09	-50.24	-51.77	8.92	56.09	Peak	68.2	Pass
NVNT	ac160	5250	5107.88	-64.96	-63.87	-64.91	8.92	42.78	Average	54	Pass
NVNT	ac160	5250	5150	-56.96	-56.26	-55.86	8.92	50.56	Peak	68.2	Pass
NVNT	ac160	5250	5150	-65.83	-66.26	-66.12	8.92	41.12	Average	54	Pass
NVNT	ax160	5250	5350	-54.42	-51.53	-49.79	8.92	54.42	Peak	68.2	Pass
NVNT	ax160	5250	5350	-64.16	-63.93	-60.69	8.92	43.11	Average	54	Pass
NVNT	ax160	5250	5393.4	-44.24	-43.98	-41.01	8.92	63.05	Peak	68.2	Pass
NVNT	ax160	5250	5402.28	-61.68	-61.72	-56.87	8.92	45.46	Average	54	Pass
NVNT	ax160	5250	5460	-57.84	-59.17	-54.82	8.92	48.70	Peak	68.2	Pass
NVNT	ax160	5250	5460	-66.81	-66.72	-66.17	8.92	40.39	Average	54	Pass
NVNT	ax160	5250	4500	-60.94	-61.48	-60.67	8.92	45.96	Peak	68.2	Pass
NVNT	ax160	5250	4500	-68.12	-68.5	-68.88	8.92	38.85	Average	54	Pass
NVNT	ax160	5250	5133.36	-52.38	-50.69	-48.5	8.92	55.70	Peak	68.2	Pass
NVNT	ax160	5250	5141.55	-63.99	-63.05	-62.78	8.92	43.66	Average	54	Pass
NVNT	ax160	5250	5150	-55.23	-55.59	-53.79	8.92	51.75	Peak	68.2	Pass
NVNT	ax160	5250	5150	-65.16	-65.03	-63.81	8.92	42.06	Average	54	Pass
NVNT	be160	5250	5350	-51.77	-48.55	-37.64	8.92	57.29	Peak	68.2	Pass
NVNT	be160	5250	5350	-57.62	-57.18	-57.39	8.92	49.76	Average	54	Pass
NVNT	be160	5250	5351.59	-45.66	-41.72	-37.64	8.92	63.90	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be160	5250	5435.21	-56.97	-56.33	-55.7	8.92	50.52	Average	54	Pass
NVNT	be160	5250	5460	-50.42	-48.83	-49.36	8.92	57.61	Peak	68.2	Pass
NVNT	be160	5250	5460	-57.63	-57.63	-57.65	8.92	49.53	Average	54	Pass
NVNT	be160	5250	4500	-51.11	-48.62	-50.01	8.92	57.47	Peak	68.2	Pass
NVNT	be160	5250	4500	-58.13	-59.09	-59.23	8.92	48.57	Average	54	Pass
NVNT	be160	5250	5022.34	-46.21	-46.02	-41.51	8.92	61.04	Peak	68.2	Pass
NVNT	be160	5250	5077.85	-56.35	-56.26	-55.74	8.92	50.85	Average	54	Pass
NVNT	be160	5250	5150	-48.16	-48.07	-44.85	8.92	59.04	Peak	68.2	Pass
NVNT	be160	5250	5150	-57.39	-57.36	-57.04	8.92	49.78	Average	54	Pass





C.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5260	0	0	25	Pass
NVNT	a	5300	Ant1	5300	0	0	25	Pass
NVNT	a	5320	Ant1	5320	0	0	25	Pass
NVNT	n20	5260	Ant1	5260	0	0	25	Pass
NVNT	n20	5300	Ant1	5300.02	20000	3.77	25	Pass
NVNT	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant1	5270	0	0	25	Pass
NVNT	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant1	5320	0	0	25	Pass
NVNT	ac40	5270	Ant1	5270	0	0	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass
NVNT	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant1	5270	0	0	25	Pass
NVNT	ax40	5310	Ant1	5310	0	0	25	Pass
NVNT	ax80	5290	Ant1	5290	0	0	25	Pass
NVNT	be20	5260	Ant1	5260	0	0	25	Pass
NVNT	be20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	be20	5320	Ant1	5320	0	0	25	Pass
NVNT	be40	5270	Ant1	5270	0	0	25	Pass
NVNT	be40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	be80	5290	Ant1	5290	0	0	25	Pass
NVNT	ac160	5250	Ant1	5250	0	0	25	Pass
NVNT	ax160	5250	Ant1	5250	0	0	25	Pass
NVNT	be160	5250	Ant1	5250	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

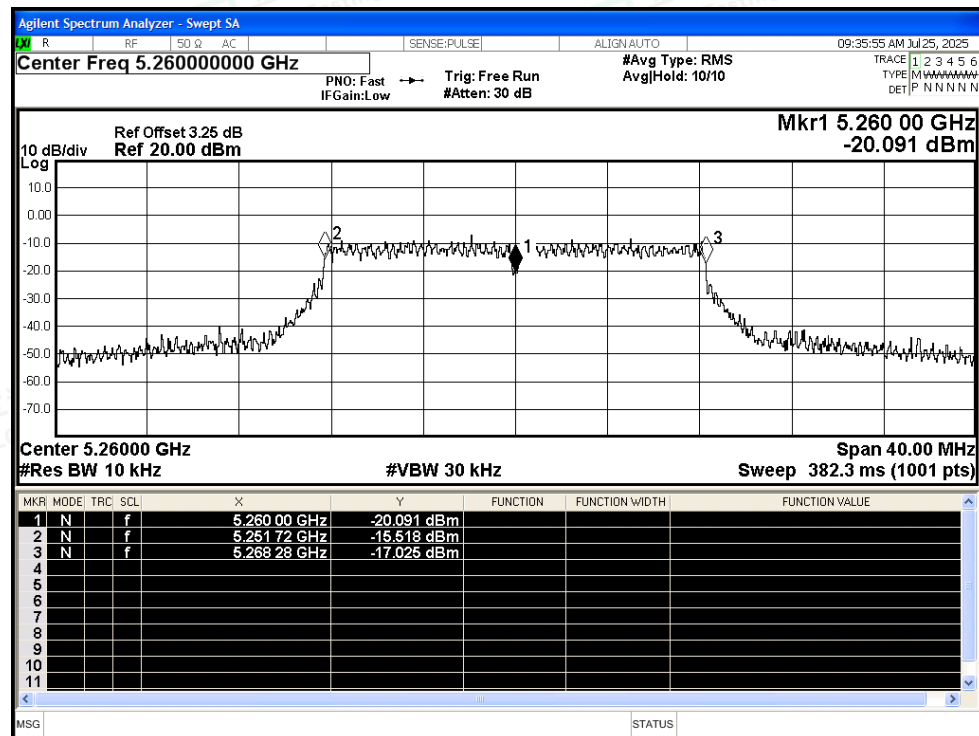

Freq. Stability NVNT a 5300MHz Ant1

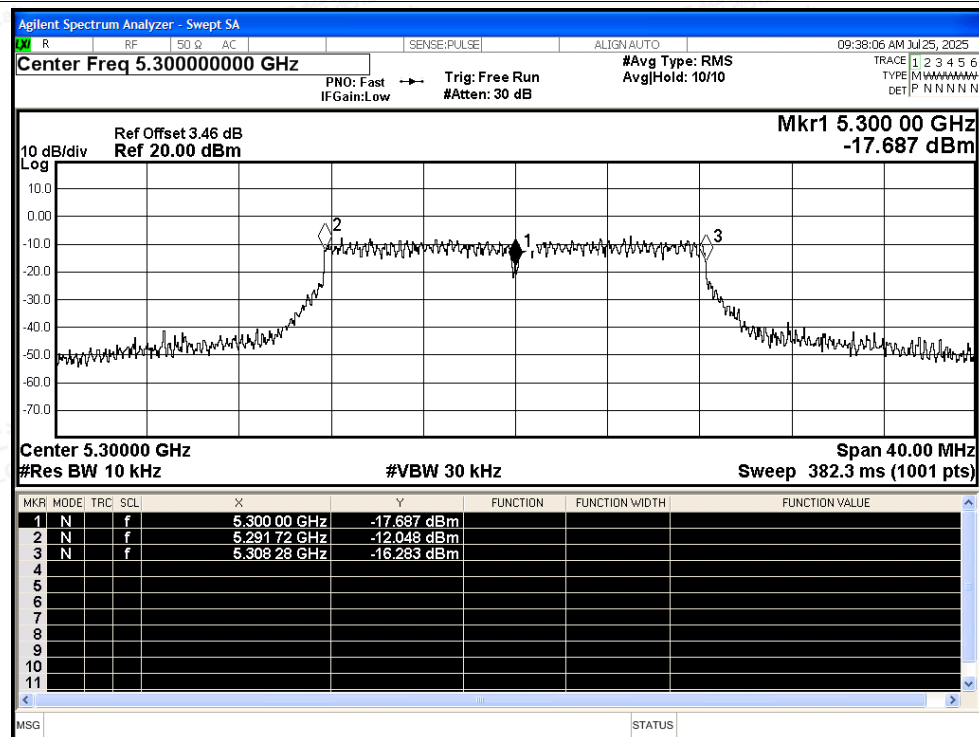

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant1

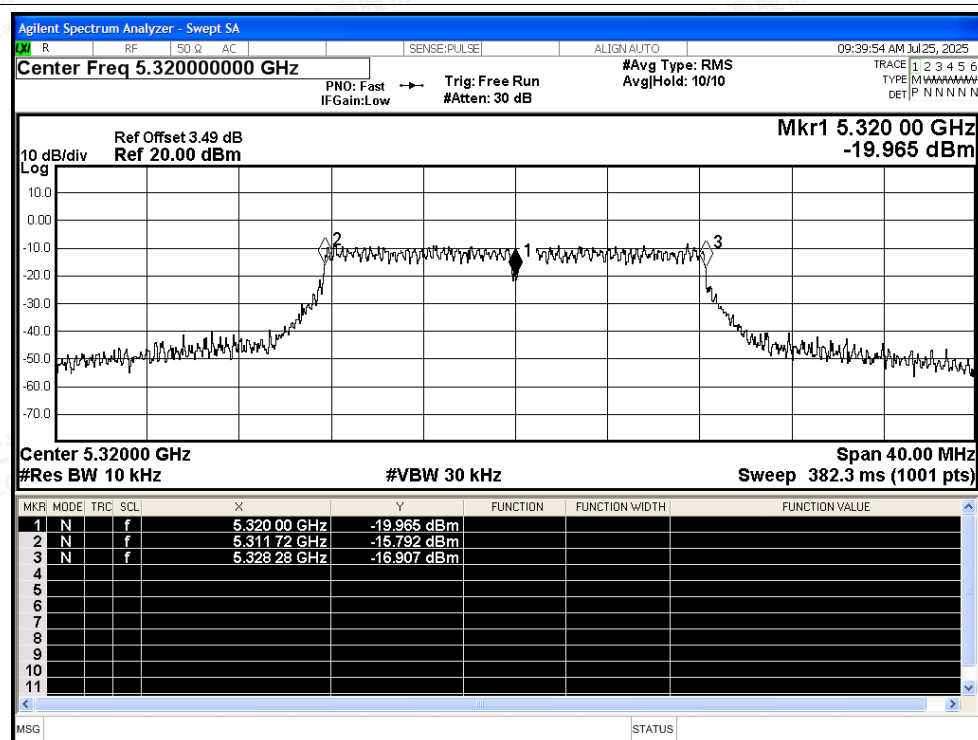

Freq. Stability NVNT n20 5260MHz Ant1

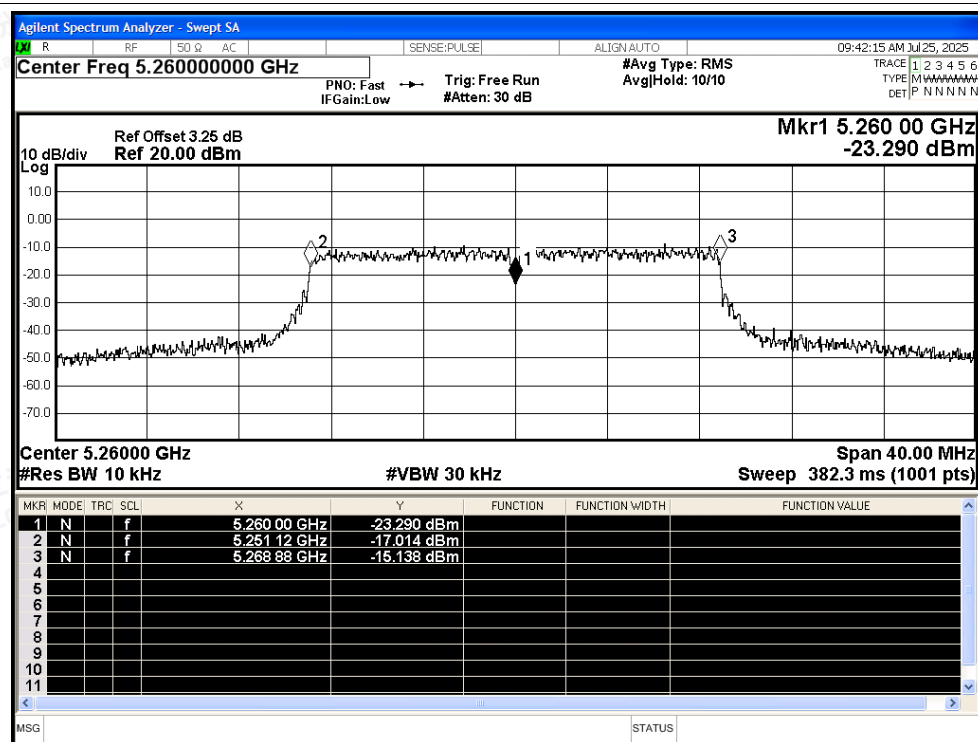

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant1

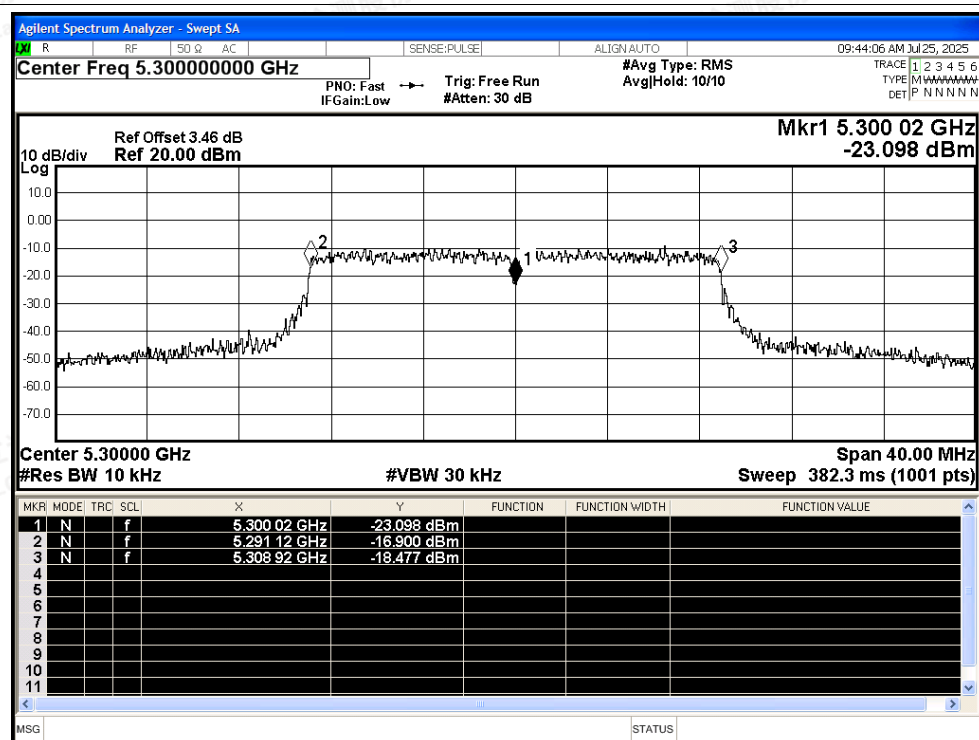

Freq. Stability NVNT n20 5320MHz Ant1

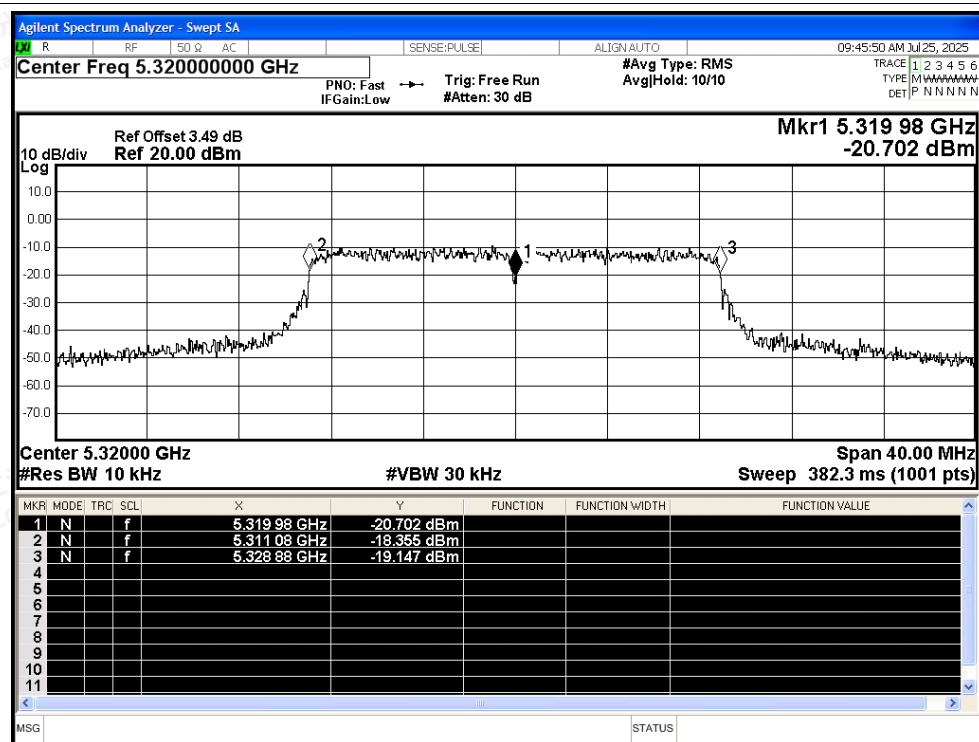

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

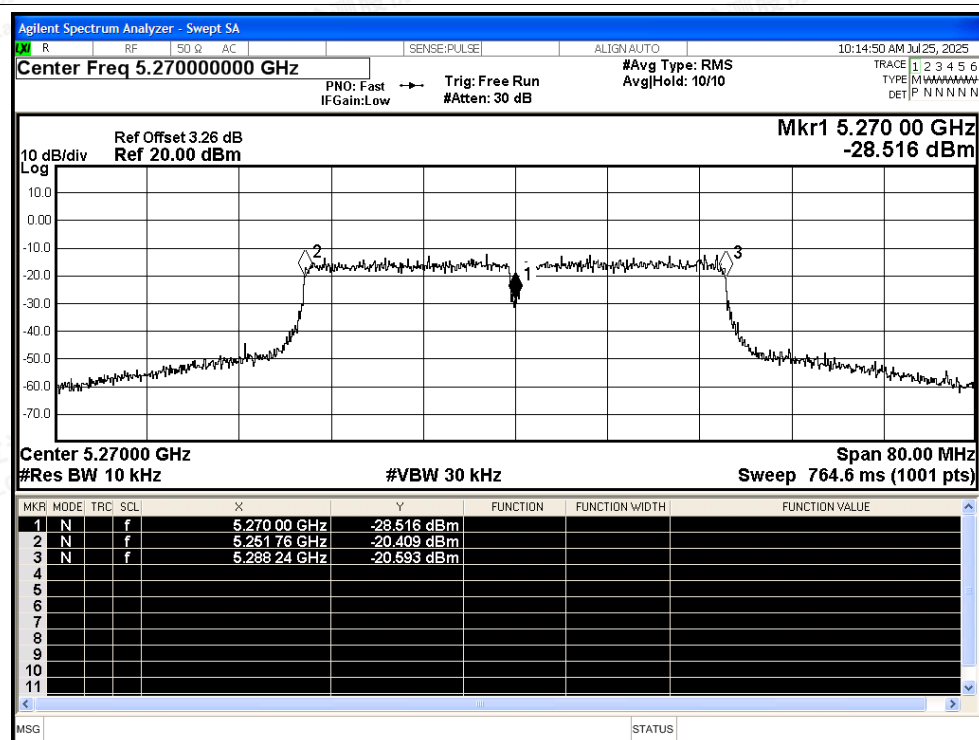

Freq. Stability NVNT n40 5310MHz Ant1

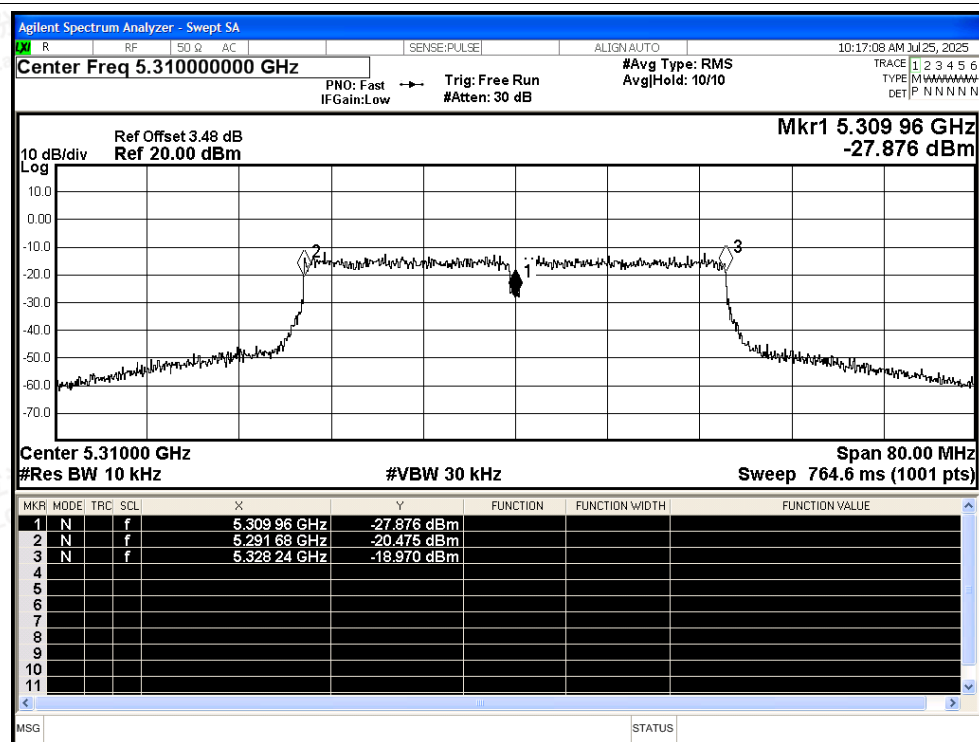

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

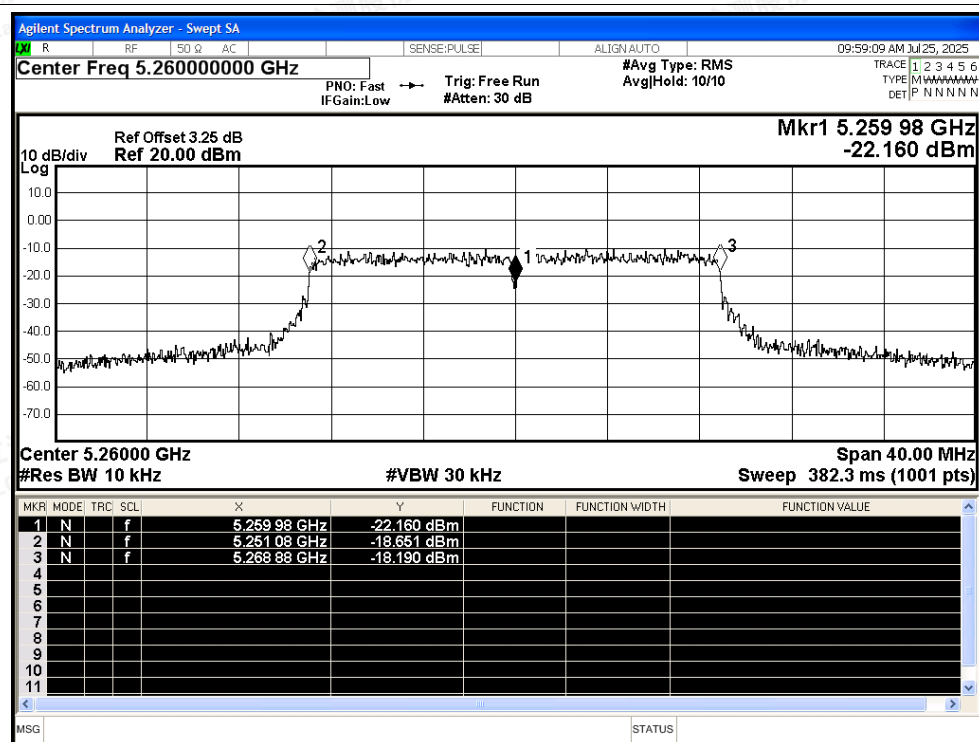

Freq. Stability NVNT ac20 5300MHz Ant1

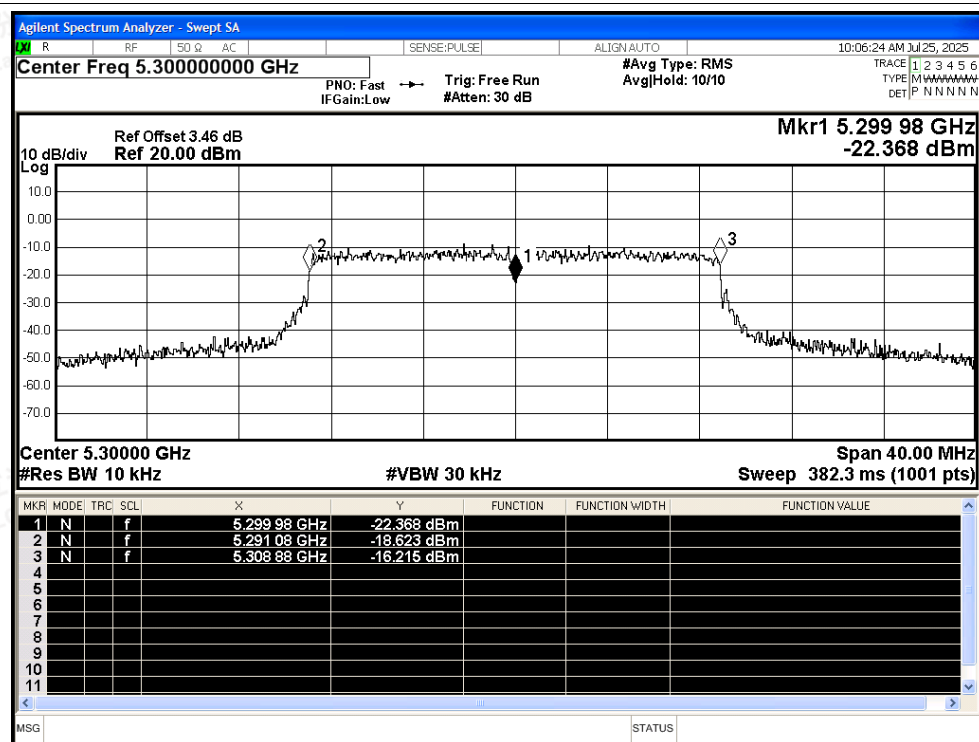

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

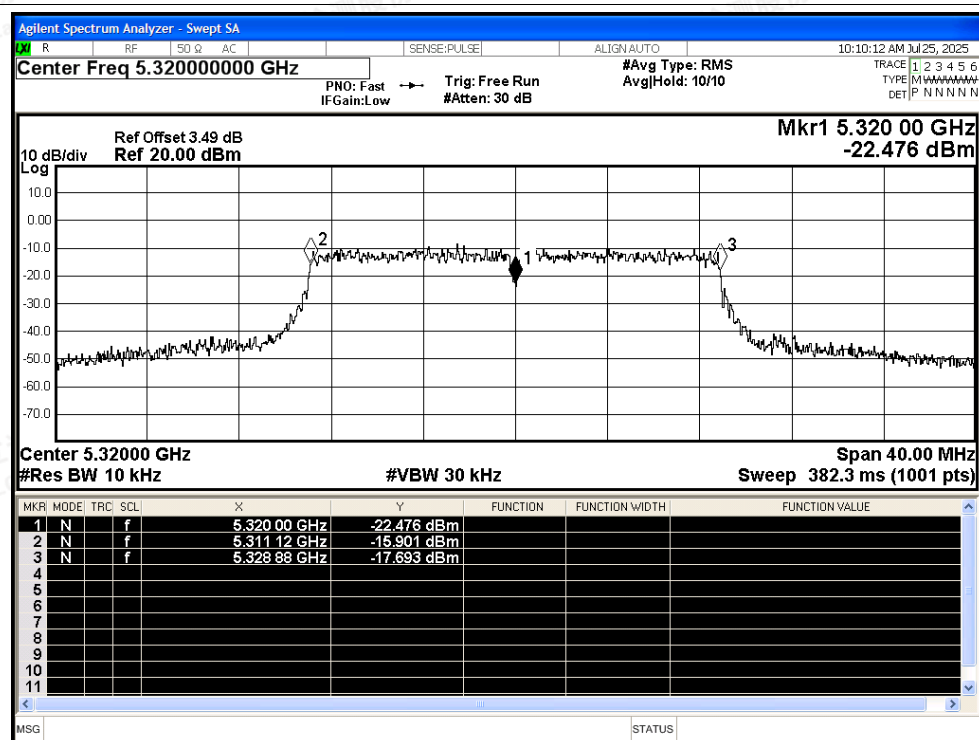

Freq. Stability NVNT ac40 5270MHz Ant1

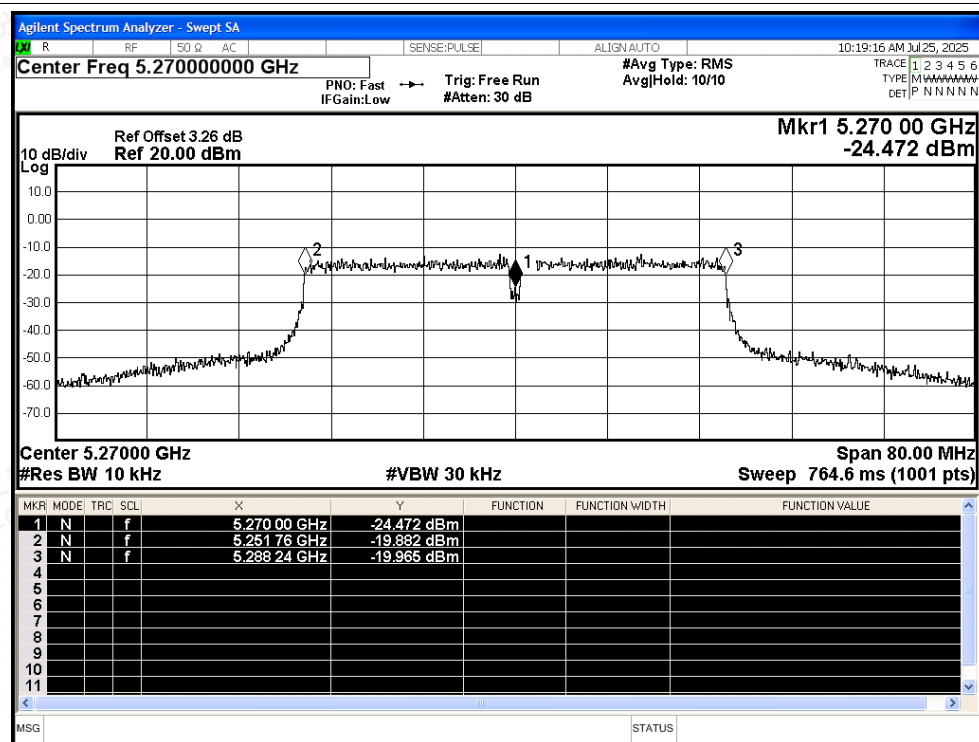

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

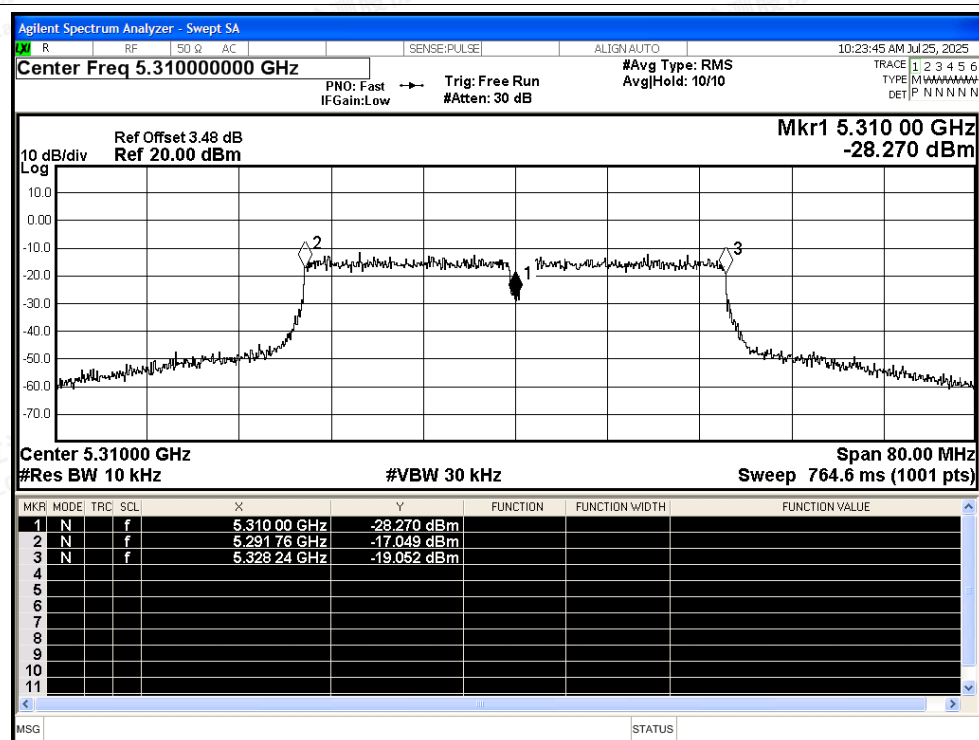

Freq. Stability NVNT ac80 5290MHz Ant1

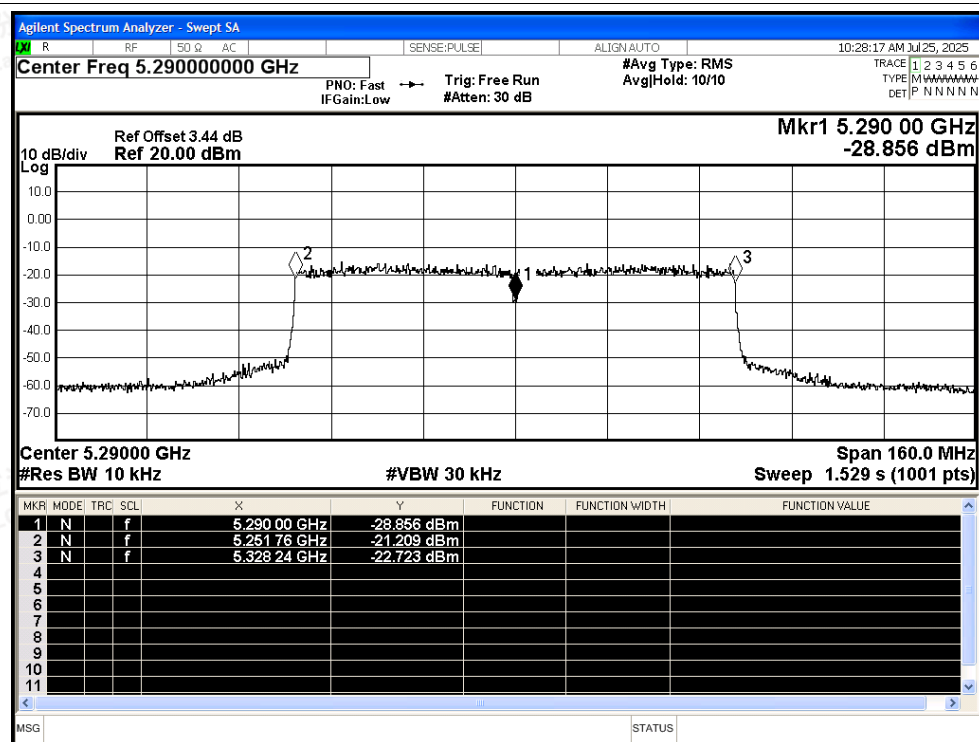

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant1

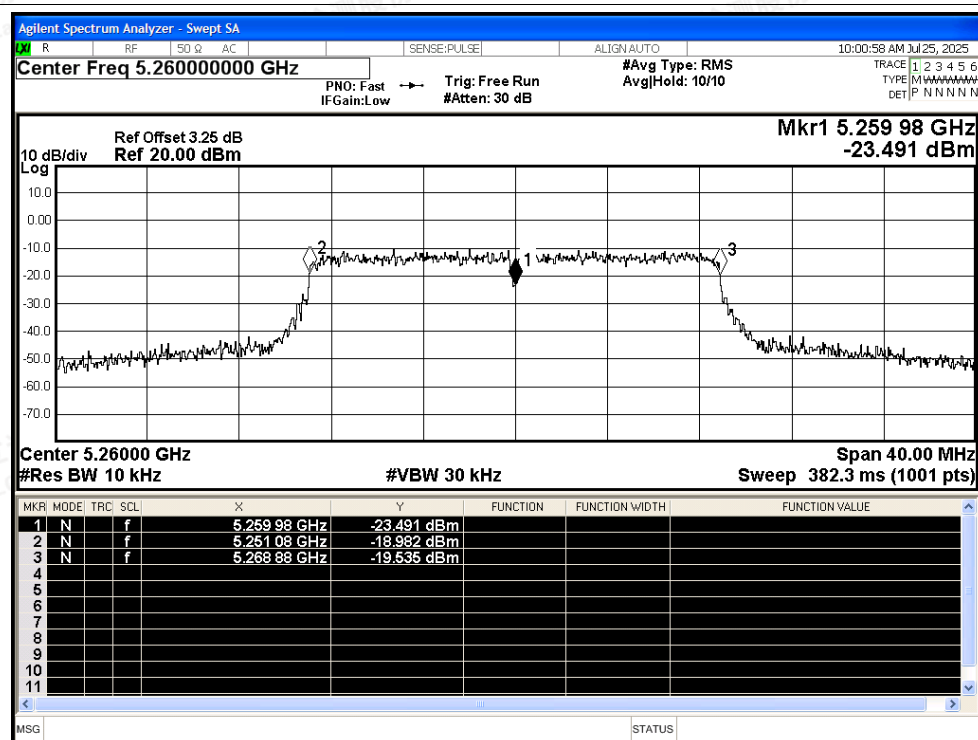

Freq. Stability NVNT ax20 5300MHz Ant1

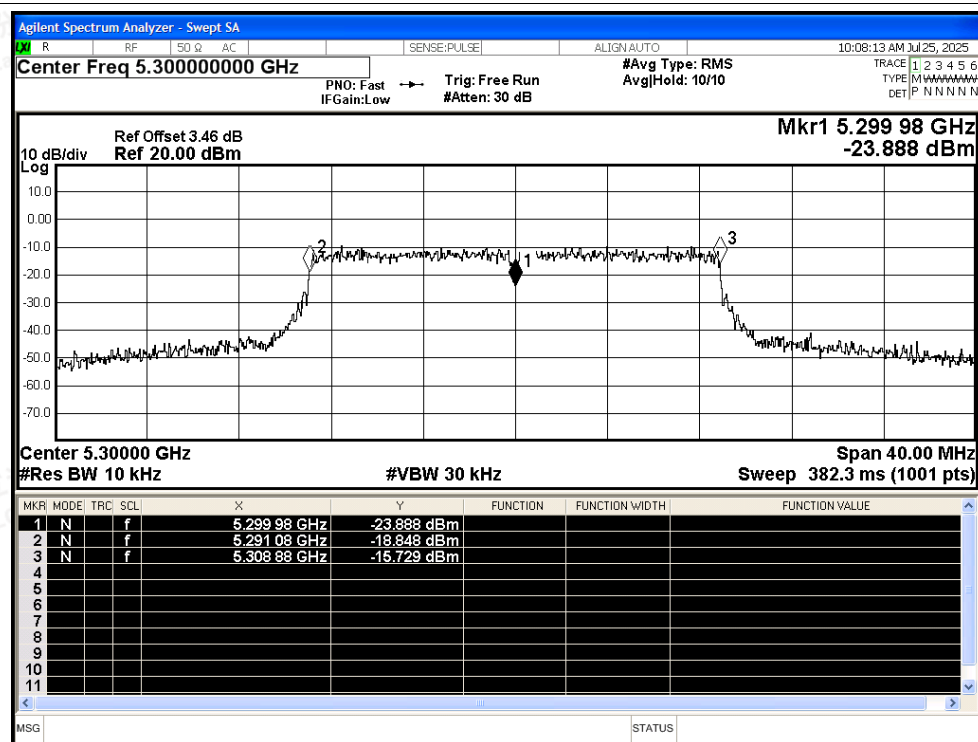

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant1

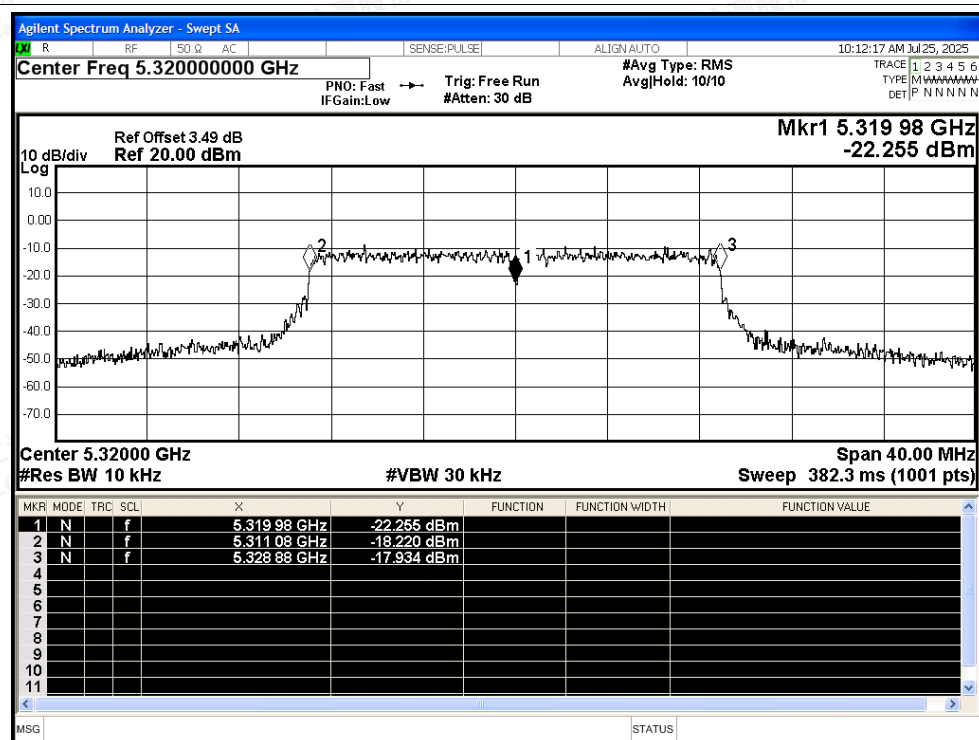

Freq. Stability NVNT ax40 5270MHz Ant1

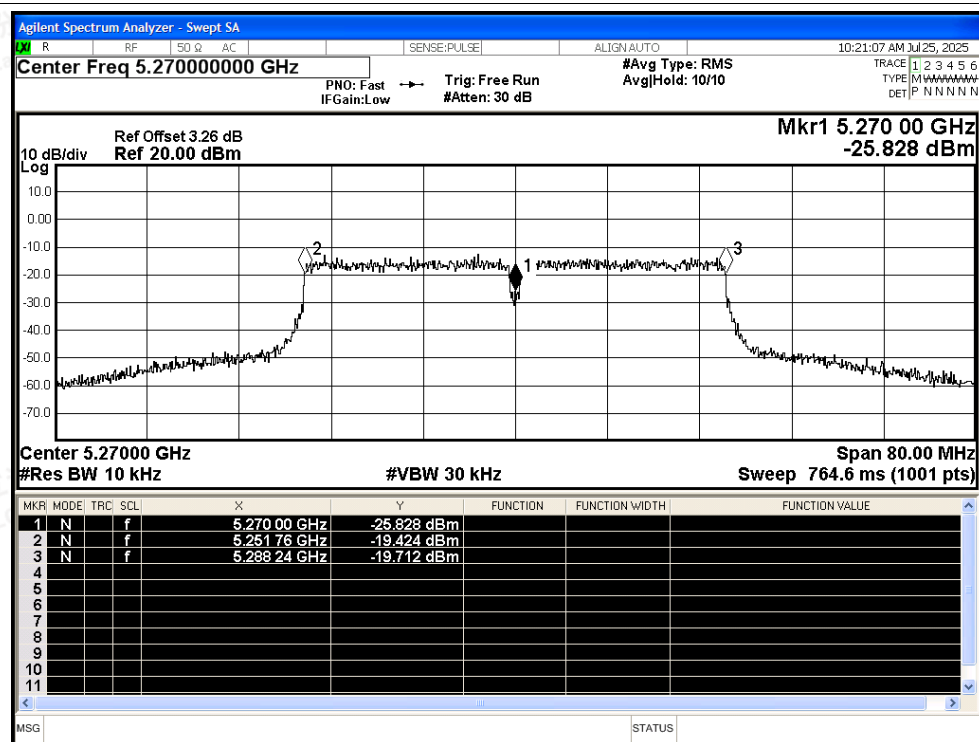

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant1

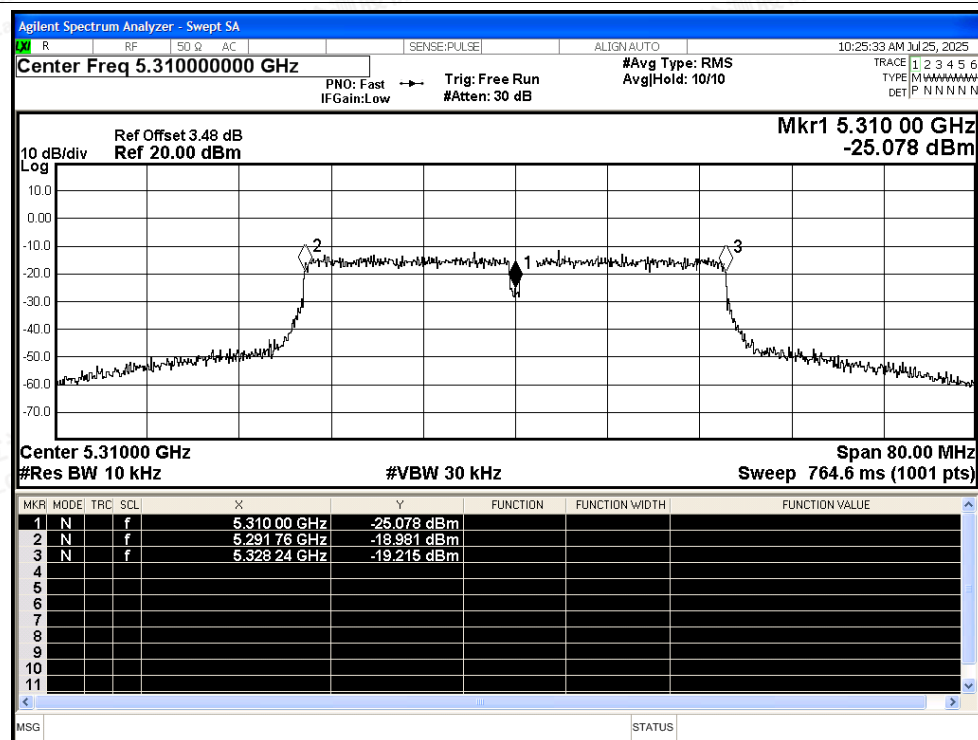

Freq. Stability NVNT ax80 5290MHz Ant1

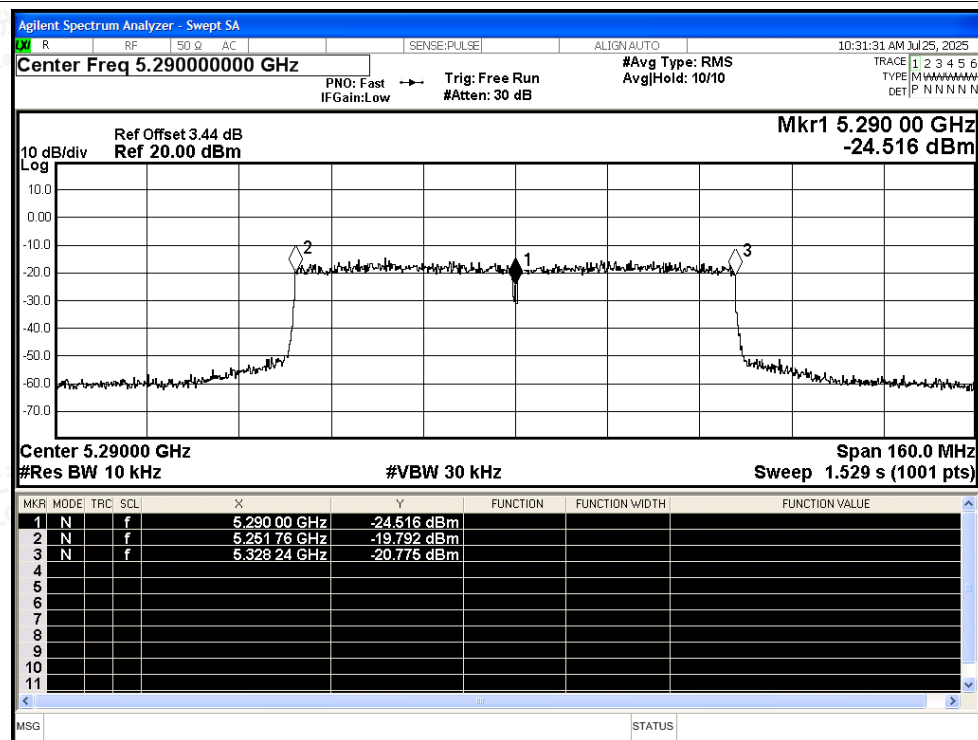

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5260MHz Ant1

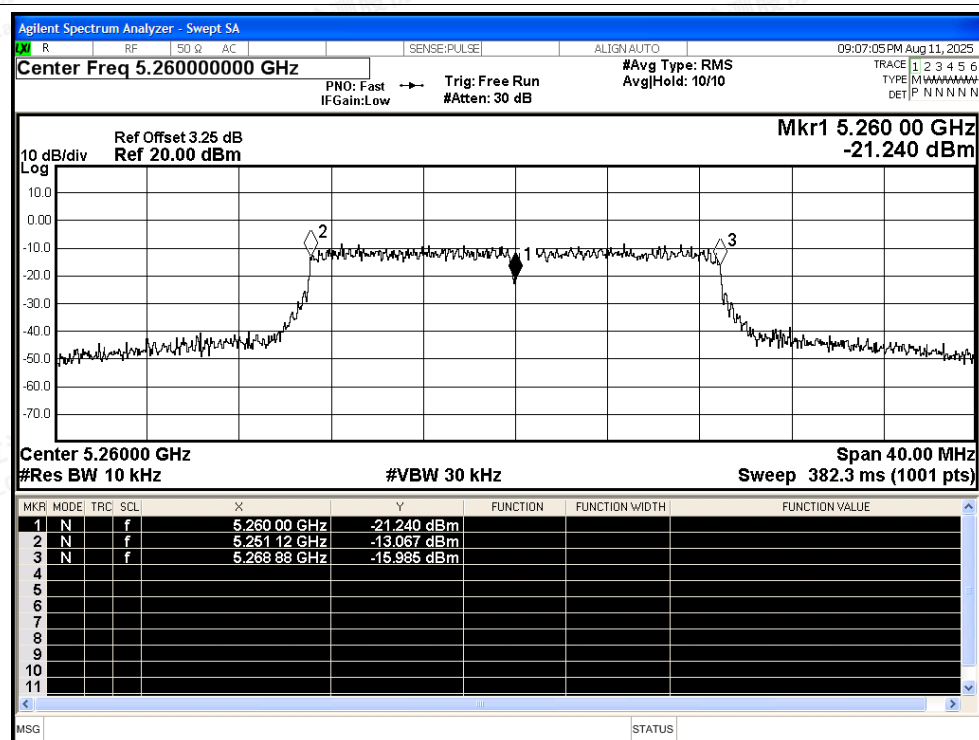

Freq. Stability NVNT be20 5300MHz Ant1

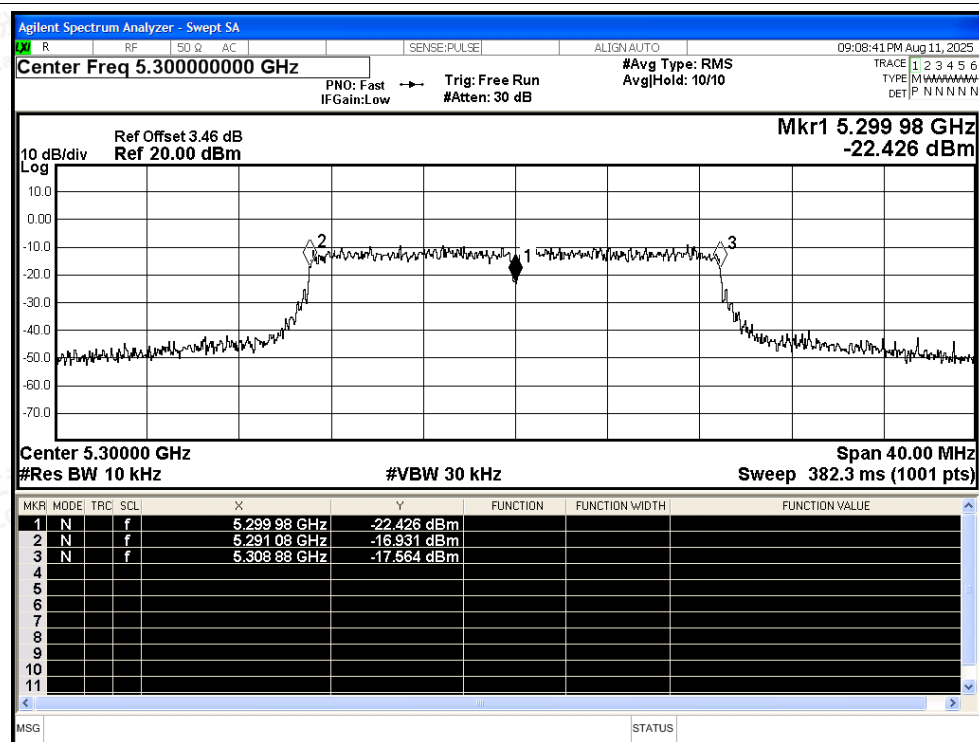

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5320MHz Ant1

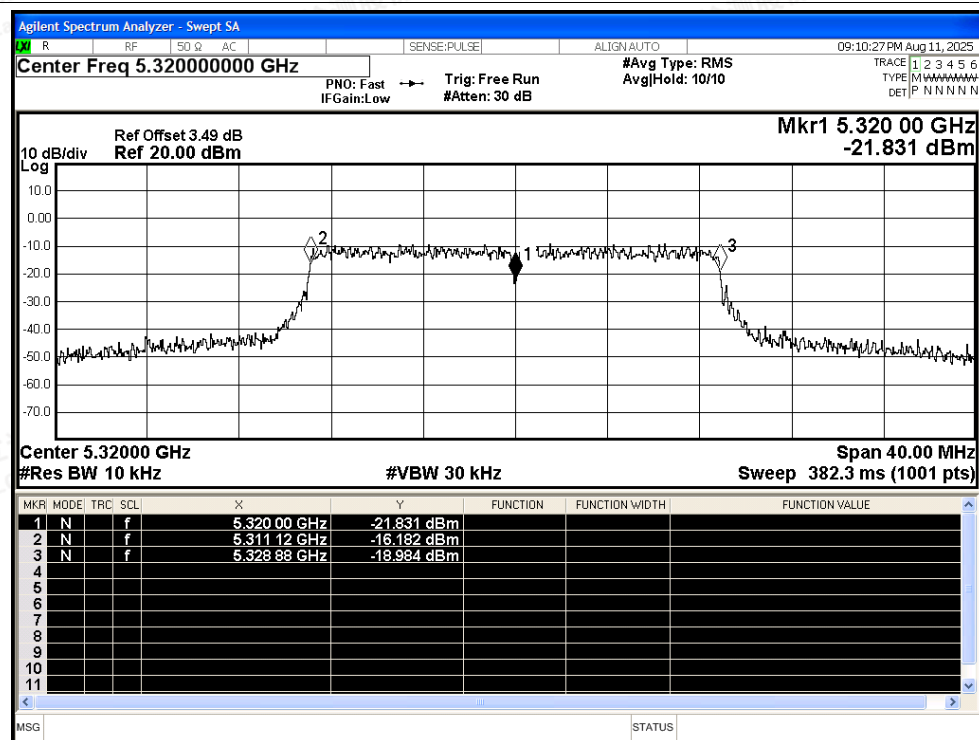

Freq. Stability NVNT be40 5270MHz Ant1

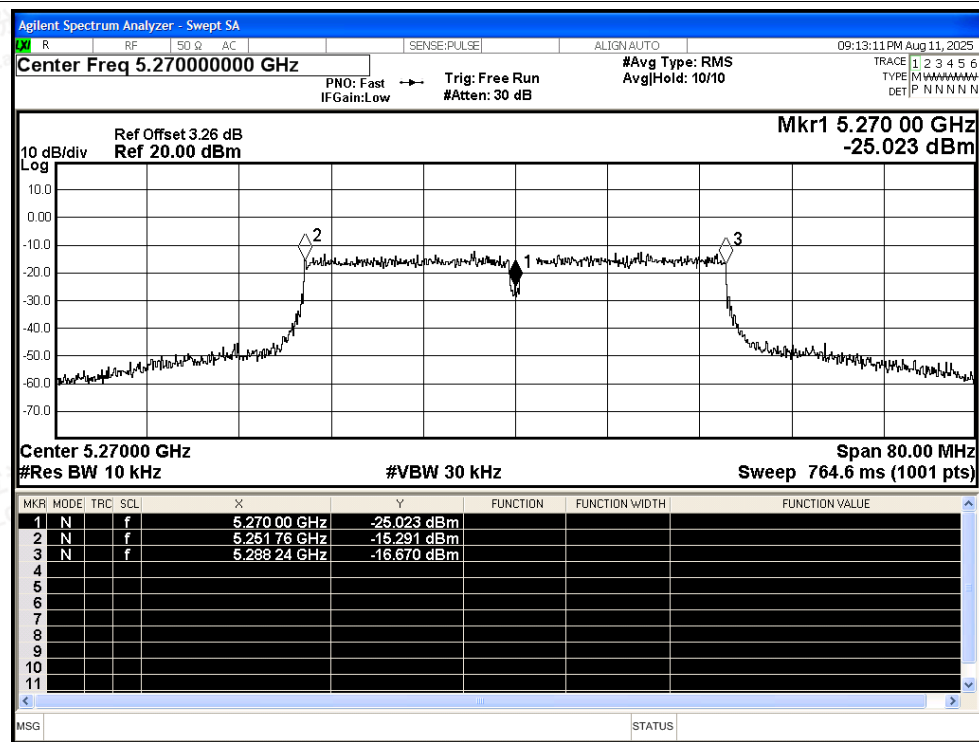

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be40 5310MHz Ant1

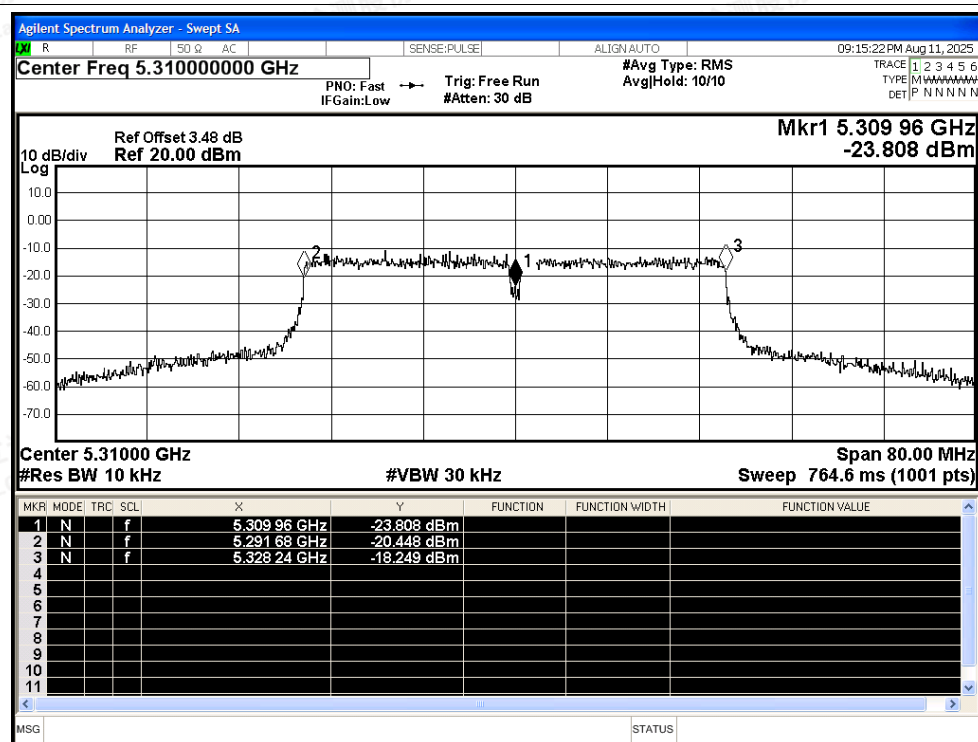

Freq. Stability NVNT be80 5290MHz Ant1

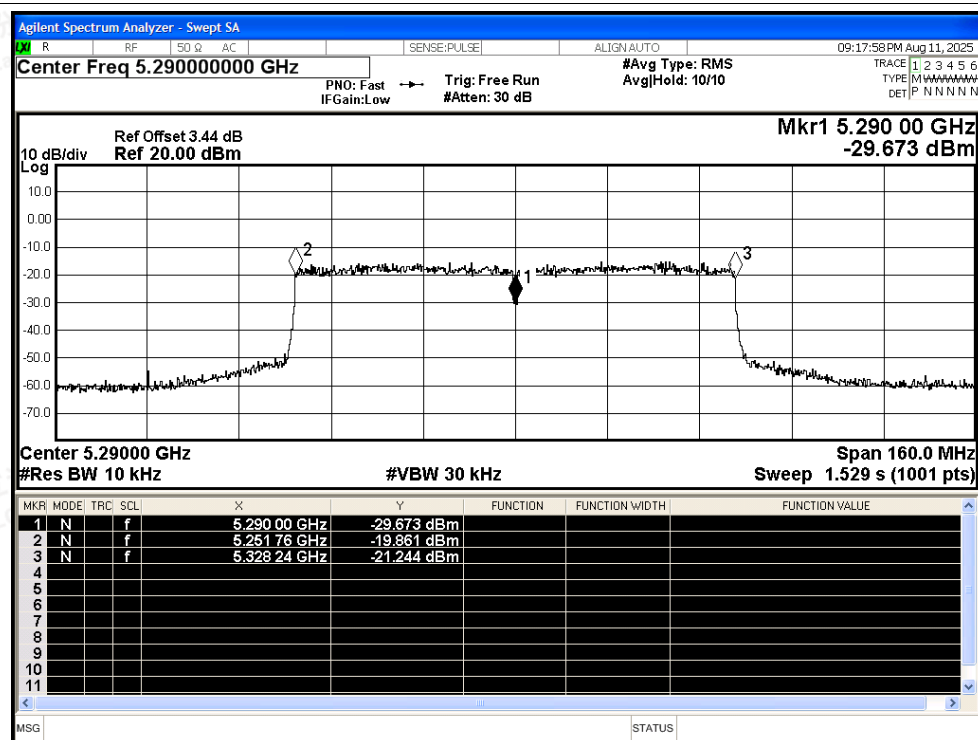

Freq. Stability NVNT ac160 5250MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

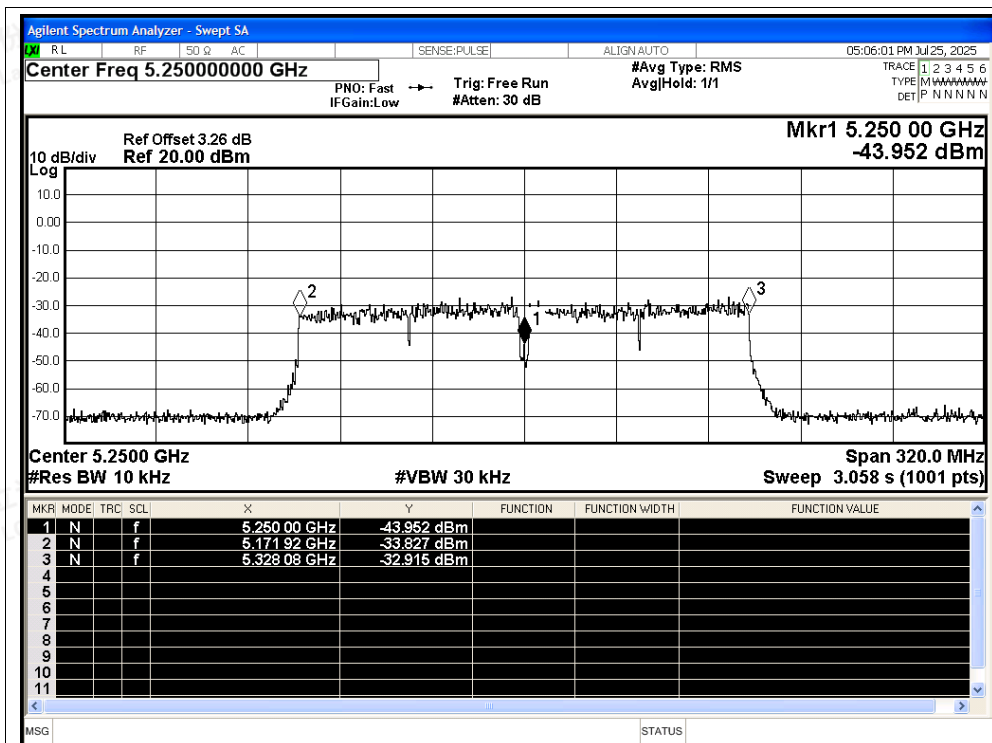

Freq. Stability NVNT ax160 5250MHz Ant1

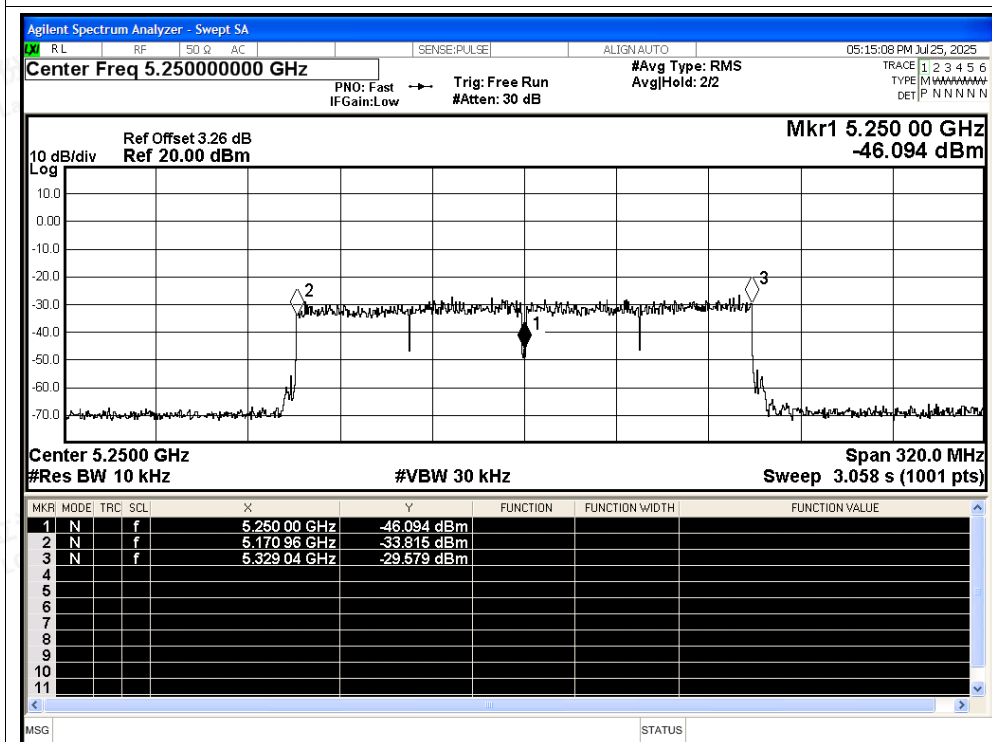

Freq. Stability NVNT be160 5250MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

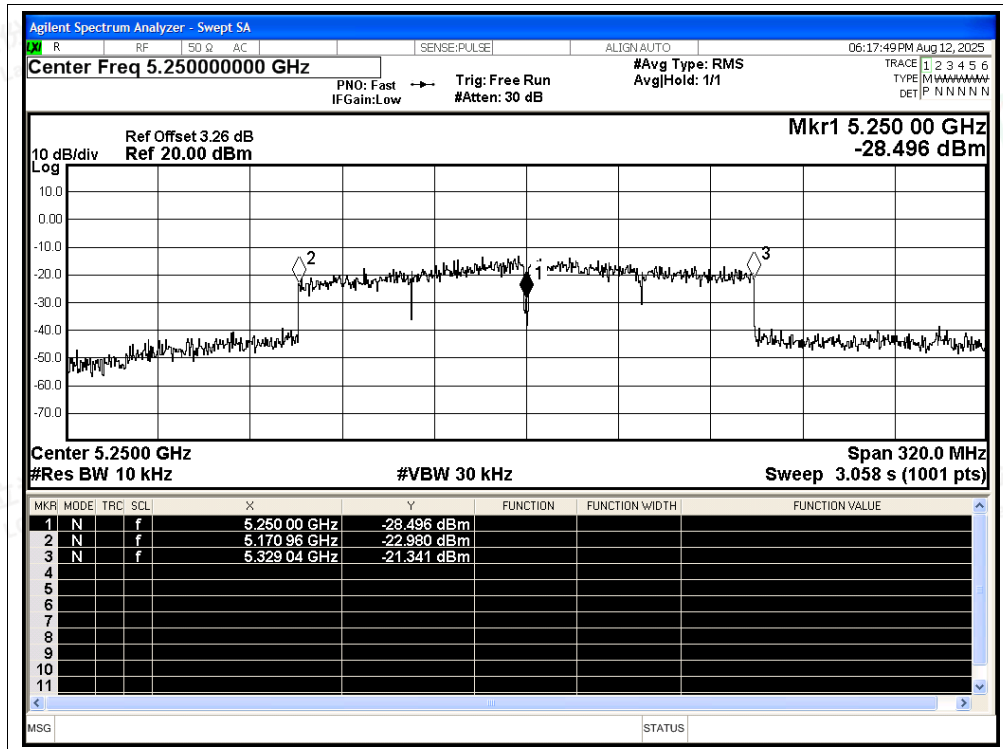

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5260	0	0	25	Pass
NVNT	a	5300	Ant2	5300	0	0	25	Pass
NVNT	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant2	5300	0	0	25	Pass
NVNT	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant2	5270	0	0	25	Pass
NVNT	ac40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass
NVNT	ax20	5260	Ant2	5260	0	0	25	Pass
NVNT	ax20	5300	Ant2	5300	0	0	25	Pass
NVNT	ax20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant2	5270	0	0	25	Pass
NVNT	ax40	5310	Ant2	5310	0	0	25	Pass
NVNT	ax80	5290	Ant2	5290	0	0	25	Pass
NVNT	be20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	be20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	be20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	be40	5270	Ant2	5270	0	0	25	Pass
NVNT	be40	5310	Ant2	5310	0	0	25	Pass
NVNT	be80	5290	Ant2	5290	0	0	25	Pass
NVNT	ac160	5250	Ant2	5250	0	0	25	Pass
NVNT	ax160	5250	Ant2	5250	0	0	25	Pass
NVNT	be160	5250	Ant2	5250	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

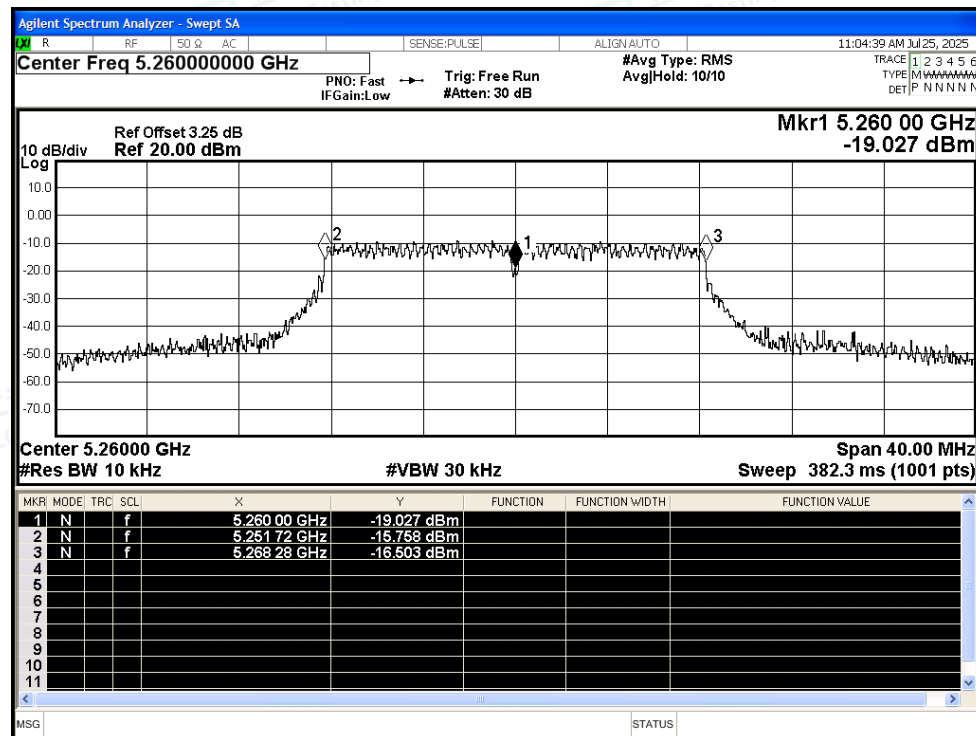

Freq. Stability NVNT a 5300MHz Ant2

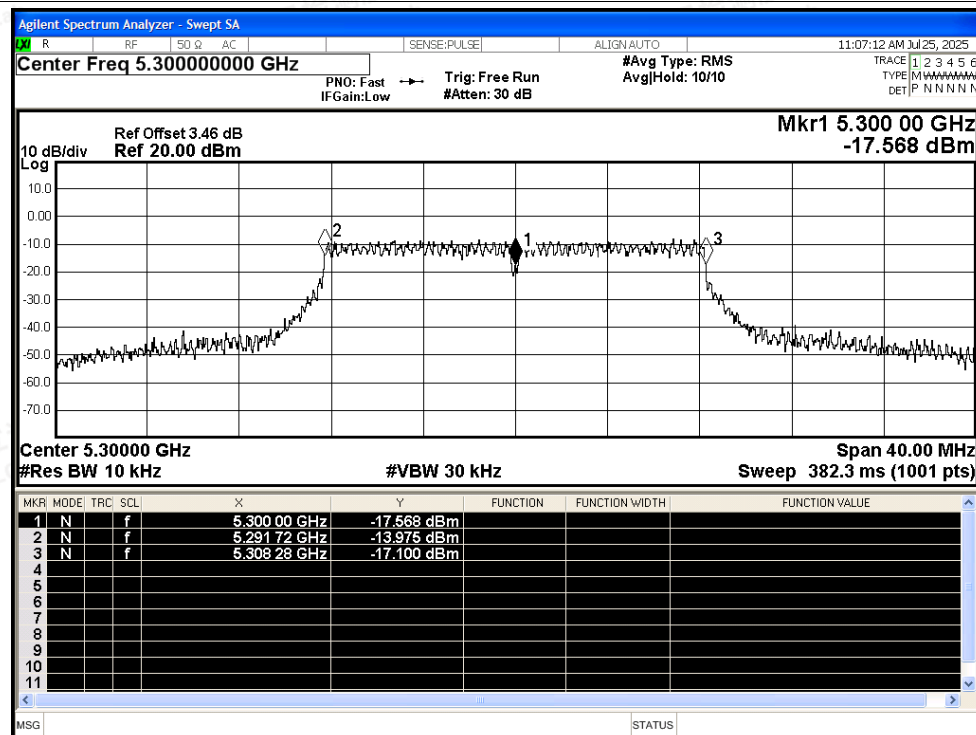

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant2

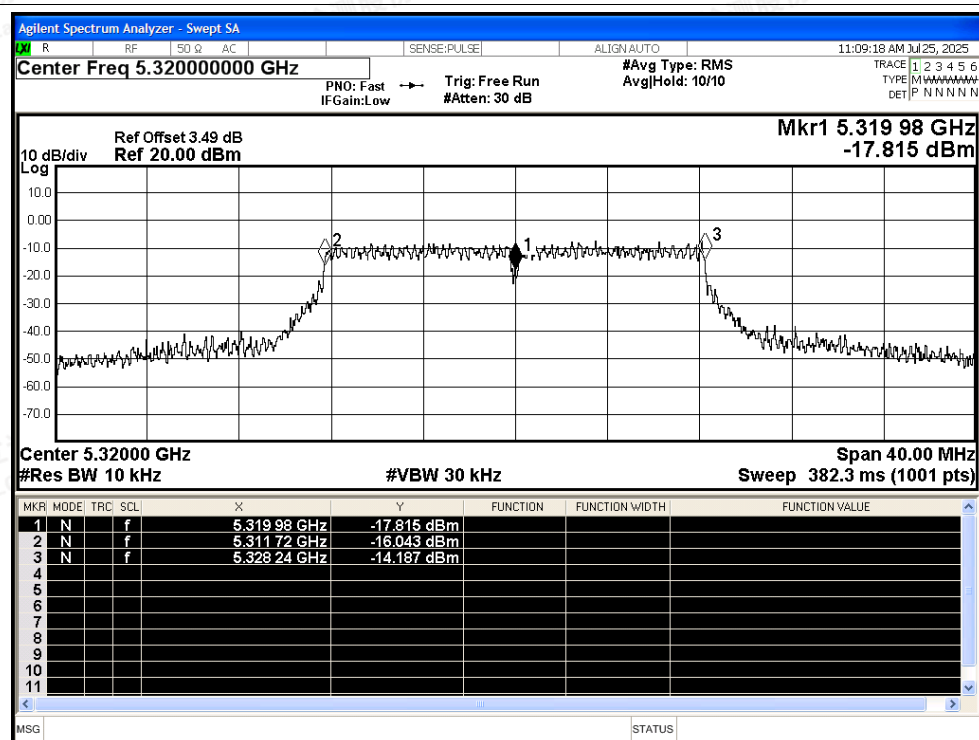

Freq. Stability NVNT n20 5260MHz Ant2

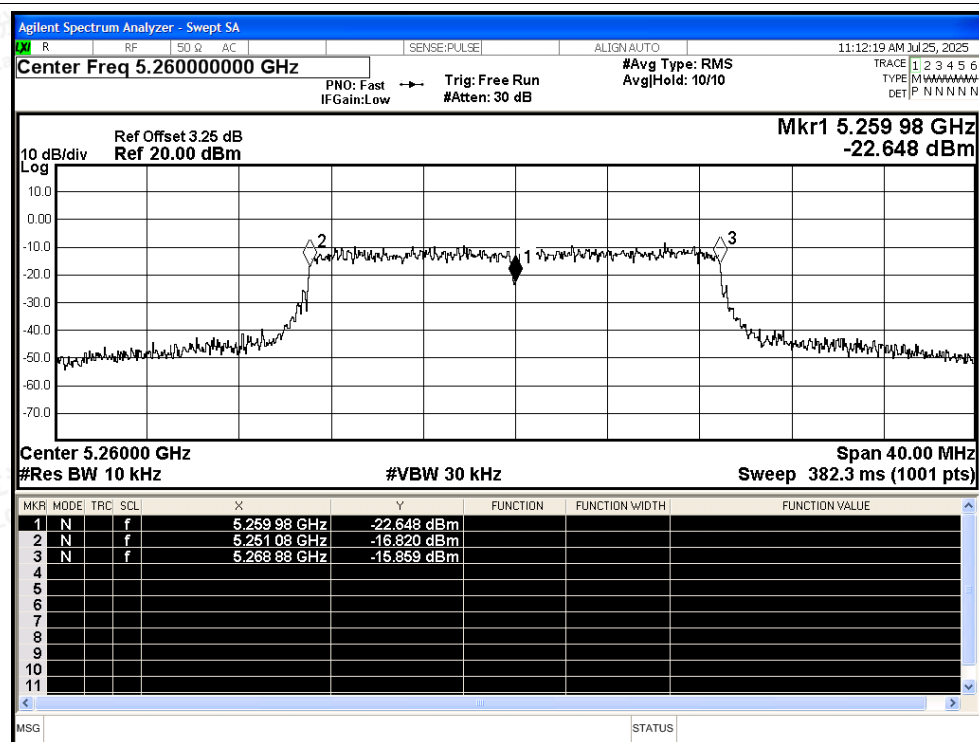

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant2

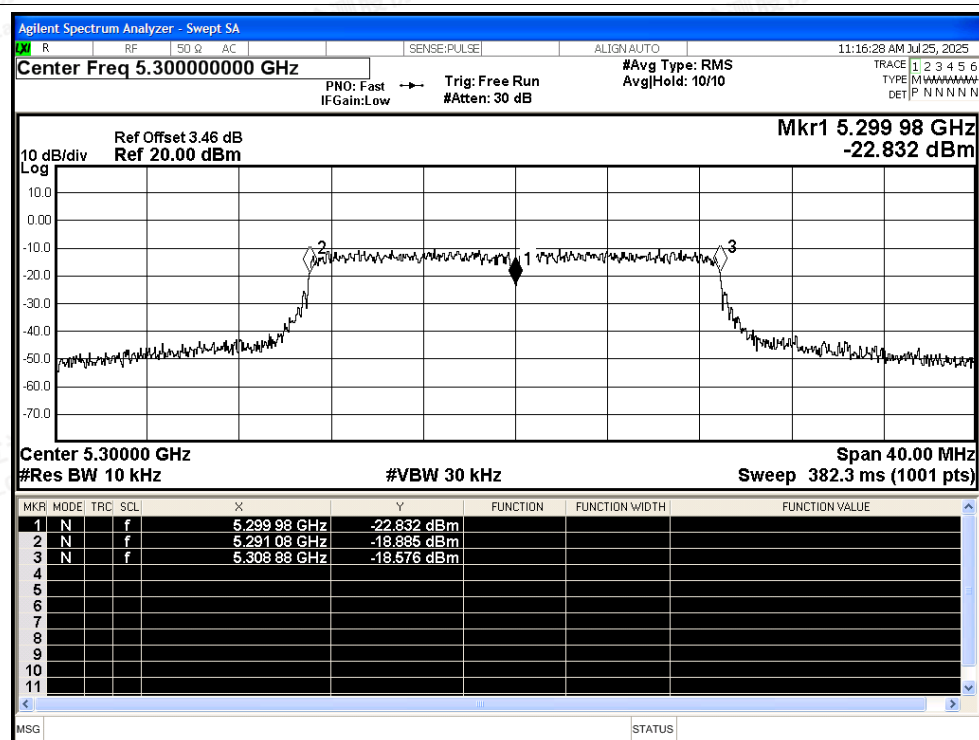

Freq. Stability NVNT n20 5320MHz Ant2

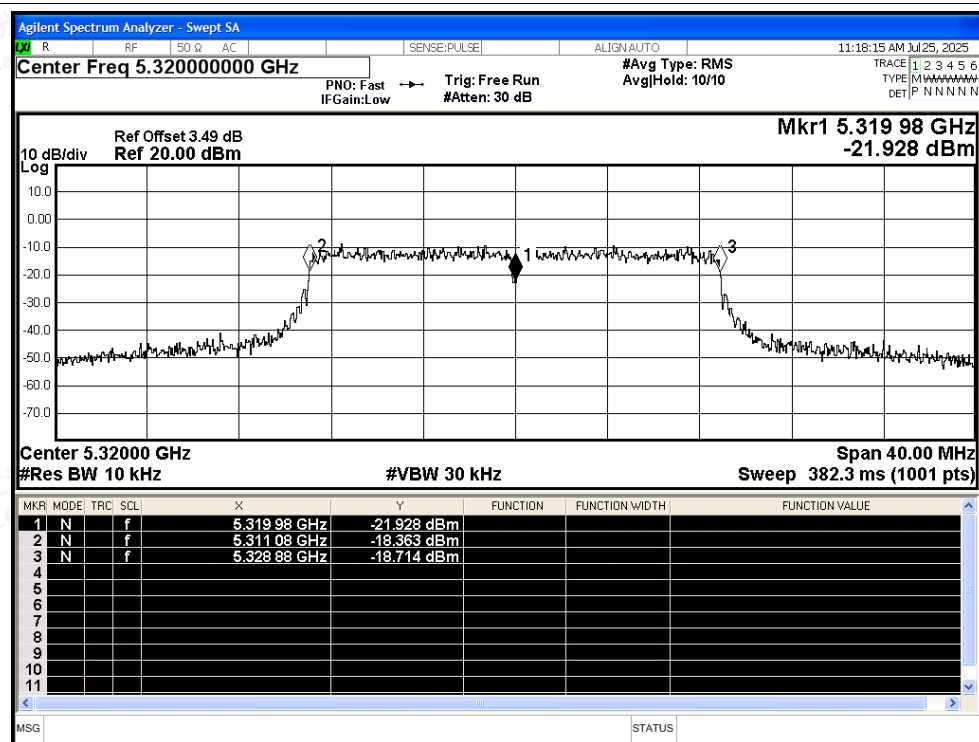

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant2

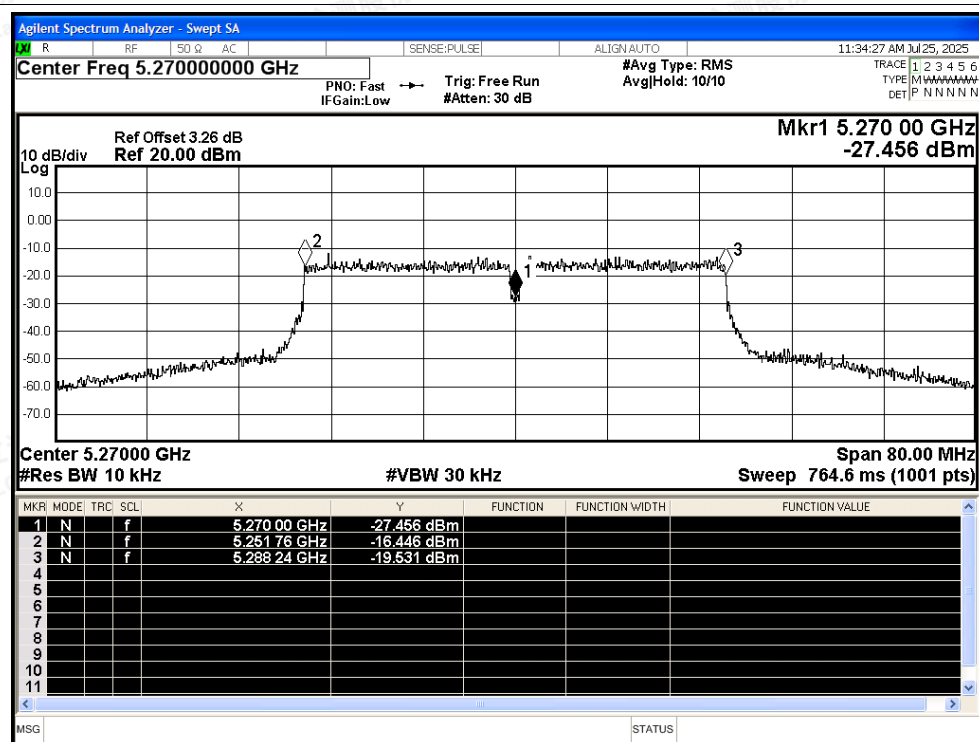

Freq. Stability NVNT n40 5310MHz Ant2

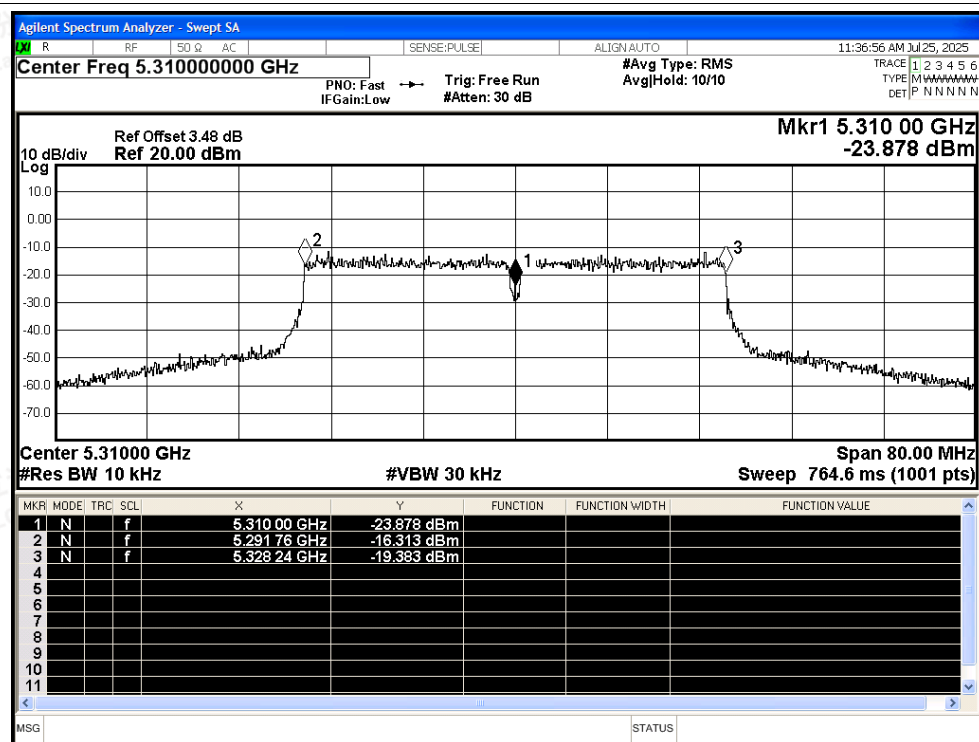

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant2

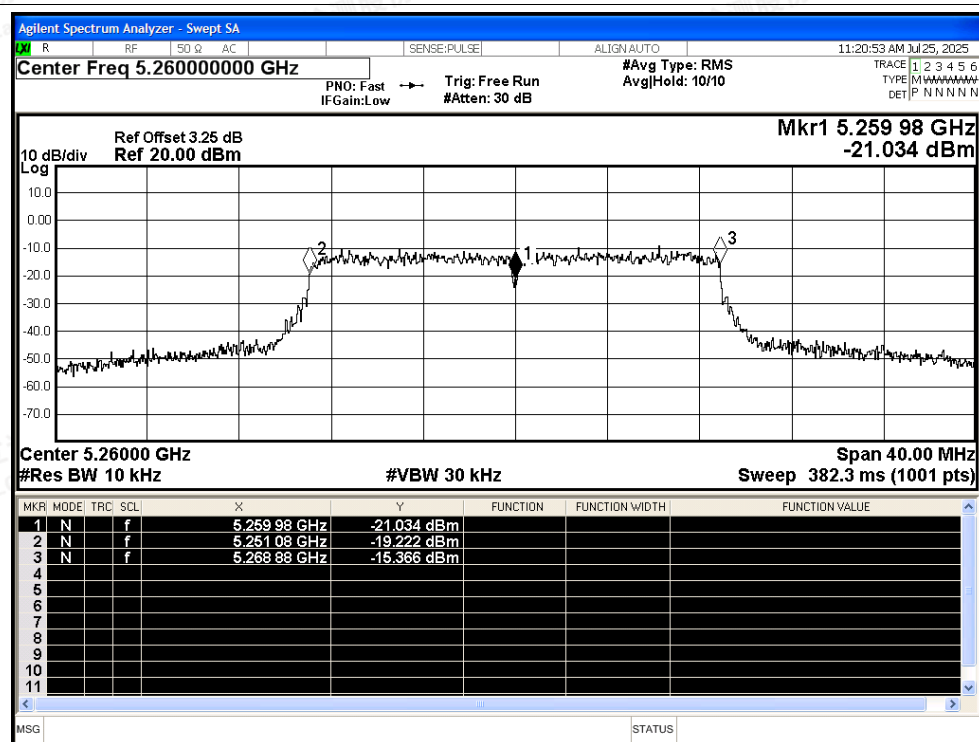

Freq. Stability NVNT ac20 5300MHz Ant2

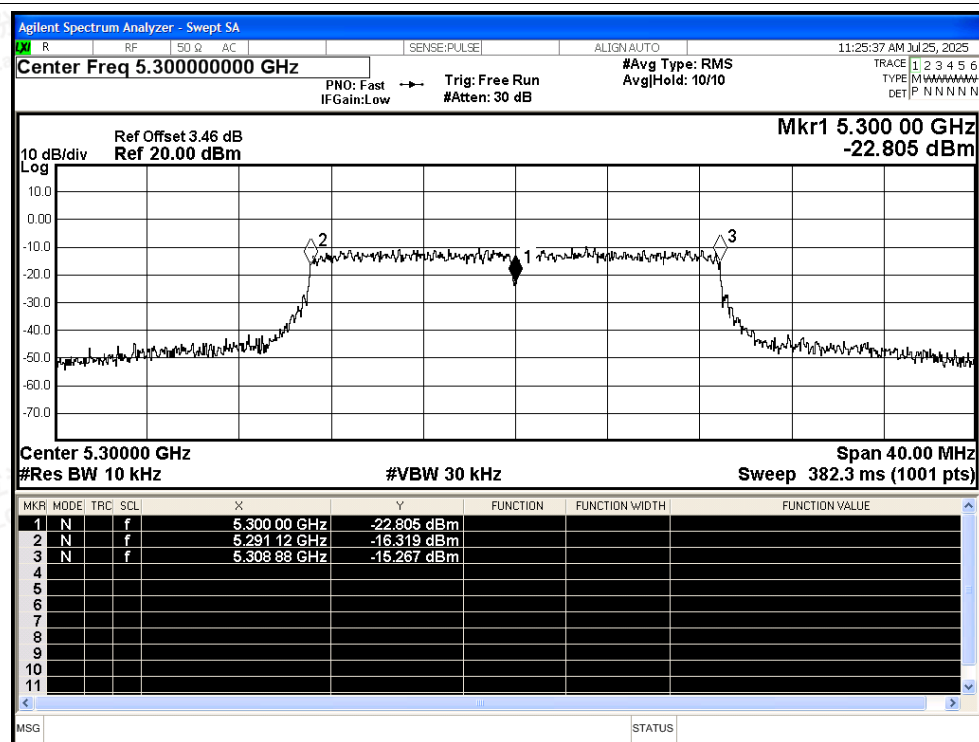

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

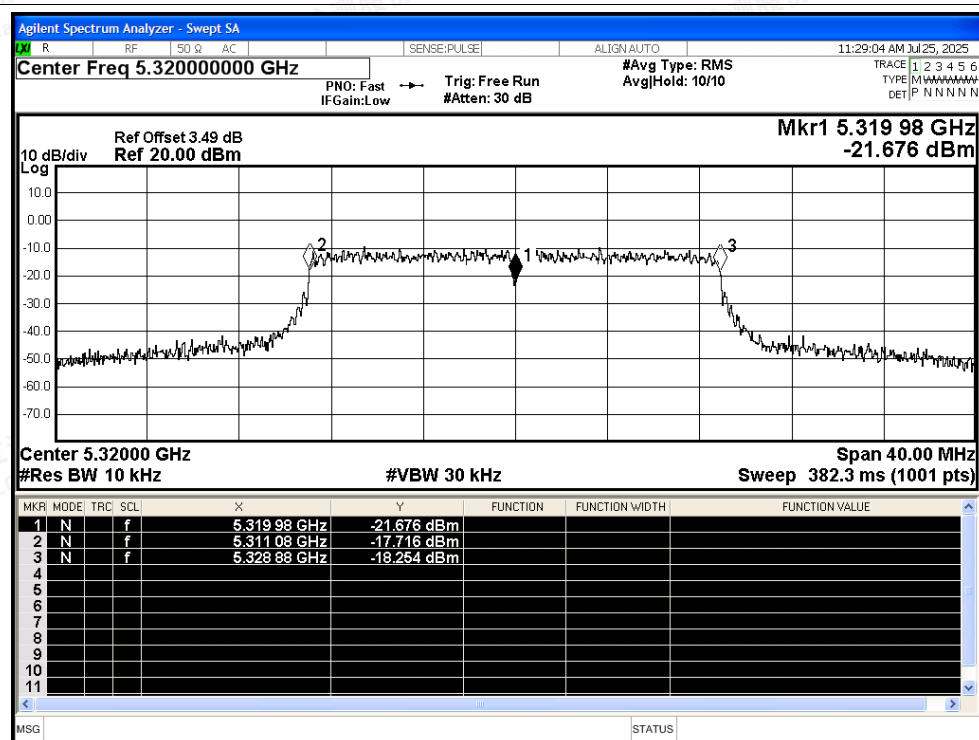

Freq. Stability NVNT ac40 5270MHz Ant2

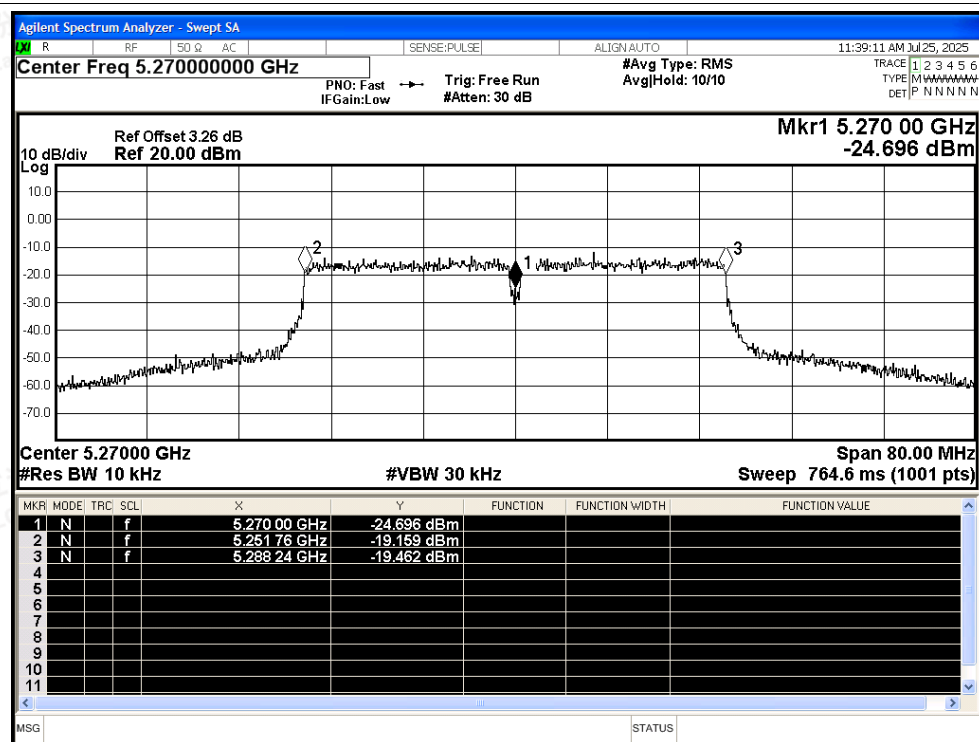

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant2

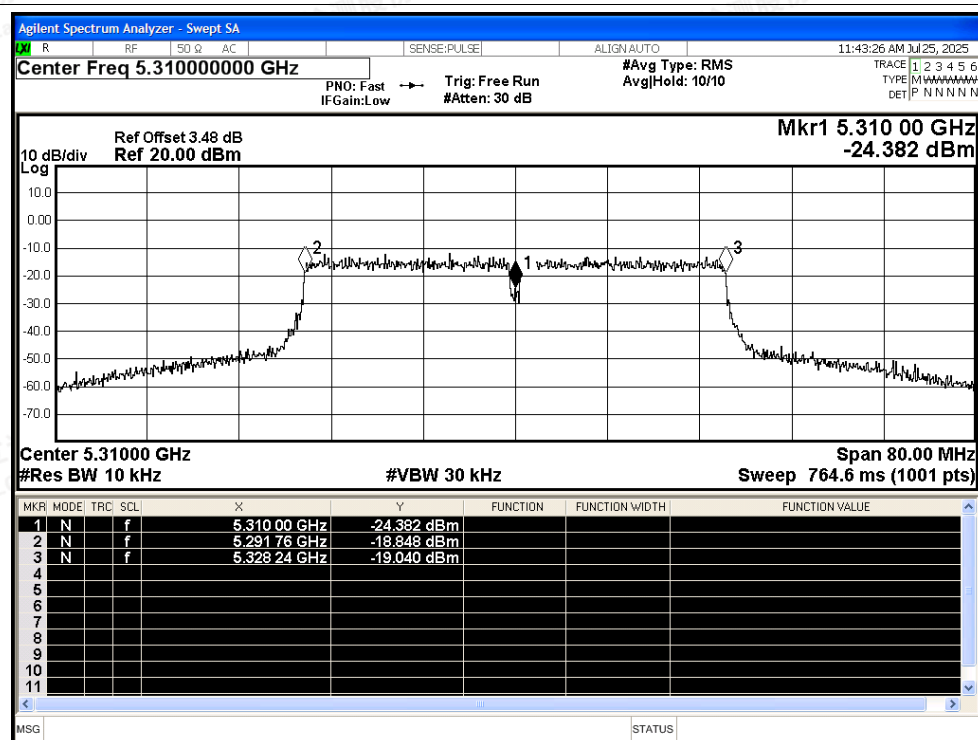

Freq. Stability NVNT ac80 5290MHz Ant2

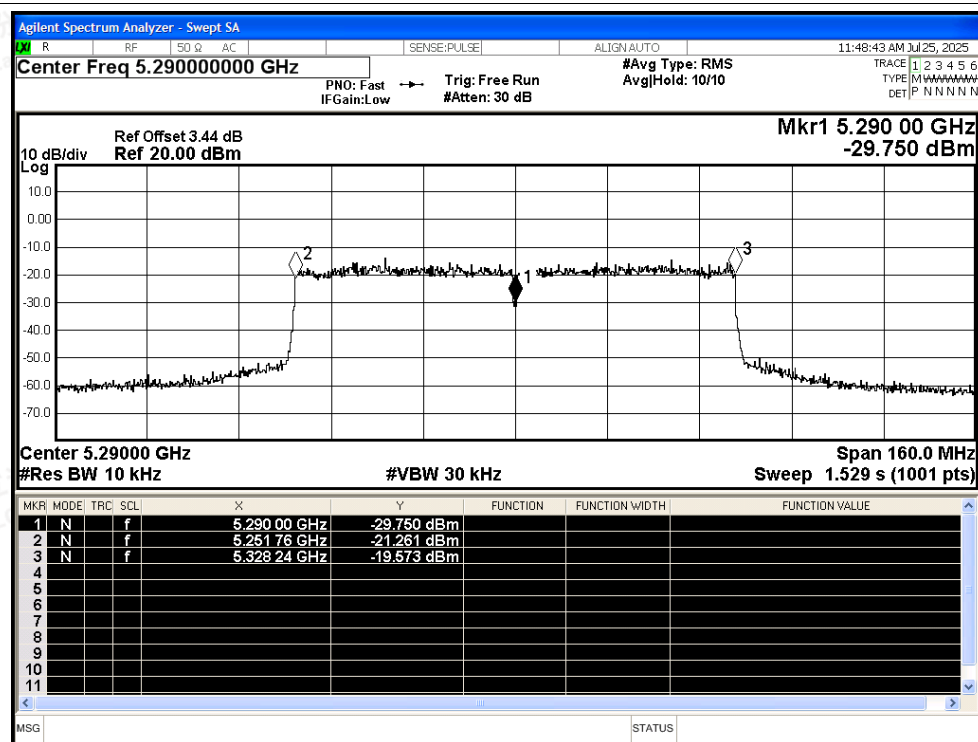

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant2

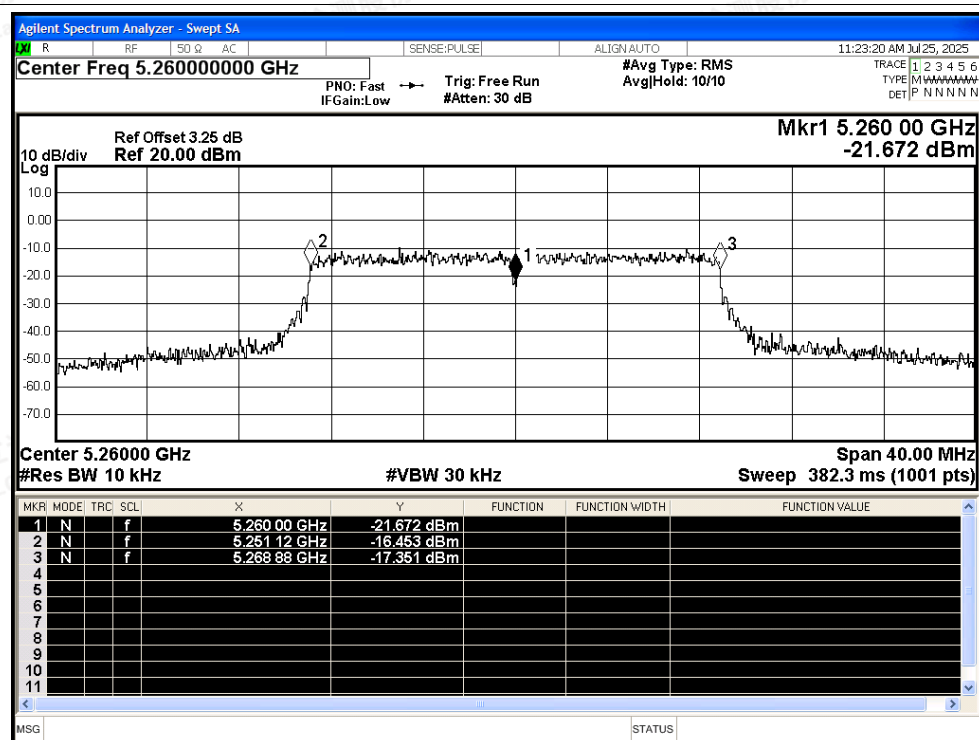

Freq. Stability NVNT ax20 5300MHz Ant2

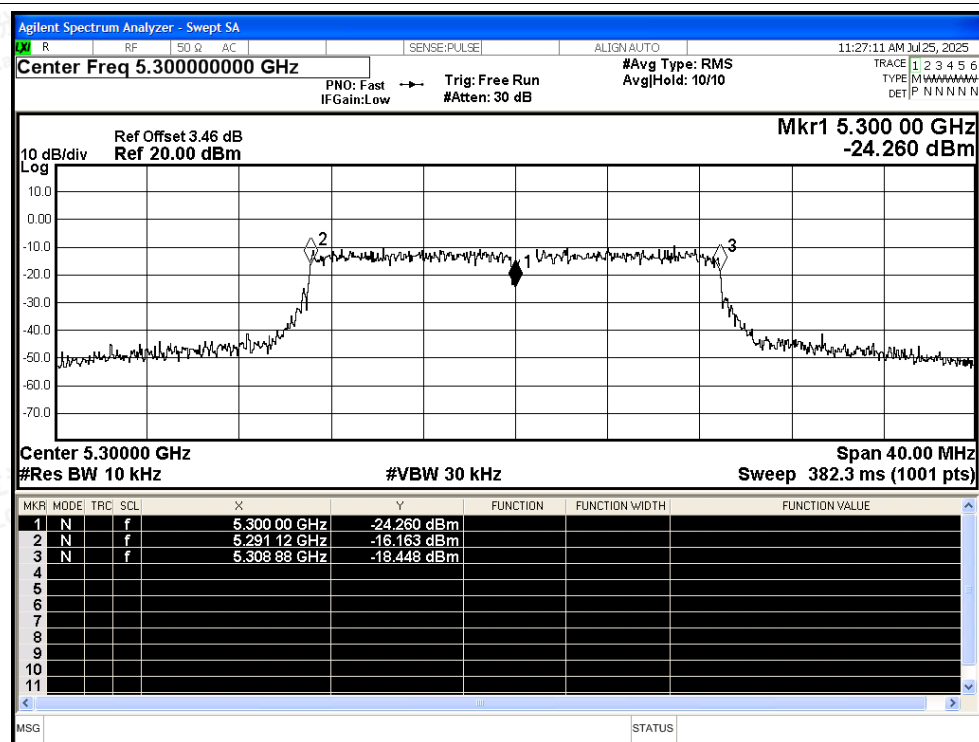

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant2

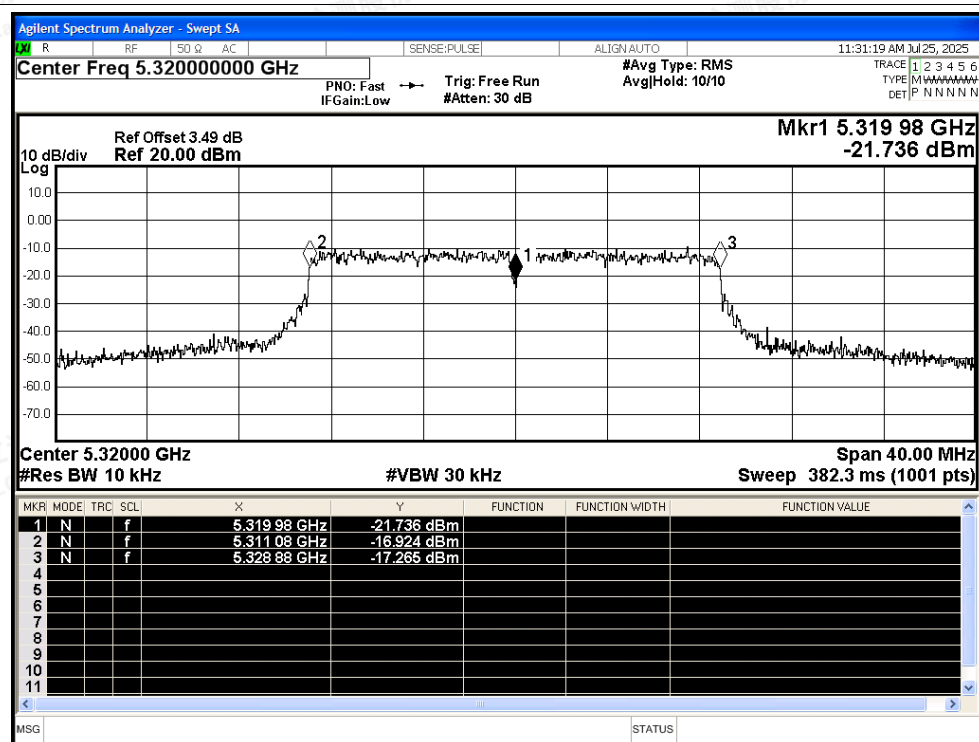

Freq. Stability NVNT ax40 5270MHz Ant2

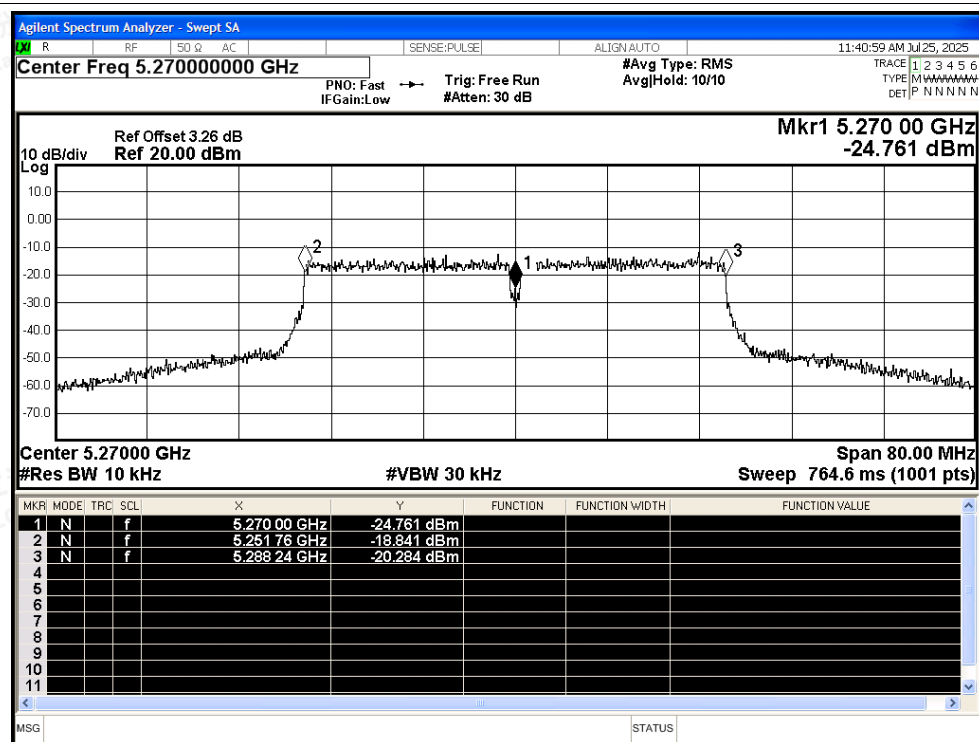

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant2

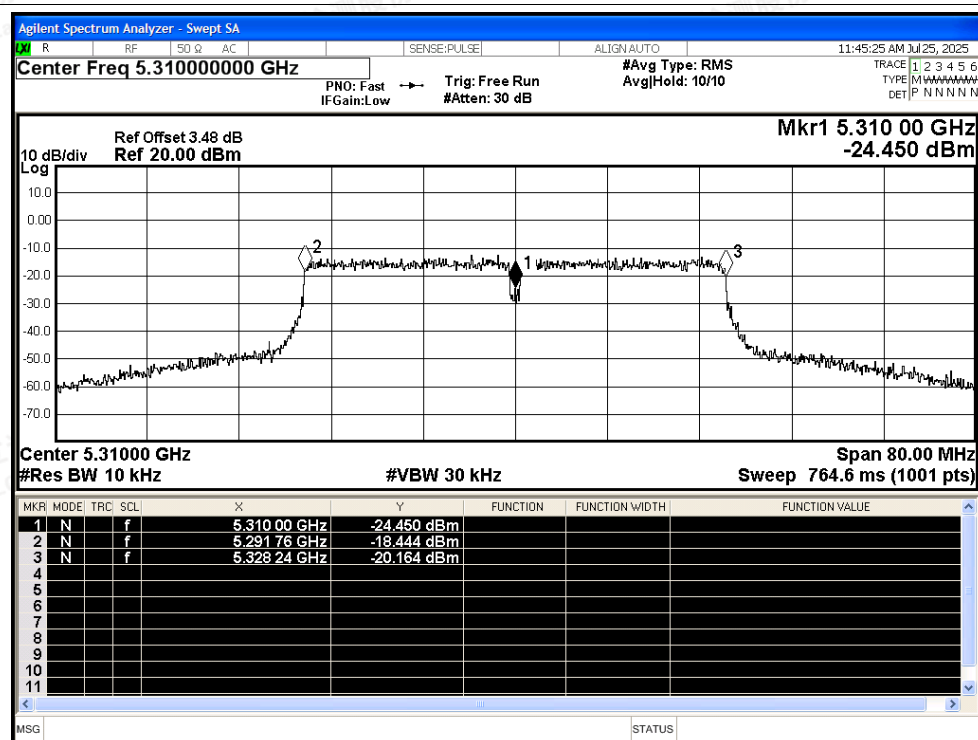

Freq. Stability NVNT ax80 5290MHz Ant2

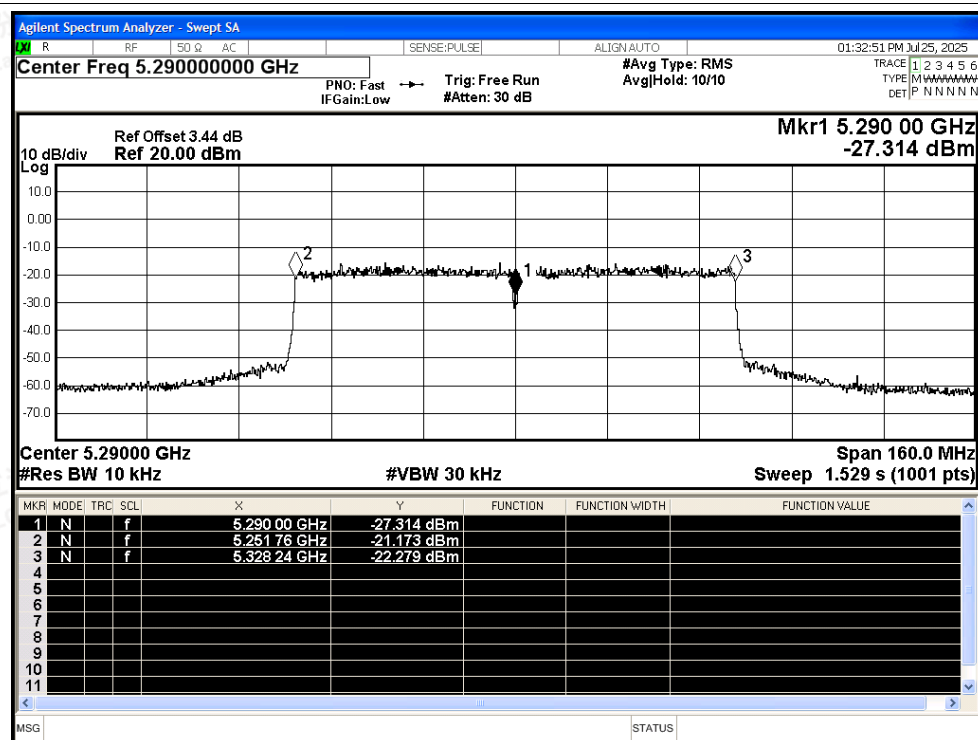

Freq. Stability NVNT be20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

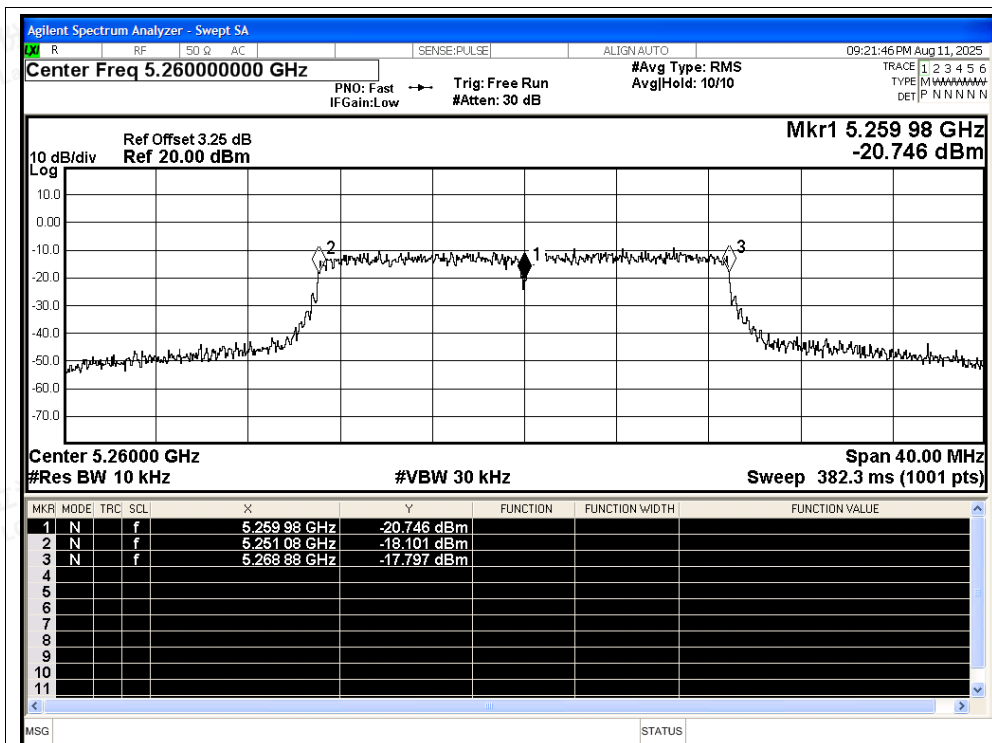

Freq. Stability NVNT be20 5300MHz Ant2

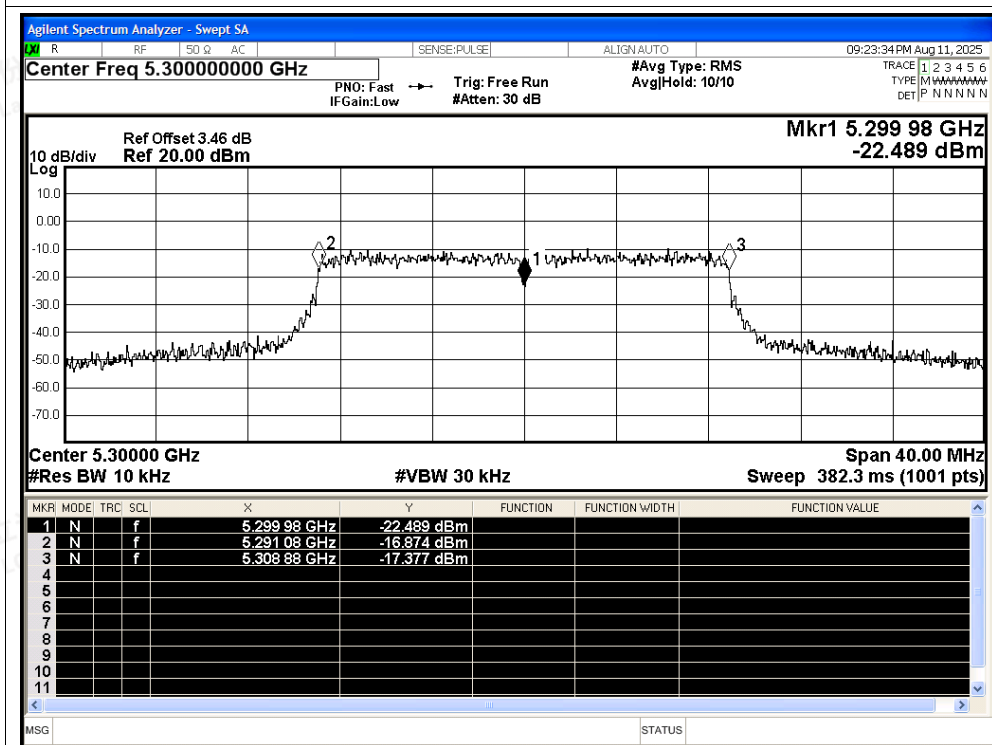

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5320MHz Ant2

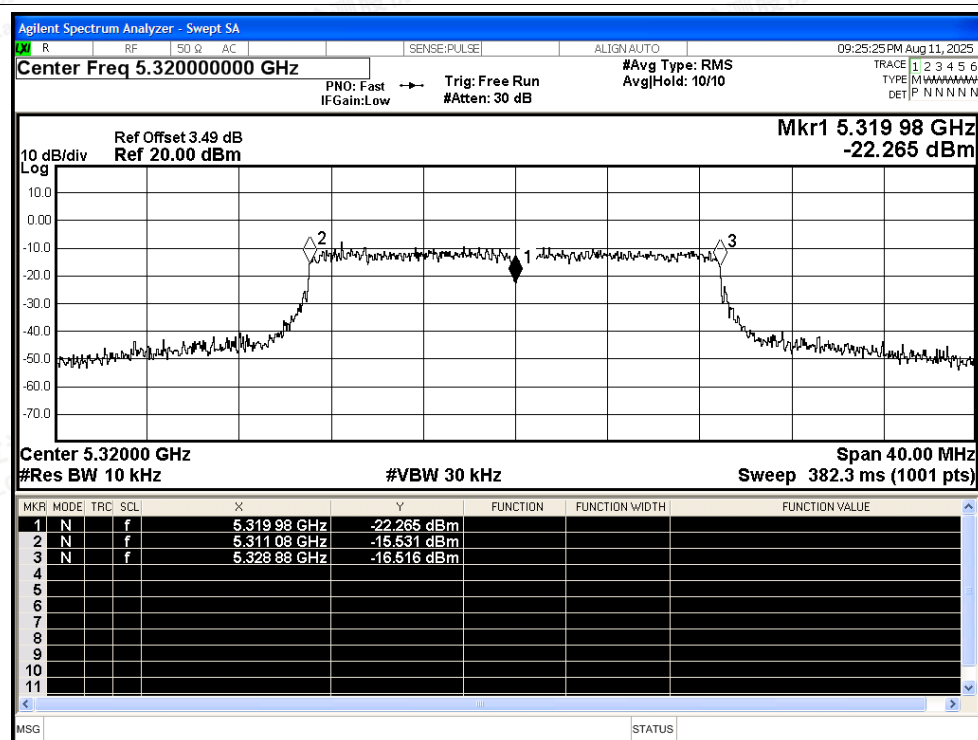

Freq. Stability NVNT be40 5270MHz Ant2

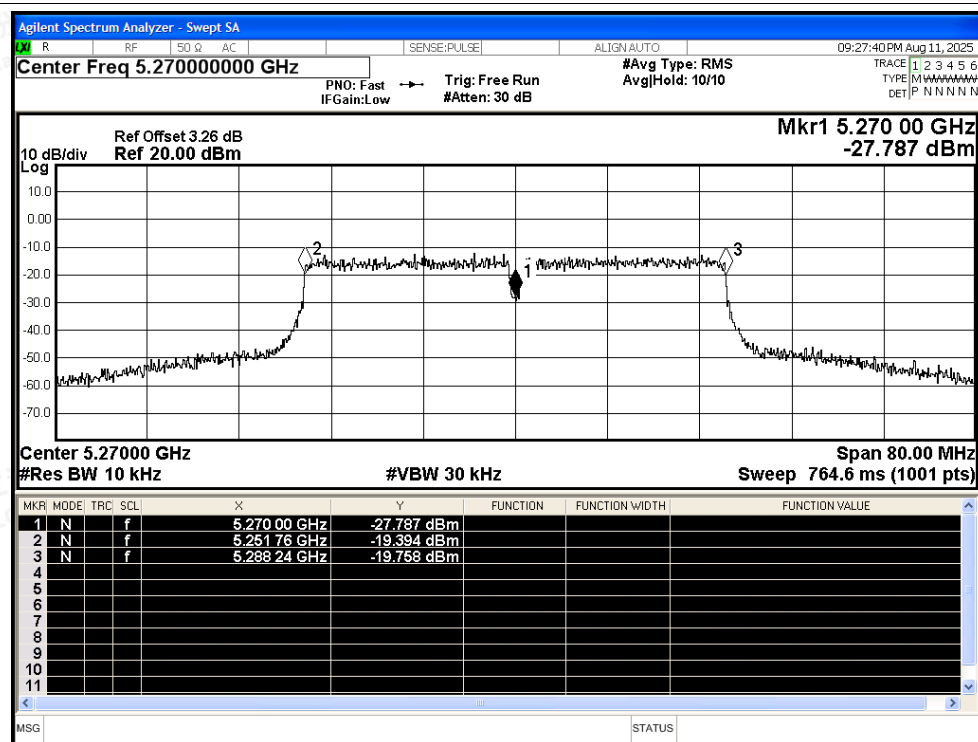

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be40 5310MHz Ant2

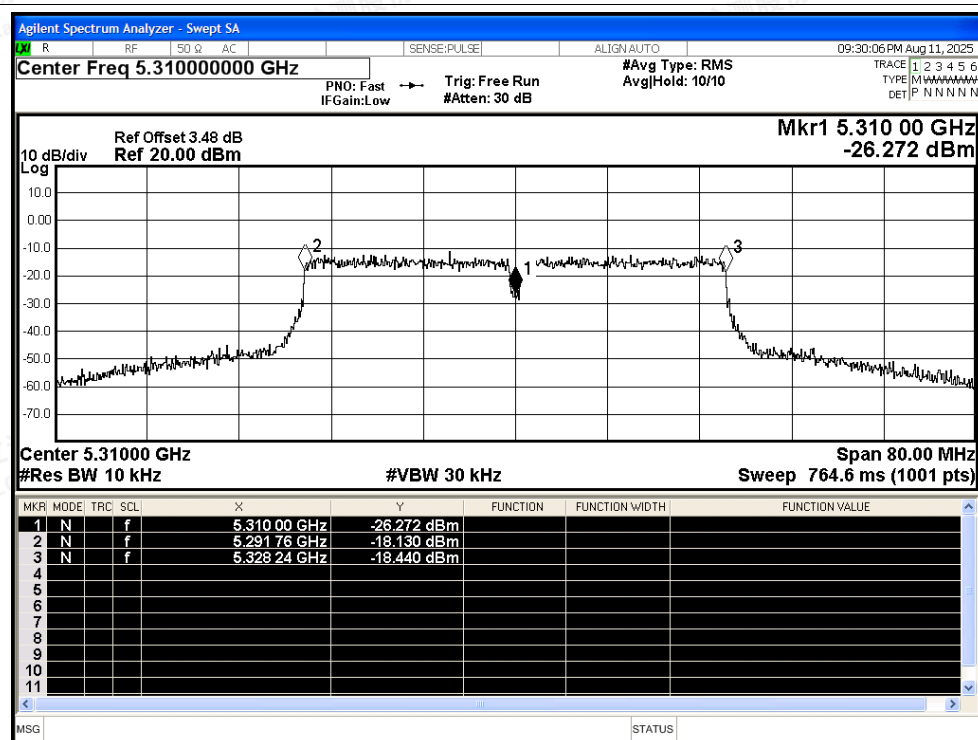

Freq. Stability NVNT be80 5290MHz Ant2

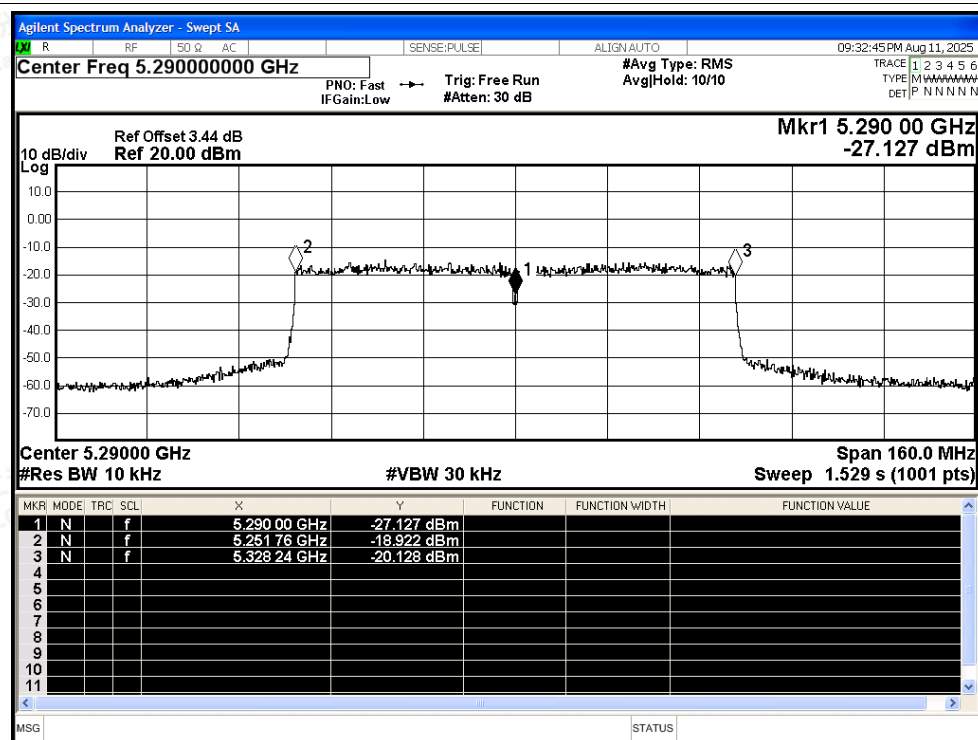

Freq. Stability NVNT ac160 5250MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

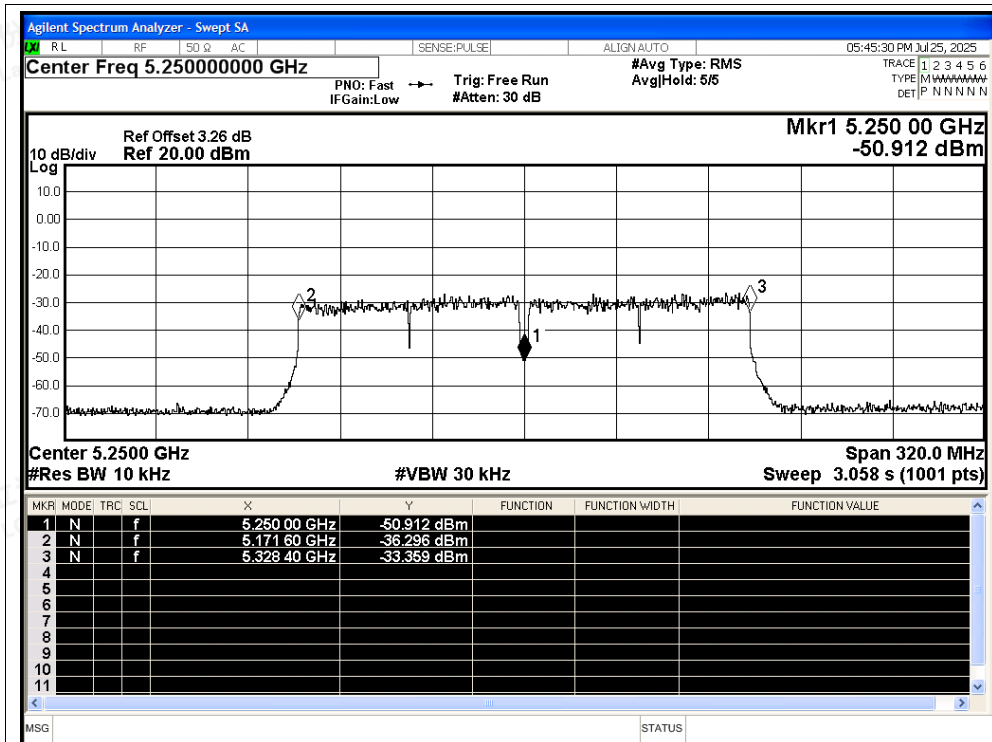

Freq. Stability NVNT ax160 5250MHz Ant2

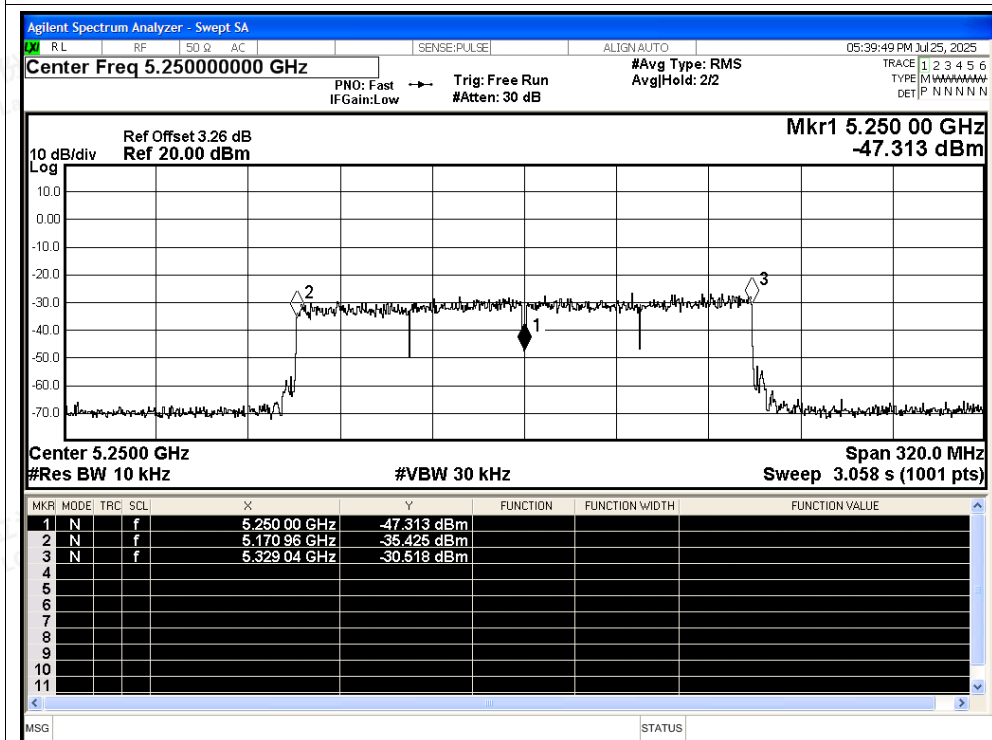

Freq. Stability NVNT be160 5250MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

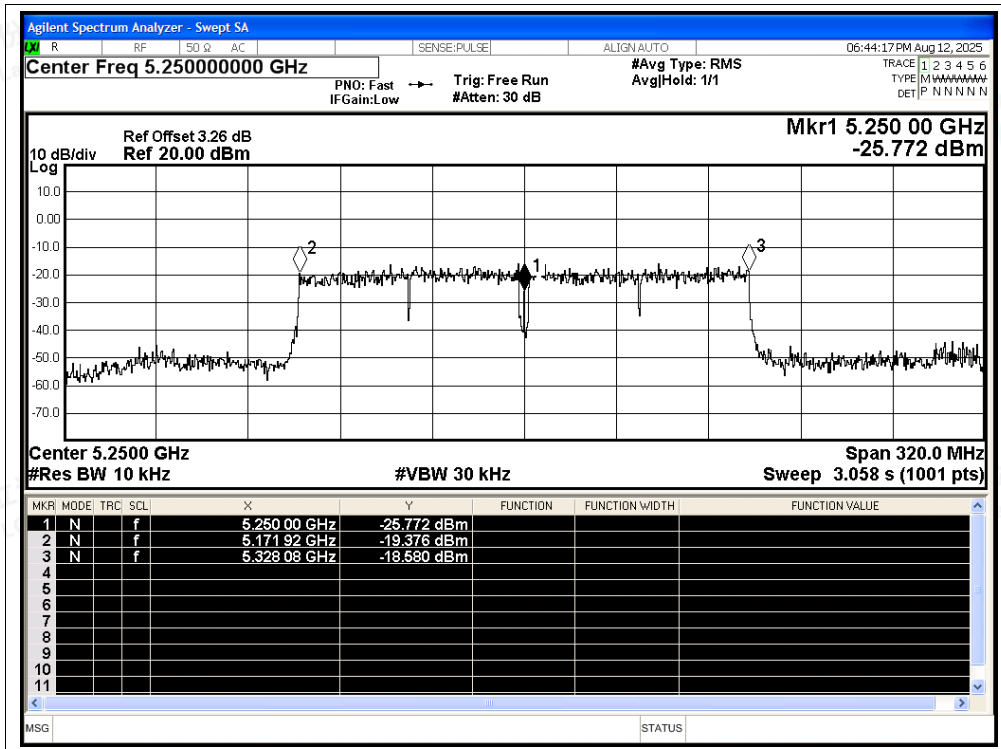

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant3	5260	0	0	25	Pass
NVNT	a	5300	Ant3	5300	0	0	25	Pass
NVNT	a	5320	Ant3	5320	0	0	25	Pass
NVNT	n20	5260	Ant3	5260	0	0	25	Pass
NVNT	n20	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant3	5319.96	-40000	-7.52	25	Pass
NVNT	n40	5270	Ant3	5270	0	0	25	Pass
NVNT	n40	5310	Ant3	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant3	5260	0	0	25	Pass
NVNT	ac20	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant3	5270	0	0	25	Pass
NVNT	ac40	5310	Ant3	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant3	5290	0	0	25	Pass
NVNT	ax20	5260	Ant3	5260	0	0	25	Pass
NVNT	ax20	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant3	5269.96	-40000	-7.59	25	Pass
NVNT	ax40	5310	Ant3	5309.96	-40000	-7.53	25	Pass
NVNT	ax80	5290	Ant3	5290	0	0	25	Pass
NVNT	be20	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	be20	5300	Ant3	5300	0	0	25	Pass
NVNT	be20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	be40	5270	Ant3	5269.96	-40000	-7.59	25	Pass
NVNT	be40	5310	Ant3	5310	0	0	25	Pass
NVNT	be80	5290	Ant3	5290	0	0	25	Pass
NVNT	ac160	5250	Ant3	5250	0	0	25	Pass
NVNT	ax160	5250	Ant3	5250	0	0	25	Pass
NVNT	be160	5250	Ant3	5250	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant3

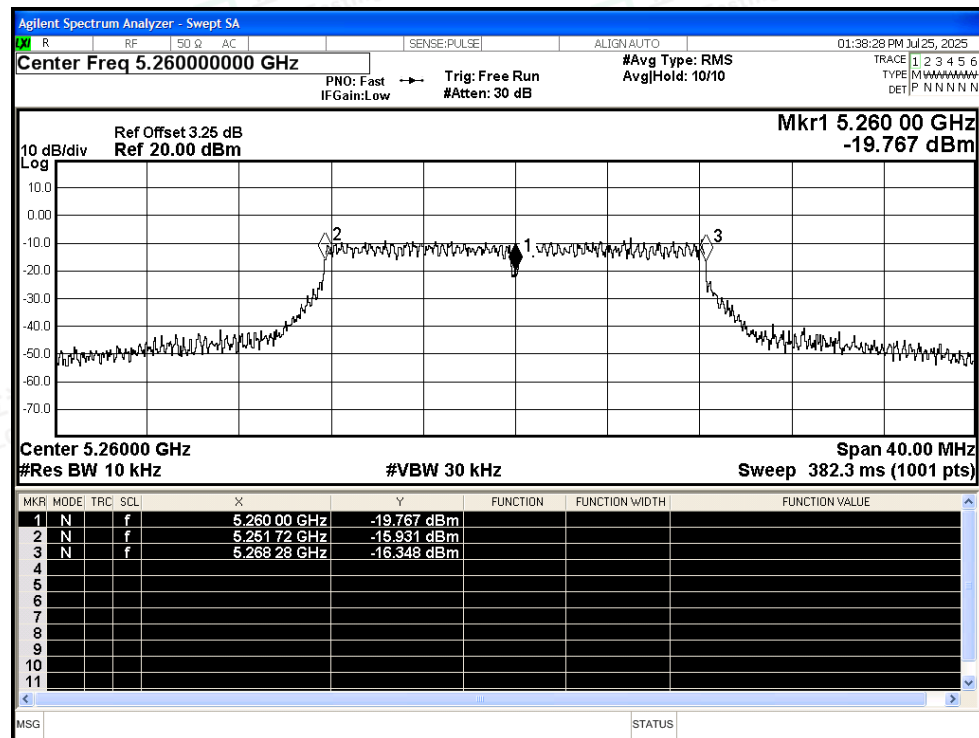

Freq. Stability NVNT a 5300MHz Ant3

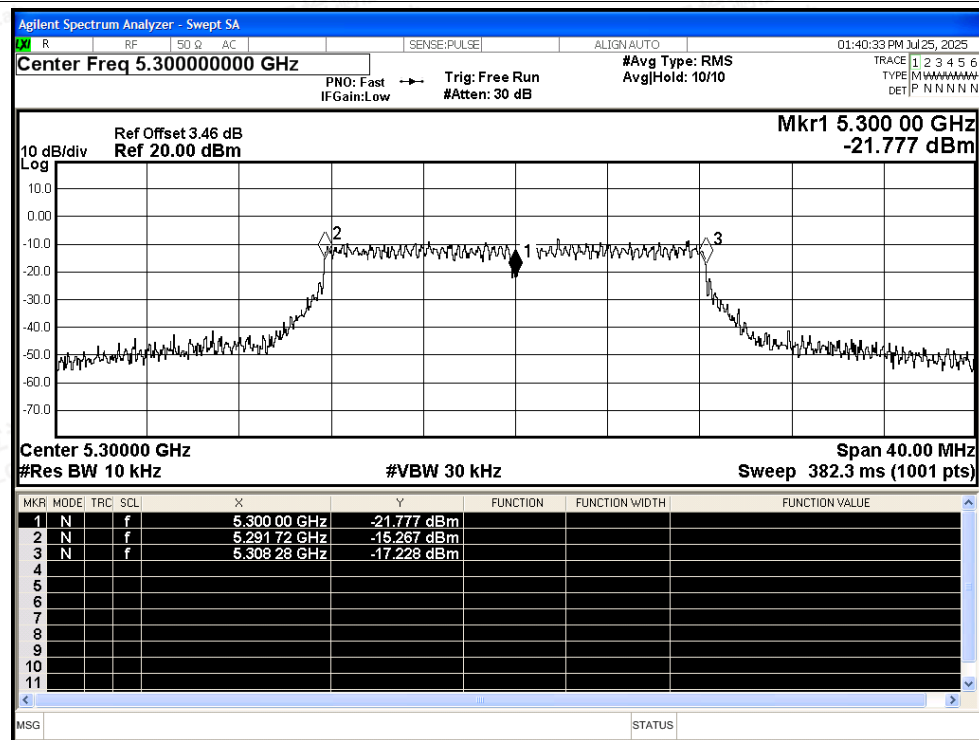

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant3

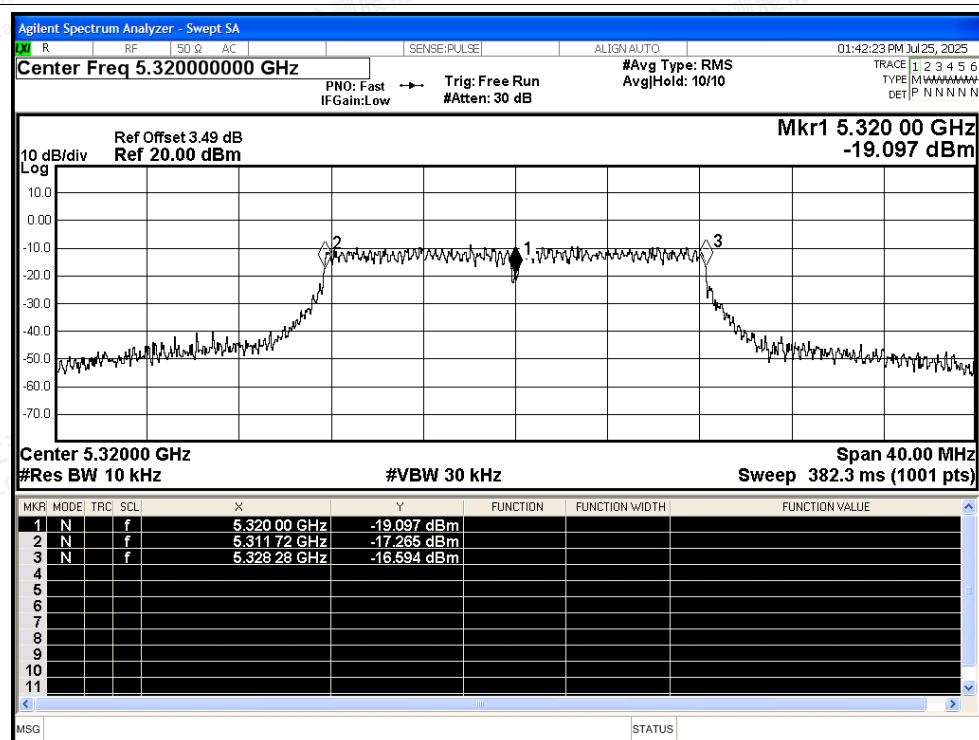

Freq. Stability NVNT n20 5260MHz Ant3

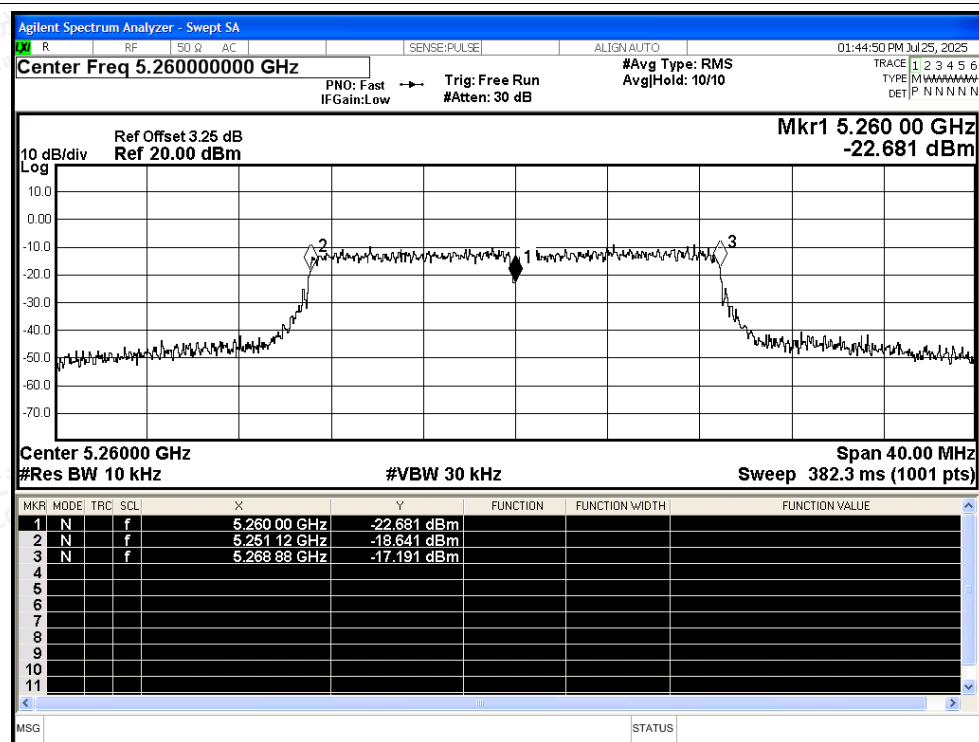

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant3

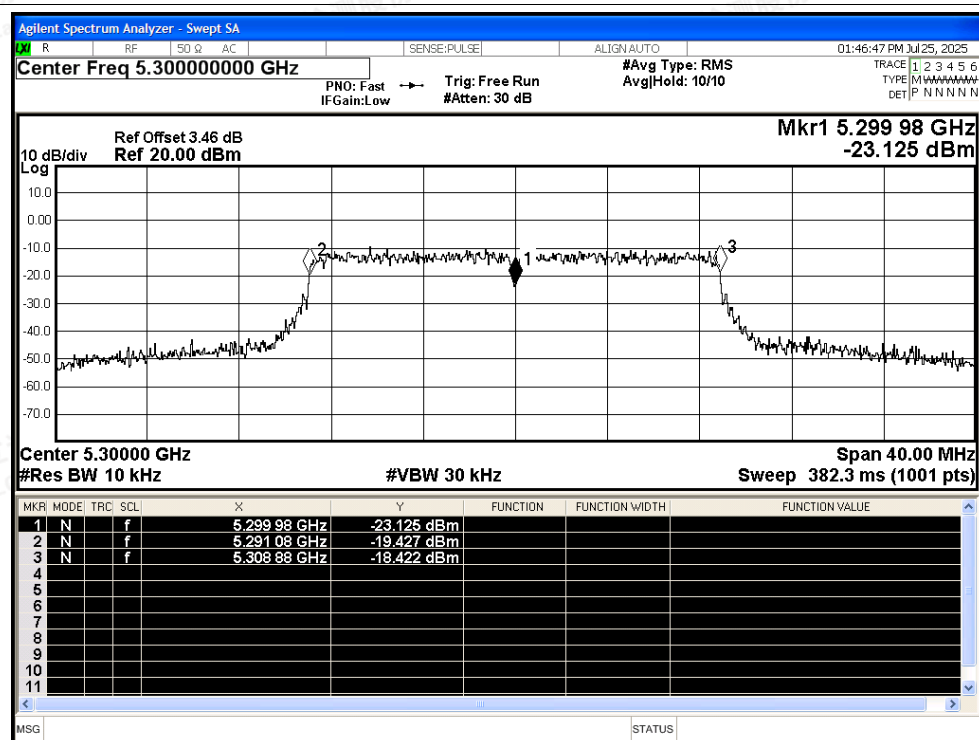

Freq. Stability NVNT n20 5320MHz Ant3

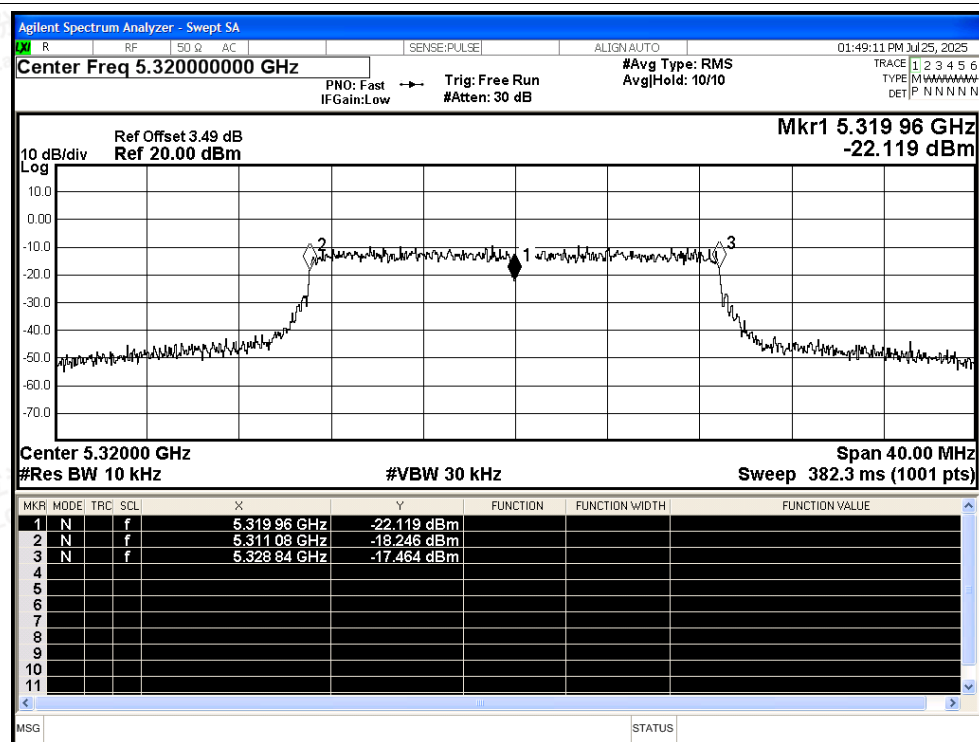

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant3

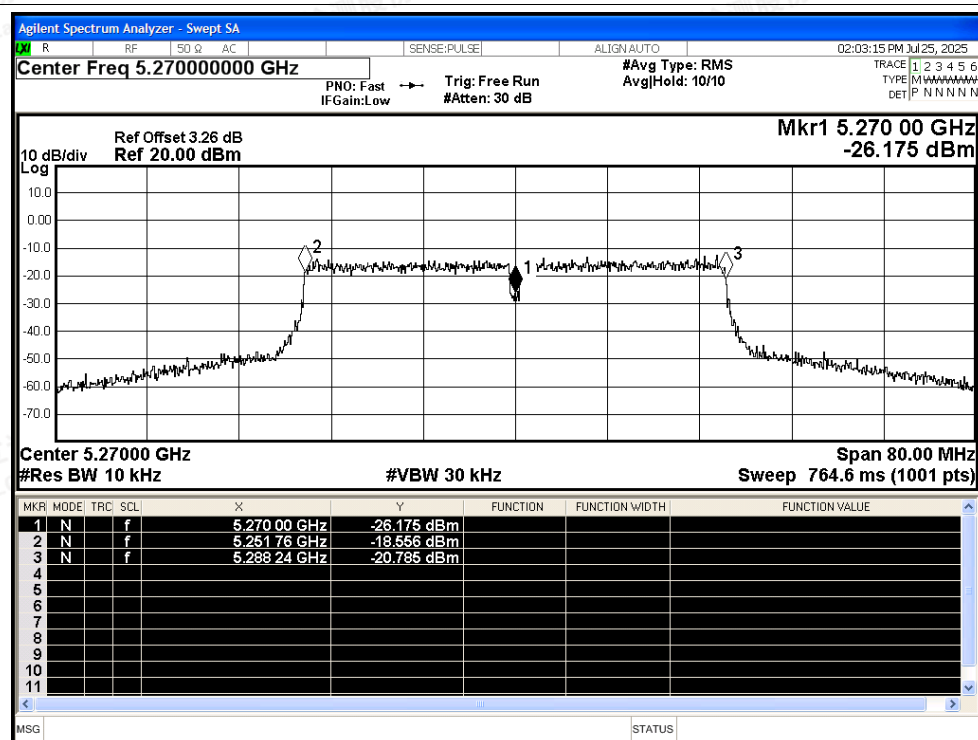

Freq. Stability NVNT n40 5310MHz Ant3


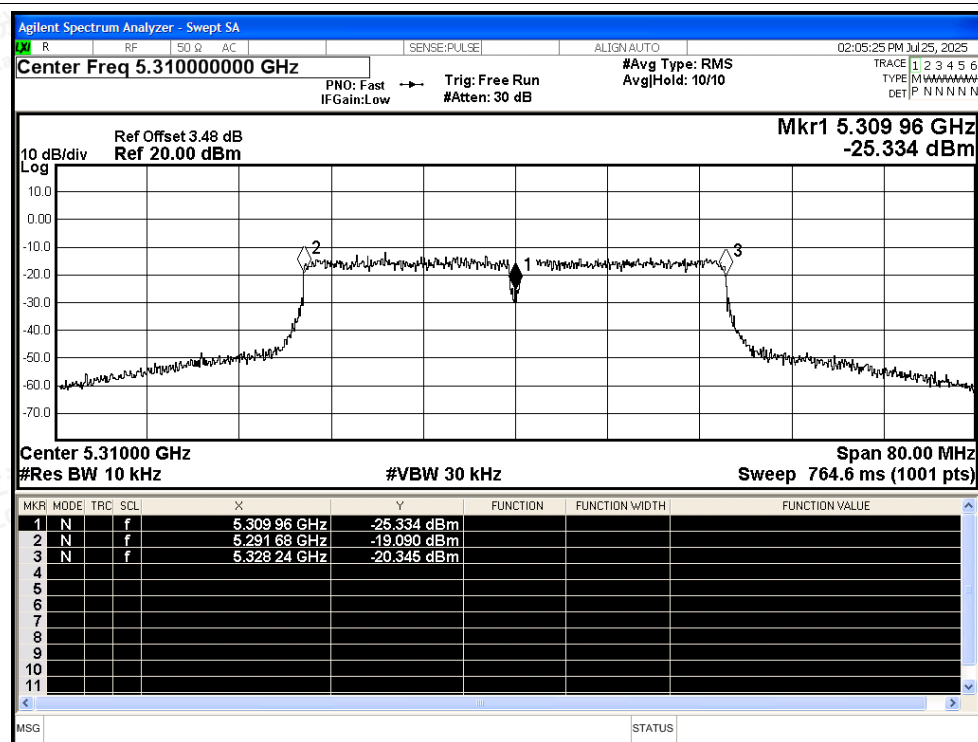


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

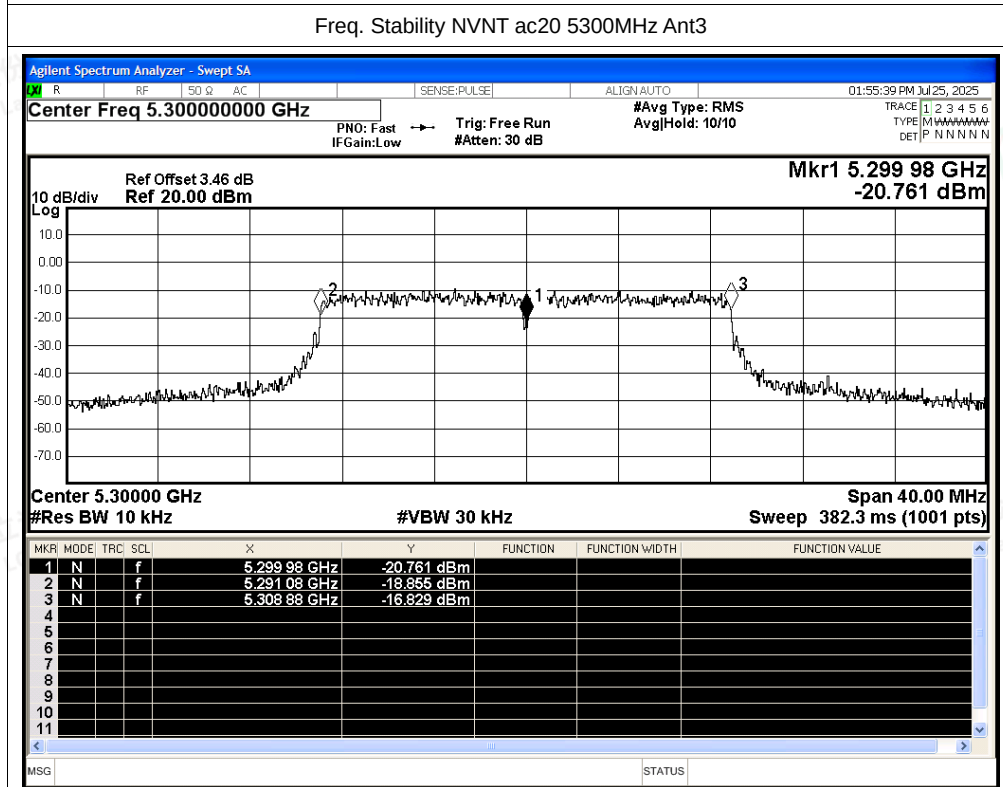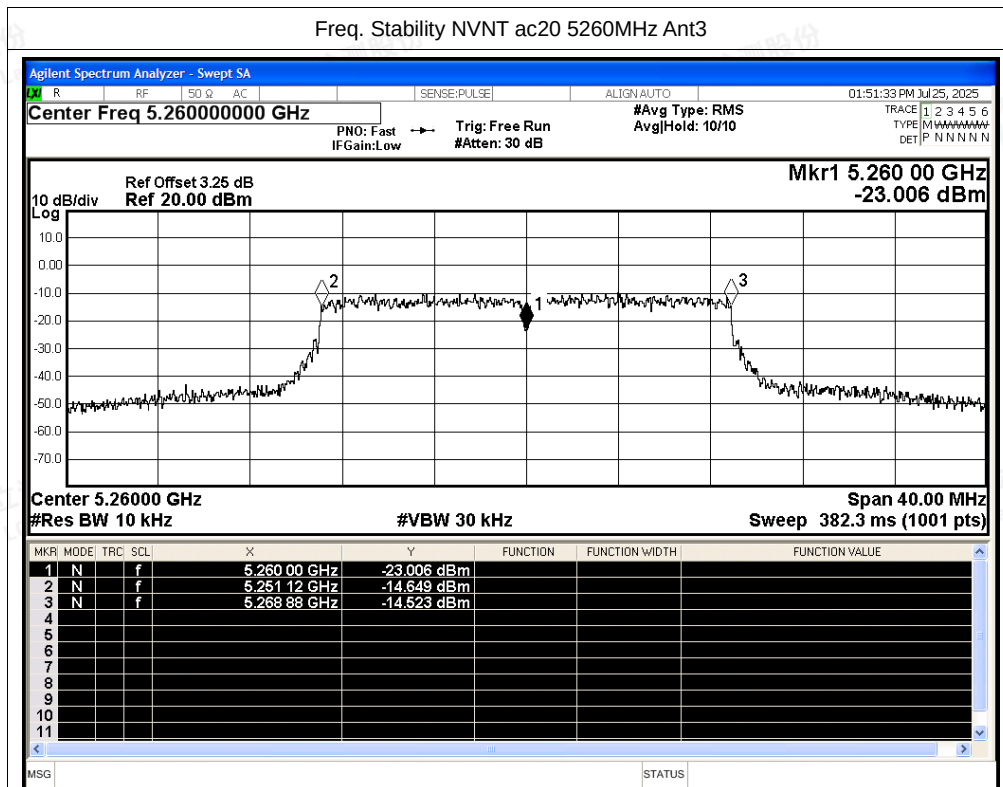

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant3

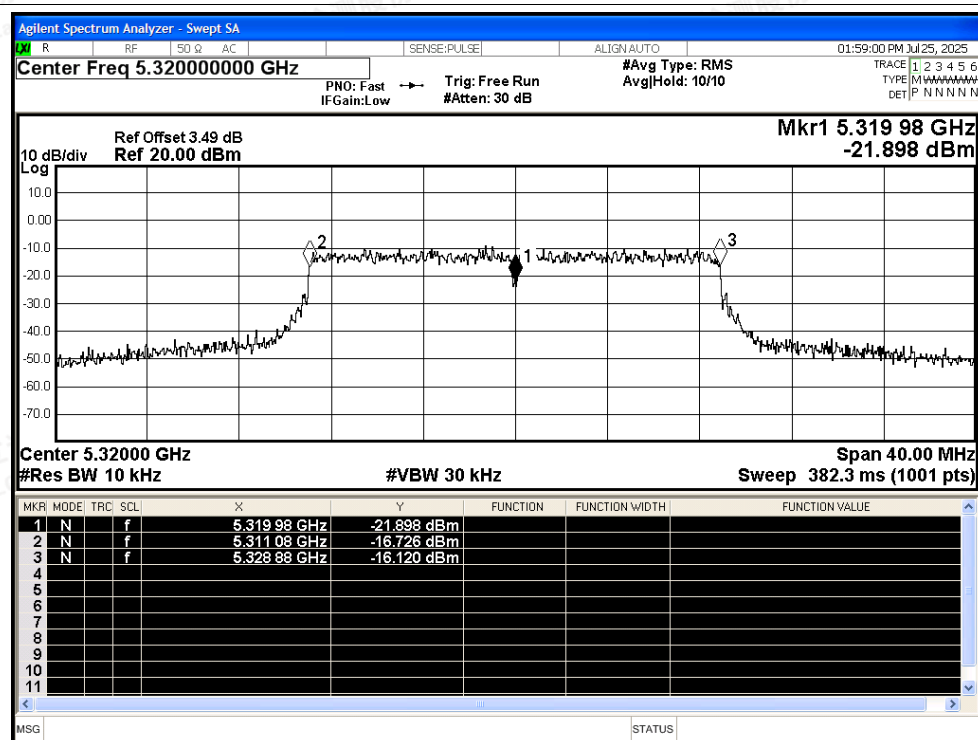

Freq. Stability NVNT ac40 5270MHz Ant3

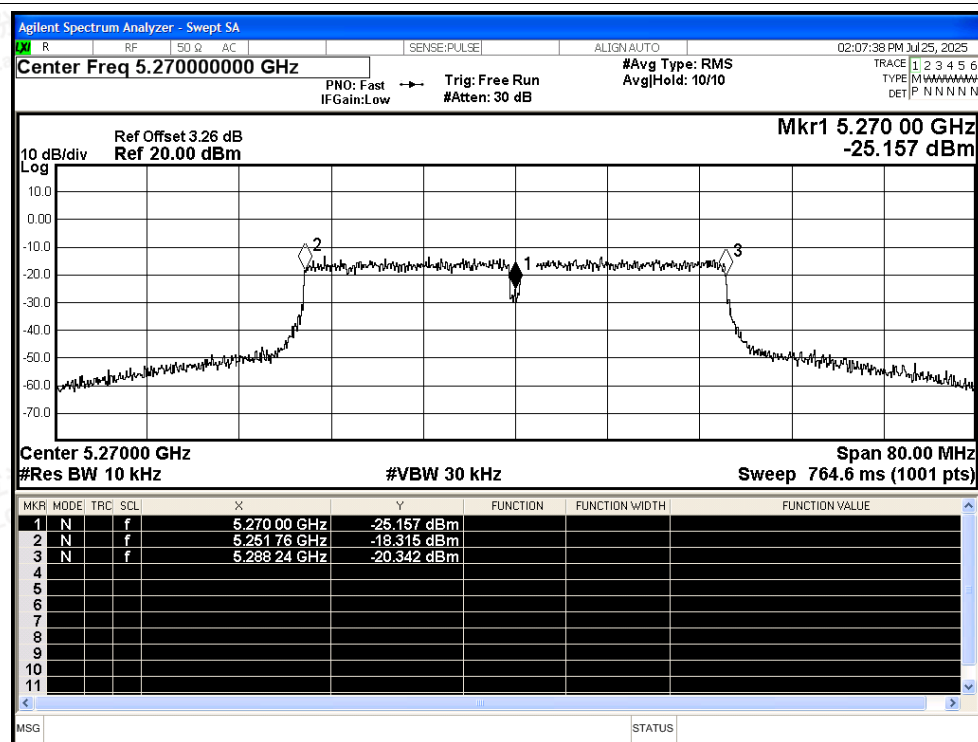

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant3

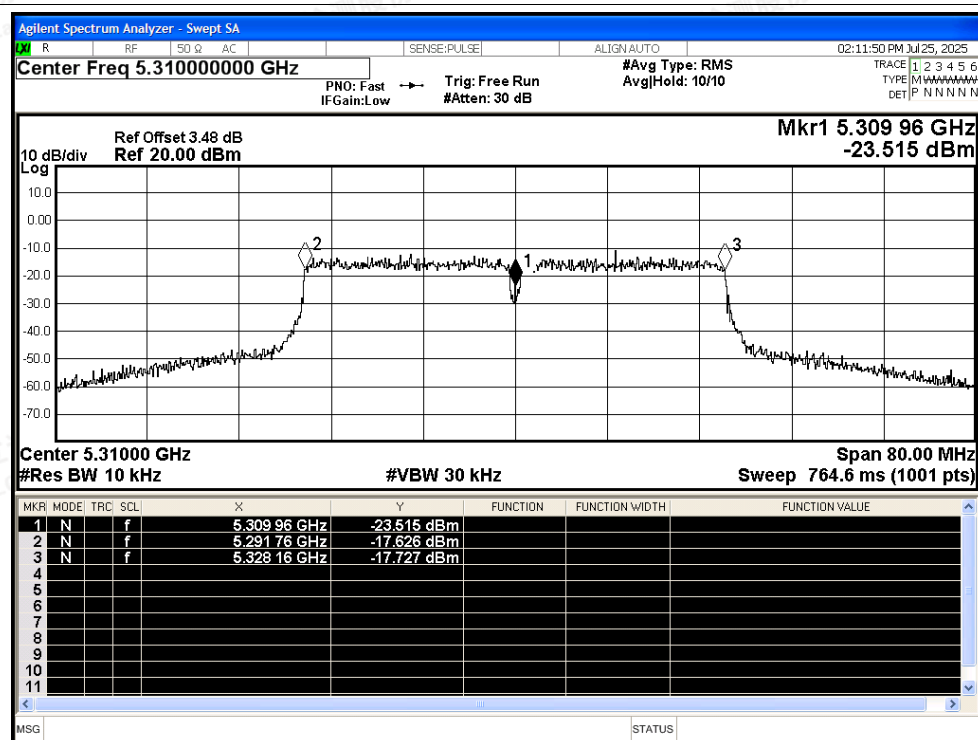

Freq. Stability NVNT ac80 5290MHz Ant3

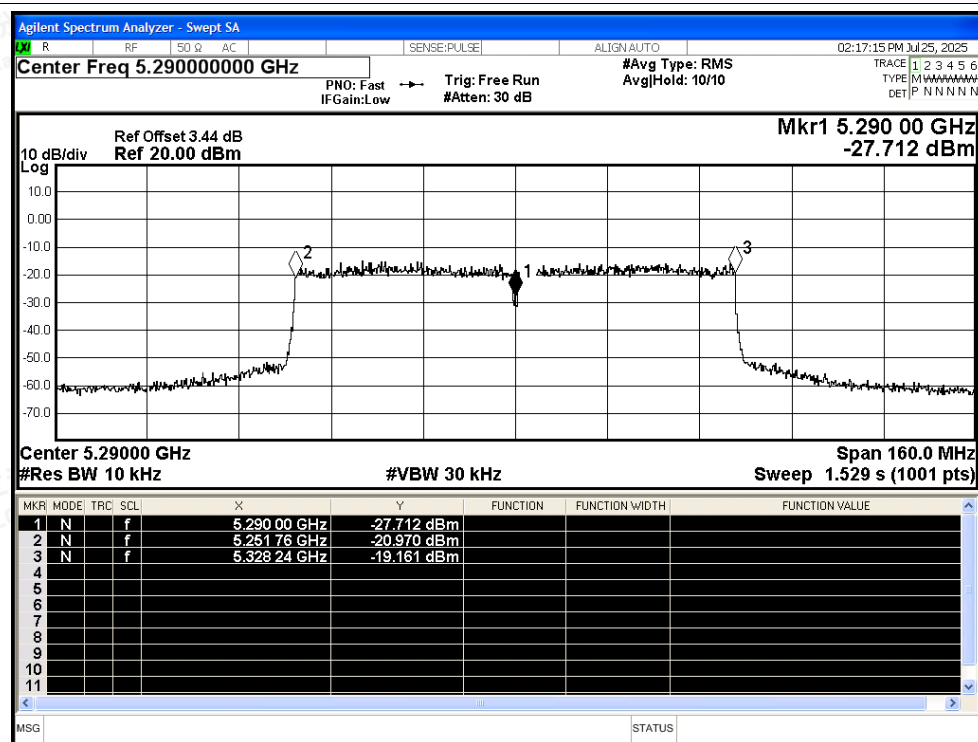

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant3

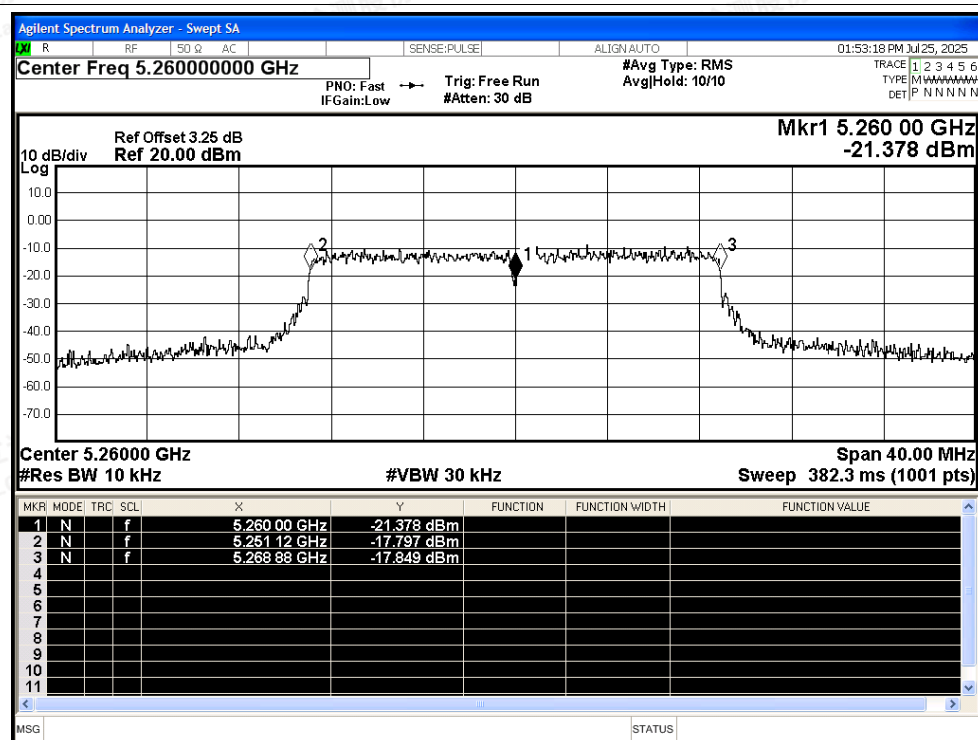

Freq. Stability NVNT ax20 5300MHz Ant3

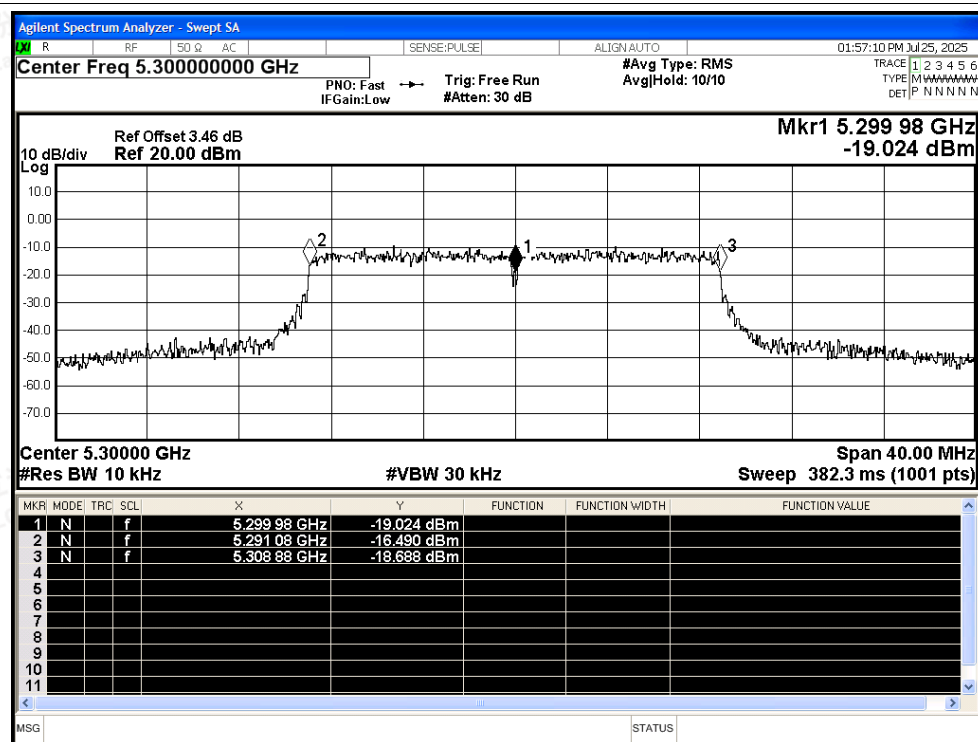

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant3

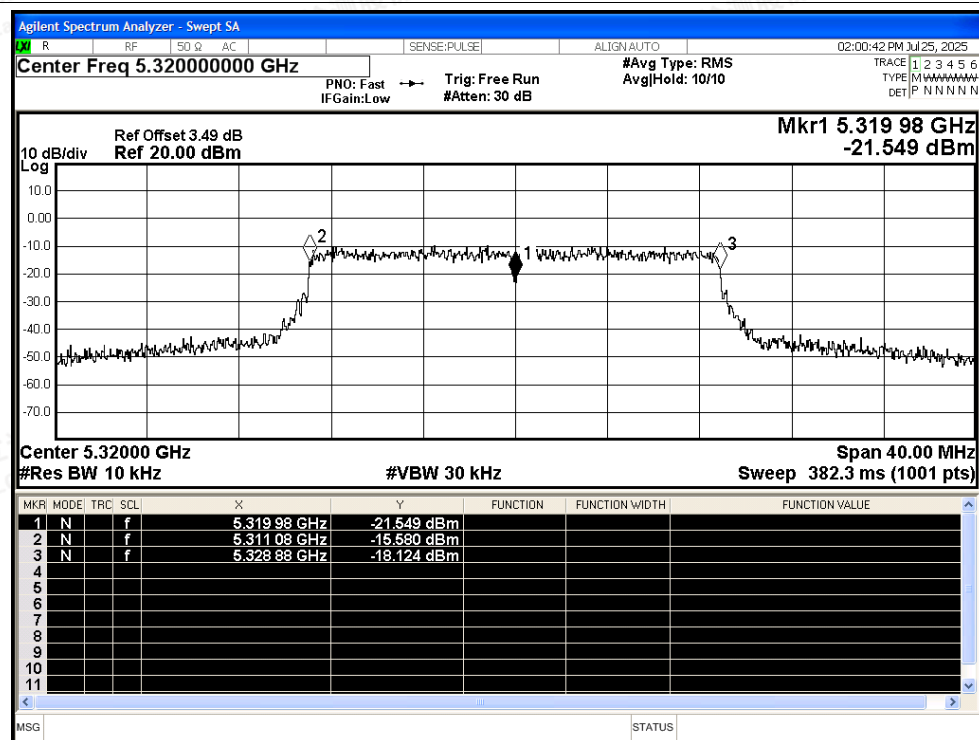

Freq. Stability NVNT ax40 5270MHz Ant3

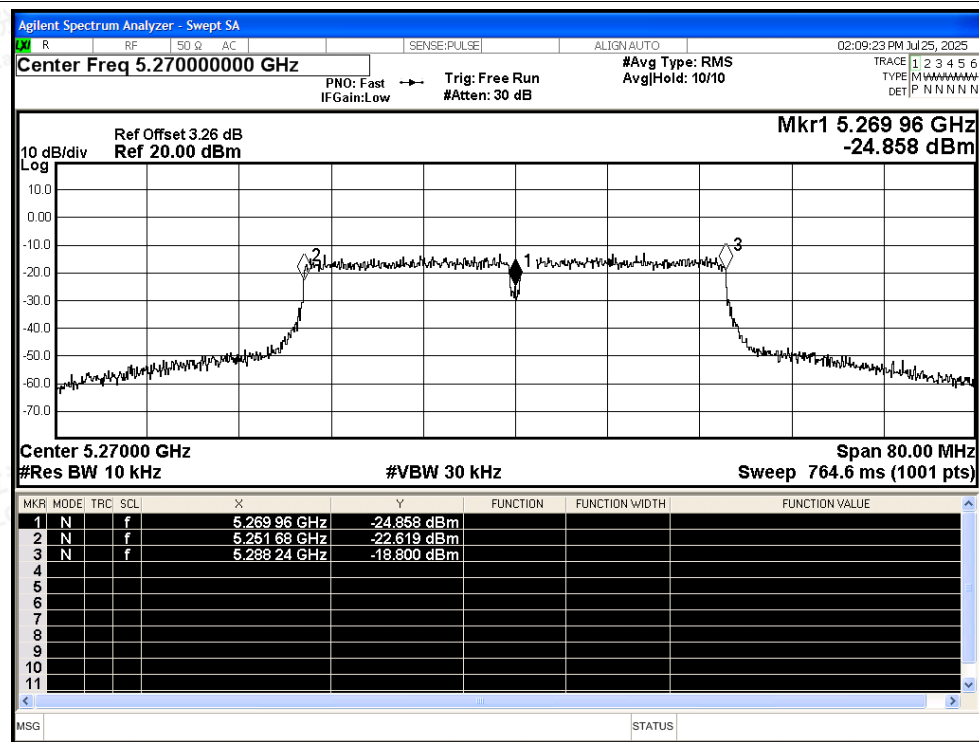

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant3

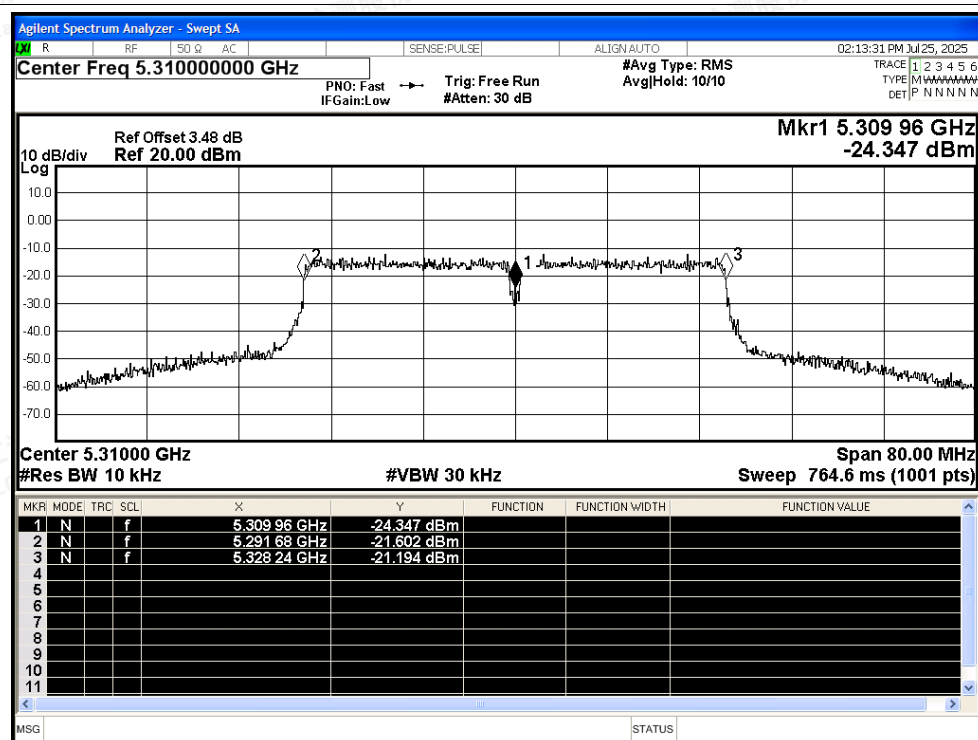

Freq. Stability NVNT ax80 5290MHz Ant3

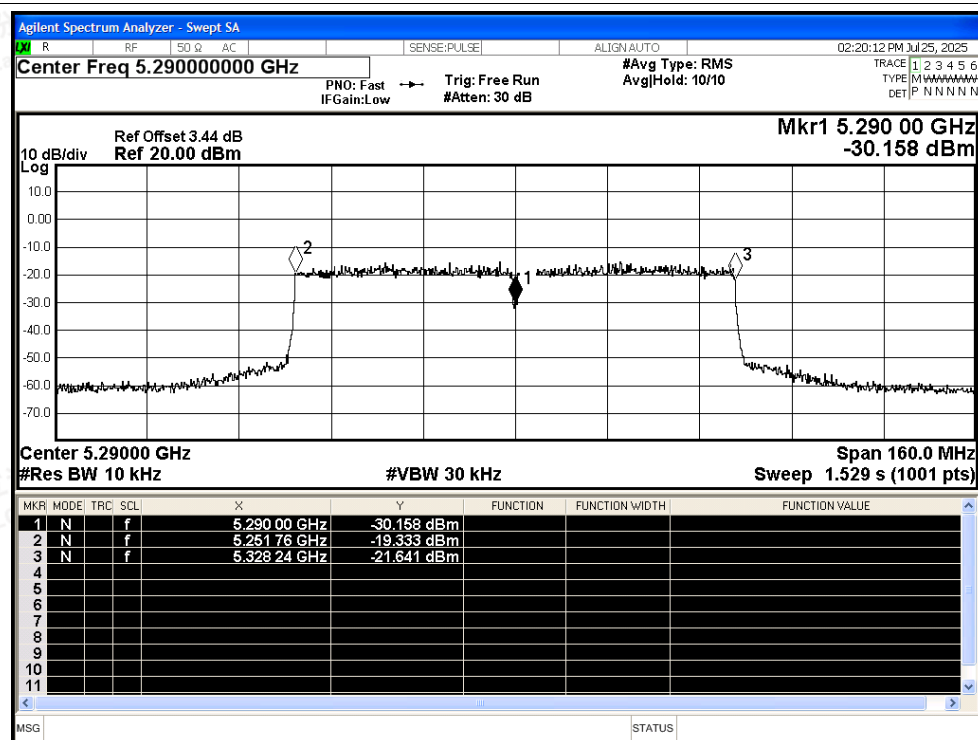

Freq. Stability NVNT be20 5260MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

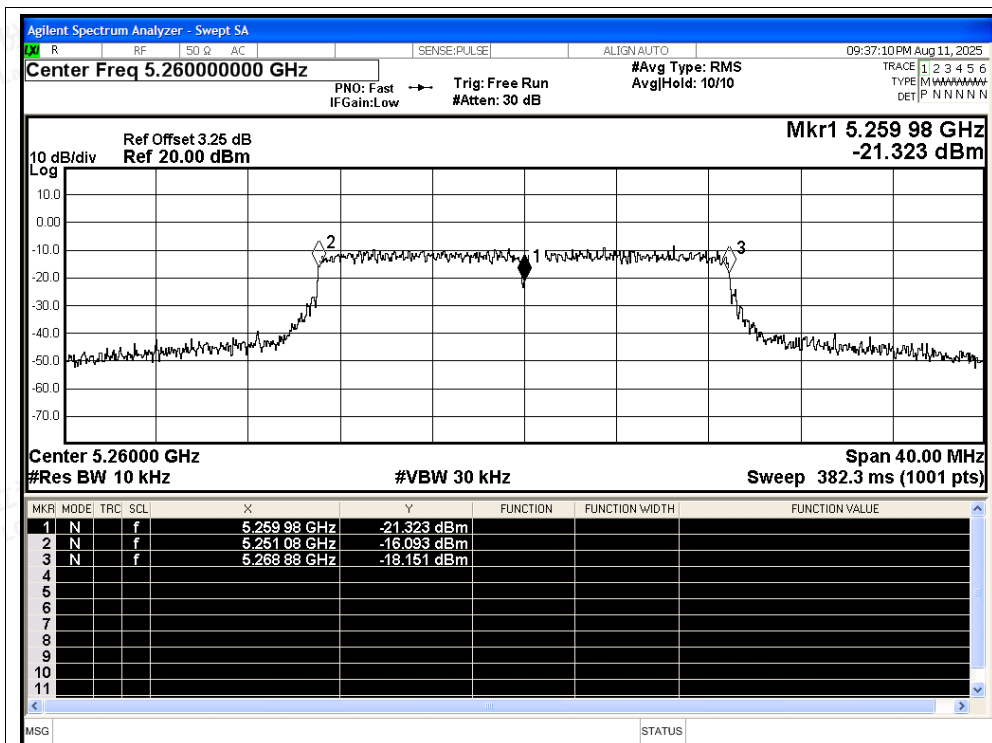

Freq. Stability NVNT be20 5300MHz Ant3

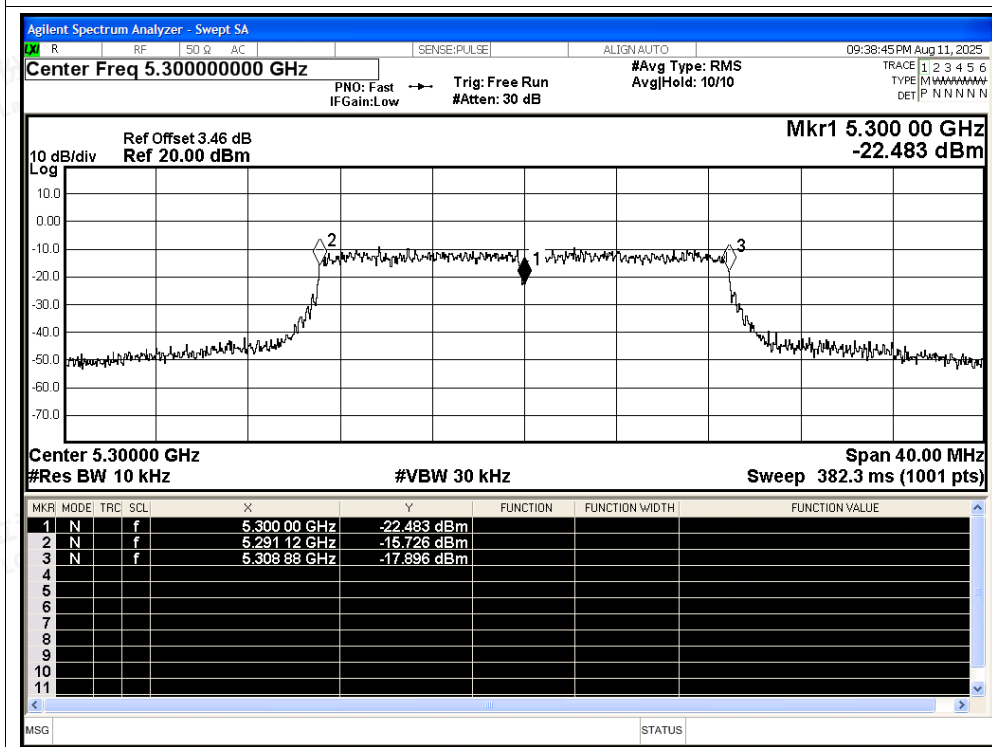

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5320MHz Ant3

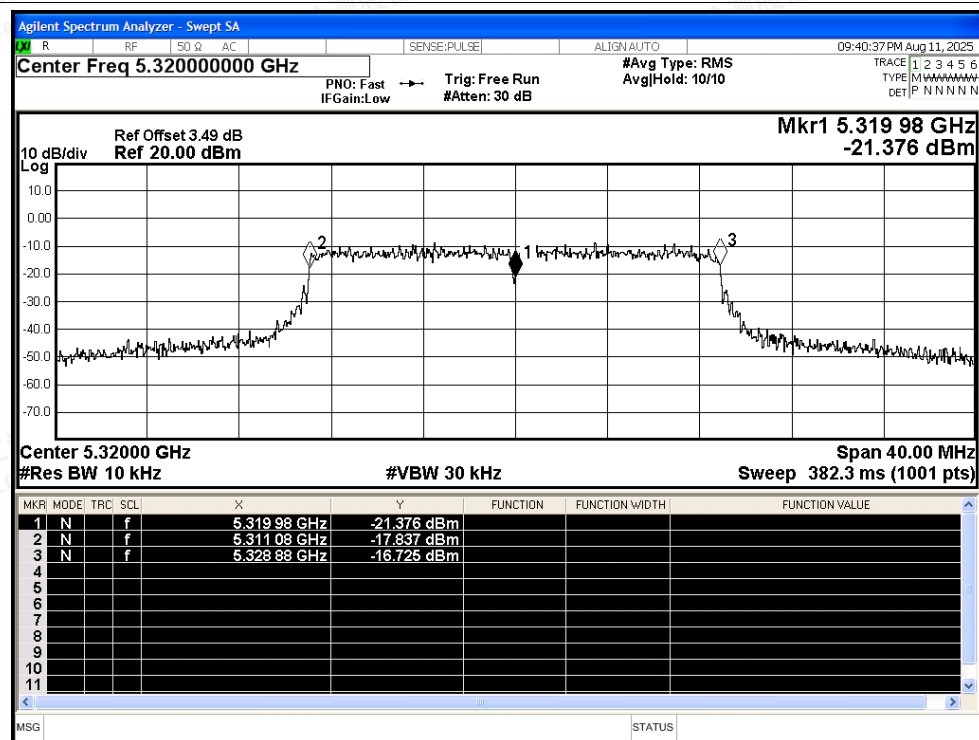

Freq. Stability NVNT be40 5270MHz Ant3

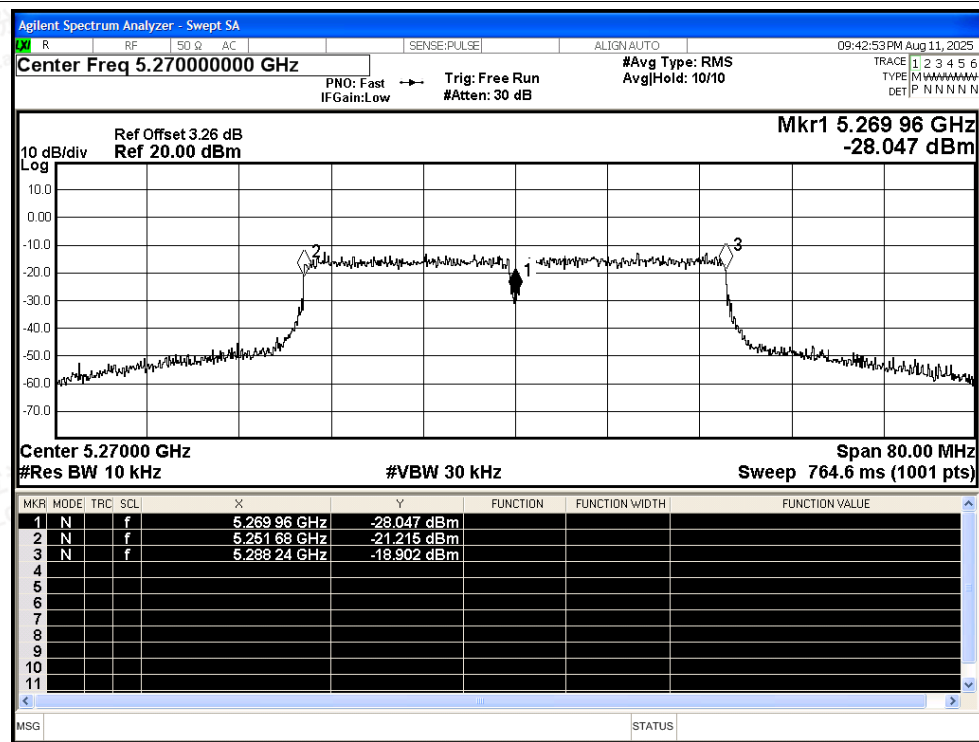

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be40 5310MHz Ant3

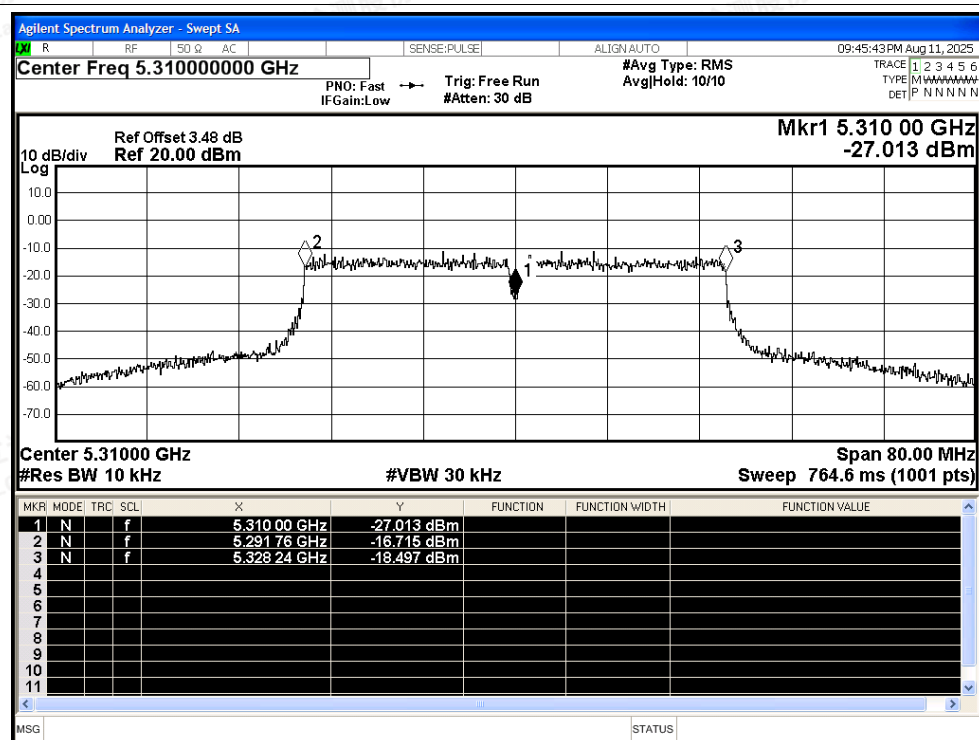

Freq. Stability NVNT be80 5290MHz Ant3

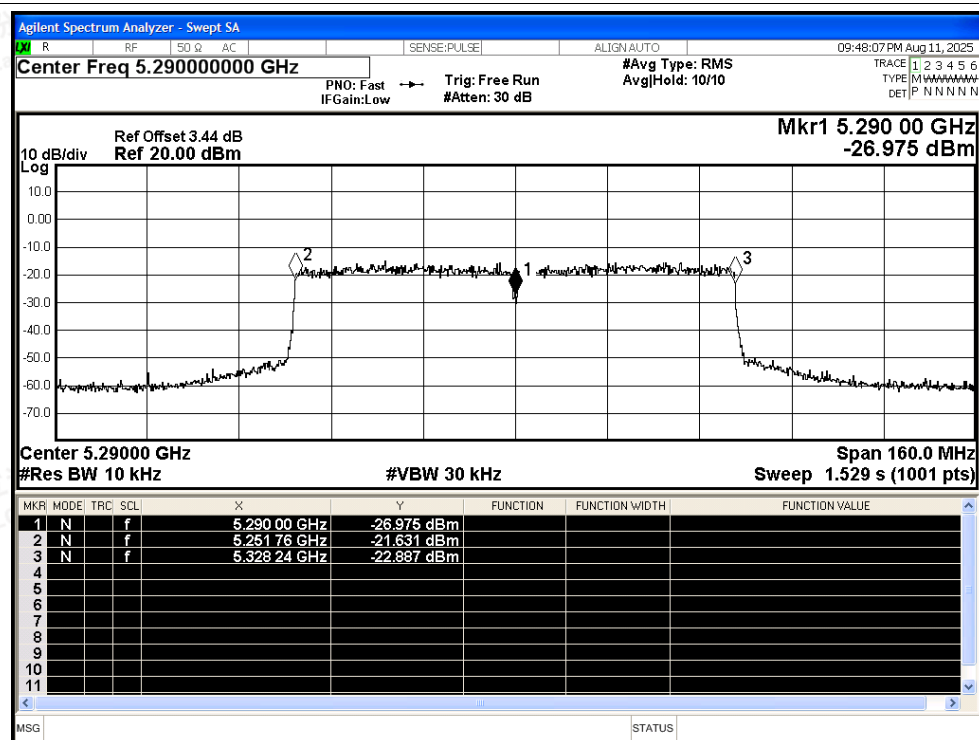

Freq. Stability NVNT ac160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

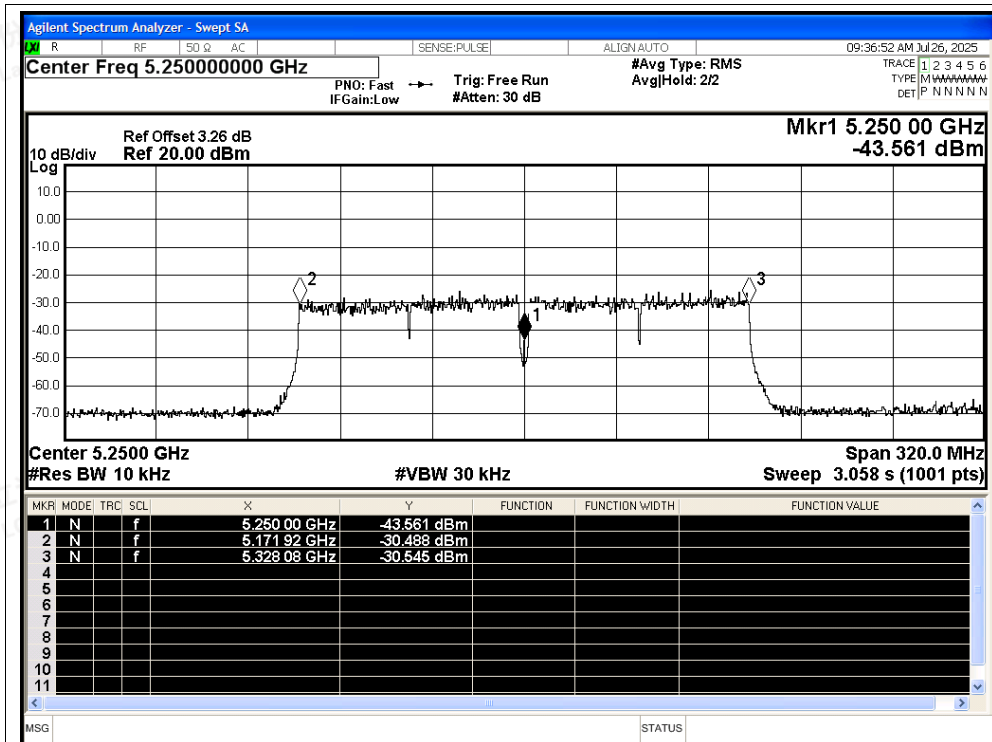

Freq. Stability NVNT ax160 5250MHz Ant3

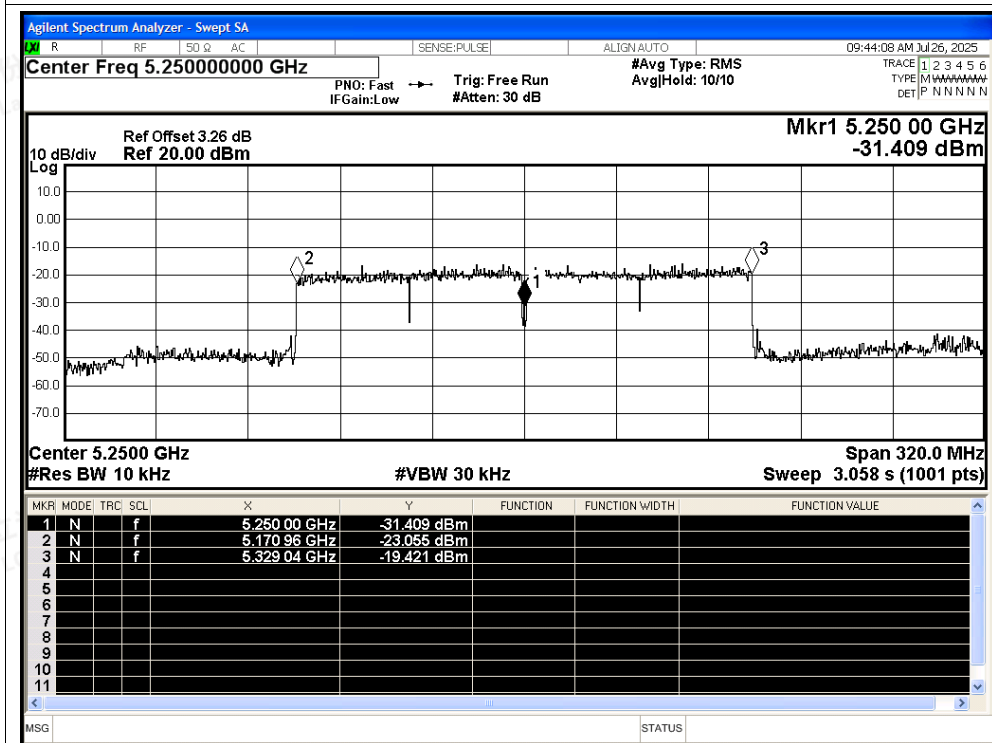

Freq. Stability NVNT be160 5250MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

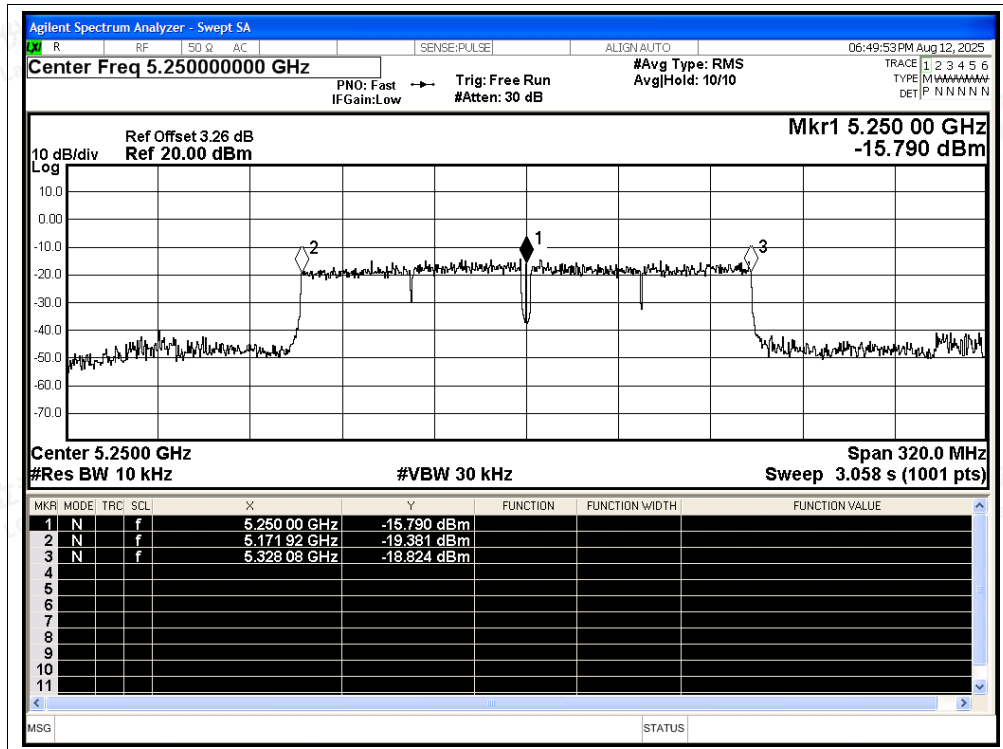

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	94.56	0.24	0.91
NVNT	a	5300	Ant1	94.56	0.24	0.91
NVNT	a	5320	Ant1	94.65	0.24	0.91
NVNT	n20	5260	Ant1	97.33	0.12	0.44
NVNT	n20	5300	Ant1	97.29	0.12	0.44
NVNT	n20	5320	Ant1	97.29	0.12	0.44
NVNT	n40	5270	Ant1	94.71	0.24	0.9
NVNT	n40	5310	Ant1	94.79	0.23	0.9
NVNT	ac20	5260	Ant1	97.34	0.12	0.44
NVNT	ac20	5300	Ant1	97.34	0.12	0.44
NVNT	ac20	5320	Ant1	97.34	0.12	0.44
NVNT	ac40	5270	Ant1	94.72	0.24	0.9
NVNT	ac40	5310	Ant1	94.72	0.24	0.9
NVNT	ac80	5290	Ant1	89.65	0.47	1.86
NVNT	ax20	5260	Ant1	97.34	0.12	0.44
NVNT	ax20	5300	Ant1	97.34	0.12	0.44
NVNT	ax20	5320	Ant1	97.34	0.12	0.44
NVNT	ax40	5270	Ant1	94.81	0.23	0.9
NVNT	ax40	5310	Ant1	94.72	0.24	0.9
NVNT	ax80	5290	Ant1	89.82	0.47	1.86
NVNT	be20	5260	Ant1	97.34	0.12	0.44
NVNT	be20	5300	Ant1	97.34	0.12	0.44
NVNT	be20	5320	Ant1	97.34	0.12	0.44
NVNT	be40	5270	Ant1	94.81	0.23	0.9
NVNT	be40	5310	Ant1	94.72	0.24	0.9
NVNT	be80	5290	Ant1	89.65	0.47	1.86
NVNT	ac160	5250	Ant1	40	3.98	5.95
NVNT	ax160	5250	Ant1	40	3.98	5.95
NVNT	be160	5250	Ant1	41.94	3.77	5.49



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

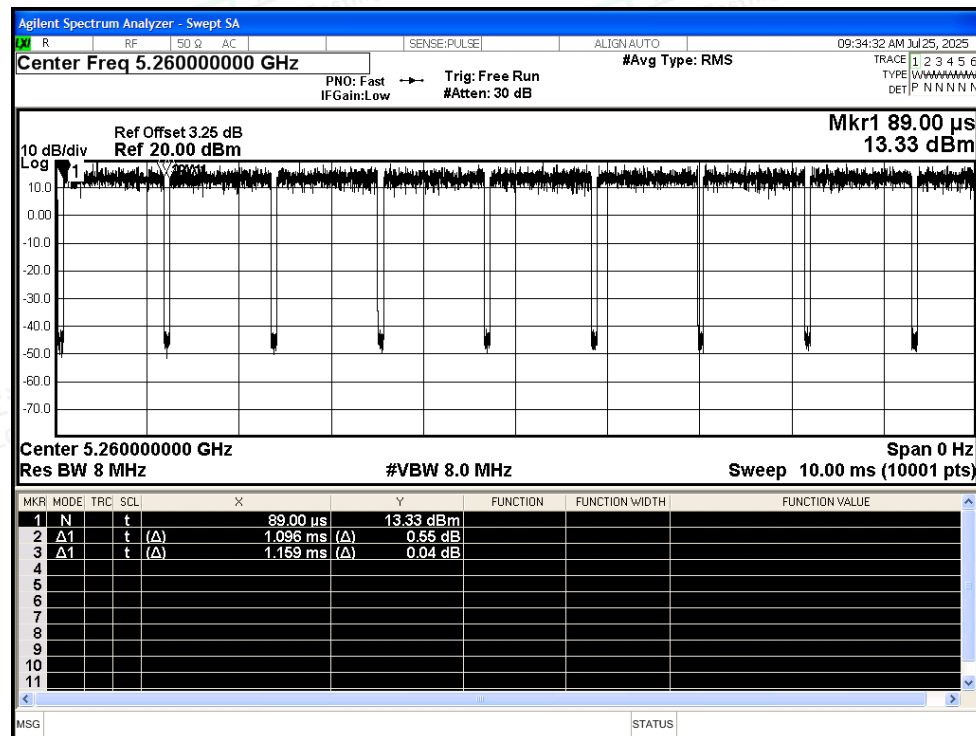

Duty Cycle NVNT a 5300MHz Ant1

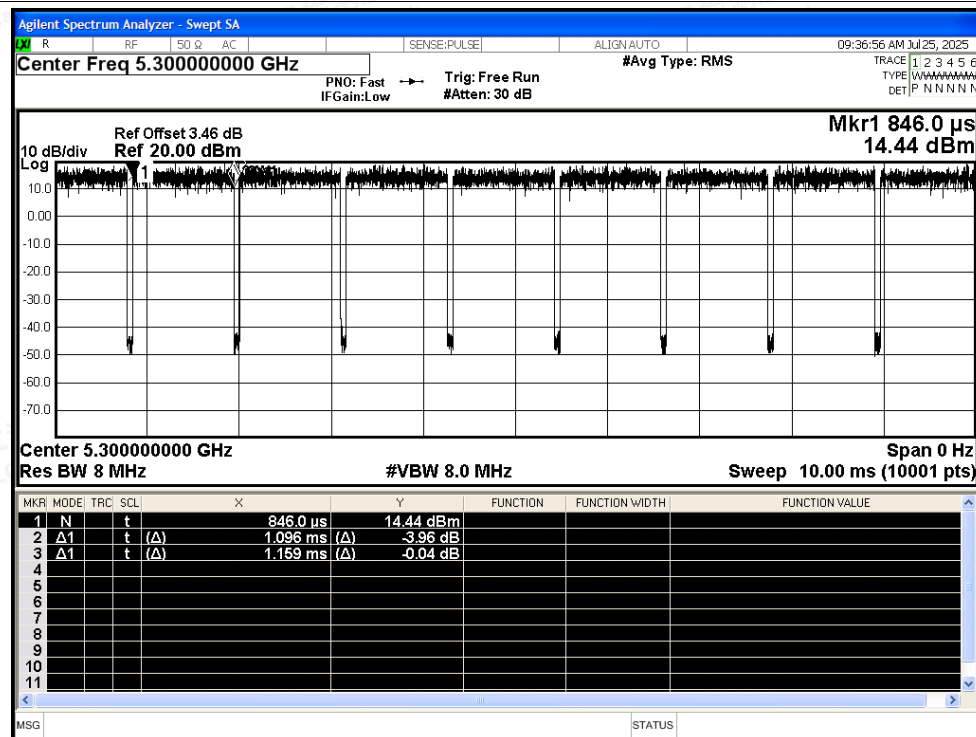

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

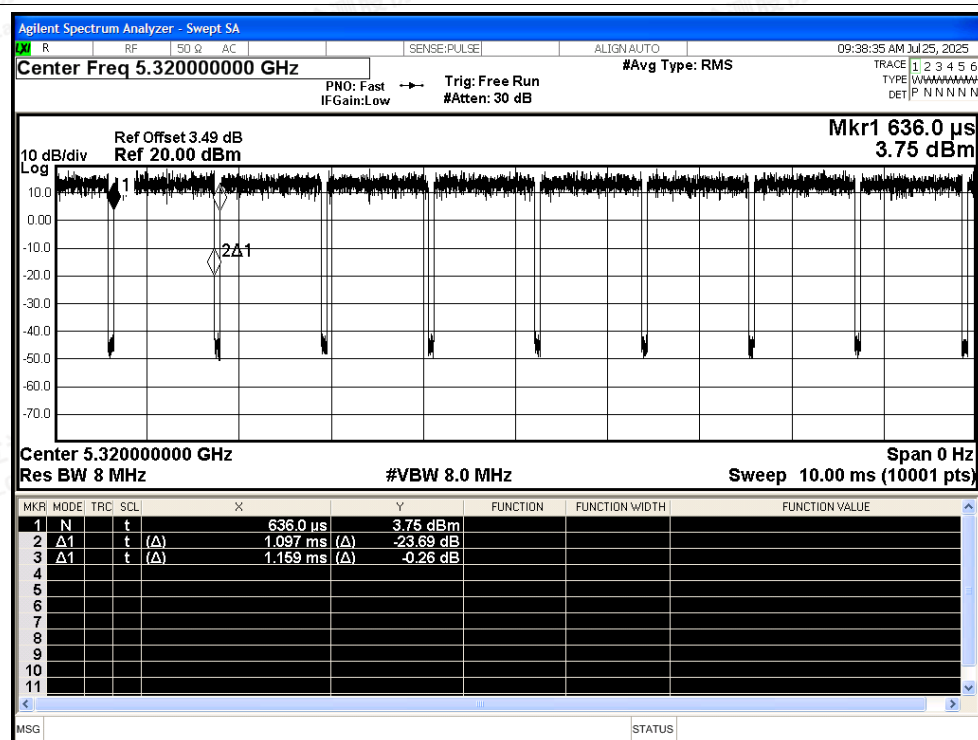

Duty Cycle NVNT n20 5260MHz Ant1


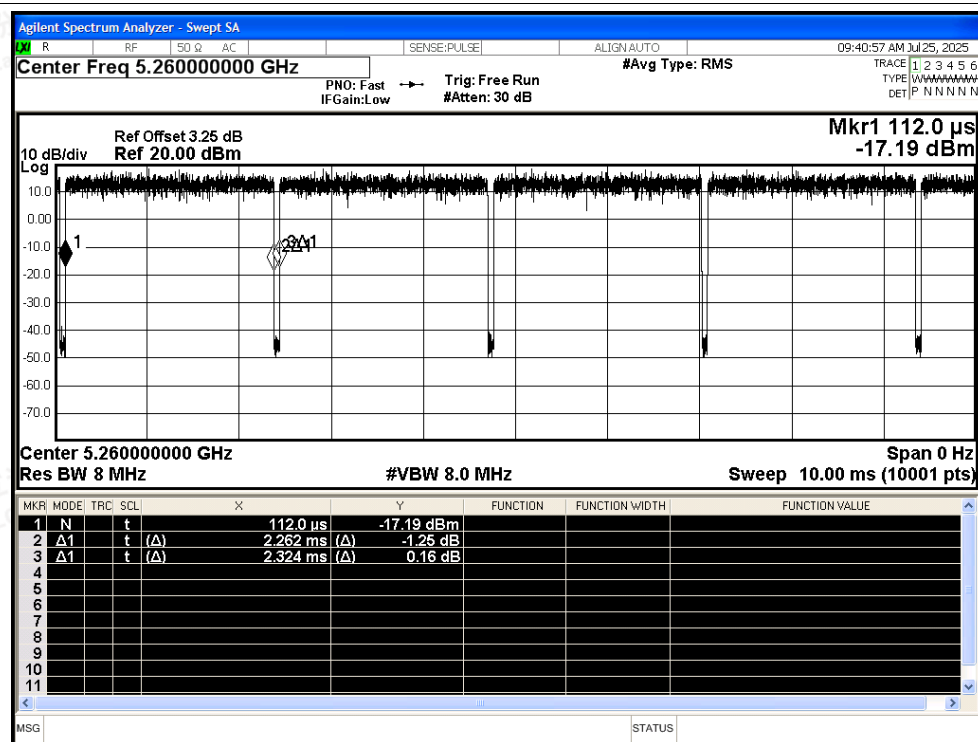


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

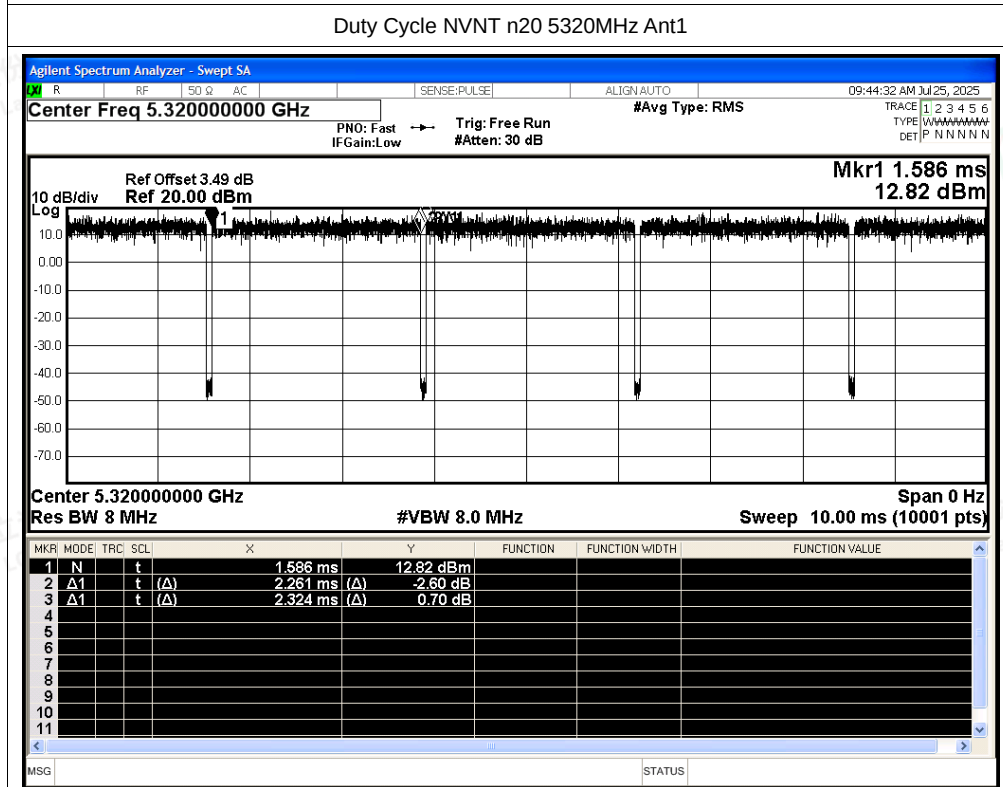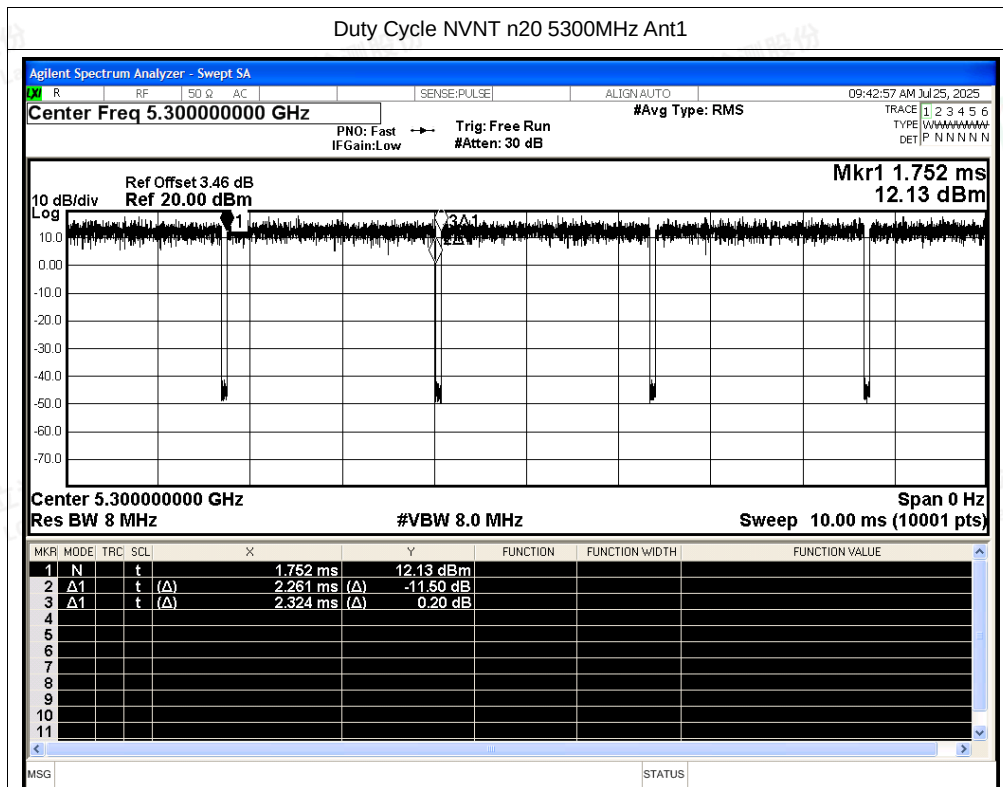

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant1

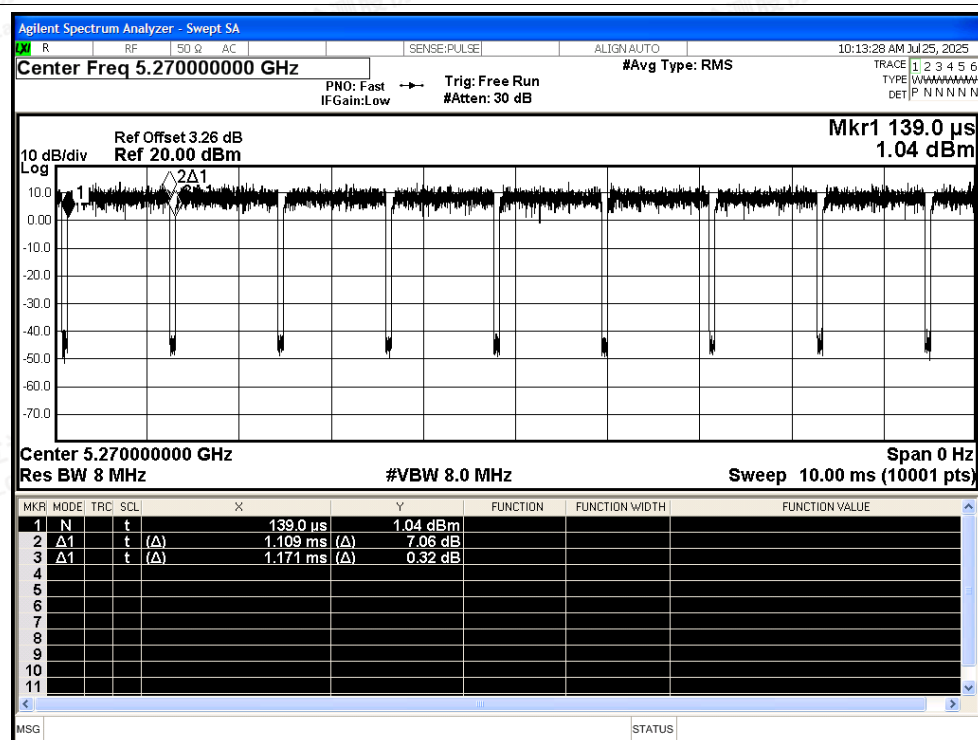

Duty Cycle NVNT n40 5310MHz Ant1

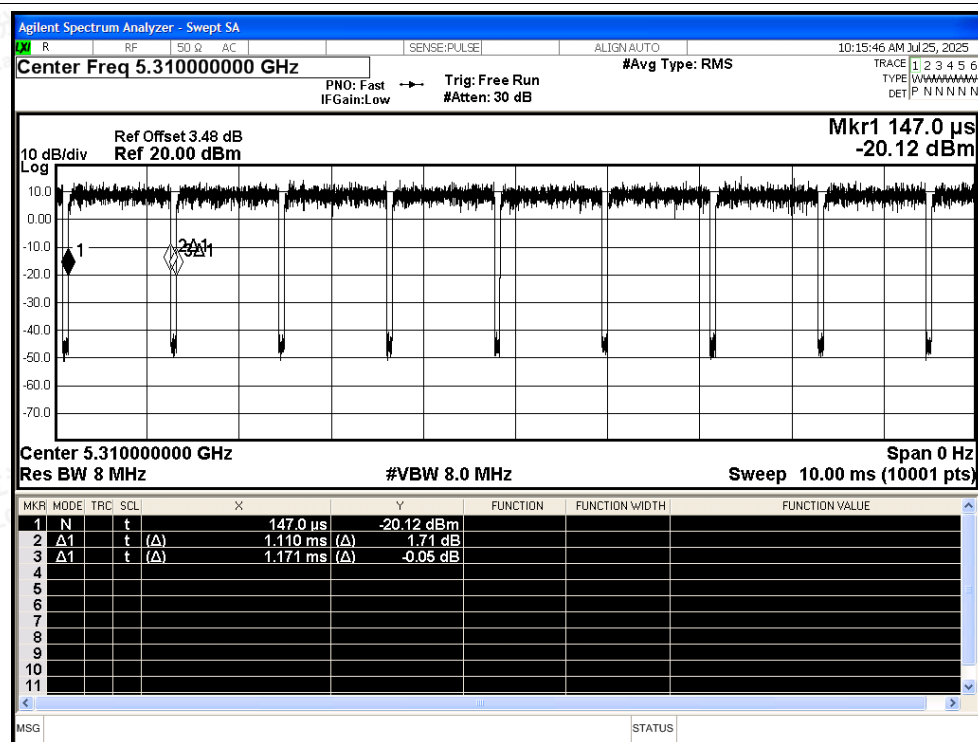

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

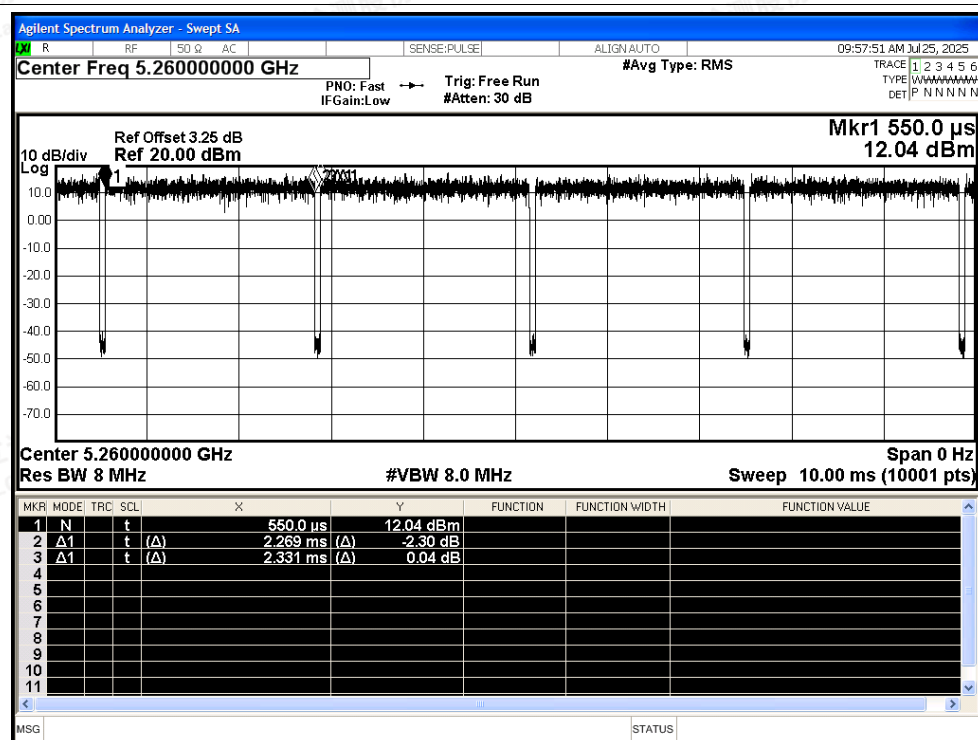

Duty Cycle NVNT ac20 5300MHz Ant1

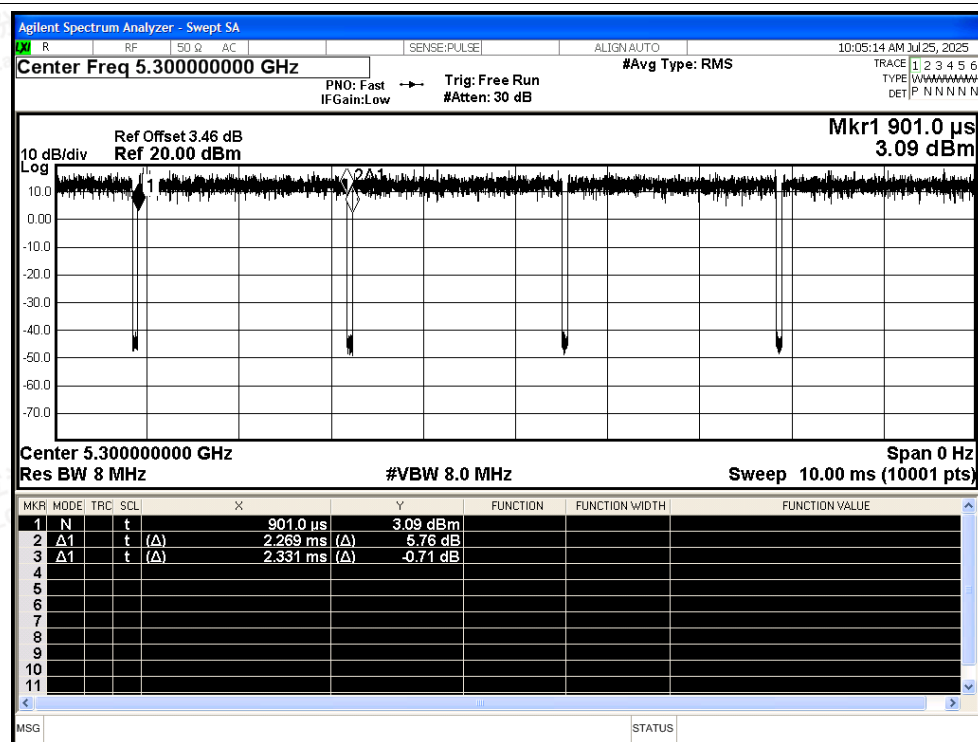

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

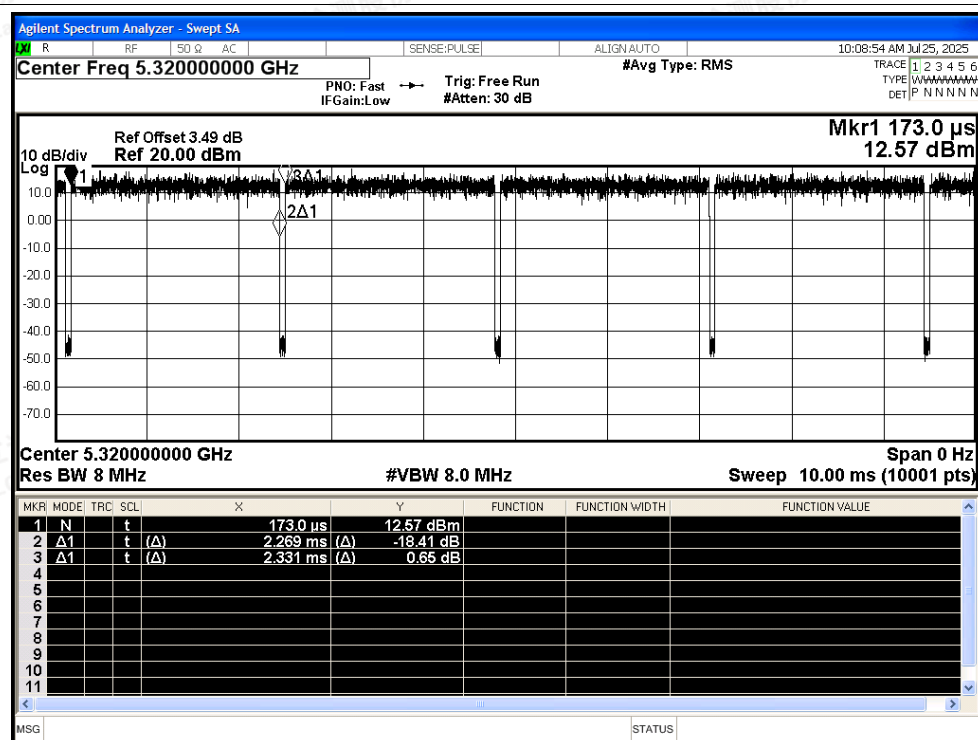

Duty Cycle NVNT ac40 5270MHz Ant1

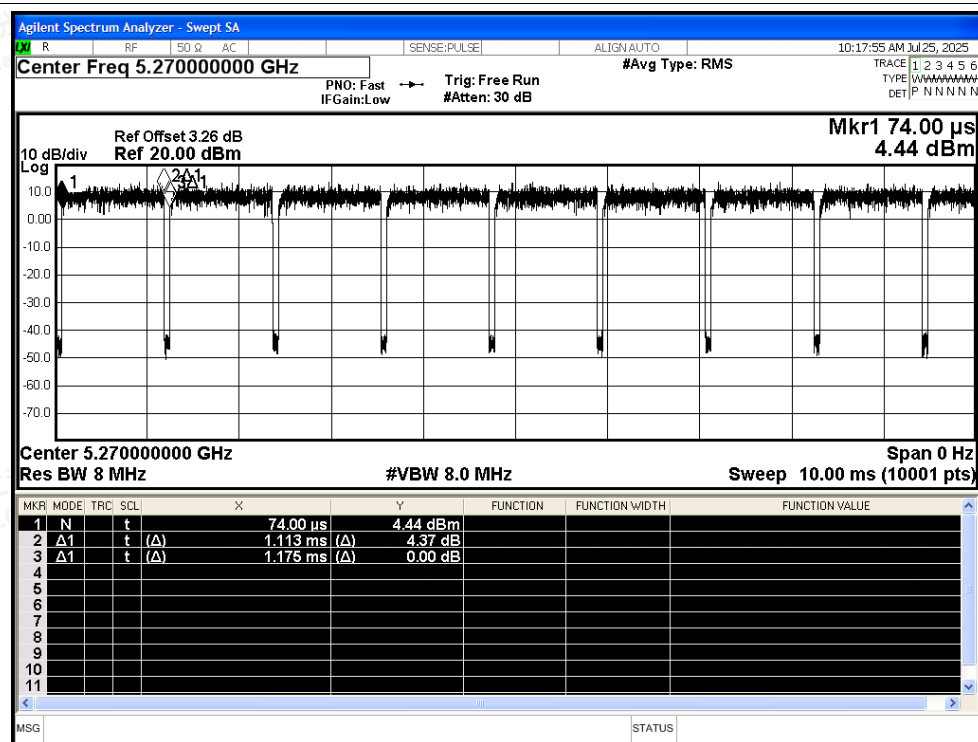

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant1

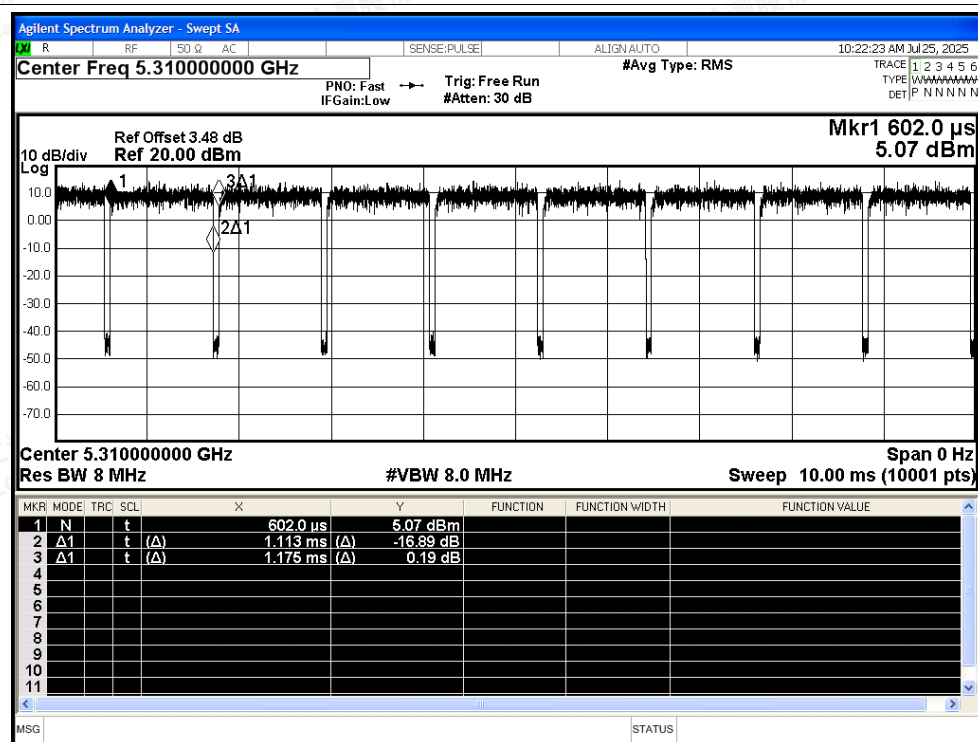

Duty Cycle NVNT ac80 5290MHz Ant1

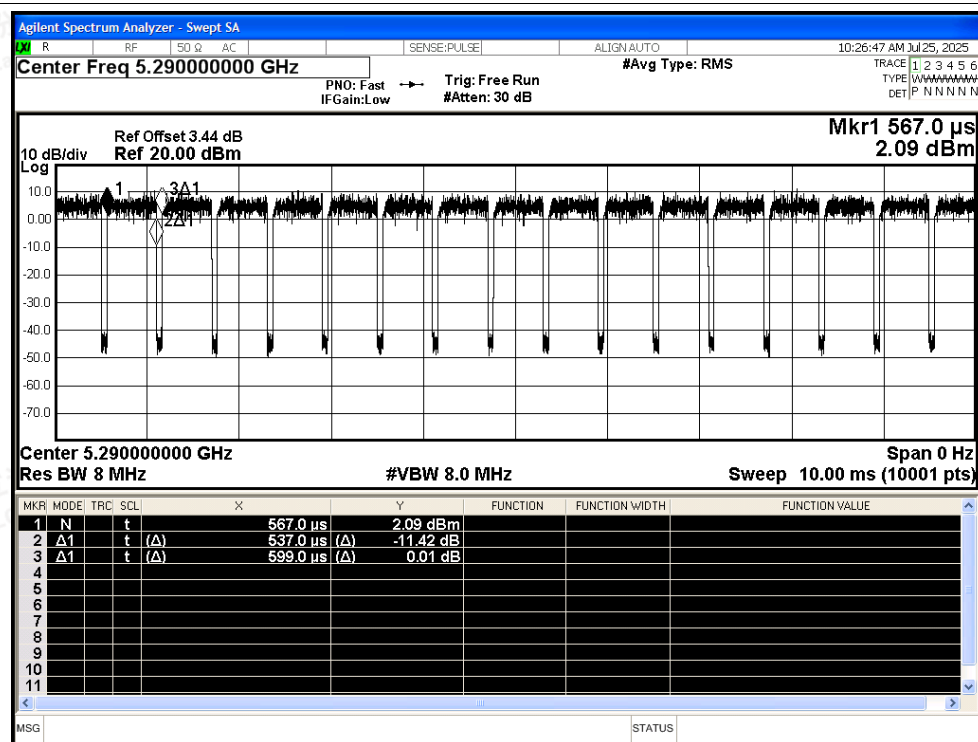

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant1

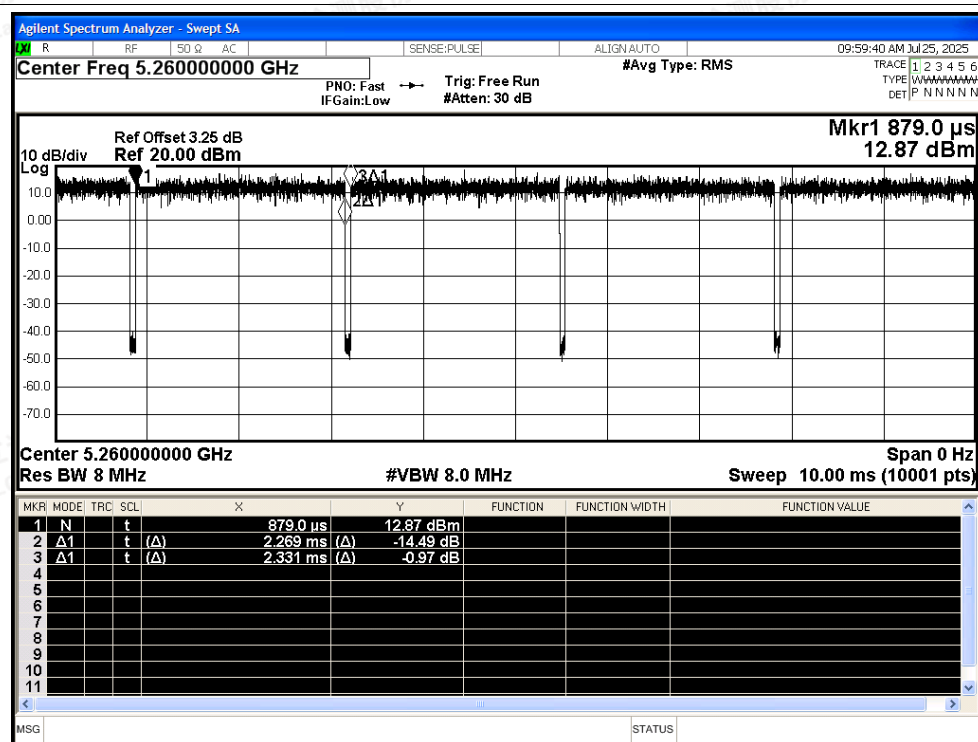

Duty Cycle NVNT ax20 5300MHz Ant1

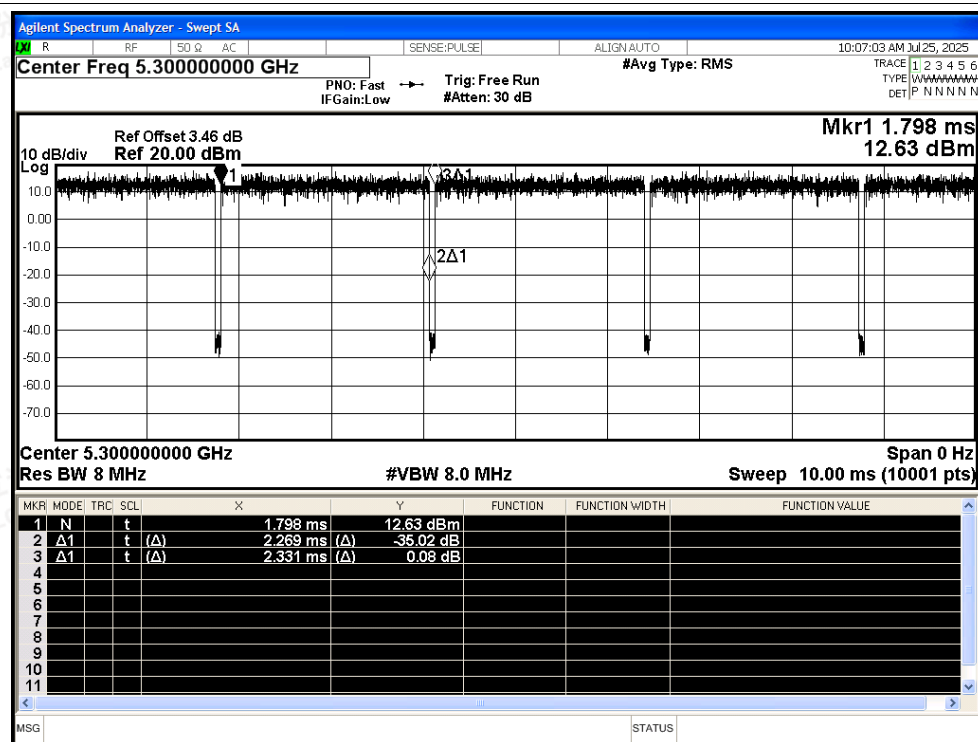

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5320MHz Ant1

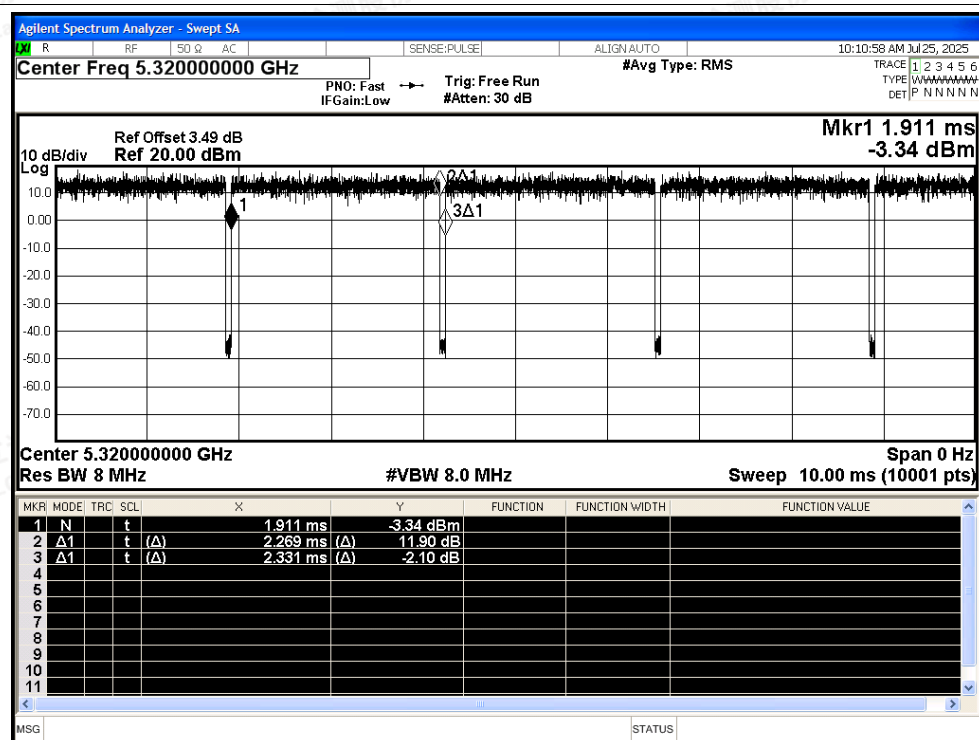

Duty Cycle NVNT ax40 5270MHz Ant1

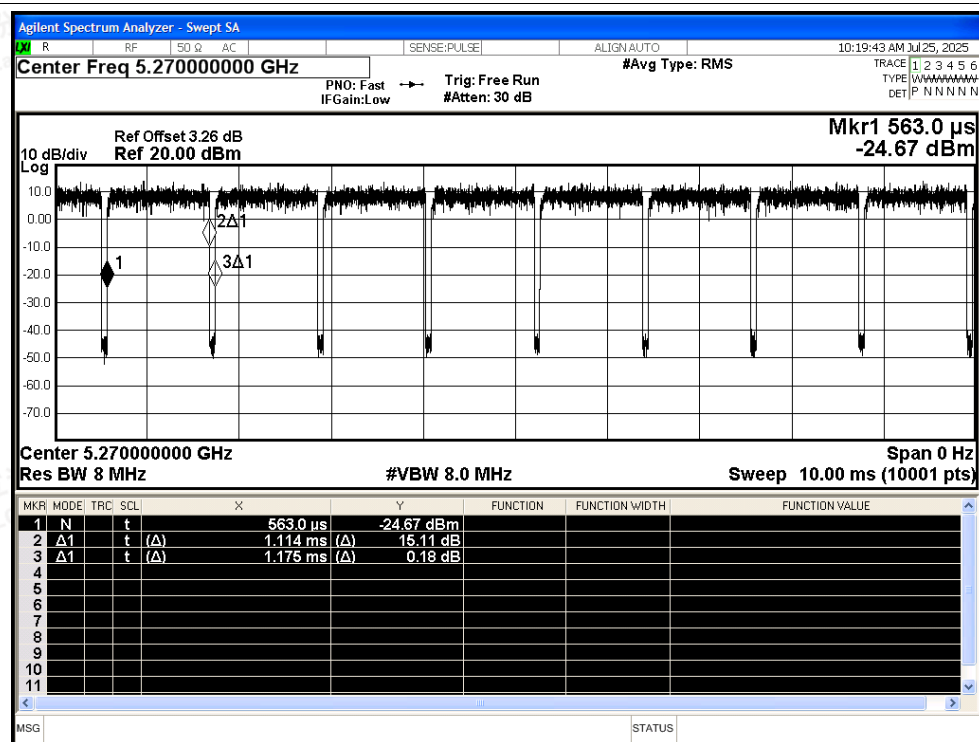

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5310MHz Ant1

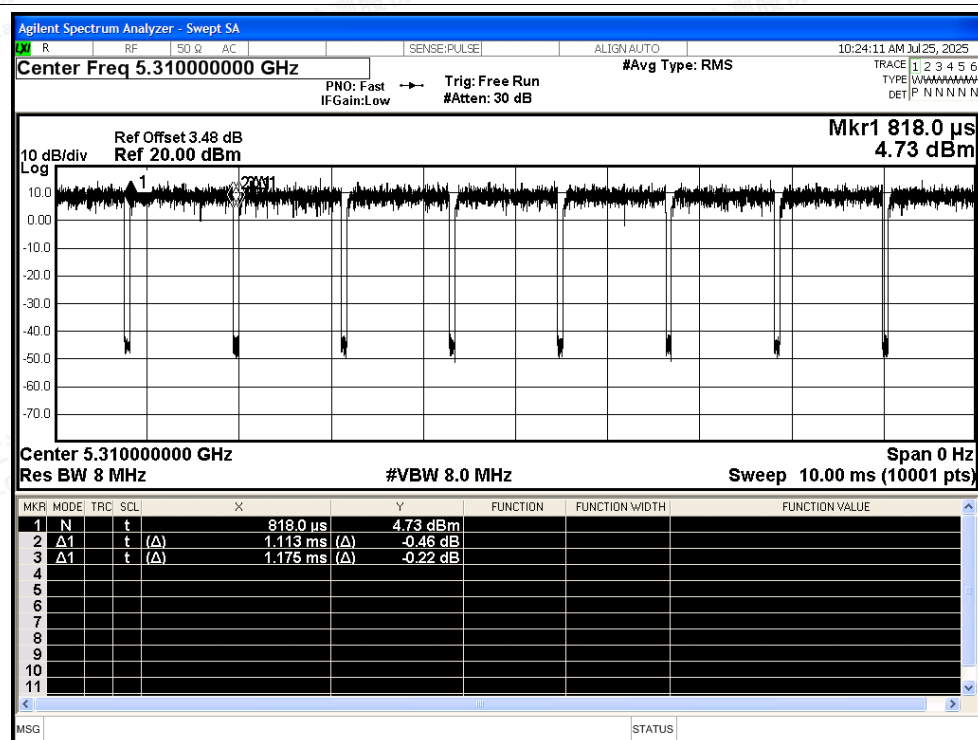

Duty Cycle NVNT ax80 5290MHz Ant1

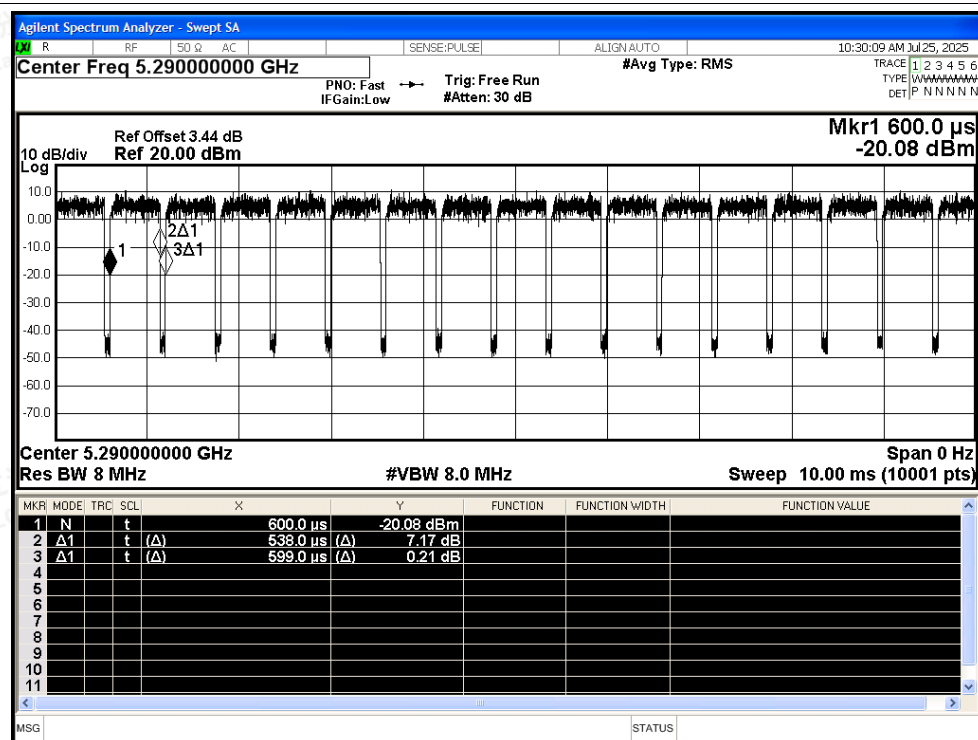

Duty Cycle NVNT be20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

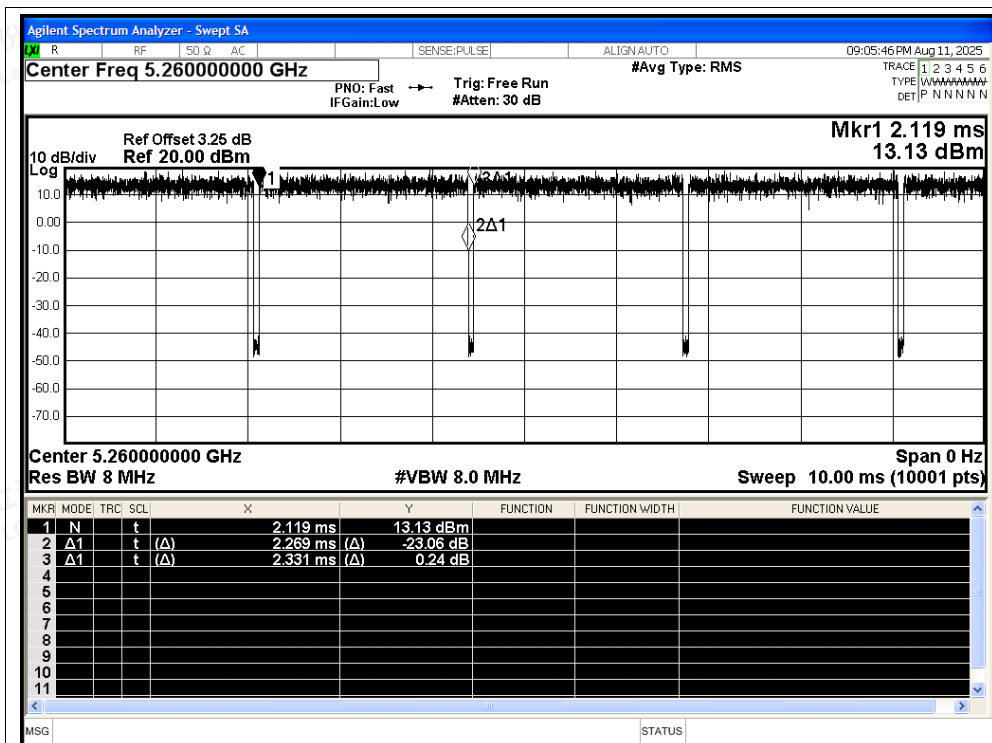

Duty Cycle NVNT be20 5300MHz Ant1

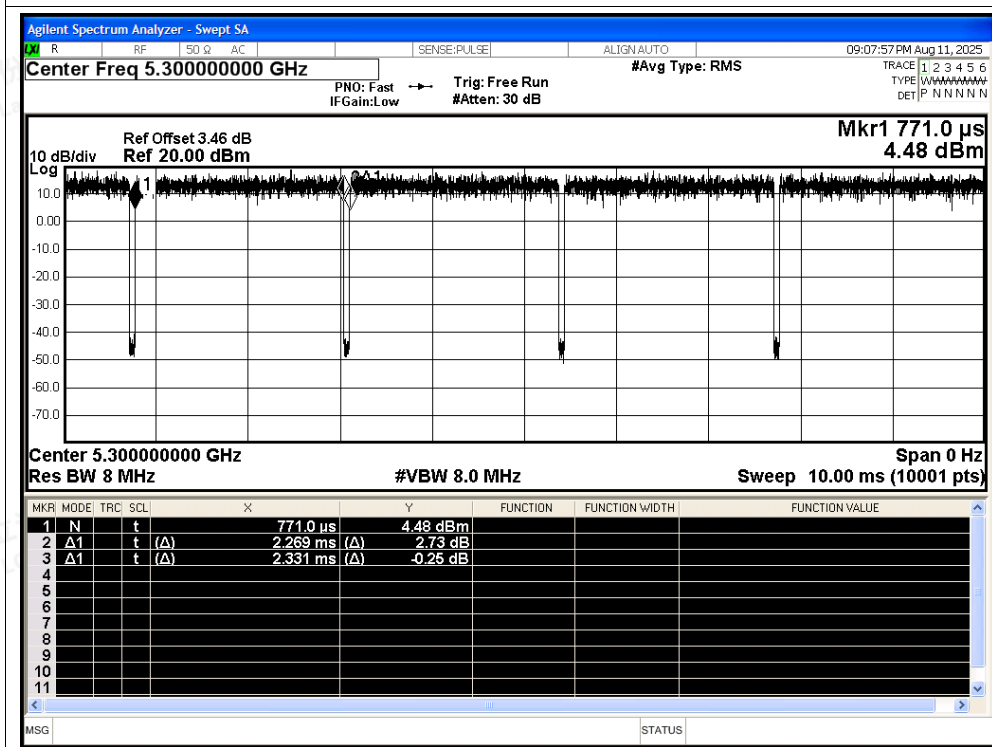

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT be20 5320MHz Ant1

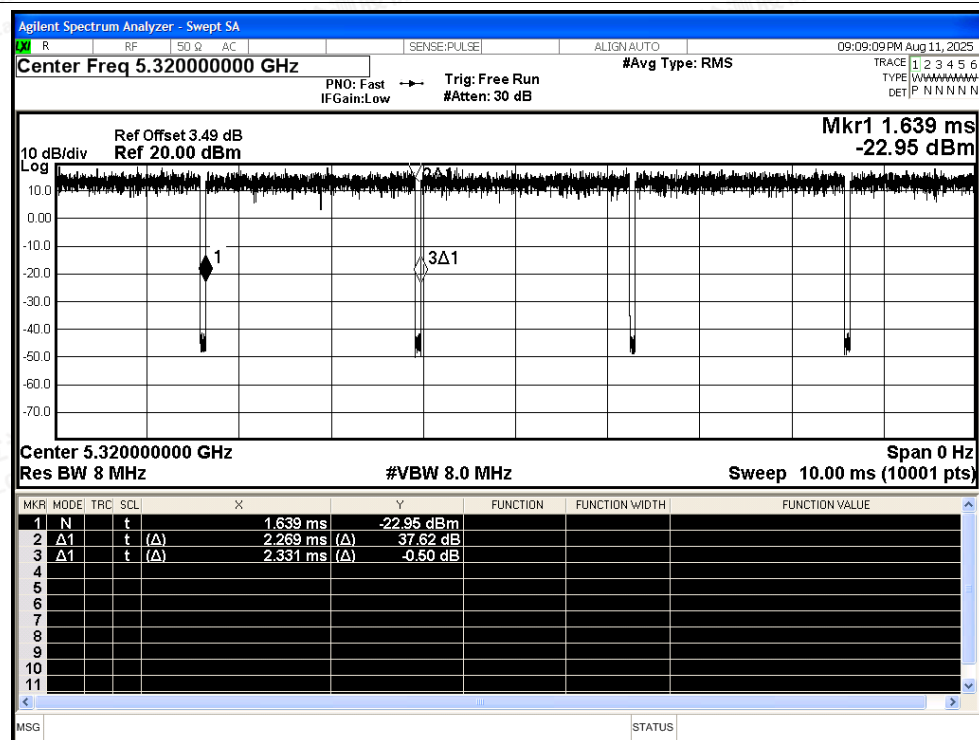

Duty Cycle NVNT be40 5270MHz Ant1

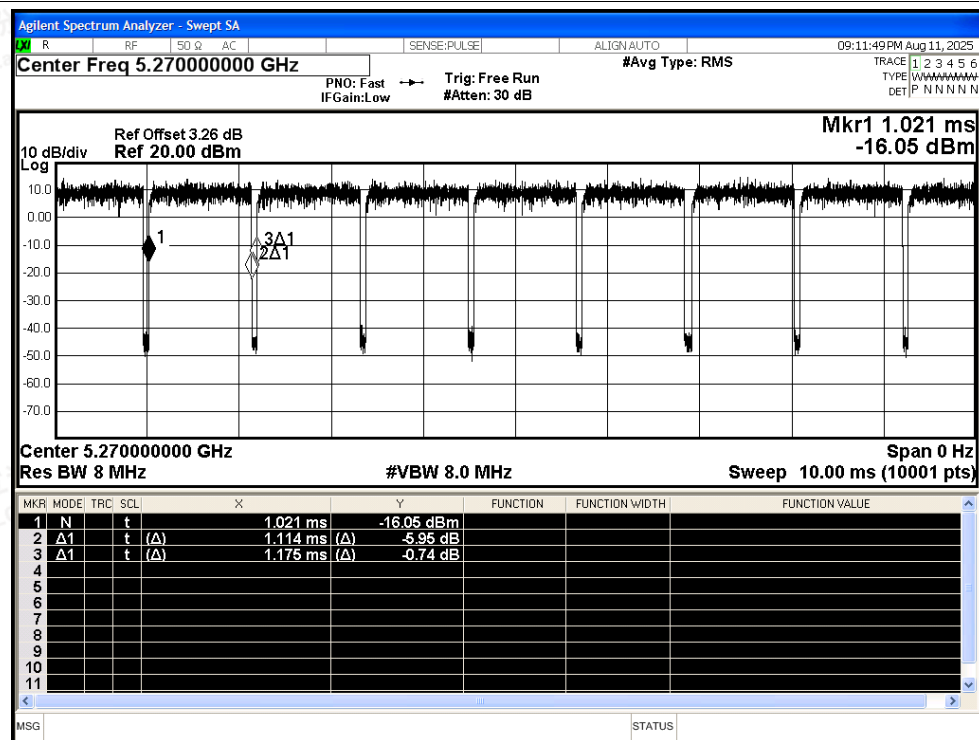

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT be40 5310MHz Ant1

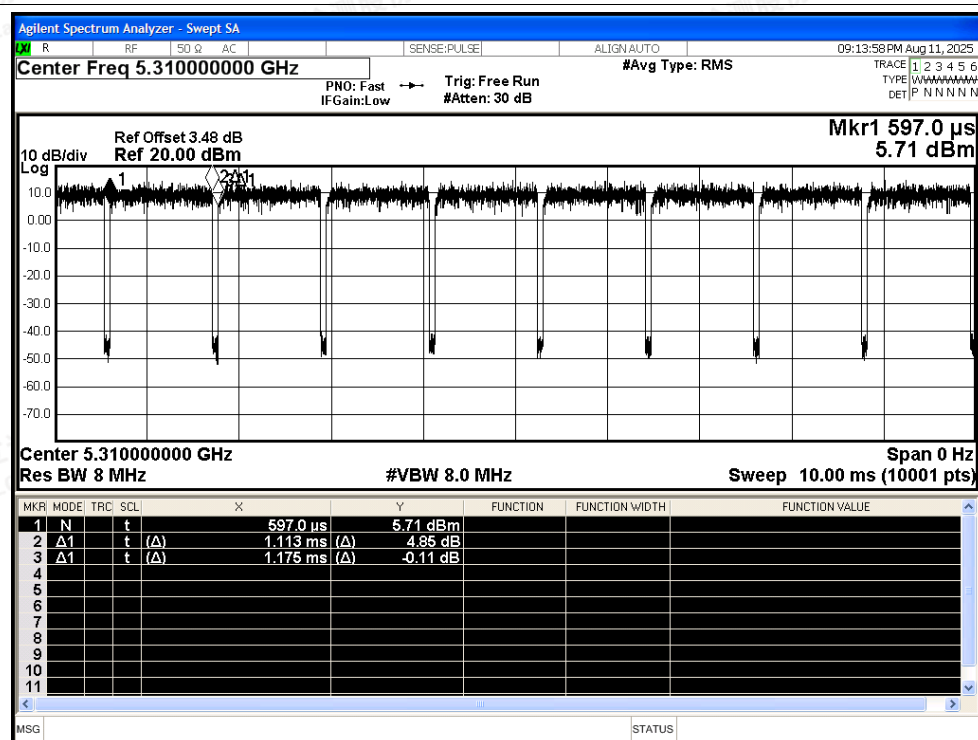

Duty Cycle NVNT be80 5290MHz Ant1

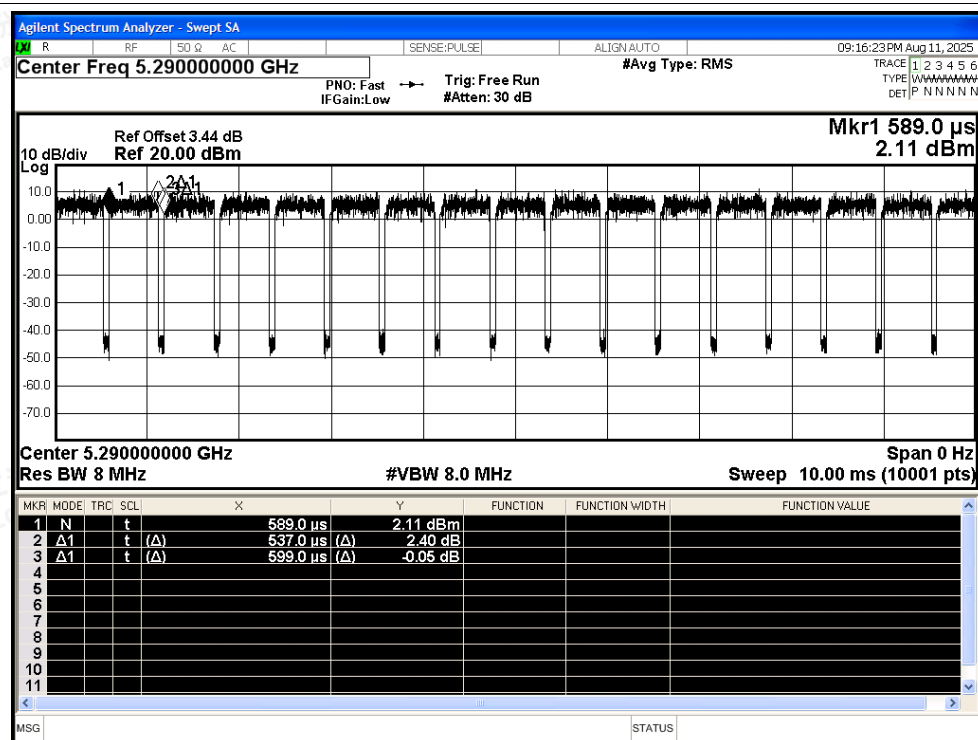

Duty Cycle NVNT ac160 5250MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

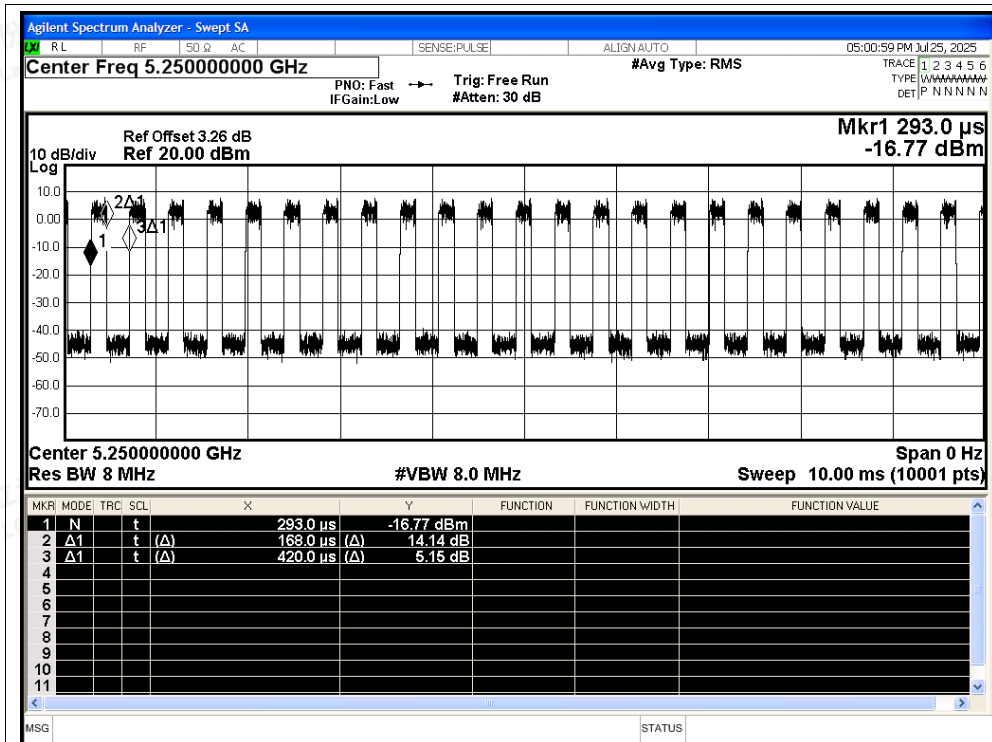

Duty Cycle NVNT ax160 5250MHz Ant1

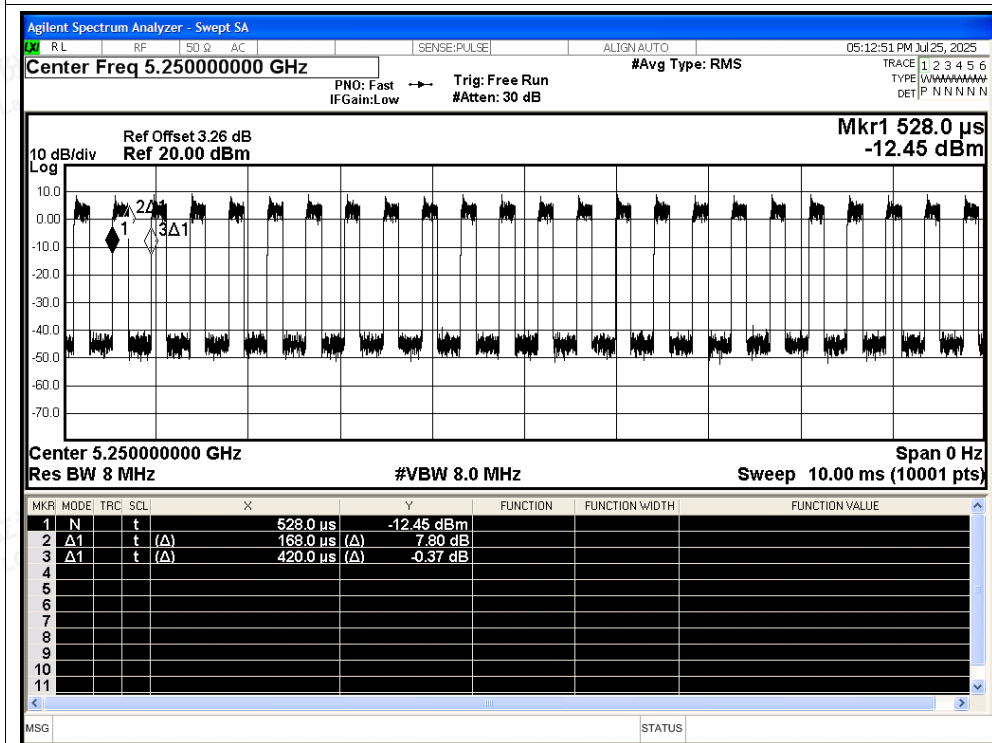

Duty Cycle NVNT be160 5250MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

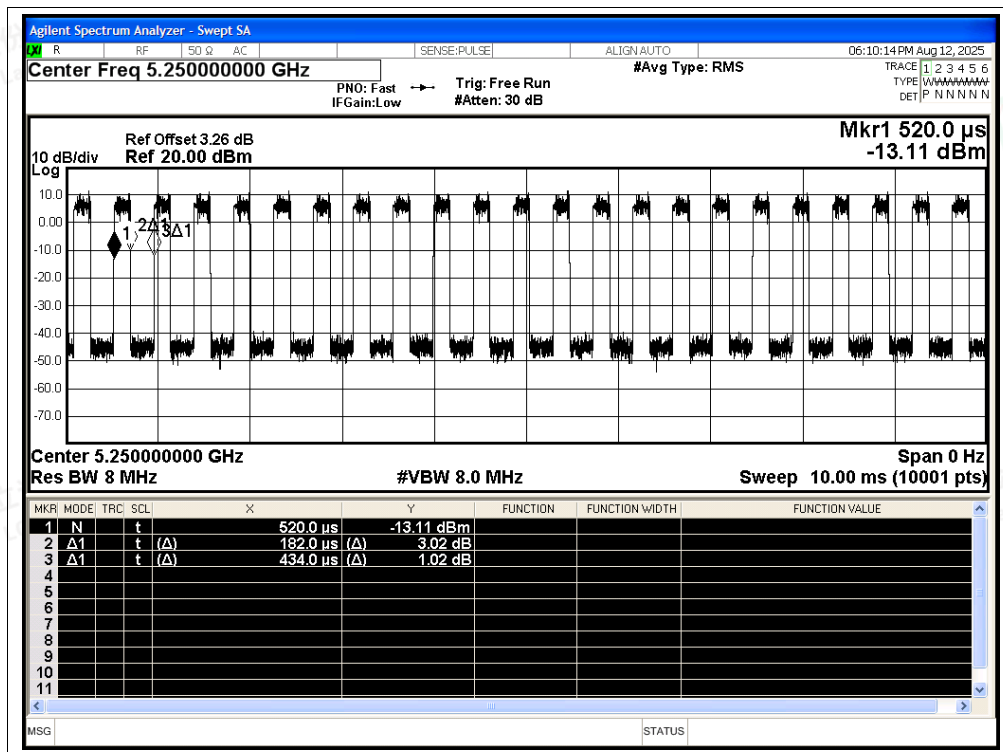

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	94.65	0.24	0.91
NVNT	a	5300	Ant2	94.65	0.24	0.91
NVNT	a	5320	Ant2	94.56	0.24	0.91
NVNT	n20	5260	Ant2	97.29	0.12	0.44
NVNT	n20	5300	Ant2	97.29	0.12	0.44
NVNT	n20	5320	Ant2	97.29	0.12	0.44
NVNT	n40	5270	Ant2	94.71	0.24	0.9
NVNT	n40	5310	Ant2	94.71	0.24	0.9
NVNT	ac20	5260	Ant2	97.34	0.12	0.44
NVNT	ac20	5300	Ant2	97.34	0.12	0.44
NVNT	ac20	5320	Ant2	97.34	0.12	0.44
NVNT	ac40	5270	Ant2	94.72	0.24	0.9
NVNT	ac40	5310	Ant2	94.81	0.23	0.9
NVNT	ac80	5290	Ant2	89.65	0.47	1.86
NVNT	ax20	5260	Ant2	97.34	0.12	0.44
NVNT	ax20	5300	Ant2	97.3	0.12	0.44
NVNT	ax20	5320	Ant2	97.34	0.12	0.44
NVNT	ax40	5270	Ant2	94.81	0.23	0.9
NVNT	ax40	5310	Ant2	94.72	0.24	0.9
NVNT	ax80	5290	Ant2	89.65	0.47	1.86
NVNT	be20	5260	Ant2	97.34	0.12	0.44
NVNT	be20	5300	Ant2	97.34	0.12	0.44
NVNT	be20	5320	Ant2	97.34	0.12	0.44
NVNT	be40	5270	Ant2	94.72	0.24	0.9
NVNT	be40	5310	Ant2	94.72	0.24	0.9
NVNT	be80	5290	Ant2	89.65	0.47	1.86
NVNT	ac160	5250	Ant2	39.86	3.99	5.99
NVNT	ax160	5250	Ant2	40	3.98	5.95
NVNT	be160	5250	Ant2	41.94	3.77	5.49



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant2

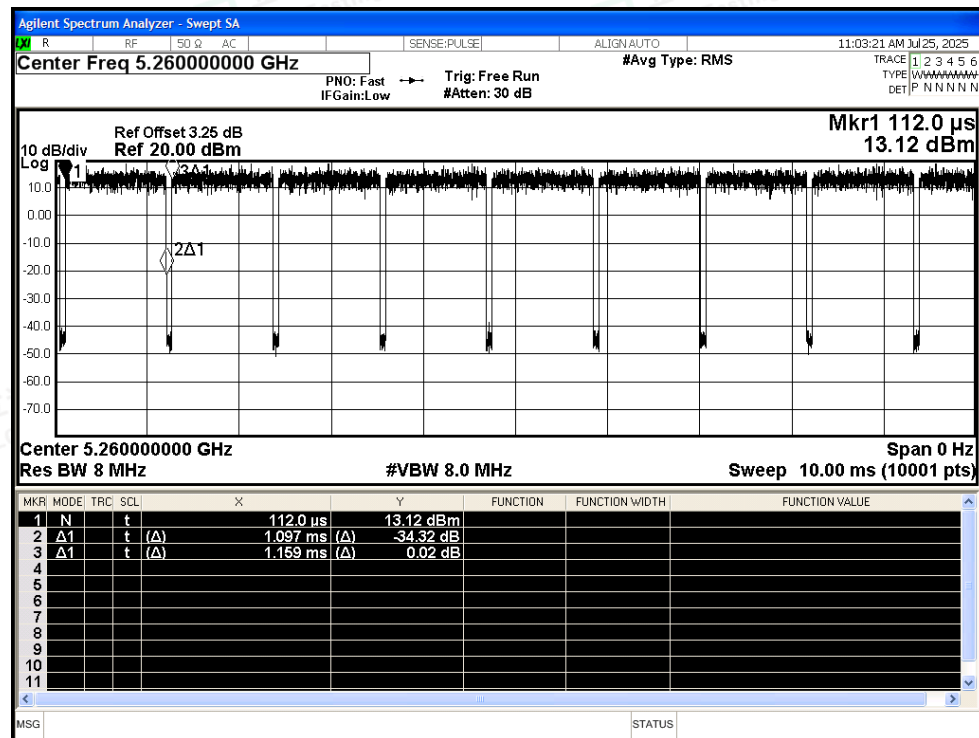

Duty Cycle NVNT a 5300MHz Ant2

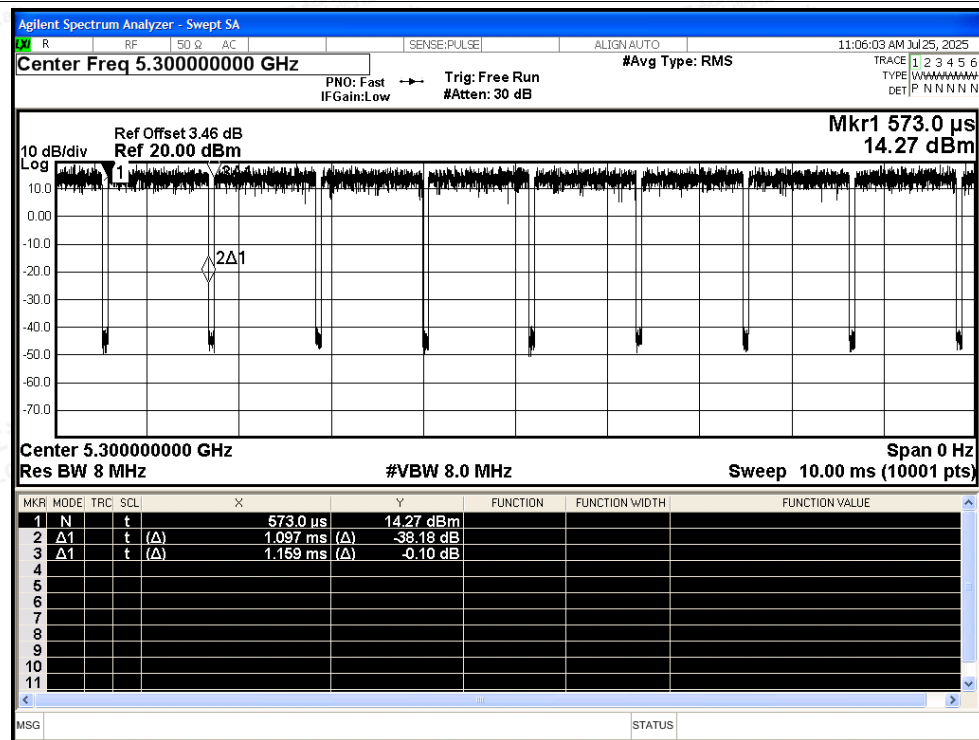

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant2

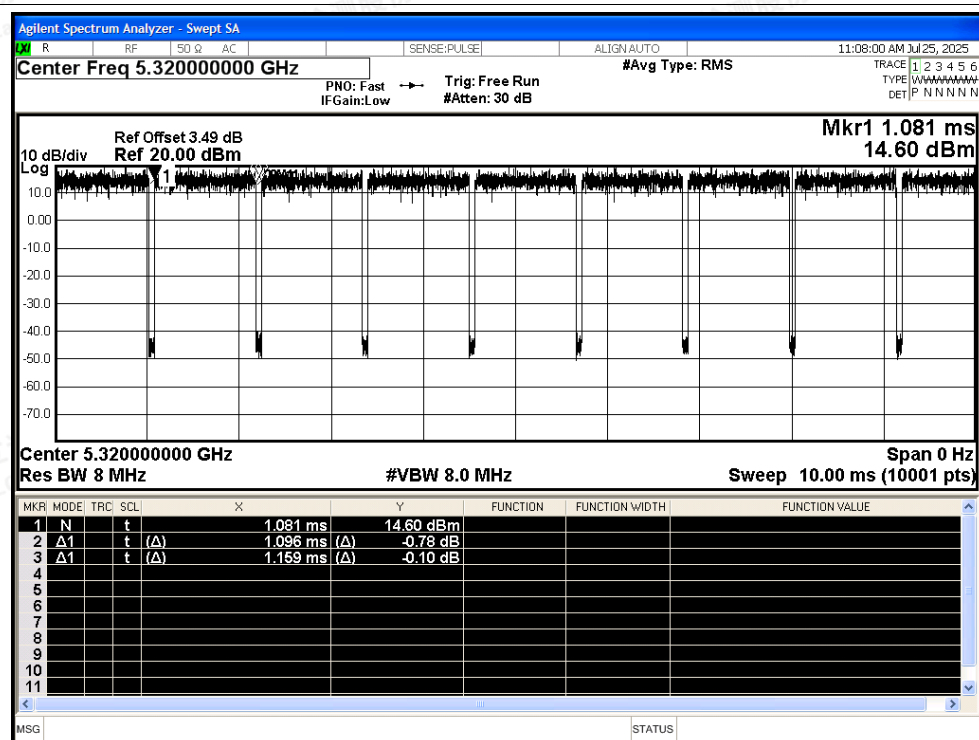

Duty Cycle NVNT n20 5260MHz Ant2


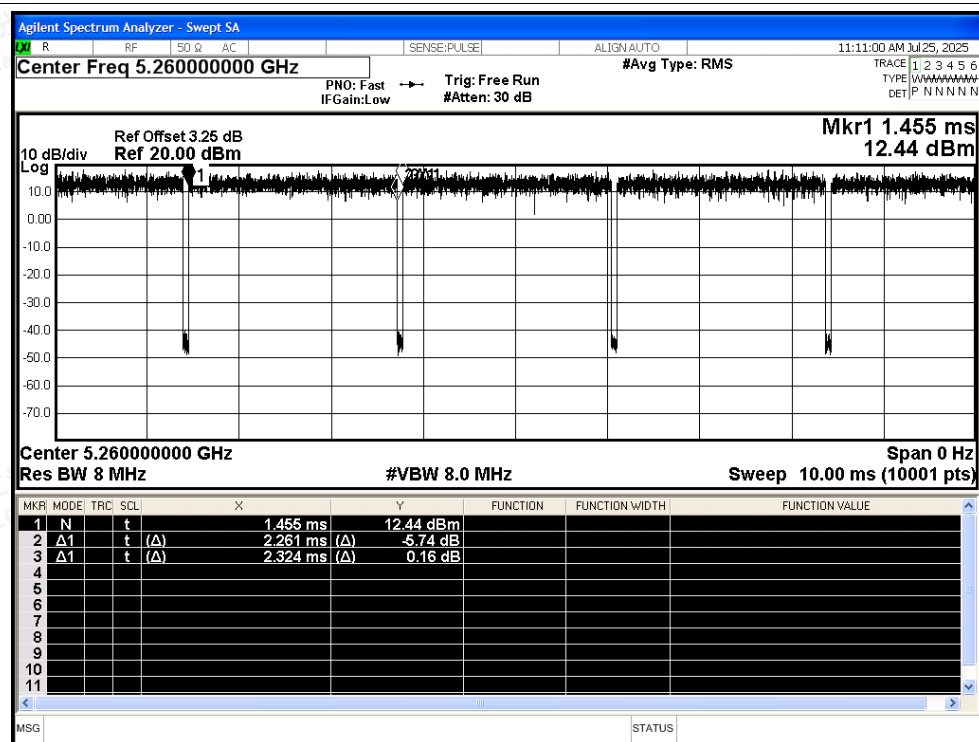


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

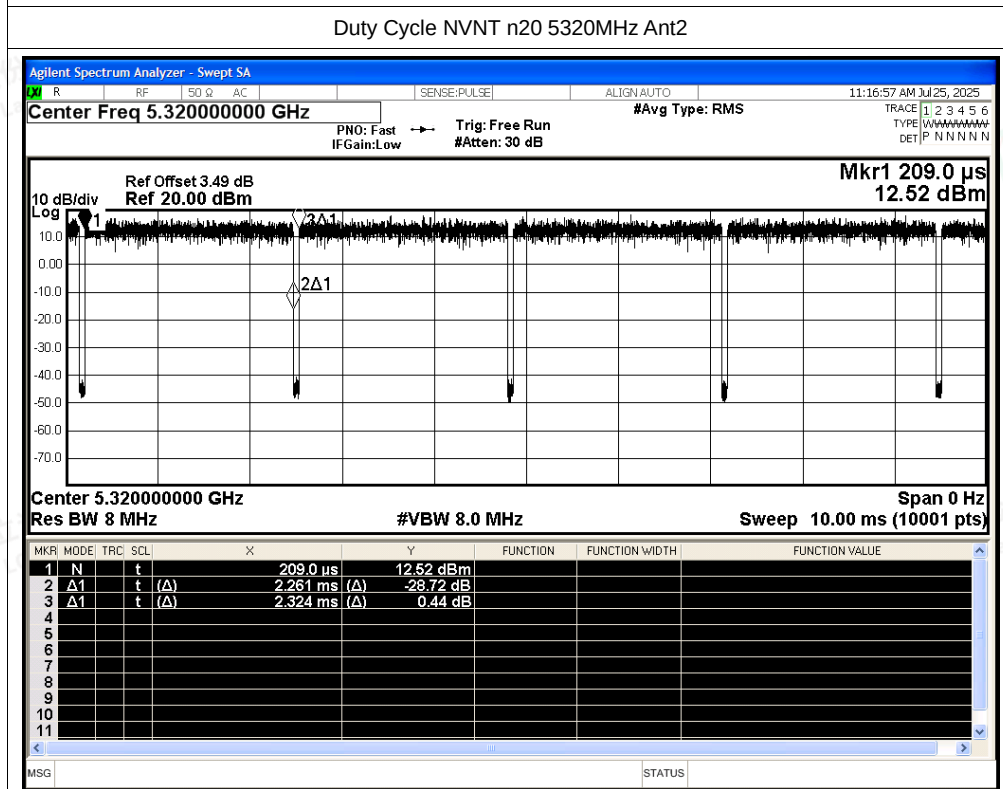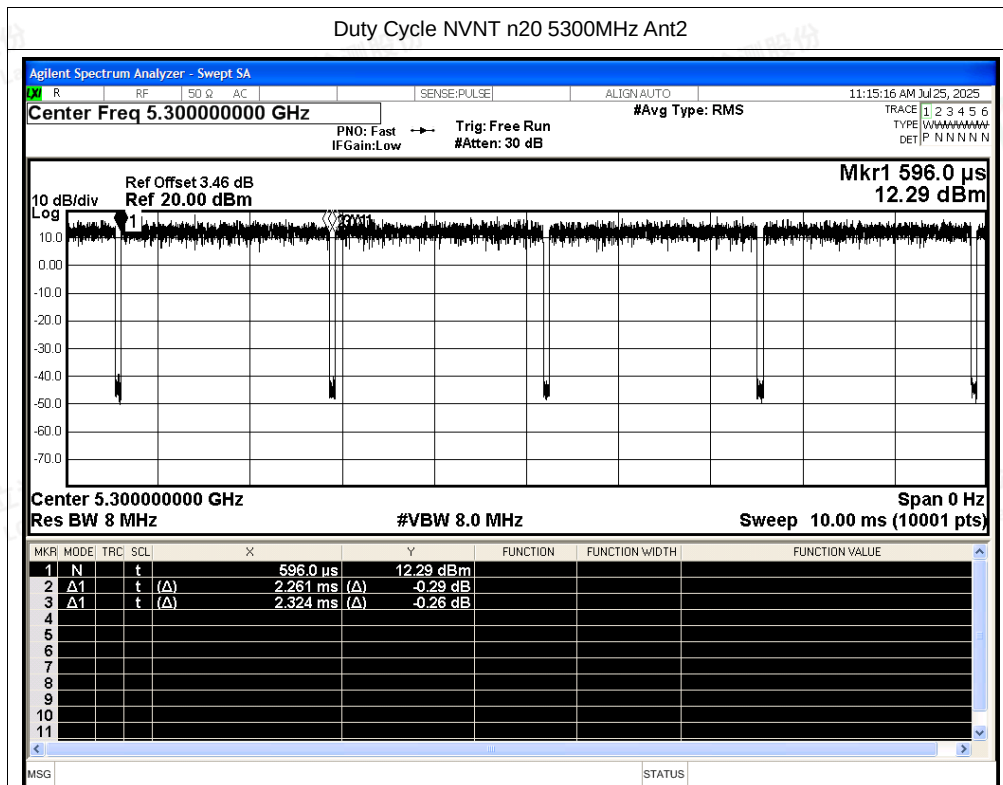

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant2

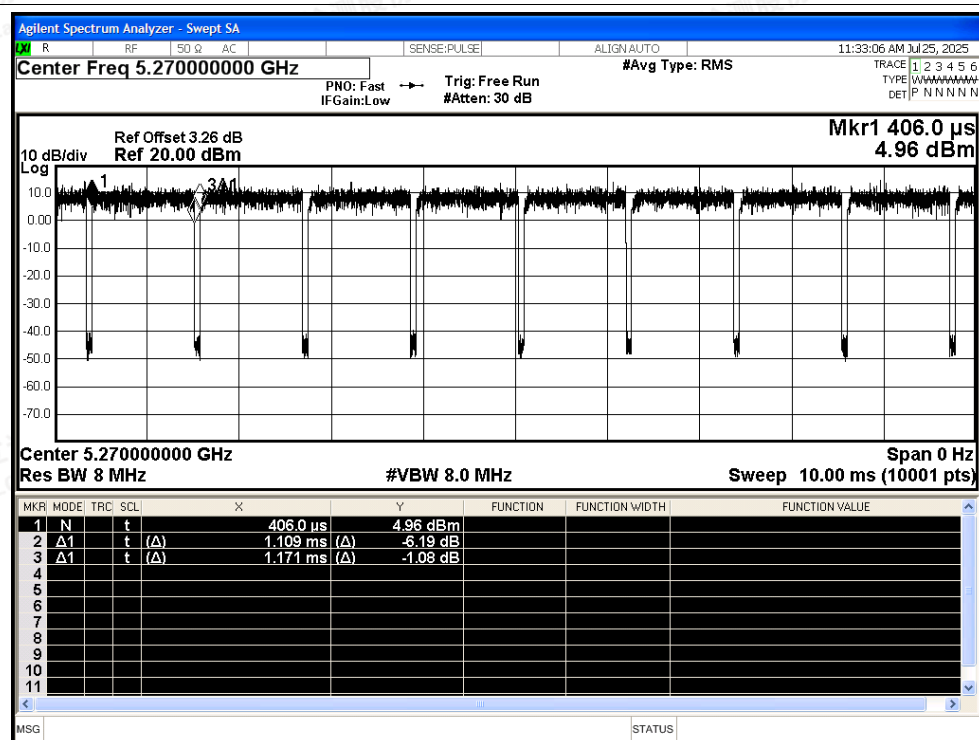

Duty Cycle NVNT n40 5310MHz Ant2

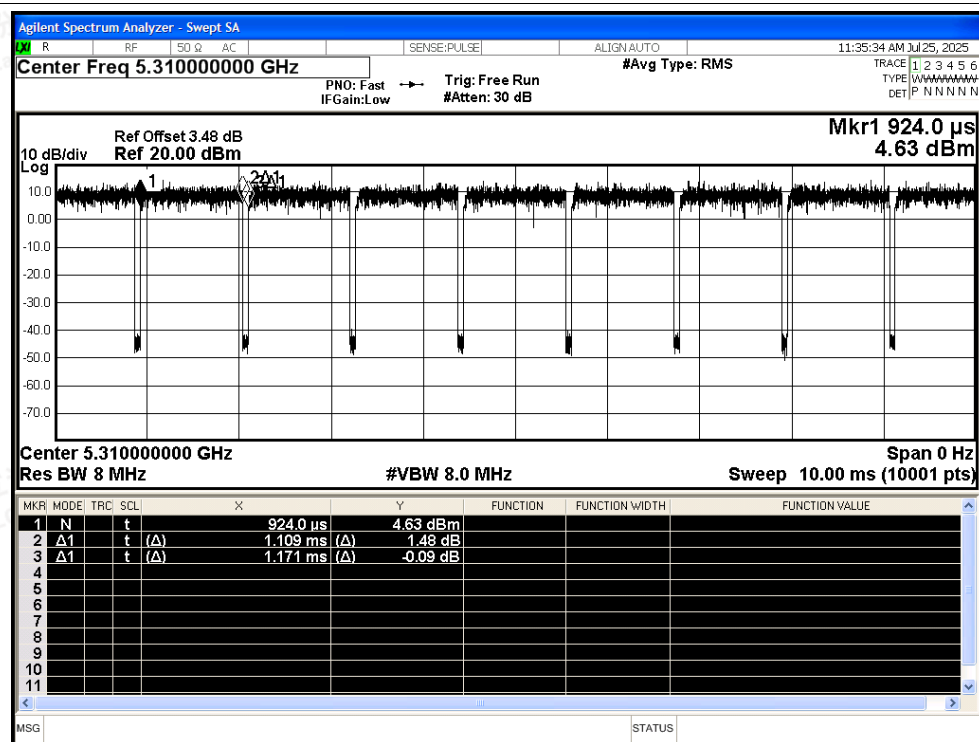

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant2

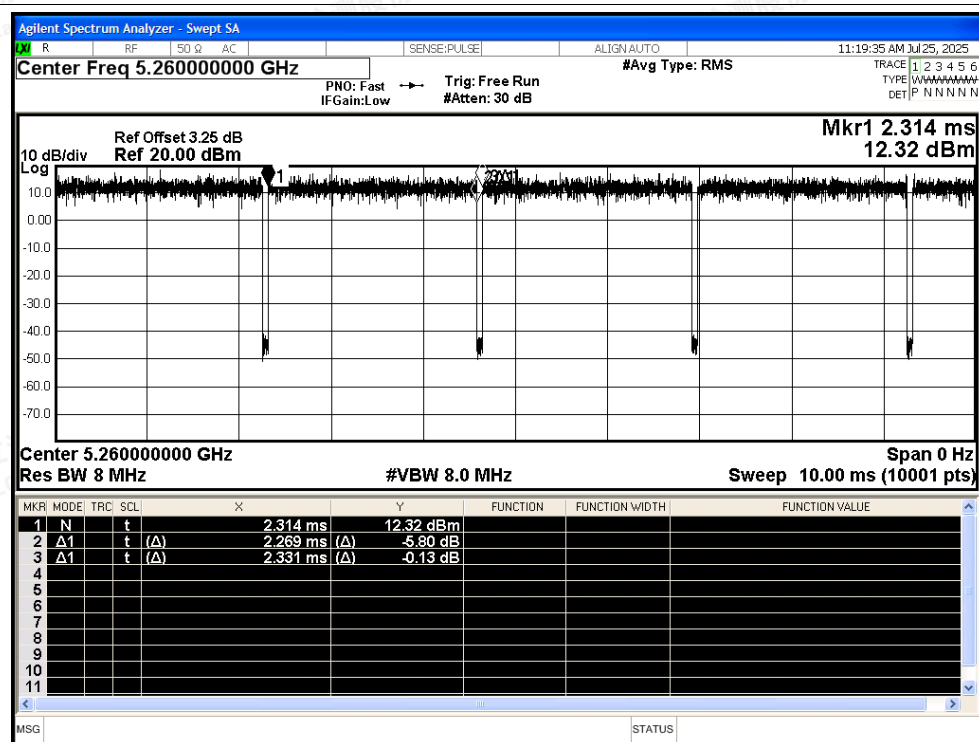

Duty Cycle NVNT ac20 5300MHz Ant2

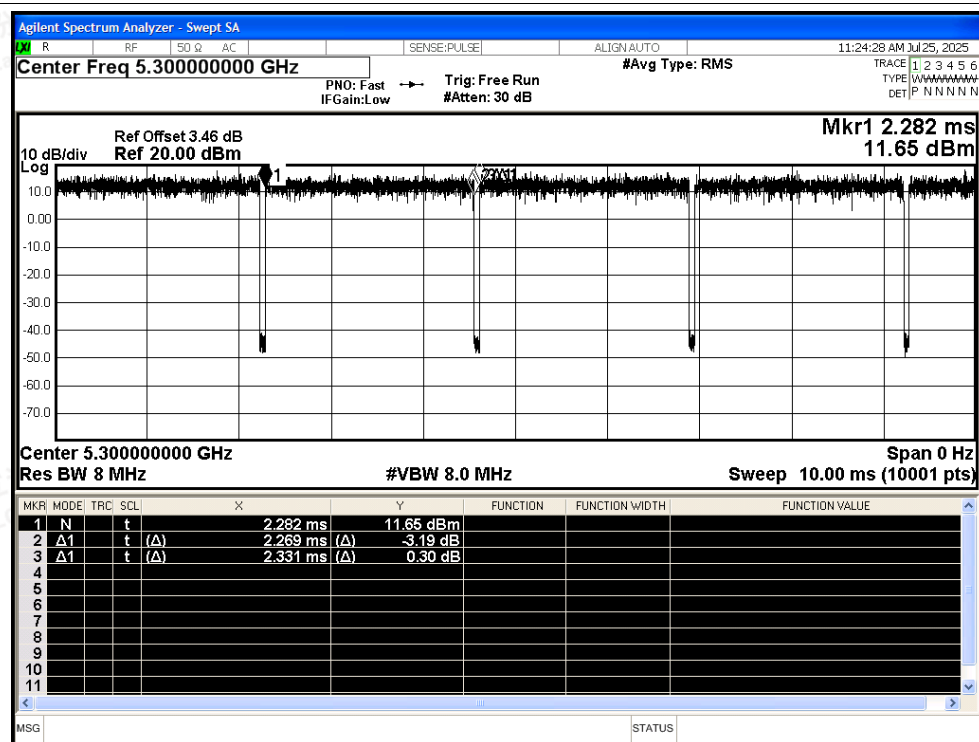

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant2

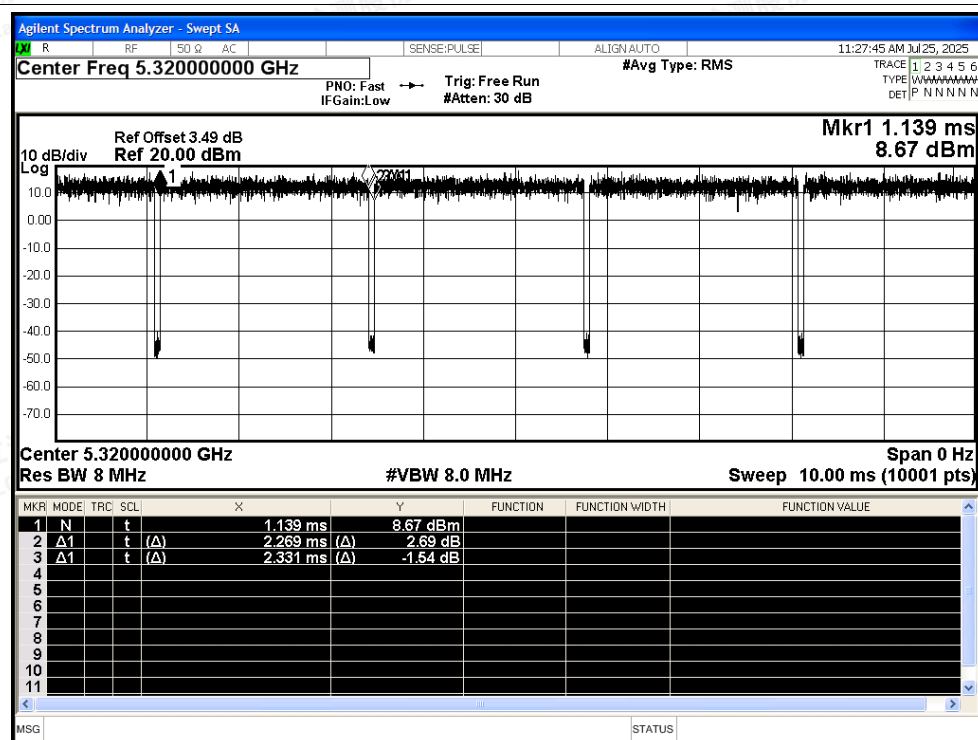

Duty Cycle NVNT ac40 5270MHz Ant2

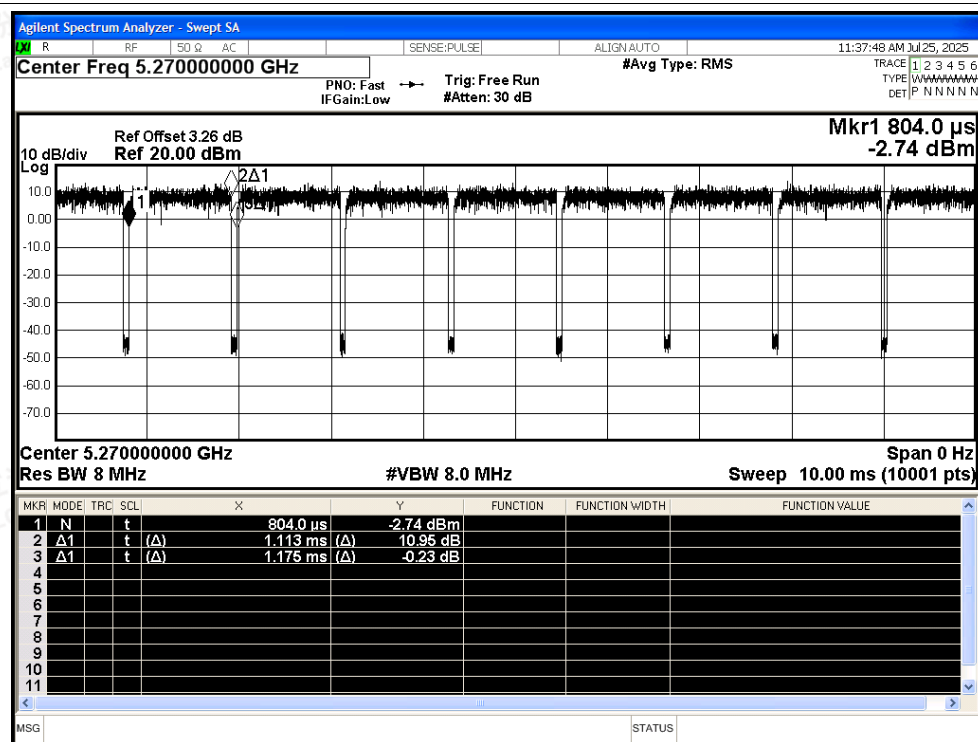

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant2

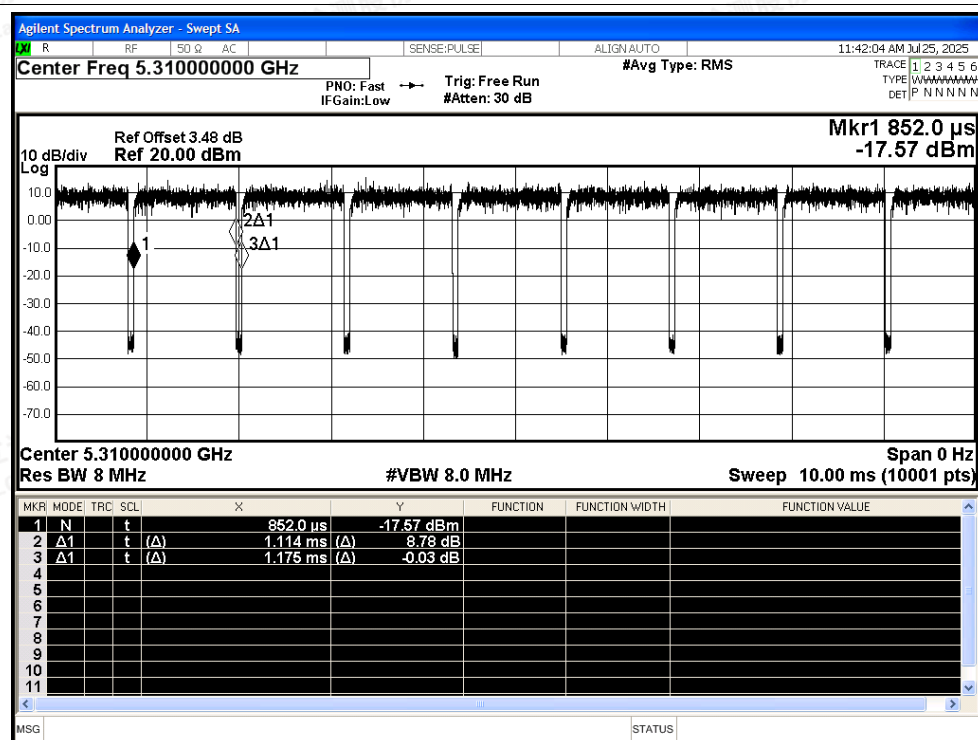

Duty Cycle NVNT ac80 5290MHz Ant2

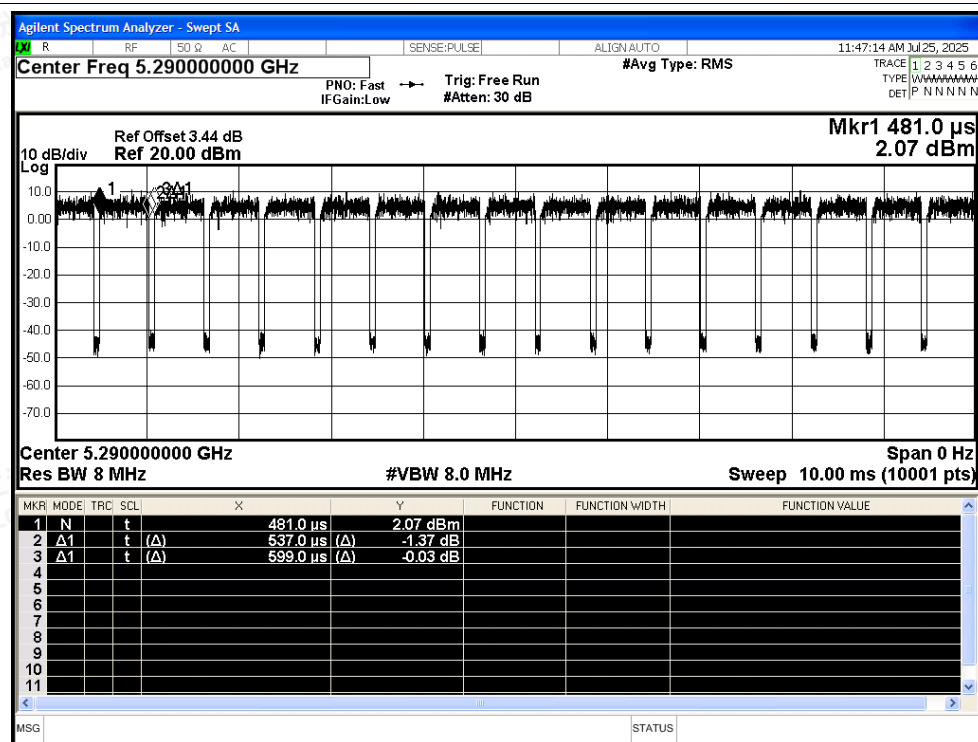

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant2

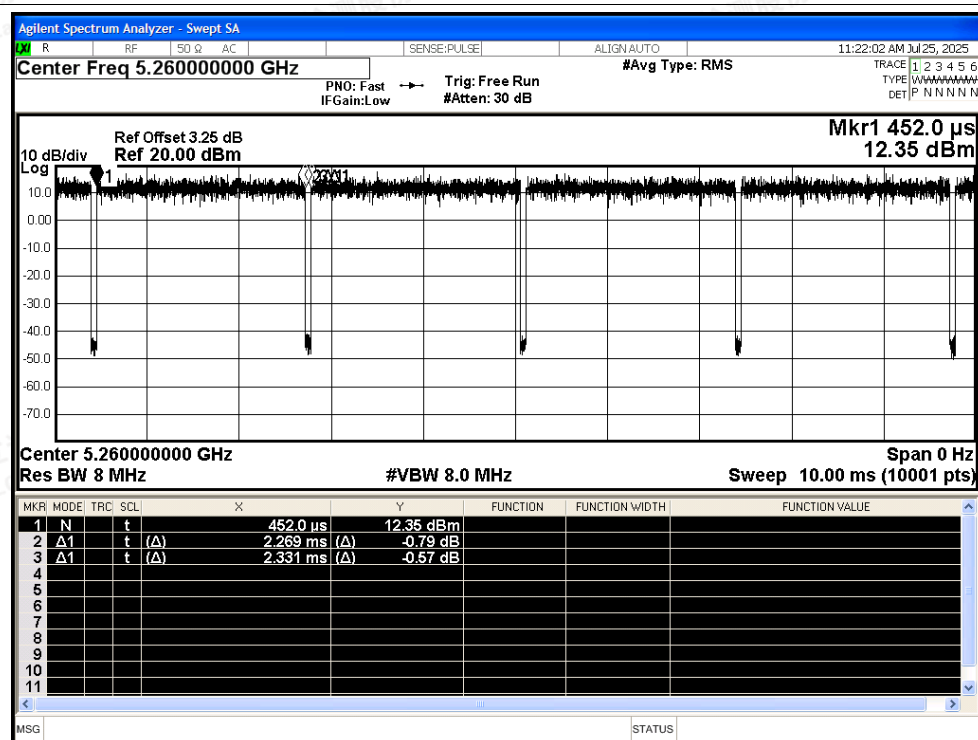

Duty Cycle NVNT ax20 5300MHz Ant2

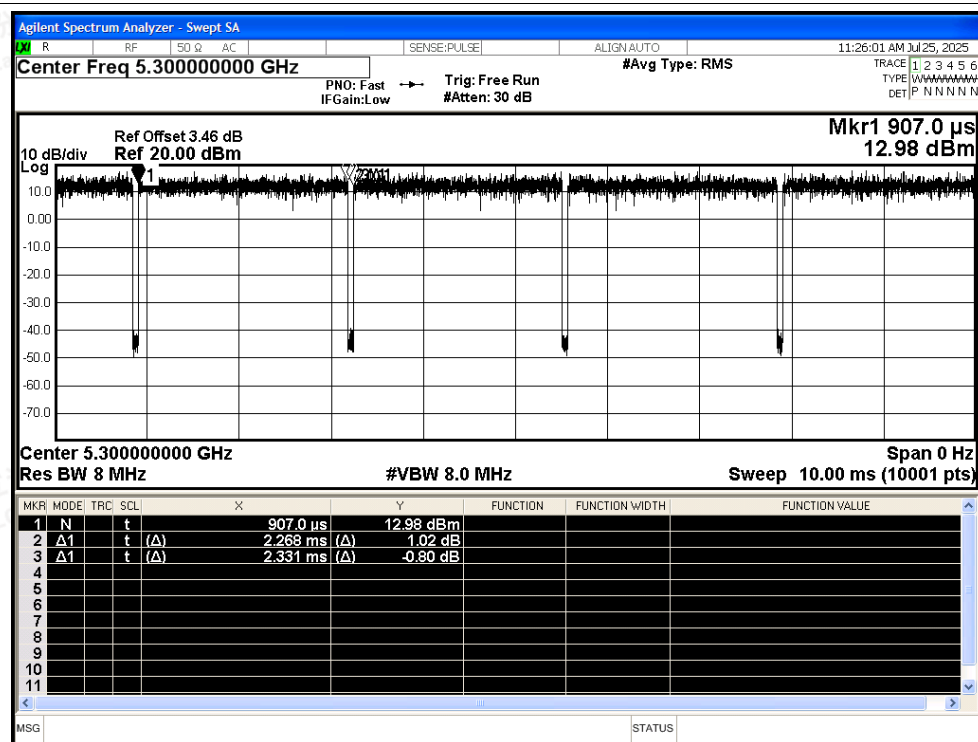

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity