



NVNT	ac20	5825	Ant2	11.54	0.12	11.66	30	Pass
NVNT	ac40	5755	Ant2	10.75	0.24	10.99	30	Pass
NVNT	ac40	5795	Ant2	10.07	0.24	10.31	30	Pass
NVNT	ac80	5775	Ant2	10.66	0.47	11.13	30	Pass
NVNT	ax20	5745	Ant2	11.18	0.12	11.3	30	Pass
NVNT	ax20	5785	Ant2	11.53	0.12	11.65	30	Pass
NVNT	ax20	5825	Ant2	11.49	0.12	11.61	30	Pass
NVNT	ax40	5755	Ant2	10.69	0.24	10.93	30	Pass
NVNT	ax40	5795	Ant2	11.04	0.23	11.27	30	Pass
NVNT	ax80	5775	Ant2	10.69	0.47	11.16	30	Pass
NVNT	be20	5745	Ant2	11.5	0.12	11.62	30	Pass
NVNT	be20	5785	Ant2	10.86	0.12	10.98	30	Pass
NVNT	be20	5825	Ant2	10.91	0.12	11.03	30	Pass
NVNT	be40	5755	Ant2	11.01	0.24	11.25	30	Pass
NVNT	be40	5795	Ant2	10.36	0.23	10.59	30	Pass
NVNT	be80	5775	Ant2	10.18	0.47	10.65	30	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5745	Ant3	12.75	0.24	12.99	30	Pass
NVNT	a	5785	Ant3	12.09	0.24	12.33	30	Pass
NVNT	a	5825	Ant3	12.17	0.24	12.41	30	Pass
NVNT	n20	5745	Ant3	11.24	0.12	11.36	30	Pass
NVNT	n20	5785	Ant3	11.54	0.12	11.66	30	Pass
NVNT	n20	5825	Ant3	11.62	0.12	11.74	30	Pass
NVNT	n40	5755	Ant3	10.8	0.24	11.04	30	Pass
NVNT	n40	5795	Ant3	10.1	0.23	10.33	30	Pass
NVNT	ac20	5745	Ant3	11.27	0.12	11.39	30	Pass
NVNT	ac20	5785	Ant3	11.57	0.12	11.69	30	Pass
NVNT	ac20	5825	Ant3	11.66	0.12	11.78	30	Pass
NVNT	ac40	5755	Ant3	10.82	0.23	11.05	30	Pass
NVNT	ac40	5795	Ant3	10.08	0.24	10.32	30	Pass
NVNT	ac80	5775	Ant3	10.8	0.47	11.27	30	Pass
NVNT	ax20	5745	Ant3	11.28	0.12	11.4	30	Pass
NVNT	ax20	5785	Ant3	11.56	0.12	11.68	30	Pass
NVNT	ax20	5825	Ant3	11.66	0.12	11.78	30	Pass
NVNT	ax40	5755	Ant3	10.82	0.24	11.06	30	Pass
NVNT	ax40	5795	Ant3	10.07	0.24	10.31	30	Pass
NVNT	ax80	5775	Ant3	10.8	0.47	11.27	30	Pass
NVNT	be20	5745	Ant3	11.58	0.12	11.7	30	Pass
NVNT	be20	5785	Ant3	10.84	0.12	10.96	30	Pass
NVNT	be20	5825	Ant3	10.91	0.12	11.03	30	Pass
NVNT	be40	5755	Ant3	11.07	0.24	11.31	30	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5795	Ant3	10.31	0.23	10.54	30	Pass
NVNT	be80	5775	Ant3	10.08	0.47	10.55	30	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total Power (dBm)				Limit (dBm)	Verdict
			Ant1	Ant2	Ant3	Ant1+Ant2+Ant3		
NVNT	n20	5745	11.27	11.31	11.36	16.08	30	Pass
NVNT	n20	5785	11.5	11.57	11.66	16.35	30	Pass
NVNT	n20	5825	11.56	11.63	11.74	16.42	30	Pass
NVNT	n40	5755	10.94	10.97	11.04	15.75	30	Pass
NVNT	n40	5795	11.13	10.22	10.33	15.35	30	Pass
NVNT	ac20	5745	11.26	11.32	11.39	16.09	30	Pass
NVNT	ac20	5785	11.58	11.67	11.69	16.42	30	Pass
NVNT	ac20	5825	11.54	11.66	11.78	16.43	30	Pass
NVNT	ac40	5755	10.9	10.99	11.05	15.75	30	Pass
NVNT	ac40	5795	11.09	10.31	10.32	15.36	30	Pass
NVNT	ac80	5775	11.15	11.13	11.27	15.95	30	Pass
NVNT	ax20	5745	11.28	11.3	11.4	16.10	30	Pass
NVNT	ax20	5785	11.58	11.65	11.68	16.41	30	Pass
NVNT	ax20	5825	11.51	11.61	11.78	16.41	30	Pass
NVNT	ax40	5755	10.89	10.93	11.06	15.73	30	Pass
NVNT	ax40	5795	11.09	11.27	10.31	15.68	30	Pass
NVNT	ax80	5775	11.15	11.16	11.27	15.96	30	Pass
NVNT	be20	5745	11.52	11.62	11.7	16.39	30	Pass
NVNT	be20	5785	10.9	10.98	10.96	15.72	30	Pass
NVNT	be20	5825	10.99	11.03	11.03	15.79	30	Pass
NVNT	be40	5755	11.21	11.25	11.31	16.03	30	Pass
NVNT	be40	5795	10.5	10.59	10.54	15.31	30	Pass
NVNT	be80	5775	10.56	10.65	10.55	15.36	30	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit(dBm/500KHz)	Verdict
NVNT	a	5745	Ant1	-1.02	0.24	-0.78	30	Pass
NVNT	a	5785	Ant1	-1.63	0.24	-1.39	30	Pass
NVNT	a	5825	Ant1	-1.57	0.24	-1.33	30	Pass
NVNT	n20	5745	Ant1	-2.51	0.12	-2.39	30	Pass
NVNT	n20	5785	Ant1	-2.36	0.12	-2.24	30	Pass
NVNT	n20	5825	Ant1	-2.55	0.12	-2.43	30	Pass
NVNT	n40	5755	Ant1	-6.17	0.24	-5.93	30	Pass
NVNT	n40	5795	Ant1	-5.85	0.23	-5.62	30	Pass
NVNT	ac20	5745	Ant1	-2.82	0.12	-2.7	30	Pass
NVNT	ac20	5785	Ant1	-2.31	0.12	-2.19	30	Pass
NVNT	ac20	5825	Ant1	-2.52	0.12	-2.4	30	Pass
NVNT	ac40	5755	Ant1	-6.25	0.24	-6.01	30	Pass
NVNT	ac40	5795	Ant1	-5.81	0.23	-5.58	30	Pass
NVNT	ac80	5775	Ant1	-8.73	0.47	-8.26	30	Pass
NVNT	ax20	5745	Ant1	-2.75	0.12	-2.63	30	Pass
NVNT	ax20	5785	Ant1	-2.38	0.12	-2.26	30	Pass
NVNT	ax20	5825	Ant1	-2.51	0.12	-2.39	30	Pass
NVNT	ax40	5755	Ant1	-6.01	0.23	-5.78	30	Pass
NVNT	ax40	5795	Ant1	-6.04	0.23	-5.81	30	Pass
NVNT	ax80	5775	Ant1	-8.65	0.47	-8.18	30	Pass
NVNT	be20	5745	Ant1	-2.56	0.12	-2.44	30	Pass
NVNT	be20	5785	Ant1	-3.02	0.12	-2.9	30	Pass
NVNT	be20	5825	Ant1	-2.77	0.12	-2.65	30	Pass
NVNT	be40	5755	Ant1	-5.81	0.24	-5.57	30	Pass
NVNT	be40	5795	Ant1	-6.54	0.24	-6.3	30	Pass
NVNT	be80	5775	Ant1	-9.23	0.47	-8.76	30	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit(dBm/500KHz)	Verdict
NVNT	a	5745	Ant2	-0.99	0.24	-0.75	30	Pass
NVNT	a	5785	Ant2	-1.66	0.24	-1.42	30	Pass
NVNT	a	5825	Ant2	-1.69	0.24	-1.45	30	Pass
NVNT	n20	5745	Ant2	-2.44	0.12	-2.32	30	Pass
NVNT	n20	5785	Ant2	-2.42	0.12	-2.3	30	Pass
NVNT	n20	5825	Ant2	-2.36	0.12	-2.24	30	Pass
NVNT	n40	5755	Ant2	-6.11	0.23	-5.88	30	Pass
NVNT	n40	5795	Ant2	-6.91	0.24	-6.67	30	Pass
NVNT	ac20	5745	Ant2	-2.52	0.12	-2.4	30	Pass
NVNT	ac20	5785	Ant2	-2.39	0.12	-2.27	30	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5825	Ant2	-2.34	0.12	-2.22	30	Pass
NVNT	ac40	5755	Ant2	-6.12	0.24	-5.88	30	Pass
NVNT	ac40	5795	Ant2	-6.81	0.24	-6.57	30	Pass
NVNT	ac80	5775	Ant2	-8.81	0.47	-8.34	30	Pass
NVNT	ax20	5745	Ant2	-2.5	0.12	-2.38	30	Pass
NVNT	ax20	5785	Ant2	-2.31	0.12	-2.19	30	Pass
NVNT	ax20	5825	Ant2	-2.37	0.12	-2.25	30	Pass
NVNT	ax40	5755	Ant2	-6.03	0.24	-5.79	30	Pass
NVNT	ax40	5795	Ant2	-5.56	0.23	-5.33	30	Pass
NVNT	ax80	5775	Ant2	-8.53	0.47	-8.06	30	Pass
NVNT	be20	5745	Ant2	-2.18	0.12	-2.06	30	Pass
NVNT	be20	5785	Ant2	-3.01	0.12	-2.89	30	Pass
NVNT	be20	5825	Ant2	-3.03	0.12	-2.91	30	Pass
NVNT	be40	5755	Ant2	-5.6	0.24	-5.36	30	Pass
NVNT	be40	5795	Ant2	-5.98	0.23	-5.75	30	Pass
NVNT	be80	5775	Ant2	-9.19	0.47	-8.72	30	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit(dBm/500KHz)	Verdict
NVNT	a	5745	Ant3	-0.61	0.24	-0.37	30	Pass
NVNT	a	5785	Ant3	-1.5	0.24	-1.26	30	Pass
NVNT	a	5825	Ant3	-1.32	0.24	-1.08	30	Pass
NVNT	n20	5745	Ant3	-2.67	0.12	-2.55	30	Pass
NVNT	n20	5785	Ant3	-2.21	0.12	-2.09	30	Pass
NVNT	n20	5825	Ant3	-2.12	0.12	-2	30	Pass
NVNT	n40	5755	Ant3	-5.51	0.24	-5.27	30	Pass
NVNT	n40	5795	Ant3	-6.59	0.23	-6.36	30	Pass
NVNT	ac20	5745	Ant3	-2.51	0.12	-2.39	30	Pass
NVNT	ac20	5785	Ant3	-2.31	0.12	-2.19	30	Pass
NVNT	ac20	5825	Ant3	-2.11	0.12	-1.99	30	Pass
NVNT	ac40	5755	Ant3	-6.03	0.23	-5.8	30	Pass
NVNT	ac40	5795	Ant3	-6.88	0.24	-6.64	30	Pass
NVNT	ac80	5775	Ant3	-8.66	0.47	-8.19	30	Pass
NVNT	ax20	5745	Ant3	-2.69	0.12	-2.57	30	Pass
NVNT	ax20	5785	Ant3	-2.17	0.12	-2.05	30	Pass
NVNT	ax20	5825	Ant3	-2.16	0.12	-2.04	30	Pass
NVNT	ax40	5755	Ant3	-5.94	0.24	-5.7	30	Pass
NVNT	ax40	5795	Ant3	-6.6	0.24	-6.36	30	Pass
NVNT	ax80	5775	Ant3	-8.46	0.47	-7.99	30	Pass
NVNT	be20	5745	Ant3	-2.34	0.12	-2.22	30	Pass
NVNT	be20	5785	Ant3	-3.12	0.12	-3	30	Pass
NVNT	be20	5825	Ant3	-2.67	0.12	-2.55	30	Pass
NVNT	be40	5755	Ant3	-5.59	0.24	-5.35	30	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5795	Ant3	-6.63	0.23	-6.4	30	Pass
NVNT	be80	5775	Ant3	-9.34	0.47	-8.87	30	Pass

MIMO


Condition	Mode	Frequency (MHz)	Total PSD (dBm/500KHz)				Limit (dBm/500KHz)	Verdict
			Ant1	Ant2	Ant3	Ant1+Ant2+Ant3		
NVNT	n20	5745	-2.39	-2.32	-2.55	2.35	27.5	Pass
NVNT	n20	5785	-2.24	-2.3	-2.09	2.56	27.5	Pass
NVNT	n20	5825	-2.43	-2.24	-2	2.55	27.5	Pass
NVNT	n40	5755	-5.93	-5.88	-5.27	-0.91	27.5	Pass
NVNT	n40	5795	-5.62	-6.67	-6.36	-1.42	27.5	Pass
NVNT	ac20	5745	-2.7	-2.4	-2.39	2.28	27.5	Pass
NVNT	ac20	5785	-2.19	-2.27	-2.19	2.55	27.5	Pass
NVNT	ac20	5825	-2.4	-2.22	-1.99	2.57	27.5	Pass
NVNT	ac40	5755	-6.01	-5.88	-5.8	-1.12	27.5	Pass
NVNT	ac40	5795	-5.58	-6.57	-6.64	-1.46	27.5	Pass
NVNT	ac80	5775	-8.26	-8.34	-8.19	-3.49	27.5	Pass
NVNT	ax20	5745	-2.63	-2.38	-2.57	2.25	27.5	Pass
NVNT	ax20	5785	-2.26	-2.19	-2.05	2.61	27.5	Pass
NVNT	ax20	5825	-2.39	-2.25	-2.04	2.55	27.5	Pass
NVNT	ax40	5755	-5.78	-5.79	-5.7	-0.99	27.5	Pass
NVNT	ax40	5795	-5.81	-5.33	-6.36	-1.04	27.5	Pass
NVNT	ax80	5775	-8.18	-8.06	-7.99	-3.30	27.5	Pass
NVNT	be20	5745	-2.44	-2.06	-2.22	2.53	27.5	Pass
NVNT	be20	5785	-2.9	-2.89	-3	1.84	27.5	Pass
NVNT	be20	5825	-2.65	-2.91	-2.55	2.07	27.5	Pass
NVNT	be40	5755	-5.57	-5.36	-5.35	-0.65	27.5	Pass
NVNT	be40	5795	-6.3	-5.75	-6.4	-1.37	27.5	Pass
NVNT	be80	5775	-8.76	-8.72	-8.87	-4.01	27.5	Pass






Test Graphs

PSD NVNT a 5745MHz Ant1

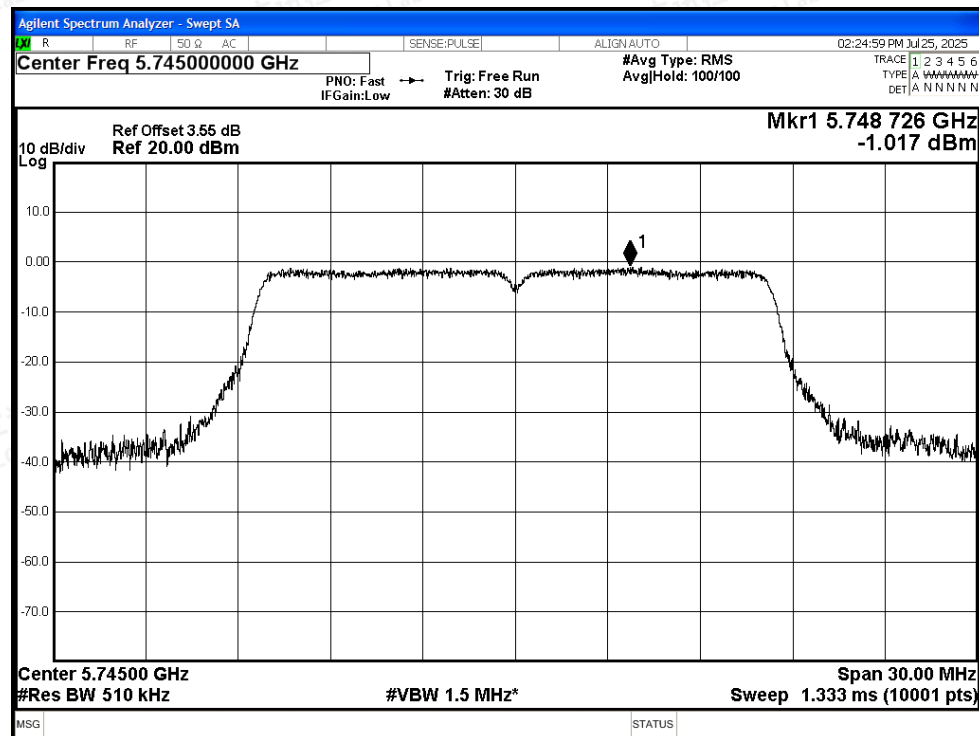

PSD NVNT a 5785MHz Ant1

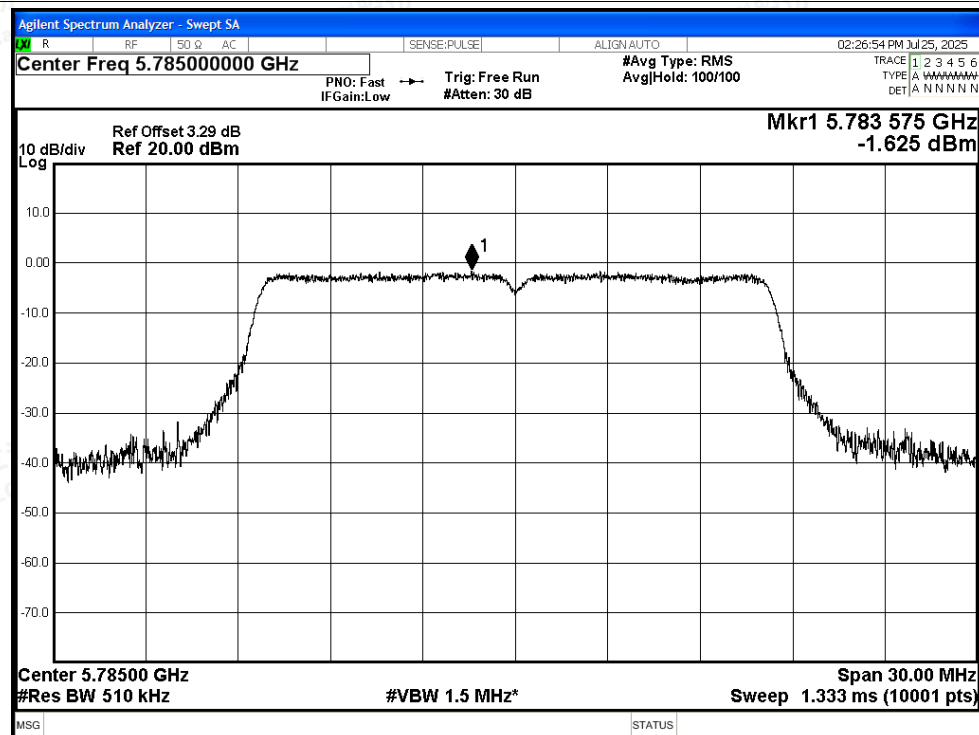

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5825MHz Ant1

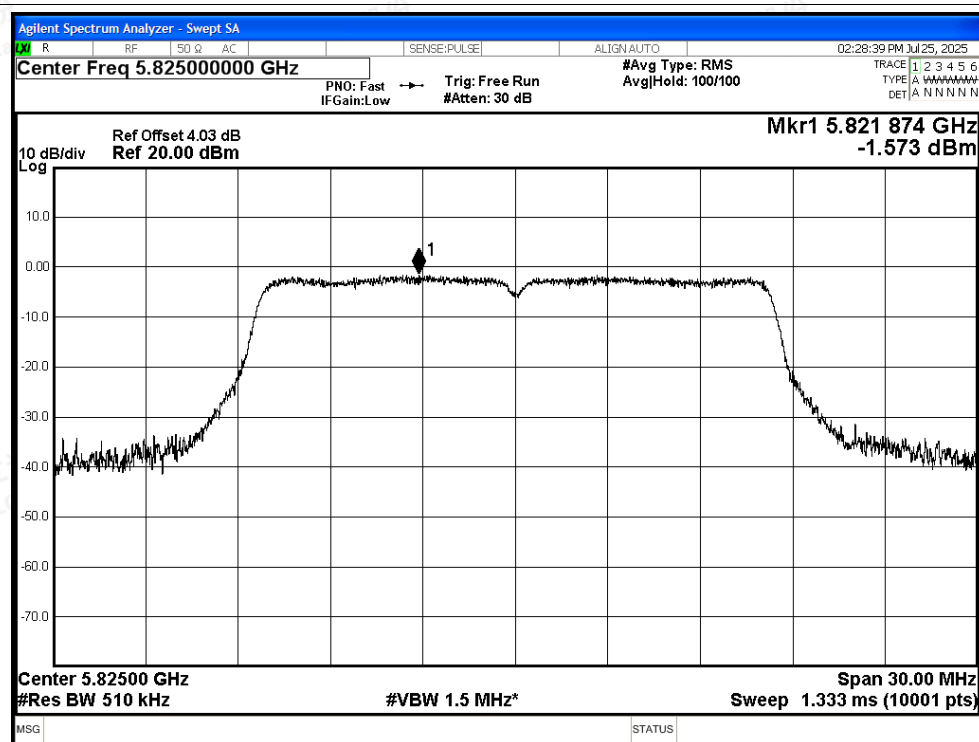

PSD NVNT n20 5745MHz Ant1


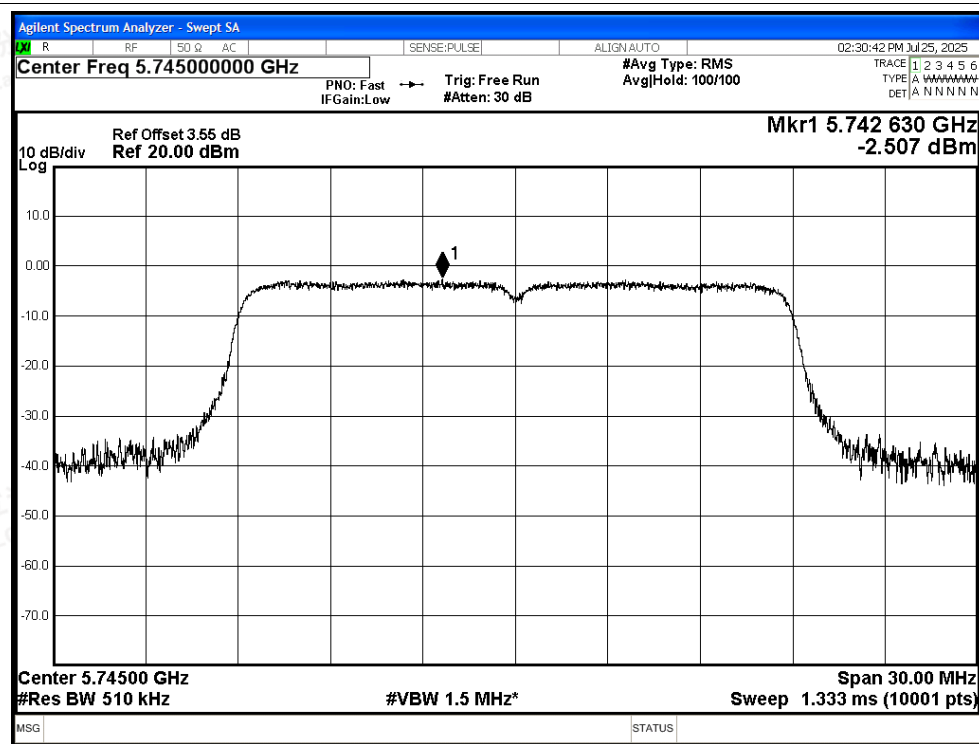


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

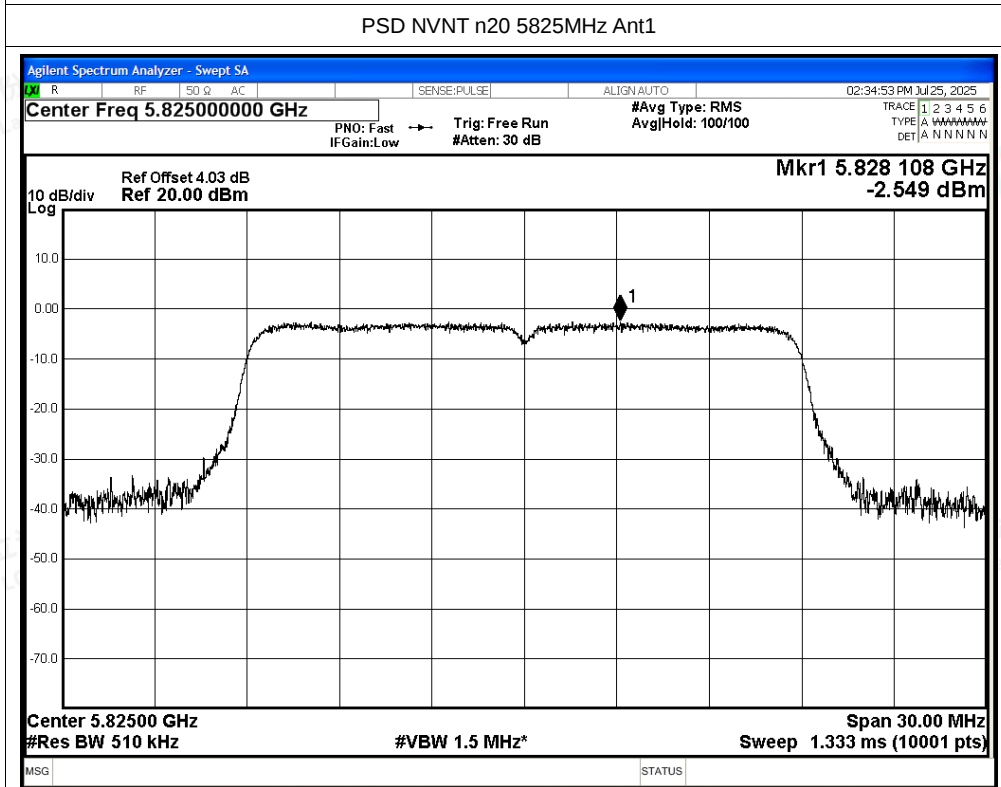
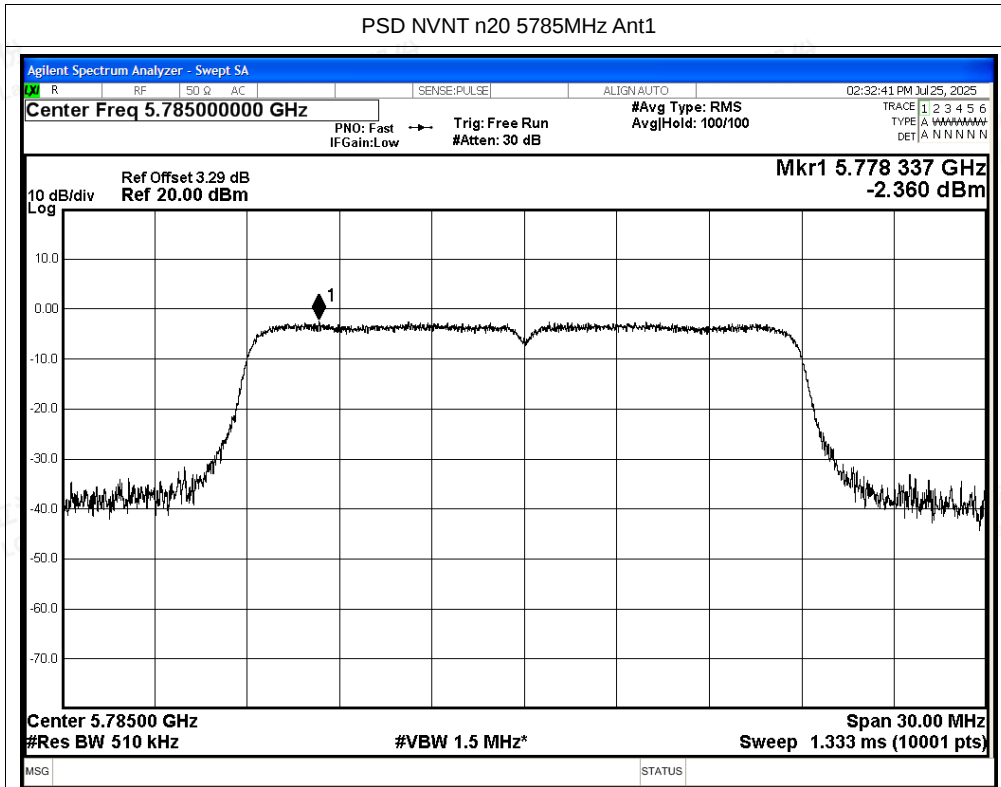


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

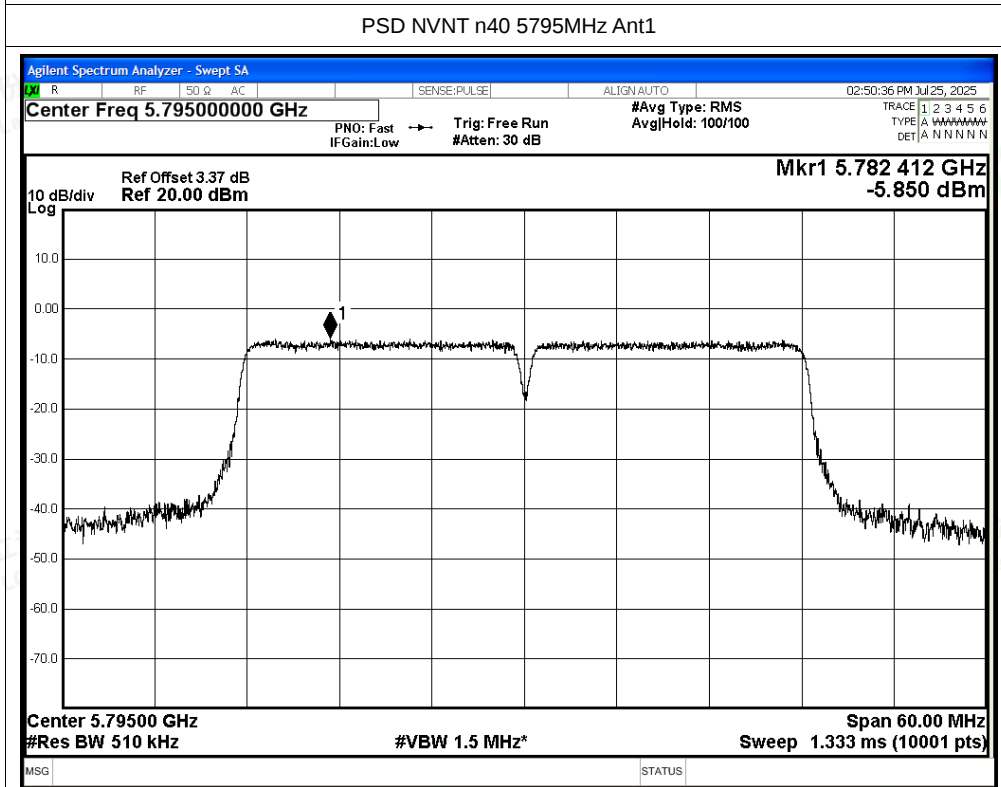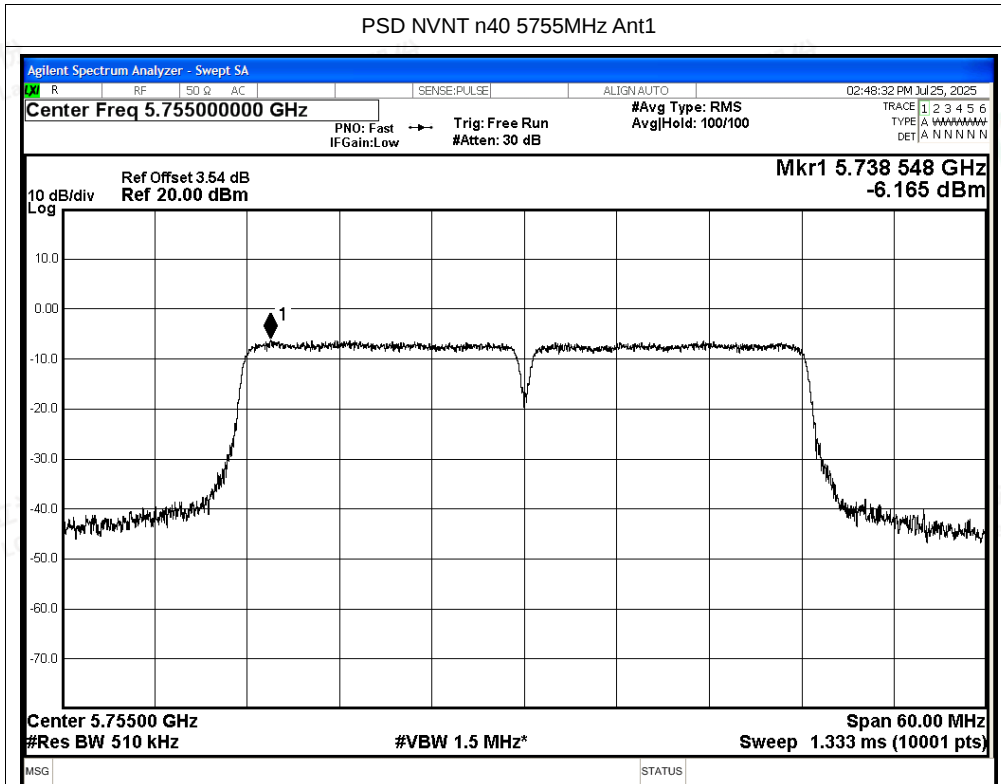




PSD NVNT ac20 5745MHz Ant1

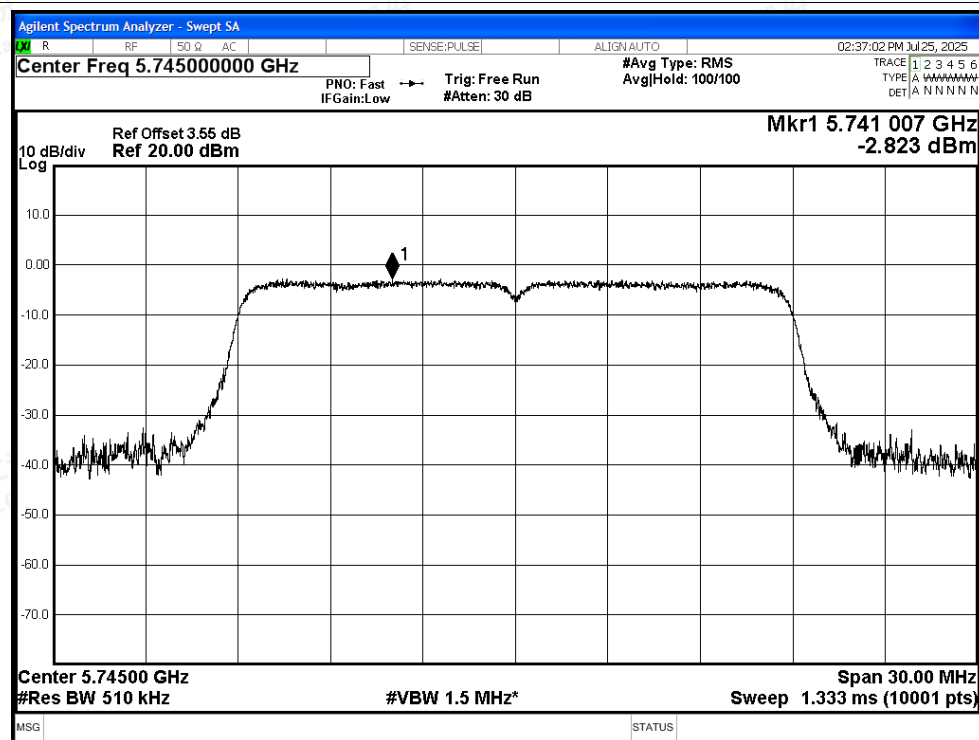

PSD NVNT ac20 5785MHz Ant1

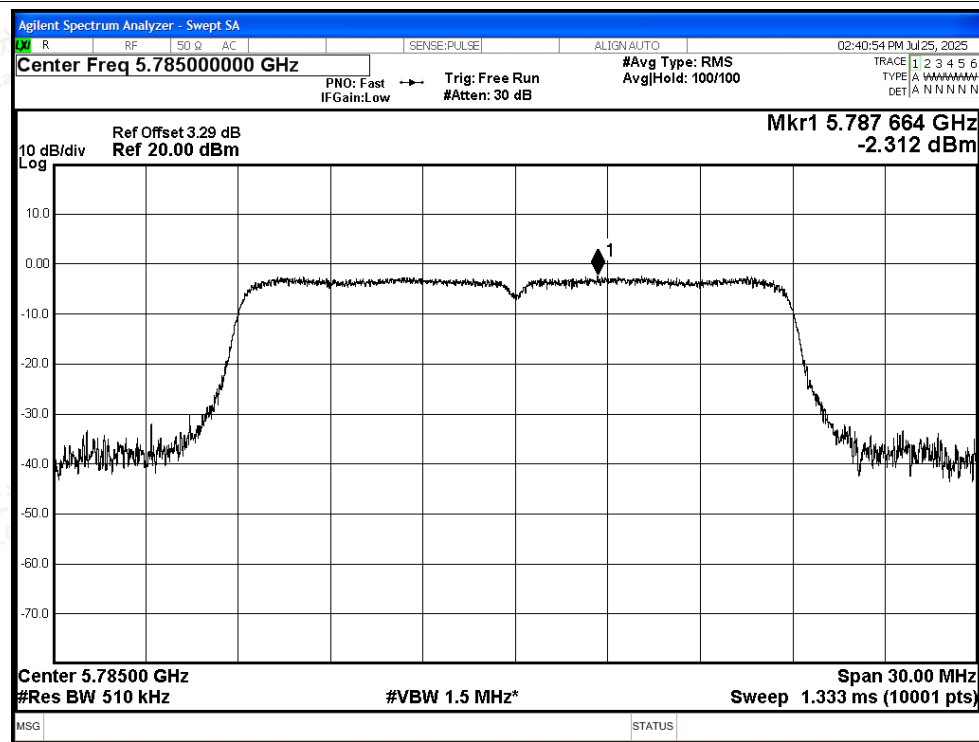

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5825MHz Ant1

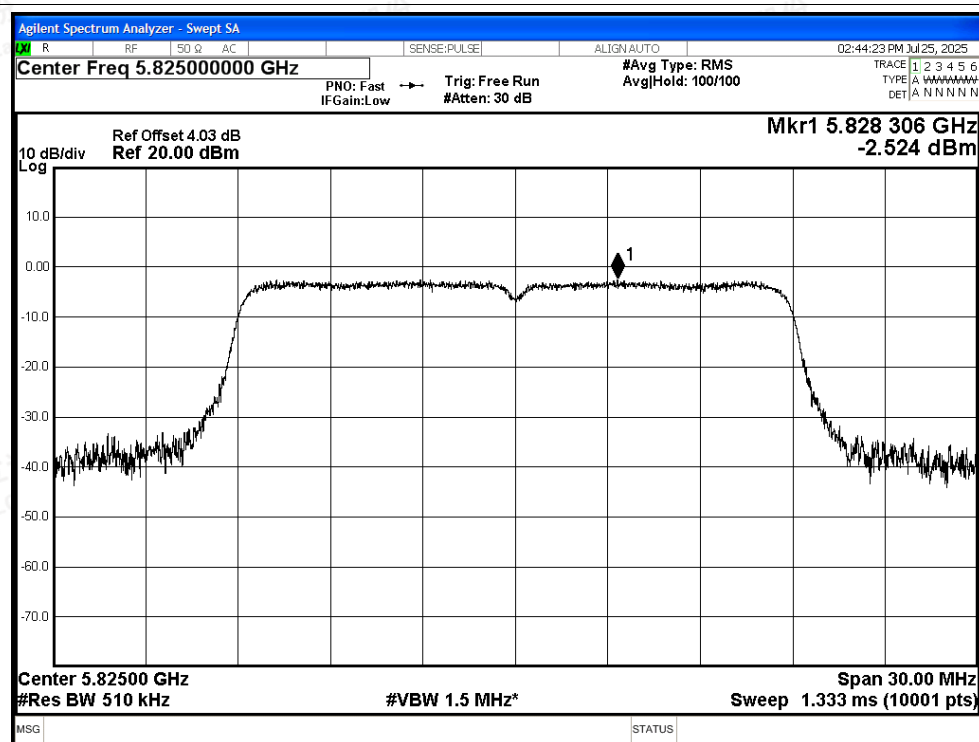

PSD NVNT ac40 5755MHz Ant1

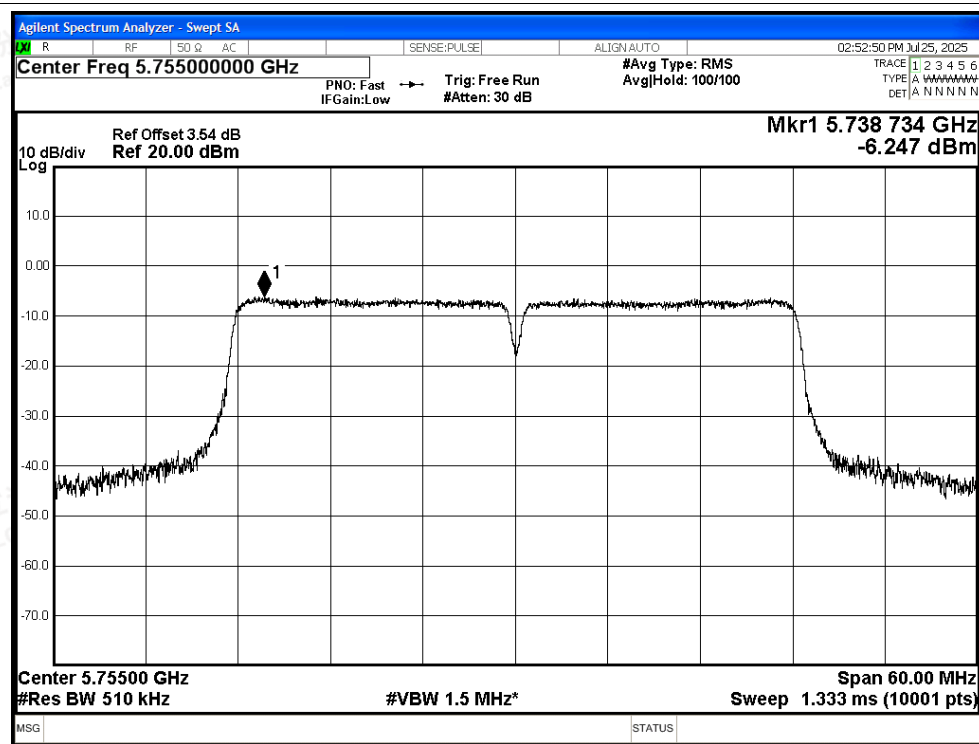

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5795MHz Ant1

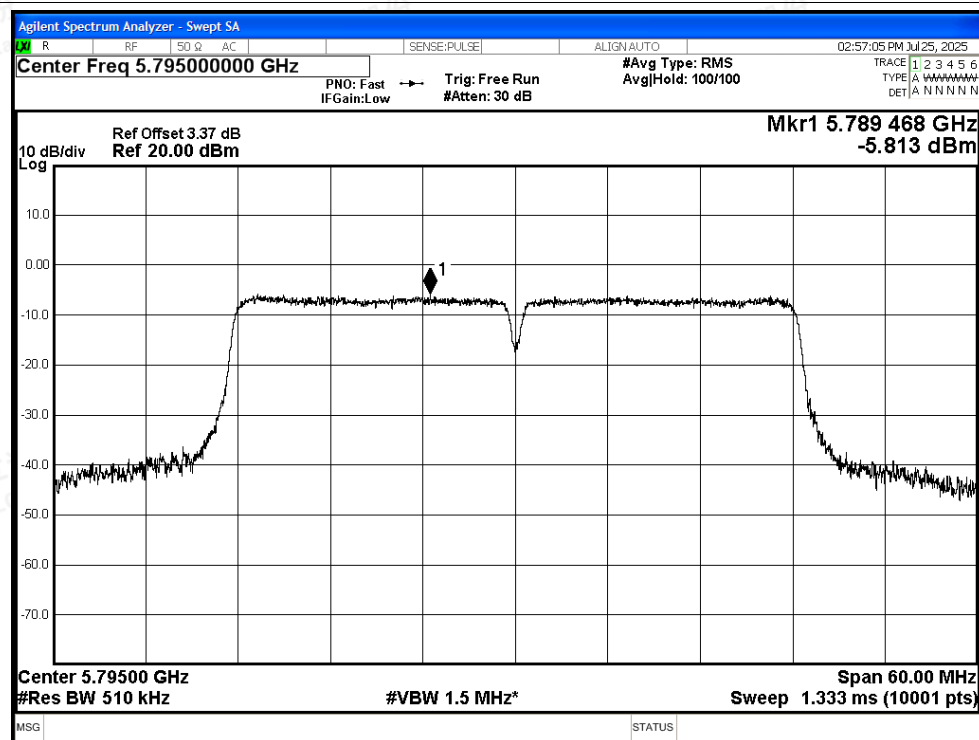

PSD NVNT ac80 5775MHz Ant1

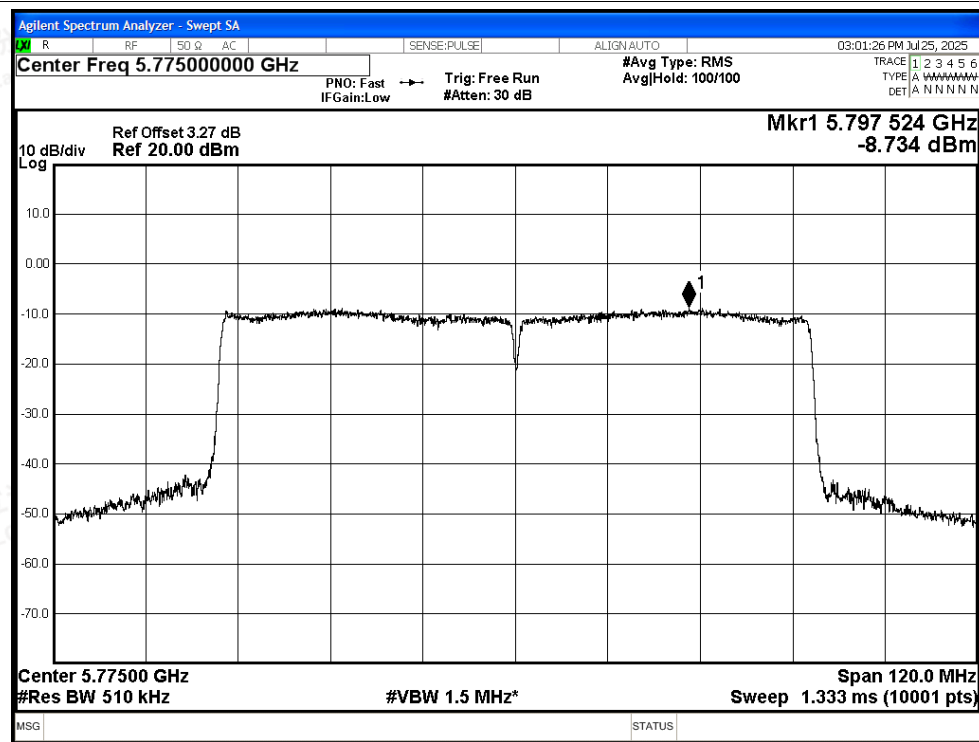

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5745MHz Ant1

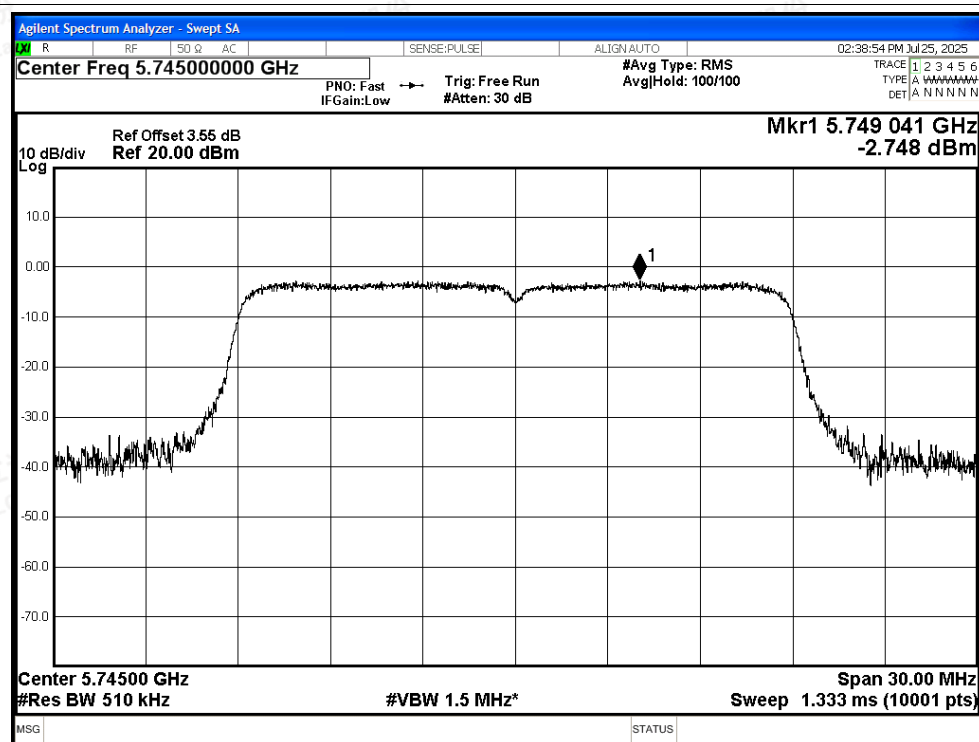

PSD NVNT ax20 5785MHz Ant1

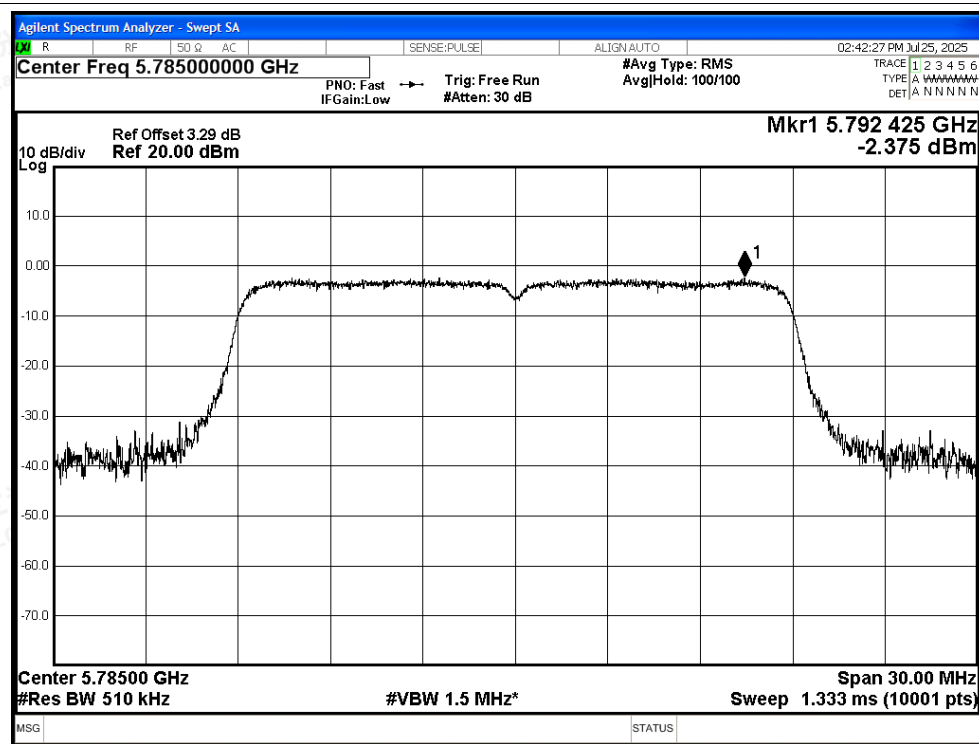

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5825MHz Ant1

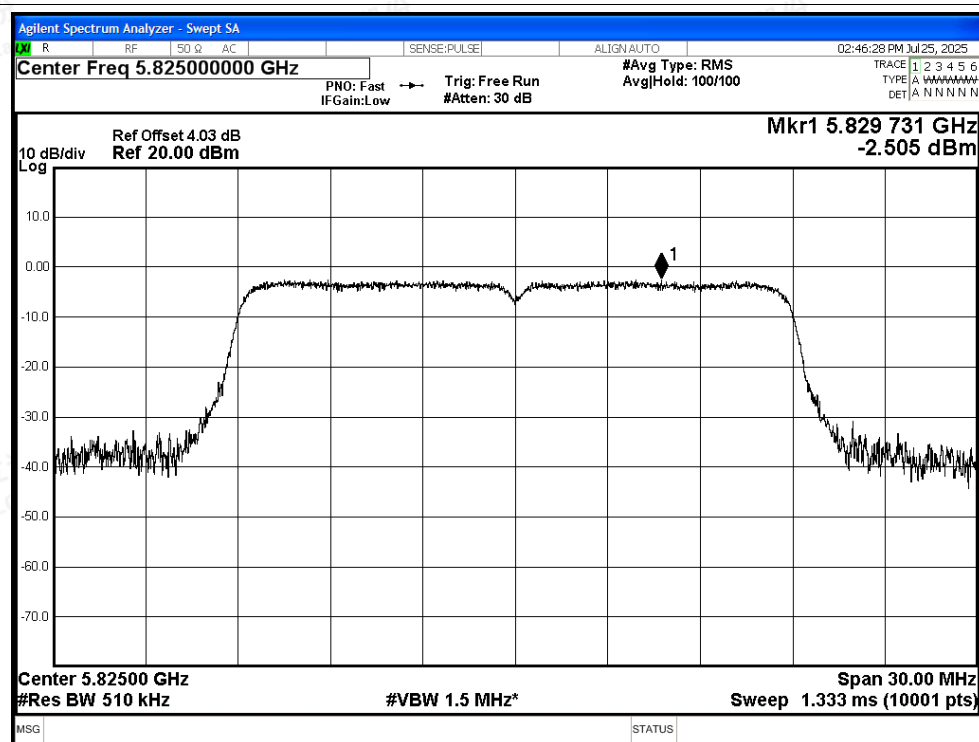

PSD NVNT ax40 5755MHz Ant1

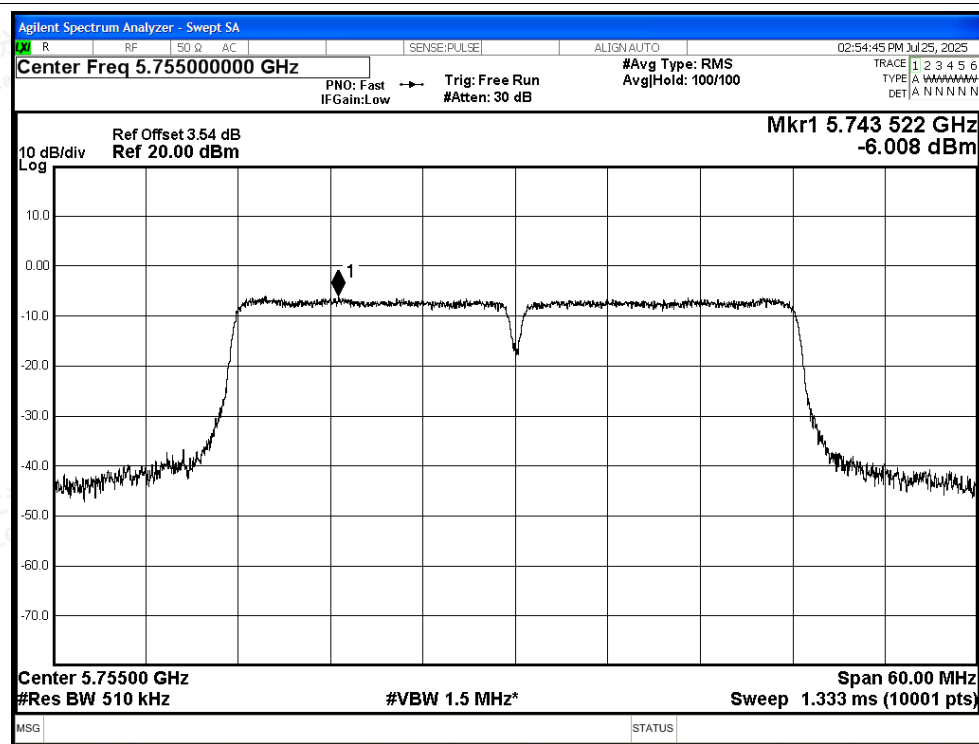

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5795MHz Ant1

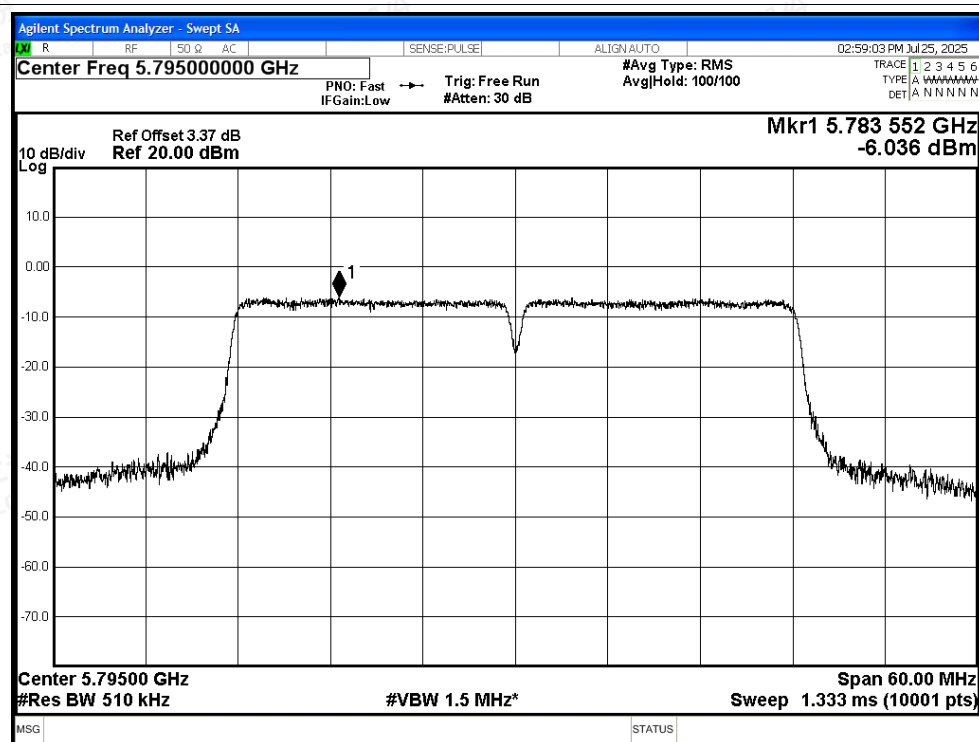

PSD NVNT ax80 5775MHz Ant1

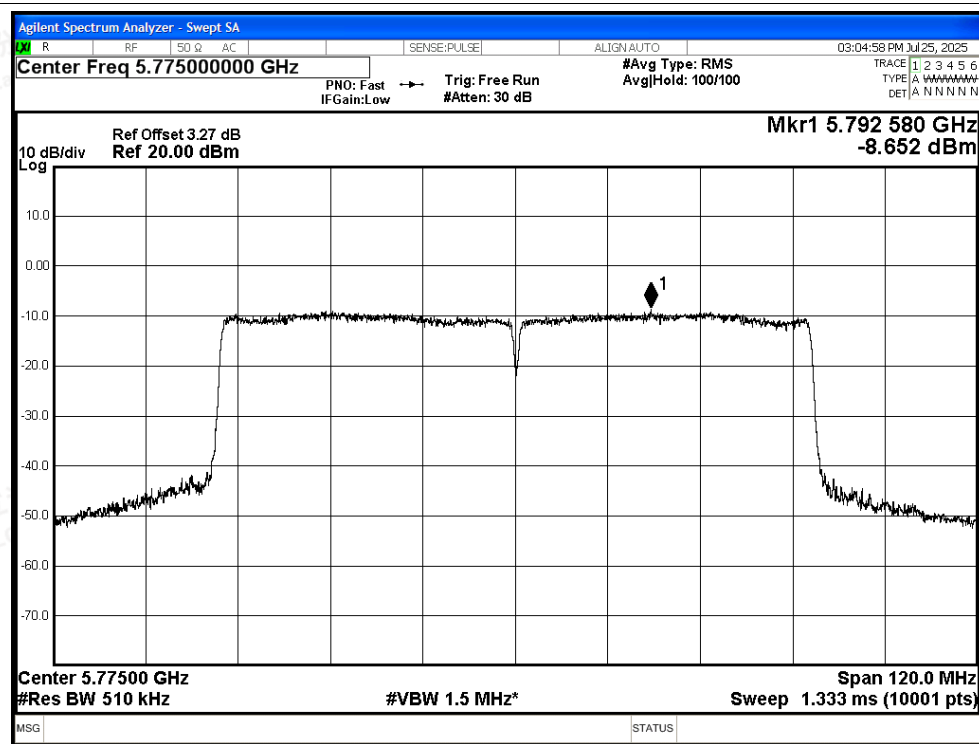

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5745MHz Ant1

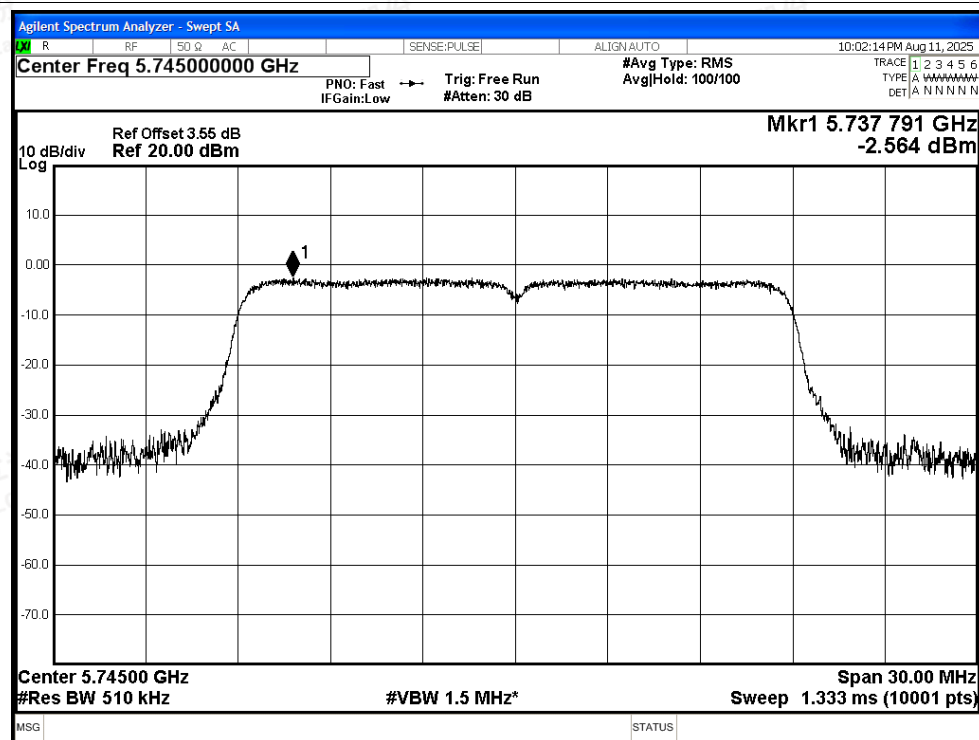

PSD NVNT be20 5785MHz Ant1

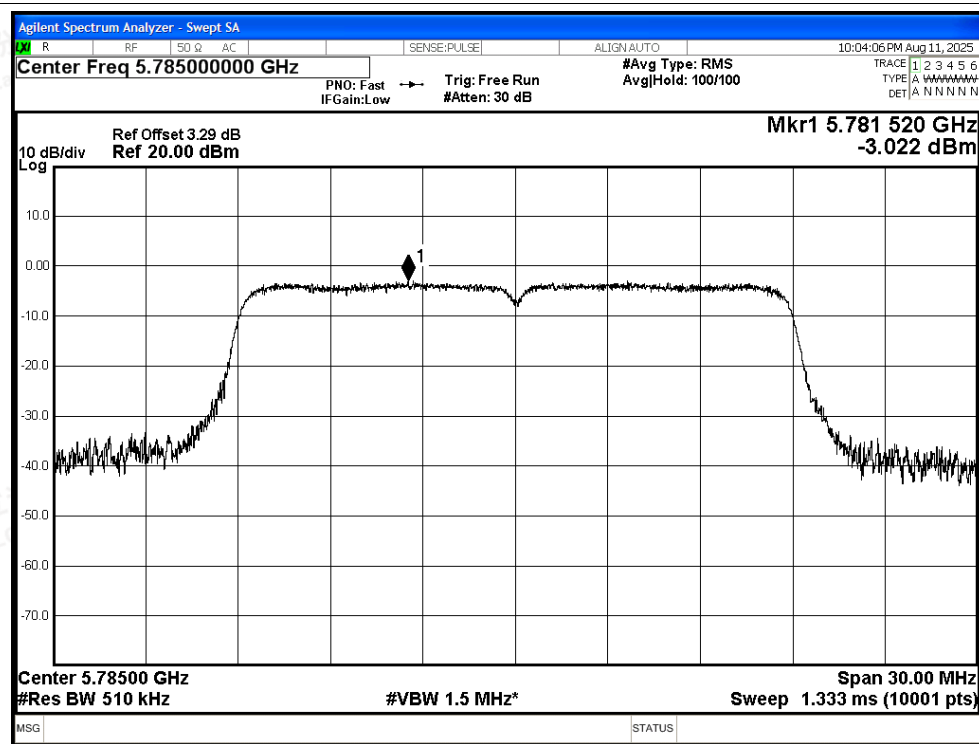

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5825MHz Ant1

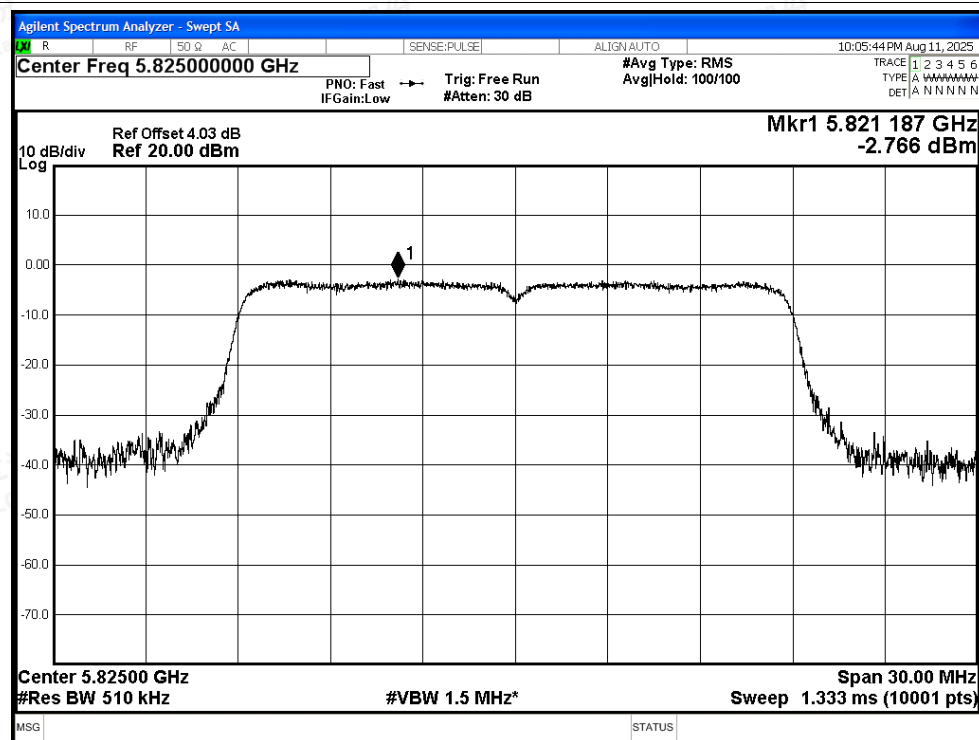

PSD NVNT be40 5755MHz Ant1

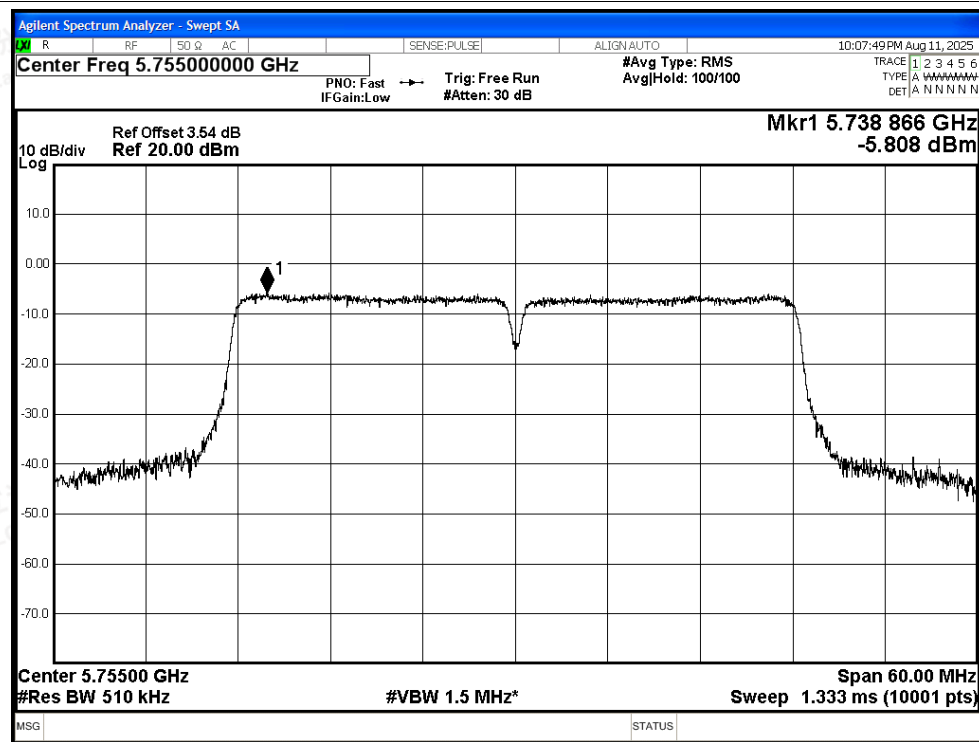

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5795MHz Ant1

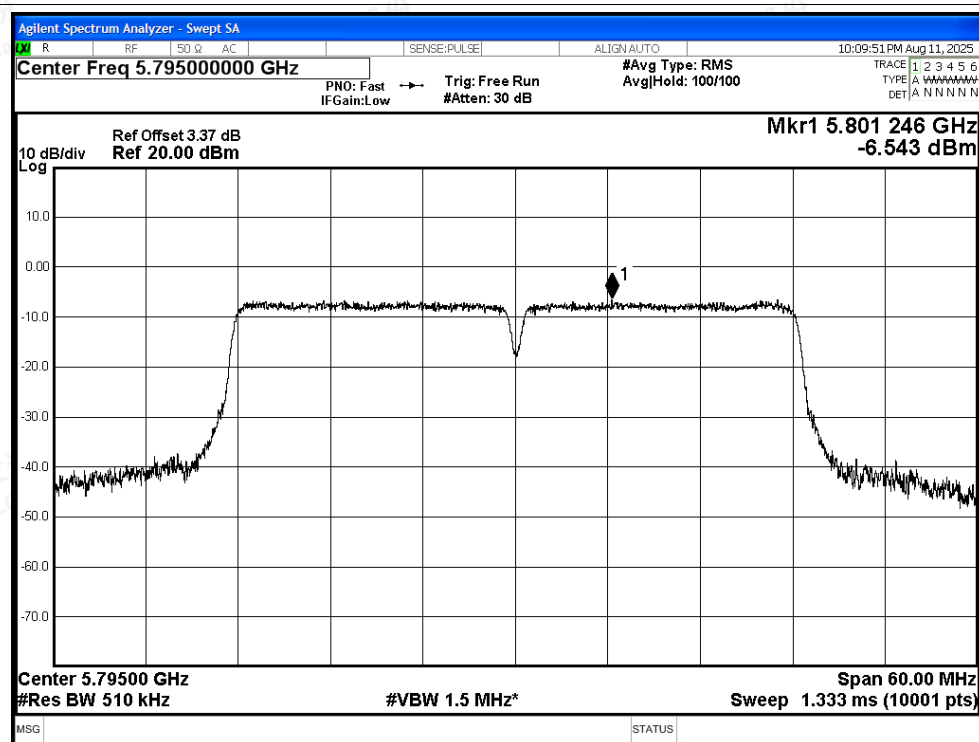

PSD NVNT be80 5775MHz Ant1

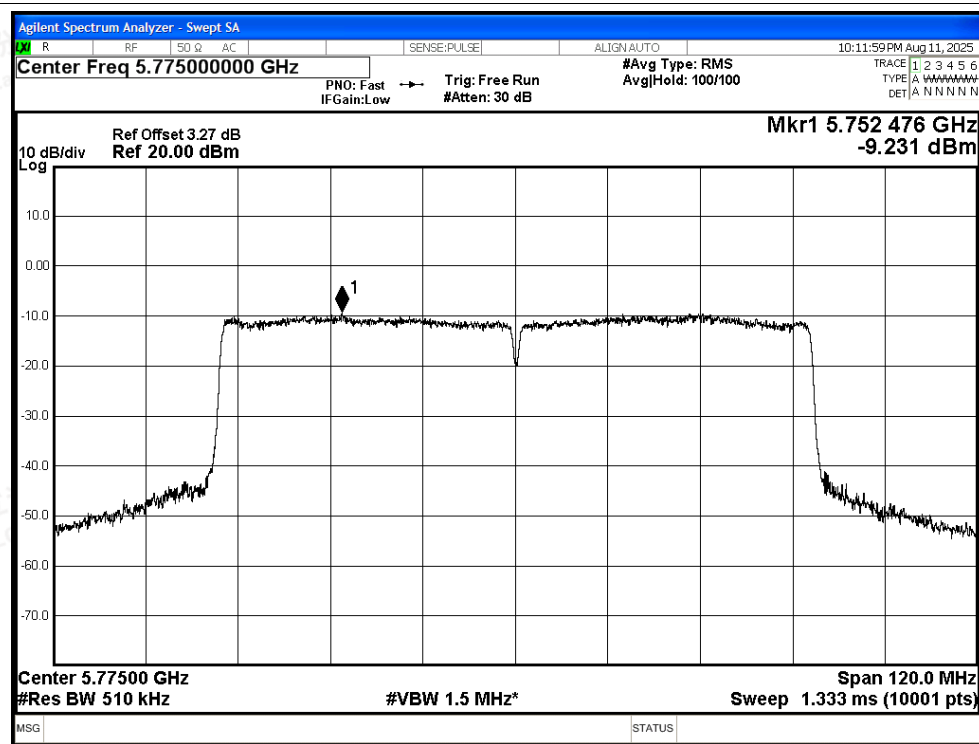

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5745MHz Ant2

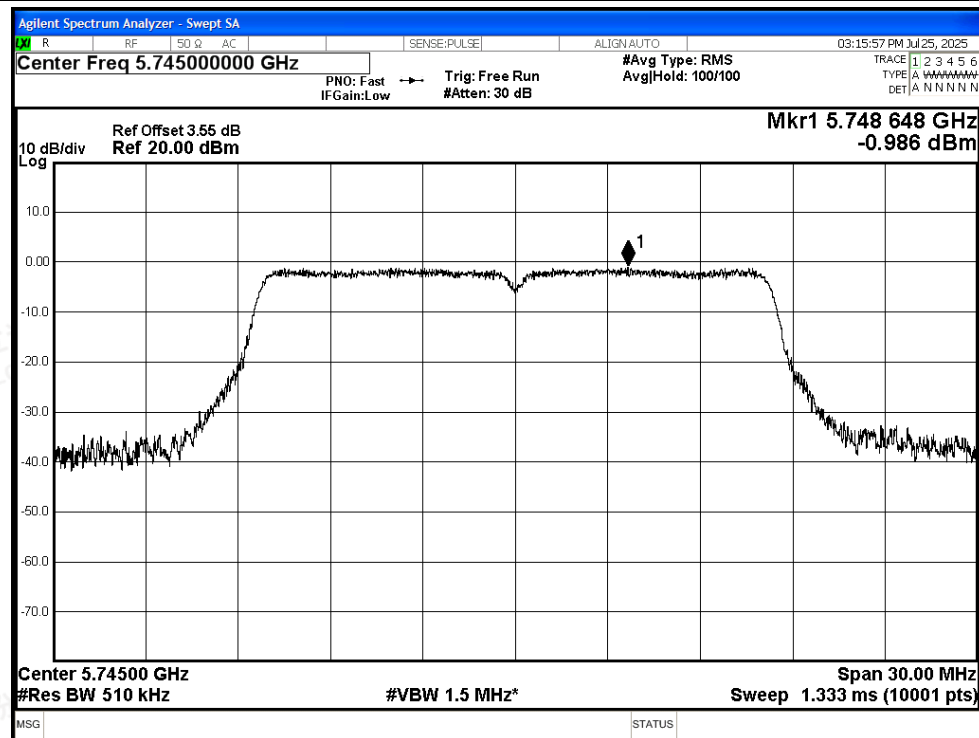

PSD NVNT a 5785MHz Ant2

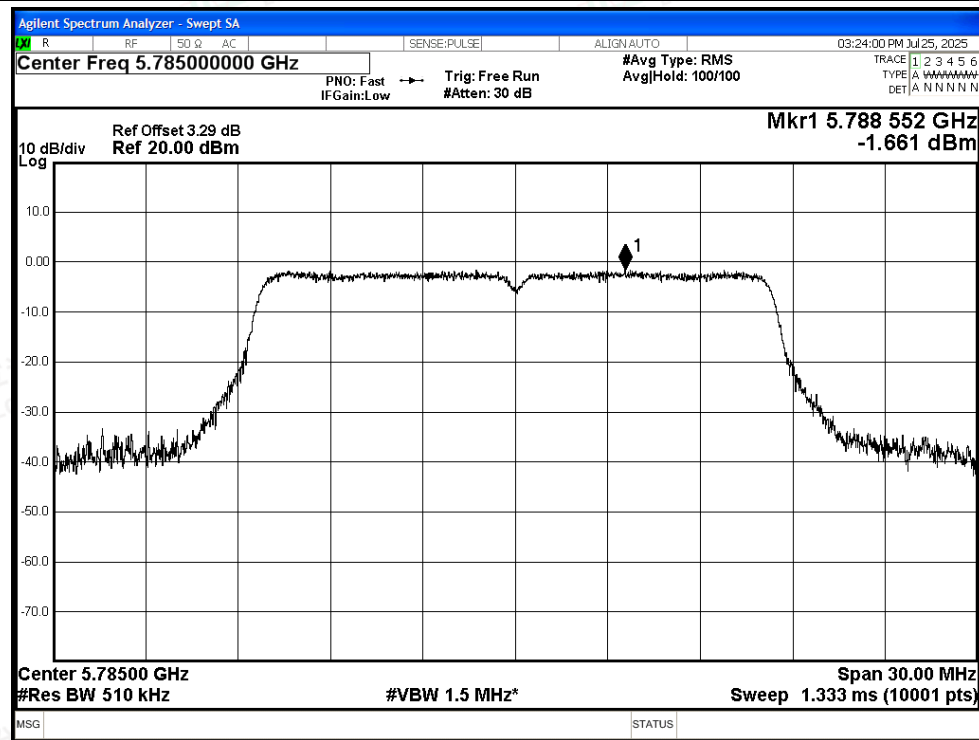

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





PSD NVNT a 5825MHz Ant2

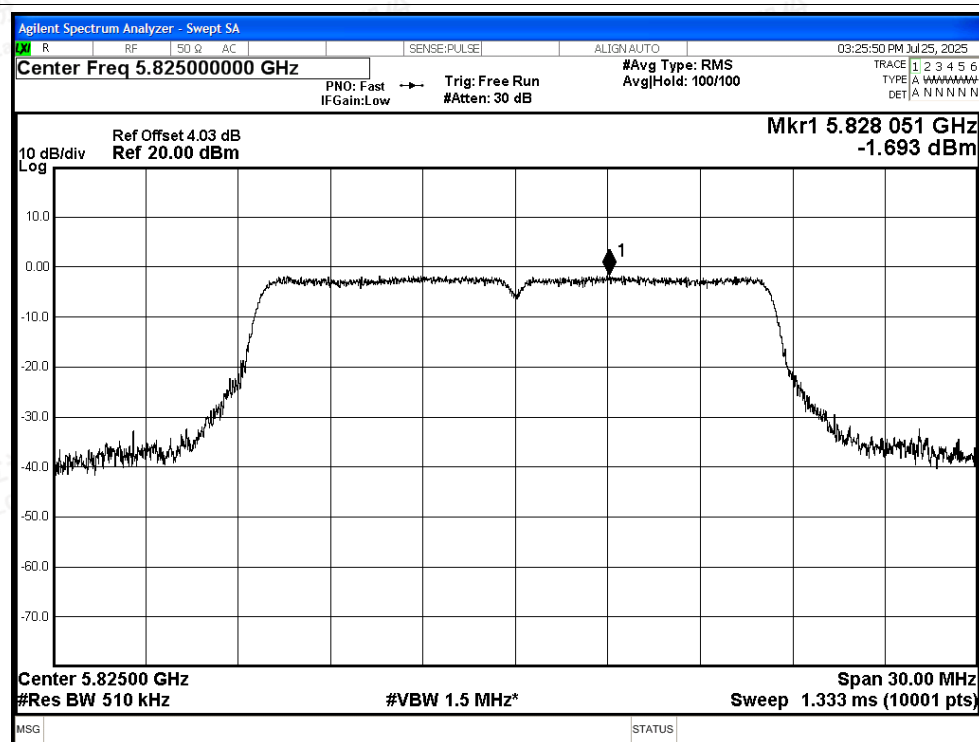

PSD NVNT n20 5745MHz Ant2

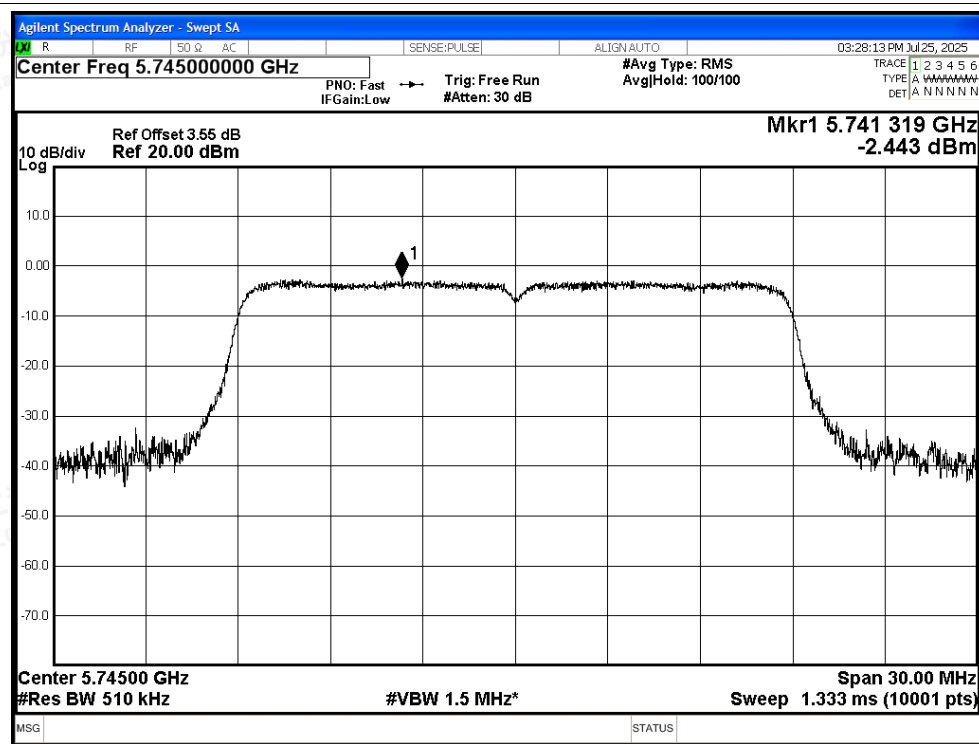

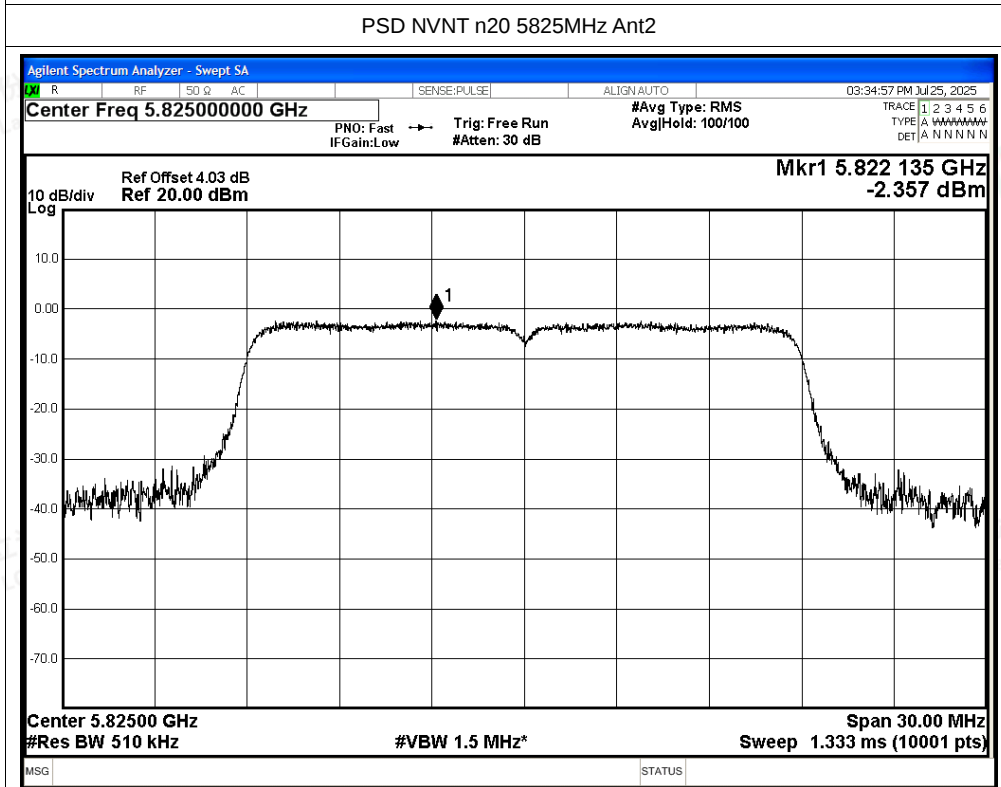
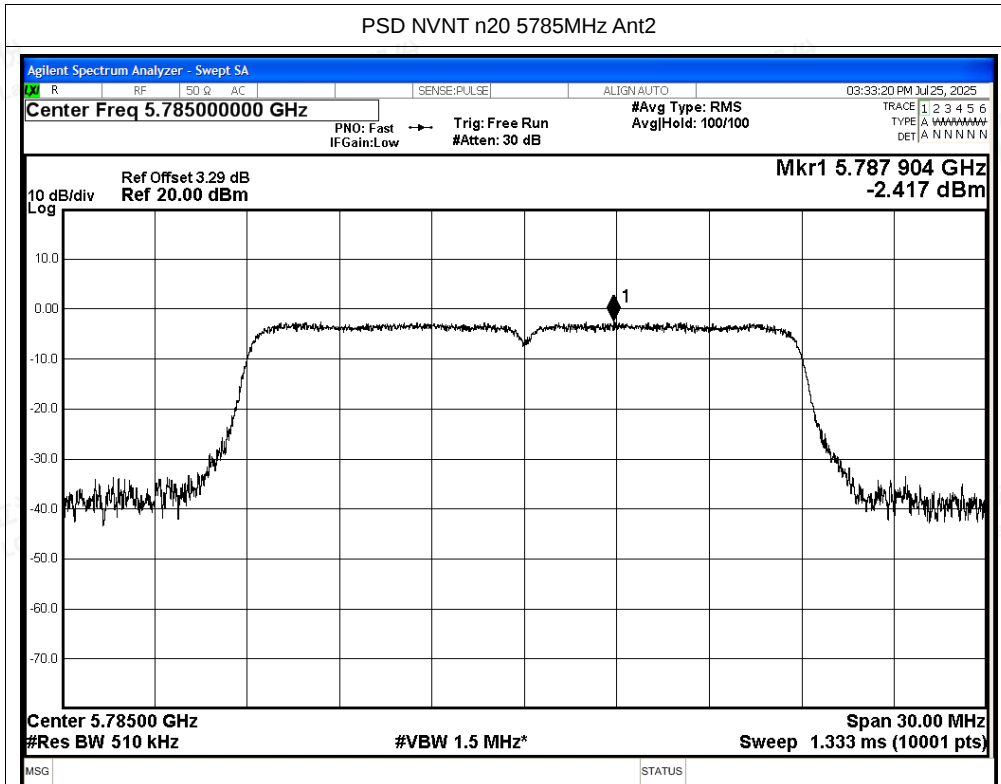


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

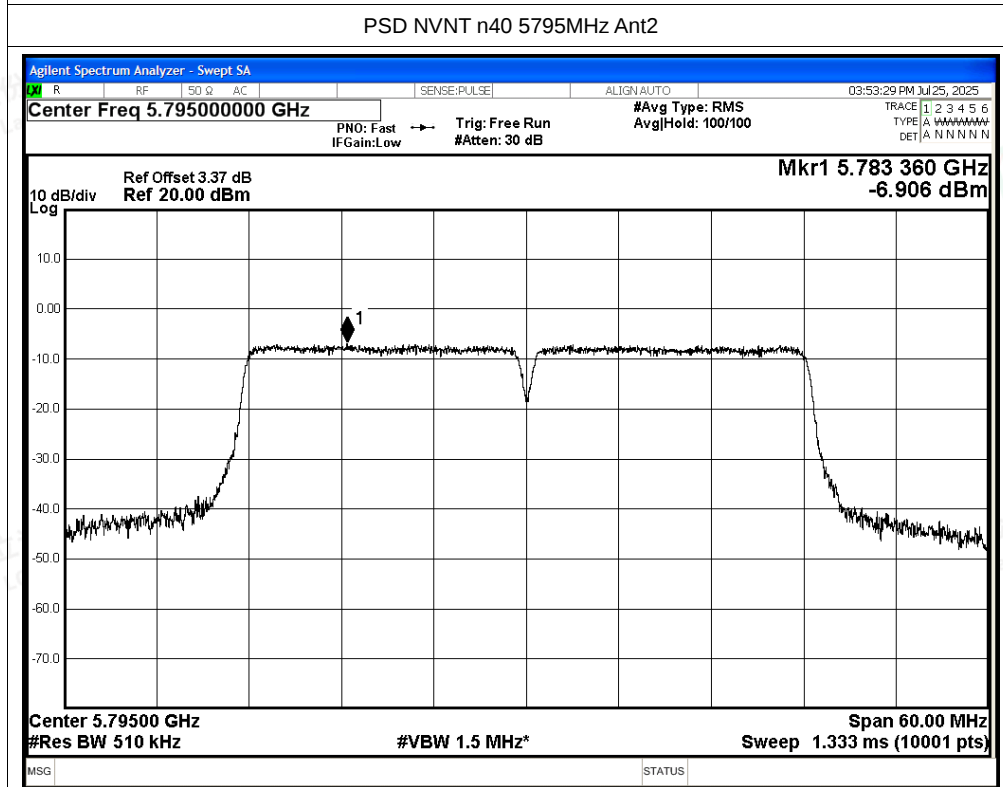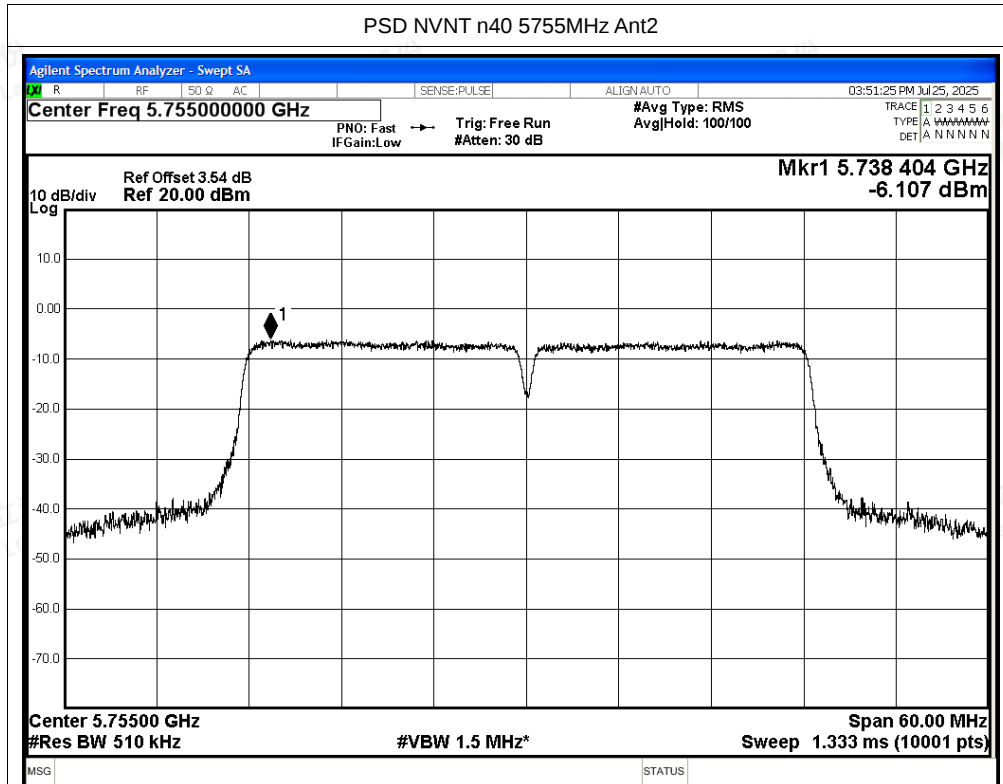

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5745MHz Ant2

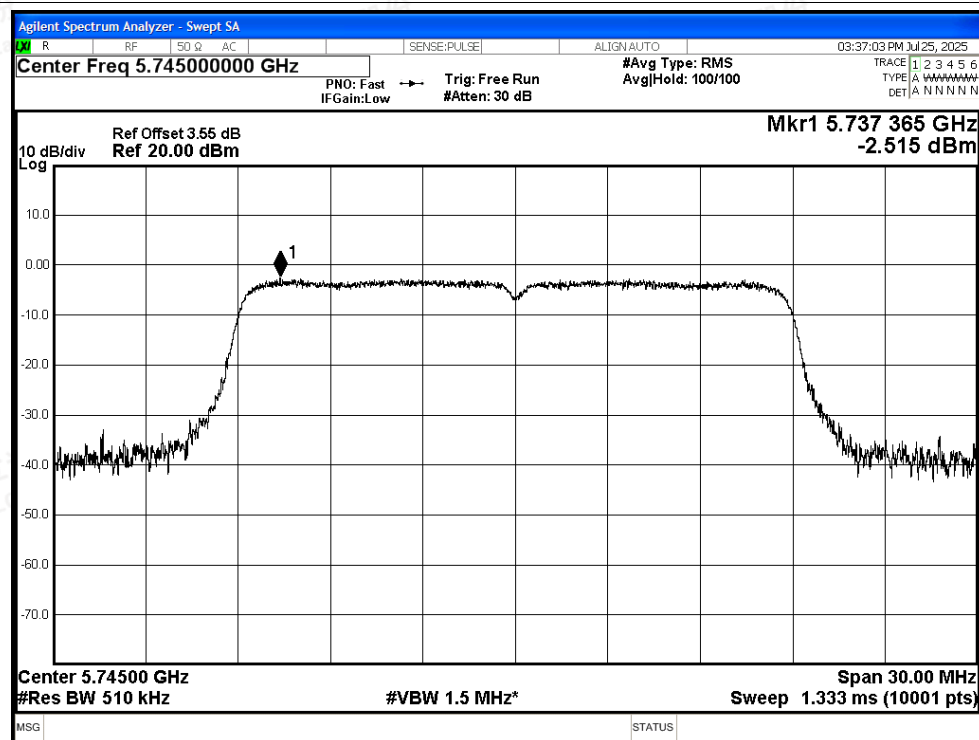

PSD NVNT ac20 5785MHz Ant2

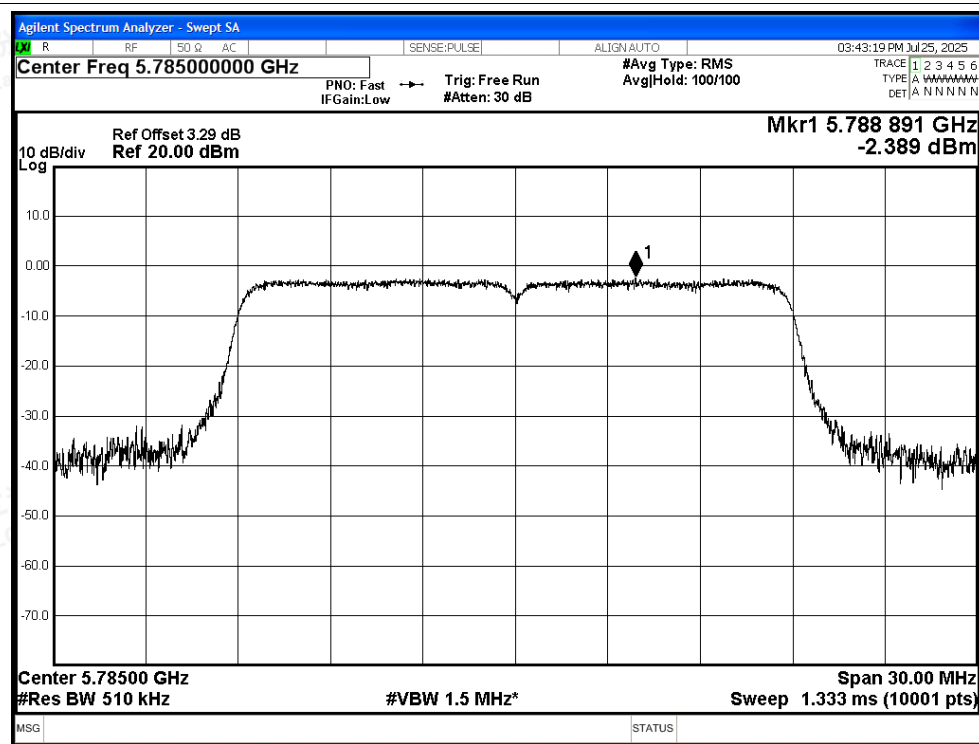

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5825MHz Ant2

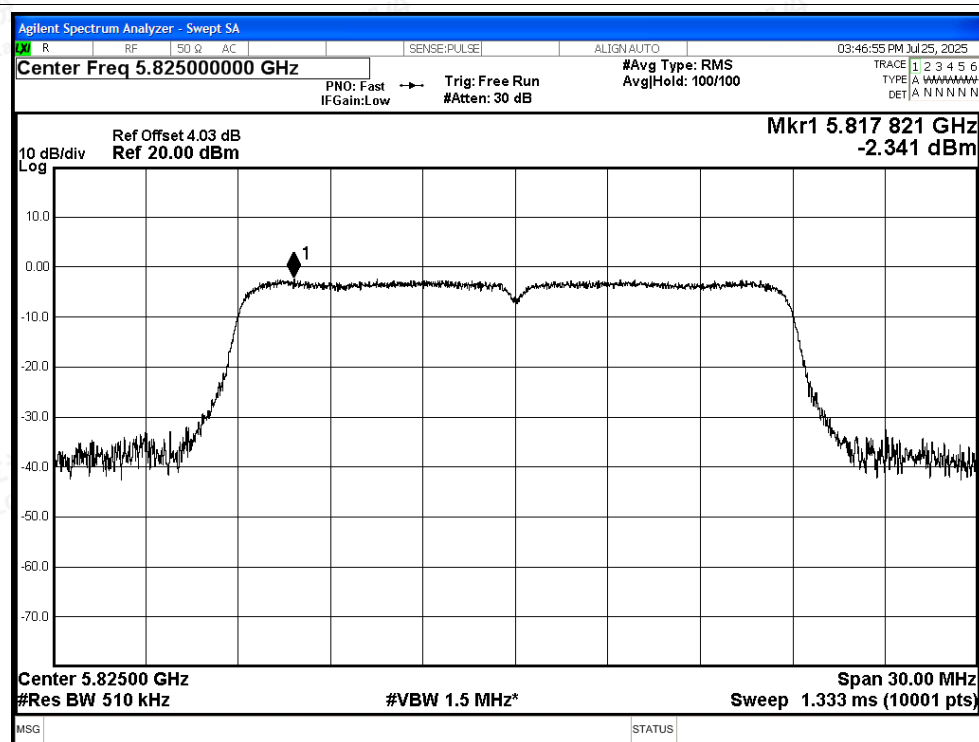

PSD NVNT ac40 5755MHz Ant2

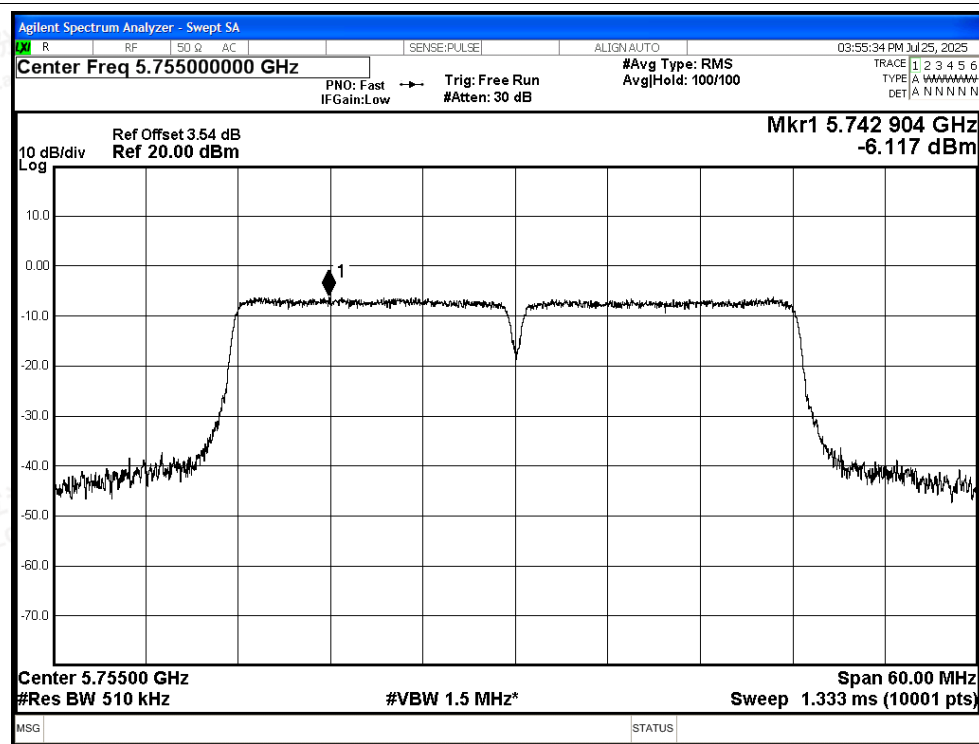

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5795MHz Ant2

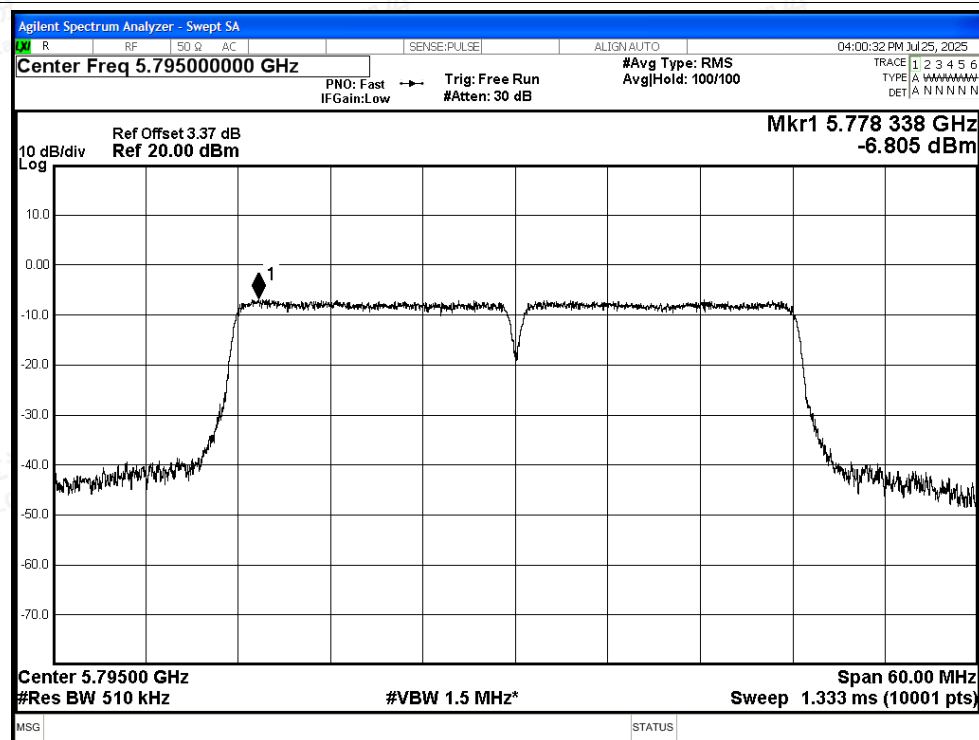

PSD NVNT ac80 5775MHz Ant2

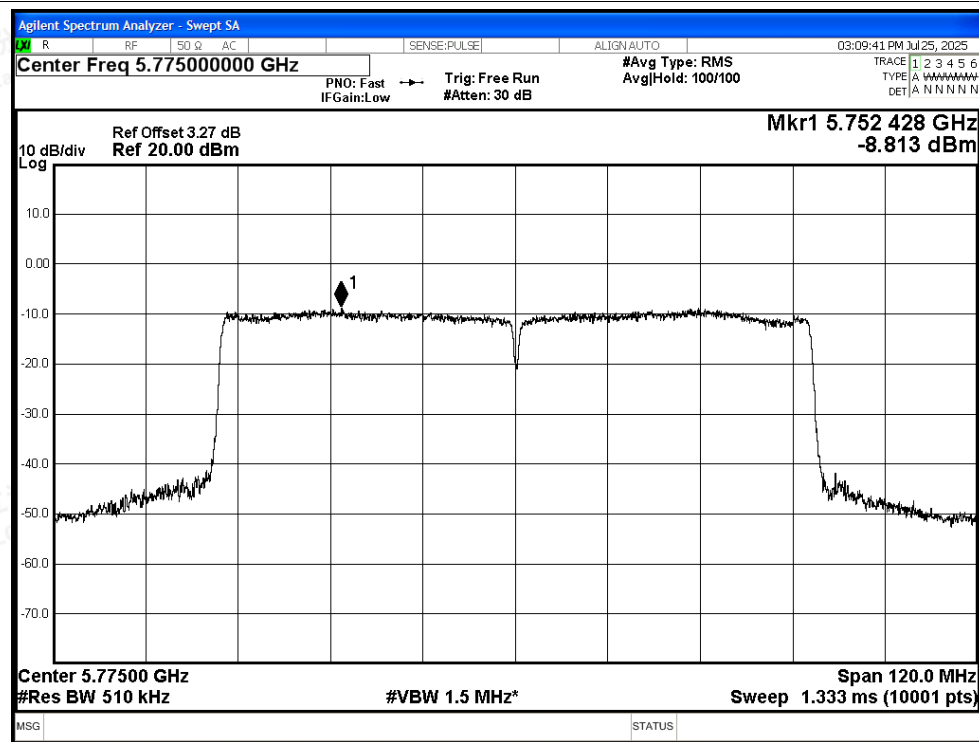

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5745MHz Ant2

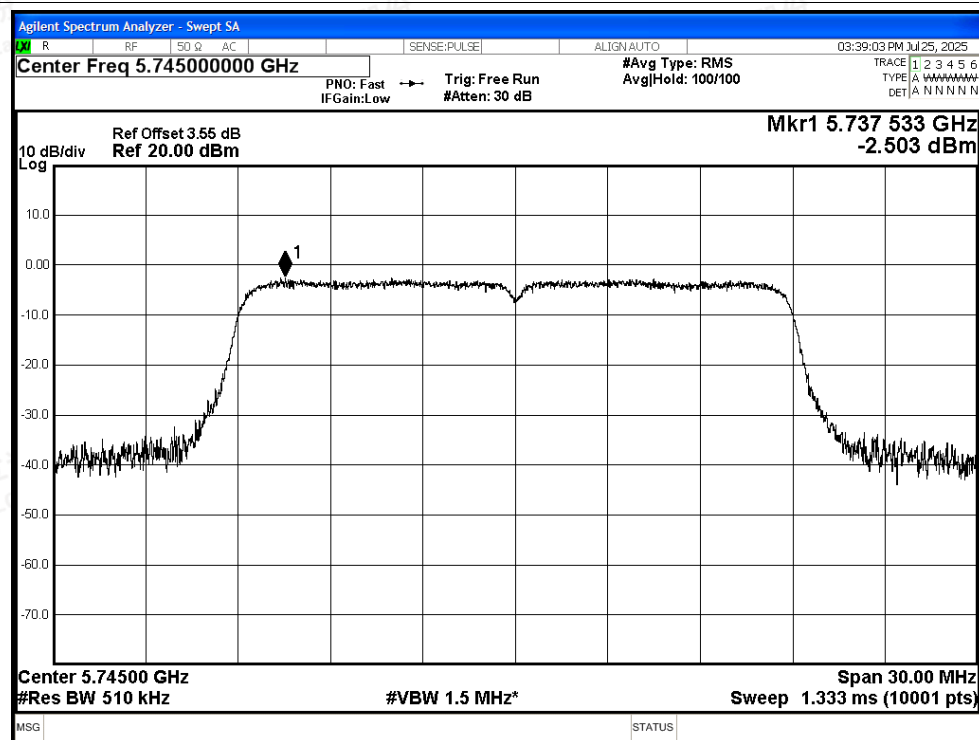

PSD NVNT ax20 5785MHz Ant2

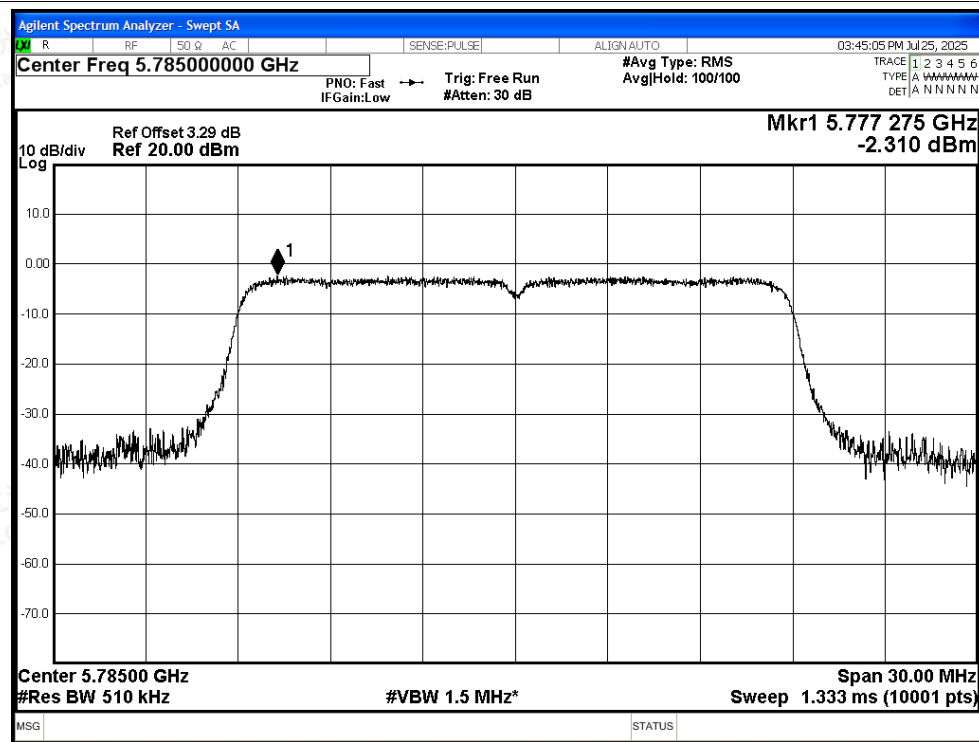

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5825MHz Ant2

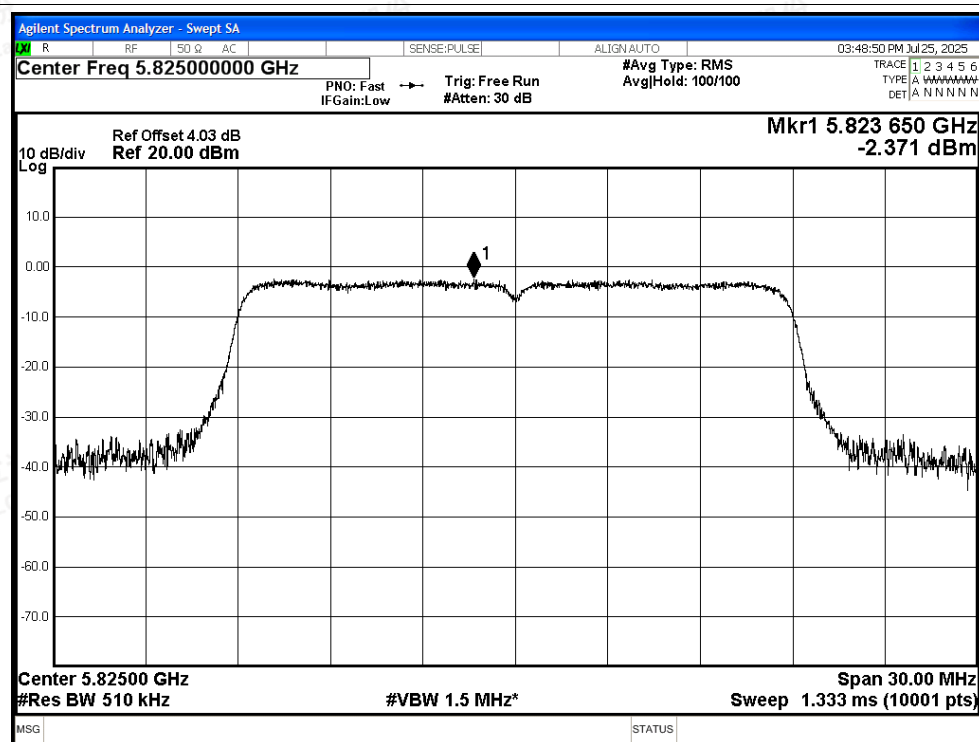

PSD NVNT ax40 5755MHz Ant2

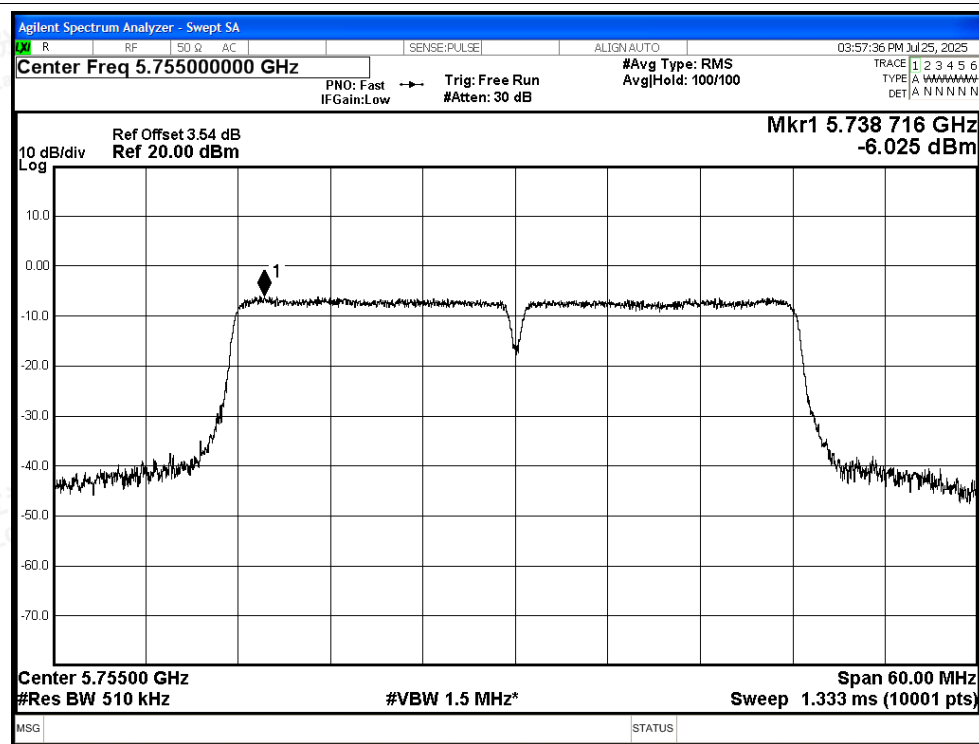

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5795MHz Ant2

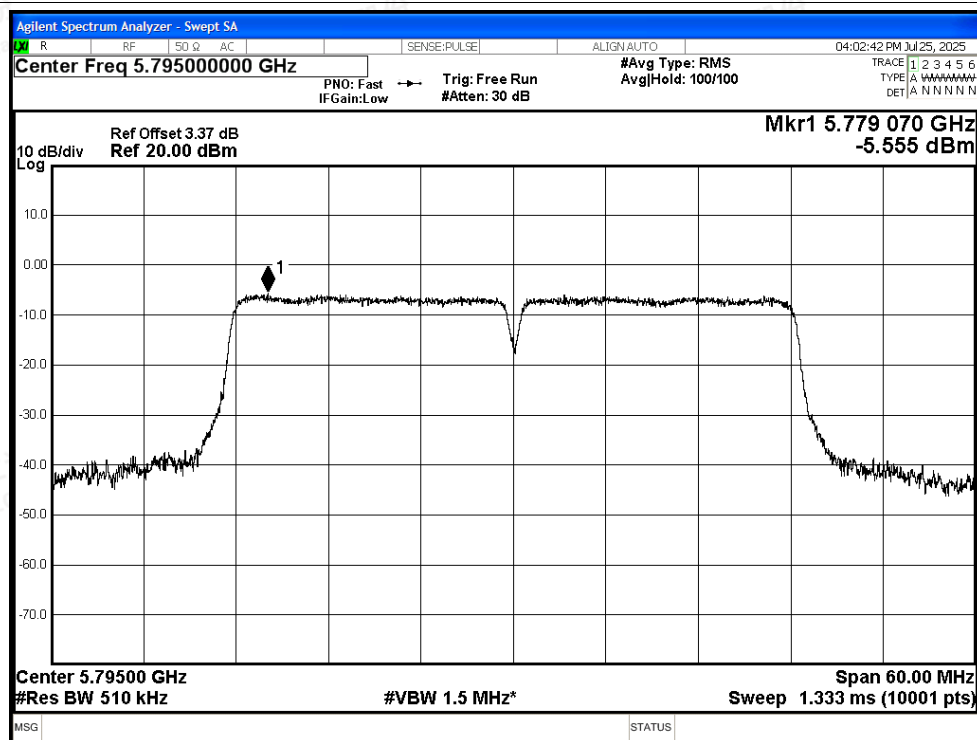

PSD NVNT ax80 5775MHz Ant2

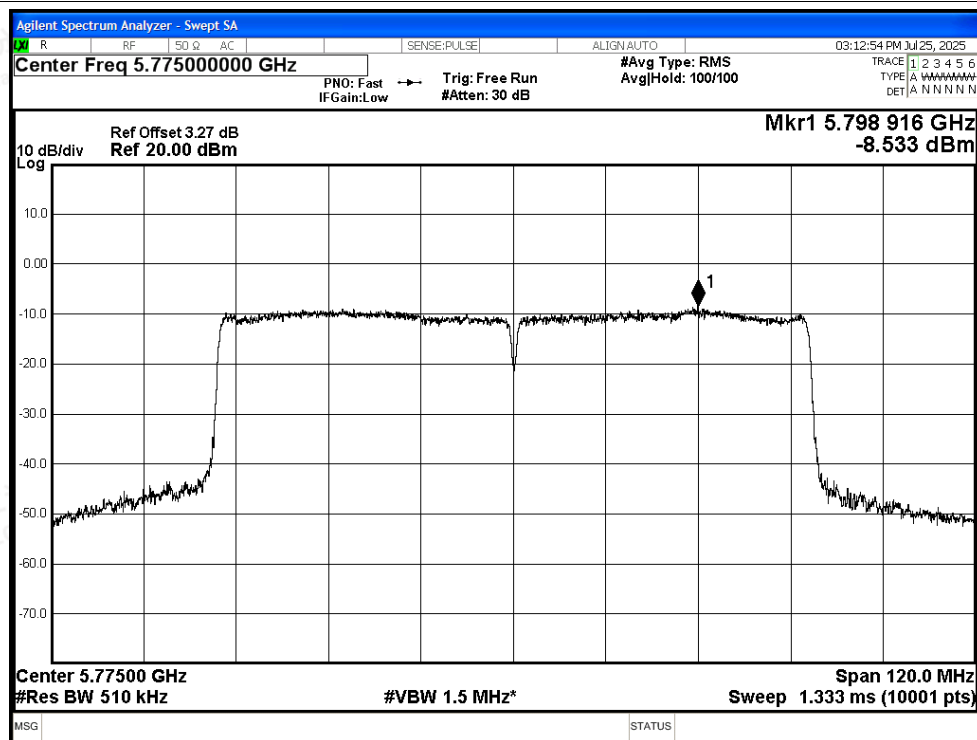

PSD NVNT be20 5745MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

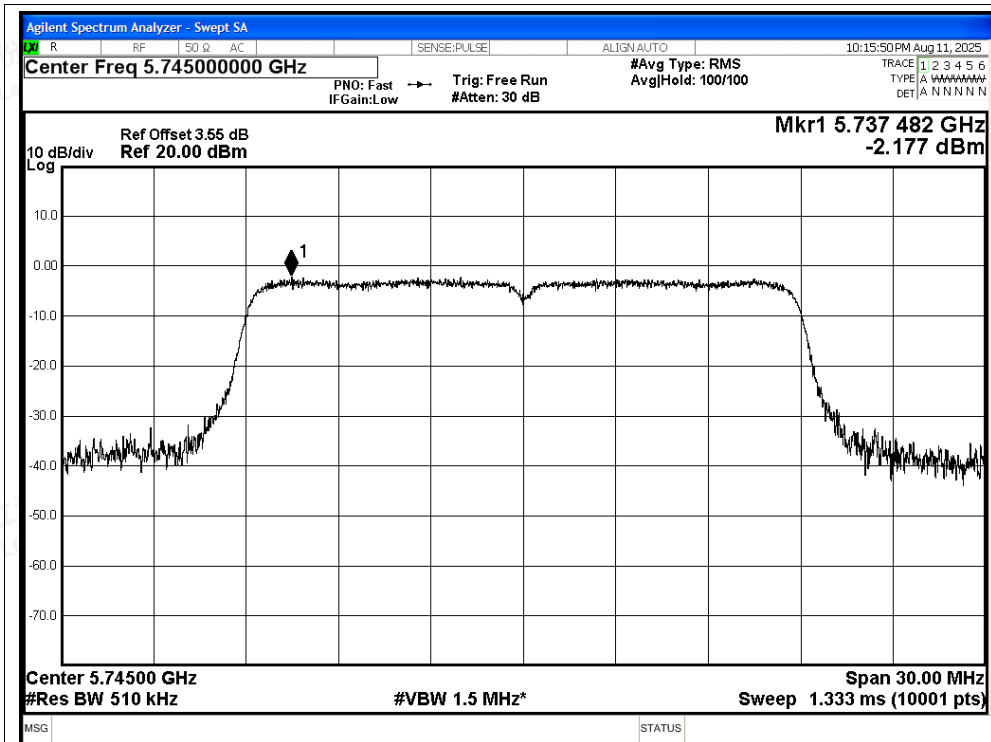

PSD NVNT be20 5785MHz Ant2

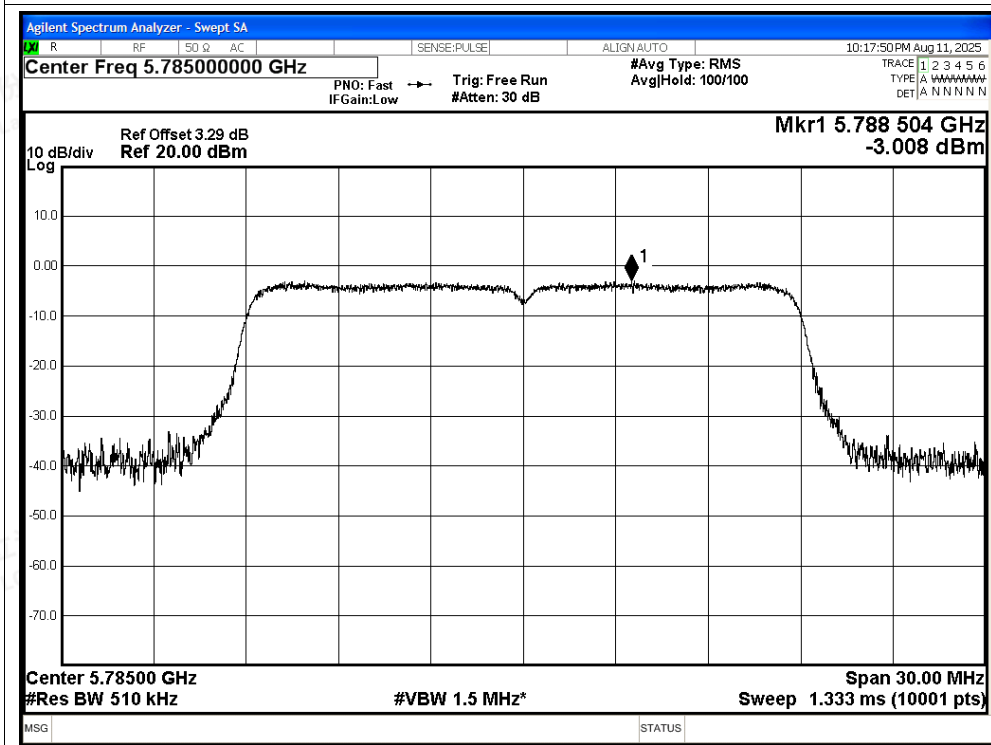

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5825MHz Ant2

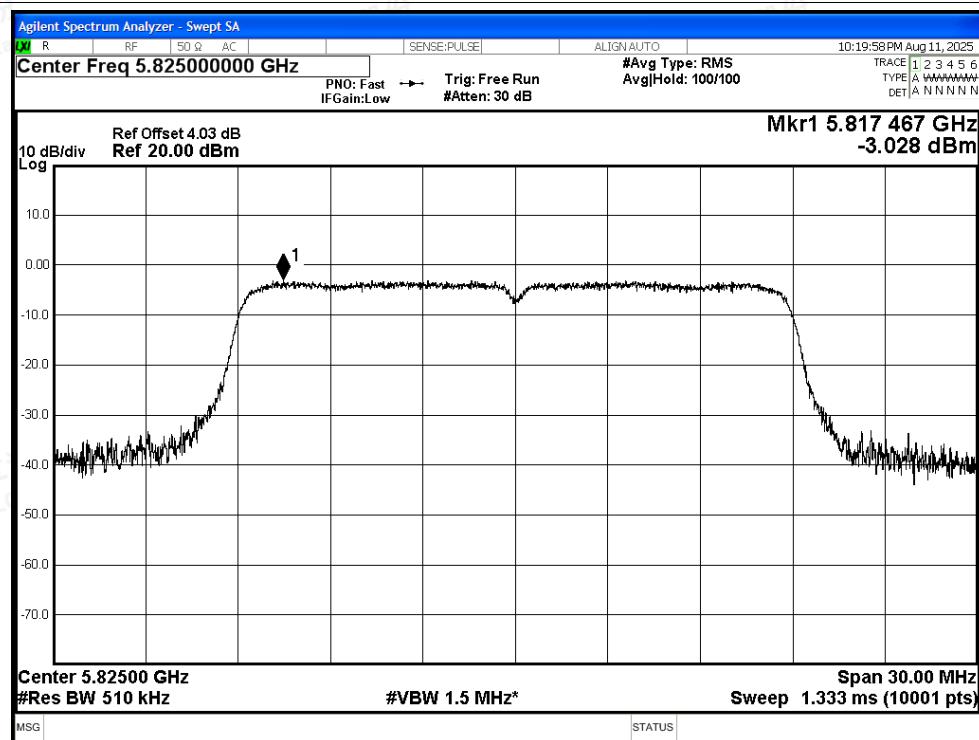

PSD NVNT be40 5755MHz Ant2

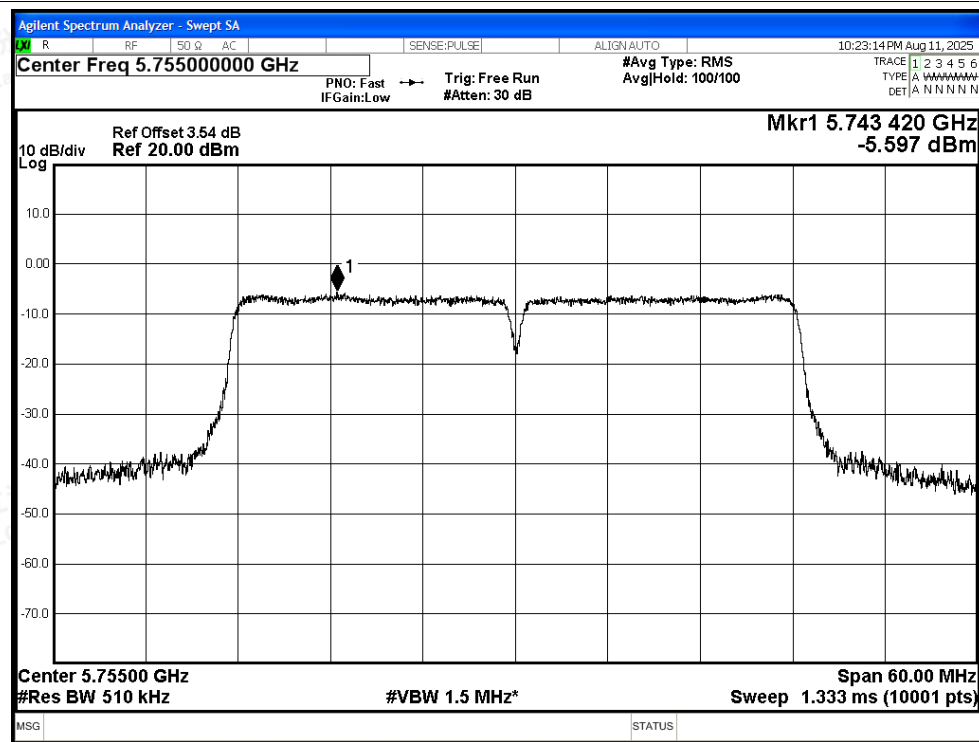

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5795MHz Ant2

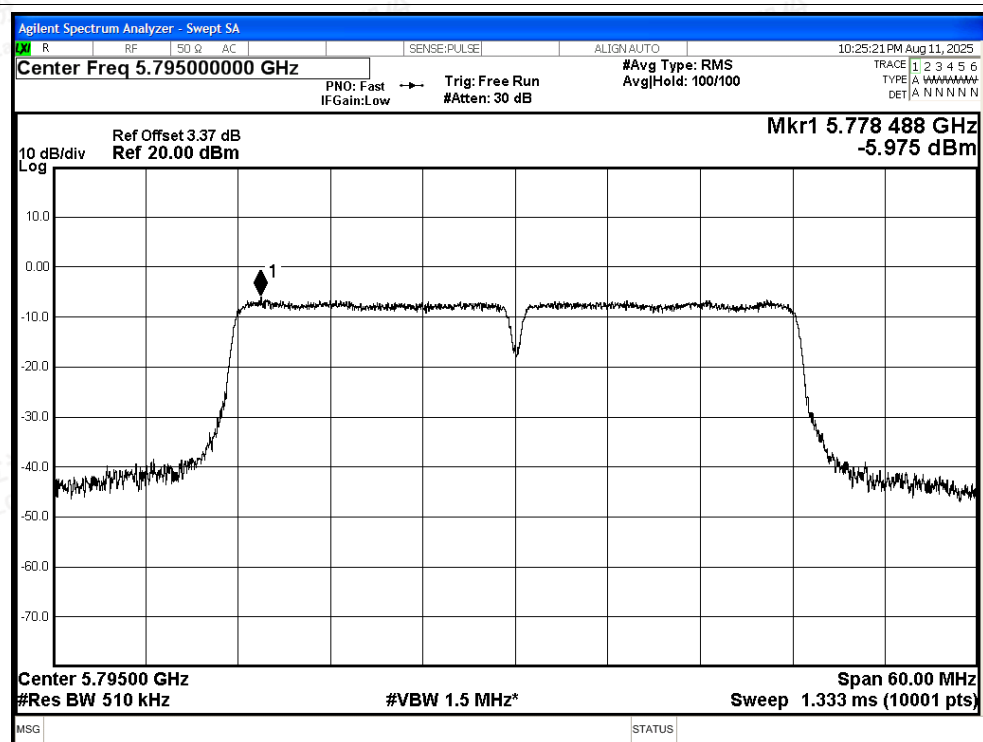

PSD NVNT be80 5775MHz Ant2

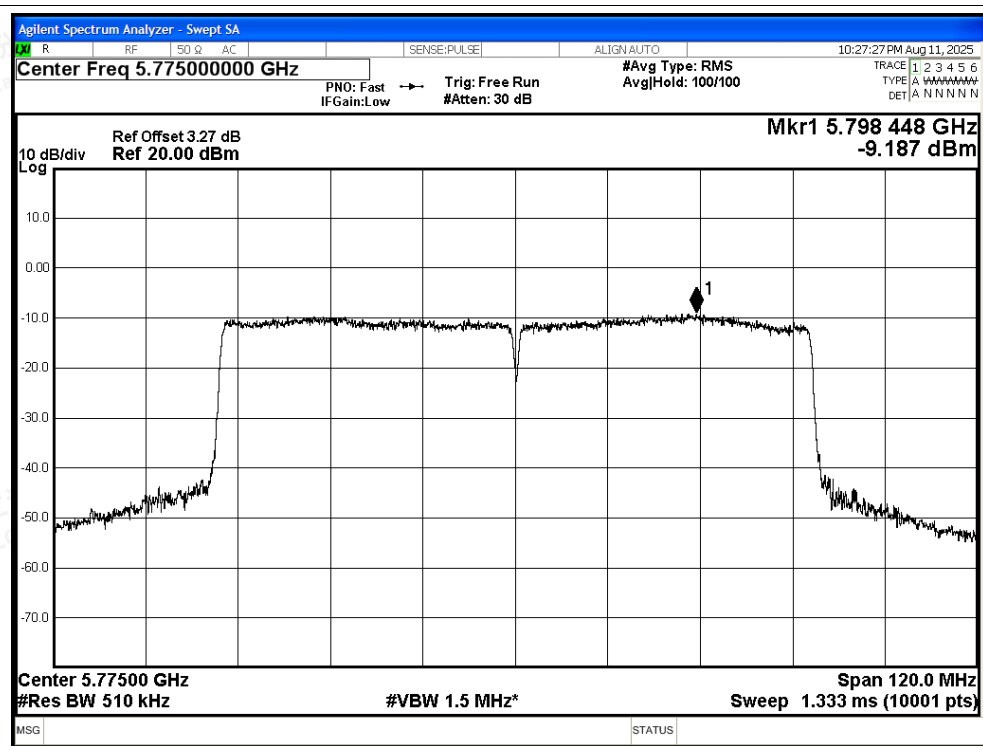

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5745MHz Ant3

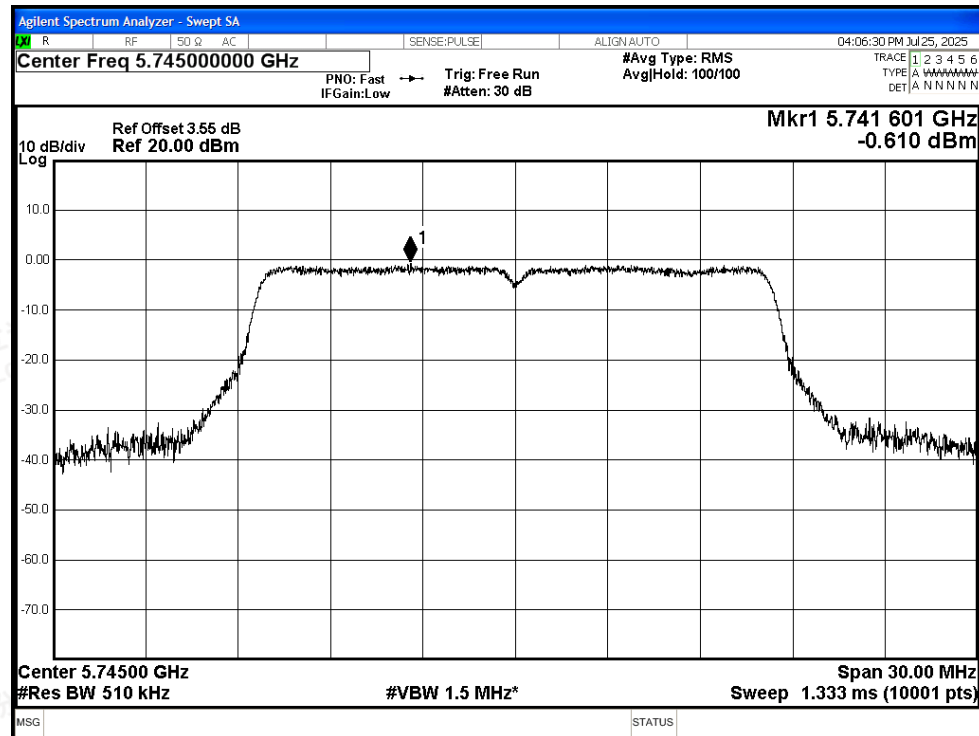

PSD NVNT a 5785MHz Ant3

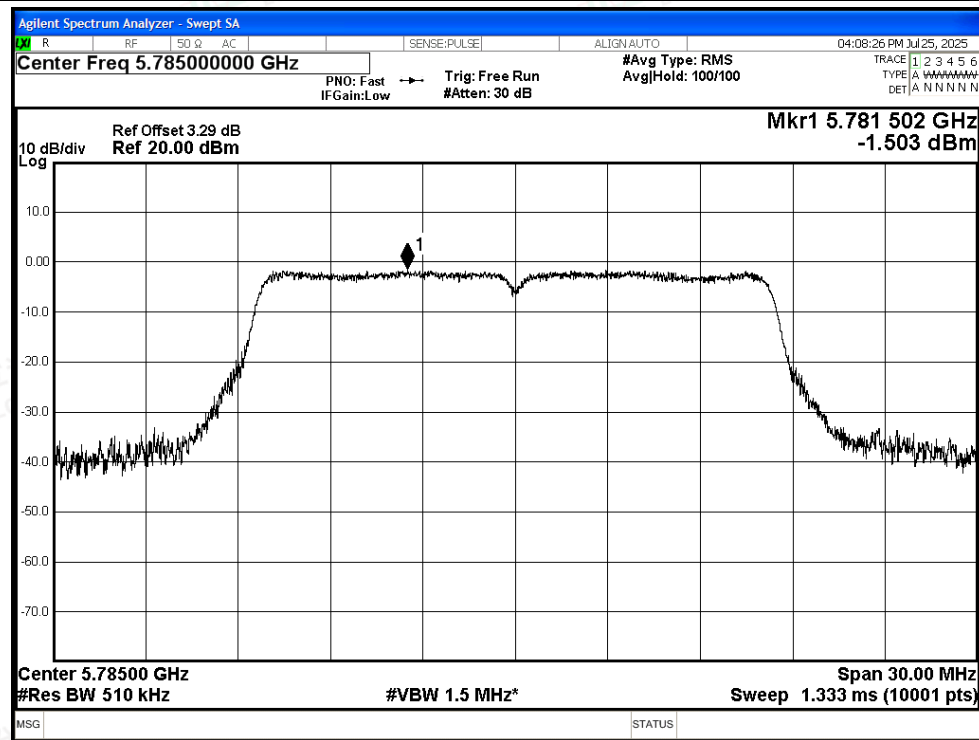

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





PSD NVNT a 5825MHz Ant3

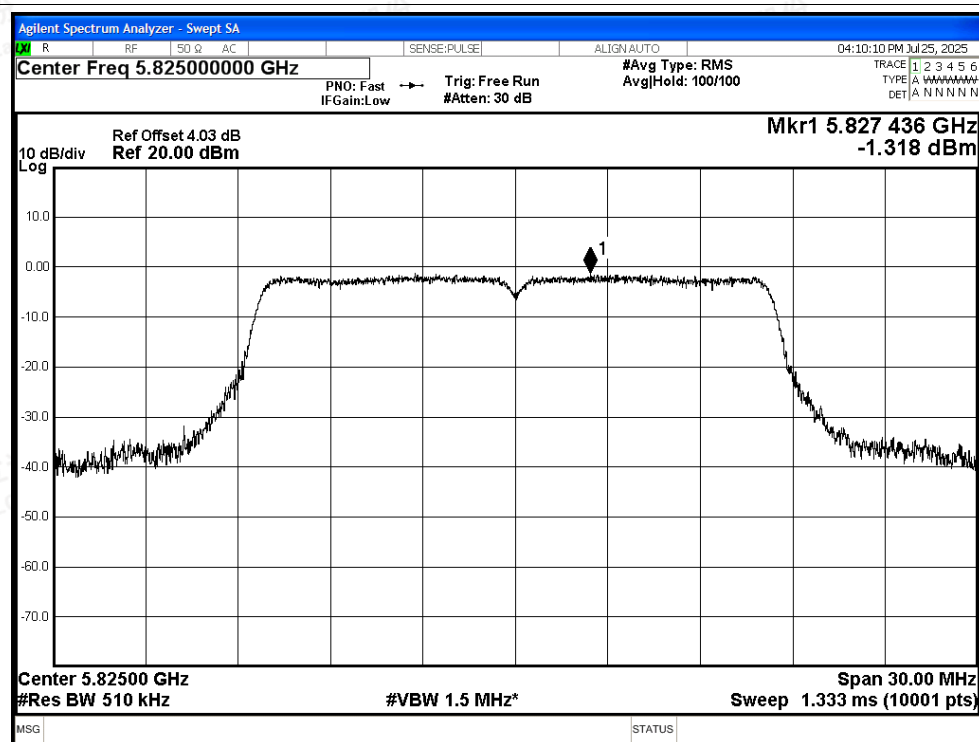

PSD NVNT n20 5745MHz Ant3

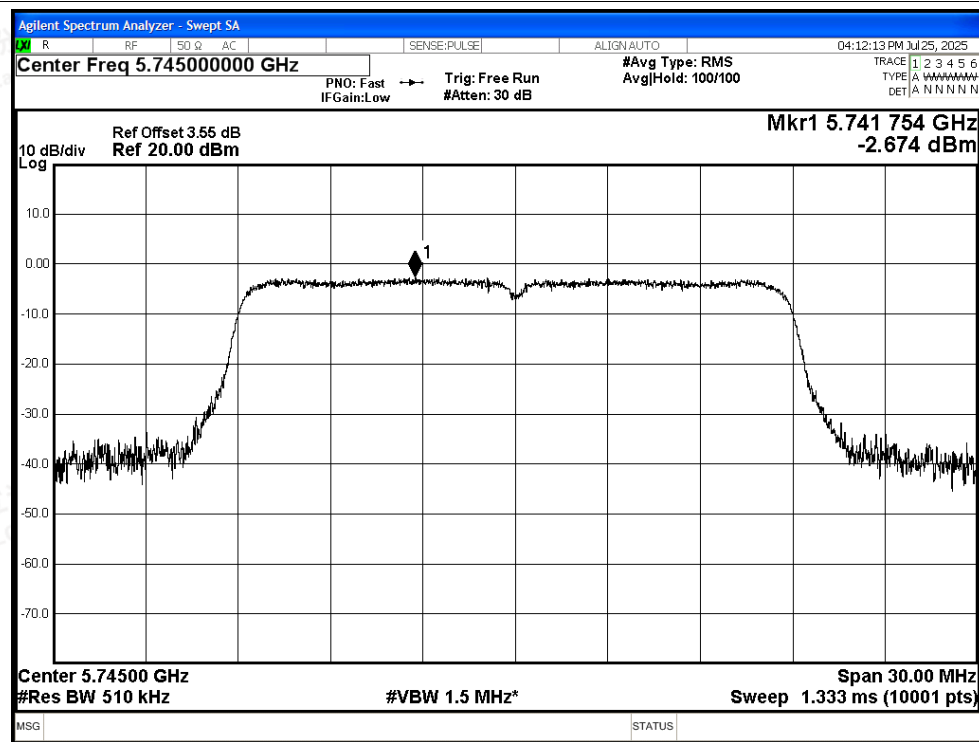

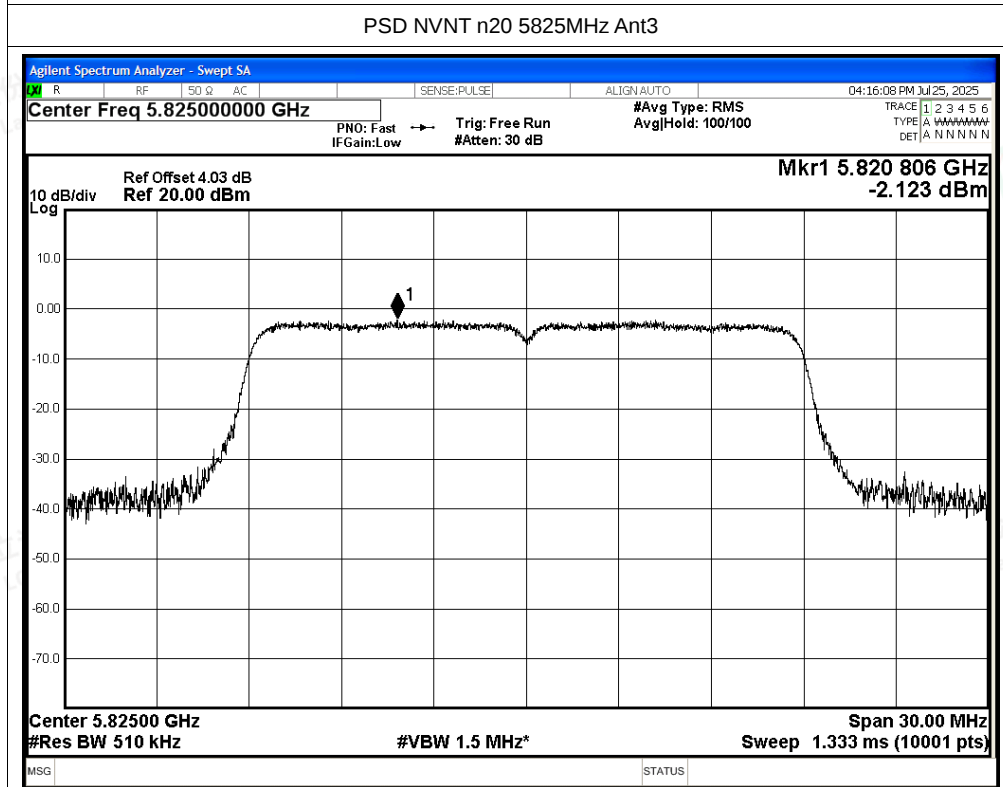
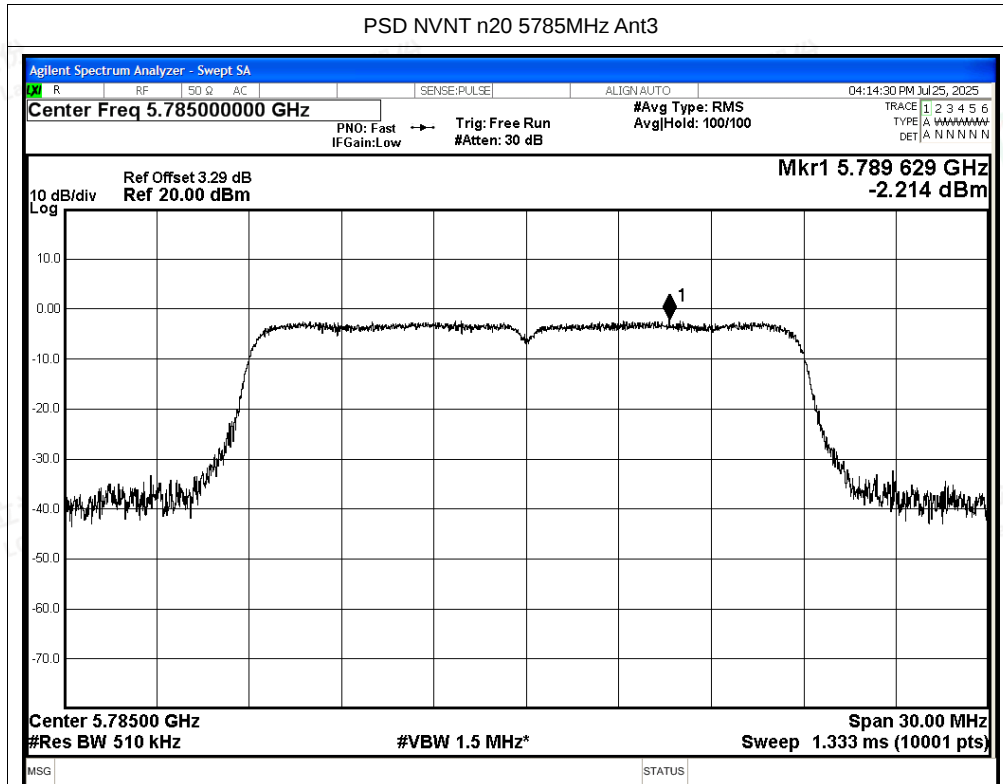


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

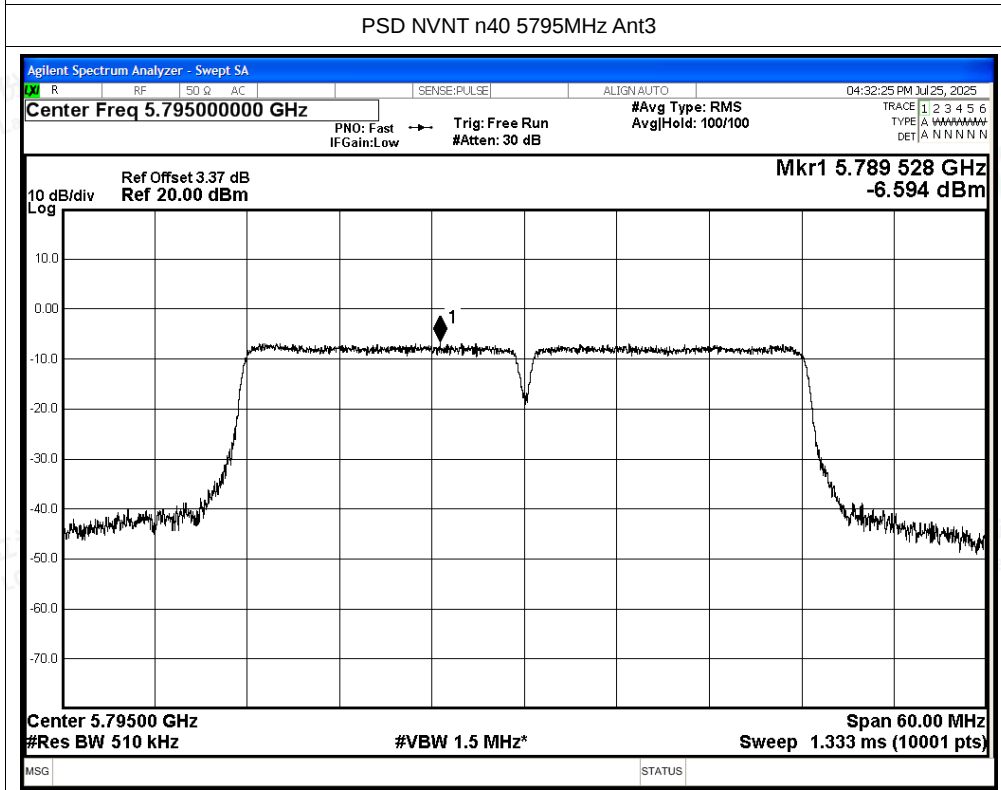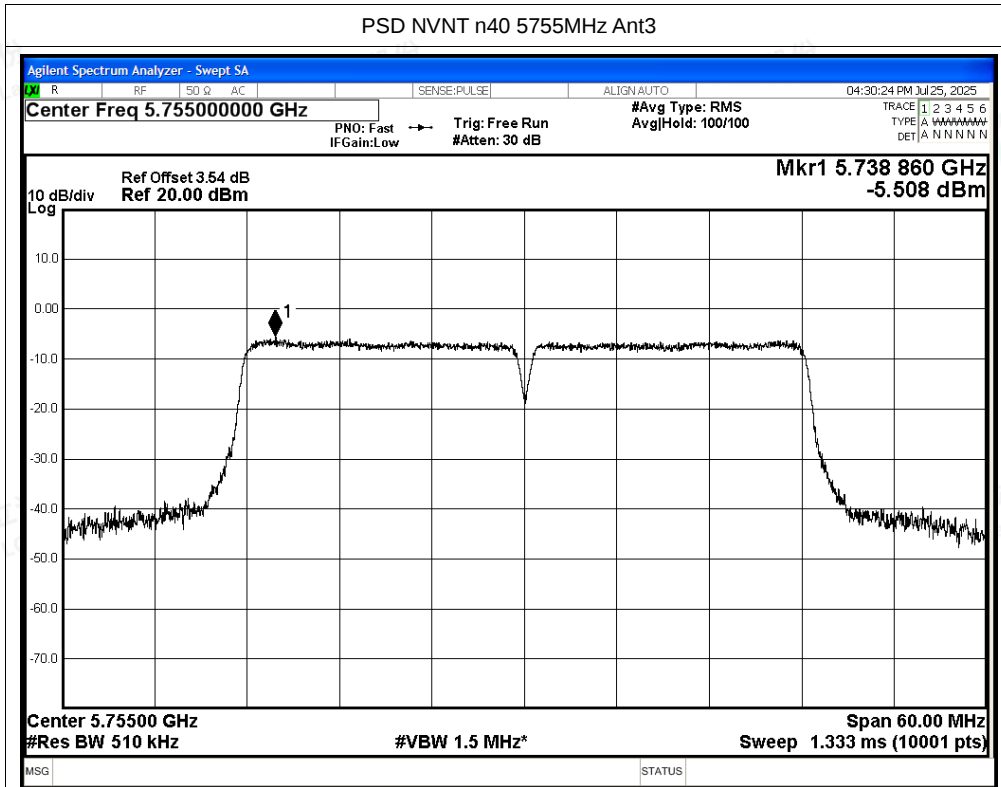

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5745MHz Ant3

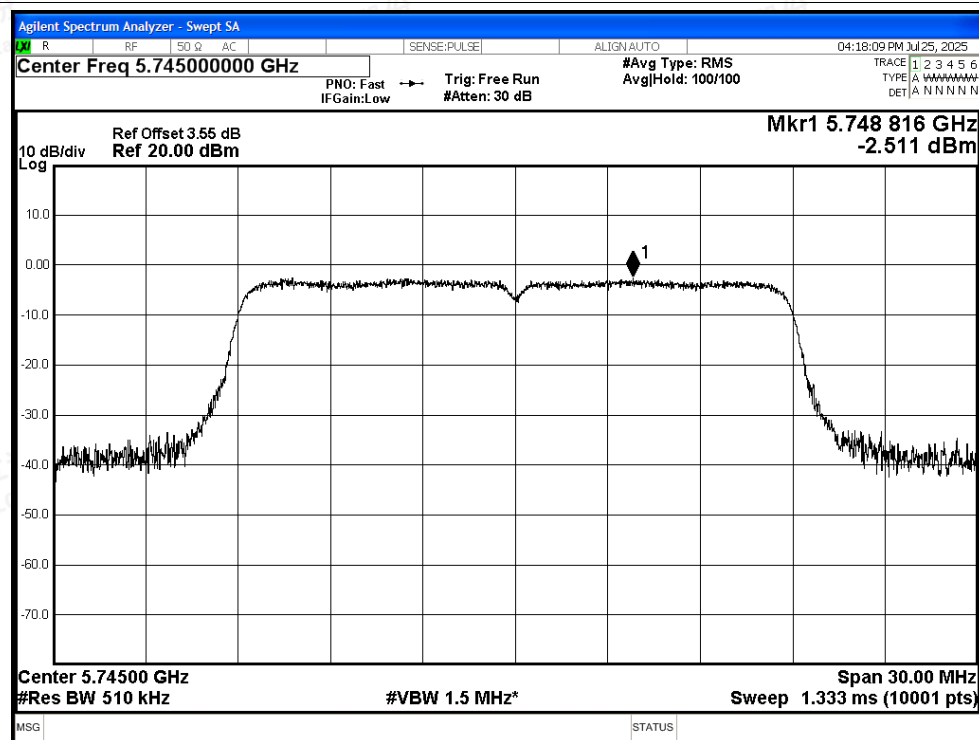

PSD NVNT ac20 5785MHz Ant3

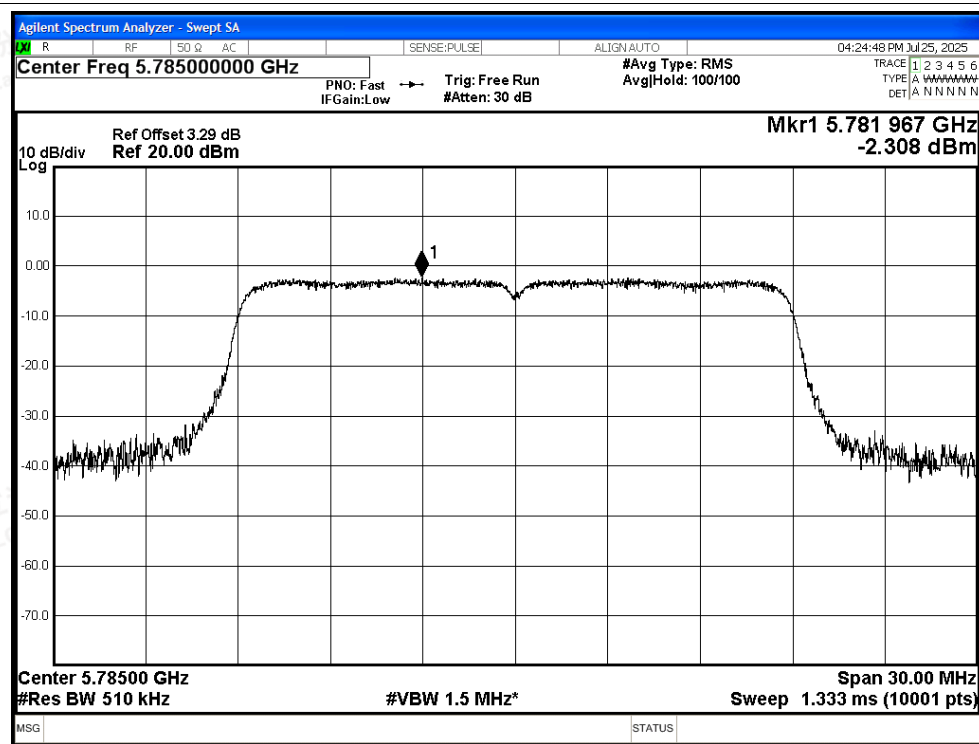

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5825MHz Ant3

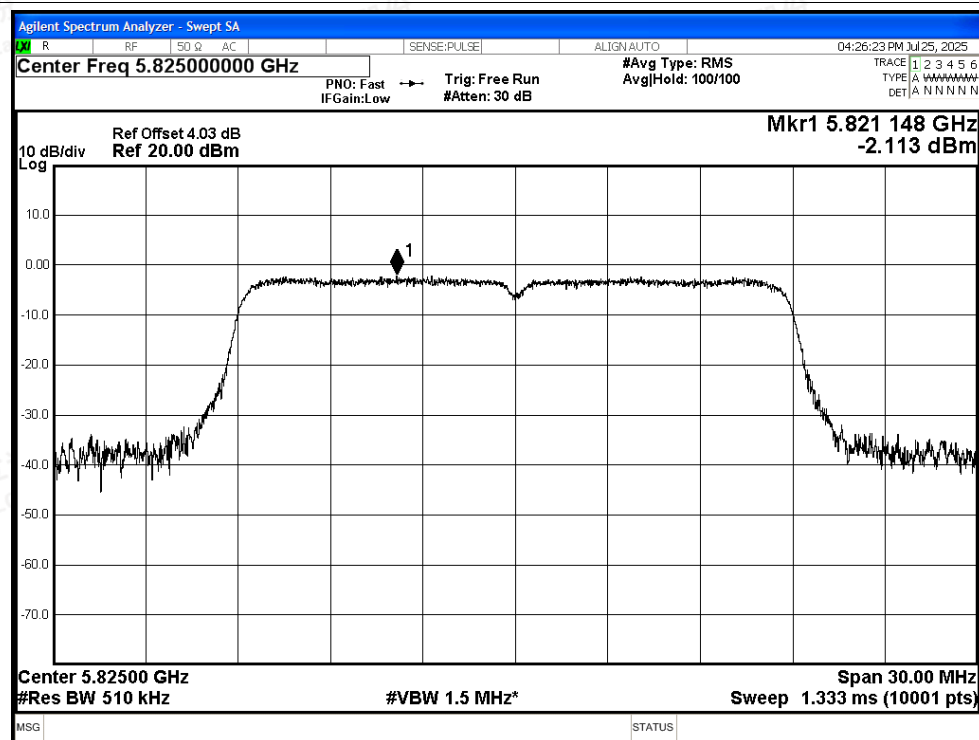

PSD NVNT ac40 5755MHz Ant3

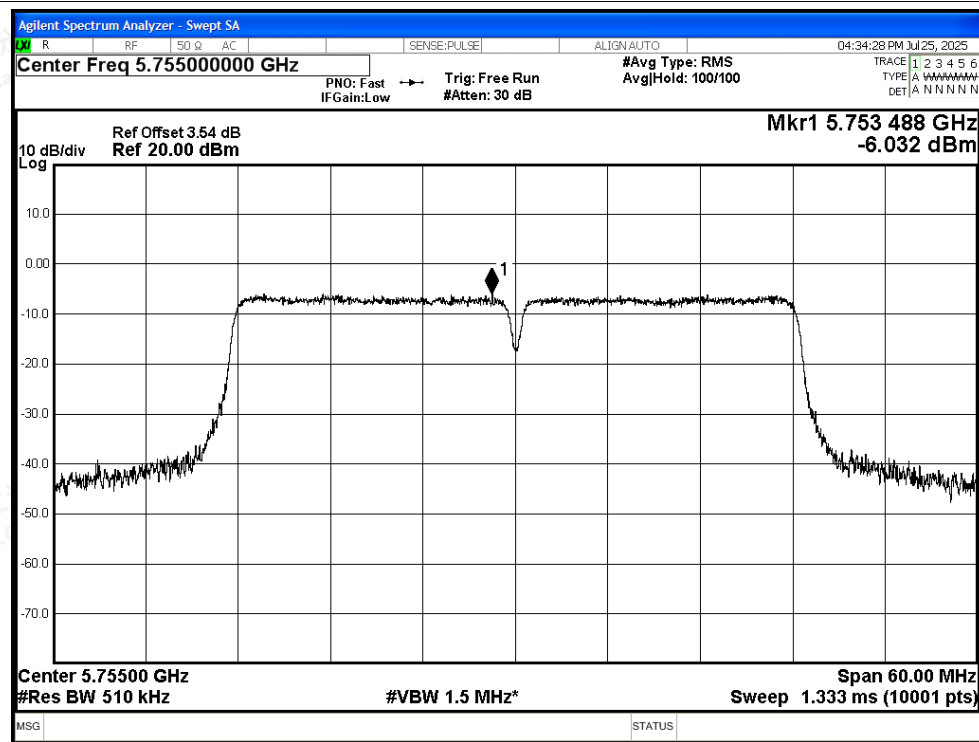

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5795MHz Ant3

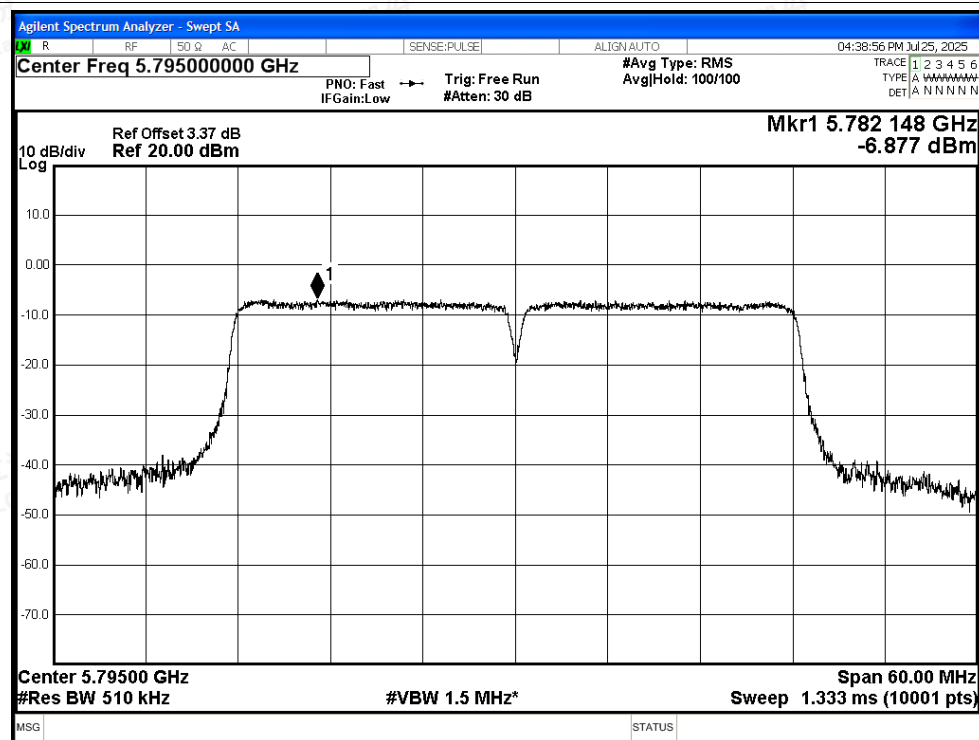

PSD NVNT ac80 5775MHz Ant3

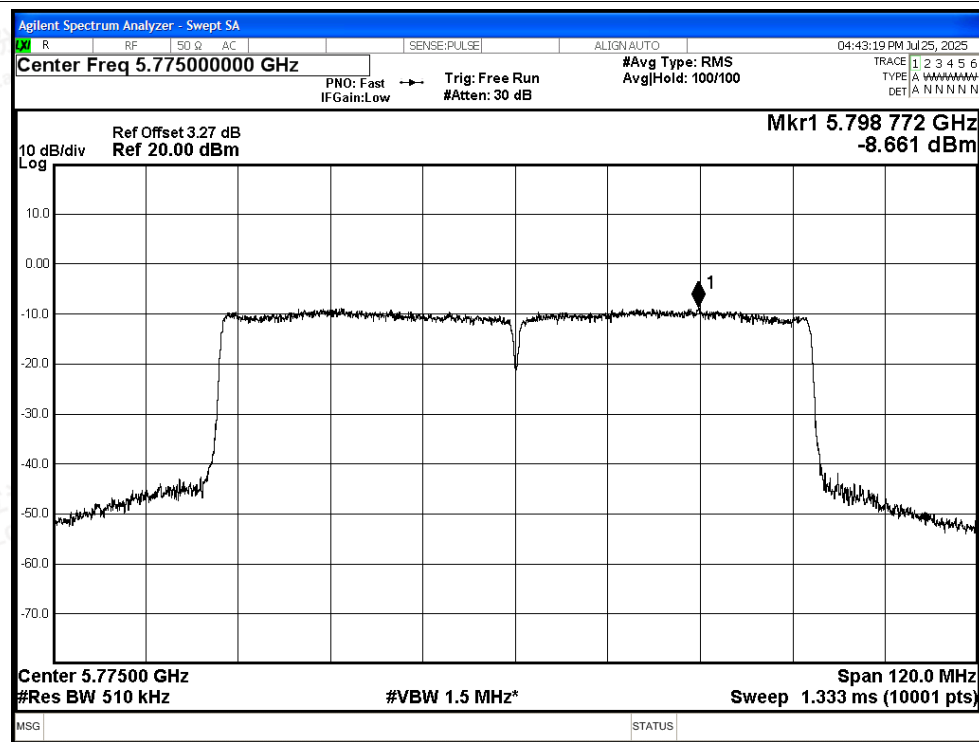

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5745MHz Ant3

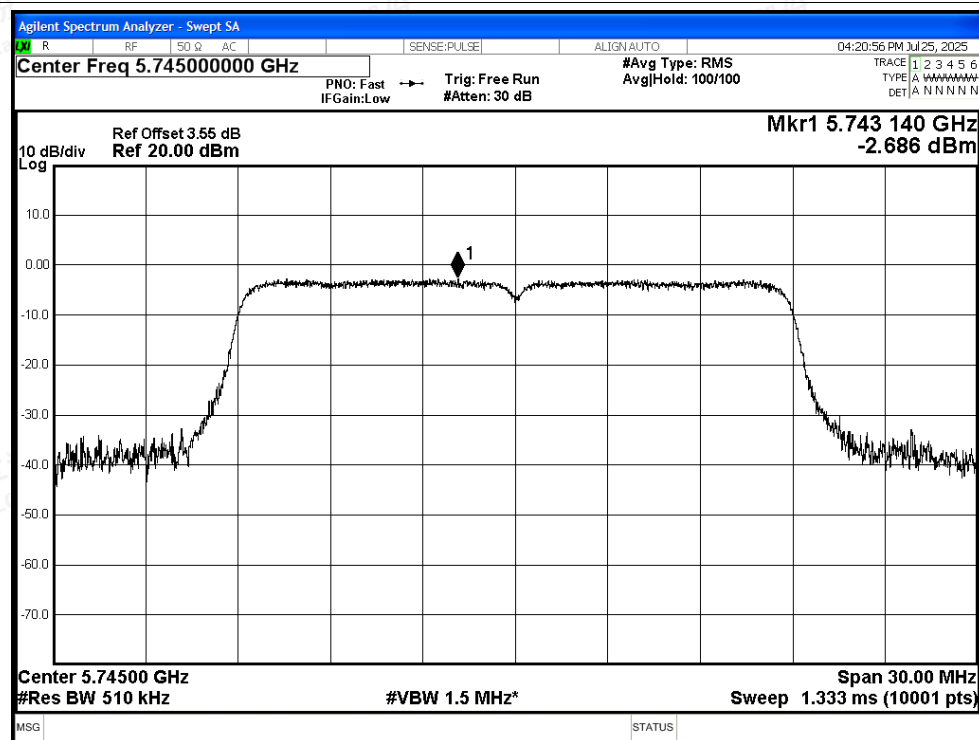

PSD NVNT ax20 5785MHz Ant3

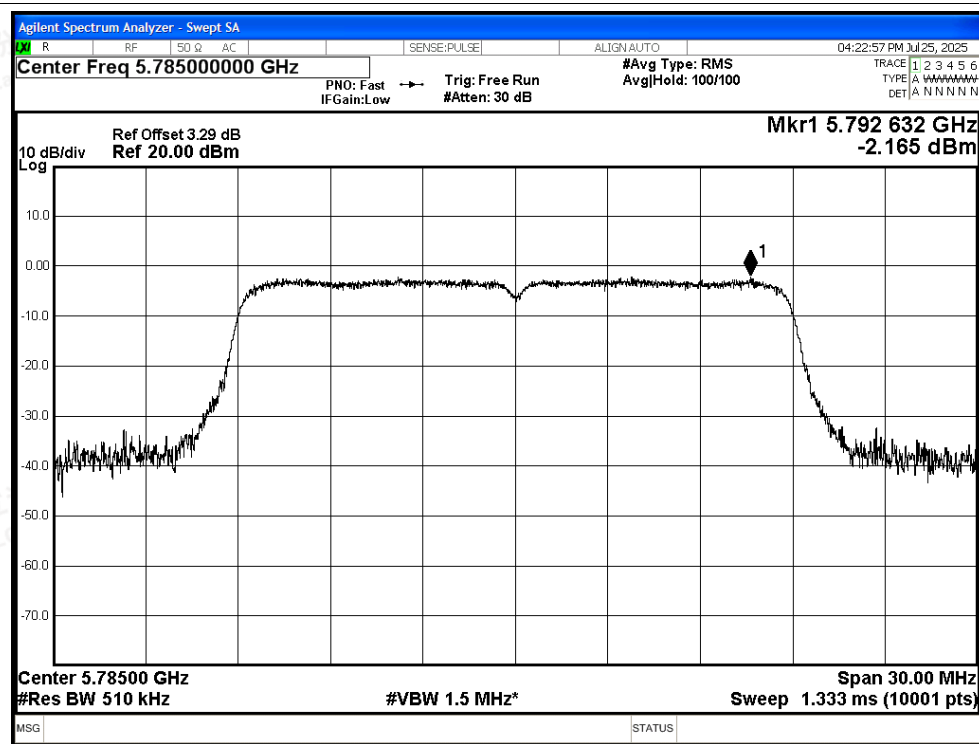

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5825MHz Ant3

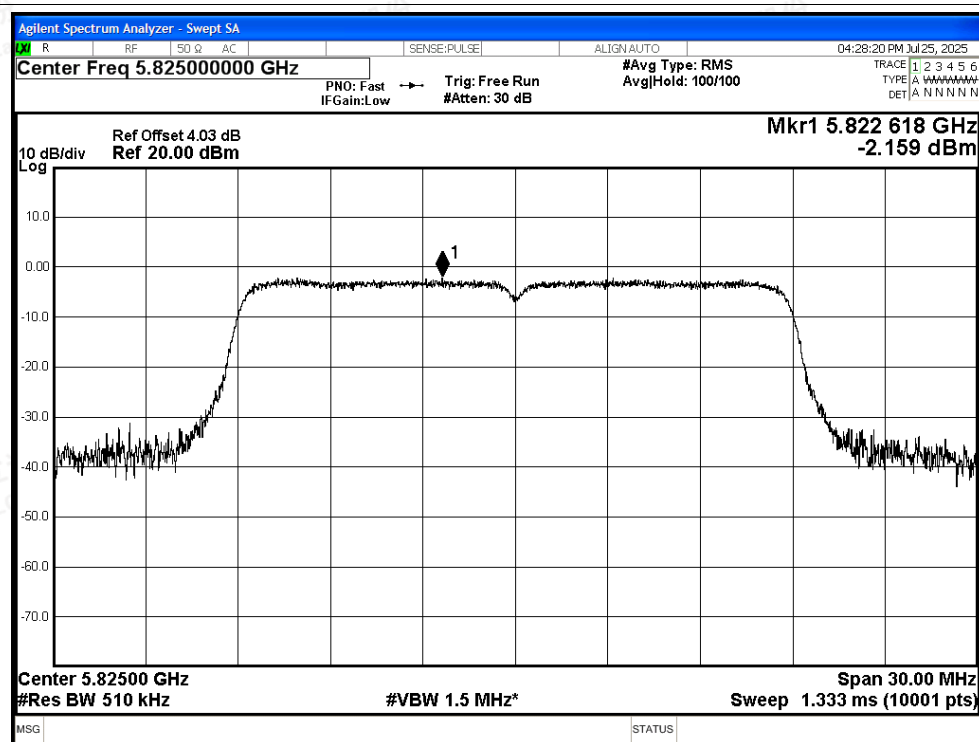

PSD NVNT ax40 5755MHz Ant3

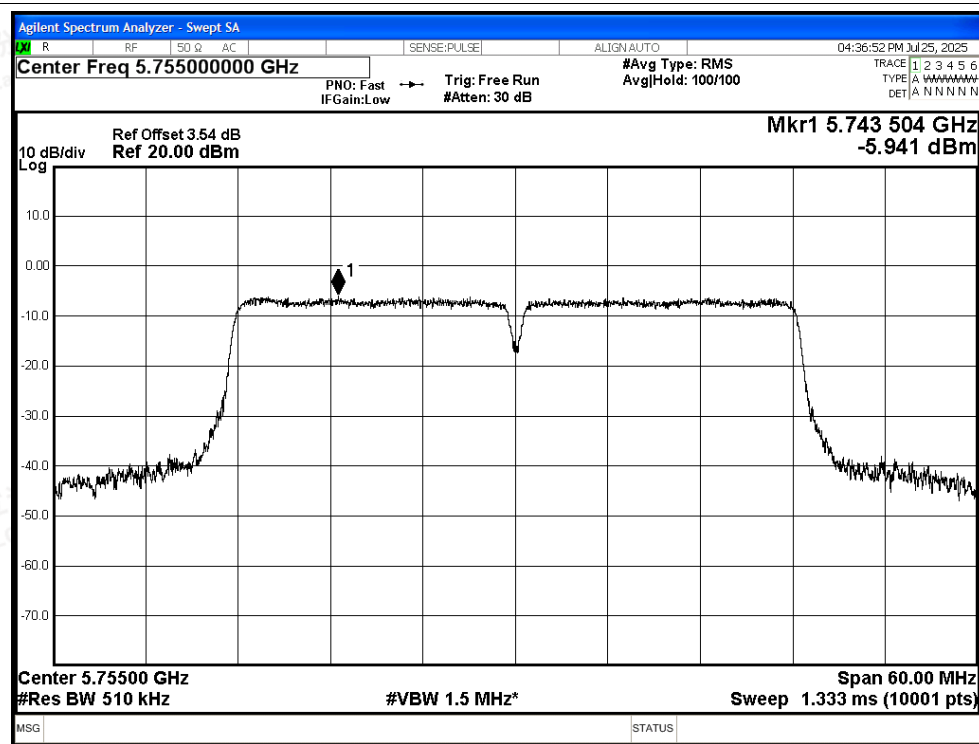

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5795MHz Ant3

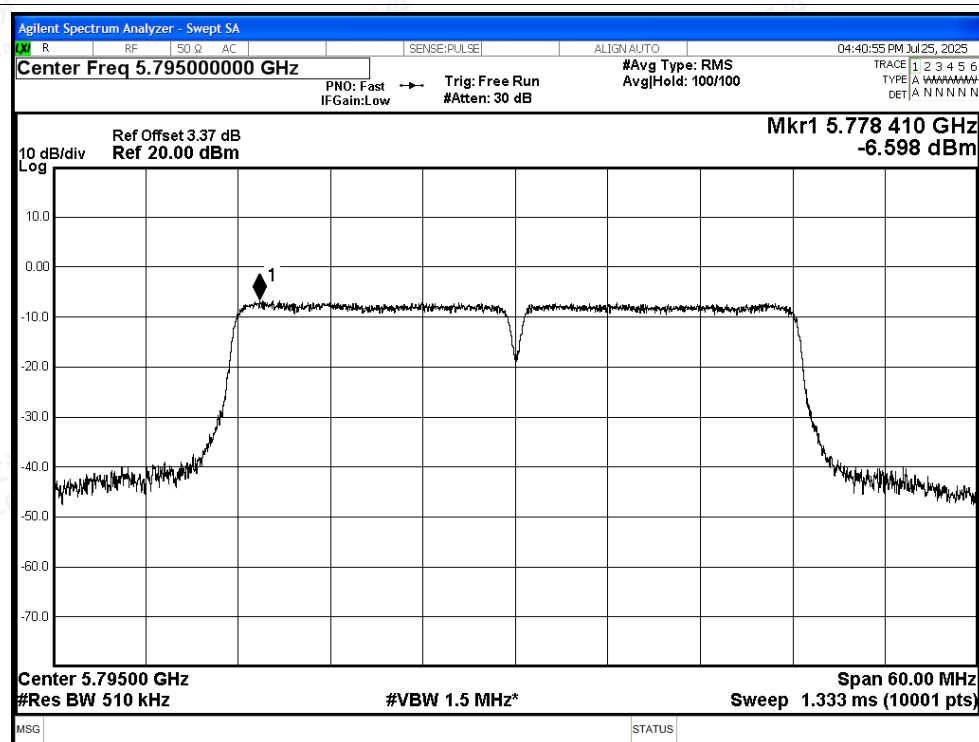

PSD NVNT ax80 5775MHz Ant3

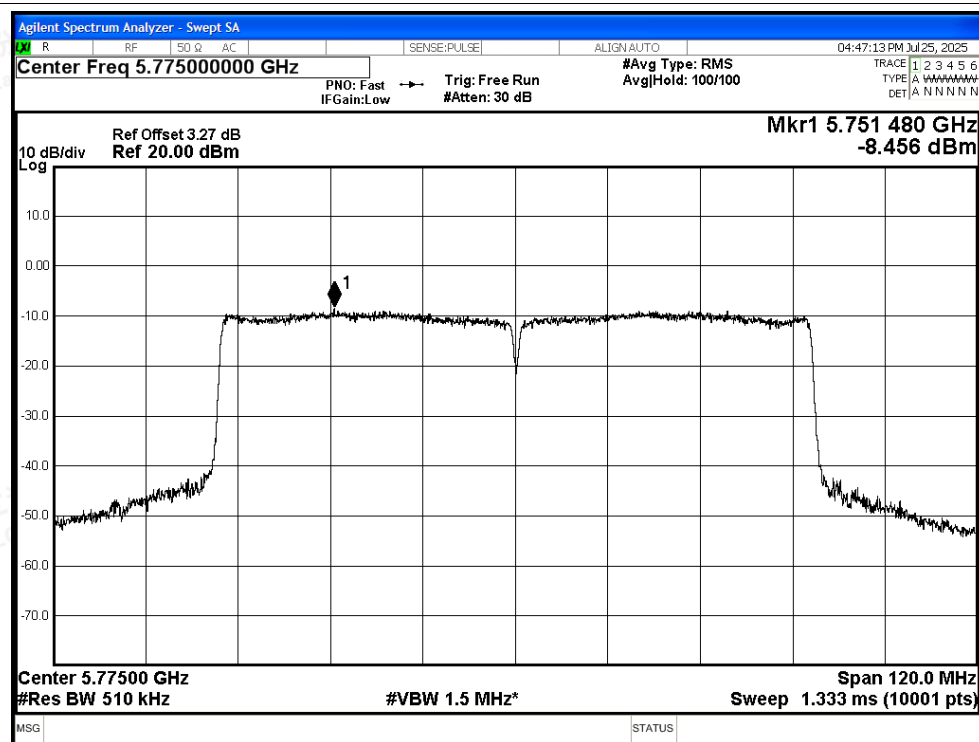

PSD NVNT be20 5745MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

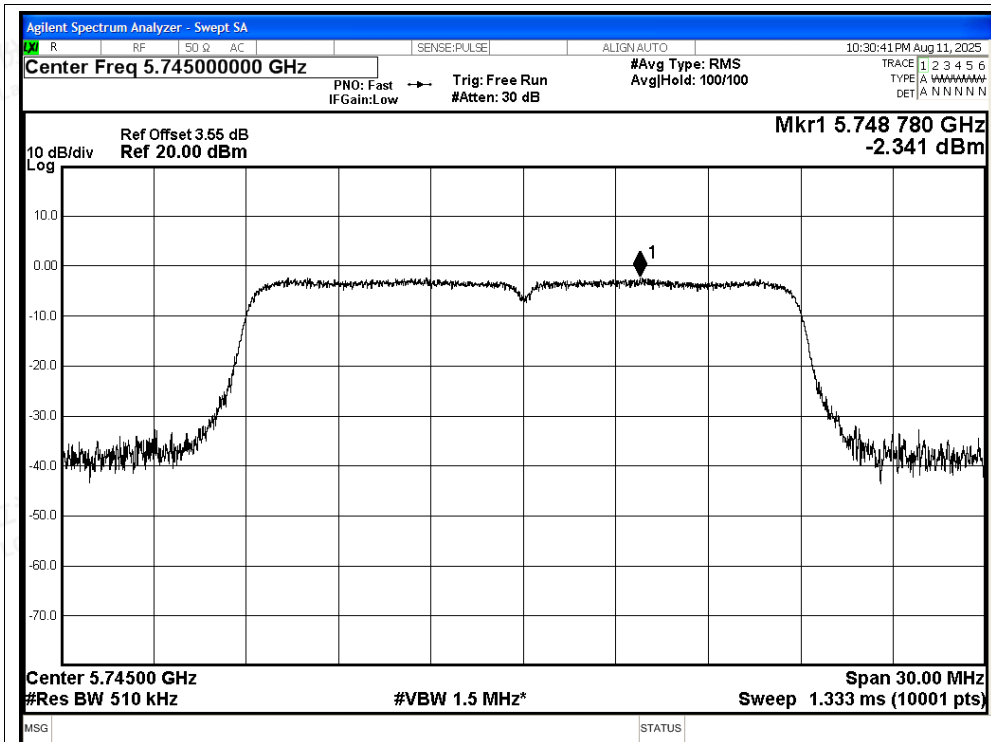

PSD NVNT be20 5785MHz Ant3

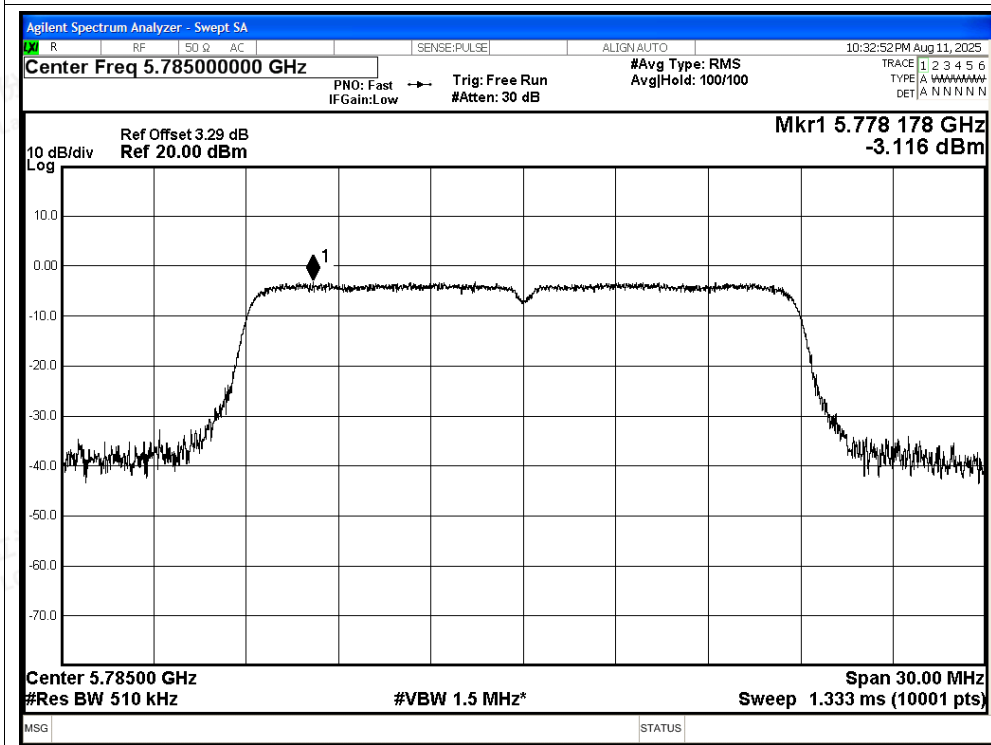

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be20 5825MHz Ant3

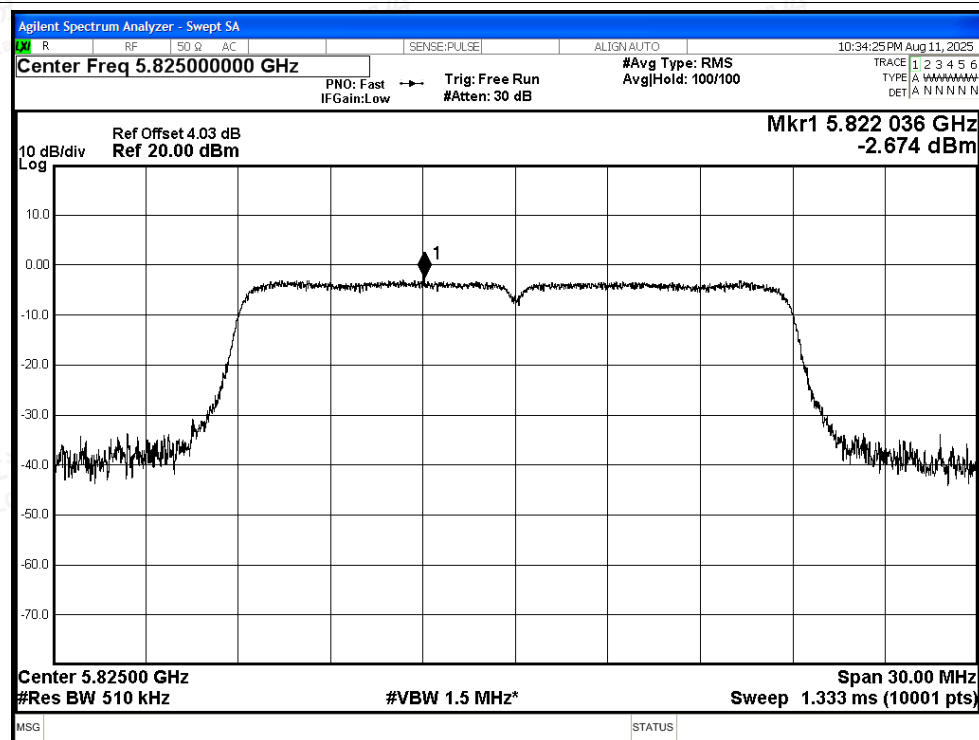

PSD NVNT be40 5755MHz Ant3

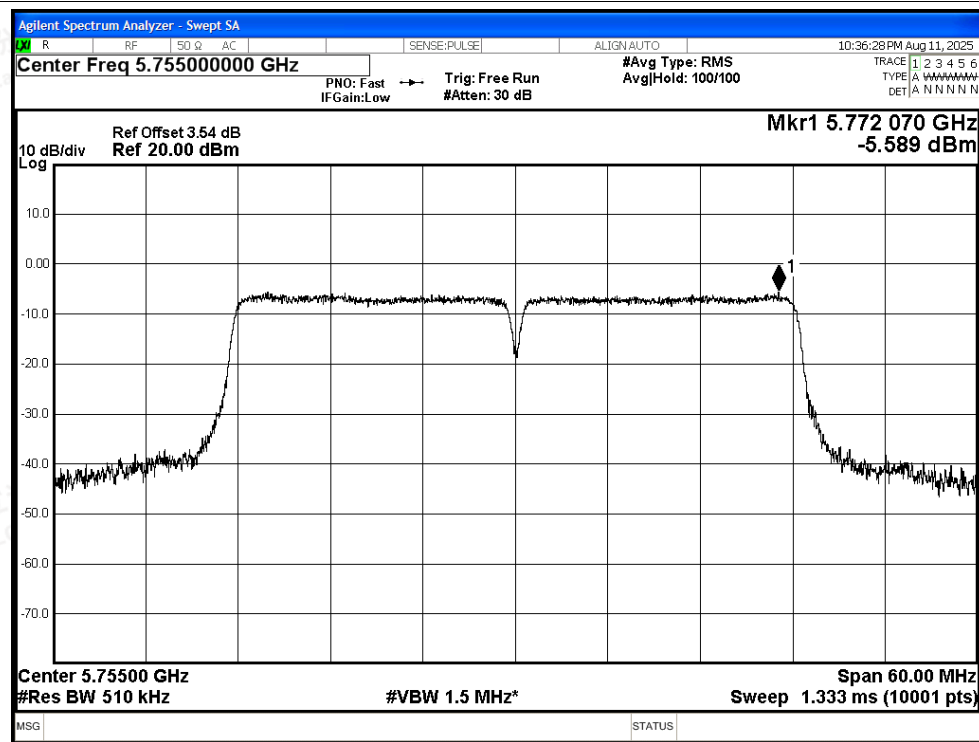

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT be40 5795MHz Ant3

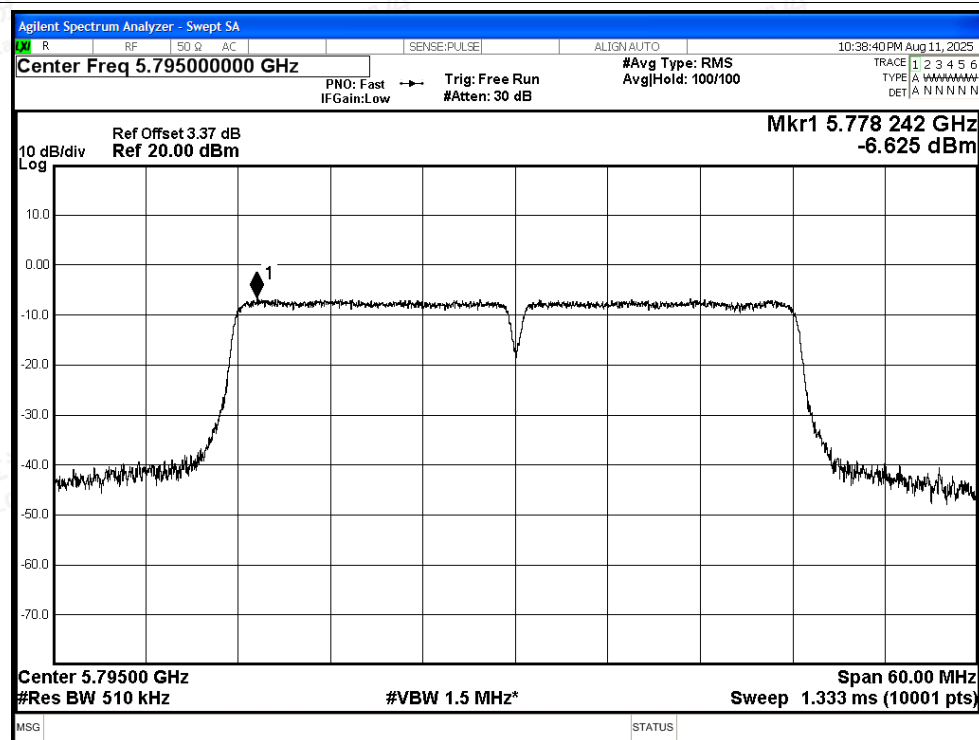

PSD NVNT be80 5775MHz Ant3

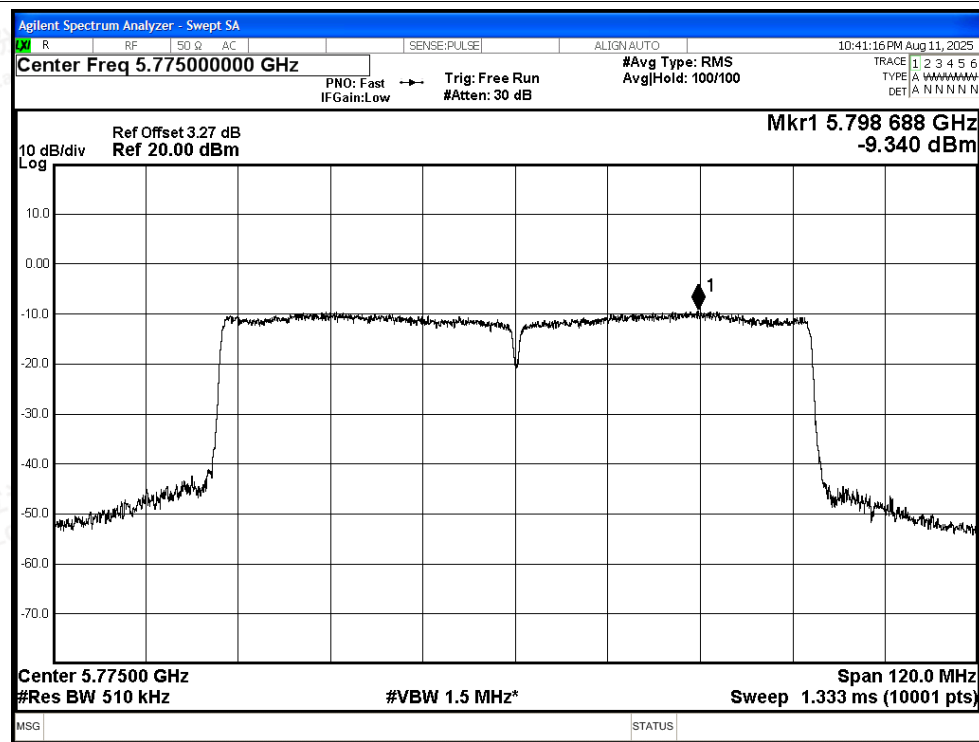

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	5650	-49.5	3.3	-	-46.20	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-57.26	3.3	0.24	-53.72	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-46.58	3.3	-	-43.28	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-54.28	3.3	0.24	-50.74	Average	10	Pass
NVNT	a	5745	Ant1	5720	-35.07	3.3	-	-31.77	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-47.62	3.3	0.24	-44.08	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-28.89	3.3	-	-25.59	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-40.26	3.3	0.24	-36.72	Average	27	Pass
NVNT	a	5825	Ant1	5850	-35.74	3.3	-	-32.44	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-49.35	3.3	0.24	-45.81	Average	27	Pass
NVNT	a	5825	Ant1	5855	-41.35	3.3	-	-38.05	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-53.28	3.3	0.24	-49.74	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-47.27	3.3	-	-43.97	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-55.4	3.3	0.24	-51.86	Average	10	Pass
NVNT	a	5825	Ant1	5925	-47.81	3.3	-	-44.51	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-55.66	3.3	0.24	-52.12	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-48.7	3.3	-	-45.40	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-56.7	3.3	0.12	-53.28	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-47.96	3.3	-	-44.66	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-55.46	3.3	0.12	-52.04	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-30.44	3.3	-	-27.14	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-44.64	3.3	0.12	-41.22	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-23.99	3.3	-	-20.69	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-38.69	3.3	0.12	-35.27	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-33.18	3.3	-	-29.88	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-45.55	3.3	0.12	-42.13	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-37.58	3.3	-	-34.28	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-51.16	3.3	0.12	-47.74	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-46.45	3.3	-	-43.15	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-54.93	3.3	0.12	-51.51	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-48.06	3.3	-	-44.76	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-55.99	3.3	0.12	-52.57	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-49.15	3.3	-	-45.85	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-57.25	3.3	0.24	-53.71	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-44.37	3.3	-	-41.07	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-53.86	3.3	0.24	-50.32	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-29.04	3.3	-	-25.74	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-46.5	3.3	0.24	-42.96	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant1	5725	-28.76	3.3	-	-25.46	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-42.13	3.3	0.24	-38.59	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-47.21	3.3	-	-43.91	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-55.51	3.3	0.23	-51.98	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-46.18	3.3	-	-42.88	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-55.95	3.3	0.23	-52.42	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-50.03	3.3	-	-46.73	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-57.11	3.3	0.23	-53.58	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-47.72	3.3	-	-44.42	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-57.1	3.3	0.23	-53.57	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-48.6	3.3	-	-45.30	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-57.28	3.3	0.12	-53.86	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-45.95	3.3	-	-42.65	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-54.75	3.3	0.12	-51.33	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-30.39	3.3	-	-27.09	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-44.66	3.3	0.12	-41.24	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-22.47	3.3	-	-19.17	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-41.12	3.3	0.12	-37.70	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-31.06	3.3	-	-27.76	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-45.72	3.3	0.12	-42.30	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-34.65	3.3	-	-31.35	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-50.08	3.3	0.12	-46.66	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-46.7	3.3	-	-43.40	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-54.74	3.3	0.12	-51.32	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-47.62	3.3	-	-44.32	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-55.59	3.3	0.12	-52.17	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-48.49	3.3	-	-45.19	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-57.15	3.3	0.24	-53.61	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-46.61	3.3	-	-43.31	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-54.92	3.3	0.24	-51.38	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-31.45	3.3	-	-28.15	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-45.47	3.3	0.24	-41.93	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-26.5	3.3	-	-23.20	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-43.03	3.3	0.24	-39.49	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-44.15	3.3	-	-40.85	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-55.4	3.3	0.23	-51.87	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-45.93	3.3	-	-42.63	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-55.9	3.3	0.23	-52.37	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-49.37	3.3	-	-46.07	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-56.79	3.3	0.23	-53.26	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-48.18	3.3	-	-44.88	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-57.95	3.3	0.23	-54.42	Average	-27	Pass
NVNT	ac80	5775	Ant1	5850	-37.68	3.3	-	-34.38	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant1	5850	-49.04	3.3	0.47	-45.27	Average	27	Pass
NVNT	ac80	5775	Ant1	5855	-38.78	3.3	-	-35.48	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5855	-49.28	3.3	0.47	-45.51	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5875	-45.51	3.3	-	-42.21	Peak	10	Pass
NVNT	ac80	5775	Ant1	5875	-54	3.3	0.47	-50.23	Average	10	Pass
NVNT	ac80	5775	Ant1	5925	-48.35	3.3	-	-45.05	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5925	-56.95	3.3	0.47	-53.18	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-47.96	3.3	-	-44.66	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-55.59	3.3	0.47	-51.82	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-39.37	3.3	-	-36.07	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-50.59	3.3	0.47	-46.82	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-35.78	3.3	-	-32.48	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-47.64	3.3	0.47	-43.87	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-31.05	3.3	-	-27.75	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-45.68	3.3	0.47	-41.91	Average	27	Pass
NVNT	ax20	5745	Ant1	5650	-48.58	3.3	-	-45.28	Peak	-27	Pass
NVNT	ax20	5745	Ant1	5650	-56.58	3.3	0.12	-53.16	Average	-27	Pass
NVNT	ax20	5745	Ant1	5700	-47.52	3.3	-	-44.22	Peak	10	Pass
NVNT	ax20	5745	Ant1	5700	-55.04	3.3	0.12	-51.62	Average	10	Pass
NVNT	ax20	5745	Ant1	5720	-27.74	3.3	-	-24.44	Peak	15.6	Pass
NVNT	ax20	5745	Ant1	5720	-45.09	3.3	0.12	-41.67	Average	15.6	Pass
NVNT	ax20	5745	Ant1	5725	-26.91	3.3	-	-23.61	Peak	27	Pass
NVNT	ax20	5745	Ant1	5725	-40.02	3.3	0.12	-36.60	Average	27	Pass
NVNT	ax20	5825	Ant1	5850	-29.51	3.3	-	-26.21	Peak	27	Pass
NVNT	ax20	5825	Ant1	5850	-45.12	3.3	0.12	-41.70	Average	27	Pass
NVNT	ax20	5825	Ant1	5855	-37.19	3.3	-	-33.89	Peak	15.6	Pass
NVNT	ax20	5825	Ant1	5855	-49.91	3.3	0.12	-46.49	Average	15.6	Pass
NVNT	ax20	5825	Ant1	5875	-47.51	3.3	-	-44.21	Peak	10	Pass
NVNT	ax20	5825	Ant1	5875	-55.53	3.3	0.12	-52.11	Average	10	Pass
NVNT	ax20	5825	Ant1	5925	-47.69	3.3	-	-44.39	Peak	-27	Pass
NVNT	ax20	5825	Ant1	5925	-55.78	3.3	0.12	-52.36	Average	-27	Pass
NVNT	ax40	5755	Ant1	5650	-48.44	3.3	-	-45.14	Peak	-27	Pass
NVNT	ax40	5755	Ant1	5650	-56.57	3.3	0.23	-53.04	Average	-27	Pass
NVNT	ax40	5755	Ant1	5700	-47.91	3.3	-	-44.61	Peak	10	Pass
NVNT	ax40	5755	Ant1	5700	-54.73	3.3	0.23	-51.20	Average	10	Pass
NVNT	ax40	5755	Ant1	5720	-30.82	3.3	-	-27.52	Peak	15.6	Pass
NVNT	ax40	5755	Ant1	5720	-44.59	3.3	0.23	-41.06	Average	15.6	Pass
NVNT	ax40	5755	Ant1	5725	-24.78	3.3	-	-21.48	Peak	27	Pass
NVNT	ax40	5755	Ant1	5725	-42.23	3.3	0.23	-38.70	Average	27	Pass
NVNT	ax40	5795	Ant1	5850	-47.72	3.3	-	-44.42	Peak	27	Pass
NVNT	ax40	5795	Ant1	5850	-55.41	3.3	0.23	-51.88	Average	27	Pass
NVNT	ax40	5795	Ant1	5855	-47.25	3.3	-	-43.95	Peak	15.6	Pass
NVNT	ax40	5795	Ant1	5855	-56.07	3.3	0.23	-52.54	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant1	5875	-48.3	3.3	-	-45.00	Peak	10	Pass
NVNT	ax40	5795	Ant1	5875	-56.93	3.3	0.23	-53.40	Average	10	Pass
NVNT	ax40	5795	Ant1	5925	-49.43	3.3	-	-46.13	Peak	-27	Pass
NVNT	ax40	5795	Ant1	5925	-57	3.3	0.23	-53.47	Average	-27	Pass
NVNT	ax80	5775	Ant1	5850	-36.88	3.3	-	-33.58	Peak	27	Pass
NVNT	ax80	5775	Ant1	5850	-49.56	3.3	0.47	-45.79	Average	27	Pass
NVNT	ax80	5775	Ant1	5855	-40.31	3.3	-	-37.01	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5855	-49.3	3.3	0.47	-45.53	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5875	-43.8	3.3	-	-40.50	Peak	10	Pass
NVNT	ax80	5775	Ant1	5875	-54.19	3.3	0.47	-50.42	Average	10	Pass
NVNT	ax80	5775	Ant1	5925	-49.22	3.3	-	-45.92	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5925	-56.5	3.3	0.47	-52.73	Average	-27	Pass
NVNT	ax80	5775	Ant1	5650	-47.32	3.3	-	-44.02	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5650	-55.77	3.3	0.47	-52.00	Average	-27	Pass
NVNT	ax80	5775	Ant1	5700	-42.19	3.3	-	-38.89	Peak	10	Pass
NVNT	ax80	5775	Ant1	5700	-50.86	3.3	0.47	-47.09	Average	10	Pass
NVNT	ax80	5775	Ant1	5720	-34.56	3.3	-	-31.26	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5720	-46.93	3.3	0.47	-43.16	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5725	-32.01	3.3	-	-28.71	Peak	27	Pass
NVNT	ax80	5775	Ant1	5725	-43.69	3.3	0.47	-39.92	Average	27	Pass
NVNT	be20	5745	Ant1	5650	-48.45	3.3	-	-45.15	Peak	-27	Pass
NVNT	be20	5745	Ant1	5650	-56.83	3.3	0.12	-53.41	Average	-27	Pass
NVNT	be20	5745	Ant1	5700	-46.2	3.3	-	-42.90	Peak	10	Pass
NVNT	be20	5745	Ant1	5700	-55.17	3.3	0.12	-51.75	Average	10	Pass
NVNT	be20	5745	Ant1	5720	-32.17	3.3	-	-28.87	Peak	15.6	Pass
NVNT	be20	5745	Ant1	5720	-45.86	3.3	0.12	-42.44	Average	15.6	Pass
NVNT	be20	5745	Ant1	5725	-24.62	3.3	-	-21.32	Peak	27	Pass
NVNT	be20	5745	Ant1	5725	-40.14	3.3	0.12	-36.72	Average	27	Pass
NVNT	be20	5825	Ant1	5850	-29.68	3.3	-	-26.38	Peak	27	Pass
NVNT	be20	5825	Ant1	5850	-46.06	3.3	0.12	-42.64	Average	27	Pass
NVNT	be20	5825	Ant1	5855	-34.9	3.3	-	-31.60	Peak	15.6	Pass
NVNT	be20	5825	Ant1	5855	-48.95	3.3	0.12	-45.53	Average	15.6	Pass
NVNT	be20	5825	Ant1	5875	-44.46	3.3	-	-41.16	Peak	10	Pass
NVNT	be20	5825	Ant1	5875	-55.45	3.3	0.12	-52.03	Average	10	Pass
NVNT	be20	5825	Ant1	5925	-47.99	3.3	-	-44.69	Peak	-27	Pass
NVNT	be20	5825	Ant1	5925	-55.64	3.3	0.12	-52.22	Average	-27	Pass
NVNT	be40	5755	Ant1	5650	-48.69	3.3	-	-45.39	Peak	-27	Pass
NVNT	be40	5755	Ant1	5650	-56.72	3.3	0.24	-53.18	Average	-27	Pass
NVNT	be40	5755	Ant1	5700	-45.37	3.3	-	-42.07	Peak	10	Pass
NVNT	be40	5755	Ant1	5700	-54.03	3.3	0.24	-50.49	Average	10	Pass
NVNT	be40	5755	Ant1	5720	-29.73	3.3	-	-26.43	Peak	15.6	Pass
NVNT	be40	5755	Ant1	5720	-43.73	3.3	0.24	-40.19	Average	15.6	Pass
NVNT	be40	5755	Ant1	5725	-25.41	3.3	-	-22.11	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5755	Ant1	5725	-41.03	3.3	0.24	-37.49	Average	27	Pass
NVNT	be40	5795	Ant1	5850	-47.36	3.3	-	-44.06	Peak	27	Pass
NVNT	be40	5795	Ant1	5850	-55.77	3.3	0.24	-52.23	Average	27	Pass
NVNT	be40	5795	Ant1	5855	-49.56	3.3	-	-46.26	Peak	15.6	Pass
NVNT	be40	5795	Ant1	5855	-56.51	3.3	0.24	-52.97	Average	15.6	Pass
NVNT	be40	5795	Ant1	5875	-49.4	3.3	-	-46.10	Peak	10	Pass
NVNT	be40	5795	Ant1	5875	-57.28	3.3	0.24	-53.74	Average	10	Pass
NVNT	be40	5795	Ant1	5925	-49.26	3.3	-	-45.96	Peak	-27	Pass
NVNT	be40	5795	Ant1	5925	-57	3.3	0.24	-53.46	Average	-27	Pass
NVNT	be80	5775	Ant1	5850	-42.42	3.3	-	-39.12	Peak	27	Pass
NVNT	be80	5775	Ant1	5850	-51.02	3.3	0.47	-47.25	Average	27	Pass
NVNT	be80	5775	Ant1	5855	-41.24	3.3	-	-37.94	Peak	15.6	Pass
NVNT	be80	5775	Ant1	5855	-51.14	3.3	0.47	-47.37	Average	15.6	Pass
NVNT	be80	5775	Ant1	5875	-45.97	3.3	-	-42.67	Peak	10	Pass
NVNT	be80	5775	Ant1	5875	-54.42	3.3	0.47	-50.65	Average	10	Pass
NVNT	be80	5775	Ant1	5925	-48.4	3.3	-	-45.10	Peak	-27	Pass
NVNT	be80	5775	Ant1	5925	-56.89	3.3	0.47	-53.12	Average	-27	Pass
NVNT	be80	5775	Ant1	5650	-48.72	3.3	-	-45.42	Peak	-27	Pass
NVNT	be80	5775	Ant1	5650	-56.83	3.3	0.47	-53.06	Average	-27	Pass
NVNT	be80	5775	Ant1	5700	-42.22	3.3	-	-38.92	Peak	10	Pass
NVNT	be80	5775	Ant1	5700	-52.07	3.3	0.47	-48.30	Average	10	Pass
NVNT	be80	5775	Ant1	5720	-34.65	3.3	-	-31.35	Peak	15.6	Pass
NVNT	be80	5775	Ant1	5720	-48.83	3.3	0.47	-45.06	Average	15.6	Pass
NVNT	be80	5775	Ant1	5725	-31.03	3.3	-	-27.73	Peak	27	Pass
NVNT	be80	5775	Ant1	5725	-44.35	3.3	0.47	-40.58	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant1 Peak

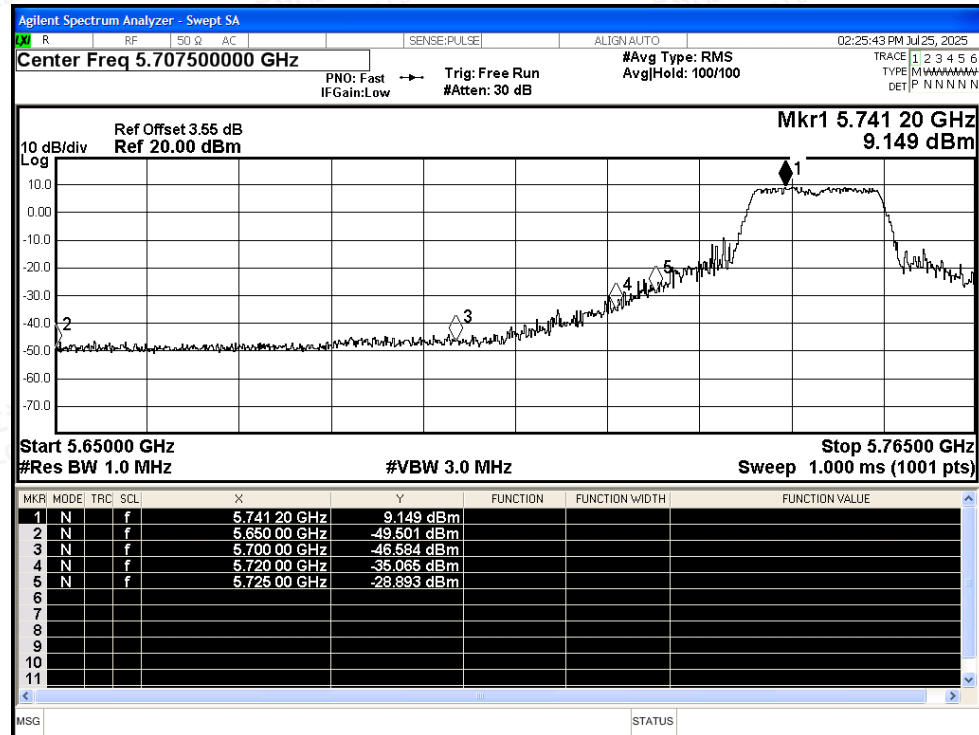

Restrict Band NVNT a 5745MHz Ant1 Average

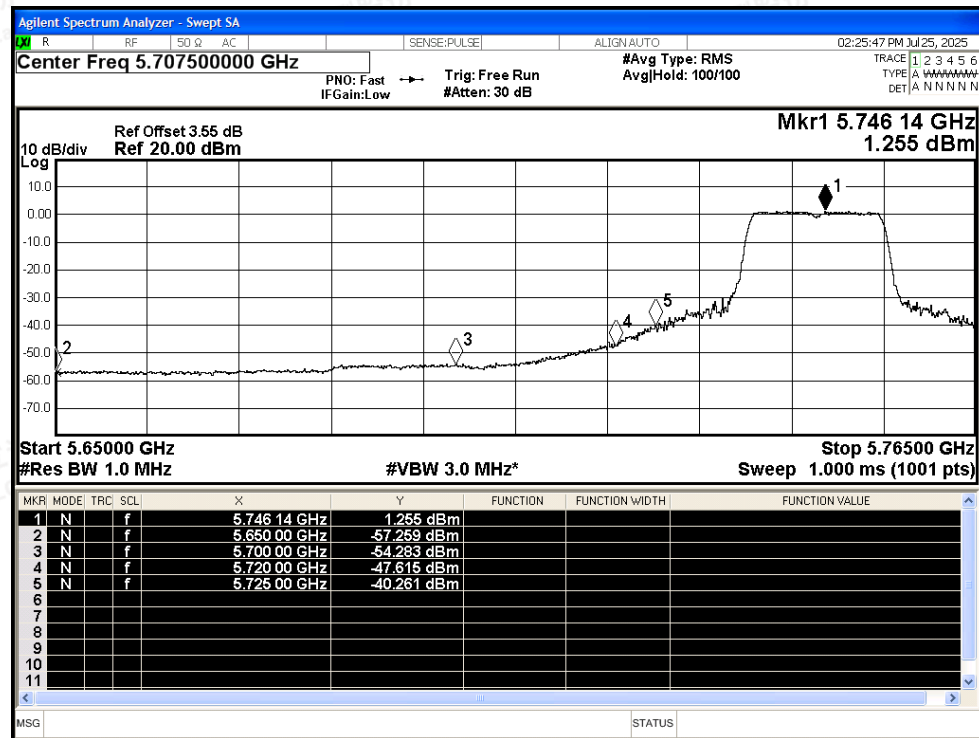

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant1 Peak

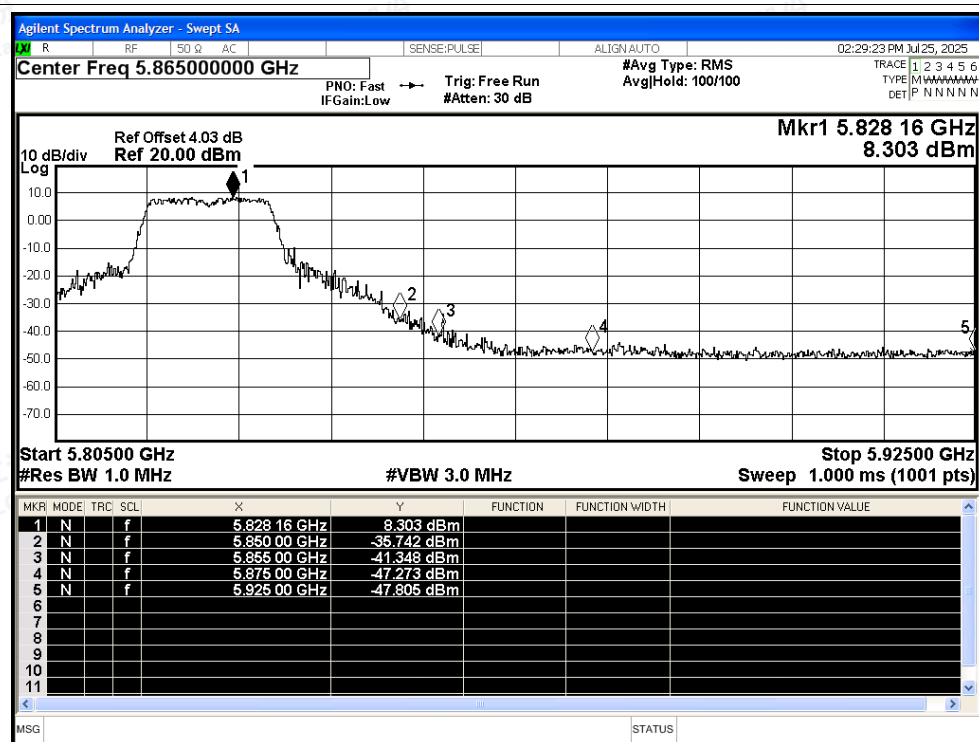

Restrict Band NVNT a 5825MHz Ant1 Average

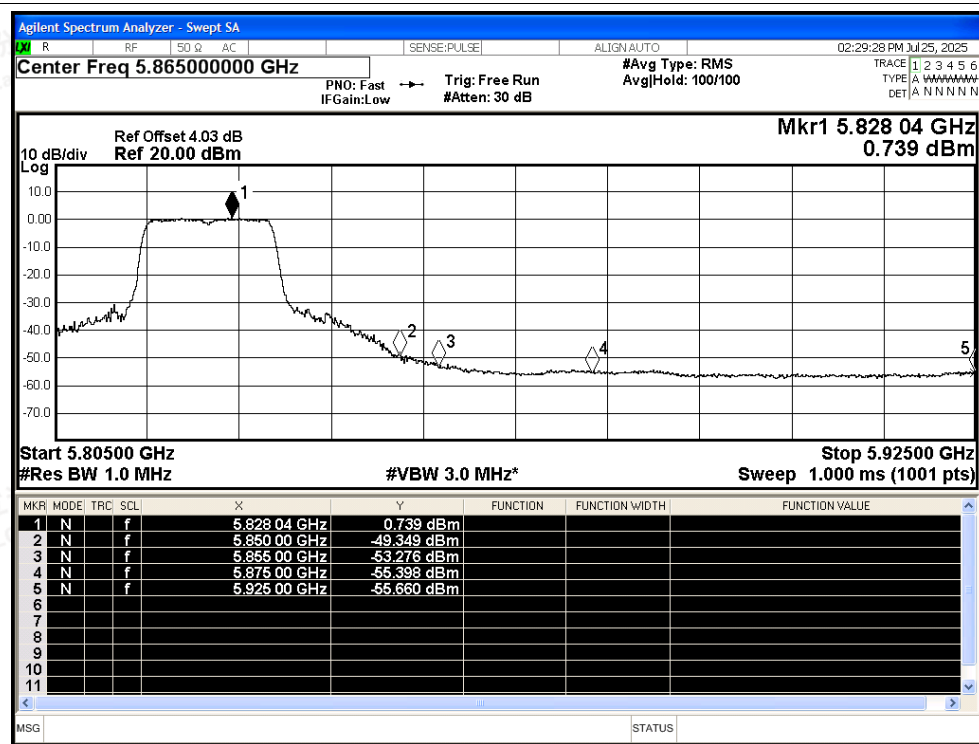

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant1 Peak

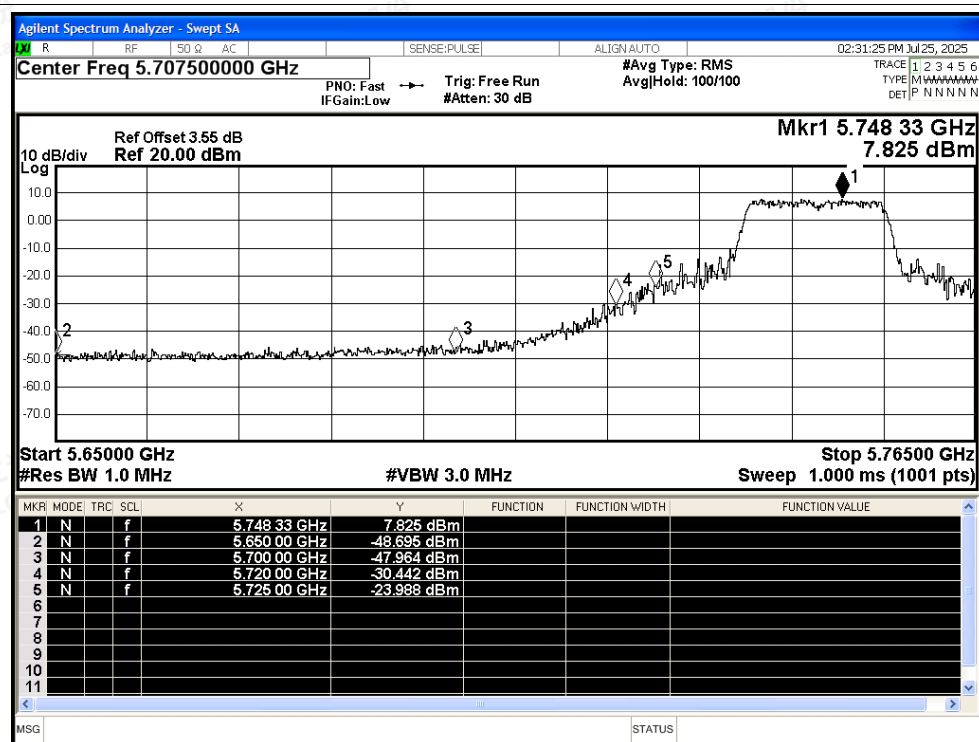

Restrict Band NVNT n20 5745MHz Ant1 Average

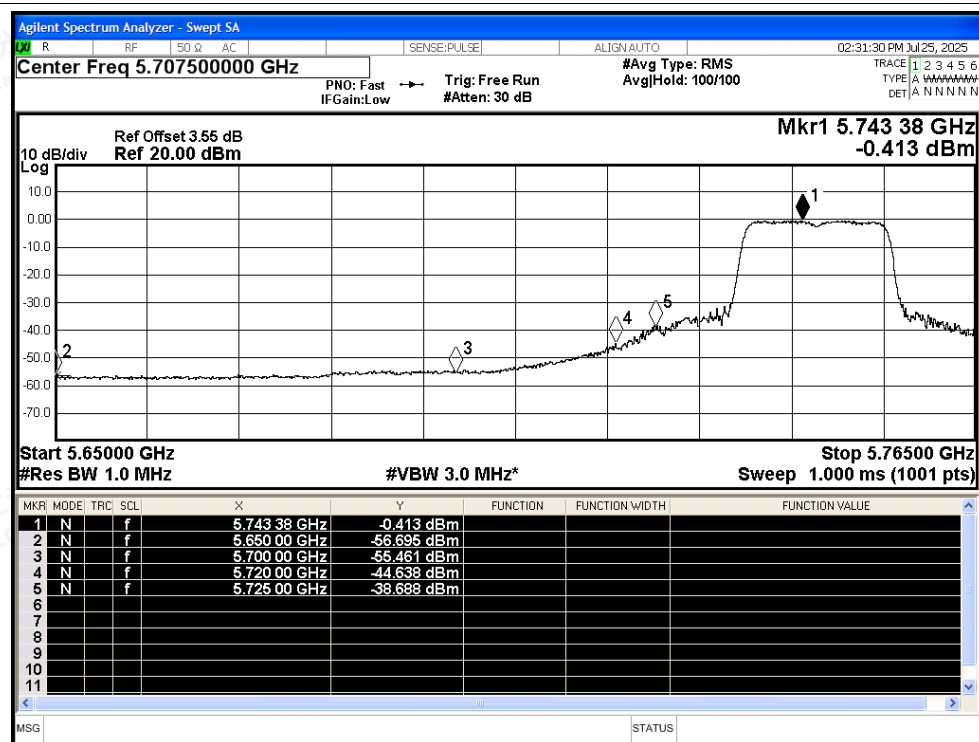

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant1 Peak

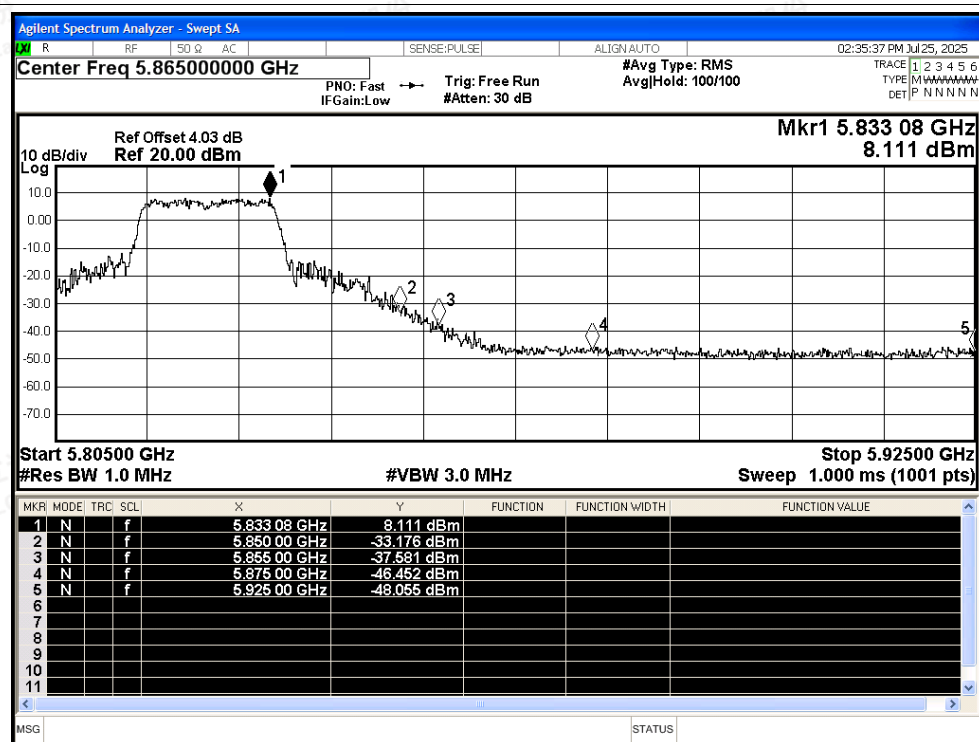

Restrict Band NVNT n20 5825MHz Ant1 Average

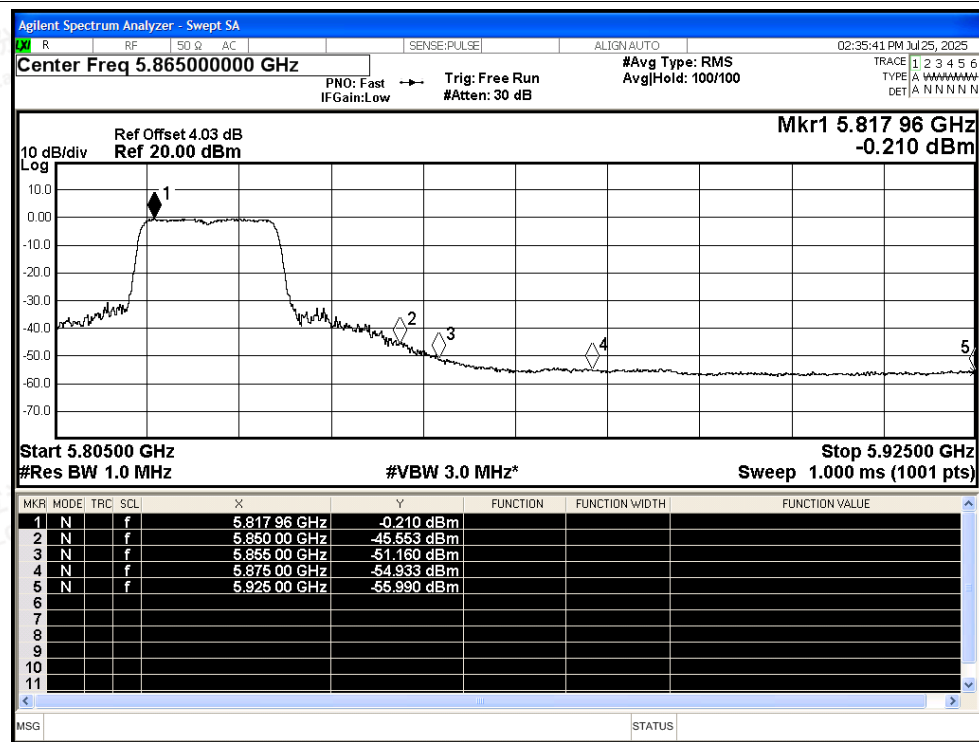

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant1 Peak

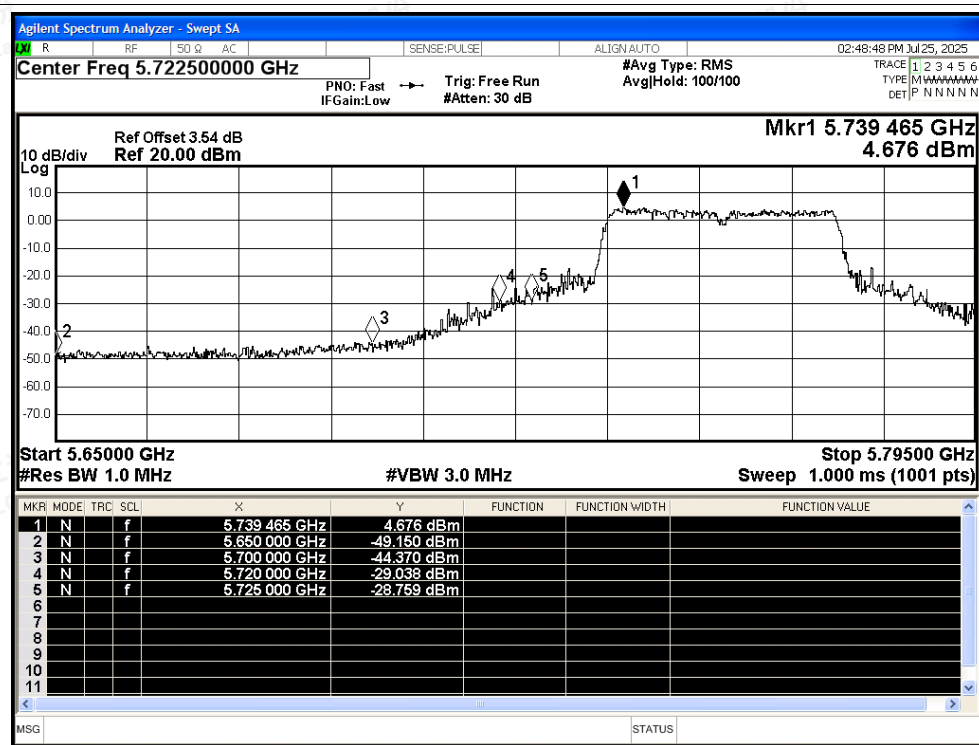

Restrict Band NVNT n40 5755MHz Ant1 Average



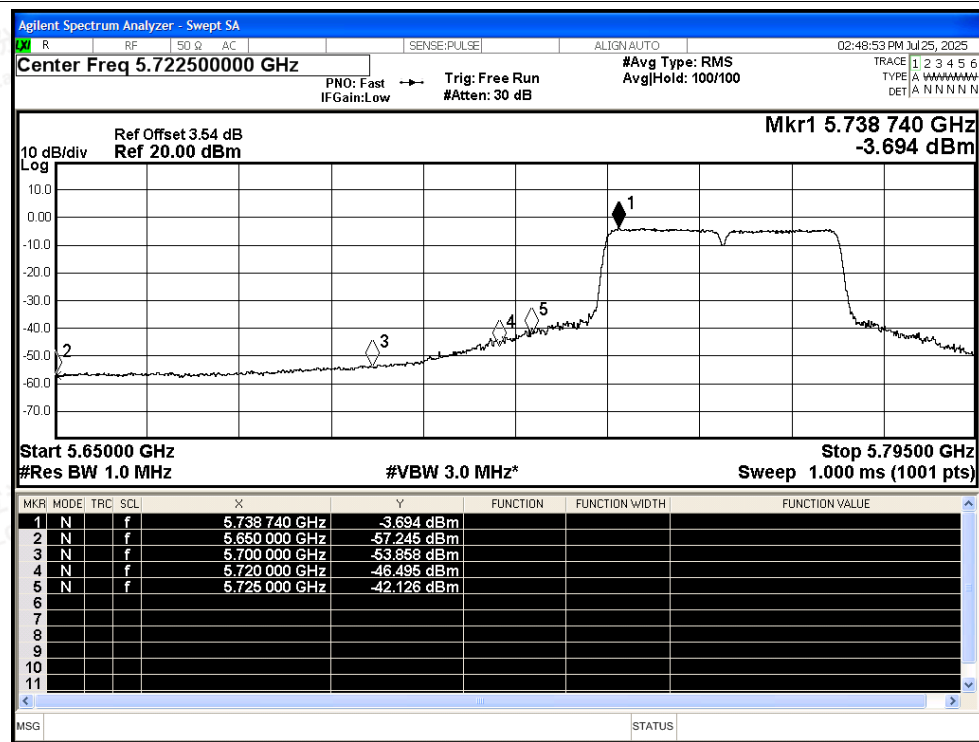


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

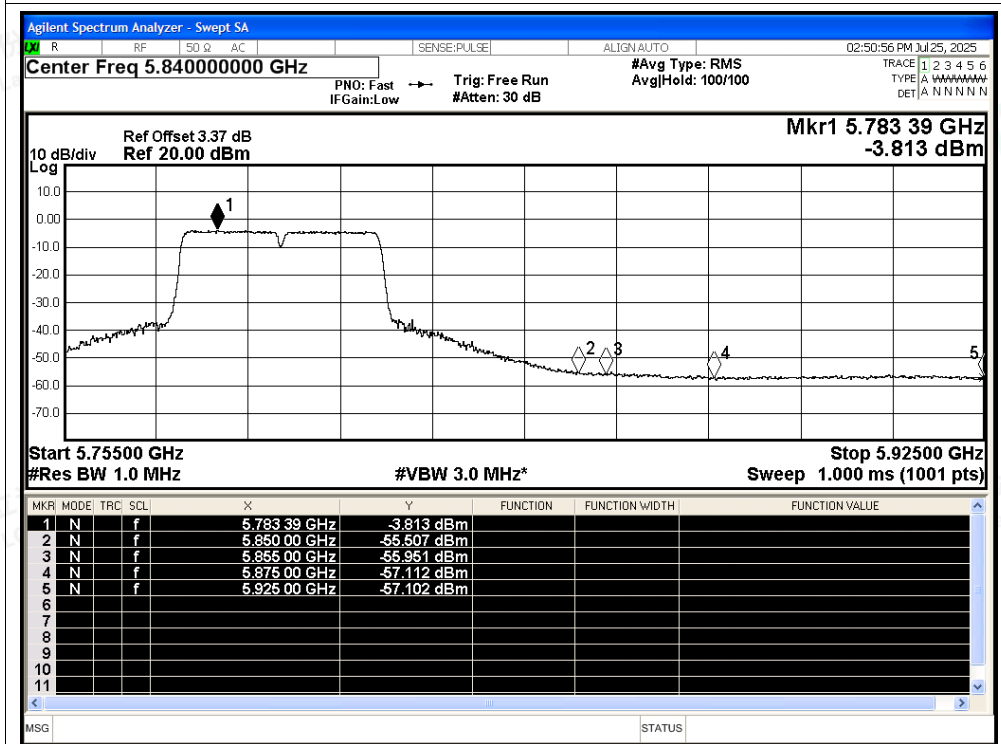




Restrict Band NVNT ac20 5825MHz Ant1 Peak

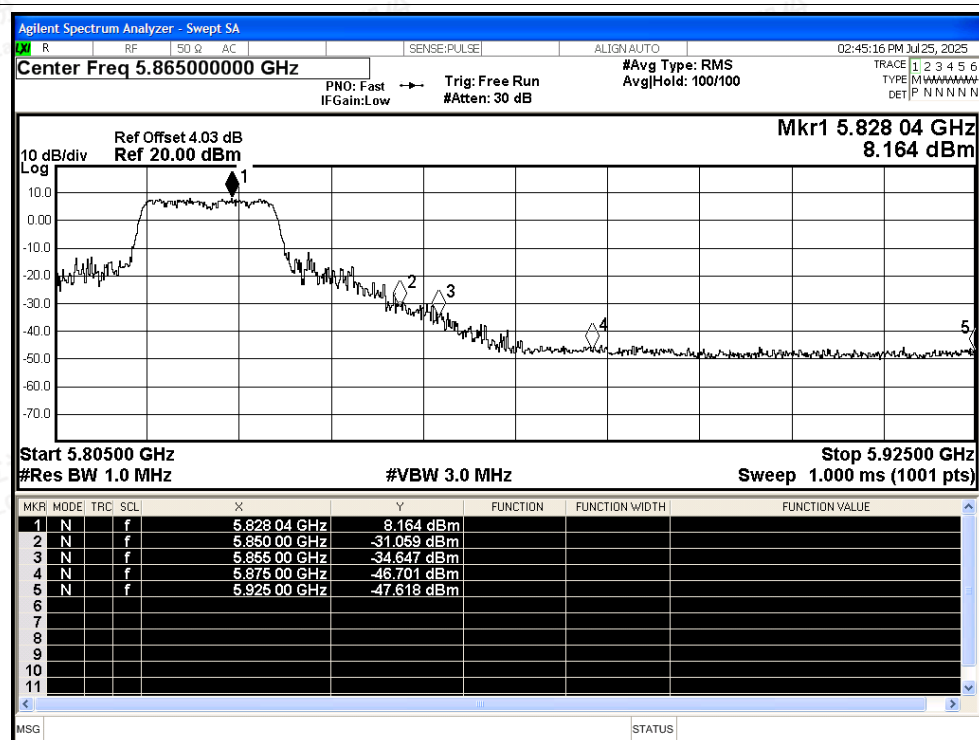

Restrict Band NVNT ac20 5825MHz Ant1 Average

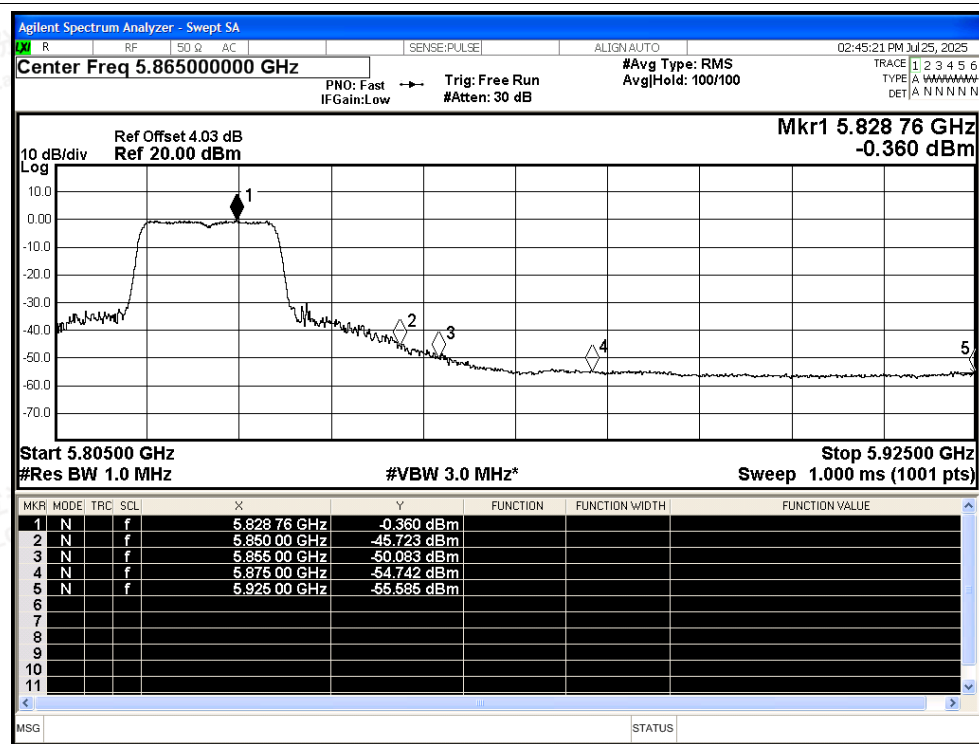

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant1 Peak

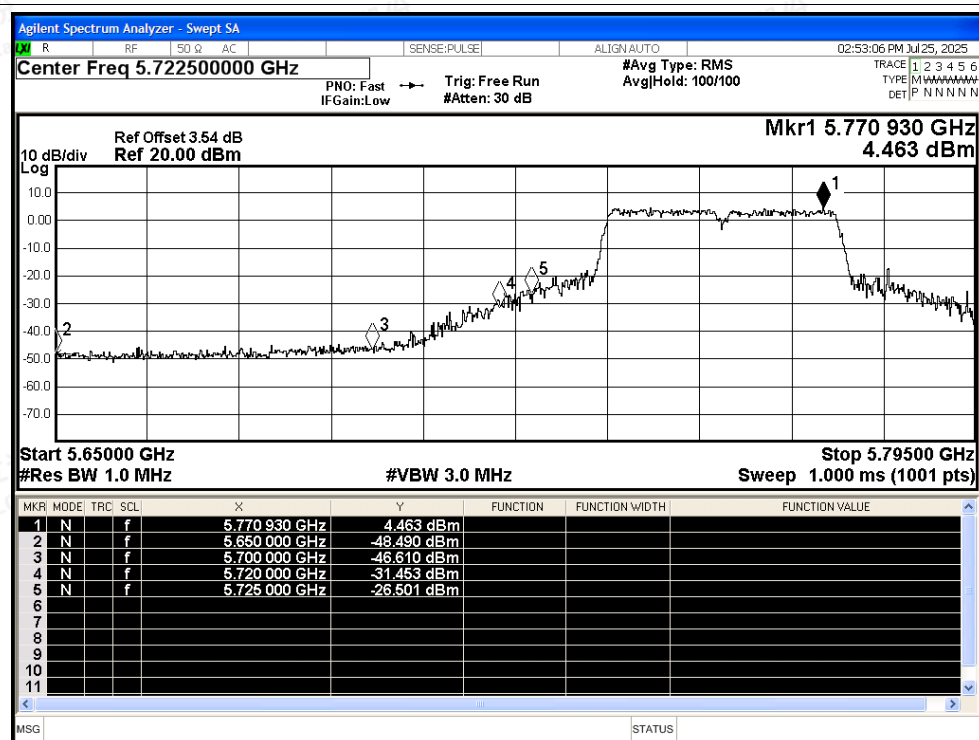

Restrict Band NVNT ac40 5755MHz Ant1 Average



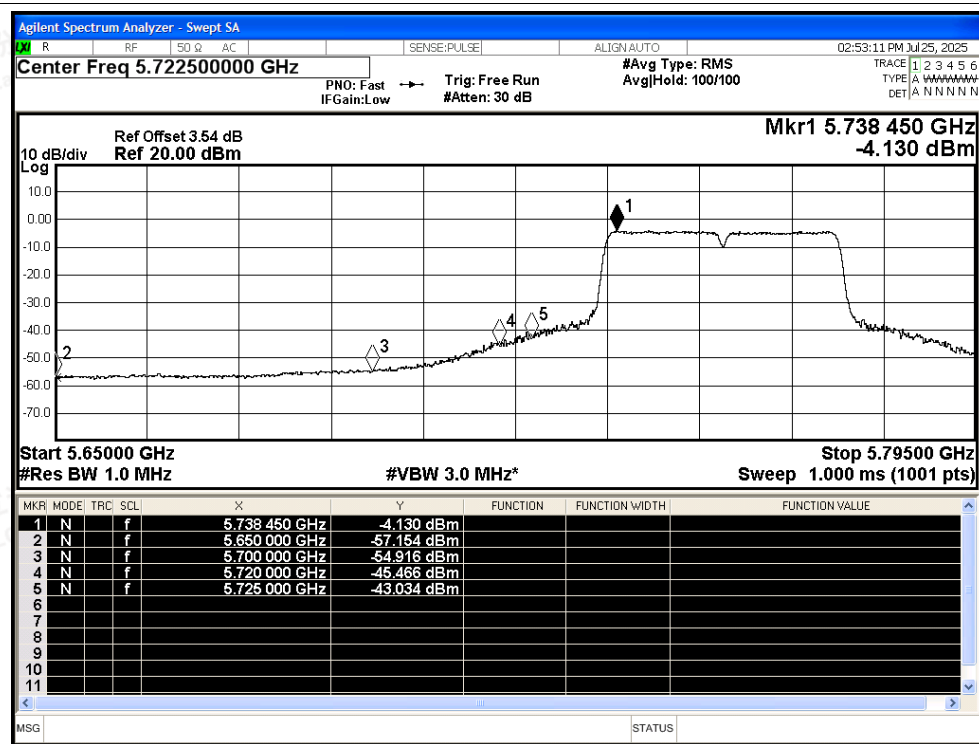


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

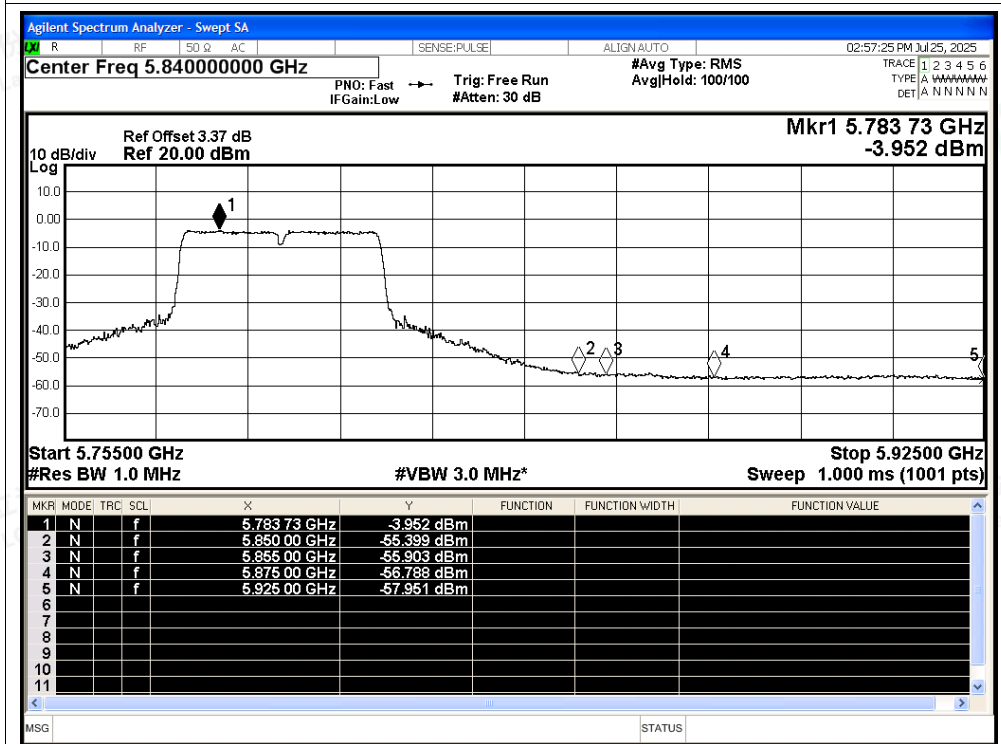




Restrict Band NVNT ac80 5775MHz Ant1 Peak

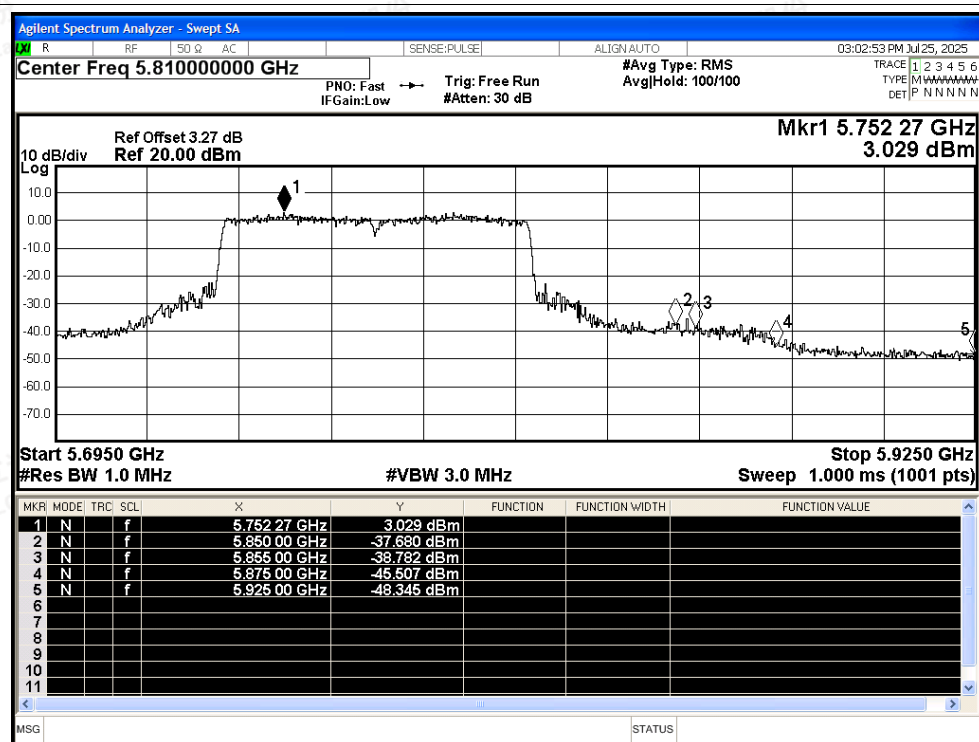

Restrict Band NVNT ac80 5775MHz Ant1 Average

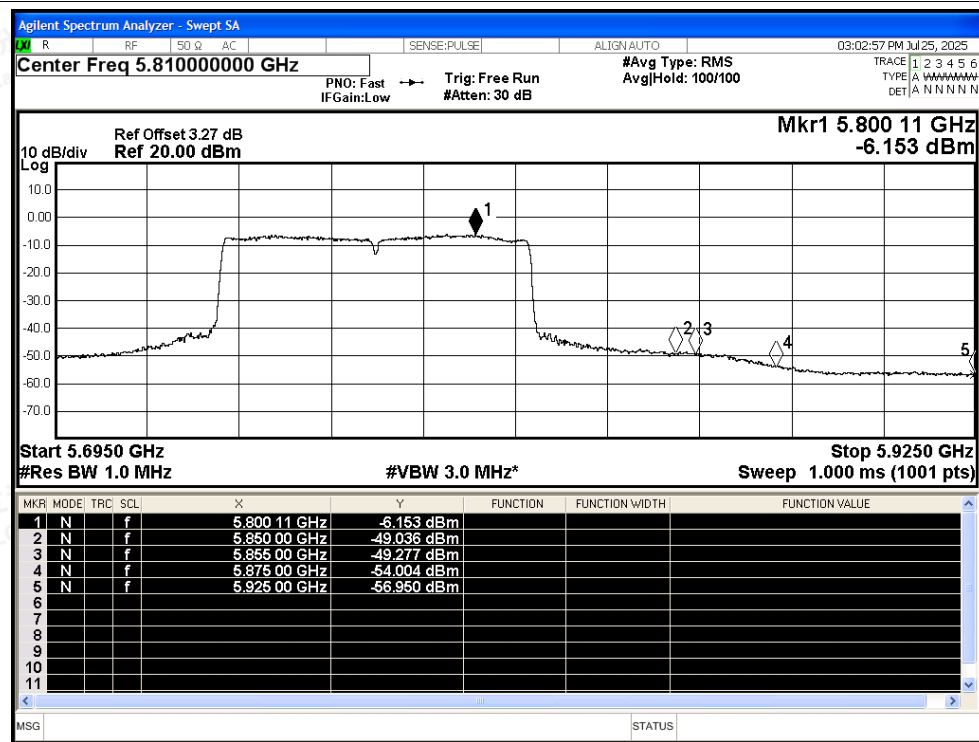

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant1 Peak

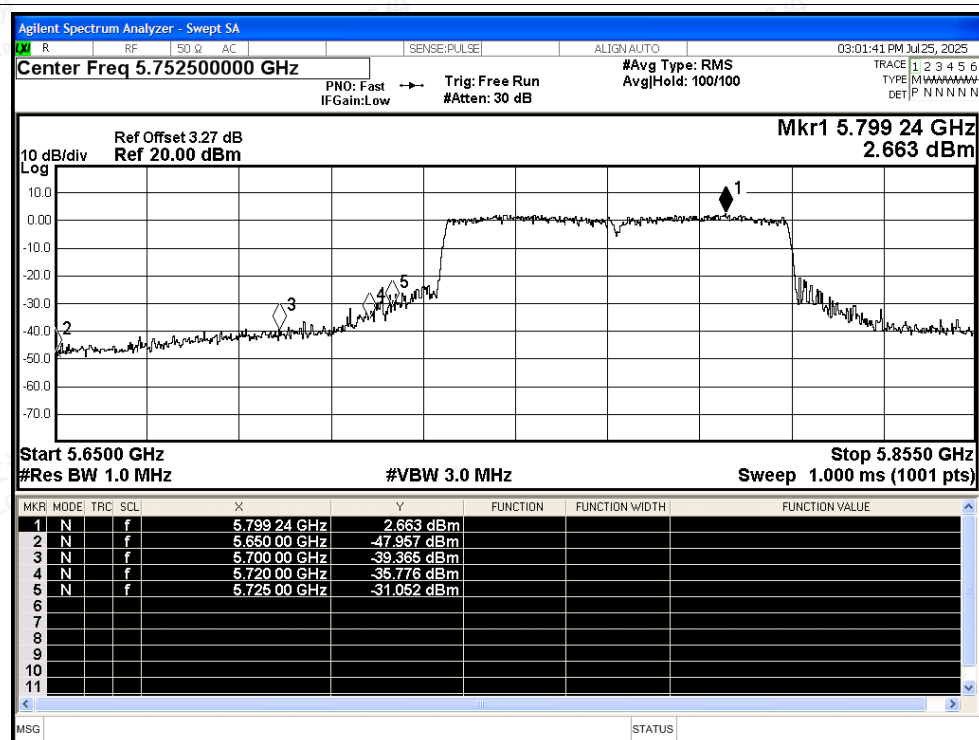

Restrict Band NVNT ac80 5775MHz Ant1 Average

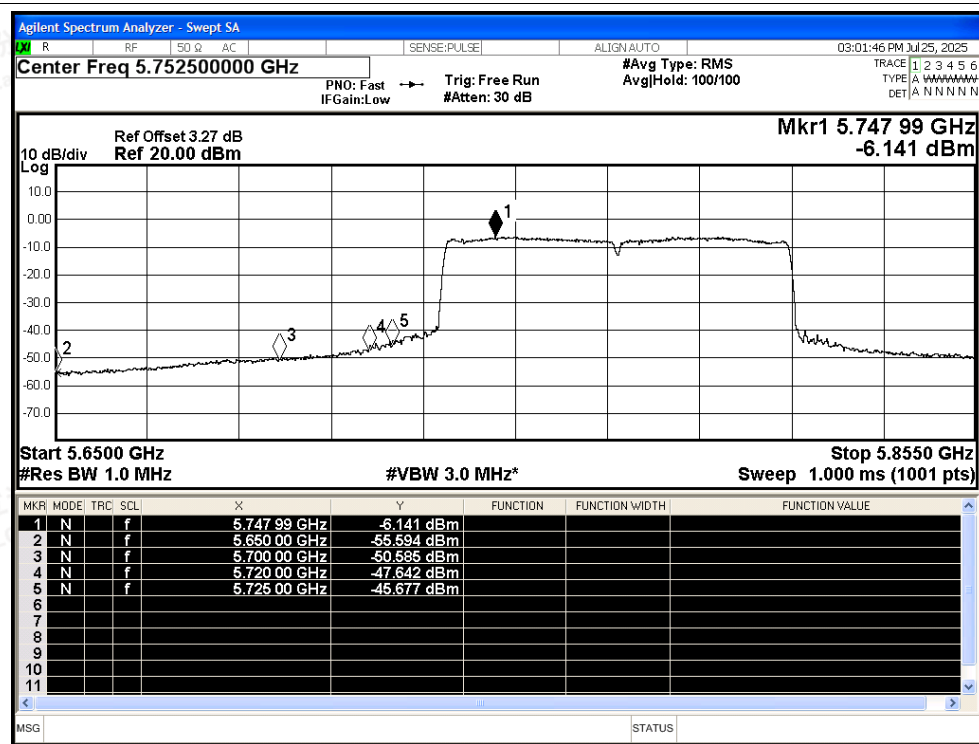

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant1 Peak

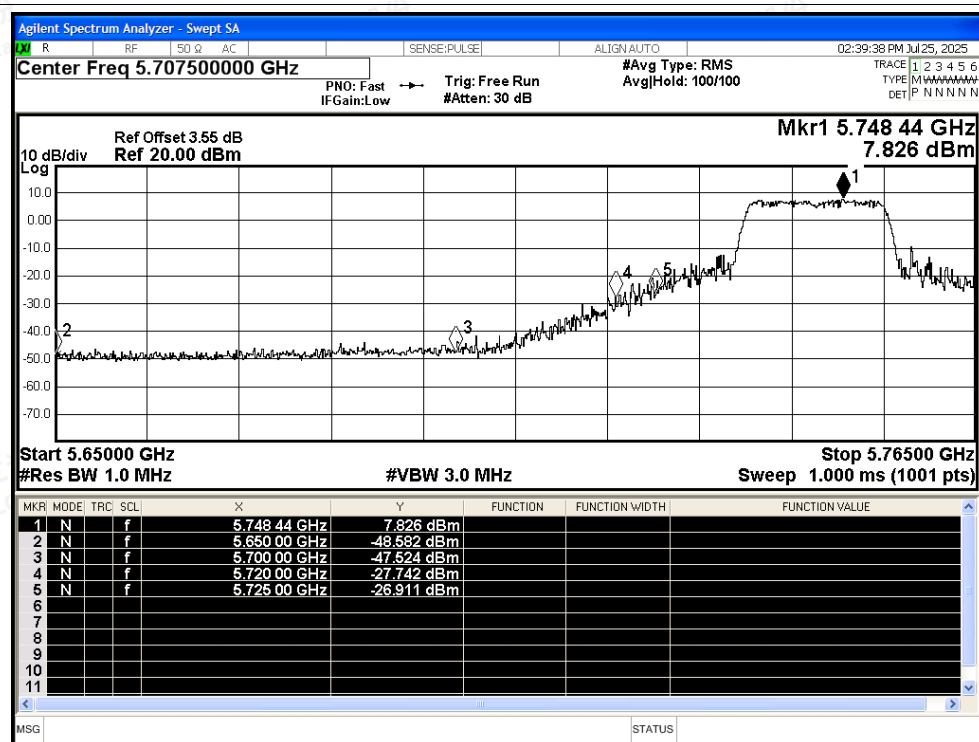

Restrict Band NVNT ax20 5745MHz Ant1 Average

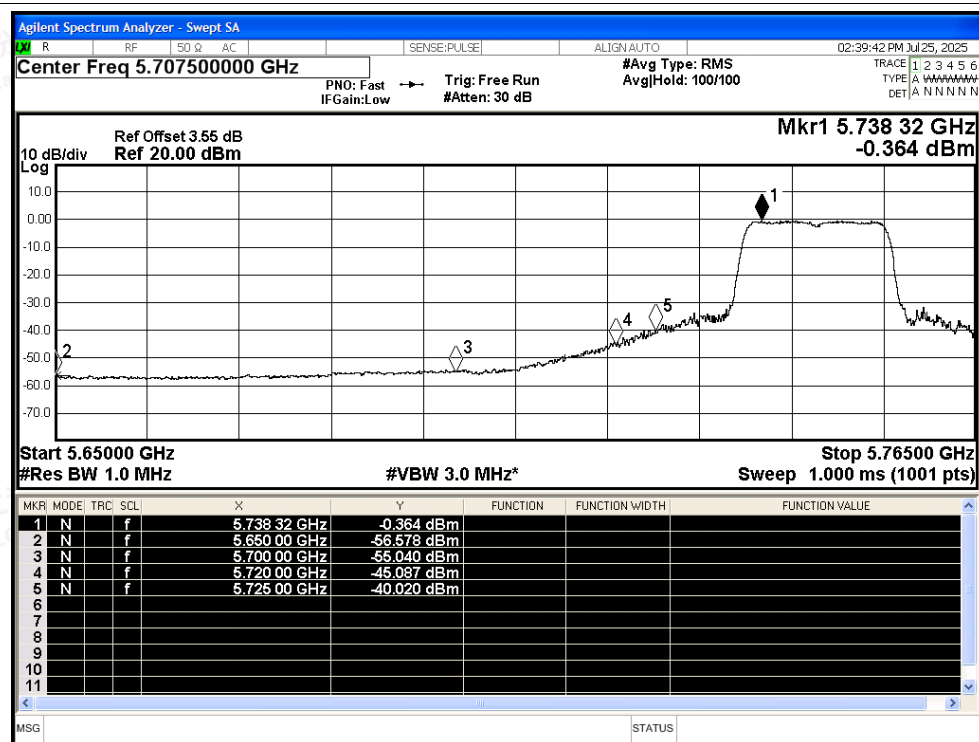

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant1 Peak

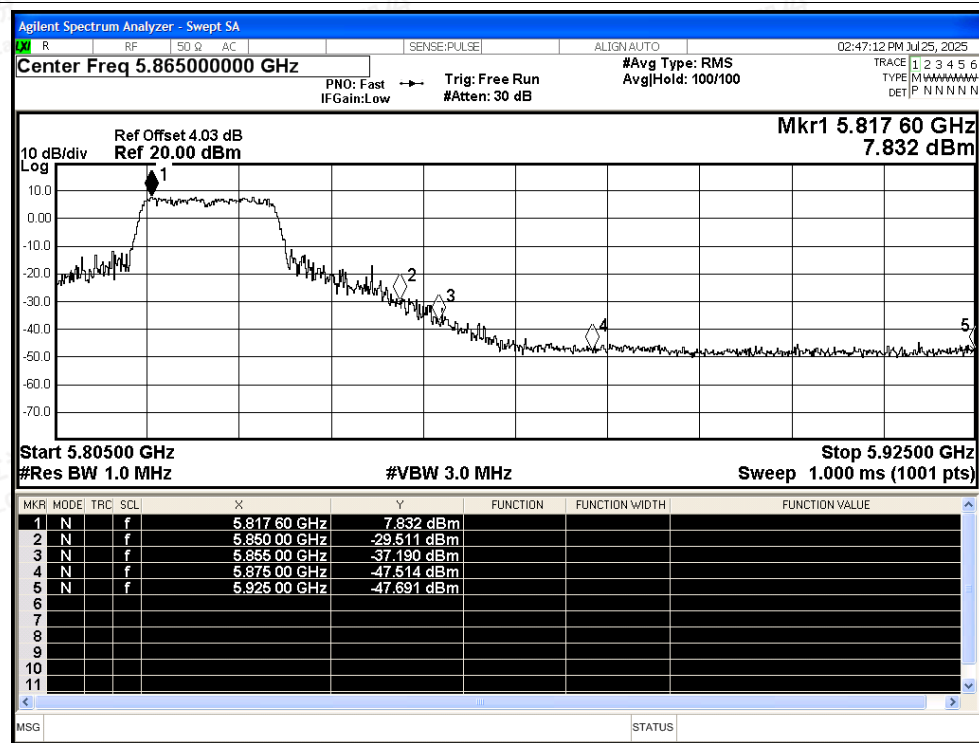

Restrict Band NVNT ax20 5825MHz Ant1 Average

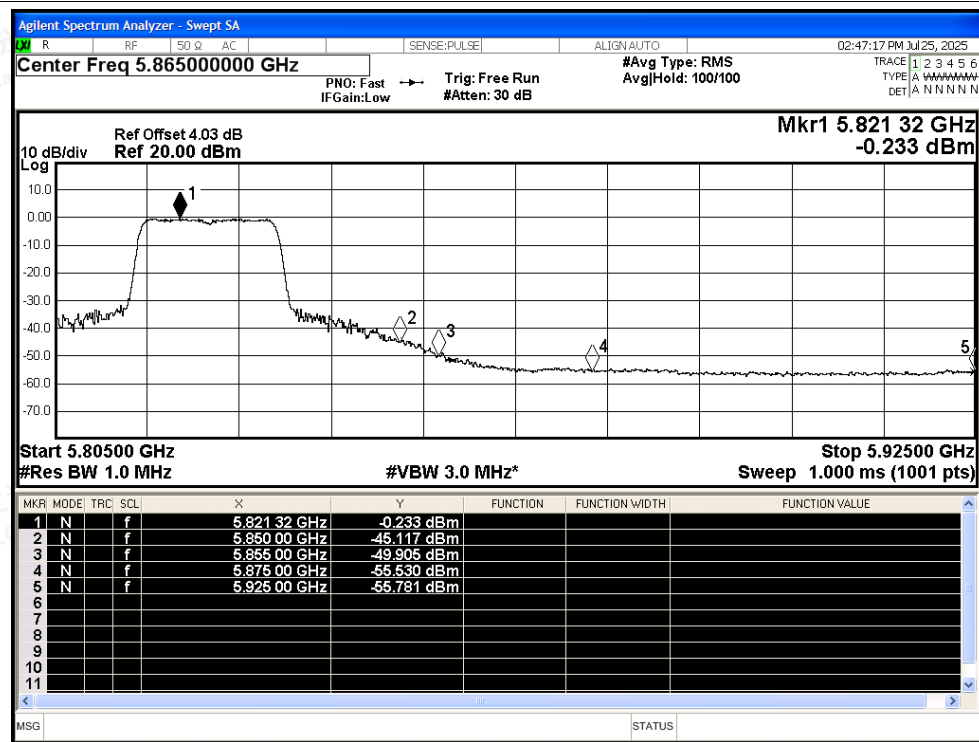

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant1 Peak

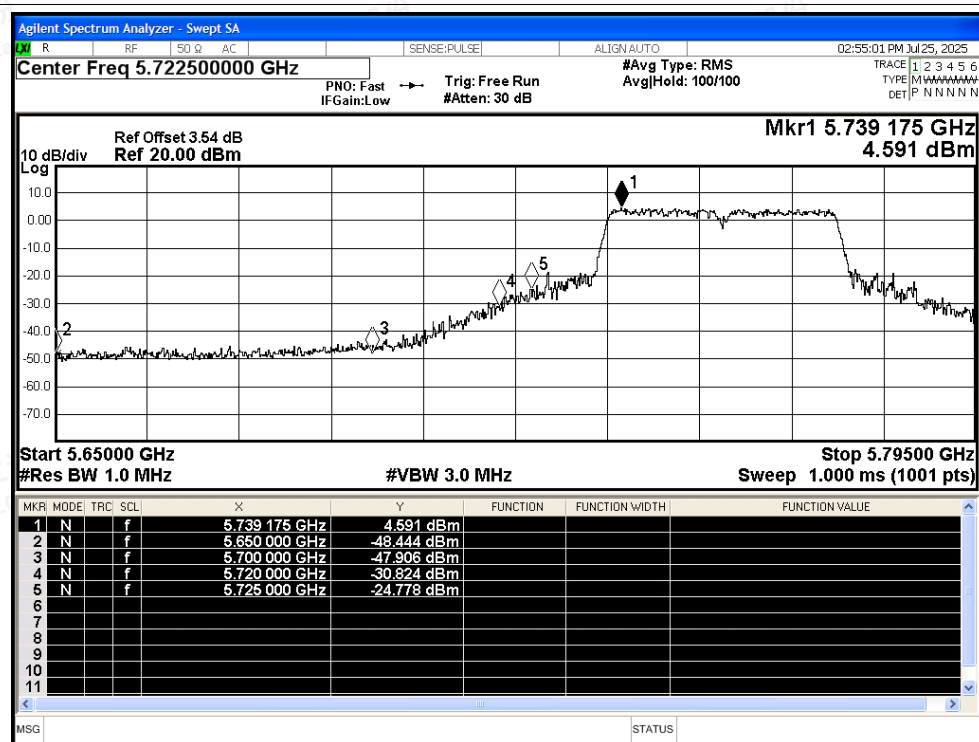

Restrict Band NVNT ax40 5755MHz Ant1 Average

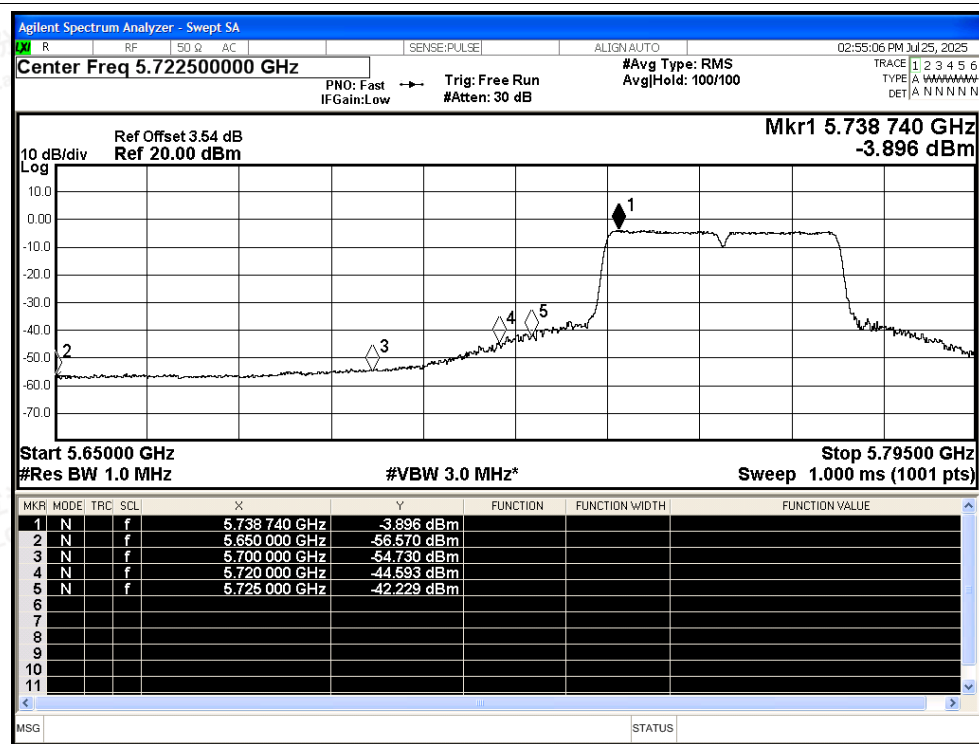

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant1 Peak

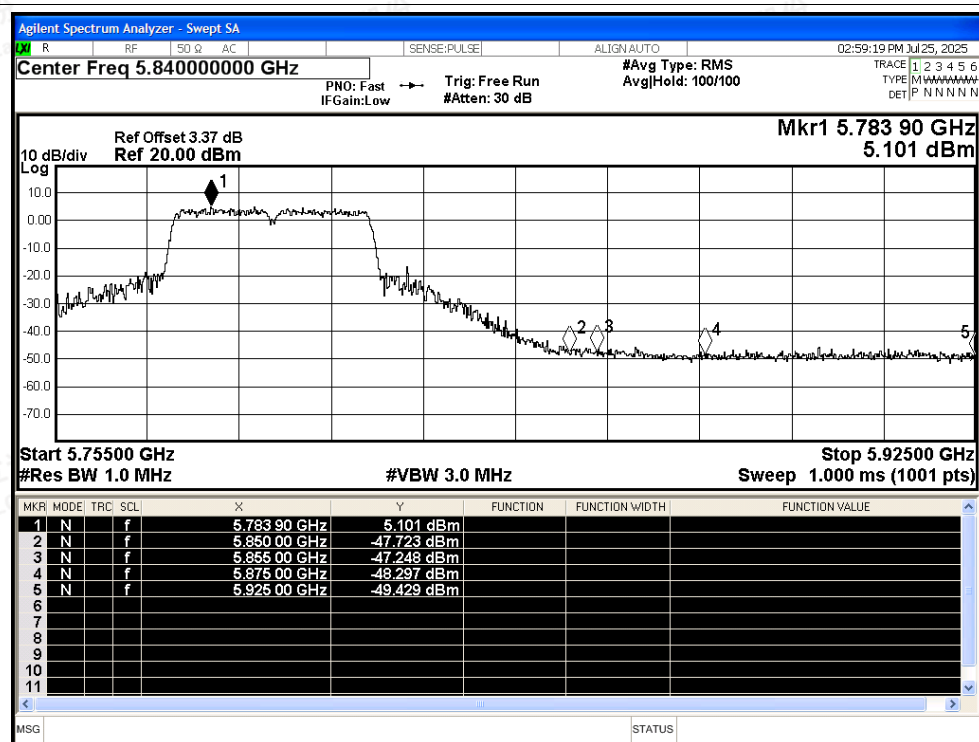

Restrict Band NVNT ax40 5795MHz Ant1 Average

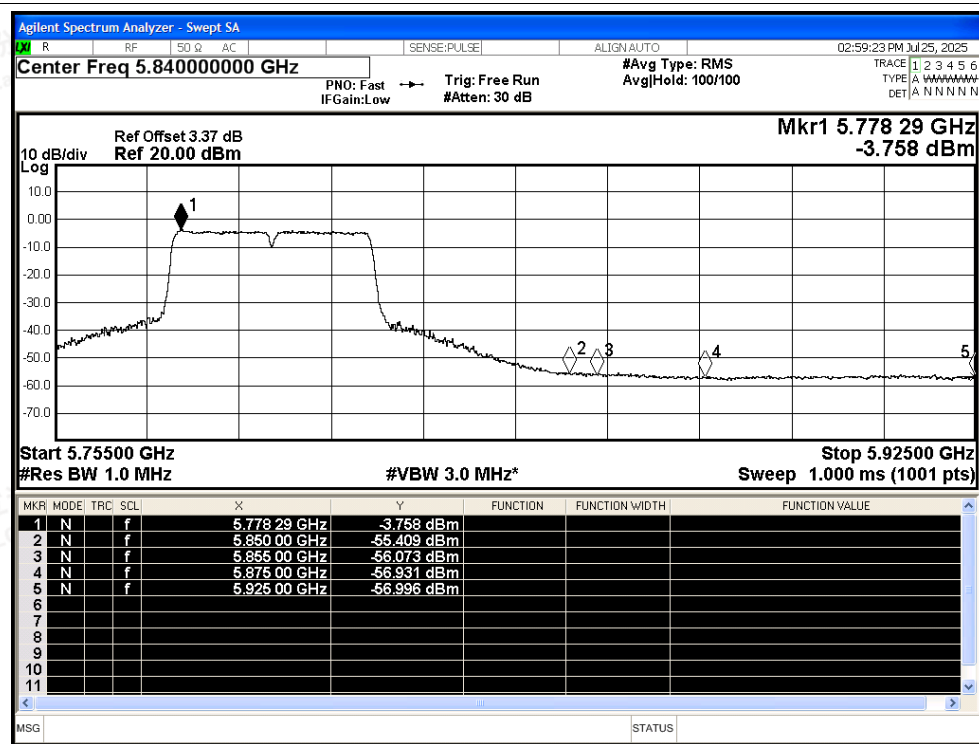

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant1 Peak

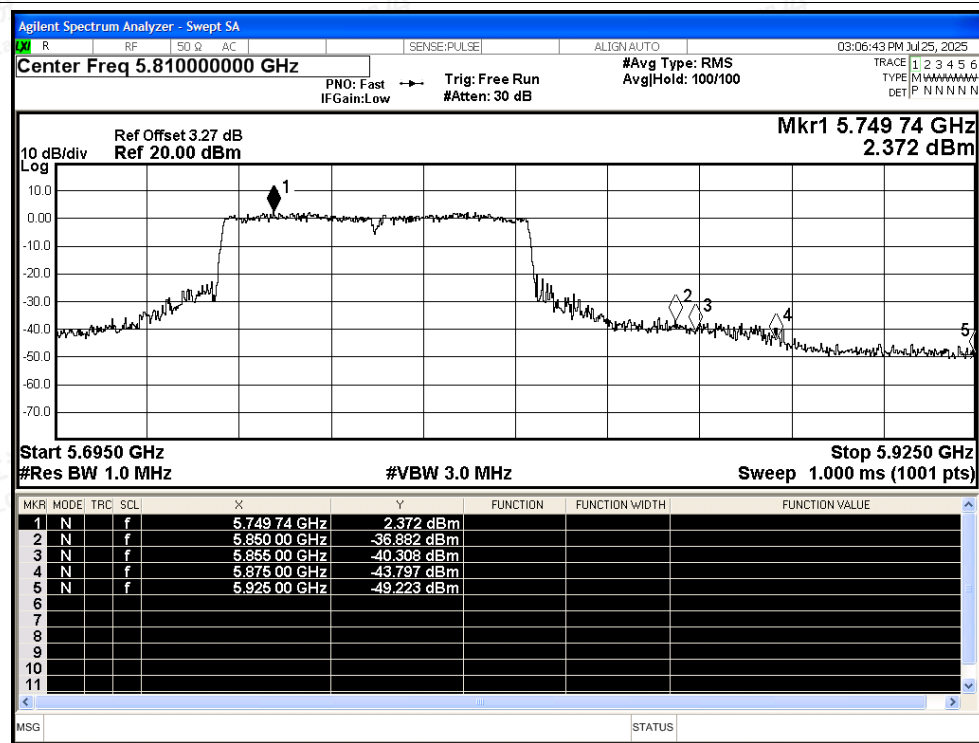

Restrict Band NVNT ax80 5775MHz Ant1 Average

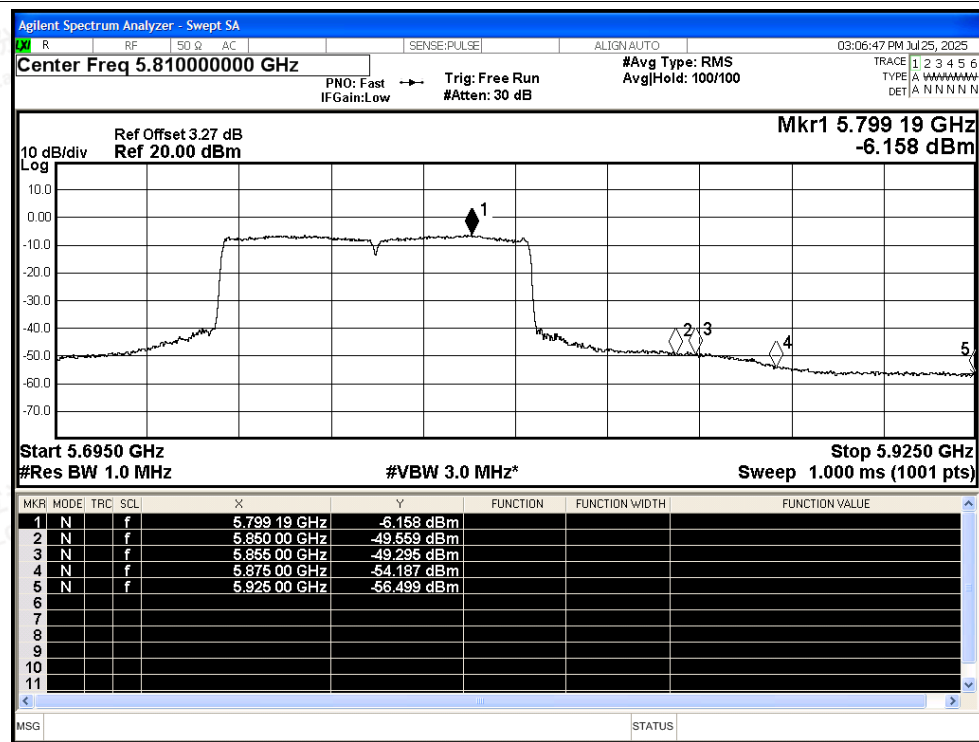

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant1 Peak

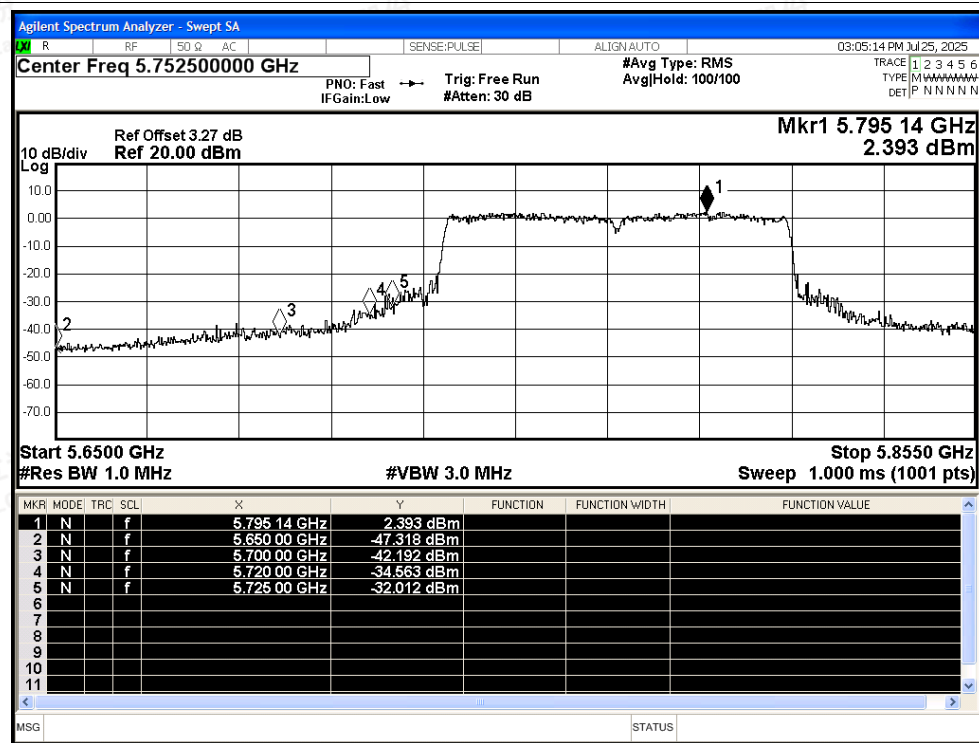

Restrict Band NVNT ax80 5775MHz Ant1 Average

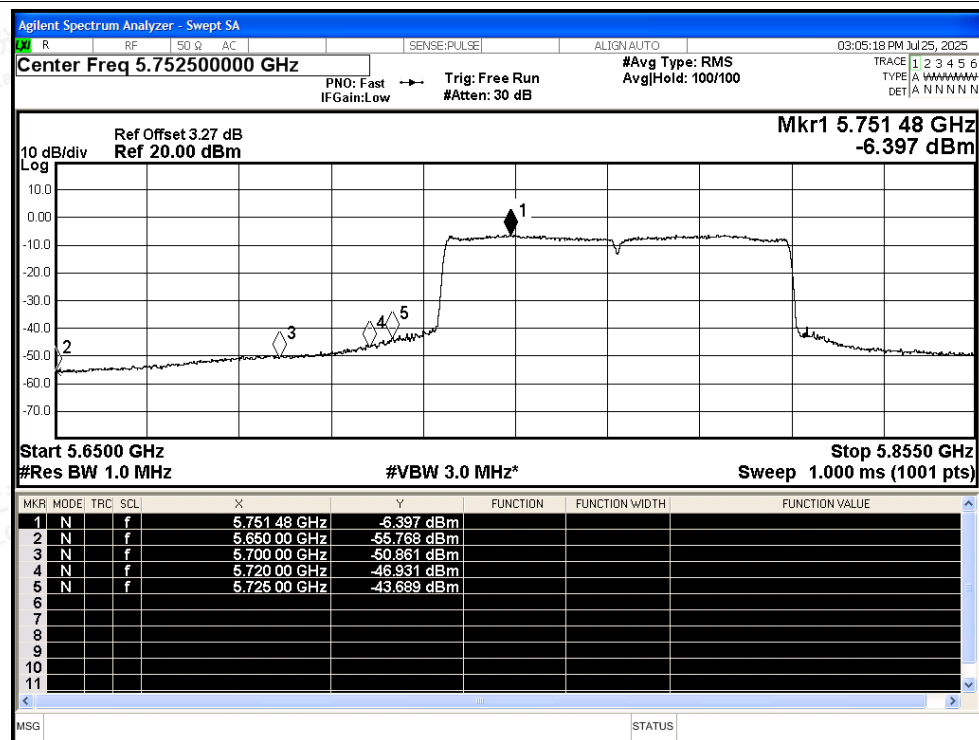

Restrict Band NVNT be20 5745MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

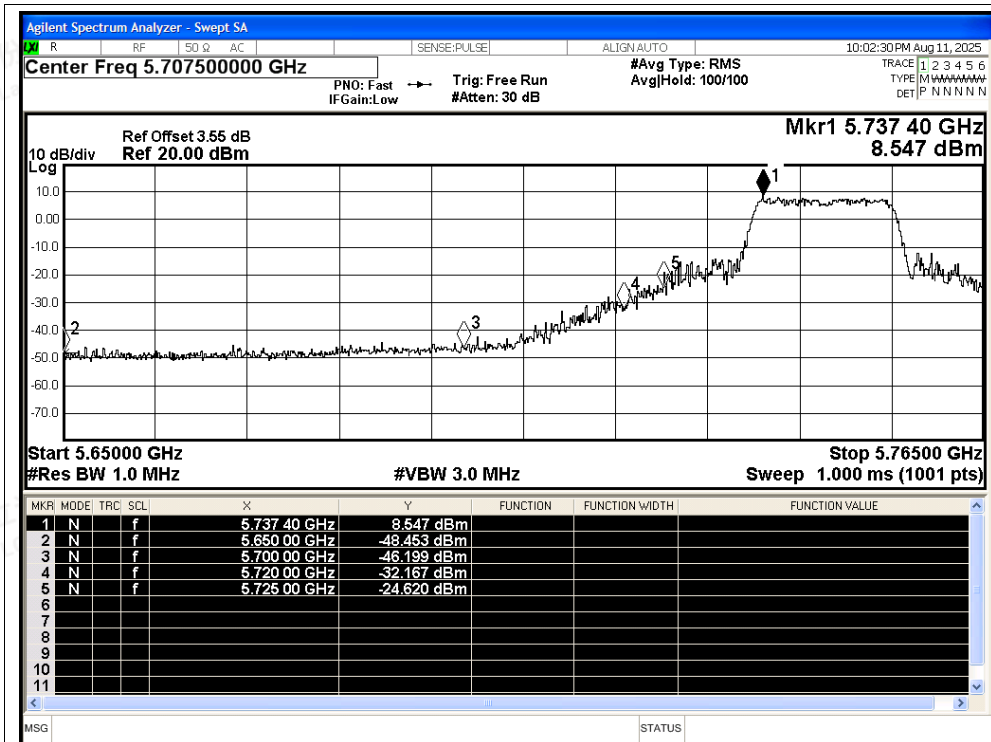

Restrict Band NVNT be20 5745MHz Ant1 Average

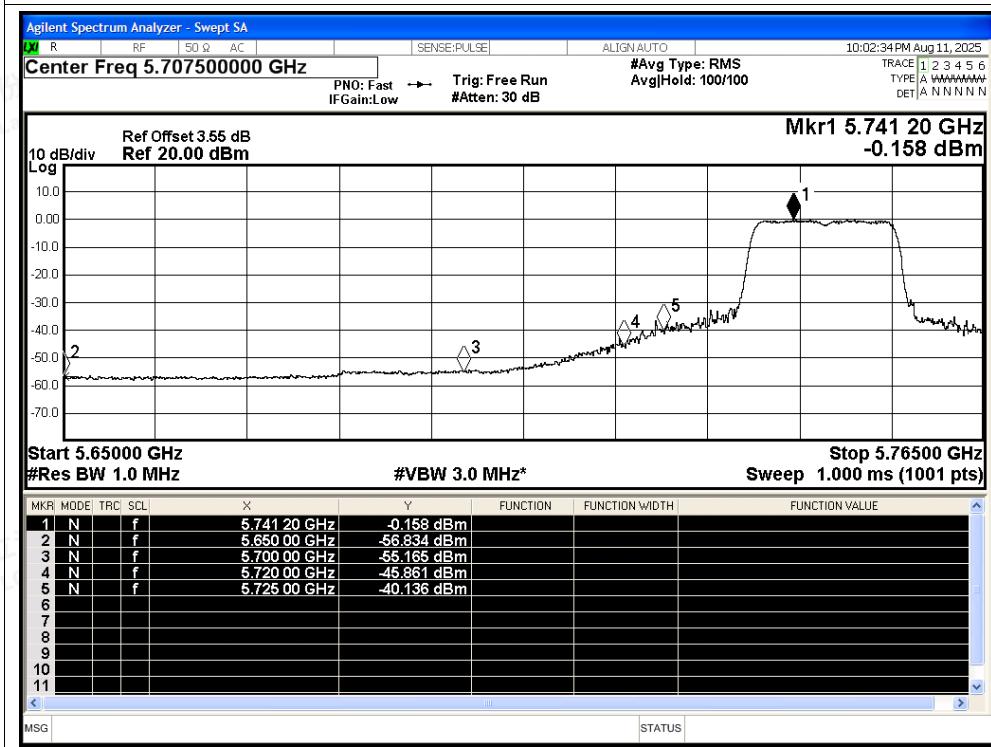

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5825MHz Ant1 Peak

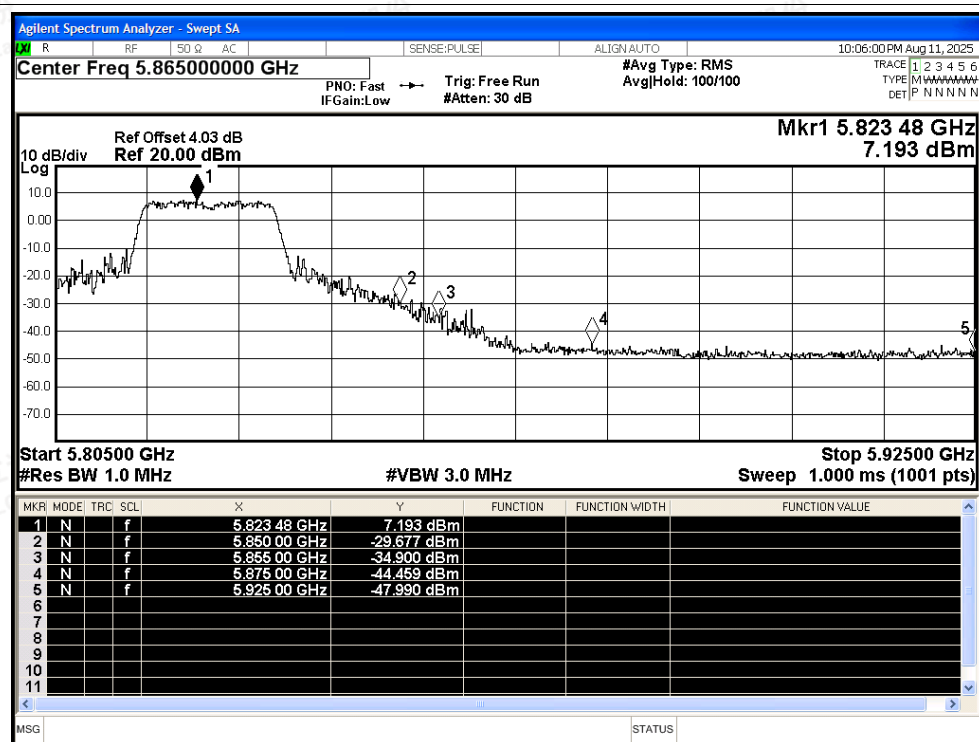

Restrict Band NVNT be20 5825MHz Ant1 Average

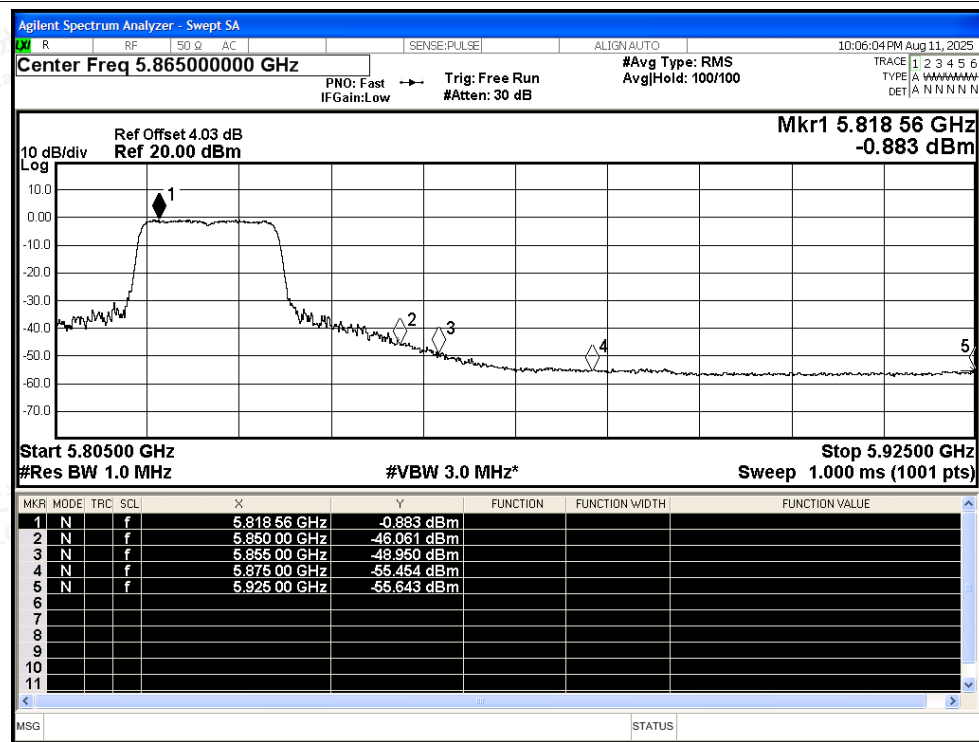

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5755MHz Ant1 Peak

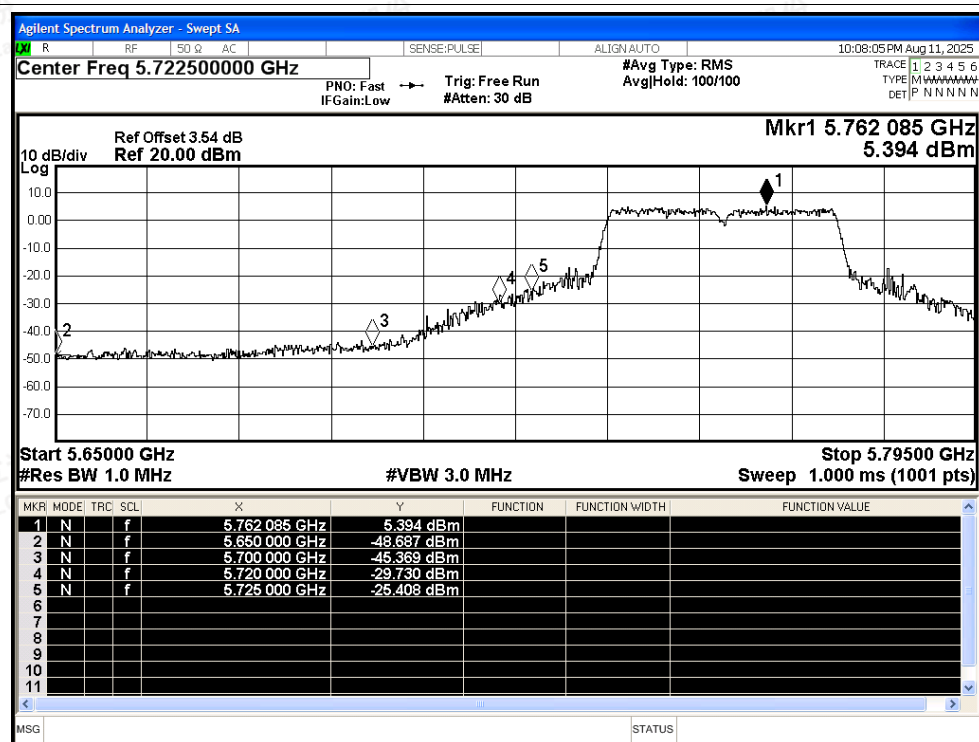

Restrict Band NVNT be40 5755MHz Ant1 Average

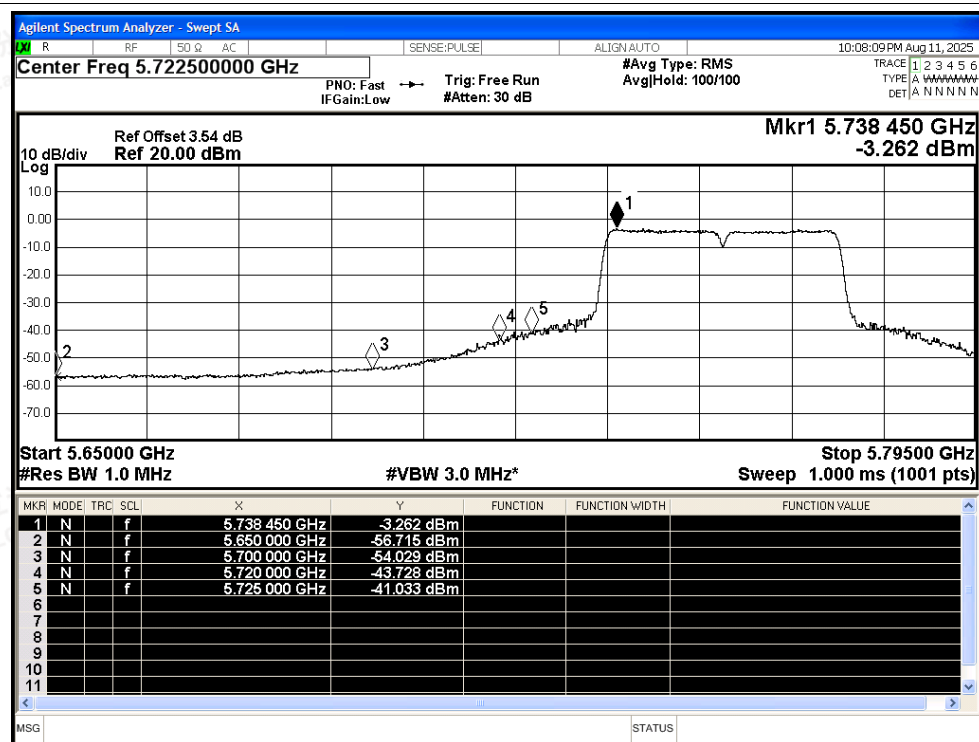

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5795MHz Ant1 Peak

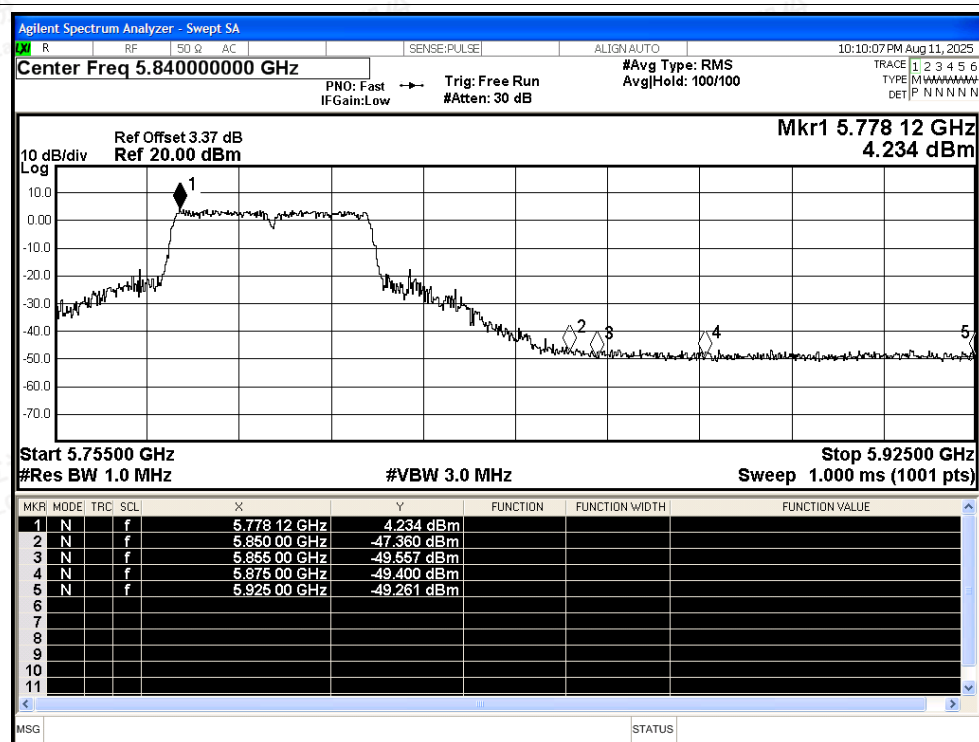

Restrict Band NVNT be40 5795MHz Ant1 Average

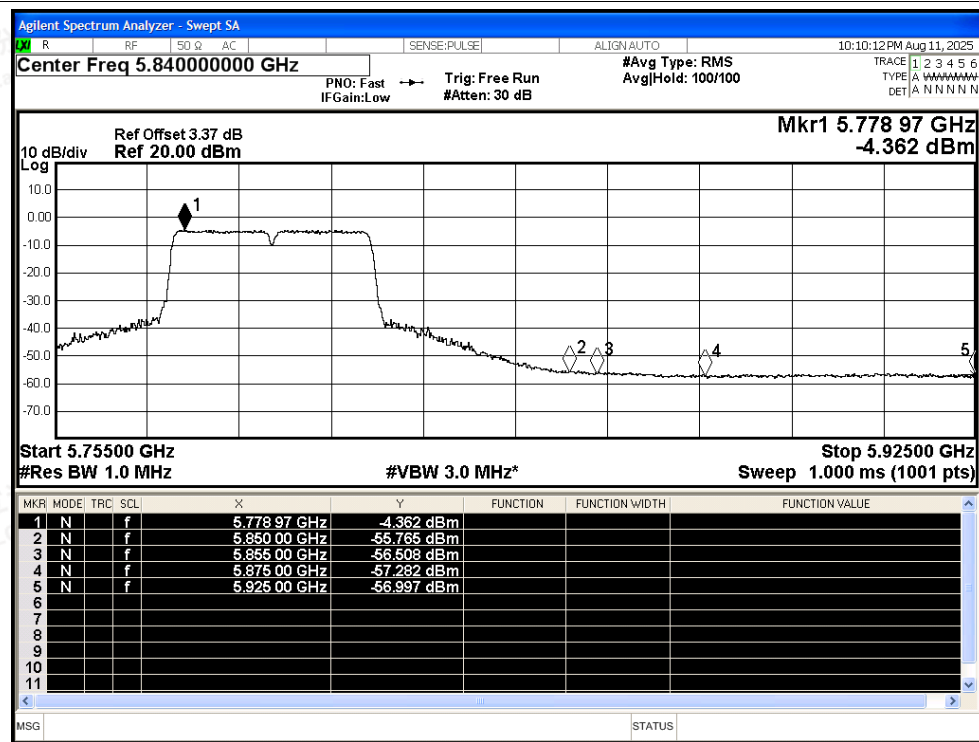

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant1 Peak

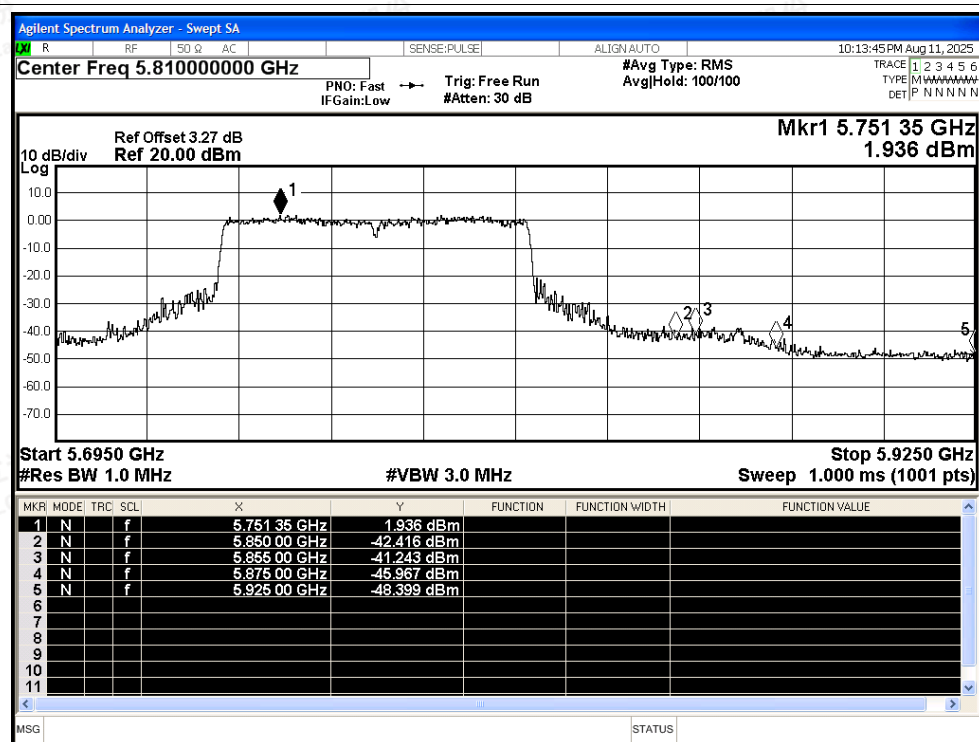

Restrict Band NVNT be80 5775MHz Ant1 Average

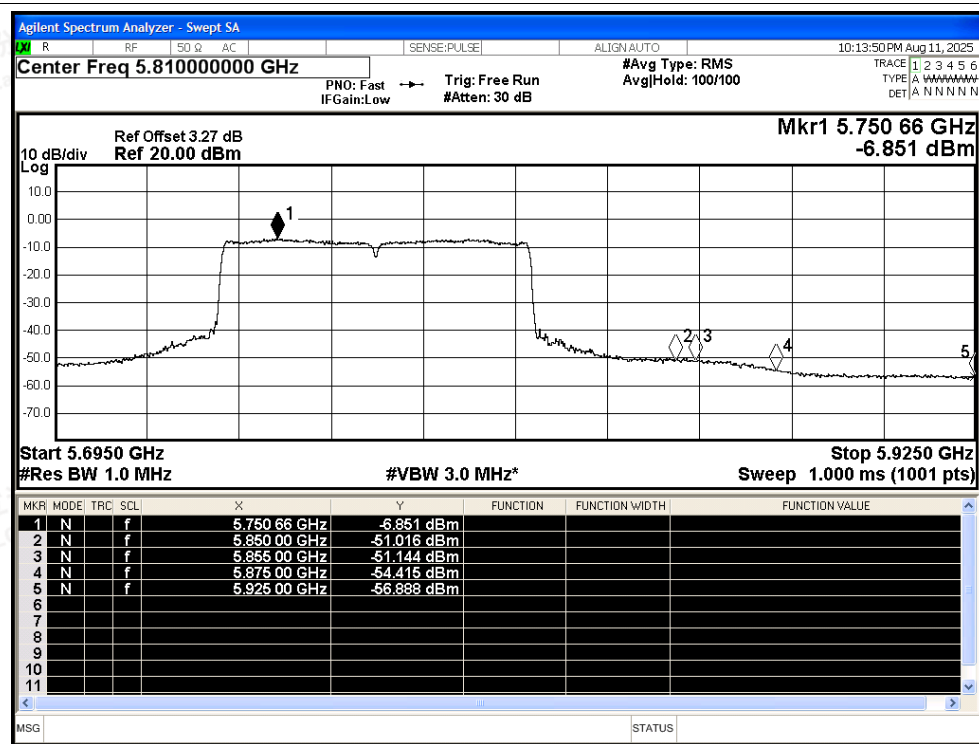

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant1 Peak

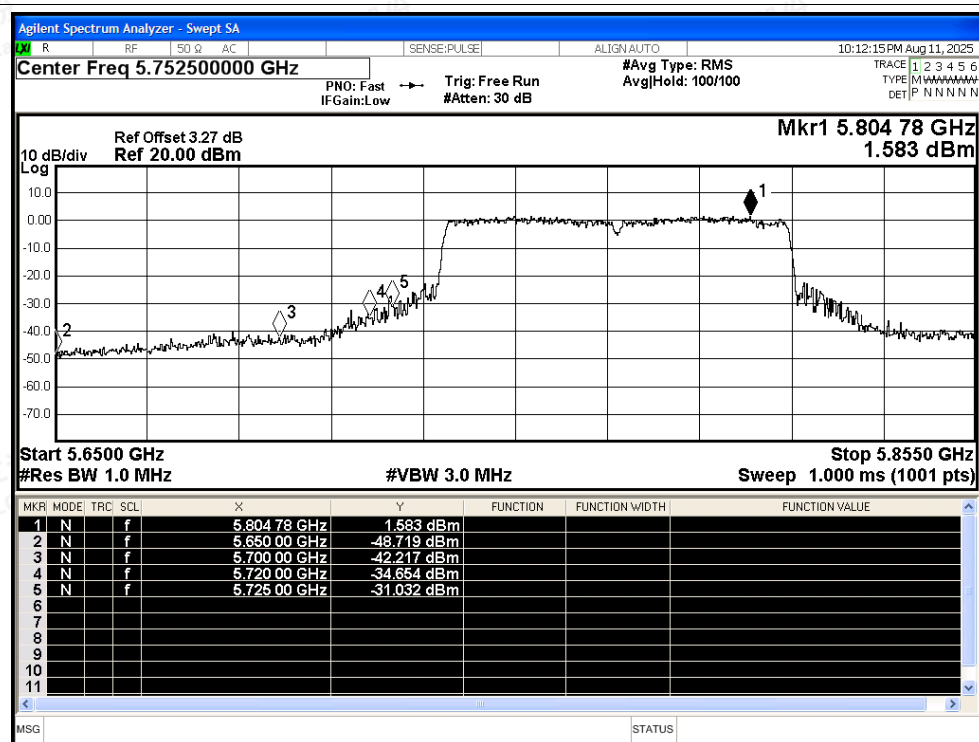

Restrict Band NVNT be80 5775MHz Ant1 Average

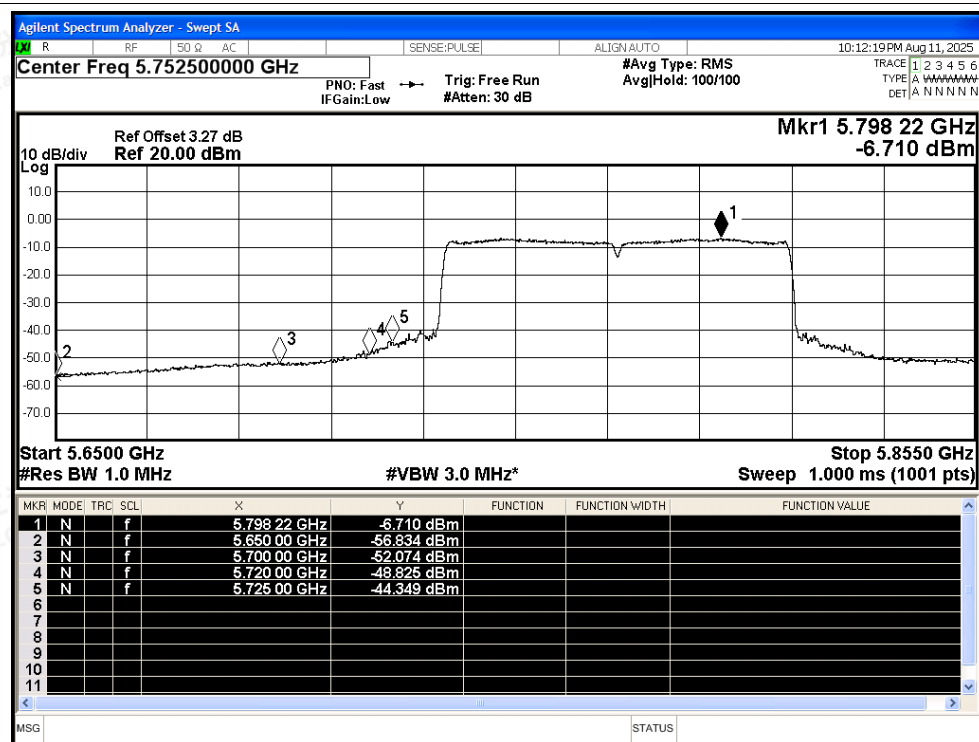

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant2	5650	-48.66	3.73	-	-44.93	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-57.26	3.73	0.24	-53.29	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-46.23	3.73	-	-42.50	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-54.6	3.73	0.24	-50.63	Average	10	Pass
NVNT	a	5745	Ant2	5720	-33.89	3.73	-	-30.16	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-45.13	3.73	0.24	-41.16	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-28.43	3.73	-	-24.70	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-40.94	3.73	0.24	-36.97	Average	27	Pass
NVNT	a	5825	Ant2	5850	-35.28	3.73	-	-31.55	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-48.57	3.73	0.24	-44.60	Average	27	Pass
NVNT	a	5825	Ant2	5855	-43.53	3.73	-	-39.80	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-52.38	3.73	0.24	-48.41	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-45.38	3.73	-	-41.65	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-55.17	3.73	0.24	-51.20	Average	10	Pass
NVNT	a	5825	Ant2	5925	-45.8	3.73	-	-42.07	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-55.36	3.73	0.24	-51.39	Average	-27	Pass
NVNT	n20	5745	Ant2	5650	-49.75	3.73	-	-46.02	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-56.93	3.73	0.12	-53.08	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-48.2	3.73	-	-44.47	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-54.93	3.73	0.12	-51.08	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-29.59	3.73	-	-25.86	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-47.04	3.73	0.12	-43.19	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-27.15	3.73	-	-23.42	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-40.23	3.73	0.12	-36.38	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-33.87	3.73	-	-30.14	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-45.04	3.73	0.12	-41.19	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-36.03	3.73	-	-32.30	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-49.74	3.73	0.12	-45.89	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-47.37	3.73	-	-43.64	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-54.67	3.73	0.12	-50.82	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-47.64	3.73	-	-43.91	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-55.04	3.73	0.12	-51.19	Average	-27	Pass
NVNT	n40	5755	Ant2	5650	-49.22	3.73	-	-45.49	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-57.42	3.73	0.23	-53.46	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-46.95	3.73	-	-43.22	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-54.63	3.73	0.23	-50.67	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-30.95	3.73	-	-27.22	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-46.11	3.73	0.23	-42.15	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-28.65	3.73	-	-24.92	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant2	5725	-42.39	3.73	0.23	-38.43	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-48.17	3.73	-	-44.44	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-55.59	3.73	0.24	-51.62	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-47.49	3.73	-	-43.76	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-56.15	3.73	0.24	-52.18	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-48.36	3.73	-	-44.63	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-57.2	3.73	0.24	-53.23	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-49.5	3.73	-	-45.77	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-57.13	3.73	0.24	-53.16	Average	-27	Pass
NVNT	ac20	5745	Ant2	5650	-49.61	3.73	-	-45.88	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-56.57	3.73	0.12	-52.72	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-48.49	3.73	-	-44.76	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-55.07	3.73	0.12	-51.22	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-33.1	3.73	-	-29.37	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-47.59	3.73	0.12	-43.74	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-24.66	3.73	-	-20.93	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-40.1	3.73	0.12	-36.25	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-28.61	3.73	-	-24.88	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-45.08	3.73	0.12	-41.23	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-34.36	3.73	-	-30.63	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-50.19	3.73	0.12	-46.34	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-46.6	3.73	-	-42.87	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-55.26	3.73	0.12	-51.41	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-48.46	3.73	-	-44.73	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-55.72	3.73	0.12	-51.87	Average	-27	Pass
NVNT	ac40	5755	Ant2	5650	-49.86	3.73	-	-46.13	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-56.81	3.73	0.24	-52.84	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-45.95	3.73	-	-42.22	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-54.75	3.73	0.24	-50.78	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-28.61	3.73	-	-24.88	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-44.41	3.73	0.24	-40.44	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-26.43	3.73	-	-22.70	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-42.95	3.73	0.24	-38.98	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-47.73	3.73	-	-44.00	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-56.14	3.73	0.24	-52.17	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-47.08	3.73	-	-43.35	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-55.96	3.73	0.24	-51.99	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-49.04	3.73	-	-45.31	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-57.14	3.73	0.24	-53.17	Average	10	Pass
NVNT	ac40	5795	Ant2	5925	-46.26	3.73	-	-42.53	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-57.53	3.73	0.24	-53.56	Average	-27	Pass
NVNT	ac80	5775	Ant2	5850	-40.85	3.73	-	-37.12	Peak	27	Pass
NVNT	ac80	5775	Ant2	5850	-48.83	3.73	0.47	-44.63	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant2	5855	-40.6	3.73	-	-36.87	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5855	-49.49	3.73	0.47	-45.29	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5875	-46.28	3.73	-	-42.55	Peak	10	Pass
NVNT	ac80	5775	Ant2	5875	-54.49	3.73	0.47	-50.29	Average	10	Pass
NVNT	ac80	5775	Ant2	5925	-50.59	3.73	-	-46.86	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5925	-56.5	3.73	0.47	-52.30	Average	-27	Pass
NVNT	ac80	5775	Ant2	5650	-47.66	3.73	-	-43.93	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-55.88	3.73	0.47	-51.68	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-41.77	3.73	-	-38.04	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-49.96	3.73	0.47	-45.76	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-34	3.73	-	-30.27	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-46.04	3.73	0.47	-41.84	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-30.88	3.73	-	-27.15	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-43.3	3.73	0.47	-39.10	Average	27	Pass
NVNT	ax20	5745	Ant2	5650	-47.84	3.73	-	-44.11	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-57.13	3.73	0.12	-53.28	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-45.79	3.73	-	-42.06	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-54.93	3.73	0.12	-51.08	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-31.65	3.73	-	-27.92	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-48.44	3.73	0.12	-44.59	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-27.81	3.73	-	-24.08	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-41.12	3.73	0.12	-37.27	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-32.04	3.73	-	-28.31	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-43.48	3.73	0.12	-39.63	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-35.7	3.73	-	-31.97	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-49.91	3.73	0.12	-46.06	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-46.37	3.73	-	-42.64	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-54.87	3.73	0.12	-51.02	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-48.88	3.73	-	-45.15	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-56.07	3.73	0.12	-52.22	Average	-27	Pass
NVNT	ax40	5755	Ant2	5650	-49.82	3.73	-	-46.09	Peak	-27	Pass
NVNT	ax40	5755	Ant2	5650	-57.08	3.73	0.24	-53.11	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-45.9	3.73	-	-42.17	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-54.97	3.73	0.24	-51.00	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-28.8	3.73	-	-25.07	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-45.98	3.73	0.24	-42.01	Average	15.6	Pass
NVNT	ax40	5755	Ant2	5725	-27.12	3.73	-	-23.39	Peak	27	Pass
NVNT	ax40	5755	Ant2	5725	-42.87	3.73	0.24	-38.90	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-47.98	3.73	-	-44.25	Peak	27	Pass
NVNT	ax40	5795	Ant2	5850	-55.42	3.73	0.23	-51.46	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-47.74	3.73	-	-44.01	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-56.19	3.73	0.23	-52.23	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-49.36	3.73	-	-45.63	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant2	5875	-56.92	3.73	0.23	-52.96	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-50.27	3.73	-	-46.54	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-56.53	3.73	0.23	-52.57	Average	-27	Pass
NVNT	ax80	5775	Ant2	5850	-39.2	3.73	-	-35.47	Peak	27	Pass
NVNT	ax80	5775	Ant2	5850	-48.67	3.73	0.47	-44.47	Average	27	Pass
NVNT	ax80	5775	Ant2	5855	-39.58	3.73	-	-35.85	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5855	-49.57	3.73	0.47	-45.37	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5875	-44.05	3.73	-	-40.32	Peak	10	Pass
NVNT	ax80	5775	Ant2	5875	-53.67	3.73	0.47	-49.47	Average	10	Pass
NVNT	ax80	5775	Ant2	5925	-48.41	3.73	-	-44.68	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5925	-57.08	3.73	0.47	-52.88	Average	-27	Pass
NVNT	ax80	5775	Ant2	5650	-46.97	3.73	-	-43.24	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-55.47	3.73	0.47	-51.27	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-41.43	3.73	-	-37.70	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-50.12	3.73	0.47	-45.92	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-34.51	3.73	-	-30.78	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-47.08	3.73	0.47	-42.88	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-33.05	3.73	-	-29.32	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-44.95	3.73	0.47	-40.75	Average	27	Pass
NVNT	be20	5745	Ant2	5650	-48.46	3.73	-	-44.73	Peak	-27	Pass
NVNT	be20	5745	Ant2	5650	-57.36	3.73	0.12	-53.51	Average	-27	Pass
NVNT	be20	5745	Ant2	5700	-46.81	3.73	-	-43.08	Peak	10	Pass
NVNT	be20	5745	Ant2	5700	-54.3	3.73	0.12	-50.45	Average	10	Pass
NVNT	be20	5745	Ant2	5720	-33.29	3.73	-	-29.56	Peak	15.6	Pass
NVNT	be20	5745	Ant2	5720	-44.1	3.73	0.12	-40.25	Average	15.6	Pass
NVNT	be20	5745	Ant2	5725	-22.98	3.73	-	-19.25	Peak	27	Pass
NVNT	be20	5745	Ant2	5725	-39.7	3.73	0.12	-35.85	Average	27	Pass
NVNT	be20	5825	Ant2	5850	-32.02	3.73	-	-28.29	Peak	27	Pass
NVNT	be20	5825	Ant2	5850	-48.31	3.73	0.12	-44.46	Average	27	Pass
NVNT	be20	5825	Ant2	5855	-39.63	3.73	-	-35.90	Peak	15.6	Pass
NVNT	be20	5825	Ant2	5855	-51.04	3.73	0.12	-47.19	Average	15.6	Pass
NVNT	be20	5825	Ant2	5875	-46.98	3.73	-	-43.25	Peak	10	Pass
NVNT	be20	5825	Ant2	5875	-55.59	3.73	0.12	-51.74	Average	10	Pass
NVNT	be20	5825	Ant2	5925	-48.07	3.73	-	-44.34	Peak	-27	Pass
NVNT	be20	5825	Ant2	5925	-55.82	3.73	0.12	-51.97	Average	-27	Pass
NVNT	be40	5755	Ant2	5650	-47.66	3.73	-	-43.93	Peak	-27	Pass
NVNT	be40	5755	Ant2	5650	-57.08	3.73	0.24	-53.11	Average	-27	Pass
NVNT	be40	5755	Ant2	5700	-45.17	3.73	-	-41.44	Peak	10	Pass
NVNT	be40	5755	Ant2	5700	-53.19	3.73	0.24	-49.22	Average	10	Pass
NVNT	be40	5755	Ant2	5720	-29.69	3.73	-	-25.96	Peak	15.6	Pass
NVNT	be40	5755	Ant2	5720	-43.05	3.73	0.24	-39.08	Average	15.6	Pass
NVNT	be40	5755	Ant2	5725	-27.16	3.73	-	-23.43	Peak	27	Pass
NVNT	be40	5755	Ant2	5725	-39.77	3.73	0.24	-35.80	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5795	Ant2	5850	-48.38	3.73	-	-44.65	Peak	27	Pass
NVNT	be40	5795	Ant2	5850	-55.91	3.73	0.23	-51.95	Average	27	Pass
NVNT	be40	5795	Ant2	5855	-48.31	3.73	-	-44.58	Peak	15.6	Pass
NVNT	be40	5795	Ant2	5855	-56.12	3.73	0.23	-52.16	Average	15.6	Pass
NVNT	be40	5795	Ant2	5875	-49.46	3.73	-	-45.73	Peak	10	Pass
NVNT	be40	5795	Ant2	5875	-56.4	3.73	0.23	-52.44	Average	10	Pass
NVNT	be40	5795	Ant2	5925	-49.56	3.73	-	-45.83	Peak	-27	Pass
NVNT	be40	5795	Ant2	5925	-57.23	3.73	0.23	-53.27	Average	-27	Pass
NVNT	be80	5775	Ant2	5850	-40.6	3.73	-	-36.87	Peak	27	Pass
NVNT	be80	5775	Ant2	5850	-51.49	3.73	0.47	-47.29	Average	27	Pass
NVNT	be80	5775	Ant2	5855	-40.5	3.73	-	-36.77	Peak	15.6	Pass
NVNT	be80	5775	Ant2	5855	-51.11	3.73	0.47	-46.91	Average	15.6	Pass
NVNT	be80	5775	Ant2	5875	-44.69	3.73	-	-40.96	Peak	10	Pass
NVNT	be80	5775	Ant2	5875	-54.13	3.73	0.47	-49.93	Average	10	Pass
NVNT	be80	5775	Ant2	5925	-49.22	3.73	-	-45.49	Peak	-27	Pass
NVNT	be80	5775	Ant2	5925	-57.18	3.73	0.47	-52.98	Average	-27	Pass
NVNT	be80	5775	Ant2	5650	-48.77	3.73	-	-45.04	Peak	-27	Pass
NVNT	be80	5775	Ant2	5650	-55.94	3.73	0.47	-51.74	Average	-27	Pass
NVNT	be80	5775	Ant2	5700	-42.17	3.73	-	-38.44	Peak	10	Pass
NVNT	be80	5775	Ant2	5700	-51.91	3.73	0.47	-47.71	Average	10	Pass
NVNT	be80	5775	Ant2	5720	-35.44	3.73	-	-31.71	Peak	15.6	Pass
NVNT	be80	5775	Ant2	5720	-47.72	3.73	0.47	-43.52	Average	15.6	Pass
NVNT	be80	5775	Ant2	5725	-29.01	3.73	-	-25.28	Peak	27	Pass
NVNT	be80	5775	Ant2	5725	-45.29	3.73	0.47	-41.09	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant2 Peak

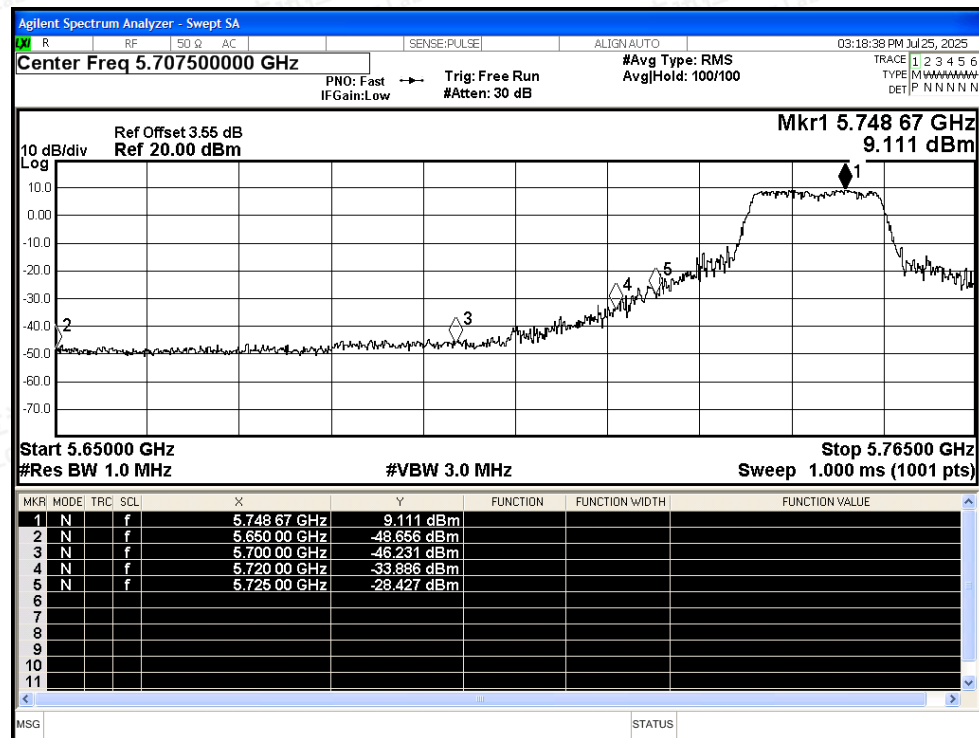

Restrict Band NVNT a 5745MHz Ant2 Average

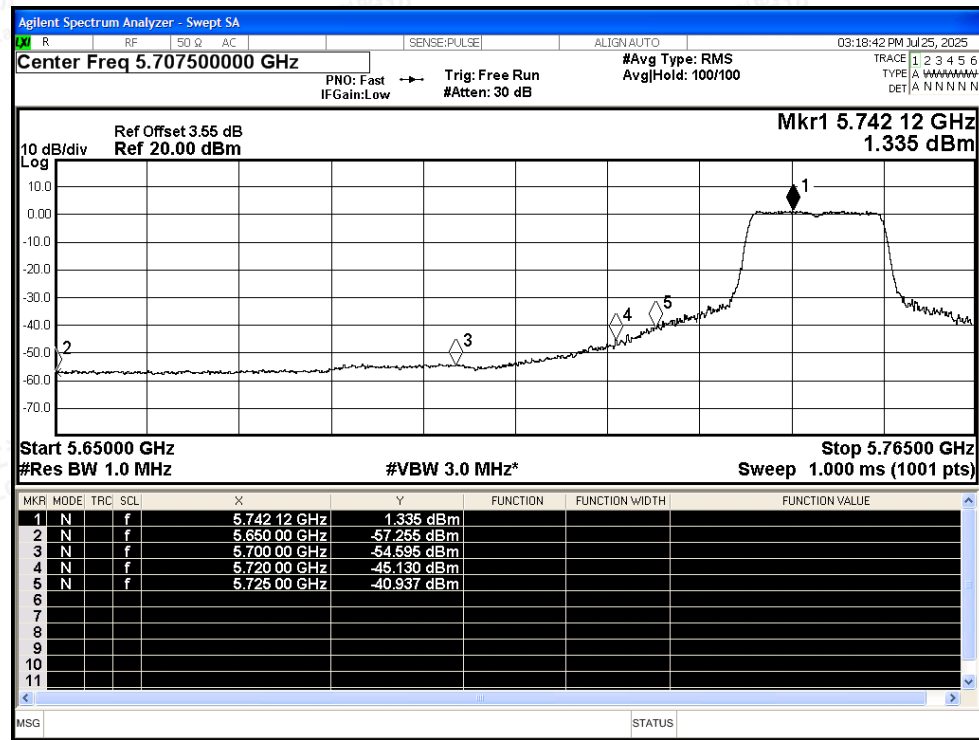

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant2 Peak

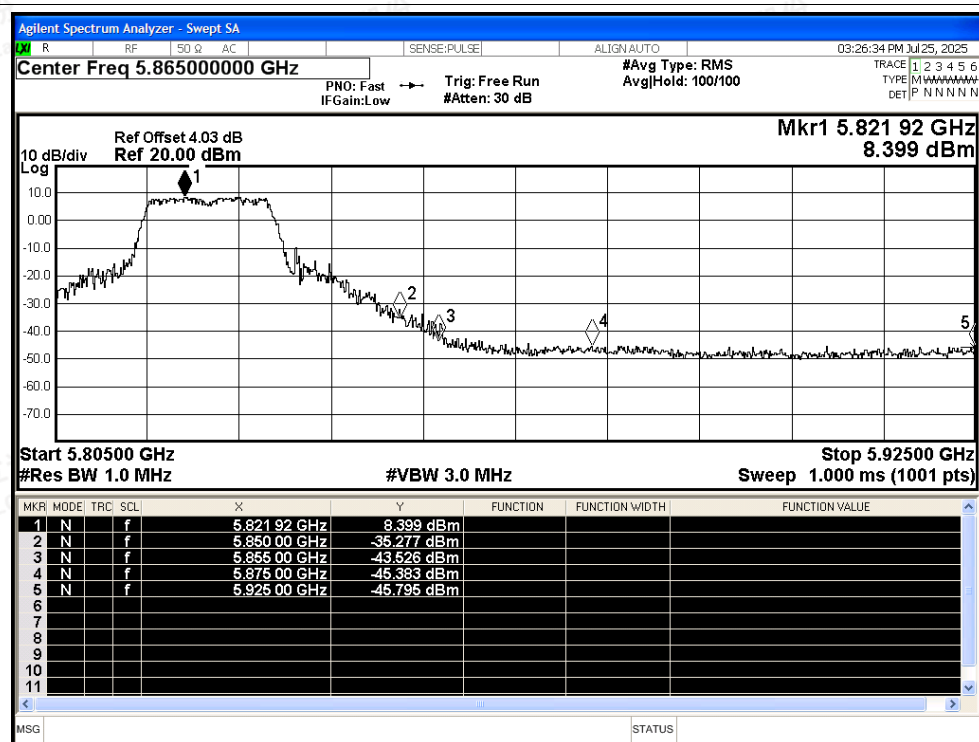

Restrict Band NVNT a 5825MHz Ant2 Average

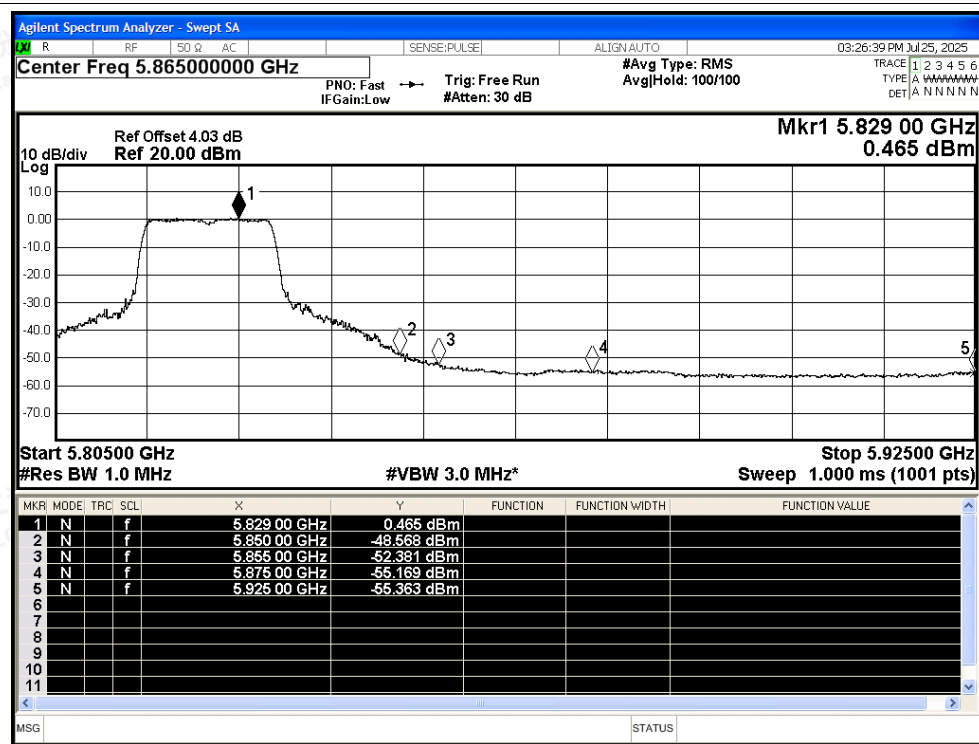

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant2 Peak

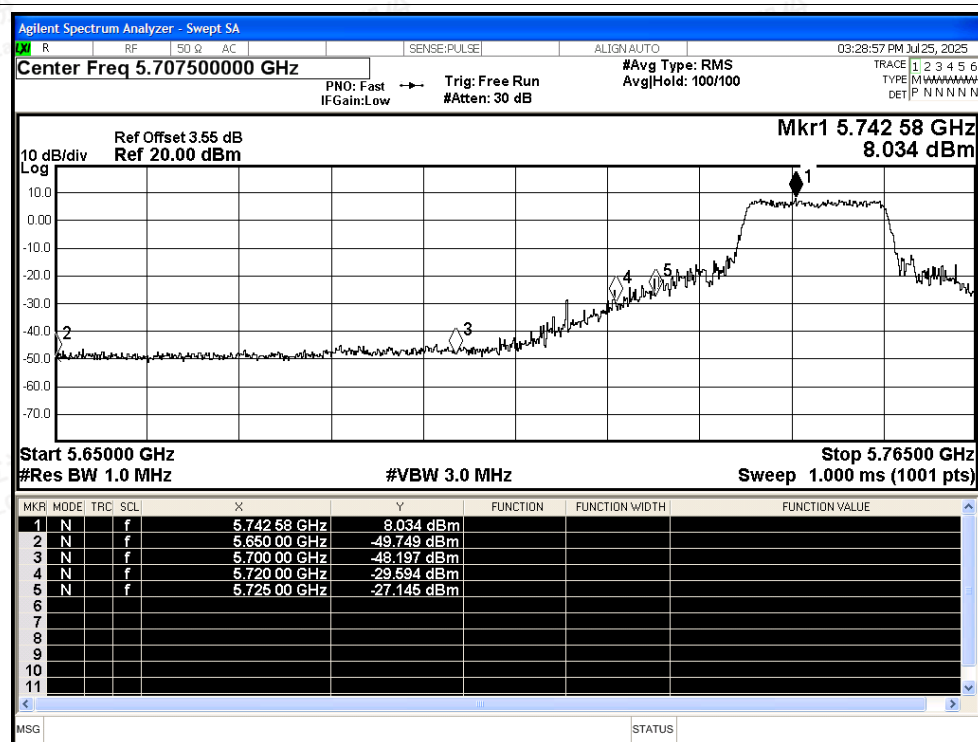

Restrict Band NVNT n20 5745MHz Ant2 Average

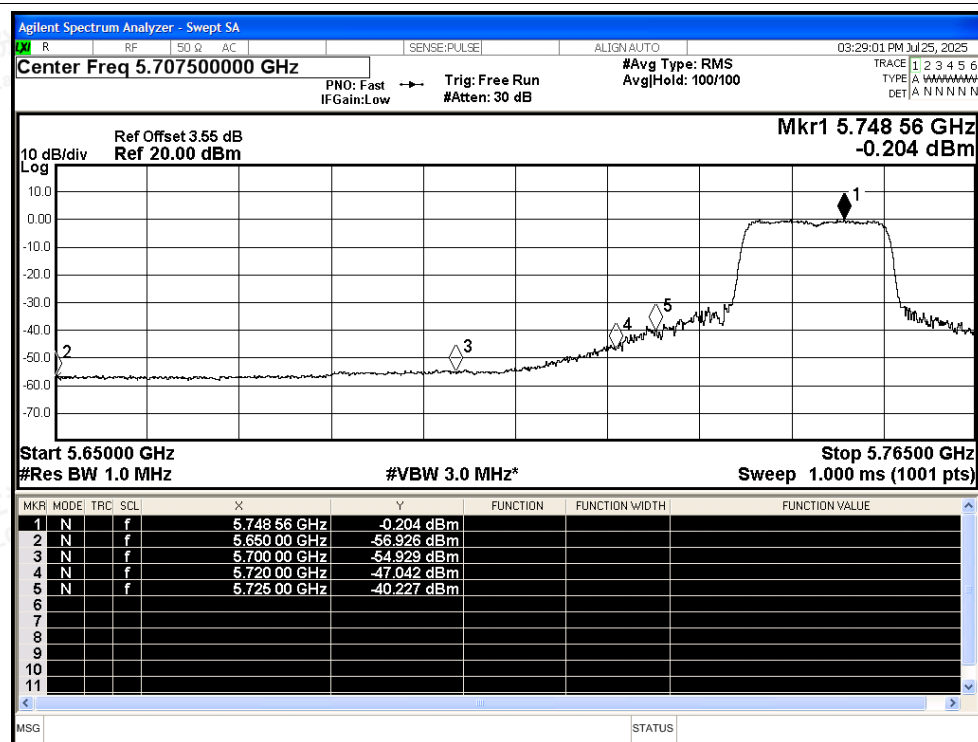

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant2 Peak

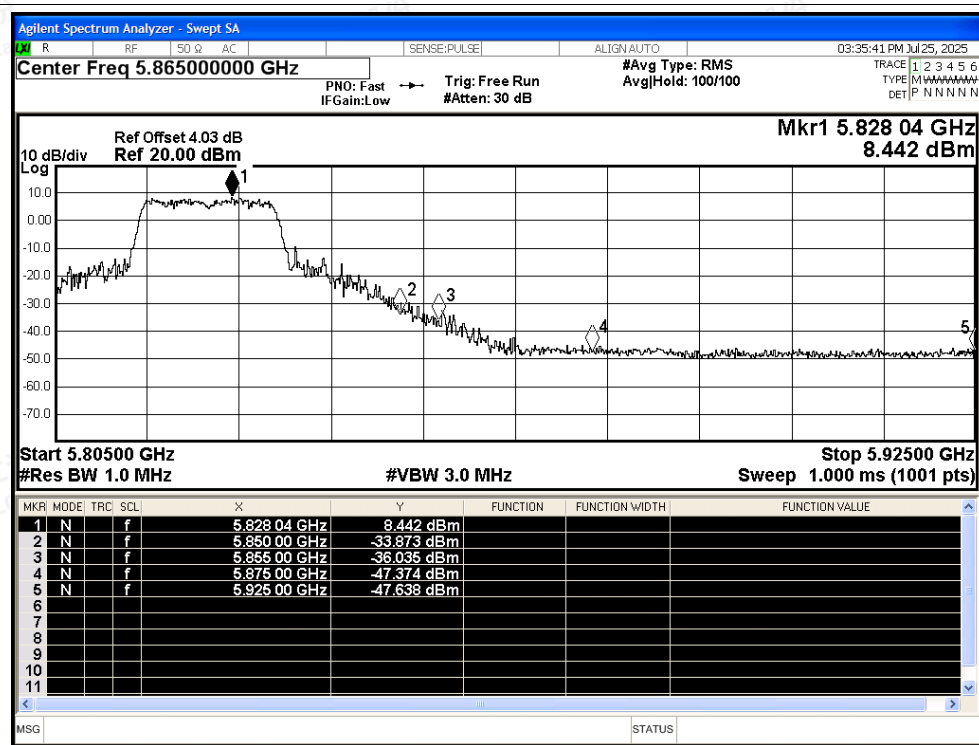

Restrict Band NVNT n20 5825MHz Ant2 Average

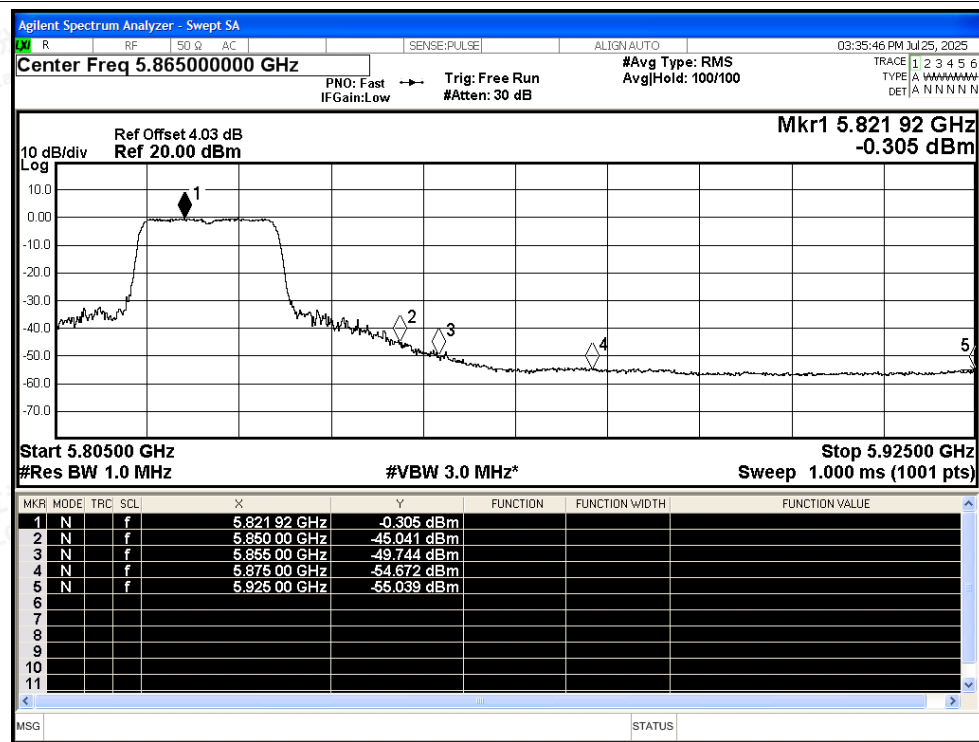

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant2 Peak

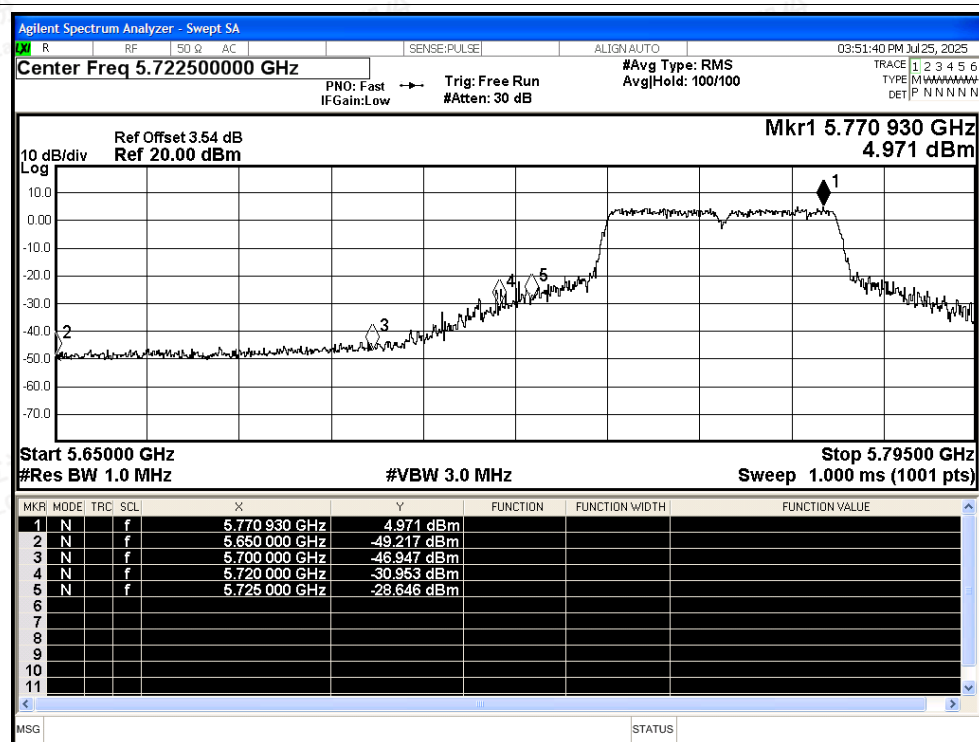

Restrict Band NVNT n40 5755MHz Ant2 Average

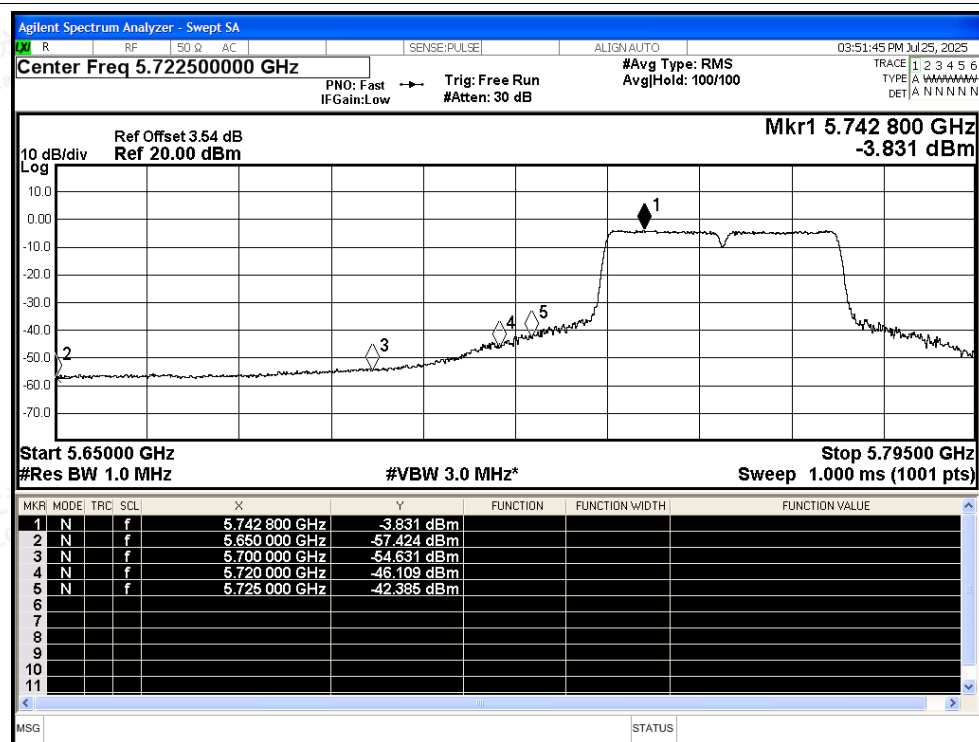

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant2 Peak

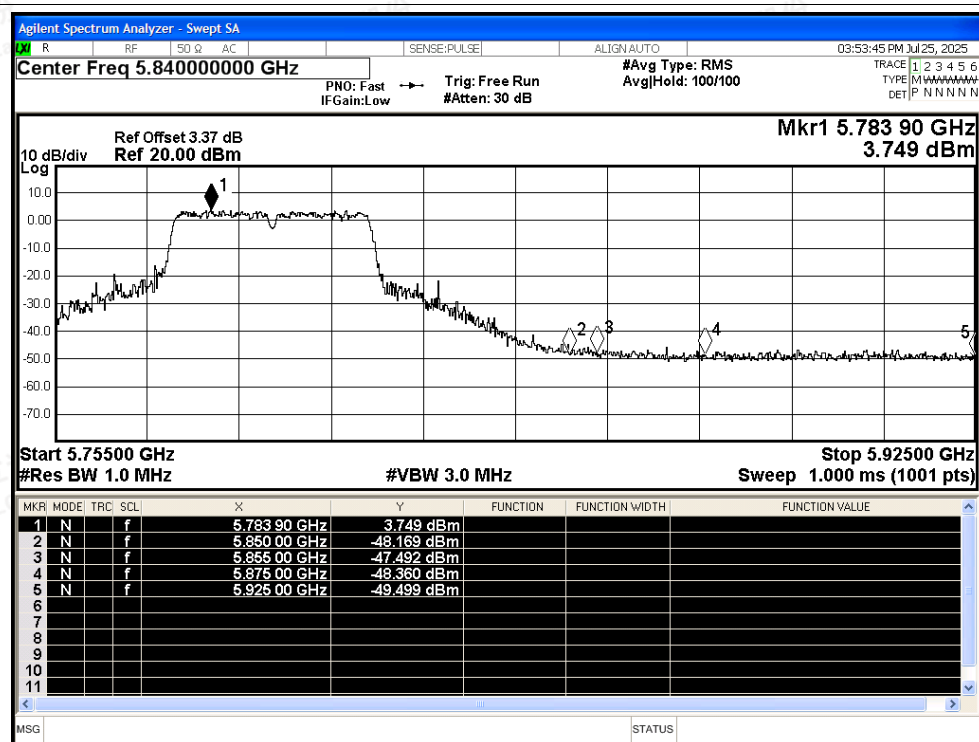

Restrict Band NVNT n40 5795MHz Ant2 Average

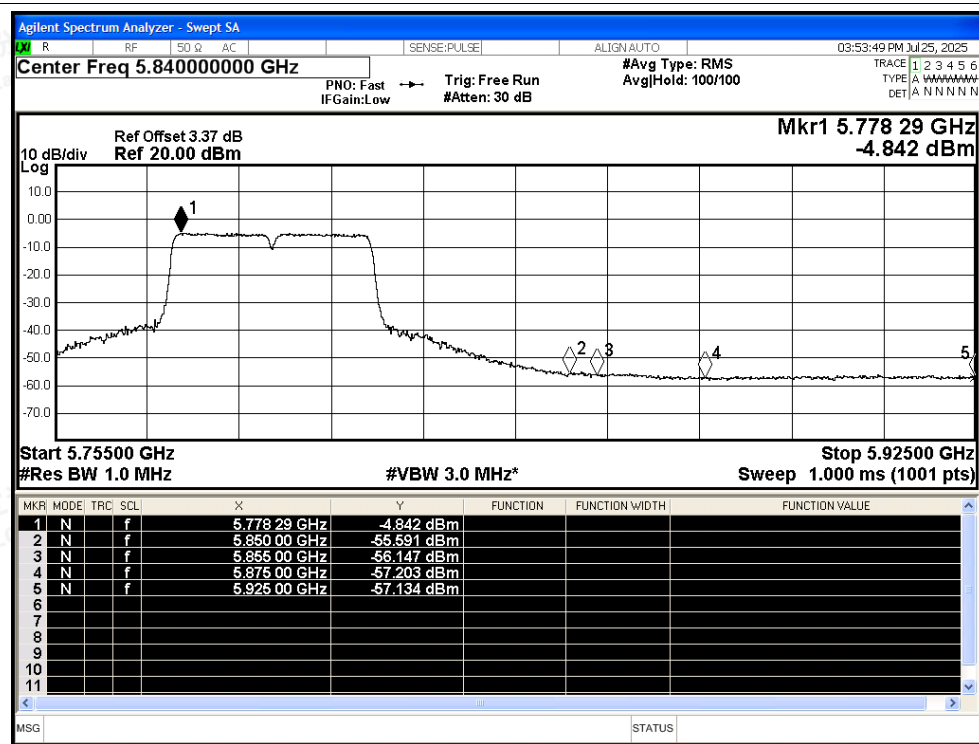

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant2 Peak

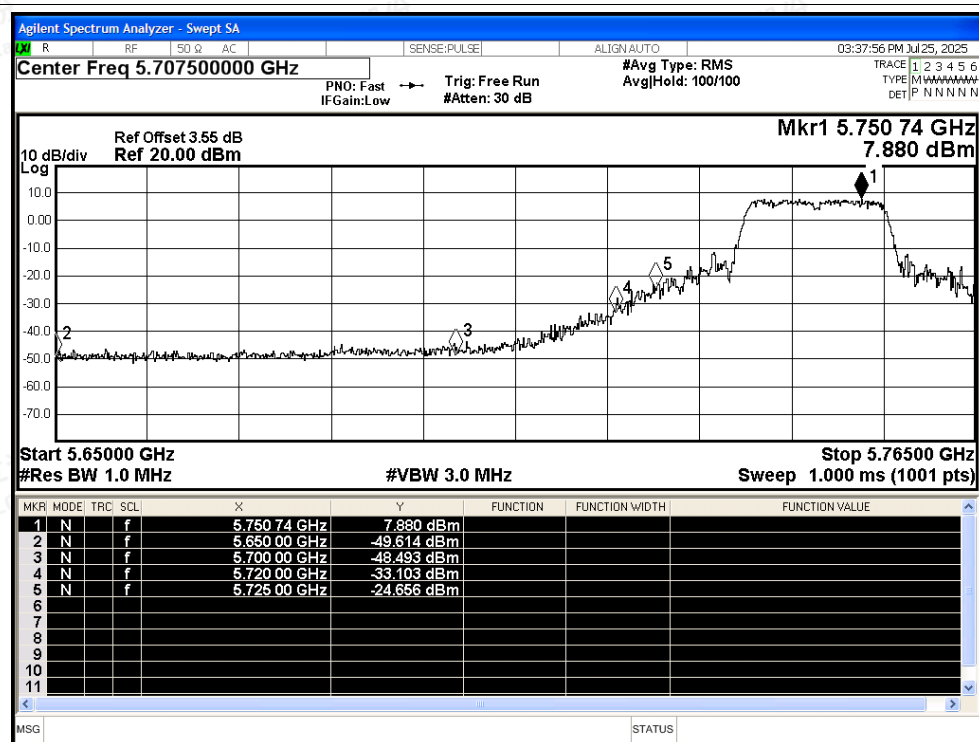

Restrict Band NVNT ac20 5745MHz Ant2 Average

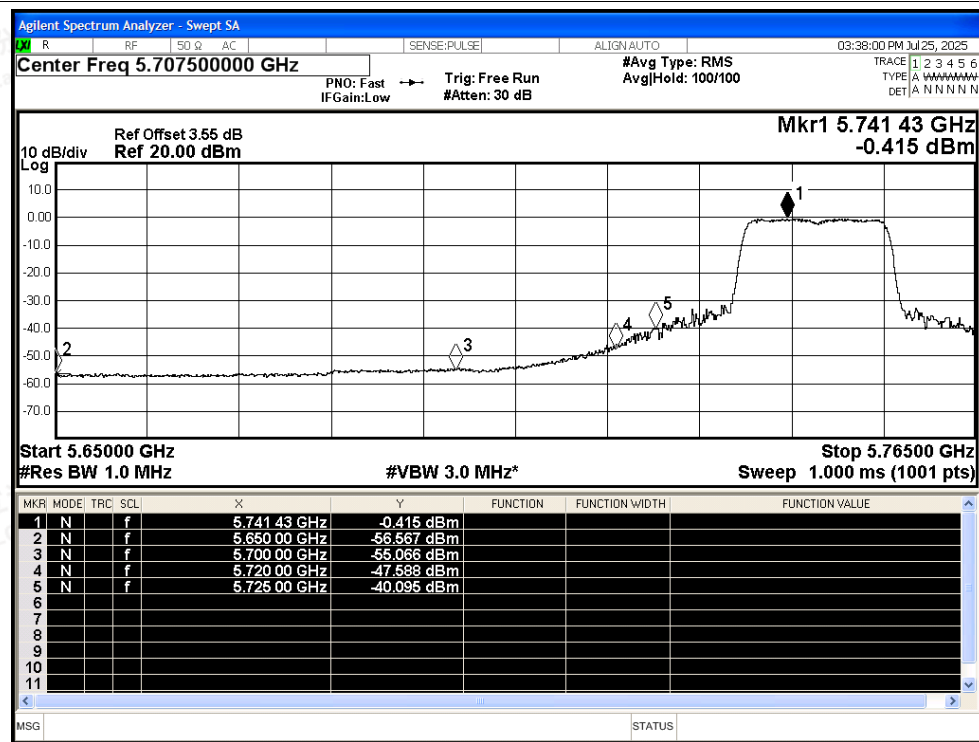

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity