





Restrict Band NVNT ac20 5825MHz Ant2 Peak

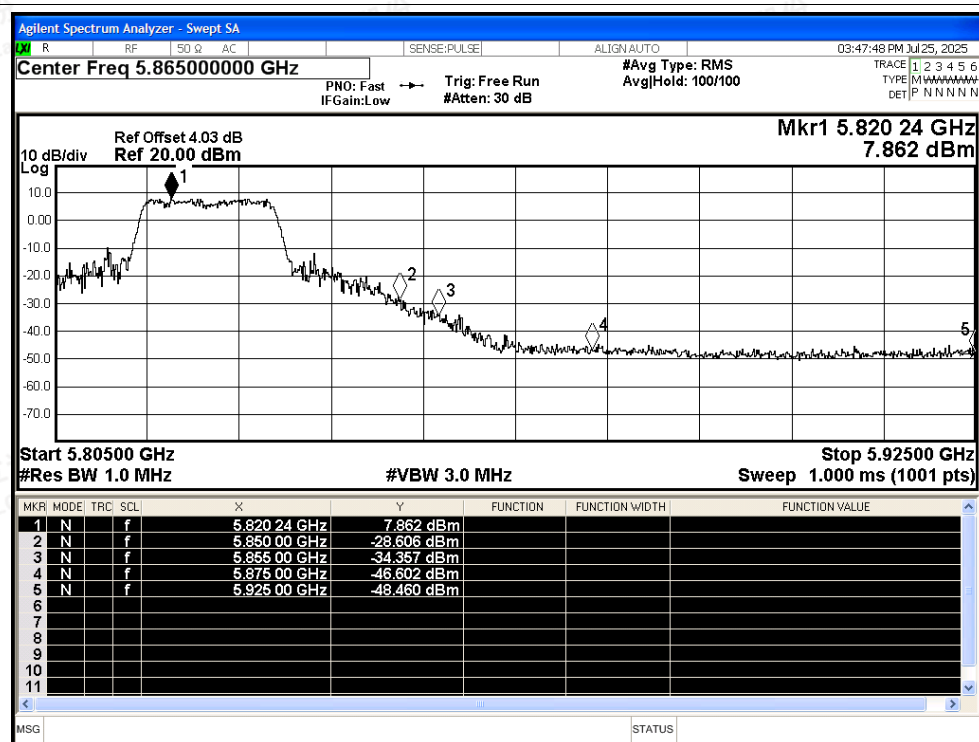

Restrict Band NVNT ac20 5825MHz Ant2 Average

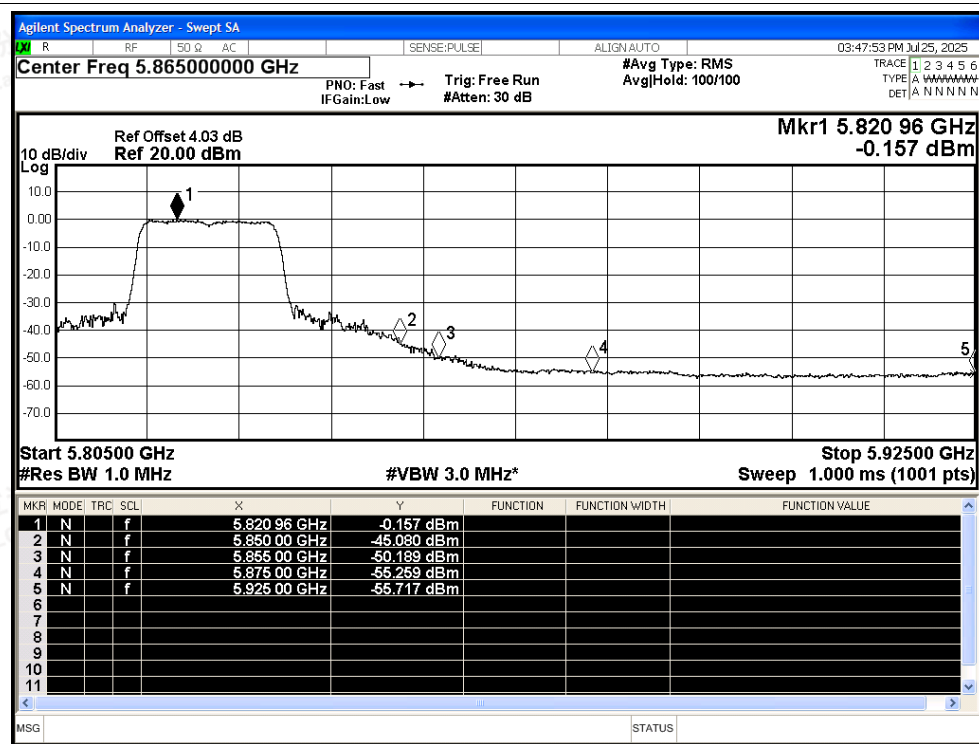

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant2 Peak

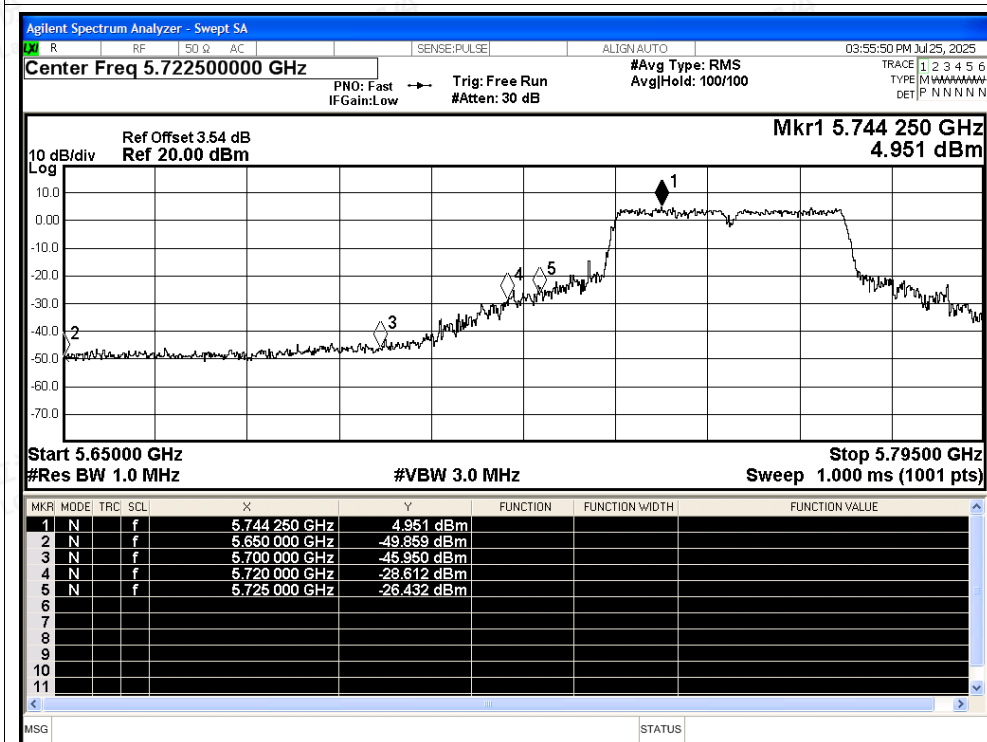

Restrict Band NVNT ac40 5755MHz Ant2 Average

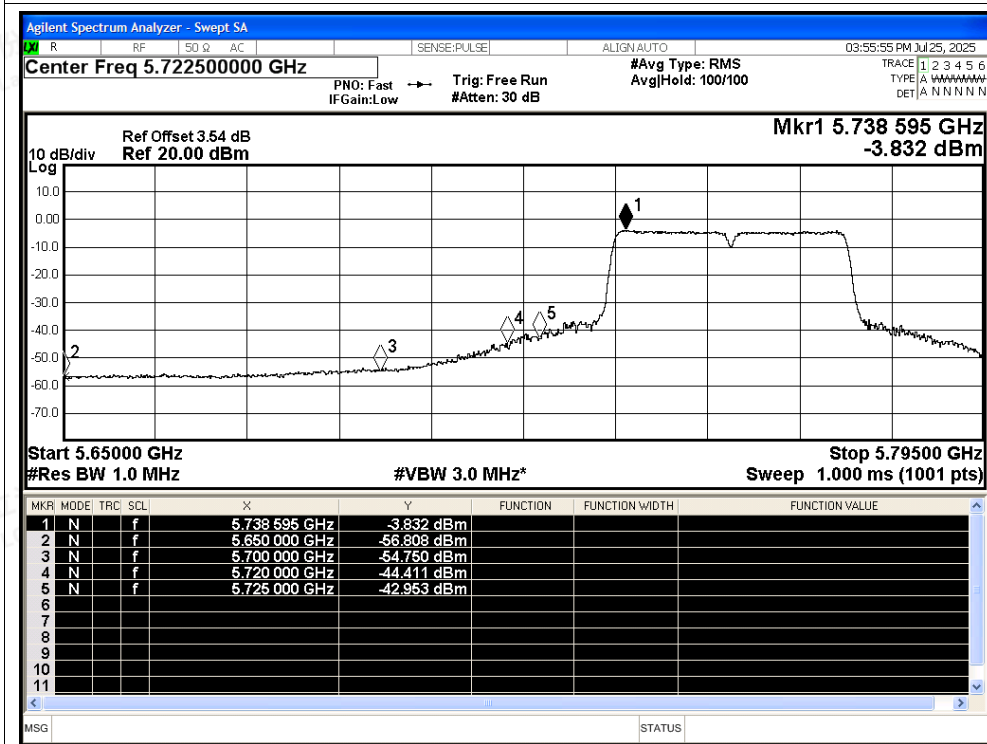

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant2 Peak

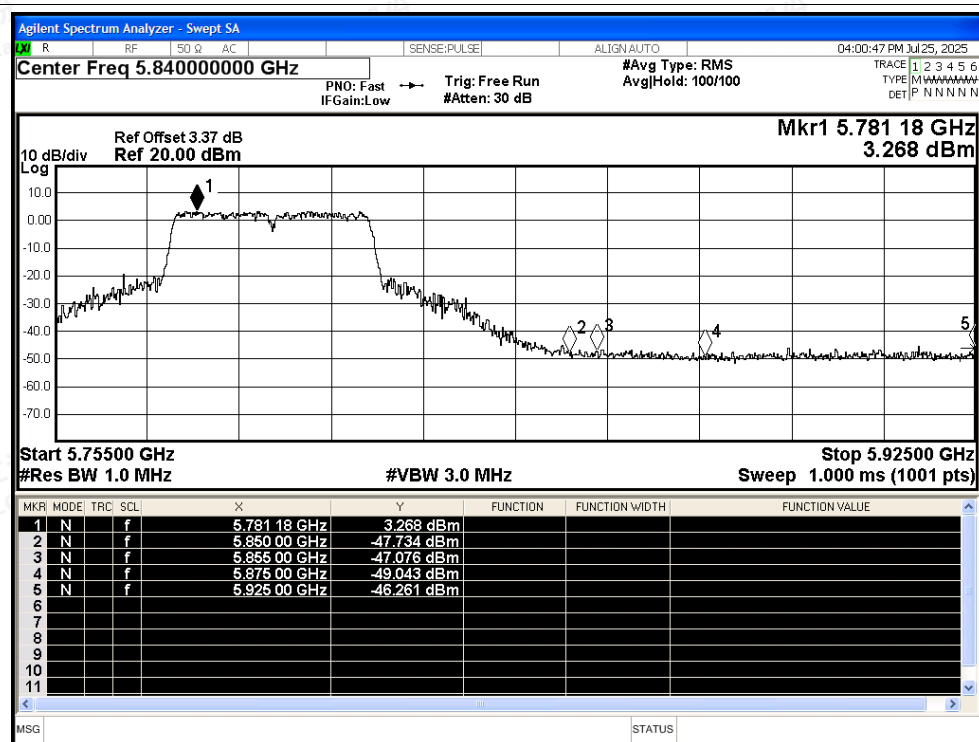

Restrict Band NVNT ac40 5795MHz Ant2 Average

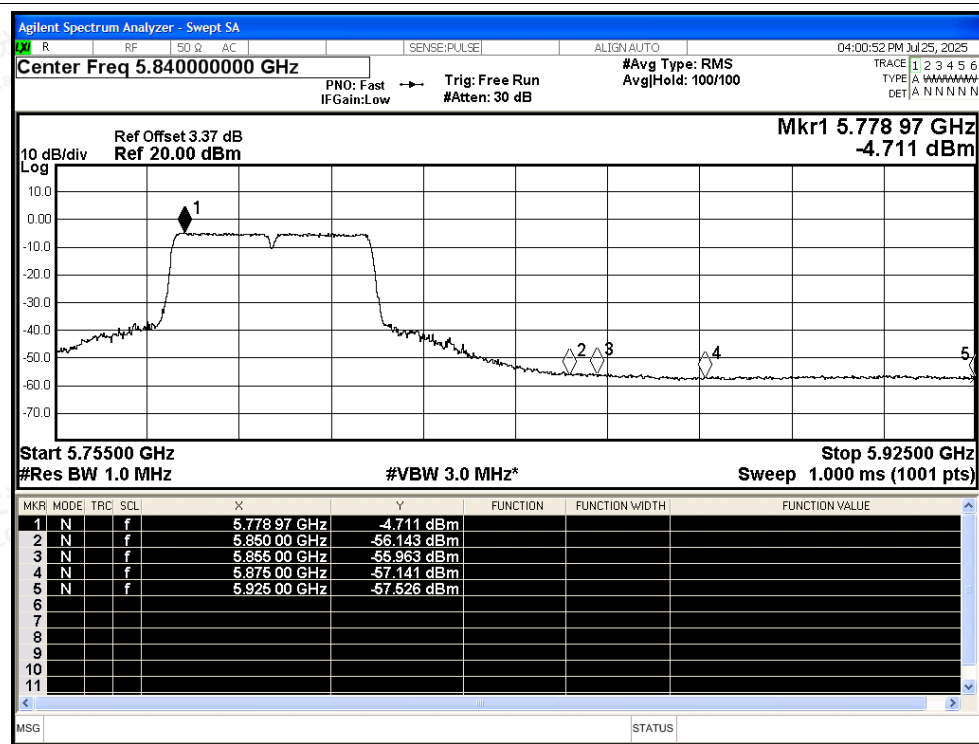

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant2 Peak

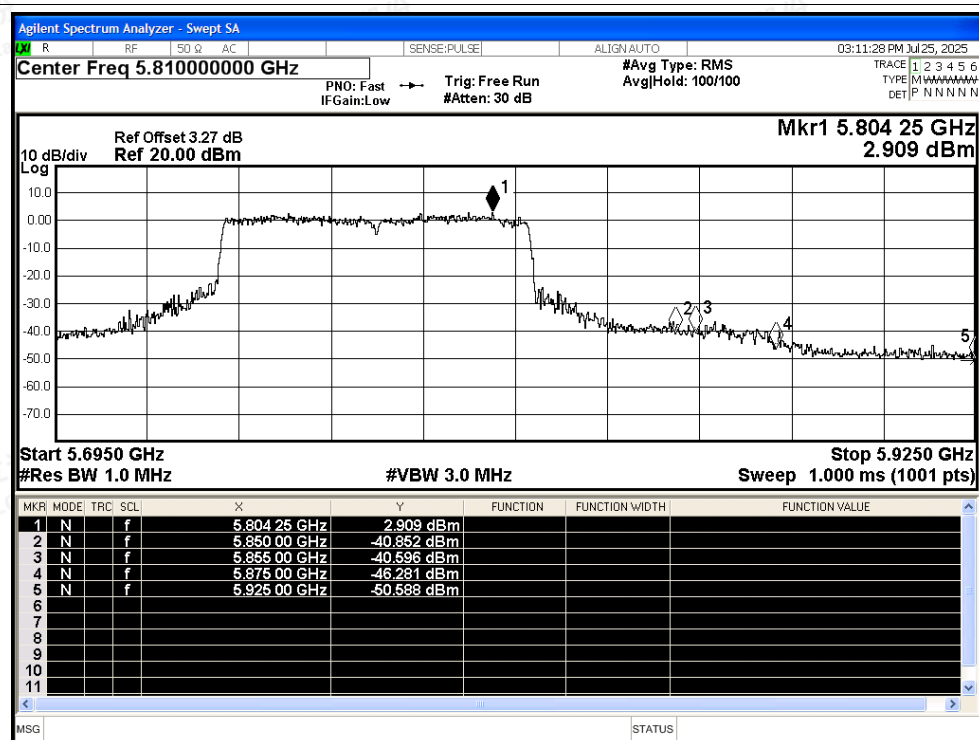

Restrict Band NVNT ac80 5775MHz Ant2 Average

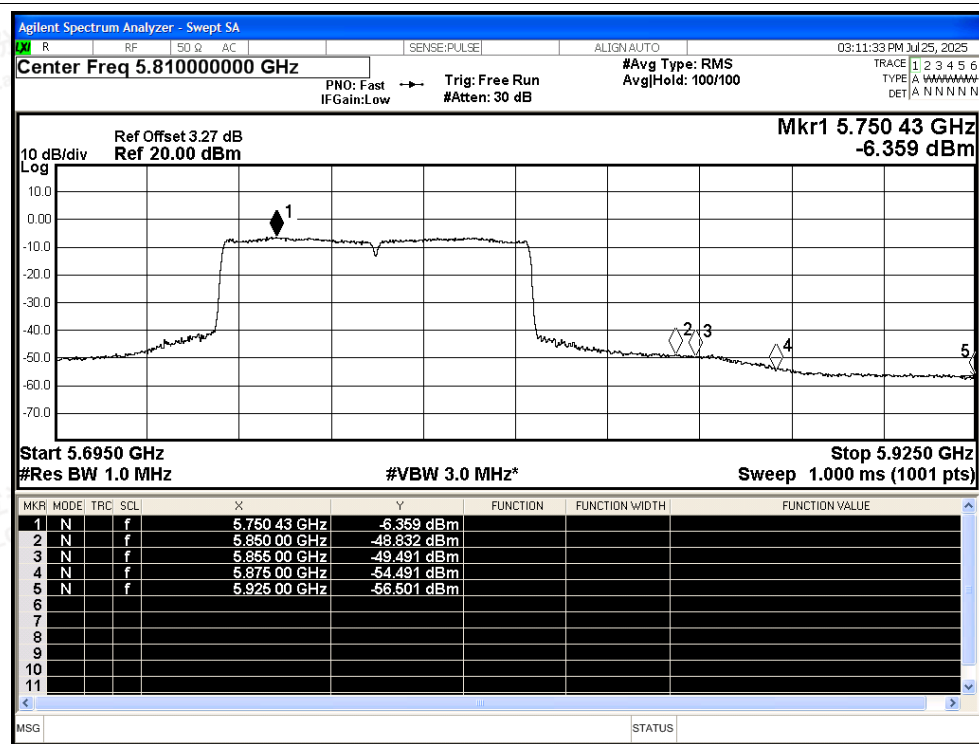

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant2 Peak

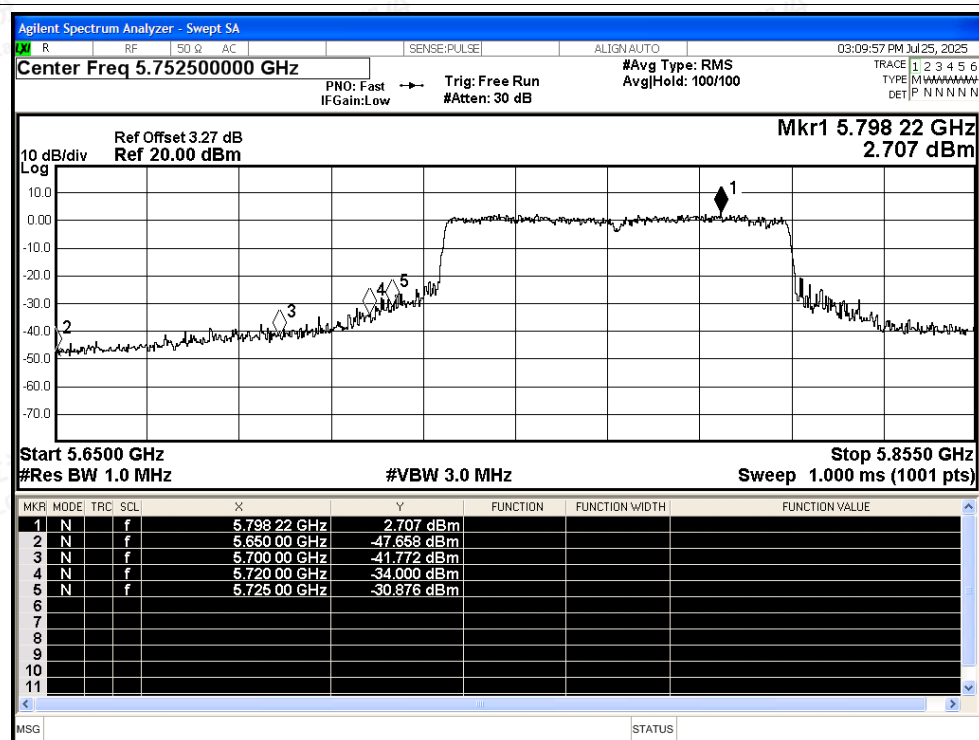

Restrict Band NVNT ac80 5775MHz Ant2 Average

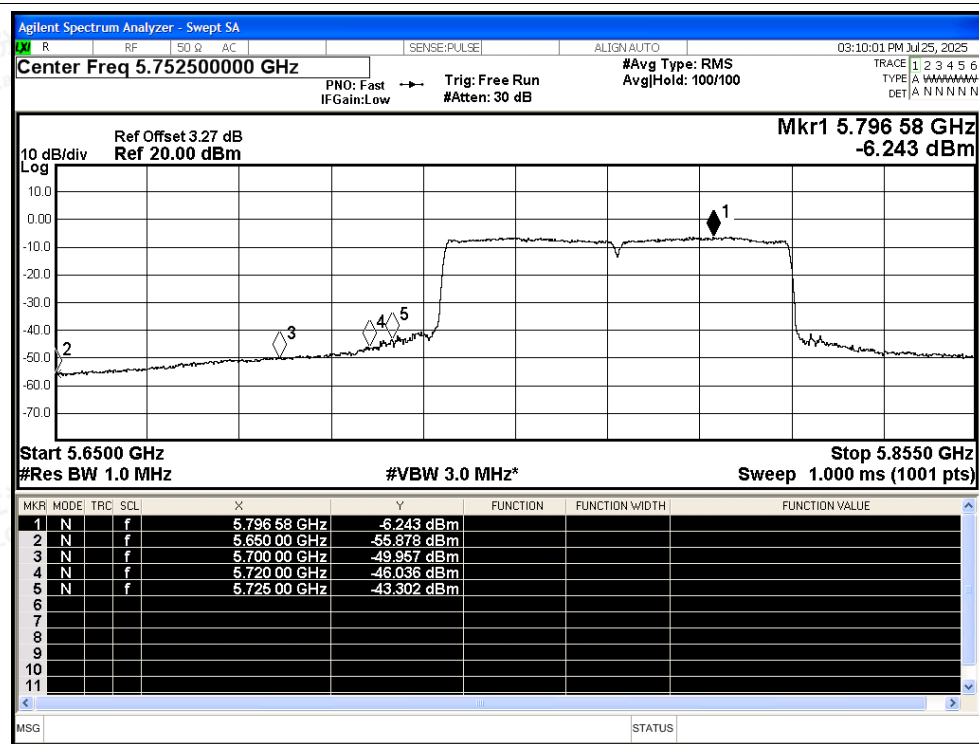

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant2 Peak

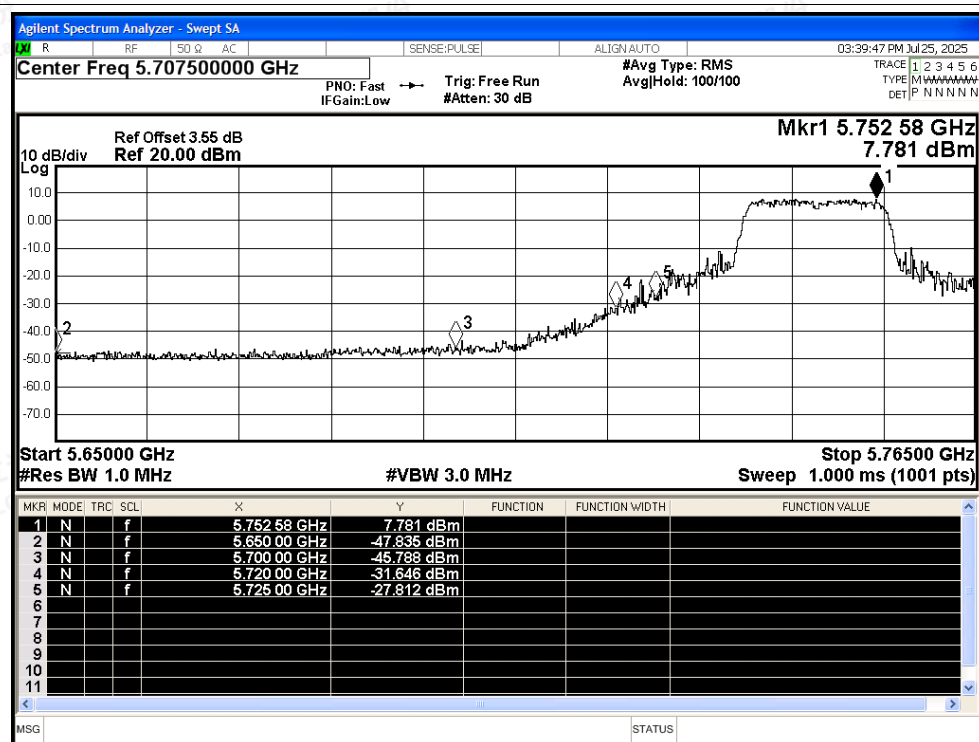

Restrict Band NVNT ax20 5745MHz Ant2 Average

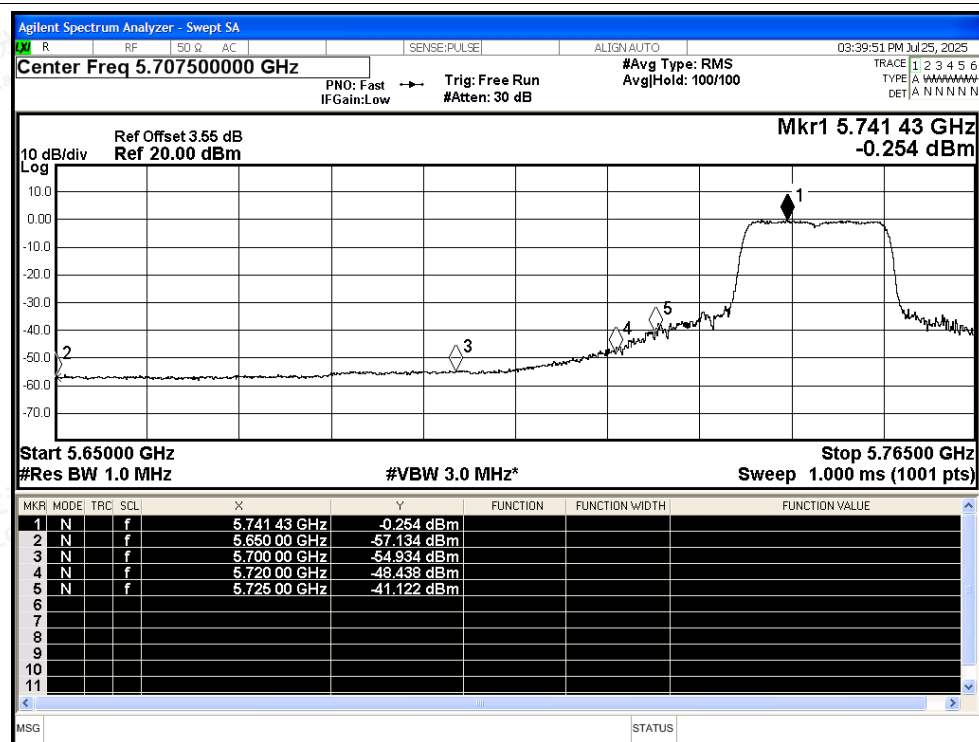

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant2 Peak

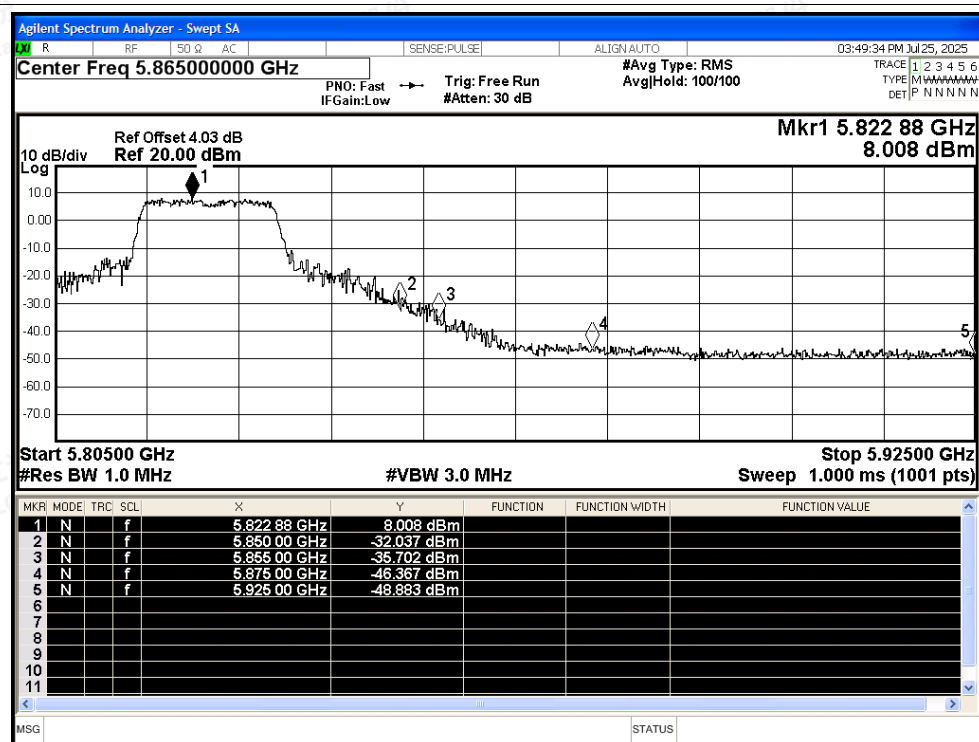

Restrict Band NVNT ax20 5825MHz Ant2 Average

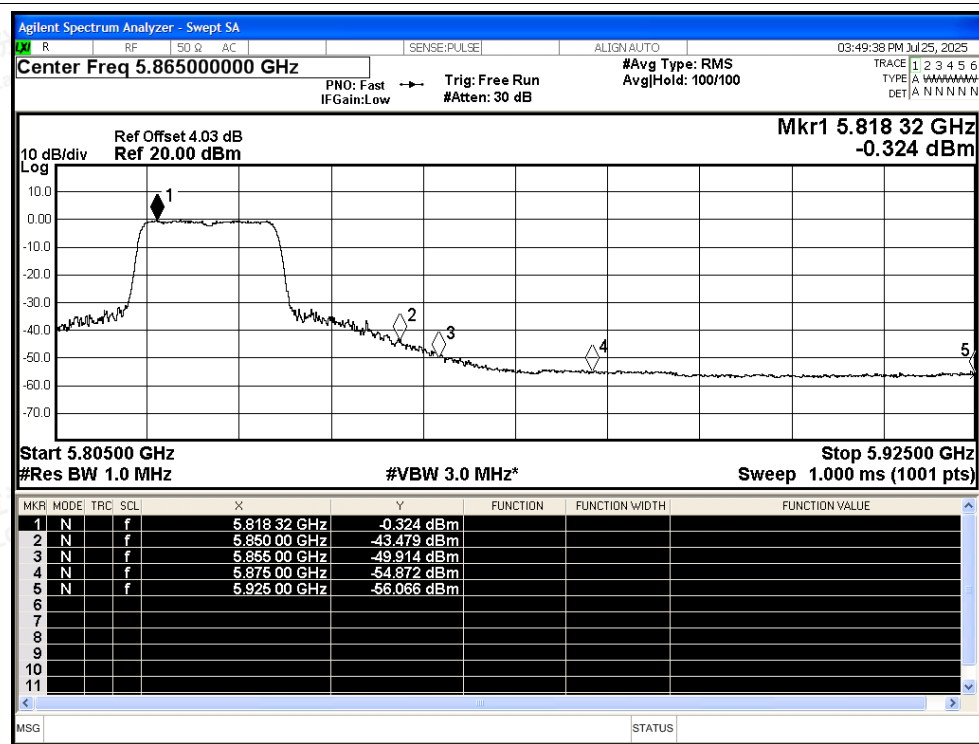

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant2 Peak

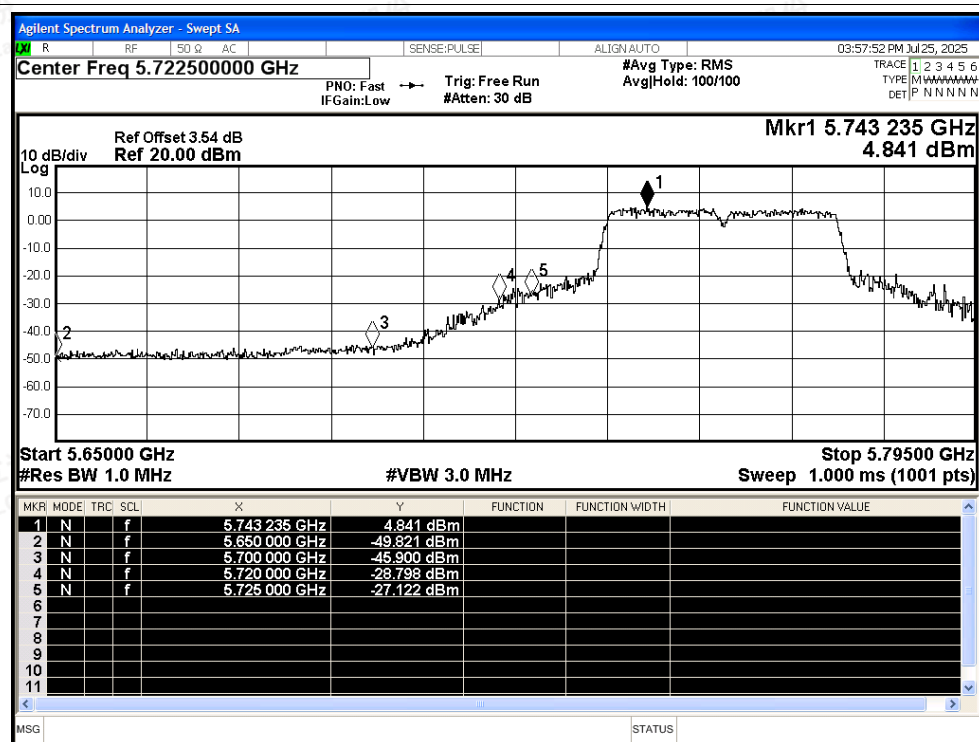

Restrict Band NVNT ax40 5755MHz Ant2 Average

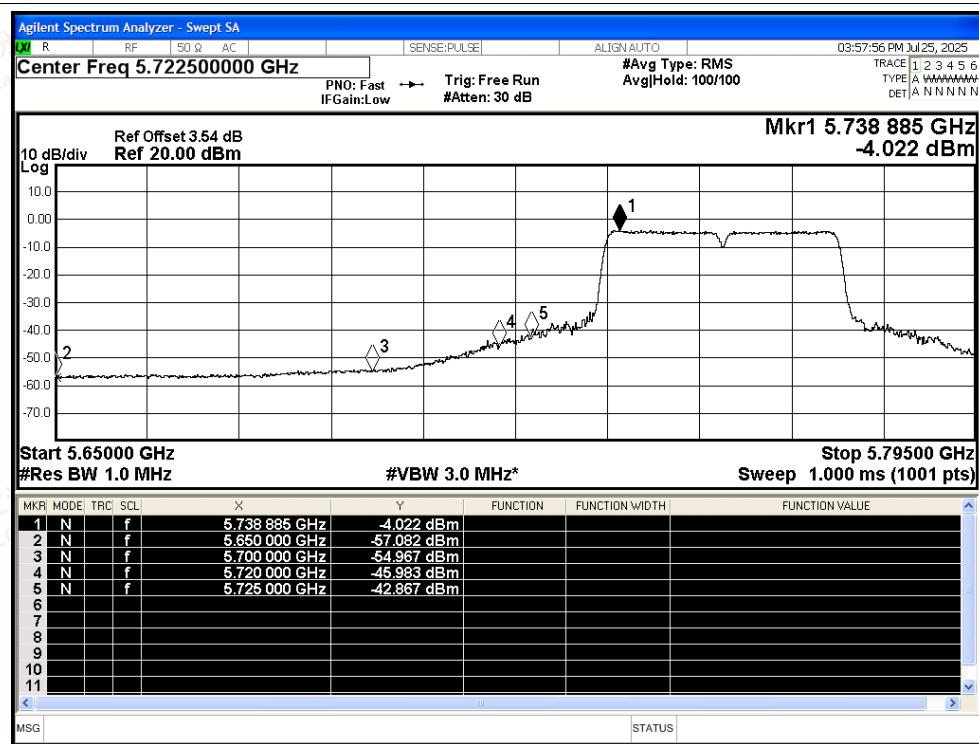

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant2 Peak

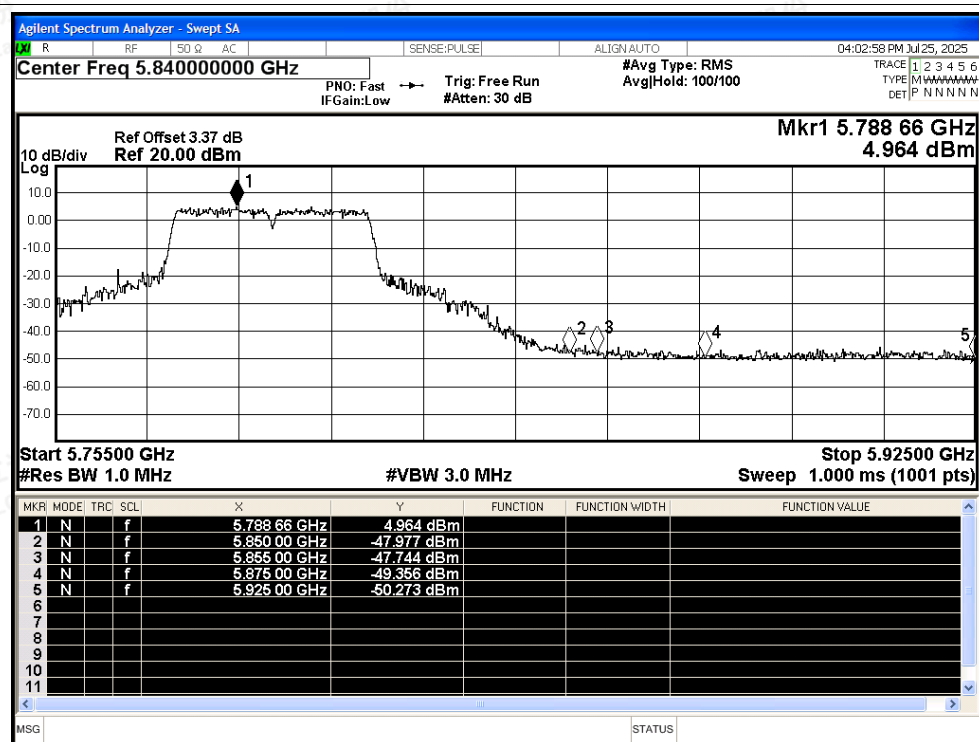

Restrict Band NVNT ax40 5795MHz Ant2 Average

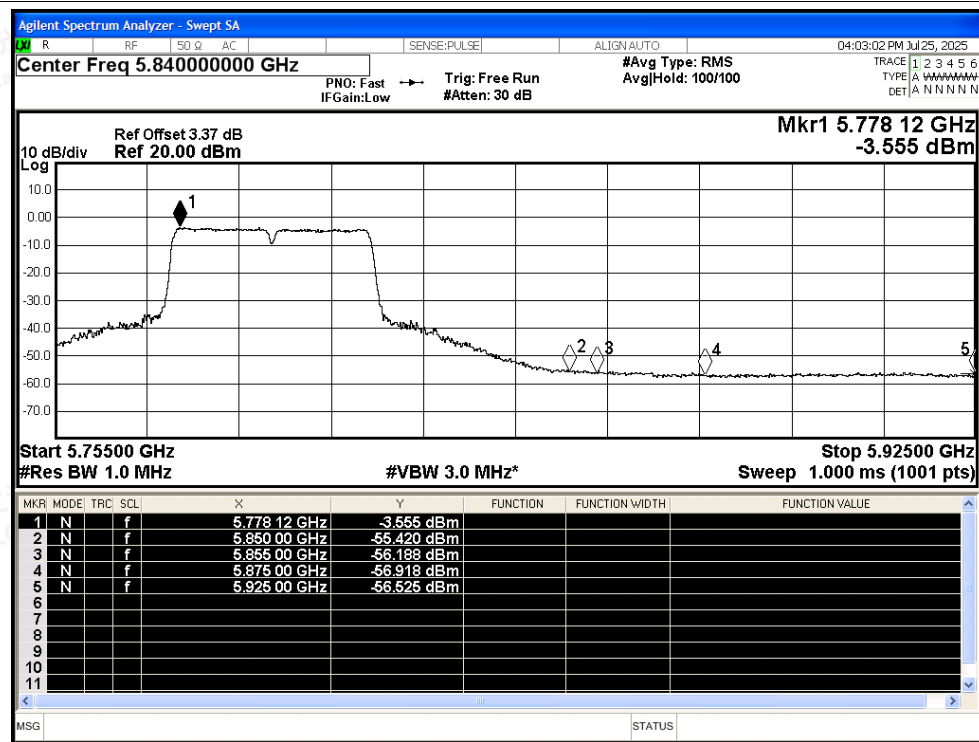

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

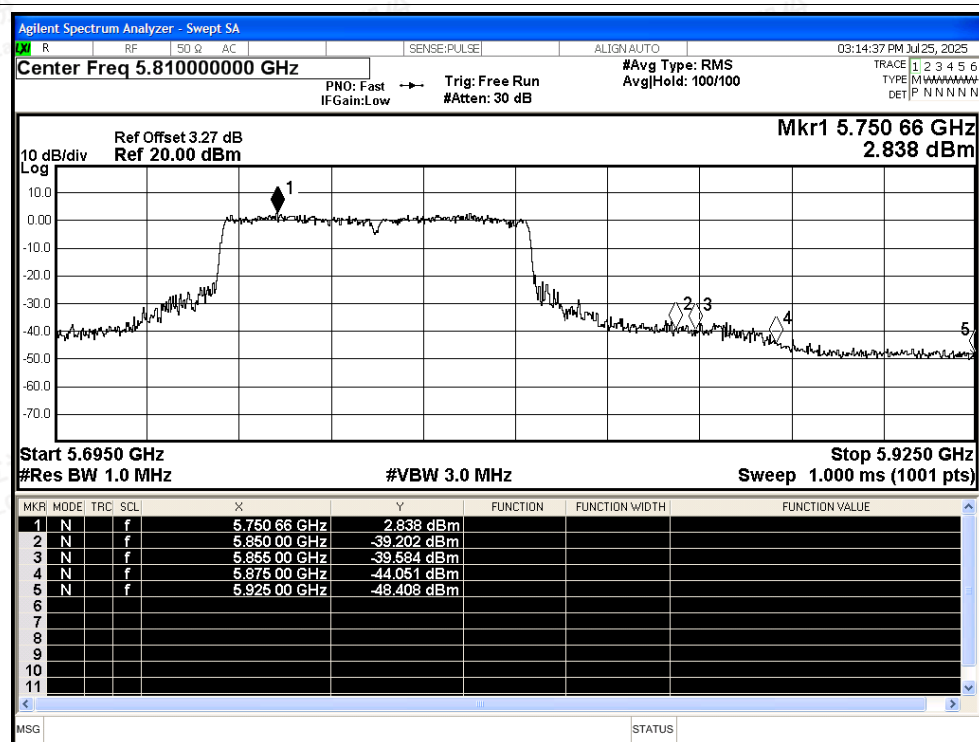

Restrict Band NVNT ax80 5775MHz Ant2 Average

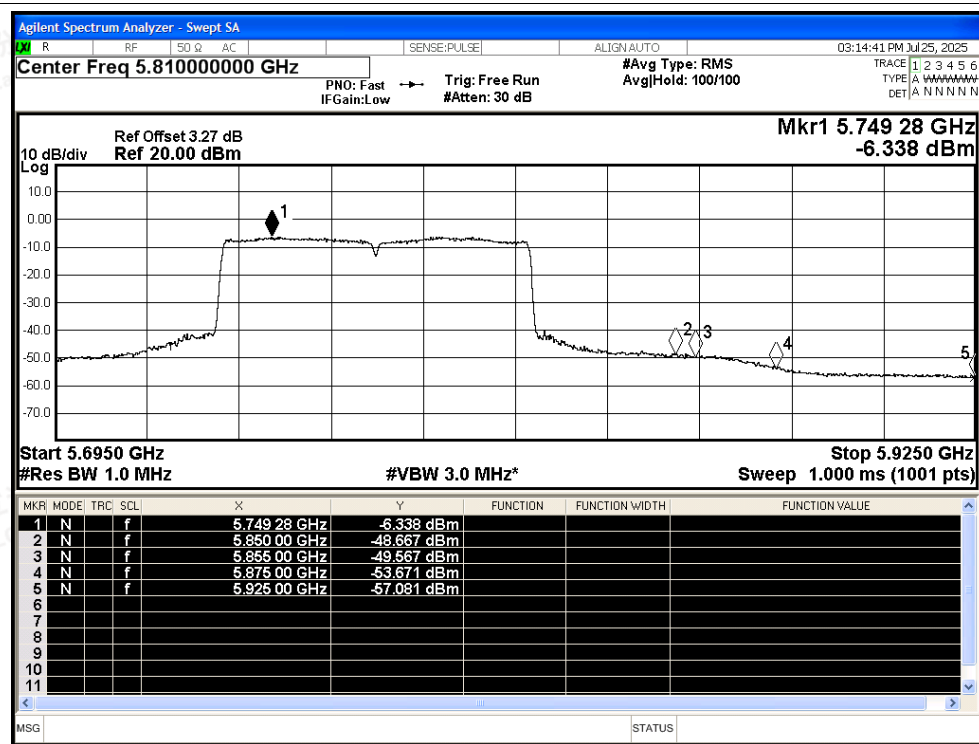

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

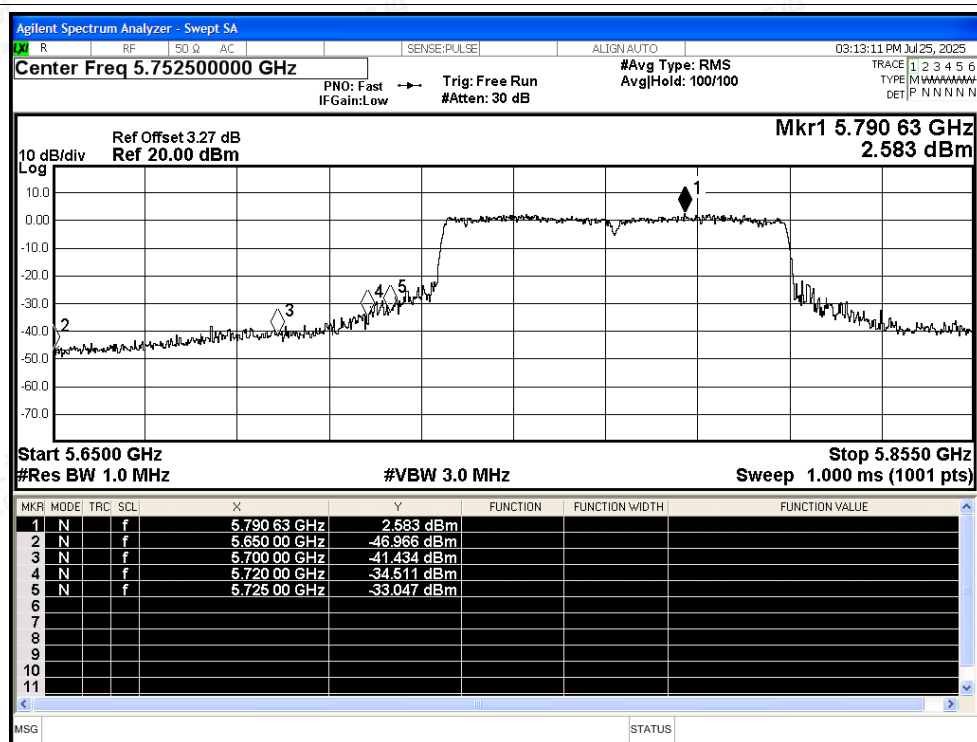

Restrict Band NVNT ax80 5775MHz Ant2 Average

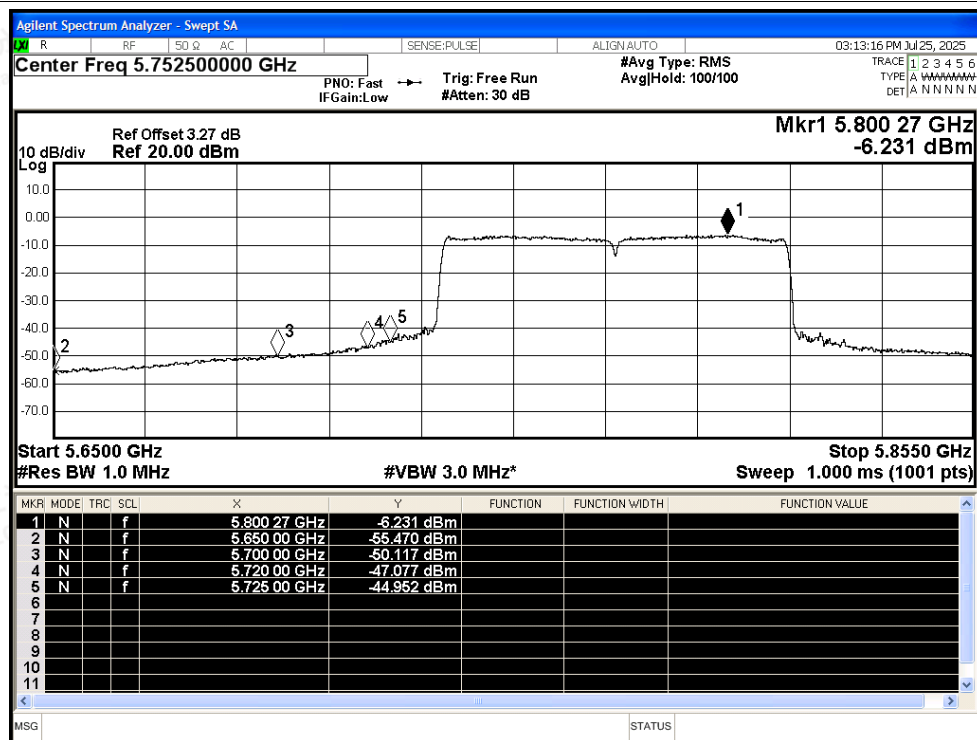

Restrict Band NVNT be20 5745MHz Ant2 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

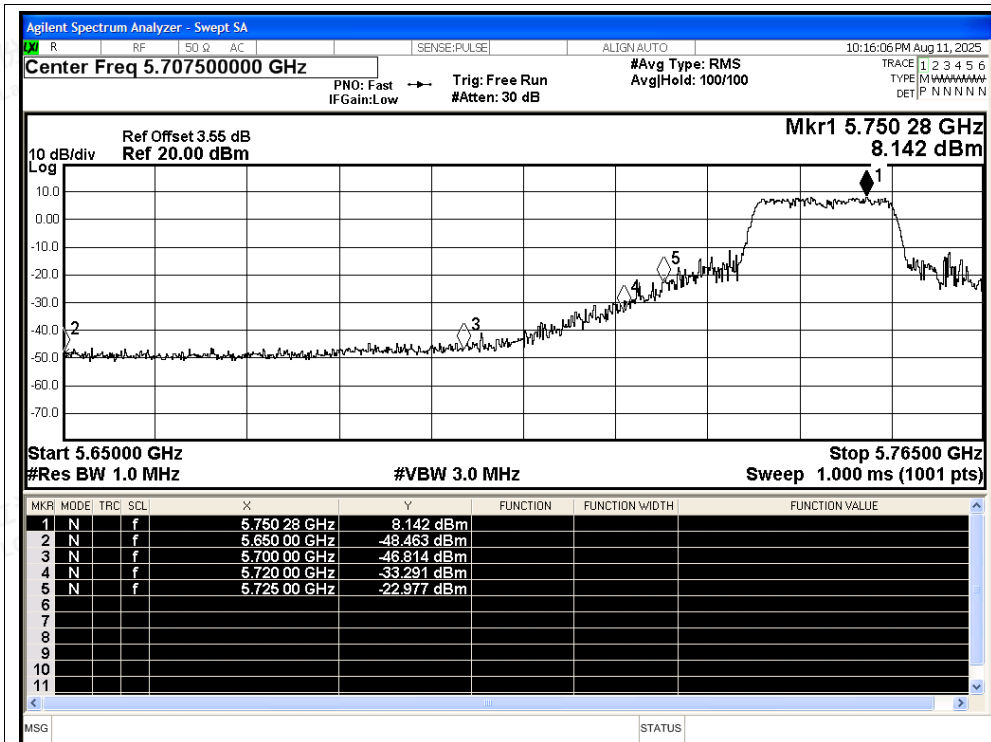

Restrict Band NVNT be20 5745MHz Ant2 Average

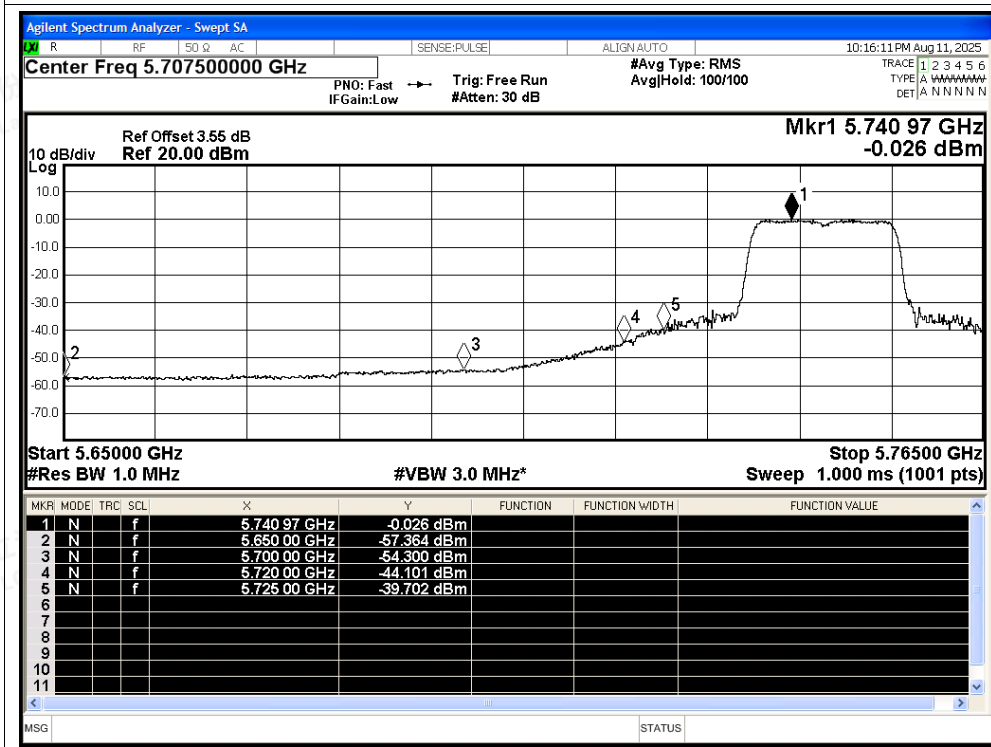

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5825MHz Ant2 Peak

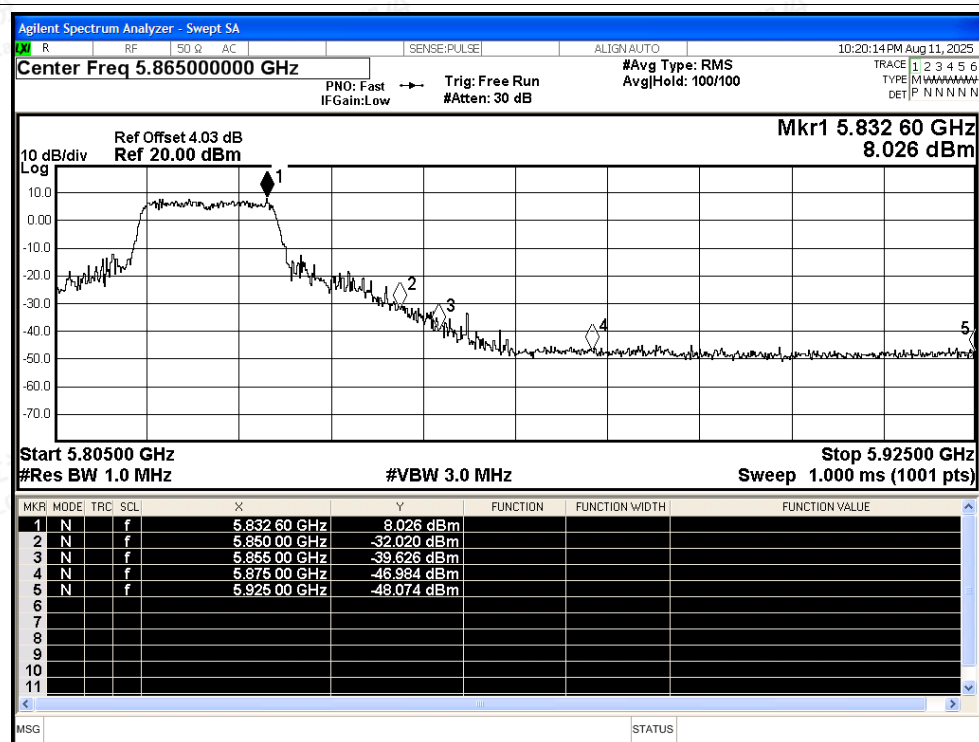

Restrict Band NVNT be20 5825MHz Ant2 Average

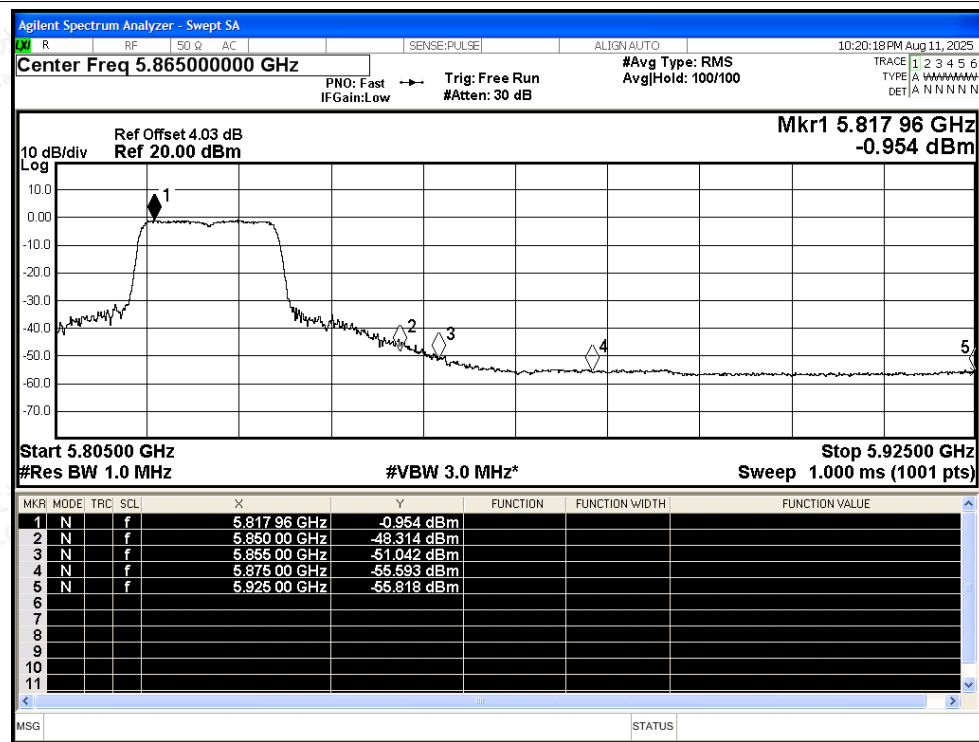

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5755MHz Ant2 Peak

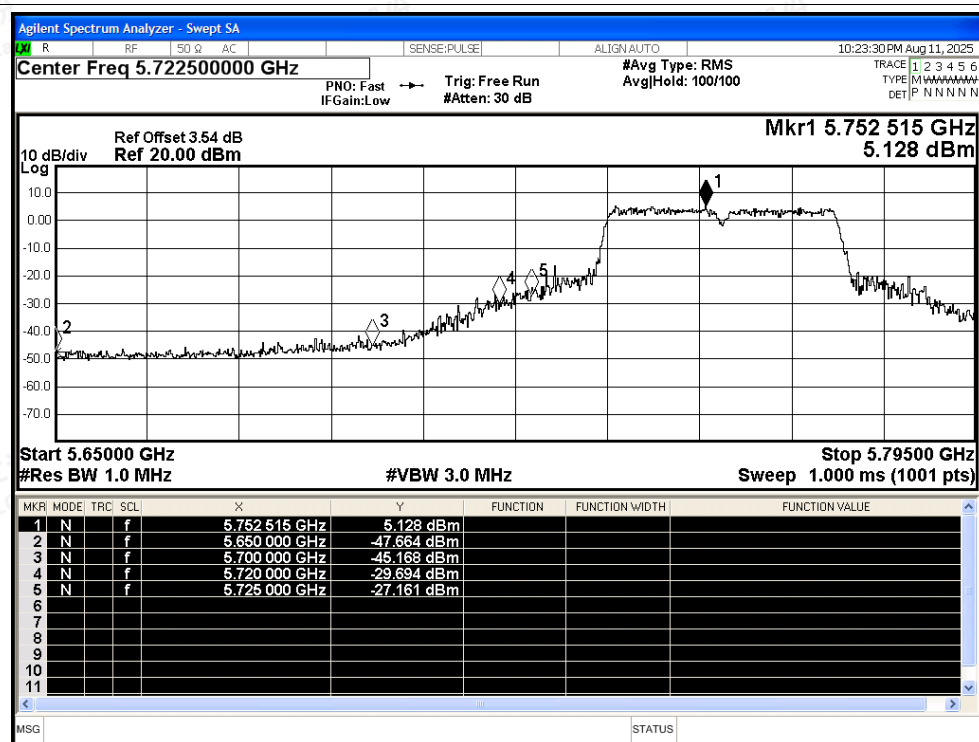

Restrict Band NVNT be40 5755MHz Ant2 Average

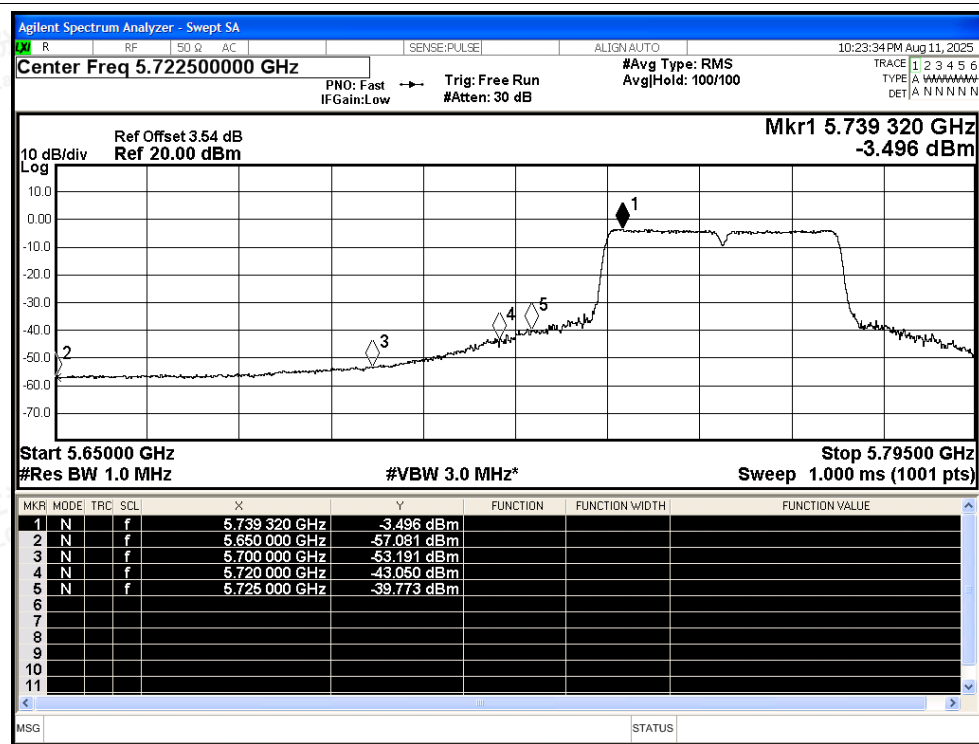

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5795MHz Ant2 Peak

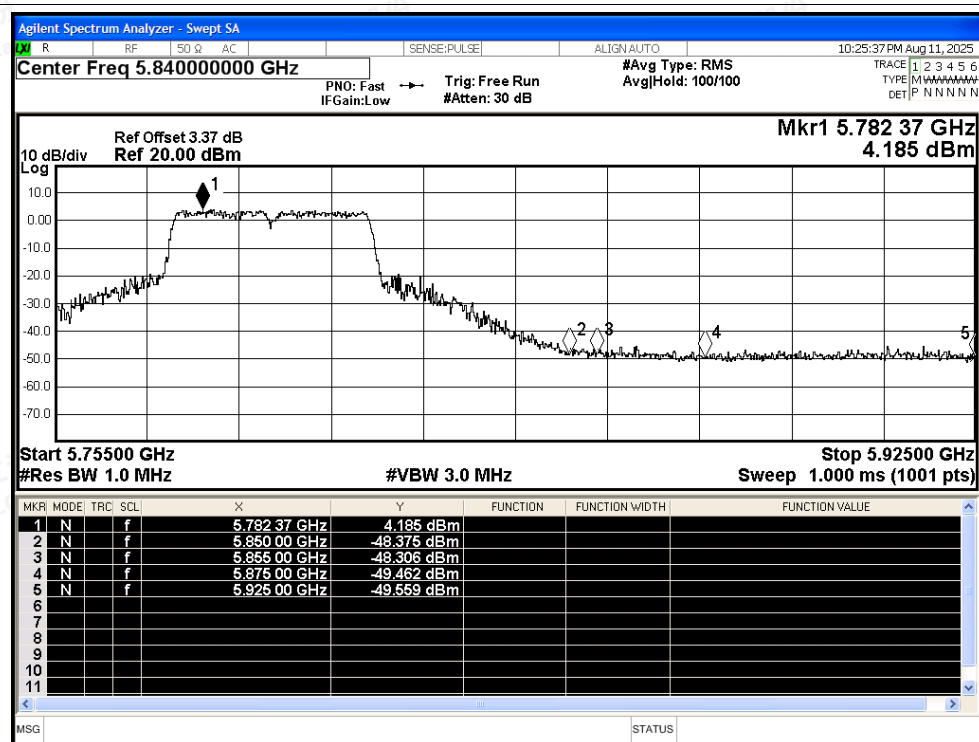

Restrict Band NVNT be40 5795MHz Ant2 Average

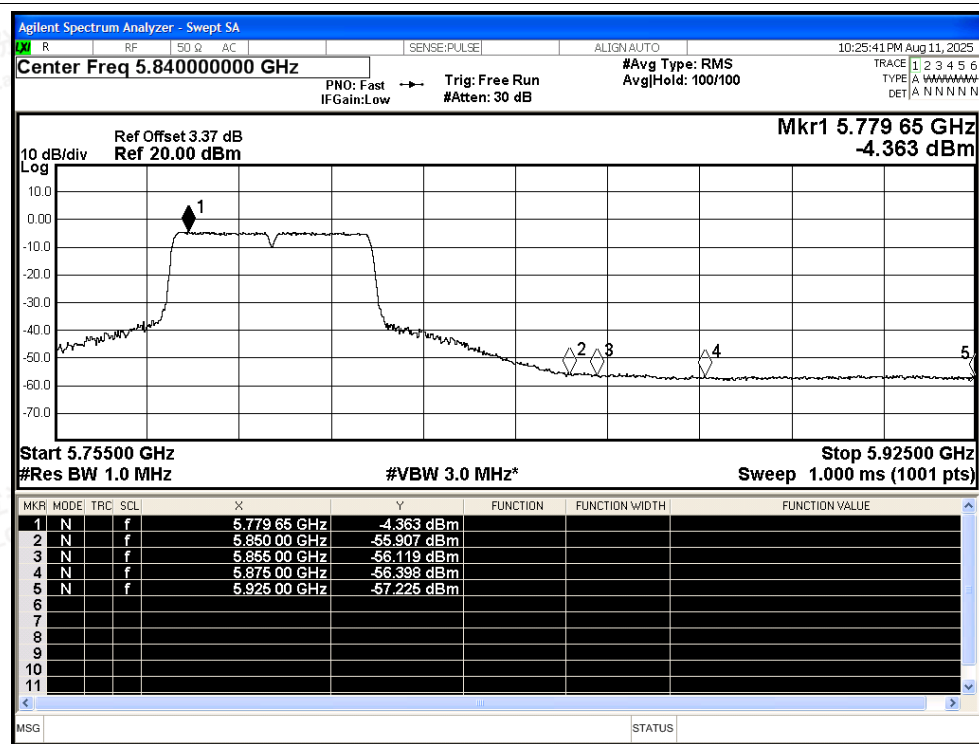

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant2 Peak

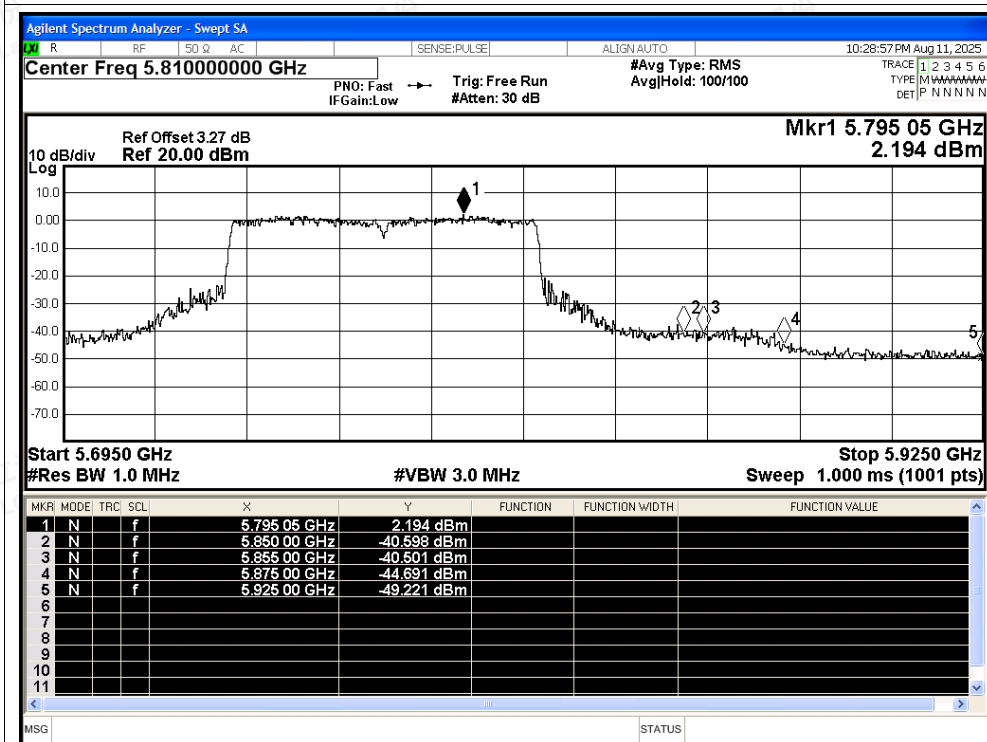

Restrict Band NVNT be80 5775MHz Ant2 Average

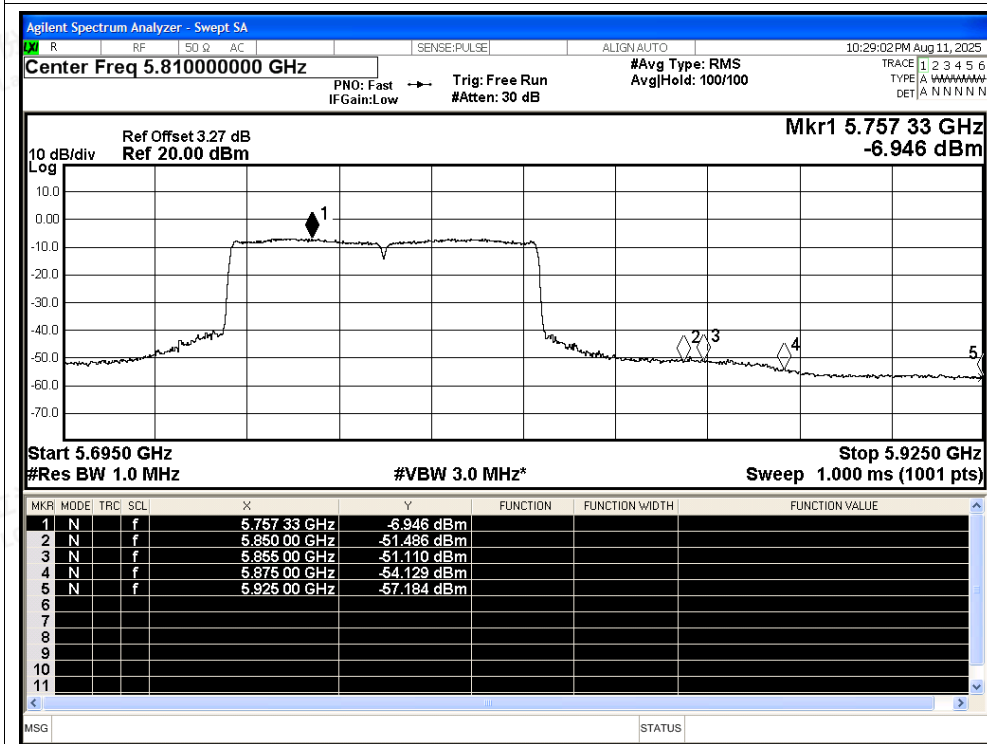

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant2 Peak

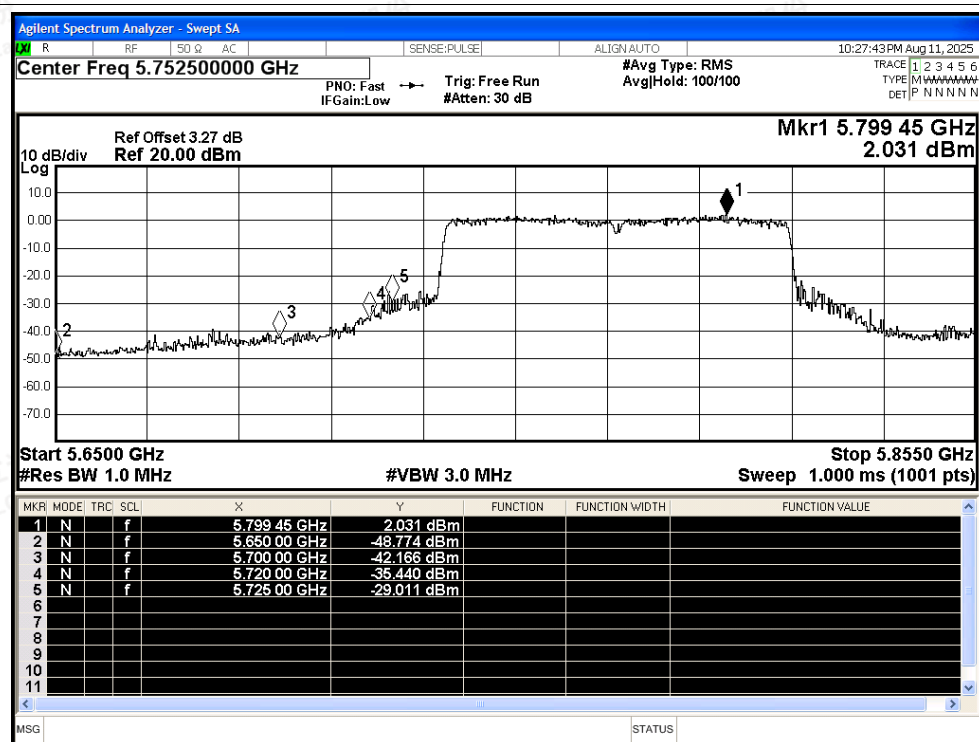

Restrict Band NVNT be80 5775MHz Ant2 Average

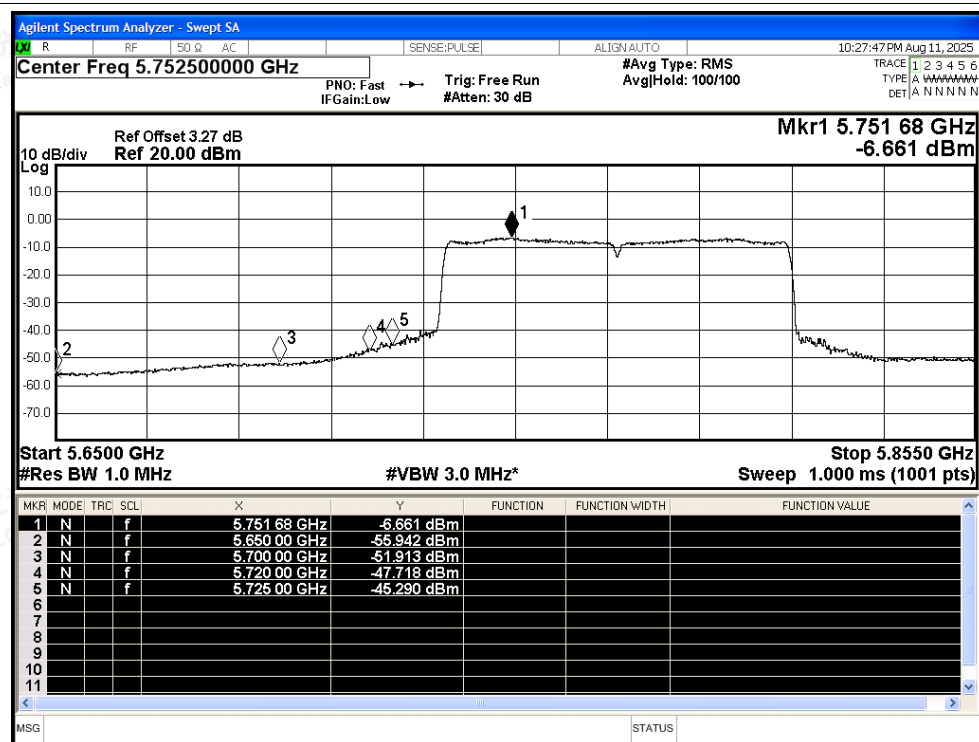

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant3	5650	-47.81	3.42	-	-44.39	Peak	-27	Pass
NVNT	a	5745	Ant3	5650	-56.84	3.42	0.24	-53.18	Average	-27	Pass
NVNT	a	5745	Ant3	5700	-47.93	3.42	-	-44.51	Peak	10	Pass
NVNT	a	5745	Ant3	5700	-54.48	3.42	0.24	-50.82	Average	10	Pass
NVNT	a	5745	Ant3	5720	-34.25	3.42	-	-30.83	Peak	15.6	Pass
NVNT	a	5745	Ant3	5720	-47.36	3.42	0.24	-43.70	Average	15.6	Pass
NVNT	a	5745	Ant3	5725	-30.48	3.42	-	-27.06	Peak	27	Pass
NVNT	a	5745	Ant3	5725	-39.71	3.42	0.24	-36.05	Average	27	Pass
NVNT	a	5825	Ant3	5850	-35.07	3.42	-	-31.65	Peak	27	Pass
NVNT	a	5825	Ant3	5850	-47.91	3.42	0.24	-44.25	Average	27	Pass
NVNT	a	5825	Ant3	5855	-41.64	3.42	-	-38.22	Peak	15.6	Pass
NVNT	a	5825	Ant3	5855	-52.57	3.42	0.24	-48.91	Average	15.6	Pass
NVNT	a	5825	Ant3	5875	-47.5	3.42	-	-44.08	Peak	10	Pass
NVNT	a	5825	Ant3	5875	-54.55	3.42	0.24	-50.89	Average	10	Pass
NVNT	a	5825	Ant3	5925	-46.49	3.42	-	-43.07	Peak	-27	Pass
NVNT	a	5825	Ant3	5925	-55.48	3.42	0.24	-51.82	Average	-27	Pass
NVNT	n20	5745	Ant3	5650	-49.77	3.42	-	-46.35	Peak	-27	Pass
NVNT	n20	5745	Ant3	5650	-56.69	3.42	0.12	-53.15	Average	-27	Pass
NVNT	n20	5745	Ant3	5700	-47.07	3.42	-	-43.65	Peak	10	Pass
NVNT	n20	5745	Ant3	5700	-54.6	3.42	0.12	-51.06	Average	10	Pass
NVNT	n20	5745	Ant3	5720	-31.82	3.42	-	-28.40	Peak	15.6	Pass
NVNT	n20	5745	Ant3	5720	-45.79	3.42	0.12	-42.25	Average	15.6	Pass
NVNT	n20	5745	Ant3	5725	-24.78	3.42	-	-21.36	Peak	27	Pass
NVNT	n20	5745	Ant3	5725	-41.25	3.42	0.12	-37.71	Average	27	Pass
NVNT	n20	5825	Ant3	5850	-30.02	3.42	-	-26.60	Peak	27	Pass
NVNT	n20	5825	Ant3	5850	-45.95	3.42	0.12	-42.41	Average	27	Pass
NVNT	n20	5825	Ant3	5855	-39.09	3.42	-	-35.67	Peak	15.6	Pass
NVNT	n20	5825	Ant3	5855	-50.12	3.42	0.12	-46.58	Average	15.6	Pass
NVNT	n20	5825	Ant3	5875	-47.89	3.42	-	-44.47	Peak	10	Pass
NVNT	n20	5825	Ant3	5875	-54.93	3.42	0.12	-51.39	Average	10	Pass
NVNT	n20	5825	Ant3	5925	-47.21	3.42	-	-43.79	Peak	-27	Pass
NVNT	n20	5825	Ant3	5925	-55.75	3.42	0.12	-52.21	Average	-27	Pass
NVNT	n40	5755	Ant3	5650	-48.78	3.42	-	-45.36	Peak	-27	Pass
NVNT	n40	5755	Ant3	5650	-57.12	3.42	0.24	-53.46	Average	-27	Pass
NVNT	n40	5755	Ant3	5700	-46.03	3.42	-	-42.61	Peak	10	Pass
NVNT	n40	5755	Ant3	5700	-53.65	3.42	0.24	-49.99	Average	10	Pass
NVNT	n40	5755	Ant3	5720	-34.92	3.42	-	-31.50	Peak	15.6	Pass
NVNT	n40	5755	Ant3	5720	-44.58	3.42	0.24	-40.92	Average	15.6	Pass
NVNT	n40	5755	Ant3	5725	-26.69	3.42	-	-23.27	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant3	5725	-41.9	3.42	0.24	-38.24	Average	27	Pass
NVNT	n40	5795	Ant3	5850	-48.27	3.42	-	-44.85	Peak	27	Pass
NVNT	n40	5795	Ant3	5850	-56.04	3.42	0.23	-52.39	Average	27	Pass
NVNT	n40	5795	Ant3	5855	-48.69	3.42	-	-45.27	Peak	15.6	Pass
NVNT	n40	5795	Ant3	5855	-56.16	3.42	0.23	-52.51	Average	15.6	Pass
NVNT	n40	5795	Ant3	5875	-48.9	3.42	-	-45.48	Peak	10	Pass
NVNT	n40	5795	Ant3	5875	-57.26	3.42	0.23	-53.61	Average	10	Pass
NVNT	n40	5795	Ant3	5925	-49.12	3.42	-	-45.70	Peak	-27	Pass
NVNT	n40	5795	Ant3	5925	-56.98	3.42	0.23	-53.33	Average	-27	Pass
NVNT	ac20	5745	Ant3	5650	-48	3.42	-	-44.58	Peak	-27	Pass
NVNT	ac20	5745	Ant3	5650	-57.06	3.42	0.12	-53.52	Average	-27	Pass
NVNT	ac20	5745	Ant3	5700	-45.94	3.42	-	-42.52	Peak	10	Pass
NVNT	ac20	5745	Ant3	5700	-54.59	3.42	0.12	-51.05	Average	10	Pass
NVNT	ac20	5745	Ant3	5720	-29.43	3.42	-	-26.01	Peak	15.6	Pass
NVNT	ac20	5745	Ant3	5720	-45.83	3.42	0.12	-42.29	Average	15.6	Pass
NVNT	ac20	5745	Ant3	5725	-21.14	3.42	-	-17.72	Peak	27	Pass
NVNT	ac20	5745	Ant3	5725	-39.32	3.42	0.12	-35.78	Average	27	Pass
NVNT	ac20	5825	Ant3	5850	-32.74	3.42	-	-29.32	Peak	27	Pass
NVNT	ac20	5825	Ant3	5850	-44.45	3.42	0.12	-40.91	Average	27	Pass
NVNT	ac20	5825	Ant3	5855	-39.77	3.42	-	-36.35	Peak	15.6	Pass
NVNT	ac20	5825	Ant3	5855	-49.99	3.42	0.12	-46.45	Average	15.6	Pass
NVNT	ac20	5825	Ant3	5875	-45.31	3.42	-	-41.89	Peak	10	Pass
NVNT	ac20	5825	Ant3	5875	-55.12	3.42	0.12	-51.58	Average	10	Pass
NVNT	ac20	5825	Ant3	5925	-47.82	3.42	-	-44.40	Peak	-27	Pass
NVNT	ac20	5825	Ant3	5925	-55.43	3.42	0.12	-51.89	Average	-27	Pass
NVNT	ac40	5755	Ant3	5650	-47.81	3.42	-	-44.39	Peak	-27	Pass
NVNT	ac40	5755	Ant3	5650	-57.01	3.42	0.23	-53.36	Average	-27	Pass
NVNT	ac40	5755	Ant3	5700	-45.61	3.42	-	-42.19	Peak	10	Pass
NVNT	ac40	5755	Ant3	5700	-54.22	3.42	0.23	-50.57	Average	10	Pass
NVNT	ac40	5755	Ant3	5720	-30.11	3.42	-	-26.69	Peak	15.6	Pass
NVNT	ac40	5755	Ant3	5720	-44.19	3.42	0.23	-40.54	Average	15.6	Pass
NVNT	ac40	5755	Ant3	5725	-26.64	3.42	-	-23.22	Peak	27	Pass
NVNT	ac40	5755	Ant3	5725	-41.29	3.42	0.23	-37.64	Average	27	Pass
NVNT	ac40	5795	Ant3	5850	-47.51	3.42	-	-44.09	Peak	27	Pass
NVNT	ac40	5795	Ant3	5850	-56.45	3.42	0.24	-52.79	Average	27	Pass
NVNT	ac40	5795	Ant3	5855	-46.44	3.42	-	-43.02	Peak	15.6	Pass
NVNT	ac40	5795	Ant3	5855	-56.01	3.42	0.24	-52.35	Average	15.6	Pass
NVNT	ac40	5795	Ant3	5875	-50.02	3.42	-	-46.60	Peak	10	Pass
NVNT	ac40	5795	Ant3	5875	-57.45	3.42	0.24	-53.79	Average	10	Pass
NVNT	ac40	5795	Ant3	5925	-48.21	3.42	-	-44.79	Peak	-27	Pass
NVNT	ac40	5795	Ant3	5925	-57.31	3.42	0.24	-53.65	Average	-27	Pass
NVNT	ac80	5775	Ant3	5850	-39.87	3.42	-	-36.45	Peak	27	Pass
NVNT	ac80	5775	Ant3	5850	-51.02	3.42	0.47	-47.13	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant3	5855	-40.68	3.42	-	-37.26	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5855	-49.89	3.42	0.47	-46.00	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5875	-45.33	3.42	-	-41.91	Peak	10	Pass
NVNT	ac80	5775	Ant3	5875	-54	3.42	0.47	-50.11	Average	10	Pass
NVNT	ac80	5775	Ant3	5925	-49.53	3.42	-	-46.11	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5925	-56.96	3.42	0.47	-53.07	Average	-27	Pass
NVNT	ac80	5775	Ant3	5650	-46.95	3.42	-	-43.53	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5650	-55.95	3.42	0.47	-52.06	Average	-27	Pass
NVNT	ac80	5775	Ant3	5700	-41.59	3.42	-	-38.17	Peak	10	Pass
NVNT	ac80	5775	Ant3	5700	-50.84	3.42	0.47	-46.95	Average	10	Pass
NVNT	ac80	5775	Ant3	5720	-31.9	3.42	-	-28.48	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5720	-46.31	3.42	0.47	-42.42	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5725	-32.62	3.42	-	-29.20	Peak	27	Pass
NVNT	ac80	5775	Ant3	5725	-44.25	3.42	0.47	-40.36	Average	27	Pass
NVNT	ax20	5745	Ant3	5650	-47.95	3.42	-	-44.53	Peak	-27	Pass
NVNT	ax20	5745	Ant3	5650	-56.36	3.42	0.12	-52.82	Average	-27	Pass
NVNT	ax20	5745	Ant3	5700	-46.39	3.42	-	-42.97	Peak	10	Pass
NVNT	ax20	5745	Ant3	5700	-54.75	3.42	0.12	-51.21	Average	10	Pass
NVNT	ax20	5745	Ant3	5720	-30.85	3.42	-	-27.43	Peak	15.6	Pass
NVNT	ax20	5745	Ant3	5720	-43.1	3.42	0.12	-39.56	Average	15.6	Pass
NVNT	ax20	5745	Ant3	5725	-21.89	3.42	-	-18.47	Peak	27	Pass
NVNT	ax20	5745	Ant3	5725	-39.01	3.42	0.12	-35.47	Average	27	Pass
NVNT	ax20	5825	Ant3	5850	-30.96	3.42	-	-27.54	Peak	27	Pass
NVNT	ax20	5825	Ant3	5850	-45.15	3.42	0.12	-41.61	Average	27	Pass
NVNT	ax20	5825	Ant3	5855	-34.72	3.42	-	-31.30	Peak	15.6	Pass
NVNT	ax20	5825	Ant3	5855	-49.81	3.42	0.12	-46.27	Average	15.6	Pass
NVNT	ax20	5825	Ant3	5875	-46.44	3.42	-	-43.02	Peak	10	Pass
NVNT	ax20	5825	Ant3	5875	-54.48	3.42	0.12	-50.94	Average	10	Pass
NVNT	ax20	5825	Ant3	5925	-47.54	3.42	-	-44.12	Peak	-27	Pass
NVNT	ax20	5825	Ant3	5925	-55.3	3.42	0.12	-51.76	Average	-27	Pass
NVNT	ax40	5755	Ant3	5650	-47.78	3.42	-	-44.36	Peak	-27	Pass
NVNT	ax40	5755	Ant3	5650	-56.42	3.42	0.24	-52.76	Average	-27	Pass
NVNT	ax40	5755	Ant3	5700	-45.17	3.42	-	-41.75	Peak	10	Pass
NVNT	ax40	5755	Ant3	5700	-53.47	3.42	0.24	-49.81	Average	10	Pass
NVNT	ax40	5755	Ant3	5720	-31.99	3.42	-	-28.57	Peak	15.6	Pass
NVNT	ax40	5755	Ant3	5720	-43.77	3.42	0.24	-40.11	Average	15.6	Pass
NVNT	ax40	5755	Ant3	5725	-25.92	3.42	-	-22.50	Peak	27	Pass
NVNT	ax40	5755	Ant3	5725	-43.04	3.42	0.24	-39.38	Average	27	Pass
NVNT	ax40	5795	Ant3	5850	-48.35	3.42	-	-44.93	Peak	27	Pass
NVNT	ax40	5795	Ant3	5850	-56.22	3.42	0.24	-52.56	Average	27	Pass
NVNT	ax40	5795	Ant3	5855	-49.51	3.42	-	-46.09	Peak	15.6	Pass
NVNT	ax40	5795	Ant3	5855	-55.75	3.42	0.24	-52.09	Average	15.6	Pass
NVNT	ax40	5795	Ant3	5875	-48.75	3.42	-	-45.33	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant3	5875	-57.61	3.42	0.24	-53.95	Average	10	Pass
NVNT	ax40	5795	Ant3	5925	-48.29	3.42	-	-44.87	Peak	-27	Pass
NVNT	ax40	5795	Ant3	5925	-57.15	3.42	0.24	-53.49	Average	-27	Pass
NVNT	ax80	5775	Ant3	5850	-38.4	3.42	-	-34.98	Peak	27	Pass
NVNT	ax80	5775	Ant3	5850	-49.88	3.42	0.47	-45.99	Average	27	Pass
NVNT	ax80	5775	Ant3	5855	-40.98	3.42	-	-37.56	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5855	-50.75	3.42	0.47	-46.86	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5875	-44.19	3.42	-	-40.77	Peak	10	Pass
NVNT	ax80	5775	Ant3	5875	-53.29	3.42	0.47	-49.40	Average	10	Pass
NVNT	ax80	5775	Ant3	5925	-47.29	3.42	-	-43.87	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5925	-57.38	3.42	0.47	-53.49	Average	-27	Pass
NVNT	ax80	5775	Ant3	5650	-47.13	3.42	-	-43.71	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5650	-55.81	3.42	0.47	-51.92	Average	-27	Pass
NVNT	ax80	5775	Ant3	5700	-42.79	3.42	-	-39.37	Peak	10	Pass
NVNT	ax80	5775	Ant3	5700	-50.53	3.42	0.47	-46.64	Average	10	Pass
NVNT	ax80	5775	Ant3	5720	-34.62	3.42	-	-31.20	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5720	-46.88	3.42	0.47	-42.99	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5725	-31.61	3.42	-	-28.19	Peak	27	Pass
NVNT	ax80	5775	Ant3	5725	-44.25	3.42	0.47	-40.36	Average	27	Pass
NVNT	be20	5745	Ant3	5650	-50.04	3.42	-	-46.62	Peak	-27	Pass
NVNT	be20	5745	Ant3	5650	-56.46	3.42	0.12	-52.92	Average	-27	Pass
NVNT	be20	5745	Ant3	5700	-48.26	3.42	-	-44.84	Peak	10	Pass
NVNT	be20	5745	Ant3	5700	-54.86	3.42	0.12	-51.32	Average	10	Pass
NVNT	be20	5745	Ant3	5720	-27.55	3.42	-	-24.13	Peak	15.6	Pass
NVNT	be20	5745	Ant3	5720	-43.37	3.42	0.12	-39.83	Average	15.6	Pass
NVNT	be20	5745	Ant3	5725	-17.72	3.42	-	-14.30	Peak	27	Pass
NVNT	be20	5745	Ant3	5725	-38.33	3.42	0.12	-34.79	Average	27	Pass
NVNT	be20	5825	Ant3	5850	-30.02	3.42	-	-26.60	Peak	27	Pass
NVNT	be20	5825	Ant3	5850	-45.87	3.42	0.12	-42.33	Average	27	Pass
NVNT	be20	5825	Ant3	5855	-31.02	3.42	-	-27.60	Peak	15.6	Pass
NVNT	be20	5825	Ant3	5855	-50.26	3.42	0.12	-46.72	Average	15.6	Pass
NVNT	be20	5825	Ant3	5875	-48.4	3.42	-	-44.98	Peak	10	Pass
NVNT	be20	5825	Ant3	5875	-54.68	3.42	0.12	-51.14	Average	10	Pass
NVNT	be20	5825	Ant3	5925	-48.36	3.42	-	-44.94	Peak	-27	Pass
NVNT	be20	5825	Ant3	5925	-55.72	3.42	0.12	-52.18	Average	-27	Pass
NVNT	be40	5755	Ant3	5650	-48.51	3.42	-	-45.09	Peak	-27	Pass
NVNT	be40	5755	Ant3	5650	-56.83	3.42	0.24	-53.17	Average	-27	Pass
NVNT	be40	5755	Ant3	5700	-45.69	3.42	-	-42.27	Peak	10	Pass
NVNT	be40	5755	Ant3	5700	-53.96	3.42	0.24	-50.30	Average	10	Pass
NVNT	be40	5755	Ant3	5720	-24.87	3.42	-	-21.45	Peak	15.6	Pass
NVNT	be40	5755	Ant3	5720	-43.23	3.42	0.24	-39.57	Average	15.6	Pass
NVNT	be40	5755	Ant3	5725	-27.25	3.42	-	-23.83	Peak	27	Pass
NVNT	be40	5755	Ant3	5725	-40.77	3.42	0.24	-37.11	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5795	Ant3	5850	-47.23	3.42	-	-43.81	Peak	27	Pass
NVNT	be40	5795	Ant3	5850	-55.77	3.42	0.23	-52.12	Average	27	Pass
NVNT	be40	5795	Ant3	5855	-47.16	3.42	-	-43.74	Peak	15.6	Pass
NVNT	be40	5795	Ant3	5855	-56.38	3.42	0.23	-52.73	Average	15.6	Pass
NVNT	be40	5795	Ant3	5875	-50.38	3.42	-	-46.96	Peak	10	Pass
NVNT	be40	5795	Ant3	5875	-57.47	3.42	0.23	-53.82	Average	10	Pass
NVNT	be40	5795	Ant3	5925	-47.97	3.42	-	-44.55	Peak	-27	Pass
NVNT	be40	5795	Ant3	5925	-57.46	3.42	0.23	-53.81	Average	-27	Pass
NVNT	be80	5775	Ant3	5850	-41.6	3.42	-	-38.18	Peak	27	Pass
NVNT	be80	5775	Ant3	5850	-51.28	3.42	0.47	-47.39	Average	27	Pass
NVNT	be80	5775	Ant3	5855	-41.93	3.42	-	-38.51	Peak	15.6	Pass
NVNT	be80	5775	Ant3	5855	-50.82	3.42	0.47	-46.93	Average	15.6	Pass
NVNT	be80	5775	Ant3	5875	-46.09	3.42	-	-42.67	Peak	10	Pass
NVNT	be80	5775	Ant3	5875	-55.1	3.42	0.47	-51.21	Average	10	Pass
NVNT	be80	5775	Ant3	5925	-47.17	3.42	-	-43.75	Peak	-27	Pass
NVNT	be80	5775	Ant3	5925	-57.01	3.42	0.47	-53.12	Average	-27	Pass
NVNT	be80	5775	Ant3	5650	-48.58	3.42	-	-45.16	Peak	-27	Pass
NVNT	be80	5775	Ant3	5650	-56.14	3.42	0.47	-52.25	Average	-27	Pass
NVNT	be80	5775	Ant3	5700	-42.99	3.42	-	-39.57	Peak	10	Pass
NVNT	be80	5775	Ant3	5700	-51.29	3.42	0.47	-47.40	Average	10	Pass
NVNT	be80	5775	Ant3	5720	-35.13	3.42	-	-31.71	Peak	15.6	Pass
NVNT	be80	5775	Ant3	5720	-48.53	3.42	0.47	-44.64	Average	15.6	Pass
NVNT	be80	5775	Ant3	5725	-27.42	3.42	-	-24.00	Peak	27	Pass
NVNT	be80	5775	Ant3	5725	-45.88	3.42	0.47	-41.99	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant3 Peak

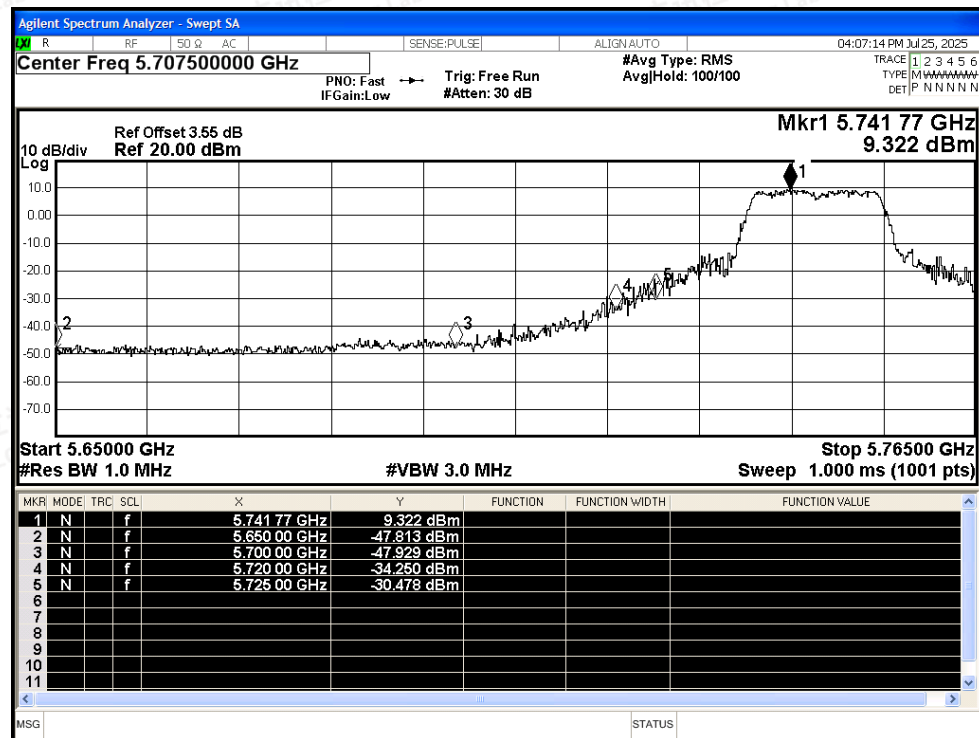

Restrict Band NVNT a 5745MHz Ant3 Average

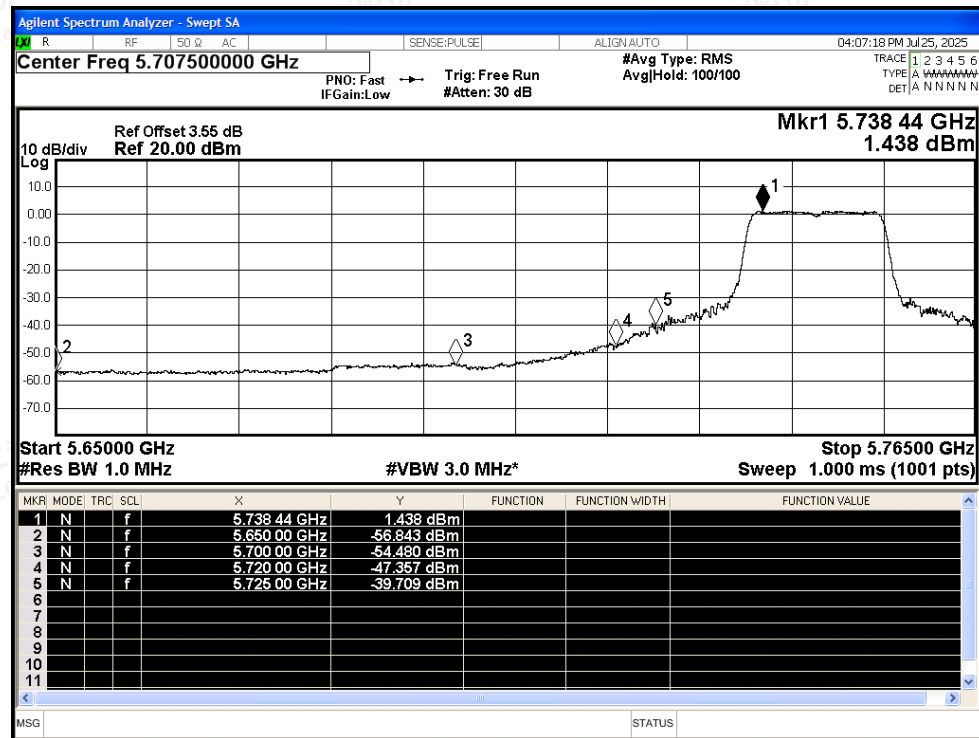

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant3 Peak

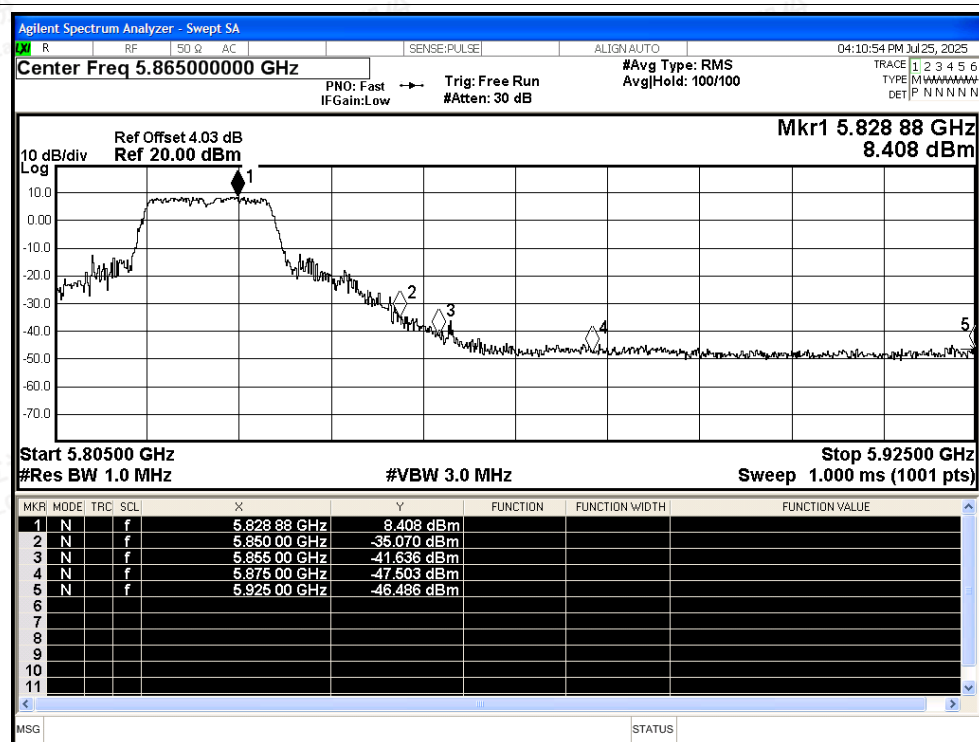

Restrict Band NVNT a 5825MHz Ant3 Average

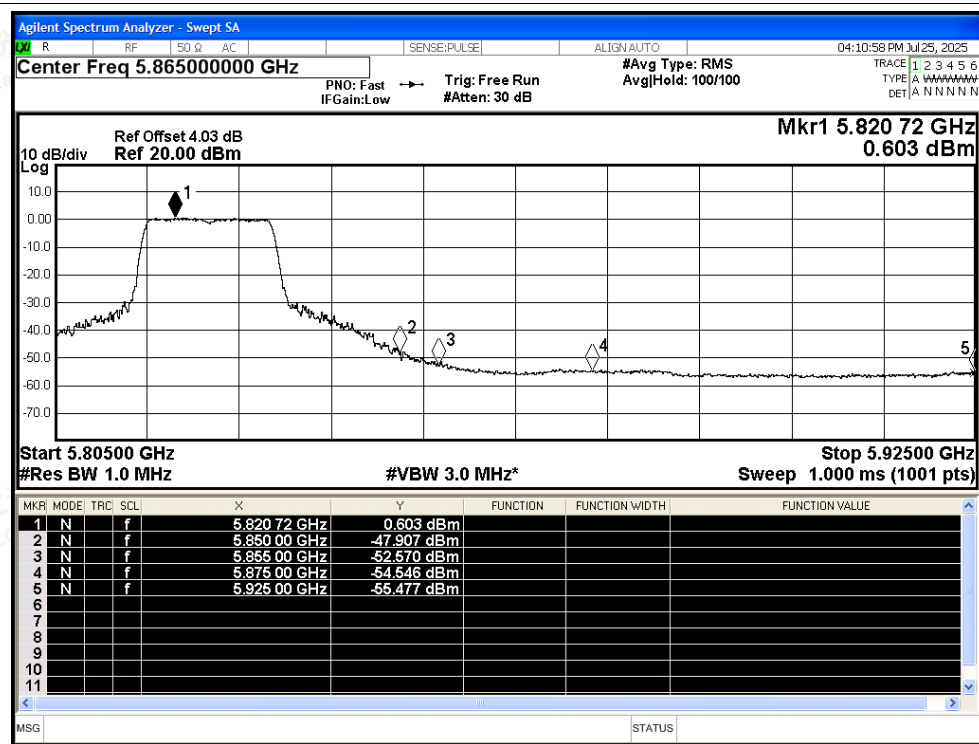

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant3 Peak

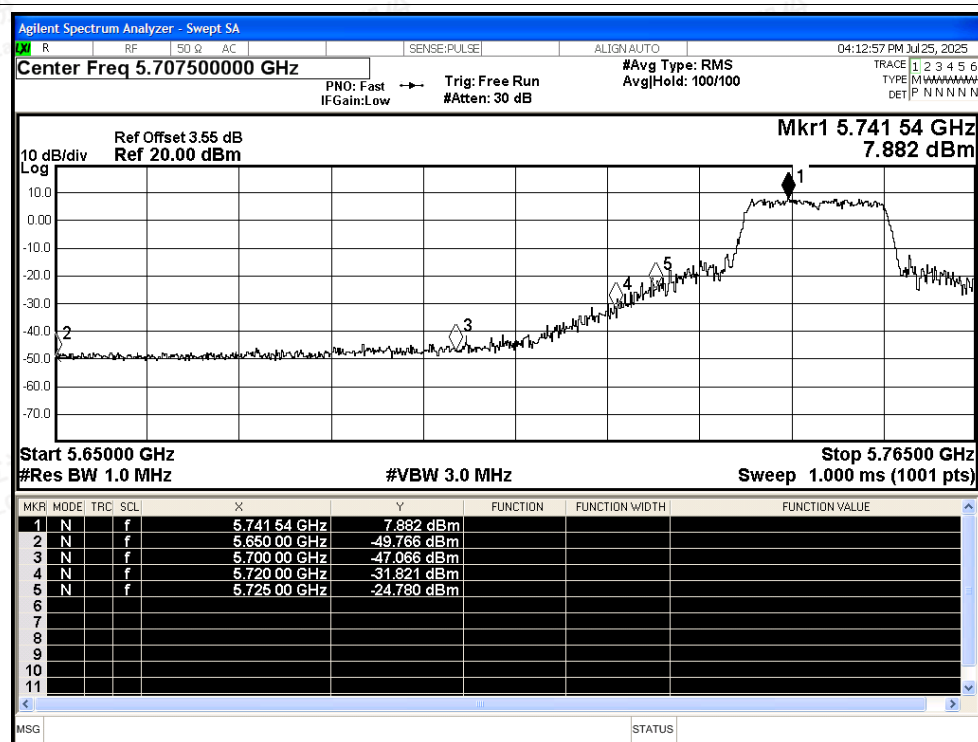

Restrict Band NVNT n20 5745MHz Ant3 Average

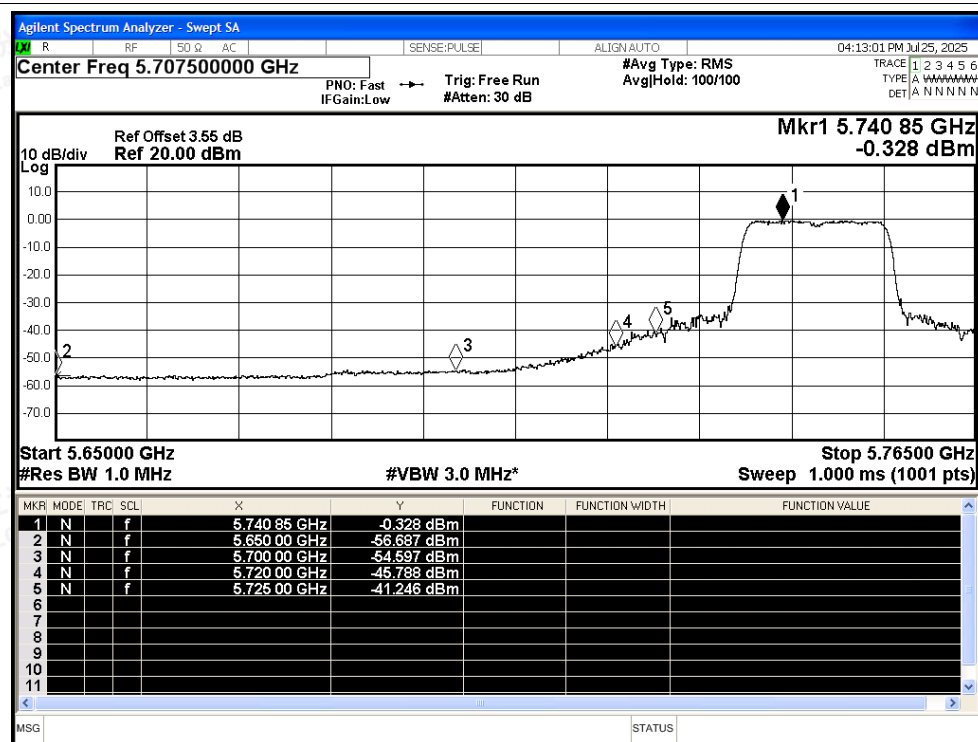

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant3 Peak

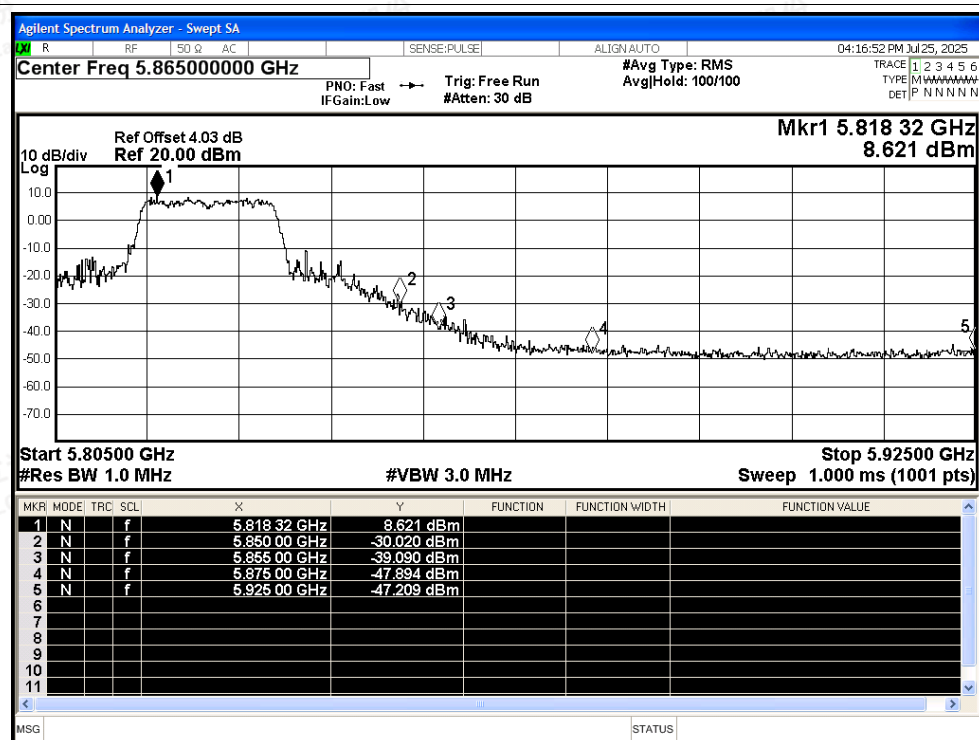

Restrict Band NVNT n20 5825MHz Ant3 Average

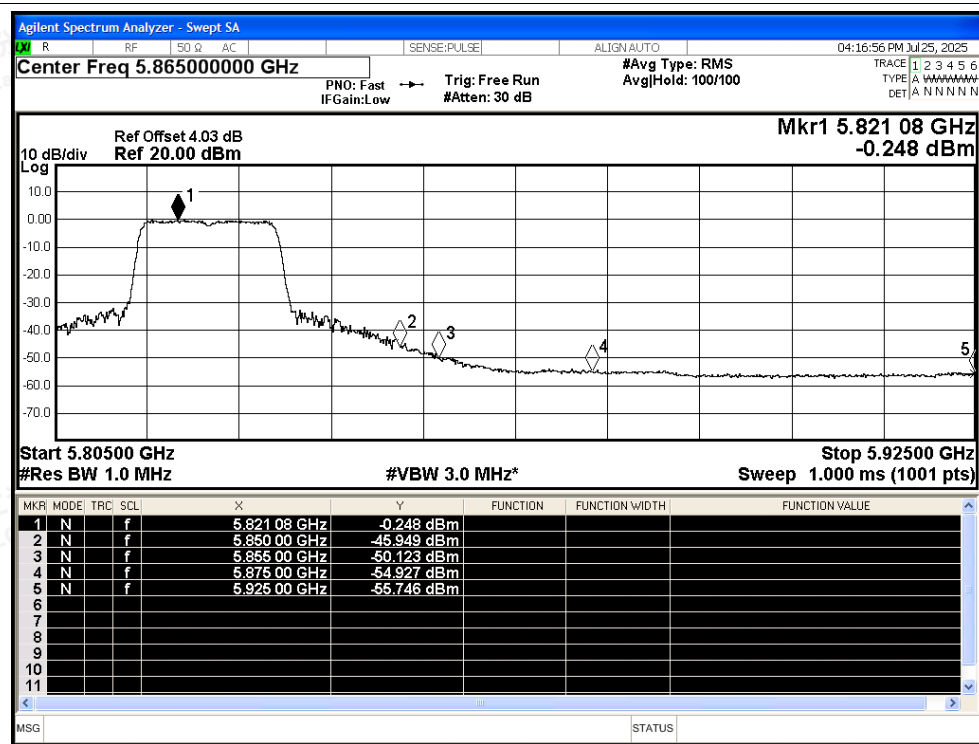

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant3 Peak

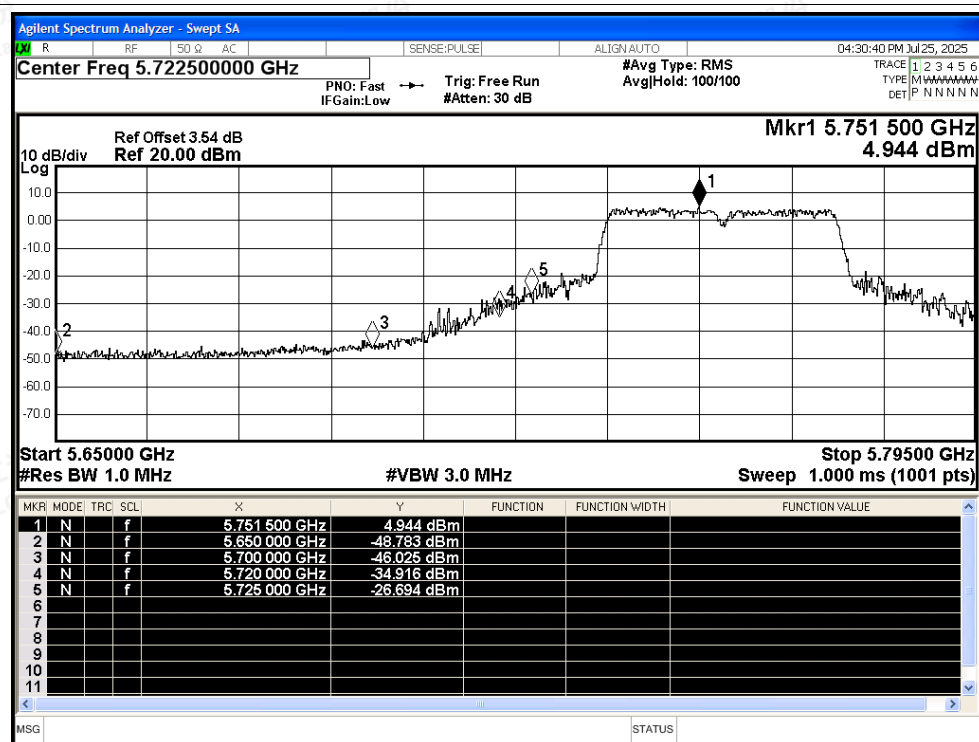

Restrict Band NVNT n40 5755MHz Ant3 Average

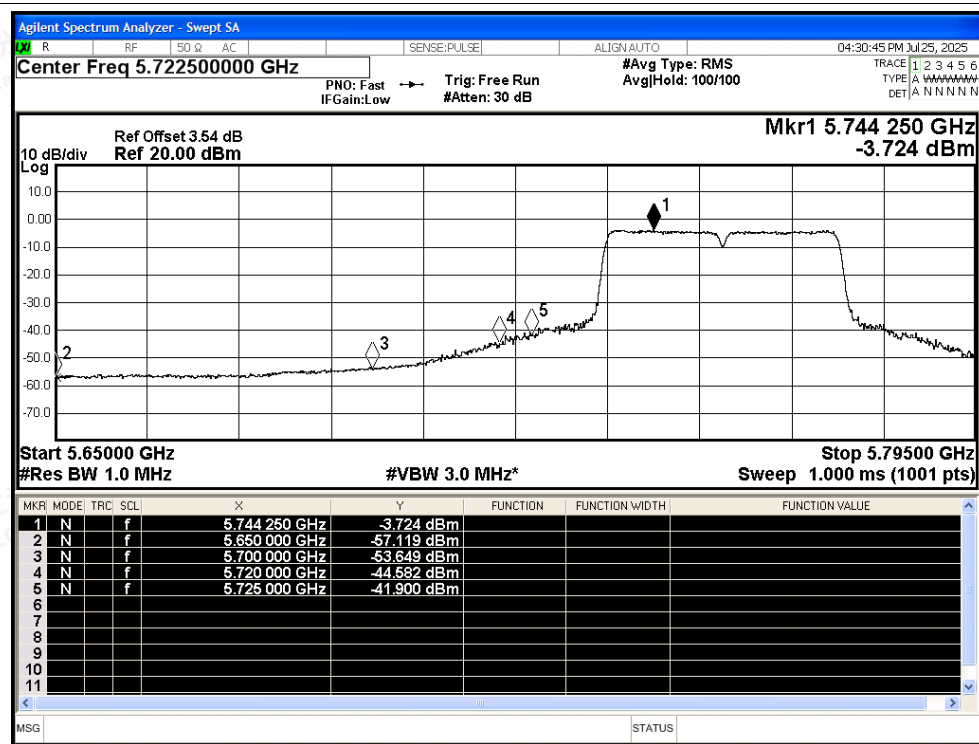

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant3 Peak

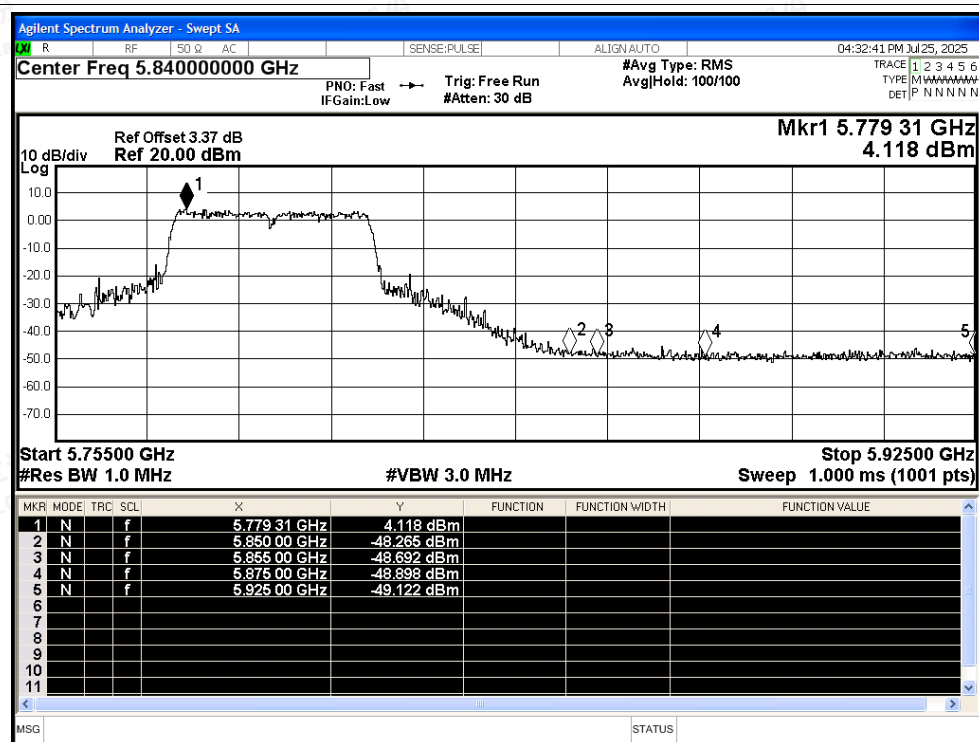

Restrict Band NVNT n40 5795MHz Ant3 Average

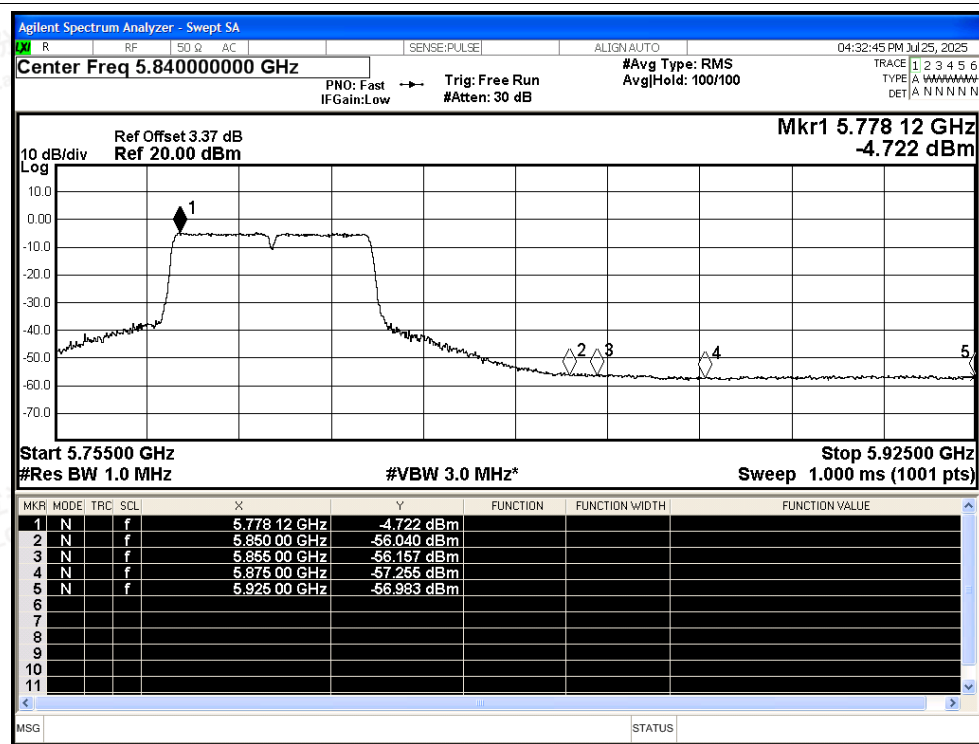

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant3 Peak



Restrict Band NVNT ac20 5745MHz Ant3 Average

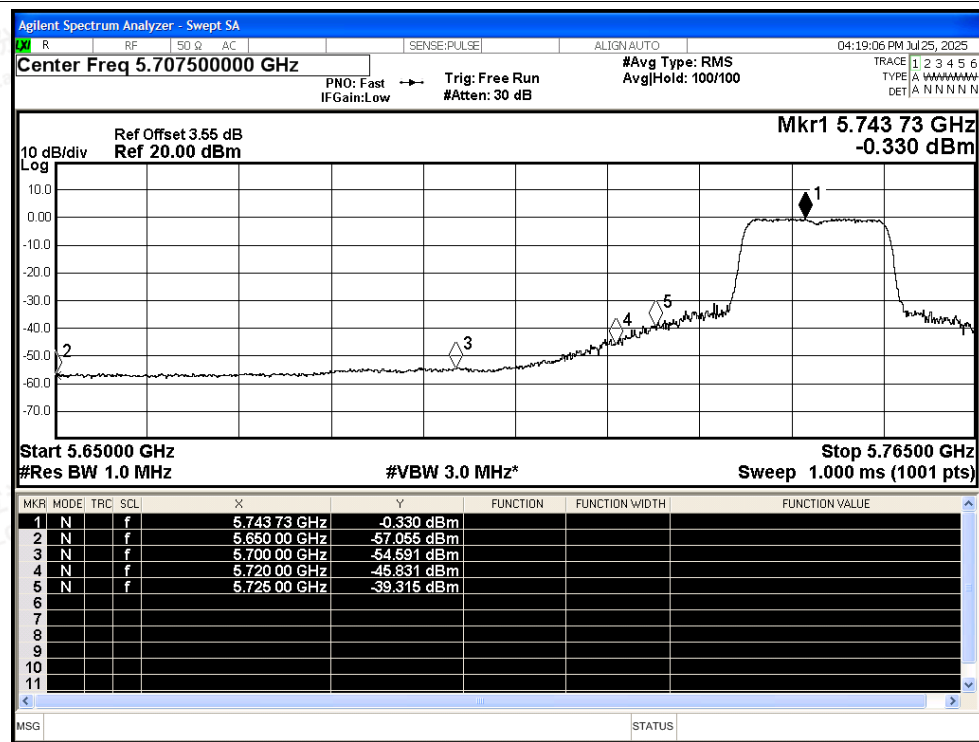

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant3 Peak

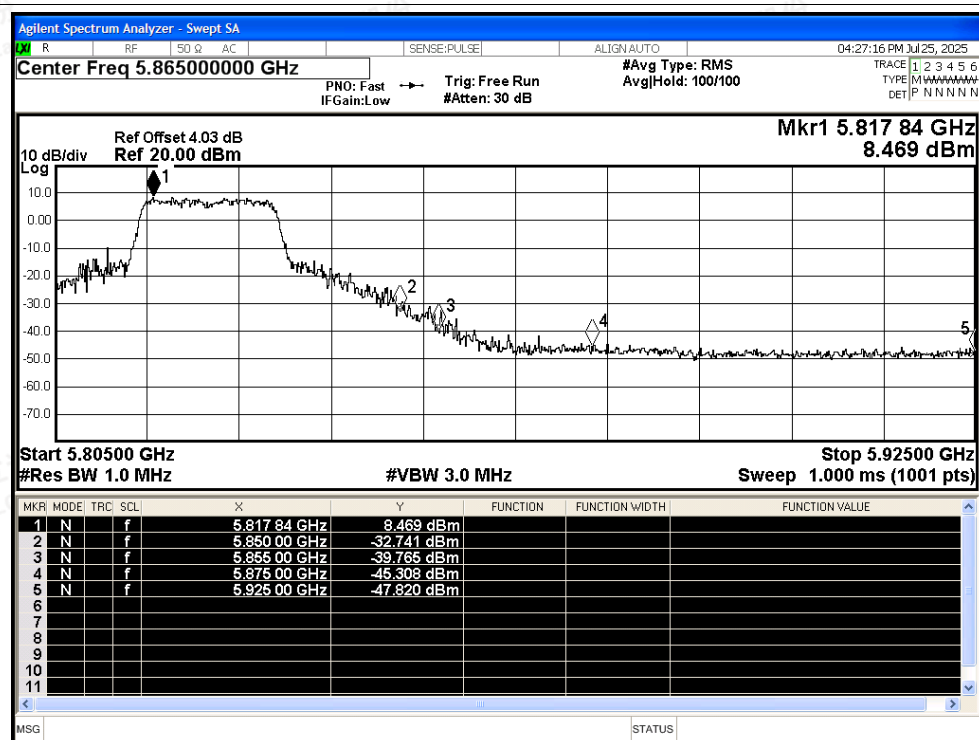

Restrict Band NVNT ac20 5825MHz Ant3 Average

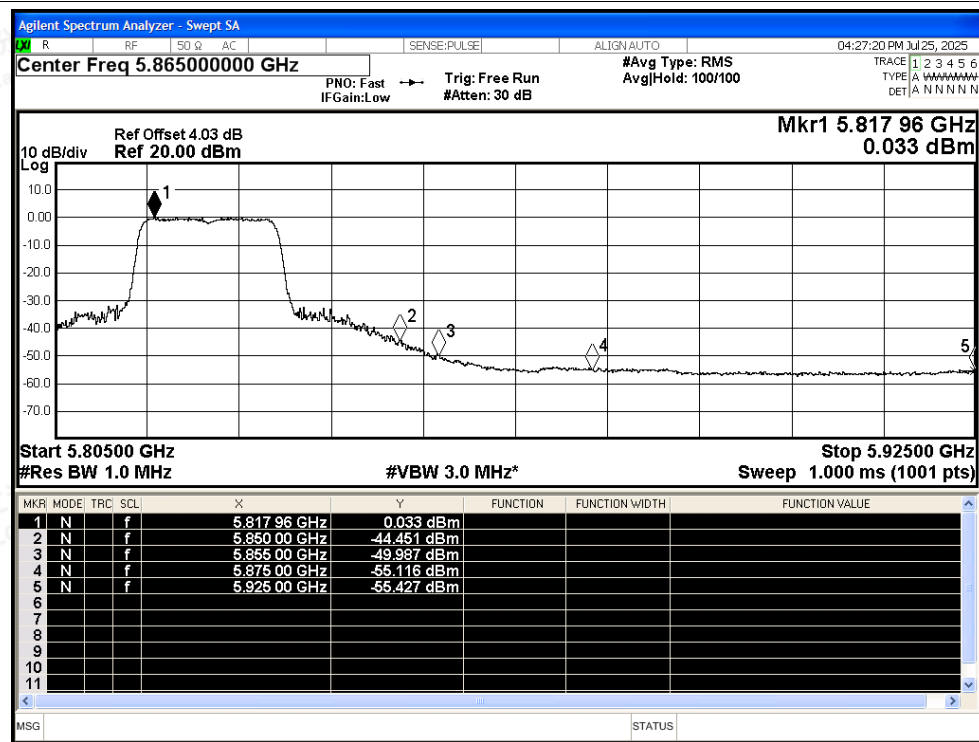

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant3 Peak

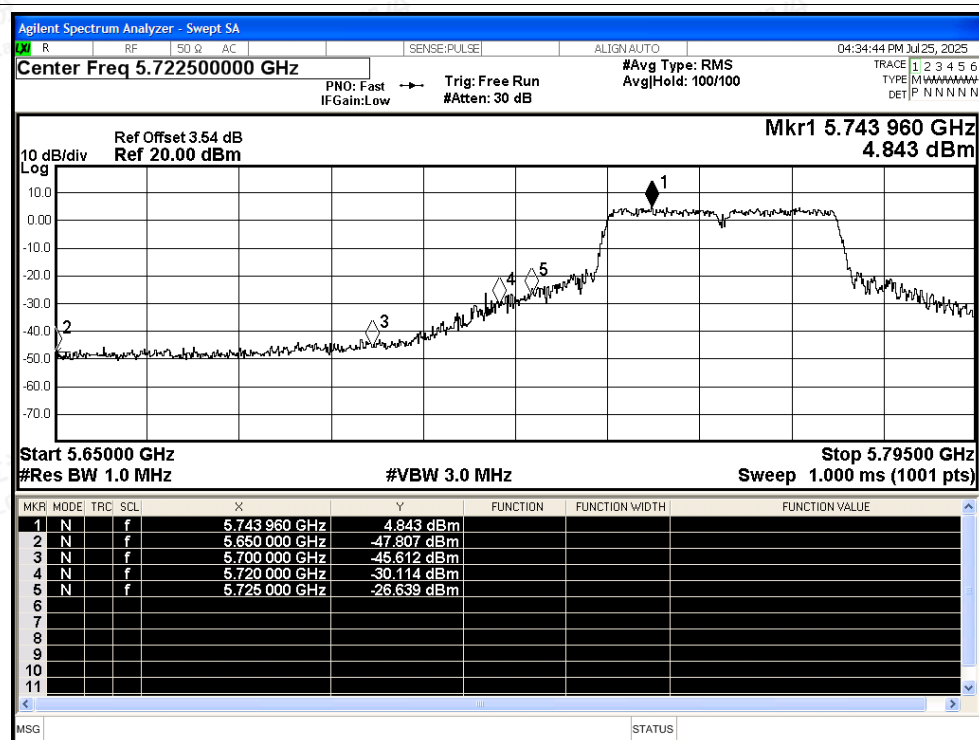

Restrict Band NVNT ac40 5755MHz Ant3 Average

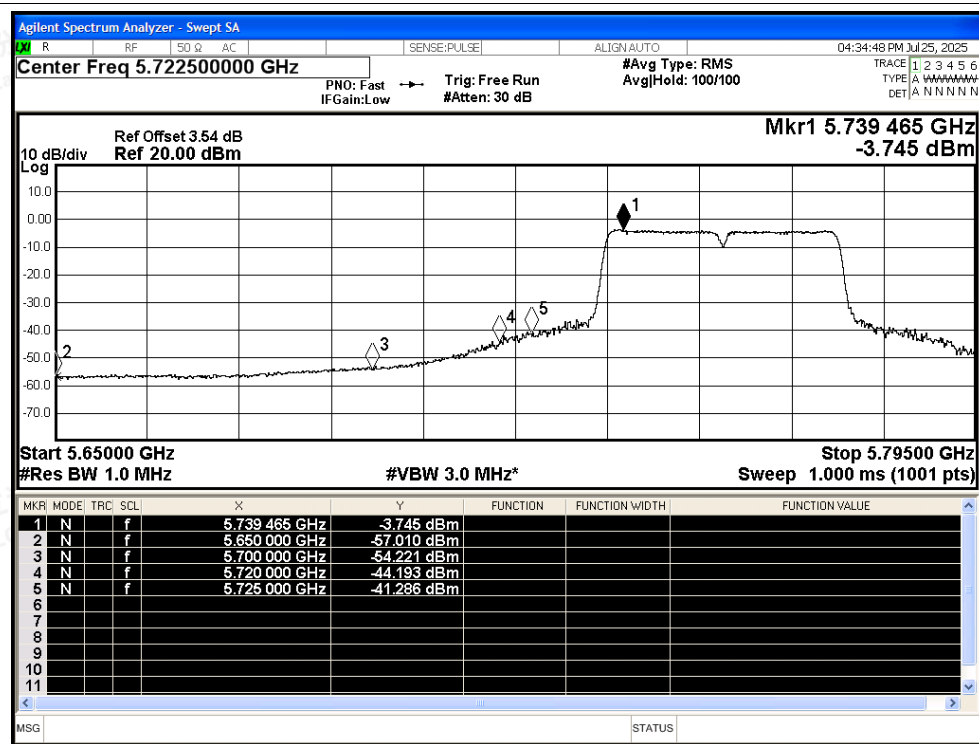

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant3 Peak

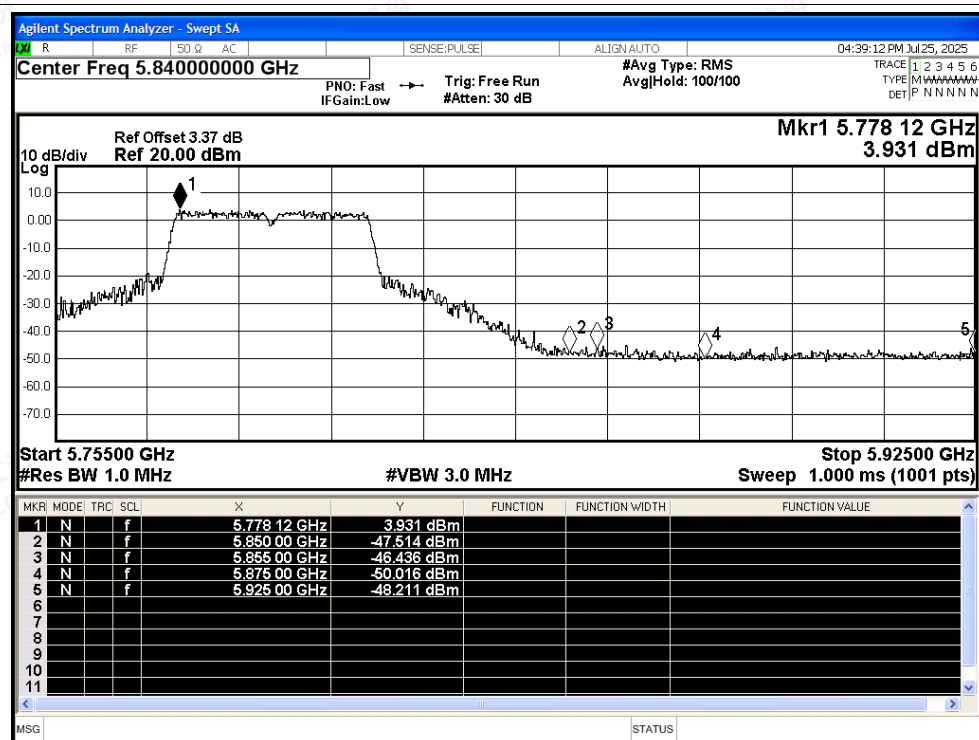

Restrict Band NVNT ac40 5795MHz Ant3 Average

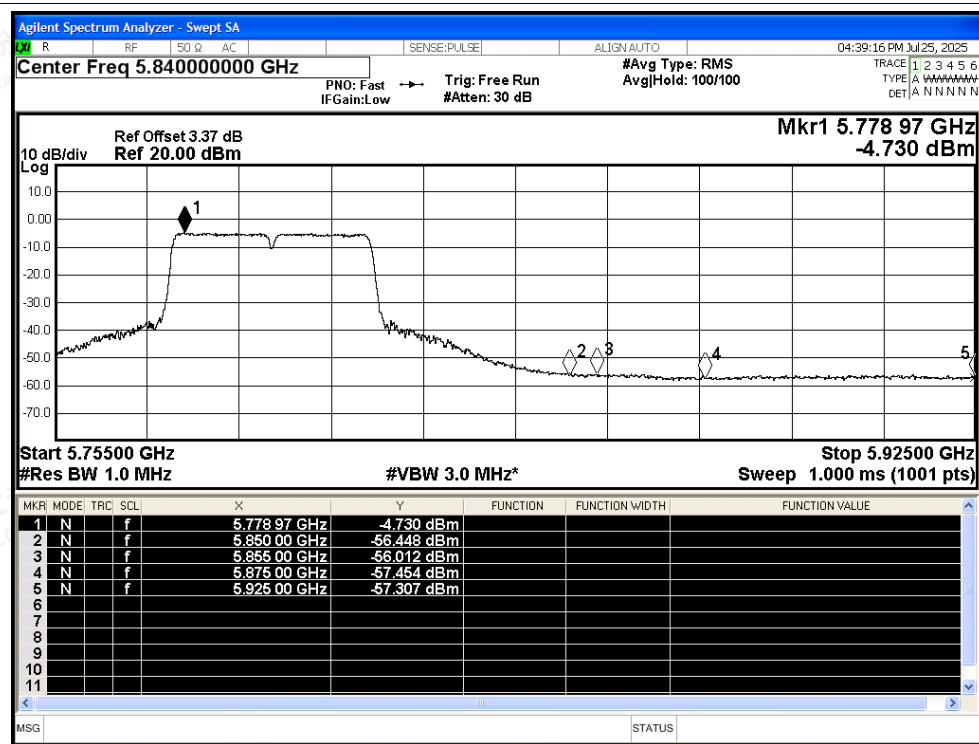

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

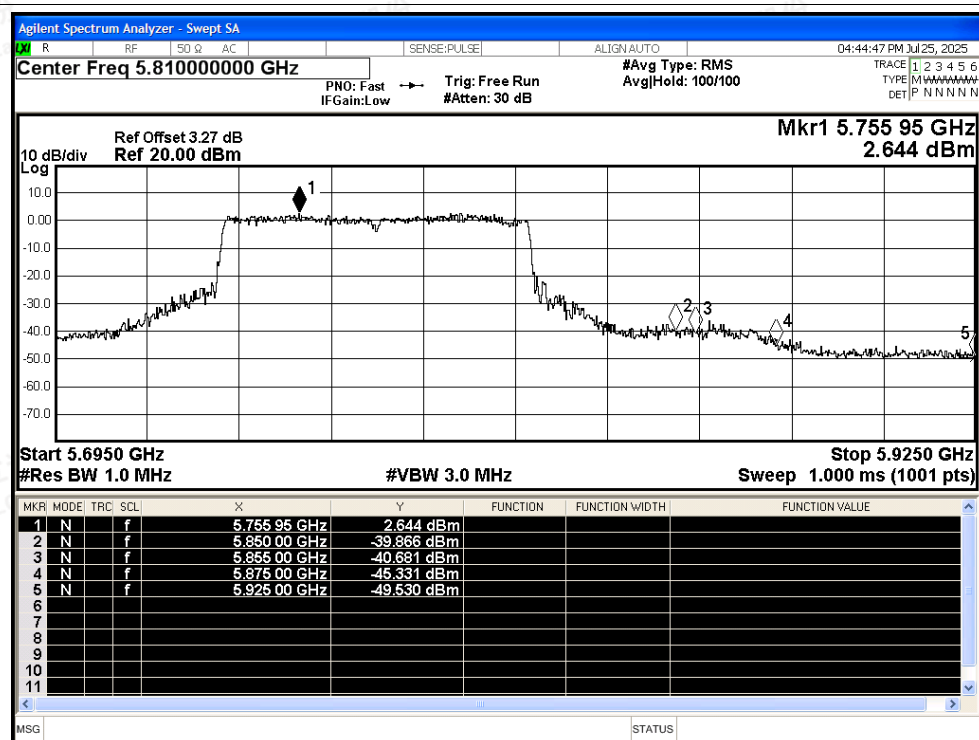

Restrict Band NVNT ac80 5775MHz Ant3 Average

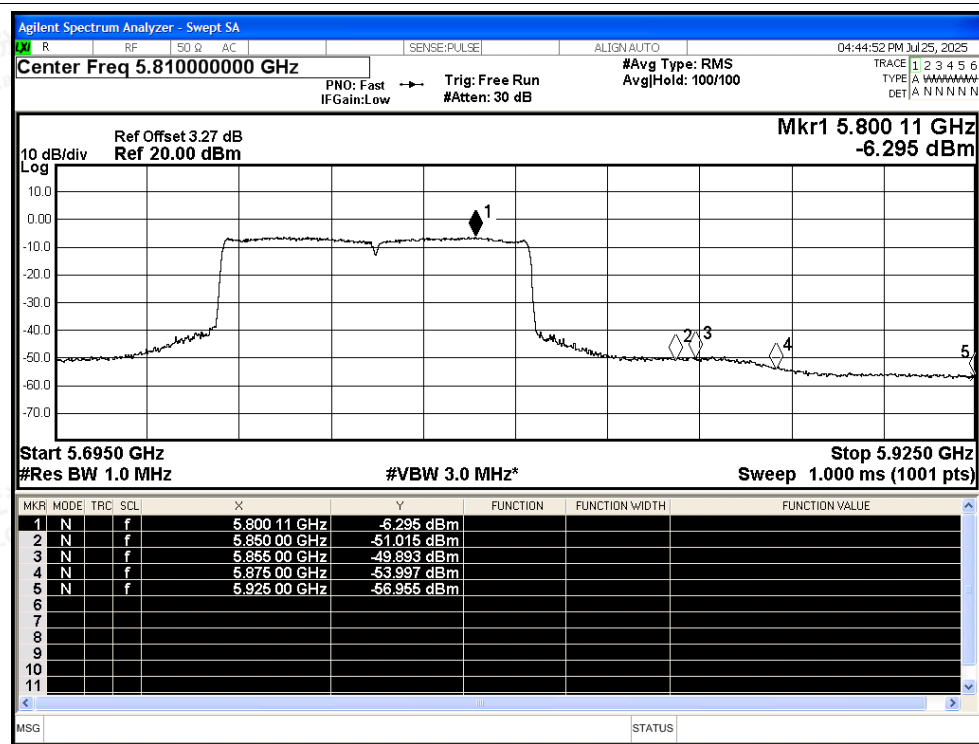

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

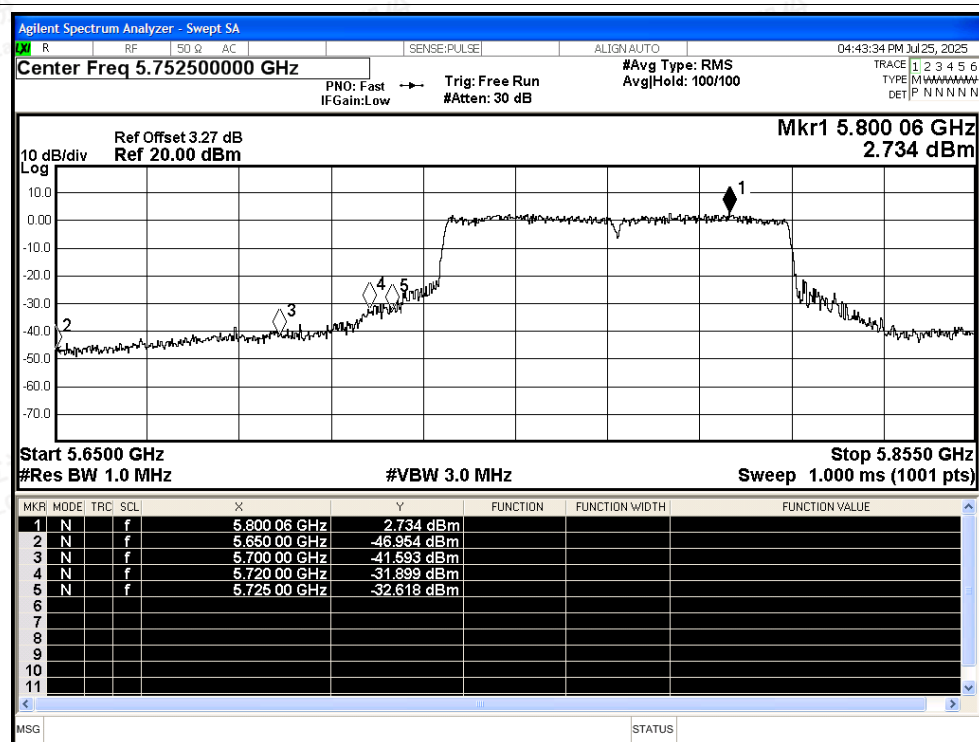

Restrict Band NVNT ac80 5775MHz Ant3 Average

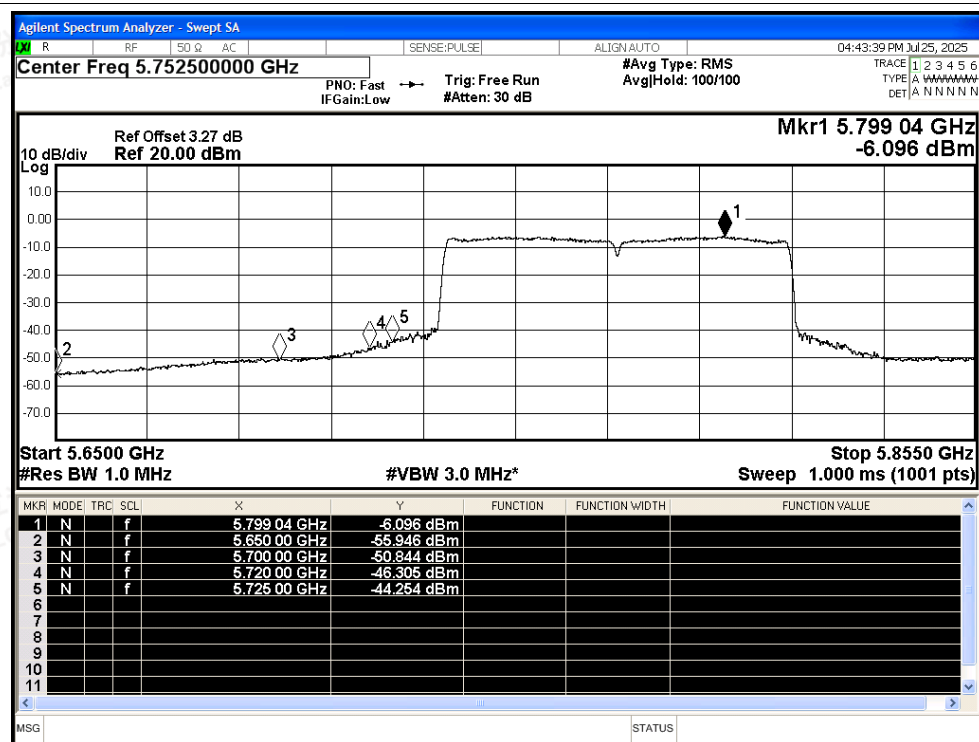

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant3 Peak

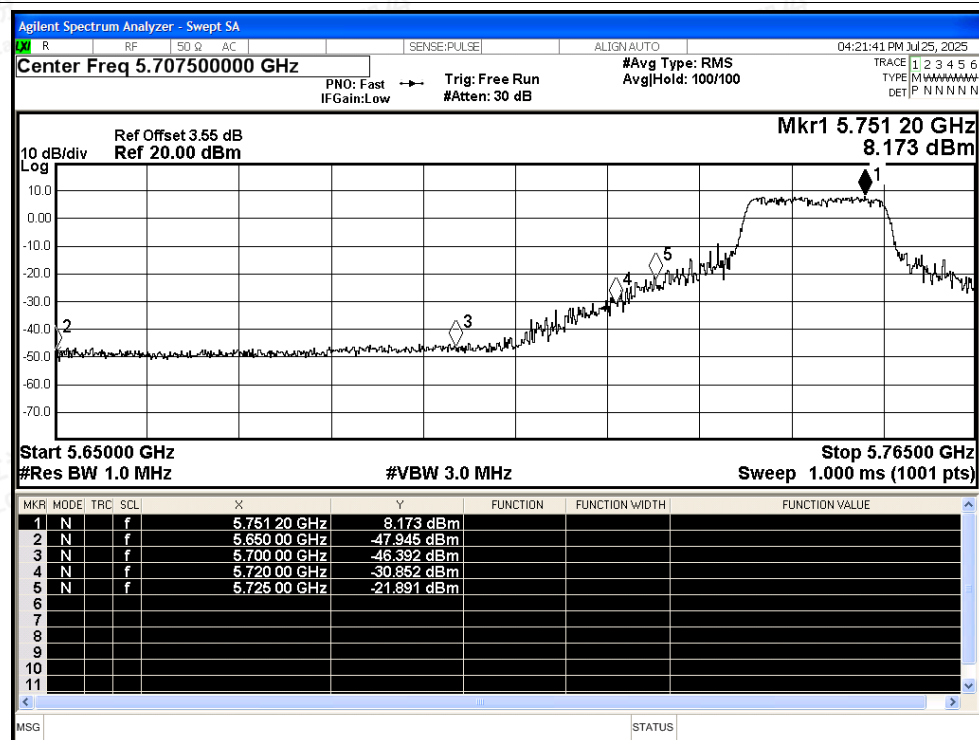

Restrict Band NVNT ax20 5745MHz Ant3 Average

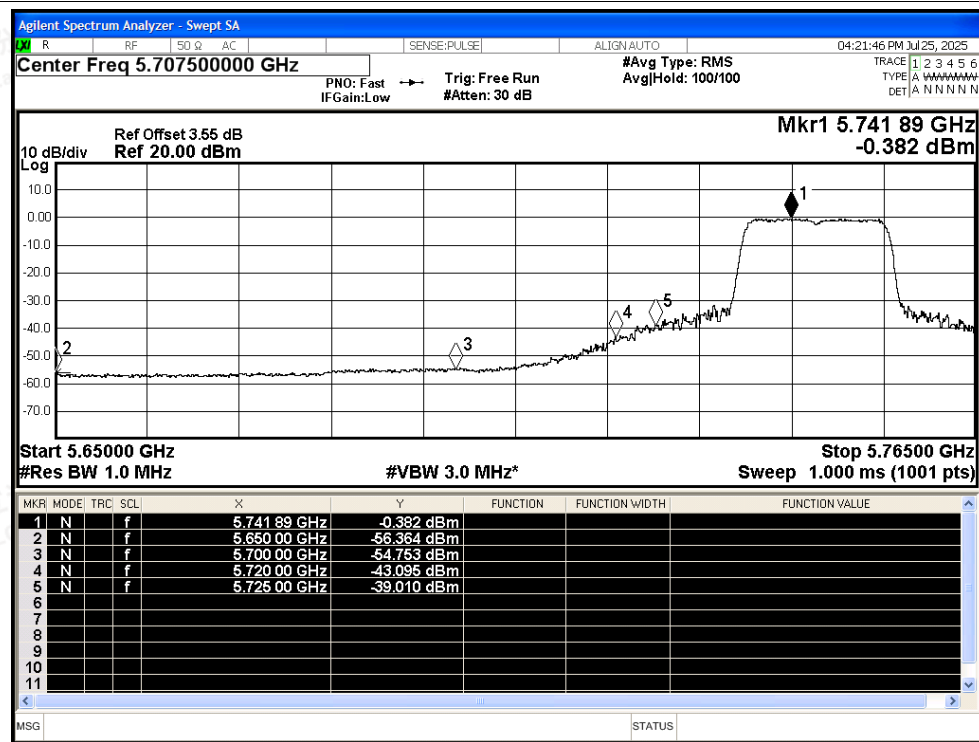

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant3 Peak

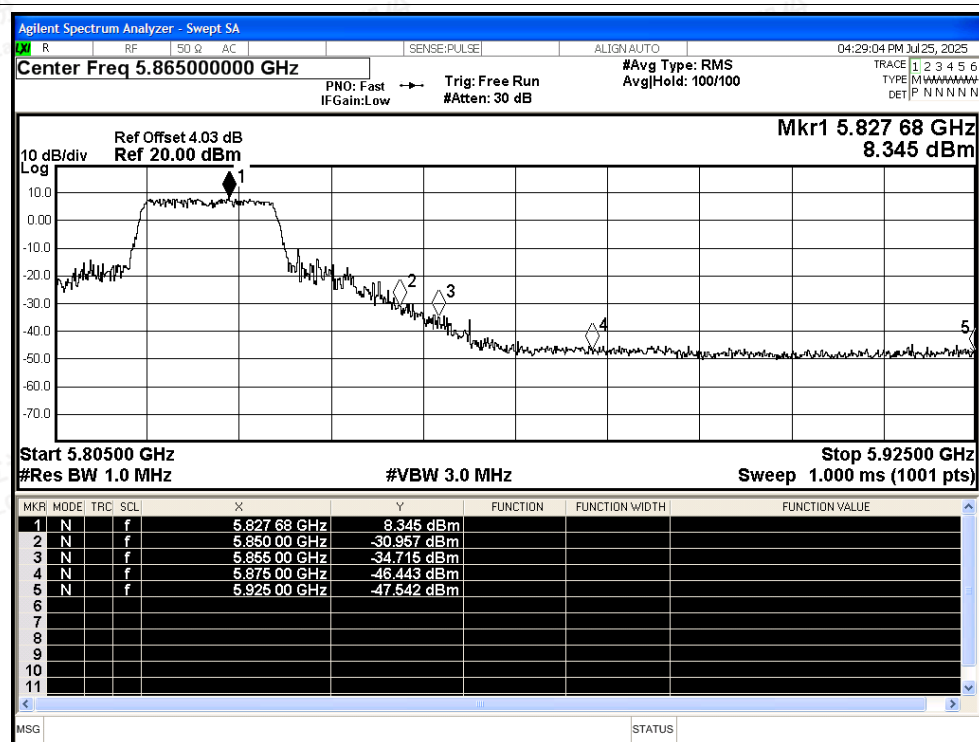

Restrict Band NVNT ax20 5825MHz Ant3 Average

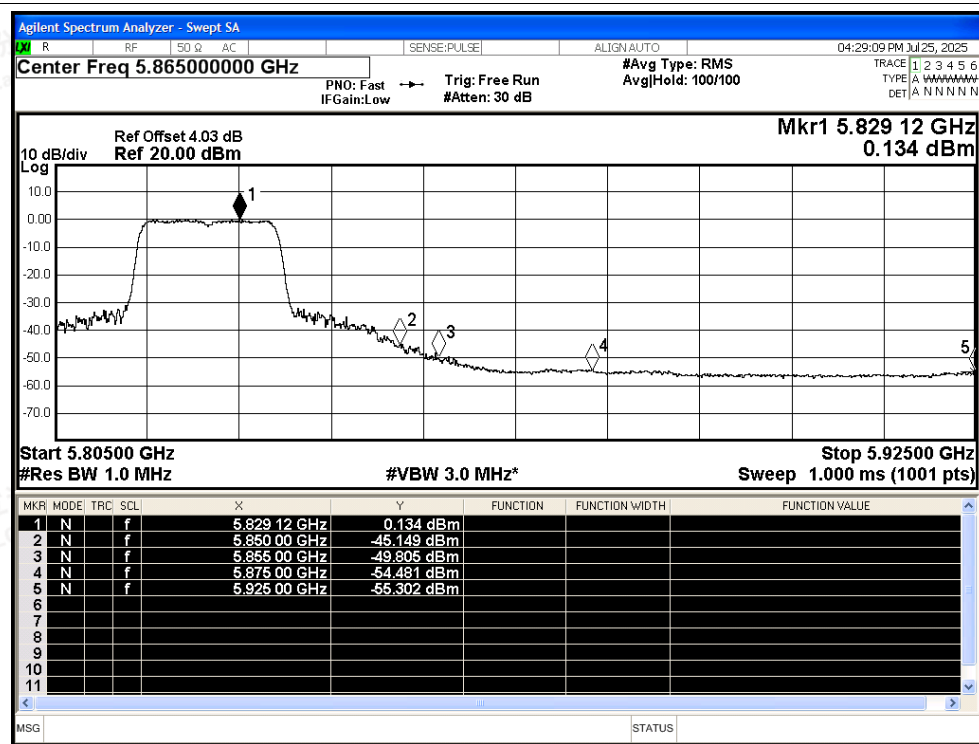

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant3 Peak

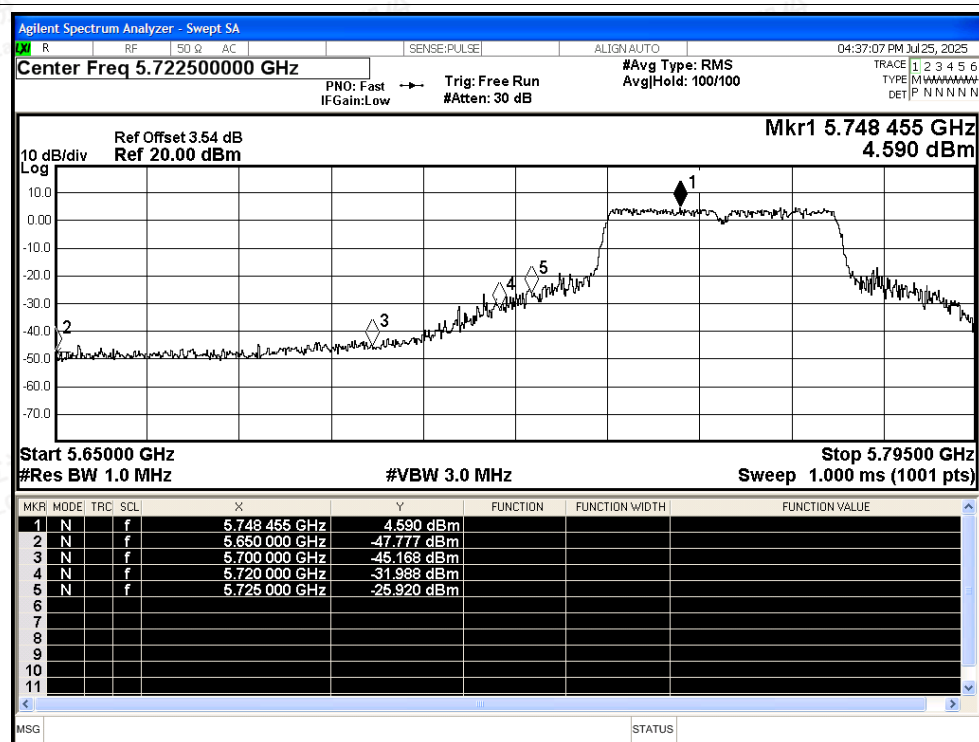

Restrict Band NVNT ax40 5755MHz Ant3 Average

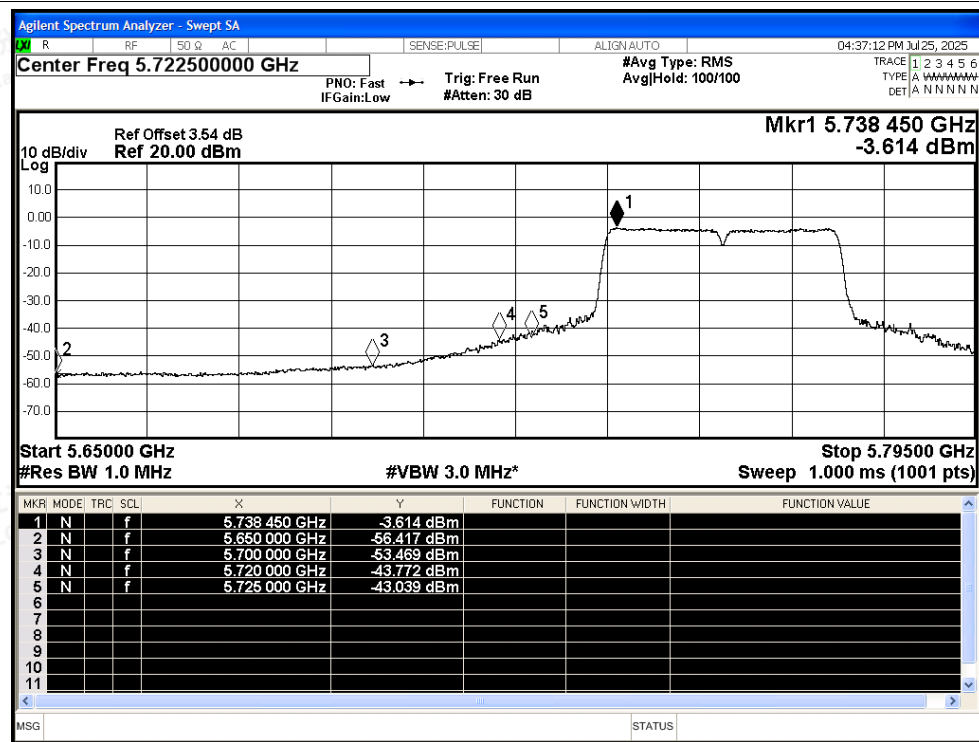

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant3 Peak

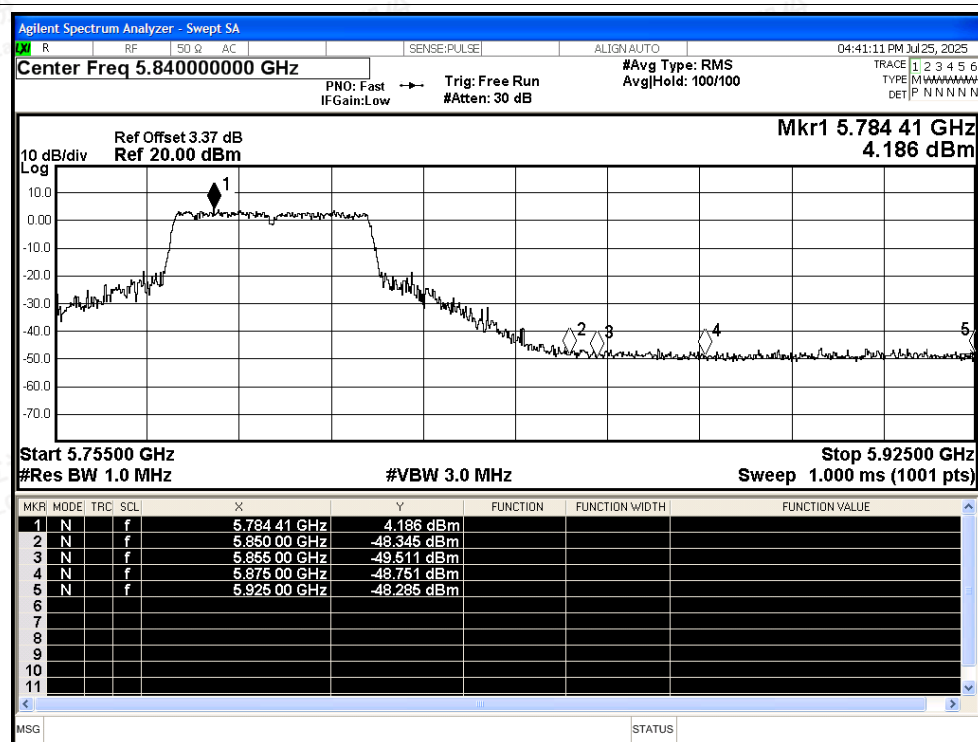

Restrict Band NVNT ax40 5795MHz Ant3 Average

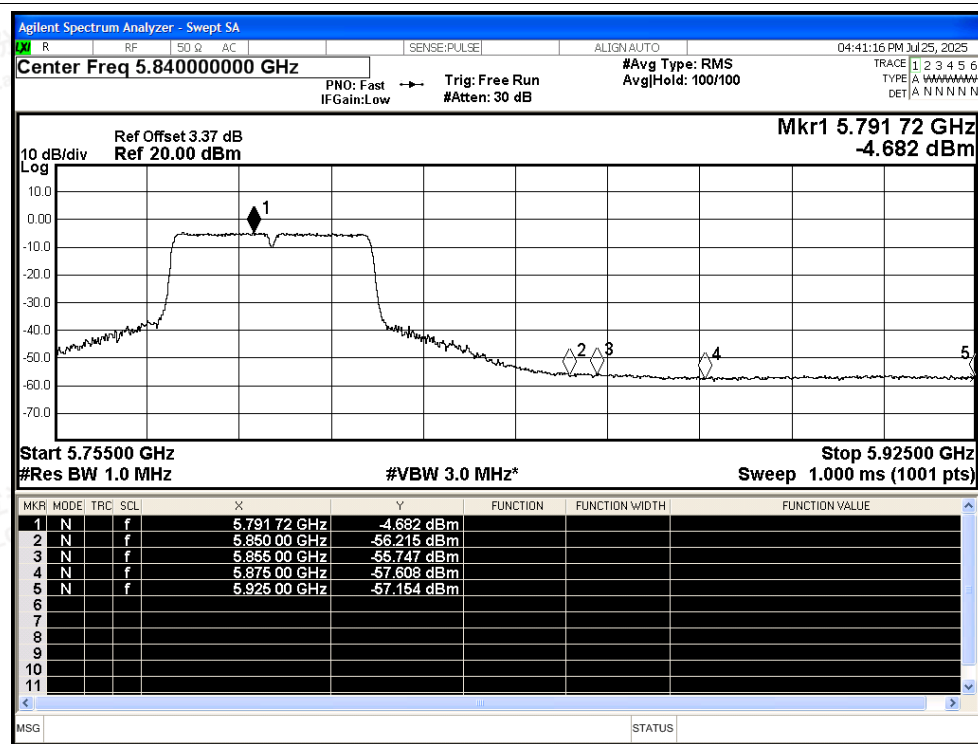

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant3 Peak

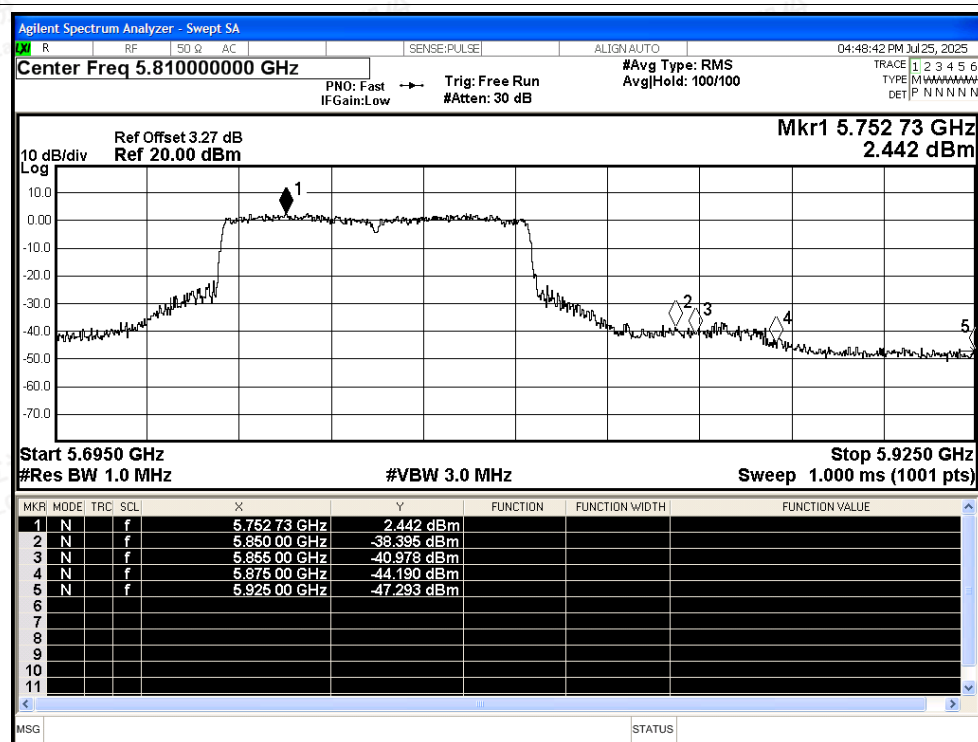

Restrict Band NVNT ax80 5775MHz Ant3 Average

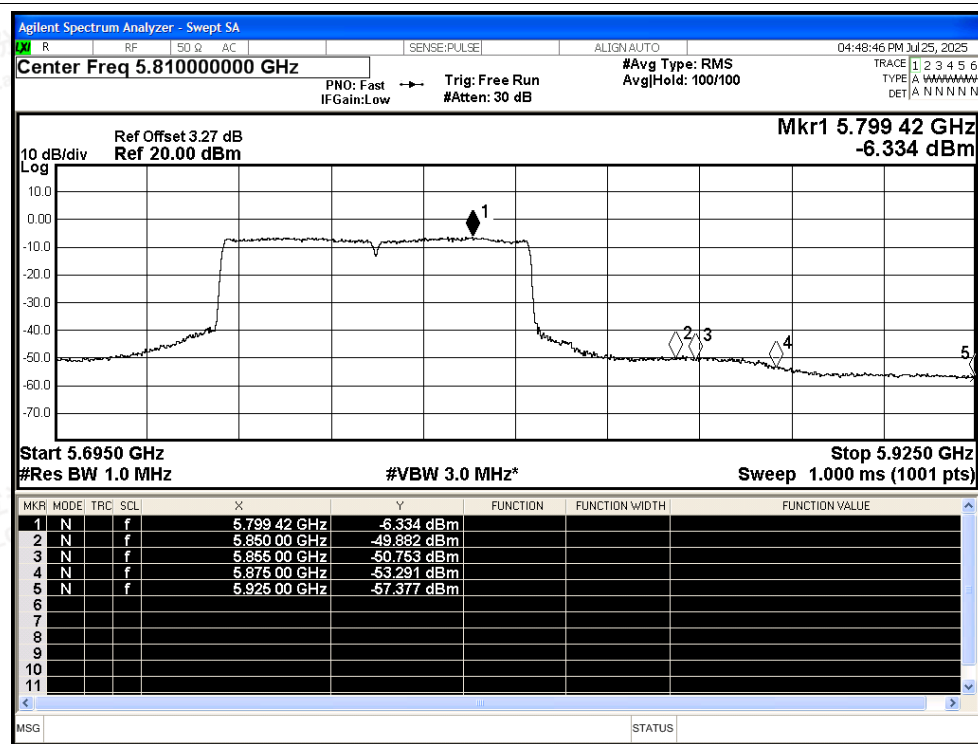

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant3 Peak

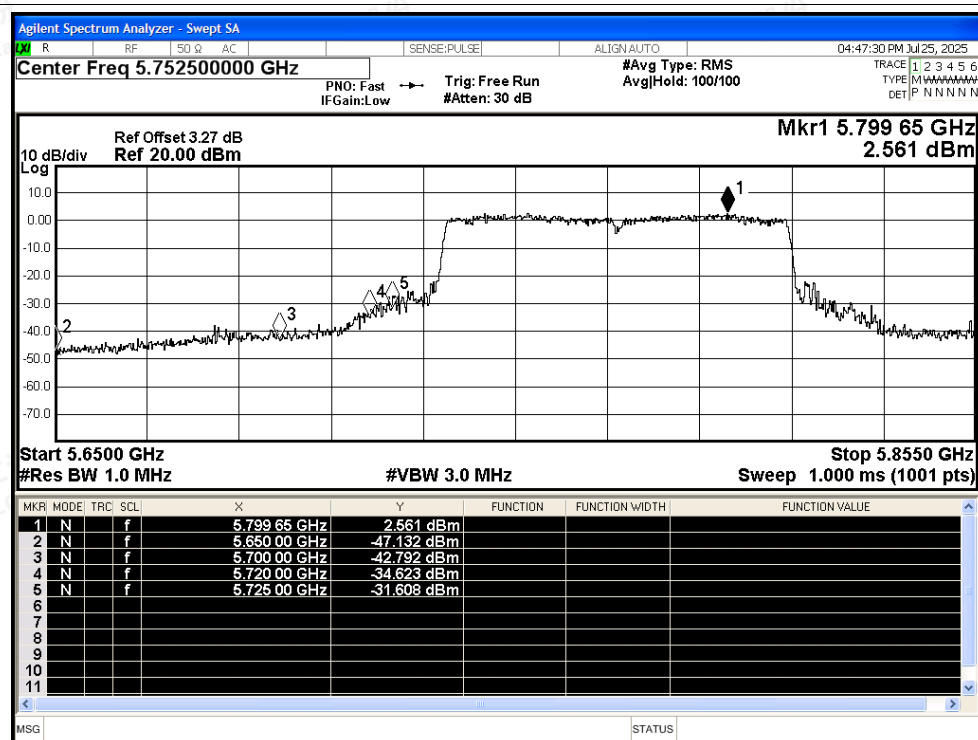

Restrict Band NVNT ax80 5775MHz Ant3 Average

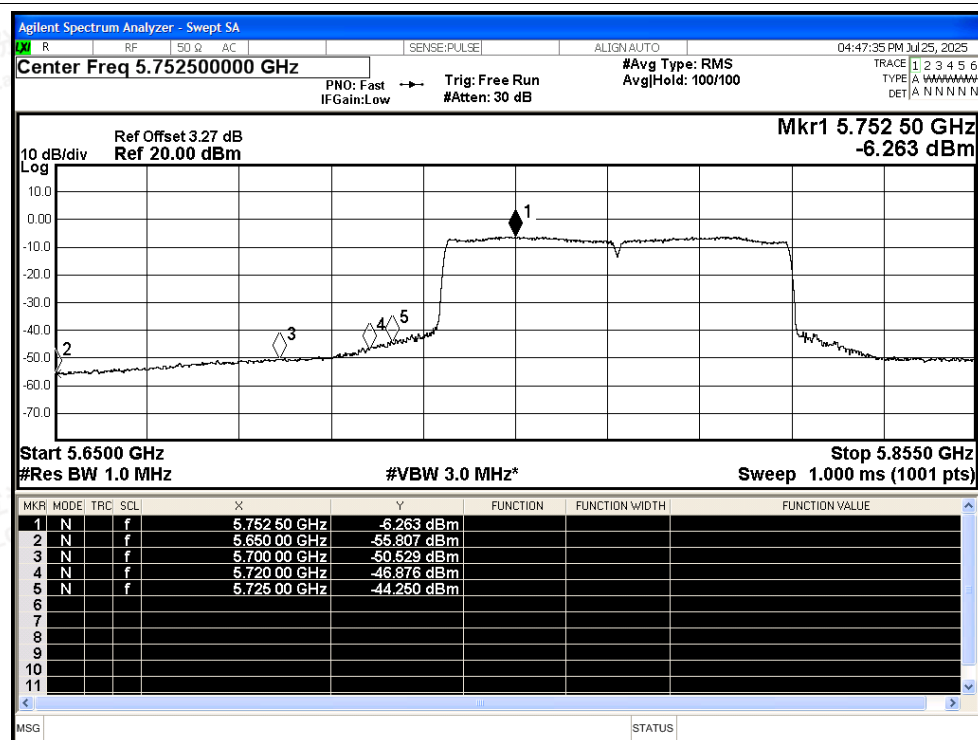

Restrict Band NVNT be20 5745MHz Ant3 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

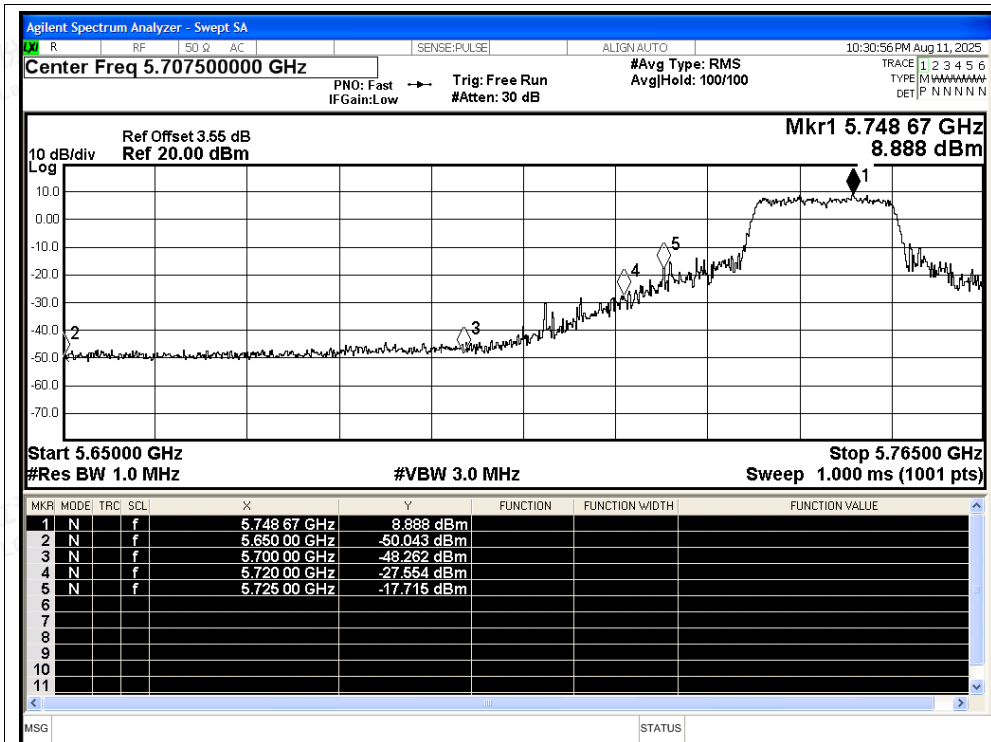

Restrict Band NVNT be20 5745MHz Ant3 Average

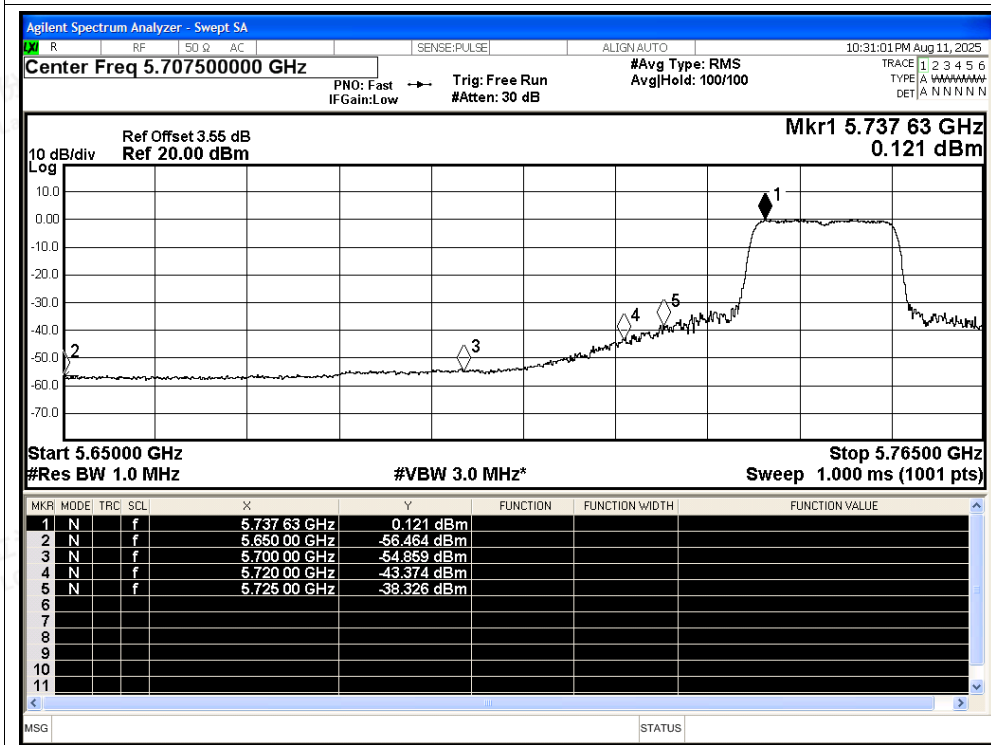

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5825MHz Ant3 Peak

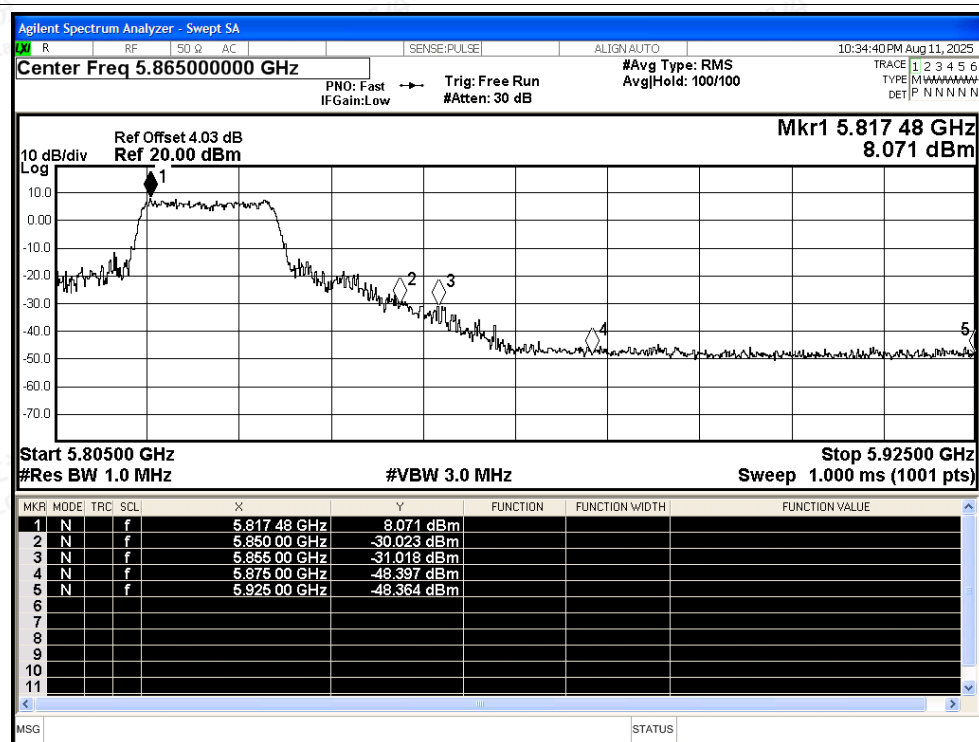

Restrict Band NVNT be20 5825MHz Ant3 Average

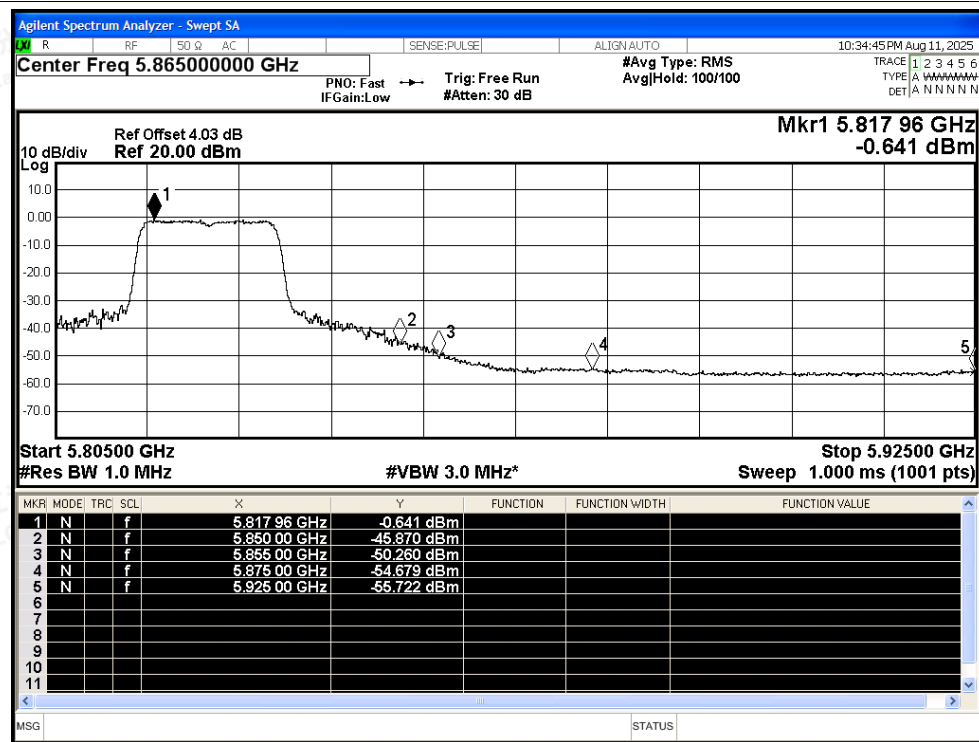

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5755MHz Ant3 Peak

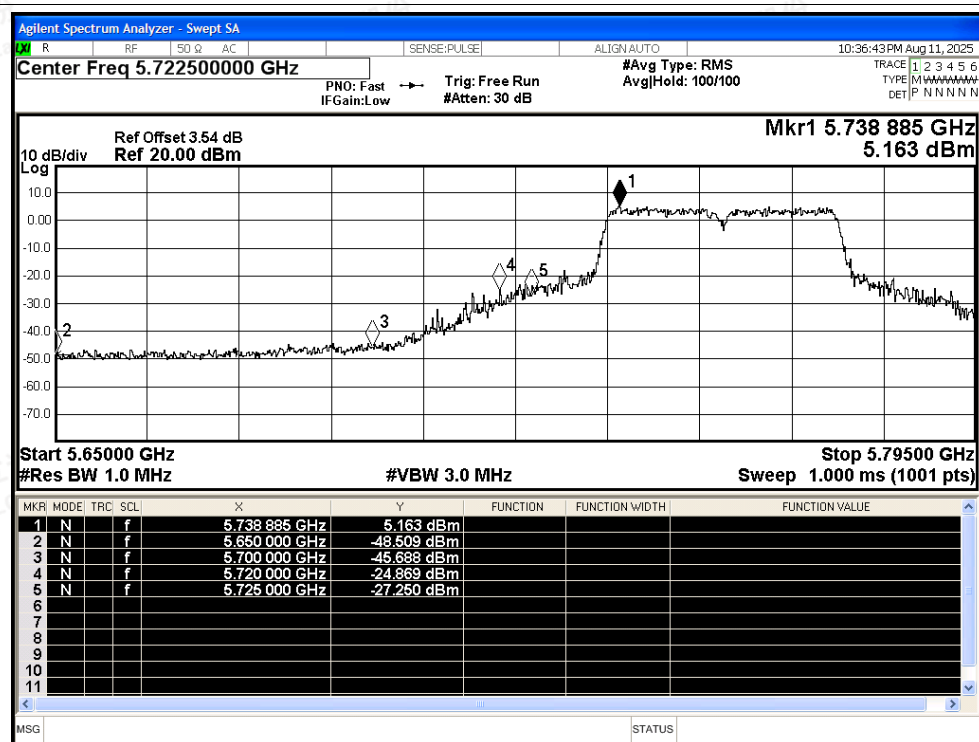

Restrict Band NVNT be40 5755MHz Ant3 Average

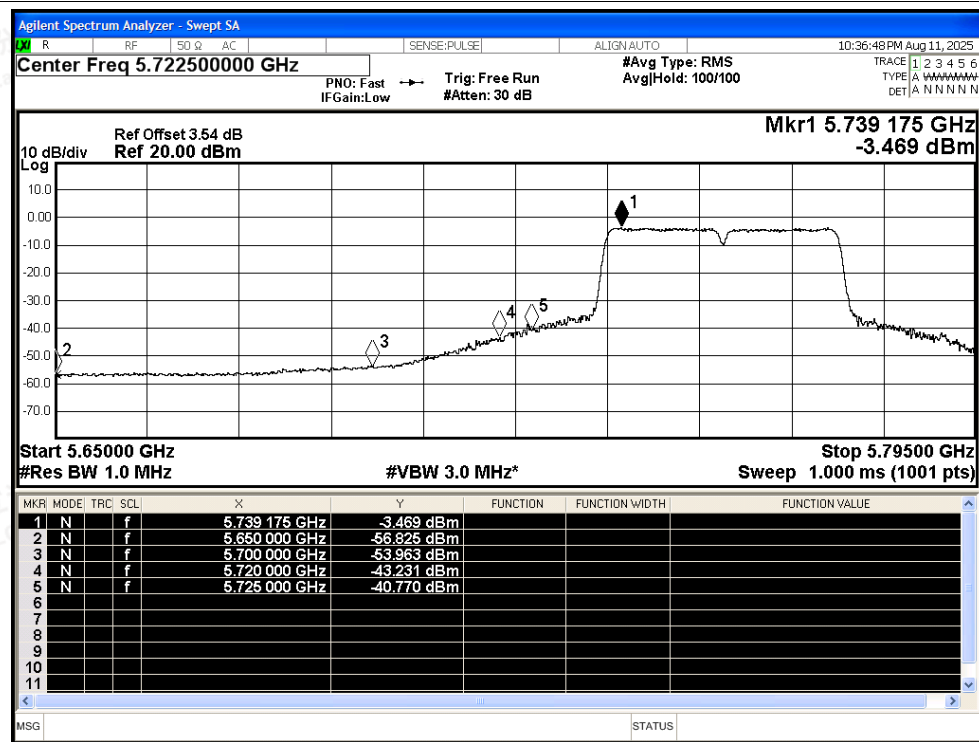

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5795MHz Ant3 Peak

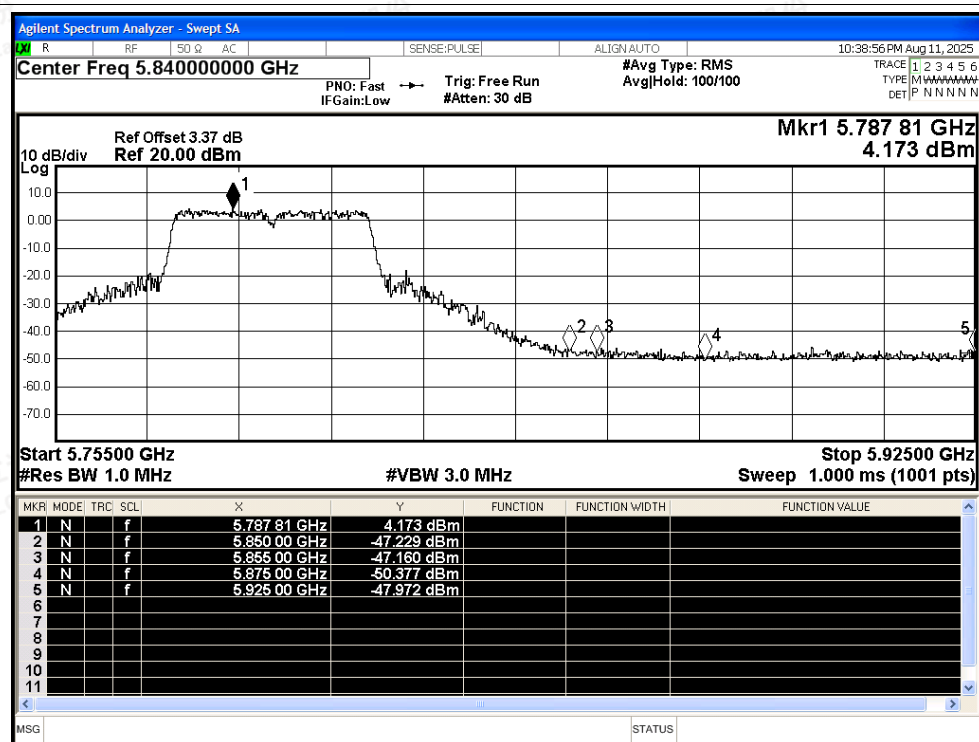

Restrict Band NVNT be40 5795MHz Ant3 Average

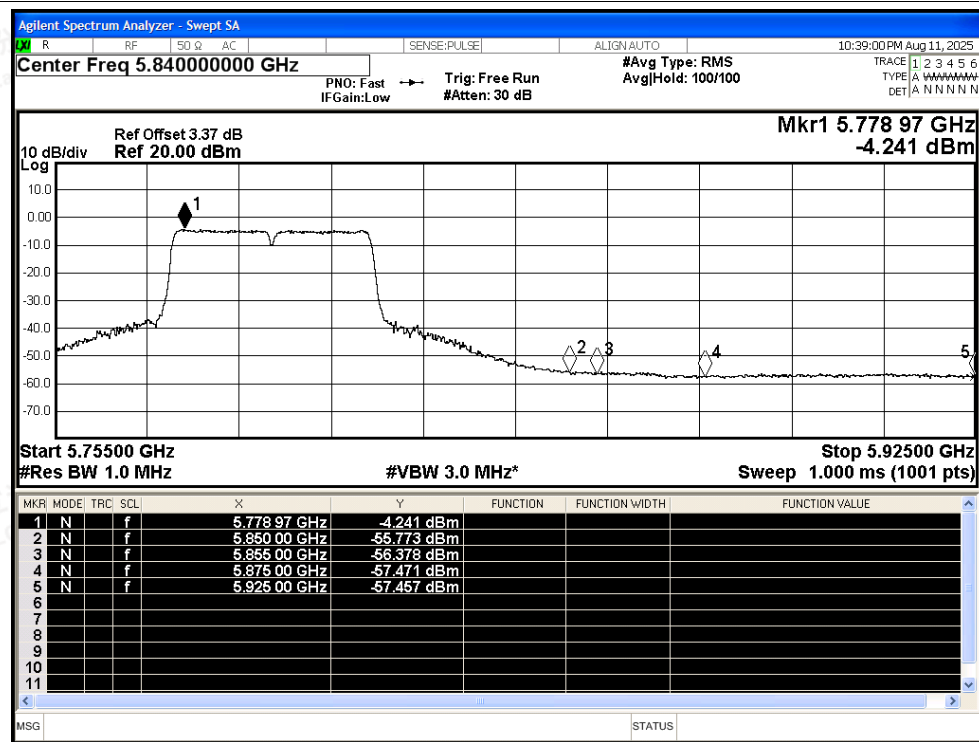

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant3 Peak

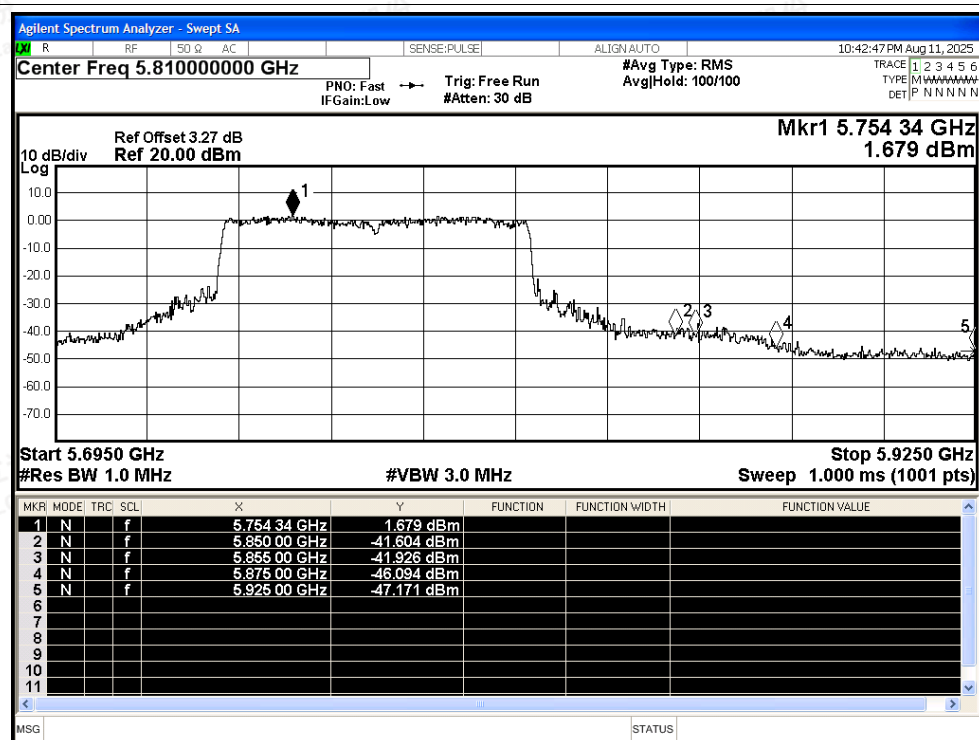

Restrict Band NVNT be80 5775MHz Ant3 Average

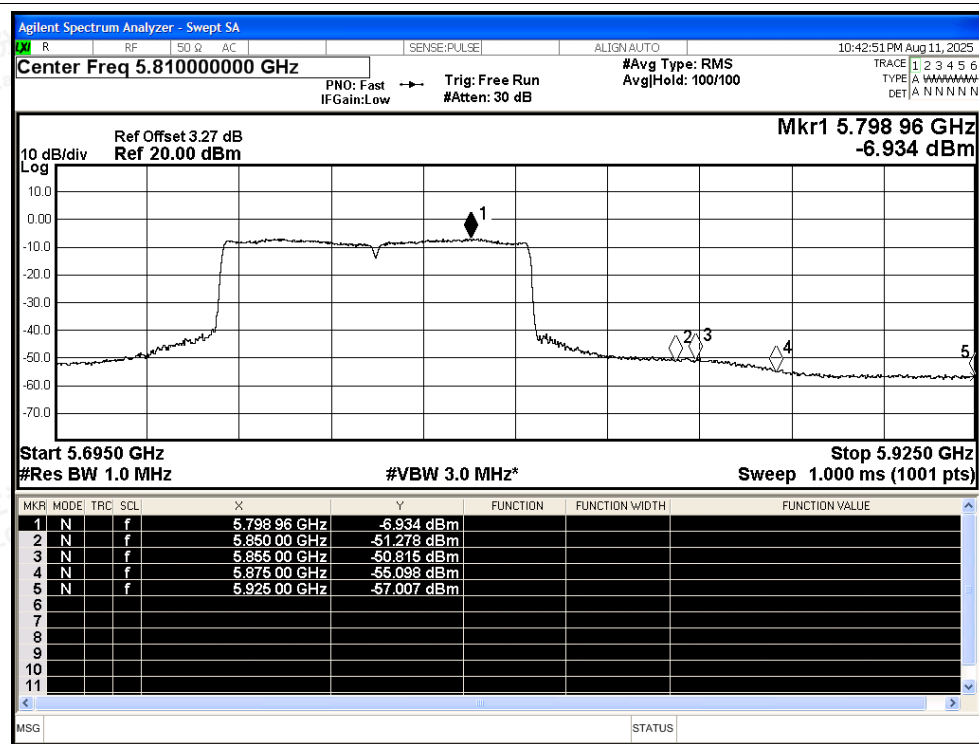

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant3 Peak

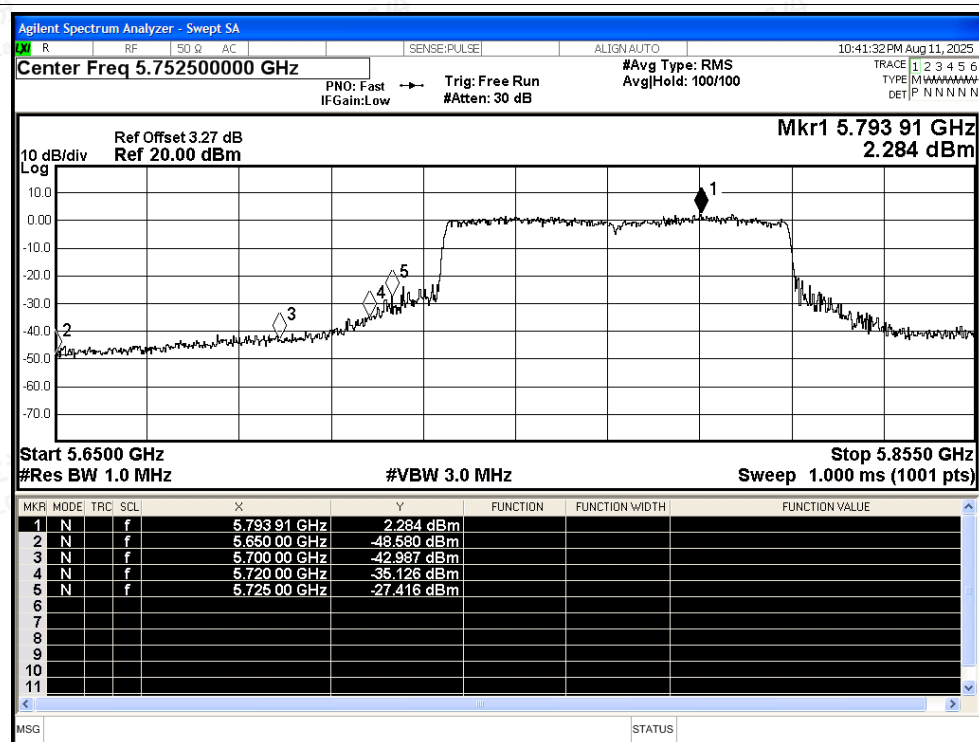

Restrict Band NVNT be80 5775MHz Ant3 Average

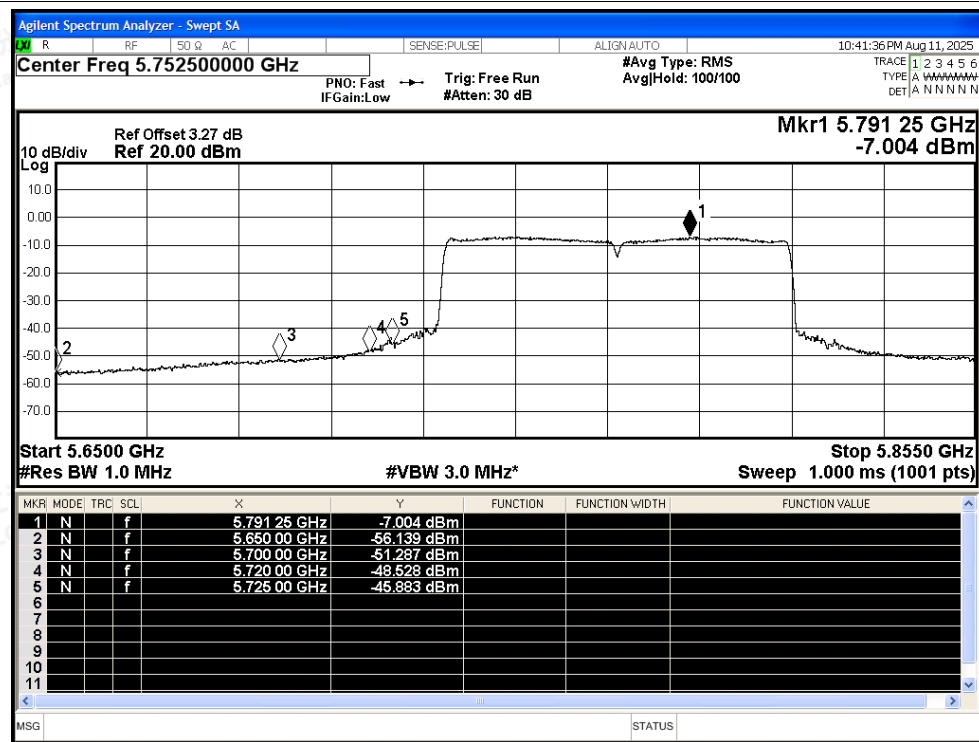

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Ant3 Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	-48.7	-49.75	-49.77	8.50	-37.68	Peak	-27	Pass
NVNT	n20	5745	-56.7	-56.93	-56.69	8.50	-45.30	Average	-27	Pass
NVNT	n20	5745	-47.96	-48.2	-47.07	8.50	-36.57	Peak	10	Pass
NVNT	n20	5745	-55.46	-54.93	-54.6	8.50	-43.68	Average	10	Pass
NVNT	n20	5745	-30.44	-29.59	-31.82	8.50	-18.48	Peak	15.6	Pass
NVNT	n20	5745	-44.64	-47.04	-45.79	8.50	-34.17	Average	15.6	Pass
NVNT	n20	5745	-23.99	-27.15	-24.78	8.50	-13.78	Peak	27	Pass
NVNT	n20	5745	-38.69	-40.23	-41.25	8.50	-27.88	Average	27	Pass
NVNT	n20	5825	-33.18	-33.87	-30.02	8.50	-22.00	Peak	27	Pass
NVNT	n20	5825	-45.55	-45.04	-45.95	8.50	-33.78	Average	27	Pass
NVNT	n20	5825	-37.58	-36.03	-39.09	8.50	-25.23	Peak	15.6	Pass
NVNT	n20	5825	-51.16	-49.74	-50.12	8.50	-38.88	Average	15.6	Pass
NVNT	n20	5825	-46.45	-47.37	-47.89	8.50	-35.38	Peak	10	Pass
NVNT	n20	5825	-54.93	-54.67	-54.93	8.50	-43.29	Average	10	Pass
NVNT	n20	5825	-48.06	-47.64	-47.21	8.50	-36.33	Peak	-27	Pass
NVNT	n20	5825	-55.99	-55.04	-55.75	8.50	-43.98	Average	-27	Pass
NVNT	n40	5755	-49.15	-49.22	-48.78	8.50	-37.67	Peak	-27	Pass
NVNT	n40	5755	-57.25	-57.42	-57.12	8.50	-45.82	Average	-27	Pass
NVNT	n40	5755	-44.37	-46.95	-46.03	8.50	-33.96	Peak	10	Pass
NVNT	n40	5755	-53.86	-54.63	-53.65	8.50	-42.72	Average	10	Pass
NVNT	n40	5755	-29.04	-30.95	-34.92	8.50	-18.38	Peak	15.6	Pass
NVNT	n40	5755	-46.5	-46.11	-44.58	8.50	-34.79	Average	15.6	Pass
NVNT	n40	5755	-28.76	-28.65	-26.69	8.50	-17.19	Peak	27	Pass
NVNT	n40	5755	-42.13	-42.39	-41.9	8.50	-30.75	Average	27	Pass
NVNT	n40	5795	-47.21	-48.17	-48.27	8.50	-36.15	Peak	27	Pass
NVNT	n40	5795	-55.51	-55.59	-56.04	8.50	-44.04	Average	27	Pass
NVNT	n40	5795	-46.18	-47.49	-48.69	8.50	-35.28	Peak	15.6	Pass
NVNT	n40	5795	-55.95	-56.15	-56.16	8.50	-44.54	Average	15.6	Pass
NVNT	n40	5795	-50.03	-48.36	-48.9	8.50	-37.60	Peak	10	Pass
NVNT	n40	5795	-57.11	-57.2	-57.26	8.50	-45.64	Average	10	Pass
NVNT	n40	5795	-47.72	-49.5	-49.12	8.50	-37.01	Peak	-27	Pass
NVNT	n40	5795	-57.1	-57.13	-56.98	8.50	-45.60	Average	-27	Pass
NVNT	ac20	5745	-48.6	-49.61	-48	8.50	-37.57	Peak	-27	Pass
NVNT	ac20	5745	-57.28	-56.57	-57.06	8.50	-45.40	Average	-27	Pass
NVNT	ac20	5745	-45.95	-48.49	-45.94	8.50	-35.53	Peak	10	Pass
NVNT	ac20	5745	-54.75	-55.07	-54.59	8.50	-43.40	Average	10	Pass
NVNT	ac20	5745	-30.39	-33.1	-29.43	8.50	-20.03	Peak	15.6	Pass
NVNT	ac20	5745	-44.66	-47.59	-45.83	8.50	-34.37	Average	15.6	Pass
NVNT	ac20	5745	-22.47	-24.66	-21.14	8.50	-11.91	Peak	27	Pass
NVNT	ac20	5745	-41.12	-40.1	-39.32	8.50	-29.07	Average	27	Pass
NVNT	ac20	5825	-31.06	-28.61	-32.74	8.50	-18.15	Peak	27	Pass
NVNT	ac20	5825	-45.72	-45.08	-44.45	8.50	-33.88	Average	27	Pass
NVNT	ac20	5825	-34.65	-34.36	-39.77	8.50	-22.99	Peak	15.6	Pass
NVNT	ac20	5825	-50.08	-50.19	-49.99	8.50	-38.62	Average	15.6	Pass
NVNT	ac20	5825	-46.7	-46.6	-45.31	8.50	-35.14	Peak	10	Pass
NVNT	ac20	5825	-54.74	-55.26	-55.12	8.50	-43.48	Average	10	Pass
NVNT	ac20	5825	-47.62	-48.46	-47.82	8.50	-36.51	Peak	-27	Pass
NVNT	ac20	5825	-55.59	-55.72	-55.43	8.50	-44.14	Average	-27	Pass
NVNT	ac40	5755	-48.49	-49.86	-47.81	8.50	-37.61	Peak	-27	Pass
NVNT	ac40	5755	-57.15	-56.81	-57.01	8.50	-45.47	Average	-27	Pass
NVNT	ac40	5755	-46.61	-45.95	-45.61	8.50	-34.76	Peak	10	Pass
NVNT	ac40	5755	-54.92	-54.75	-54.22	8.50	-43.32	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: + (86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5755	-31.45	-28.61	-30.11	8.50	-18.29	Peak	15.6	Pass
NVNT	ac40	5755	-45.47	-44.41	-44.19	8.50	-33.40	Average	15.6	Pass
NVNT	ac40	5755	-26.5	-26.43	-26.64	8.50	-14.95	Peak	27	Pass
NVNT	ac40	5755	-43.03	-42.95	-41.29	8.50	-31.48	Average	27	Pass
NVNT	ac40	5795	-44.15	-47.73	-47.51	8.50	-34.07	Peak	27	Pass
NVNT	ac40	5795	-55.4	-56.14	-56.45	8.50	-44.24	Average	27	Pass
NVNT	ac40	5795	-45.93	-47.08	-46.44	8.50	-34.96	Peak	15.6	Pass
NVNT	ac40	5795	-55.9	-55.96	-56.01	8.50	-44.42	Average	15.6	Pass
NVNT	ac40	5795	-49.37	-49.04	-50.02	8.50	-37.69	Peak	10	Pass
NVNT	ac40	5795	-56.79	-57.14	-57.45	8.50	-45.45	Average	10	Pass
NVNT	ac40	5795	-48.18	-46.26	-48.21	8.50	-35.60	Peak	-27	Pass
NVNT	ac40	5795	-57.95	-57.53	-57.31	8.50	-46.22	Average	-27	Pass
NVNT	ac80	5775	-37.68	-40.85	-39.87	8.50	-27.47	Peak	27	Pass
NVNT	ac80	5775	-49.04	-48.83	-51.02	8.50	-37.42	Average	27	Pass
NVNT	ac80	5775	-38.78	-40.6	-40.68	8.50	-28.08	Peak	15.6	Pass
NVNT	ac80	5775	-49.28	-49.49	-49.89	8.50	-37.87	Average	15.6	Pass
NVNT	ac80	5775	-45.51	-46.28	-45.33	8.50	-34.37	Peak	10	Pass
NVNT	ac80	5775	-54	-54.49	-54	8.50	-42.73	Average	10	Pass
NVNT	ac80	5775	-48.35	-50.59	-49.53	8.50	-37.82	Peak	-27	Pass
NVNT	ac80	5775	-56.95	-56.5	-56.96	8.50	-45.21	Average	-27	Pass
NVNT	ac80	5775	-47.96	-47.66	-46.95	8.50	-36.30	Peak	-27	Pass
NVNT	ac80	5775	-55.59	-55.88	-55.95	8.50	-44.22	Average	-27	Pass
NVNT	ac80	5775	-39.37	-41.77	-41.59	8.50	-28.90	Peak	10	Pass
NVNT	ac80	5775	-50.59	-49.96	-50.84	8.50	-38.75	Average	10	Pass
NVNT	ac80	5775	-35.78	-34	-31.9	8.50	-23.29	Peak	15.6	Pass
NVNT	ac80	5775	-47.64	-46.04	-46.31	8.50	-35.26	Average	15.6	Pass
NVNT	ac80	5775	-31.05	-30.88	-32.62	8.50	-19.45	Peak	27	Pass
NVNT	ac80	5775	-45.68	-43.3	-44.25	8.50	-32.82	Average	27	Pass
NVNT	ax20	5745	-48.58	-47.84	-47.95	8.50	-36.68	Peak	-27	Pass
NVNT	ax20	5745	-56.58	-57.13	-56.36	8.50	-45.34	Average	-27	Pass
NVNT	ax20	5745	-47.52	-45.79	-46.39	8.50	-35.06	Peak	10	Pass
NVNT	ax20	5745	-55.04	-54.93	-54.75	8.50	-43.47	Average	10	Pass
NVNT	ax20	5745	-27.74	-31.65	-30.85	8.50	-17.76	Peak	15.6	Pass
NVNT	ax20	5745	-45.09	-48.44	-43.1	8.50	-34.94	Average	15.6	Pass
NVNT	ax20	5745	-26.91	-27.81	-21.89	8.50	-15.82	Peak	27	Pass
NVNT	ax20	5745	-40.02	-41.12	-39.01	8.50	-29.02	Average	27	Pass
NVNT	ax20	5825	-29.51	-32.04	-30.96	8.50	-19.08	Peak	27	Pass
NVNT	ax20	5825	-45.12	-43.48	-45.15	8.50	-32.71	Average	27	Pass
NVNT	ax20	5825	-37.19	-35.7	-34.72	8.50	-24.87	Peak	15.6	Pass
NVNT	ax20	5825	-49.91	-49.91	-49.81	8.50	-38.40	Average	15.6	Pass
NVNT	ax20	5825	-47.51	-46.37	-46.44	8.50	-35.39	Peak	10	Pass
NVNT	ax20	5825	-55.53	-54.87	-54.48	8.50	-43.68	Average	10	Pass
NVNT	ax20	5825	-47.69	-48.88	-47.54	8.50	-36.73	Peak	-27	Pass
NVNT	ax20	5825	-55.78	-56.07	-55.3	8.50	-44.41	Average	-27	Pass
NVNT	ax40	5755	-48.44	-49.82	-47.78	8.50	-37.57	Peak	-27	Pass
NVNT	ax40	5755	-56.57	-57.08	-56.42	8.50	-45.31	Average	-27	Pass
NVNT	ax40	5755	-47.91	-45.9	-45.17	8.50	-35.28	Peak	10	Pass
NVNT	ax40	5755	-54.73	-54.97	-53.47	8.50	-43.34	Average	10	Pass
NVNT	ax40	5755	-30.82	-28.8	-31.99	8.50	-18.18	Peak	15.6	Pass
NVNT	ax40	5755	-44.59	-45.98	-43.77	8.50	-33.72	Average	15.6	Pass
NVNT	ax40	5755	-24.78	-27.12	-25.92	8.50	-14.28	Peak	27	Pass
NVNT	ax40	5755	-42.23	-42.87	-43.04	8.50	-31.03	Average	27	Pass
NVNT	ax40	5795	-47.72	-47.98	-48.35	8.50	-36.34	Peak	27	Pass
NVNT	ax40	5795	-55.41	-55.42	-56.22	8.50	-43.90	Average	27	Pass
NVNT	ax40	5795	-47.25	-47.74	-49.51	8.50	-35.98	Peak	15.6	Pass
NVNT	ax40	5795	-56.07	-56.19	-55.75	8.50	-44.62	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	-48.3	-49.36	-48.75	8.50	-37.29	Peak	10	Pass
NVNT	ax40	5795	-56.93	-56.92	-57.61	8.50	-45.41	Average	10	Pass
NVNT	ax40	5795	-49.43	-50.27	-48.29	8.50	-38.32	Peak	-27	Pass
NVNT	ax40	5795	-57	-56.53	-57.15	8.50	-45.25	Average	-27	Pass
NVNT	ax80	5775	-36.88	-39.2	-38.4	8.50	-26.38	Peak	27	Pass
NVNT	ax80	5775	-49.56	-48.67	-49.88	8.50	-37.58	Average	27	Pass
NVNT	ax80	5775	-40.31	-39.58	-40.98	8.50	-28.42	Peak	15.6	Pass
NVNT	ax80	5775	-49.3	-49.57	-50.75	8.50	-37.92	Average	15.6	Pass
NVNT	ax80	5775	-43.8	-44.05	-44.19	8.50	-32.41	Peak	10	Pass
NVNT	ax80	5775	-54.19	-53.67	-53.29	8.50	-42.41	Average	10	Pass
NVNT	ax80	5775	-49.22	-48.41	-47.29	8.50	-37.29	Peak	-27	Pass
NVNT	ax80	5775	-56.5	-57.08	-57.38	8.50	-45.27	Average	-27	Pass
NVNT	ax80	5775	-47.32	-46.97	-47.13	8.50	-35.63	Peak	-27	Pass
NVNT	ax80	5775	-55.77	-55.47	-55.81	8.50	-44.11	Average	-27	Pass
NVNT	ax80	5775	-42.19	-41.43	-42.79	8.50	-30.28	Peak	10	Pass
NVNT	ax80	5775	-50.86	-50.12	-50.53	8.50	-38.96	Average	10	Pass
NVNT	ax80	5775	-34.56	-34.51	-34.62	8.50	-23.02	Peak	15.6	Pass
NVNT	ax80	5775	-46.93	-47.08	-46.88	8.50	-35.49	Average	15.6	Pass
NVNT	ax80	5775	-32.01	-33.05	-31.61	8.50	-20.99	Peak	27	Pass
NVNT	ax80	5775	-43.69	-44.95	-44.25	8.50	-32.76	Average	27	Pass
NVNT	be20	5745	-48.45	-48.46	-50.04	8.50	-36.94	Peak	-27	Pass
NVNT	be20	5745	-56.83	-57.36	-56.46	8.50	-45.58	Average	-27	Pass
NVNT	be20	5745	-46.2	-46.81	-48.26	8.50	-34.98	Peak	10	Pass
NVNT	be20	5745	-55.17	-54.3	-54.86	8.50	-43.20	Average	10	Pass
NVNT	be20	5745	-32.17	-33.29	-27.55	8.50	-21.18	Peak	15.6	Pass
NVNT	be20	5745	-45.86	-44.1	-43.37	8.50	-33.38	Average	15.6	Pass
NVNT	be20	5745	-24.62	-22.98	-17.72	8.50	-12.20	Peak	27	Pass
NVNT	be20	5745	-40.14	-39.7	-38.33	8.50	-28.40	Average	27	Pass
NVNT	be20	5825	-29.68	-32.02	-30.02	8.50	-19.18	Peak	27	Pass
NVNT	be20	5825	-46.06	-48.31	-45.87	8.50	-35.53	Average	27	Pass
NVNT	be20	5825	-34.9	-39.63	-31.02	8.50	-25.14	Peak	15.6	Pass
NVNT	be20	5825	-48.95	-51.04	-50.26	8.50	-38.36	Average	15.6	Pass
NVNT	be20	5825	-44.46	-46.98	-48.4	8.50	-34.03	Peak	10	Pass
NVNT	be20	5825	-55.45	-55.59	-54.68	8.50	-44.01	Average	10	Pass
NVNT	be20	5825	-47.99	-48.07	-48.36	8.50	-36.52	Peak	-27	Pass
NVNT	be20	5825	-55.64	-55.82	-55.72	8.50	-44.22	Average	-27	Pass
NVNT	be40	5755	-48.69	-47.66	-48.51	8.50	-36.63	Peak	-27	Pass
NVNT	be40	5755	-56.72	-57.08	-56.83	8.50	-45.39	Average	-27	Pass
NVNT	be40	5755	-45.37	-45.17	-45.69	8.50	-33.76	Peak	10	Pass
NVNT	be40	5755	-54.03	-53.19	-53.96	8.50	-42.08	Average	10	Pass
NVNT	be40	5755	-29.73	-29.69	-24.87	8.50	-18.20	Peak	15.6	Pass
NVNT	be40	5755	-43.73	-43.05	-43.23	8.50	-31.87	Average	15.6	Pass
NVNT	be40	5755	-25.41	-27.16	-27.25	8.50	-14.69	Peak	27	Pass
NVNT	be40	5755	-41.03	-39.77	-40.77	8.50	-28.84	Average	27	Pass
NVNT	be40	5795	-47.36	-48.38	-47.23	8.50	-36.33	Peak	27	Pass
NVNT	be40	5795	-55.77	-55.91	-55.77	8.50	-44.33	Average	27	Pass
NVNT	be40	5795	-49.56	-48.31	-47.16	8.50	-37.38	Peak	15.6	Pass
NVNT	be40	5795	-56.51	-56.12	-56.38	8.50	-44.80	Average	15.6	Pass
NVNT	be40	5795	-49.4	-49.46	-50.38	8.50	-37.92	Peak	10	Pass
NVNT	be40	5795	-57.28	-56.4	-57.47	8.50	-45.31	Average	10	Pass
NVNT	be40	5795	-49.26	-49.56	-47.97	8.50	-37.90	Peak	-27	Pass
NVNT	be40	5795	-57	-57.23	-57.46	8.50	-45.60	Average	-27	Pass
NVNT	be80	5775	-42.42	-40.6	-41.6	8.50	-29.90	Peak	27	Pass
NVNT	be80	5775	-51.02	-51.49	-51.28	8.50	-39.74	Average	27	Pass
NVNT	be80	5775	-41.24	-40.5	-41.93	8.50	-29.34	Peak	15.6	Pass
NVNT	be80	5775	-51.14	-51.11	-50.82	8.50	-39.61	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be80	5775	-45.97	-44.69	-46.09	8.50	-33.77	Peak	10	Pass
NVNT	be80	5775	-54.42	-54.13	-55.1	8.50	-42.76	Average	10	Pass
NVNT	be80	5775	-48.4	-49.22	-47.17	8.50	-37.28	Peak	-27	Pass
NVNT	be80	5775	-56.89	-57.18	-57.01	8.50	-45.52	Average	-27	Pass
NVNT	be80	5775	-48.72	-48.77	-48.58	8.50	-37.23	Peak	-27	Pass
NVNT	be80	5775	-56.83	-55.94	-56.14	8.50	-44.85	Average	-27	Pass
NVNT	be80	5775	-42.22	-42.17	-42.99	8.50	-30.68	Peak	10	Pass
NVNT	be80	5775	-52.07	-51.91	-51.29	8.50	-40.48	Average	10	Pass
NVNT	be80	5775	-34.65	-35.44	-35.13	8.50	-23.52	Peak	15.6	Pass
NVNT	be80	5775	-48.83	-47.72	-48.53	8.50	-36.73	Average	15.6	Pass
NVNT	be80	5775	-31.03	-29.01	-27.42	8.50	-18.39	Peak	27	Pass
NVNT	be80	5775	-44.35	-45.29	-45.88	8.50	-33.28	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant1	5755	0	0	25	Pass
NVNT	n40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac80	5775	Ant1	5775	0	0	25	Pass
NVNT	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant1	5755	0	0	25	Pass
NVNT	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant1	5775	0	0	25	Pass
NVNT	be20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	be20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	be20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	be40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	be40	5795	Ant1	5795	0	0	25	Pass
NVNT	be80	5775	Ant1	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant1

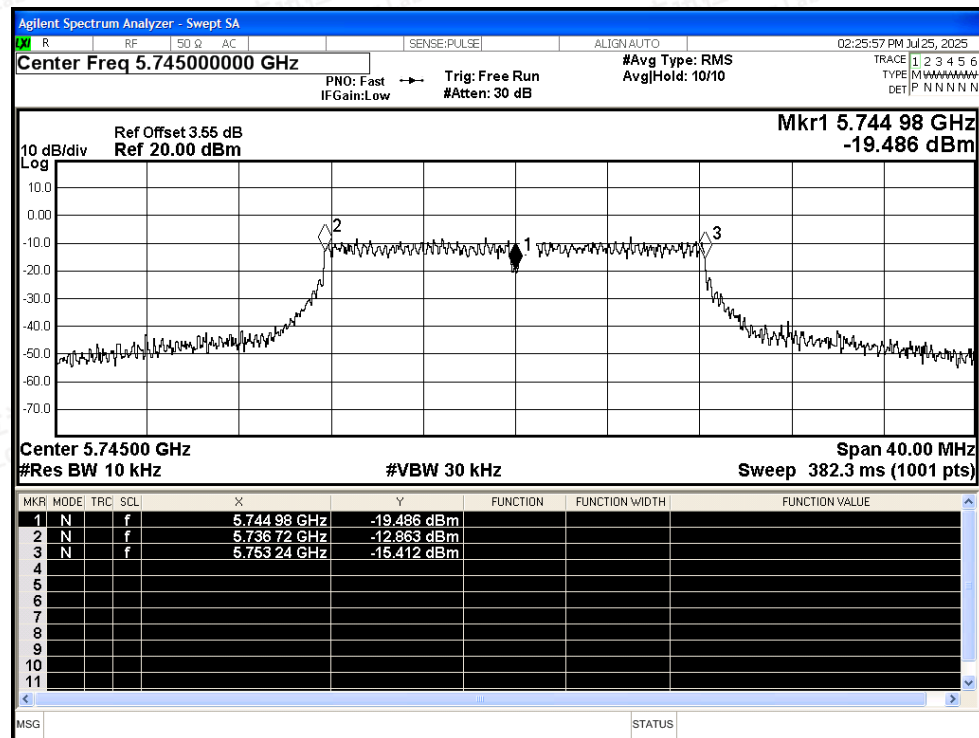

Freq. Stability NVNT a 5785MHz Ant1

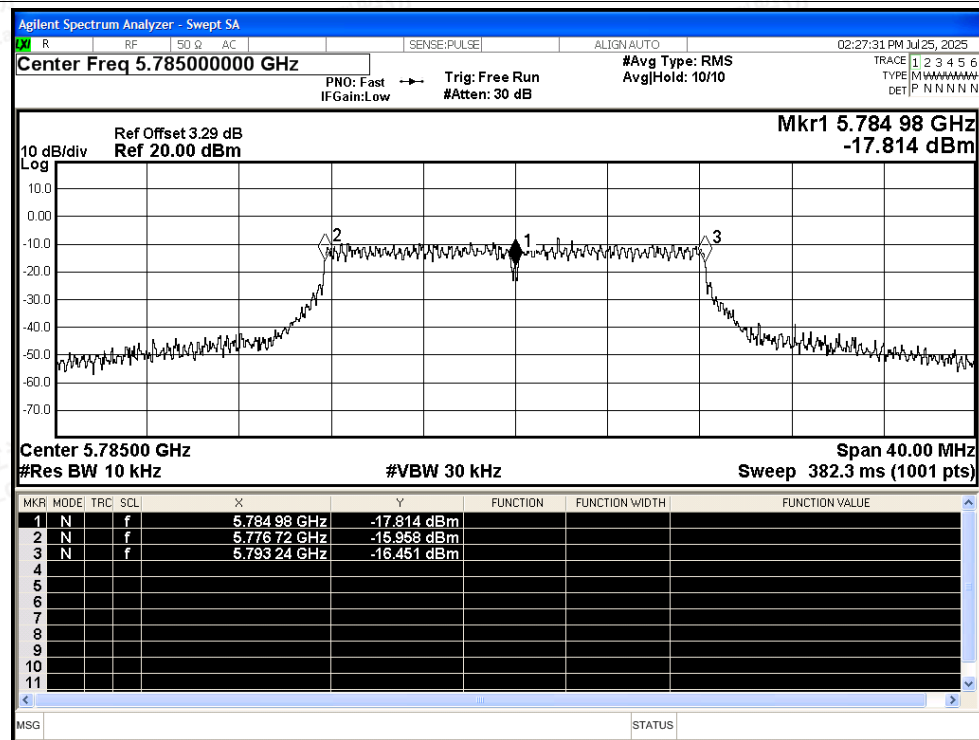

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant1

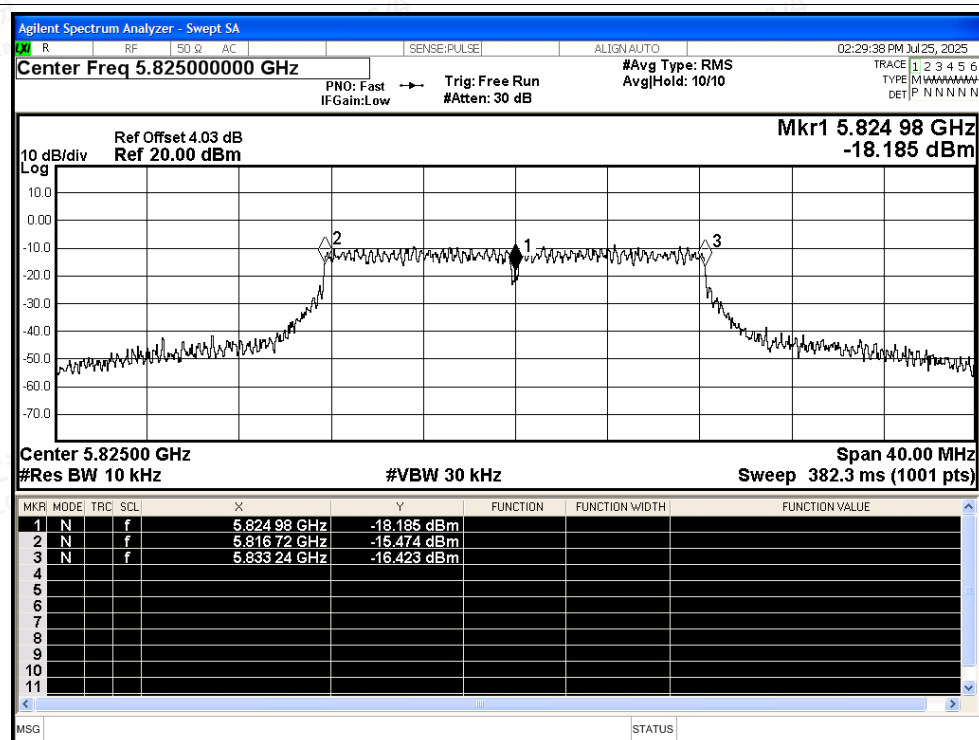

Freq. Stability NVNT n20 5745MHz Ant1

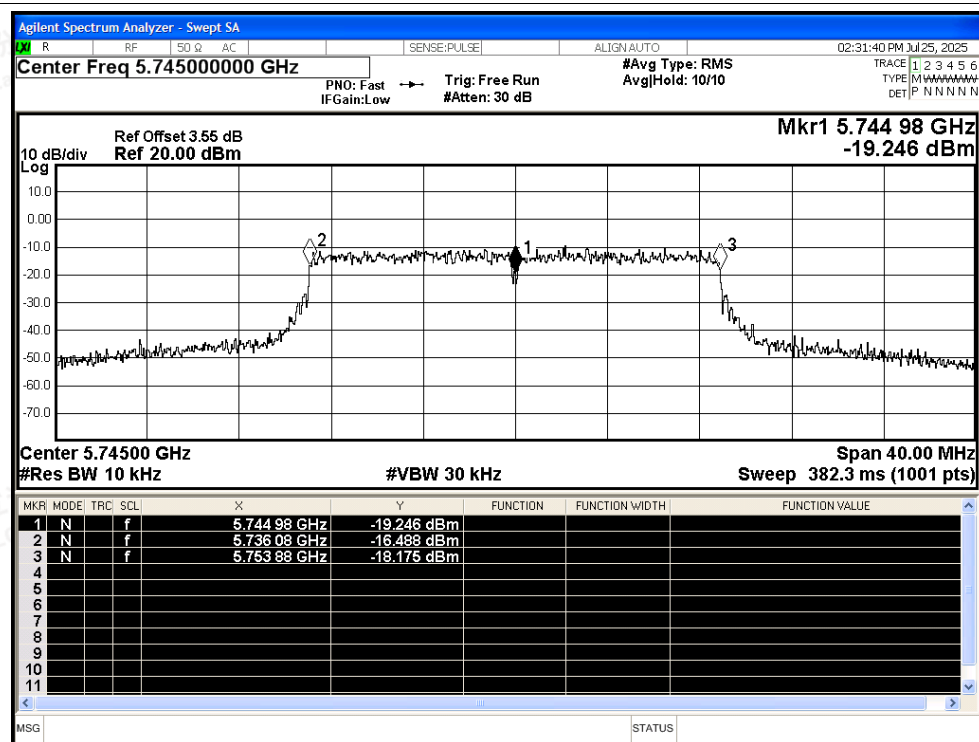

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant1

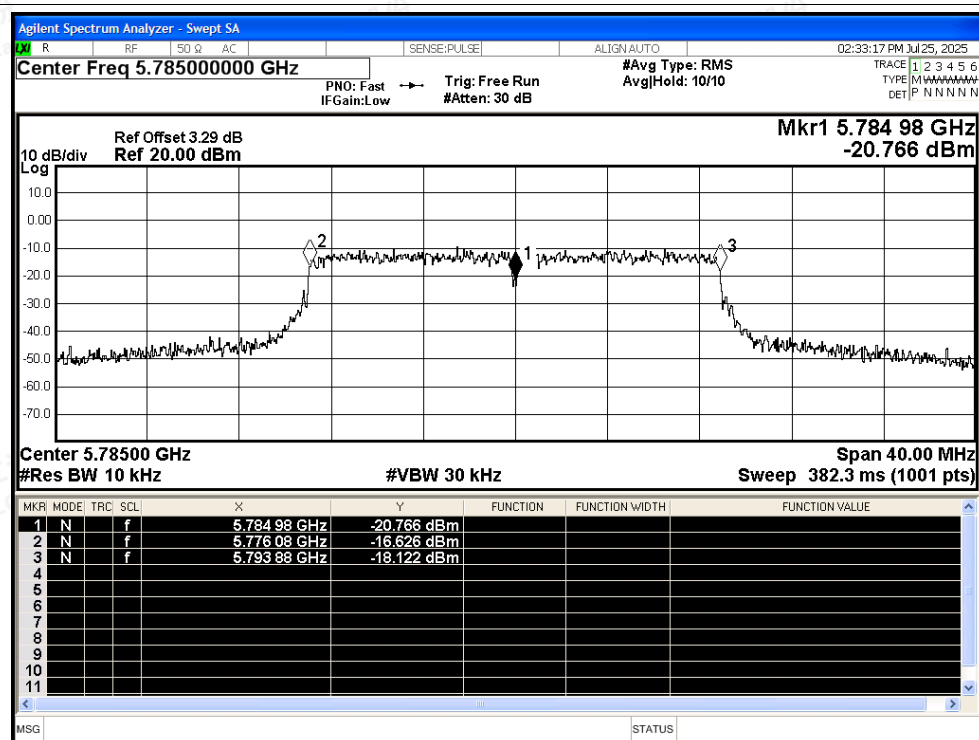

Freq. Stability NVNT n20 5825MHz Ant1

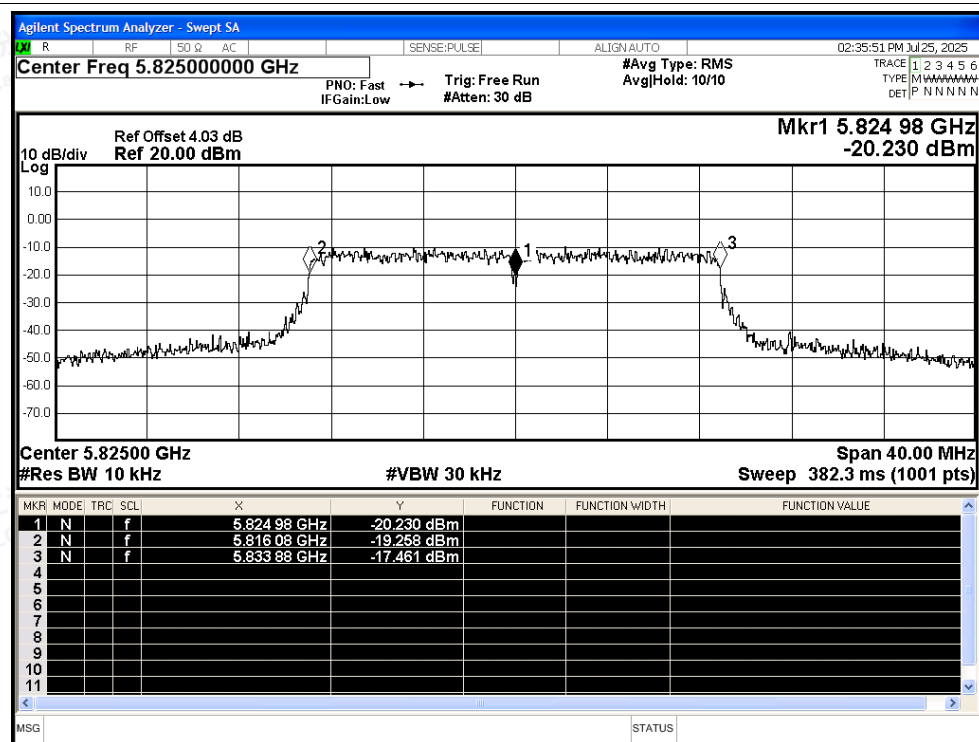

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant1

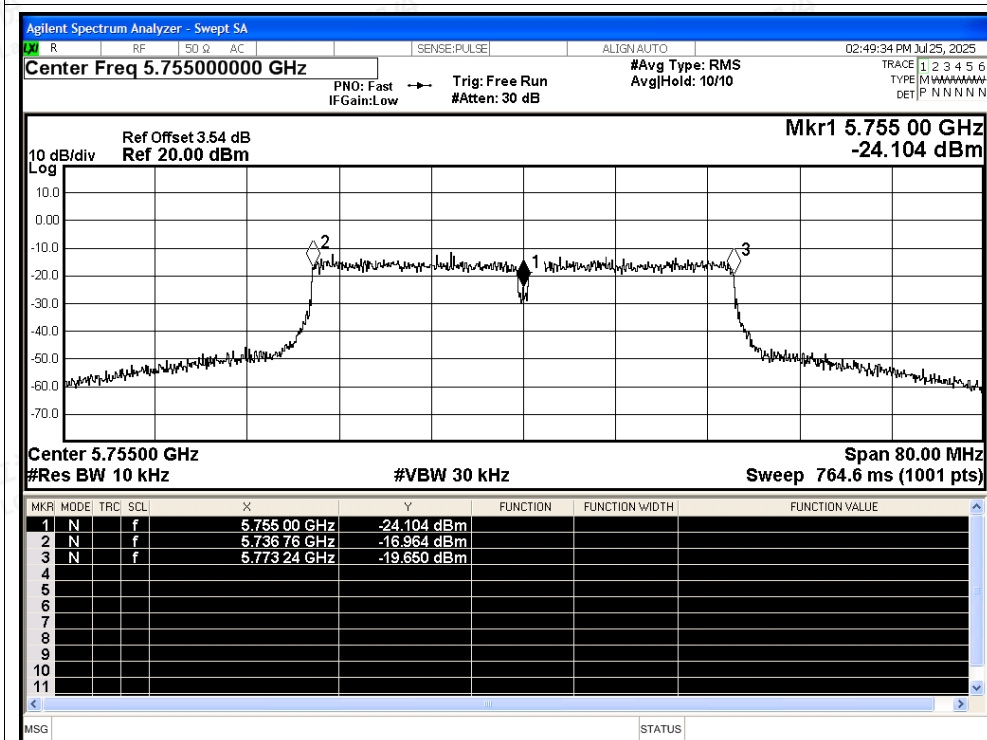

Freq. Stability NVNT n40 5795MHz Ant1

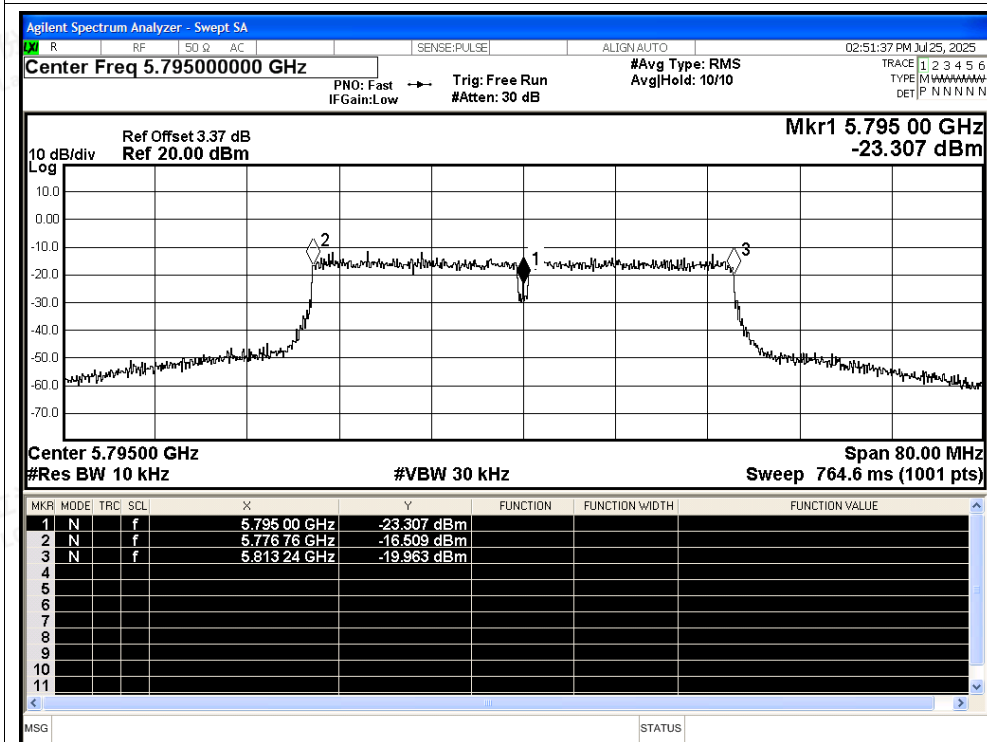

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant1

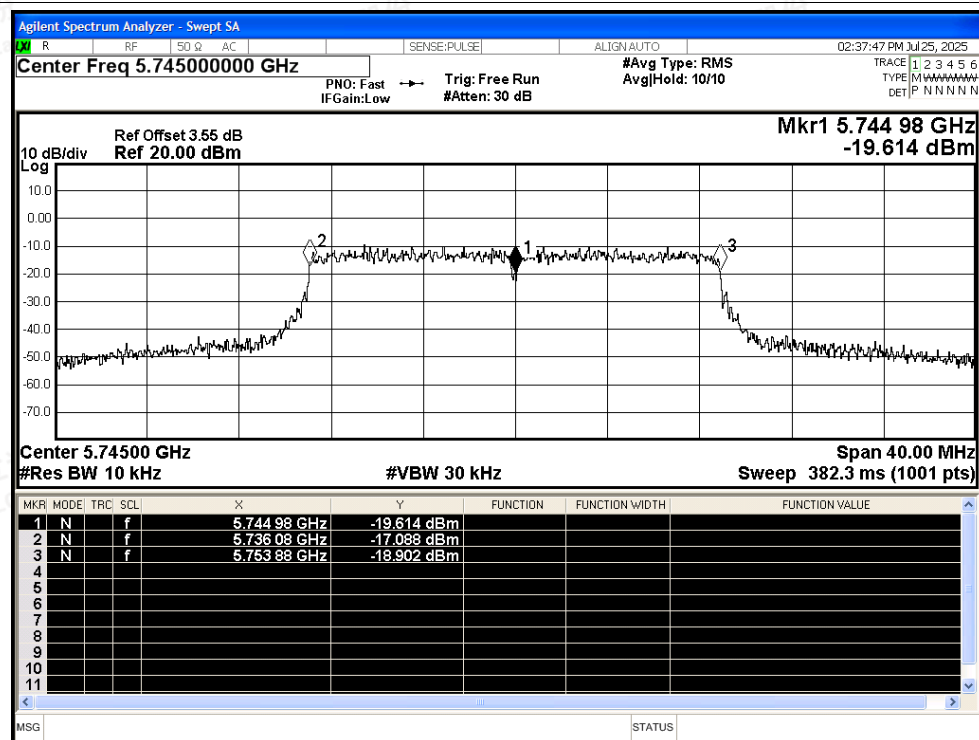

Freq. Stability NVNT ac20 5785MHz Ant1

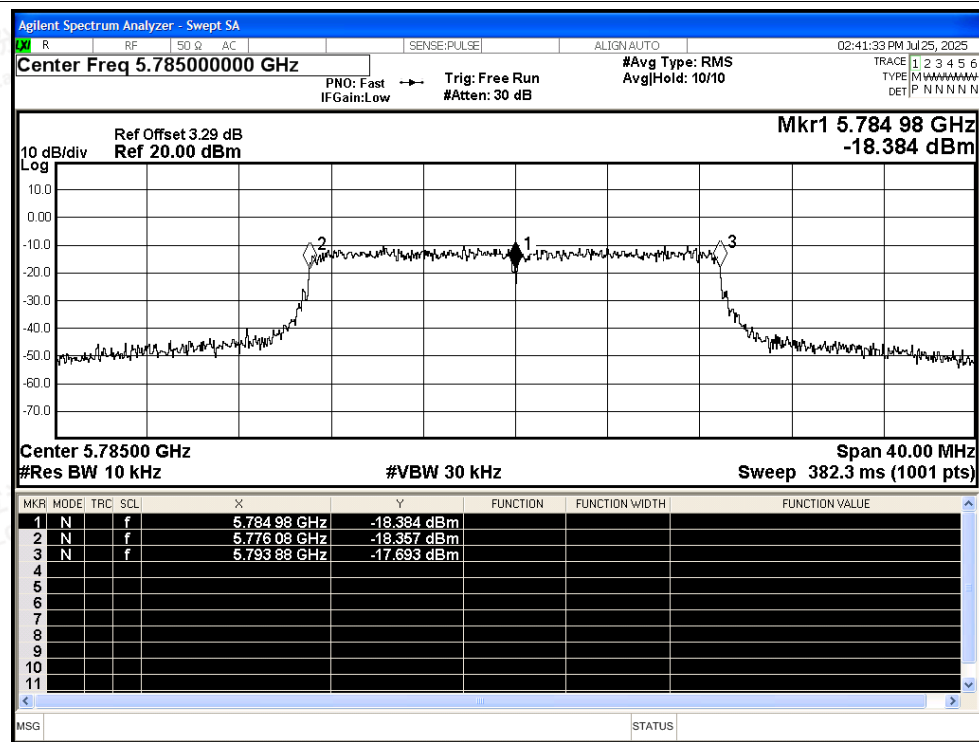

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant1

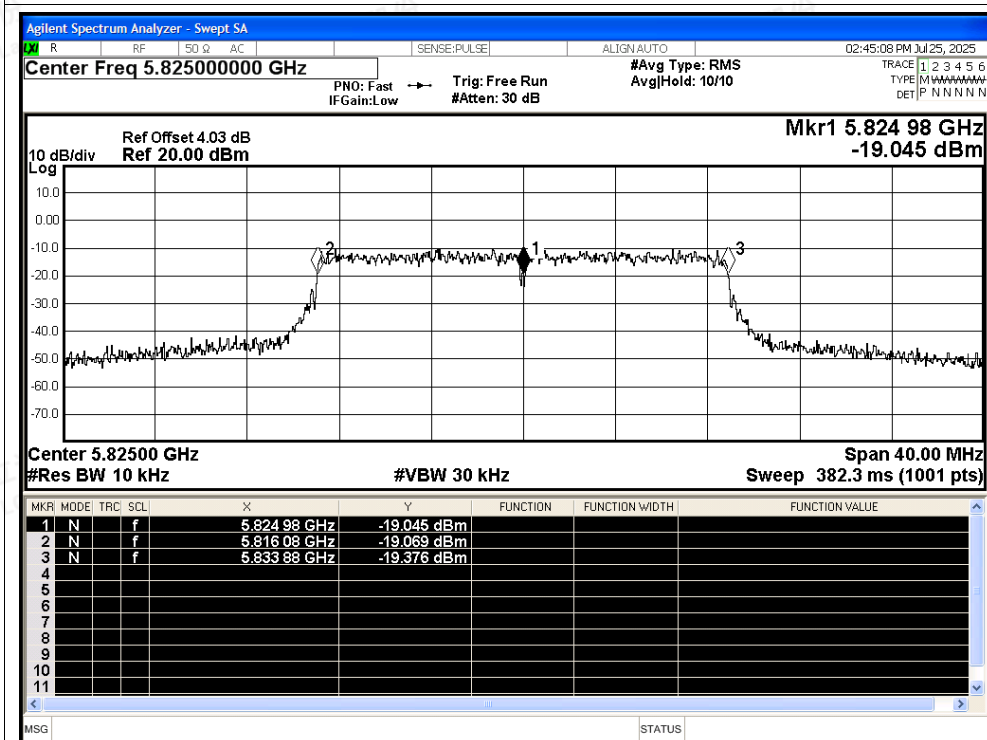

Freq. Stability NVNT ac40 5755MHz Ant1

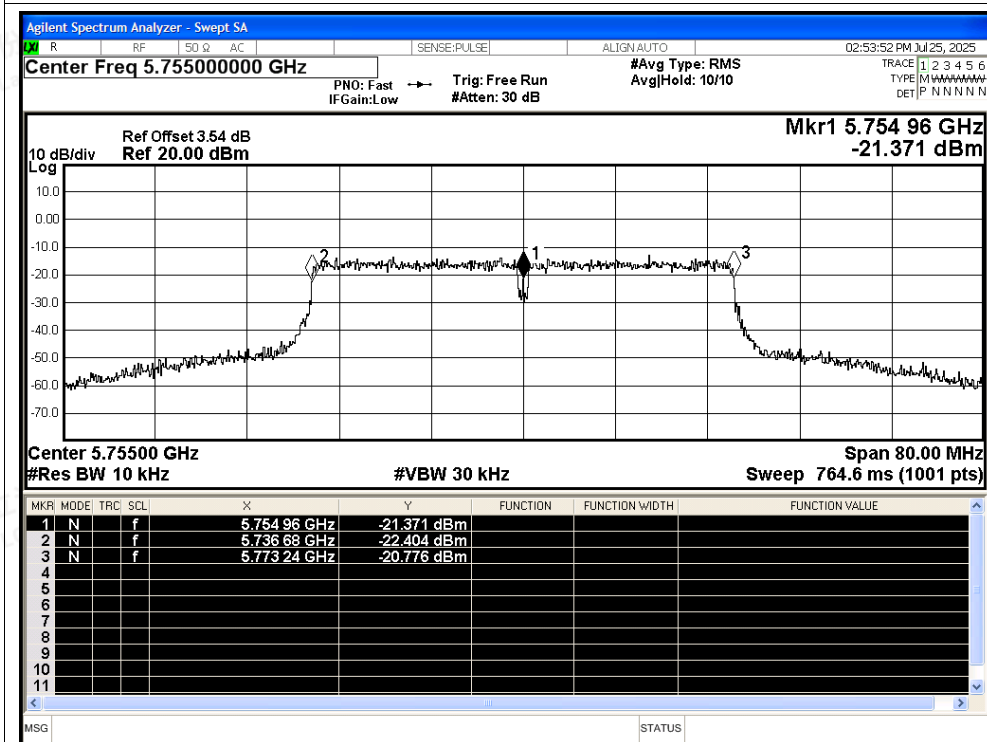

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant1

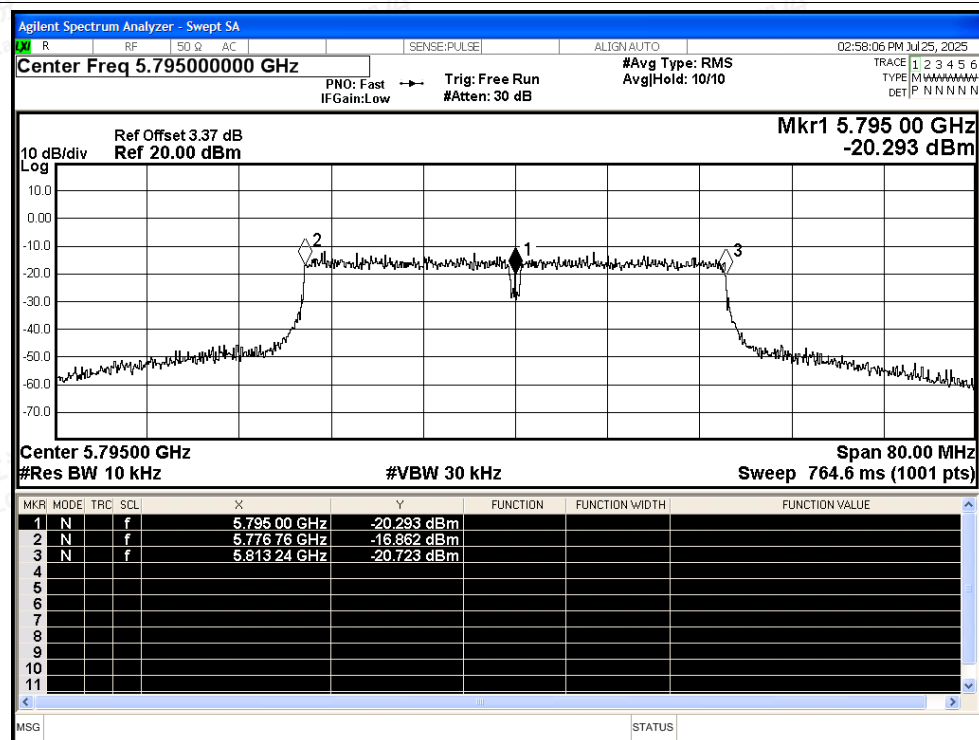

Freq. Stability NVNT ac80 5775MHz Ant1

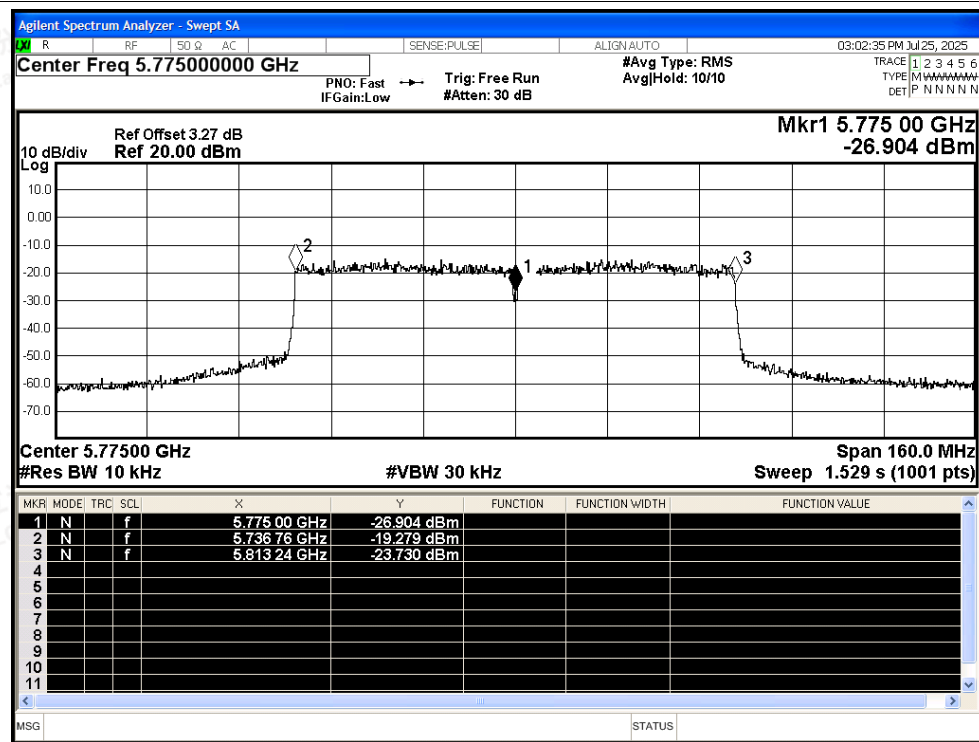

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant1

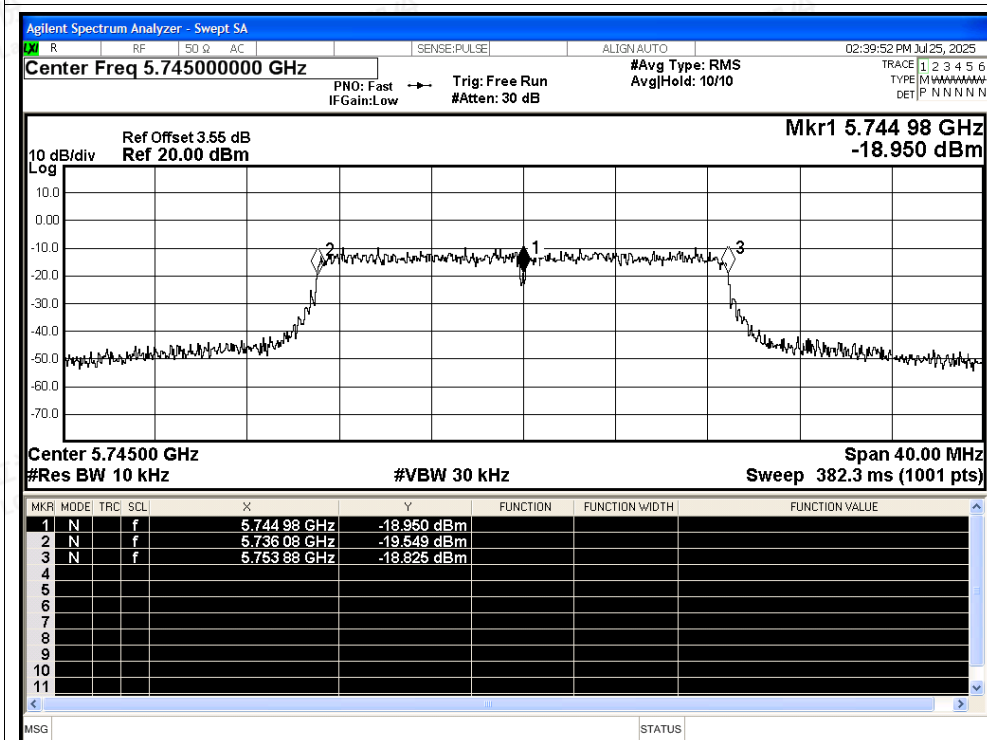

Freq. Stability NVNT ax20 5785MHz Ant1

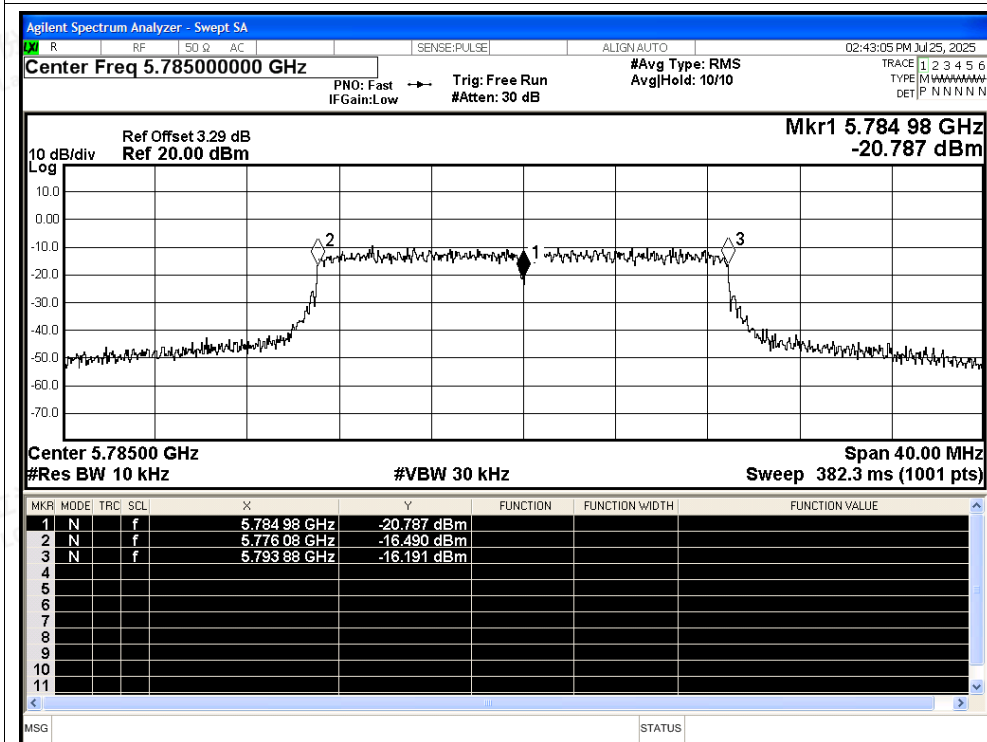

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant1

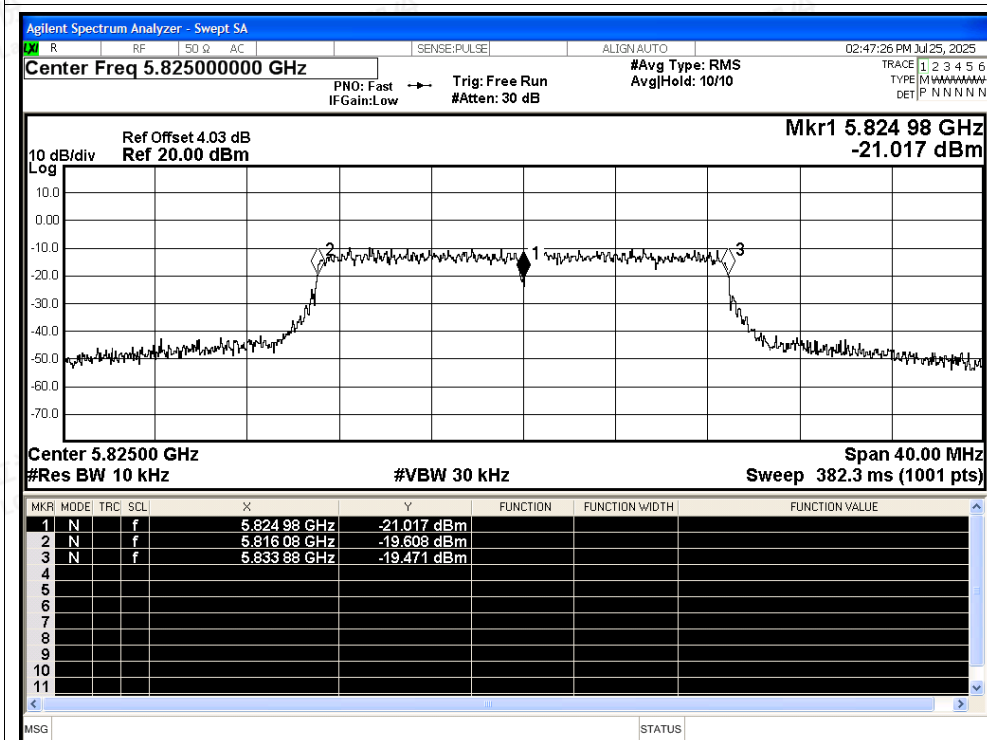

Freq. Stability NVNT ax40 5755MHz Ant1

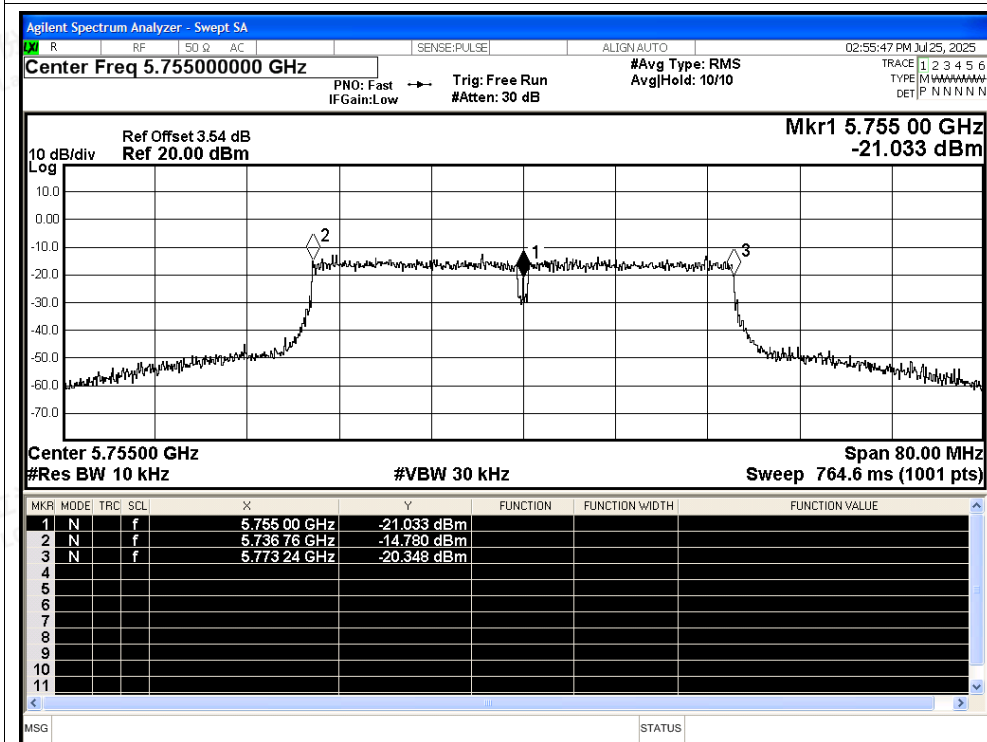

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant1

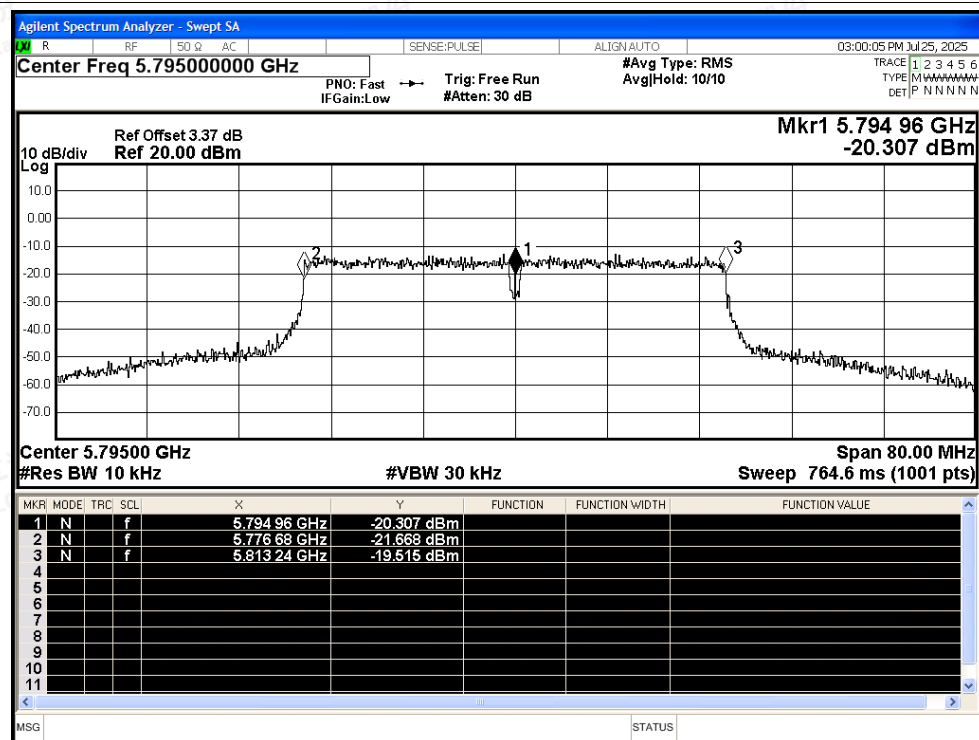

Freq. Stability NVNT ax80 5775MHz Ant1

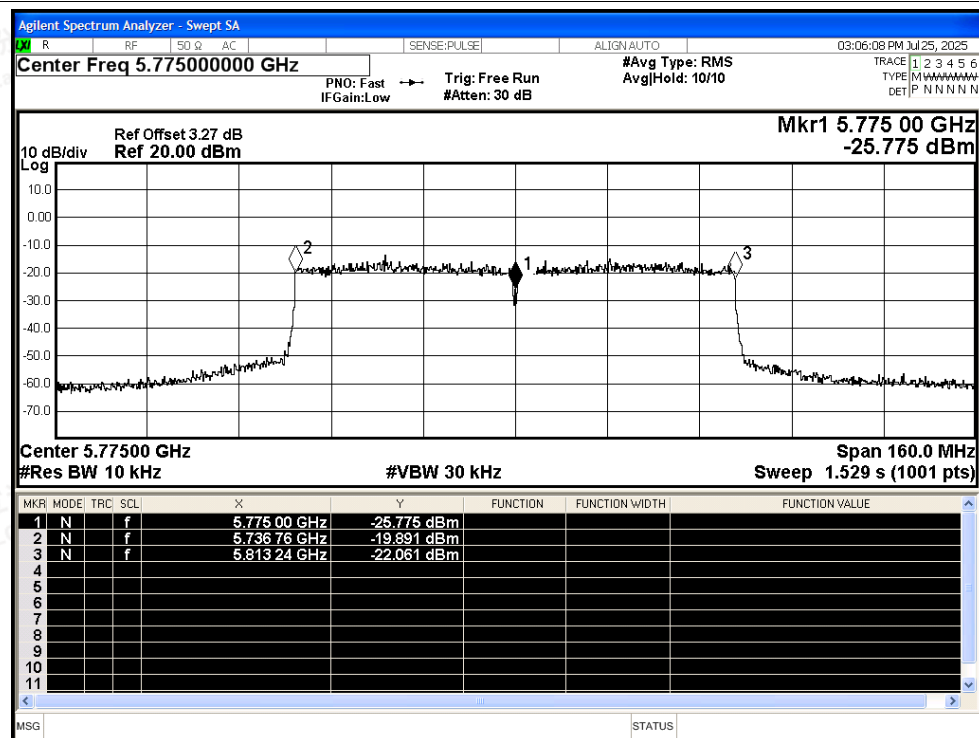

Freq. Stability NVNT be20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

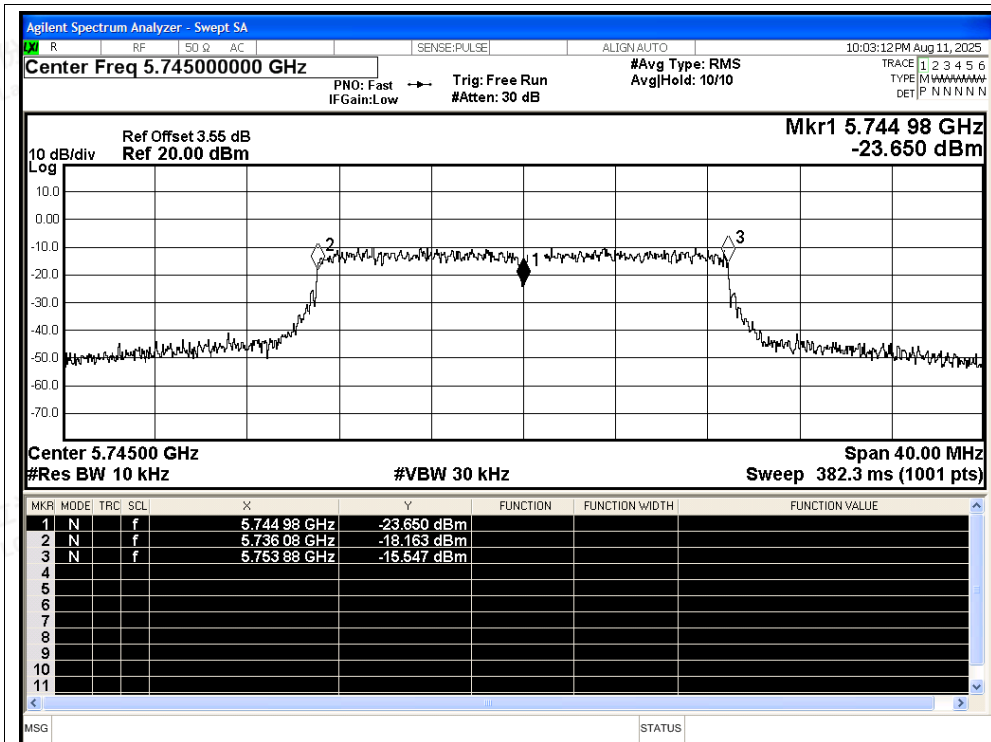

Freq. Stability NVNT be20 5785MHz Ant1

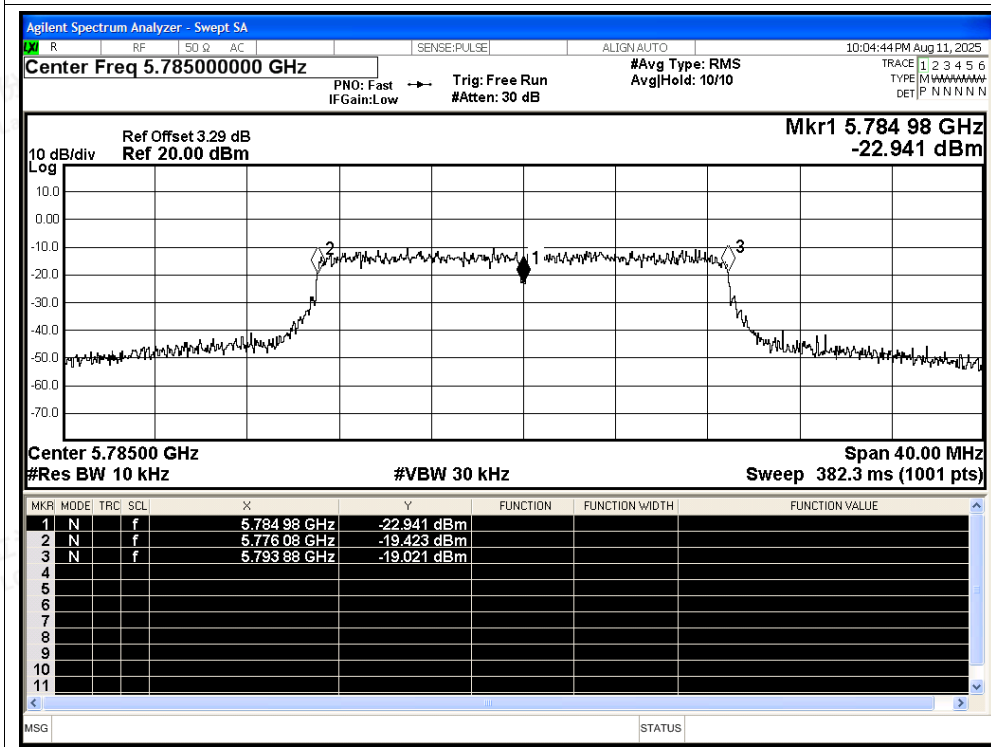

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5825MHz Ant1

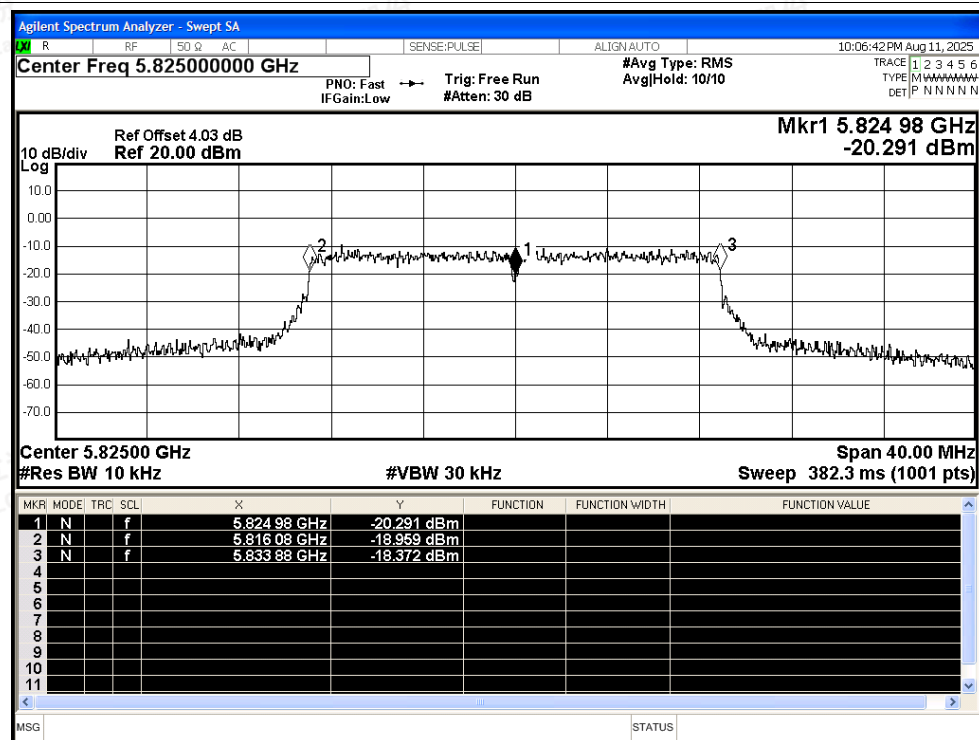

Freq. Stability NVNT be40 5755MHz Ant1

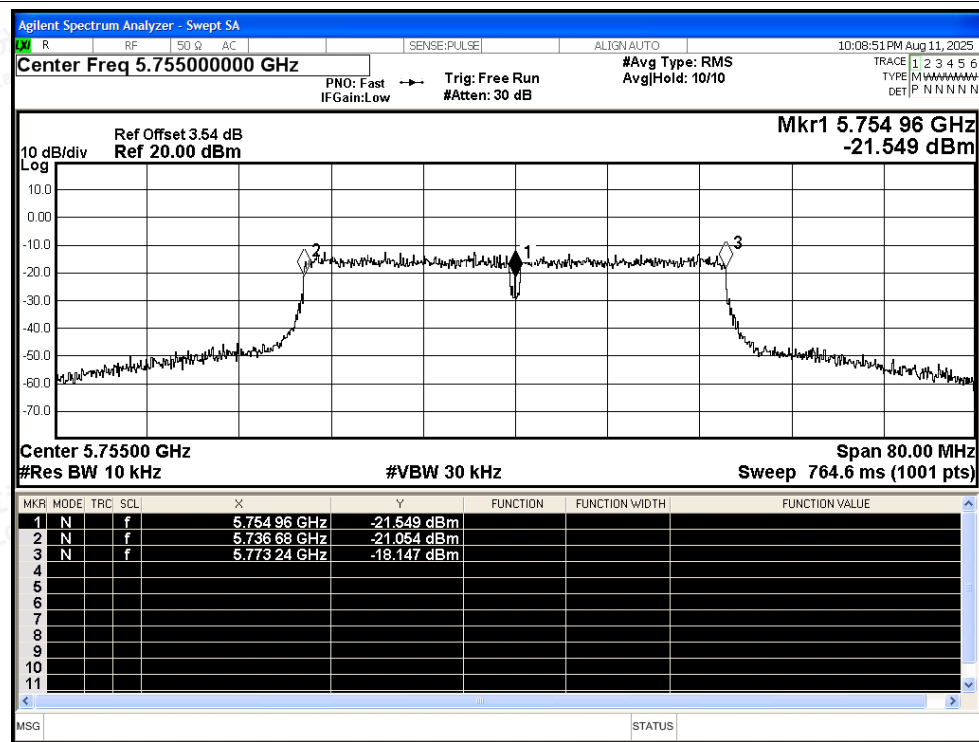

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be40 5795MHz Ant1

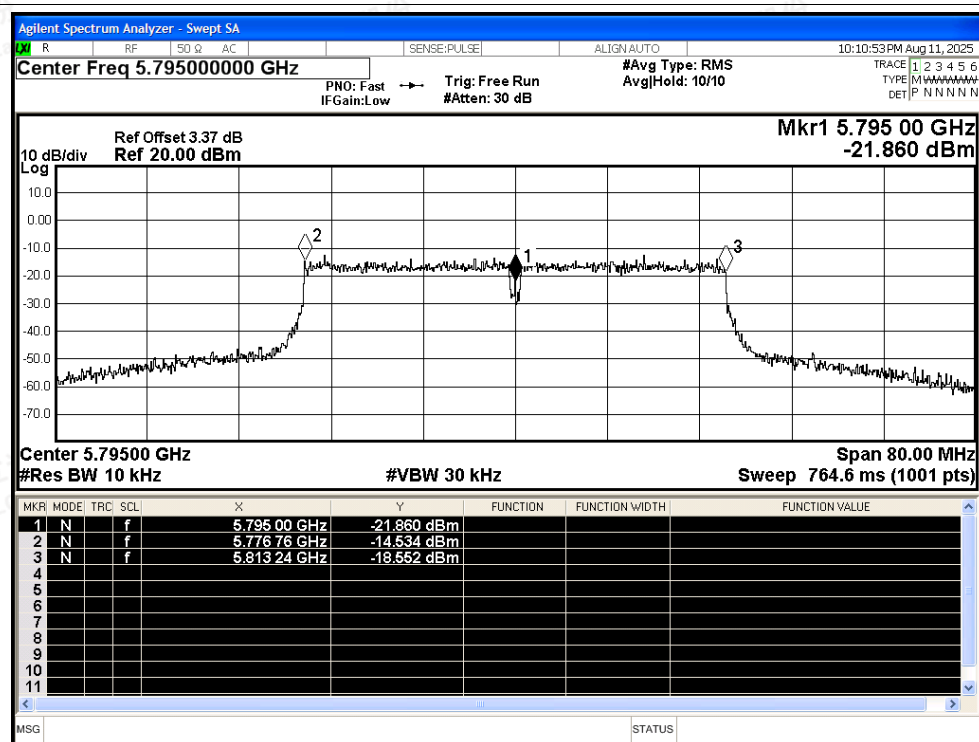

Freq. Stability NVNT be80 5775MHz Ant1

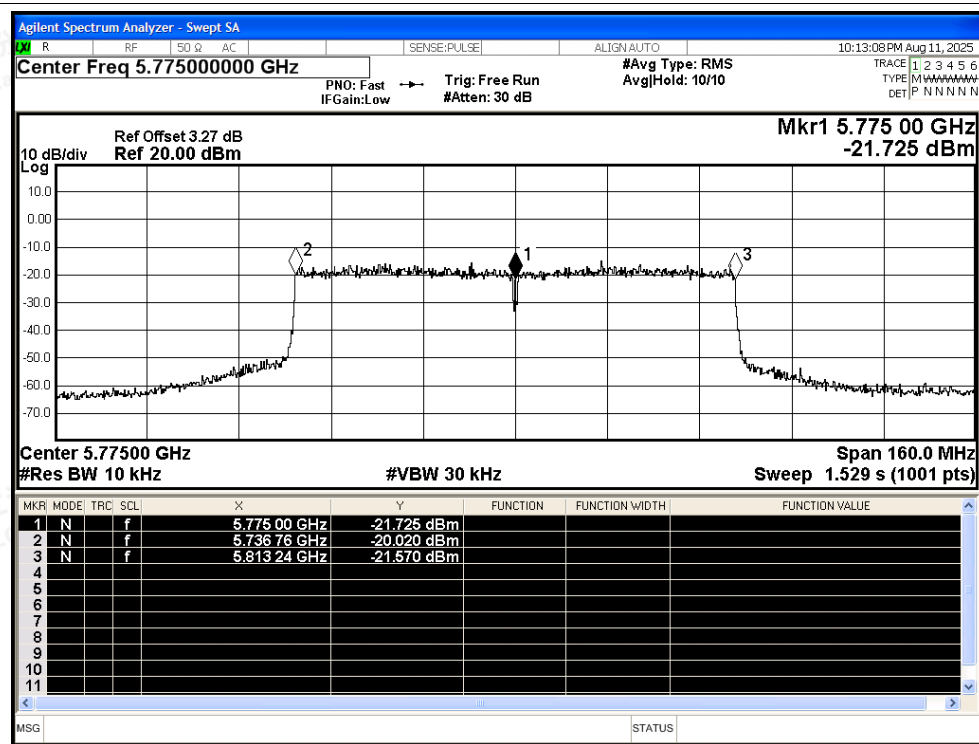

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant2	5825	0	0	25	Pass
NVNT	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
NVNT	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant2	5755	0	0	25	Pass
NVNT	n40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac20	5745	Ant2	5745	0	0	25	Pass
NVNT	ac20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
NVNT	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass
NVNT	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant2	5785	0	0	25	Pass
NVNT	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant2	5795	0	0	25	Pass
NVNT	ax80	5775	Ant2	5775	0	0	25	Pass
NVNT	be20	5745	Ant2	5745	0	0	25	Pass
NVNT	be20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	be20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
NVNT	be40	5755	Ant2	5755	0	0	25	Pass
NVNT	be40	5795	Ant2	5795	0	0	25	Pass
NVNT	be80	5775	Ant2	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant2

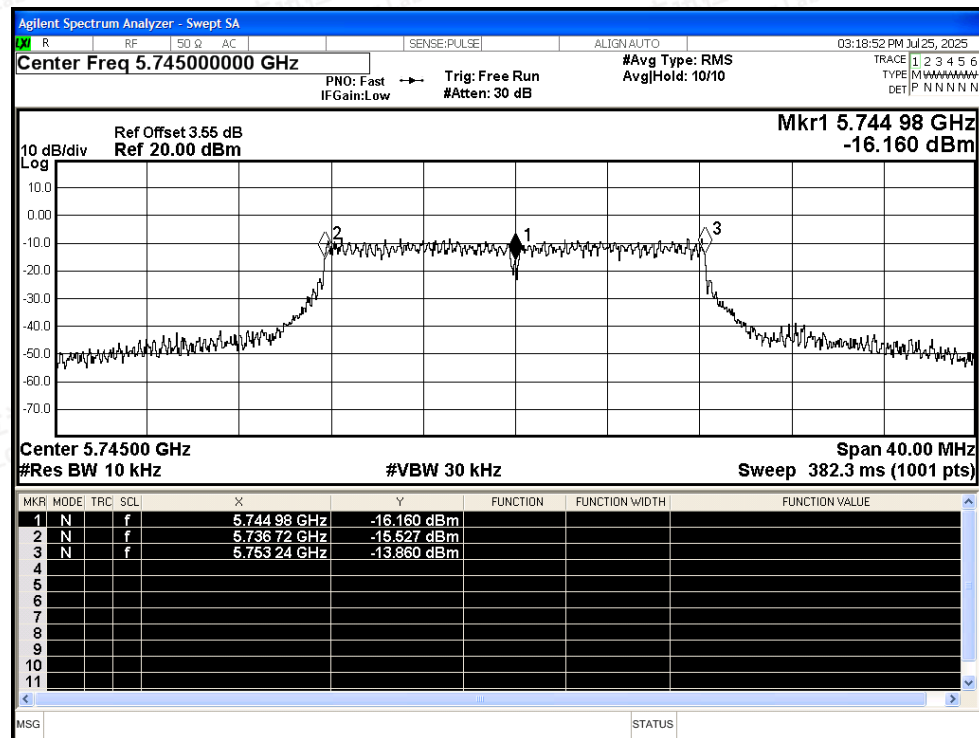

Freq. Stability NVNT a 5785MHz Ant2

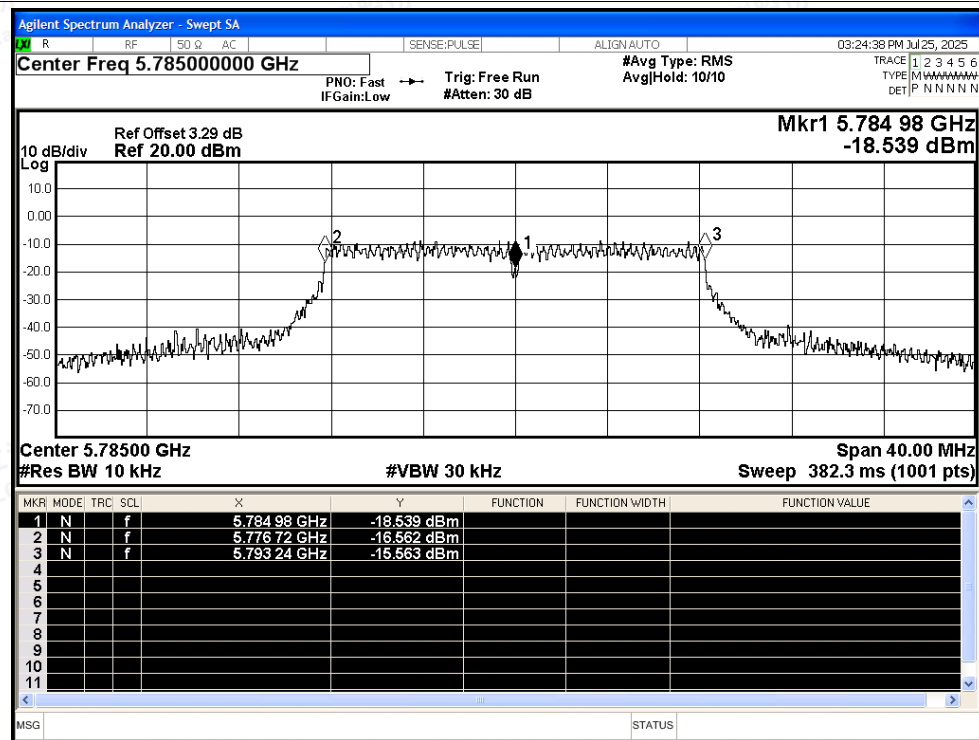

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant2

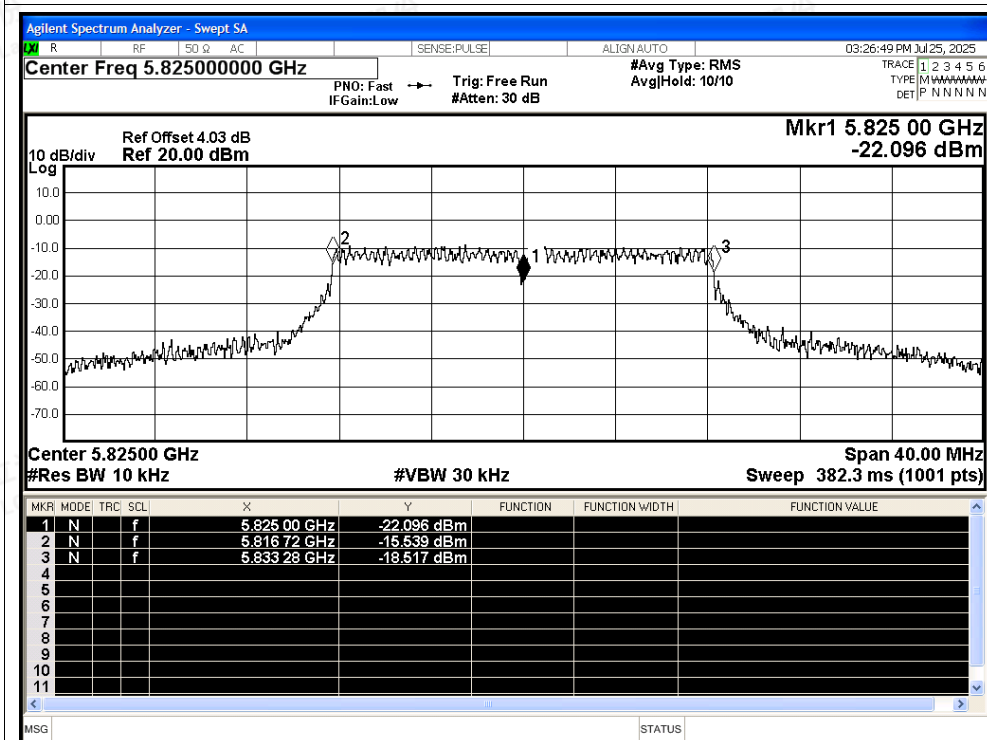

Freq. Stability NVNT n20 5745MHz Ant2

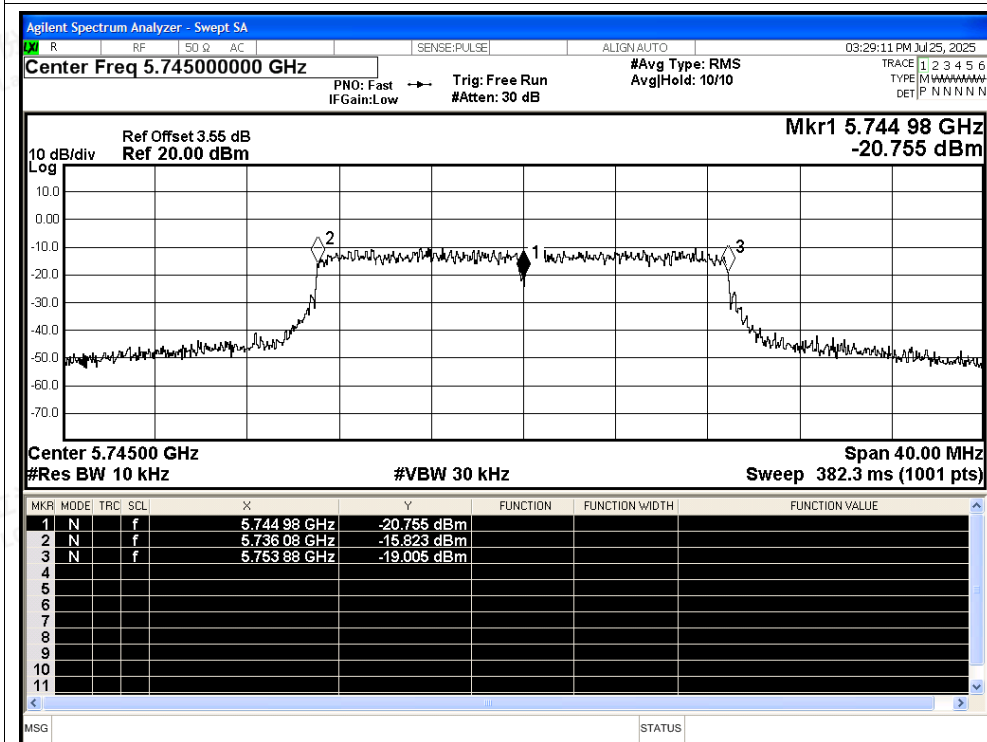

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant2

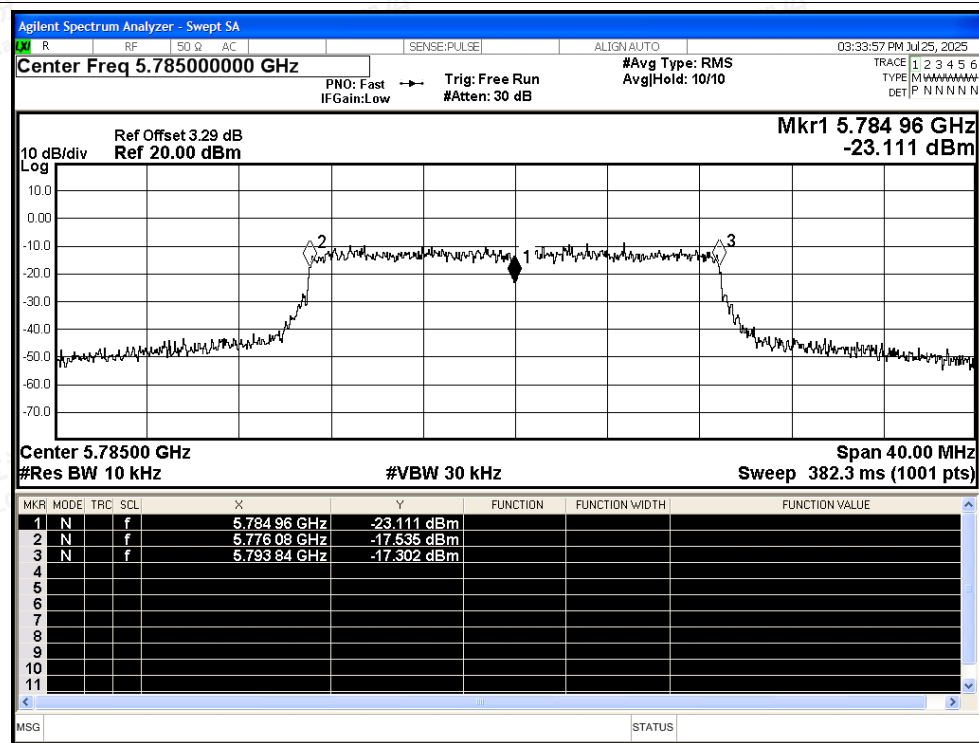

Freq. Stability NVNT n20 5825MHz Ant2

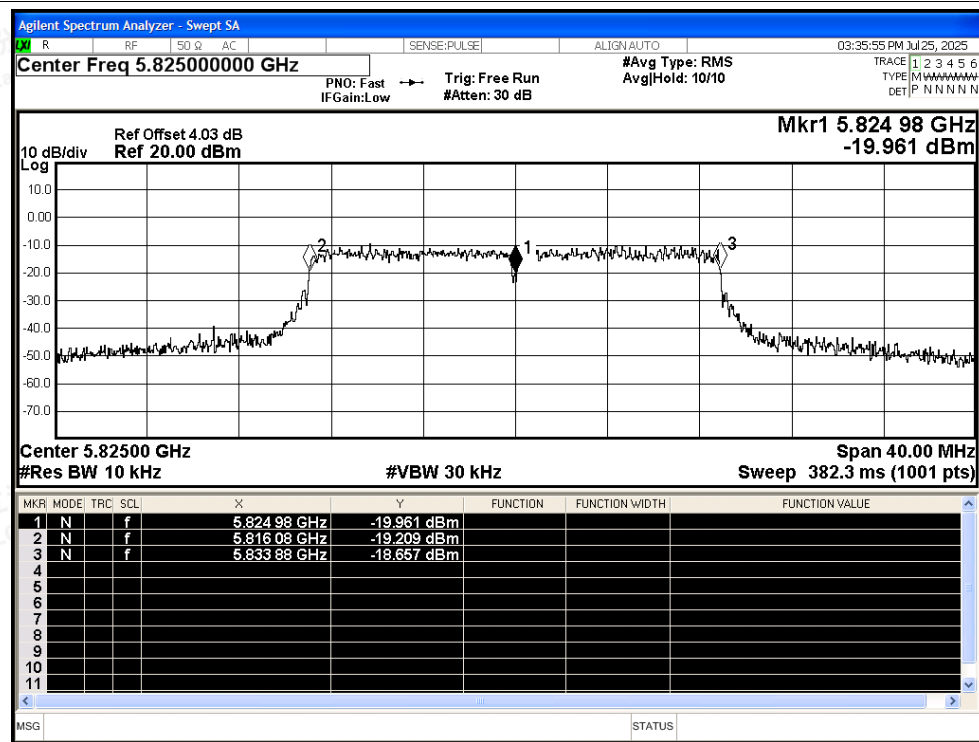

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant2

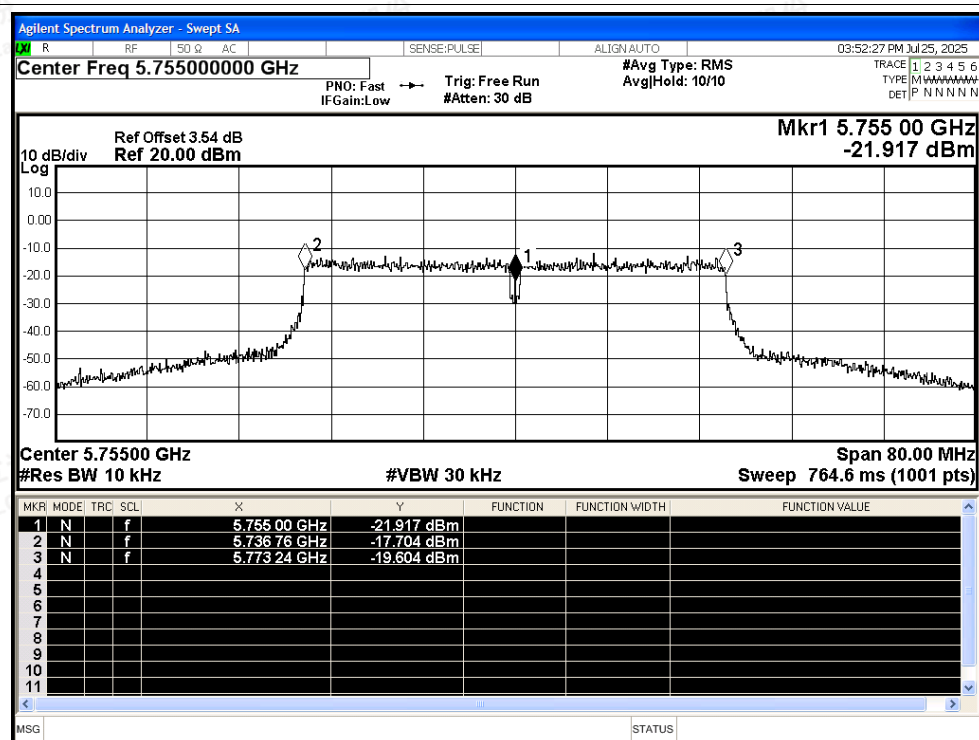

Freq. Stability NVNT n40 5795MHz Ant2

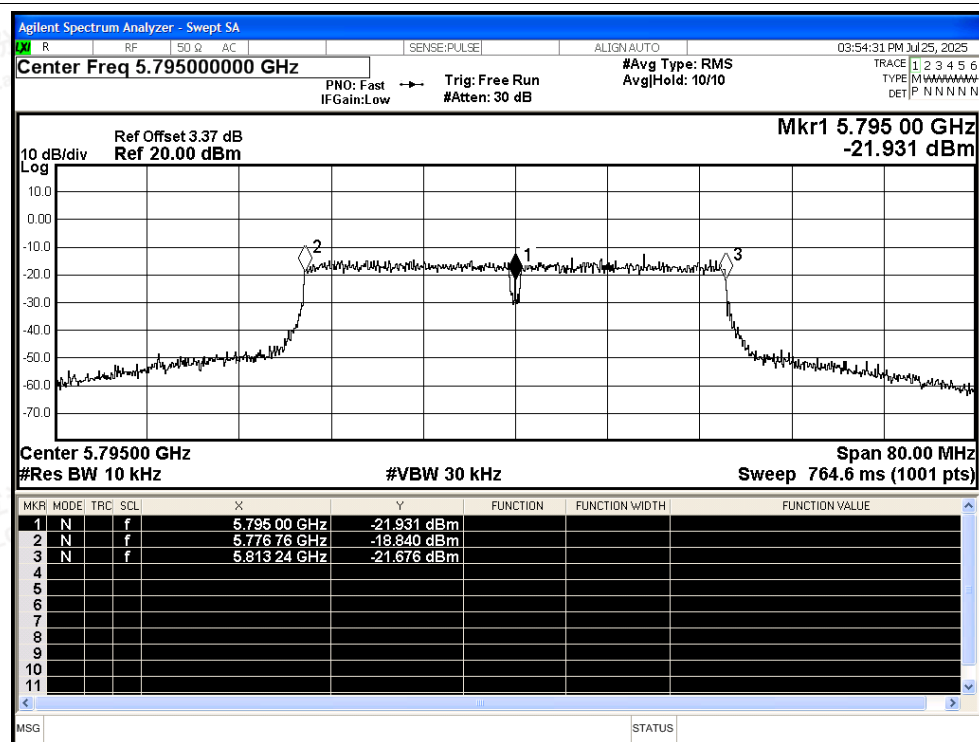

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant2

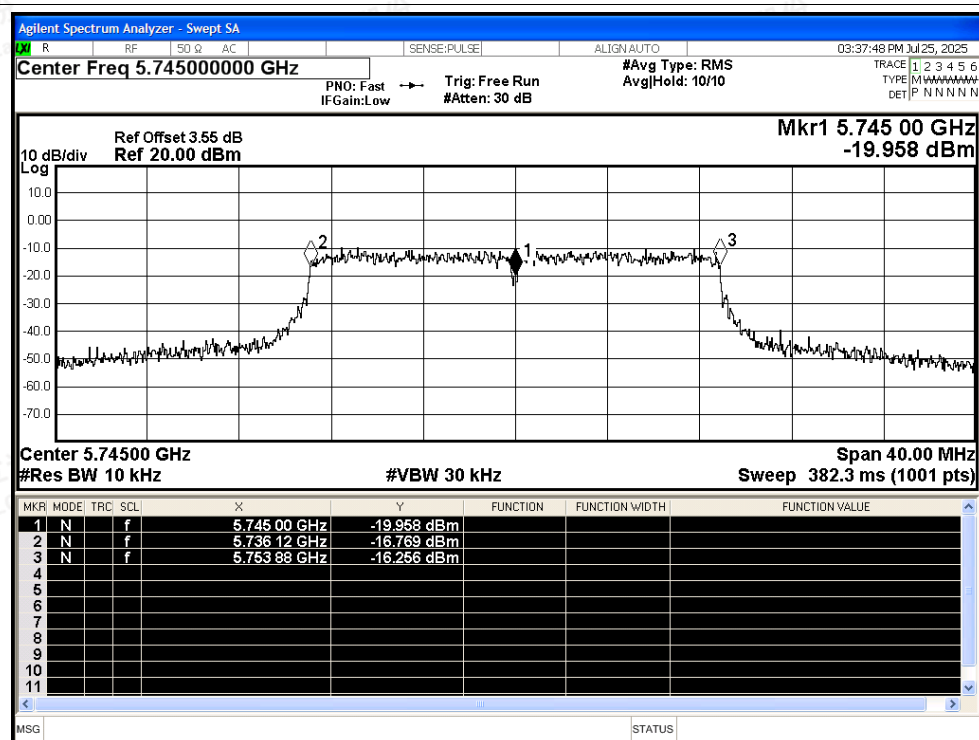

Freq. Stability NVNT ac20 5785MHz Ant2

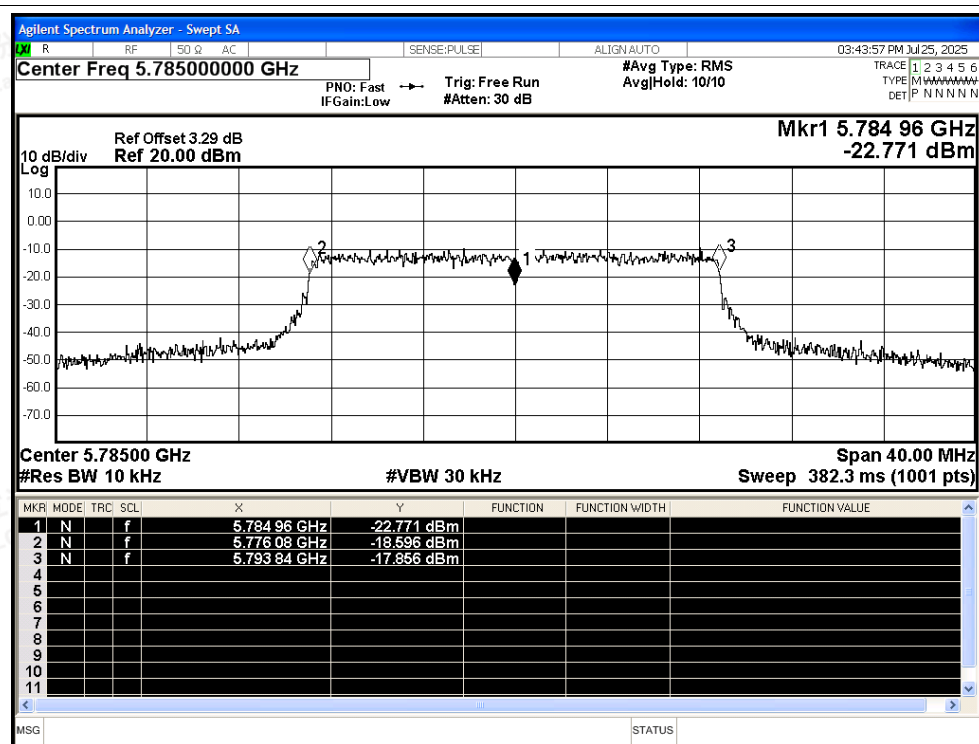

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant2

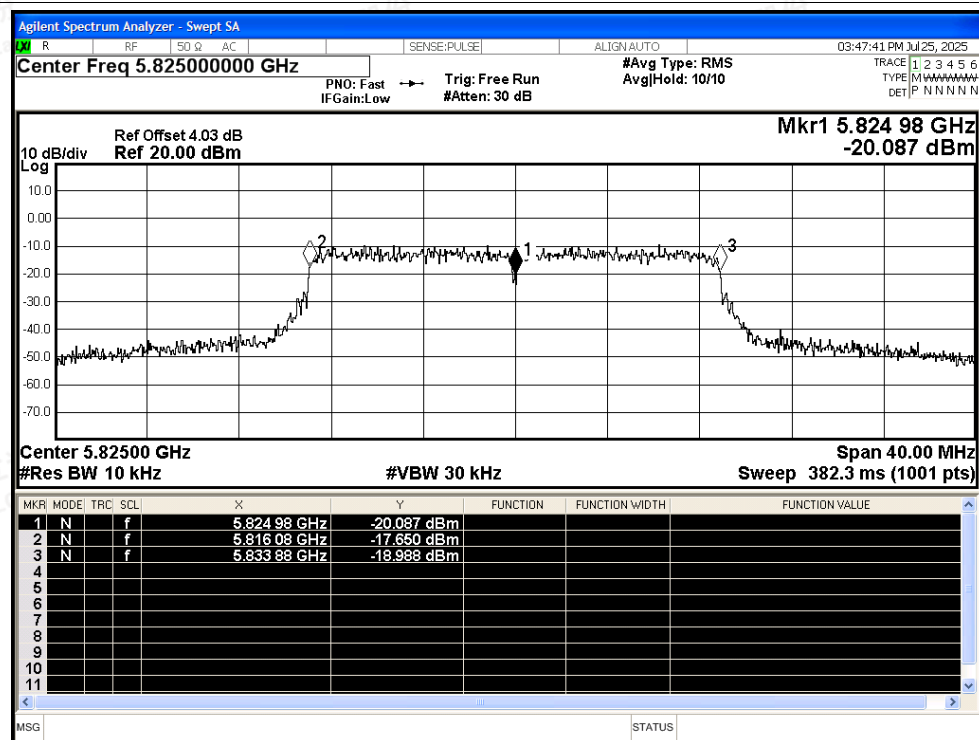

Freq. Stability NVNT ac40 5755MHz Ant2

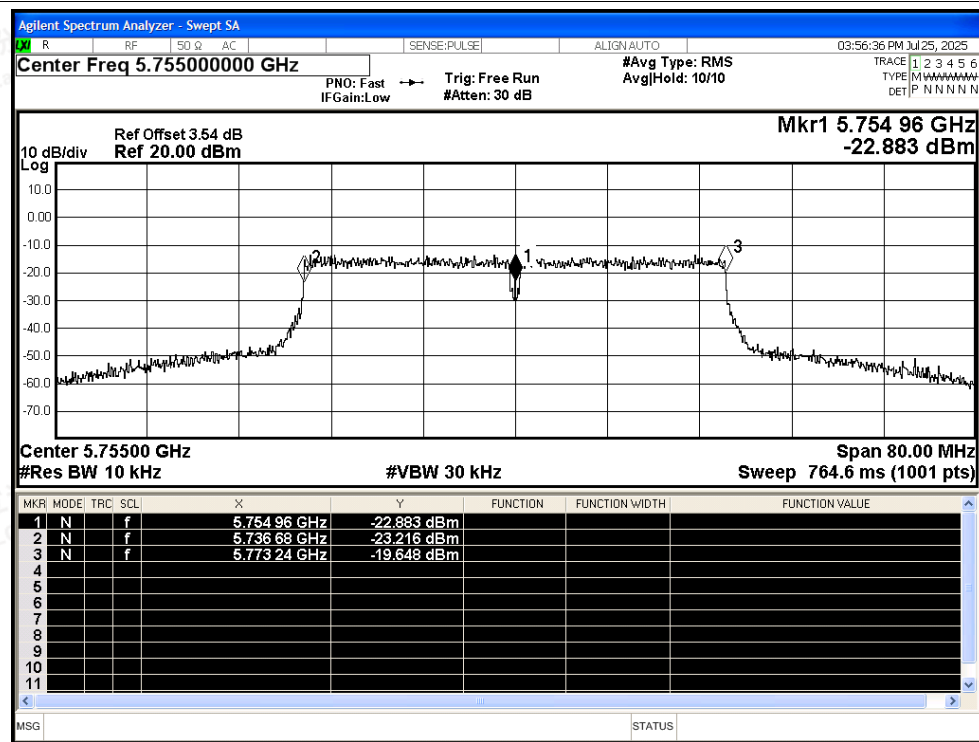

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant2

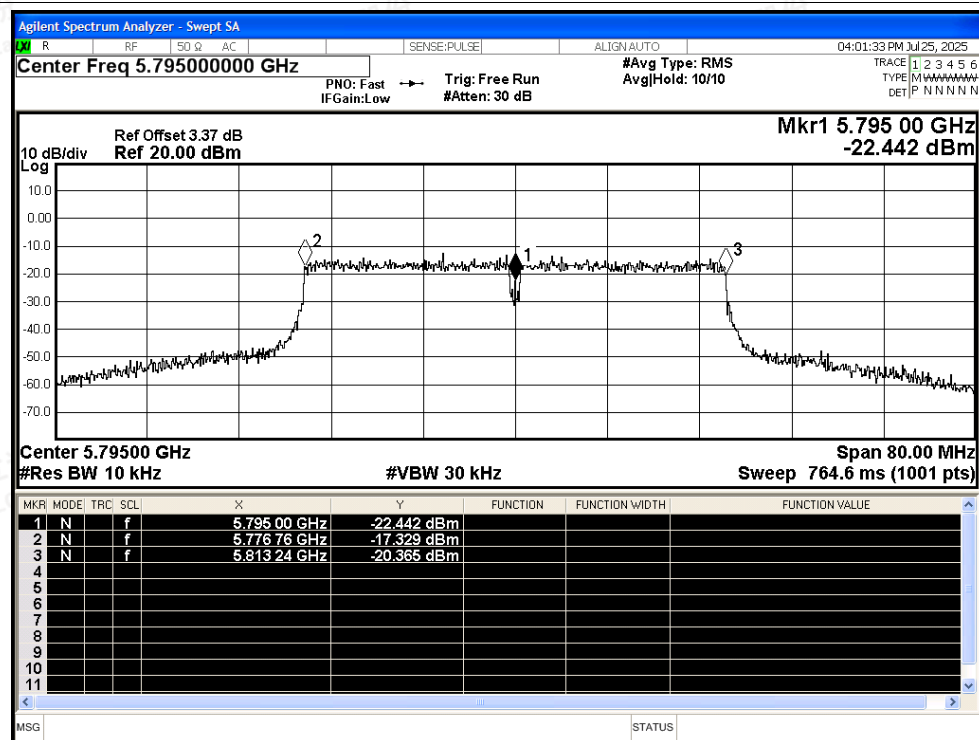

Freq. Stability NVNT ac80 5775MHz Ant2

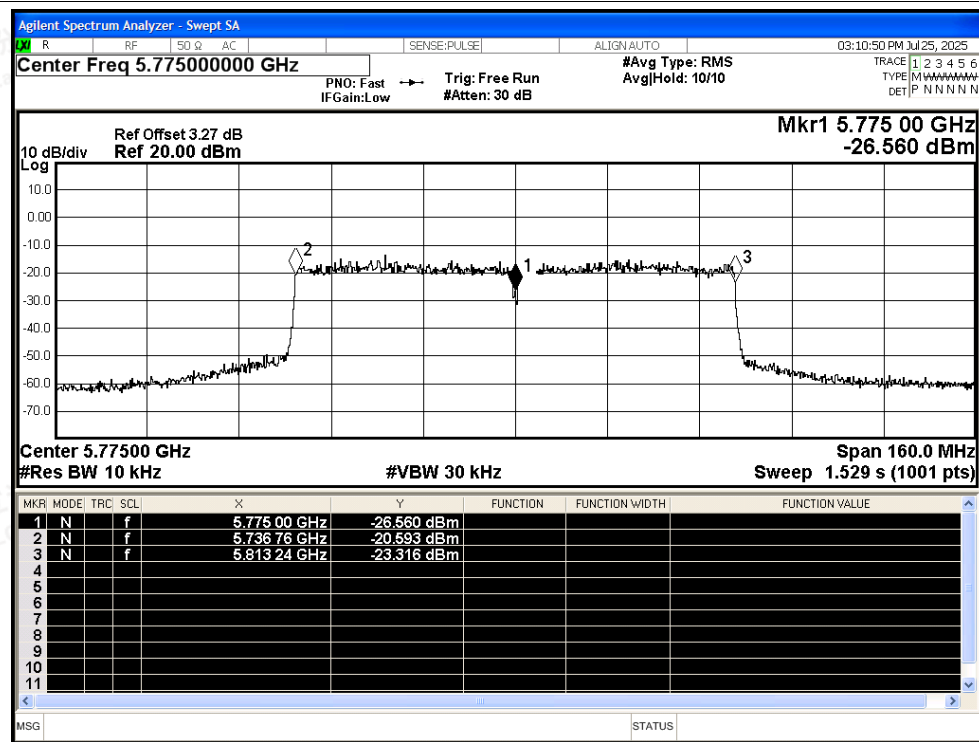

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant2

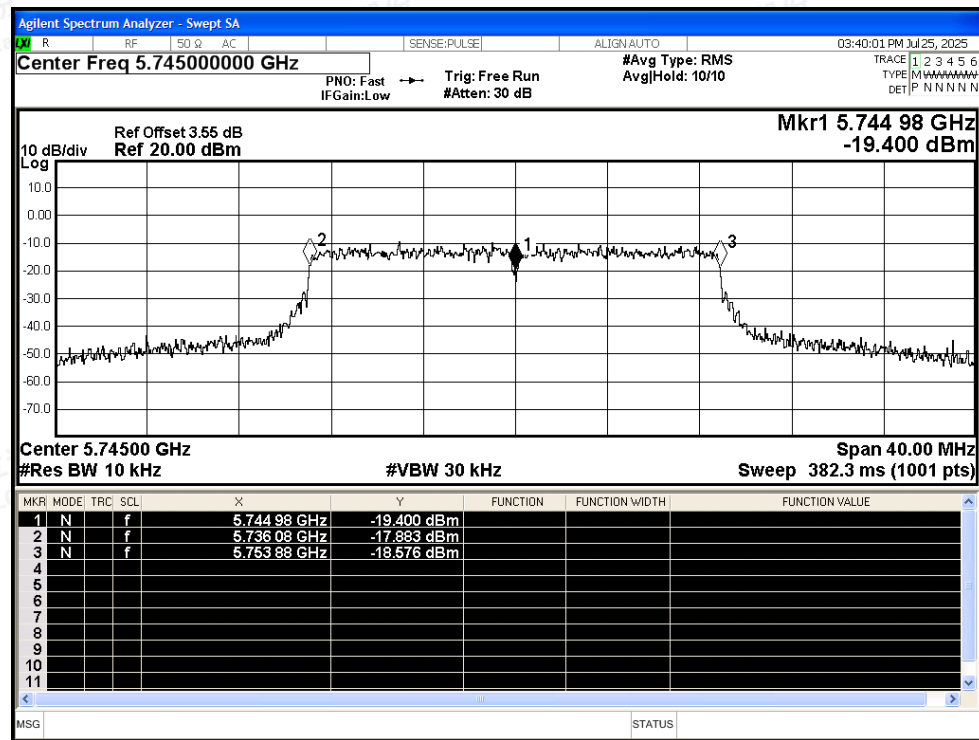

Freq. Stability NVNT ax20 5785MHz Ant2

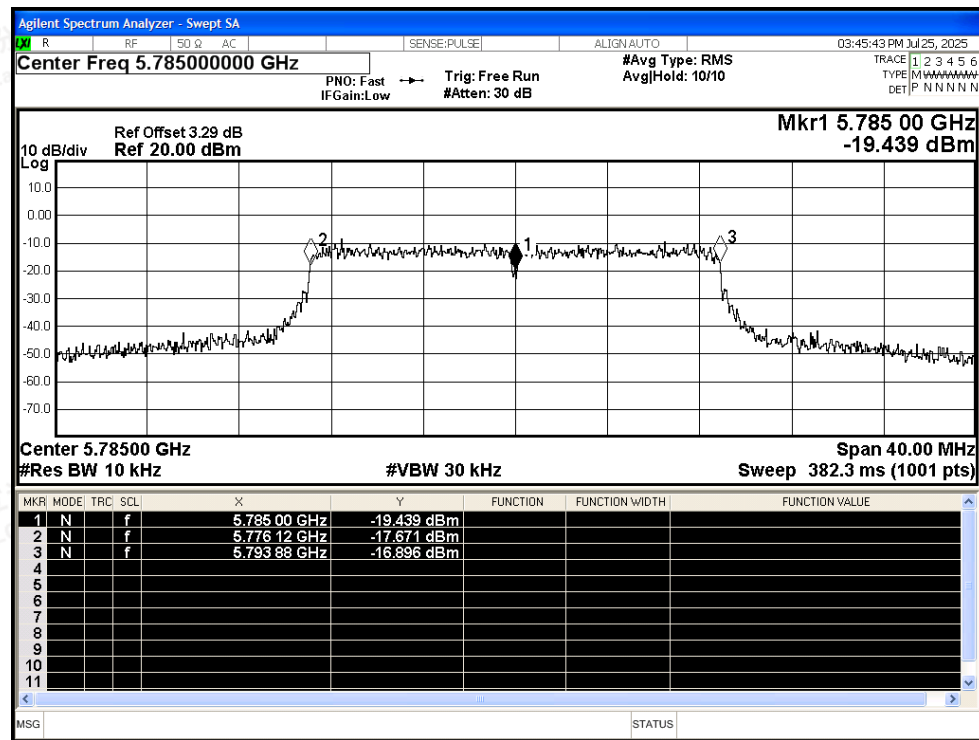

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant2

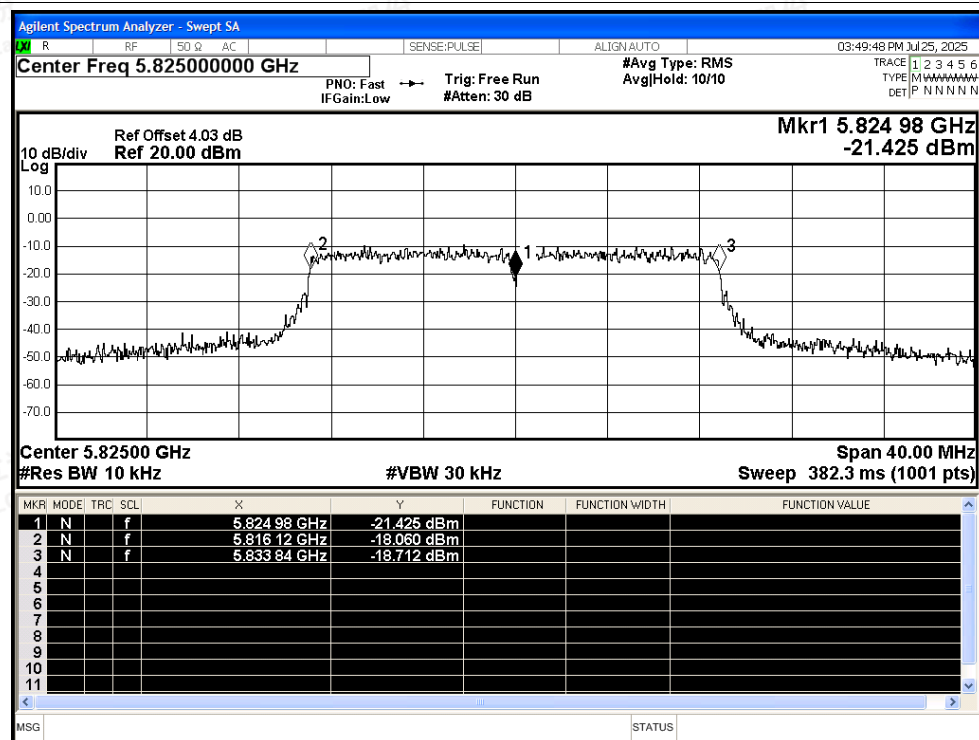

Freq. Stability NVNT ax40 5755MHz Ant2

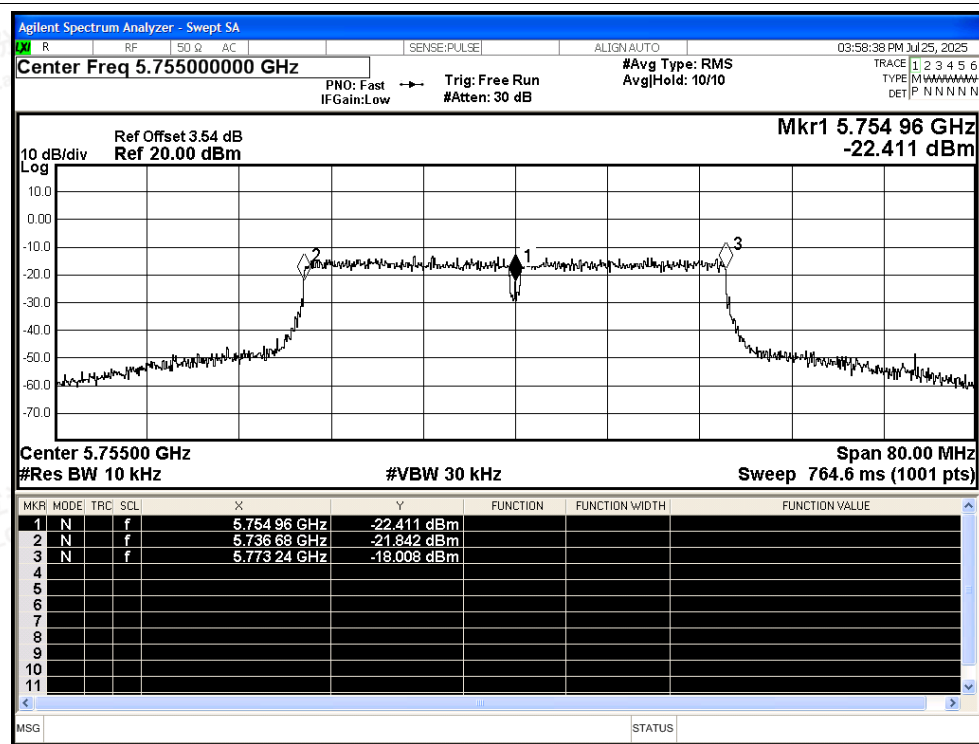

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant2

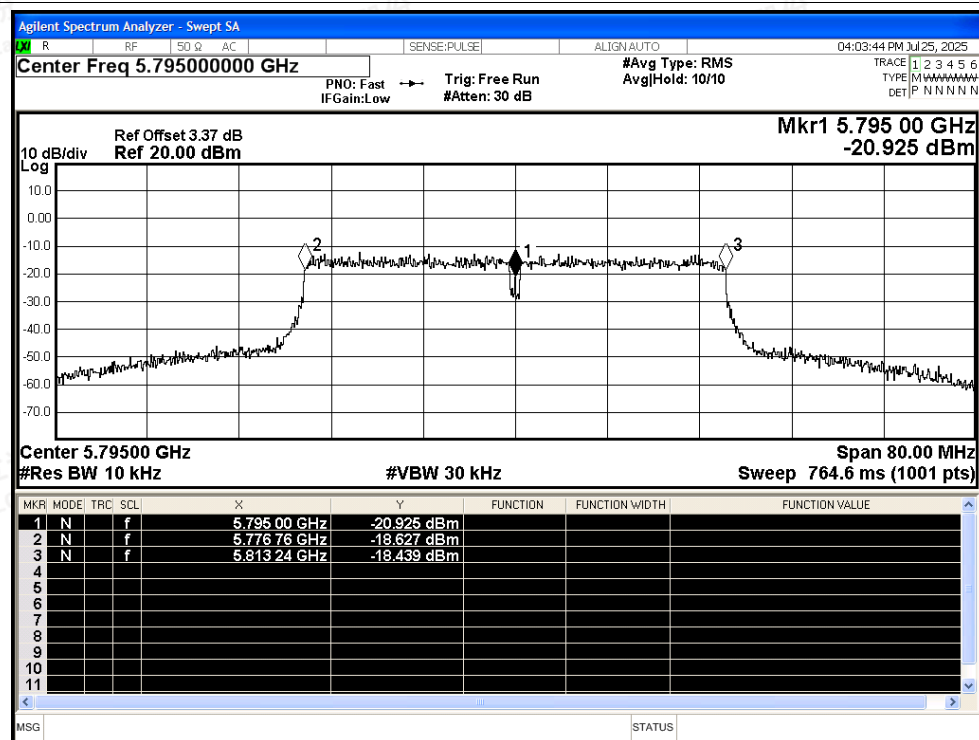

Freq. Stability NVNT ax80 5775MHz Ant2

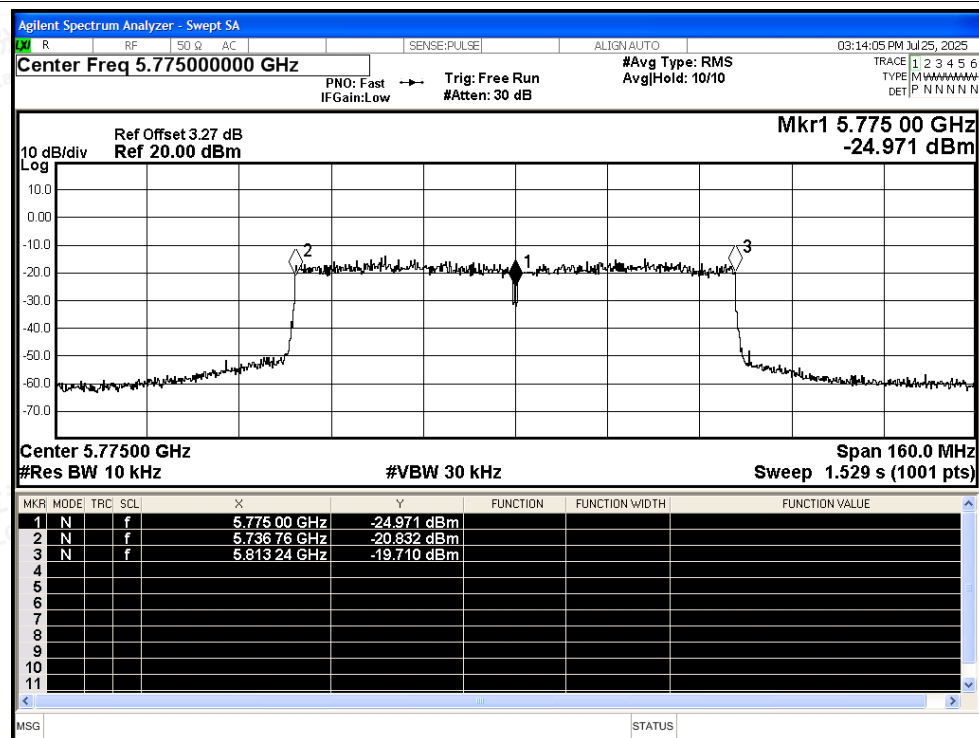

Freq. Stability NVNT be20 5745MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

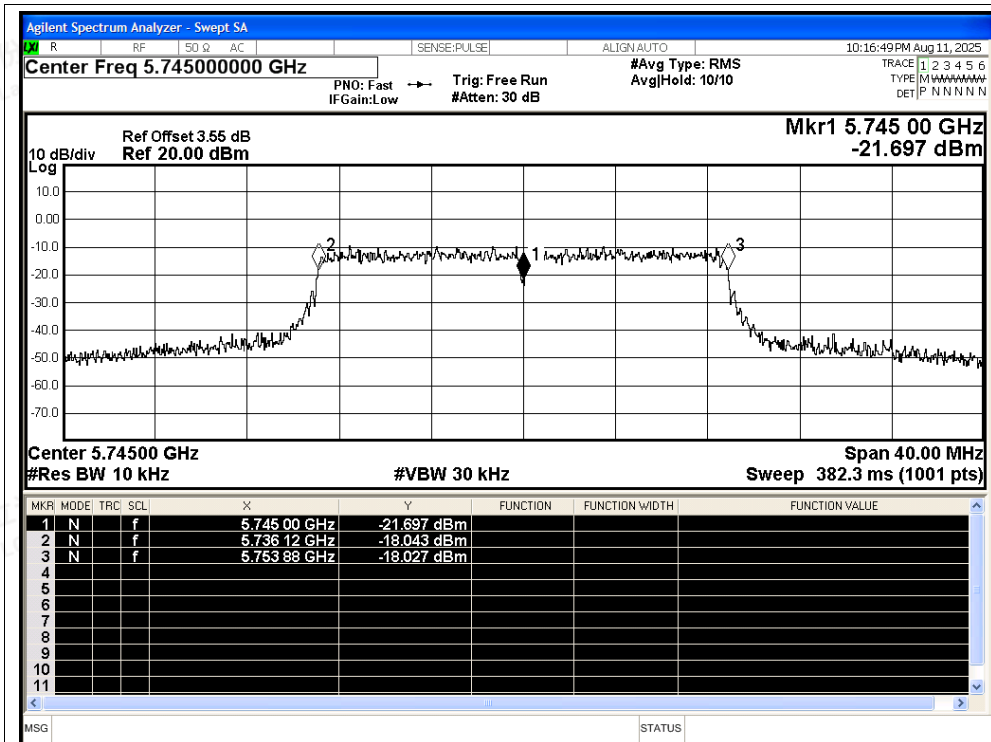

Freq. Stability NVNT be20 5785MHz Ant2

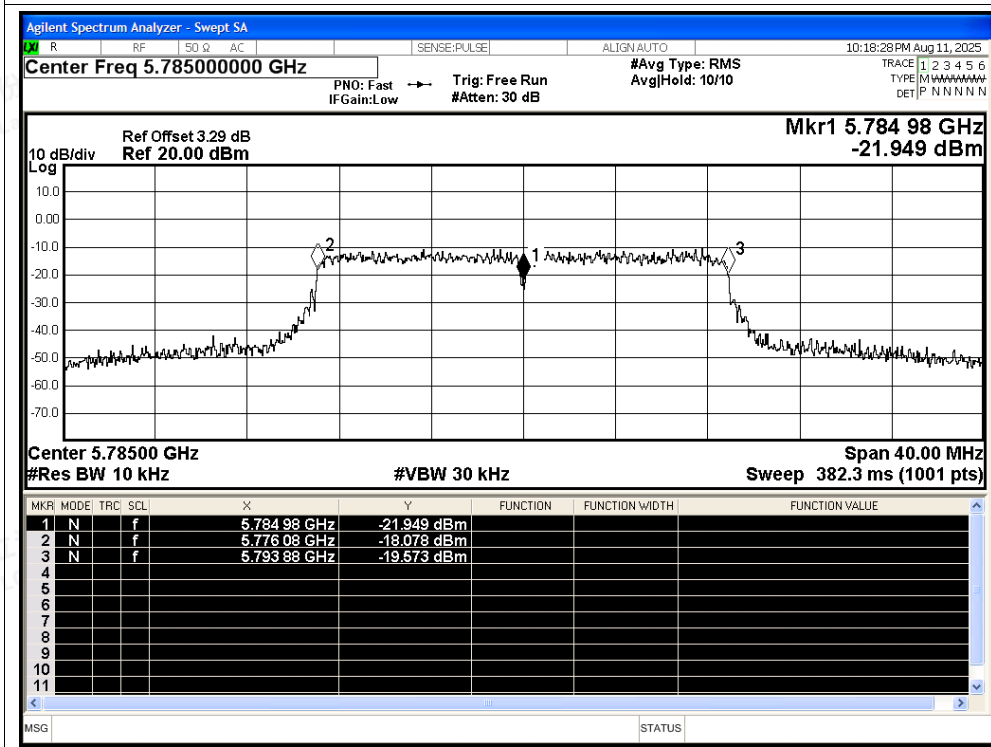

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5825MHz Ant2

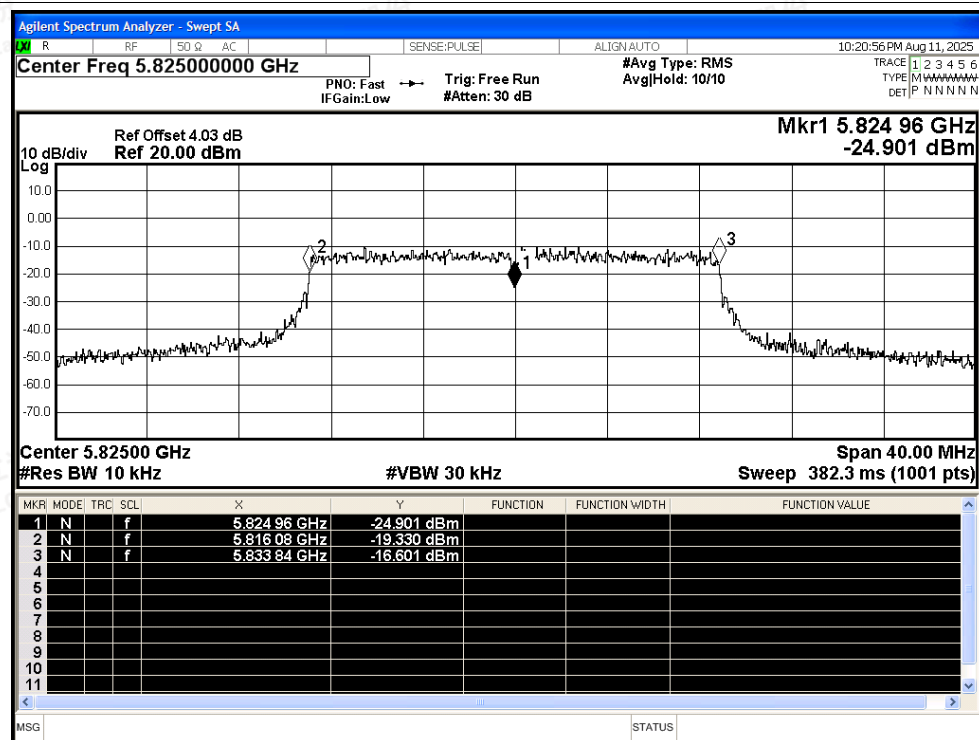

Freq. Stability NVNT be40 5755MHz Ant2

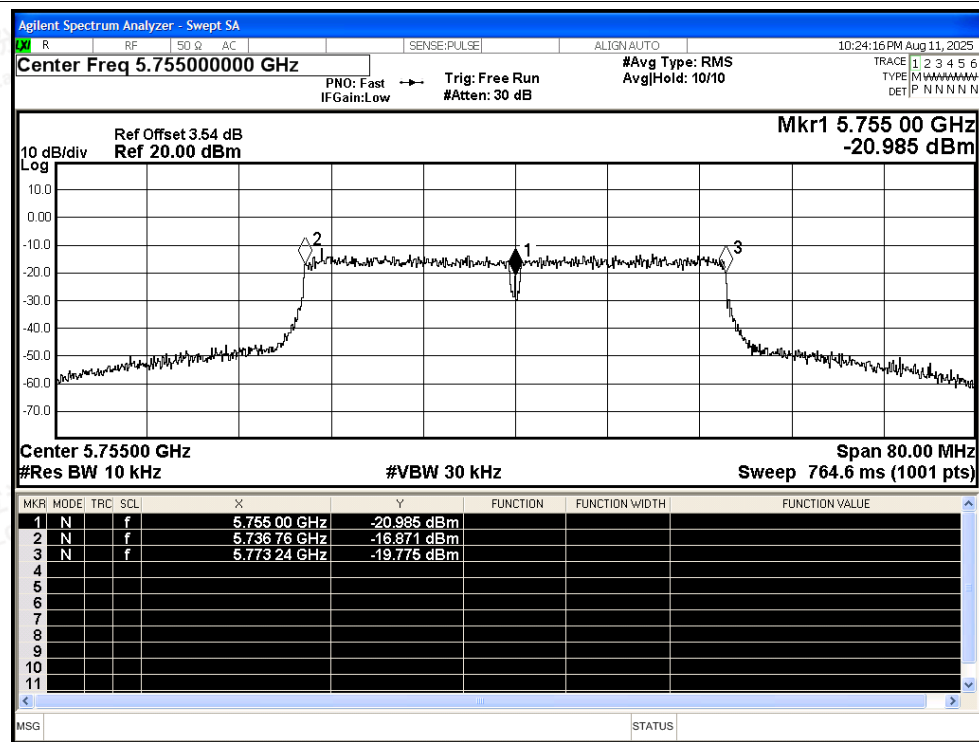

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity