



PROTOTYPE ANTENNA PERFORMANCE REPORT

ELC Lightning

June 25 2024

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia

+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**

+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**

+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

1. Table of Contents

2.	Performance of Prototype antenna	3
2.1.	Customer Device Measurement	8
2.1.1.	Measurement Setup	8
2.2.	Antenna 1	9
2.2.1.	Return Loss	9
2.2.2.	VSWR	9
2.2.3.	OTA Performance	10
2.2.4.	Radiation Pattern	12
2.3.	Antenna 2	13
2.3.1.	Return Loss	13
2.3.2.	VSWR	13
2.3.3.	OTA Performance	14
2.3.4.	Radiation Pattern	16
2.4.	Conclusion	17

2. Performance of Prototype antenna

Prototype antenna for DECT bands (1880-1930 MHz) for mounting inside customer device was developed. Casing of the device is from plastic material. Display in top casing is connected to PCB using ribbon cable (not seen in pictures). Three slide-in holders on each side are made to hold the antennas. Antennas were placed in said holders and were connected to PCB using 9.5 cm long MC137 cable with UFL connector. To obtain the best results cable routing is critical. Cable for Antenna 1 should be routed over top PCB and cable for Antenna 2 should be routed away from ribbon cable (as seen in pictures below).



Top view of the device



Side view of the device

2J Antennas, s.r.o


Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

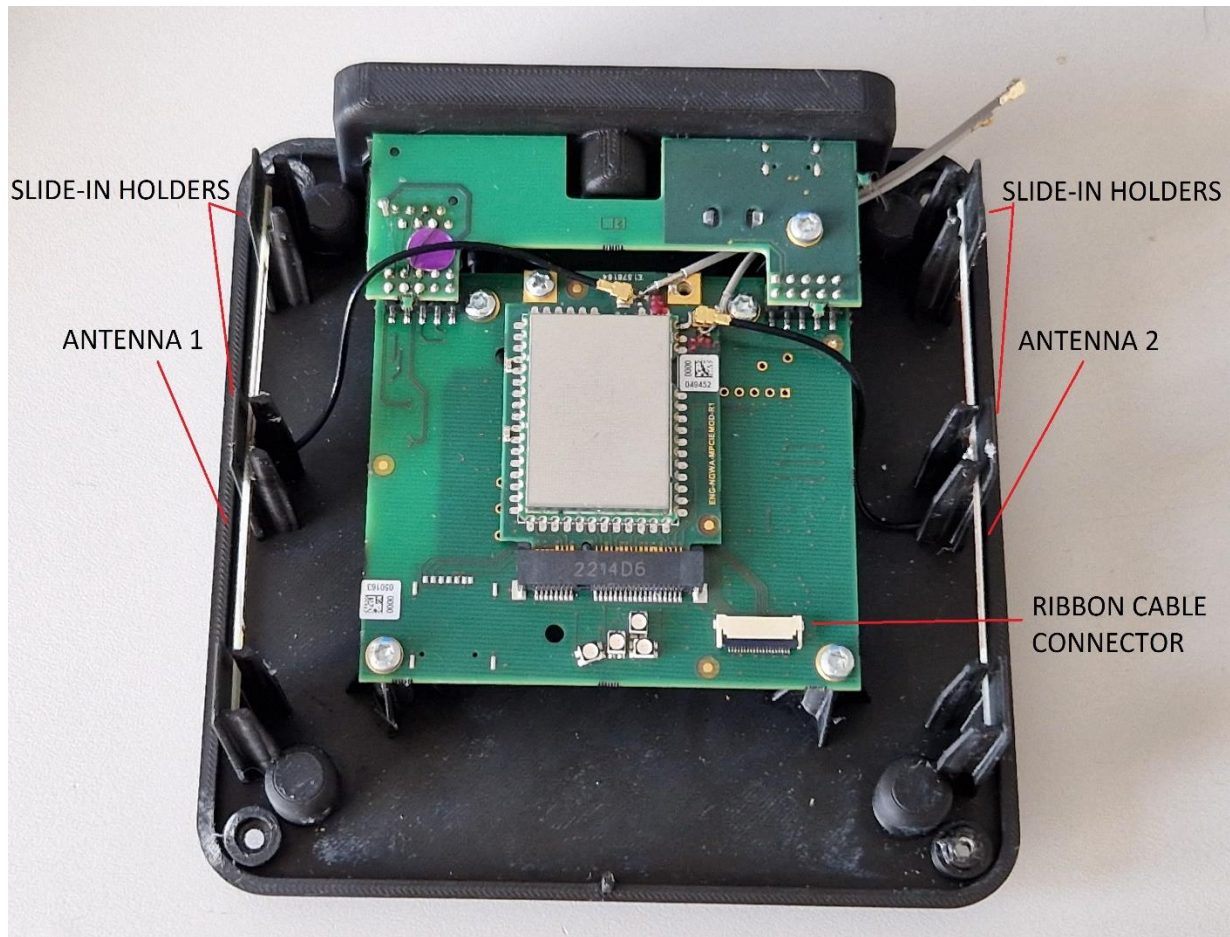

Inside view of the device with antenna placement (top casing with ribbon cable removed)

2J Antennas, s.r.o


Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd


Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp


5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

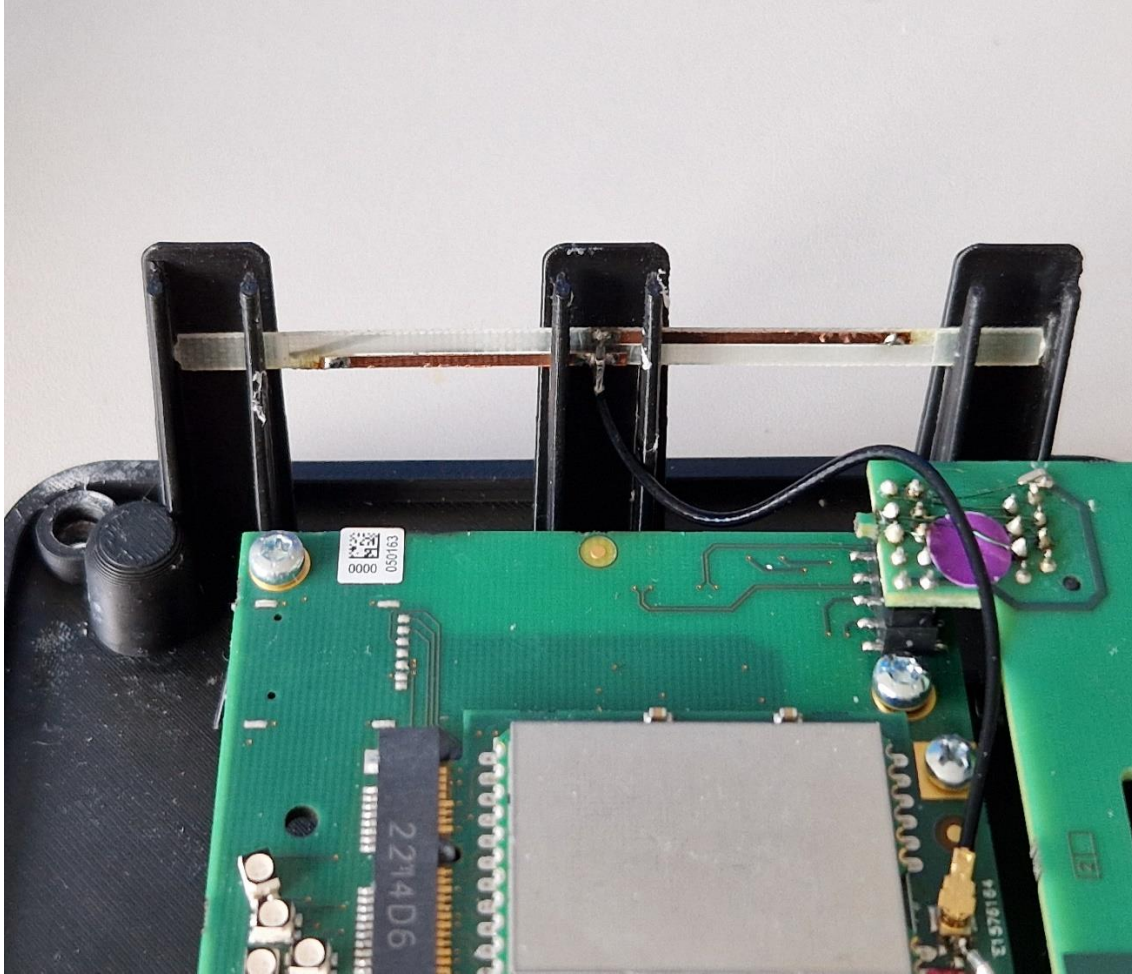

Detail view of antenna 1 and cable routing

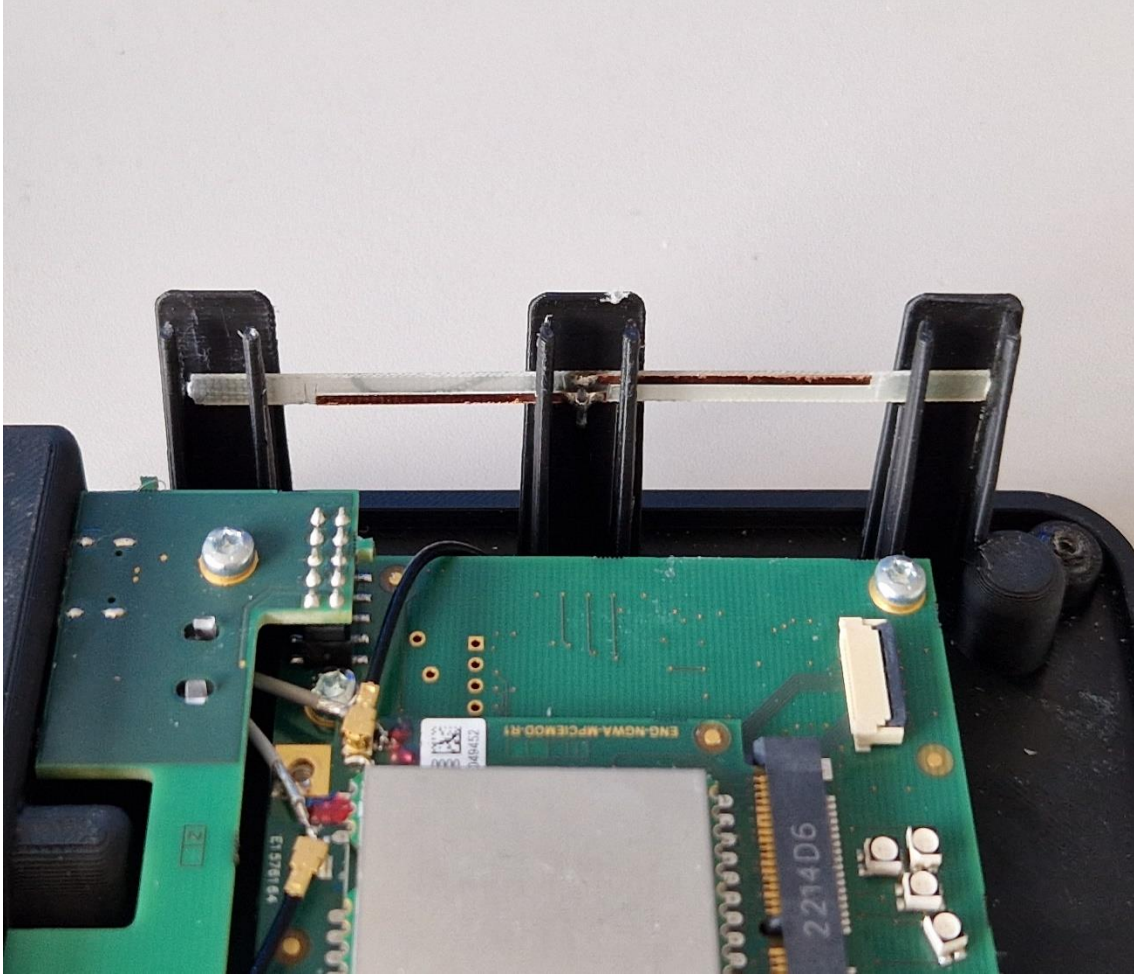

Detail view of antenna 2 and cable routing

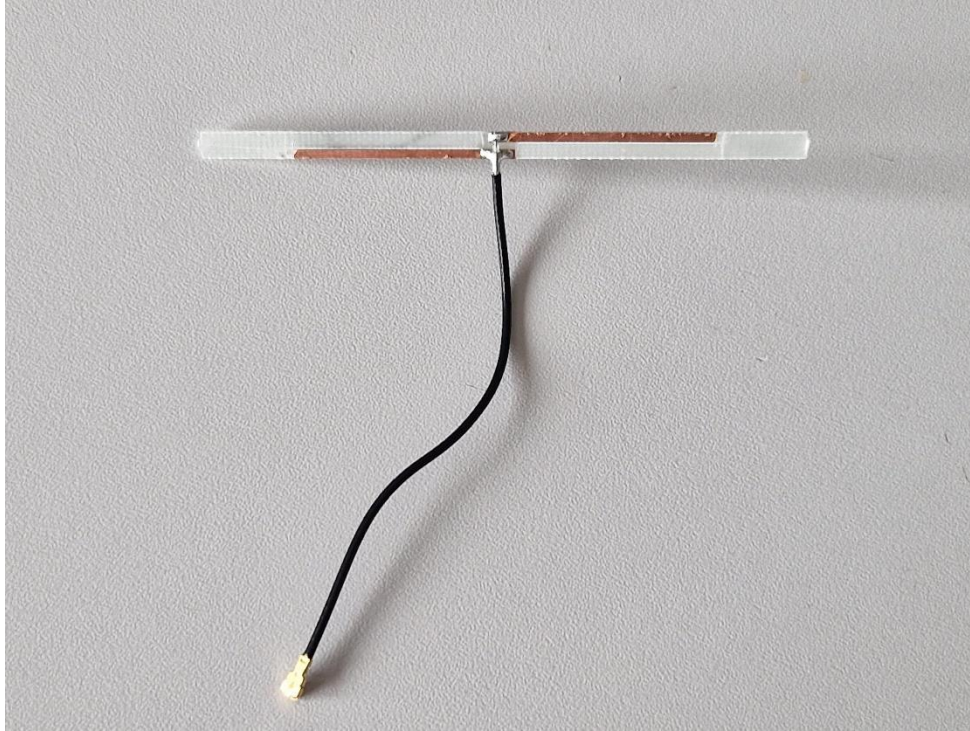


Detail view of used prototype antenna

2.1. Customer Device Measurement

2.1.1. Measurement Setup

The antenna was measured inside of Certified CTIA 3D Anechoic Chamber.

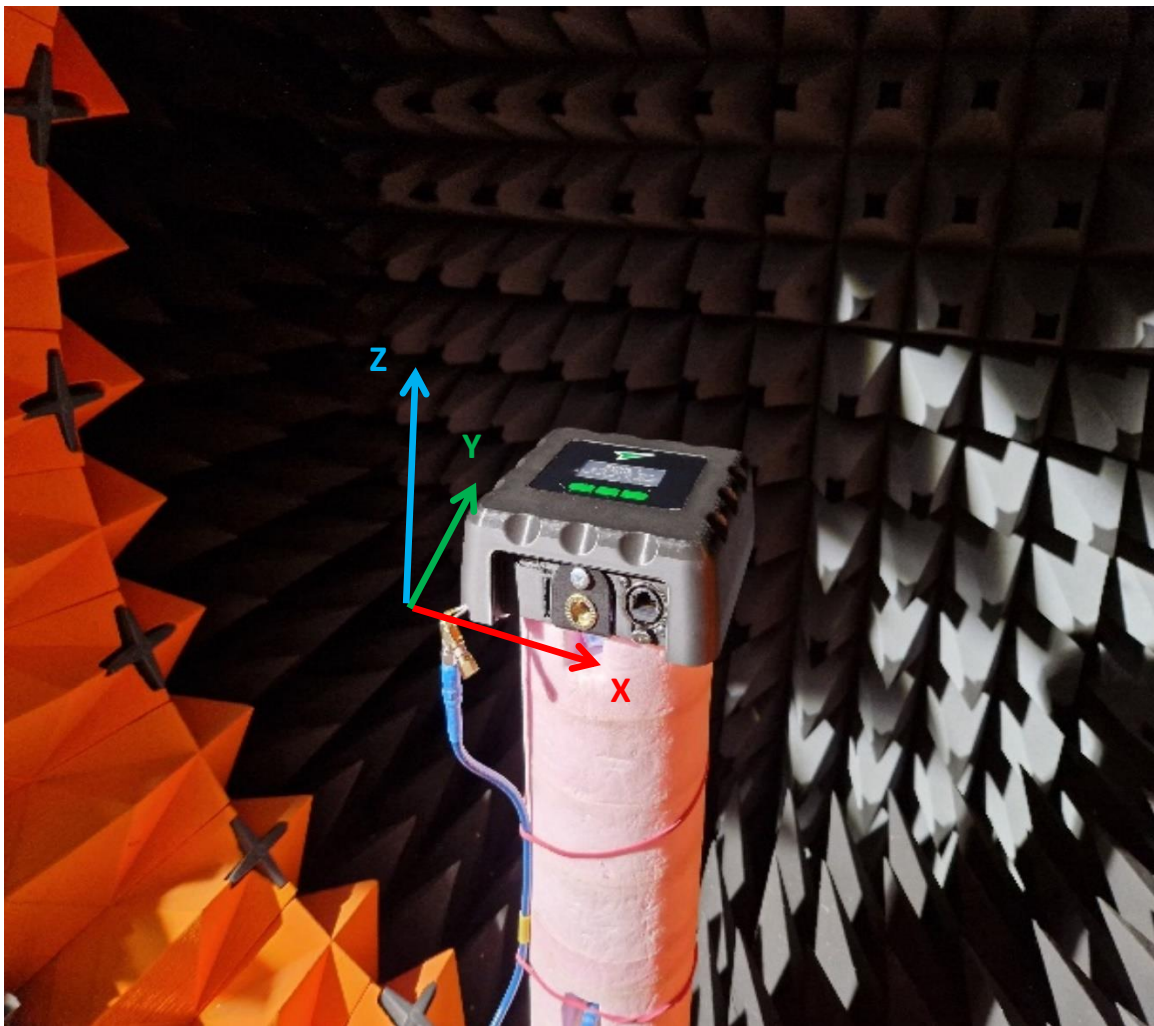

Measurement Setup

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd


Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp


5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.2. Antenna 1

2.2.1. Return Loss

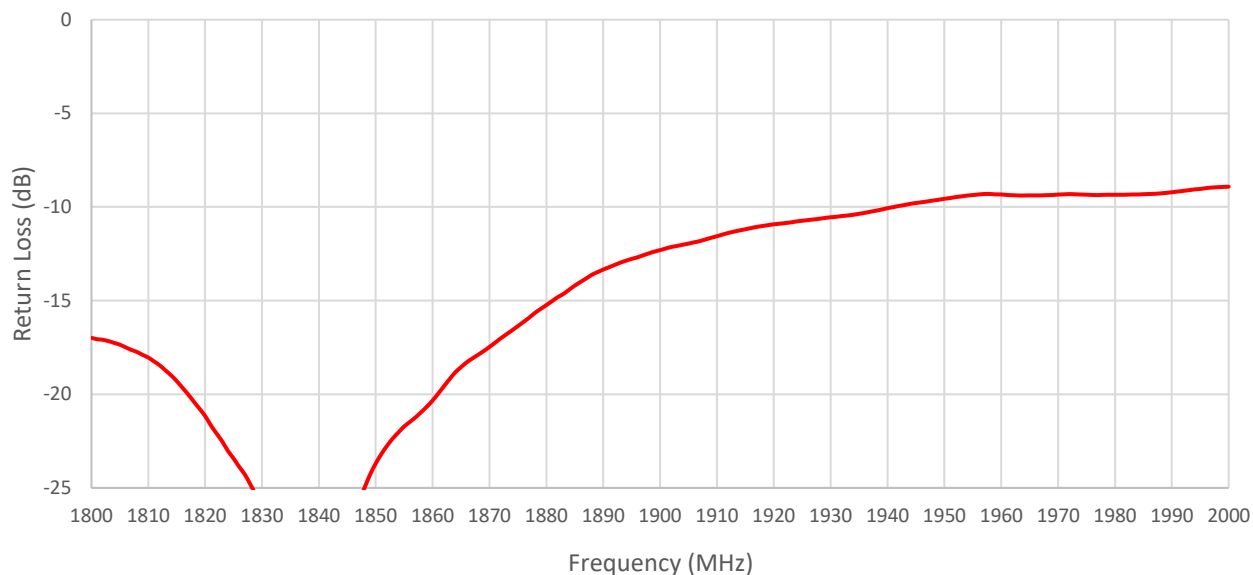

2.2.2. VSWR

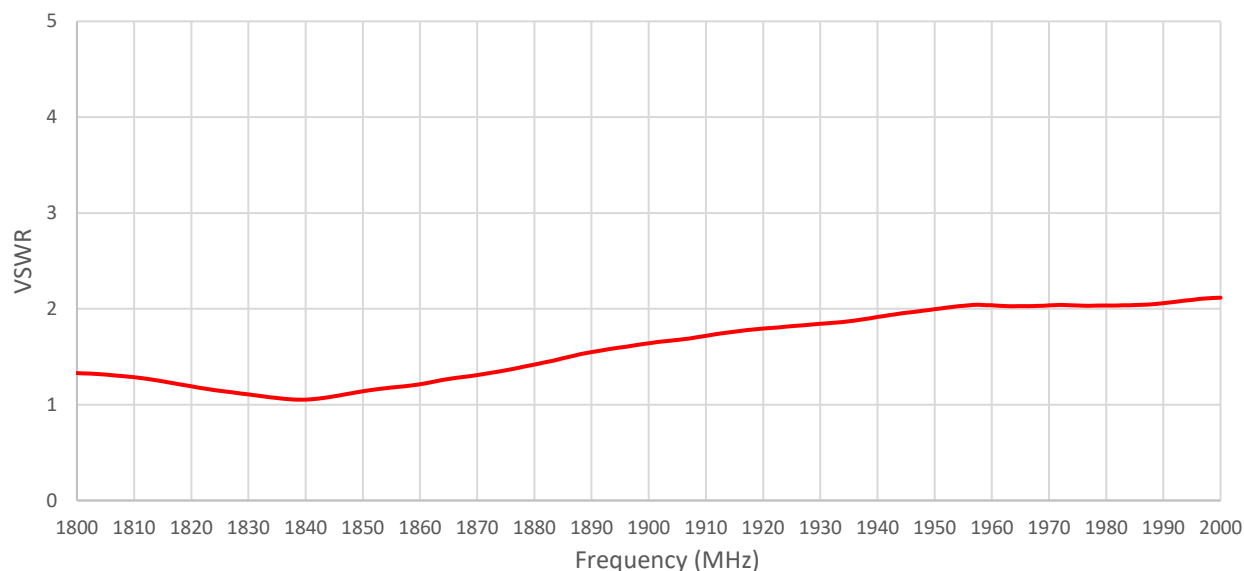

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com



2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, United Kingdom
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.2.3. OTA Performance

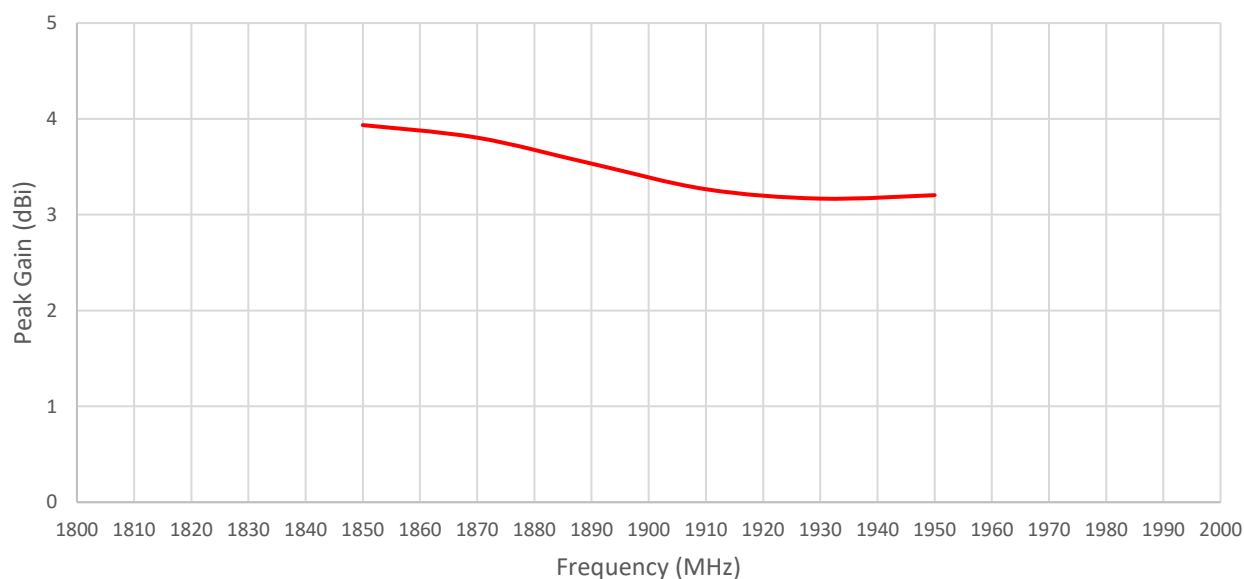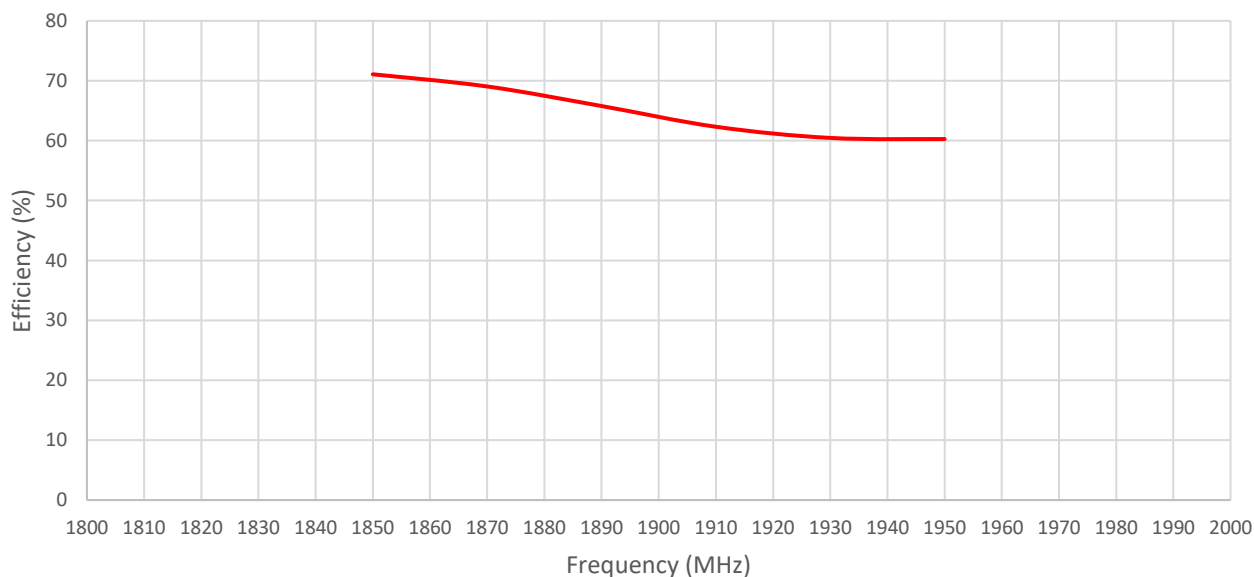

2J Antennas, s.r.o


Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

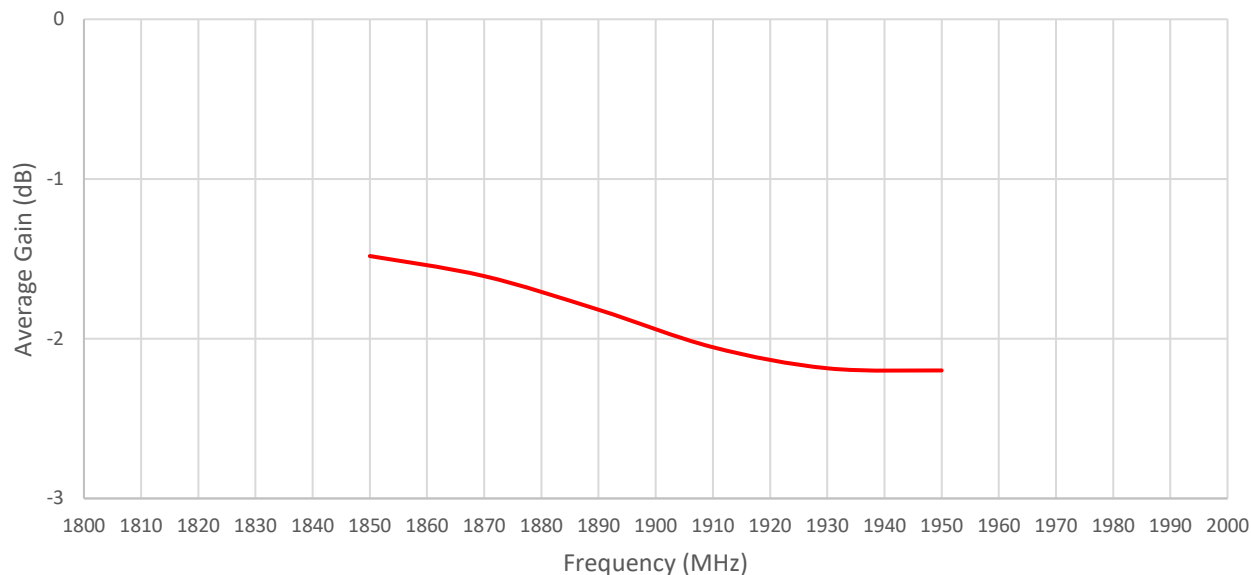

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com


2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.2.4. Radiation Pattern

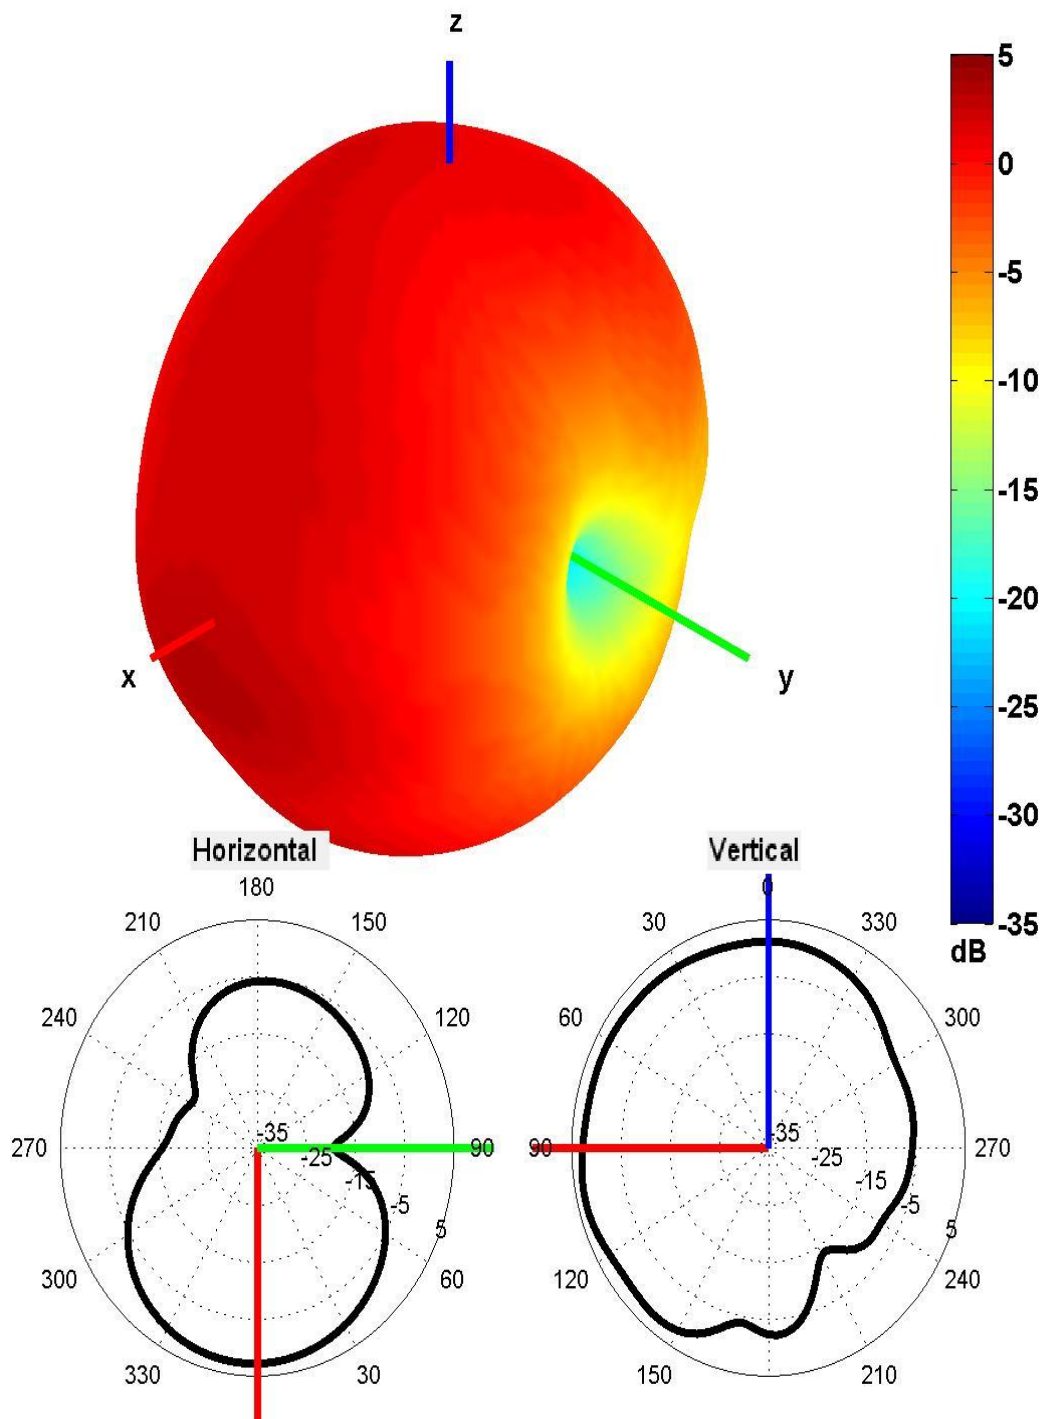

Radiation Pattern at 1900MHz

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd


Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, United Kingdom
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp


5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, USA
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.3. Antenna 2

2.3.1. Return Loss

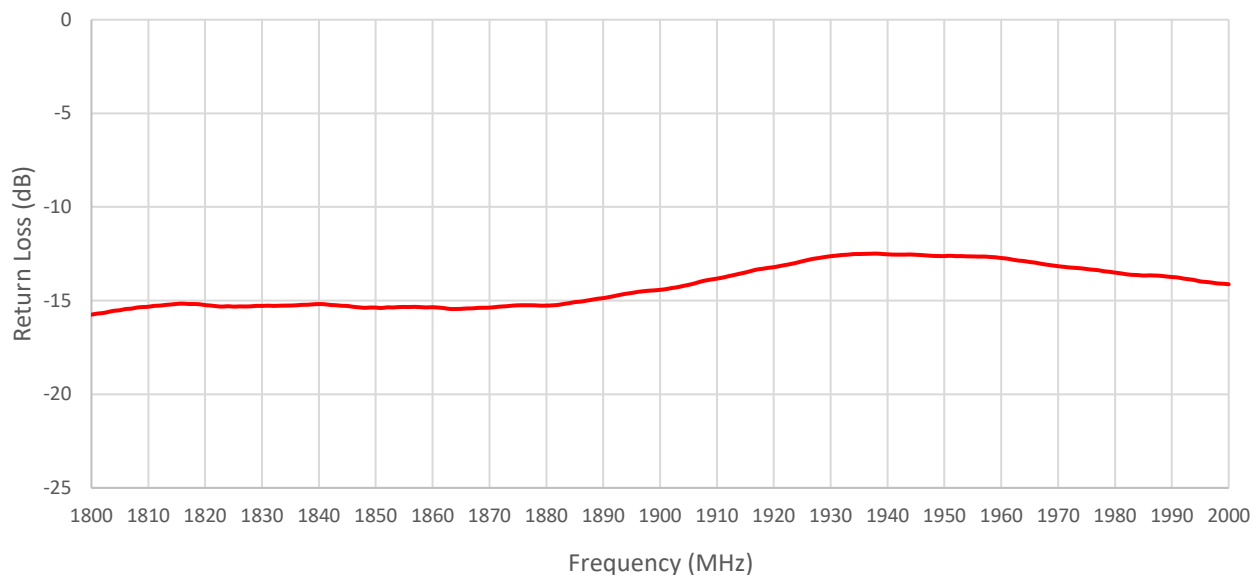

2.3.2. VSWR

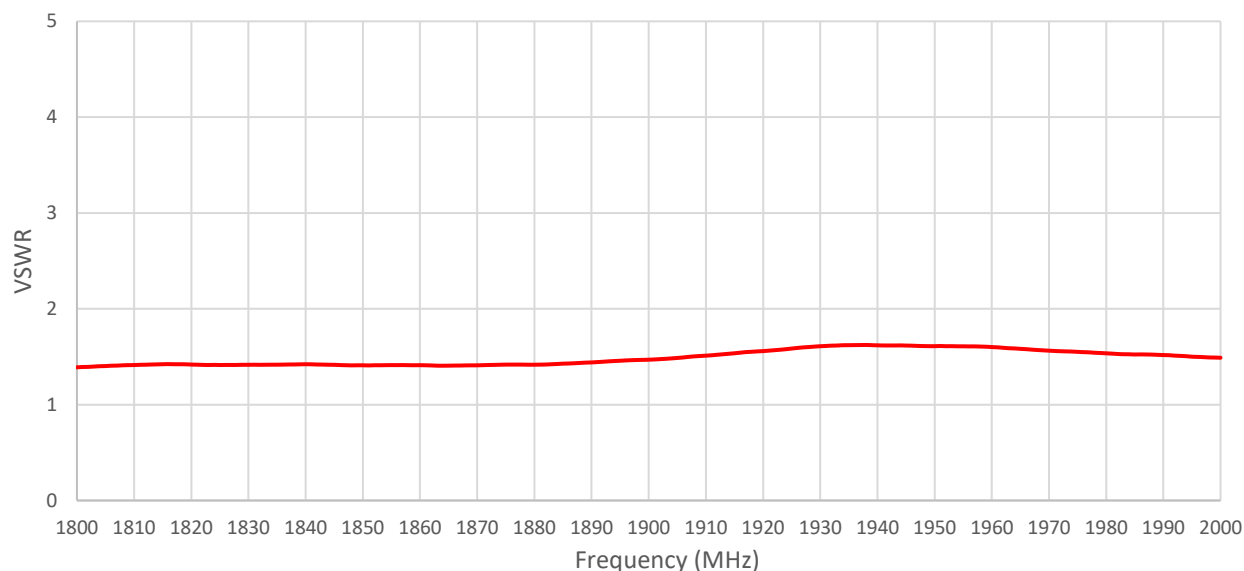

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com



2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.3.3. OTA Performance

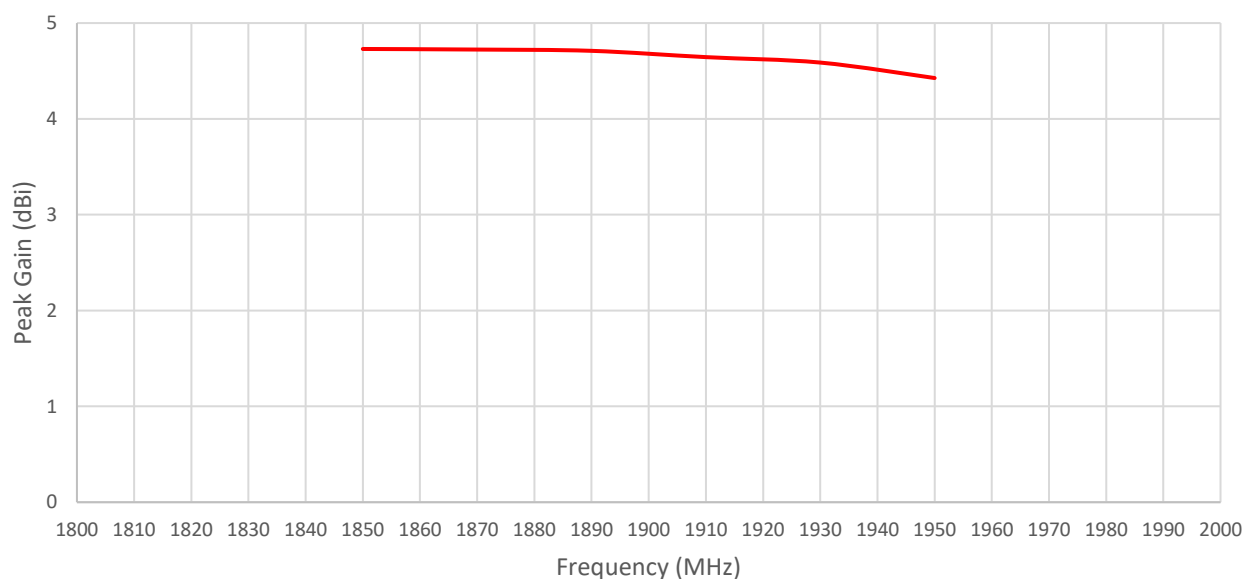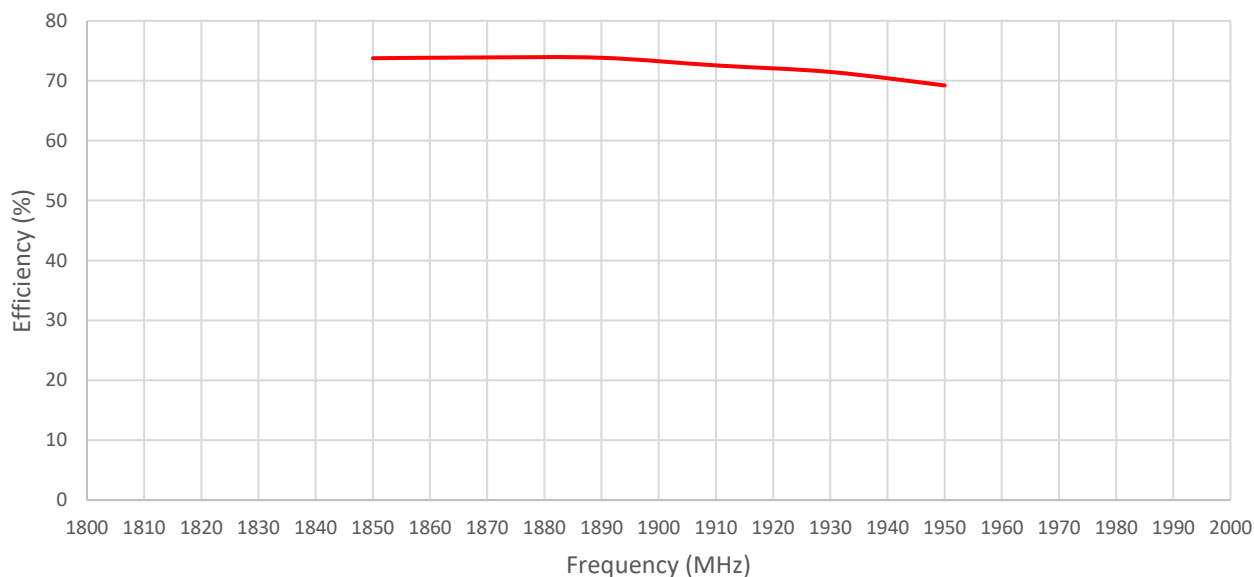

2J Antennas, s.r.o


Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

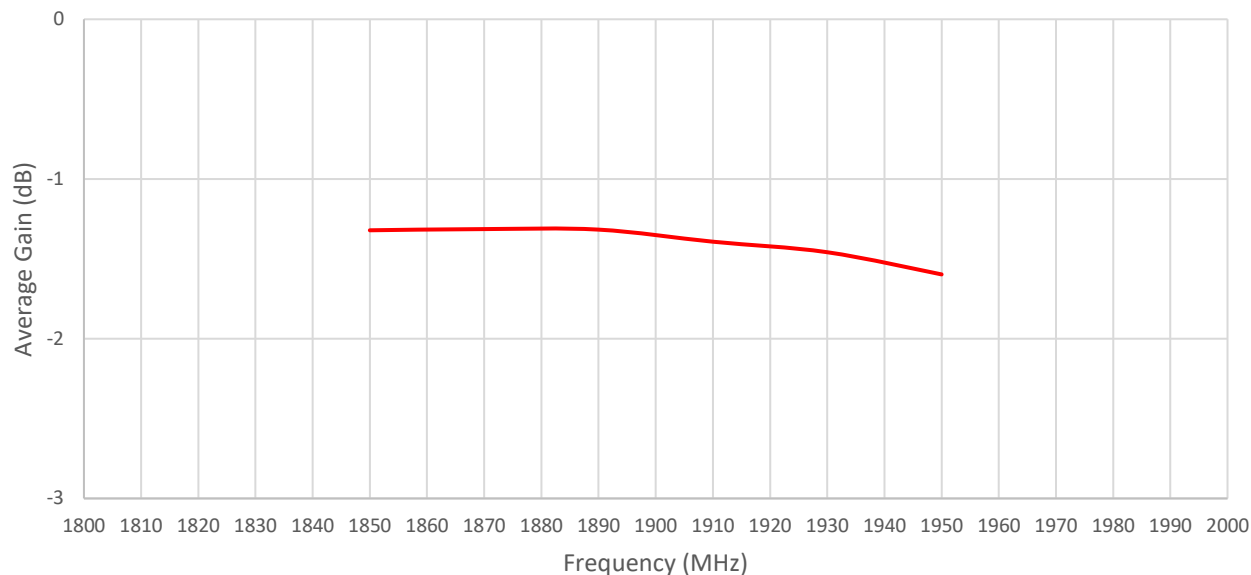**2J Antennas, s.r.o**

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com


2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.3.4. Radiation Pattern

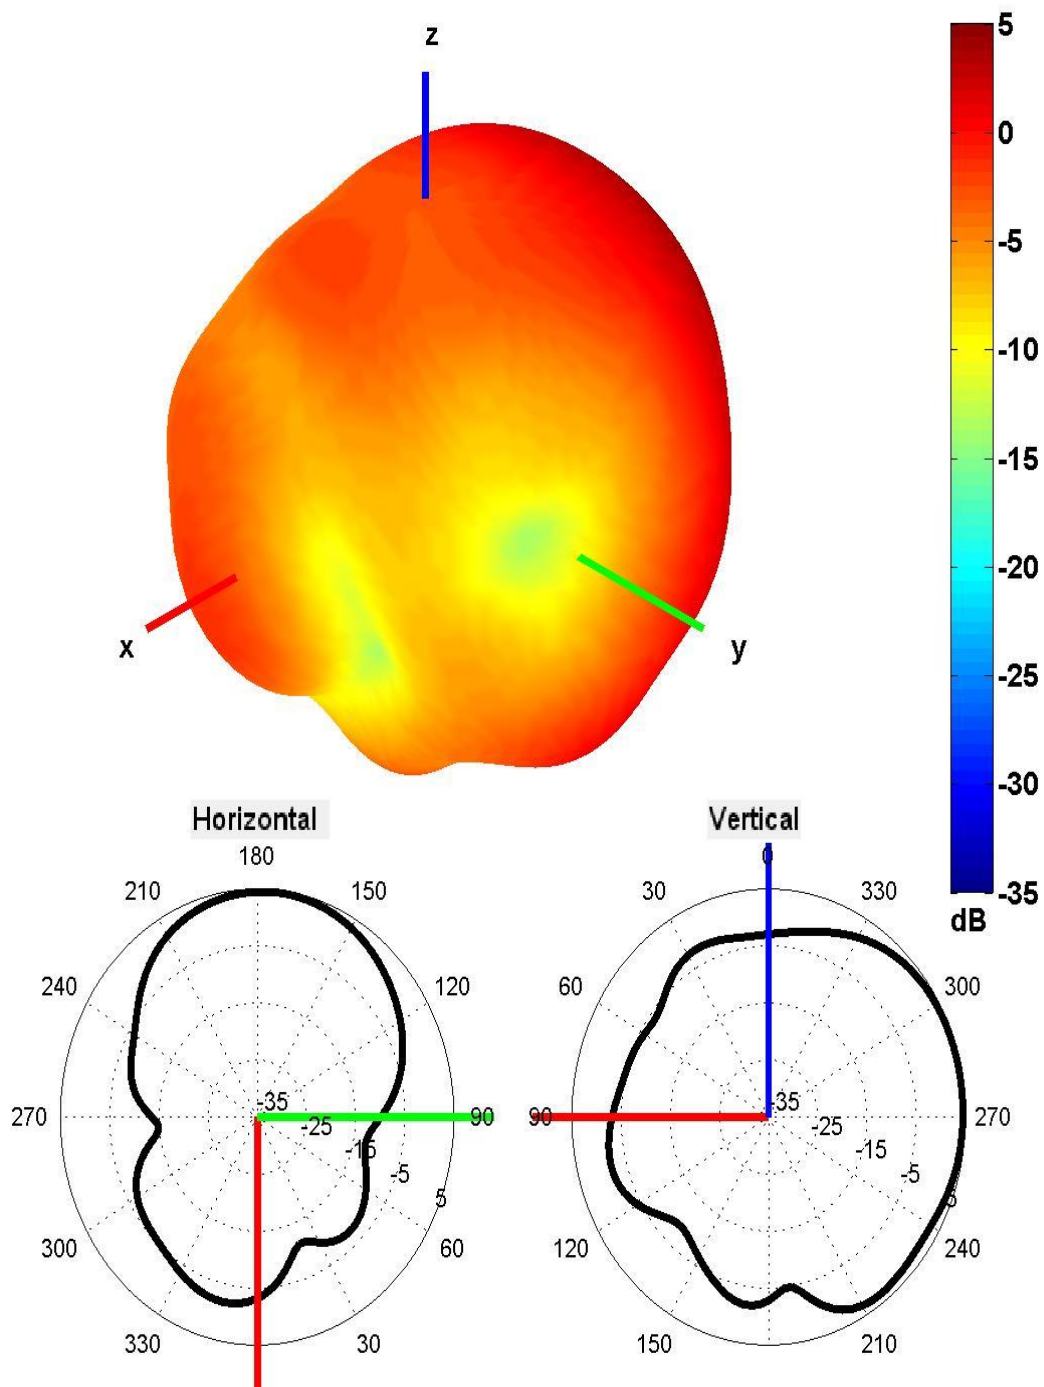

Radiation Pattern at 1900MHz

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia
+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, United Kingdom
+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, USA
+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com

2.4. Conclusion

Prototype antenna was developed for DECT bands (1880-1930 MHz) in respect to placement inside customer device. To achieve best results a cable routing as it is seen in pictures is critical to minimize coupling to nearby objects (main PCB and ribbon cable). Difference between radiation patterns is due to presence of ribbon cable near antenna 2.

Manufacturer name: 2J Antennas

Address: Stefanikova 61, 085 01 Bardejov, Slovakia

FCC Antenna gain: 4.4 dBi

Antenna type: PCB

Antenna model: SI326100548

2J Antennas, s.r.o

Stefanikova 61
085 01 Bardejov
Slovakia

+421 54 4880130
sales@2j-antennae.com
www.2j-antennae.com

2J Antennas UK Ltd

Unit 2, 24 Palmers Road
Emsworth, Hampshire
PO10 7DL, **United Kingdom**

+44 (0)1243 379673
salesuk@2j-antennae.com
www.2j-antennae.com

2J Antennas USA, Corp

5744 Pacific Center Blvd
Suite 311
San Diego, CA 92121, **USA**

+1 (858) 465-6262
sales@2j-antennasusa.com
www.2j-antennasusa.com