






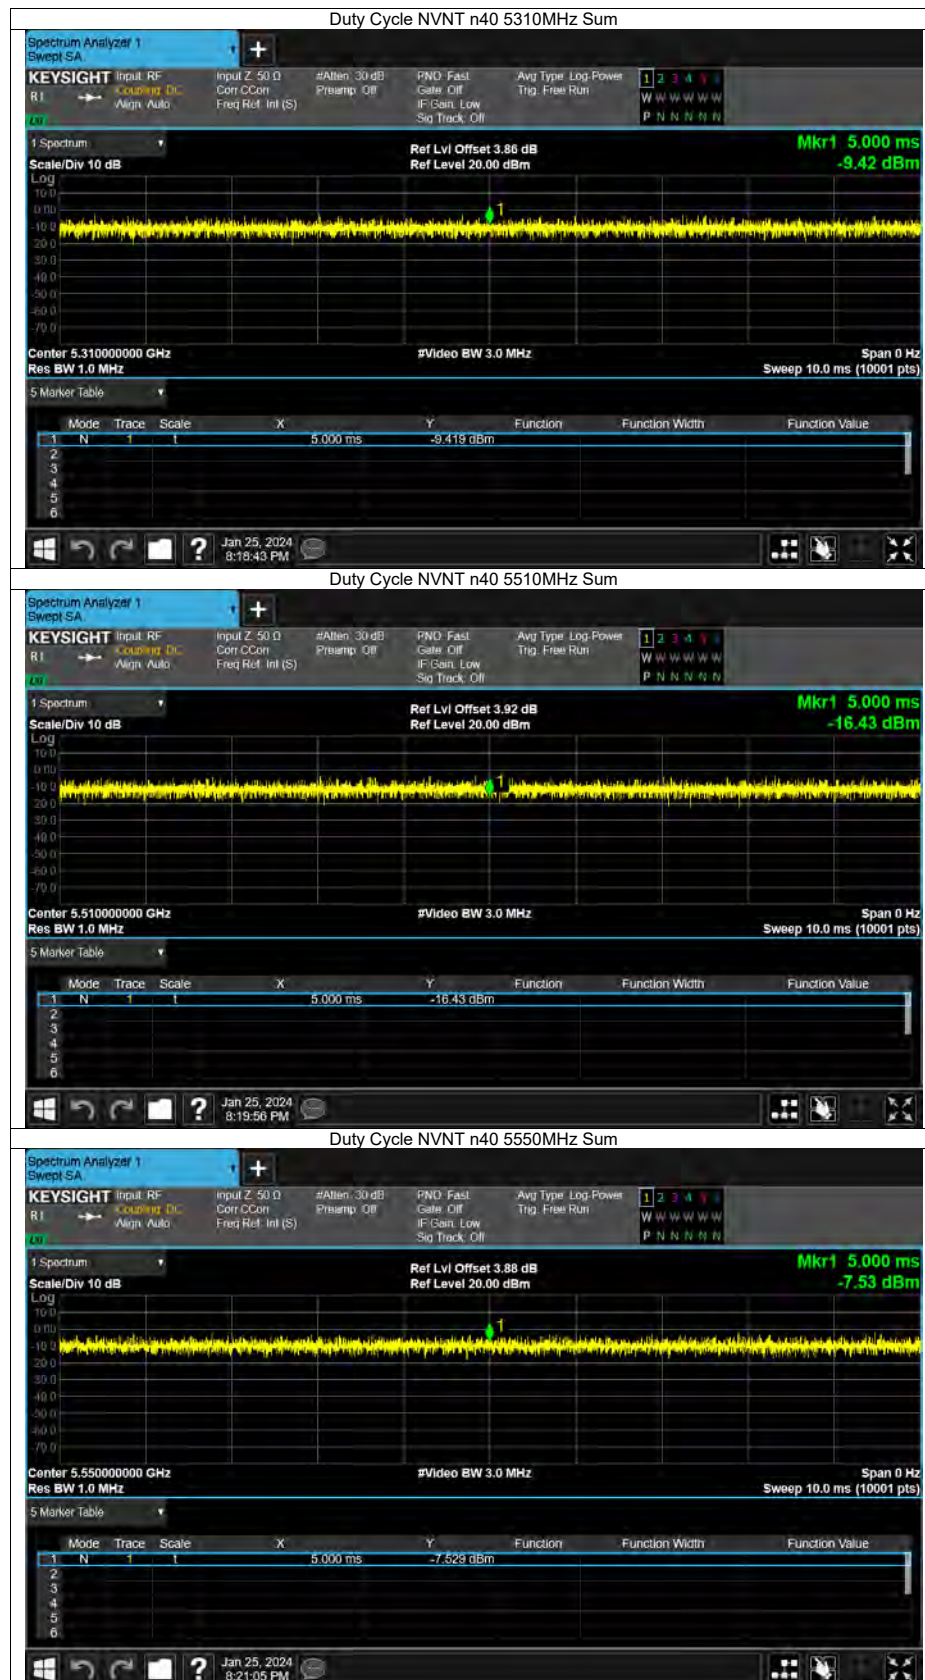


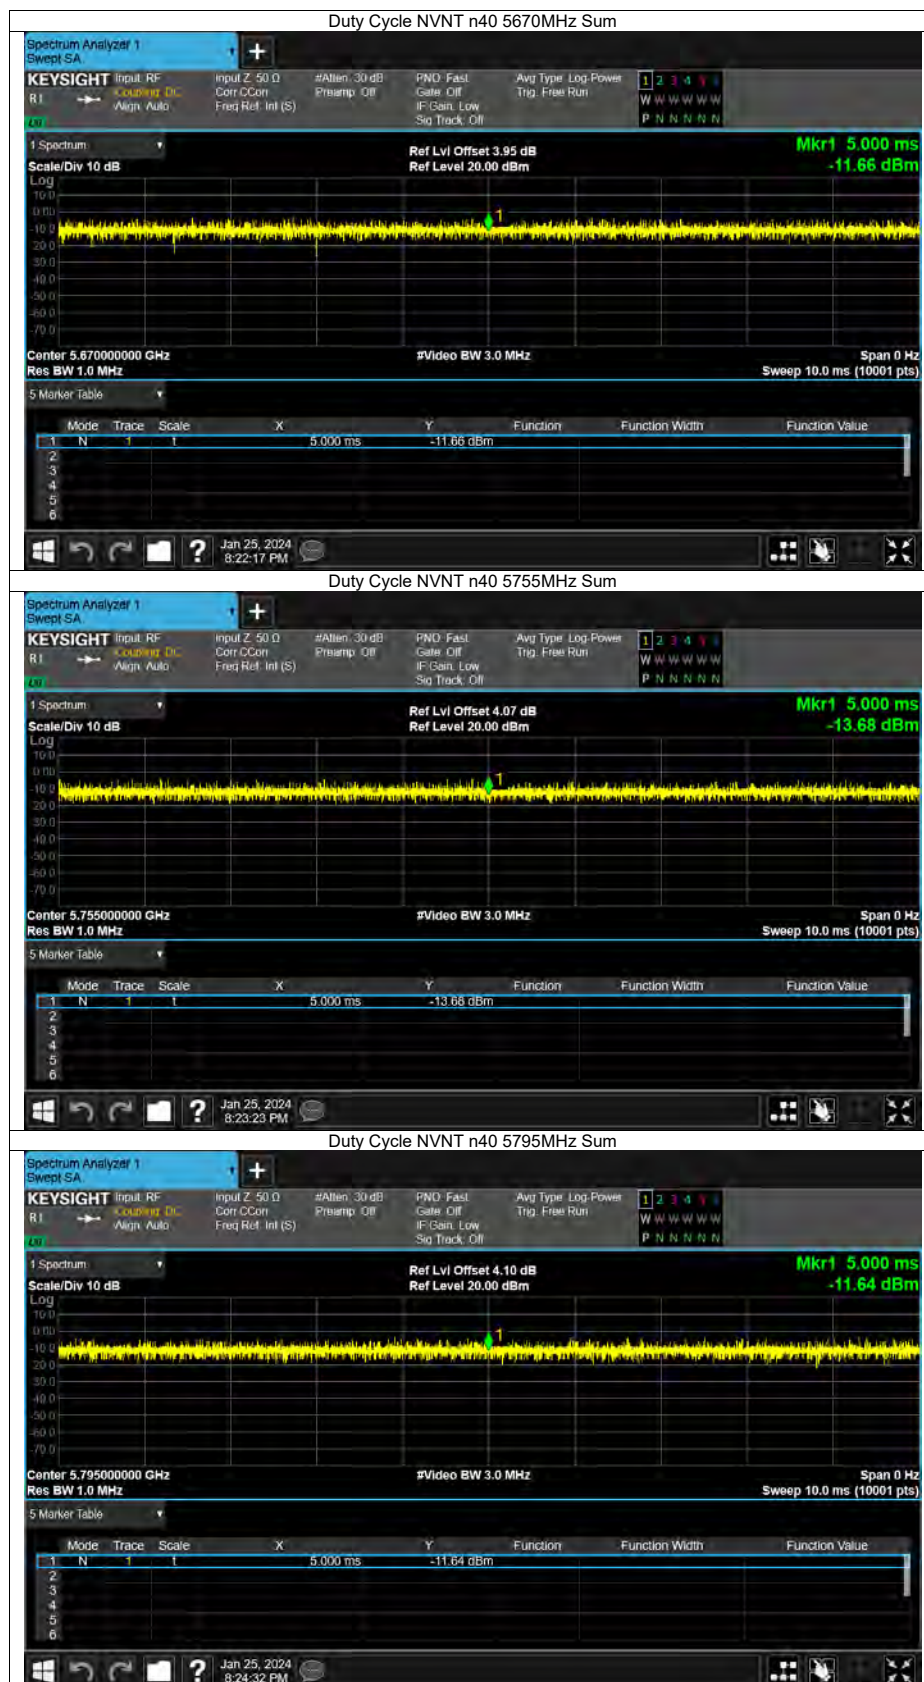


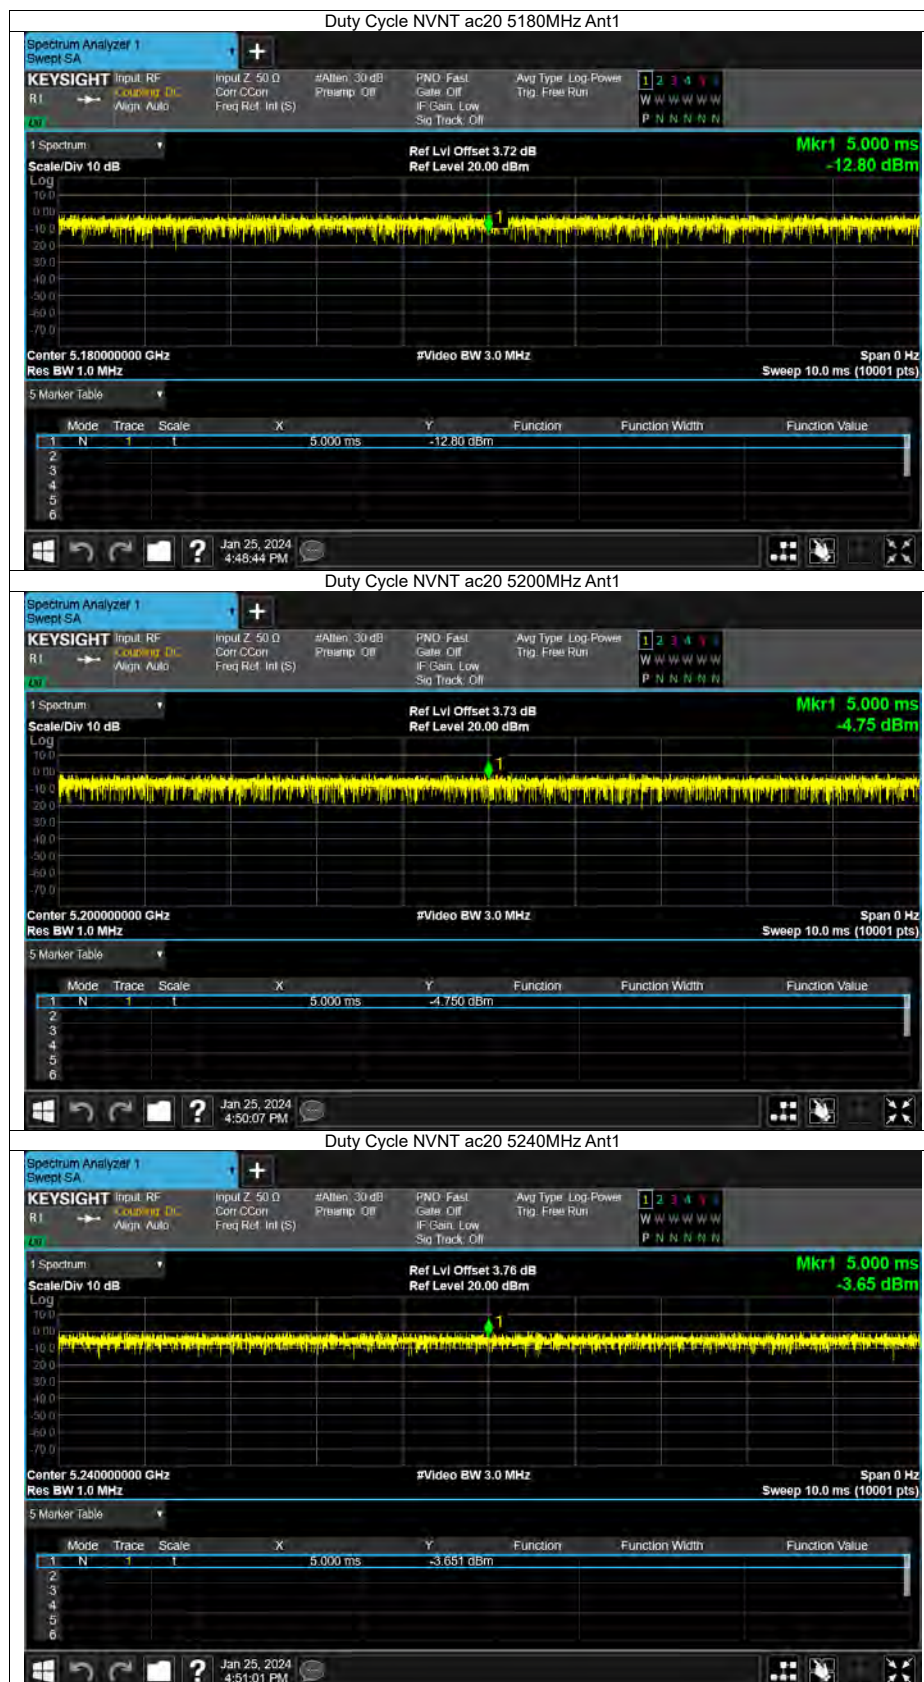


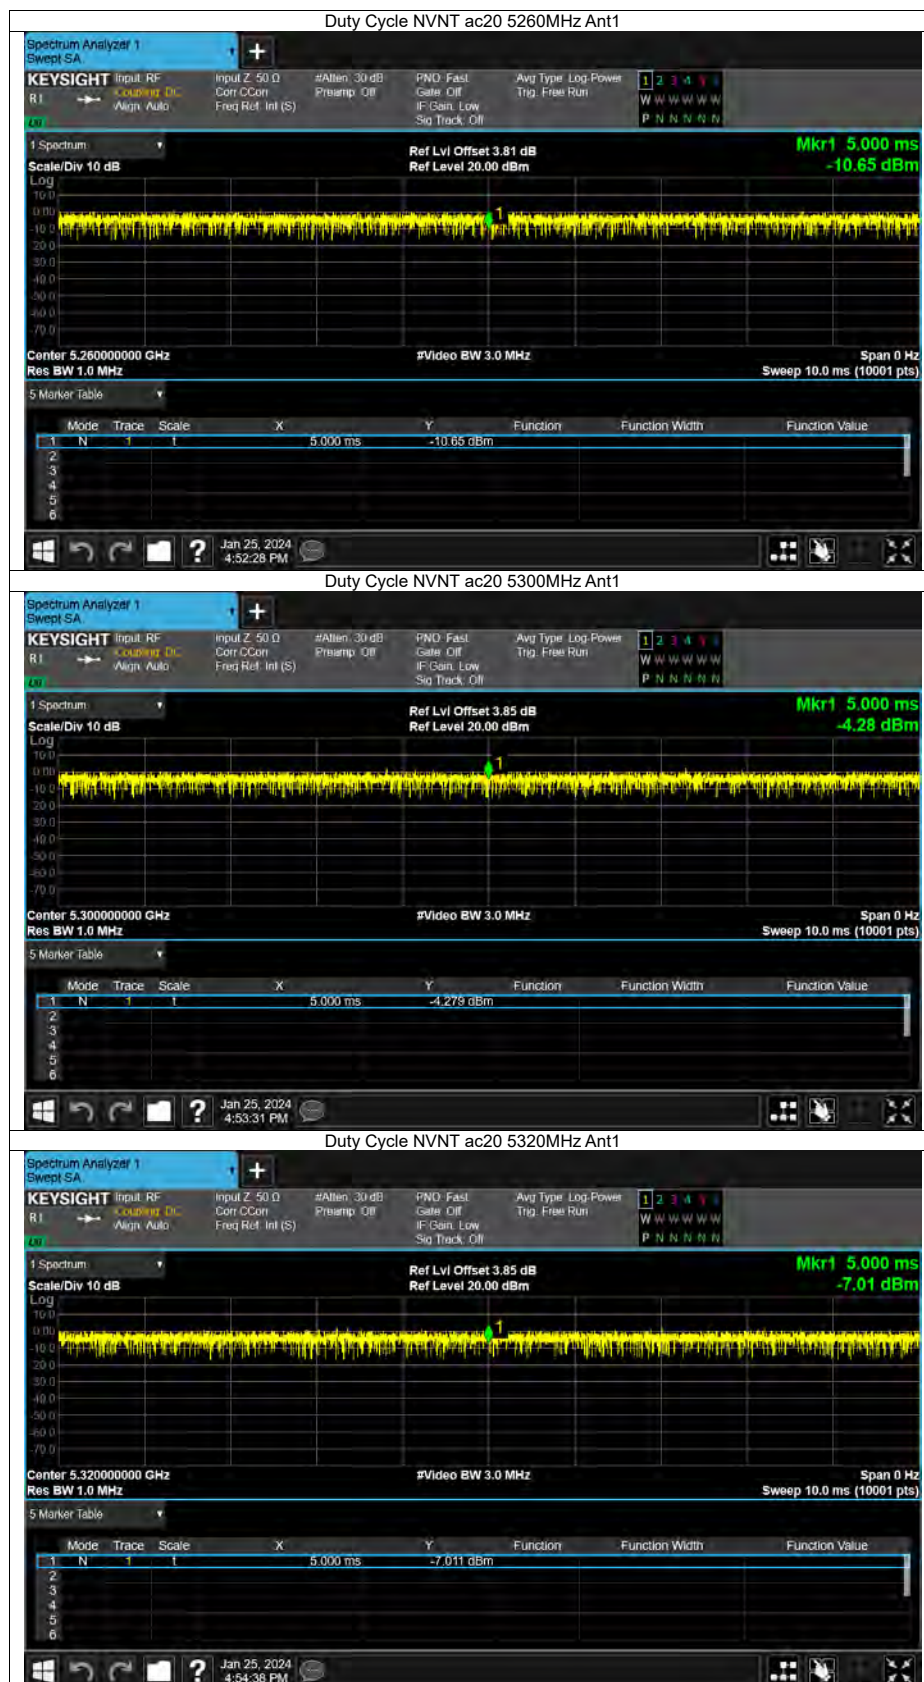


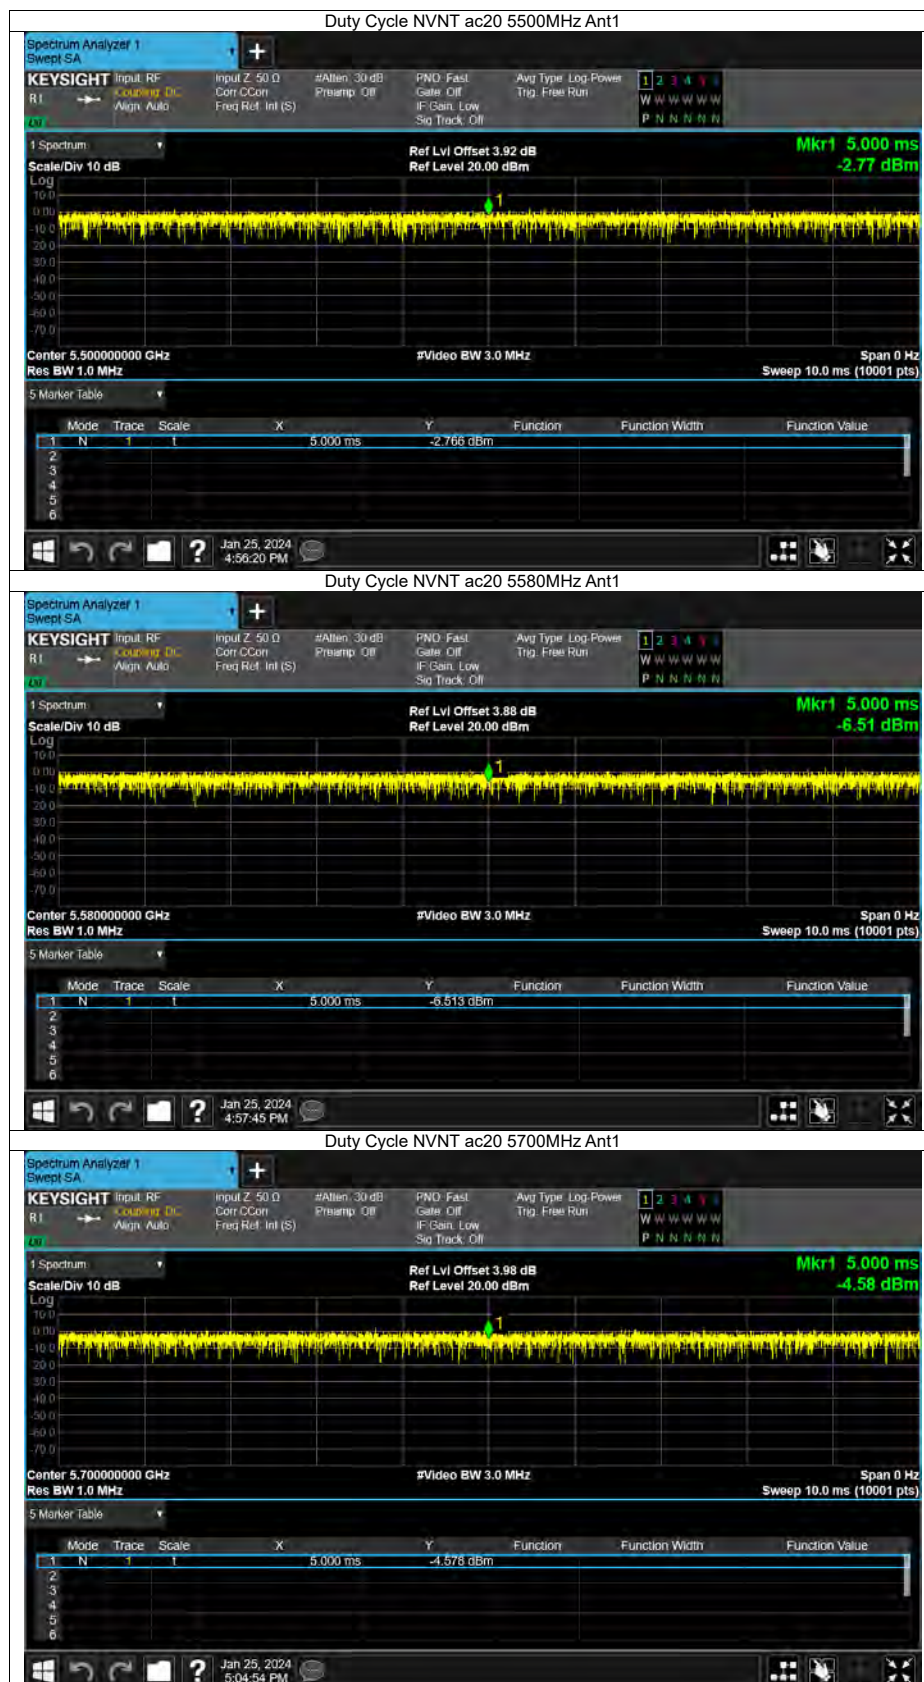


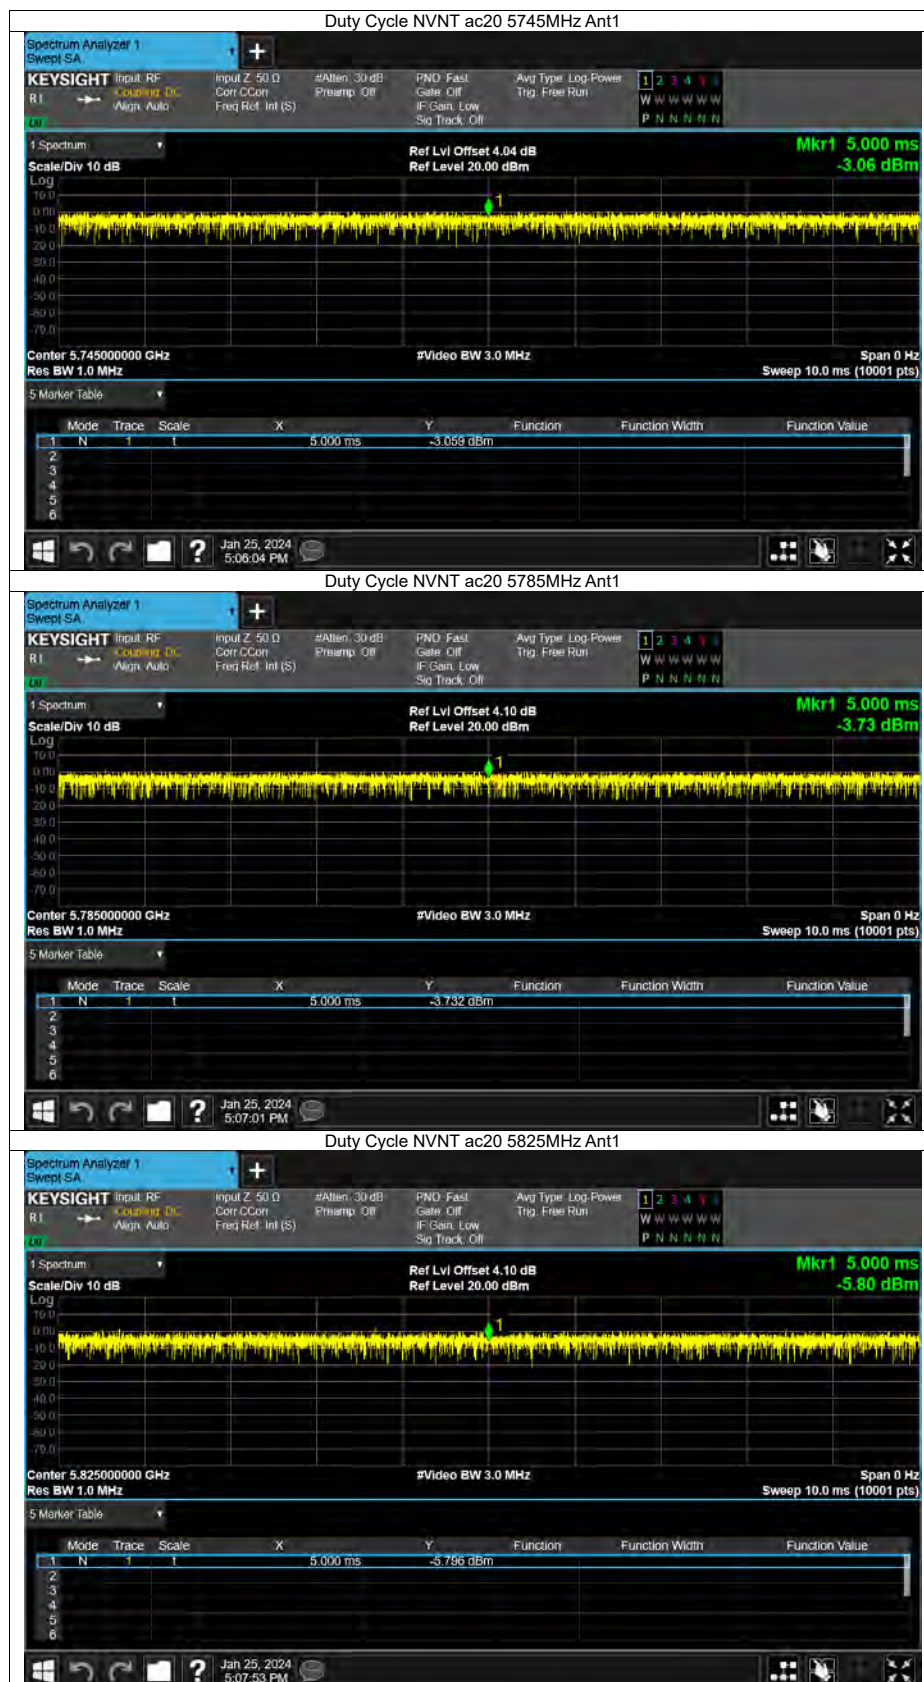


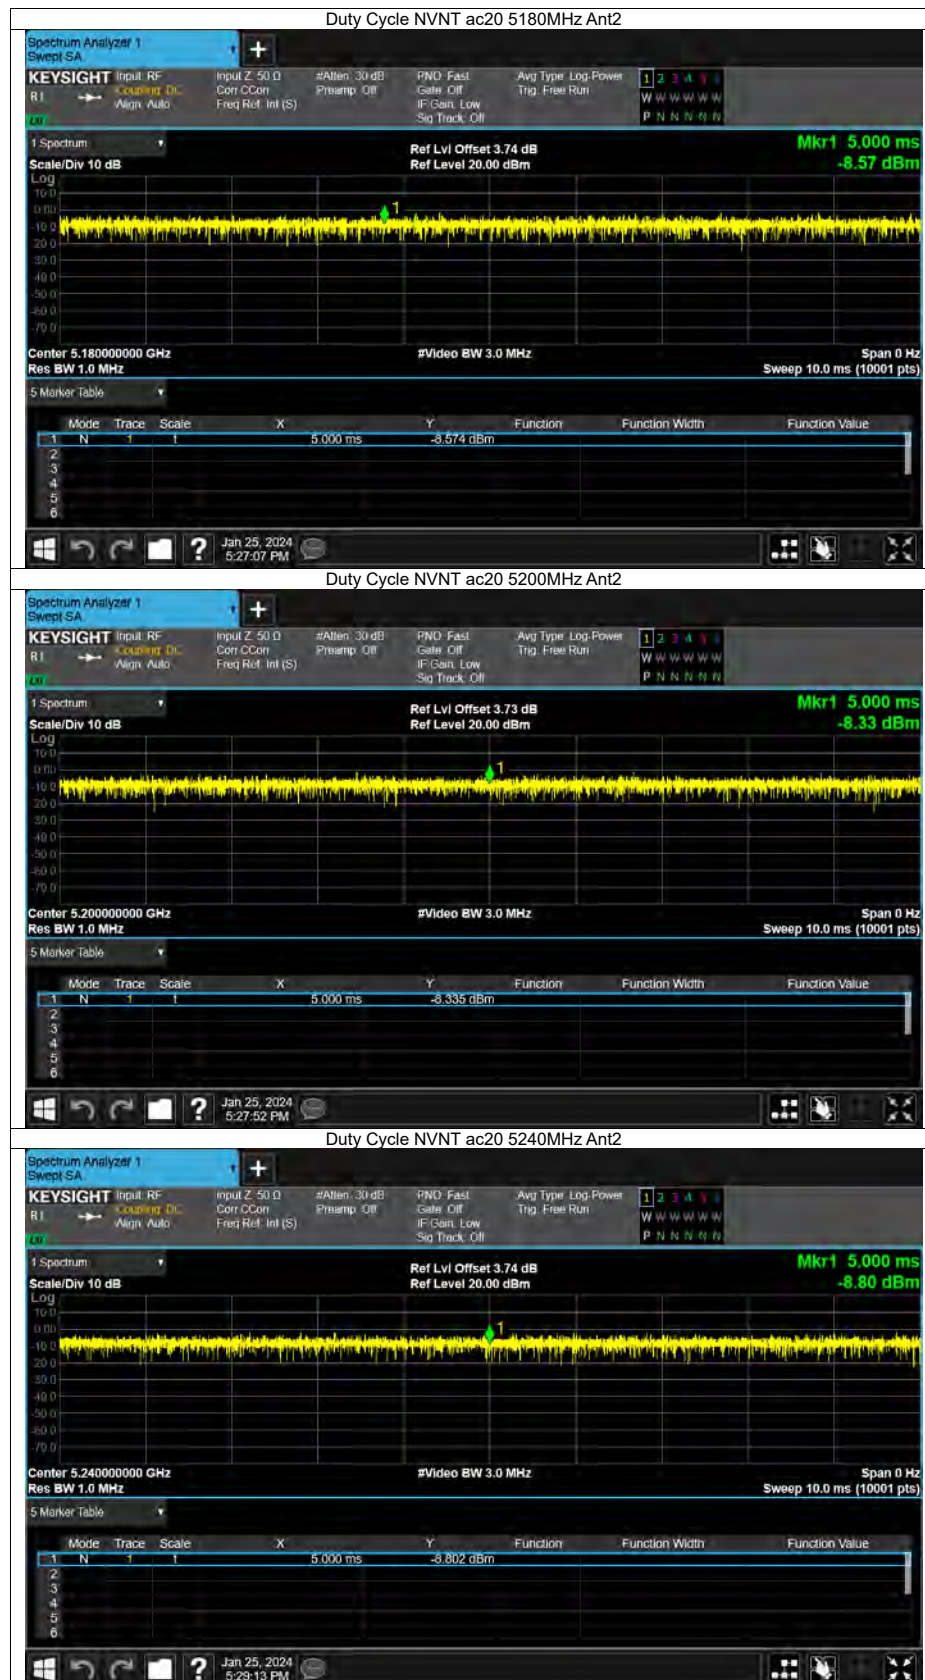


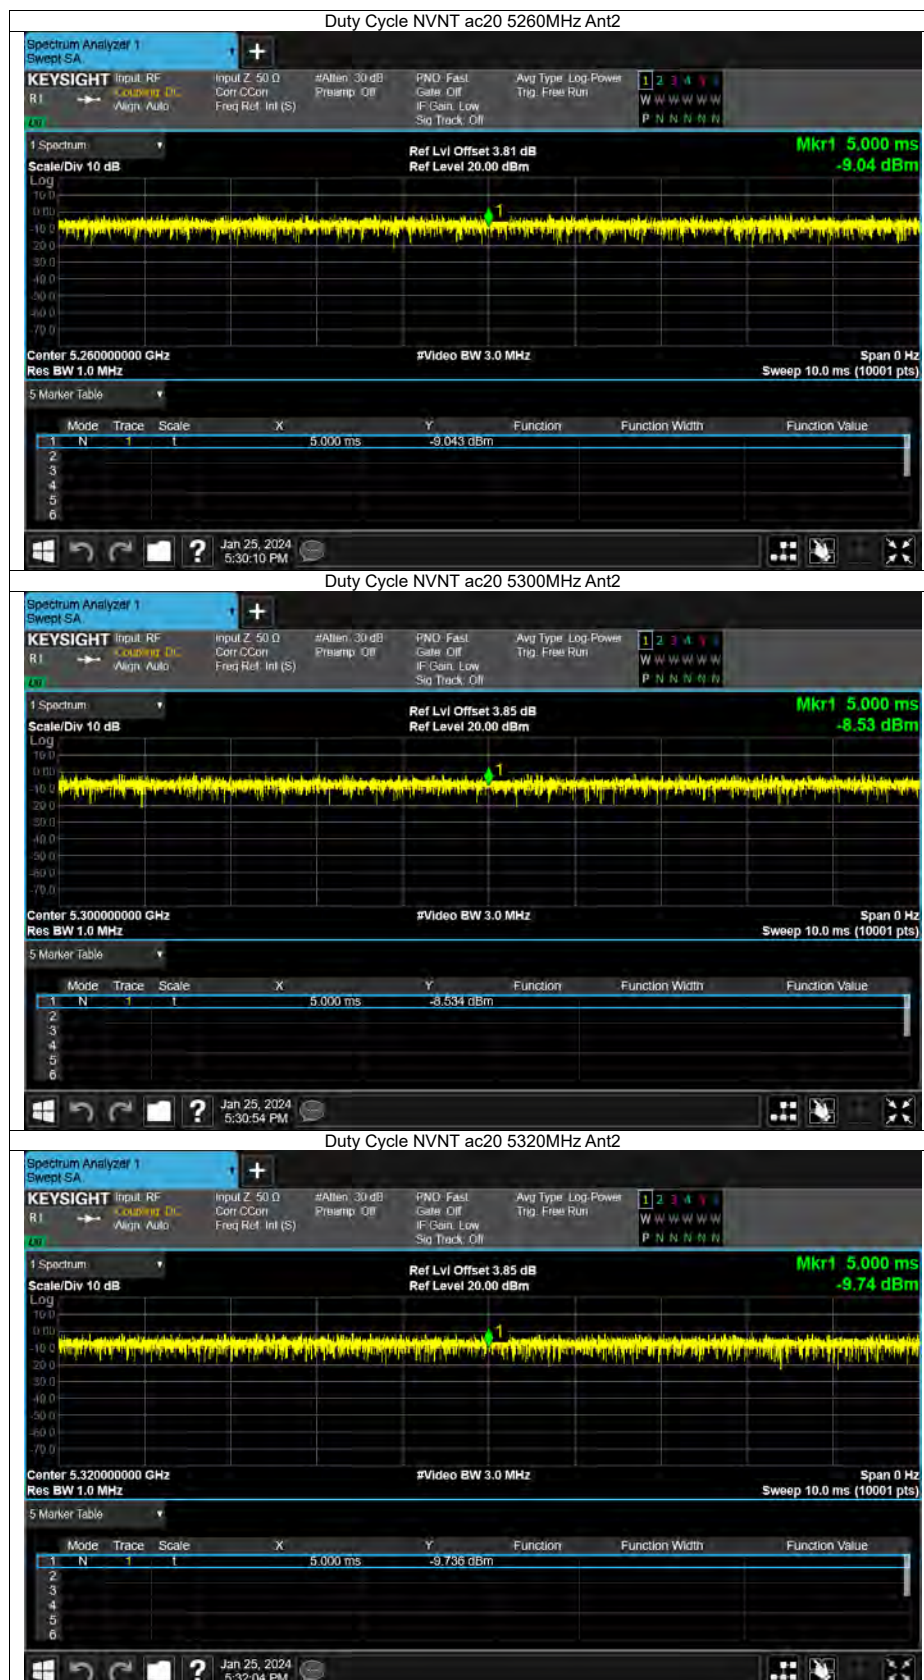


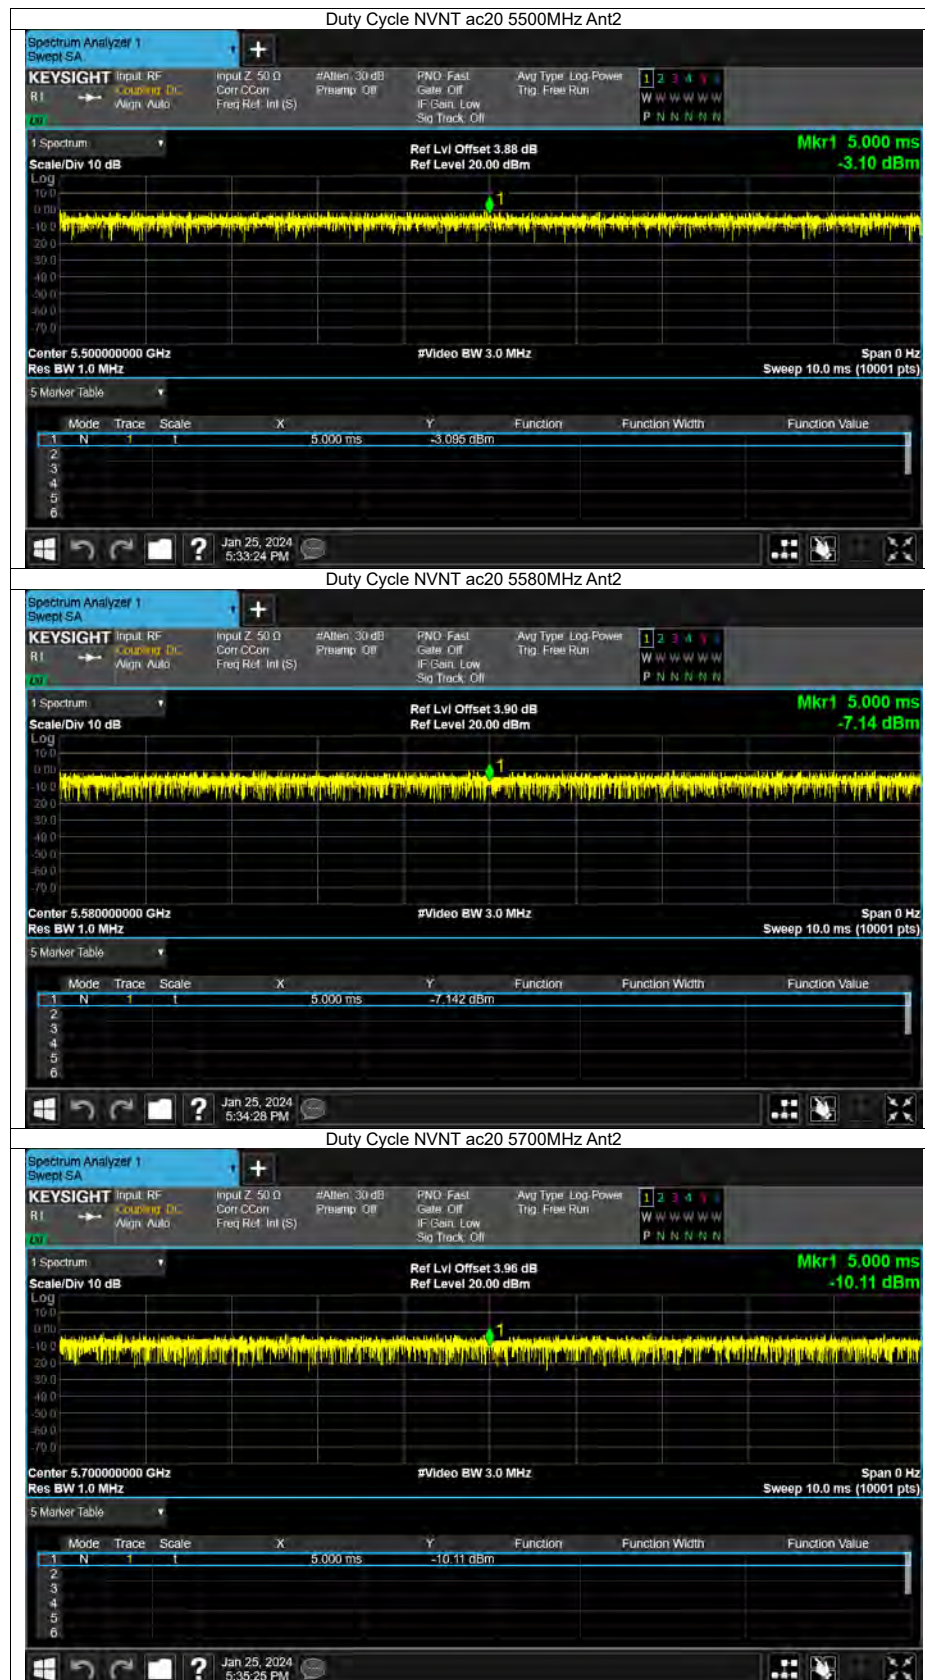


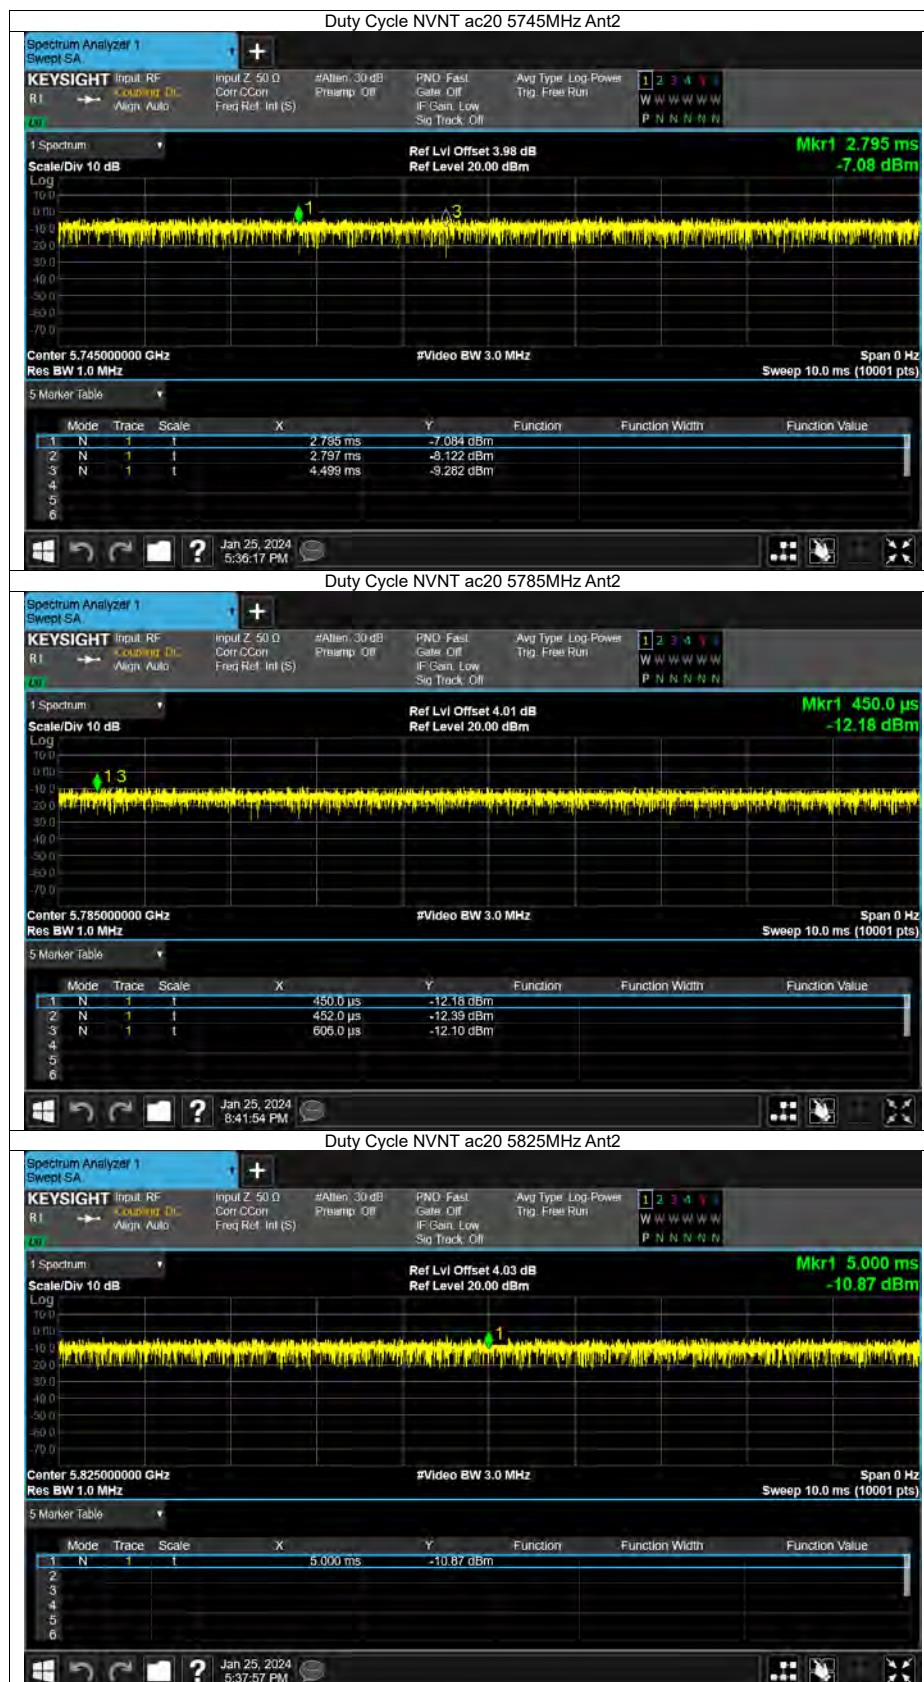


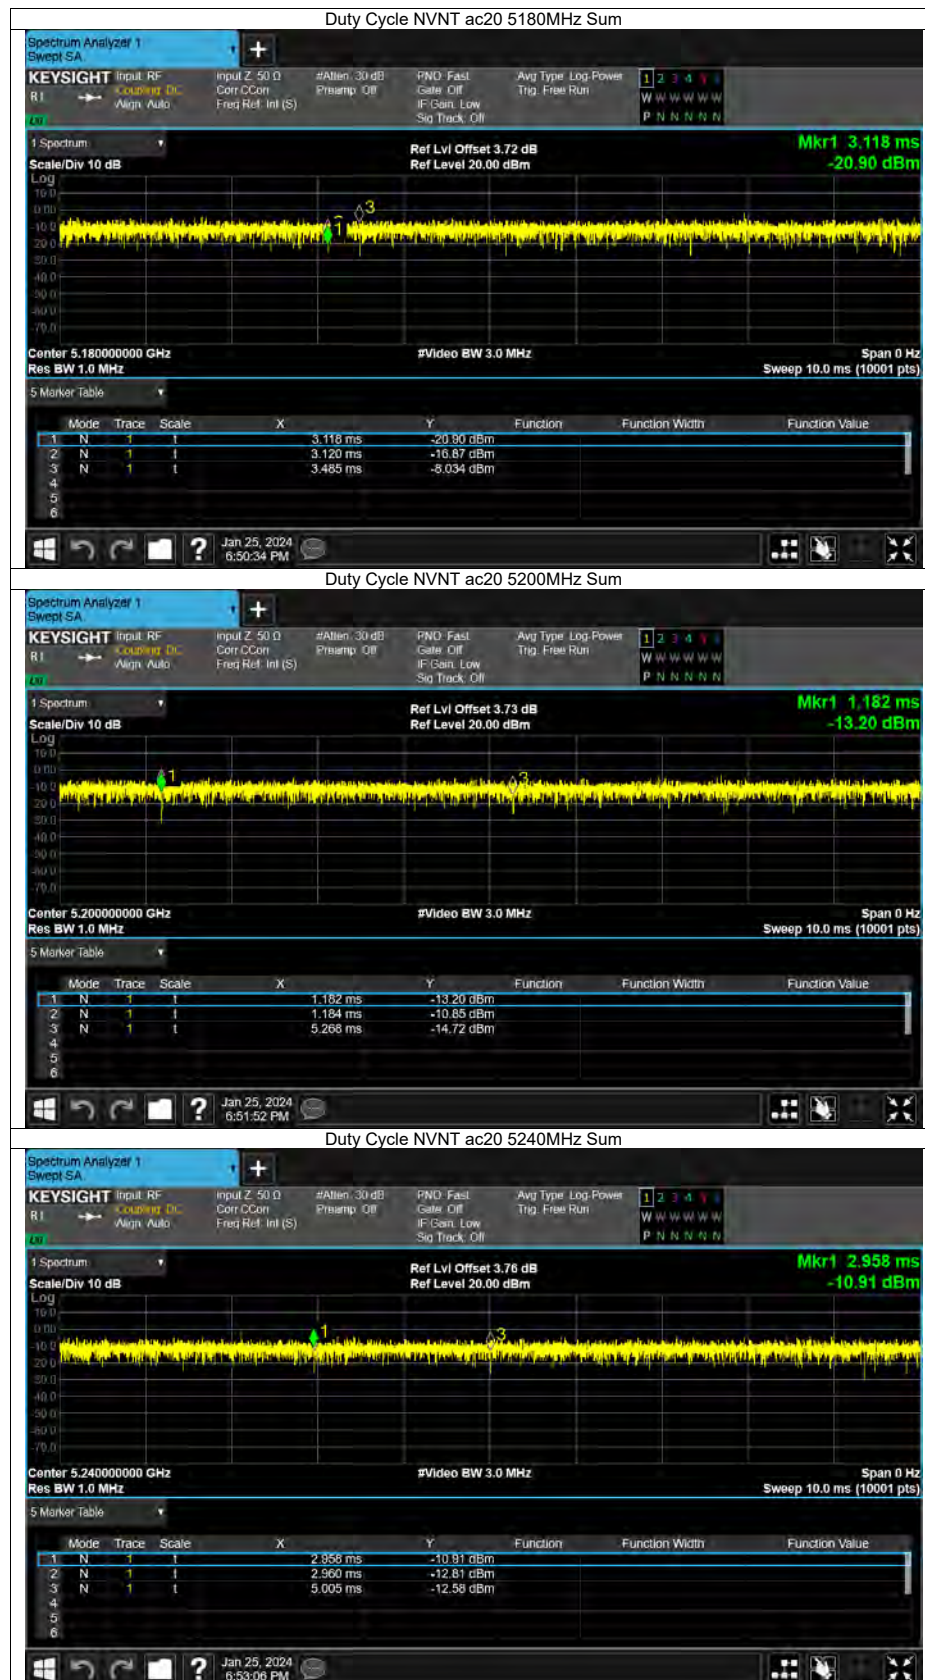


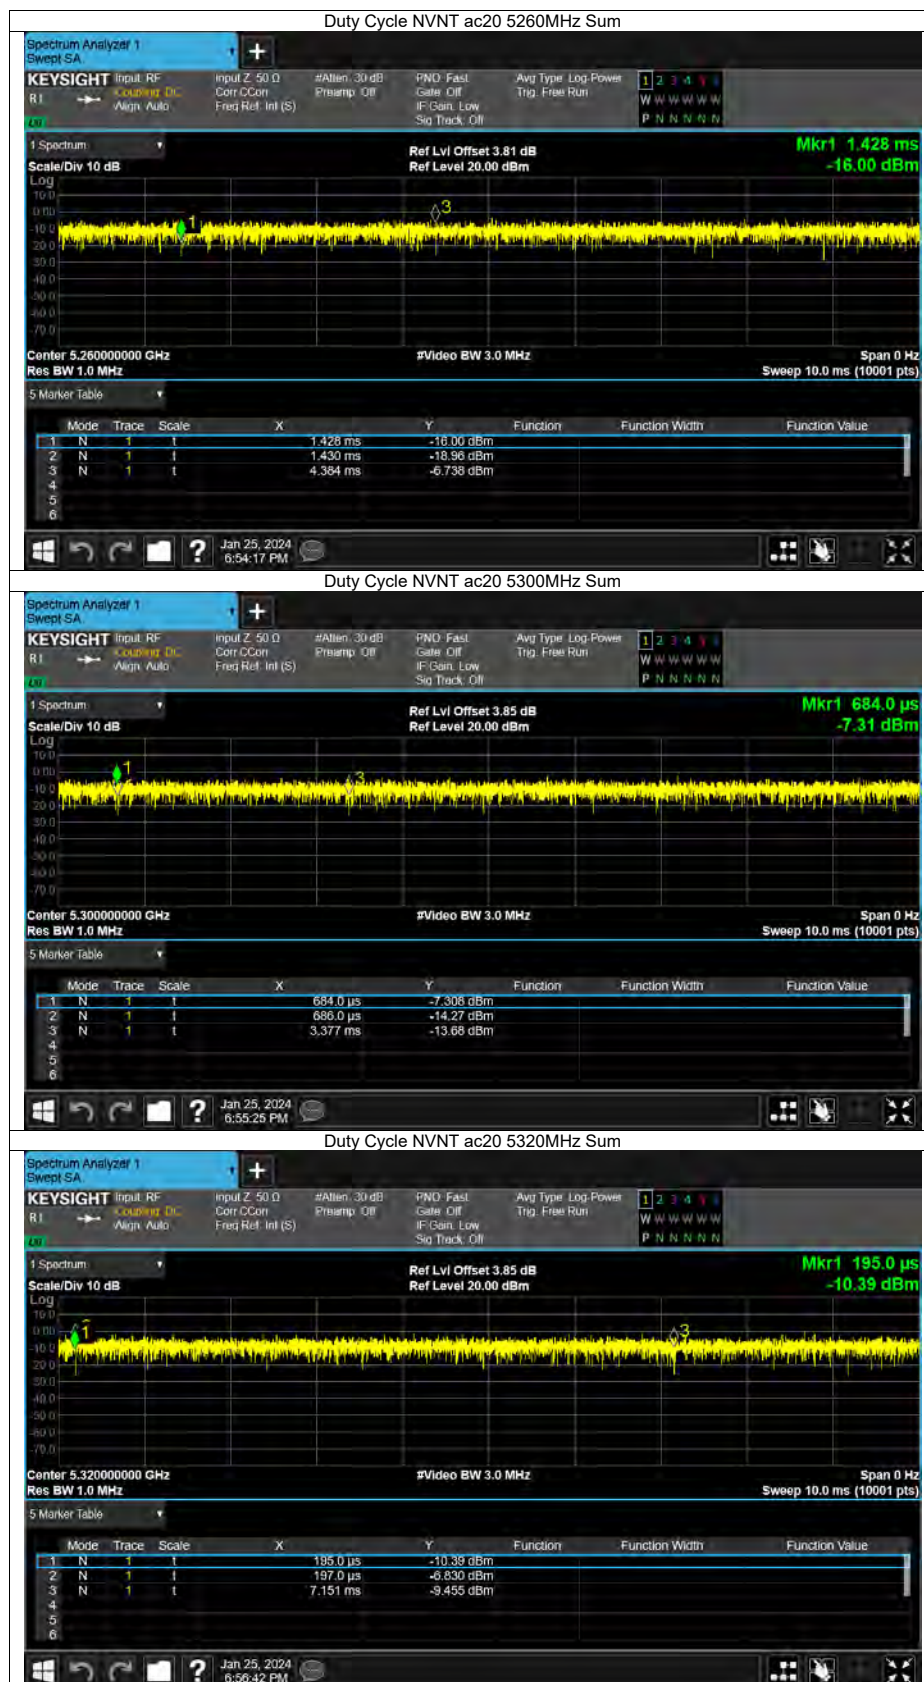


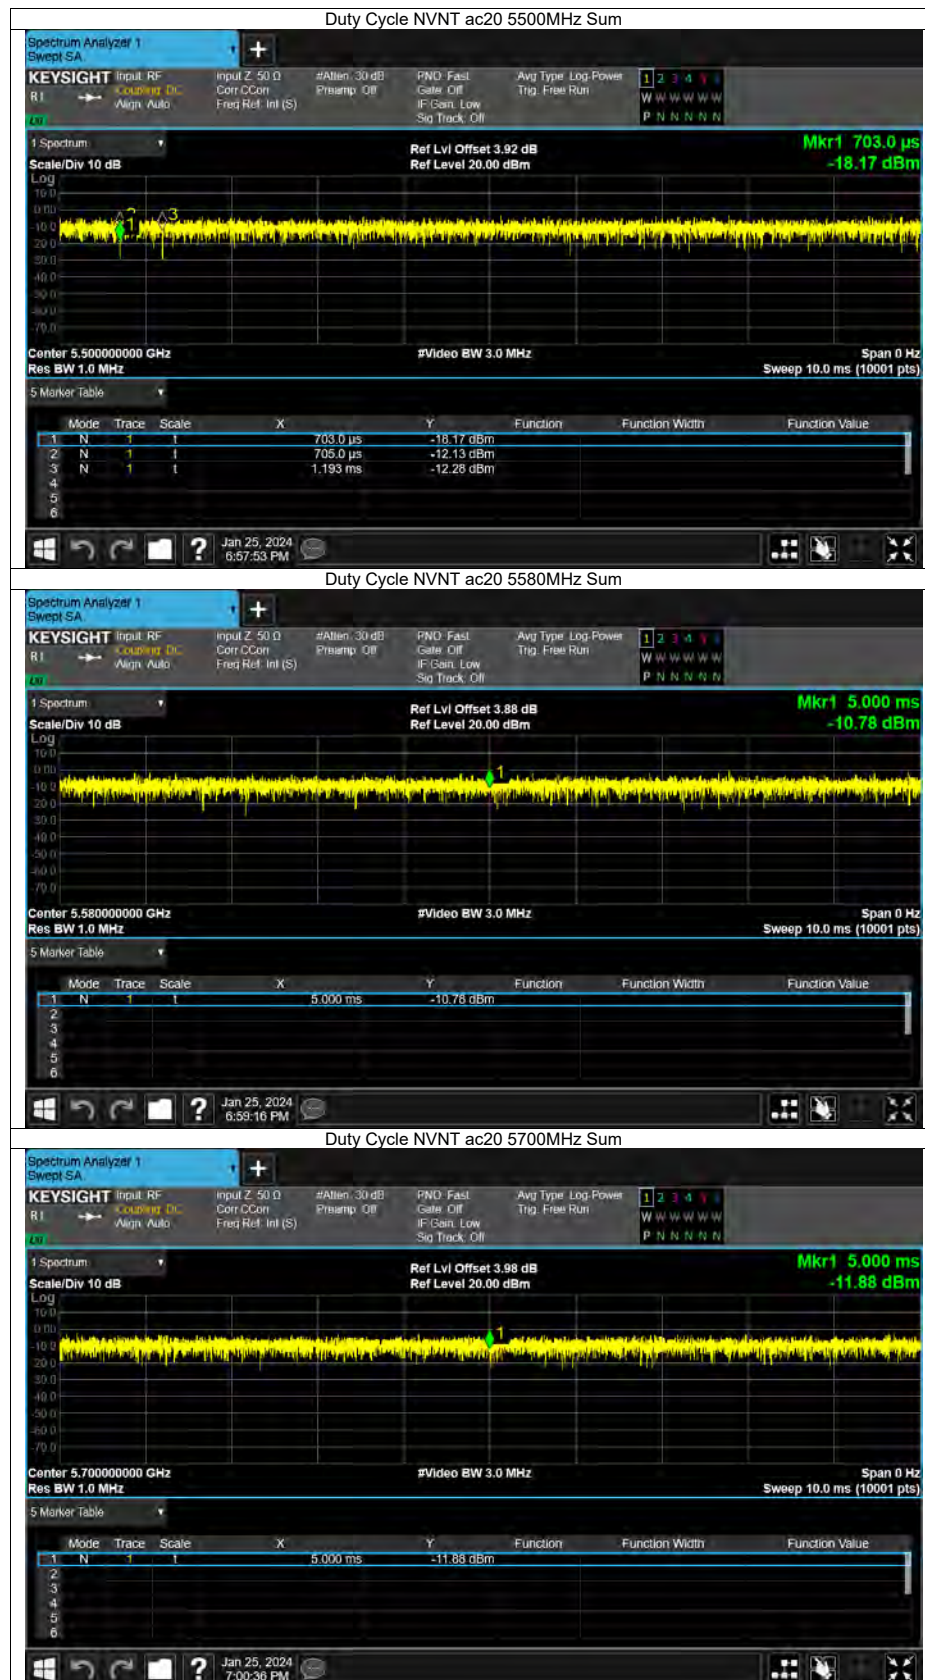


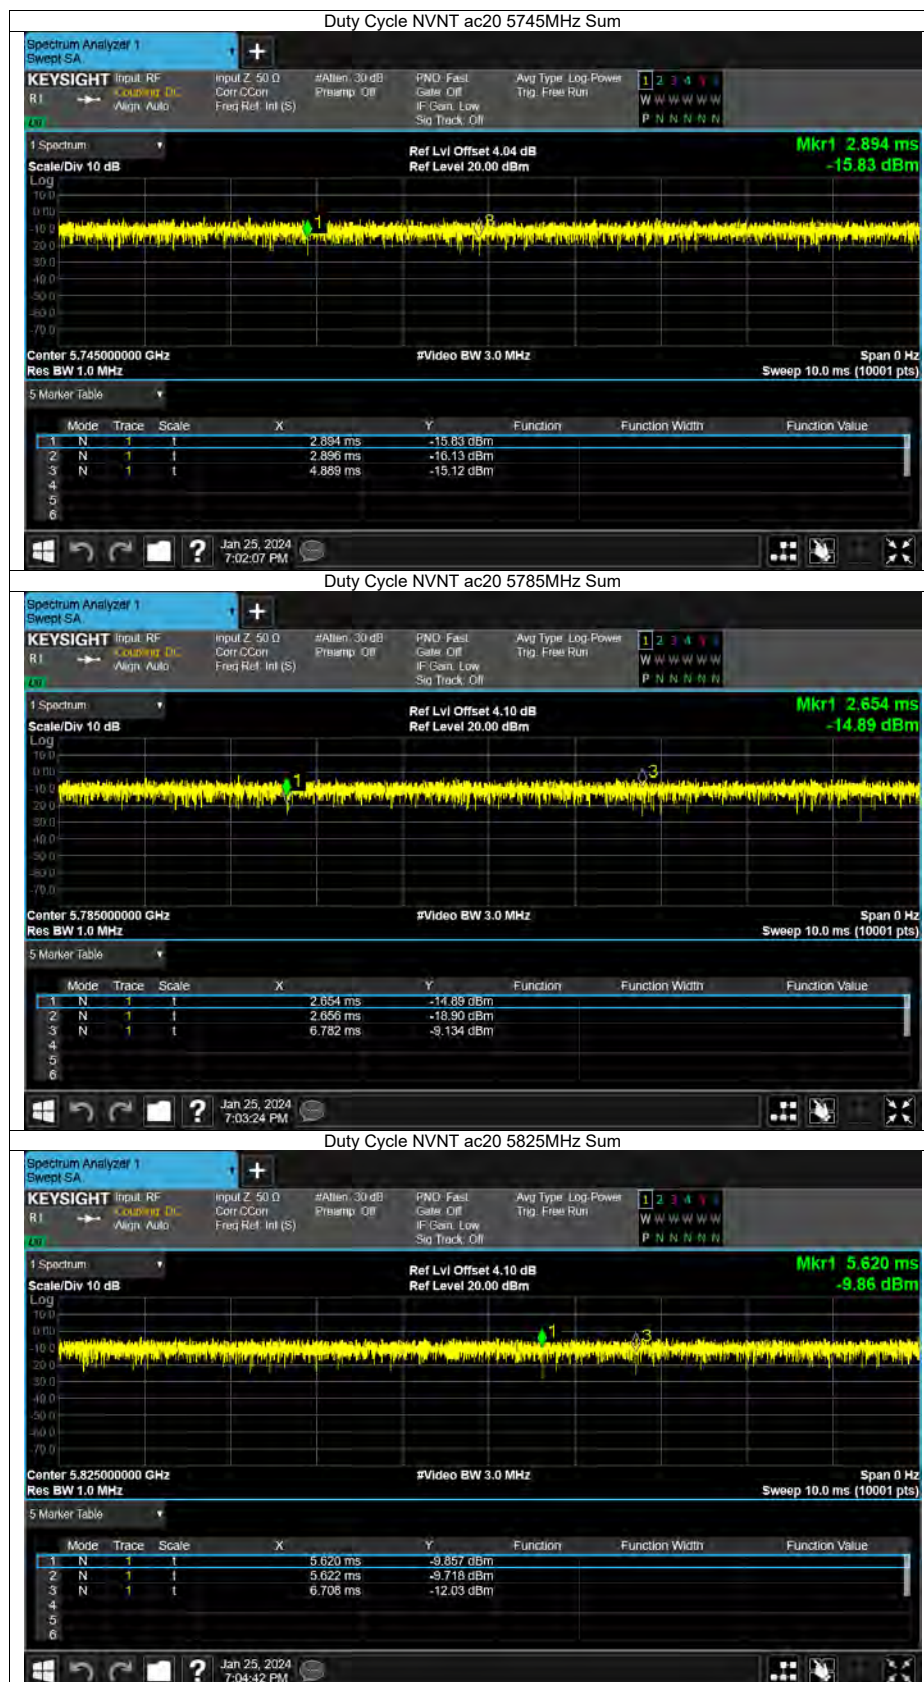


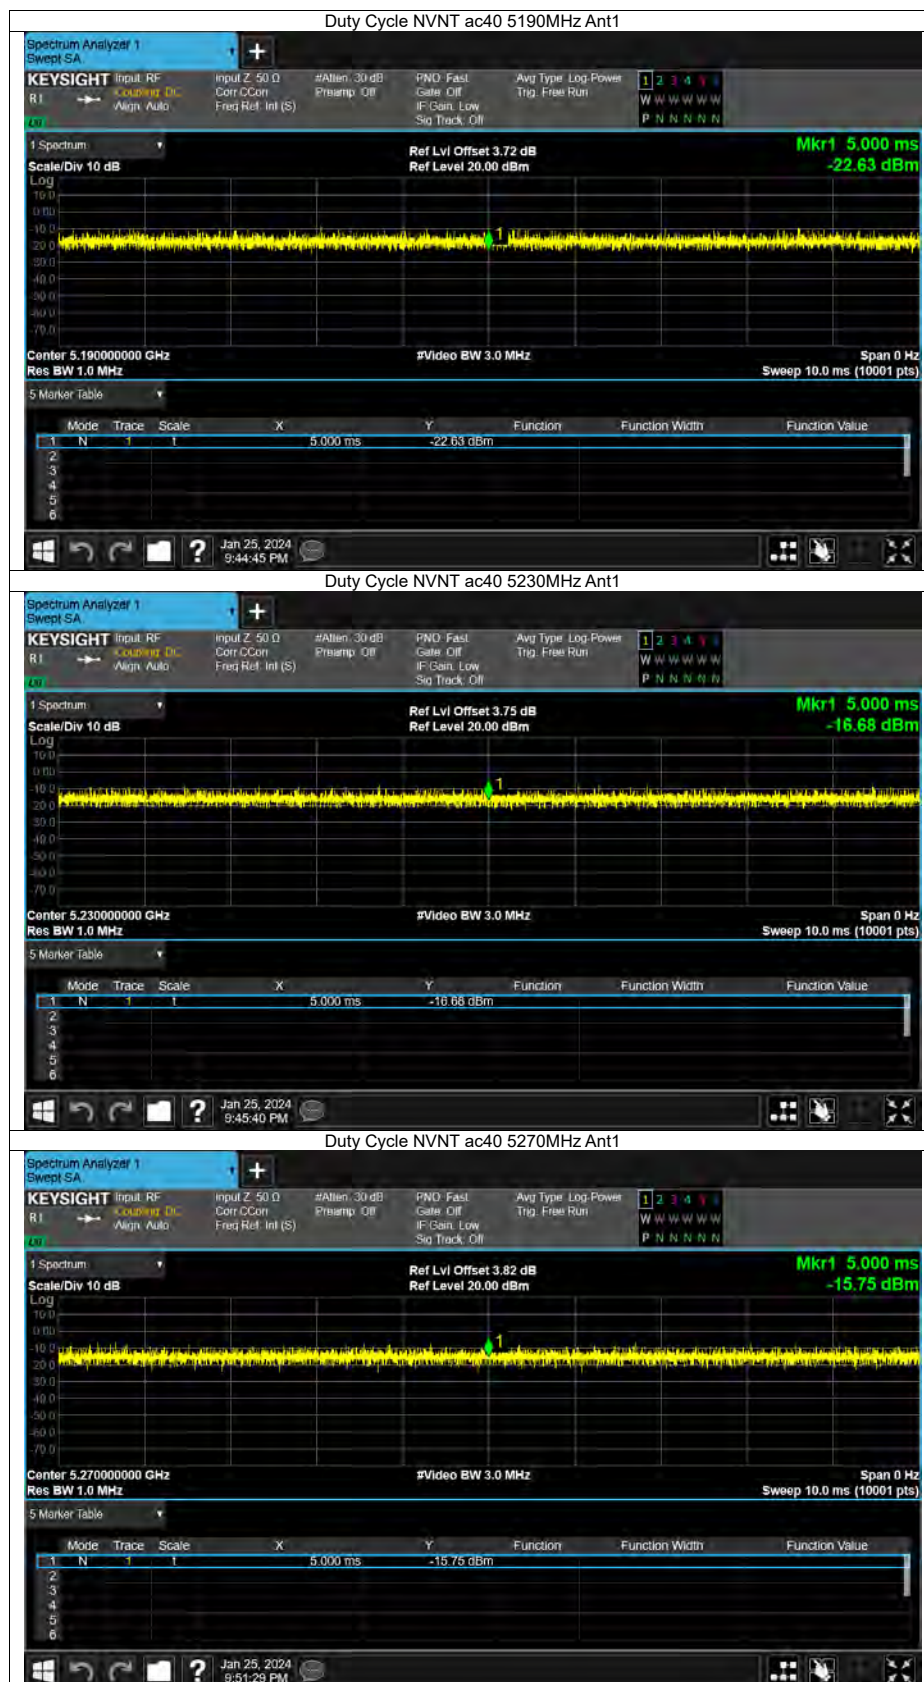


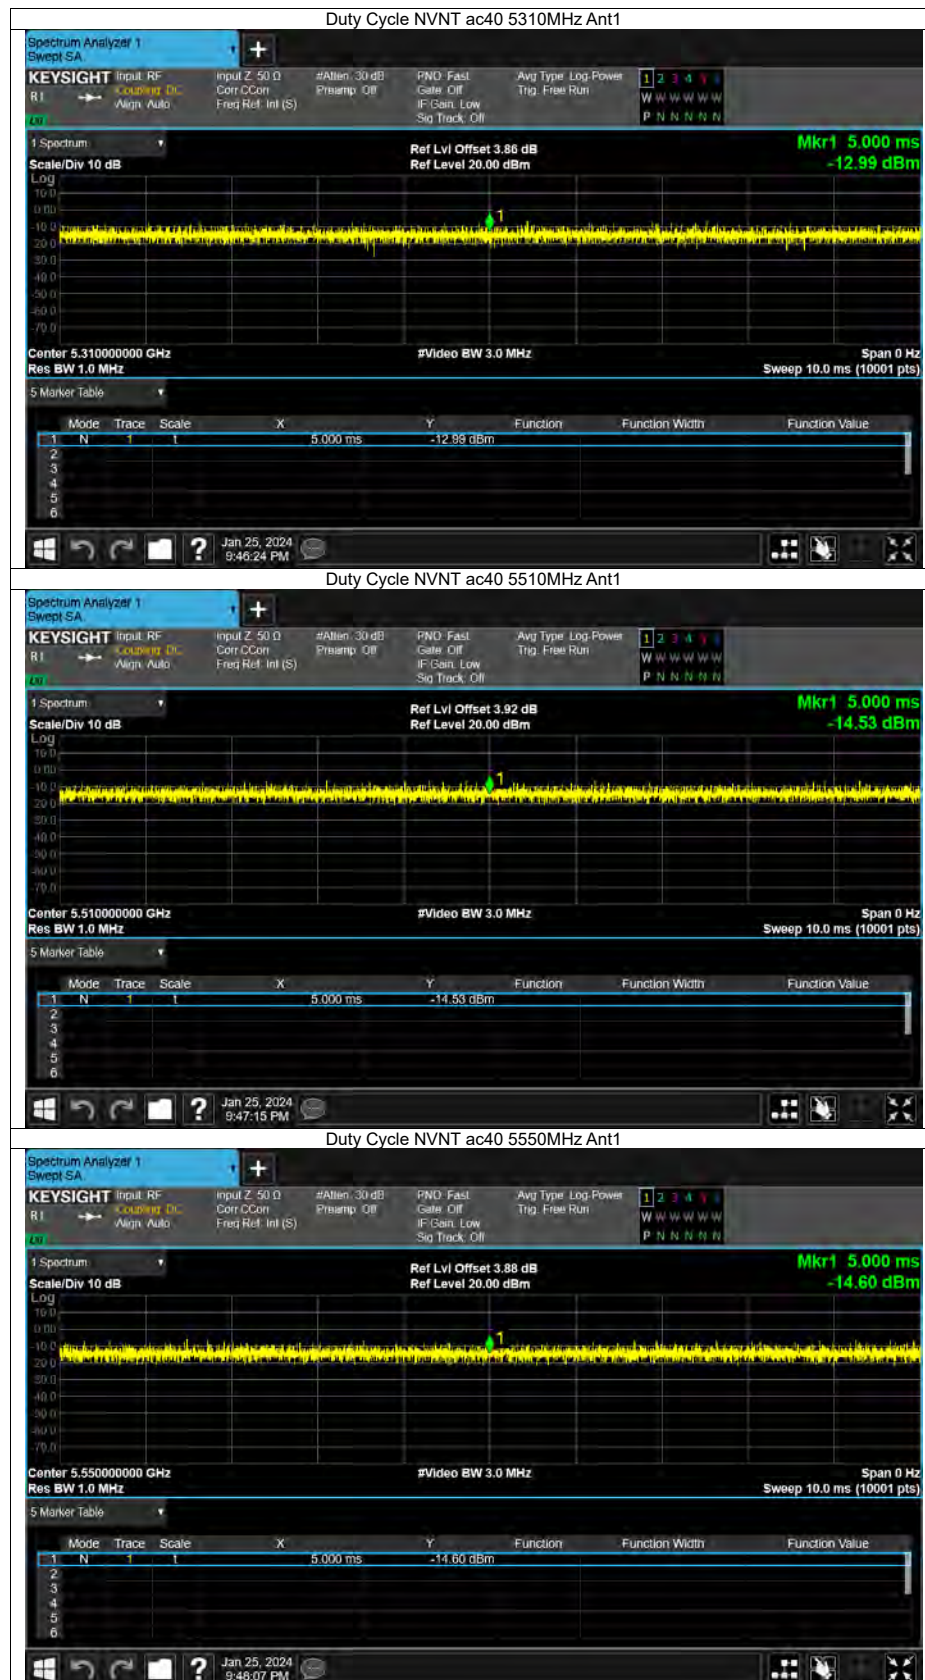


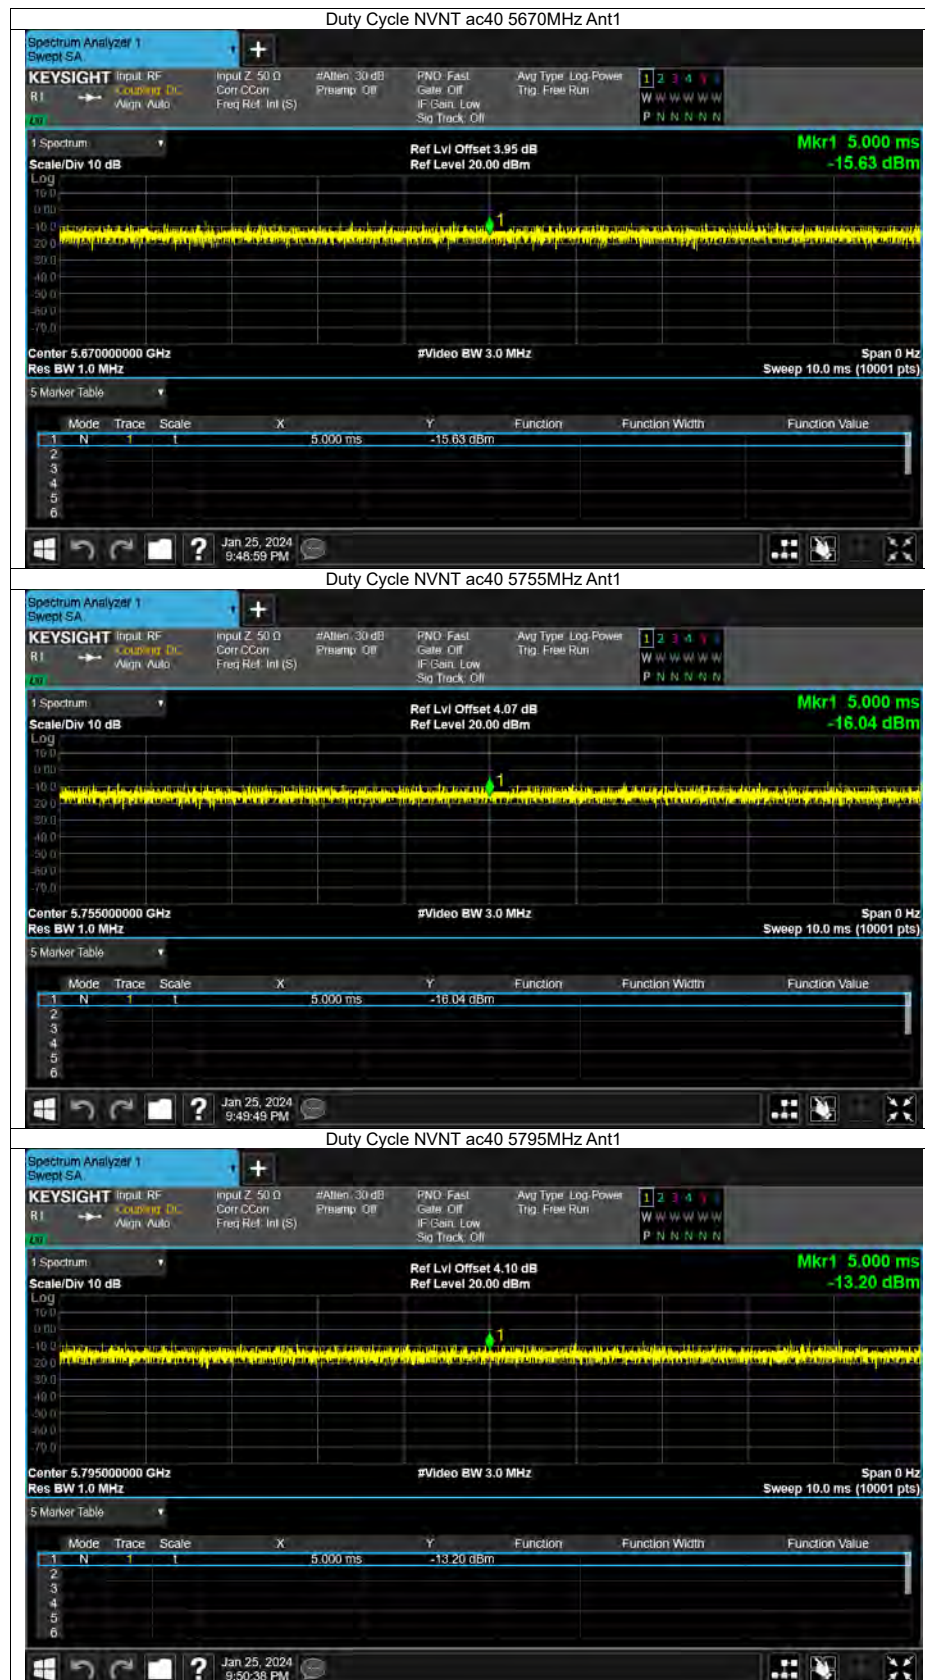


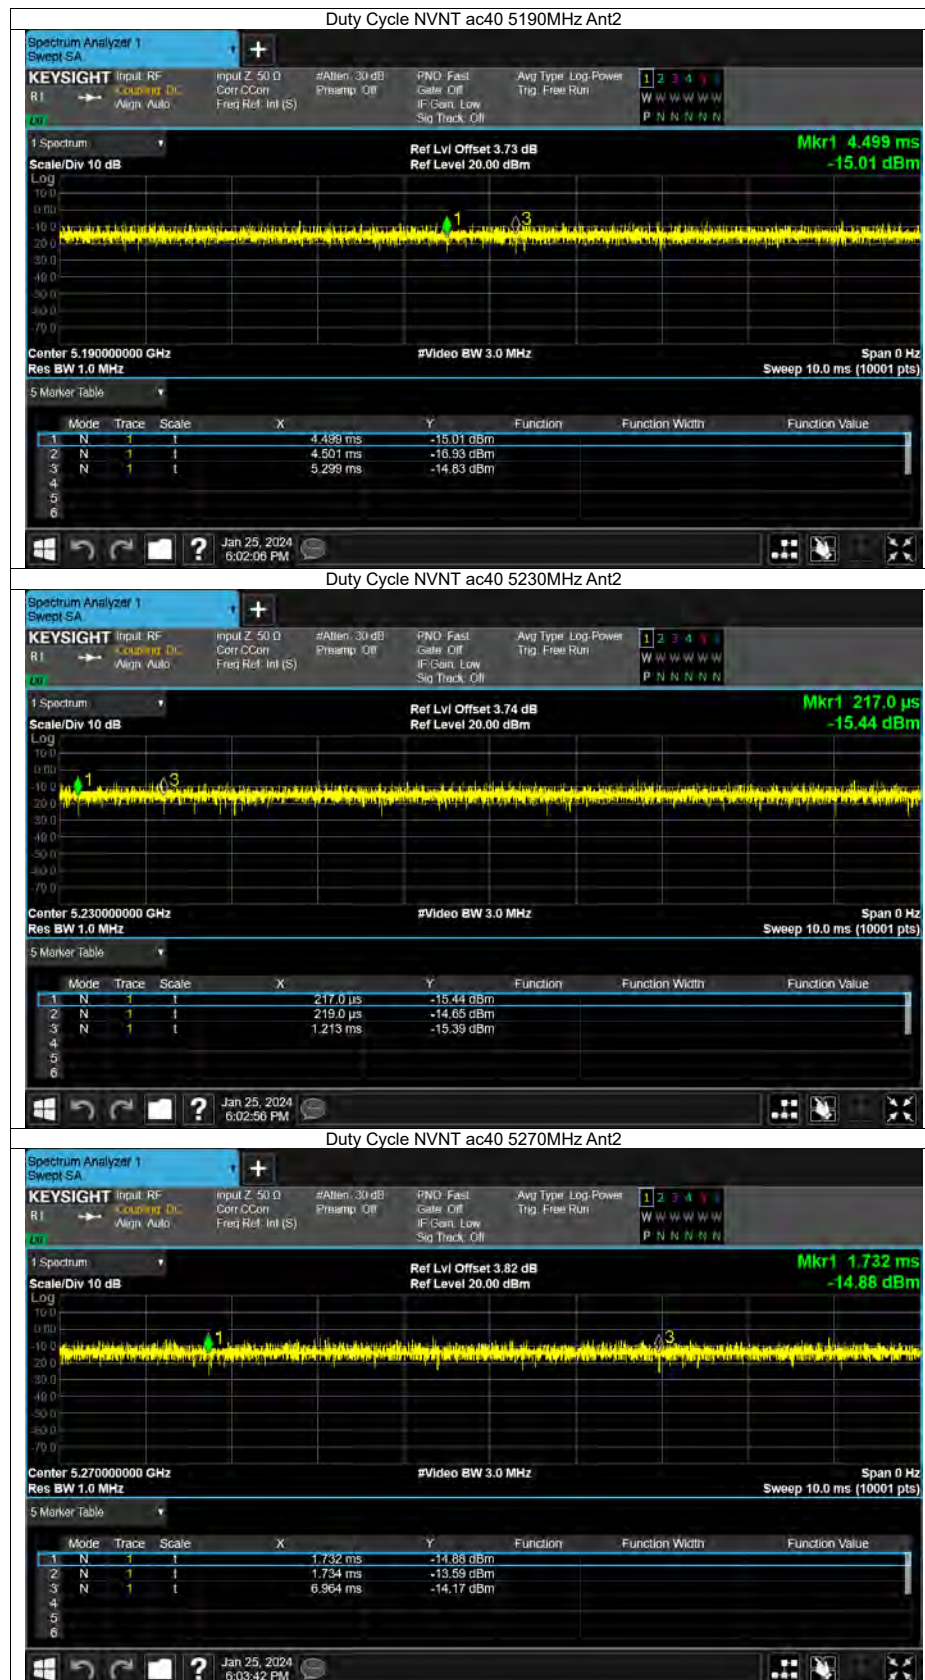


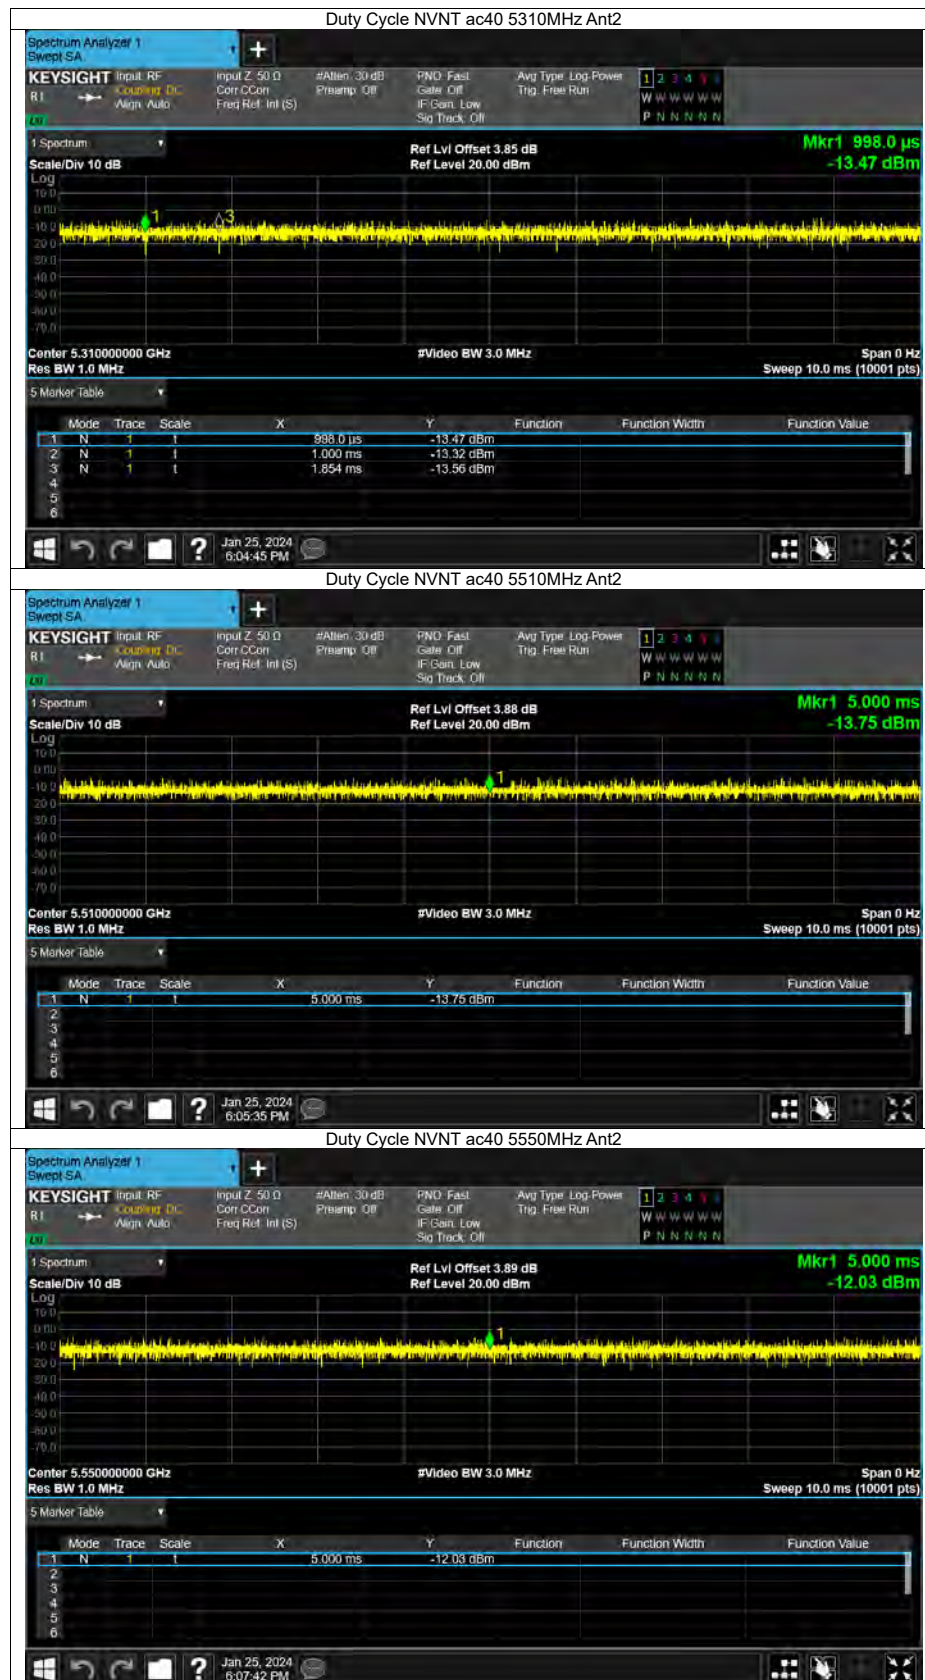


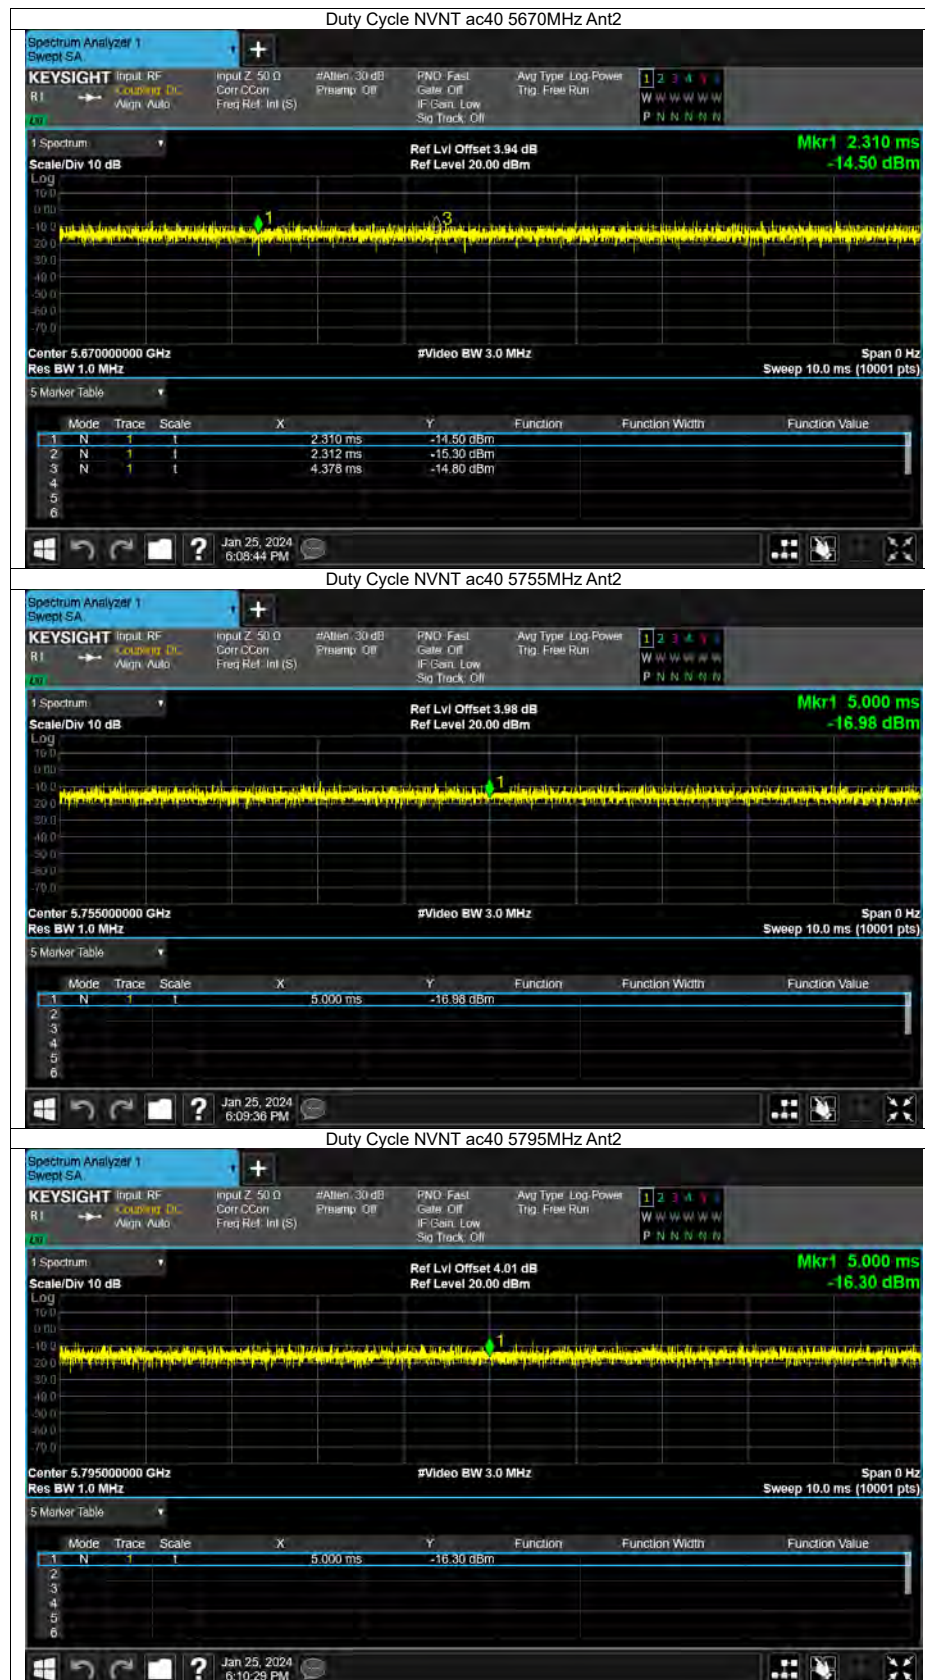


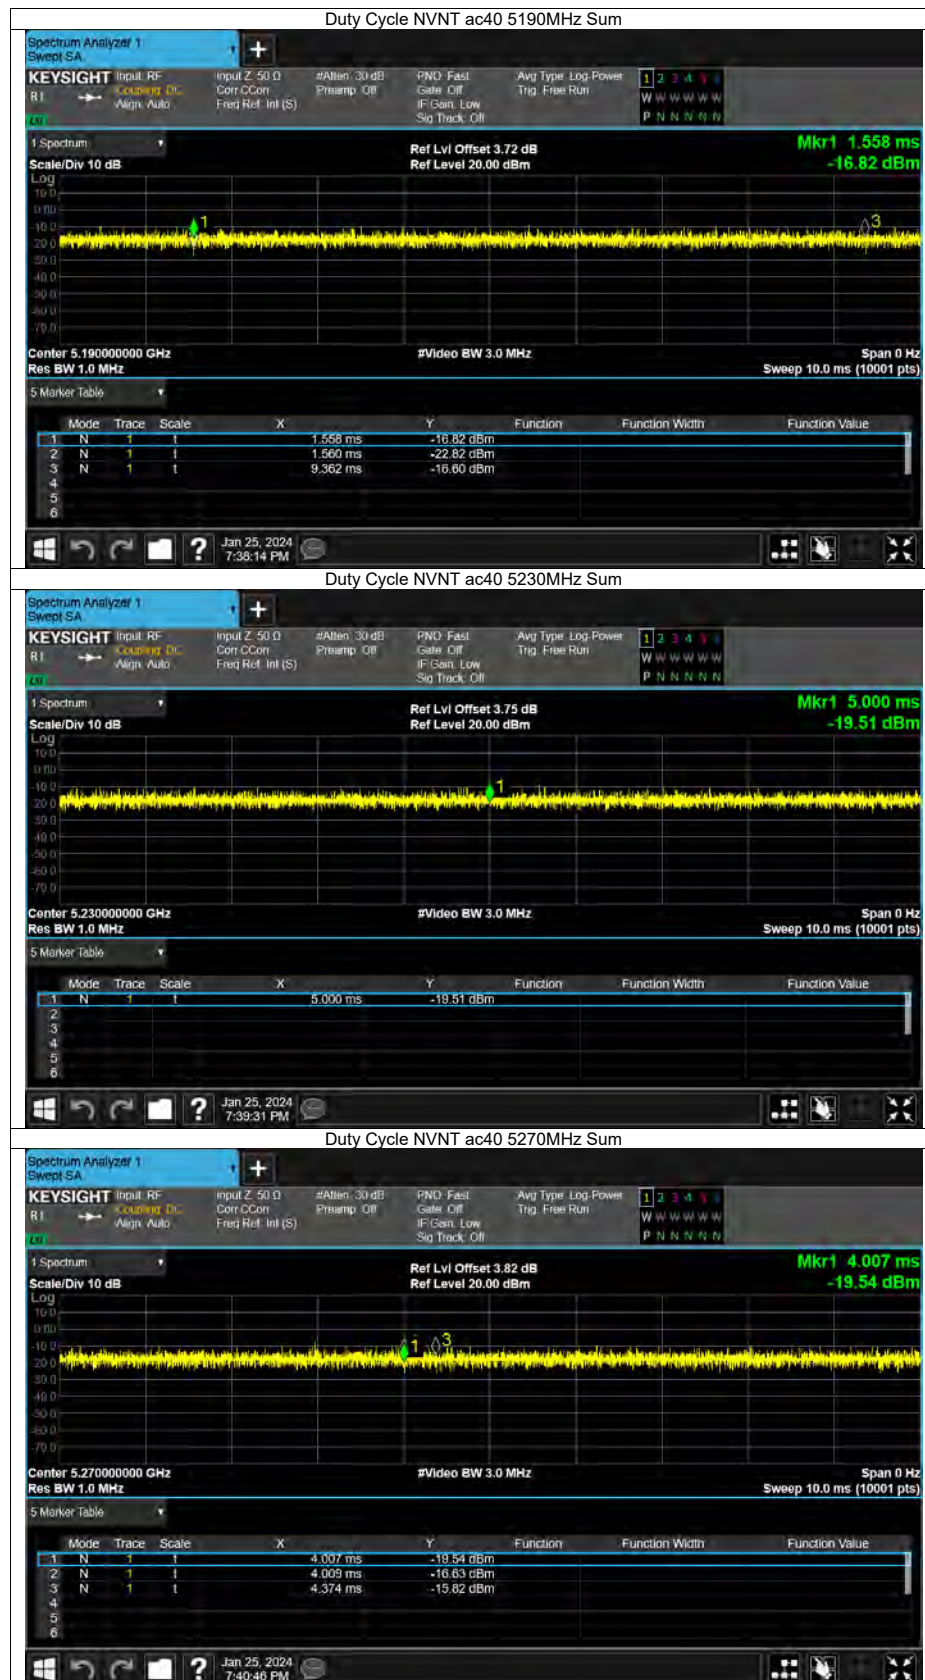


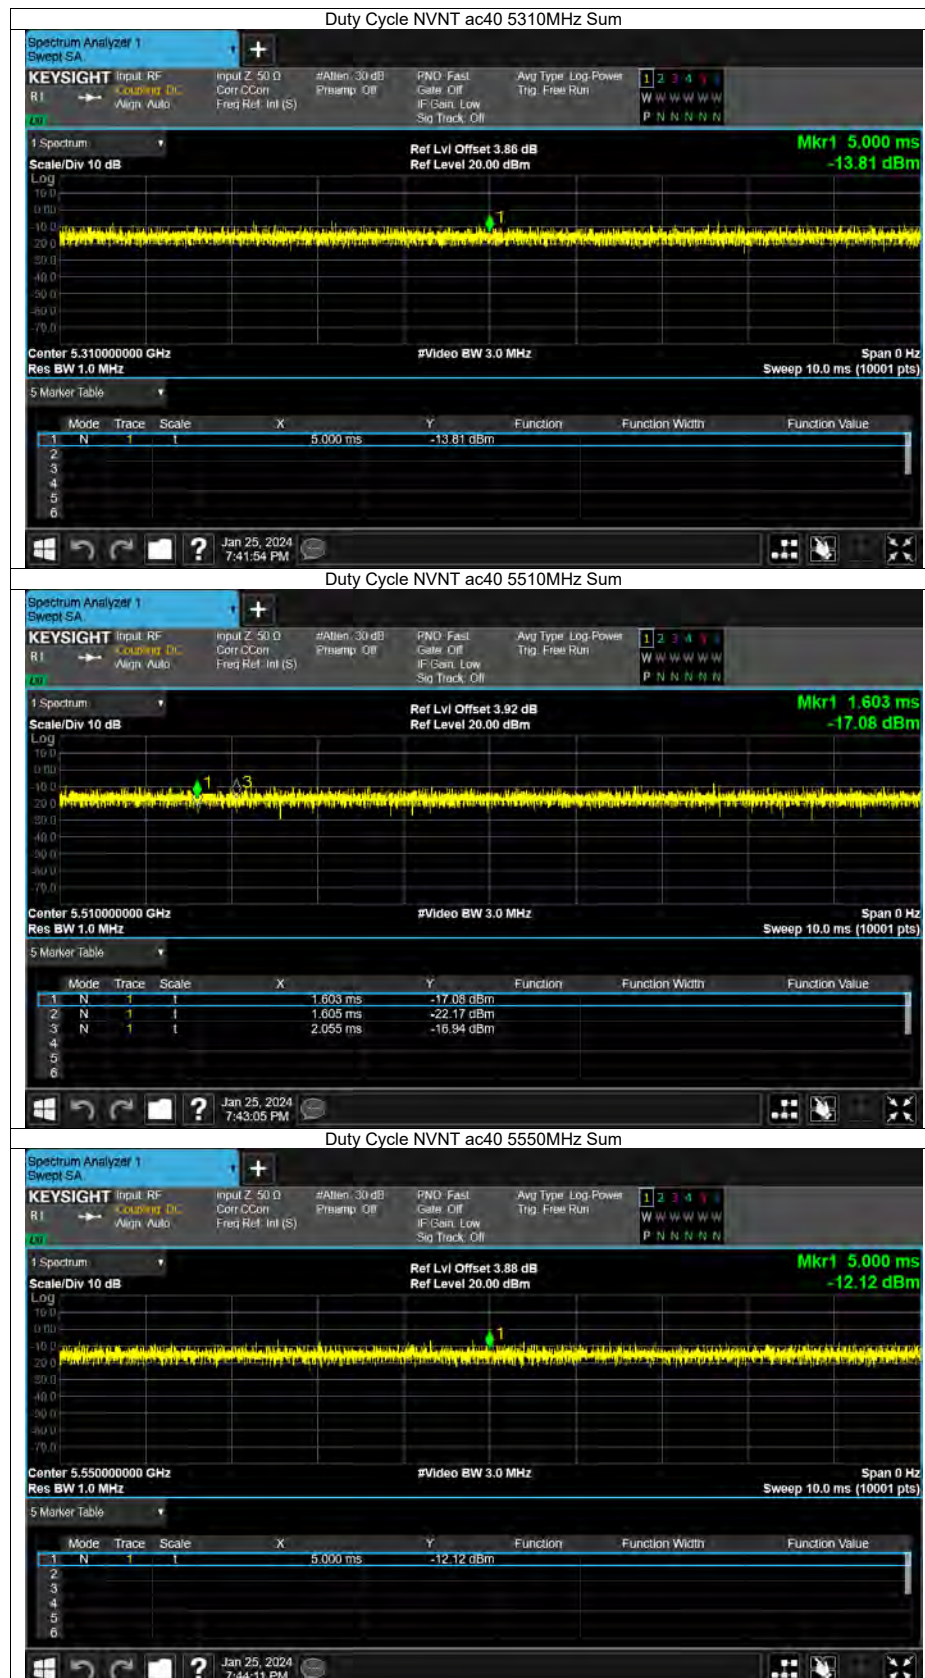


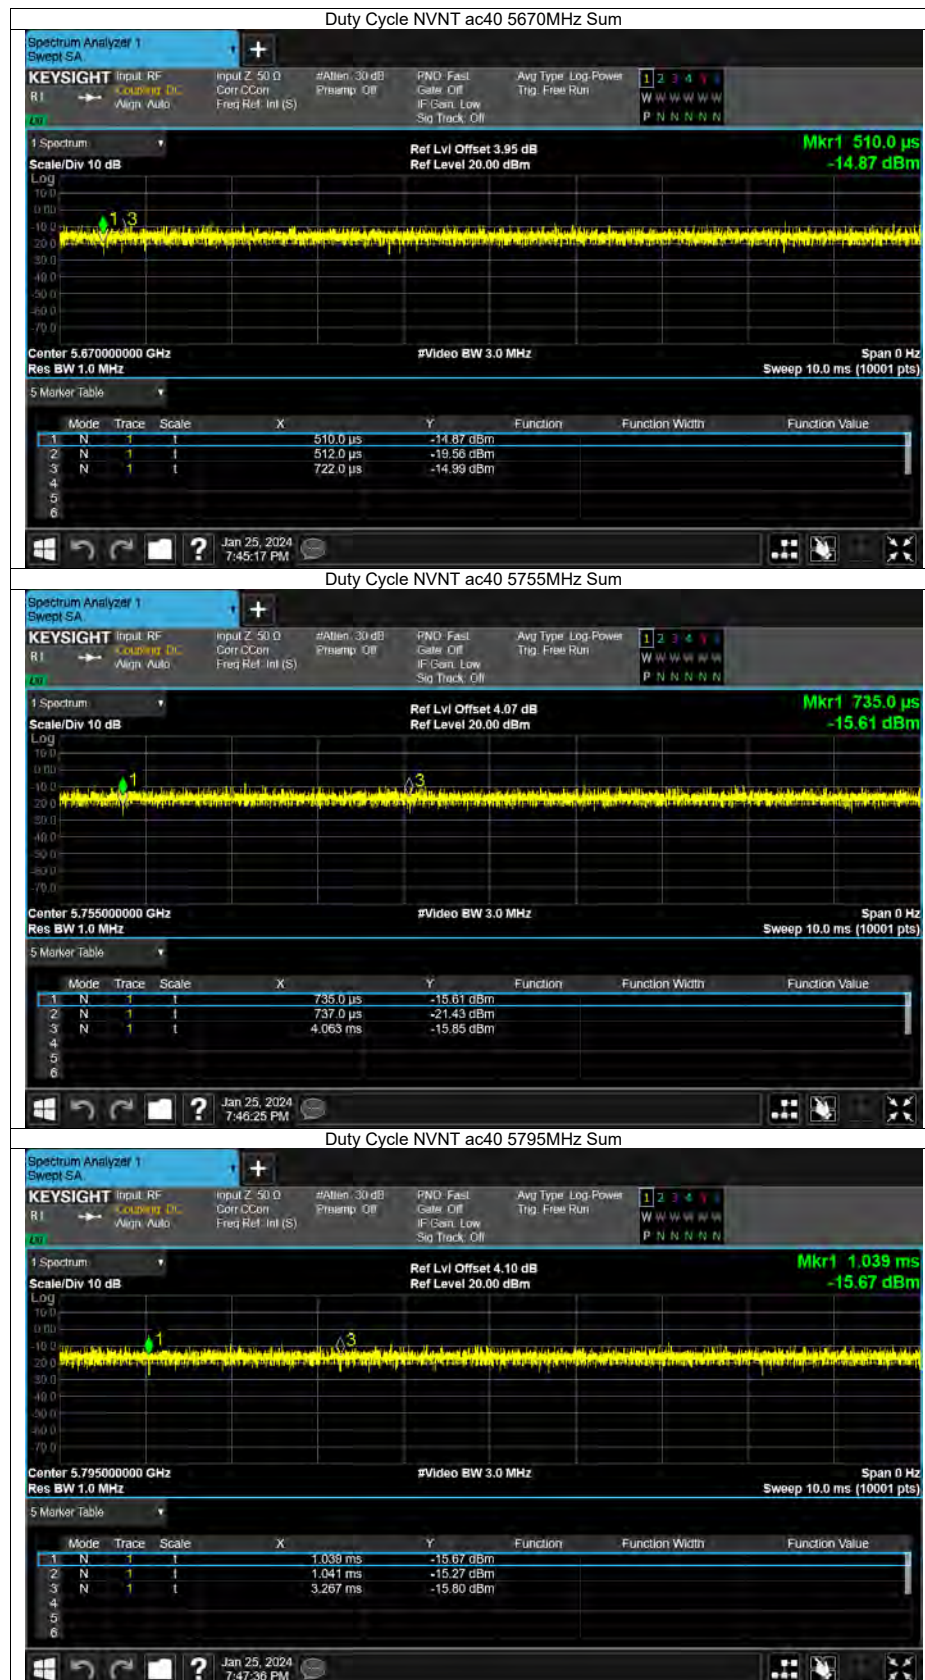


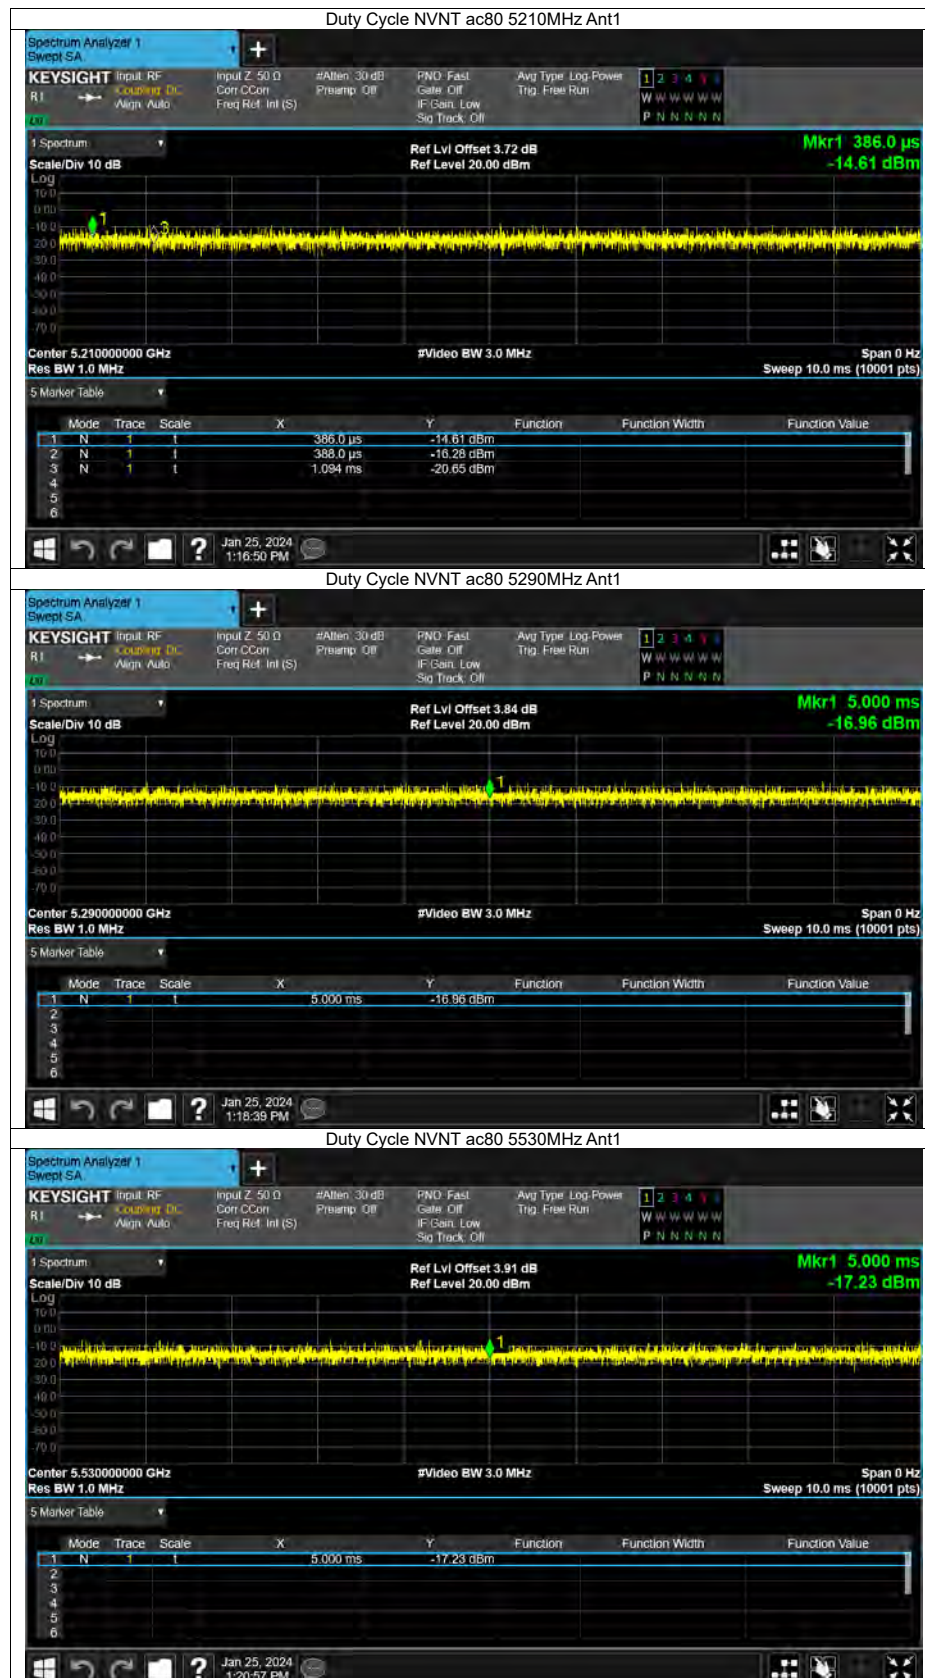


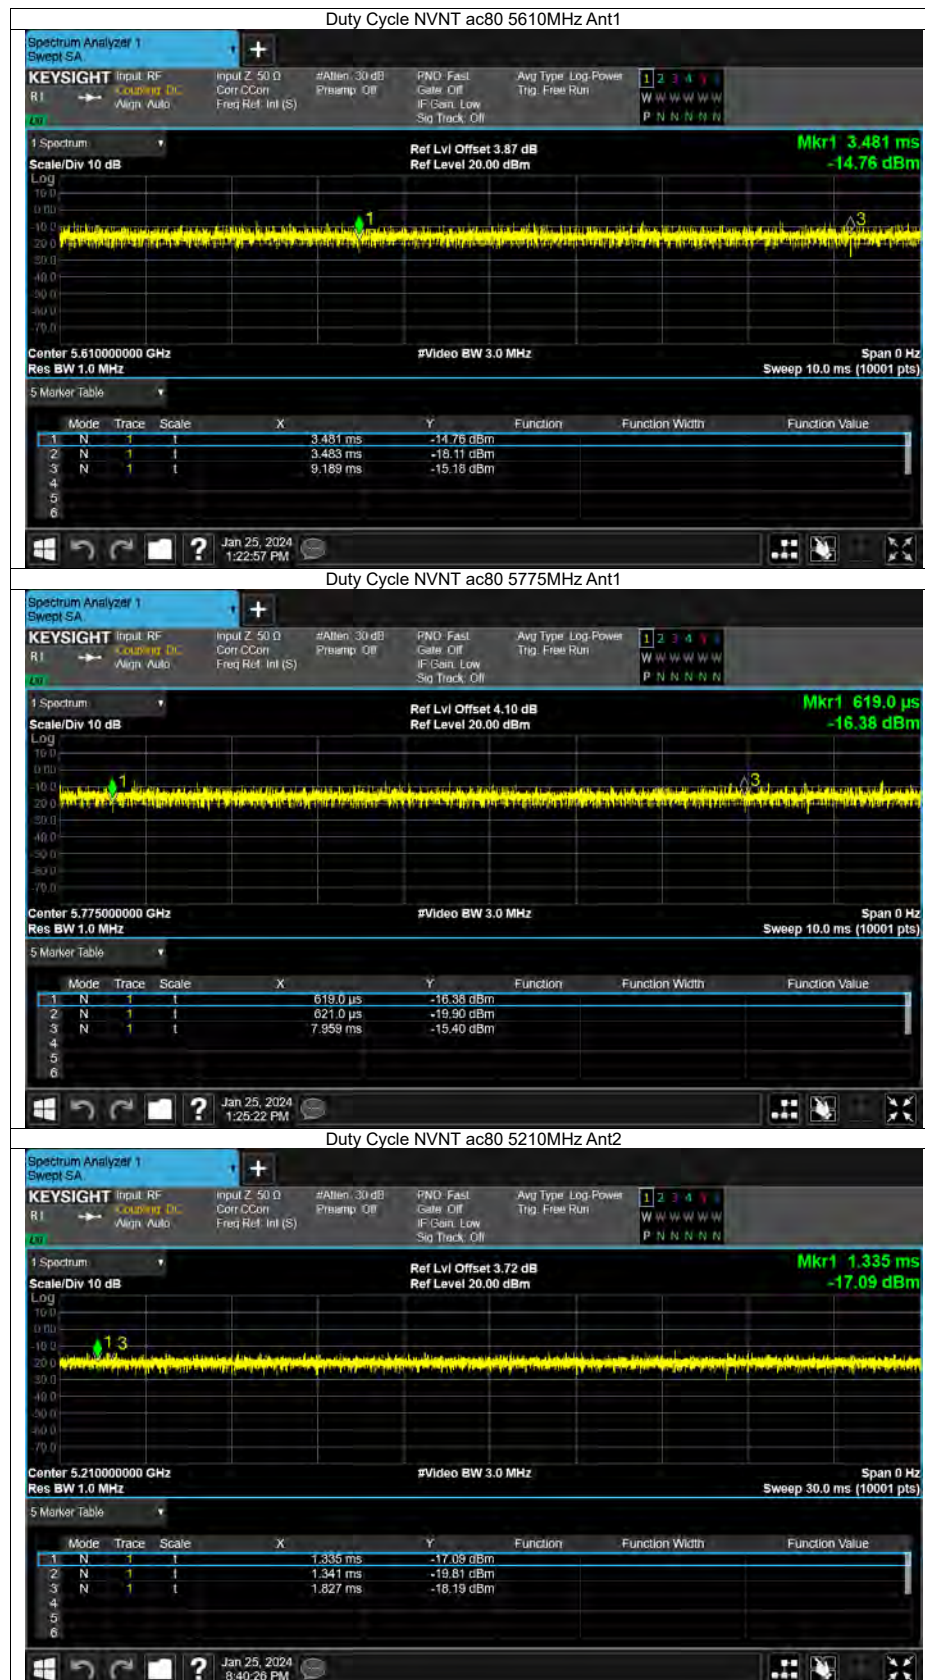


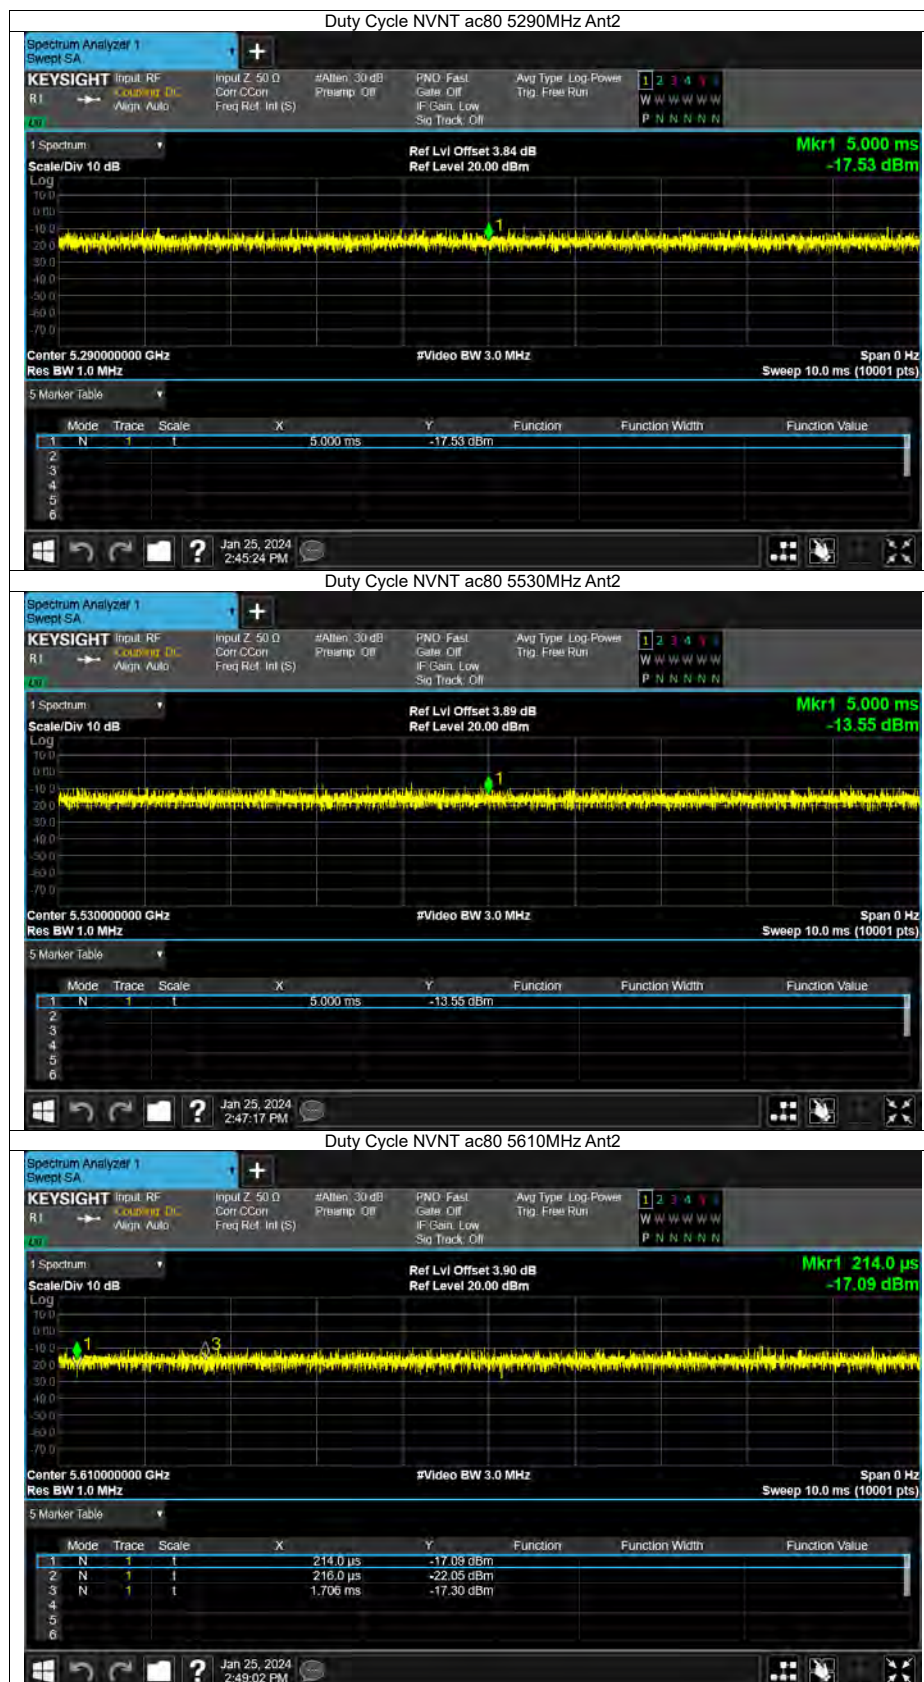


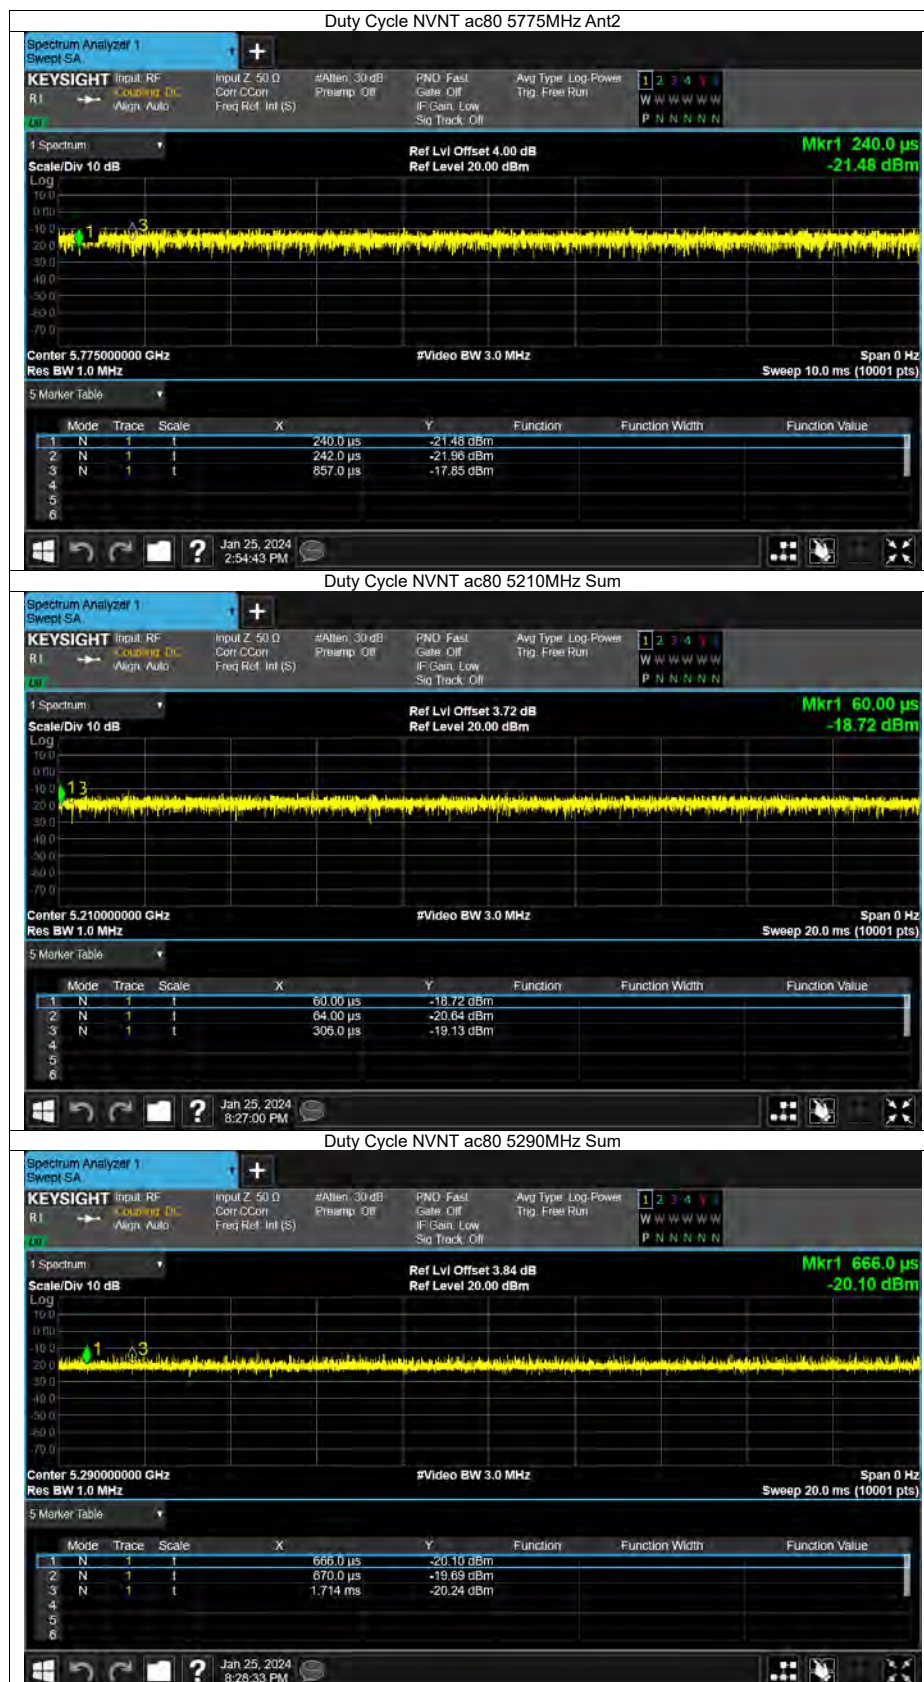


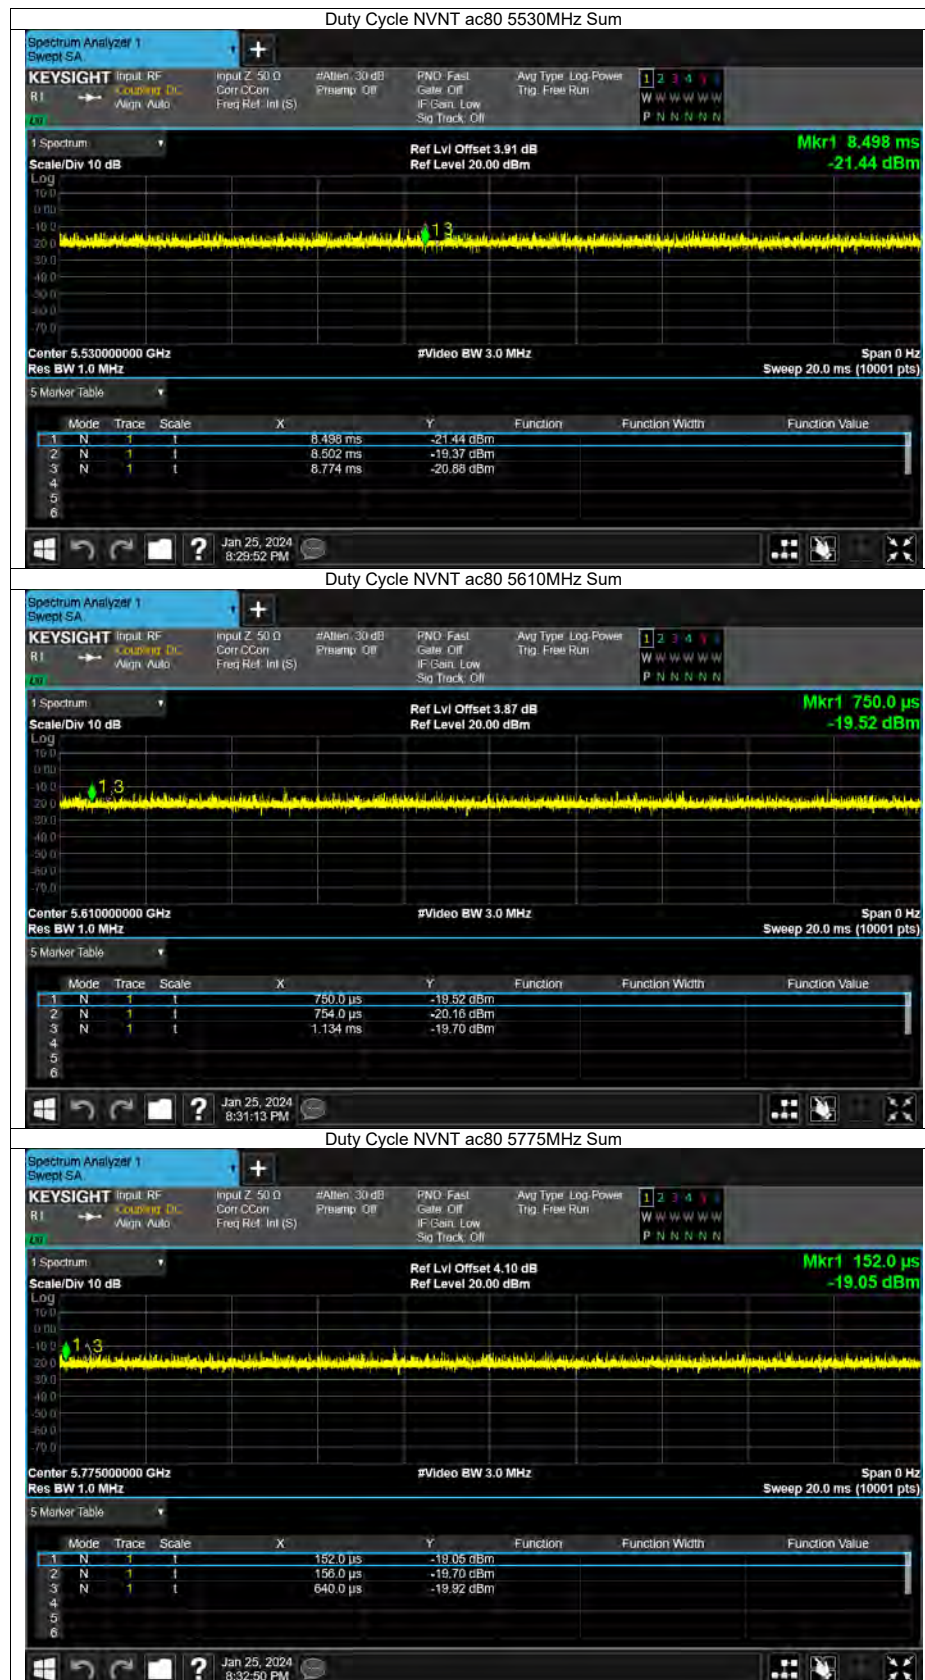


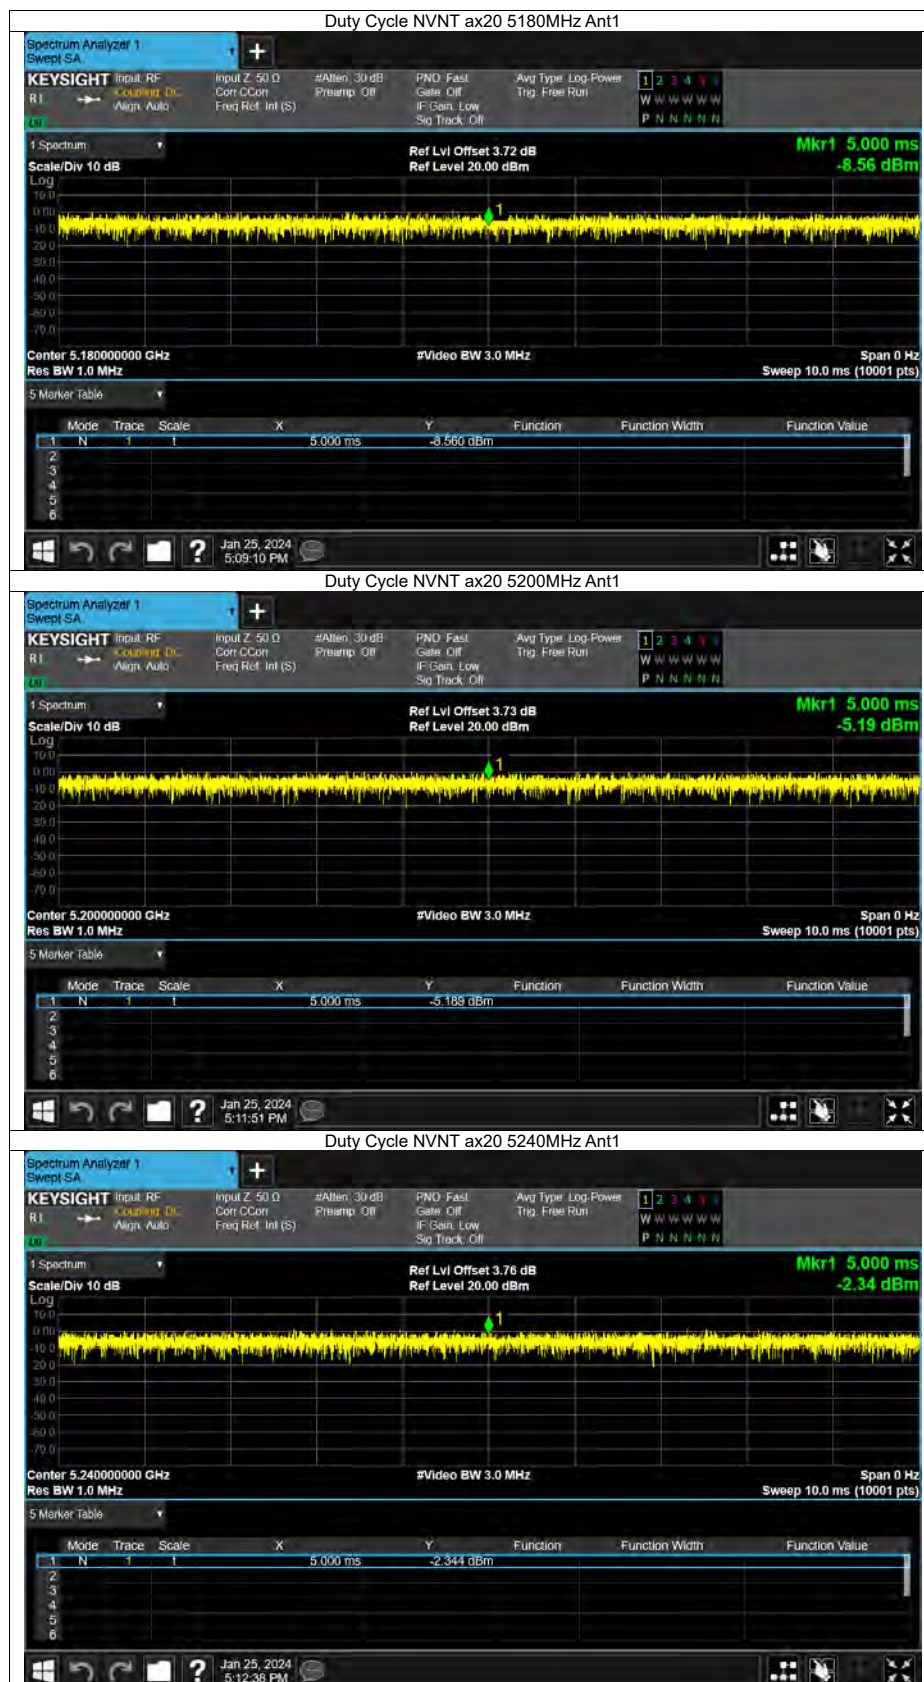


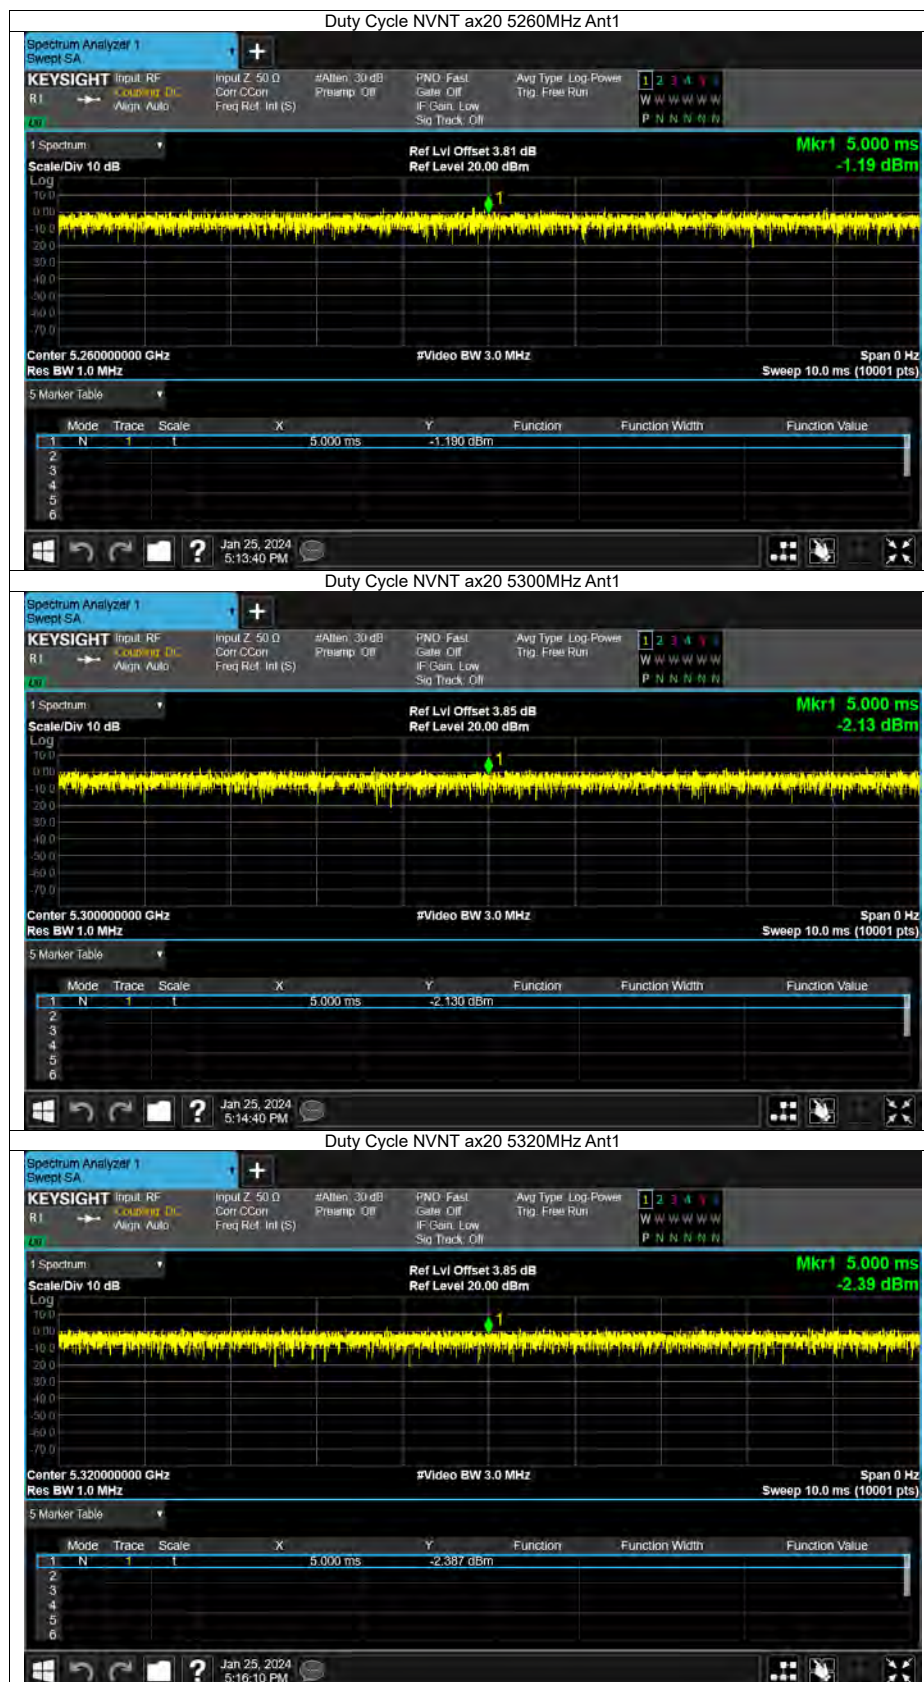


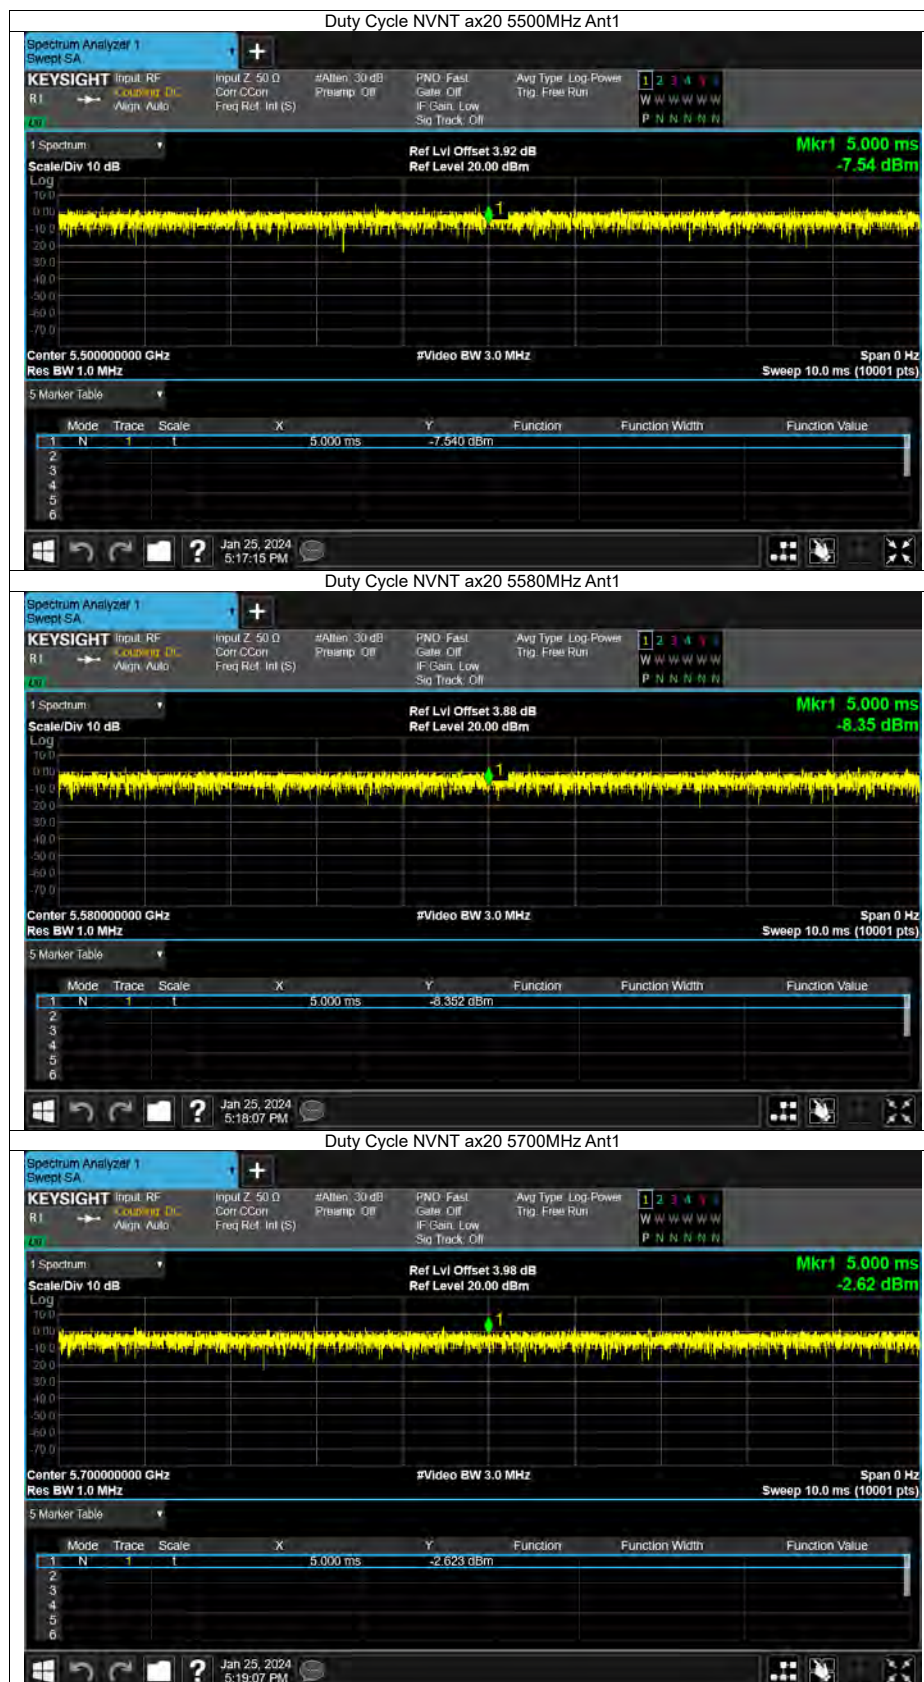


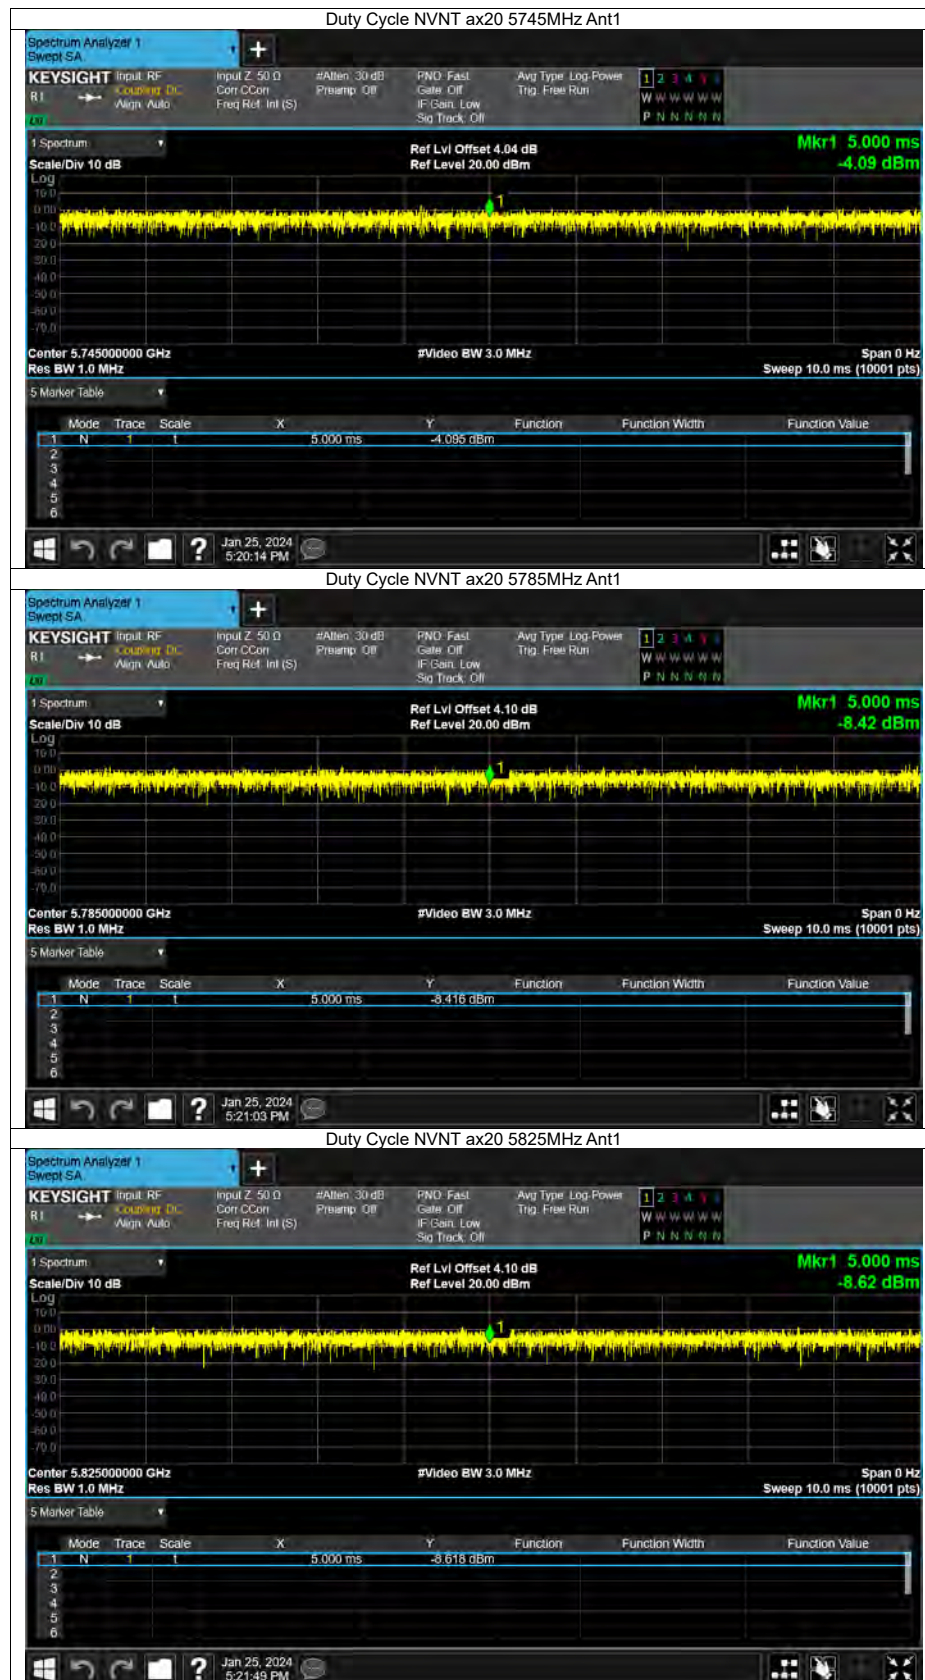


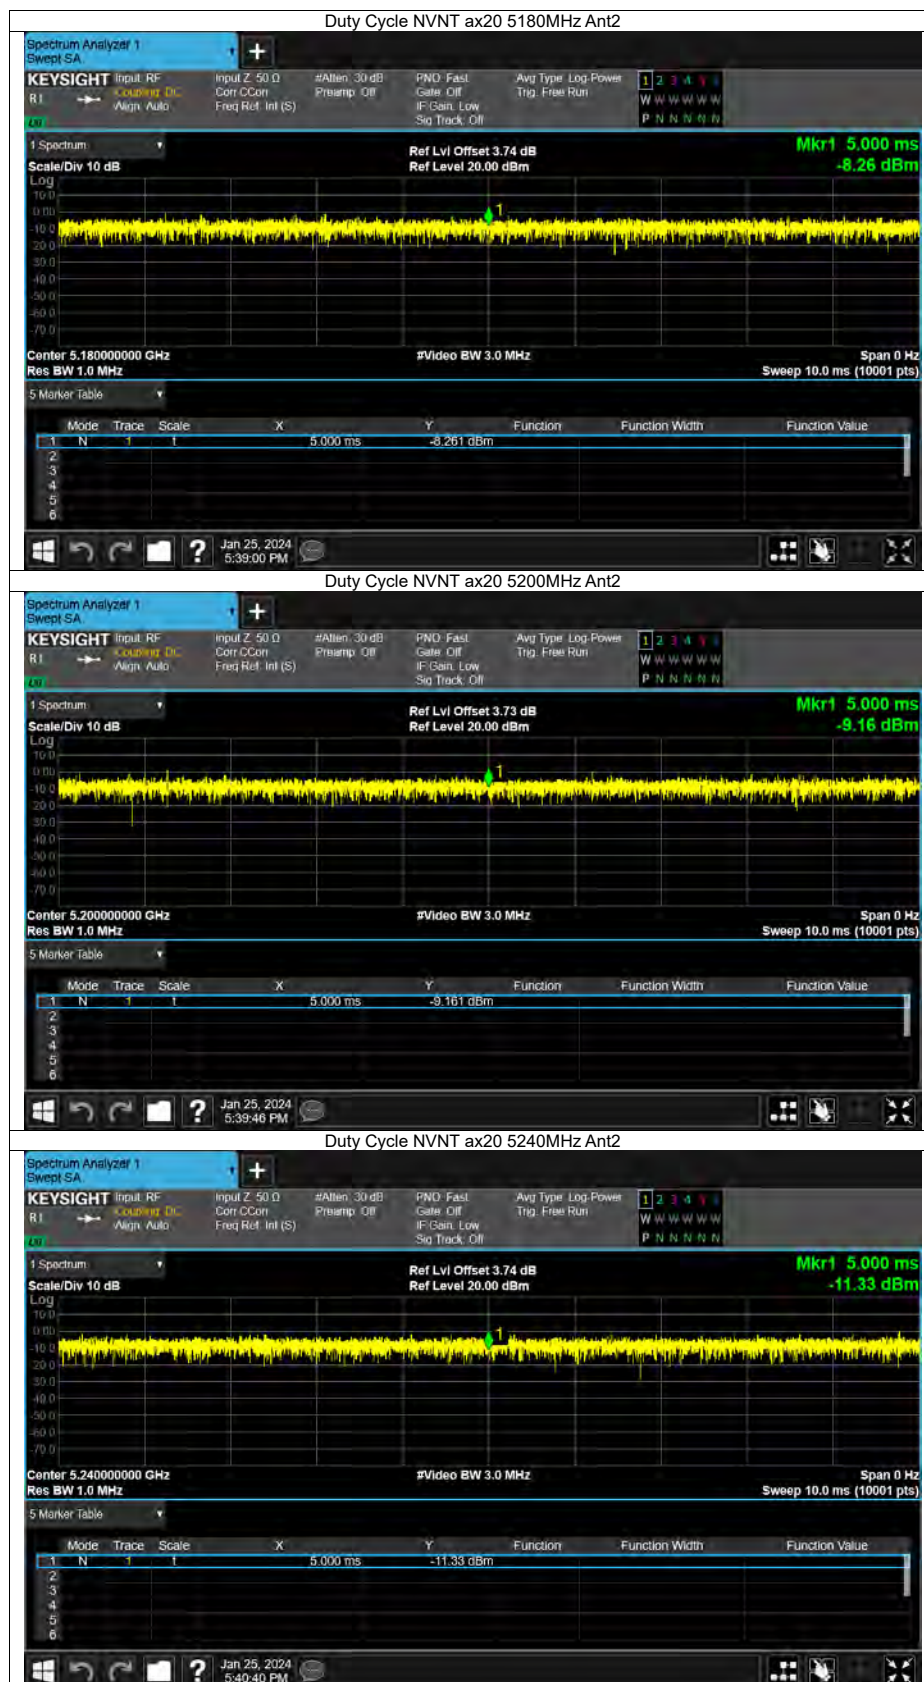


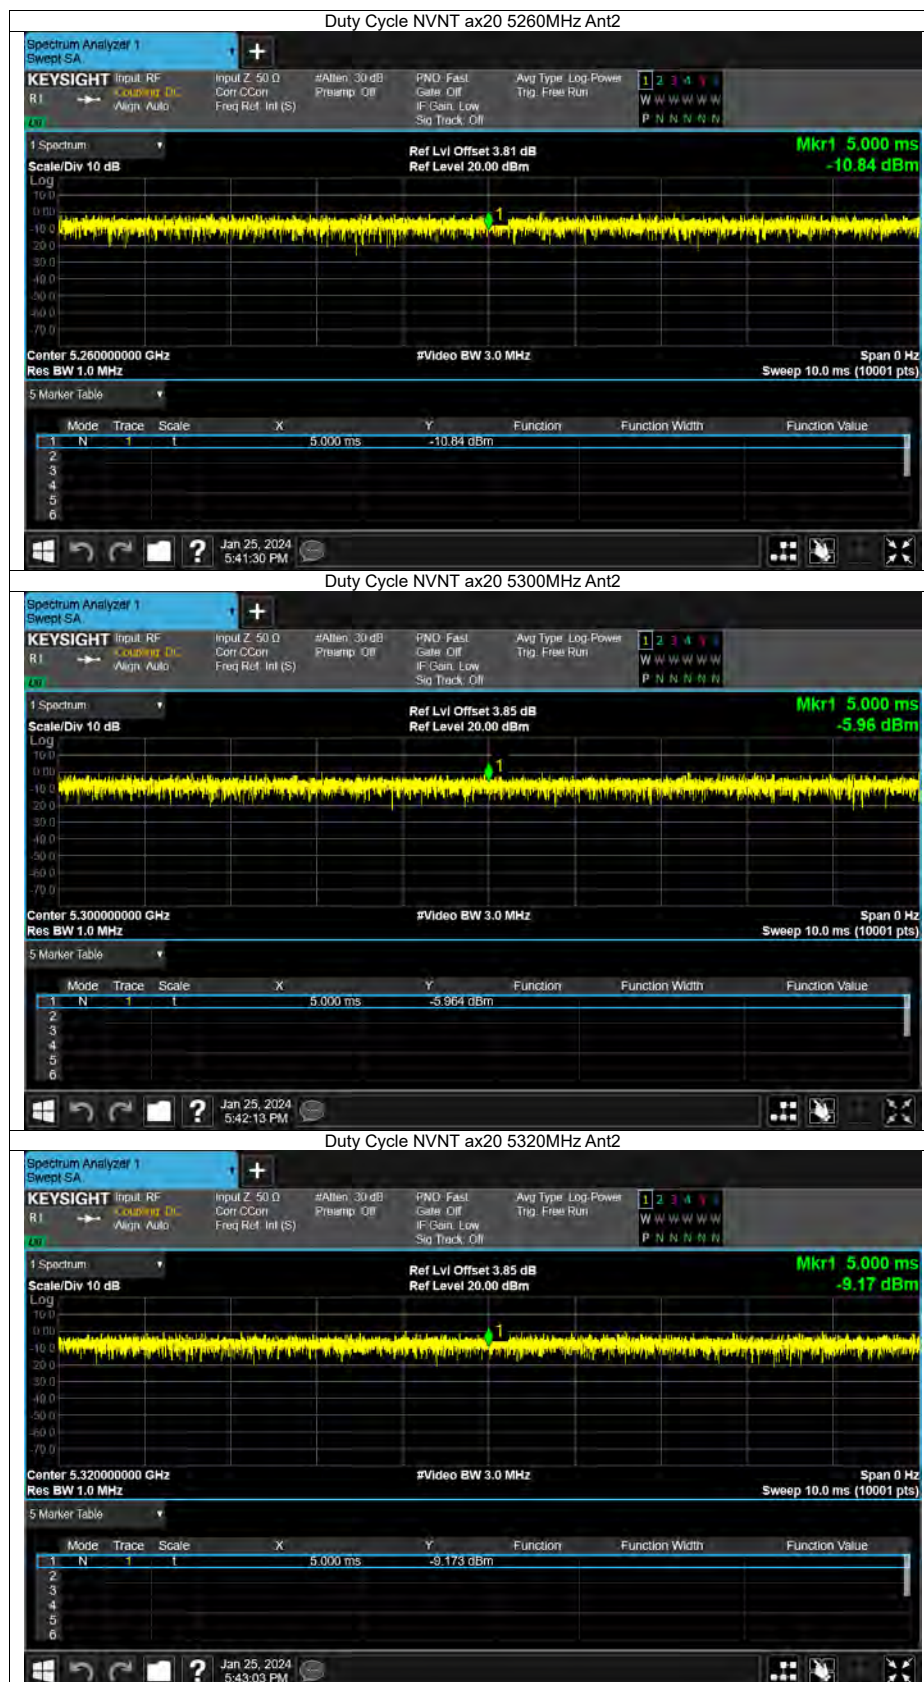


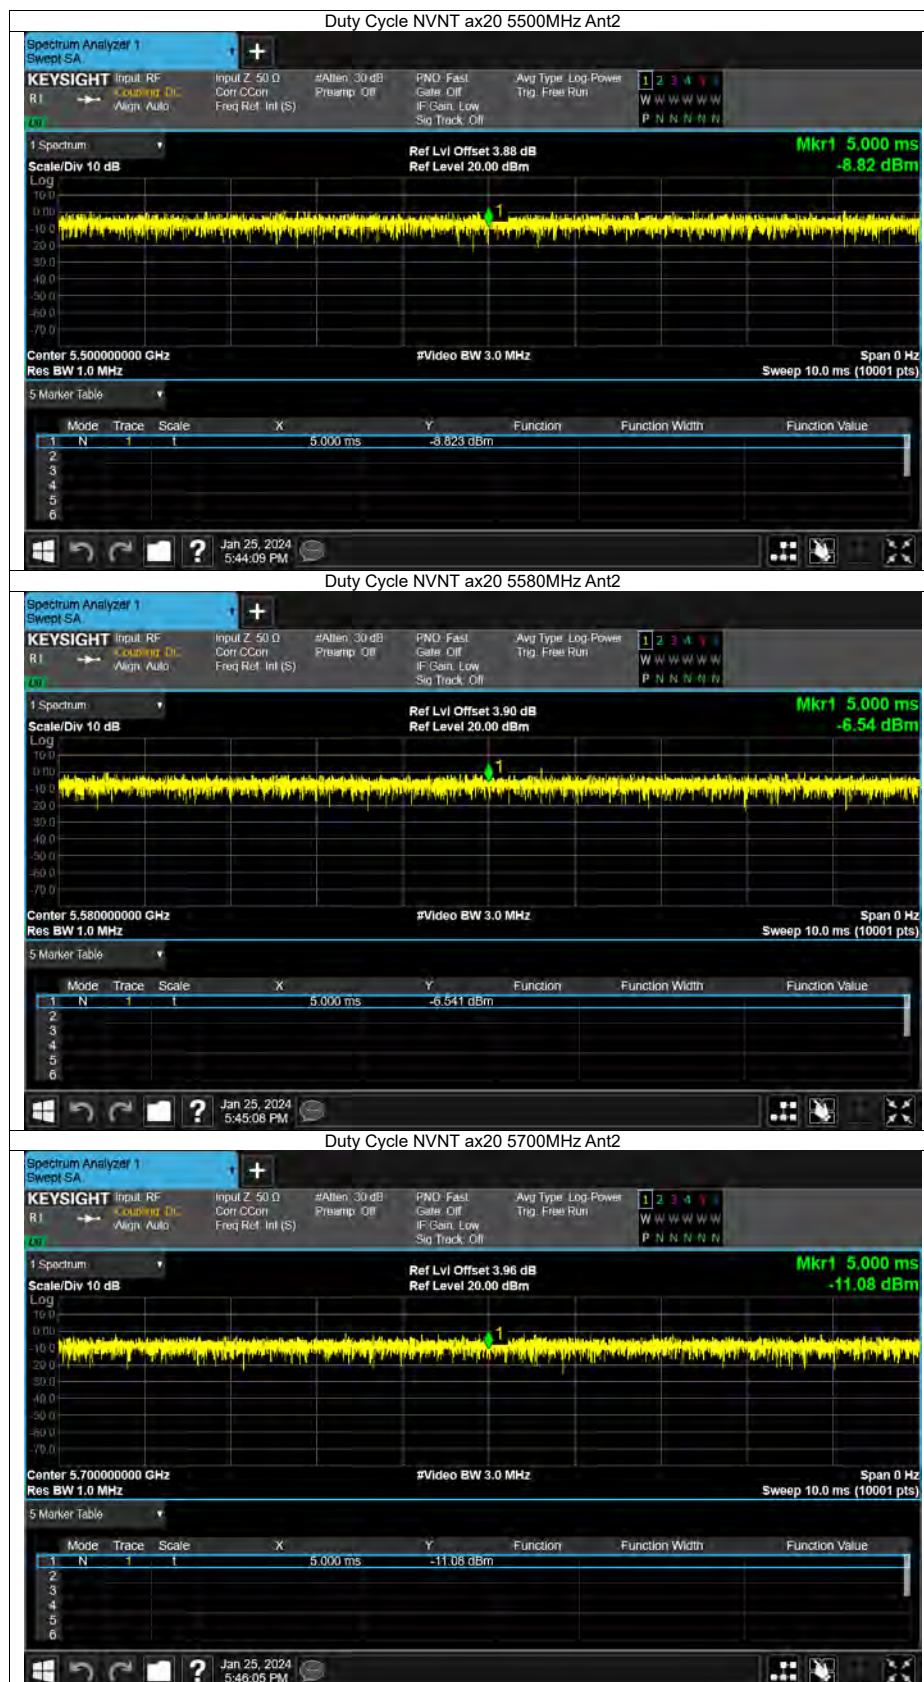


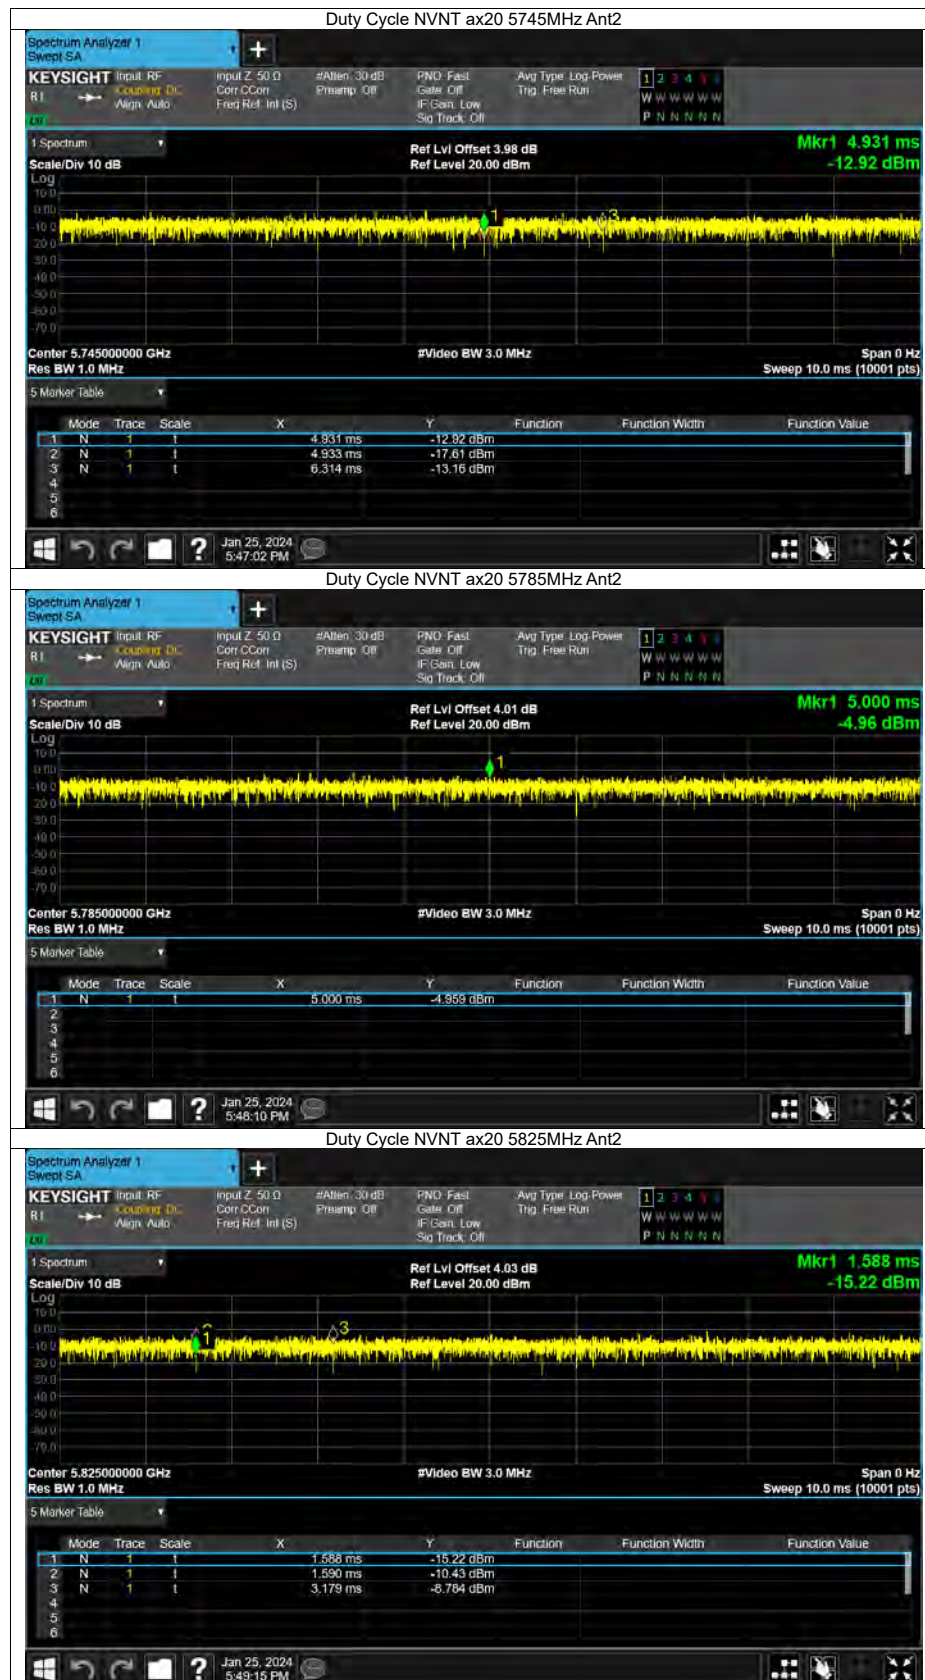


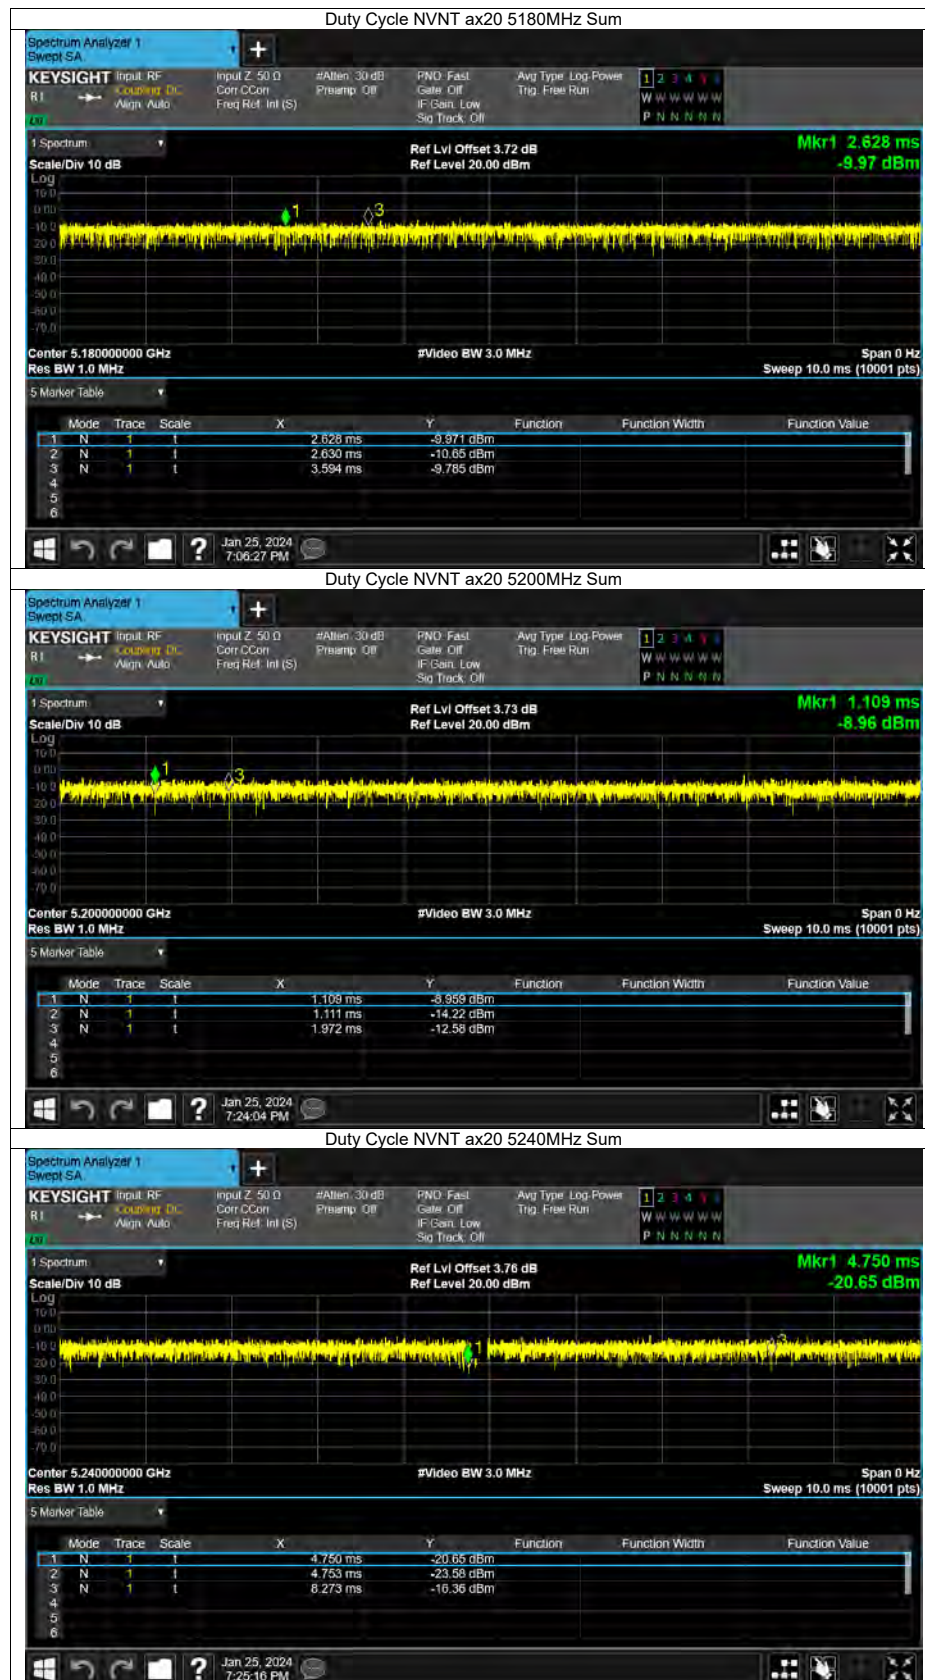


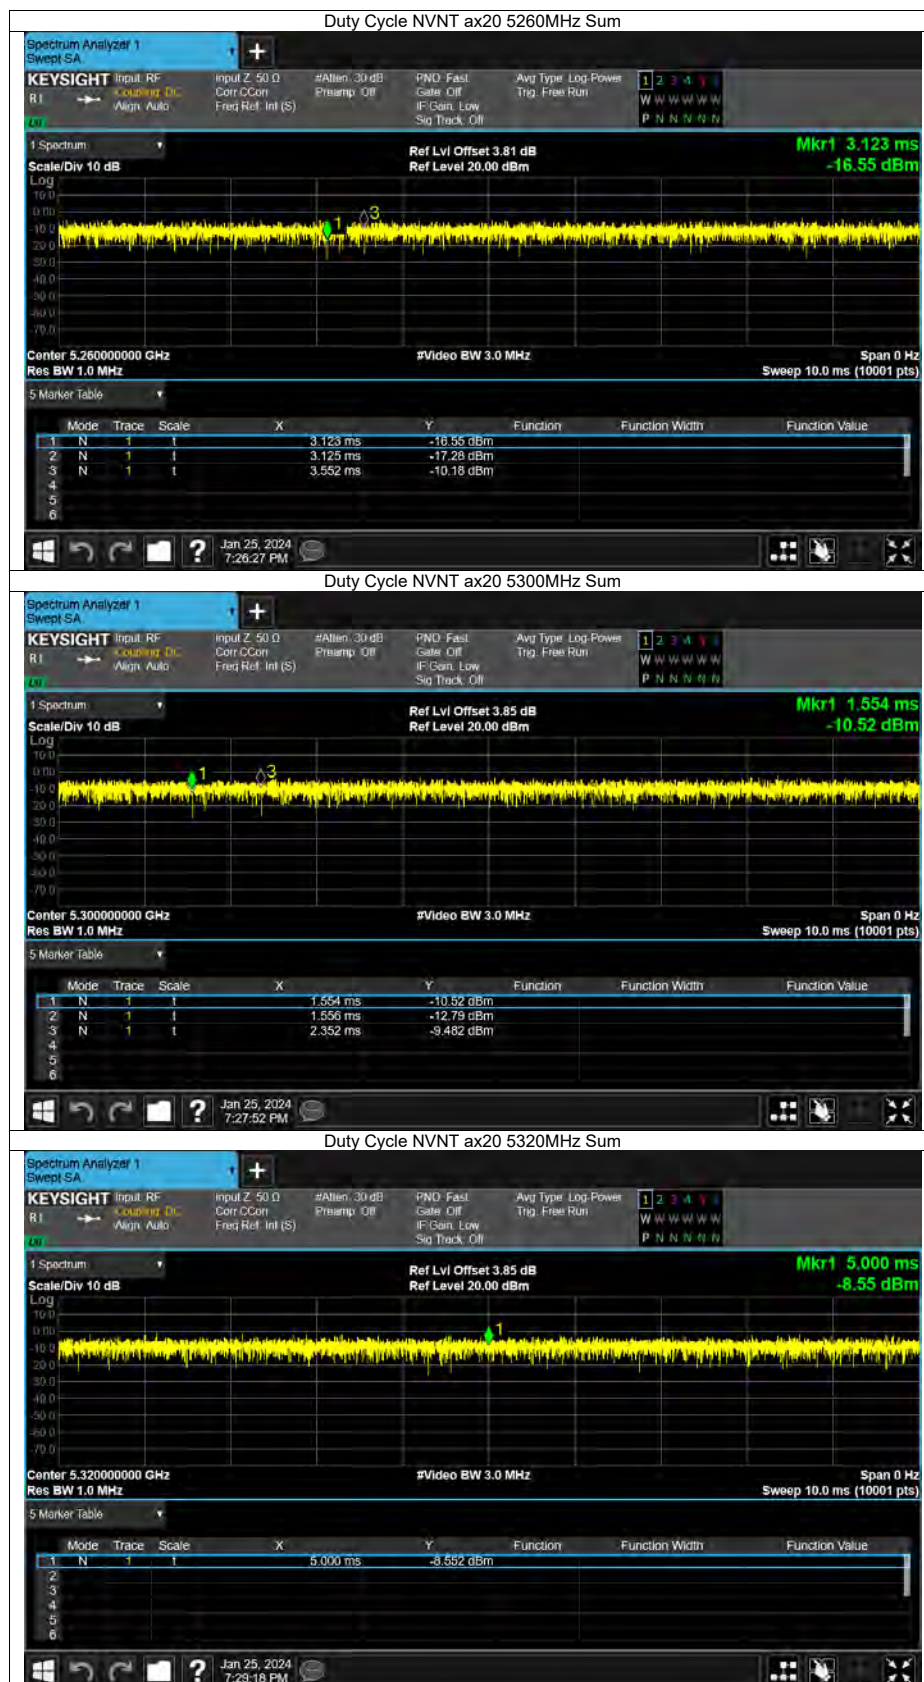


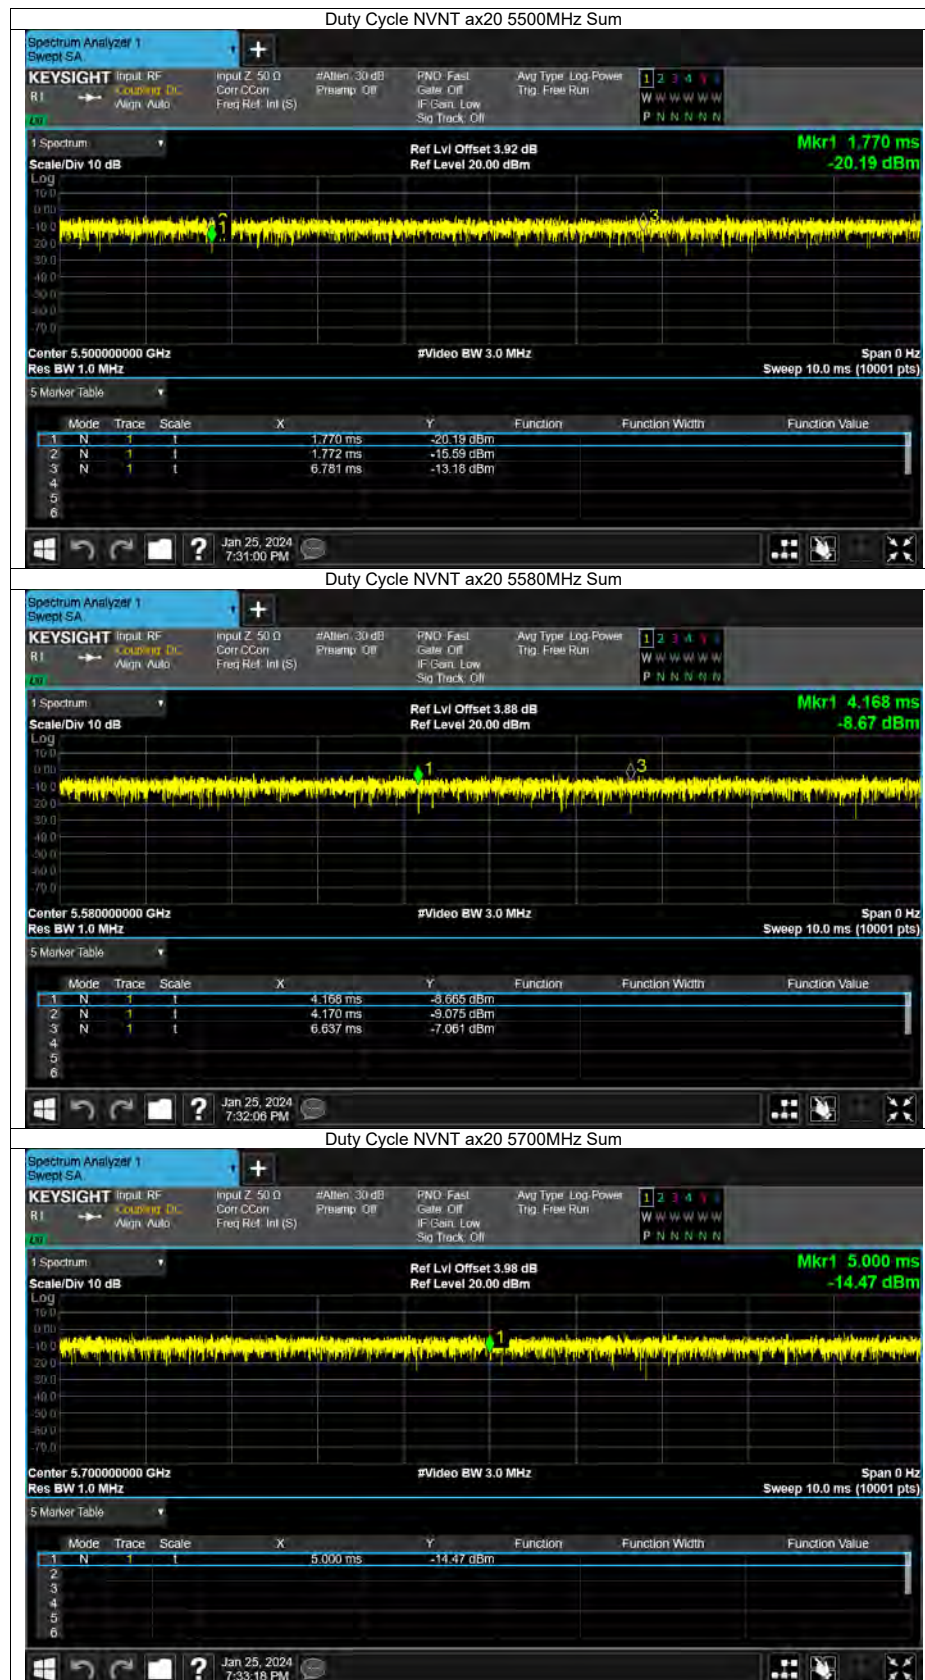


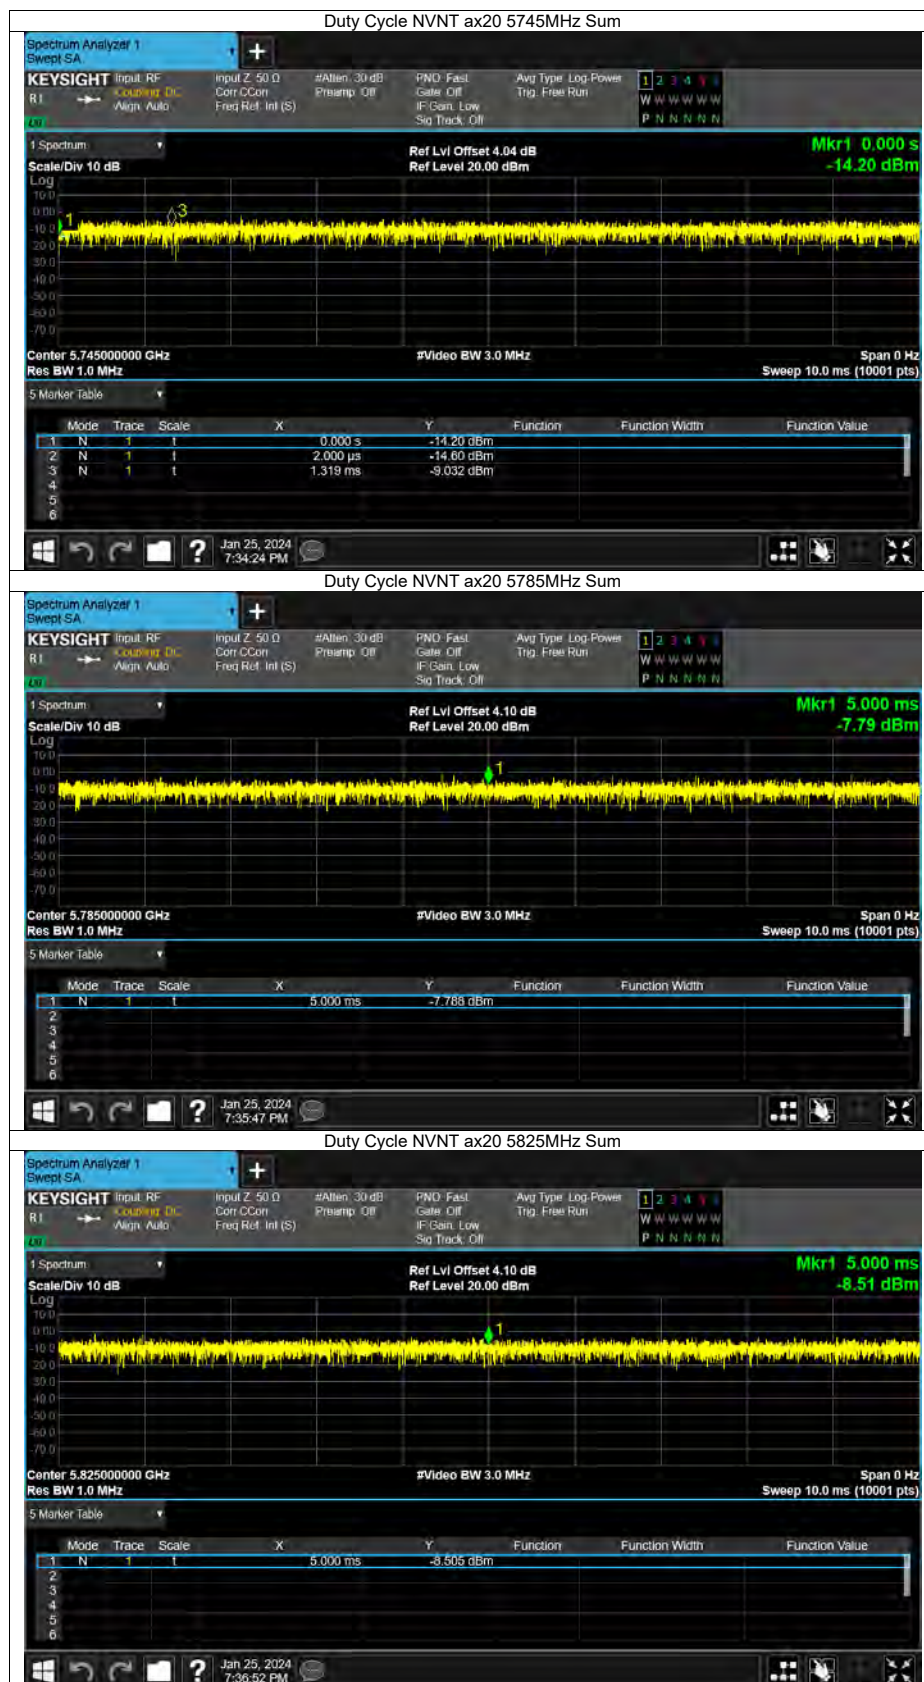


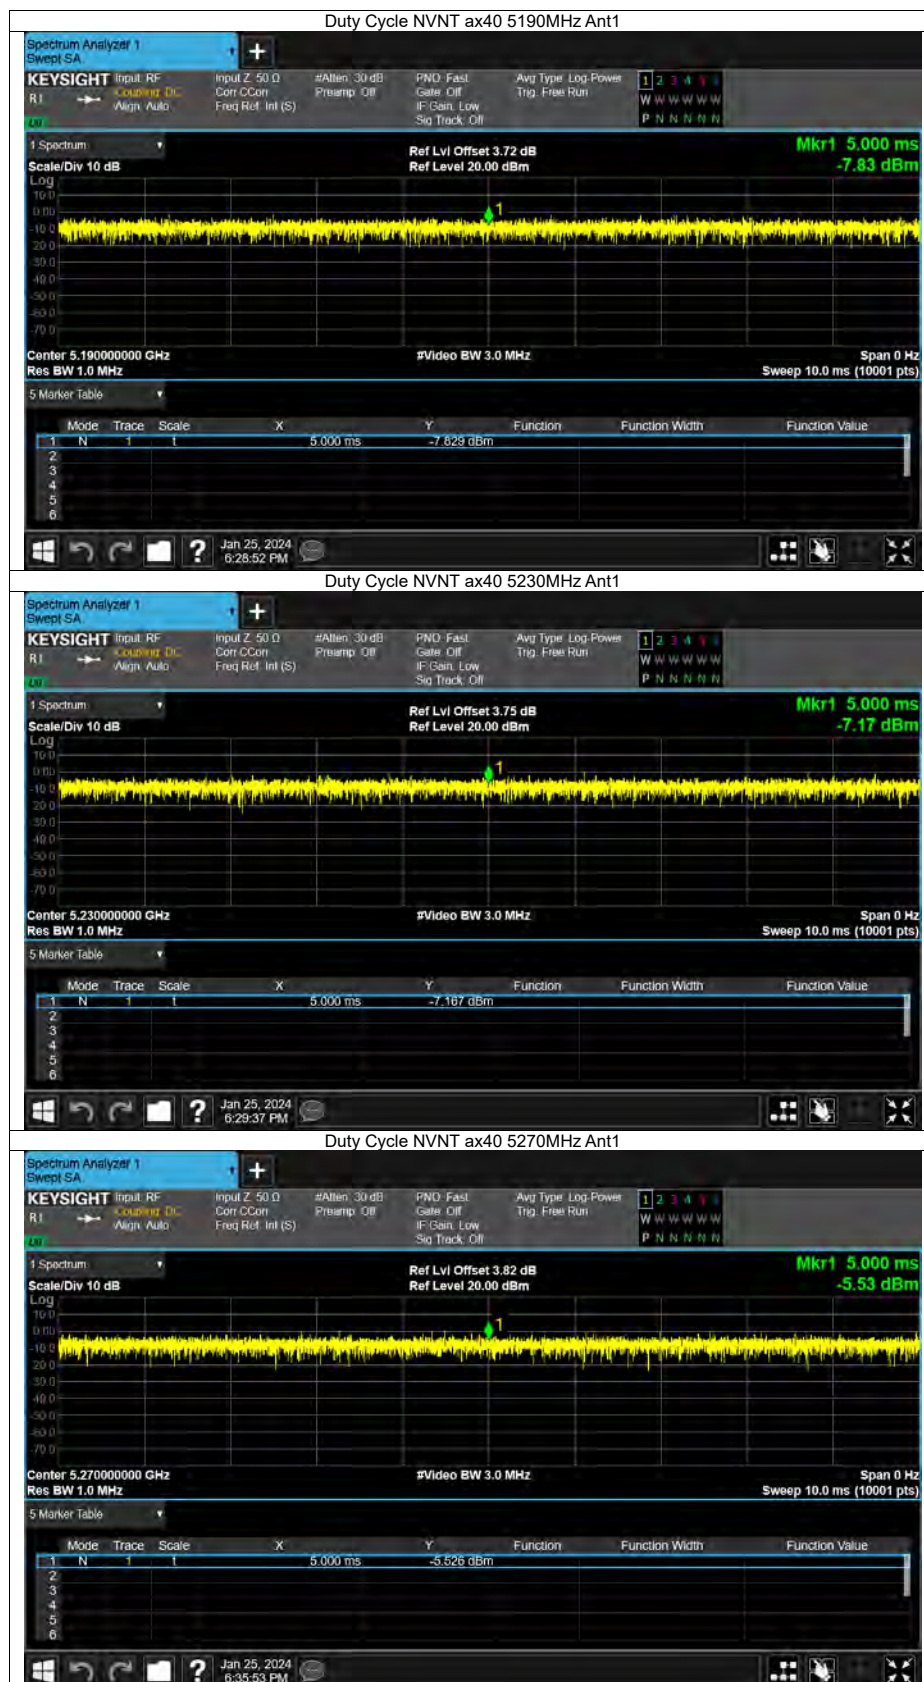


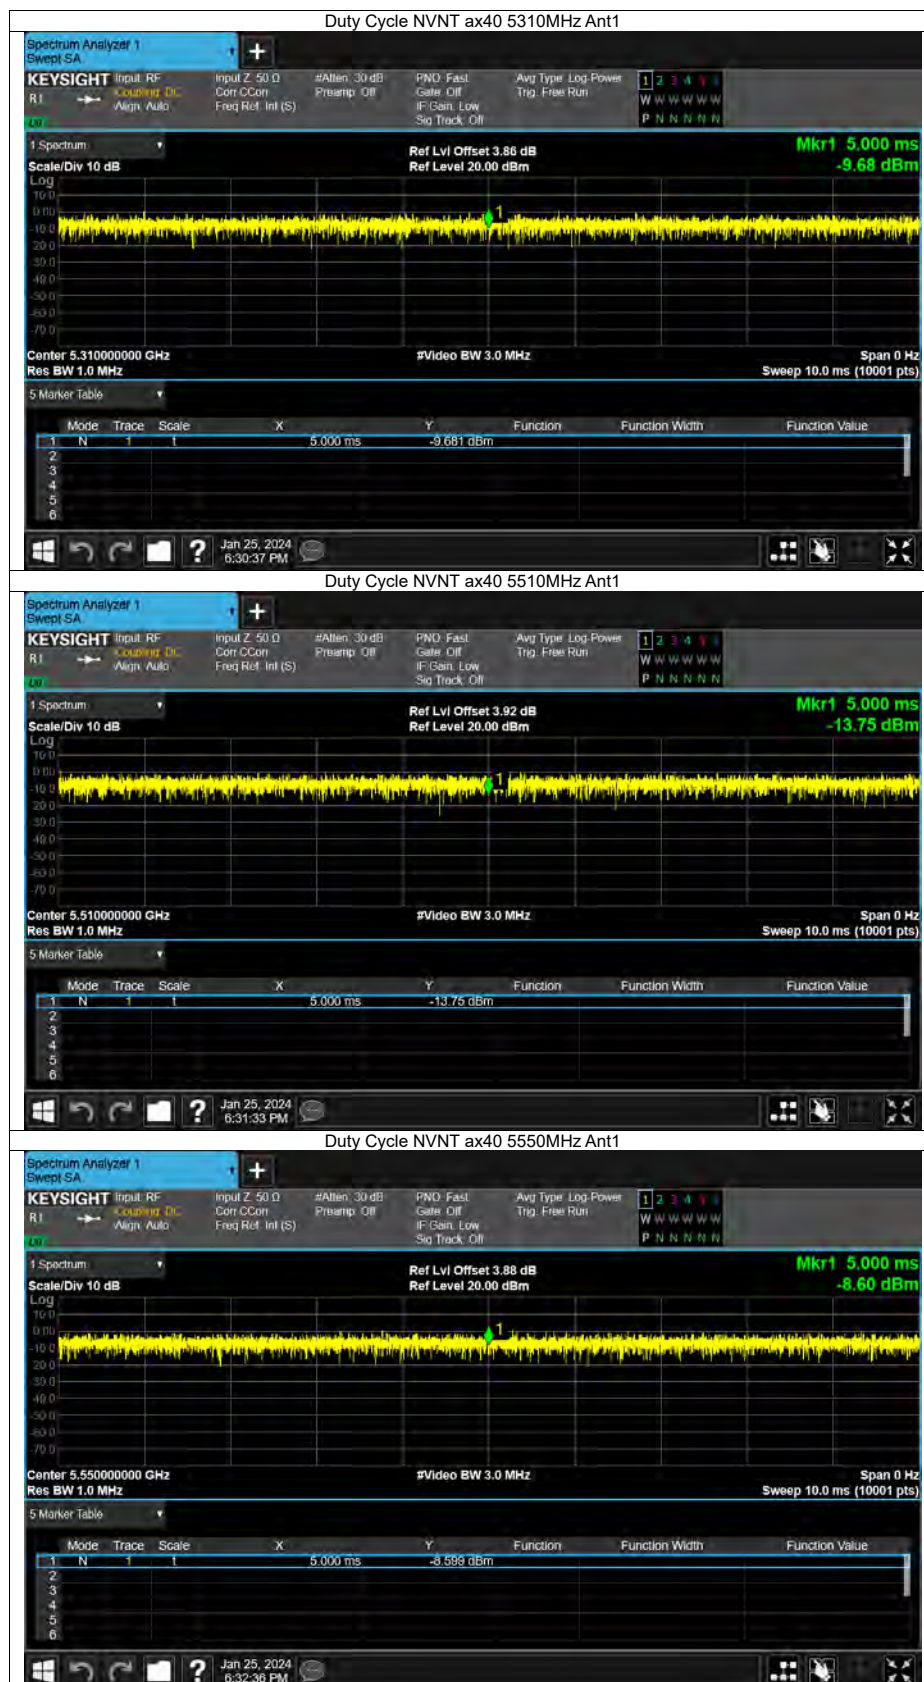


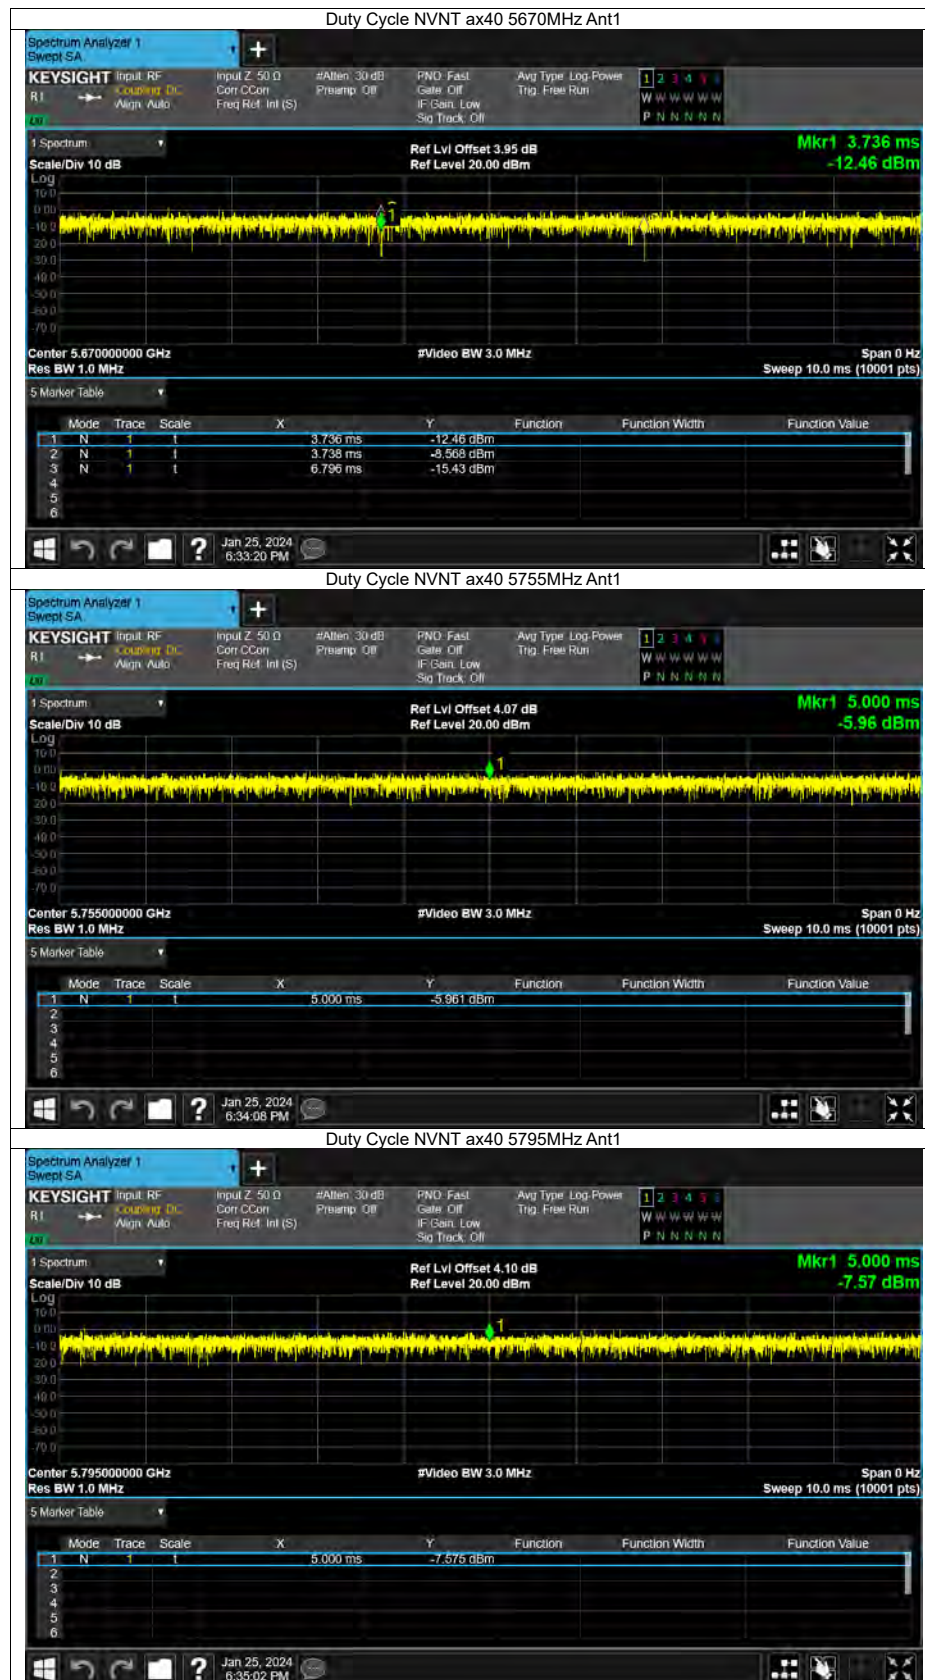


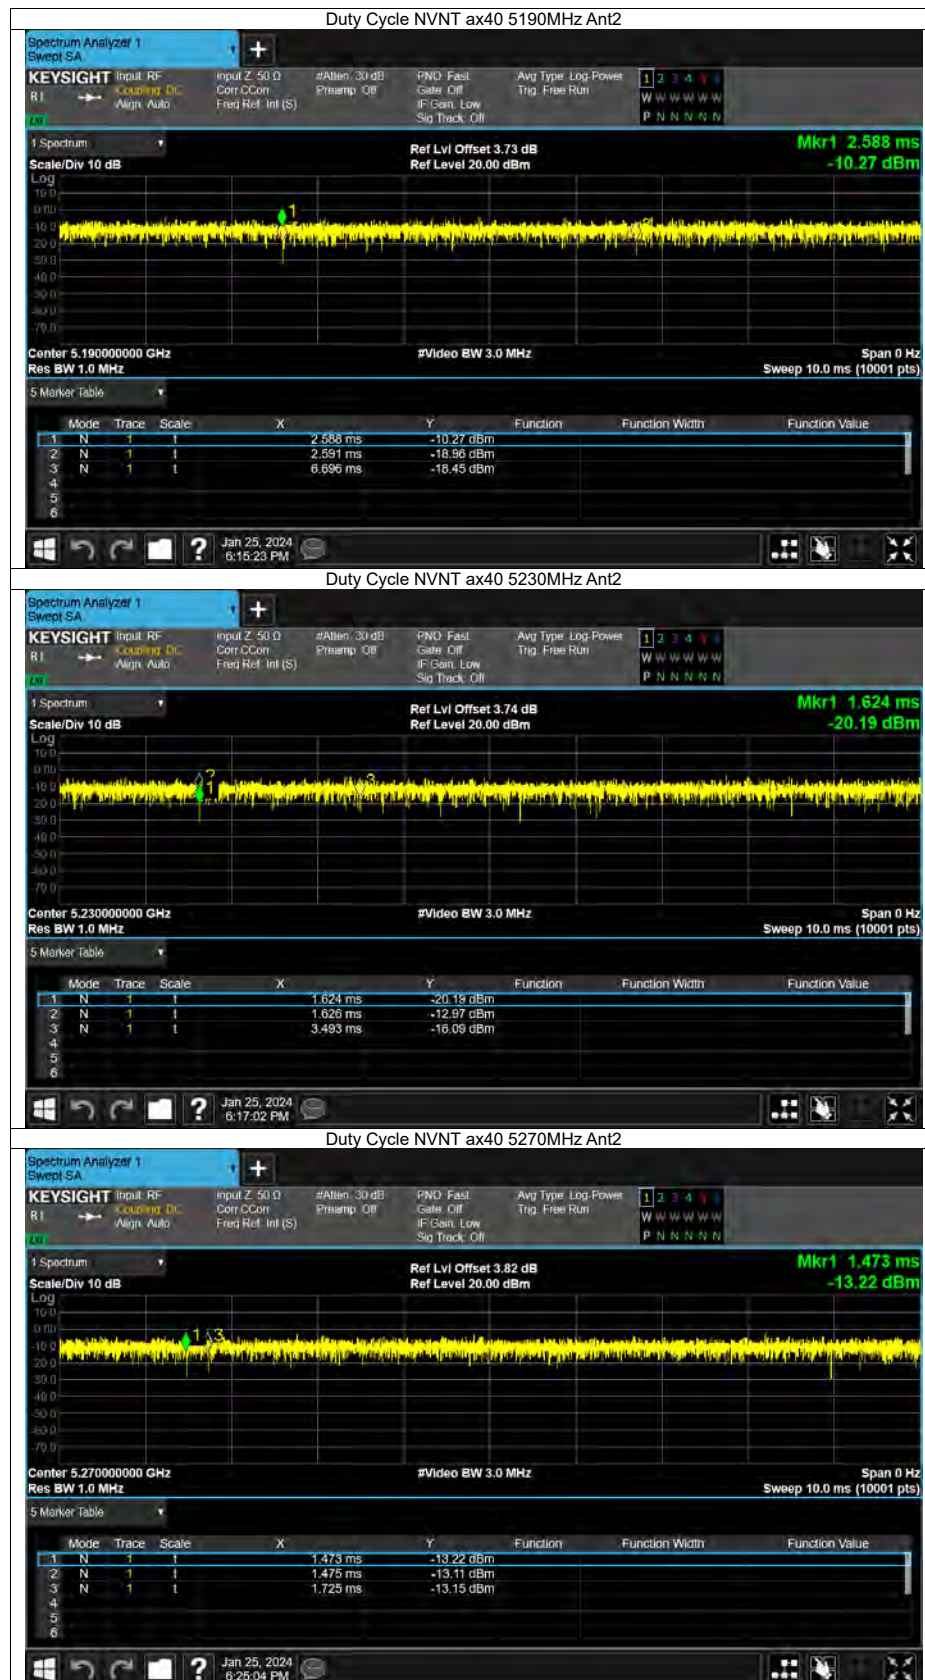


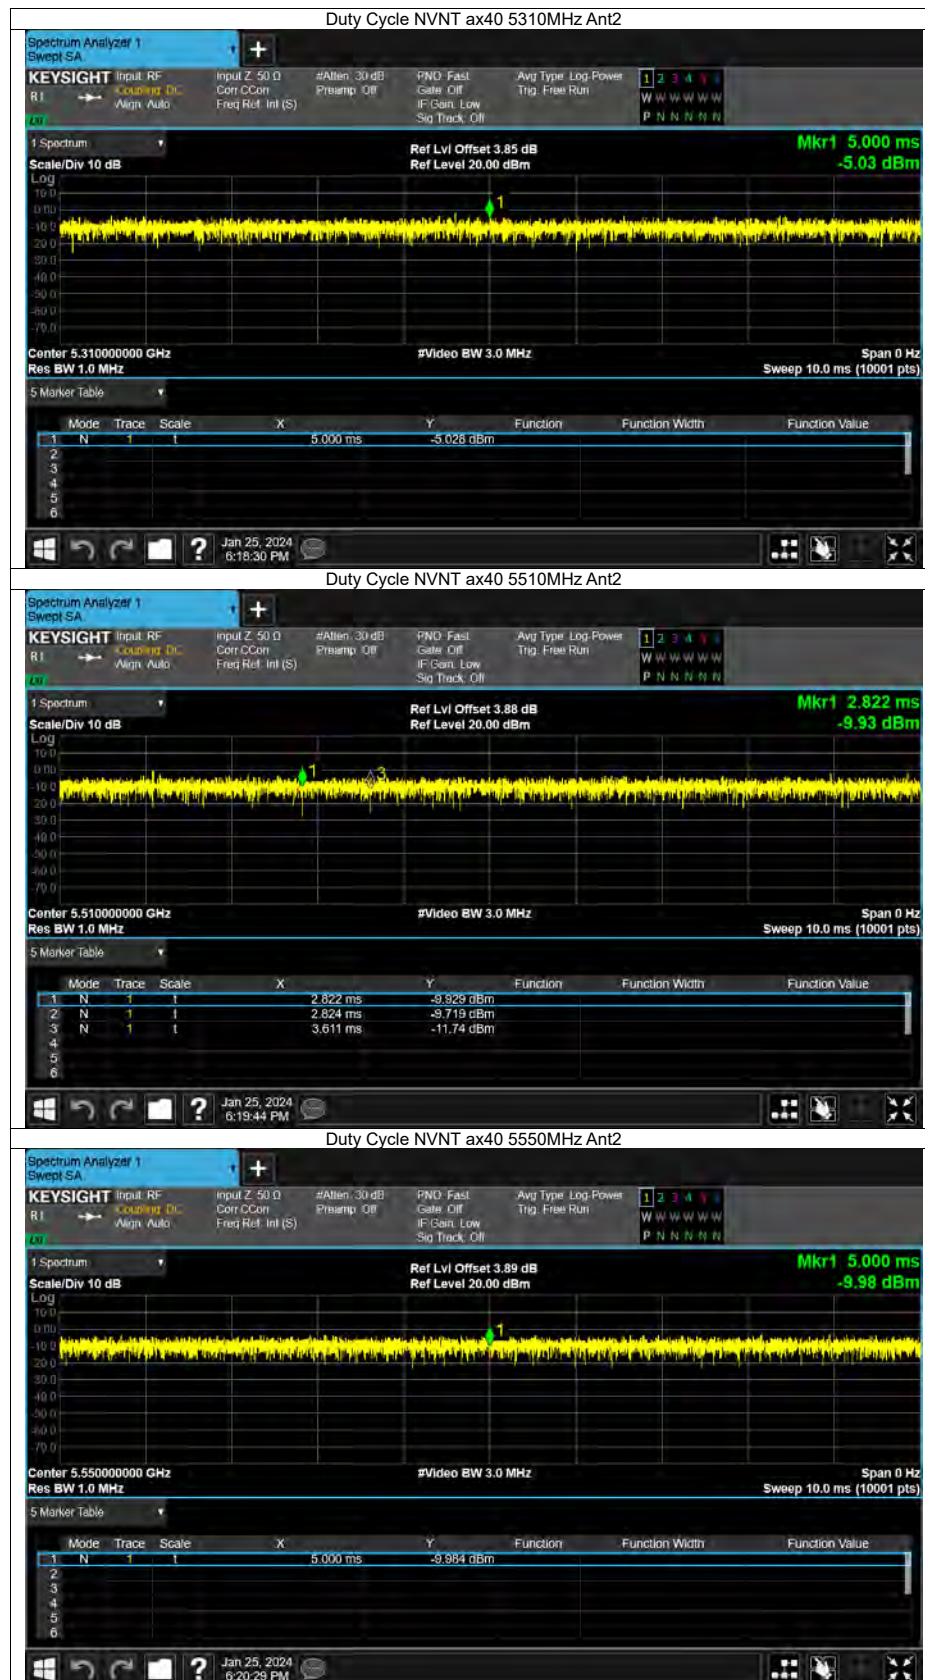


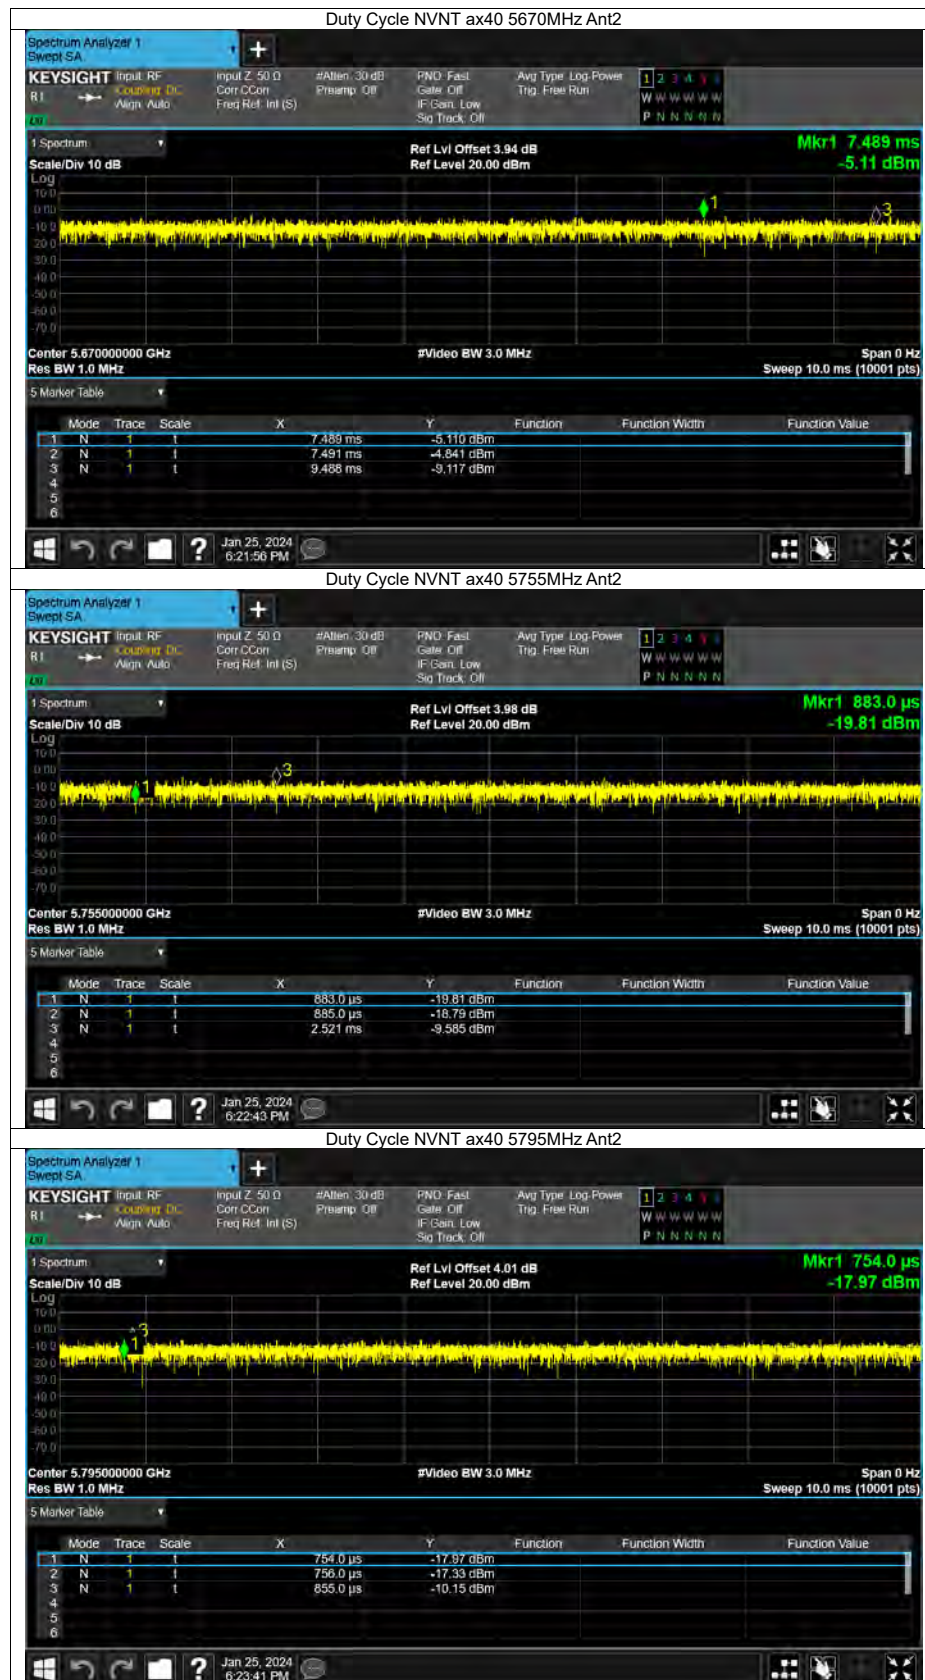


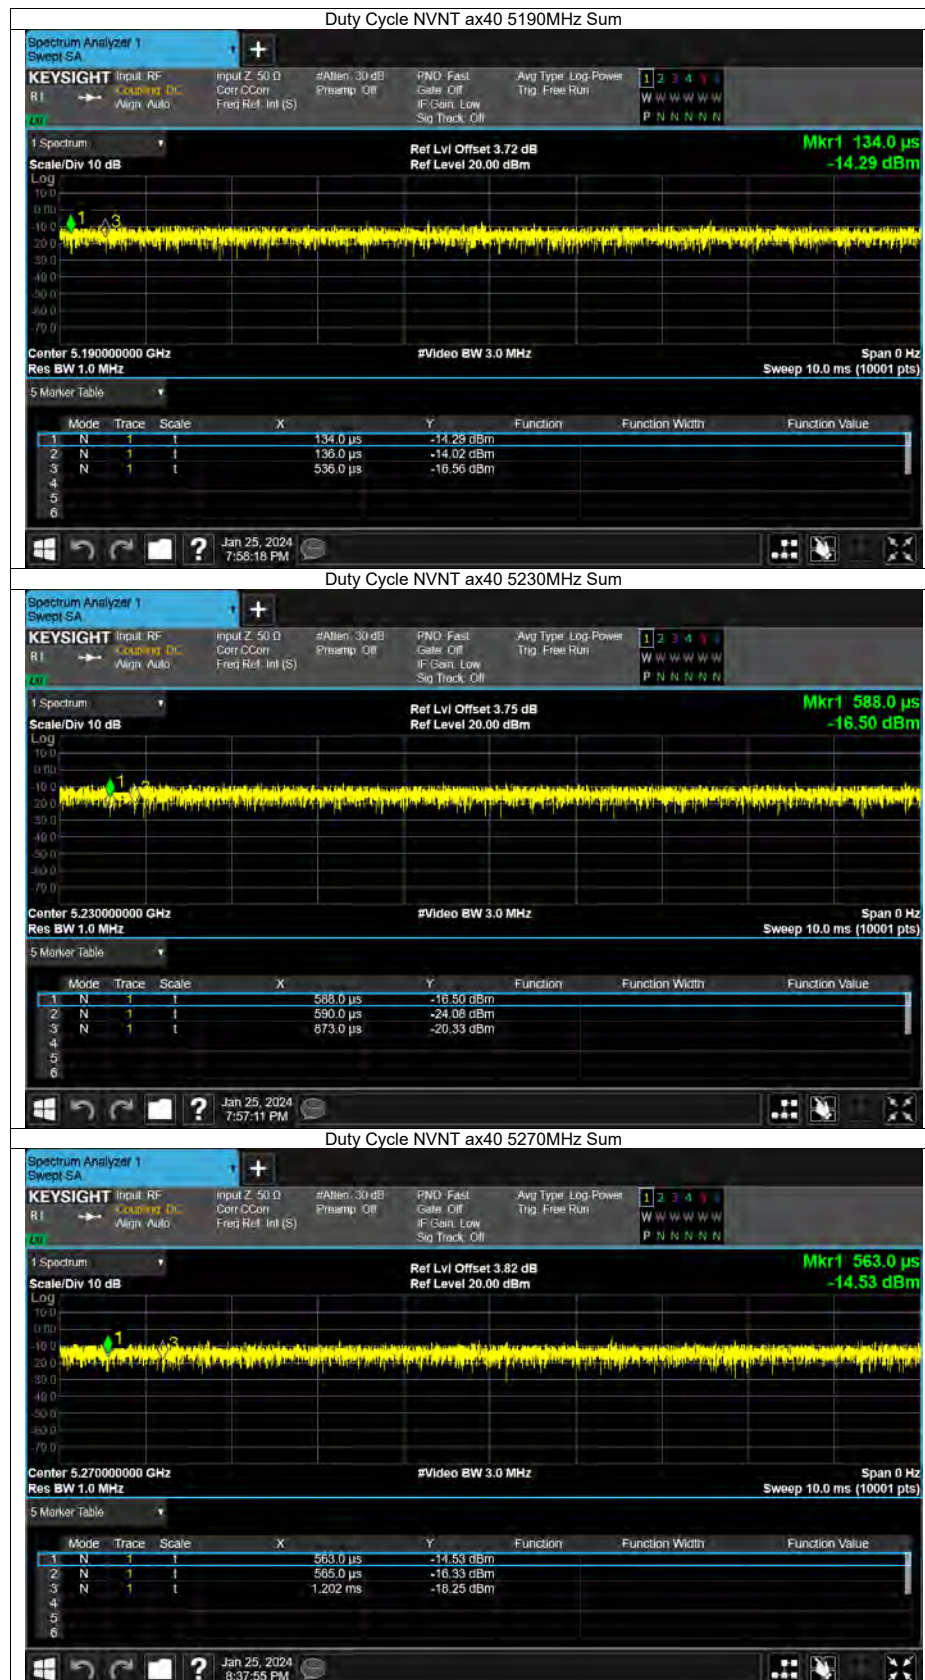


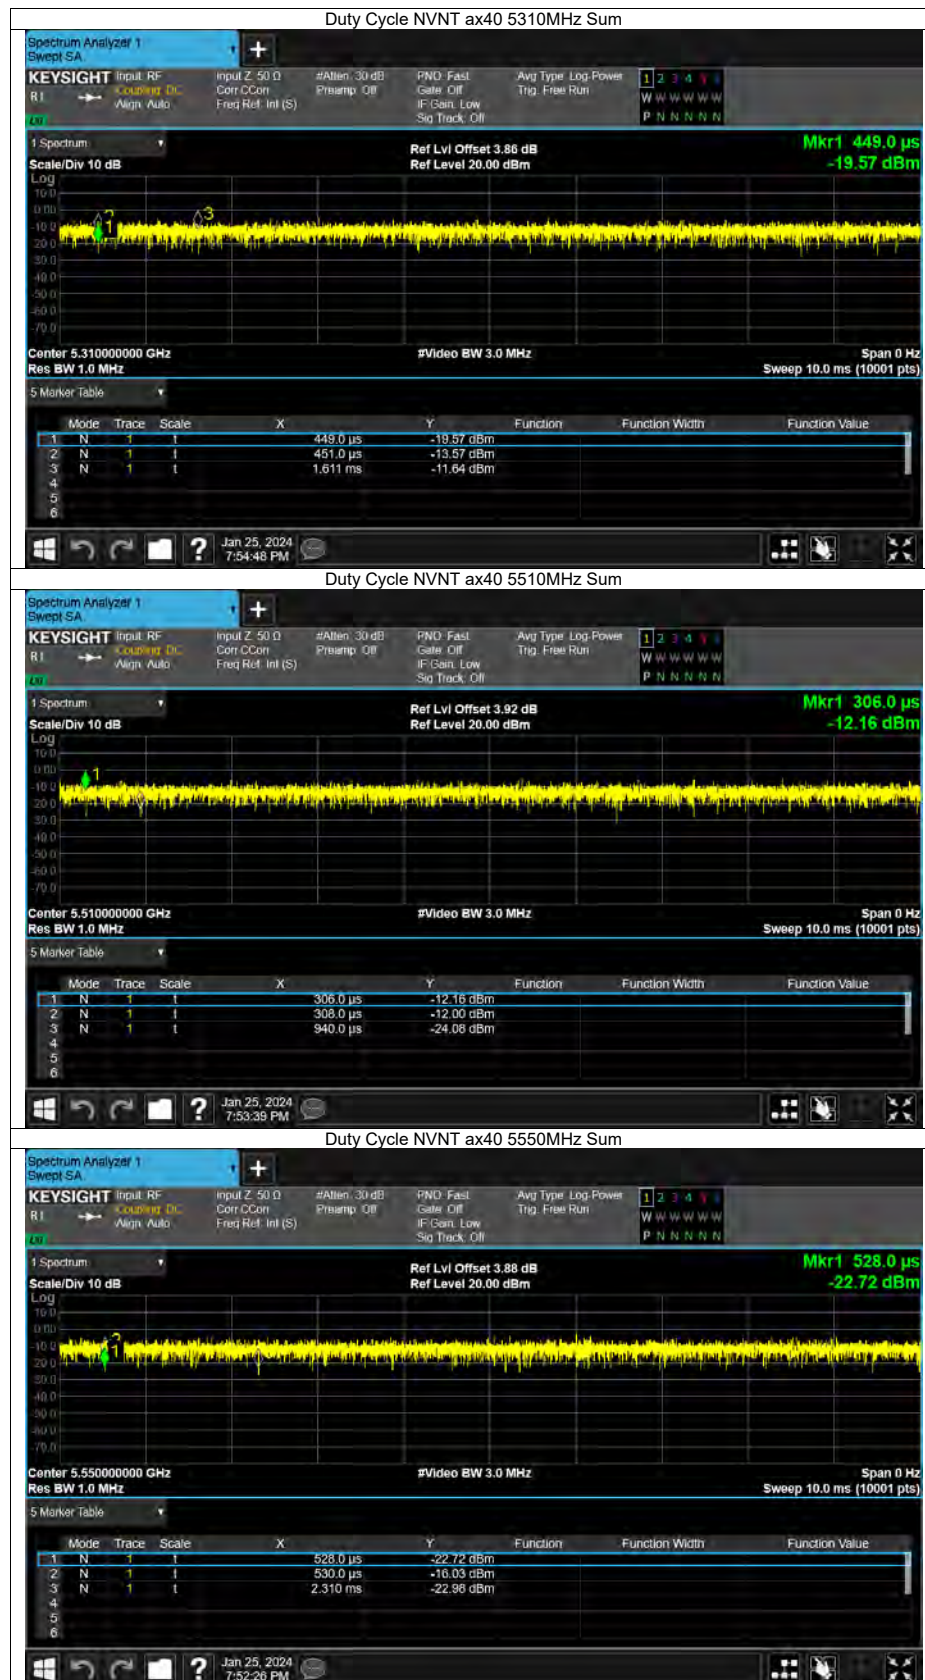


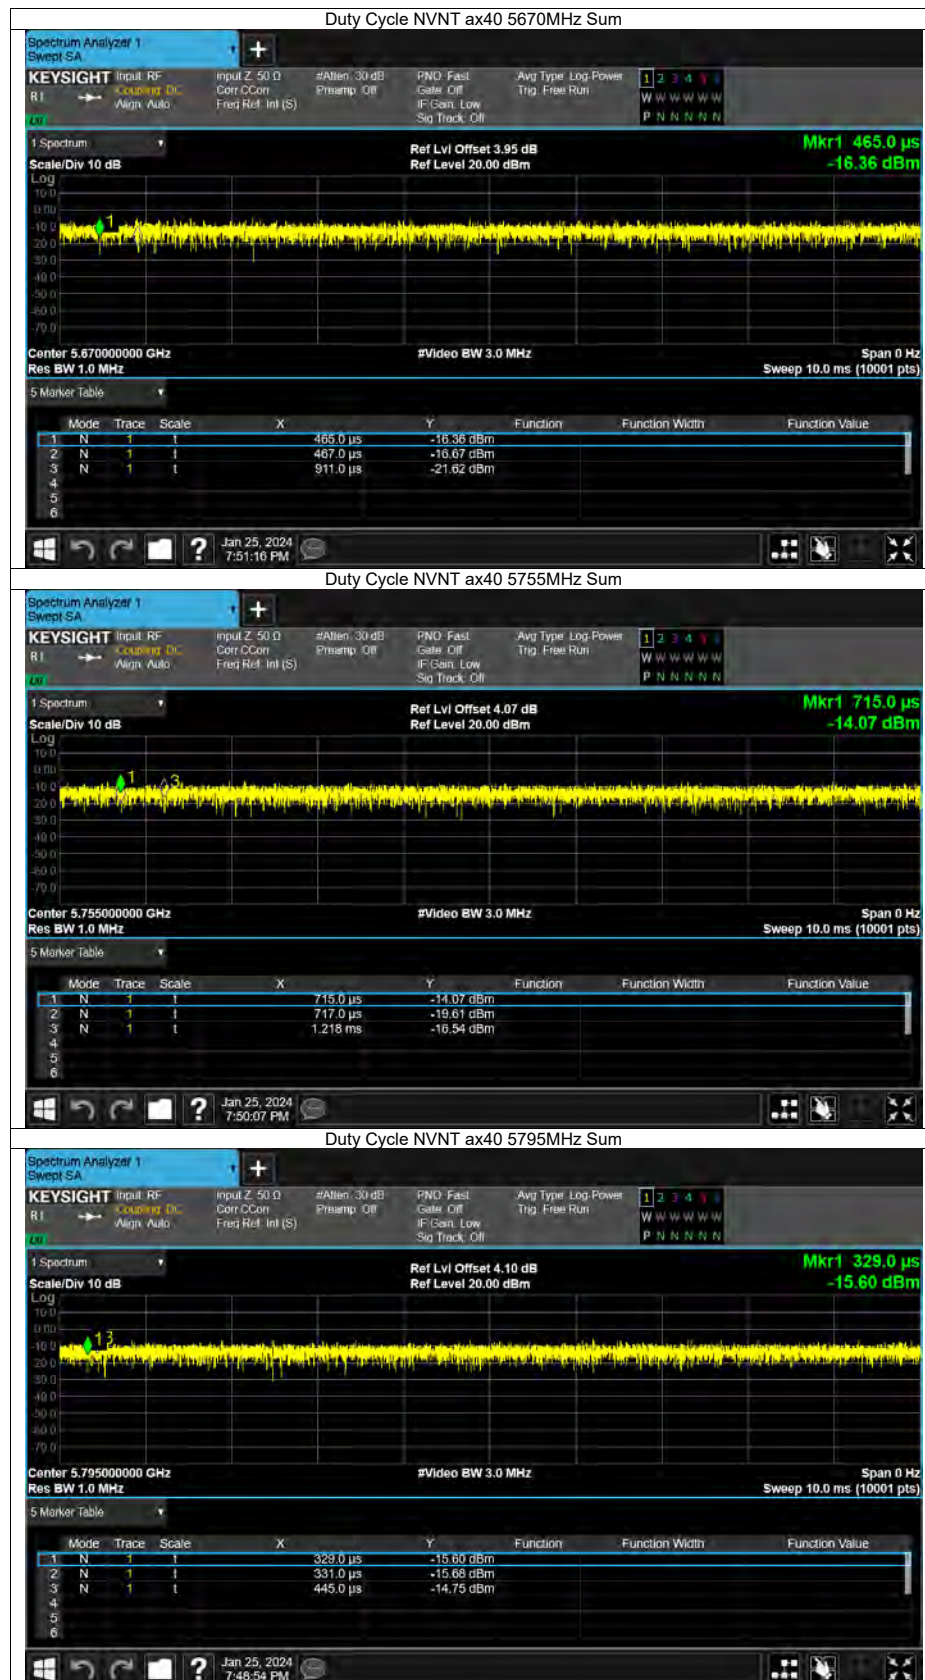

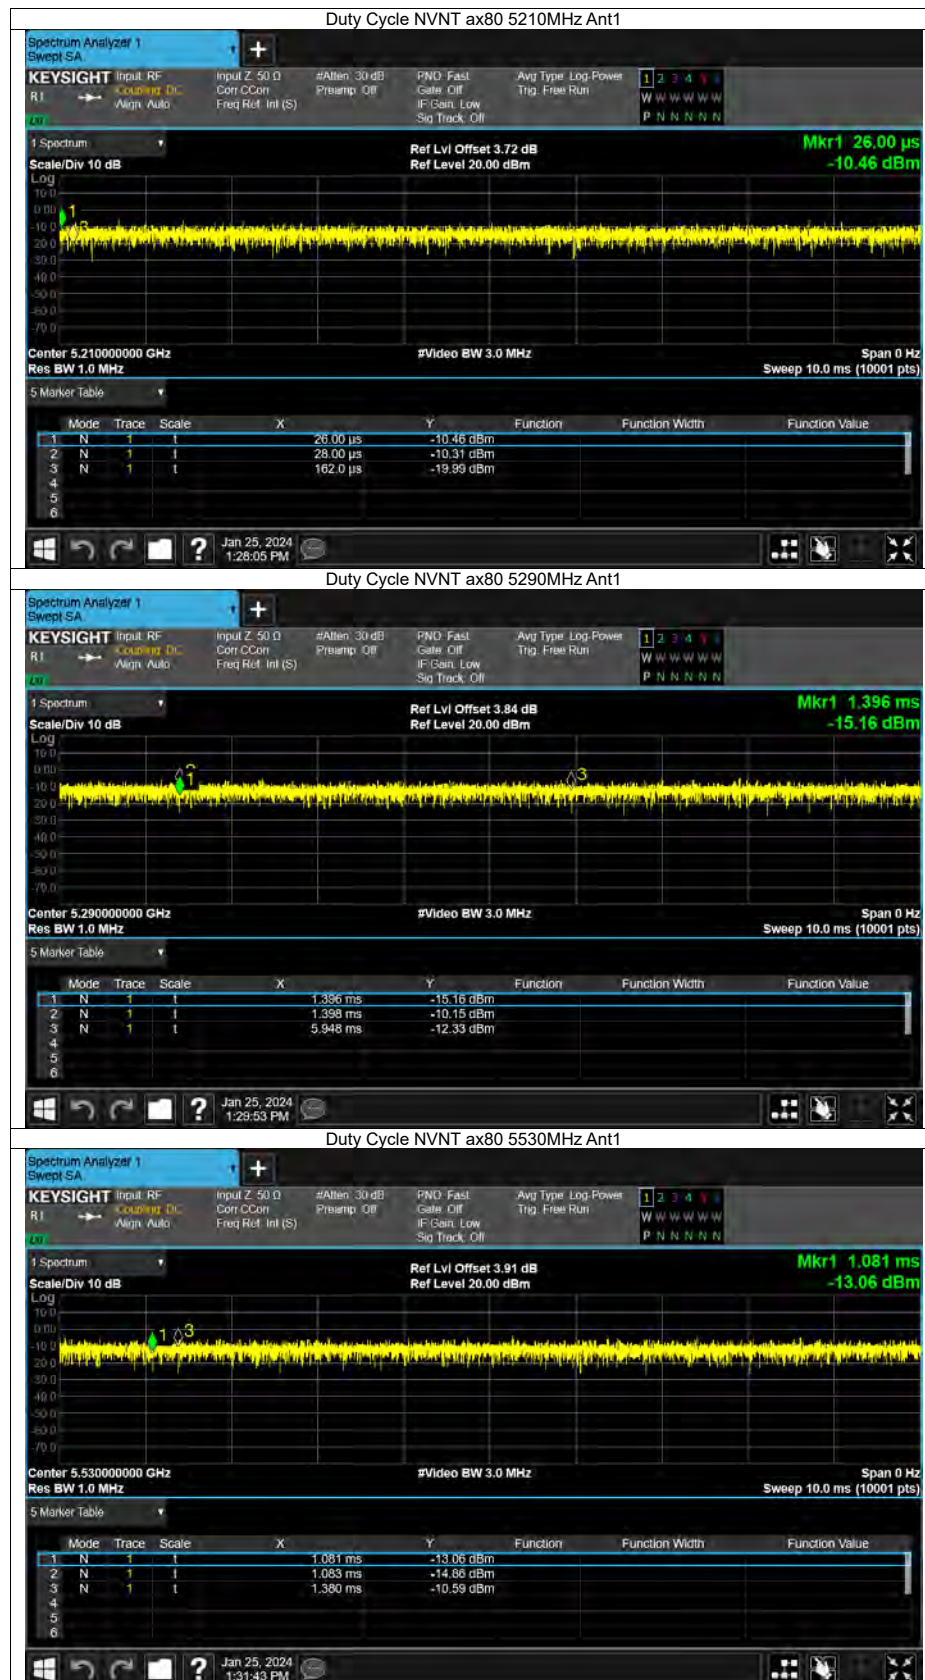

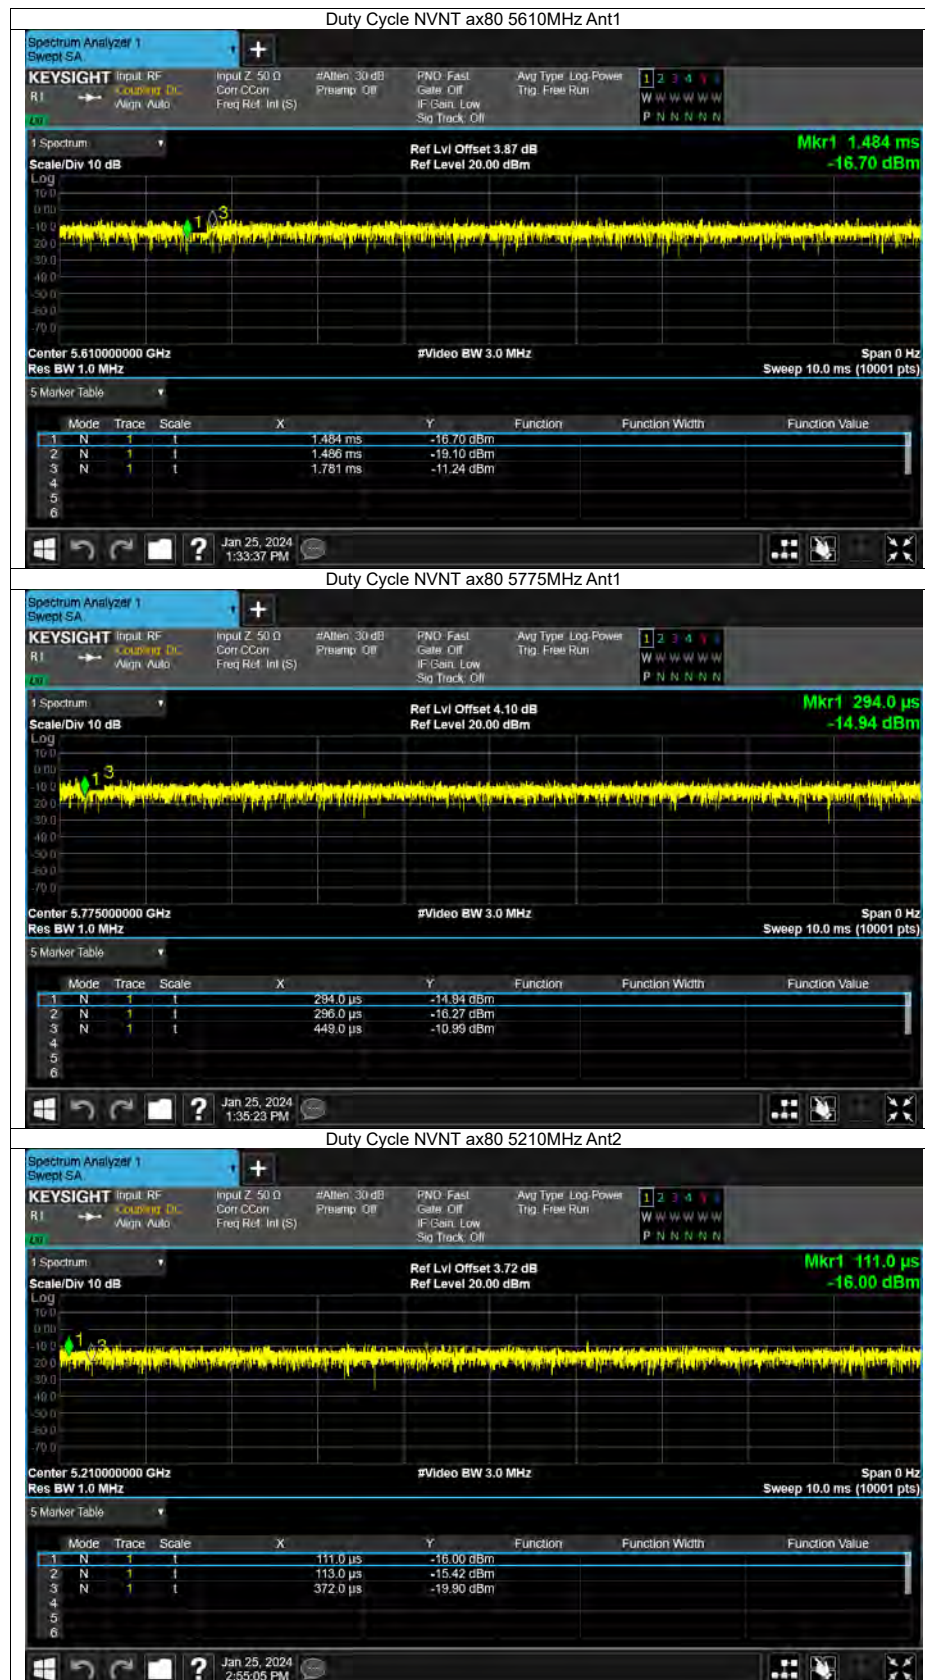

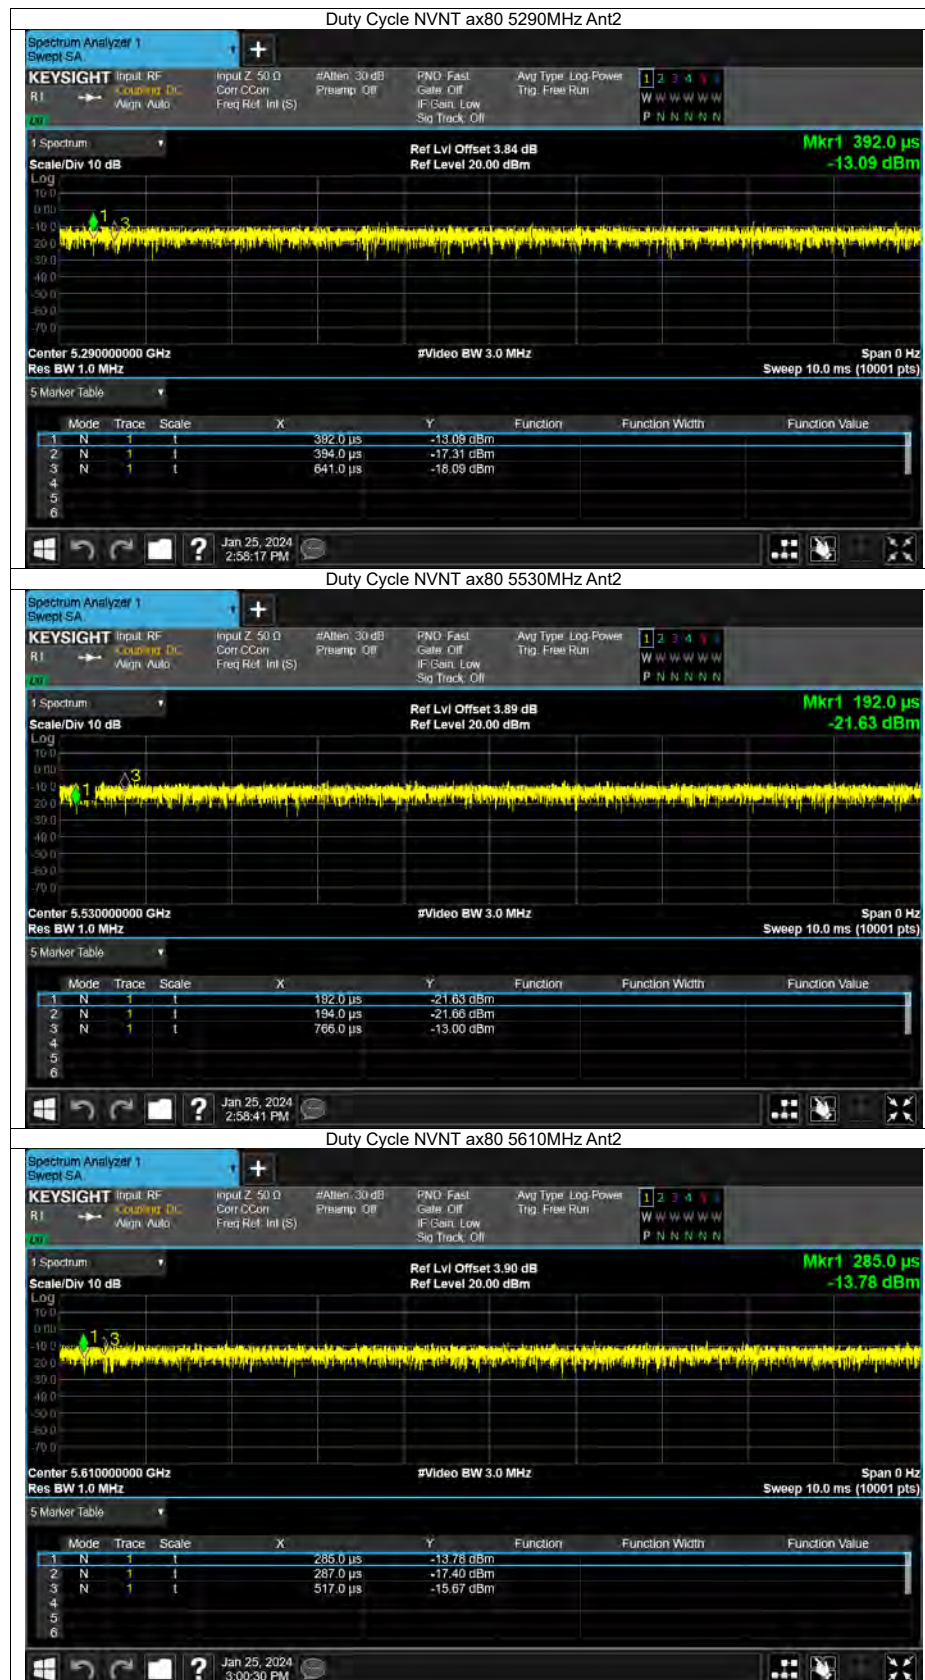

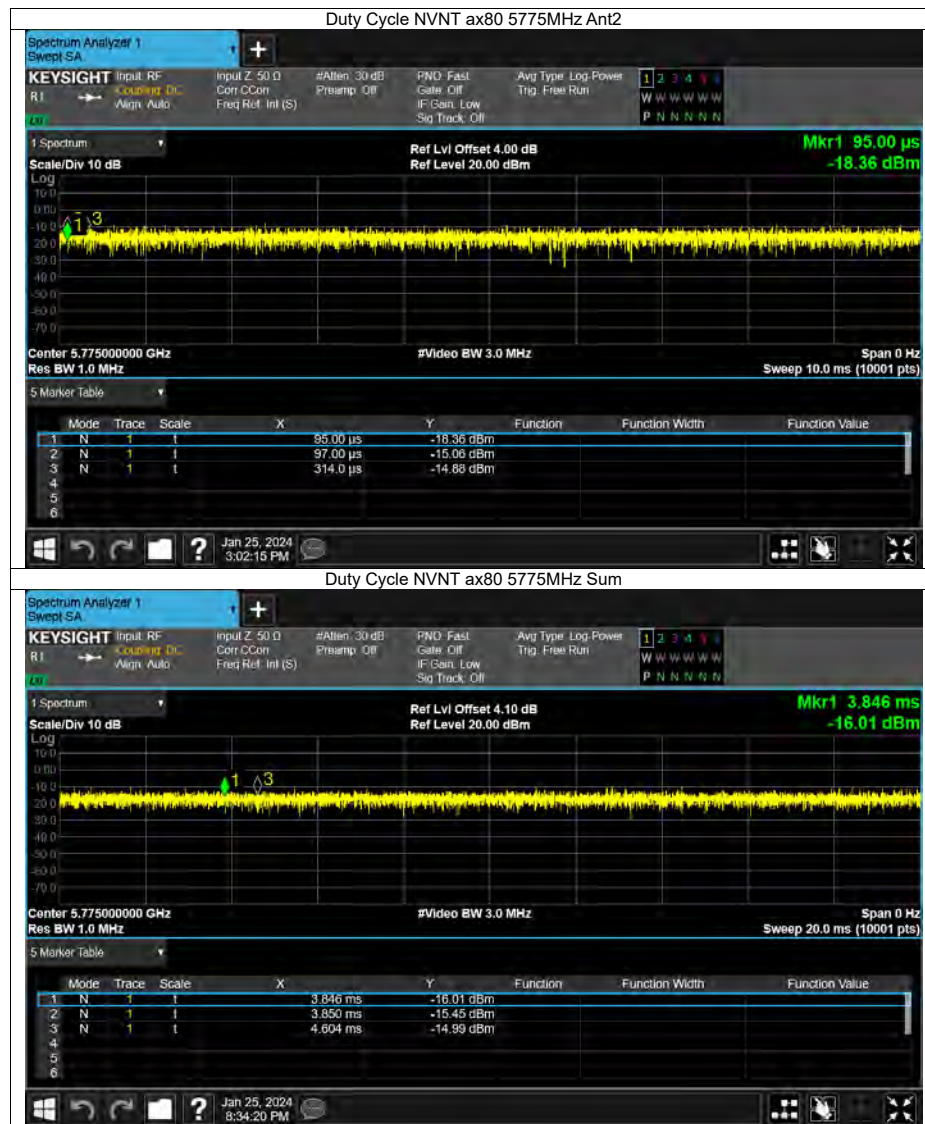



Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	7.18	0	7.18	24	Pass
NVNT	a	5200	Ant1	7.37	0	7.37	24	Pass
NVNT	a	5240	Ant1	8.29	0	8.29	24	Pass
NVNT	a	5260	Ant1	8.95	0	8.95	24	Pass
NVNT	a	5300	Ant1	9.34	0	9.34	24	Pass
NVNT	a	5320	Ant1	9.58	0	9.58	24	Pass
NVNT	a	5500	Ant1	9.71	0	9.71	24	Pass
NVNT	a	5580	Ant1	9.28	0	9.28	24	Pass
NVNT	a	5700	Ant1	9.7	0	9.7	24	Pass
NVNT	a	5745	Ant1	9.5	0	9.5	30	Pass
NVNT	a	5785	Ant1	9.46	0	9.46	30	Pass
NVNT	a	5825	Ant1	8.77	0	8.77	30	Pass
NVNT	a	5180	Ant2	6.31	0	6.31	24	Pass
NVNT	a	5200	Ant2	6.07	0	6.07	24	Pass
NVNT	a	5240	Ant2	6.54	0	6.54	24	Pass
NVNT	a	5260	Ant2	7.41	0	7.41	24	Pass
NVNT	a	5300	Ant2	7.3	0	7.3	24	Pass
NVNT	a	5320	Ant2	7.82	0	7.82	24	Pass
NVNT	a	5500	Ant2	8.85	0	8.85	24	Pass
NVNT	a	5580	Ant2	8	0	8	24	Pass
NVNT	a	5700	Ant2	6.97	0	6.97	24	Pass
NVNT	a	5745	Ant2	6.72	0	6.72	30	Pass
NVNT	a	5785	Ant2	6.16	0	6.16	30	Pass
NVNT	a	5825	Ant2	5.5	0	5.5	30	Pass
NVNT	n20	5180	Ant1	5.04	0	5.04	24	Pass
NVNT	n20	5200	Ant1	5.79	0	5.79	24	Pass
NVNT	n20	5240	Ant1	6.84	0	6.84	24	Pass
NVNT	n20	5260	Ant1	7.48	0	7.48	24	Pass
NVNT	n20	5300	Ant1	7.7	0	7.7	24	Pass
NVNT	n20	5320	Ant1	7.89	0	7.89	24	Pass
NVNT	n20	5500	Ant1	7.73	0	7.73	24	Pass
NVNT	n20	5580	Ant1	7.57	0	7.57	24	Pass
NVNT	n20	5700	Ant1	7.73	0	7.73	24	Pass
NVNT	n20	5745	Ant1	7.71	0	7.71	30	Pass
NVNT	n20	5785	Ant1	7.6	0	7.6	30	Pass
NVNT	n20	5825	Ant1	7.03	0	7.03	30	Pass
NVNT	n20	5180	Ant2	3.03	0	3.03	24	Pass
NVNT	n20	5200	Ant2	3.2	0	3.2	24	Pass
NVNT	n20	5240	Ant2	3.75	0	3.75	24	Pass
NVNT	n20	5260	Ant2	4.76	0	4.76	24	Pass
NVNT	n20	5300	Ant2	5.04	0	5.04	24	Pass
NVNT	n20	5320	Ant2	5.34	0	5.34	24	Pass
NVNT	n20	5500	Ant2	6.35	0	6.35	24	Pass
NVNT	n20	5580	Ant2	5.38	0	5.38	24	Pass
NVNT	n20	5700	Ant2	4.12	0	4.12	24	Pass
NVNT	n20	5745	Ant2	3.76	0	3.76	30	Pass
NVNT	n20	5785	Ant2	3.3	0	3.3	30	Pass
NVNT	n20	5825	Ant2	2.68	0	2.68	30	Pass
NVNT	n20	5180	Ant1	3.79	0	3.79	24	Pass
NVNT	n20	5180	Ant2	1.54	0	1.54	24	Pass
NVNT	n20	5180	Sum	5.82	0	5.82	22.32	Pass
NVNT	n20	5200	Ant1	4.53	0	4.53	24	Pass
NVNT	n20	5200	Ant2	2.11	0	2.11	24	Pass
NVNT	n20	5200	Sum	6.50	0	6.50	22.32	Pass
NVNT	n20	5240	Ant1	4.60	0	4.60	24	Pass
NVNT	n20	5240	Ant2	2.64	0	2.64	24	Pass
NVNT	n20	5240	Sum	6.74	0	6.74	22.32	Pass
NVNT	n20	5260	Ant1	4.76	0	4.76	24	Pass
NVNT	n20	5260	Ant2	3.49	0	3.49	24	Pass
NVNT	n20	5260	Sum	7.18	0	7.18	22.32	Pass
NVNT	n20	5300	Ant1	6.17	0	6.17	24	Pass
NVNT	n20	5300	Ant2	3.38	0	3.38	24	Pass
NVNT	n20	5300	Sum	8.01	0	8.01	22.32	Pass
NVNT	n20	5320	Ant1	6.57	0	6.57	24	Pass
NVNT	n20	5320	Ant2	3.53	0	3.53	24	Pass
NVNT	n20	5320	Sum	8.32	0	8.32	22.32	Pass
NVNT	n20	5500	Ant1	5.23	0	5.23	24	Pass
NVNT	n20	5500	Ant2	4.32	0	4.32	24	Pass
NVNT	n20	5500	Sum	7.81	0	7.81	22.32	Pass
NVNT	n20	5580	Ant1	6.27	0	6.27	24	Pass
NVNT	n20	5580	Ant2	3.20	0	3.20	24	Pass
NVNT	n20	5580	Sum	8.01	0	8.01	22.32	Pass
NVNT	n20	5700	Ant1	6.77	0	6.77	24	Pass
NVNT	n20	5700	Ant2	2.57	0	2.57	24	Pass
NVNT	n20	5700	Sum	8.17	0	8.17	22.32	Pass
NVNT	n20	5745	Ant1	5.84	0	5.84	30	Pass
NVNT	n20	5745	Ant2	2.16	0	2.16	30	Pass
NVNT	n20	5745	Sum	7.39	0	7.39	28.32	Pass
NVNT	n20	5785	Ant1	6.36	0	6.36	30	Pass
NVNT	n20	5785	Ant2	1.69	0	1.69	30	Pass
NVNT	n20	5785	Sum	7.63	0	7.63	28.32	Pass
NVNT	n20	5825	Ant1	6.05	0	6.05	30	Pass
NVNT	n20	5825	Ant2	1.11	0	1.11	30	Pass
NVNT	n20	5825	Sum	7.26	0	7.26	28.32	Pass
NVNT	n40	5190	Ant1	5.65	0	5.65	24	Pass
NVNT	n40	5230	Ant1	6.6	0	6.6	24	Pass
NVNT	n40	5270	Ant1	7.38	0	7.38	24	Pass
NVNT	n40	5310	Ant1	7.57	0	7.57	24	Pass
NVNT	n40	5510	Ant1	7.39	0	7.39	24	Pass
NVNT	n40	5550	Ant1	7.38	0	7.38	24	Pass
NVNT	n40	5670	Ant1	7.45	0	7.45	24	Pass
NVNT	n40	5755	Ant1	7.5	0	7.5	30	Pass



NVNT	n40	5795	Ant1	7.52	0	7.52	30	Pass
NVNT	n40	5190	Ant2	3.47	0	3.47	24	Pass
NVNT	n40	5230	Ant2	4.02	0	4.02	24	Pass
NVNT	n40	5270	Ant2	5.08	0	5.08	24	Pass
NVNT	n40	5310	Ant2	5.18	0	5.18	24	Pass
NVNT	n40	5510	Ant2	5.66	0	5.66	24	Pass
NVNT	n40	5550	Ant2	5.56	0	5.56	24	Pass
NVNT	n40	5670	Ant2	4.3	0	4.3	24	Pass
NVNT	n40	5755	Ant2	3.56	0	3.56	30	Pass
NVNT	n40	5795	Ant2	3.16	0	3.16	30	Pass
NVNT	n40	5190	Ant1	1.25	0	1.25	24	Pass
NVNT	n40	5190	Ant2	1.25	0	1.25	24	Pass
NVNT	n40	5190	Sum	4.26	0	4.26	22.32	Pass
NVNT	n40	5230	Ant1	2.30	0	2.30	24	Pass
NVNT	n40	5230	Ant2	1.90	0	1.90	24	Pass
NVNT	n40	5230	Sum	5.11	0	5.11	22.32	Pass
NVNT	n40	5270	Ant1	2.80	0	2.80	24	Pass
NVNT	n40	5270	Ant2	3.01	0	3.01	24	Pass
NVNT	n40	5270	Sum	5.92	0	5.92	22.32	Pass
NVNT	n40	5310	Ant1	4.36	0	4.36	24	Pass
NVNT	n40	5310	Ant2	2.99	0	2.99	24	Pass
NVNT	n40	5310	Sum	6.74	0	6.74	22.32	Pass
NVNT	n40	5510	Ant1	3.06	0	3.06	24	Pass
NVNT	n40	5510	Ant2	3.47	0	3.47	24	Pass
NVNT	n40	5510	Sum	6.28	0	6.28	22.32	Pass
NVNT	n40	5550	Ant1	4.44	0	4.44	24	Pass
NVNT	n40	5550	Ant2	3.46	0	3.46	24	Pass
NVNT	n40	5550	Sum	6.99	0	6.99	22.32	Pass
NVNT	n40	5670	Ant1	4.54	0	4.54	24	Pass
NVNT	n40	5670	Ant2	2.28	0	2.28	24	Pass
NVNT	n40	5670	Sum	6.57	0	6.57	22.32	Pass
NVNT	n40	5755	Ant1	3.79	0	3.79	30	Pass
NVNT	n40	5755	Ant2	1.68	0	1.68	30	Pass
NVNT	n40	5755	Sum	5.87	0	5.87	28.32	Pass
NVNT	n40	5795	Ant1	4.14	0	4.14	30	Pass
NVNT	n40	5795	Ant2	1.15	0	1.15	30	Pass
NVNT	n40	5795	Sum	5.91	0	5.91	28.32	Pass
NVNT	ac20	5180	Ant1	3.56	0	3.56	24	Pass
NVNT	ac20	5200	Ant1	3.56	0	3.56	24	Pass
NVNT	ac20	5240	Ant1	4.01	0	4.01	24	Pass
NVNT	ac20	5260	Ant1	4.75	0	4.75	24	Pass
NVNT	ac20	5300	Ant1	5.13	0	5.13	24	Pass
NVNT	ac20	5320	Ant1	5.35	0	5.35	24	Pass
NVNT	ac20	5500	Ant1	5.48	0	5.48	24	Pass
NVNT	ac20	5580	Ant1	5.43	0	5.43	24	Pass
NVNT	ac20	5700	Ant1	5.88	0	5.88	24	Pass
NVNT	ac20	5745	Ant1	5.87	0	5.87	30	Pass
NVNT	ac20	5785	Ant1	5.78	0	5.78	30	Pass
NVNT	ac20	5825	Ant1	5.03	0	5.03	30	Pass
NVNT	ac20	5180	Ant2	1.56	0	1.56	24	Pass
NVNT	ac20	5200	Ant2	1.74	0	1.74	24	Pass
NVNT	ac20	5240	Ant2	2.45	0	2.45	24	Pass
NVNT	ac20	5260	Ant2	3.12	0	3.12	24	Pass
NVNT	ac20	5300	Ant2	3.73	0	3.73	24	Pass
NVNT	ac20	5320	Ant2	3.8	0	3.8	24	Pass
NVNT	ac20	5500	Ant2	3.93	0	3.93	24	Pass
NVNT	ac20	5580	Ant2	3.26	0	3.26	24	Pass
NVNT	ac20	5700	Ant2	2.03	0	2.03	24	Pass
NVNT	ac20	5745	Ant2	1.87	0	1.87	30	Pass
NVNT	ac20	5785	Ant2	1.3	0	1.3	30	Pass
NVNT	ac20	5825	Ant2	0.8	0	0.8	30	Pass
NVNT	ac20	5180	Ant1	-1.18	0	-1.18	24	Pass
NVNT	ac20	5180	Ant2	-3.51	0	-3.51	24	Pass
NVNT	ac20	5180	Sum	0.82	0	0.82	22.32	Pass
NVNT	ac20	5200	Ant1	-0.44	0	-0.44	24	Pass
NVNT	ac20	5200	Ant2	-2.94	0	-2.94	24	Pass
NVNT	ac20	5200	Sum	1.50	0	1.50	22.32	Pass
NVNT	ac20	5240	Ant1	-0.37	0	-0.37	24	Pass
NVNT	ac20	5240	Ant2	-2.41	0	-2.41	24	Pass
NVNT	ac20	5240	Sum	1.74	0	1.74	22.32	Pass
NVNT	ac20	5260	Ant1	-0.21	0	-0.21	24	Pass
NVNT	ac20	5260	Ant2	-1.56	0	-1.56	24	Pass
NVNT	ac20	5260	Sum	2.18	0	2.18	22.32	Pass
NVNT	ac20	5300	Ant1	1.20	0	1.20	24	Pass
NVNT	ac20	5300	Ant2	-1.67	0	-1.67	24	Pass
NVNT	ac20	5300	Sum	3.01	0	3.01	22.32	Pass
NVNT	ac20	5320	Ant1	1.60	0	1.60	24	Pass
NVNT	ac20	5320	Ant2	-1.52	0	-1.52	24	Pass
NVNT	ac20	5320	Sum	3.32	0	3.32	22.32	Pass
NVNT	ac20	5500	Ant1	0.26	0	0.26	24	Pass
NVNT	ac20	5500	Ant2	-0.73	0	-0.73	24	Pass
NVNT	ac20	5500	Sum	2.80	0	2.80	22.32	Pass
NVNT	ac20	5580	Ant1	1.30	0	1.30	24	Pass
NVNT	ac20	5580	Ant2	-1.85	0	-1.85	24	Pass
NVNT	ac20	5580	Sum	3.01	0	3.01	22.32	Pass
NVNT	ac20	5700	Ant1	1.80	0	1.80	24	Pass
NVNT	ac20	5700	Ant2	-2.48	0	-2.48	24	Pass
NVNT	ac20	5700	Sum	3.18	0	3.18	22.32	Pass
NVNT	ac20	5745	Ant1	0.87	0	0.87	30	Pass
NVNT	ac20	5745	Ant2	-2.89	0	-2.89	30	Pass
NVNT	ac20	5745	Sum	2.40	0	2.40	28.32	Pass
NVNT	ac20	5785	Ant1	1.39	0	1.39	30	Pass
NVNT	ac20	5785	Ant2	-3.36	0	-3.36	30	Pass
NVNT	ac20	5785	Sum	2.64	0	2.64	28.32	Pass



NVNT	ac20	5825	Ant1	1.08	0	1.08	30	Pass
NVNT	ac20	5825	Ant2	-3.94	0	-3.94	30	Pass
NVNT	ac20	5825	Sum	2.27	0	2.27	28.32	Pass
NVNT	ac40	5190	Ant1	4.5	0	4.5	24	Pass
NVNT	ac40	5230	Ant1	4.96	0	4.96	24	Pass
NVNT	ac40	5270	Ant1	5.69	0	5.69	24	Pass
NVNT	ac40	5310	Ant1	5.86	0	5.86	24	Pass
NVNT	ac40	5510	Ant1	5.66	0	5.66	24	Pass
NVNT	ac40	5550	Ant1	5.76	0	5.76	24	Pass
NVNT	ac40	5670	Ant1	6.11	0	6.11	24	Pass
NVNT	ac40	5755	Ant1	5.98	0	5.98	30	Pass
NVNT	ac40	5795	Ant1	5.83	0	5.83	30	Pass
NVNT	ac40	5190	Ant2	1.99	0	1.99	24	Pass
NVNT	ac40	5230	Ant2	2.31	0	2.31	24	Pass
NVNT	ac40	5270	Ant2	2.95	0	2.95	24	Pass
NVNT	ac40	5310	Ant2	2.76	0	2.76	24	Pass
NVNT	ac40	5510	Ant2	3.58	0	3.58	24	Pass
NVNT	ac40	5550	Ant2	3.83	0	3.83	24	Pass
NVNT	ac40	5670	Ant2	2.69	0	2.69	24	Pass
NVNT	ac40	5755	Ant2	2.33	0	2.33	30	Pass
NVNT	ac40	5795	Ant2	1.84	0	1.84	30	Pass
NVNT	ac40	5190	Ant1	-1.42	0	-1.42	24	Pass
NVNT	ac40	5190	Ant2	-3.65	0	-3.65	24	Pass
NVNT	ac40	5190	Sum	0.62	0	0.62	22.32	Pass
NVNT	ac40	5230	Ant1	-0.37	0	-0.37	24	Pass
NVNT	ac40	5230	Ant2	-3.00	0	-3.00	24	Pass
NVNT	ac40	5230	Sum	1.52	0	1.52	22.32	Pass
NVNT	ac40	5270	Ant1	0.13	0	0.13	24	Pass
NVNT	ac40	5270	Ant2	-1.89	0	-1.89	24	Pass
NVNT	ac40	5270	Sum	2.25	0	2.25	22.32	Pass
NVNT	ac40	5310	Ant1	1.69	0	1.69	24	Pass
NVNT	ac40	5310	Ant2	-1.91	0	-1.91	24	Pass
NVNT	ac40	5310	Sum	3.26	0	3.26	22.32	Pass
NVNT	ac40	5510	Ant1	0.39	0	0.39	24	Pass
NVNT	ac40	5510	Ant2	-1.43	0	-1.43	24	Pass
NVNT	ac40	5510	Sum	2.58	0	2.58	22.32	Pass
NVNT	ac40	5550	Ant1	1.77	0	1.77	24	Pass
NVNT	ac40	5550	Ant2	-1.44	0	-1.44	24	Pass
NVNT	ac40	5550	Sum	3.47	0	3.47	22.32	Pass
NVNT	ac40	5670	Ant1	1.87	0	1.87	24	Pass
NVNT	ac40	5670	Ant2	-2.62	0	-2.62	24	Pass
NVNT	ac40	5670	Sum	3.19	0	3.19	22.32	Pass
NVNT	ac40	5755	Ant1	1.12	0	1.12	30	Pass
NVNT	ac40	5755	Ant2	-3.22	0	-3.22	30	Pass
NVNT	ac40	5755	Sum	2.48	0	2.48	28.32	Pass
NVNT	ac40	5795	Ant1	1.47	0	1.47	30	Pass
NVNT	ac40	5795	Ant2	-3.75	0	-3.75	30	Pass
NVNT	ac40	5795	Sum	2.61	0	2.61	28.32	Pass
NVNT	ac80	5210	Ant1	3.75	0	3.75	24	Pass
NVNT	ac80	5290	Ant1	5.64	0	5.64	24	Pass
NVNT	ac80	5530	Ant1	5.77	0	5.77	24	Pass
NVNT	ac80	5610	Ant1	5.63	0	5.63	24	Pass
NVNT	ac80	5775	Ant1	5.59	0	5.59	30	Pass
NVNT	ac80	5210	Ant2	1.35	0	1.35	24	Pass
NVNT	ac80	5290	Ant2	4.8	0	4.8	24	Pass
NVNT	ac80	5530	Ant2	5.46	0	5.46	24	Pass
NVNT	ac80	5610	Ant2	4.56	0	4.56	24	Pass
NVNT	ac80	5775	Ant2	3.12	0	3.12	30	Pass
NVNT	ac80	5210	Ant1	-1.79	0	-1.79	24	Pass
NVNT	ac80	5210	Ant2	-3.96	0	-3.96	24	Pass
NVNT	ac80	5210	Sum	0.27	0	0.27	22.32	Pass
NVNT	ac80	5290	Ant1	-0.52	0	-0.52	24	Pass
NVNT	ac80	5290	Ant2	-2.86	0	-2.86	24	Pass
NVNT	ac80	5290	Sum	1.48	0	1.48	22.32	Pass
NVNT	ac80	5530	Ant1	-0.06	0	-0.06	24	Pass
NVNT	ac80	5530	Ant2	-1.85	0	-1.85	24	Pass
NVNT	ac80	5530	Sum	2.15	0	2.15	22.32	Pass
NVNT	ac80	5610	Ant1	0.15	0	0.15	24	Pass
NVNT	ac80	5610	Ant2	-2.54	0	-2.54	24	Pass
NVNT	ac80	5610	Sum	2.02	0	2.02	22.32	Pass
NVNT	ac80	5775	Ant1	1.93	0	1.93	30	Pass
NVNT	ac80	5775	Ant2	-2.10	0	-2.10	30	Pass
NVNT	ac80	5775	Sum	3.38	0	3.38	28.32	Pass
NVNT	ax20	5180	Ant1	2.86	0	2.86	24	Pass
NVNT	ax20	5200	Ant1	3.59	0	3.59	24	Pass
NVNT	ax20	5240	Ant1	4.46	0	4.46	24	Pass
NVNT	ax20	5260	Ant1	5.17	0	5.17	24	Pass
NVNT	ax20	5300	Ant1	5.52	0	5.52	24	Pass
NVNT	ax20	5320	Ant1	5.78	0	5.78	24	Pass
NVNT	ax20	5500	Ant1	5.78	0	5.78	24	Pass
NVNT	ax20	5580	Ant1	5.83	0	5.83	24	Pass
NVNT	ax20	5700	Ant1	6.05	0	6.05	24	Pass
NVNT	ax20	5745	Ant1	6.13	0	6.13	30	Pass
NVNT	ax20	5785	Ant1	6.03	0	6.03	30	Pass
NVNT	ax20	5825	Ant1	5.27	0	5.27	30	Pass
NVNT	ax20	5180	Ant2	1.49	0	1.49	24	Pass
NVNT	ax20	5200	Ant2	1.86	0	1.86	24	Pass
NVNT	ax20	5240	Ant2	2.57	0	2.57	24	Pass
NVNT	ax20	5260	Ant2	3.57	0	3.57	24	Pass
NVNT	ax20	5300	Ant2	3.45	0	3.45	24	Pass
NVNT	ax20	5320	Ant2	3.85	0	3.85	24	Pass
NVNT	ax20	5500	Ant2	4.01	0	4.01	24	Pass
NVNT	ax20	5580	Ant2	3.19	0	3.19	24	Pass
NVNT	ax20	5700	Ant2	2.63	0	2.63	24	Pass