

B5 , Normal


Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-28.47	See Graphs	Pass
1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)	-28.60	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.54	See Graphs	Pass
1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)	-29.02	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.60	See Graphs	Pass
1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)	-28.64	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.05	See Graphs	Pass
3MHz_Low_QPSK_15@0(30MHz~9.49GHz)	-29.34	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.67	See Graphs	Pass
3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)	-27.99	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.41	See Graphs	Pass
3MHz_High_QPSK_15@0(30MHz~9.49GHz)	-29.07	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.64	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~9.49GHz)	-29.05	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.04	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)	-28.77	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~9.49GHz)	-28.71	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~9.49GHz)	-29.76	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-28.83	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~9.49GHz)	-29.34	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.51	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)	-29.68	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.09	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~9.49GHz)	-29.53	See Graphs	Pass

Note:1RB was the worst case.

B5 , Normal


1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)

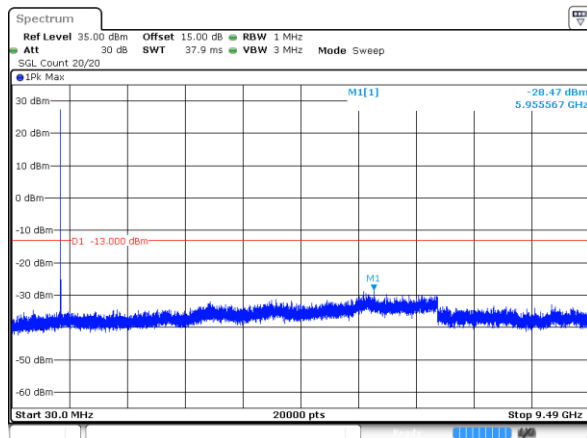


ProjectNo: RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:32:13

1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)

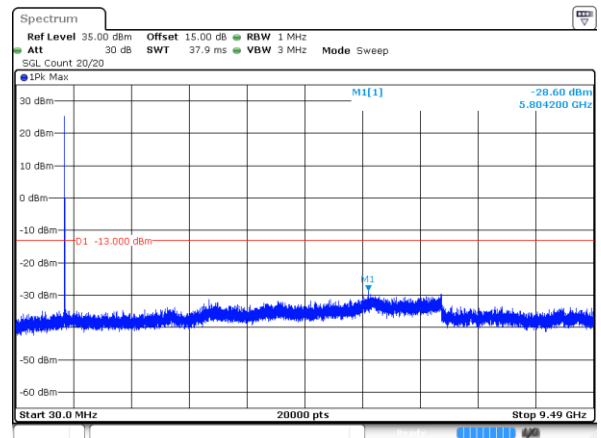


ProjectNo: RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:32:27

1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

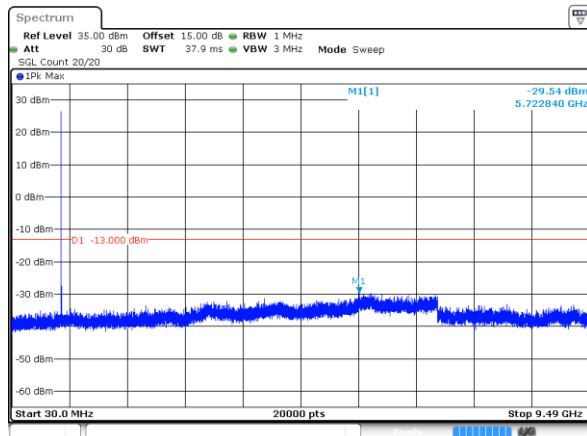


ProjectNo: RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:32:41

1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)

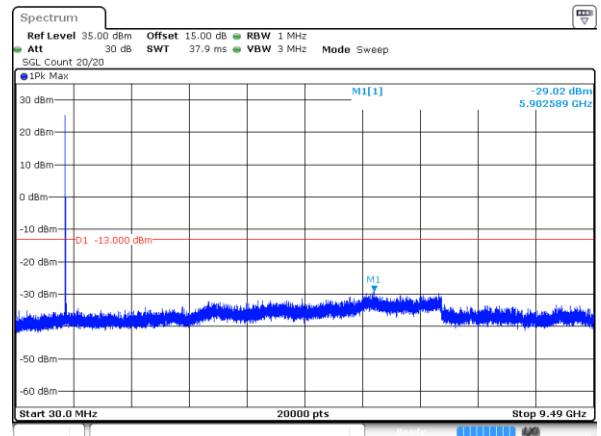


ProjectNo: RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:32:55

1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)

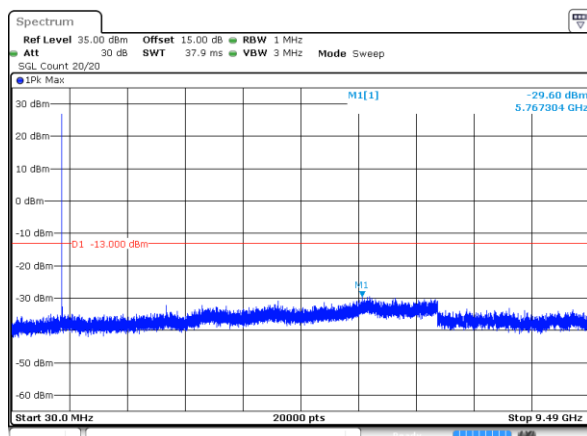


ProjectNo: RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:33:09

1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)

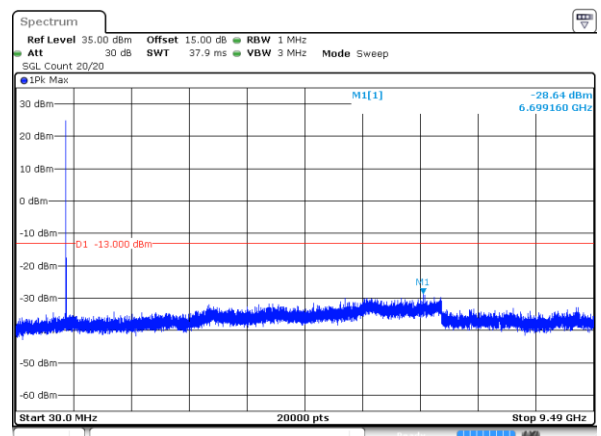


ProjectNo: RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:33:23

3MHz_Low_QPSK_1@0(30MHz~9.49GHz)

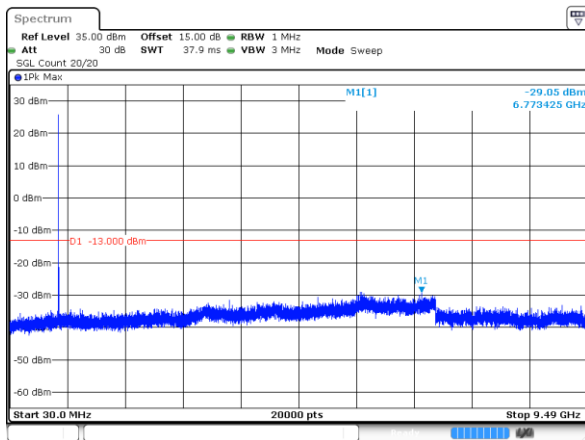


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:34:15

3MHz_Low_QPSK_15@0(30MHz~9.49GHz)

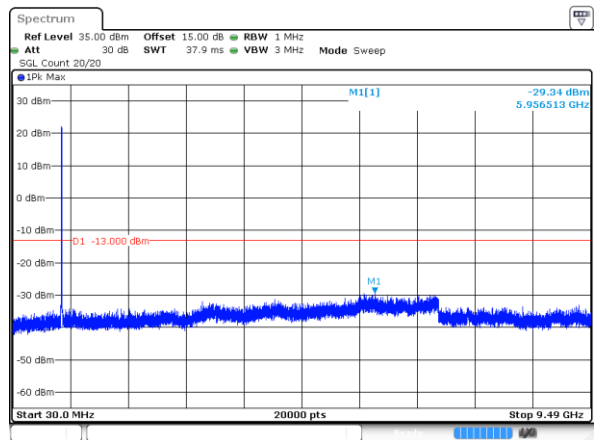


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:34:29

3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

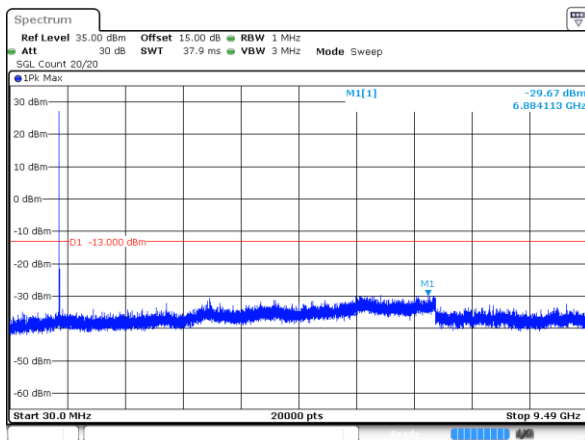


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:34:43

3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)

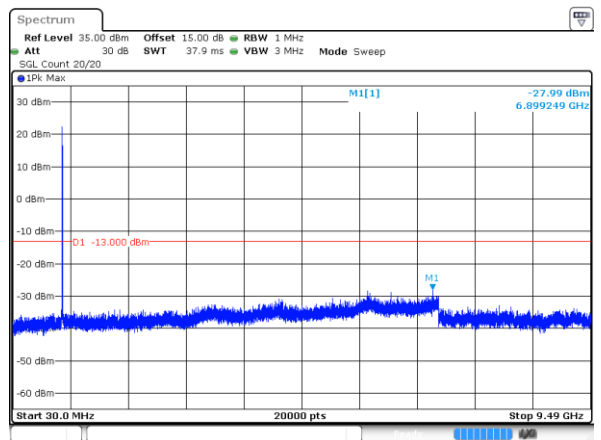


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:34:58

3MHz_High_QPSK_1@0(30MHz~9.49GHz)

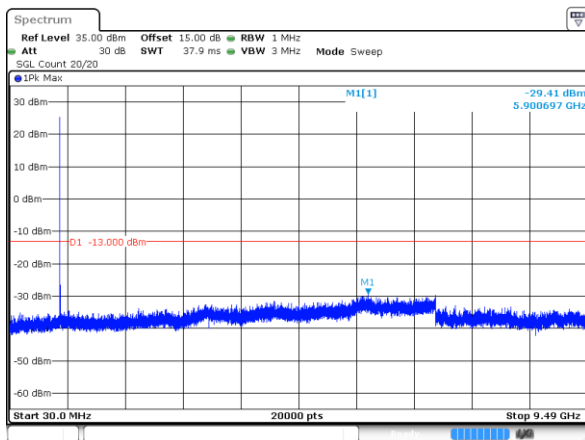


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:35:11

3MHz_High_QPSK_15@0(30MHz~9.49GHz)

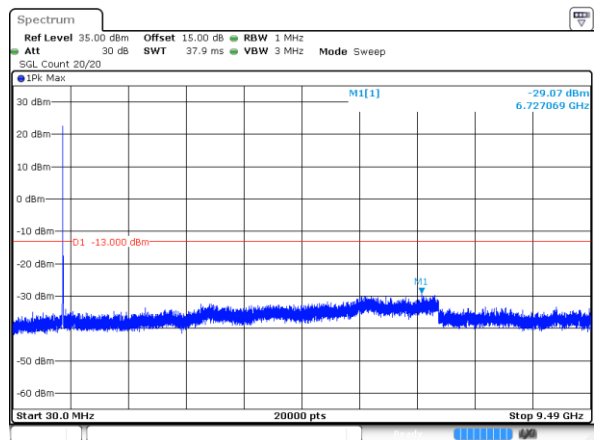


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:35:26

5MHz_Low_QPSK_1@0(30MHz~9.49GHz)

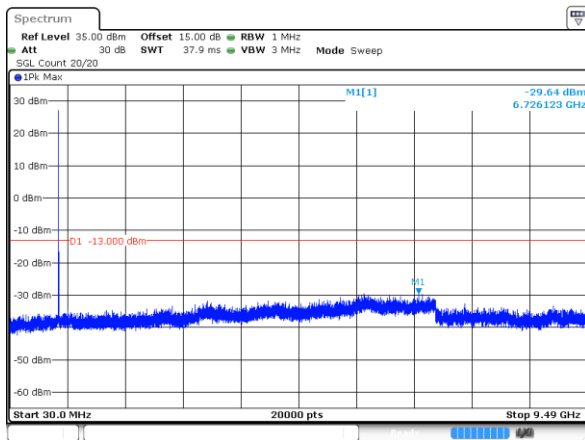


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:36:18

5MHz_Low_QPSK_25@0(30MHz~9.49GHz)

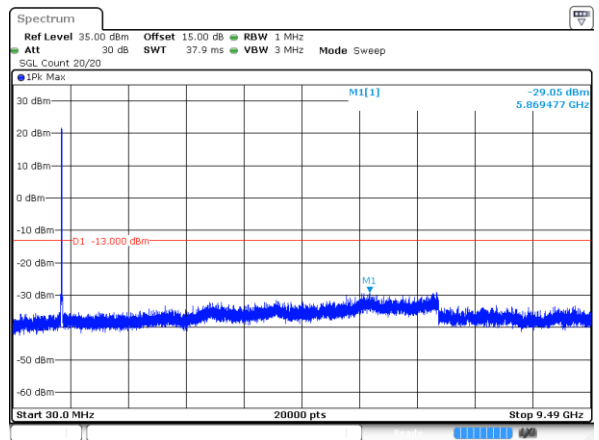


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:36:32

5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

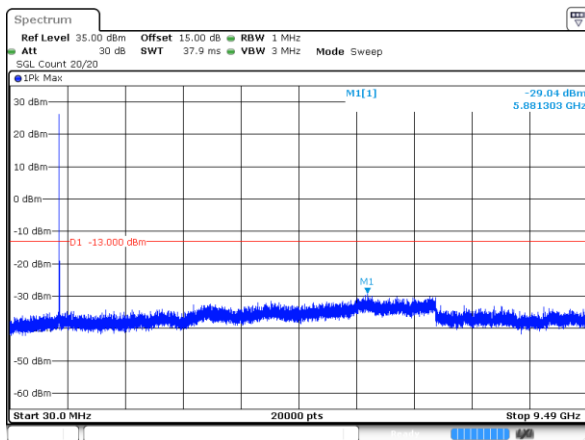


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:36:46

5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)

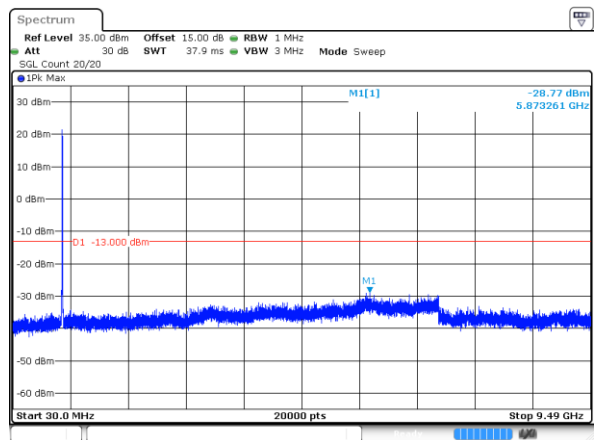


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:37:00

5MHz_High_QPSK_1@0(30MHz~9.49GHz)

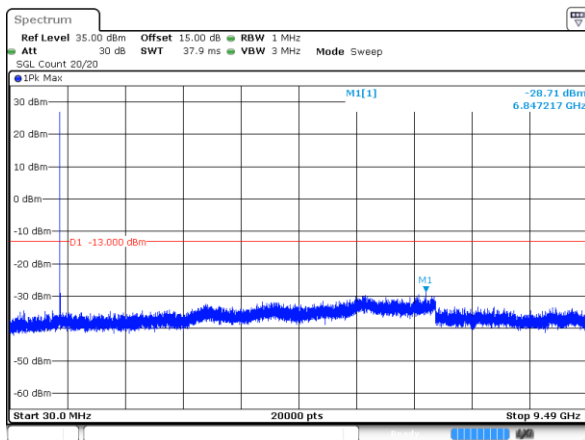


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:37:14

5MHz_High_QPSK_25@0(30MHz~9.49GHz)

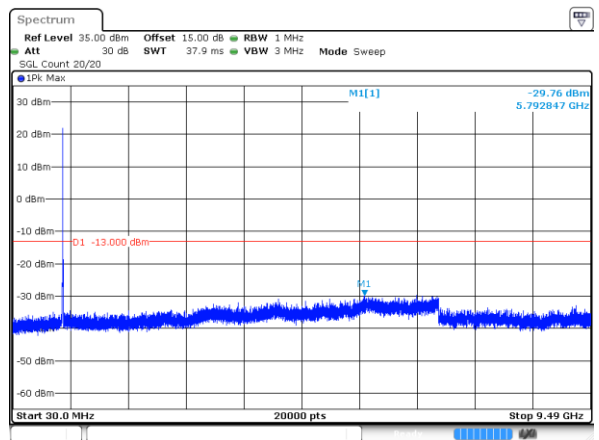


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:37:28

10MHz_Low_QPSK_1@0(30MHz~9.49GHz)

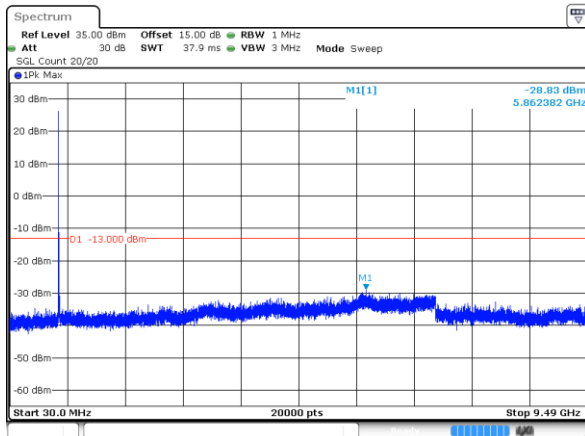


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:38:21

10MHz_Low_QPSK_50@0(30MHz~9.49GHz)

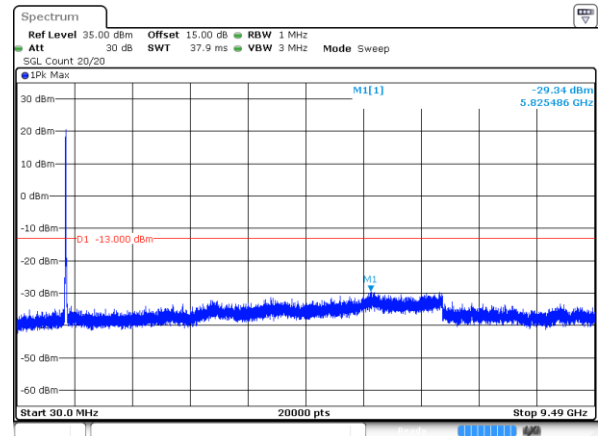


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:38:36

10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

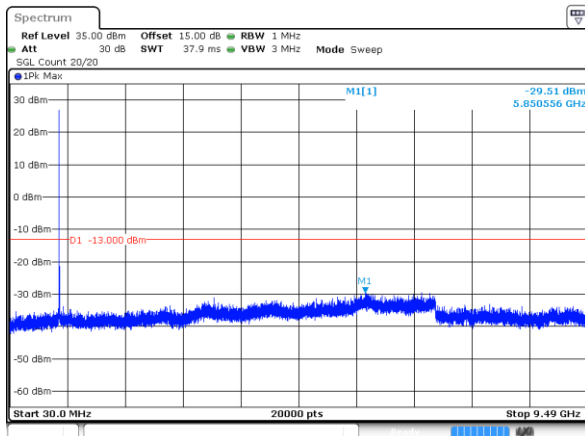


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:38:50

10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)

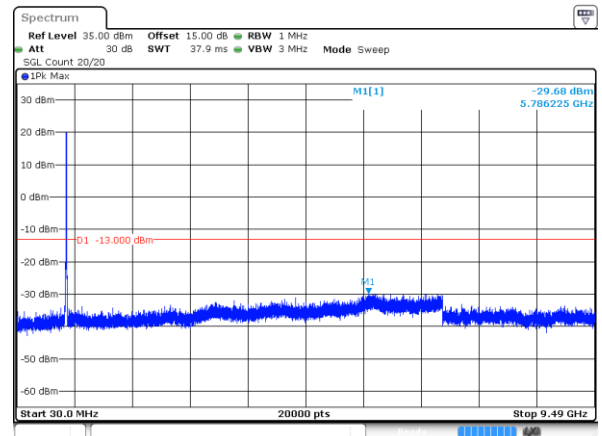


ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:39:05

10MHz_High_QPSK_1@0(30MHz~9.49GHz)

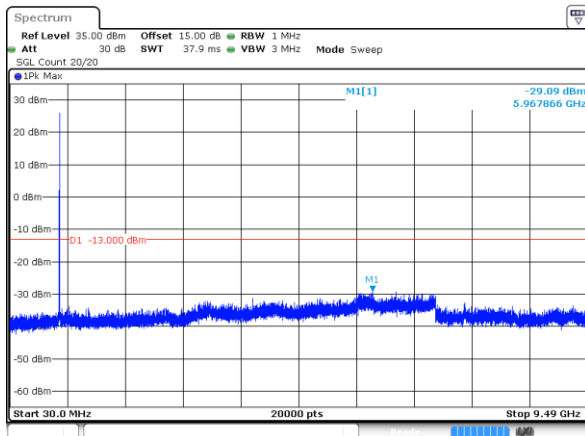

ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:39:19

10MHz_High_QPSK_50@0(30MHz~9.49GHz)

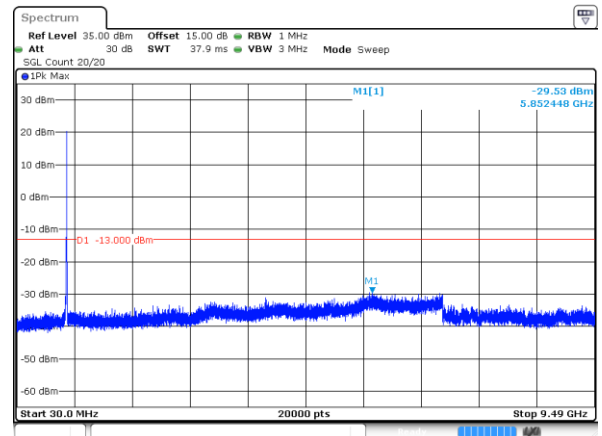

ProjectNo.:RKSA240906001 Tester:Jason Lu
Date: 4 DEC 2024 20:39:33