





Restrict Band NVNT ac20 5240MHz Ant1 Peak

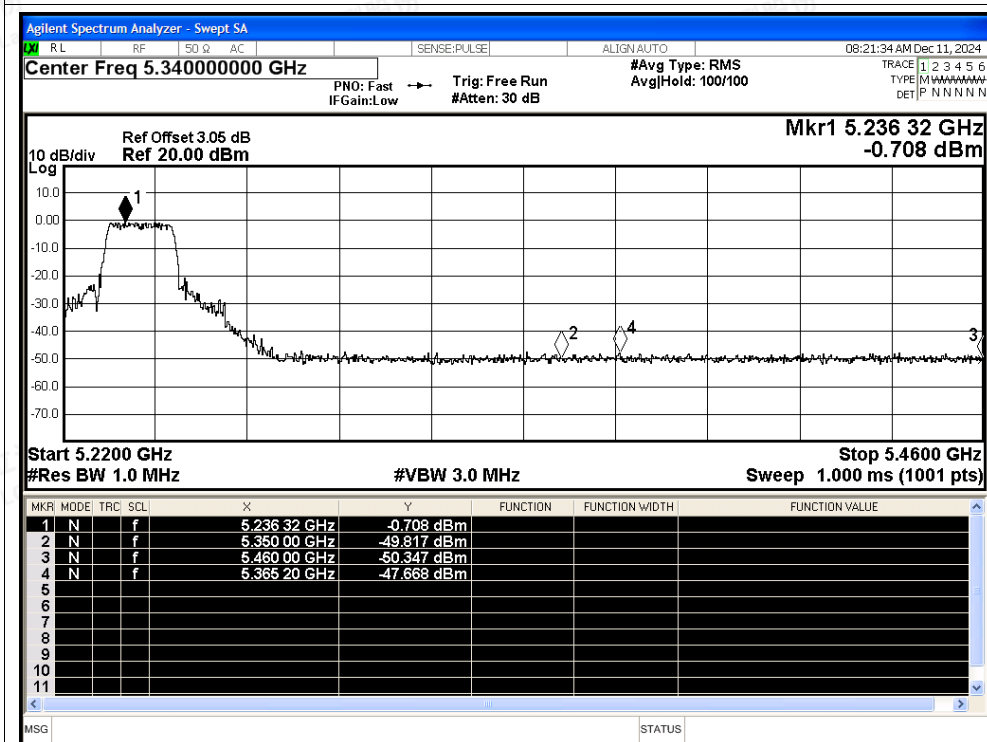

Restrict Band NVNT ac20 5240MHz Ant1 Average

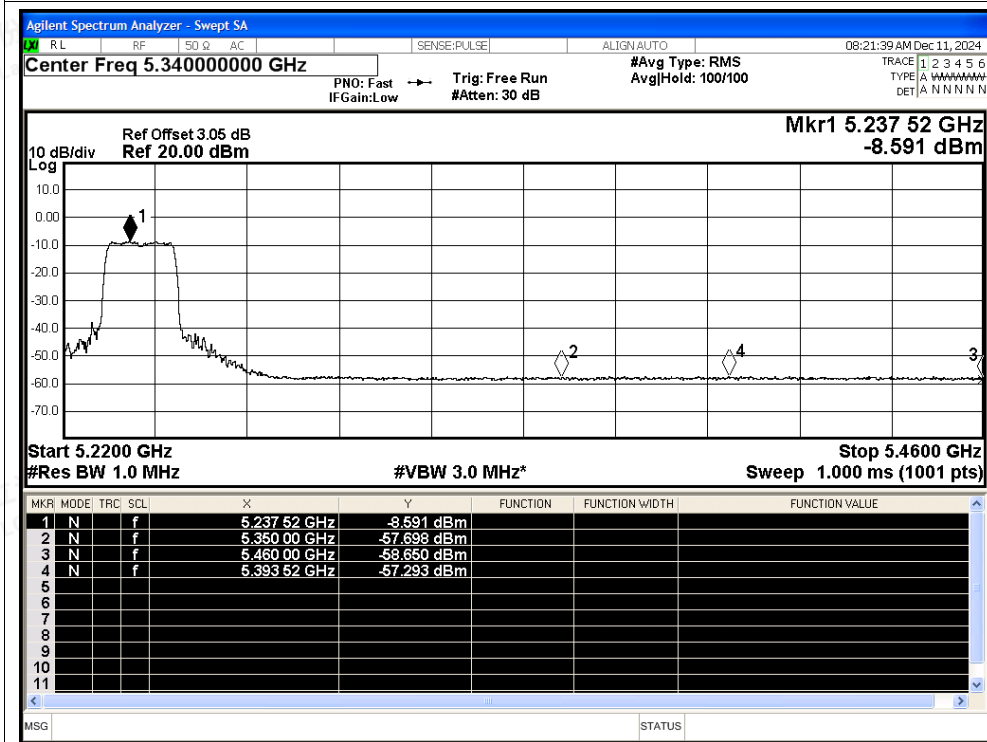

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

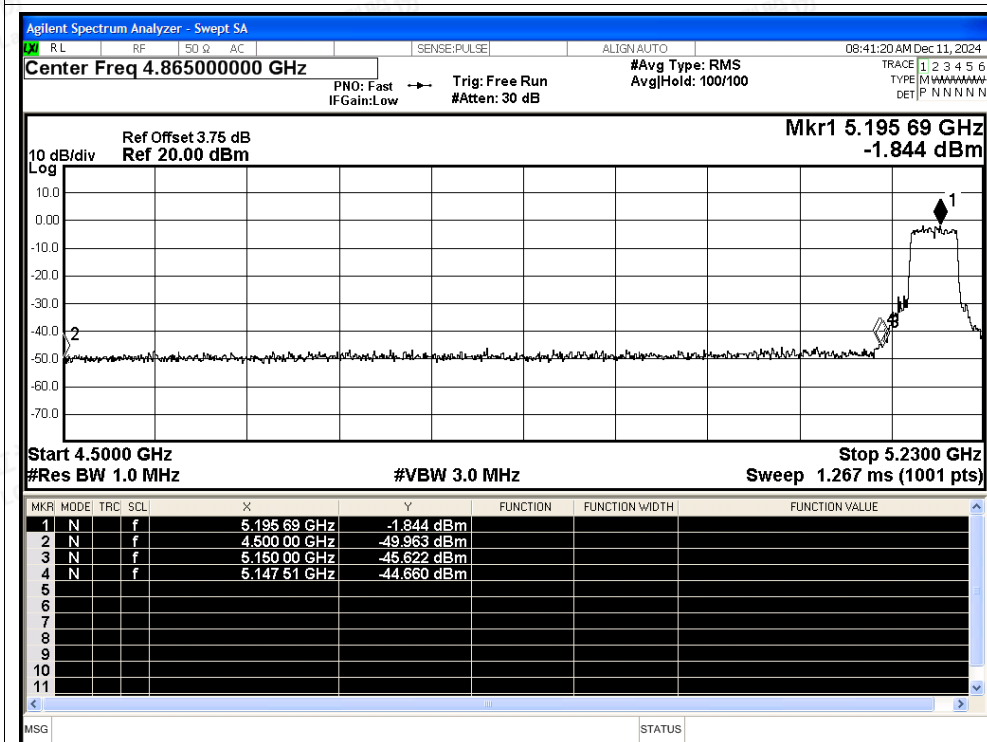

Restrict Band NVNT ac40 5190MHz Ant1 Average

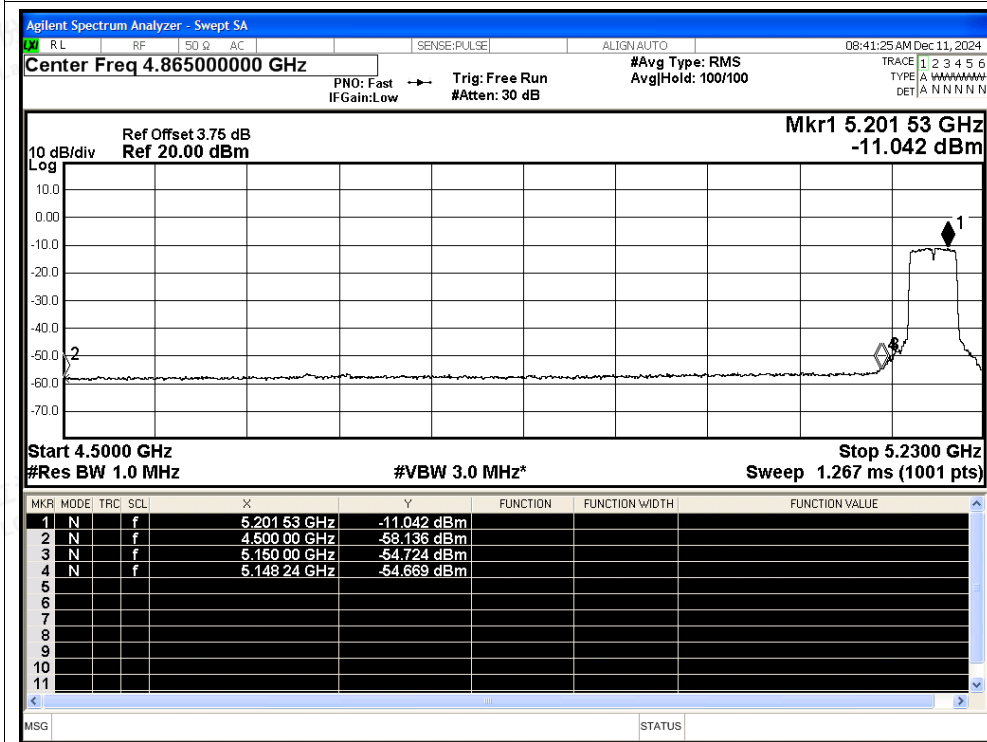

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

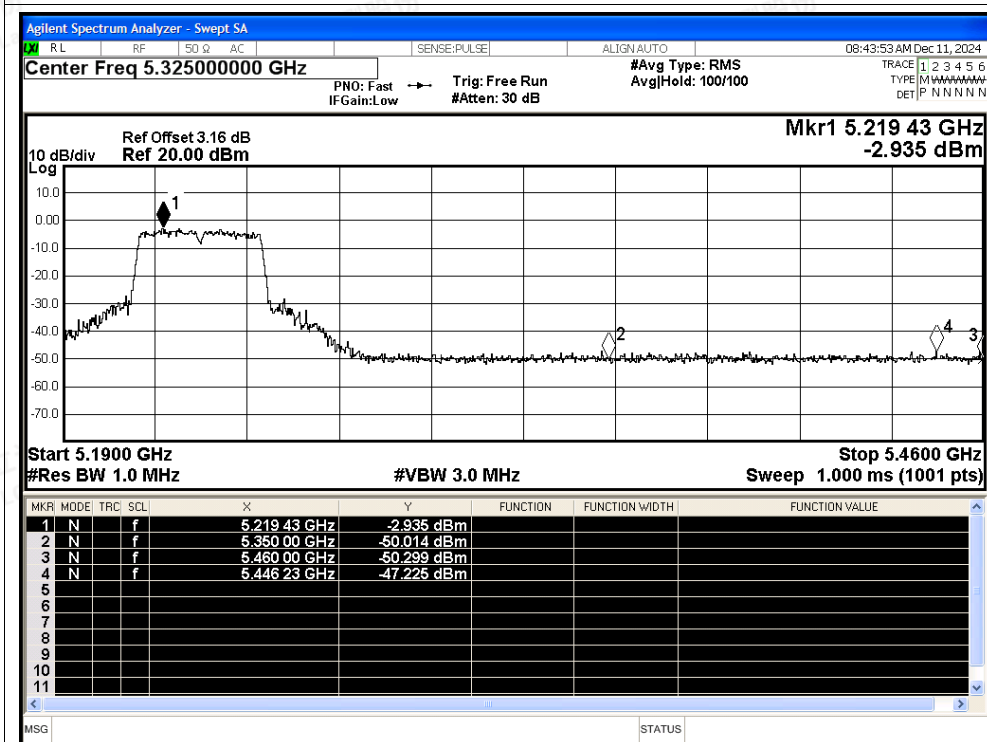

Restrict Band NVNT ac40 5230MHz Ant1 Average

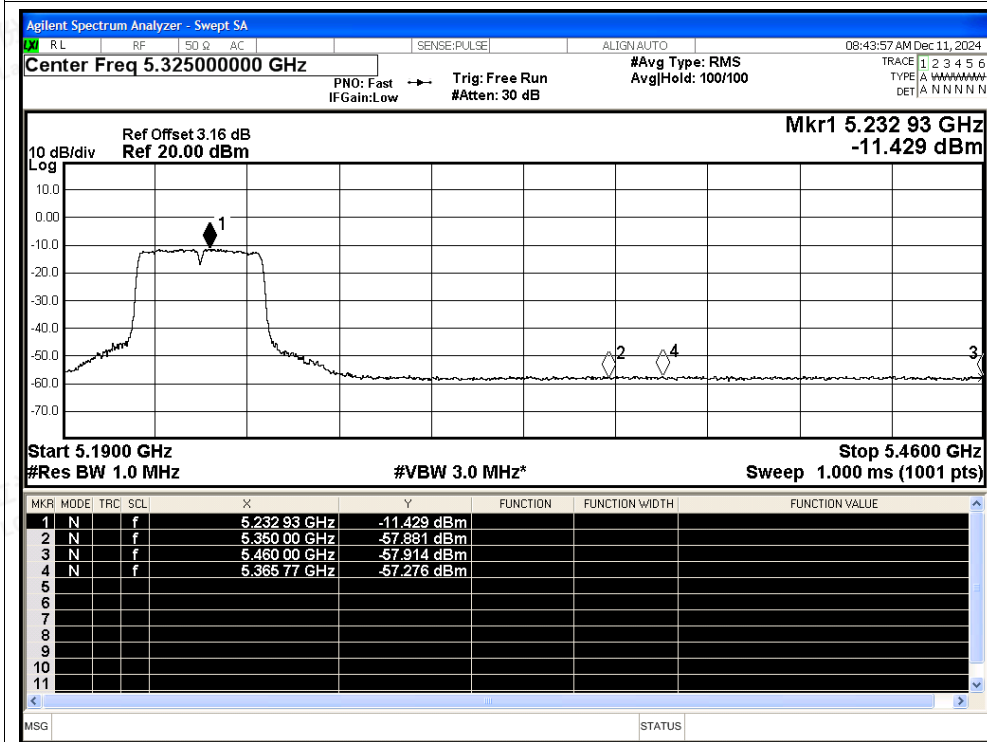

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

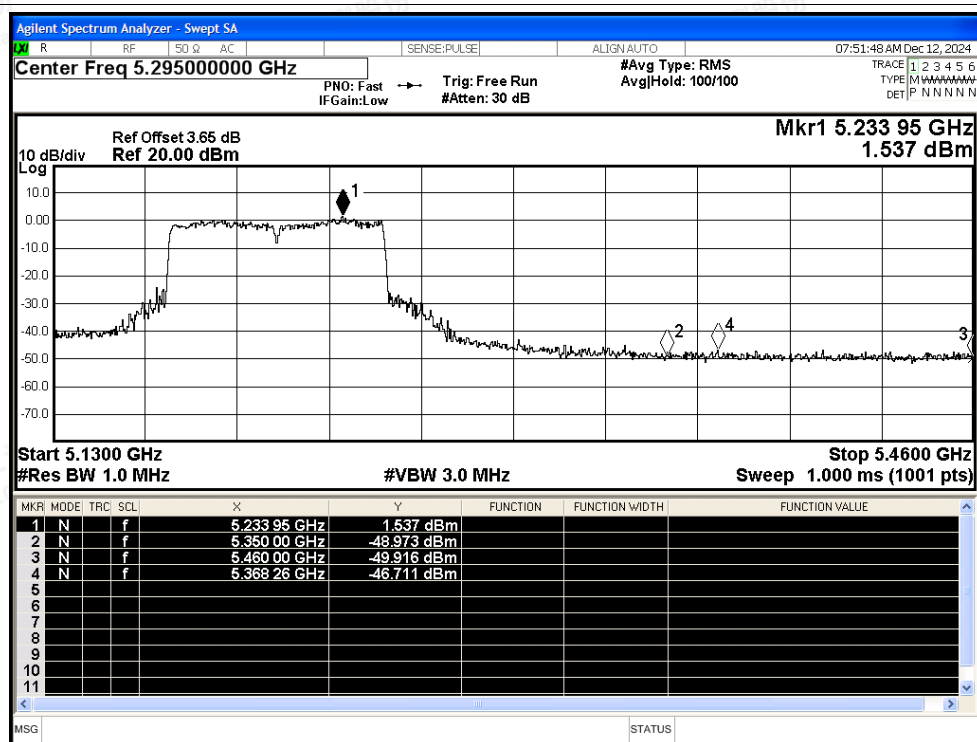

Restrict Band NVNT ac80 5210MHz Ant1 Average

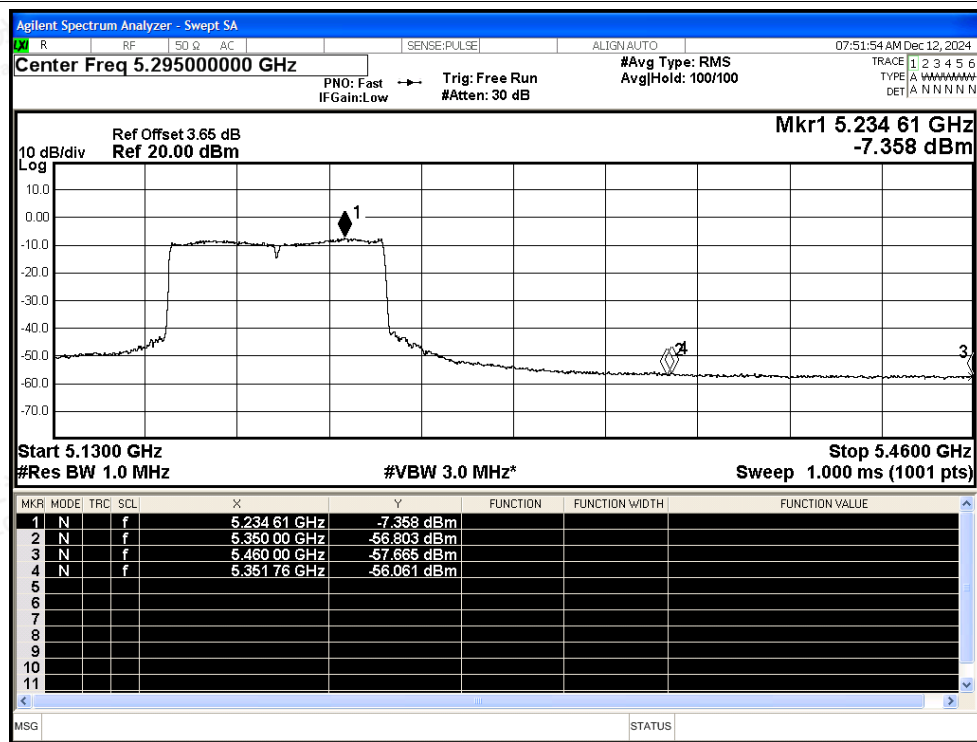

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

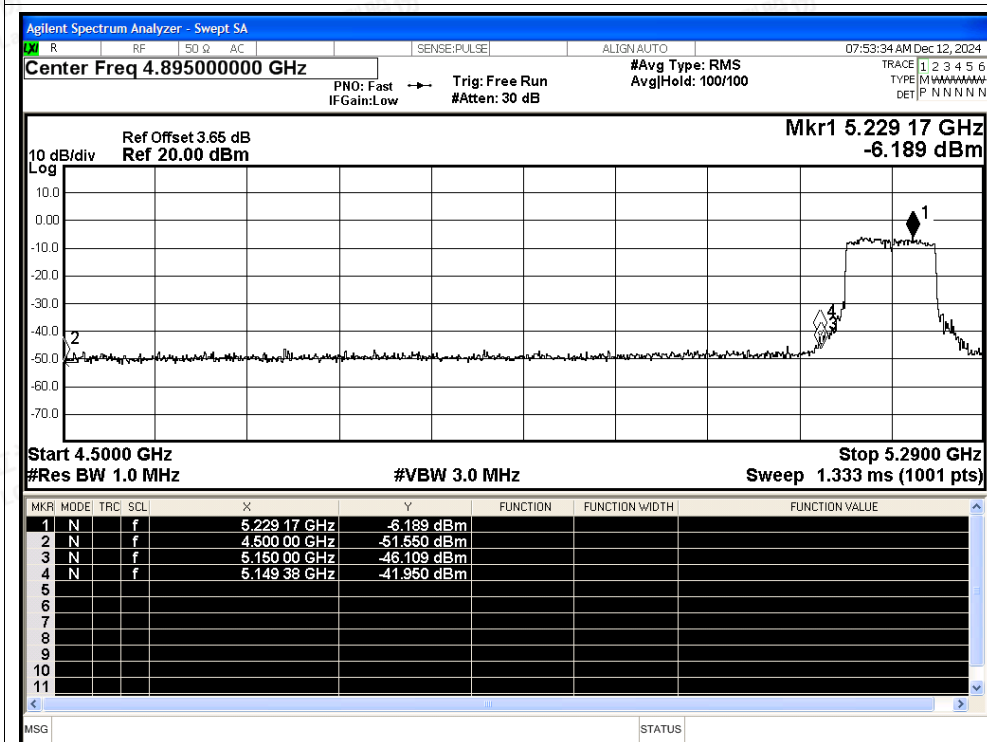

Restrict Band NVNT ac80 5210MHz Ant1 Average

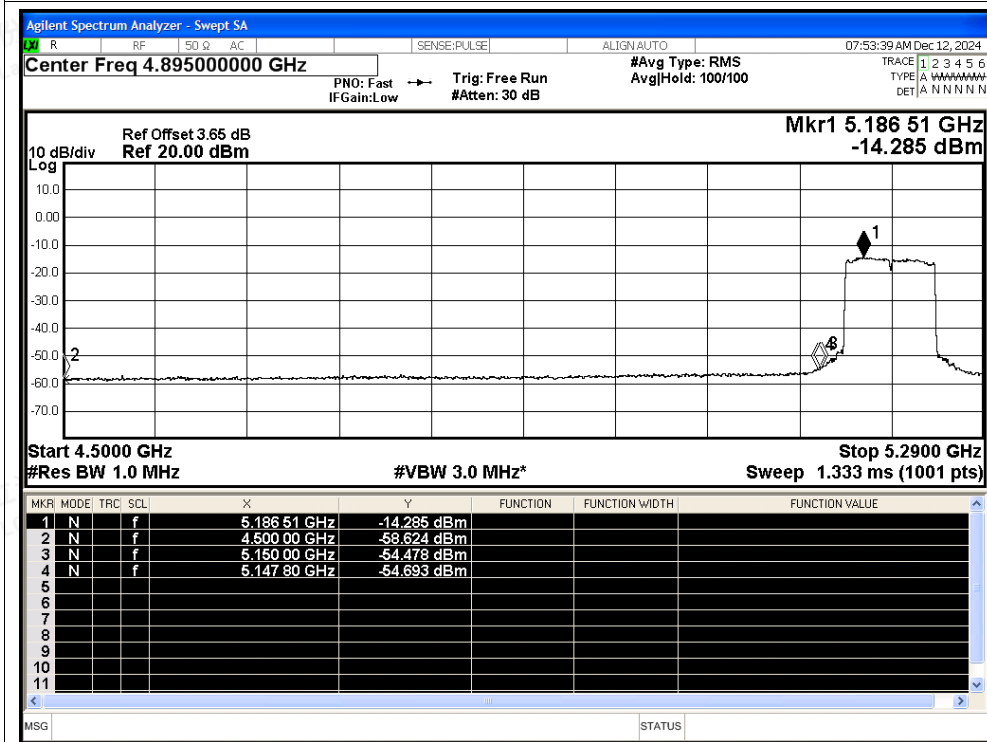

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant1 Peak

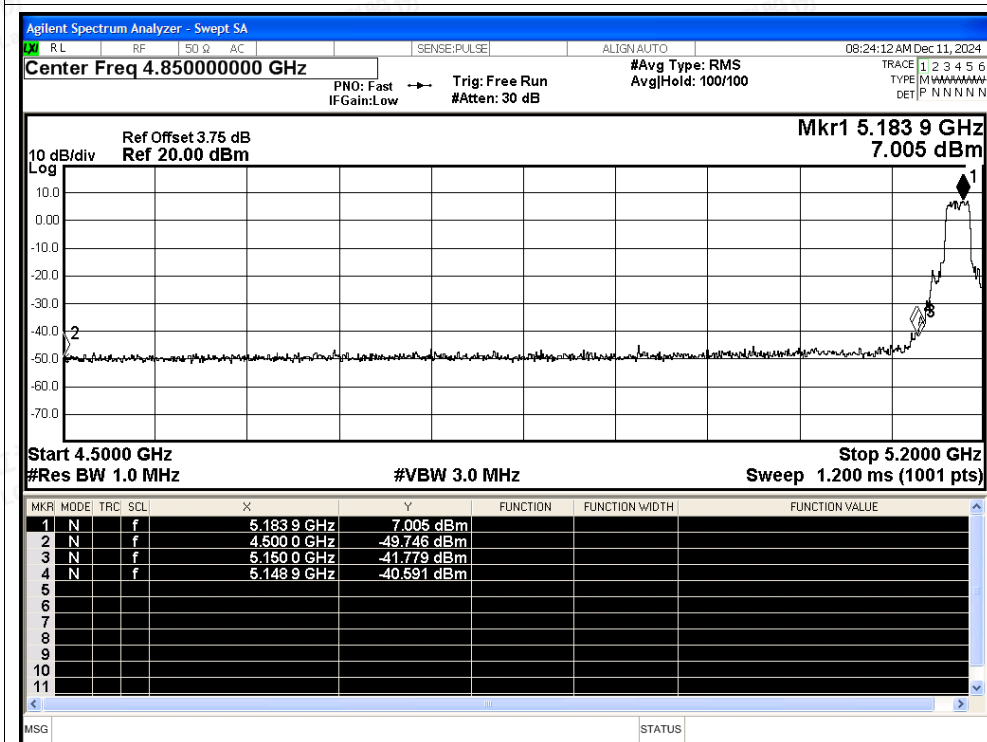

Restrict Band NVNT ax20 5180MHz Ant1 Average

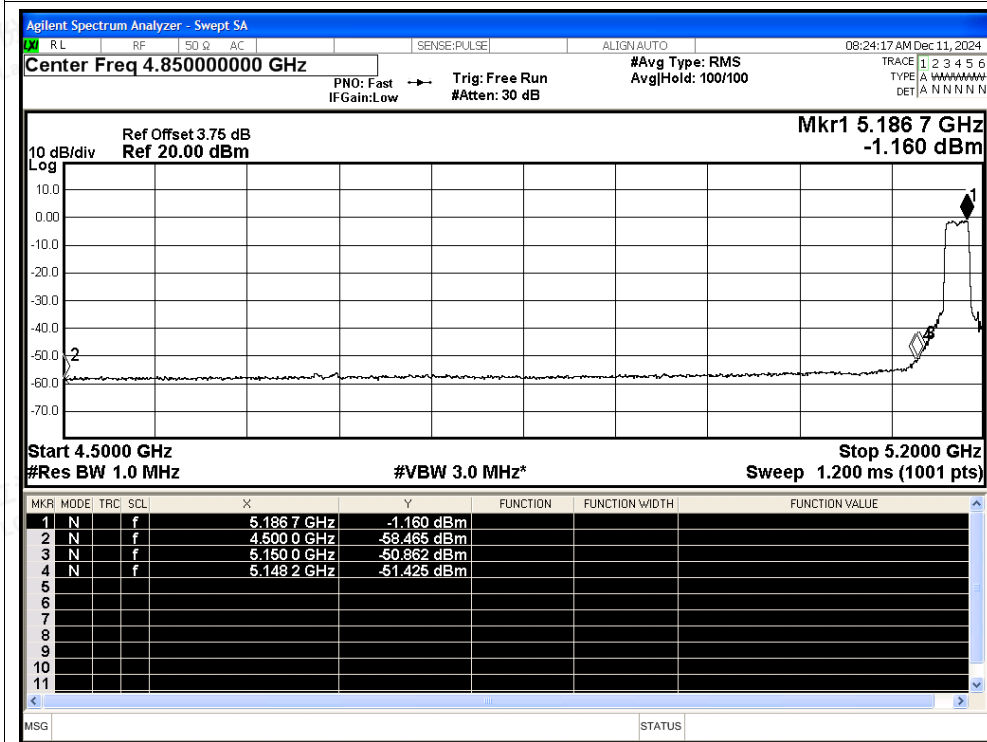

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

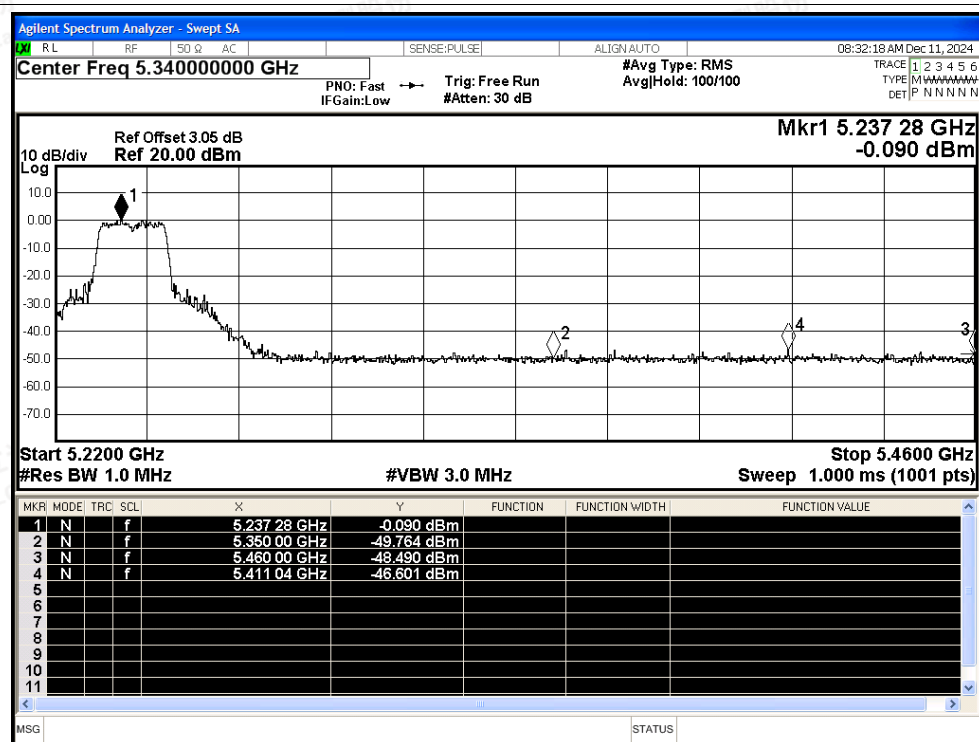

Restrict Band NVNT ax20 5240MHz Ant1 Average

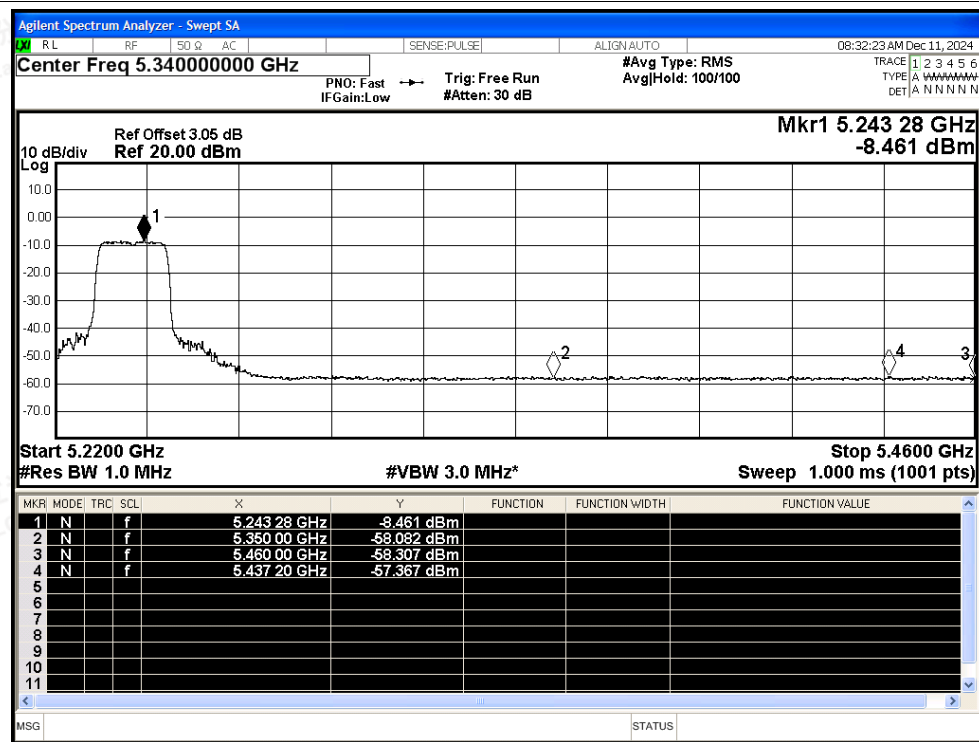

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

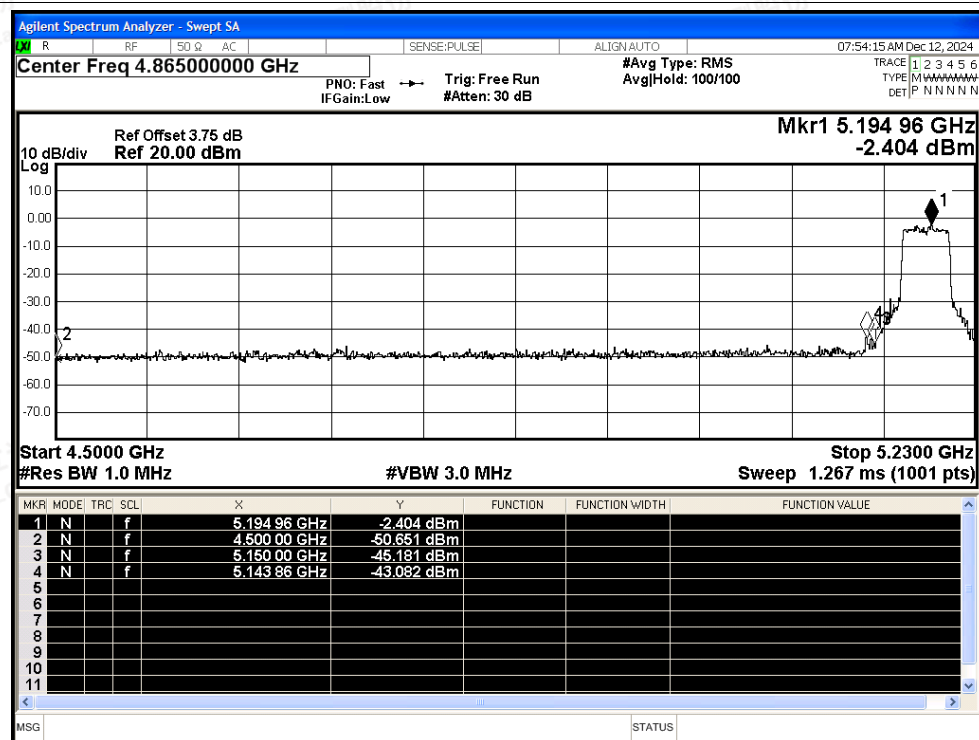

Restrict Band NVNT ax40 5190MHz Ant1 Average

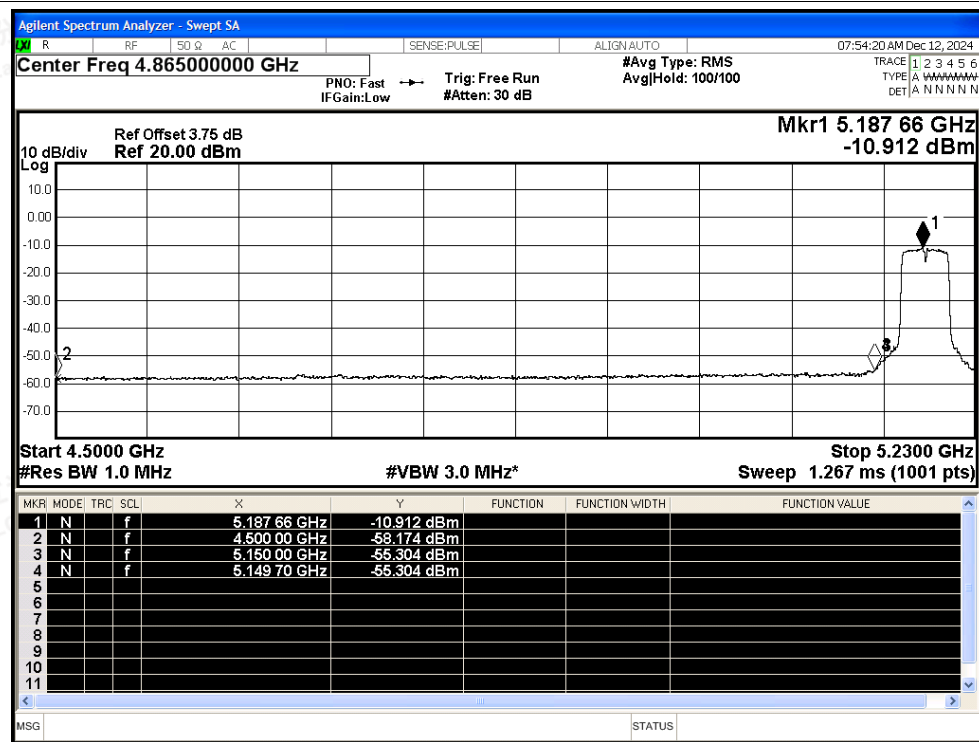

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

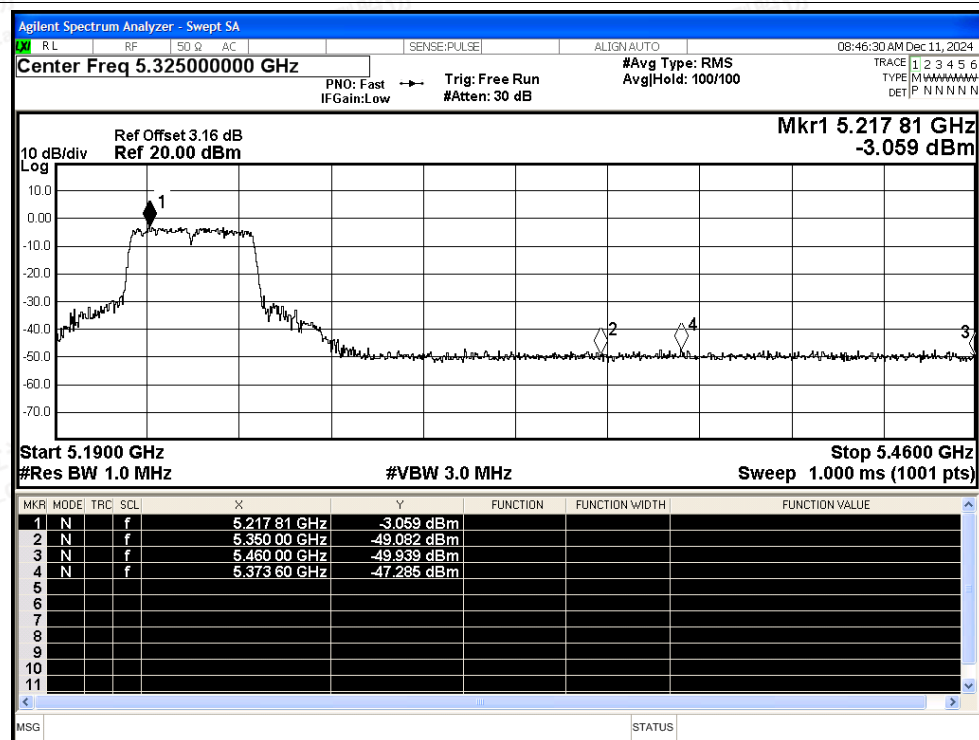

Restrict Band NVNT ax40 5230MHz Ant1 Average

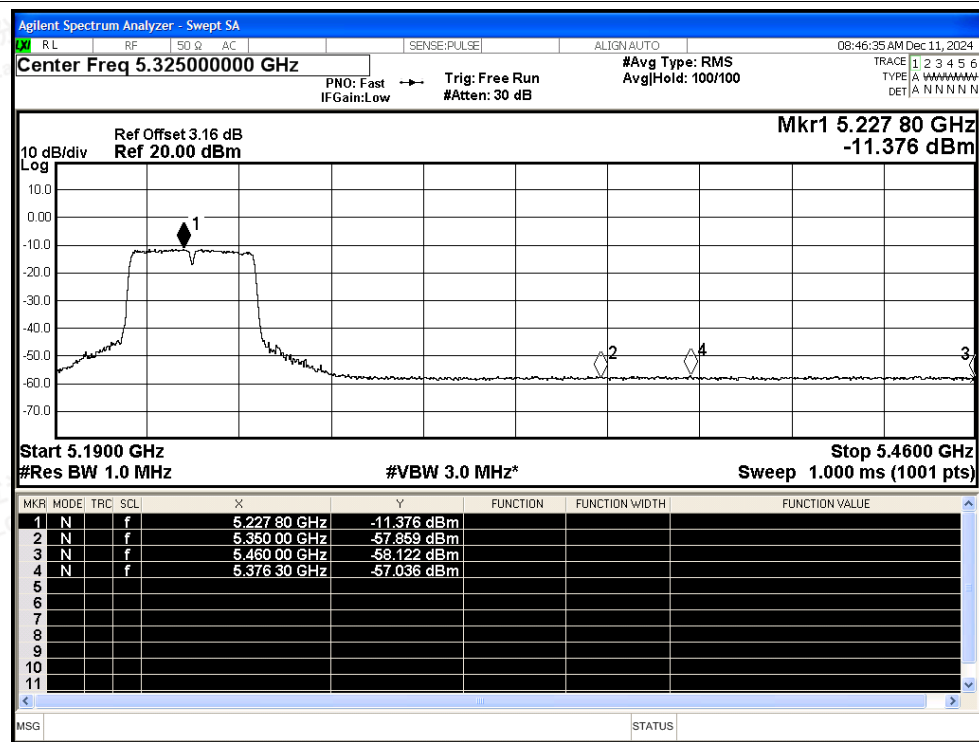

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

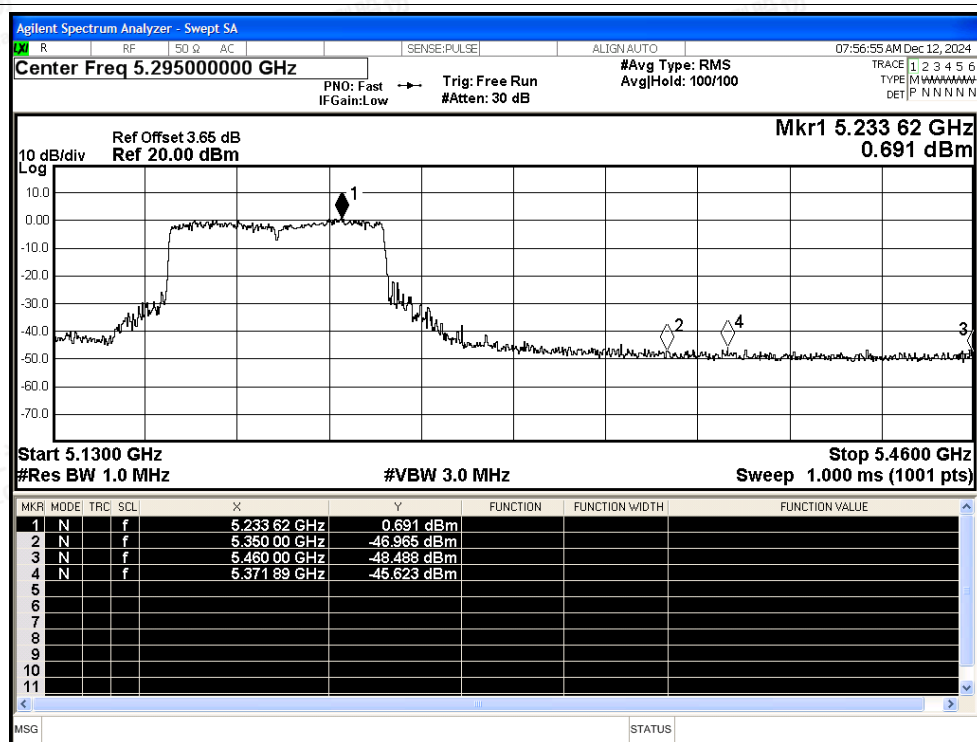

Restrict Band NVNT ax80 5210MHz Ant1 Average

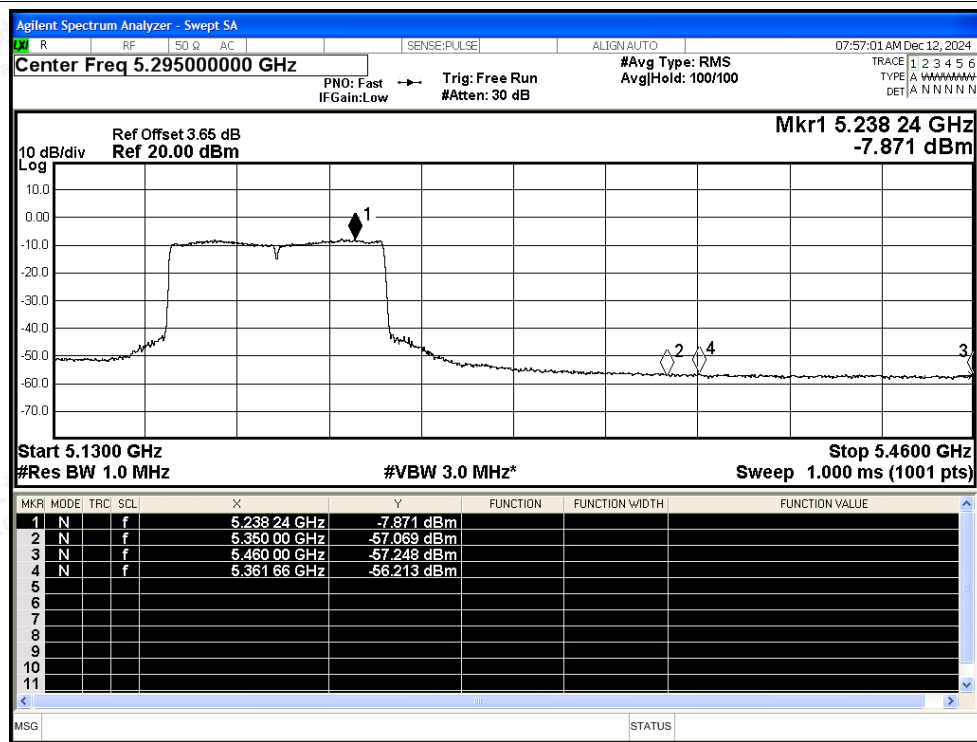

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

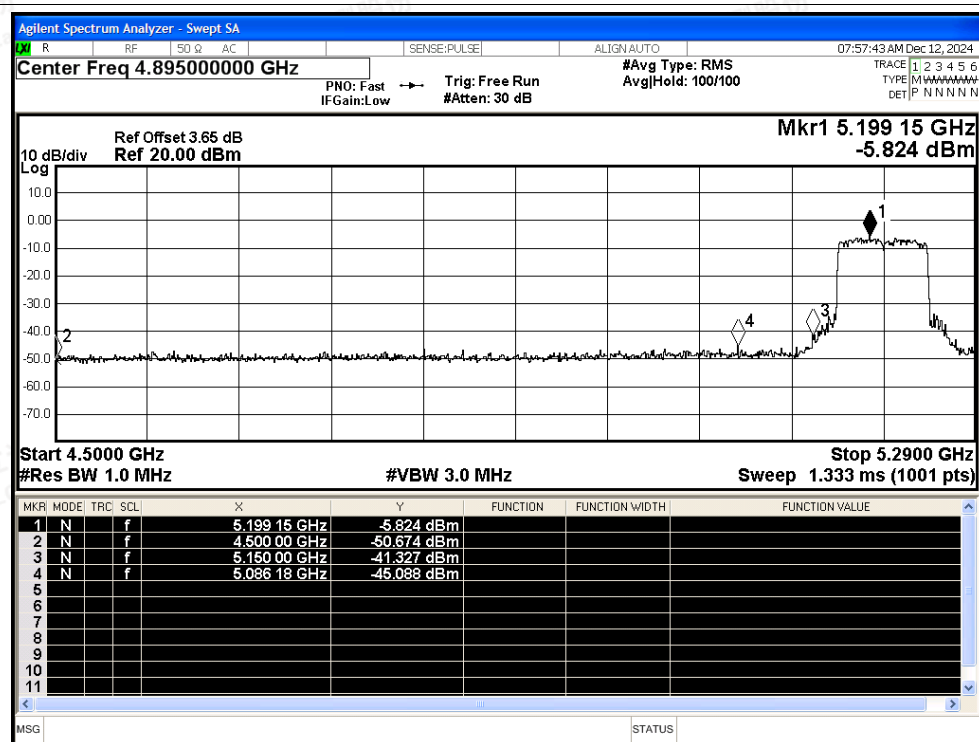

Restrict Band NVNT ax80 5210MHz Ant1 Average

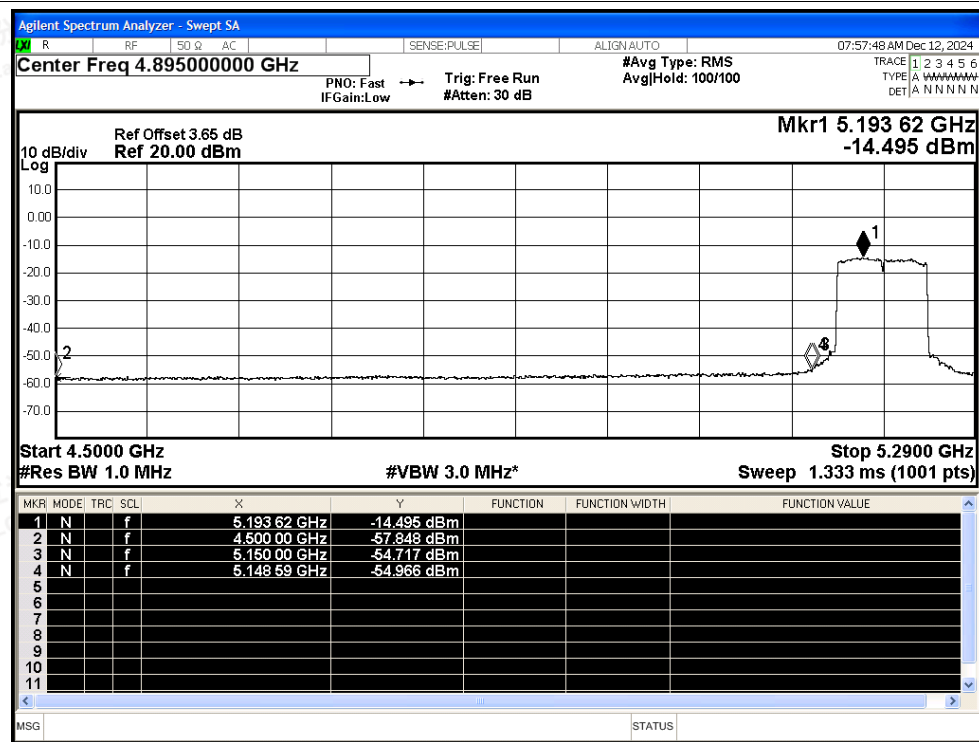

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.44	3	-	47.79	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58.33	3	0.24	40.14	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-43.83	3	-	54.40	Peak	68.2	Pass
NVNT	a	5180	Ant2	5148.2	-55.53	3	0.24	42.94	Average	54	Pass
NVNT	a	5180	Ant2	5150	-46.57	3	-	51.66	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-56.09	3	0.24	42.38	Average	54	Pass
NVNT	a	5240	Ant2	5350	-49.76	3	-	48.47	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.9	3	0.24	40.57	Average	54	Pass
NVNT	a	5240	Ant2	5370.24	-47.28	3	-	50.95	Peak	68.2	Pass
NVNT	a	5240	Ant2	5387.04	-57.3	3	0.24	41.17	Average	54	Pass
NVNT	a	5240	Ant2	5460	-50.72	3	-	47.51	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-57.74	3	0.24	40.73	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-49.94	3	-	48.29	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.37	3	0.12	39.98	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-41.19	3	-	57.04	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5148.9	-55.36	3	0.12	42.99	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-38.9	3	-	59.33	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-54.83	3	0.12	43.52	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-47.92	3	-	50.31	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-58.65	3	0.12	39.70	Average	54	Pass
NVNT	n20	5240	Ant2	5429.76	-46.95	3	-	51.28	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5411.04	-56.93	3	0.12	41.42	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-49.56	3	-	48.67	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-58.5	3	0.12	39.85	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-49.5	3	-	48.73	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.31	3	0.24	40.16	Average	54	Pass
NVNT	n40	5190	Ant2	5149.7	-43.88	3	-	54.35	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-54.57	3	0.24	43.90	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-43.88	3	-	54.35	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-54.57	3	0.24	43.90	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-48.84	3	-	49.39	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-57.72	3	0.24	40.75	Average	54	Pass
NVNT	n40	5230	Ant2	5379	-47.02	3	-	51.21	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5455.14	-57.2	3	0.24	41.27	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-50.99	3	-	47.24	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-58.02	3	0.24	40.45	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-51.03	3	-	47.20	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-57.96	3	0	40.27	Average	54	Pass
NVNT	ac20	5180	Ant2	5142.6	-45.12	3	-	53.11	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5149.6	-55.13	3	0	43.10	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-43.38	3	-	54.85	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-55.31	3	0	42.92	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-49.6	3	-	48.63	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.58	3	0.12	40.77	Average	54	Pass
NVNT	ac20	5240	Ant2	5374.08	-46.73	3	-	51.50	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5373.12	-56.98	3	0.12	41.37	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-50.09	3	-	48.14	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.18	3	0.12	40.17	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.03	3	-	48.20	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-57.78	3	0.24	40.69	Average	54	Pass
NVNT	ac40	5190	Ant2	5148.97	-42.56	3	-	55.67	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-54.64	3	0.24	43.83	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-43.21	3	-	55.02	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-54.89	3	0.24	43.58	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-50.66	3	-	47.57	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-57.81	3	0.24	40.66	Average	54	Pass
NVNT	ac40	5230	Ant2	5417.61	-46.7	3	-	51.53	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5367.93	-57.08	3	0.24	41.39	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-48.81	3	-	49.42	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-58.13	3	0.24	40.34	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.95	3	-	49.28	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.62	3	0.25	41.86	Average	54	Pass
NVNT	ac80	5210	Ant2	5397.63	-46.68	3	-	51.55	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5355.72	-56.33	3	0.25	42.15	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-50.32	3	-	47.91	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-57.16	3	0.25	41.32	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-51.05	3	-	47.18	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-57.87	3	0.25	40.61	Average	54	Pass
NVNT	ac80	5210	Ant2	5144.64	-41.14	3	-	57.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-54.14	3	0.25	44.34	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-44.52	3	-	53.71	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-53.73	3	0.25	44.75	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-50.58	3	-	47.65	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.36	3	0.12	39.99	Average	54	Pass
NVNT	ax20	5180	Ant2	5149.6	-44.16	3	-	54.07	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-55.28	3	0.12	43.07	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-44.09	3	-	54.14	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-54.75	3	0.12	43.60	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-50.88	3	-	47.35	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-57.53	3	0.12	40.82	Average	54	Pass
NVNT	ax20	5240	Ant2	5456.16	-47.46	3	-	50.77	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5383.92	-57.26	3	0.12	41.09	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant2	5460	-50.29	3	-	47.94	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-58.45	3	0.12	39.90	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-50.64	3	-	47.59	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-57.96	3	0.24	40.51	Average	54	Pass
NVNT	ax40	5190	Ant2	5149.7	-39.78	3	-	58.45	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-55.03	3	0.24	43.44	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-39.78	3	-	58.45	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-55.03	3	0.24	43.44	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-49.33	3	-	48.90	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-57.96	3	0.24	40.51	Average	54	Pass
NVNT	ax40	5230	Ant2	5421.66	-46.88	3	-	51.35	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350.92	-57.04	3	0.24	41.43	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-50.23	3	-	48.00	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-57.81	3	0.24	40.66	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-48.3	3	-	49.93	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-56.81	3	0.25	41.67	Average	54	Pass
NVNT	ax80	5210	Ant2	5374.2	-45.87	3	-	52.36	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5361.66	-56.38	3	0.25	42.10	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-50.26	3	-	47.97	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-57.59	3	0.25	40.89	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-51.16	3	-	47.07	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.51	3	0.25	39.97	Average	54	Pass
NVNT	ax80	5210	Ant2	5146.22	-42.75	3	-	55.48	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5148.59	-54.39	3	0.25	44.09	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-43.95	3	-	54.28	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-53.92	3	0.25	44.56	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

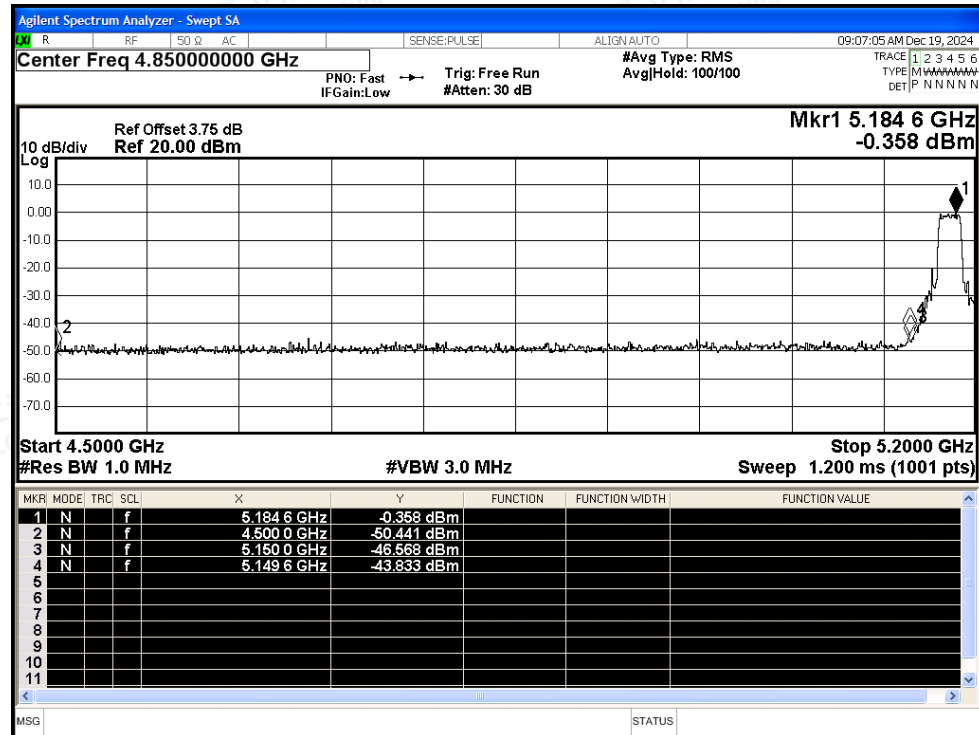

Restrict Band NVNT a 5180MHz Ant2 Average

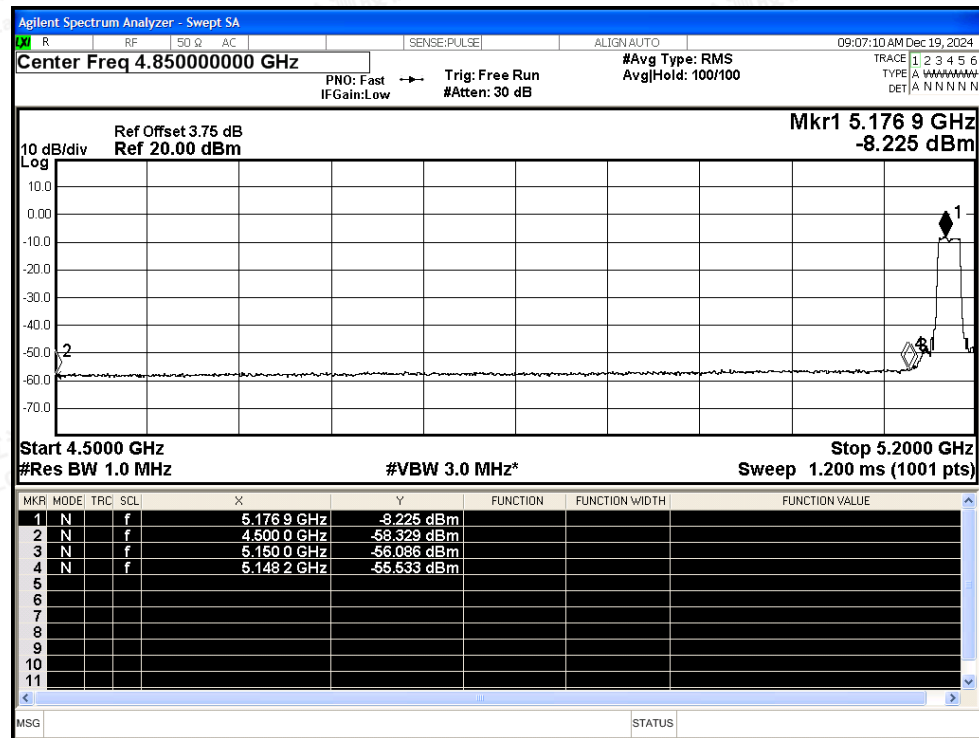

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

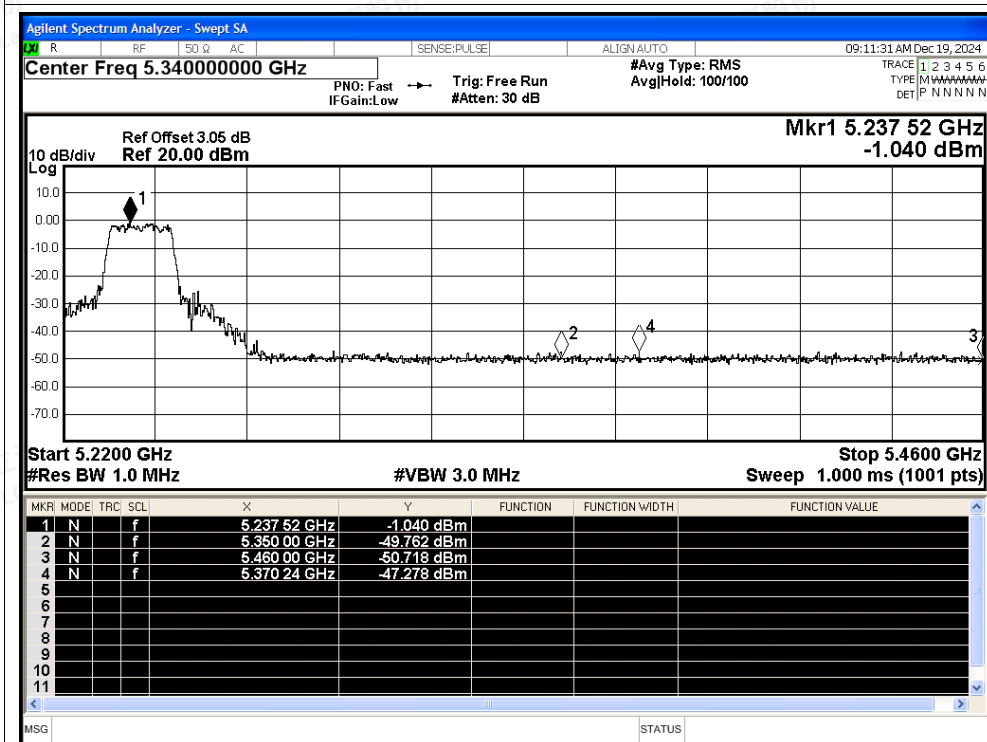

Restrict Band NVNT a 5240MHz Ant2 Average

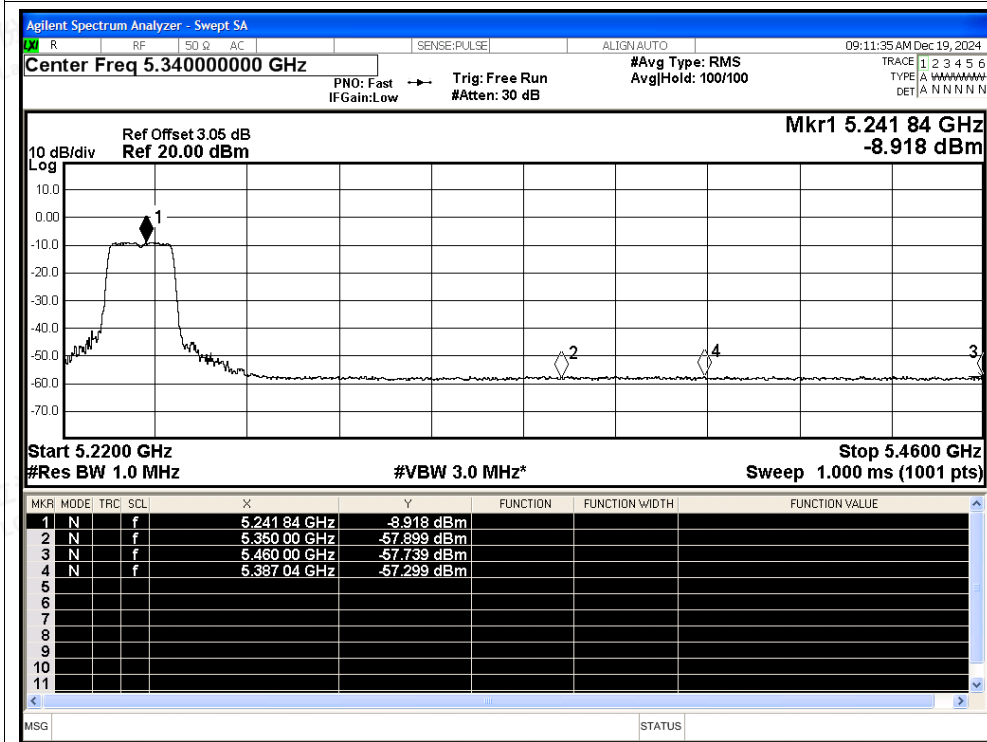

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

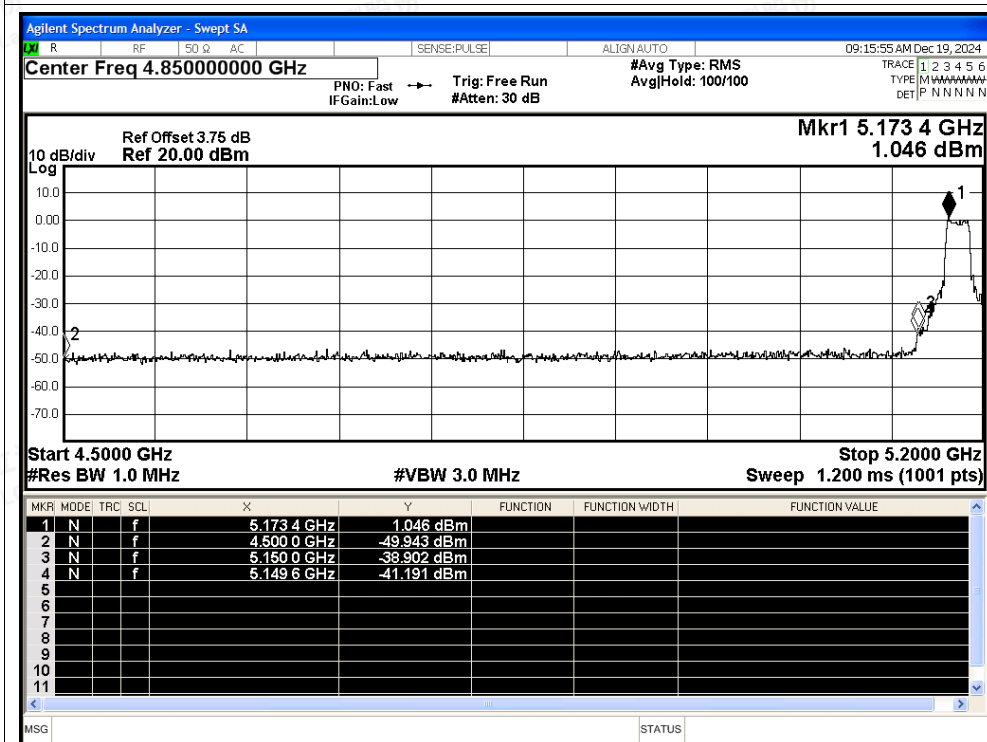

Restrict Band NVNT n20 5180MHz Ant2 Average

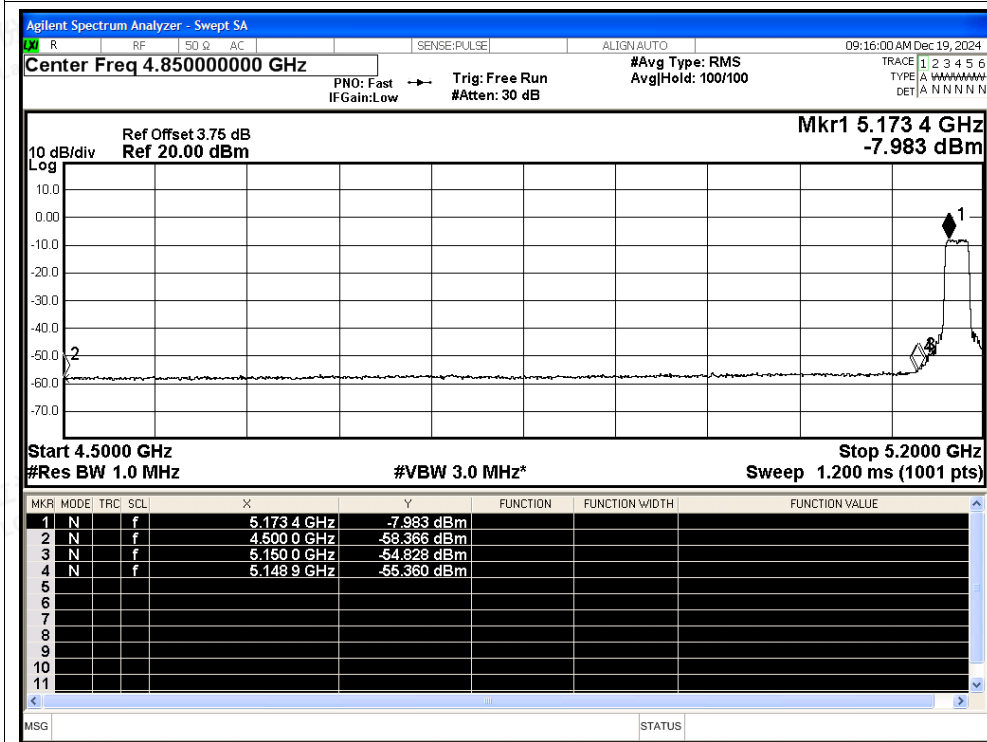

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

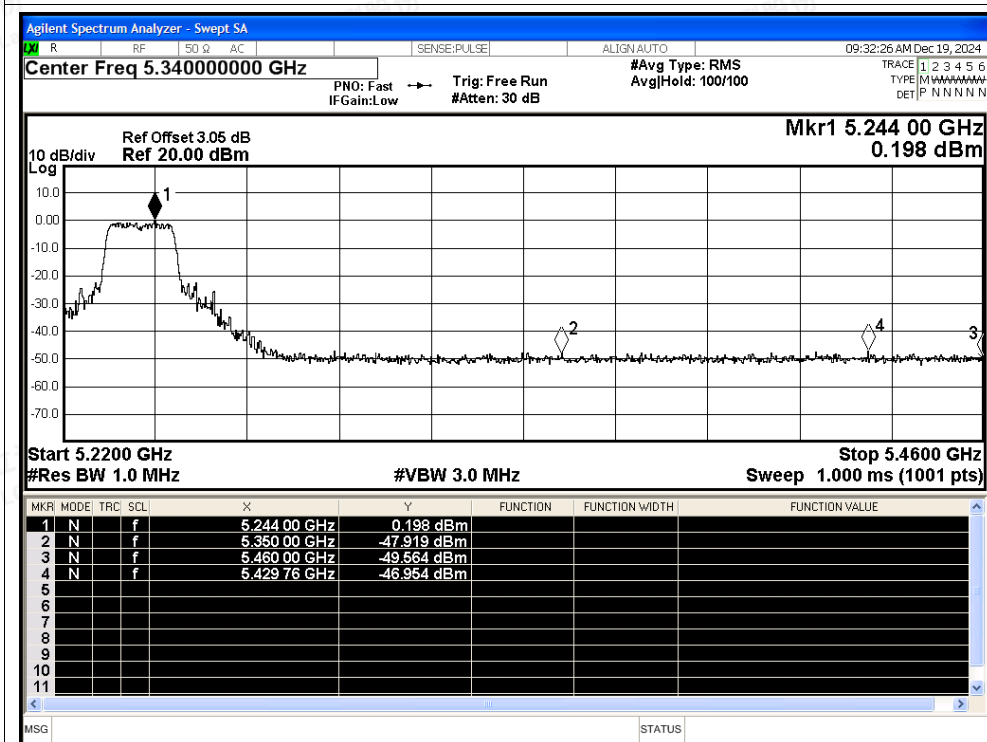

Restrict Band NVNT n20 5240MHz Ant2 Average

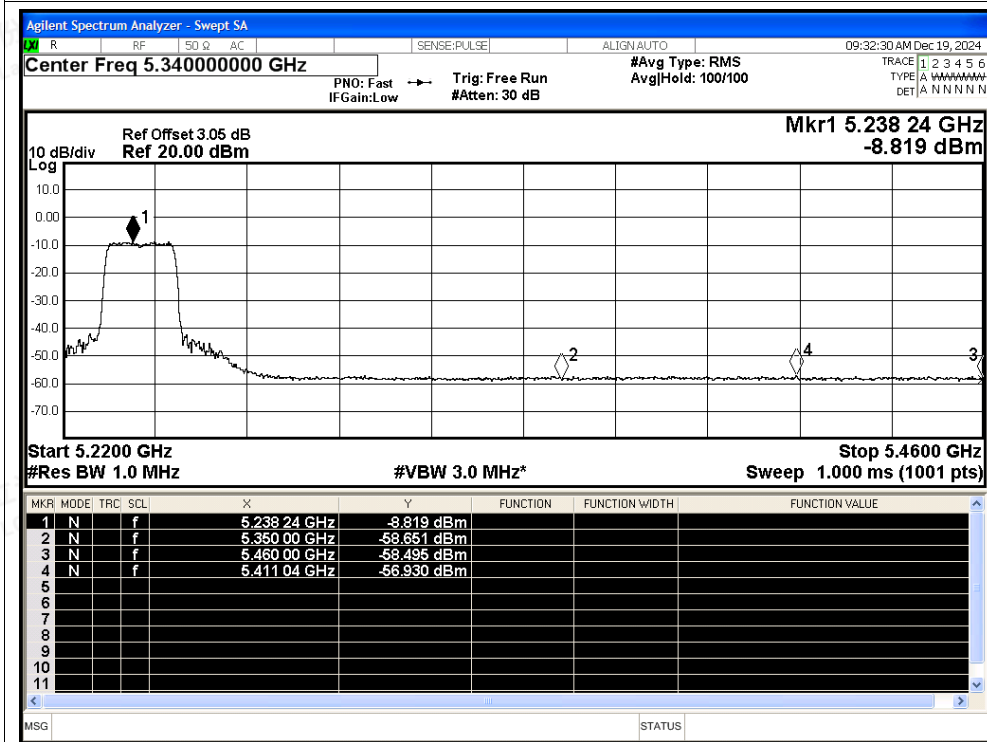

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

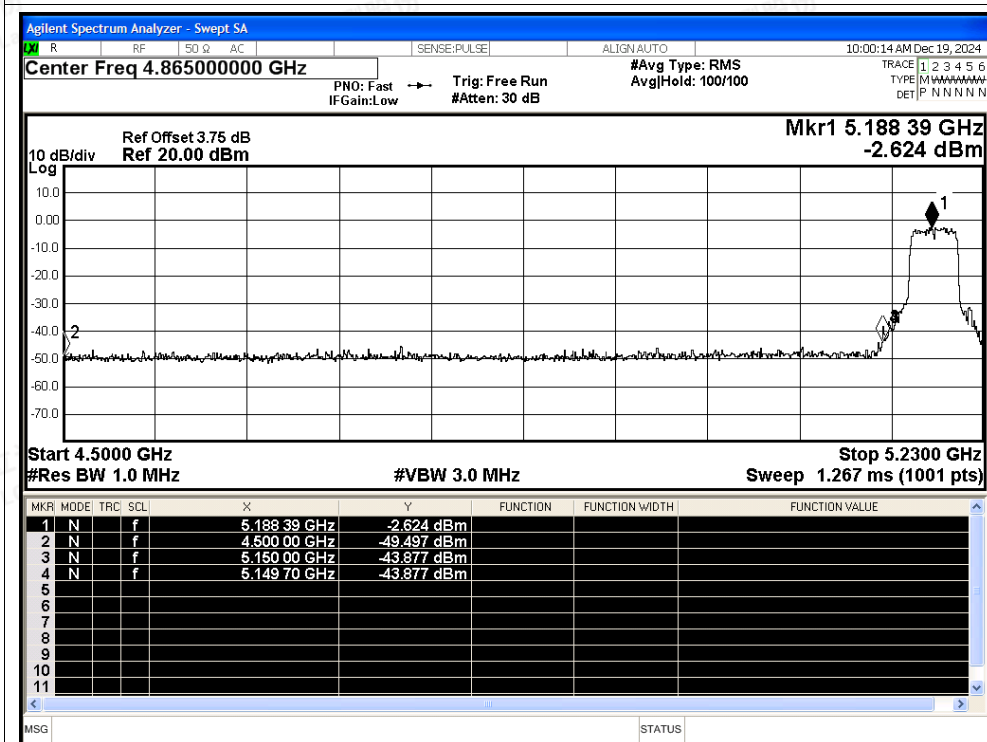

Restrict Band NVNT n40 5190MHz Ant2 Average

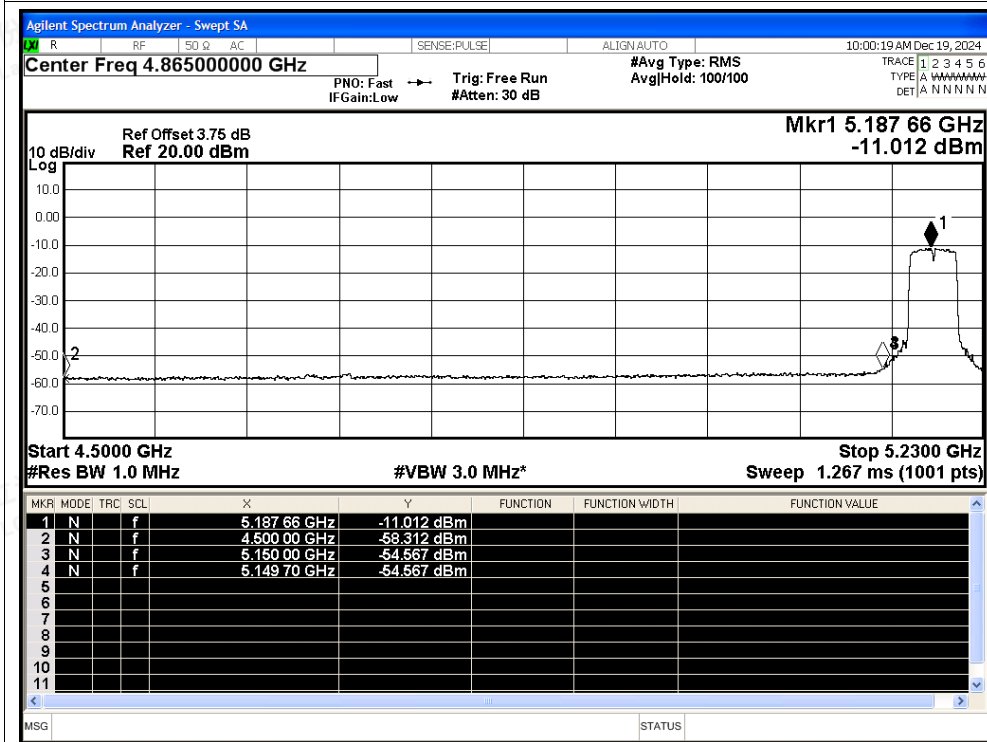

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

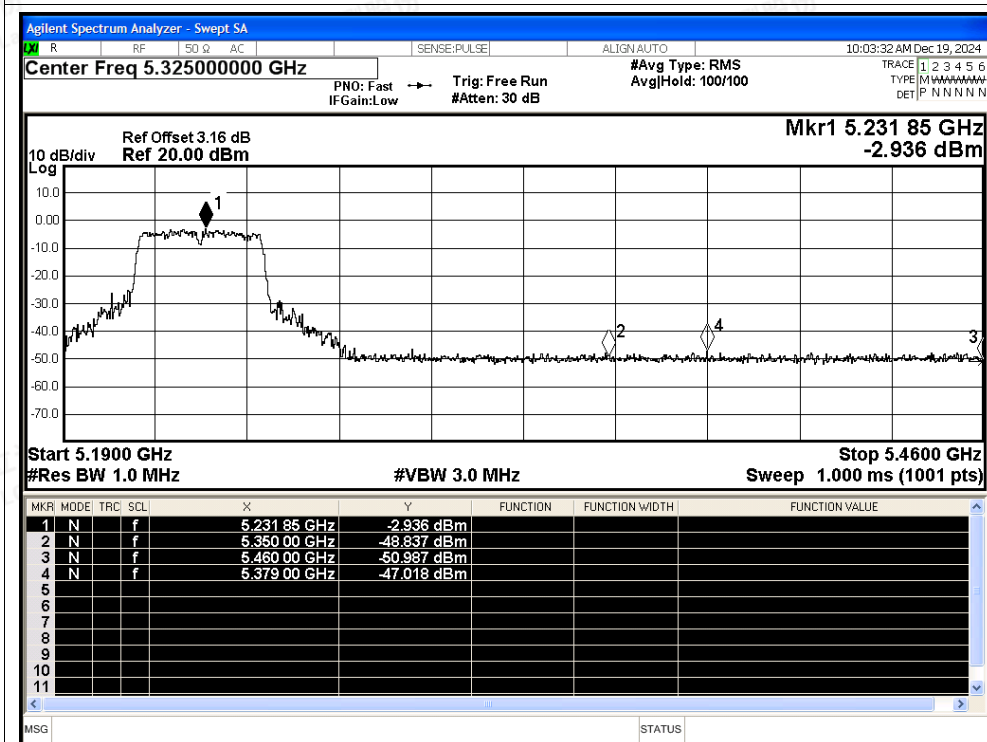

Restrict Band NVNT n40 5230MHz Ant2 Average

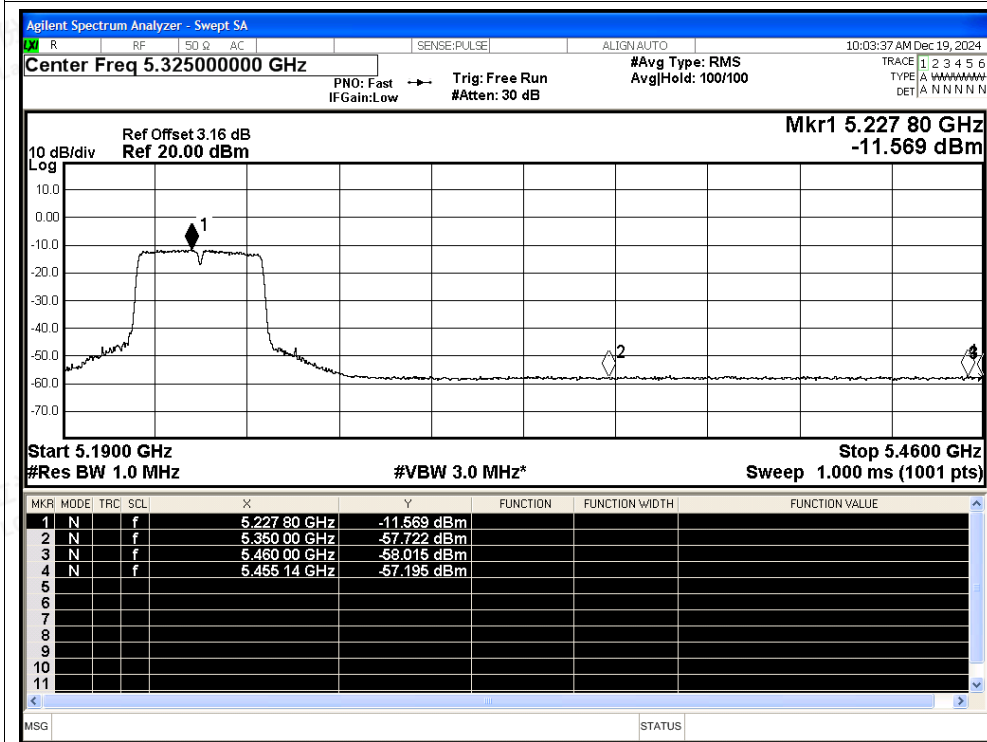

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

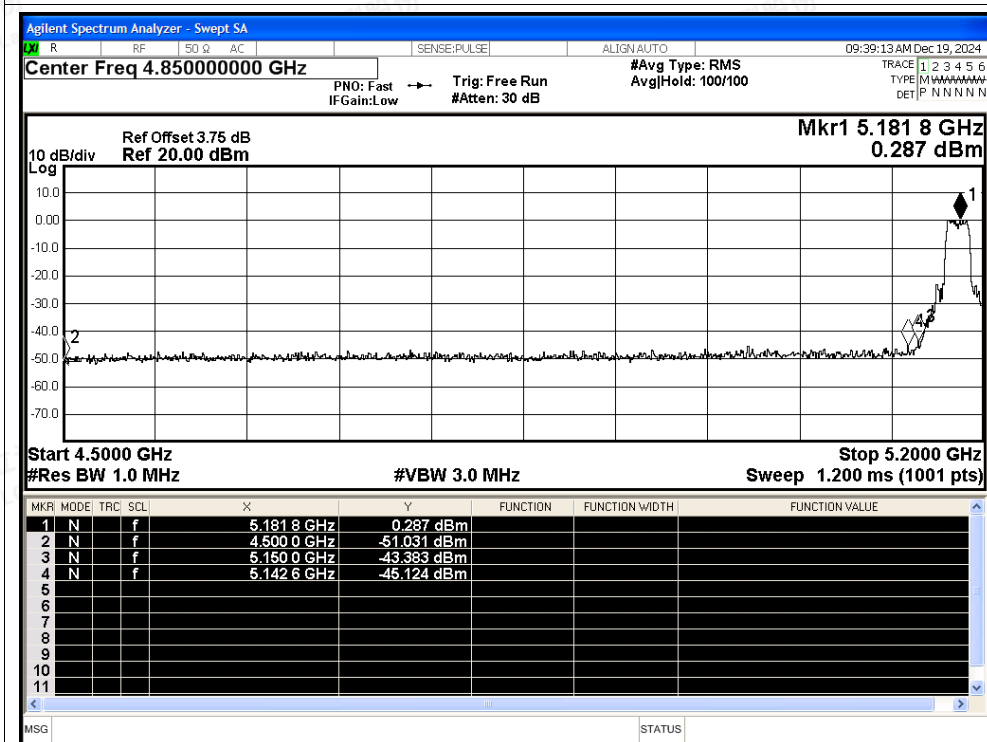

Restrict Band NVNT ac20 5180MHz Ant2 Average

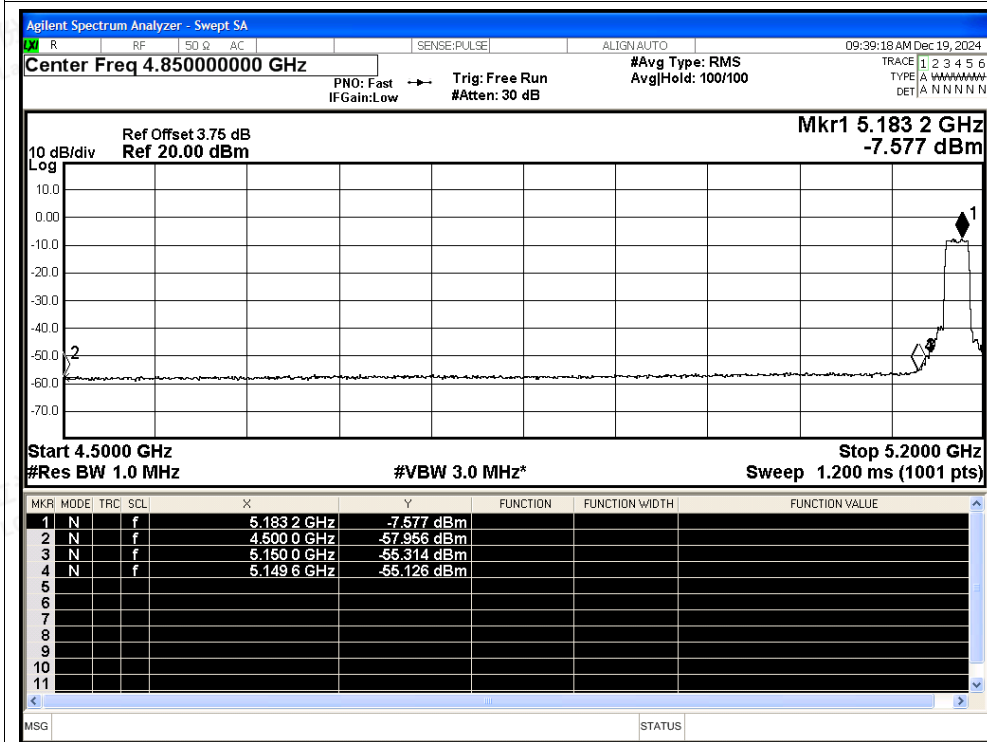

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

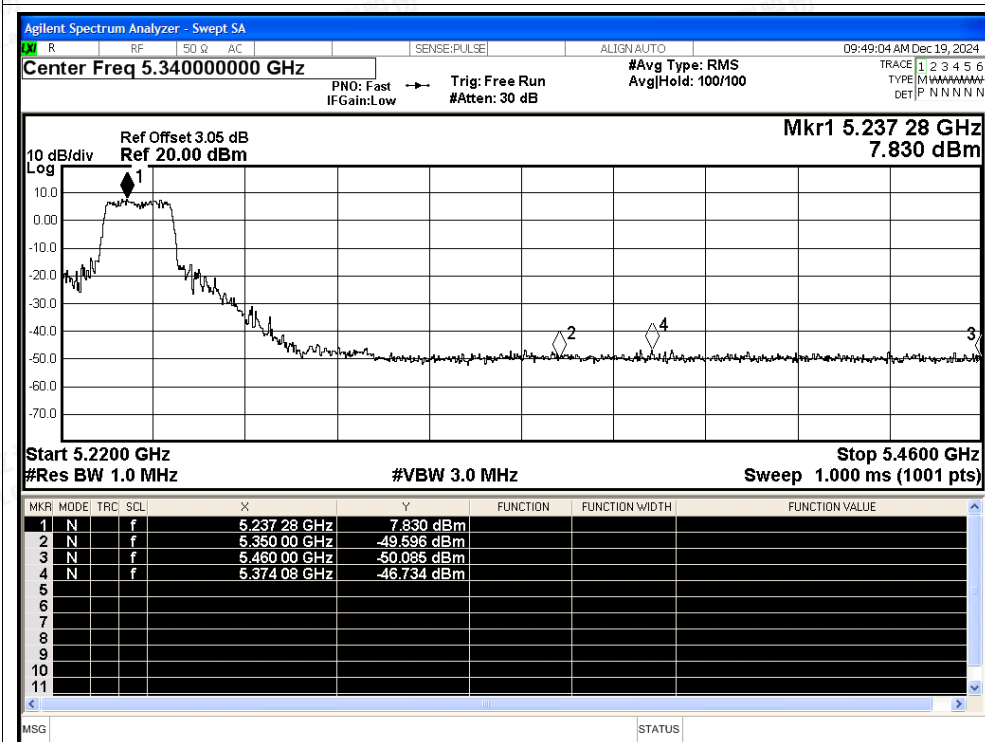

Restrict Band NVNT ac20 5240MHz Ant2 Average

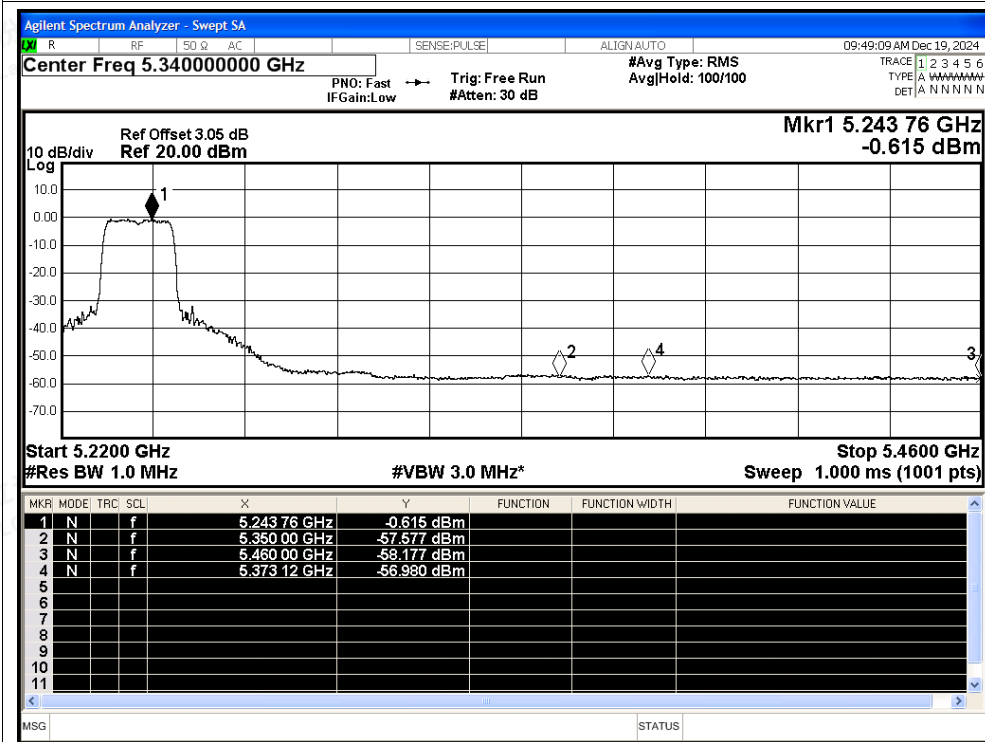

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

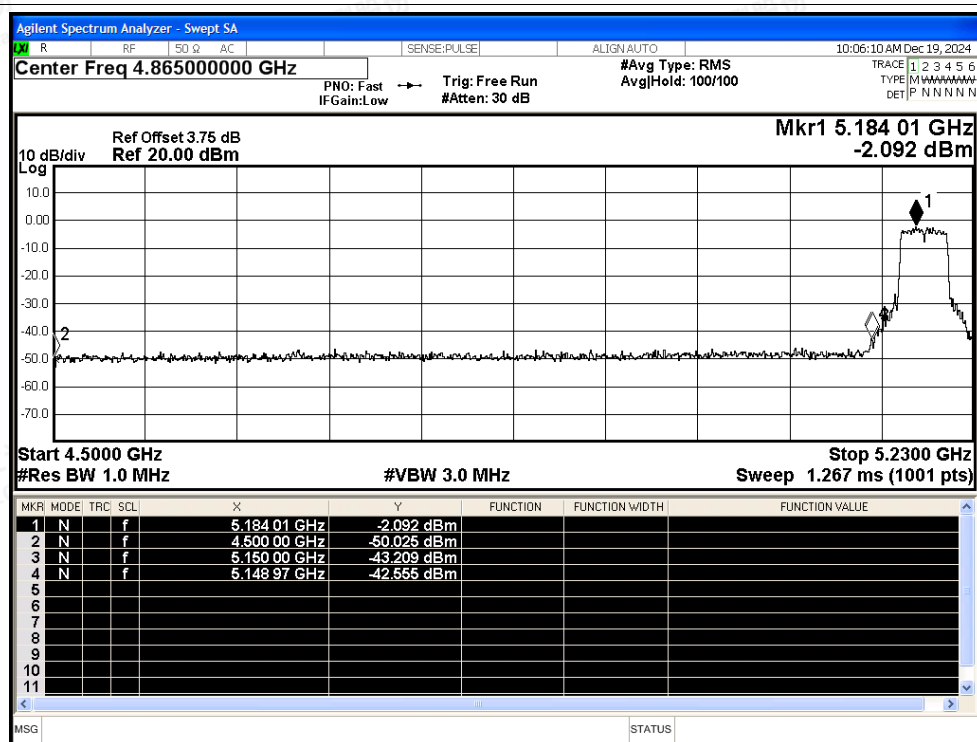

Restrict Band NVNT ac40 5190MHz Ant2 Average

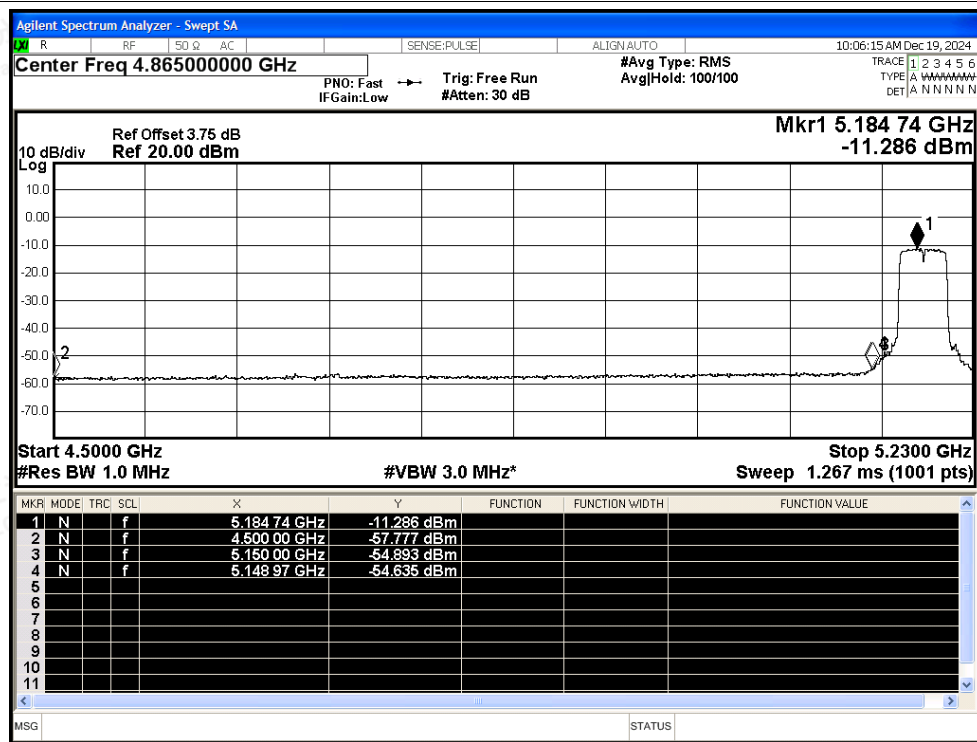

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

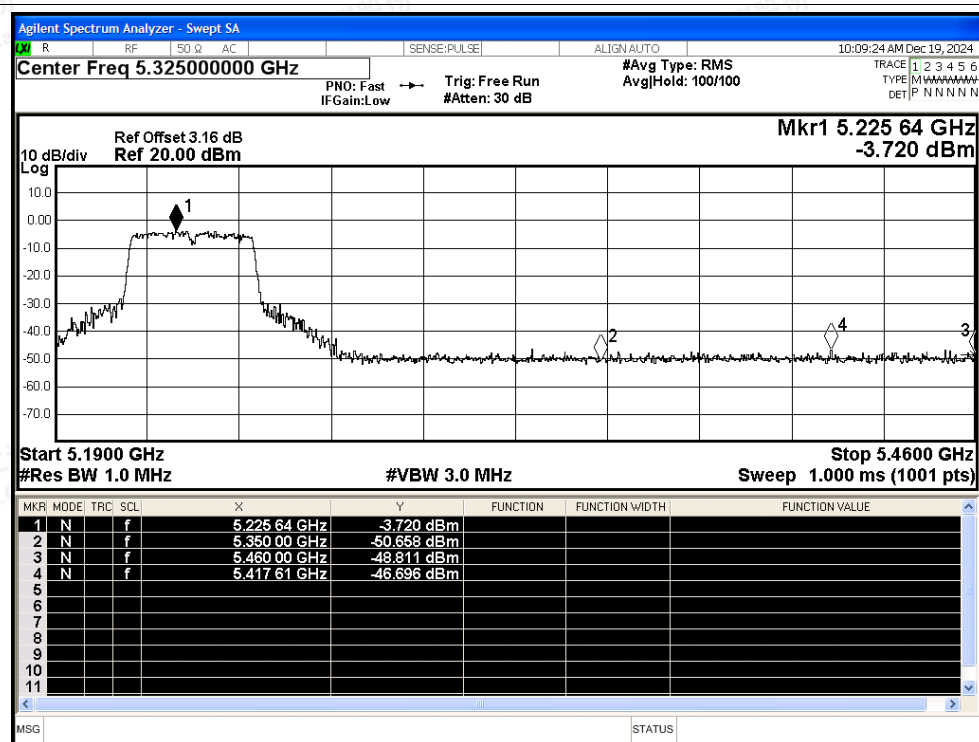

Restrict Band NVNT ac40 5230MHz Ant2 Average

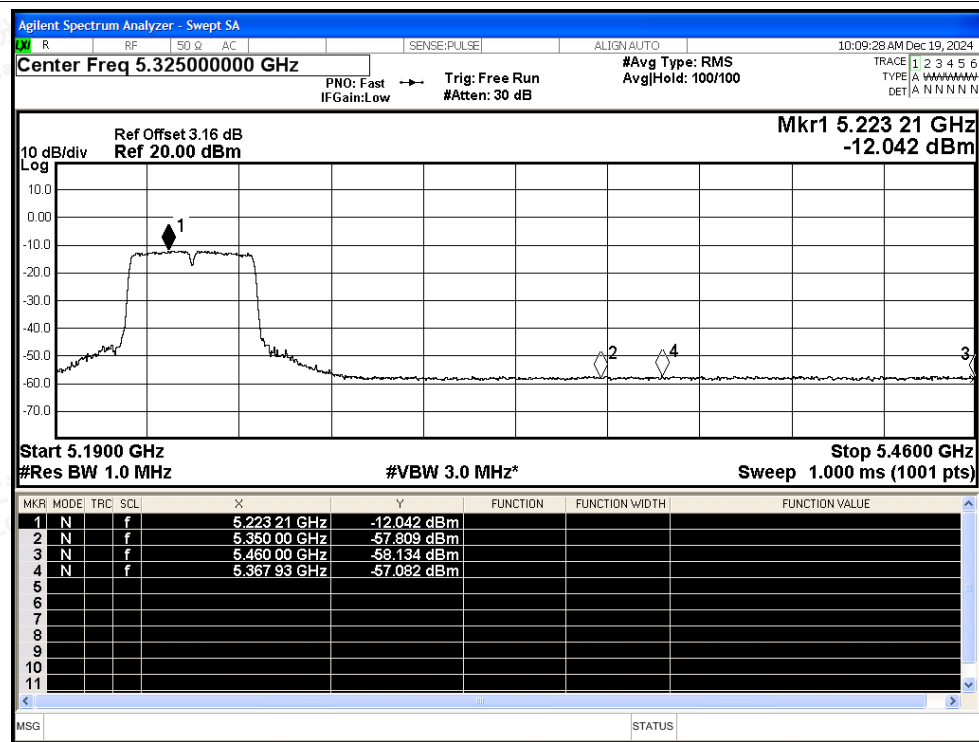

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

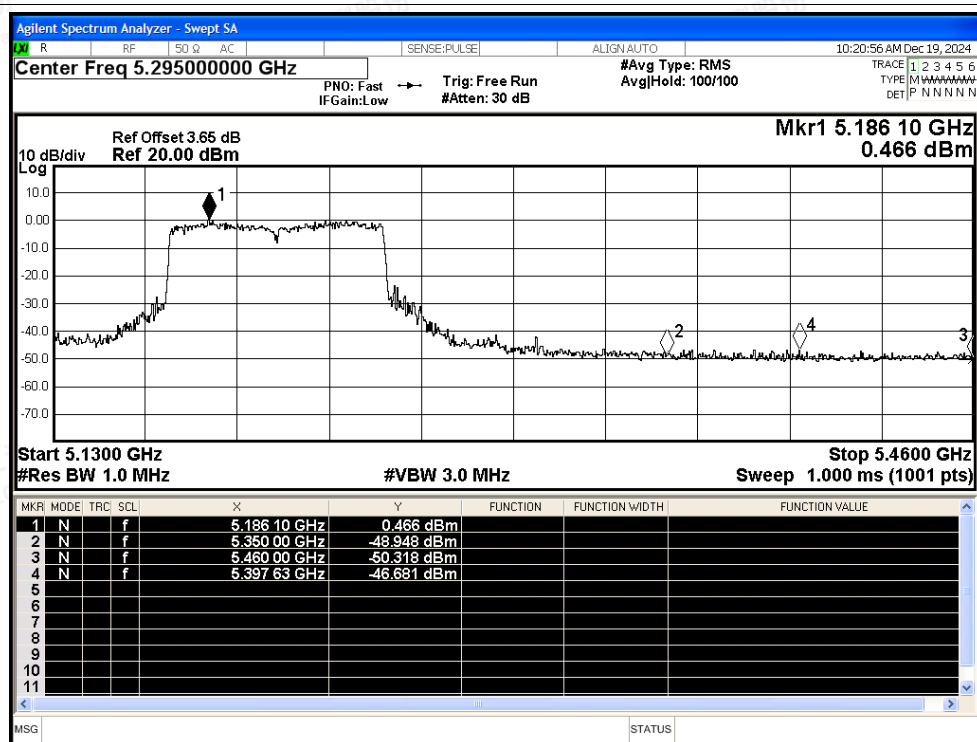

Restrict Band NVNT ac80 5210MHz Ant2 Average

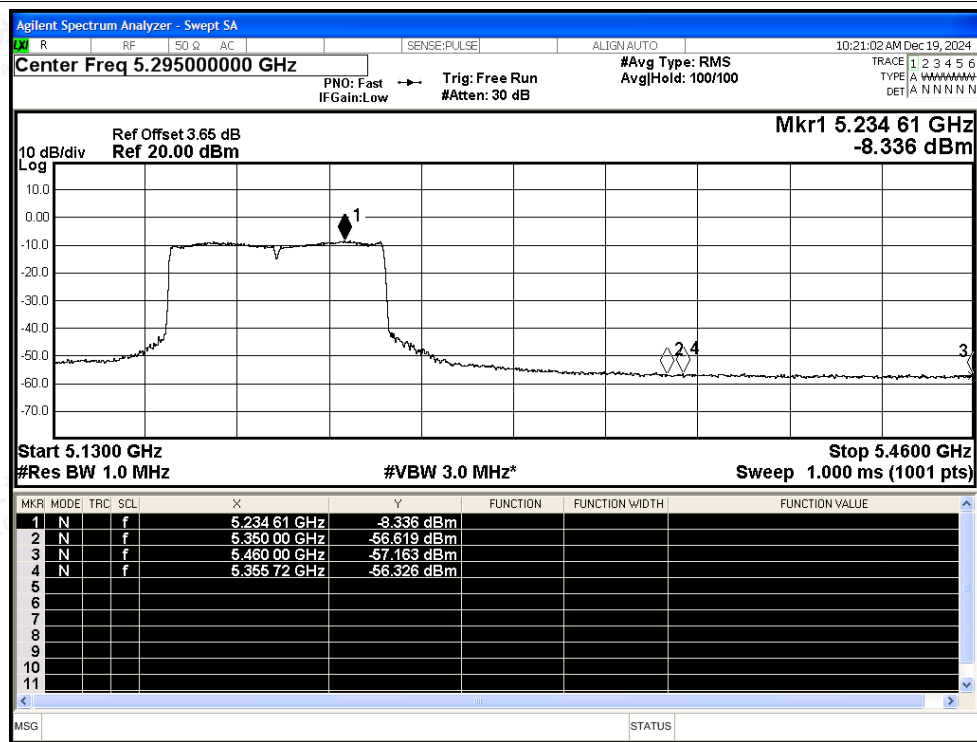

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

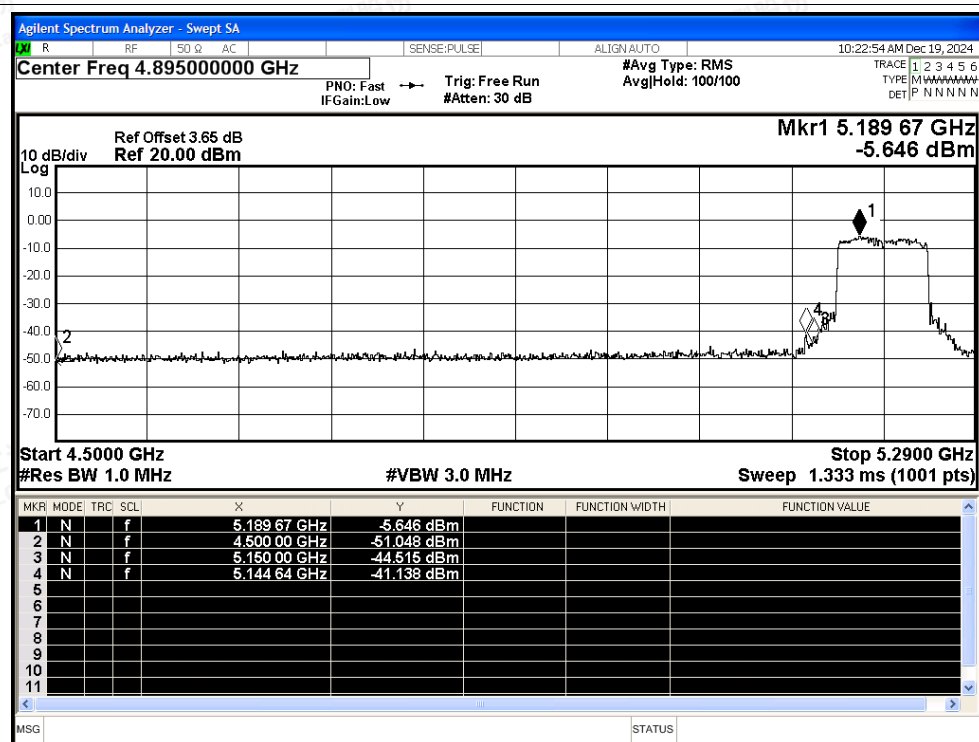

Restrict Band NVNT ac80 5210MHz Ant2 Average

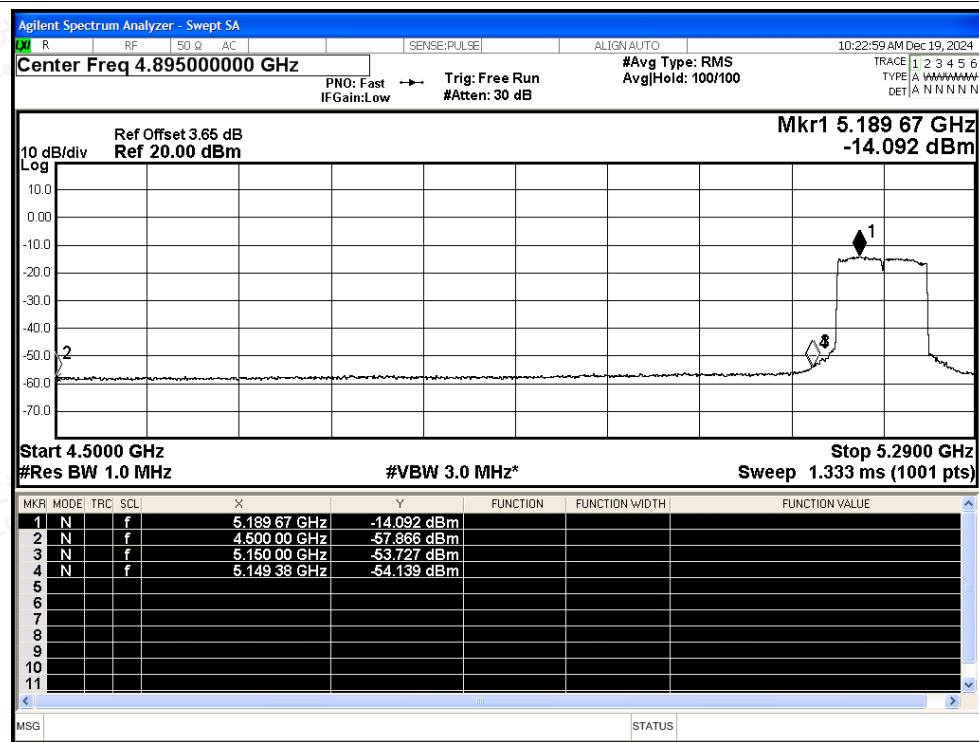

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

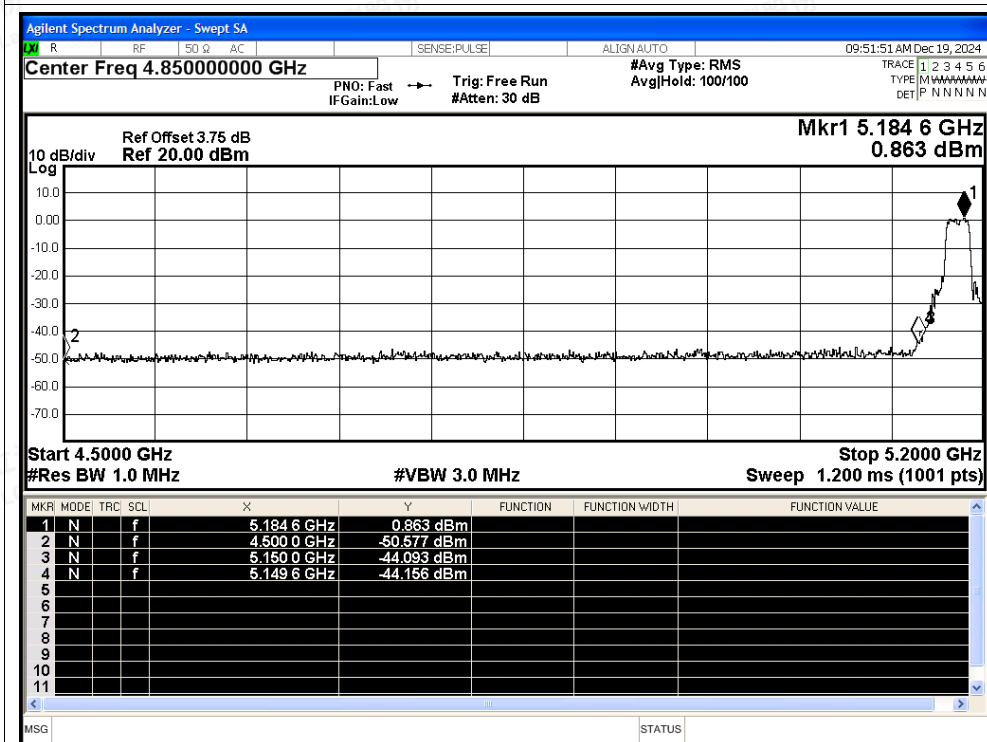

Restrict Band NVNT ax20 5180MHz Ant2 Average

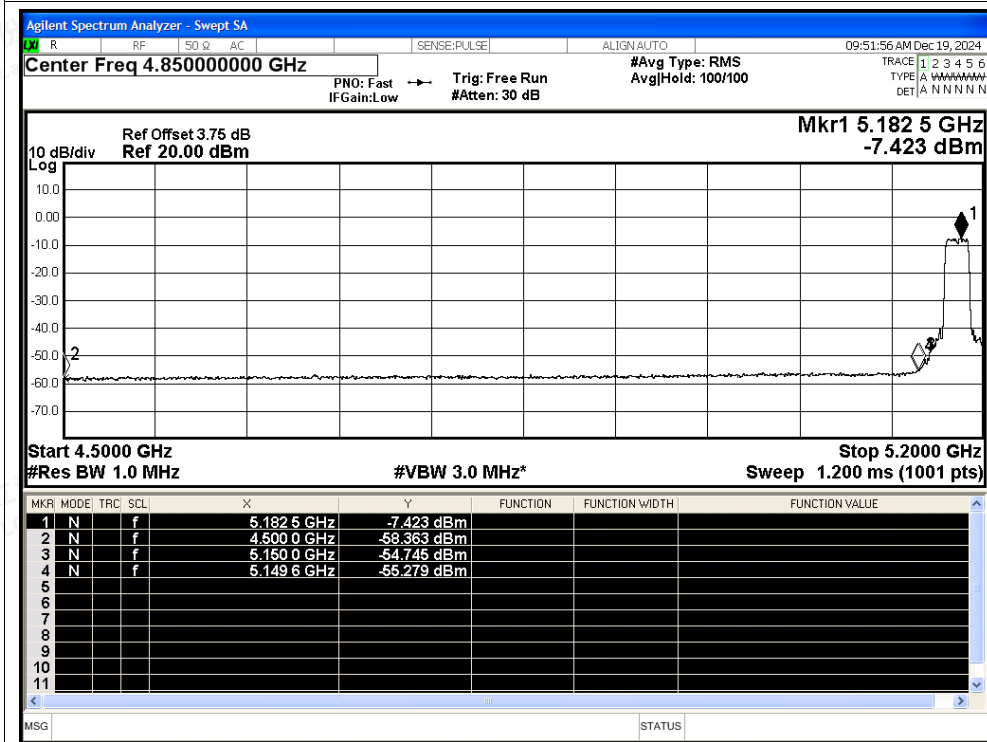

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant2 Peak

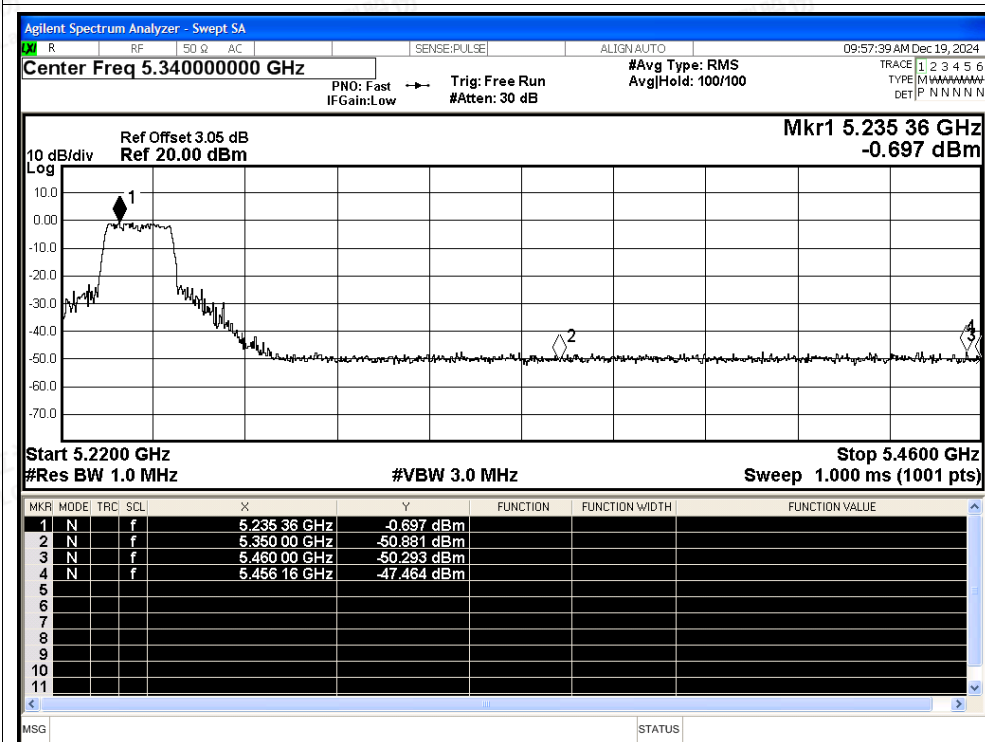

Restrict Band NVNT ax20 5240MHz Ant2 Average

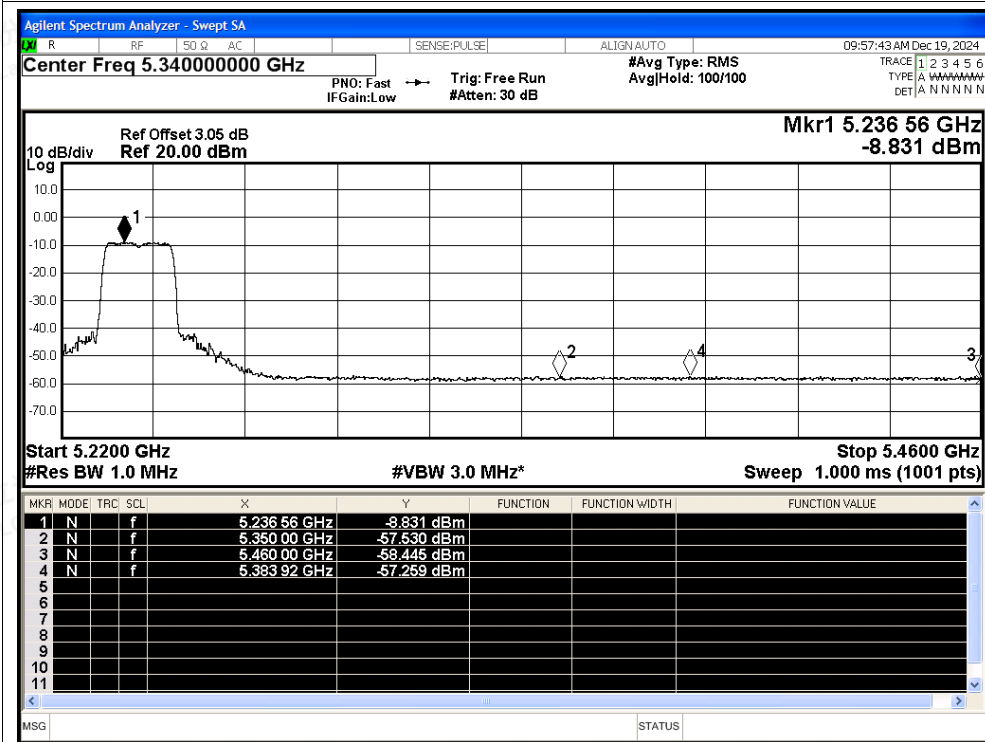

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

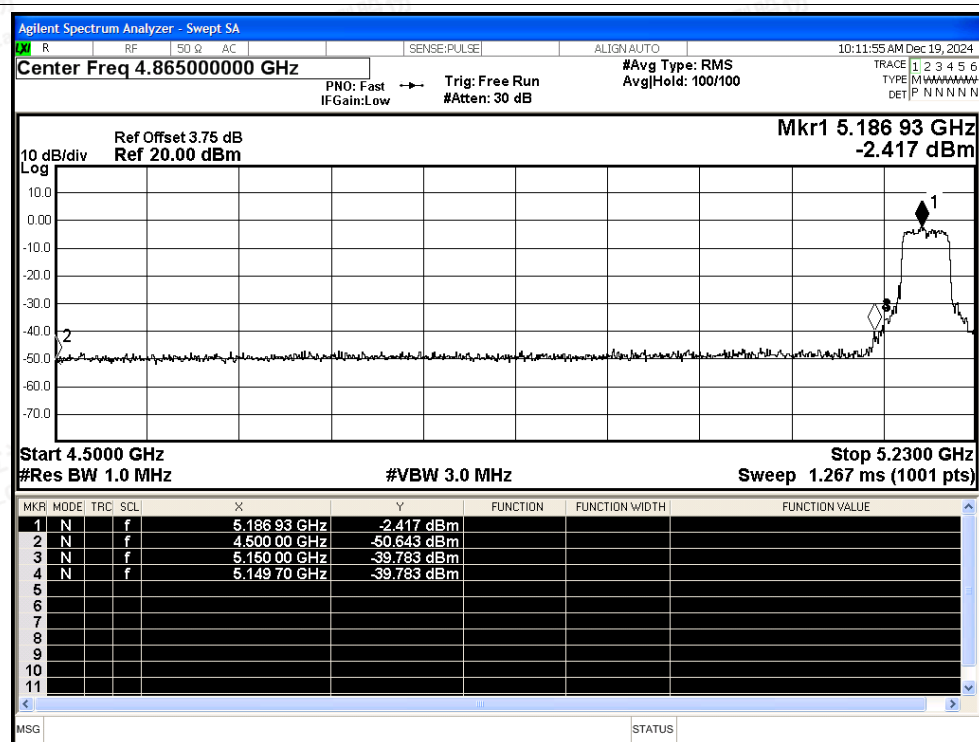

Restrict Band NVNT ax40 5190MHz Ant2 Average

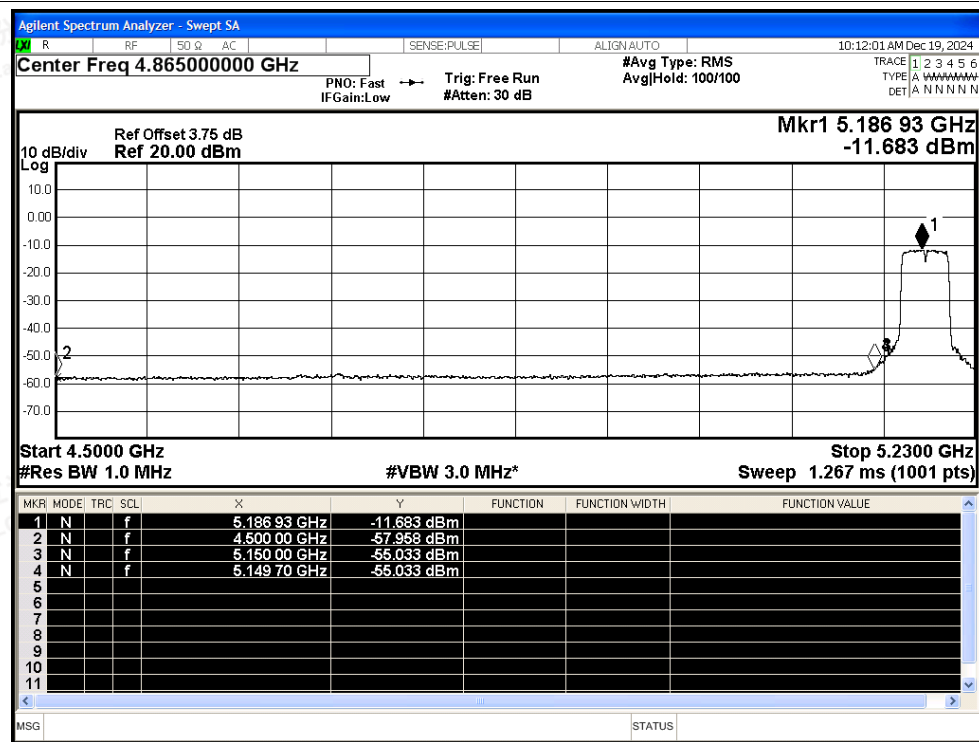

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

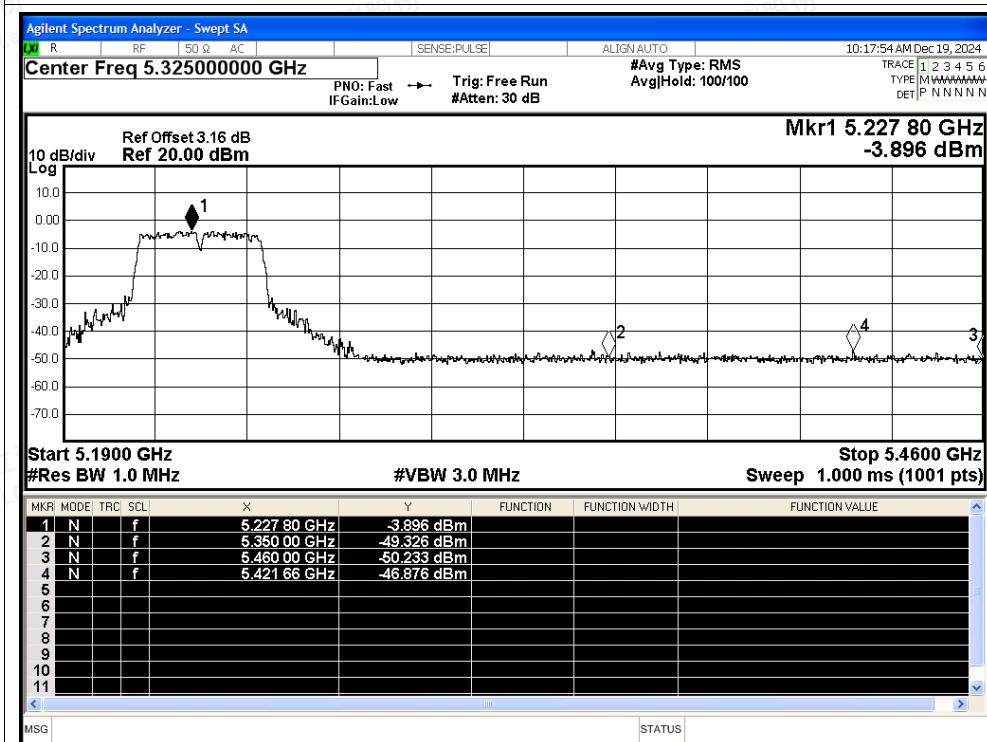

Restrict Band NVNT ax40 5230MHz Ant2 Average

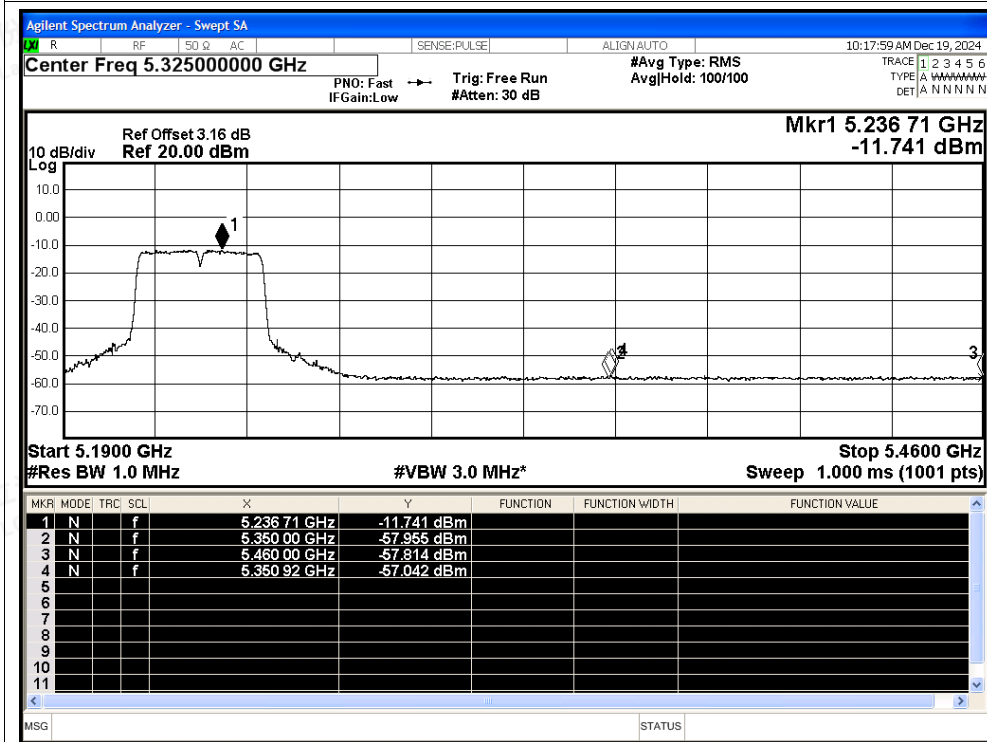

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

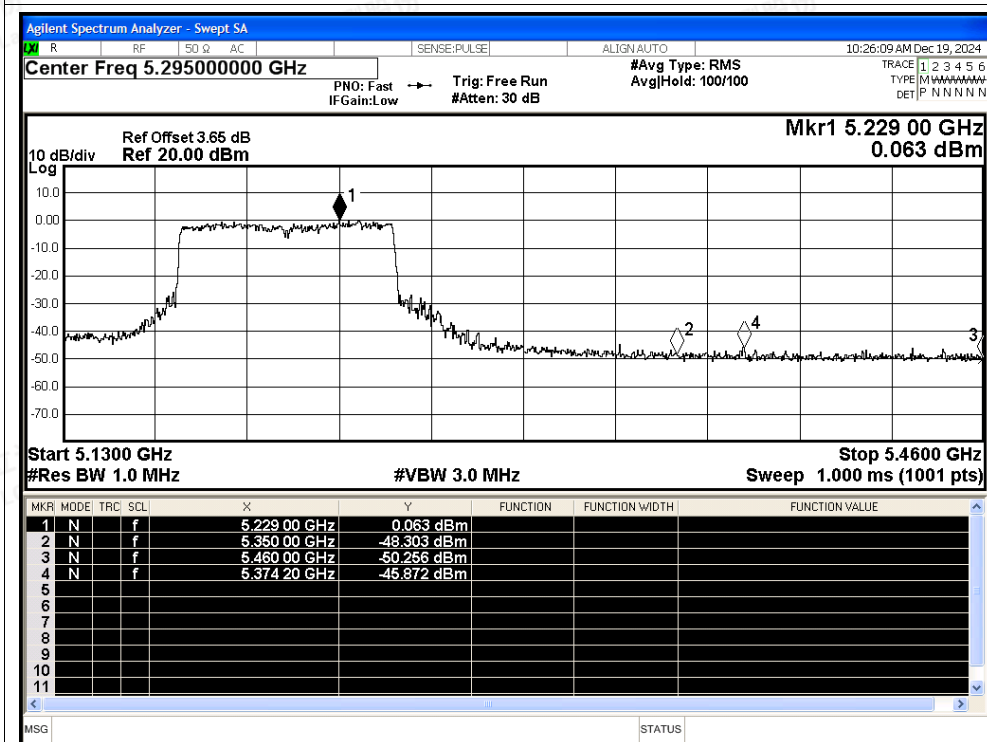

Restrict Band NVNT ax80 5210MHz Ant2 Average

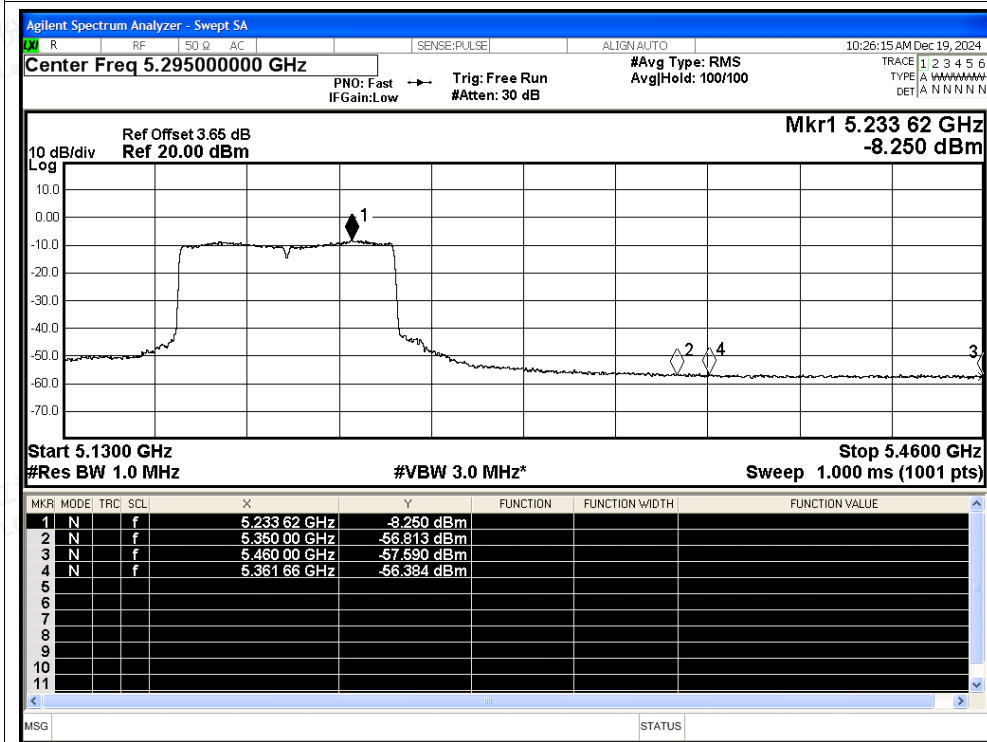

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

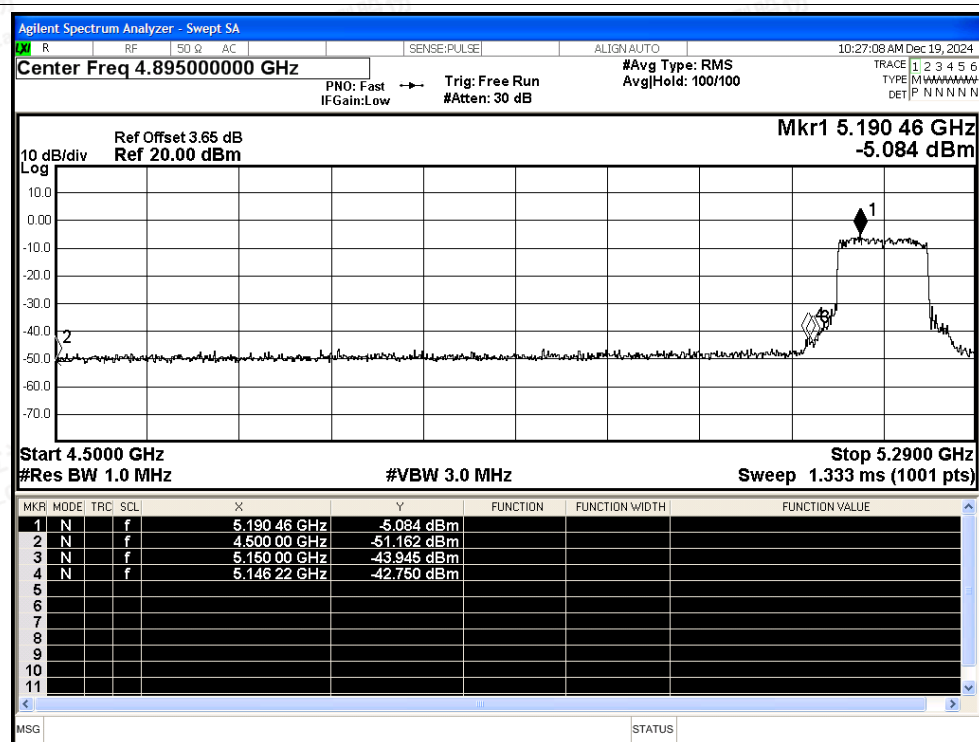

Restrict Band NVNT ax80 5210MHz Ant2 Average

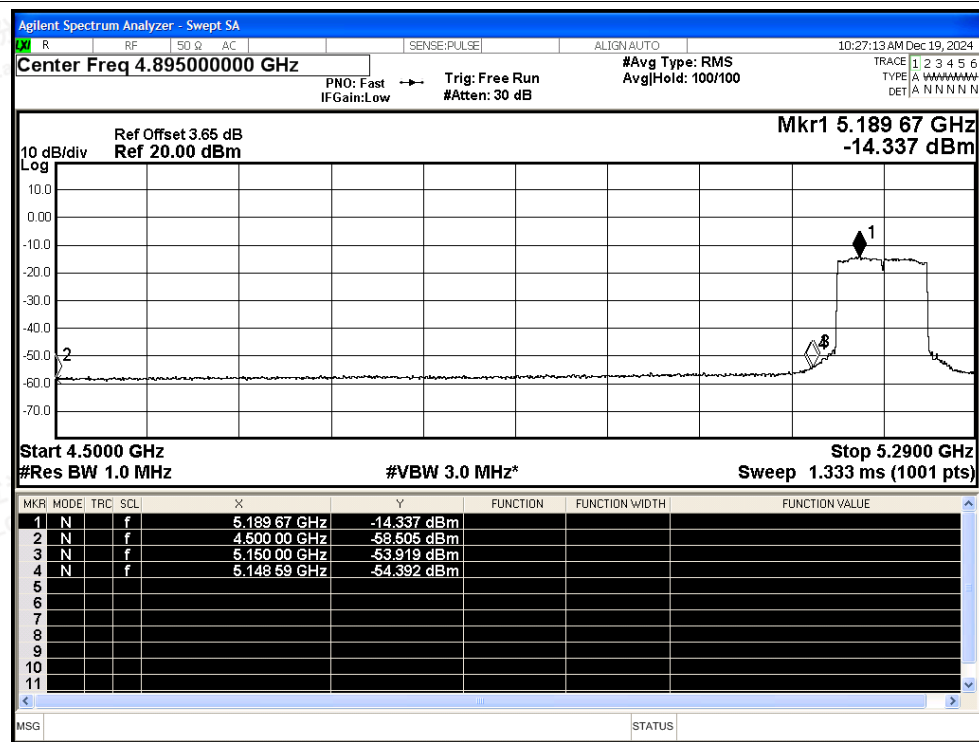

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-50.34	-49.94	6.01	54.11	Peak	68.2	Pass
NVNT	n20	5180	4500	-58.21	-58.37	6.01	45.96	Average	54	Pass
NVNT	n20	5180	4943.1	-44.83	-41.19	6.01	61.61	Peak	68.2	Pass
NVNT	n20	5180	5149.6	-54.91	-55.36	6.01	49.12	Average	54	Pass
NVNT	n20	5180	5150	-44.16	-38.9	6.01	63.47	Peak	68.2	Pass
NVNT	n20	5180	5150	-55.62	-54.83	6.01	49.04	Average	54	Pass
NVNT	n20	5240	5350	-49.96	-47.92	6.01	55.43	Peak	68.2	Pass
NVNT	n20	5240	5350	-57.37	-58.65	6.01	46.28	Average	54	Pass
NVNT	n20	5240	5377.68	-47.07	-46.95	6.01	57.24	Peak	68.2	Pass
NVNT	n20	5240	5366.4	-57.32	-56.93	6.01	47.13	Average	54	Pass
NVNT	n20	5240	5460	-50.36	-49.56	6.01	54.31	Peak	68.2	Pass
NVNT	n20	5240	5460	-58.29	-58.5	6.01	45.85	Average	54	Pass
NVNT	n40	5190	4500	-49.87	-49.5	6.01	54.57	Peak	68.2	Pass
NVNT	n40	5190	4500	-58.49	-58.31	6.01	45.85	Average	54	Pass
NVNT	n40	5190	5149.7	-42.88	-43.88	6.01	60.90	Peak	68.2	Pass
NVNT	n40	5190	5148.24	-54.53	-54.57	6.01	49.70	Average	54	Pass
NVNT	n40	5190	5150	-42.88	-43.88	6.01	60.90	Peak	68.2	Pass
NVNT	n40	5190	5150	-54.95	-54.57	6.01	49.49	Average	54	Pass
NVNT	n40	5230	5350	-48.76	-48.84	6.01	55.45	Peak	68.2	Pass
NVNT	n40	5230	5350	-58.2	-57.72	6.01	46.29	Average	54	Pass
NVNT	n40	5230	5425.17	-46.99	-47.02	6.01	57.24	Peak	68.2	Pass
NVNT	n40	5230	5409.78	-57.08	-57.2	6.01	47.11	Average	54	Pass
NVNT	n40	5230	5460	-49.6	-50.99	6.01	54.01	Peak	68.2	Pass
NVNT	n40	5230	5460	-58.41	-58.02	6.01	46.04	Average	54	Pass
NVNT	ac20	5180	4500	-50.61	-51.03	6.01	53.43	Peak	68.2	Pass
NVNT	ac20	5180	4500	-58.64	-57.96	6.01	45.96	Average	54	Pass
NVNT	ac20	5180	5148.9	-44.02	-45.12	6.01	59.71	Peak	68.2	Pass
NVNT	ac20	5180	5148.9	-55.2	-55.13	6.01	49.08	Average	54	Pass
NVNT	ac20	5180	5150	-44.55	-43.38	6.01	60.32	Peak	68.2	Pass
NVNT	ac20	5180	5150	-54.87	-55.31	6.01	49.16	Average	54	Pass
NVNT	ac20	5240	5350	-49.82	-49.6	6.01	54.54	Peak	68.2	Pass
NVNT	ac20	5240	5350	-57.7	-57.58	6.01	46.61	Average	54	Pass
NVNT	ac20	5240	5365.2	-47.67	-46.73	6.01	57.07	Peak	68.2	Pass
NVNT	ac20	5240	5393.52	-57.29	-56.98	6.01	47.12	Average	54	Pass
NVNT	ac20	5240	5460	-50.35	-50.09	6.01	54.03	Peak	68.2	Pass
NVNT	ac20	5240	5460	-58.65	-58.18	6.01	45.84	Average	54	Pass
NVNT	ac40	5190	4500	-49.96	-50.03	6.01	54.25	Peak	68.2	Pass
NVNT	ac40	5190	4500	-58.14	-57.78	6.01	46.29	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	5147.51	-44.66	-42.56	6.01	60.76	Peak	68.2	Pass
NVNT	ac40	5190	5148.24	-54.67	-54.64	6.01	49.59	Average	54	Pass
NVNT	ac40	5190	5150	-45.62	-43.21	6.01	60.00	Peak	68.2	Pass
NVNT	ac40	5190	5150	-54.72	-54.89	6.01	49.44	Average	54	Pass
NVNT	ac40	5230	5350	-50.01	-50.66	6.01	53.93	Peak	68.2	Pass
NVNT	ac40	5230	5350	-57.88	-57.81	6.01	46.40	Average	54	Pass
NVNT	ac40	5230	5446.23	-47.23	-46.7	6.01	57.29	Peak	68.2	Pass
NVNT	ac40	5230	5365.77	-57.28	-57.08	6.01	47.07	Average	54	Pass
NVNT	ac40	5230	5460	-50.3	-48.81	6.01	54.76	Peak	68.2	Pass
NVNT	ac40	5230	5460	-57.91	-58.13	6.01	46.23	Average	54	Pass
NVNT	ac80	5210	5350	-48.97	-48.95	6.01	55.29	Peak	68.2	Pass
NVNT	ac80	5210	5350	-56.8	-56.62	6.01	47.54	Average	54	Pass
NVNT	ac80	5210	5368.26	-46.71	-46.68	6.01	57.55	Peak	68.2	Pass
NVNT	ac80	5210	5351.76	-56.06	-56.33	6.01	48.05	Average	54	Pass
NVNT	ac80	5210	5460	-49.92	-50.32	6.01	54.13	Peak	68.2	Pass
NVNT	ac80	5210	5460	-57.67	-57.16	6.01	46.84	Average	54	Pass
NVNT	ac80	5210	4500	-51.55	-51.05	6.01	52.96	Peak	68.2	Pass
NVNT	ac80	5210	4500	-58.62	-57.87	6.01	46.02	Average	54	Pass
NVNT	ac80	5210	5149.38	-41.95	-41.14	6.01	62.72	Peak	68.2	Pass
NVNT	ac80	5210	5147.8	-54.69	-54.14	6.01	49.84	Average	54	Pass
NVNT	ac80	5210	5150	-46.11	-44.52	6.01	59.01	Peak	68.2	Pass
NVNT	ac80	5210	5150	-54.48	-53.73	6.01	50.16	Average	54	Pass
NVNT	ax20	5180	4500	-49.75	-50.58	6.01	54.10	Peak	68.2	Pass
NVNT	ax20	5180	4500	-58.47	-58.36	6.01	45.83	Average	54	Pass
NVNT	ax20	5180	5148.9	-40.59	-44.16	6.01	62.23	Peak	68.2	Pass
NVNT	ax20	5180	5148.2	-51.43	-55.28	6.01	51.31	Average	54	Pass
NVNT	ax20	5180	5150	-41.78	-44.09	6.01	61.46	Peak	68.2	Pass
NVNT	ax20	5180	5150	-50.86	-54.75	6.01	51.86	Average	54	Pass
NVNT	ax20	5240	5350	-49.76	-50.88	6.01	53.96	Peak	68.2	Pass
NVNT	ax20	5240	5350	-58.08	-57.53	6.01	46.45	Average	54	Pass
NVNT	ax20	5240	5411.04	-46.6	-47.46	6.01	57.24	Peak	68.2	Pass
NVNT	ax20	5240	5437.2	-57.37	-57.26	6.01	46.93	Average	54	Pass
NVNT	ax20	5240	5460	-48.49	-50.29	6.01	54.95	Peak	68.2	Pass
NVNT	ax20	5240	5460	-58.31	-58.45	6.01	45.87	Average	54	Pass
NVNT	ax40	5190	4500	-50.65	-50.64	6.01	53.60	Peak	68.2	Pass
NVNT	ax40	5190	4500	-58.17	-57.96	6.01	46.18	Average	54	Pass
NVNT	ax40	5190	5143.86	-43.08	-39.78	6.01	63.12	Peak	68.2	Pass
NVNT	ax40	5190	5149.7	-55.3	-55.03	6.01	49.08	Average	54	Pass
NVNT	ax40	5190	5150	-45.18	-39.78	6.01	62.56	Peak	68.2	Pass
NVNT	ax40	5190	5150	-55.3	-55.03	6.01	49.08	Average	54	Pass
NVNT	ax40	5230	5350	-49.08	-49.33	6.01	55.04	Peak	68.2	Pass
NVNT	ax40	5230	5350	-57.86	-57.96	6.01	46.34	Average	54	Pass
NVNT	ax40	5230	5373.6	-47.29	-46.88	6.01	57.17	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5376.3	-57.04	-57.04	6.01	47.21	Average	54	Pass
NVNT	ax40	5230	5460	-49.94	-50.23	6.01	54.17	Peak	68.2	Pass
NVNT	ax40	5230	5460	-58.12	-57.81	6.01	46.29	Average	54	Pass
NVNT	ax80	5210	5350	-46.97	-48.3	6.01	56.66	Peak	68.2	Pass
NVNT	ax80	5210	5350	-57.07	-56.81	6.01	47.31	Average	54	Pass
NVNT	ax80	5210	5371.89	-45.62	-45.87	6.01	58.50	Peak	68.2	Pass
NVNT	ax80	5210	5361.66	-56.21	-56.38	6.01	47.95	Average	54	Pass
NVNT	ax80	5210	5460	-48.49	-50.26	6.01	54.96	Peak	68.2	Pass
NVNT	ax80	5210	5460	-57.25	-57.59	6.01	46.83	Average	54	Pass
NVNT	ax80	5210	4500	-50.67	-51.16	6.01	53.34	Peak	68.2	Pass
NVNT	ax80	5210	4500	-57.85	-58.51	6.01	46.08	Average	54	Pass
NVNT	ax80	5210	5086.18	-45.09	-42.75	6.01	60.48	Peak	68.2	Pass
NVNT	ax80	5210	5148.59	-54.97	-54.39	6.01	49.58	Average	54	Pass
NVNT	ax80	5210	5150	-41.33	-43.95	6.01	61.80	Peak	68.2	Pass
NVNT	ax80	5210	5150	-54.72	-53.92	6.01	49.95	Average	54	Pass





D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5200	0	0	25	Pass
NVNT	a	5240	Ant1	5240	0	0	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5180	0	0	25	Pass
NVNT	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
NVNT	ac20	5240	Ant1	5240	0	0	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5180	0	0	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5240	0	0	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

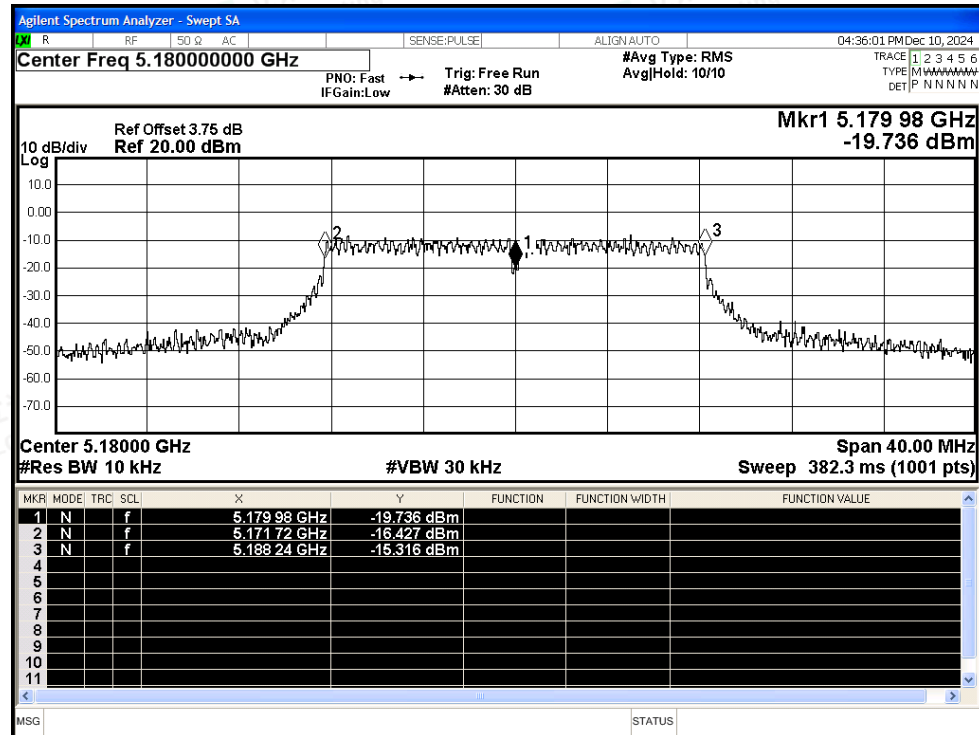

Freq. Stability NVNT a 5200MHz Ant1

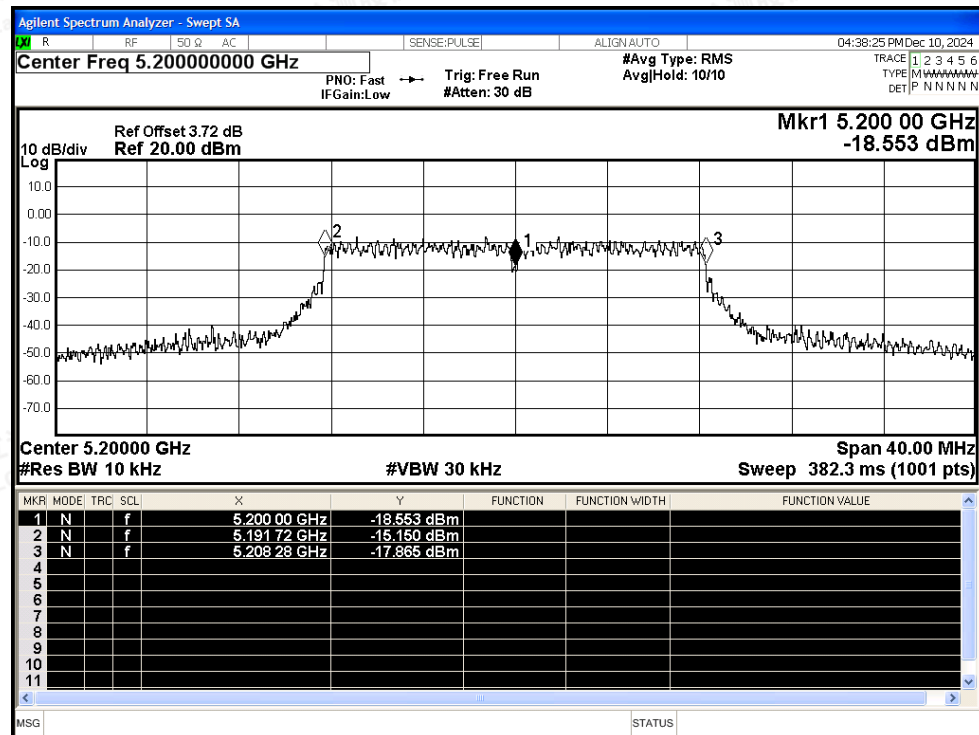

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

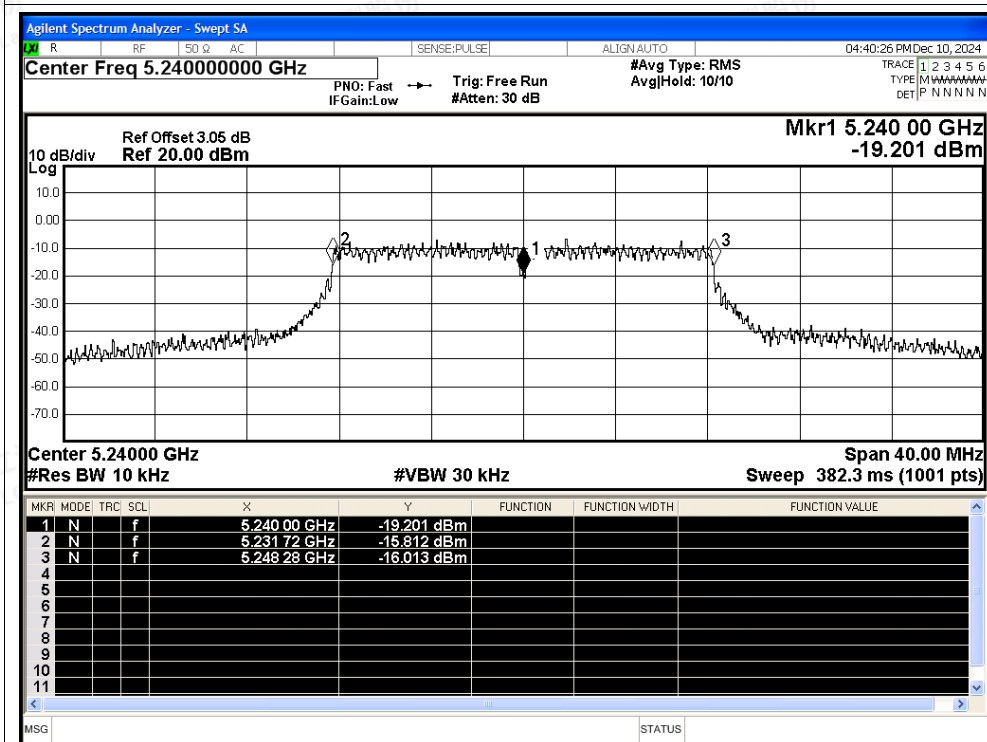

Freq. Stability NVNT n20 5180MHz Ant1

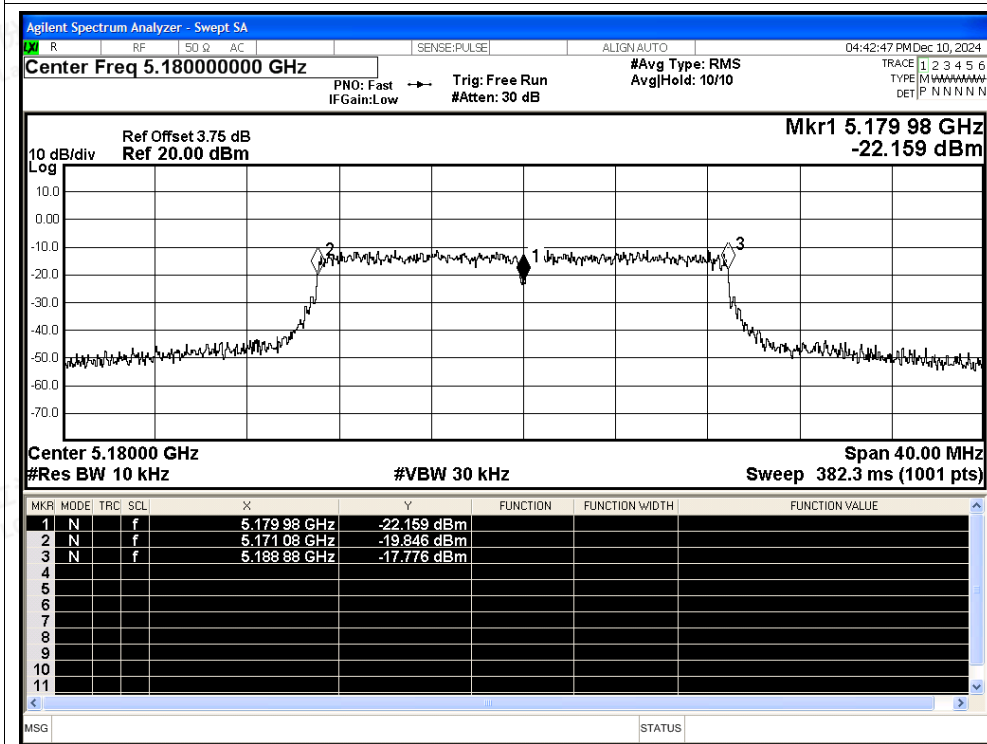

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

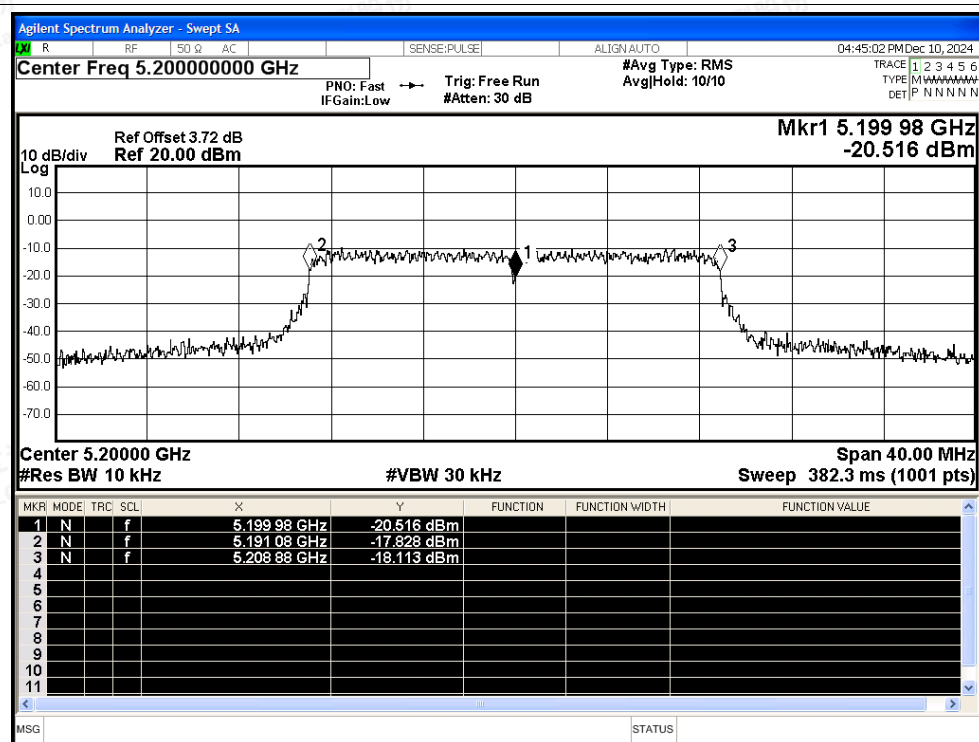

Freq. Stability NVNT n20 5240MHz Ant1

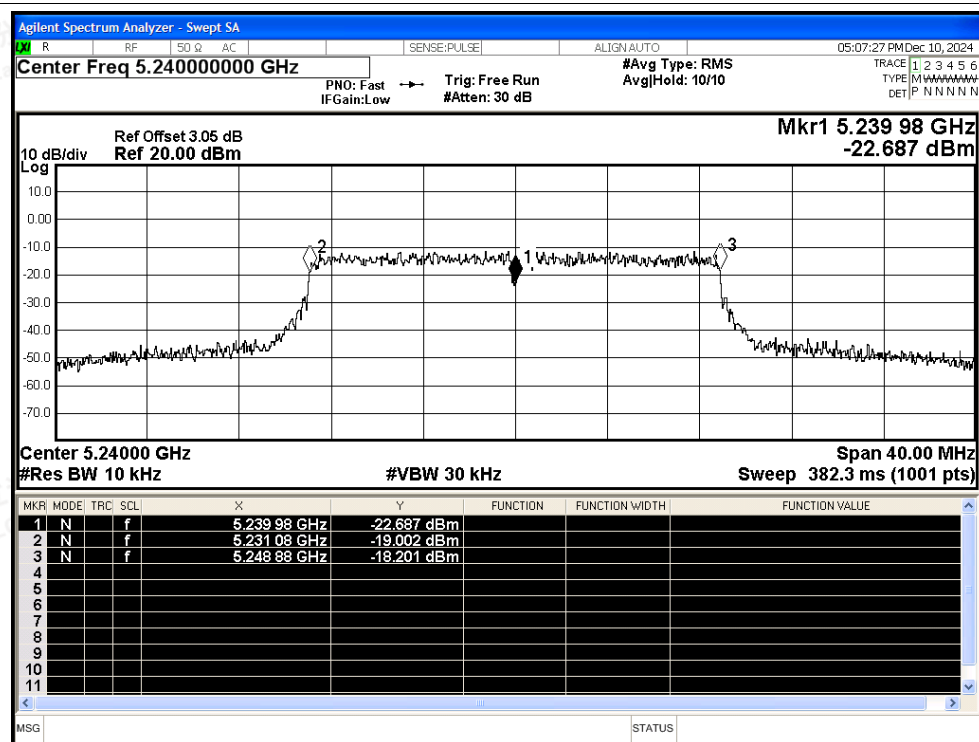

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

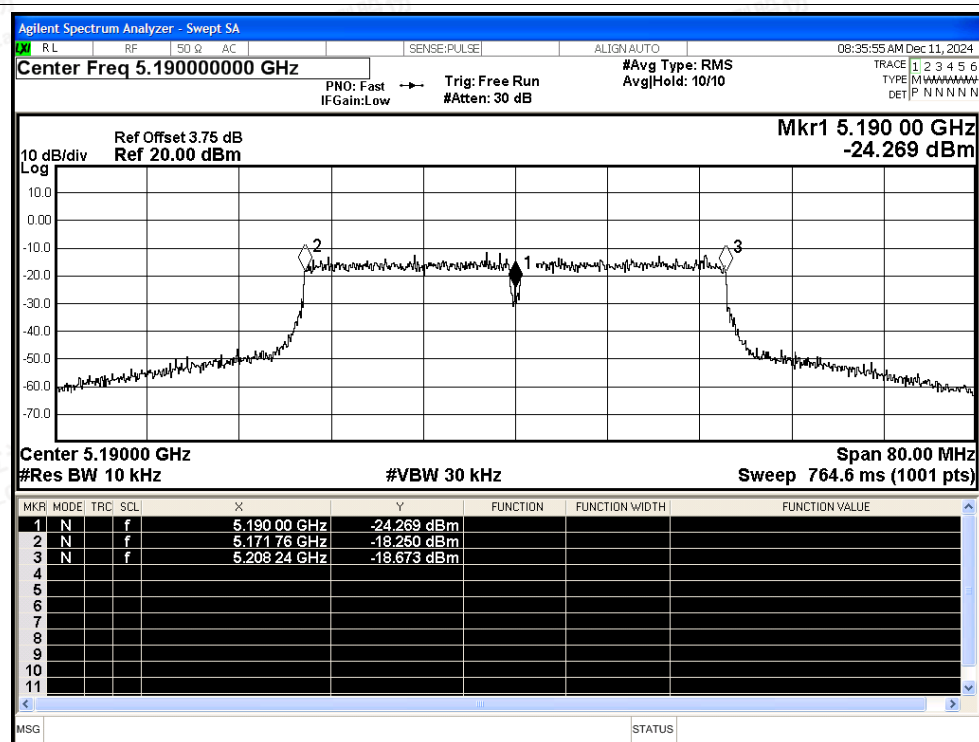

Freq. Stability NVNT n40 5230MHz Ant1

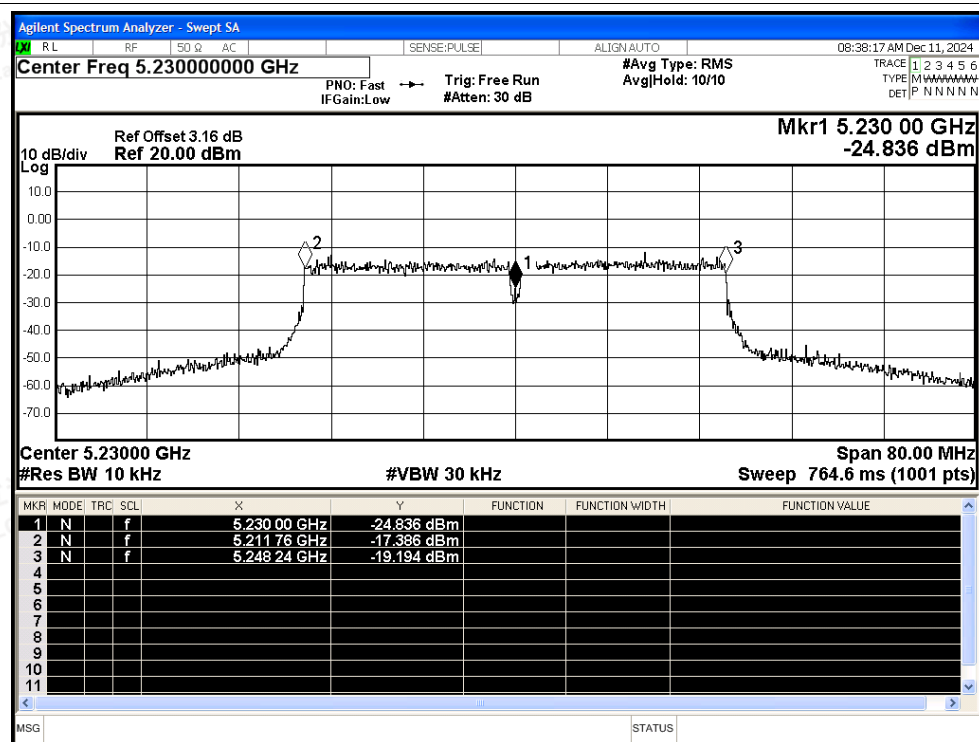

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

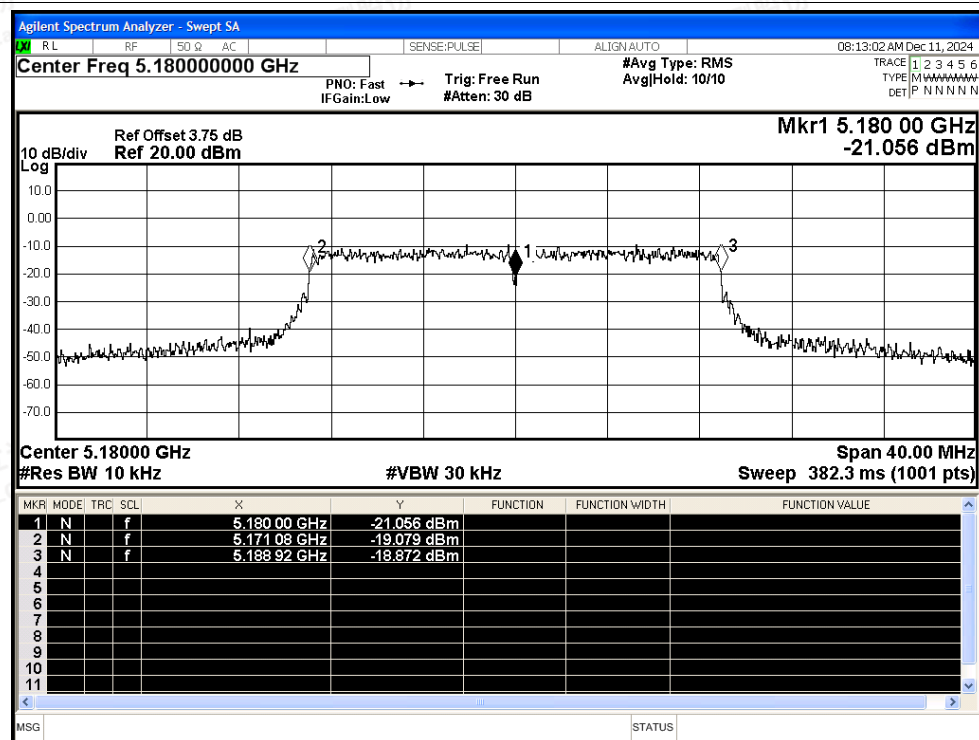

Freq. Stability NVNT ac20 5200MHz Ant1

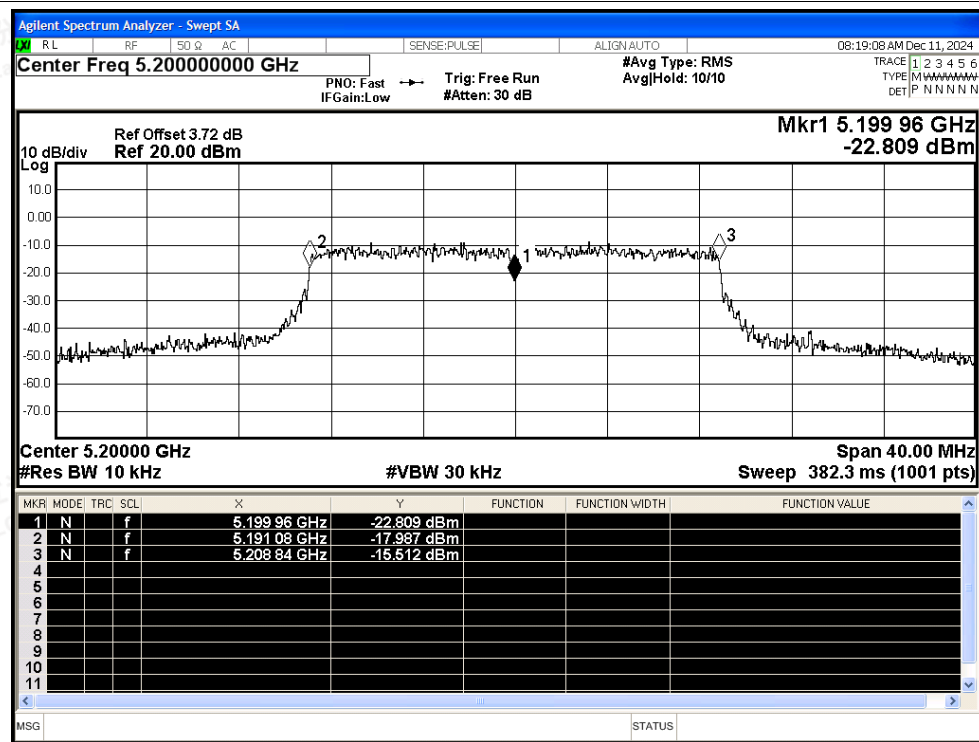

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

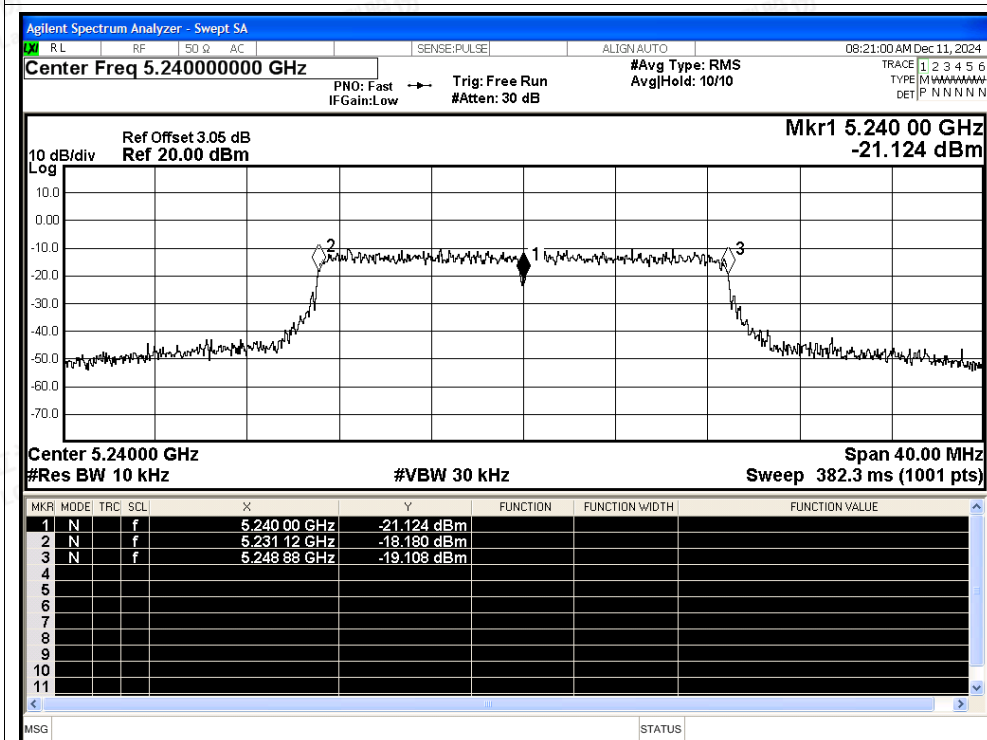

Freq. Stability NVNT ac40 5190MHz Ant1

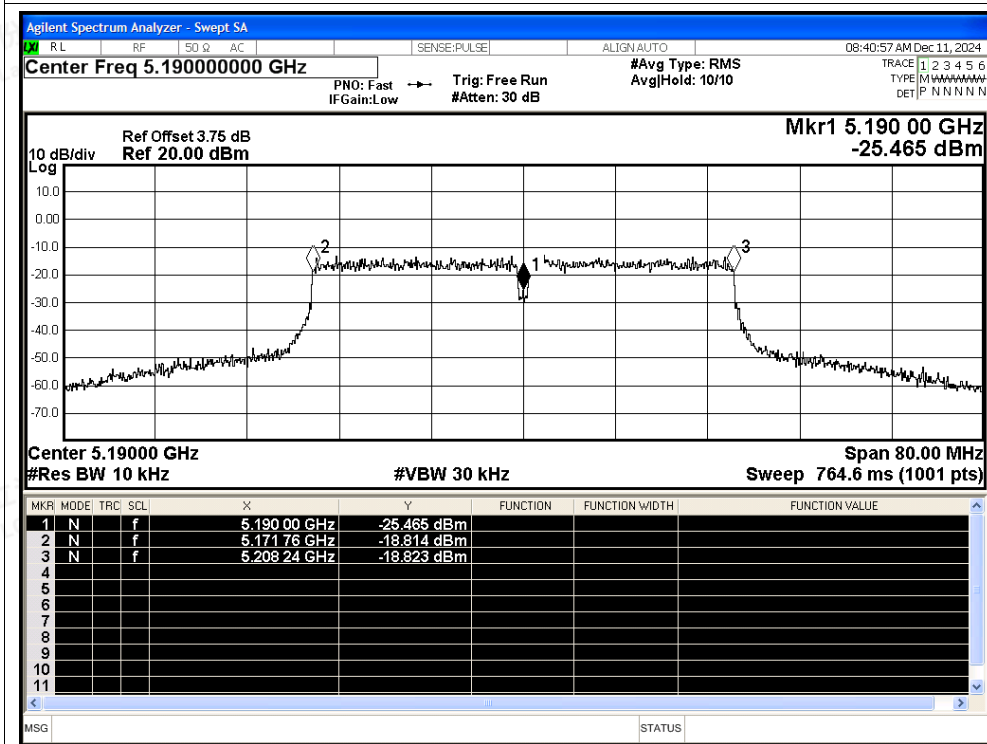

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

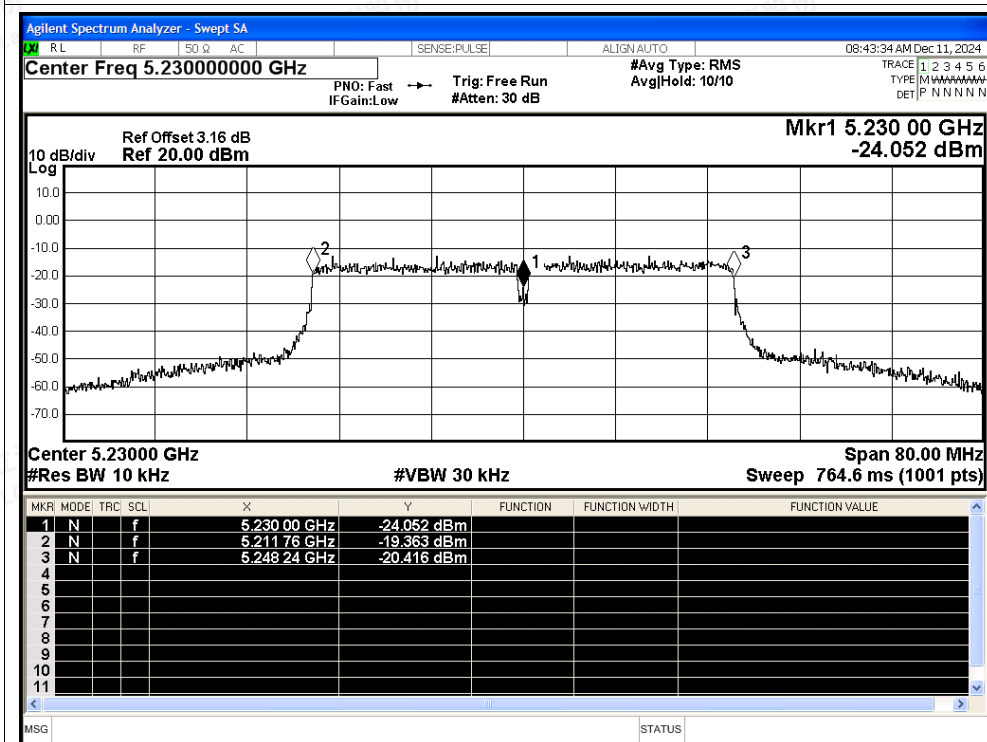

Freq. Stability NVNT ac80 5210MHz Ant1

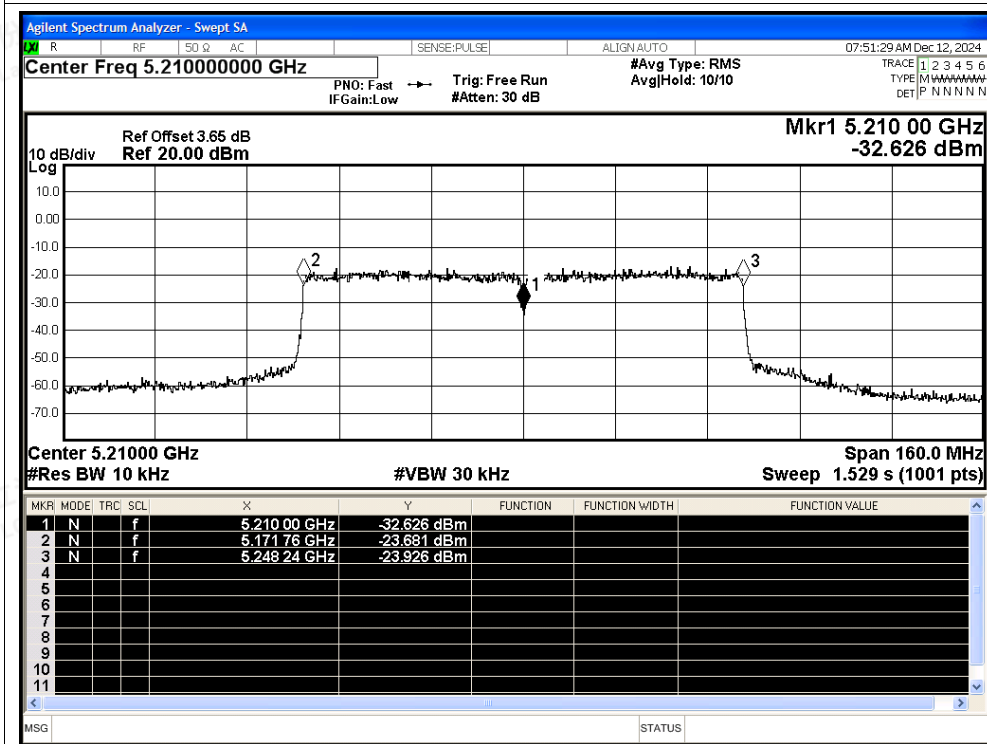

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant1

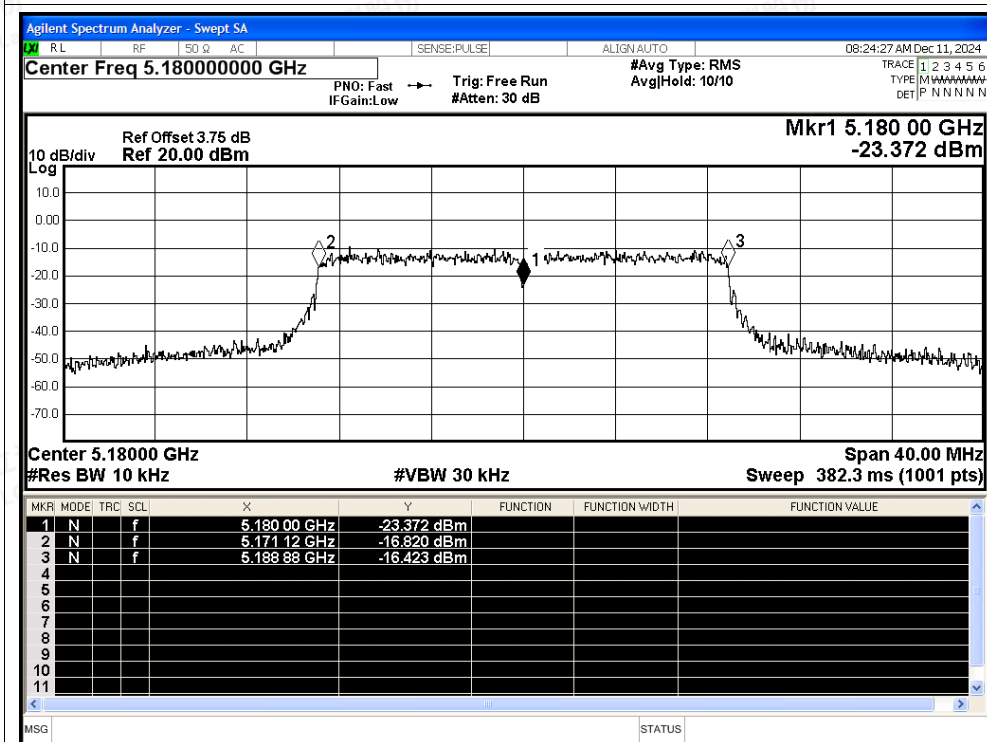

Freq. Stability NVNT ax20 5200MHz Ant1

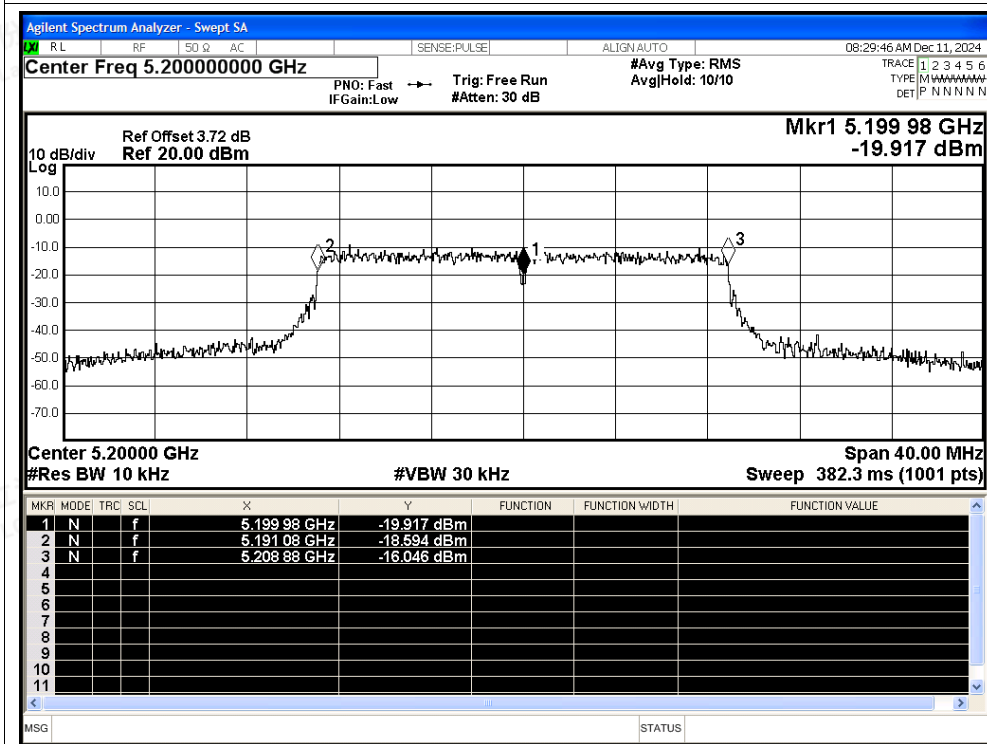

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant1

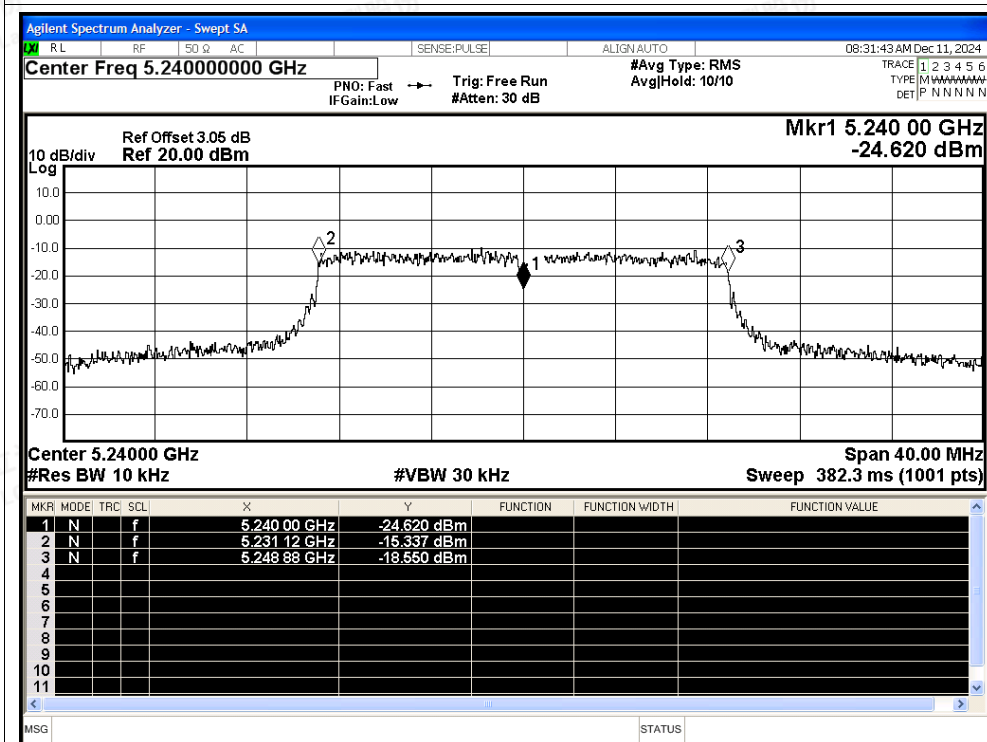

Freq. Stability NVNT ax40 5190MHz Ant1

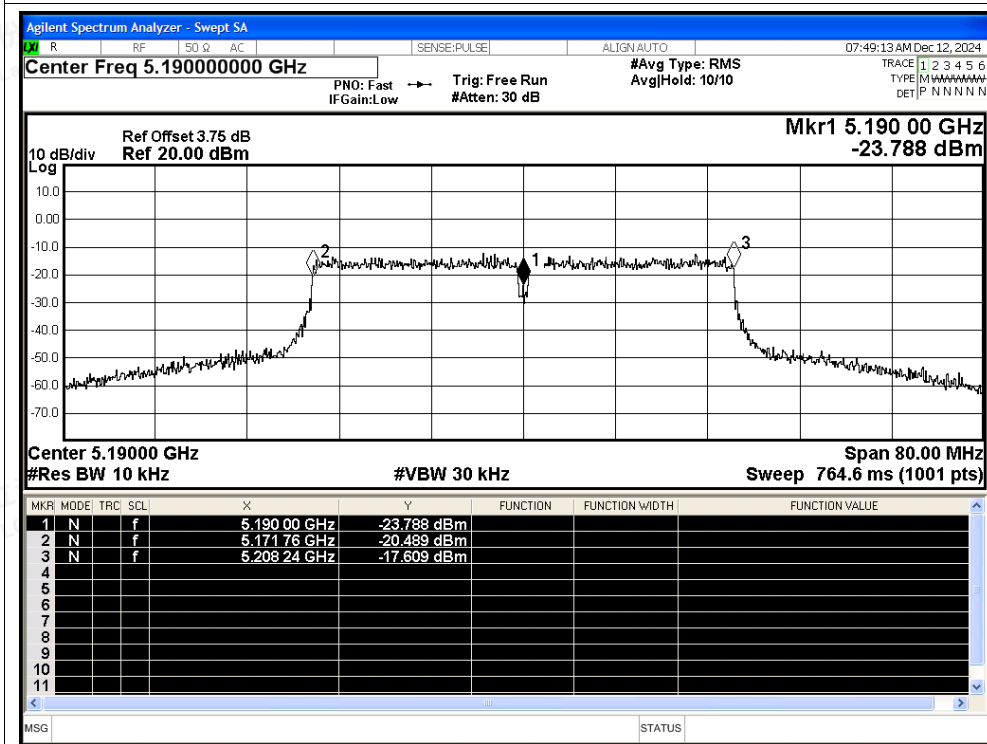

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant1

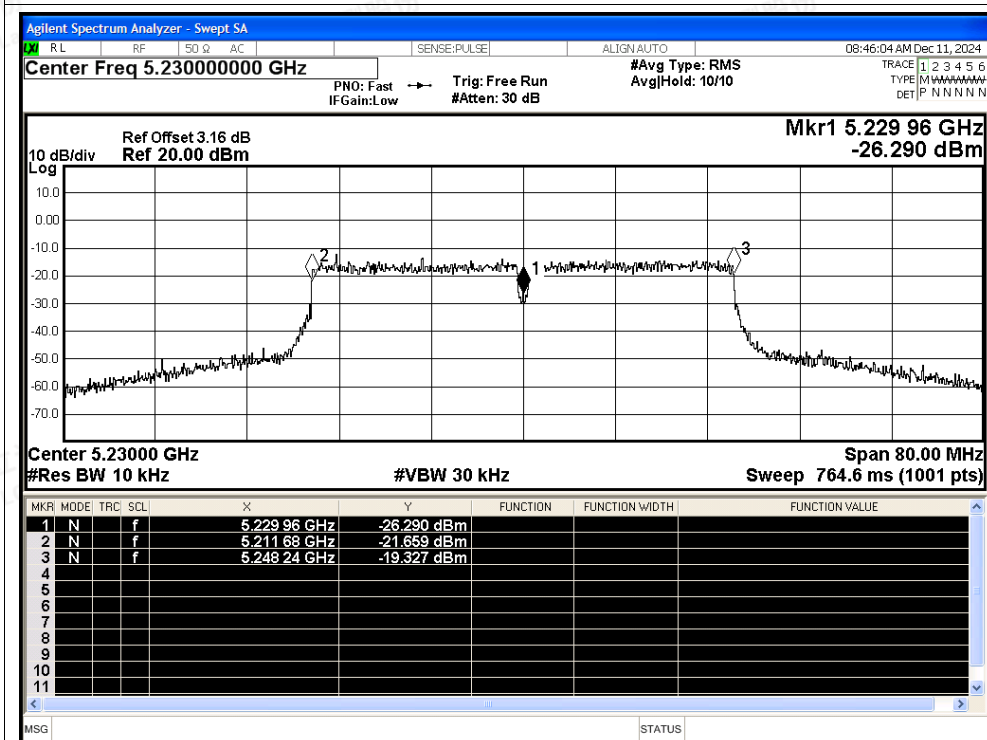

Freq. Stability NVNT ax80 5210MHz Ant1

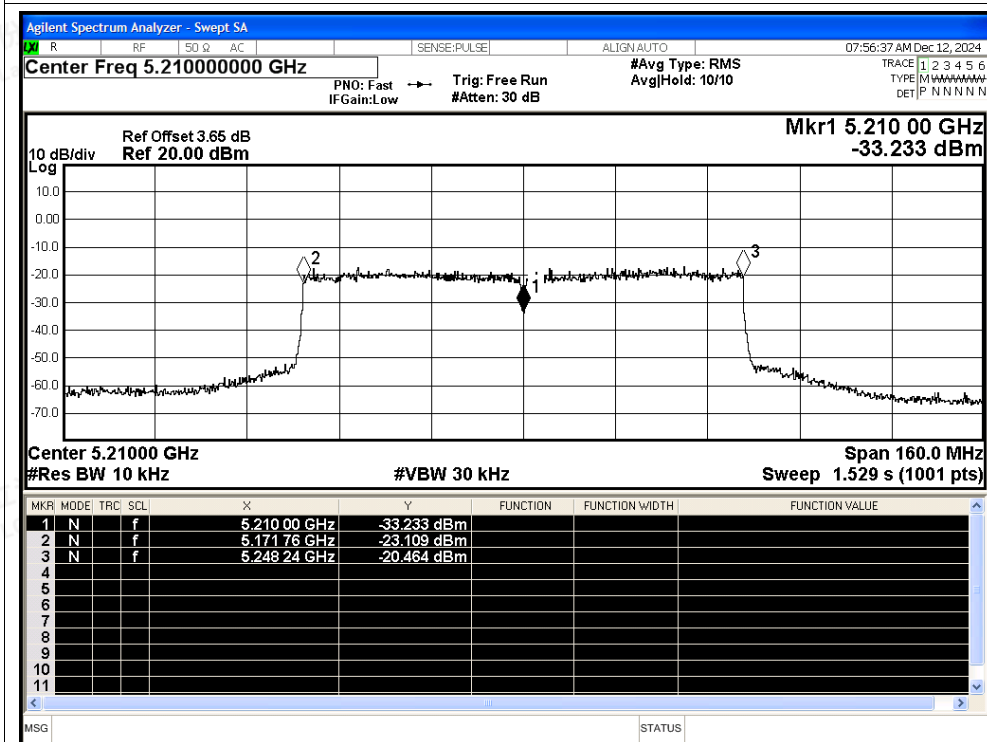

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180	0	0	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
NVNT	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant2	5230	0	0	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

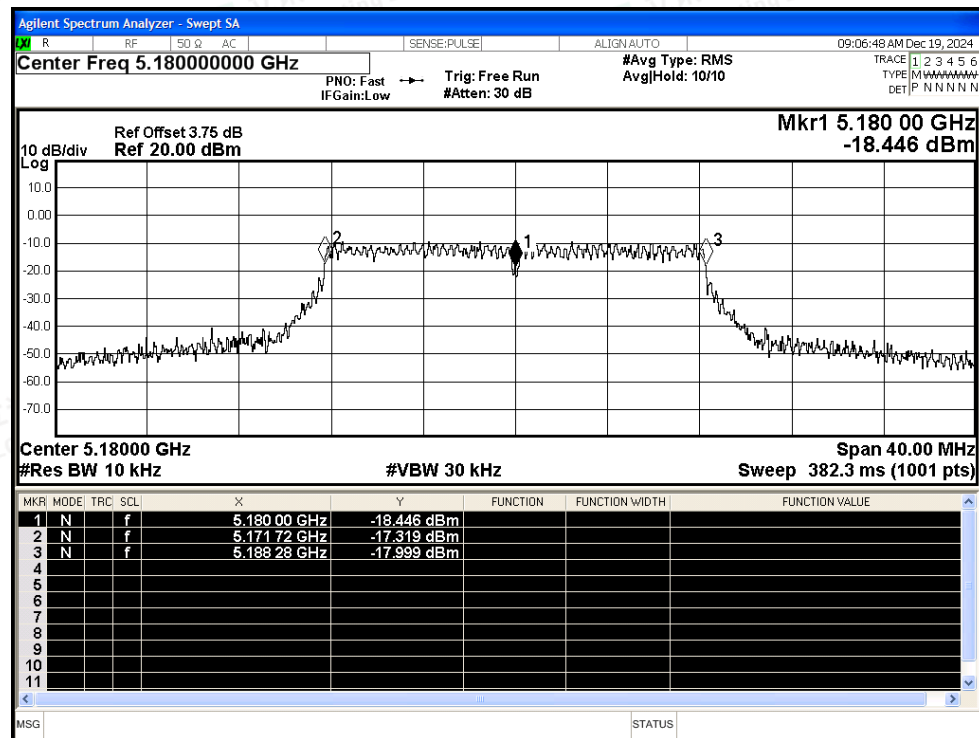

Freq. Stability NVNT a 5200MHz Ant2

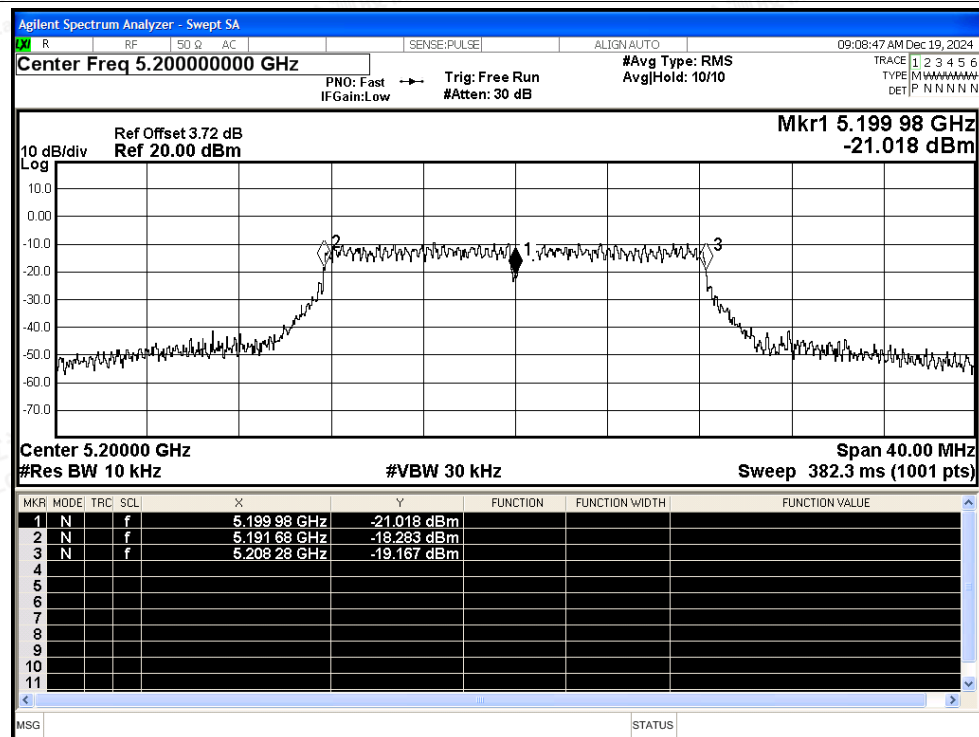

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant2

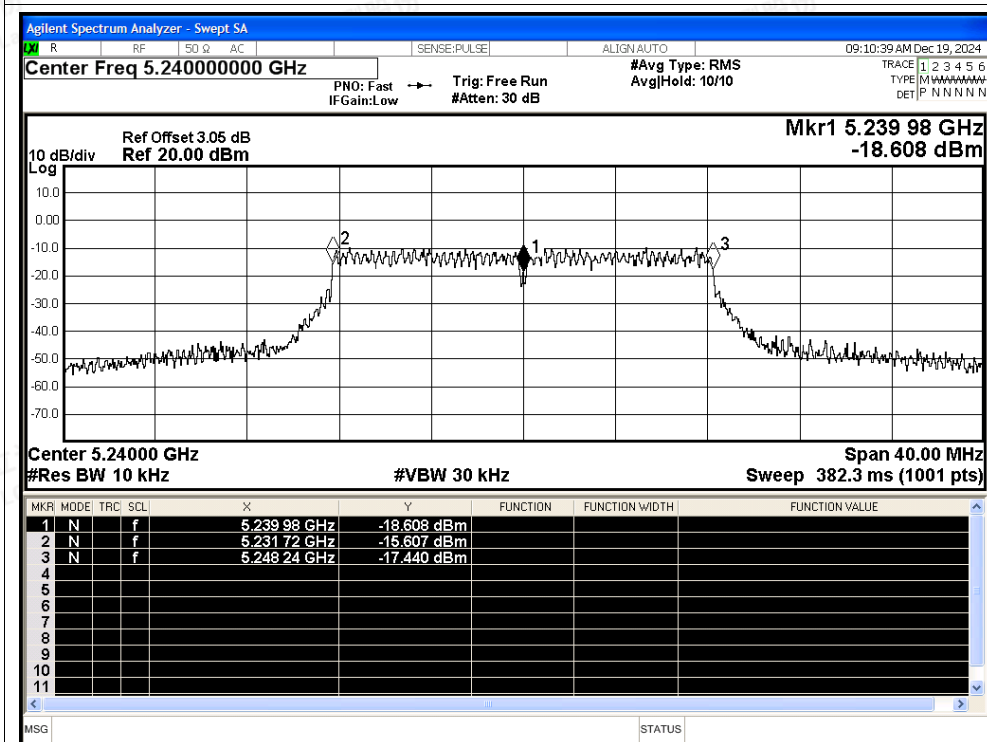

Freq. Stability NVNT n20 5180MHz Ant2

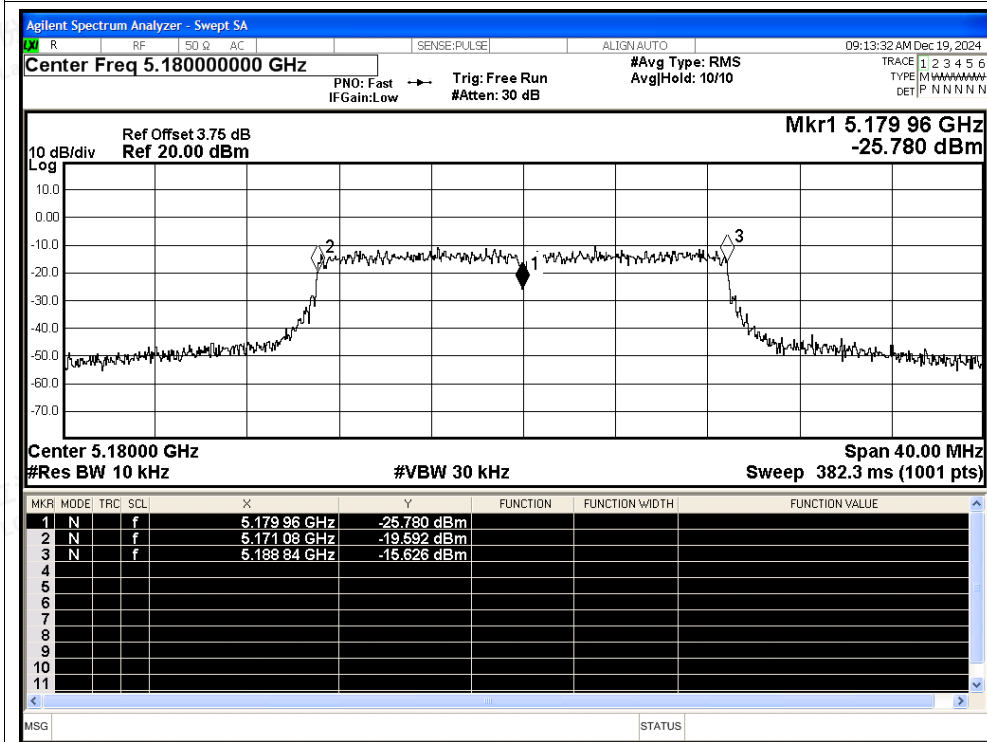

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant2

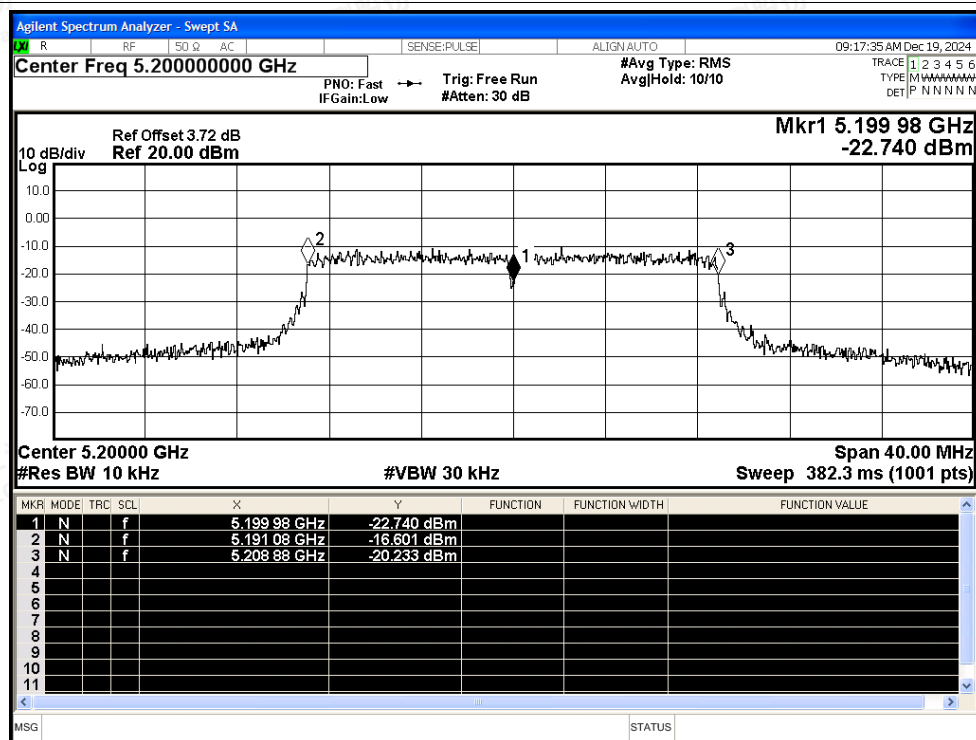

Freq. Stability NVNT n20 5240MHz Ant2

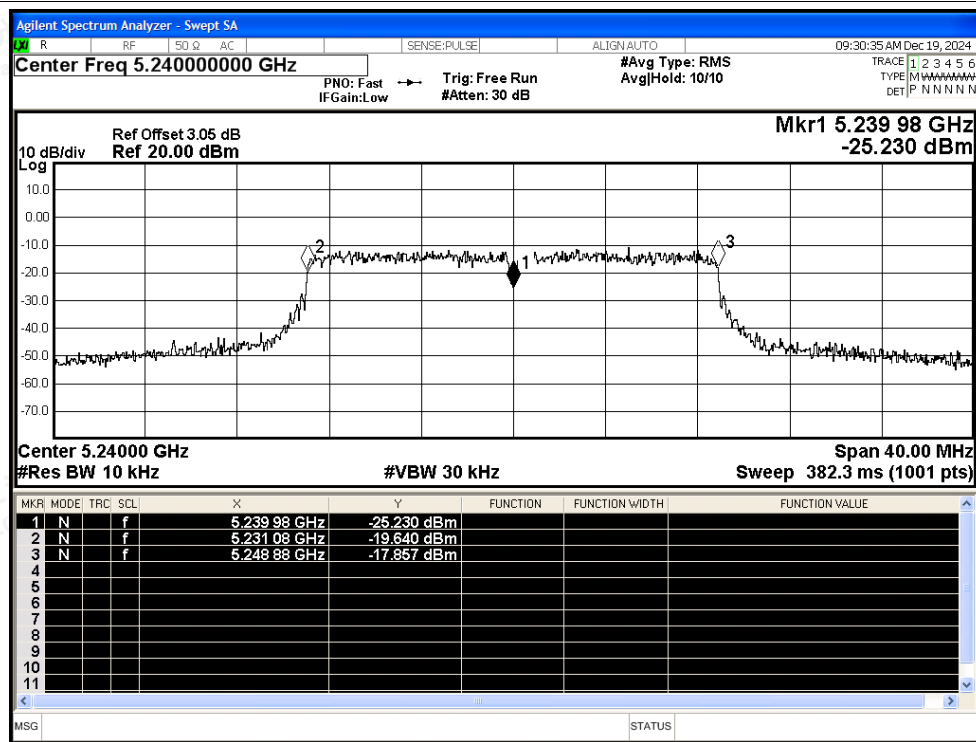

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant2

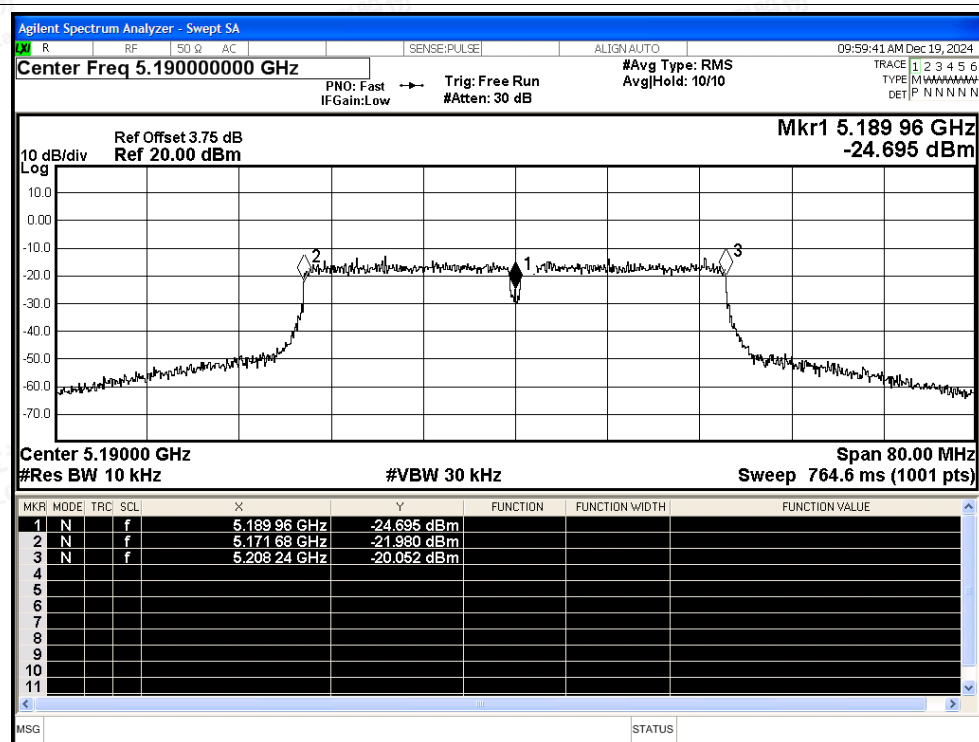

Freq. Stability NVNT n40 5230MHz Ant2

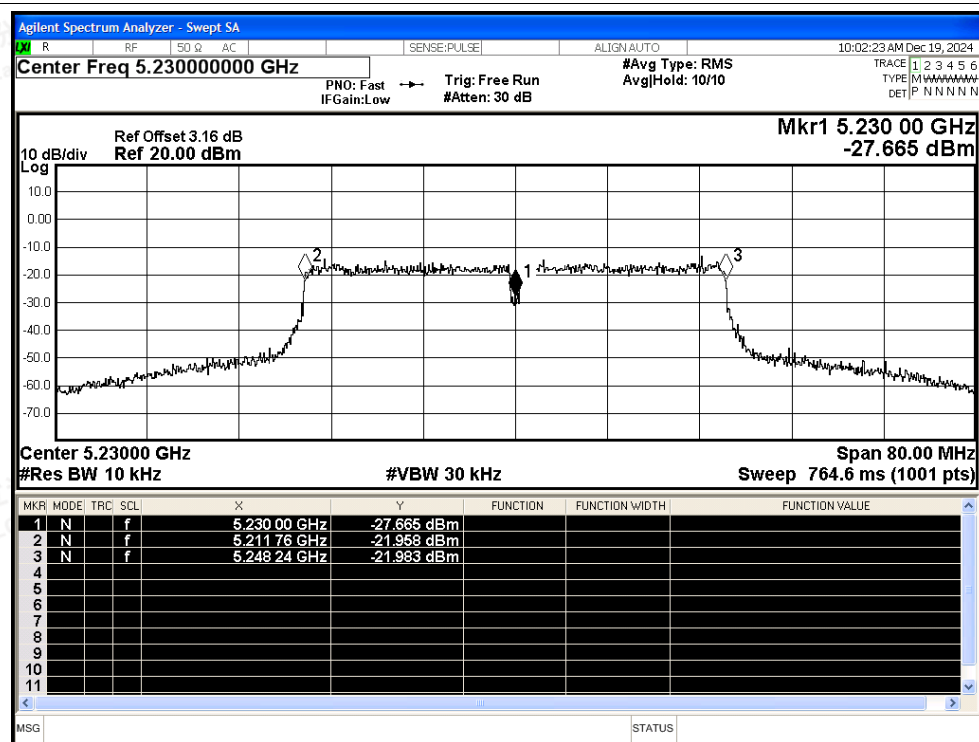

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant2

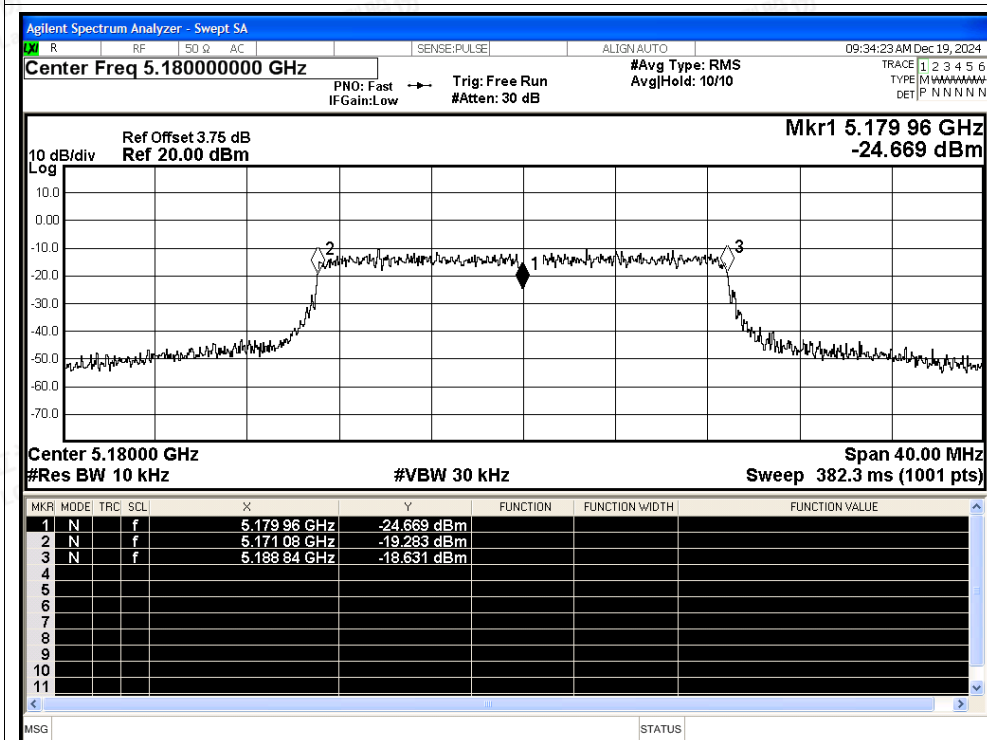

Freq. Stability NVNT ac20 5200MHz Ant2

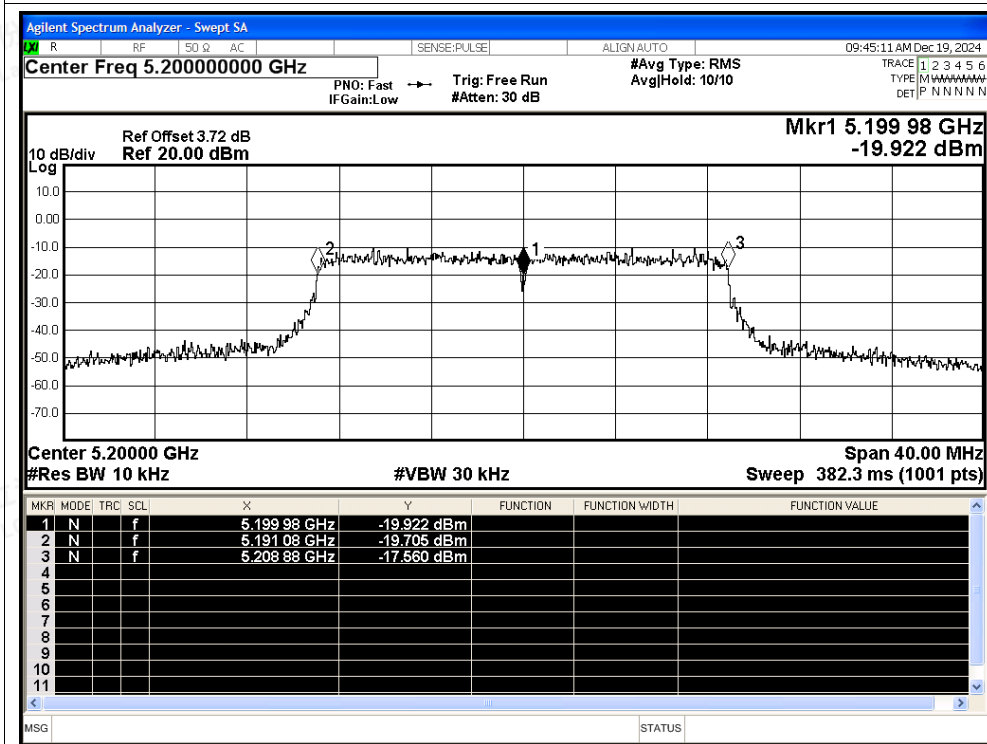

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant2

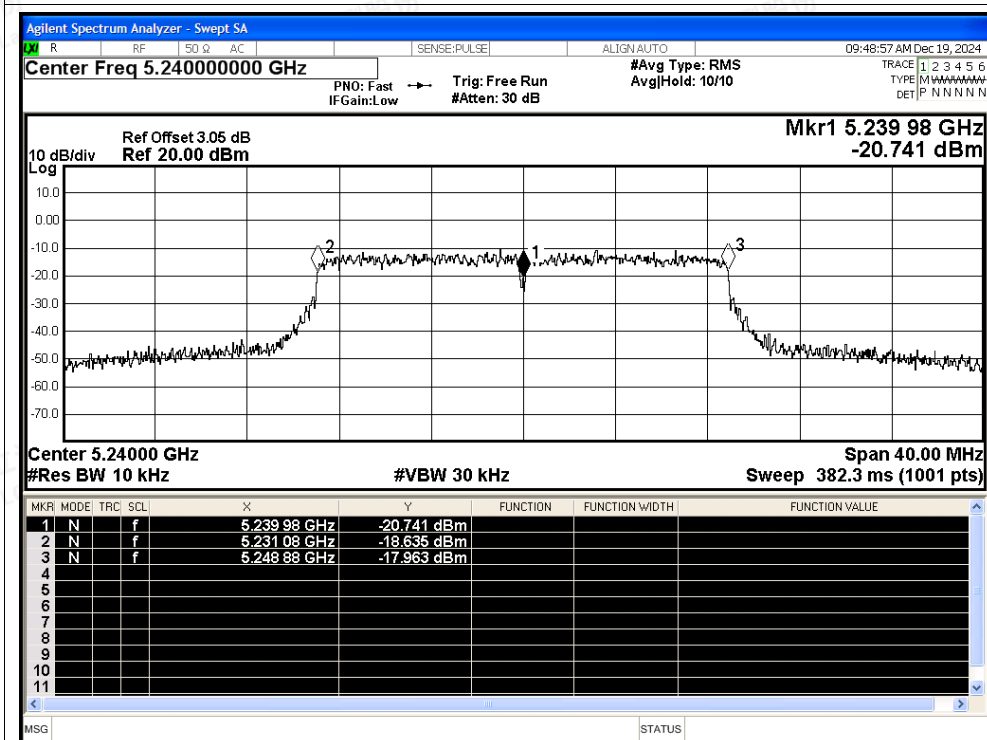

Freq. Stability NVNT ac40 5190MHz Ant2

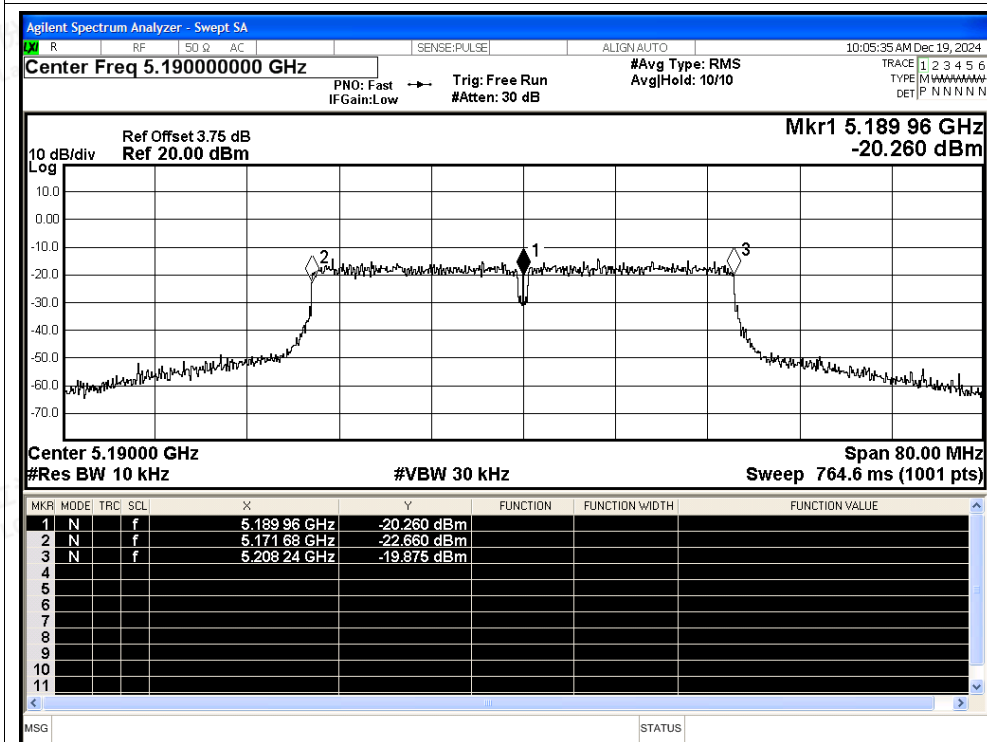

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity