





Restrict Band NVNT ac80 5290MHz Ant1 Peak

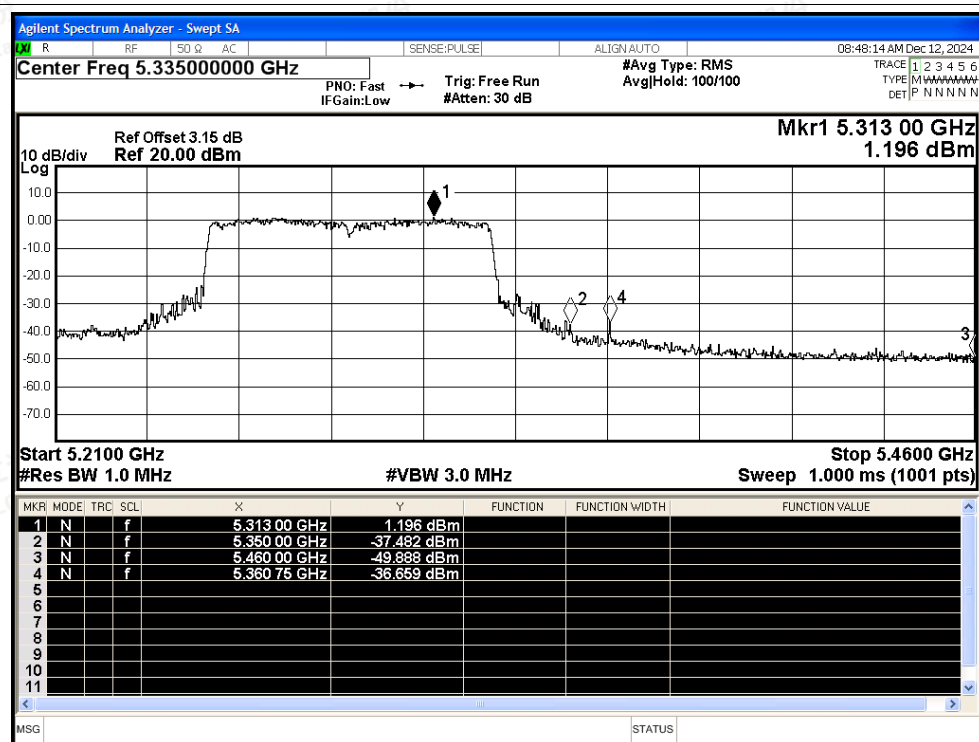

Restrict Band NVNT ac80 5290MHz Ant1 Average

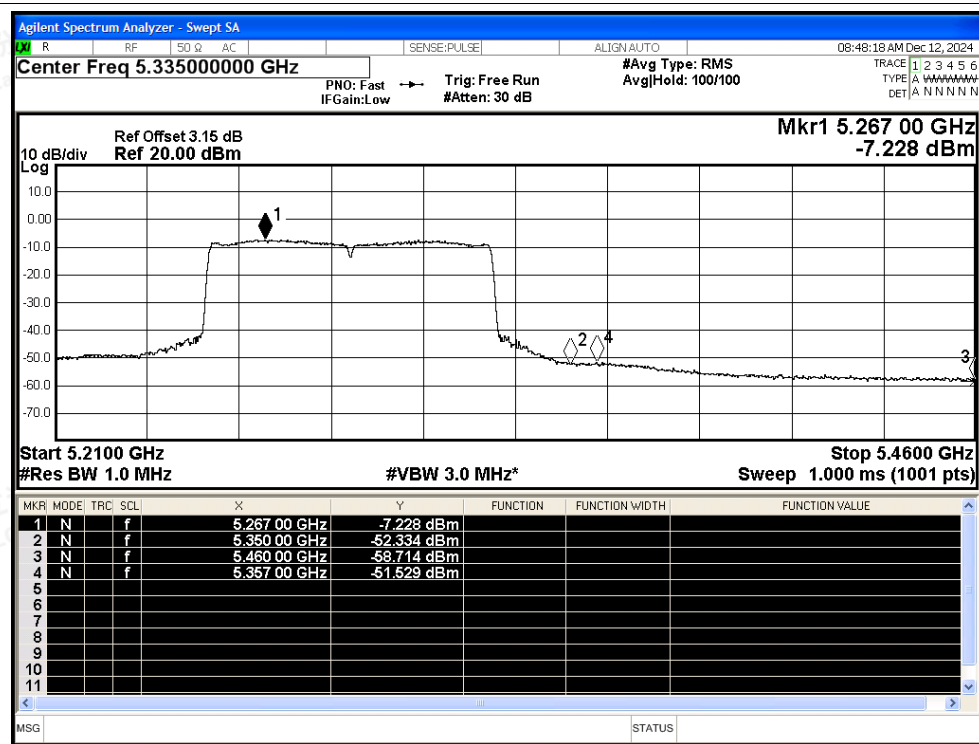

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant1 Peak

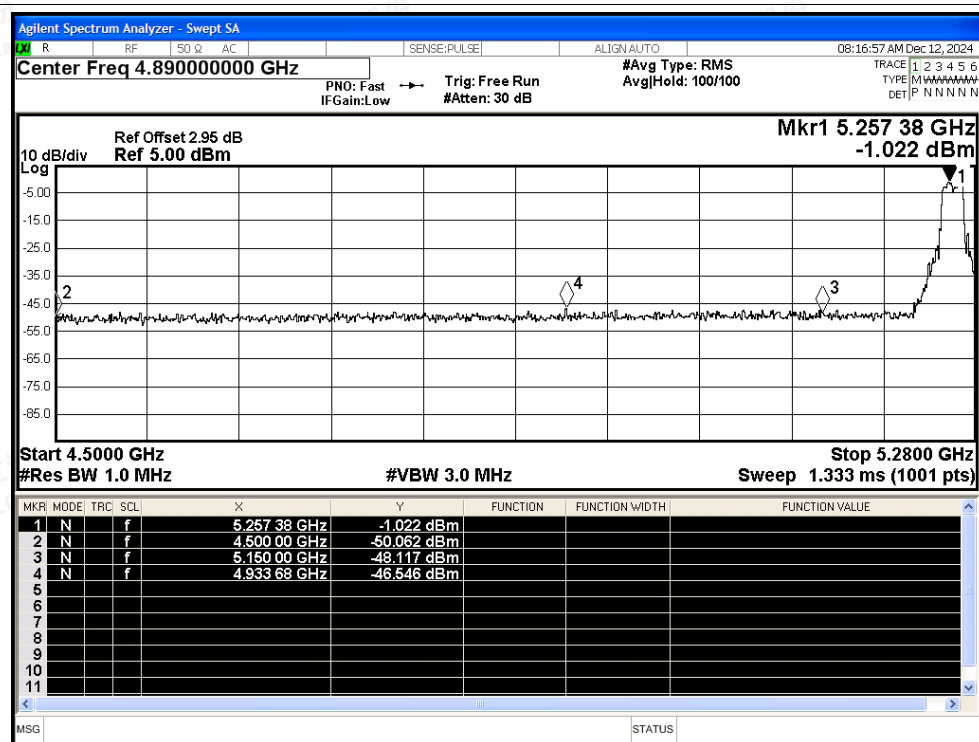

Restrict Band NVNT ax20 5260MHz Ant1 Average

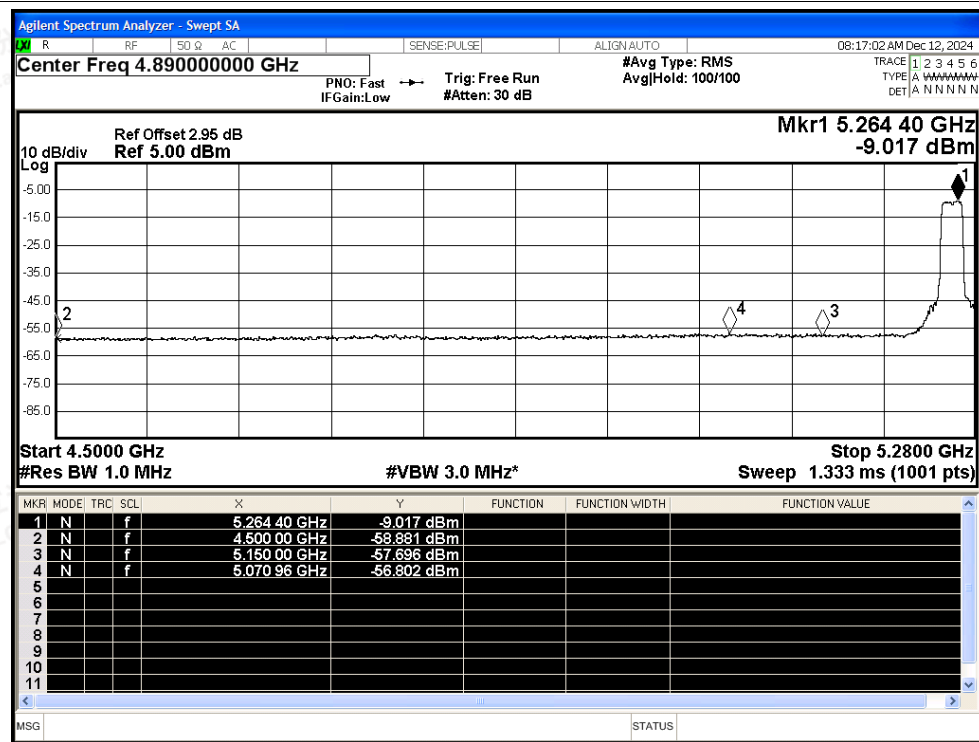

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant1 Peak

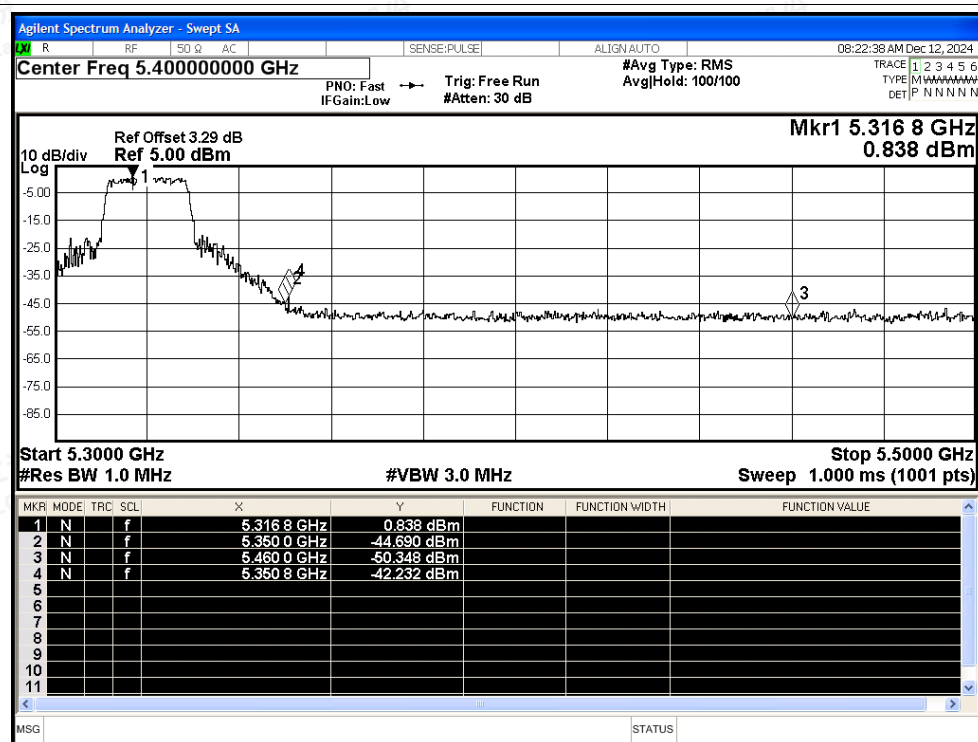

Restrict Band NVNT ax20 5320MHz Ant1 Average

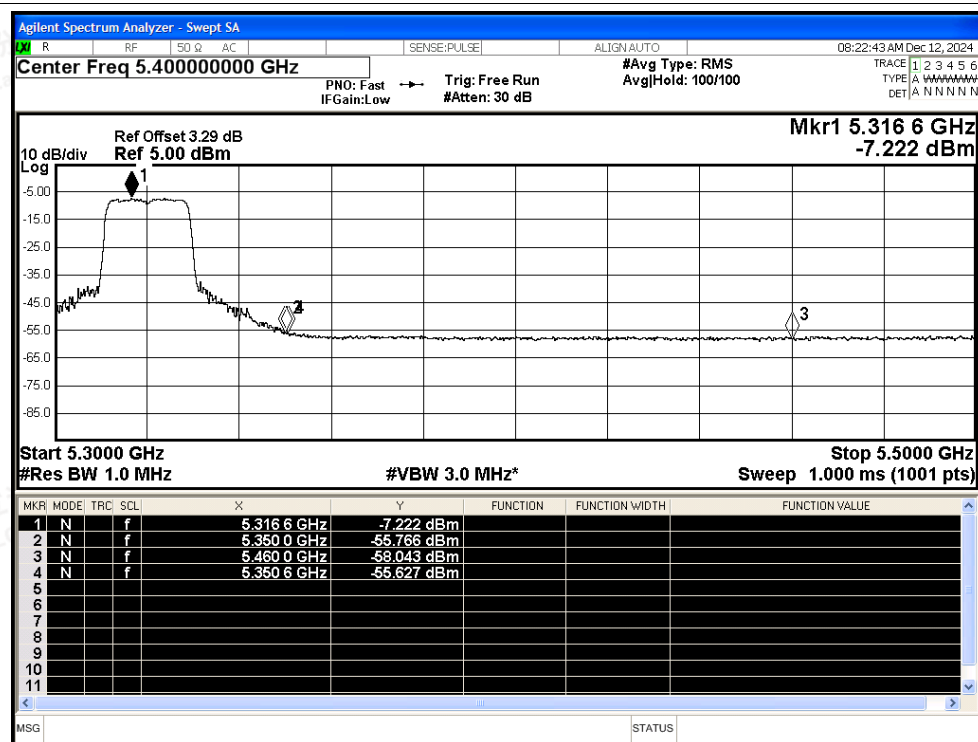

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant1 Peak

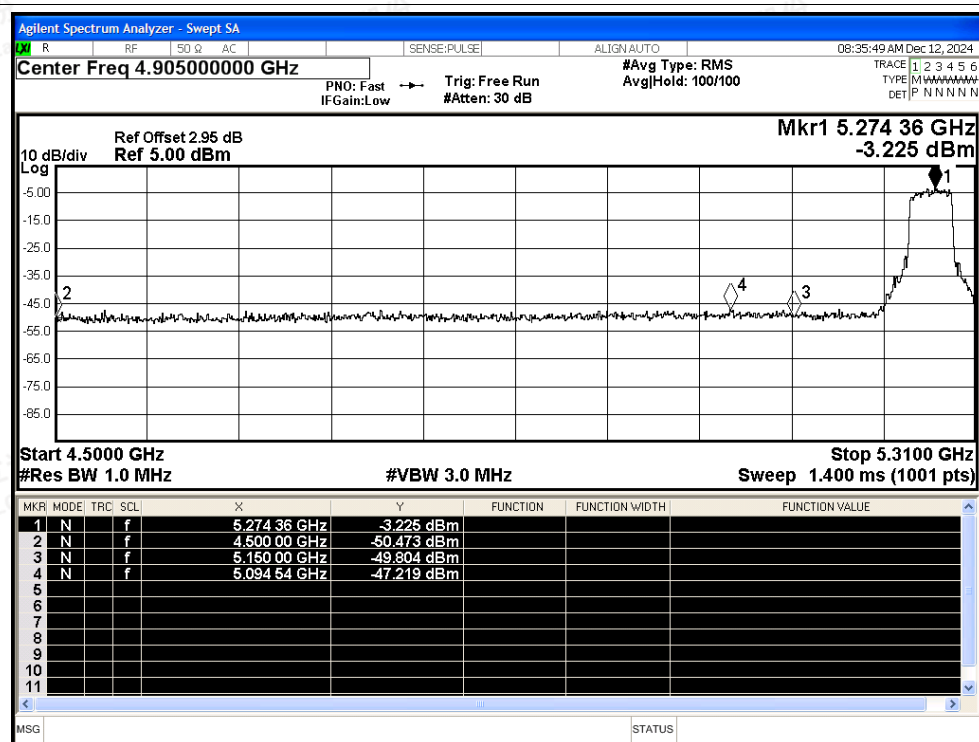

Restrict Band NVNT ax40 5270MHz Ant1 Average

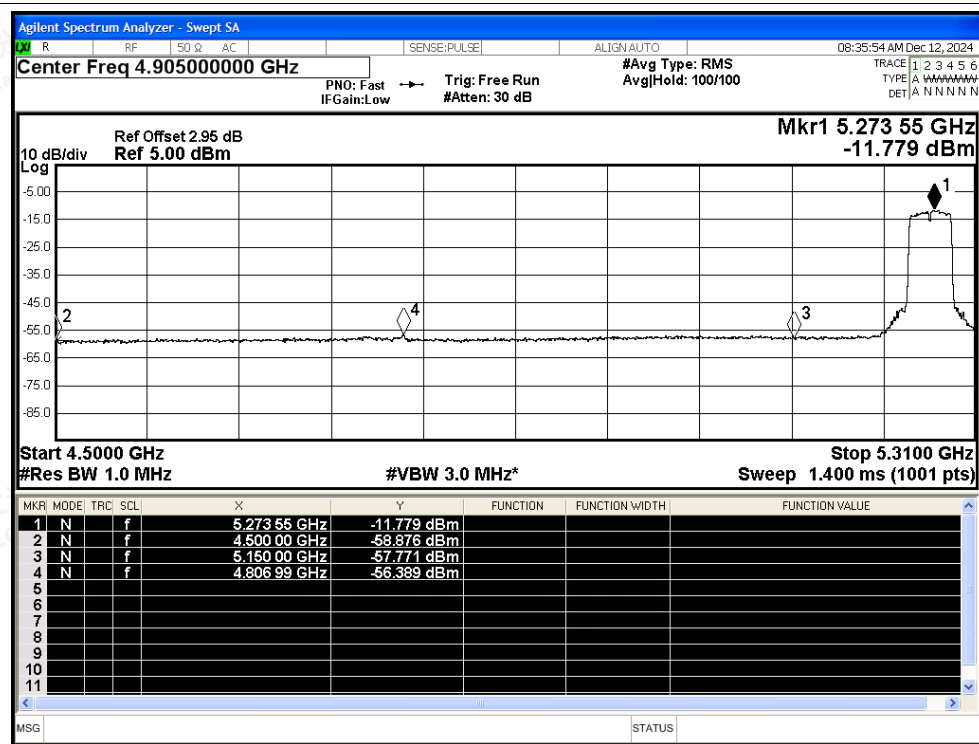

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant1 Peak

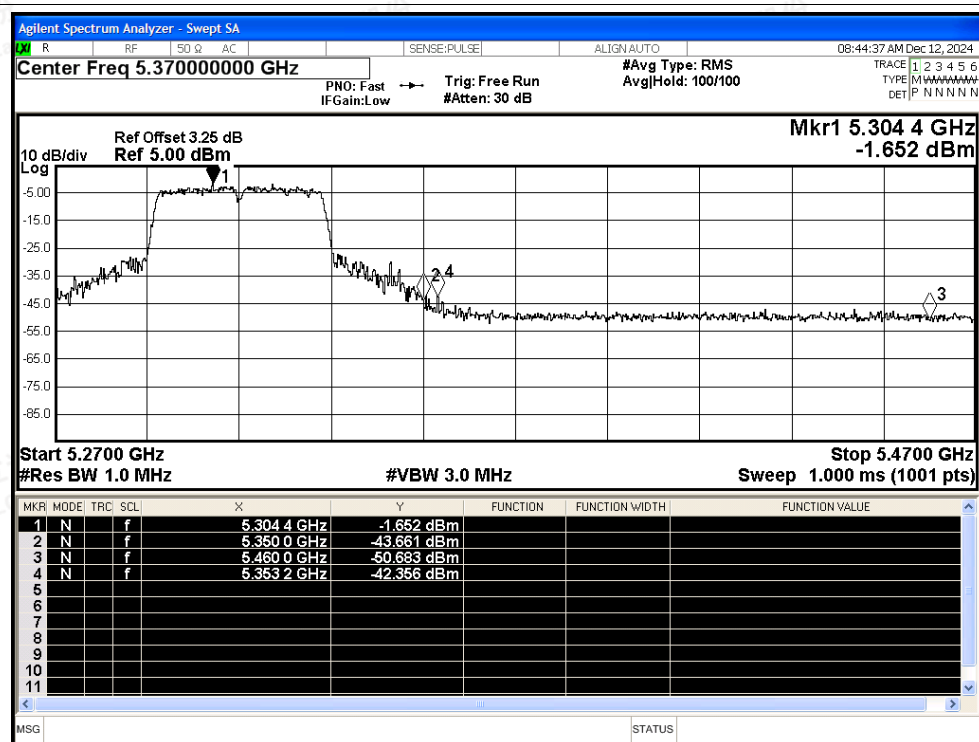

Restrict Band NVNT ax40 5310MHz Ant1 Average

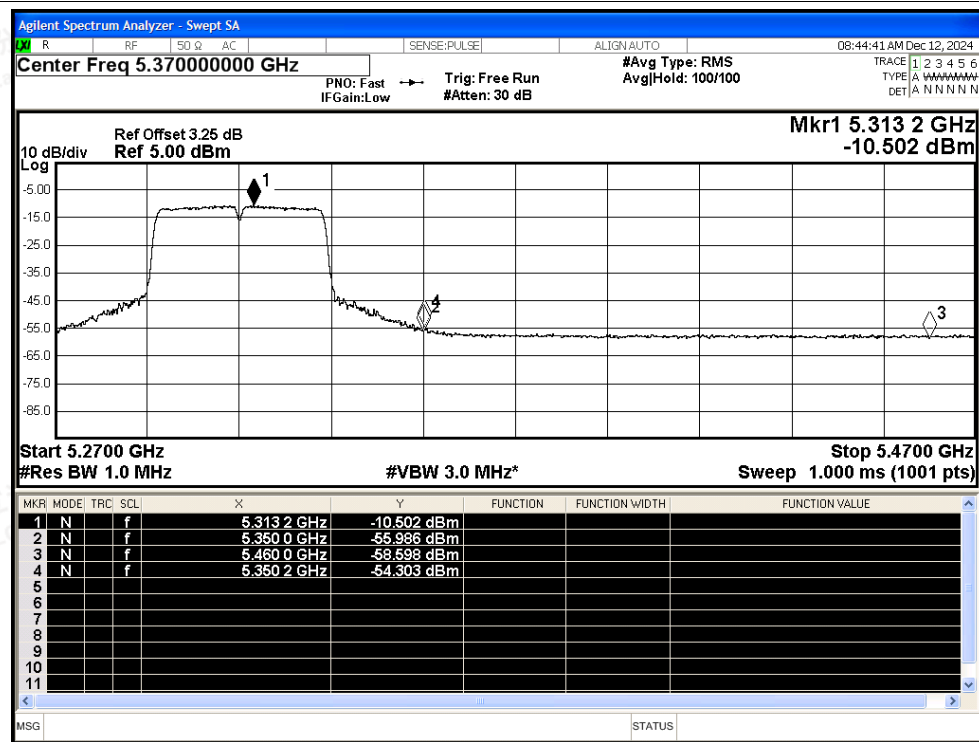

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

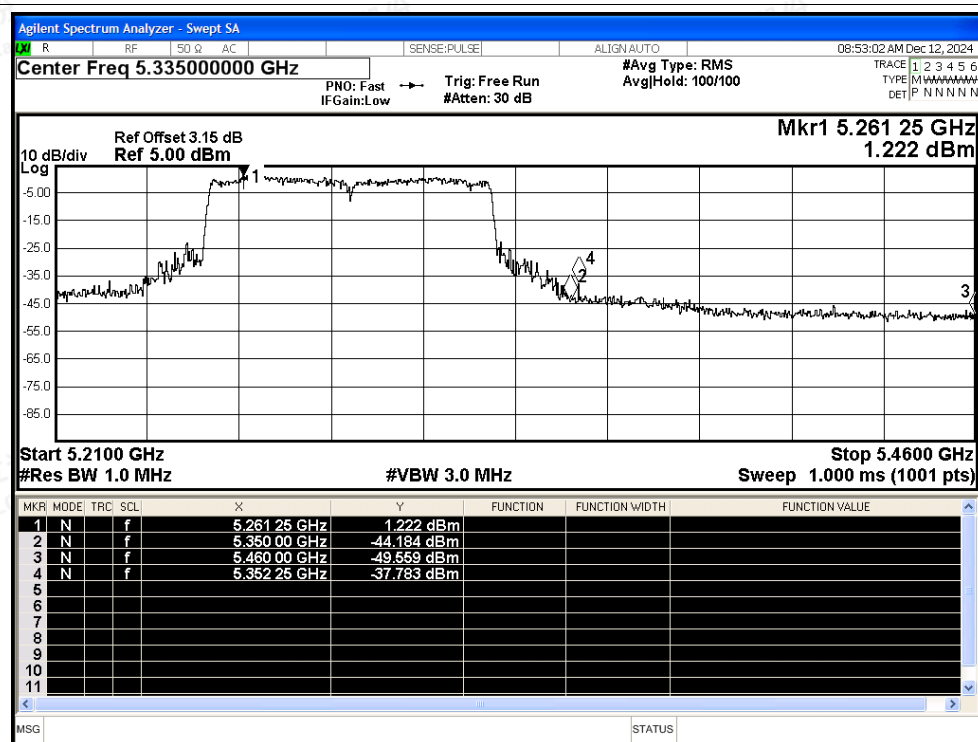

Restrict Band NVNT ax80 5290MHz Ant1 Average

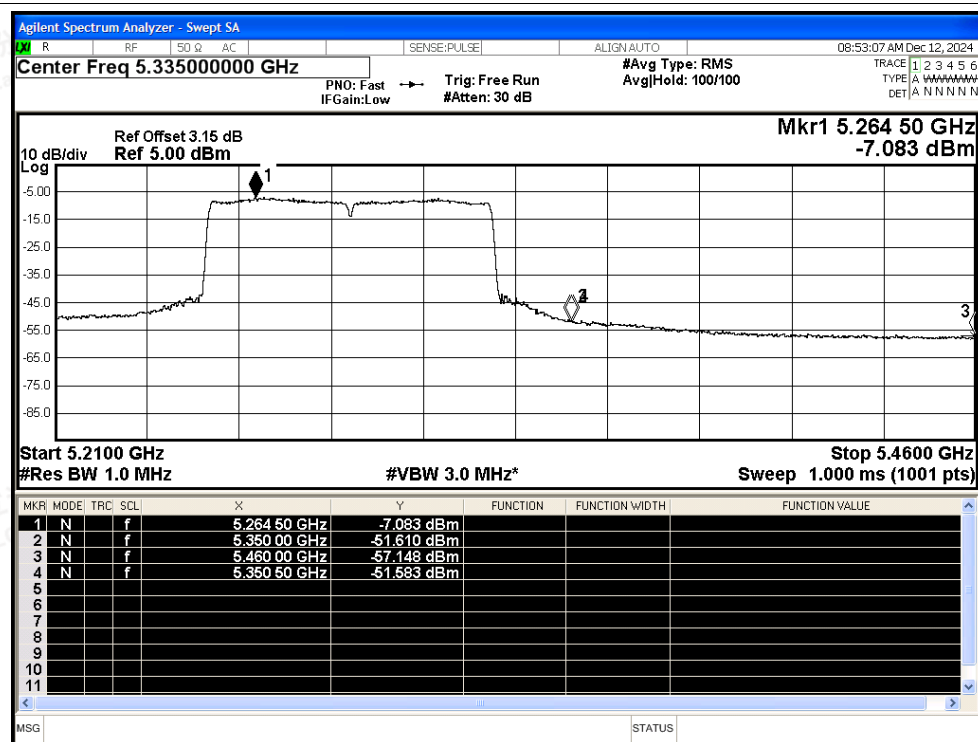

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

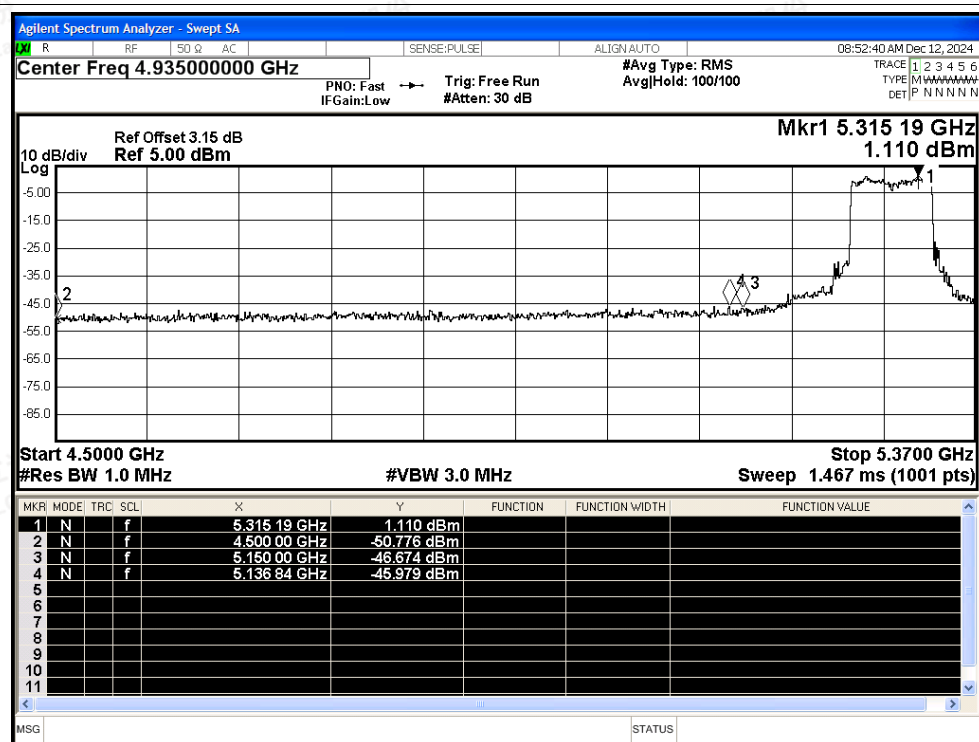

Restrict Band NVNT ax80 5290MHz Ant1 Average

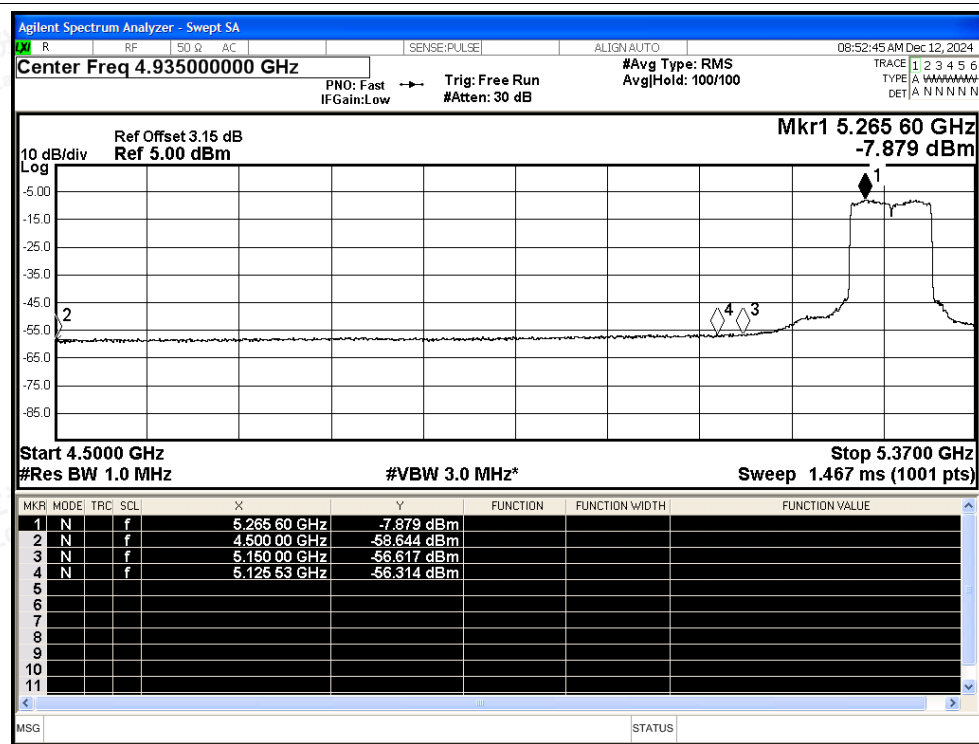

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-49.8	3	-	48.43	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-58.85	3	0.24	39.62	Average	54	Pass
NVNT	a	5260	Ant2	4804.98	-45.74	3	-	52.49	Peak	68.2	Pass
NVNT	a	5260	Ant2	5074.08	-56.94	3	0.24	41.53	Average	54	Pass
NVNT	a	5260	Ant2	5150	-48.17	3	-	50.06	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-57.54	3	0.24	40.93	Average	54	Pass
NVNT	a	5320	Ant2	5350	-48.36	3	-	49.87	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-56.98	3	0.24	41.49	Average	54	Pass
NVNT	a	5320	Ant2	5350.6	-44.43	3	-	53.80	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350.6	-56.02	3	0.24	42.45	Average	54	Pass
NVNT	a	5320	Ant2	5460	-49.79	3	-	48.44	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.47	3	0.24	41.00	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.91	3	-	46.32	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-59.43	3	0.12	38.92	Average	54	Pass
NVNT	n20	5260	Ant2	5120.88	-46.57	3	-	51.66	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5044.44	-56.93	3	0.12	41.42	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-47.74	3	-	50.49	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-57.69	3	0.12	40.66	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-46.84	3	-	51.39	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.7	3	0.12	42.65	Average	54	Pass
NVNT	n20	5320	Ant2	5353.4	-43.46	3	-	54.77	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350.6	-54.95	3	0.12	43.40	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-49.57	3	-	48.66	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.68	3	0.12	40.67	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-49.99	3	-	48.24	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-59.15	3	0.24	39.32	Average	54	Pass
NVNT	n40	5270	Ant2	5034.6	-46.14	3	-	52.09	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4772.97	-56.67	3	0.24	41.80	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-48.54	3	-	49.69	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.1	3	0.24	41.37	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-42.91	3	-	55.32	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-56.04	3	0.24	42.43	Average	54	Pass
NVNT	n40	5310	Ant2	5350.2	-40.97	3	-	57.26	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5353.2	-55.59	3	0.24	42.88	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-49.79	3	-	48.44	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.84	3	0.24	40.63	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-51.97	3	-	46.26	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-59.5	3	0.12	38.85	Average	54	Pass
NVNT	ac20	5260	Ant2	5010.9	-47.32	3	-	50.91	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	5093.58	-56.87	3	0.12	41.48	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-49.45	3	-	48.78	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-57.62	3	0.12	40.73	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-45.28	3	-	52.95	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-56.03	3	0.12	42.32	Average	54	Pass
NVNT	ac20	5320	Ant2	5350.8	-42.41	3	-	55.82	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5351.6	-55.73	3	0.12	42.62	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-48.54	3	-	49.69	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-58.31	3	0.12	40.04	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-50.41	3	-	47.82	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.71	3	0.23	39.75	Average	54	Pass
NVNT	ac40	5270	Ant2	5112.36	-46.07	3	-	52.16	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5007.87	-56.84	3	0.23	41.62	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-49.19	3	-	49.04	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-57.25	3	0.23	41.21	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-44.18	3	-	54.05	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-55.67	3	0.24	42.80	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-44.18	3	-	54.05	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.4	-55.27	3	0.24	43.20	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.19	3	-	49.04	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.46	3	0.24	41.01	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-49.77	3	-	48.46	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.88	3	0.25	39.60	Average	54	Pass
NVNT	ac80	5290	Ant2	5082.9	-46.87	3	-	51.36	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5056.8	-56.36	3	0.25	42.12	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-47.29	3	-	50.94	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-56.9	3	0.25	41.58	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-43.7	3	-	54.53	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-53.19	3	0.25	45.29	Average	54	Pass
NVNT	ac80	5290	Ant2	5358.5	-43.17	3	-	55.06	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350.25	-52.39	3	0.25	46.09	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-49.19	3	-	49.04	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.38	3	0.25	41.10	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-48.02	3	-	50.21	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-59	3	0.12	39.35	Average	54	Pass
NVNT	ax20	5260	Ant2	5034.3	-45.91	3	-	52.32	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4787.82	-55.58	3	0.12	42.77	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-46.67	3	-	51.56	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-57.04	3	0.12	41.31	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-45.15	3	-	53.08	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-55.75	3	0.12	42.60	Average	54	Pass
NVNT	ax20	5320	Ant2	5350.4	-44.21	3	-	54.02	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-55.75	3	0.12	42.60	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant2	5460	-50.99	3	-	47.24	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.78	3	0.12	40.57	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-50.53	3	-	47.70	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-58.93	3	0.24	39.54	Average	54	Pass
NVNT	ax40	5270	Ant2	5137.47	-45.32	3	-	52.91	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.99	-56.65	3	0.24	41.82	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-49.13	3	-	49.10	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-57.17	3	0.24	41.30	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-43.04	3	-	55.19	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-55.32	3	0.24	43.15	Average	54	Pass
NVNT	ax40	5310	Ant2	5355	-42.3	3	-	55.93	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-55.32	3	0.24	43.15	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-48.9	3	-	49.33	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.5	3	0.24	40.97	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-43.87	3	-	54.36	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-52	3	0.25	46.48	Average	54	Pass
NVNT	ax80	5290	Ant2	5350.75	-39.1	3	-	59.13	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-52	3	0.25	46.48	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-49.78	3	-	48.45	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.61	3	0.25	40.87	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-49.64	3	-	48.59	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.87	3	0.25	39.61	Average	54	Pass
NVNT	ax80	5290	Ant2	5119.44	-45.39	3	-	52.84	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5125.53	-56.26	3	0.25	42.22	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-49.6	3	-	48.63	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-56.49	3	0.25	41.99	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

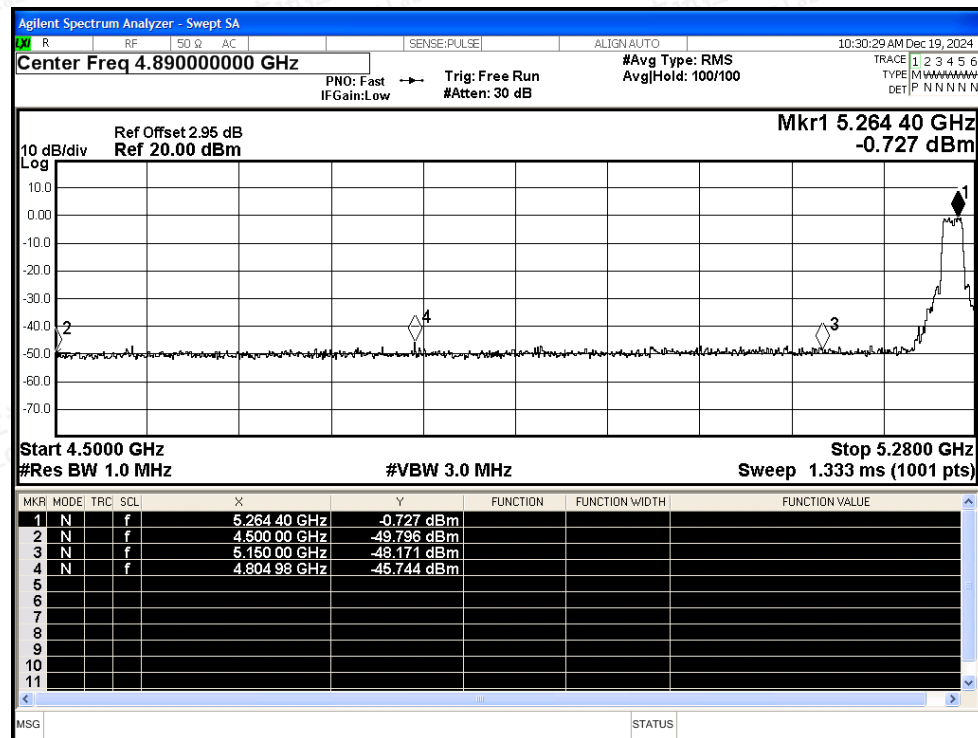

Restrict Band NVNT a 5260MHz Ant2 Average

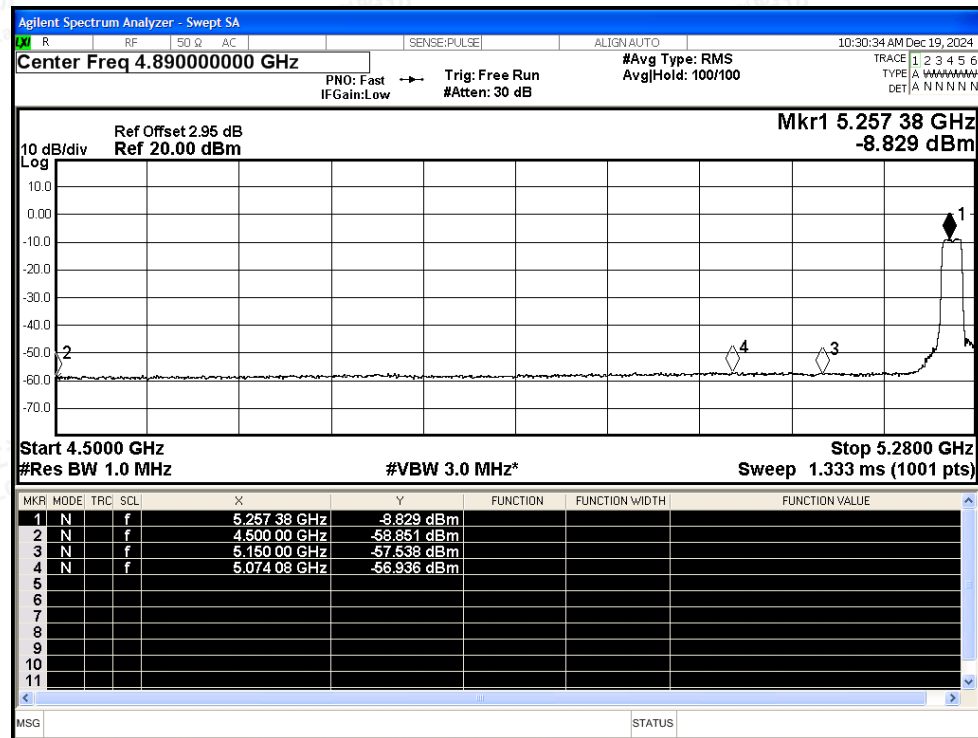

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

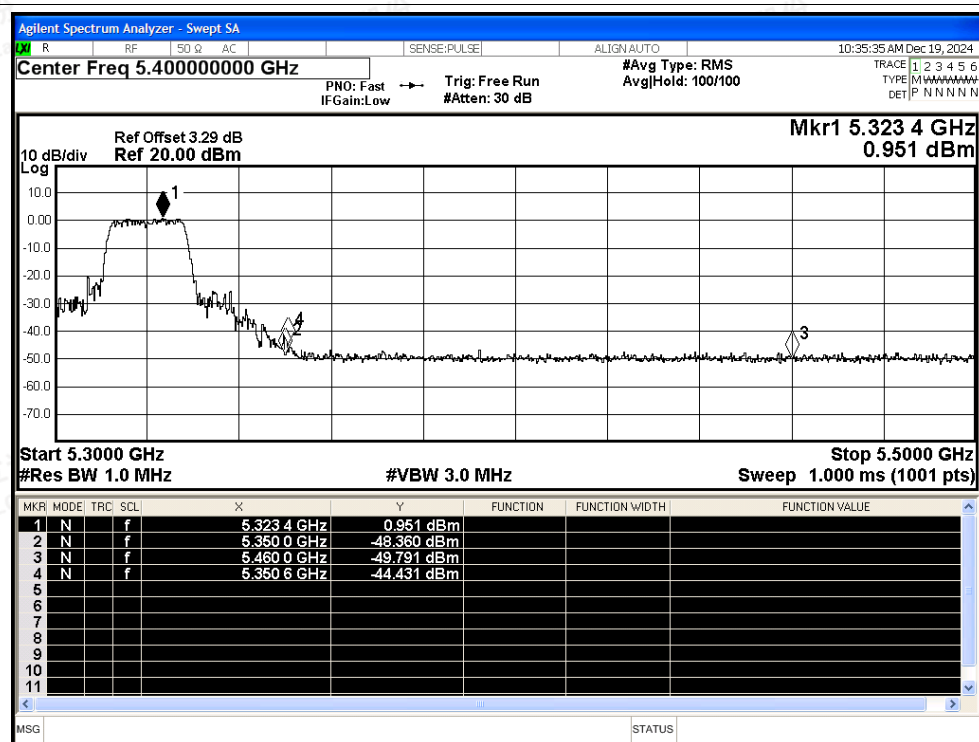

Restrict Band NVNT a 5320MHz Ant2 Average

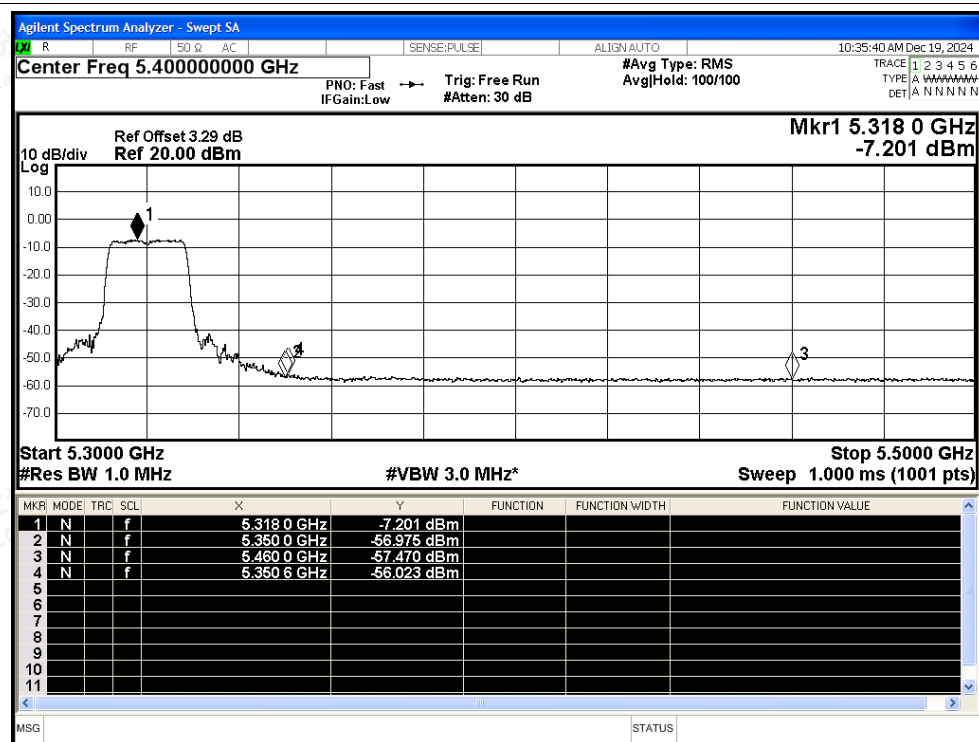

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

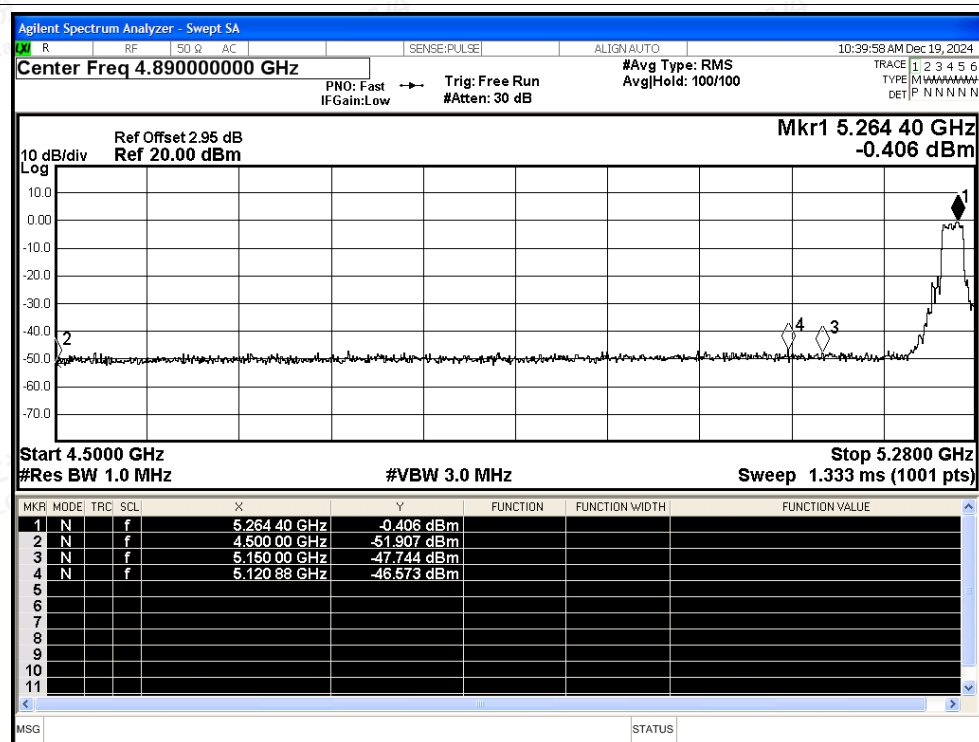

Restrict Band NVNT n20 5260MHz Ant2 Average

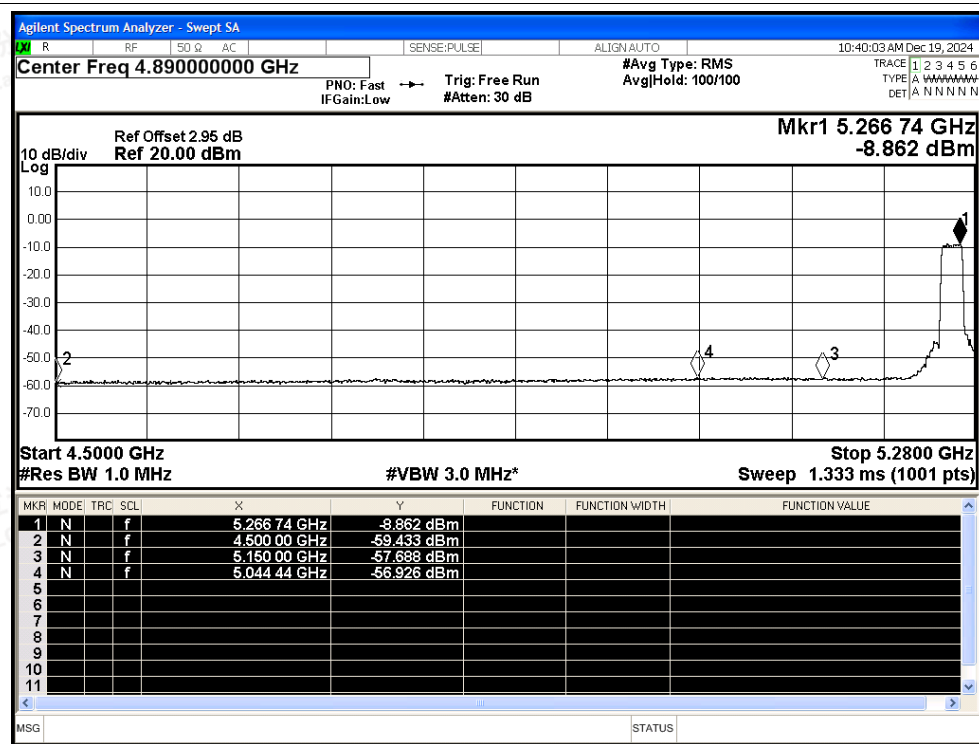

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

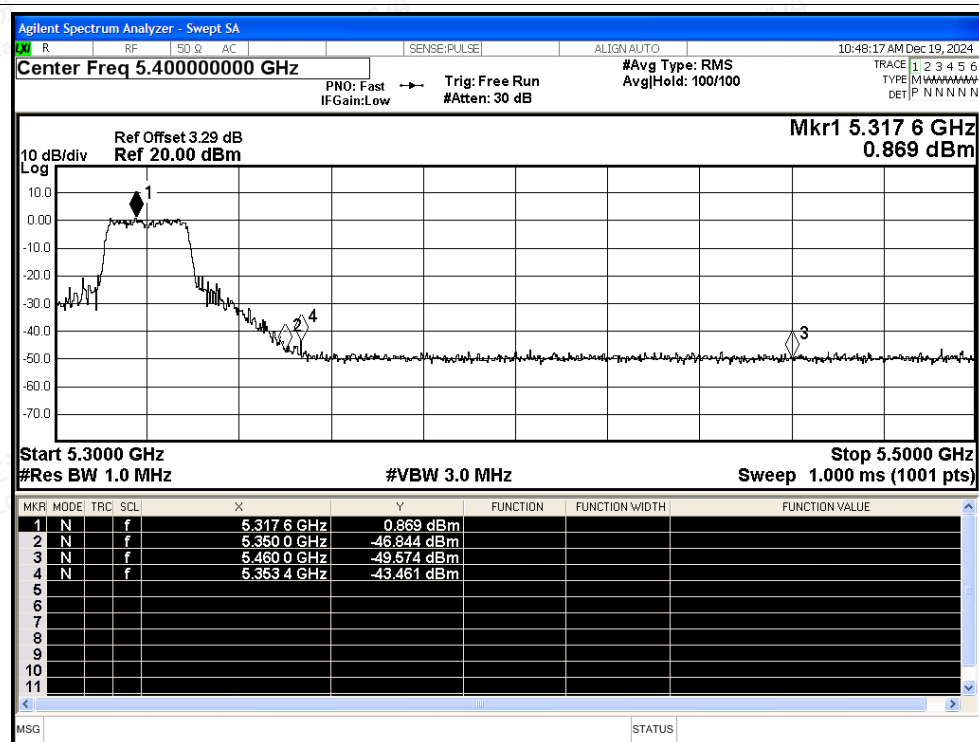

Restrict Band NVNT n20 5320MHz Ant2 Average

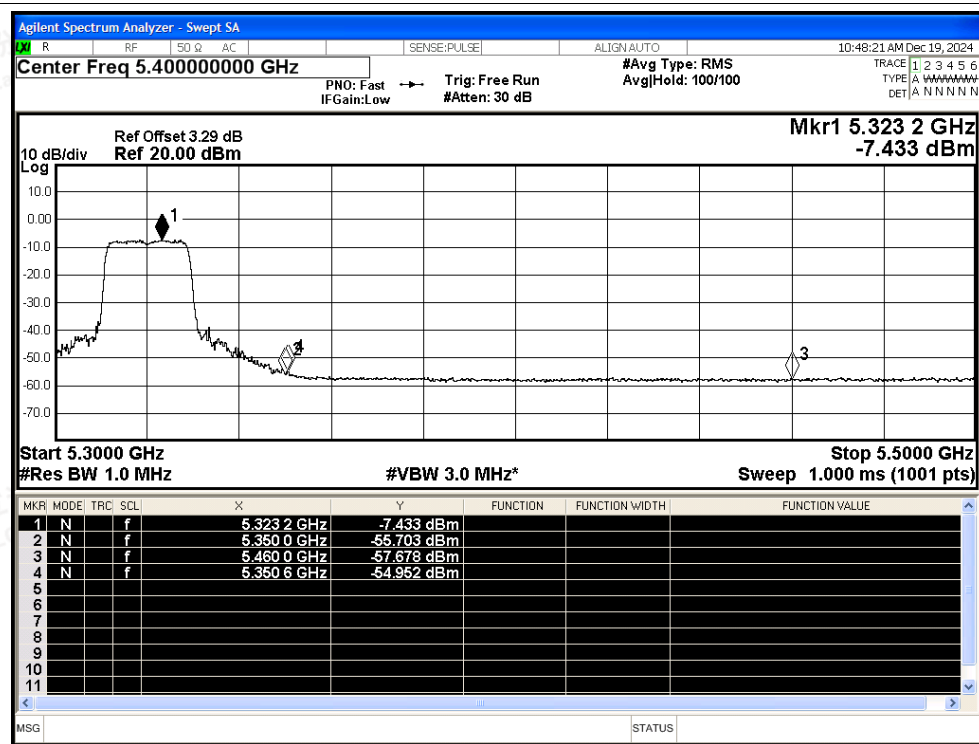

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

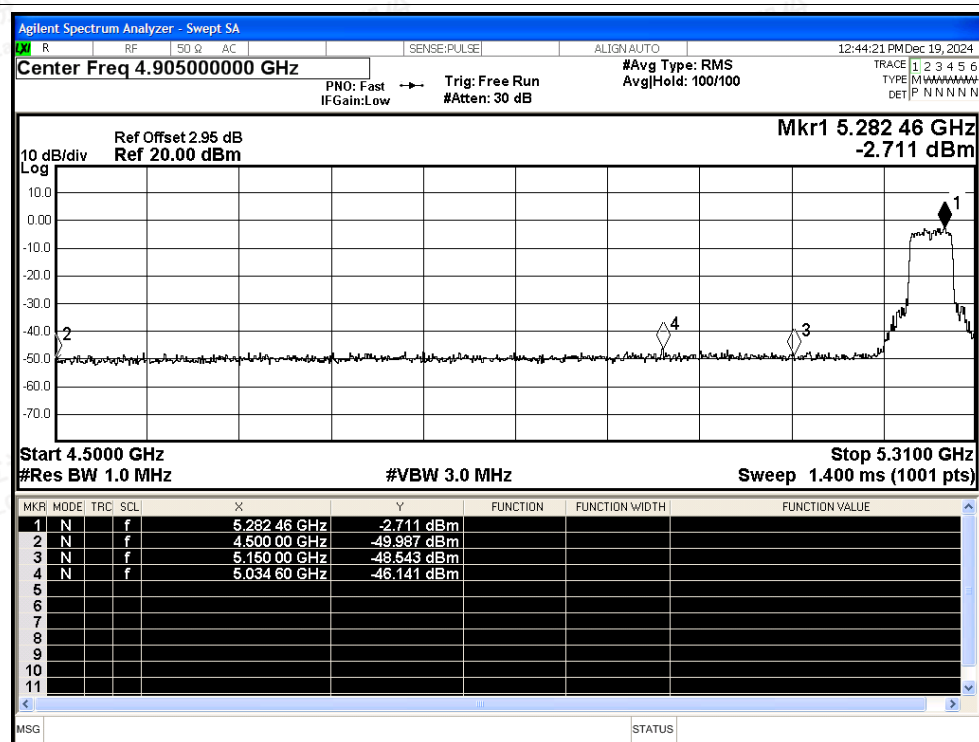

Restrict Band NVNT n40 5270MHz Ant2 Average

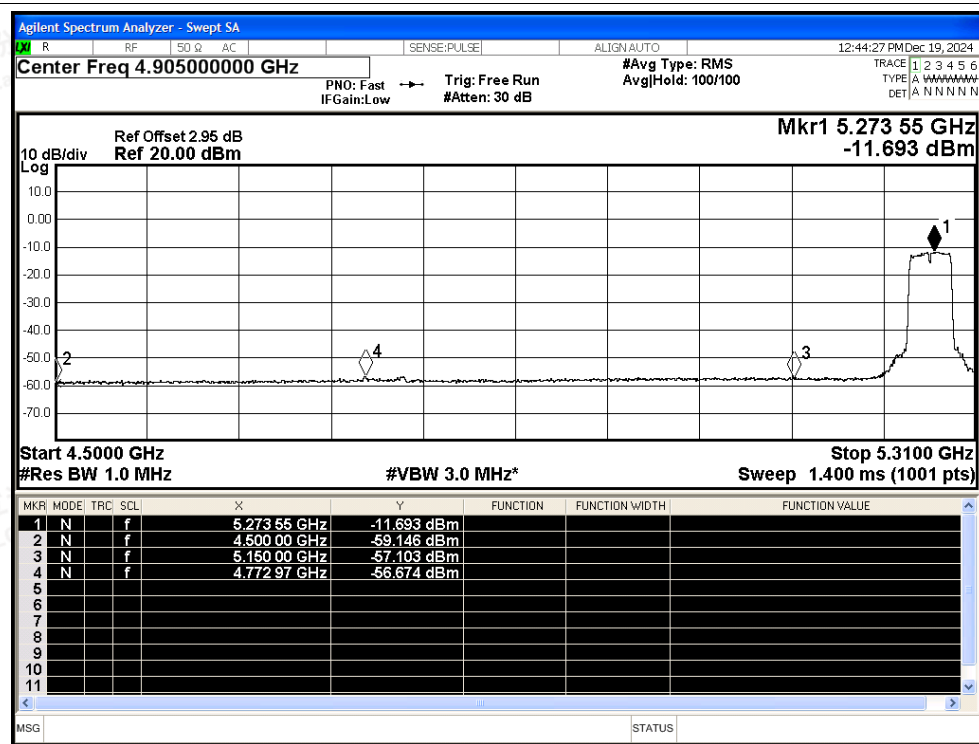

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

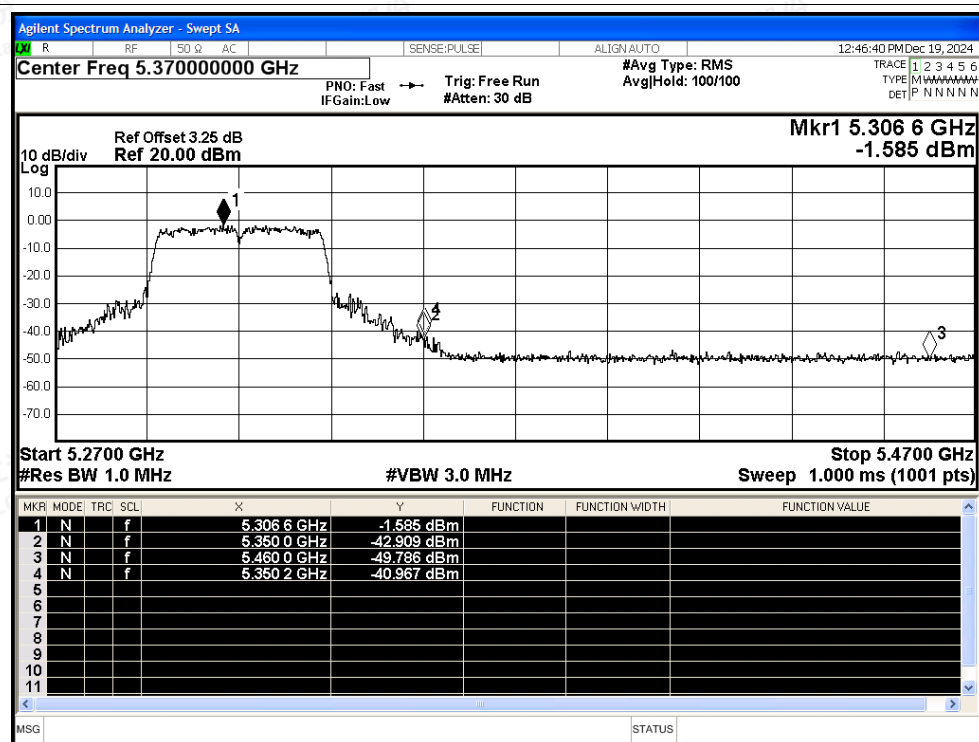

Restrict Band NVNT n40 5310MHz Ant2 Average

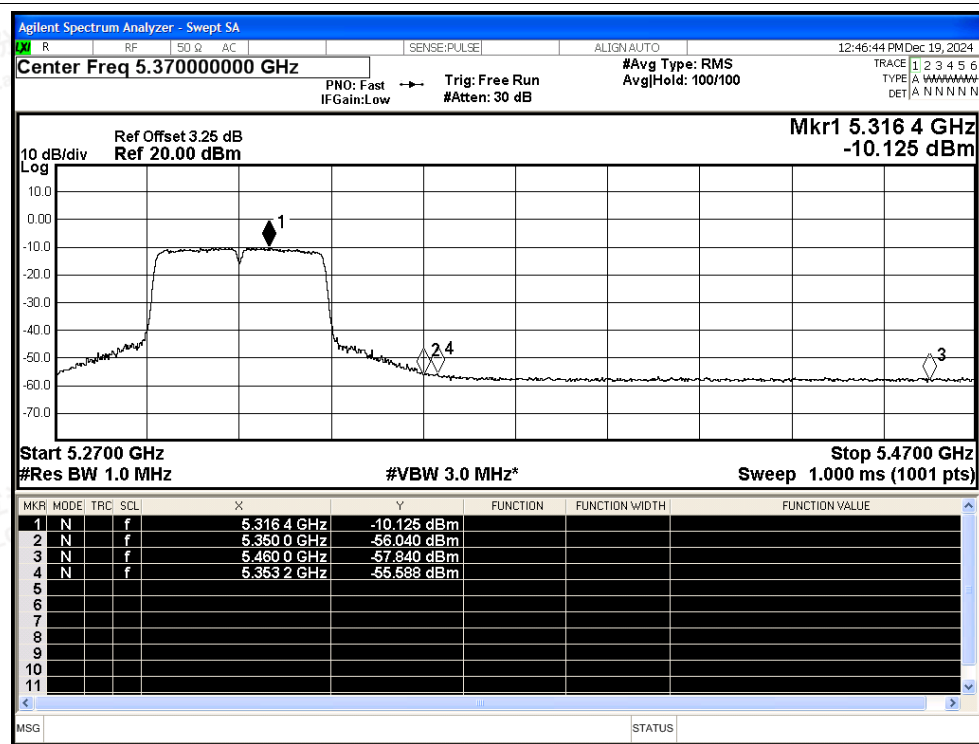

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant2 Peak

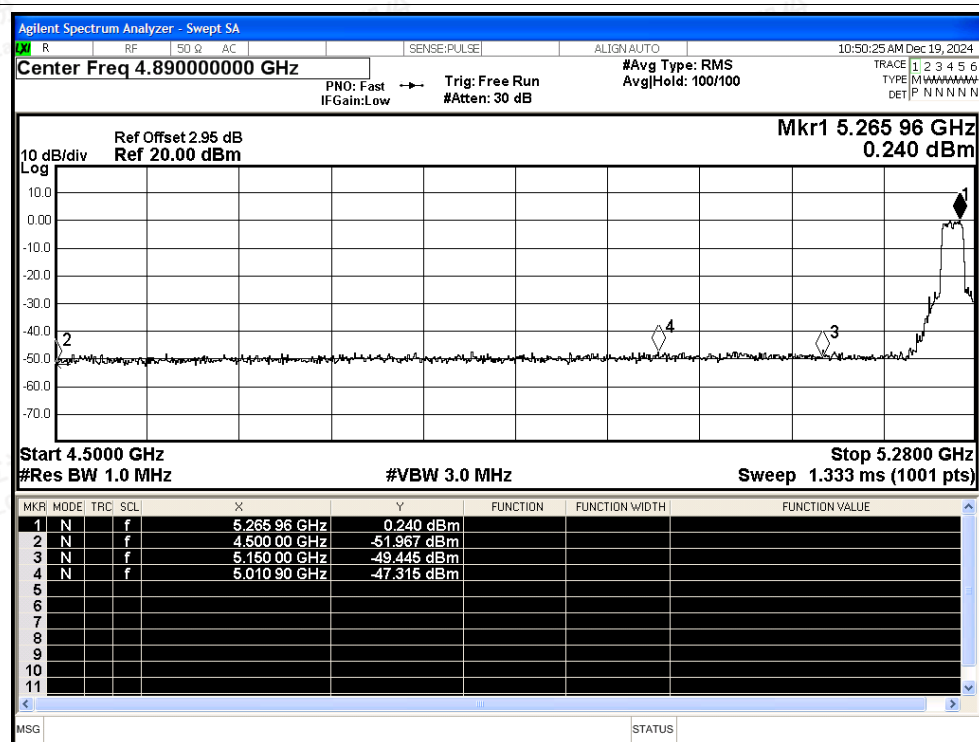

Restrict Band NVNT ac20 5260MHz Ant2 Average

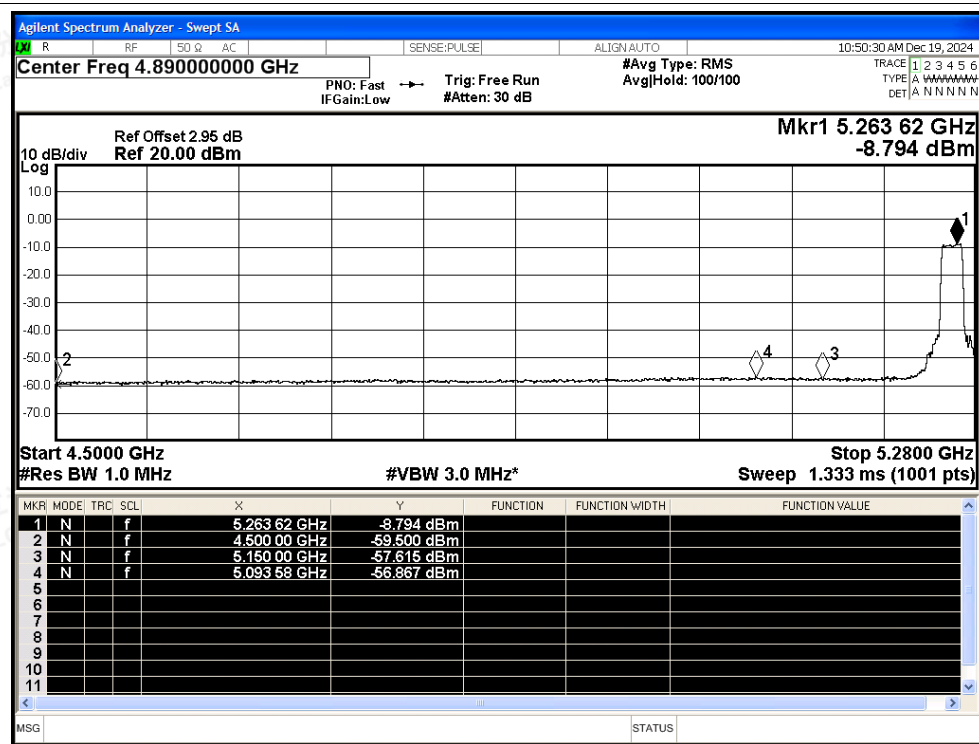

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

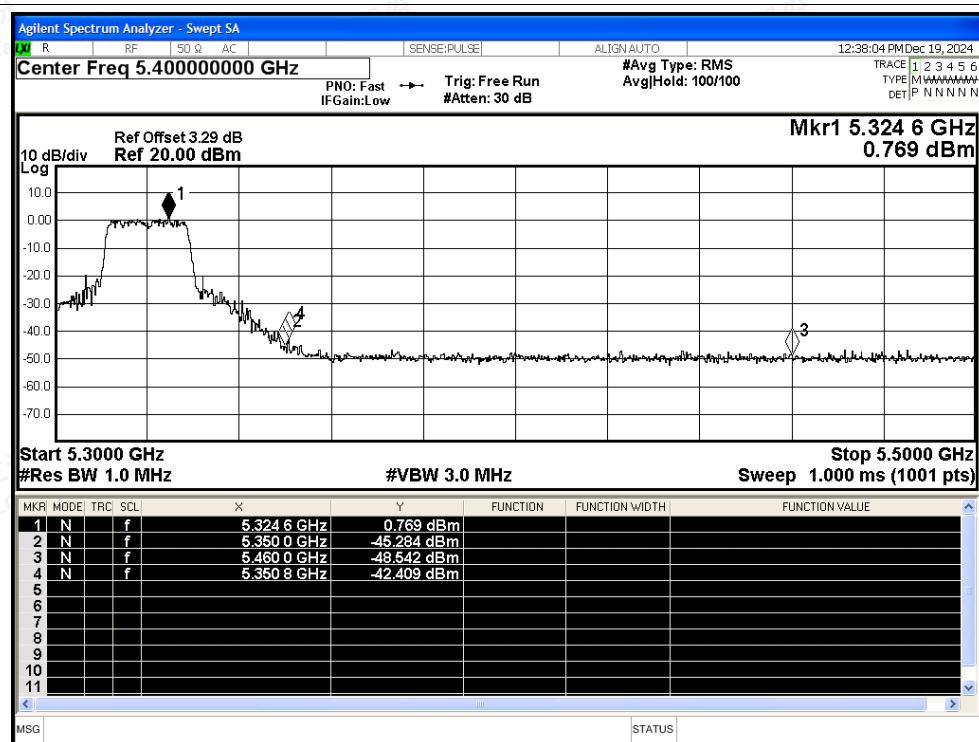

Restrict Band NVNT ac20 5320MHz Ant2 Average

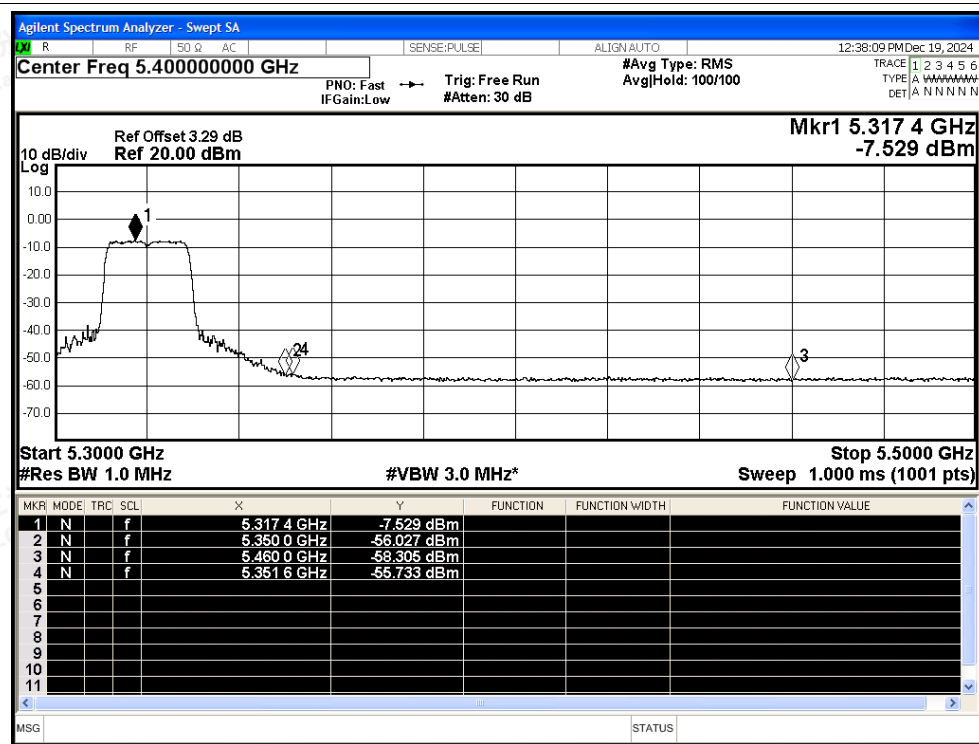

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

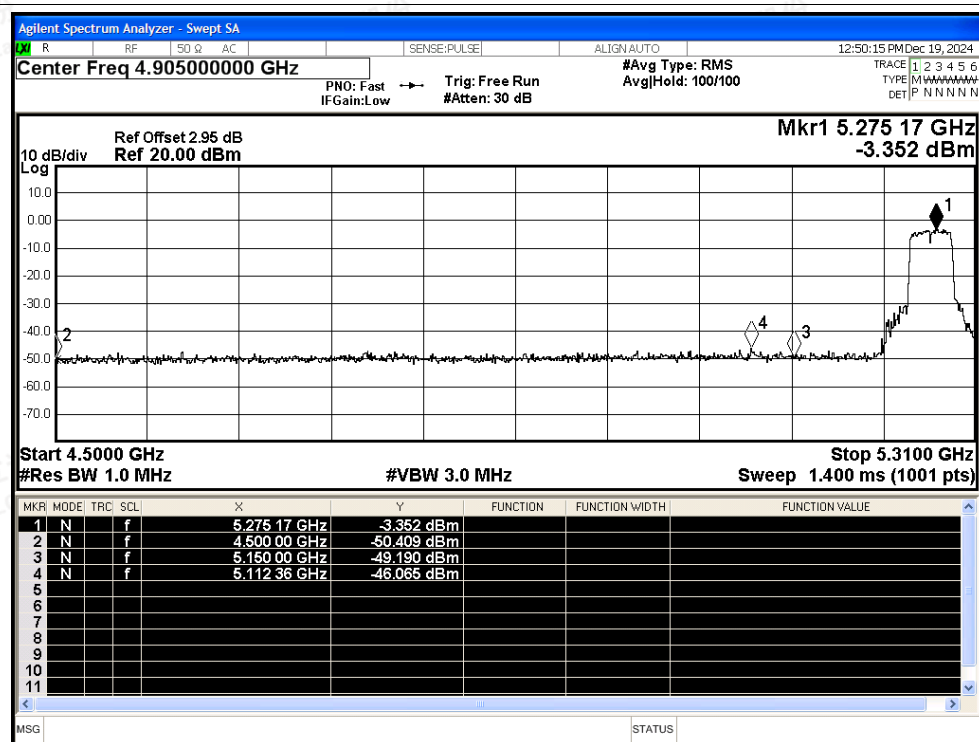

Restrict Band NVNT ac40 5270MHz Ant2 Average

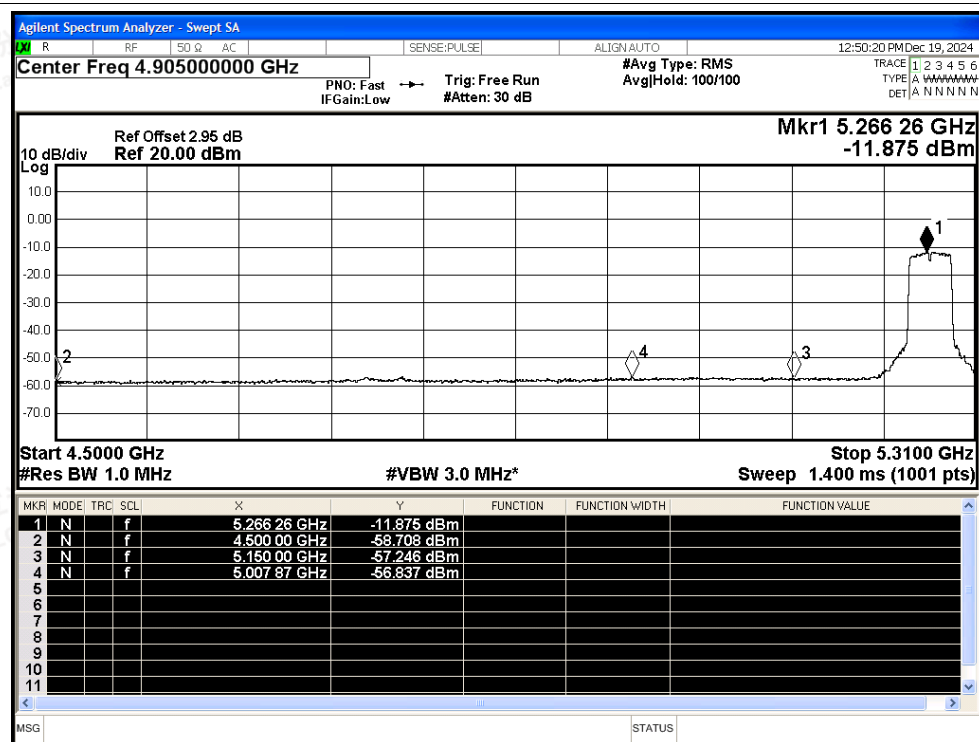

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

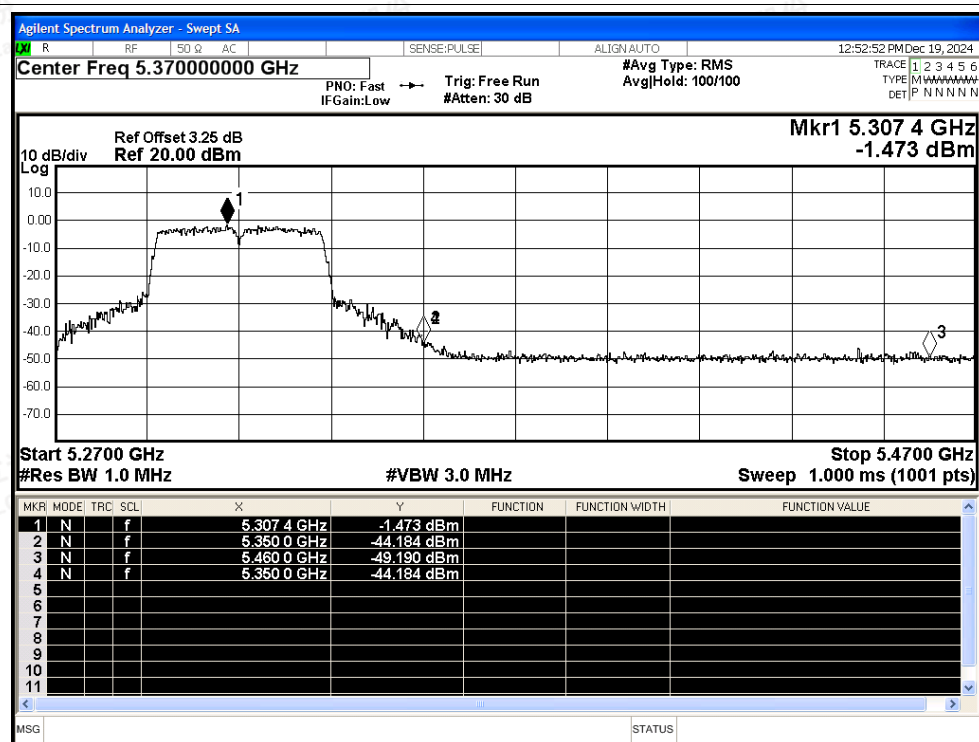

Restrict Band NVNT ac40 5310MHz Ant2 Average

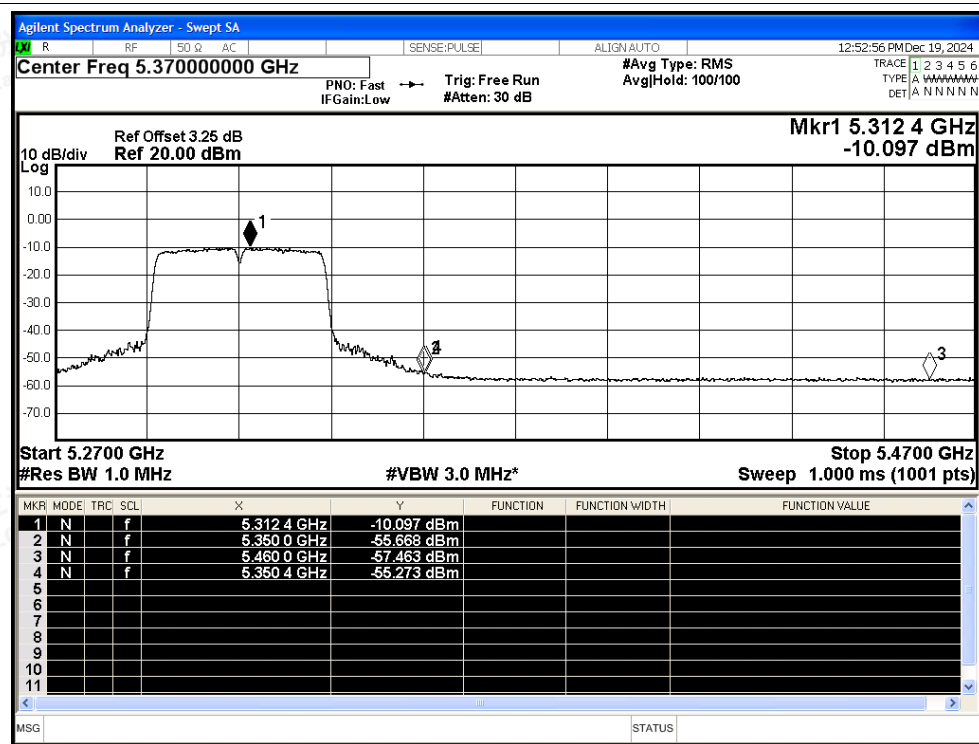

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

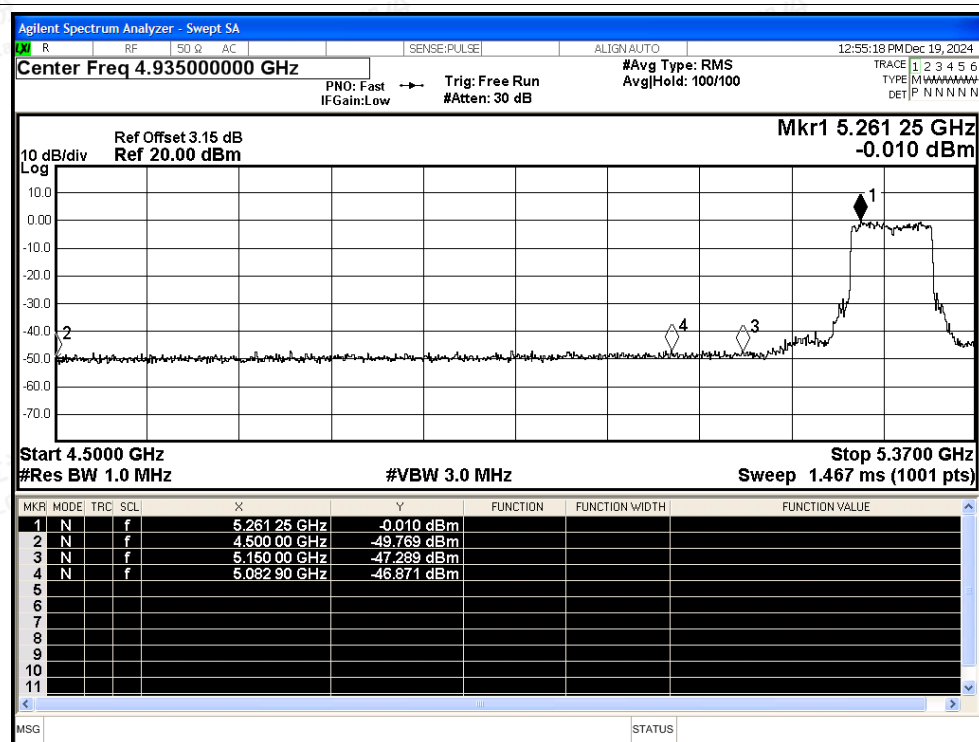

Restrict Band NVNT ac80 5290MHz Ant2 Average

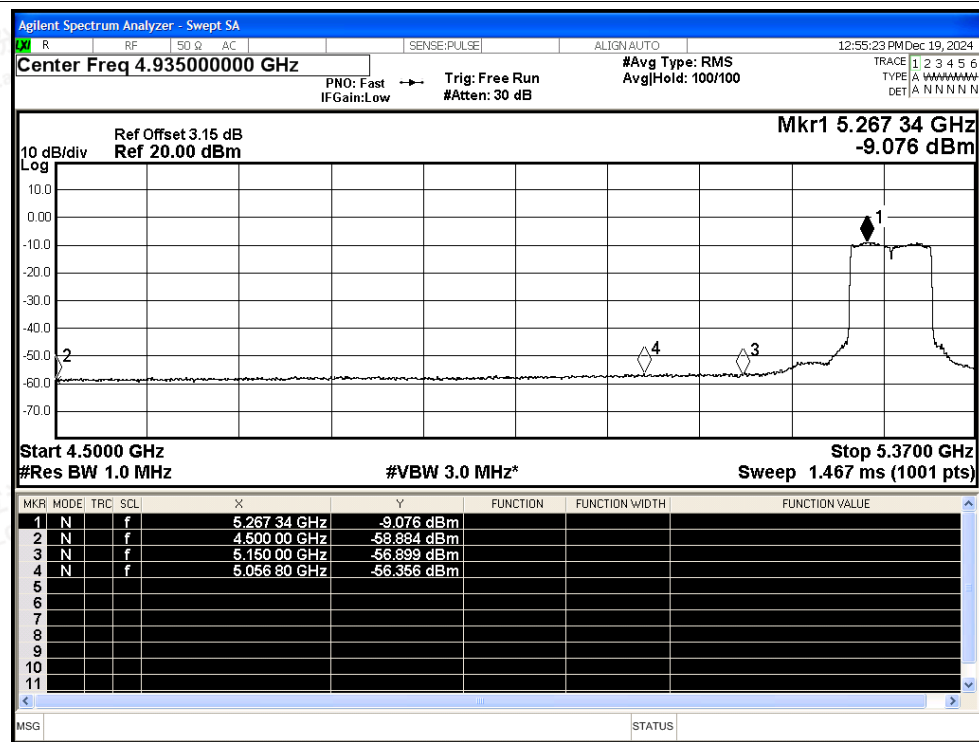

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

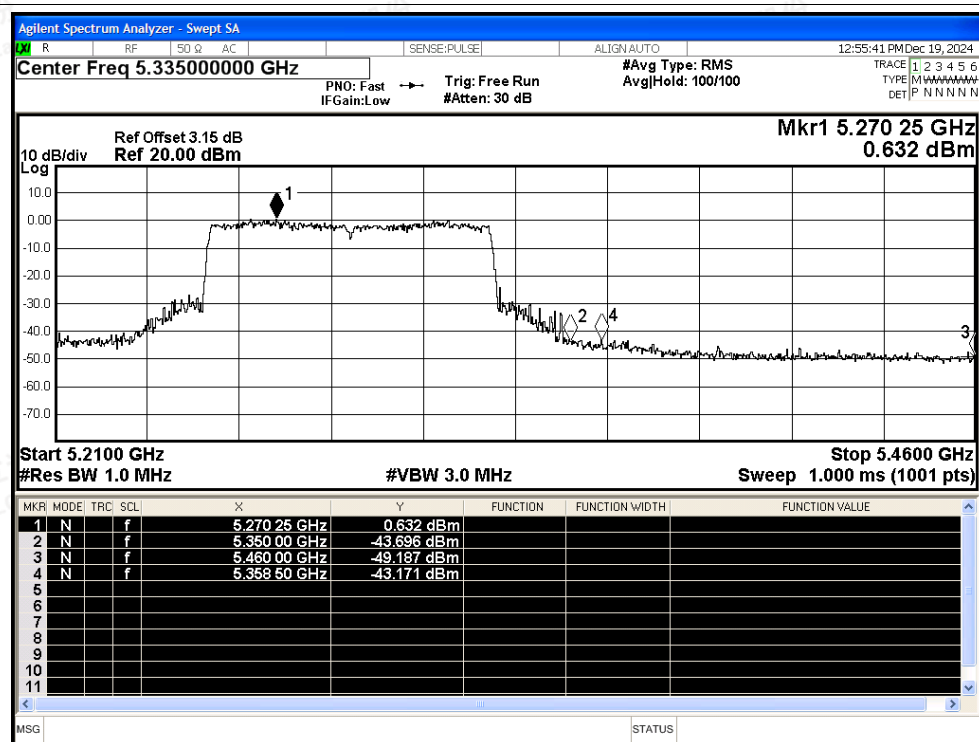

Restrict Band NVNT ac80 5290MHz Ant2 Average

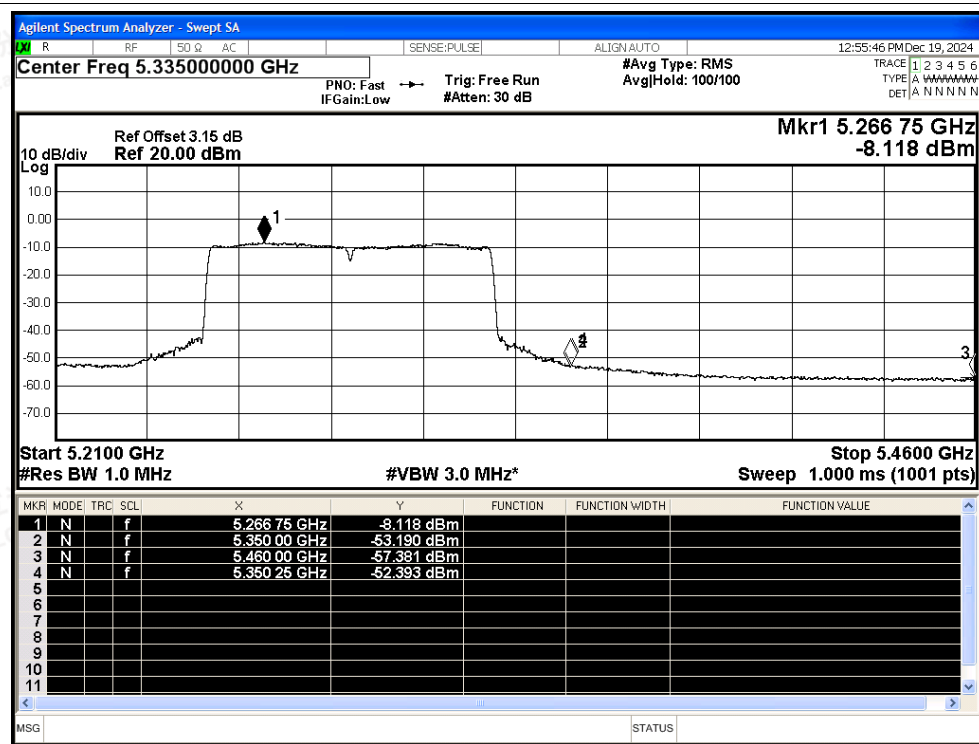

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant2 Peak

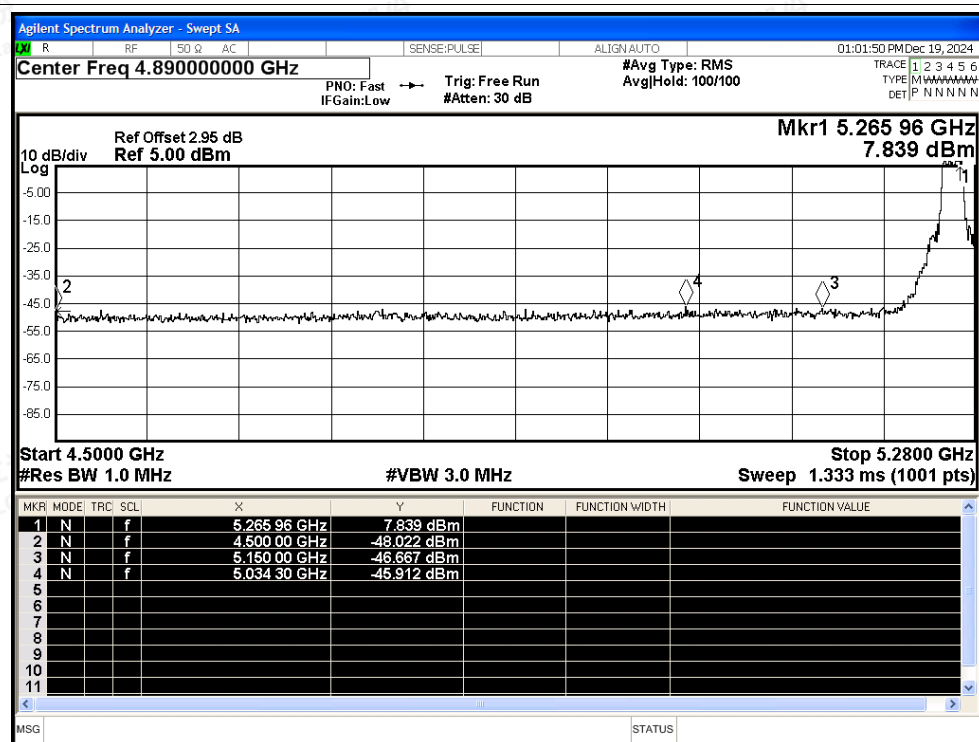

Restrict Band NVNT ax20 5260MHz Ant2 Average

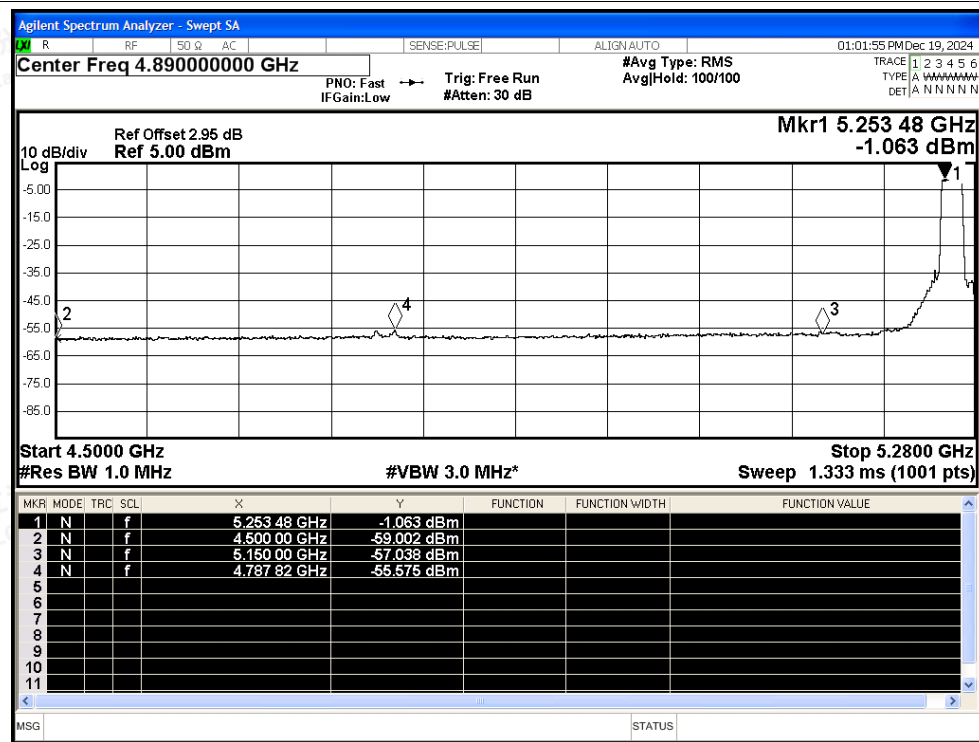

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant2 Peak

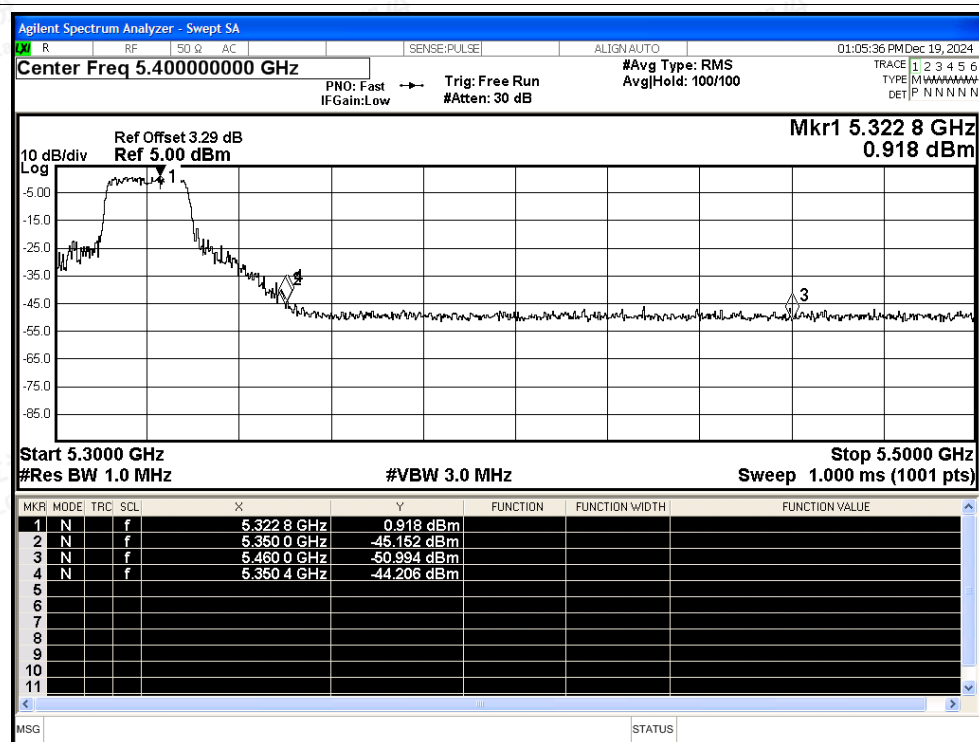

Restrict Band NVNT ax20 5320MHz Ant2 Average

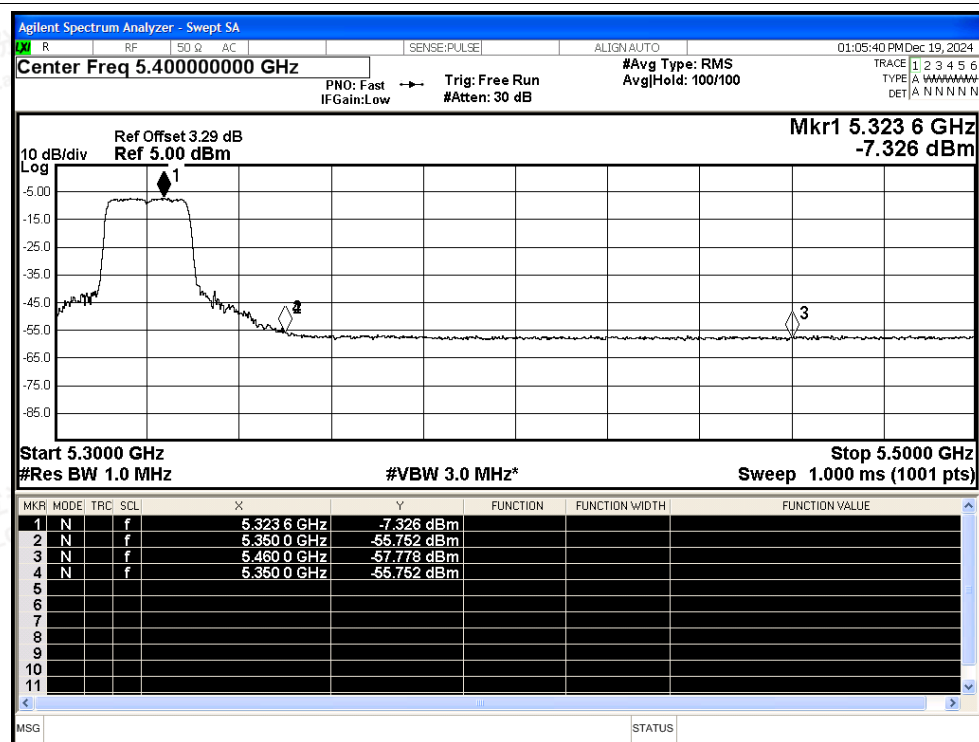

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant2 Peak

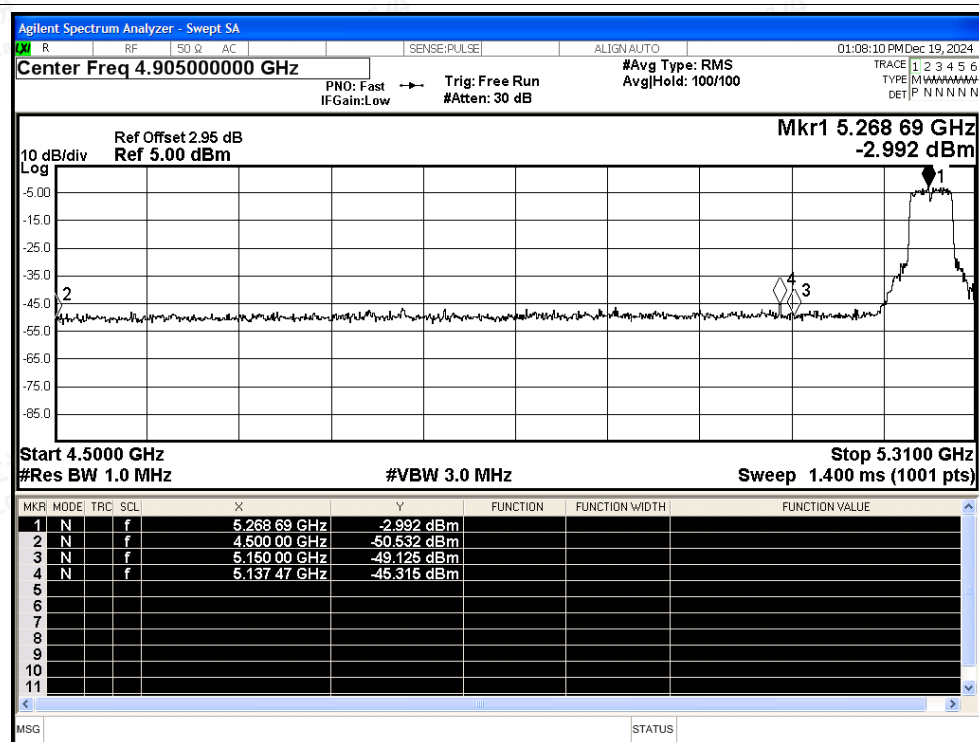

Restrict Band NVNT ax40 5270MHz Ant2 Average

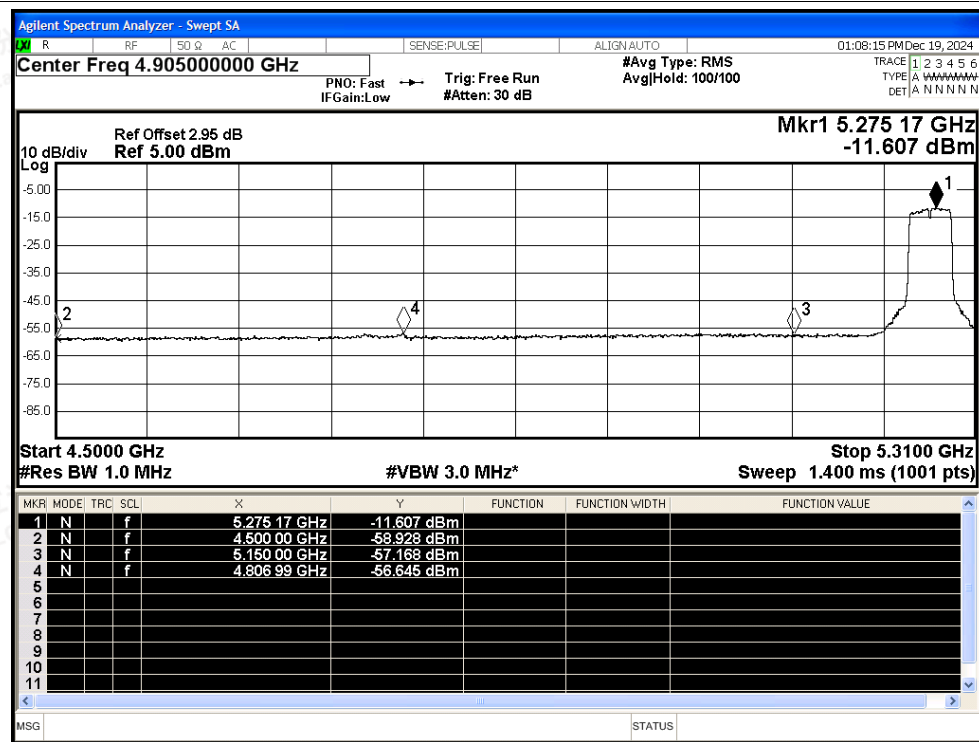

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant2 Peak

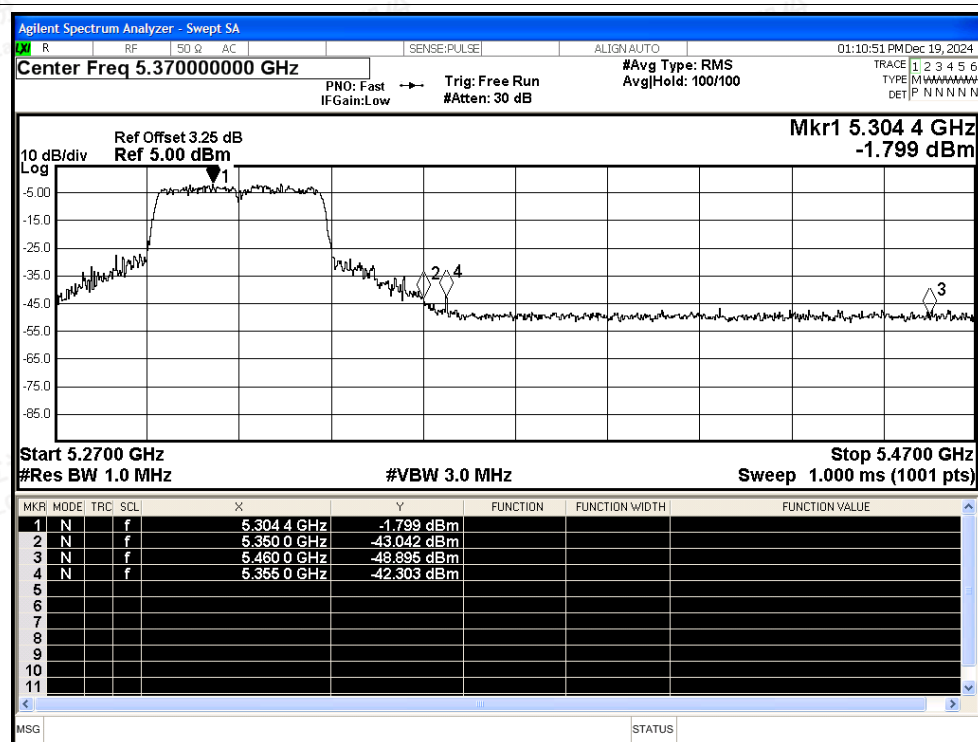

Restrict Band NVNT ax40 5310MHz Ant2 Average

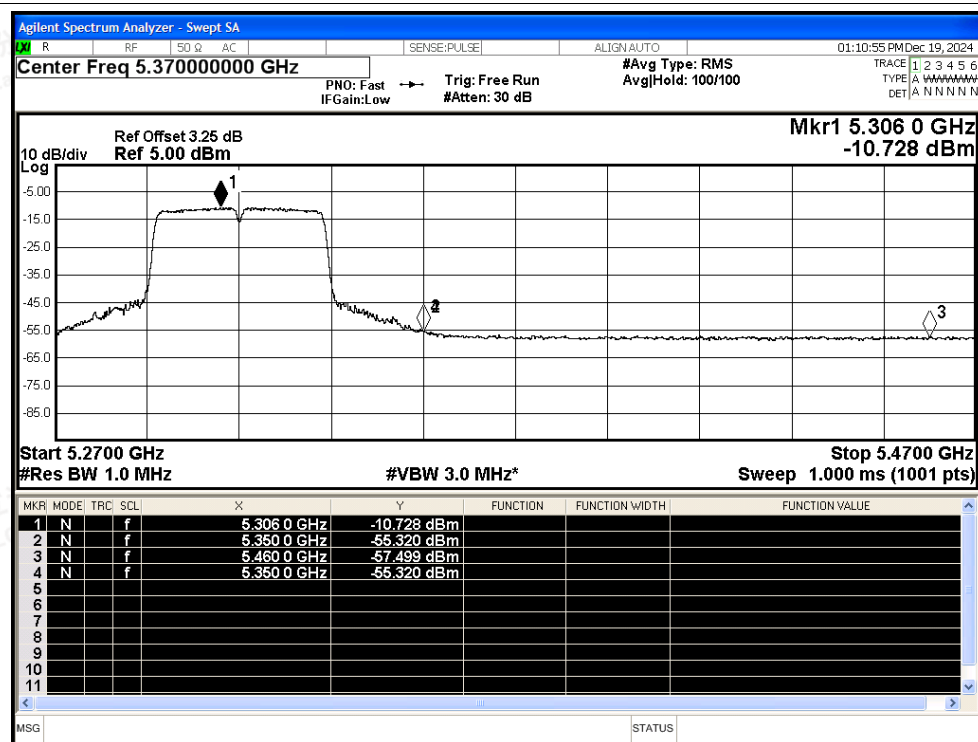

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

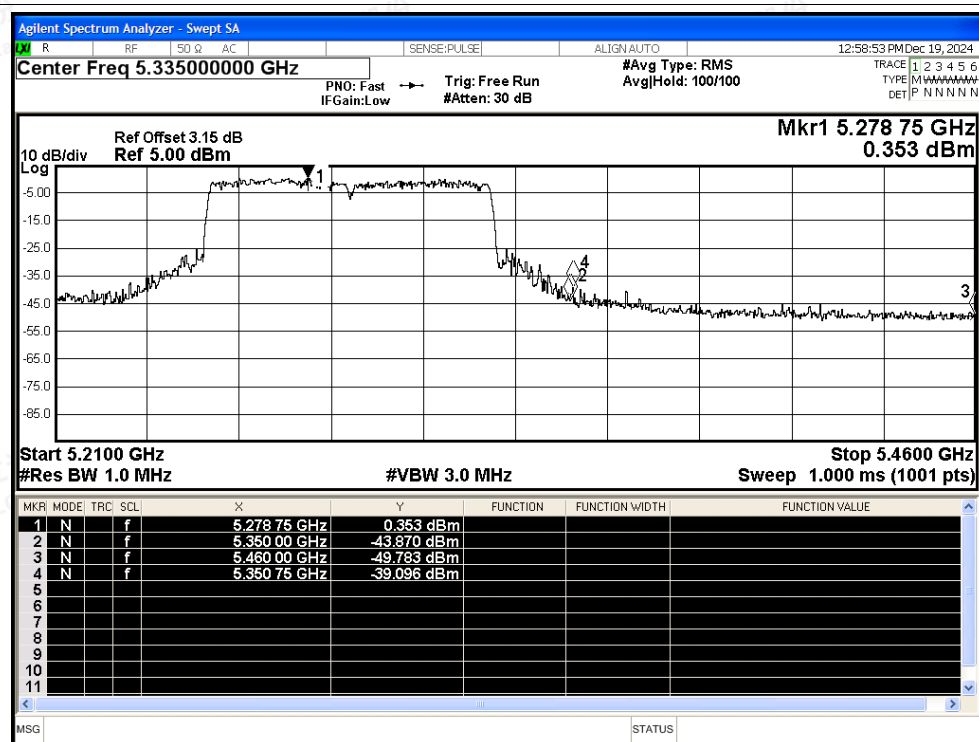

Restrict Band NVNT ax80 5290MHz Ant2 Average

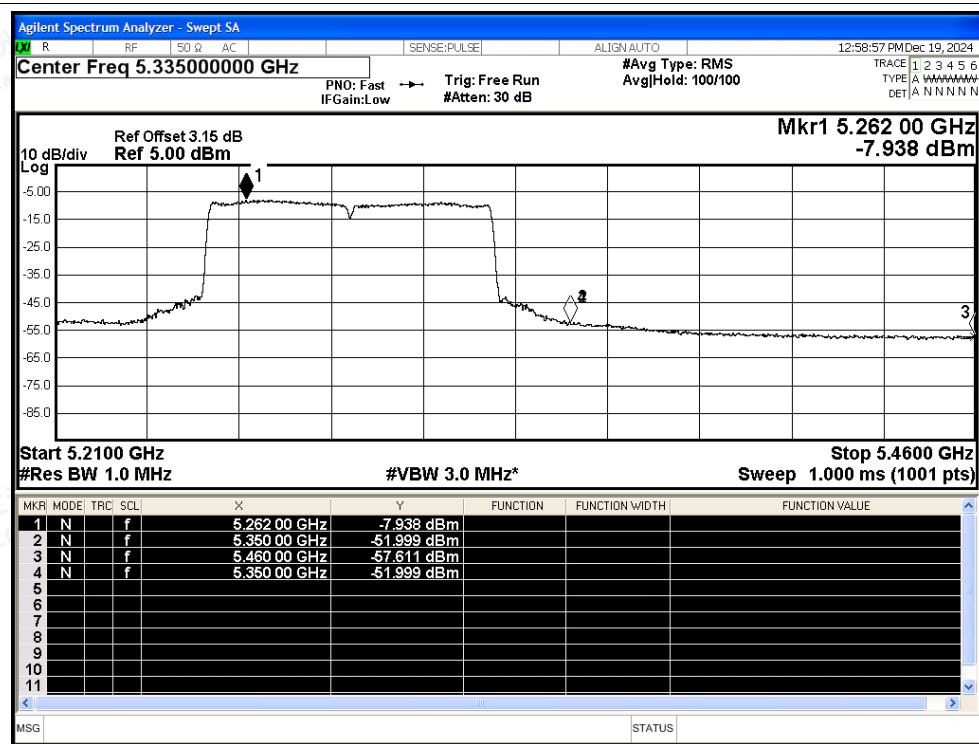

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

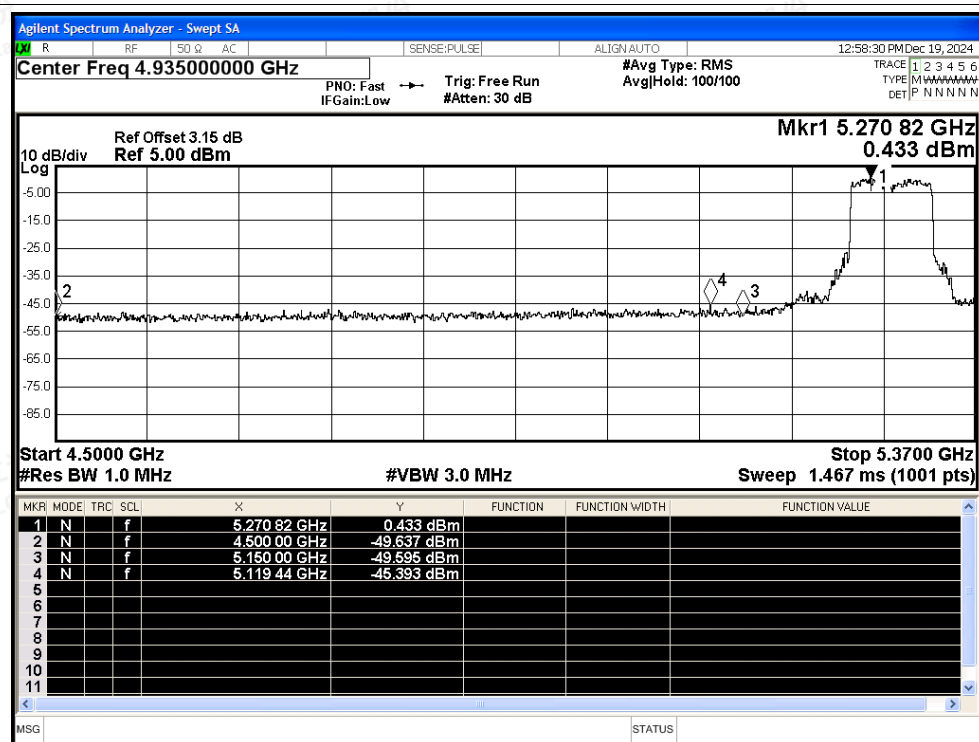

Restrict Band NVNT ax80 5290MHz Ant2 Average

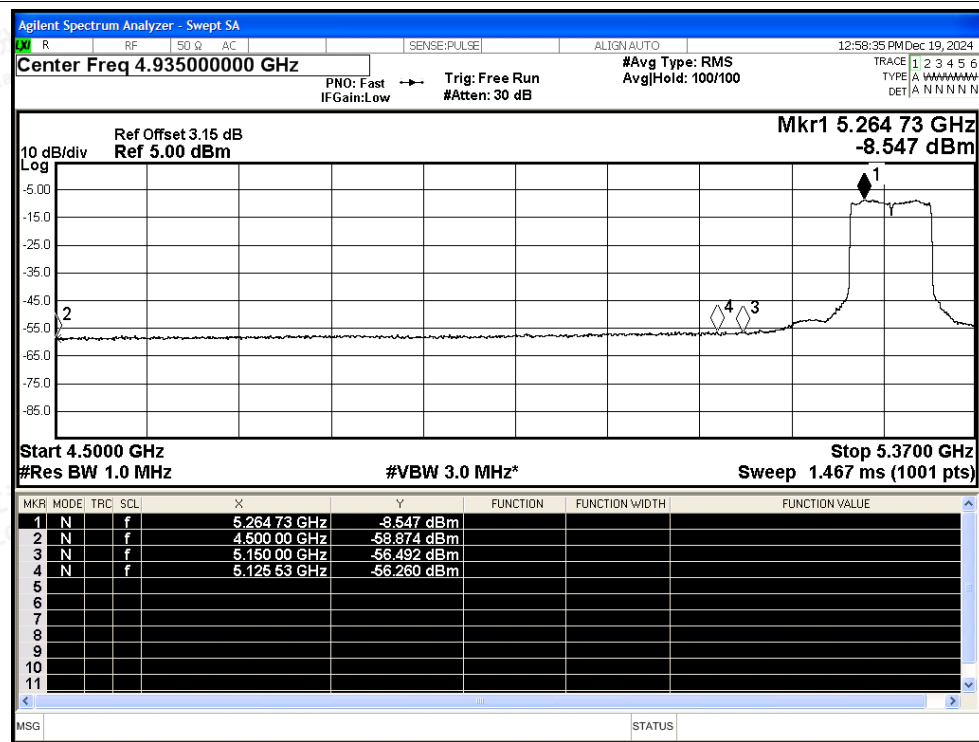

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	4500	-50.43	-51.91	6.01	53.14	Peak	68.2	Pass
NVNT	n20	5260	4500	-58.74	-59.43	6.01	45.18	Average	54	Pass
NVNT	n20	5260	4856.46	-46.68	-46.57	6.01	57.62	Peak	68.2	Pass
NVNT	n20	5260	5088.12	-56.98	-56.93	6.01	47.29	Average	54	Pass
NVNT	n20	5260	5150	-49.64	-47.74	6.01	55.66	Peak	68.2	Pass
NVNT	n20	5260	5150	-57.45	-57.69	6.01	46.68	Average	54	Pass
NVNT	n20	5320	5350	-46.51	-46.84	6.01	57.58	Peak	68.2	Pass
NVNT	n20	5320	5350	-55.61	-55.7	6.01	48.59	Average	54	Pass
NVNT	n20	5320	5350.2	-43.63	-43.46	6.01	60.70	Peak	68.2	Pass
NVNT	n20	5320	5350.6	-55.02	-54.95	6.01	49.26	Average	54	Pass
NVNT	n20	5320	5460	-48.01	-49.57	6.01	55.53	Peak	68.2	Pass
NVNT	n20	5320	5460	-58.23	-57.68	6.01	46.30	Average	54	Pass
NVNT	n40	5270	4500	-49.17	-49.99	6.01	54.69	Peak	68.2	Pass
NVNT	n40	5270	4500	-59.25	-59.15	6.01	45.05	Average	54	Pass
NVNT	n40	5270	5091.3	-46.17	-46.14	6.01	58.09	Peak	68.2	Pass
NVNT	n40	5270	5147.19	-56.59	-56.67	6.01	47.62	Average	54	Pass
NVNT	n40	5270	5150	-48.26	-48.54	6.01	55.85	Peak	68.2	Pass
NVNT	n40	5270	5150	-57.99	-57.1	6.01	46.73	Average	54	Pass
NVNT	n40	5310	5350	-46.87	-42.91	6.01	59.79	Peak	68.2	Pass
NVNT	n40	5310	5350	-55.81	-56.04	6.01	48.32	Average	54	Pass
NVNT	n40	5310	5352.6	-42.58	-40.97	6.01	62.55	Peak	68.2	Pass
NVNT	n40	5310	5350.2	-55.79	-55.59	6.01	48.56	Average	54	Pass
NVNT	n40	5310	5460	-48.63	-49.79	6.01	55.08	Peak	68.2	Pass
NVNT	n40	5310	5460	-57.57	-57.84	6.01	46.54	Average	54	Pass
NVNT	ac20	5260	4500	-51.69	-51.97	6.01	52.42	Peak	68.2	Pass
NVNT	ac20	5260	4500	-59.06	-59.5	6.01	44.97	Average	54	Pass
NVNT	ac20	5260	5130.24	-46.49	-47.32	6.01	57.36	Peak	68.2	Pass
NVNT	ac20	5260	5137.26	-56.9	-56.87	6.01	47.36	Average	54	Pass
NVNT	ac20	5260	5150	-50.15	-49.45	6.01	54.46	Peak	68.2	Pass
NVNT	ac20	5260	5150	-57.33	-57.62	6.01	46.78	Average	54	Pass
NVNT	ac20	5320	5350	-46.2	-45.28	6.01	58.53	Peak	68.2	Pass
NVNT	ac20	5320	5350	-55.83	-56.03	6.01	48.32	Average	54	Pass
NVNT	ac20	5320	5350.2	-41.38	-42.41	6.01	62.38	Peak	68.2	Pass
NVNT	ac20	5320	5351.2	-55.53	-55.73	6.01	48.62	Average	54	Pass
NVNT	ac20	5320	5460	-49.51	-48.54	6.01	55.25	Peak	68.2	Pass
NVNT	ac20	5320	5460	-58.2	-58.31	6.01	45.99	Average	54	Pass
NVNT	ac40	5270	4500	-51.17	-50.41	6.01	53.47	Peak	68.2	Pass
NVNT	ac40	5270	4500	-58.93	-58.71	6.01	45.43	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	5136.66	-46.28	-46.07	6.01	58.07	Peak	68.2	Pass
NVNT	ac40	5270	4807.8	-56.87	-56.84	6.01	47.39	Average	54	Pass
NVNT	ac40	5270	5150	-49.33	-49.19	6.01	54.99	Peak	68.2	Pass
NVNT	ac40	5270	5150	-57.45	-57.25	6.01	46.90	Average	54	Pass
NVNT	ac40	5310	5350	-45.43	-44.18	6.01	59.49	Peak	68.2	Pass
NVNT	ac40	5310	5350	-56.01	-55.67	6.01	48.41	Average	54	Pass
NVNT	ac40	5310	5350.4	-42.57	-44.18	6.01	60.95	Peak	68.2	Pass
NVNT	ac40	5310	5350.6	-55.21	-55.27	6.01	49.01	Average	54	Pass
NVNT	ac40	5310	5460	-51.1	-49.19	6.01	54.21	Peak	68.2	Pass
NVNT	ac40	5310	5460	-58.07	-57.46	6.01	46.49	Average	54	Pass
NVNT	ac80	5290	4500	-50.19	-49.77	6.01	54.27	Peak	68.2	Pass
NVNT	ac80	5290	4500	-58.87	-58.88	6.01	45.37	Average	54	Pass
NVNT	ac80	5290	5147.28	-46.31	-46.87	6.01	57.67	Peak	68.2	Pass
NVNT	ac80	5290	5149.02	-56.28	-56.36	6.01	47.93	Average	54	Pass
NVNT	ac80	5290	5150	-48.1	-47.29	6.01	56.57	Peak	68.2	Pass
NVNT	ac80	5290	5150	-56.45	-56.9	6.01	47.58	Average	54	Pass
NVNT	ac80	5290	5350	-37.48	-43.7	6.01	64.69	Peak	68.2	Pass
NVNT	ac80	5290	5350	-52.33	-53.19	6.01	51.51	Average	54	Pass
NVNT	ac80	5290	5360.75	-36.66	-43.17	6.01	65.45	Peak	68.2	Pass
NVNT	ac80	5290	5357	-51.53	-52.39	6.01	52.31	Average	54	Pass
NVNT	ac80	5290	5460	-49.89	-49.19	6.01	54.72	Peak	68.2	Pass
NVNT	ac80	5290	5460	-58.71	-57.38	6.01	46.25	Average	54	Pass
NVNT	ax20	5260	4500	-50.06	-48.02	6.01	55.33	Peak	68.2	Pass
NVNT	ax20	5260	4500	-58.88	-59	6.01	45.31	Average	54	Pass
NVNT	ax20	5260	4933.68	-46.55	-45.91	6.01	58.03	Peak	68.2	Pass
NVNT	ax20	5260	5070.96	-56.8	-55.58	6.01	48.10	Average	54	Pass
NVNT	ax20	5260	5150	-48.12	-46.67	6.01	56.91	Peak	68.2	Pass
NVNT	ax20	5260	5150	-57.7	-57.04	6.01	46.89	Average	54	Pass
NVNT	ax20	5320	5350	-44.69	-45.15	6.01	59.33	Peak	68.2	Pass
NVNT	ax20	5320	5350	-55.77	-55.75	6.01	48.49	Average	54	Pass
NVNT	ax20	5320	5350.8	-42.23	-44.21	6.01	61.14	Peak	68.2	Pass
NVNT	ax20	5320	5350.6	-55.63	-55.75	6.01	48.56	Average	54	Pass
NVNT	ax20	5320	5460	-50.35	-50.99	6.01	53.59	Peak	68.2	Pass
NVNT	ax20	5320	5460	-58.04	-57.78	6.01	46.34	Average	54	Pass
NVNT	ax40	5270	4500	-50.47	-50.53	6.01	53.75	Peak	68.2	Pass
NVNT	ax40	5270	4500	-58.88	-58.93	6.01	45.34	Average	54	Pass
NVNT	ax40	5270	5094.54	-47.22	-45.32	6.01	58.08	Peak	68.2	Pass
NVNT	ax40	5270	4806.99	-56.39	-56.65	6.01	47.73	Average	54	Pass
NVNT	ax40	5270	5150	-49.8	-49.13	6.01	54.80	Peak	68.2	Pass
NVNT	ax40	5270	5150	-57.77	-57.17	6.01	46.79	Average	54	Pass
NVNT	ax40	5310	5350	-43.66	-43.04	6.01	60.91	Peak	68.2	Pass
NVNT	ax40	5310	5350	-55.99	-55.32	6.01	48.61	Average	54	Pass
NVNT	ax40	5310	5353.2	-42.36	-42.3	6.01	61.92	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	5350.2	-54.3	-55.32	6.01	49.47	Average	54	Pass
NVNT	ax40	5310	5460	-50.68	-48.9	6.01	54.55	Peak	68.2	Pass
NVNT	ax40	5310	5460	-58.6	-57.5	6.01	46.23	Average	54	Pass
NVNT	ax80	5290	5350	-44.18	-43.87	6.01	60.23	Peak	68.2	Pass
NVNT	ax80	5290	5350	-51.61	-52	6.01	52.45	Average	54	Pass
NVNT	ax80	5290	5352.25	-37.78	-39.1	6.01	65.86	Peak	68.2	Pass
NVNT	ax80	5290	5350.5	-51.58	-52	6.01	52.46	Average	54	Pass
NVNT	ax80	5290	5460	-49.56	-49.78	6.01	54.58	Peak	68.2	Pass
NVNT	ax80	5290	5460	-57.15	-57.61	6.01	46.87	Average	54	Pass
NVNT	ax80	5290	4500	-50.78	-49.64	6.01	54.08	Peak	68.2	Pass
NVNT	ax80	5290	4500	-58.64	-58.87	6.01	45.49	Average	54	Pass
NVNT	ax80	5290	5136.84	-45.98	-45.39	6.01	58.57	Peak	68.2	Pass
NVNT	ax80	5290	5125.53	-56.31	-56.26	6.01	47.96	Average	54	Pass
NVNT	ax80	5290	5150	-46.67	-49.6	6.01	56.36	Peak	68.2	Pass
NVNT	ax80	5290	5150	-56.62	-56.49	6.01	47.69	Average	54	Pass





E.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5260	0	0	25	Pass
NVNT	a	5300	Ant1	5300	0	0	25	Pass
NVNT	a	5320	Ant1	5320	0	0	25	Pass
NVNT	n20	5260	Ant1	5260	0	0	25	Pass
NVNT	n20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant1	5270	0	0	25	Pass
NVNT	n40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
NVNT	ac20	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant1	5320	0	0	25	Pass
NVNT	ac40	5270	Ant1	5270	0	0	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass
NVNT	ax20	5260	Ant1	5260	0	0	25	Pass
NVNT	ax20	5300	Ant1	5300	0	0	25	Pass
NVNT	ax20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant1	5270.04	40000	7.59	25	Pass
NVNT	ax40	5310	Ant1	5310.04	40000	7.53	25	Pass
NVNT	ax80	5290	Ant1	5290	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

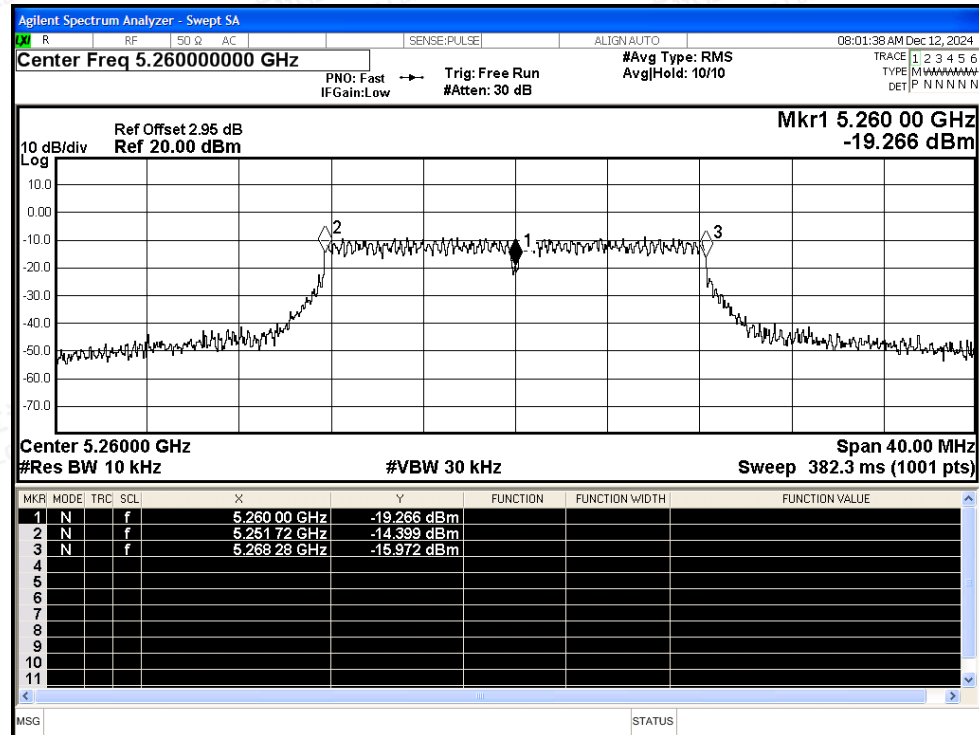

Freq. Stability NVNT a 5300MHz Ant1

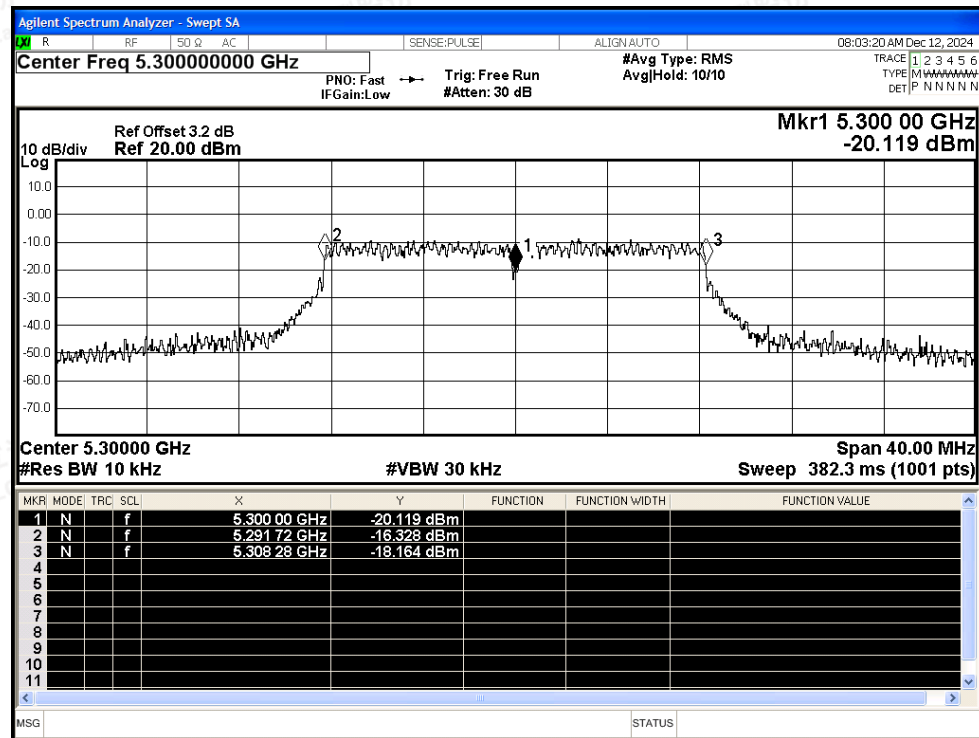

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant1

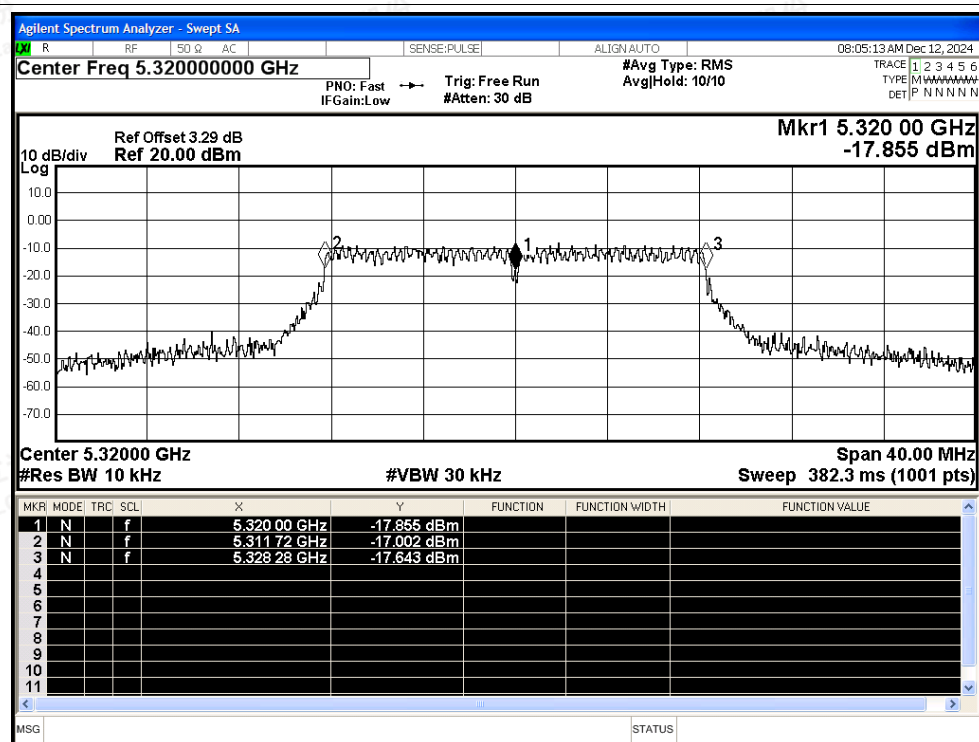

Freq. Stability NVNT n20 5260MHz Ant1

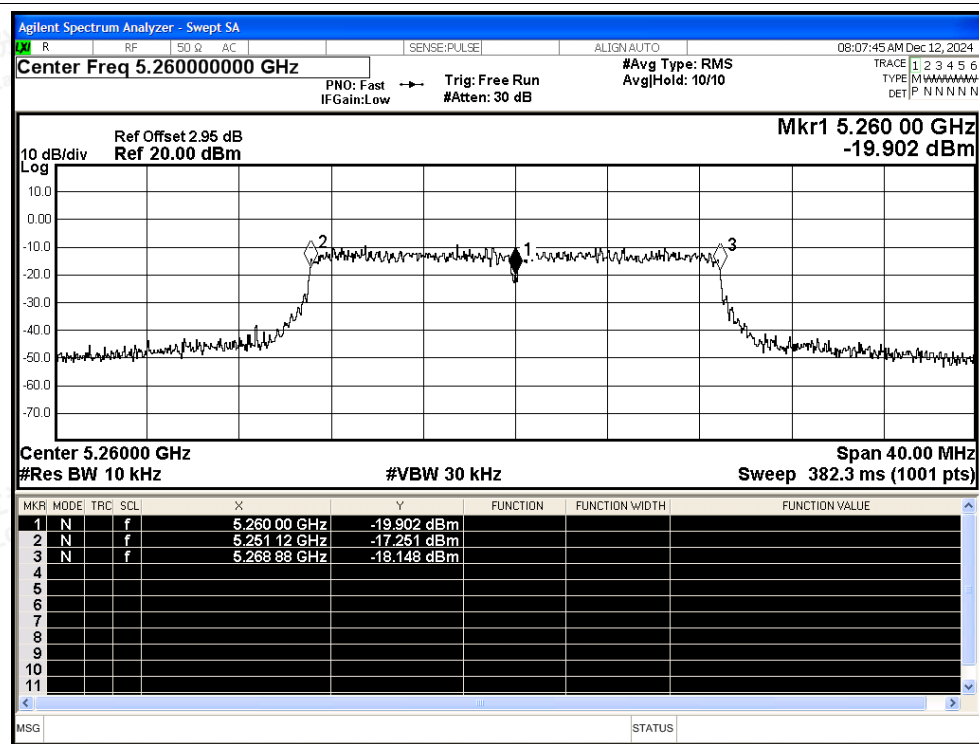

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant1

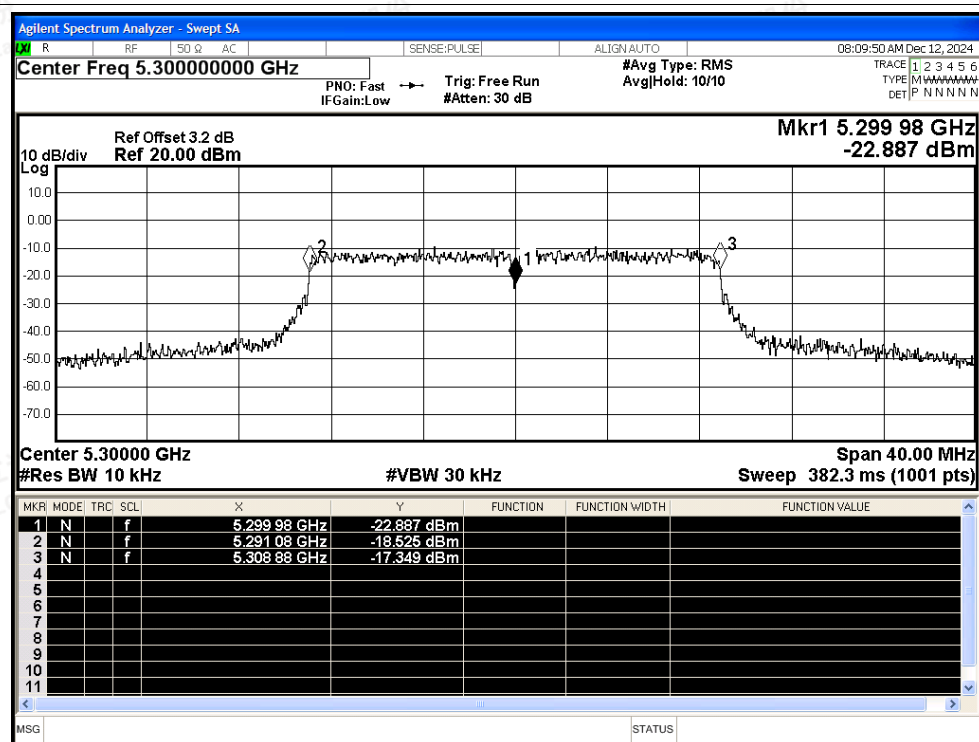

Freq. Stability NVNT n20 5320MHz Ant1

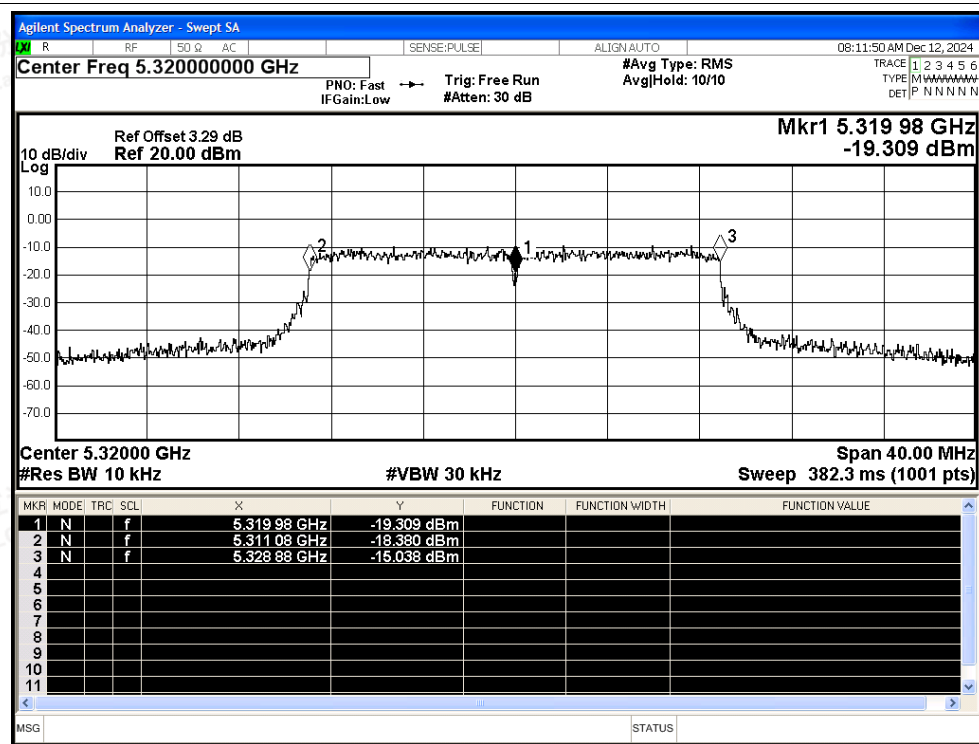

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

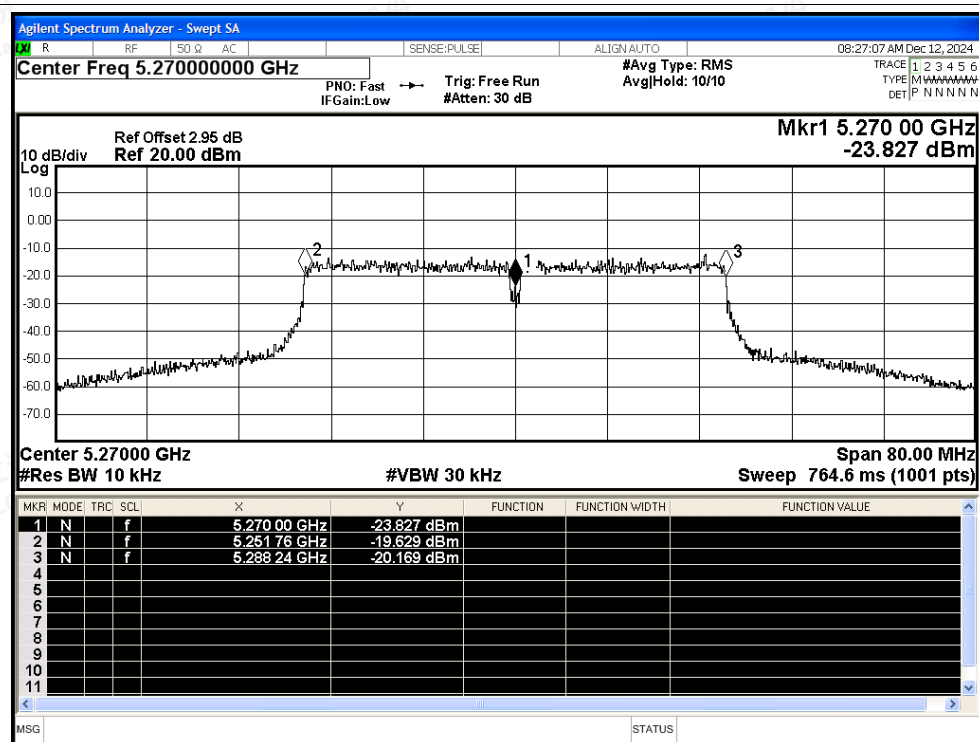

Freq. Stability NVNT n40 5310MHz Ant1

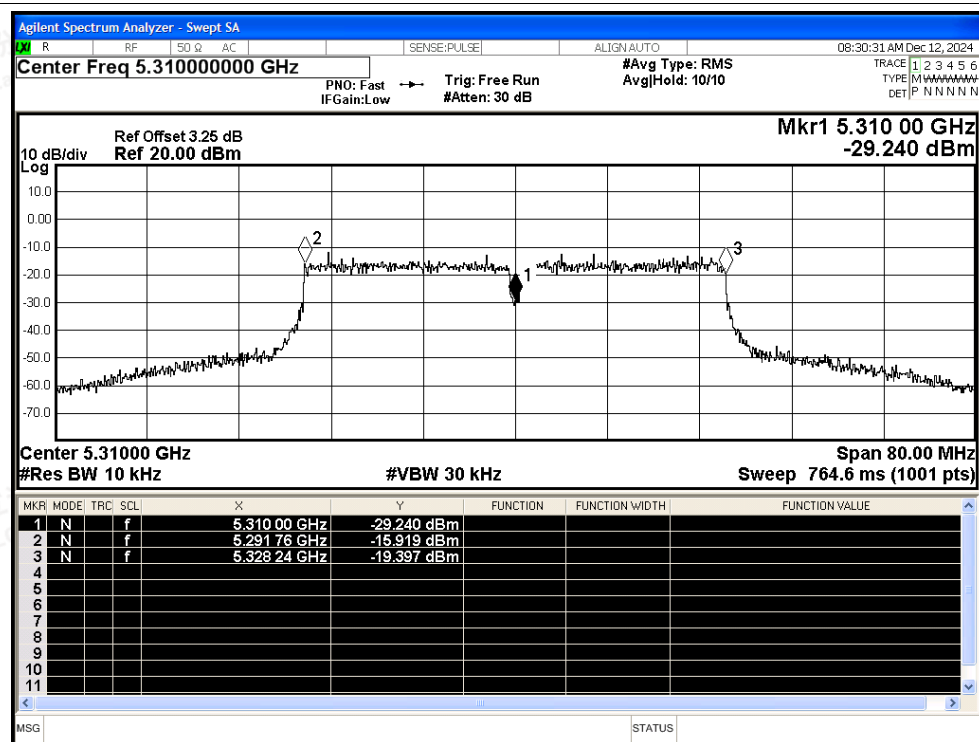

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

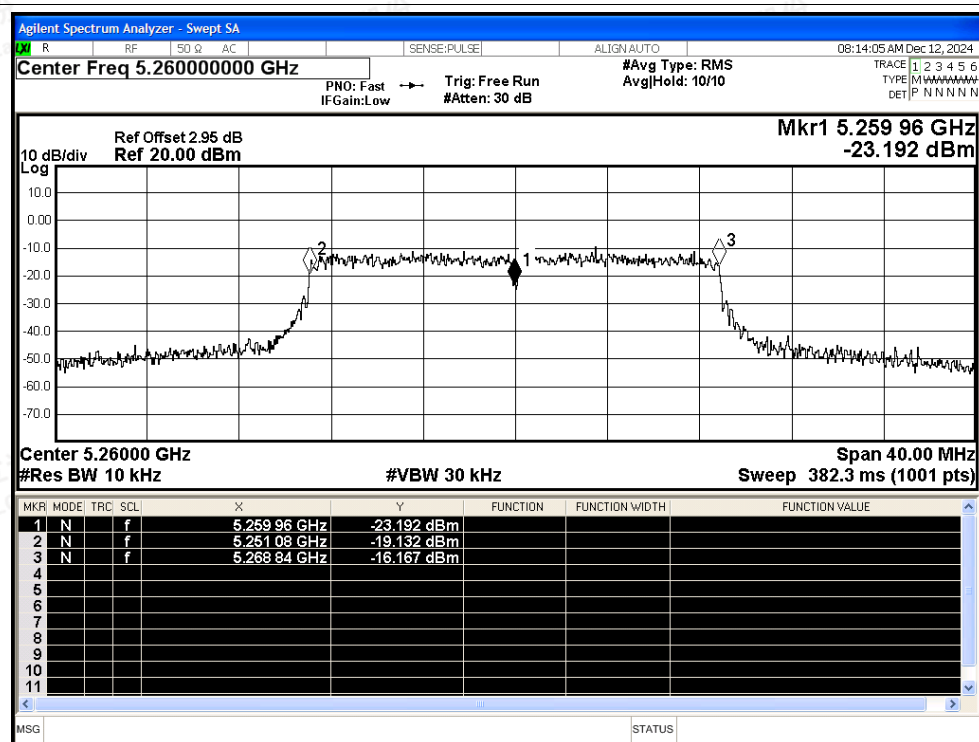

Freq. Stability NVNT ac20 5300MHz Ant1

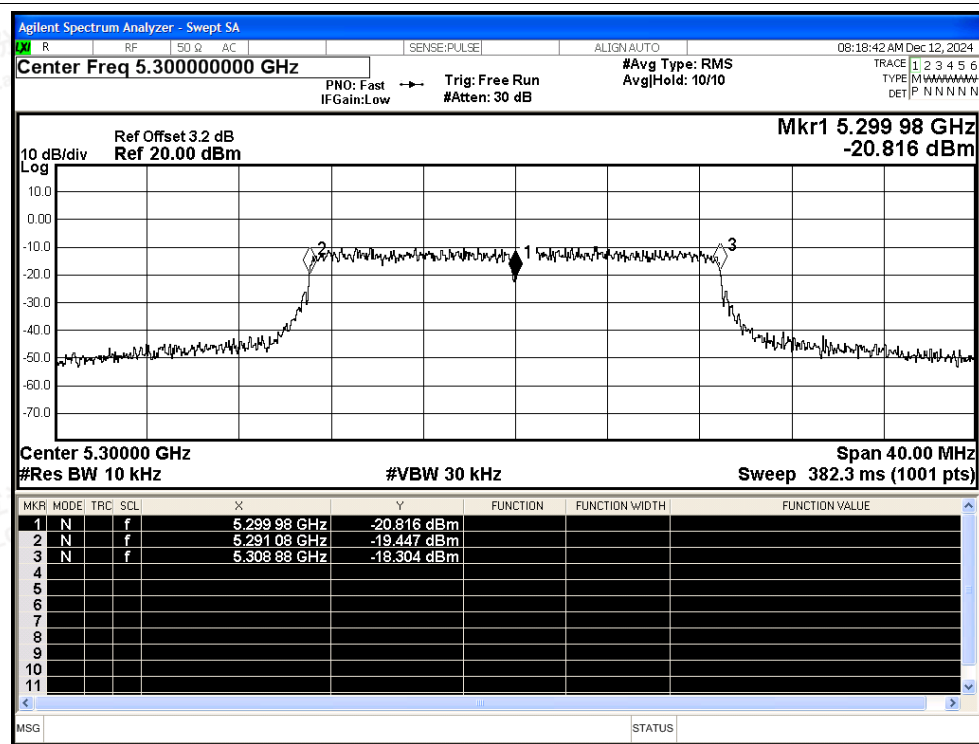

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

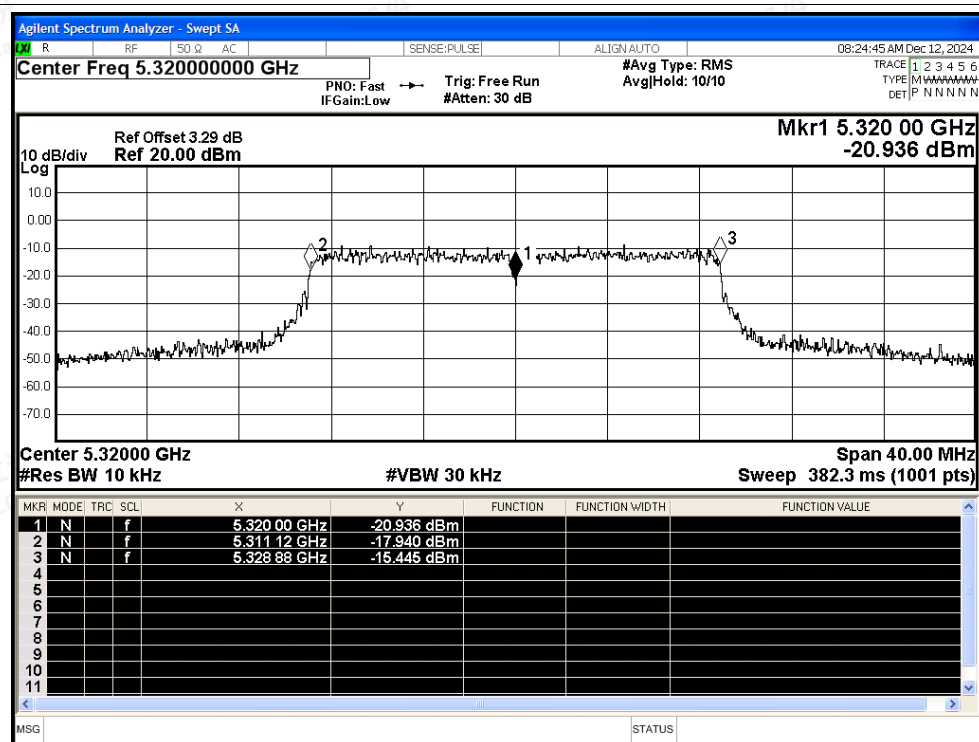

Freq. Stability NVNT ac40 5270MHz Ant1

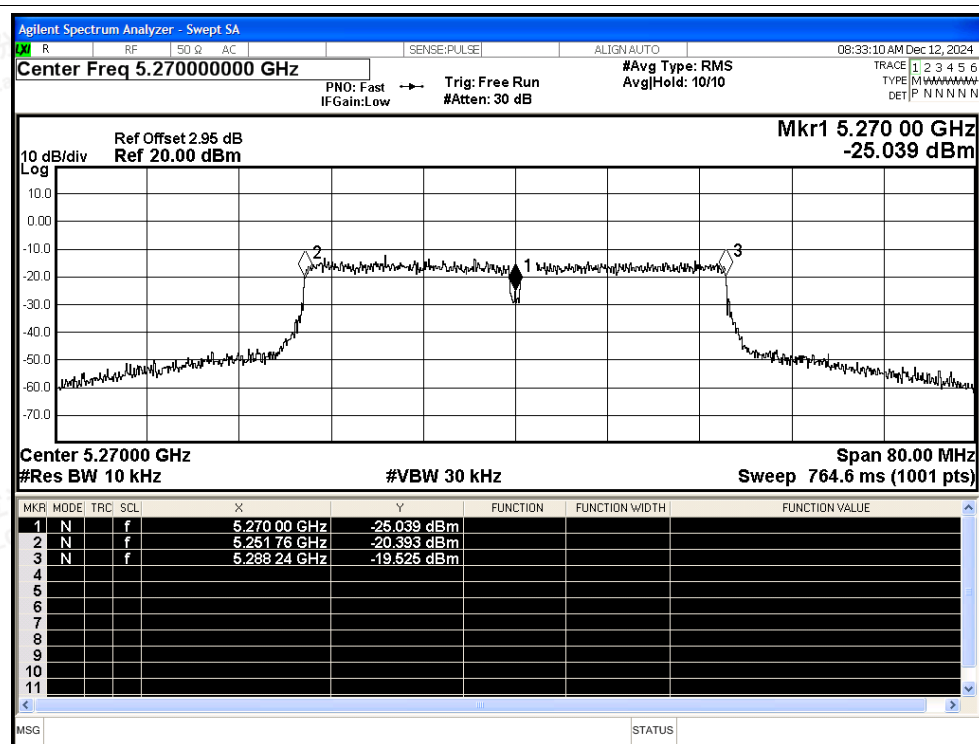

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

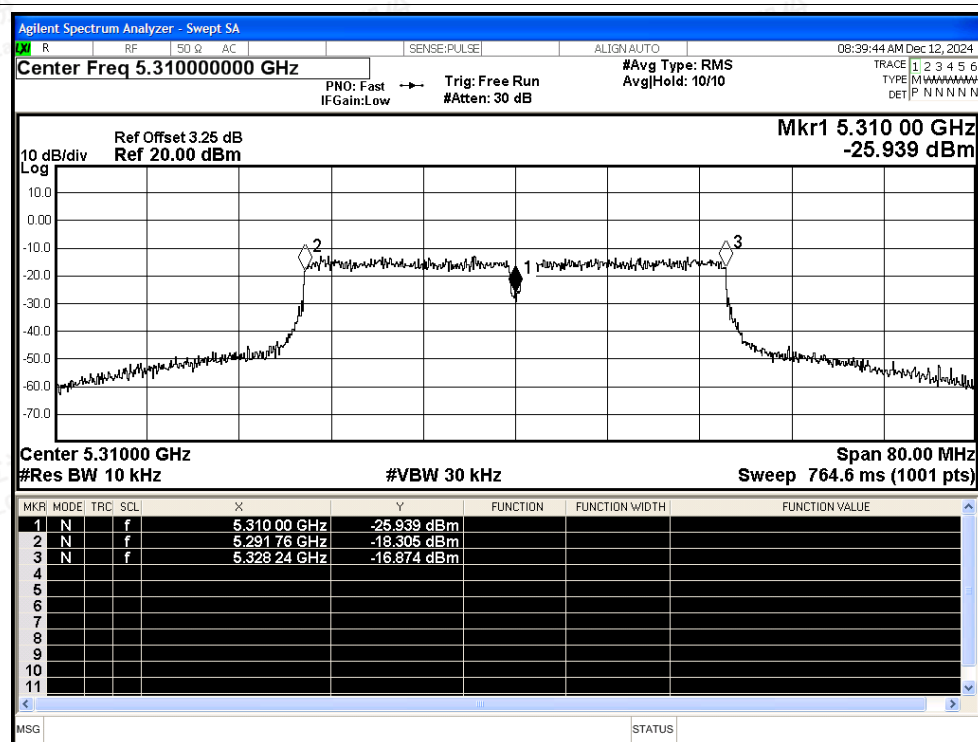

Freq. Stability NVNT ac80 5290MHz Ant1

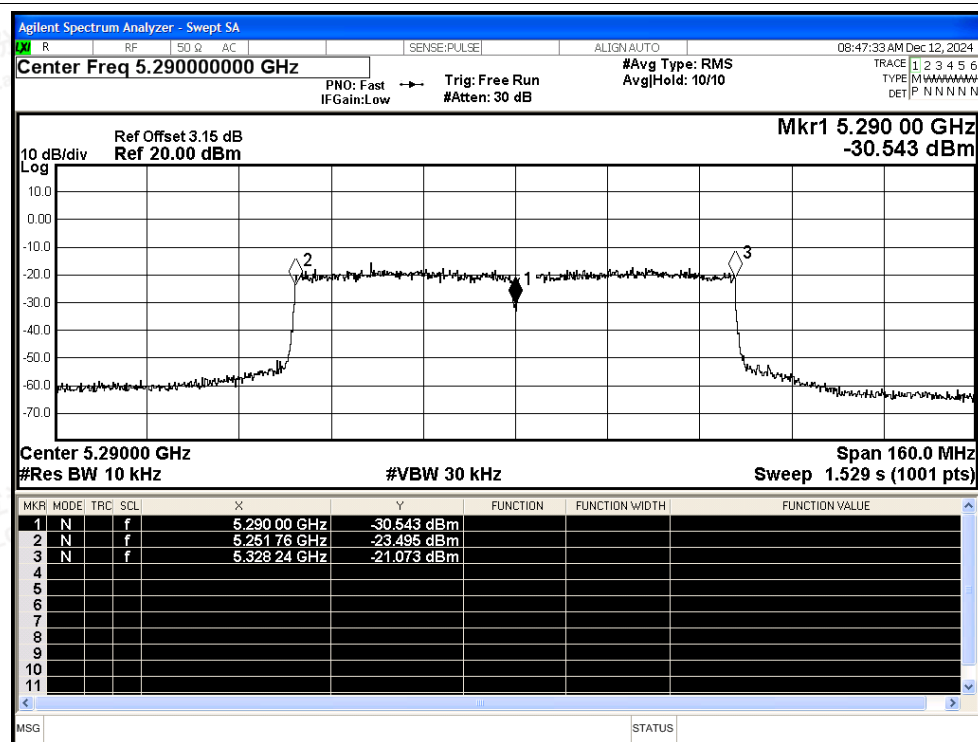

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant1

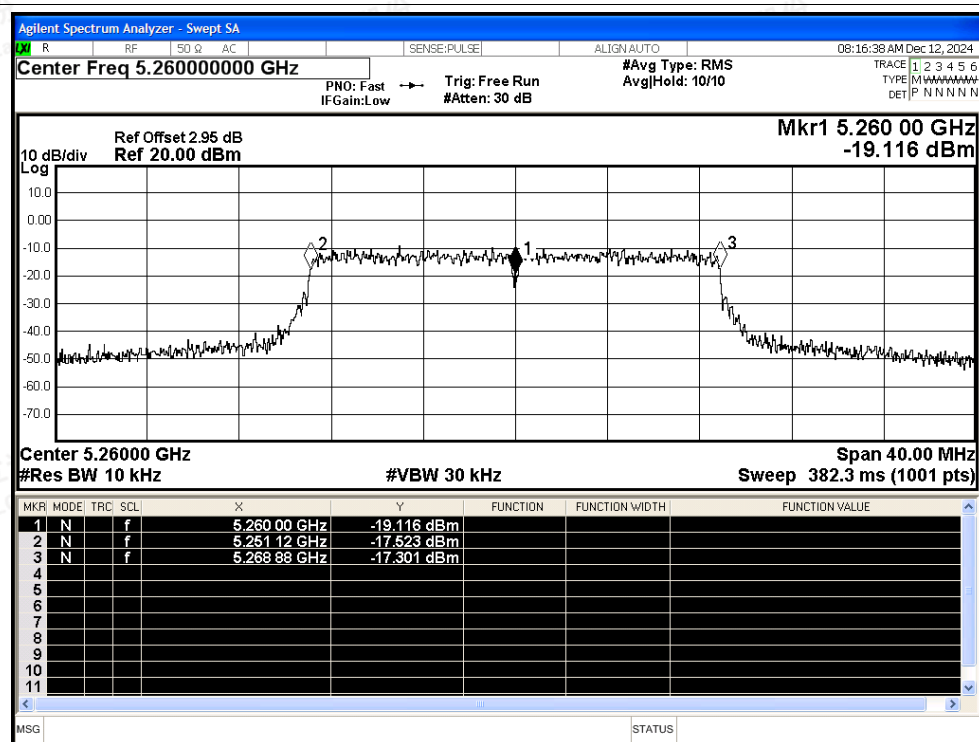

Freq. Stability NVNT ax20 5300MHz Ant1

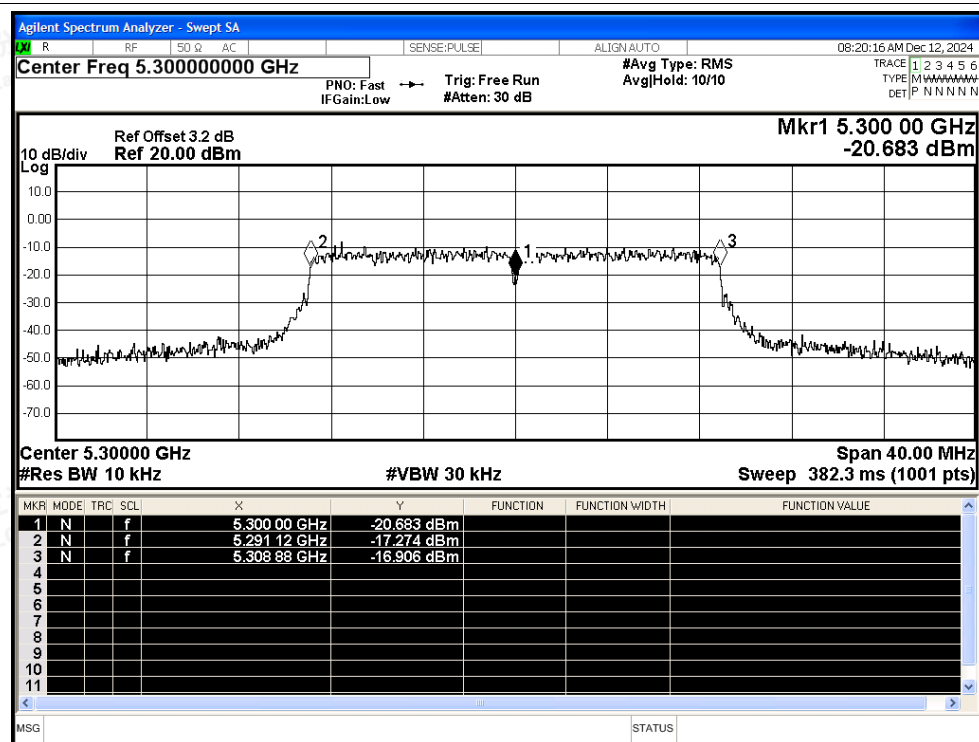

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant1

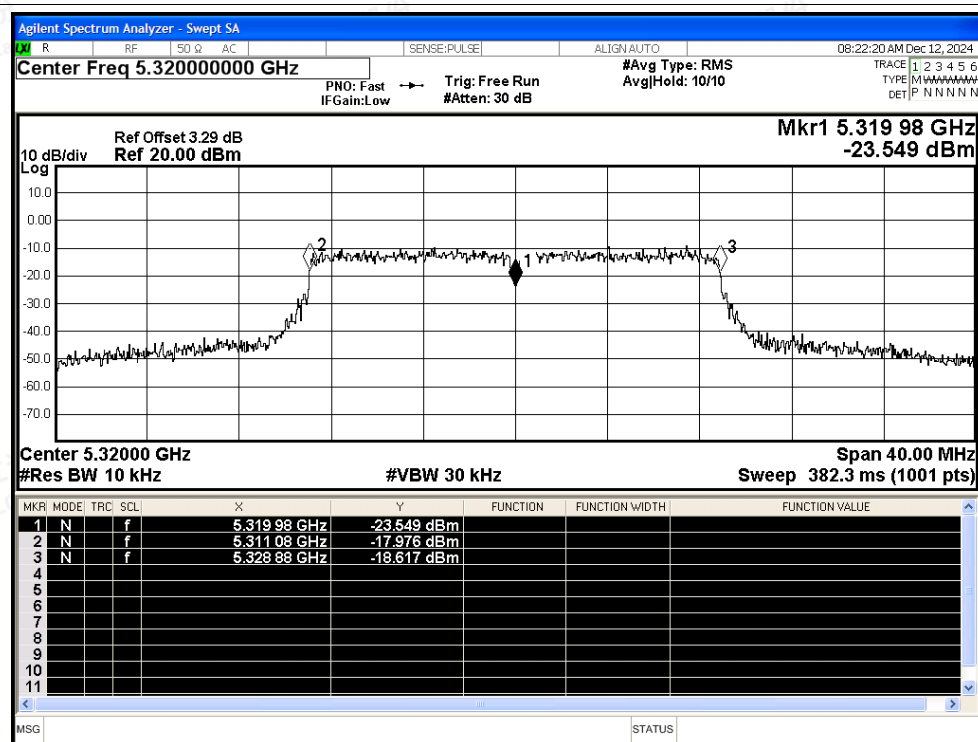

Freq. Stability NVNT ax40 5270MHz Ant1

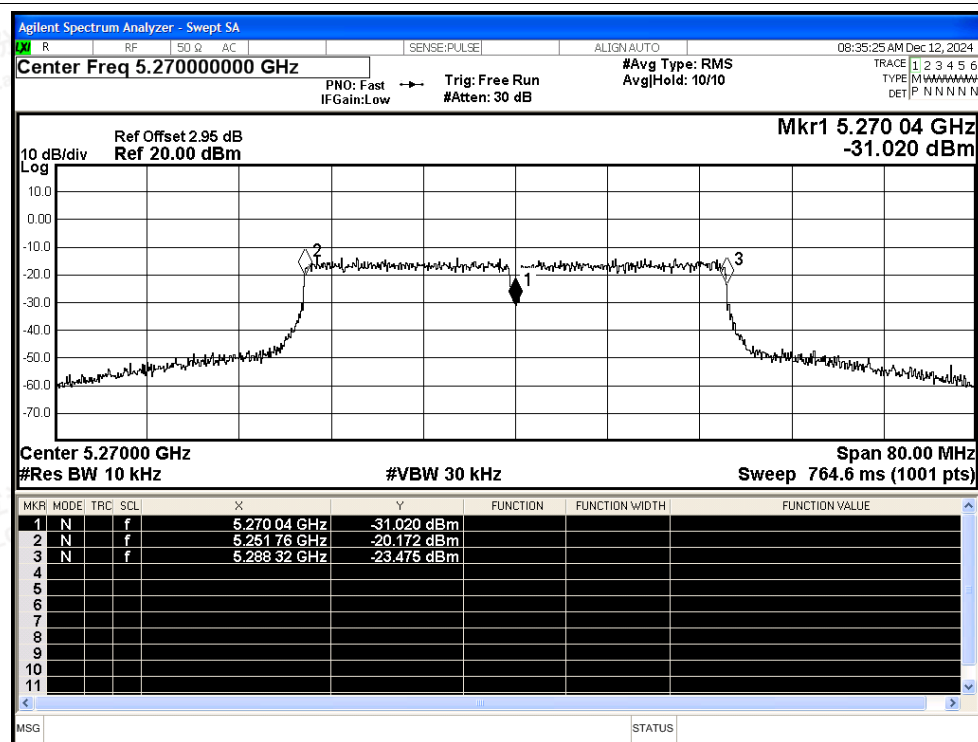

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant1

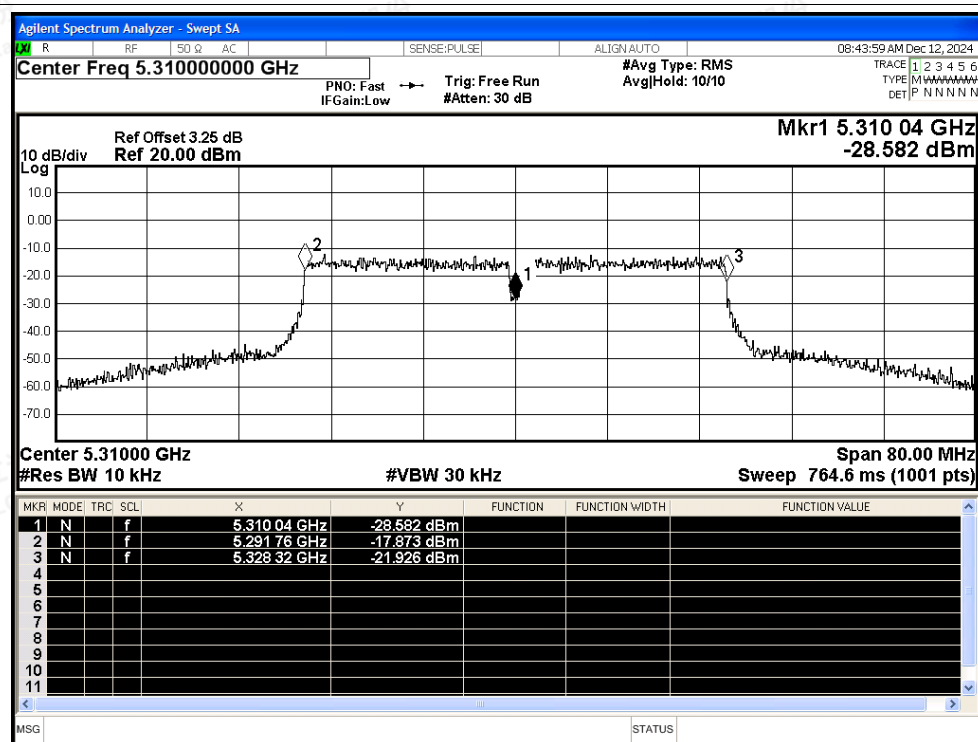

Freq. Stability NVNT ax80 5290MHz Ant1

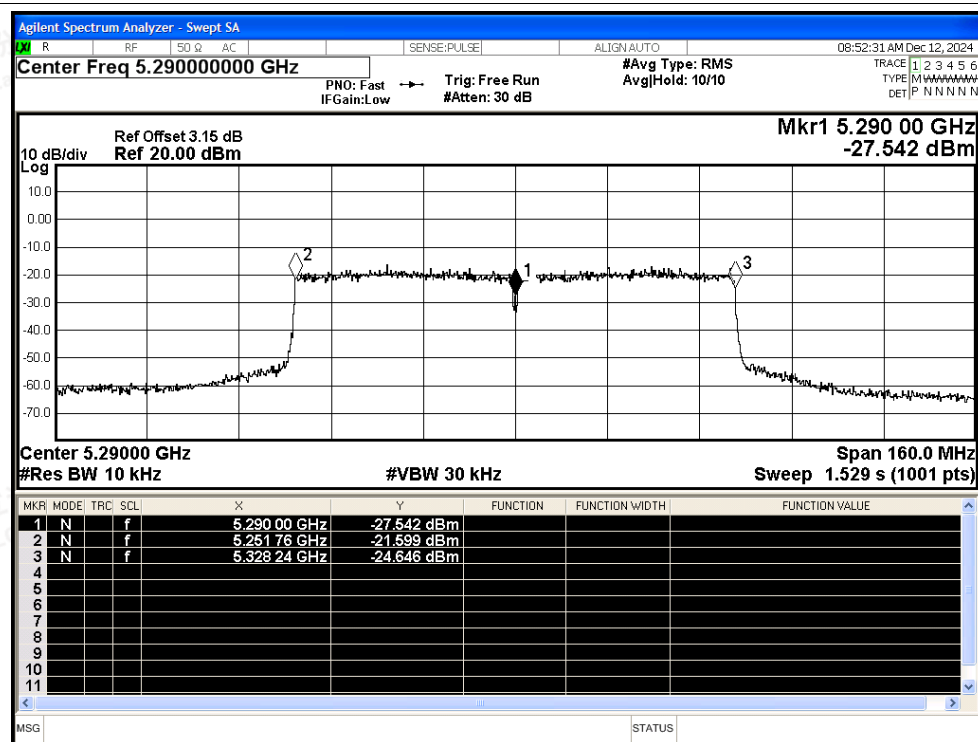

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5260	0	0	25	Pass
NVNT	a	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant2	5320	0	0	25	Pass
NVNT	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5260	0	0	25	Pass
NVNT	ac20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant2	5320	0	0	25	Pass
NVNT	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass
NVNT	ax20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant2	5320	0	0	25	Pass
NVNT	ax40	5270	Ant2	5270	0	0	25	Pass
NVNT	ax40	5310	Ant2	5310	0	0	25	Pass
NVNT	ax80	5290	Ant2	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

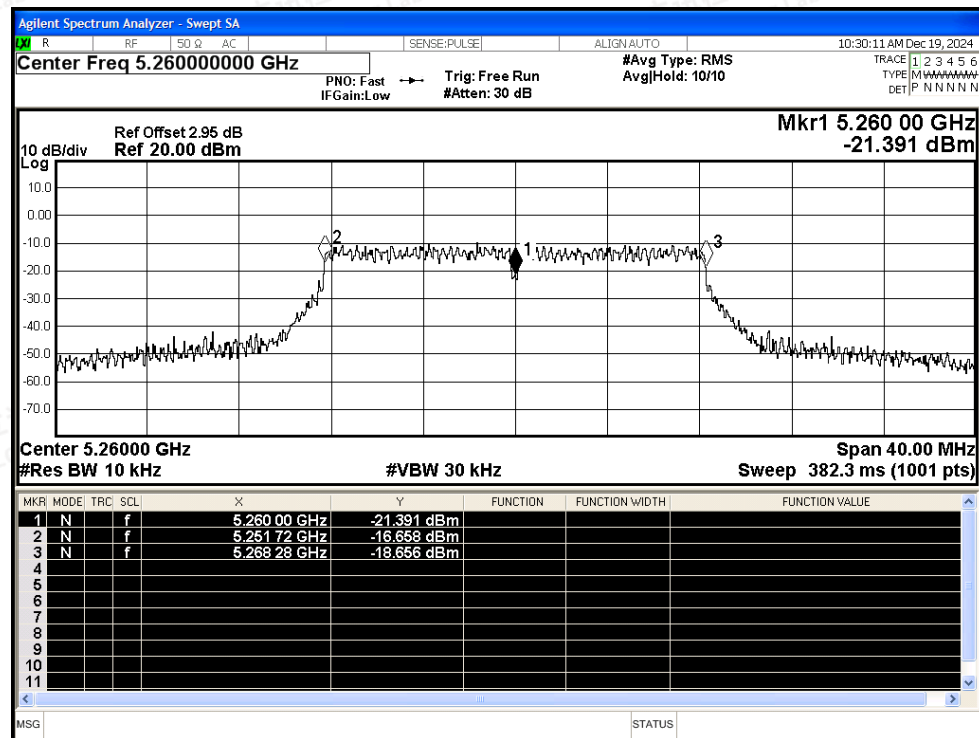

Freq. Stability NVNT a 5300MHz Ant2

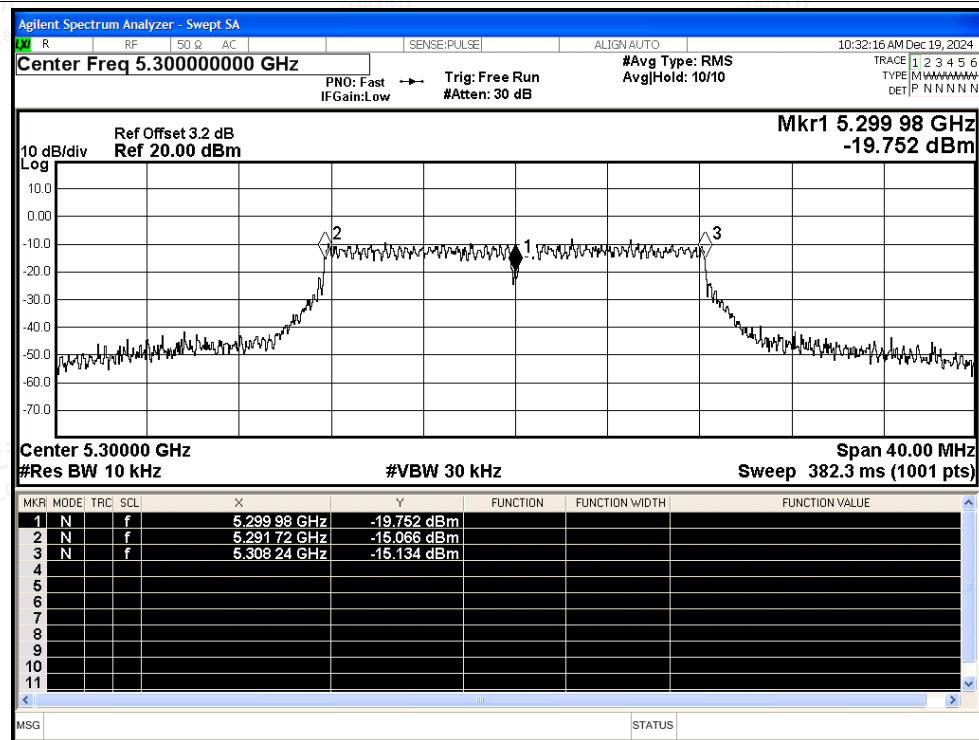

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant2

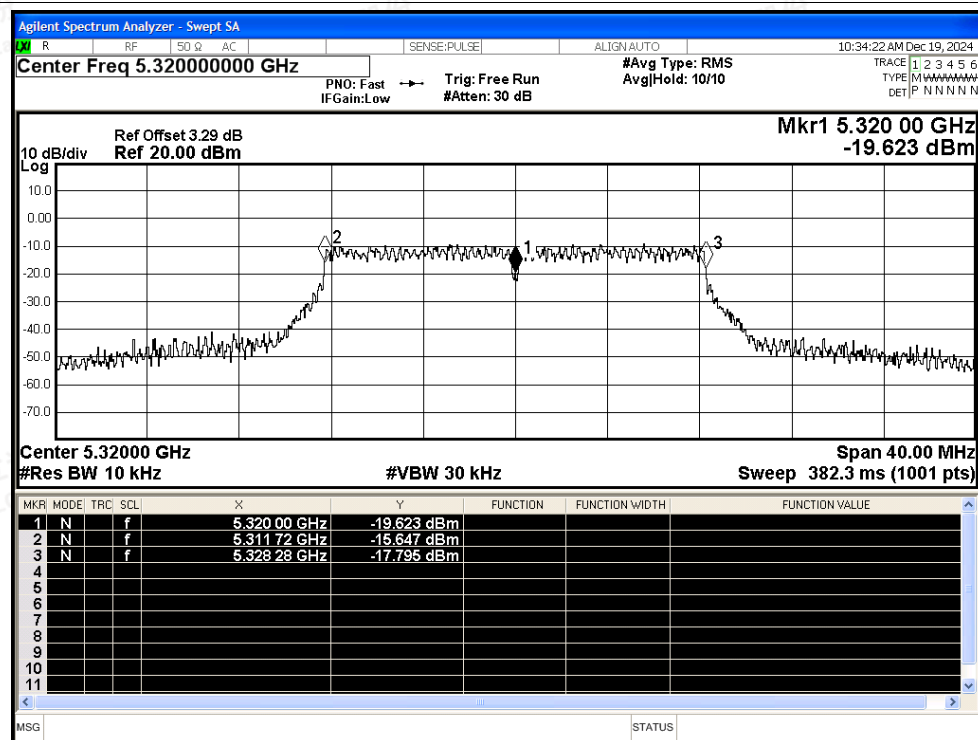

Freq. Stability NVNT n20 5260MHz Ant2

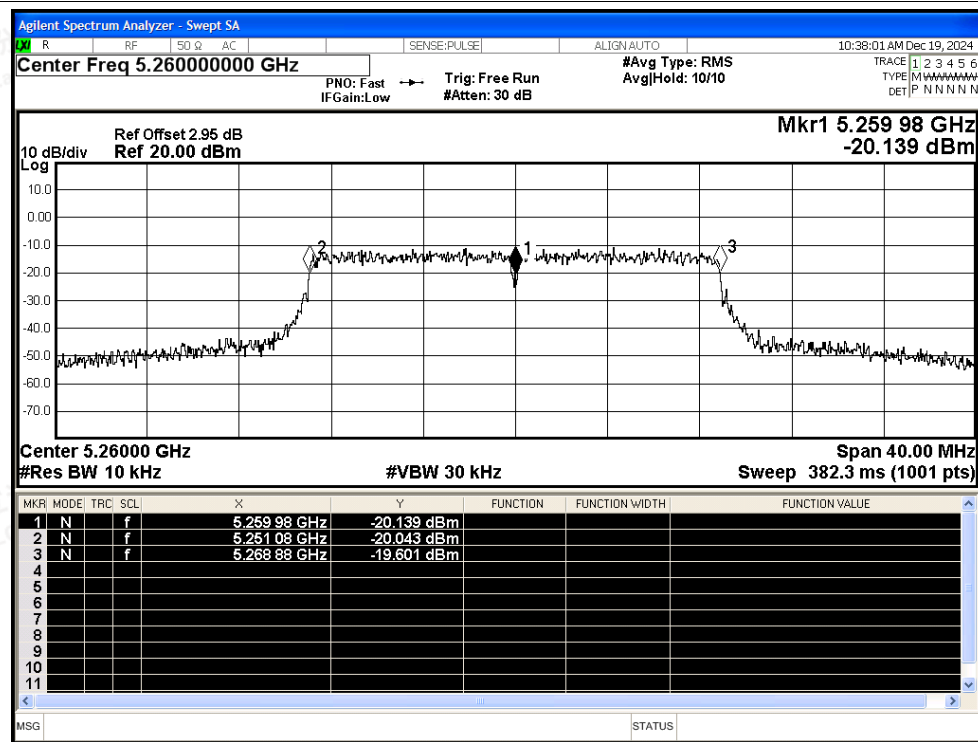

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant2

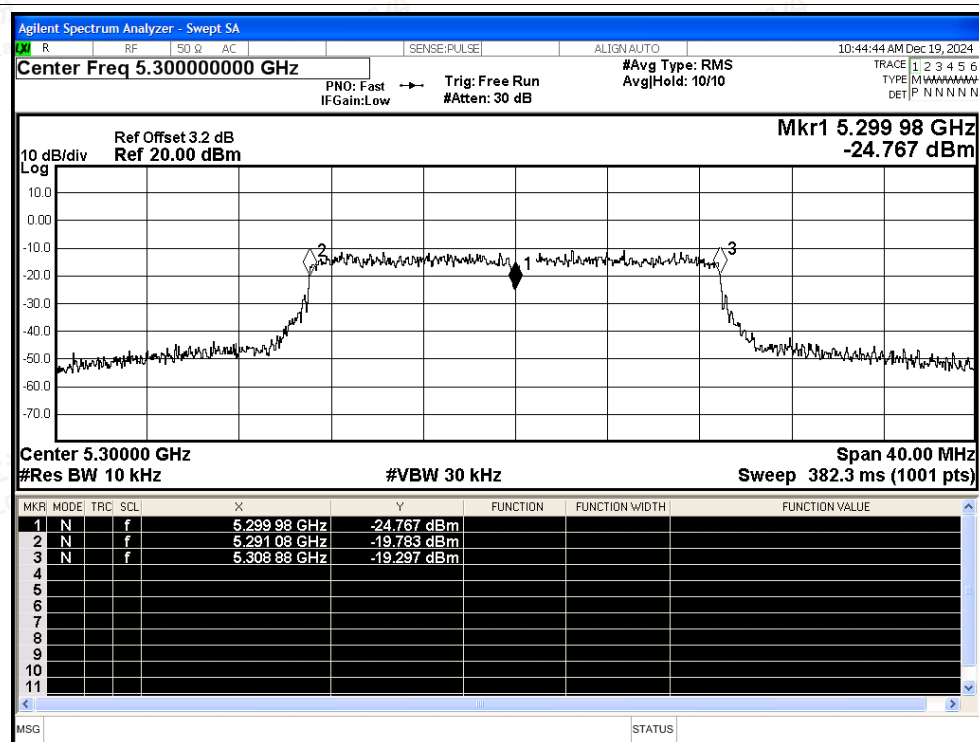

Freq. Stability NVNT n20 5320MHz Ant2

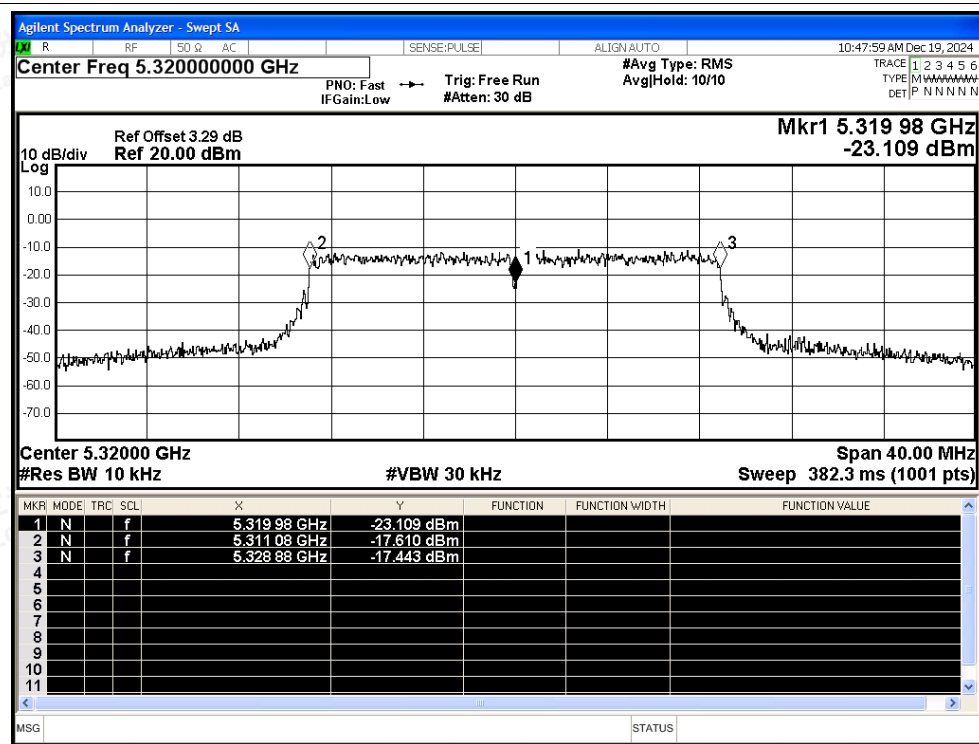

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant2

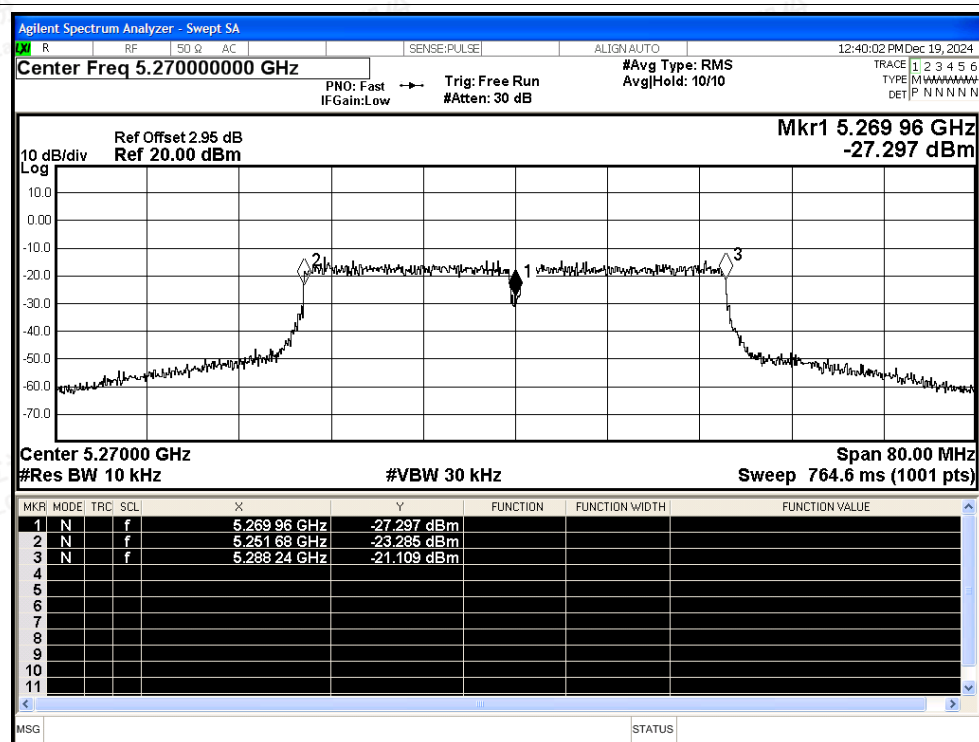

Freq. Stability NVNT n40 5310MHz Ant2

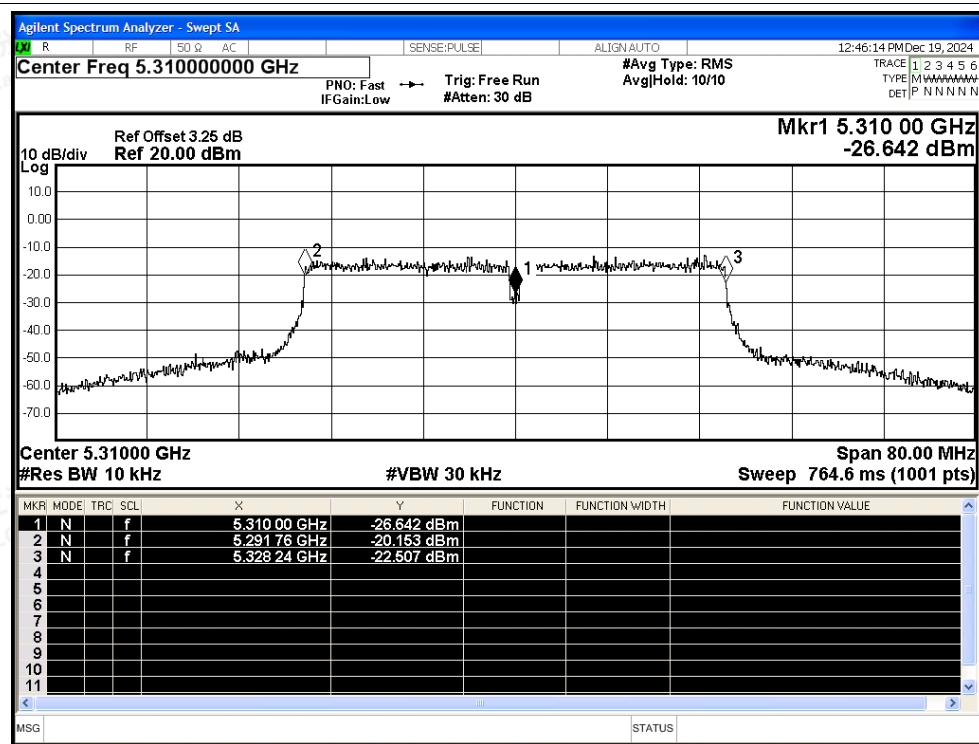

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant2

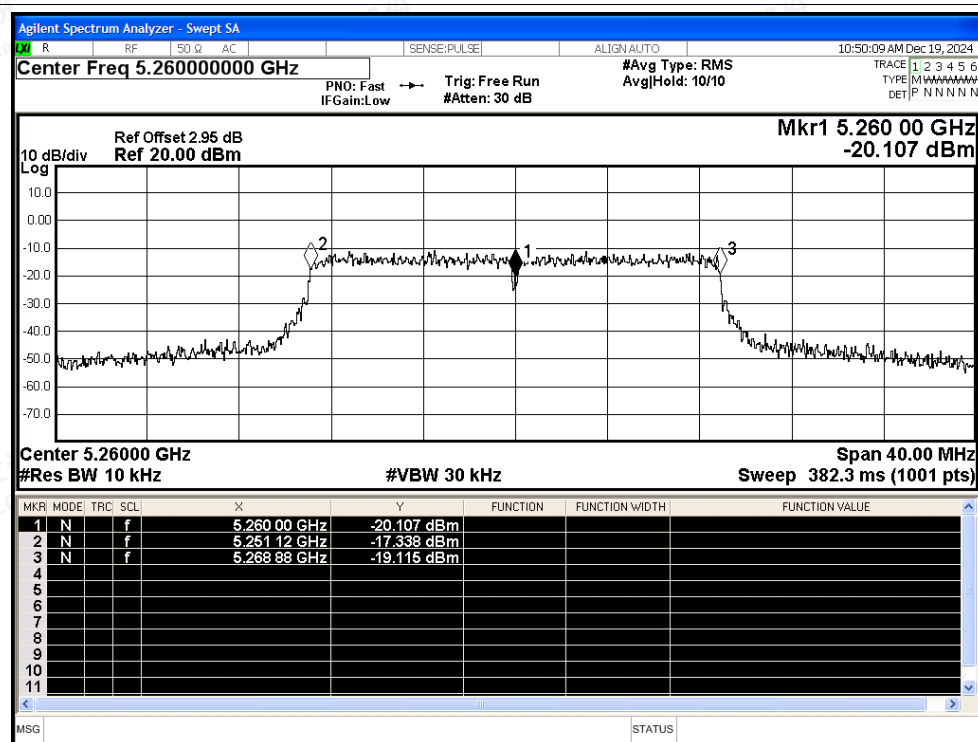

Freq. Stability NVNT ac20 5300MHz Ant2

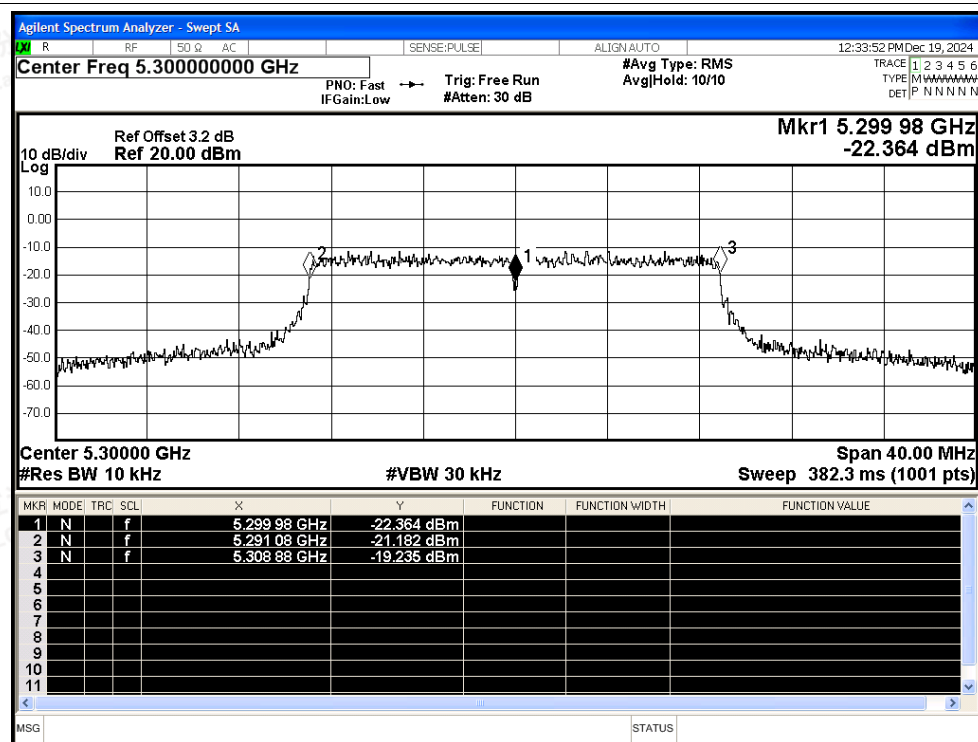

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

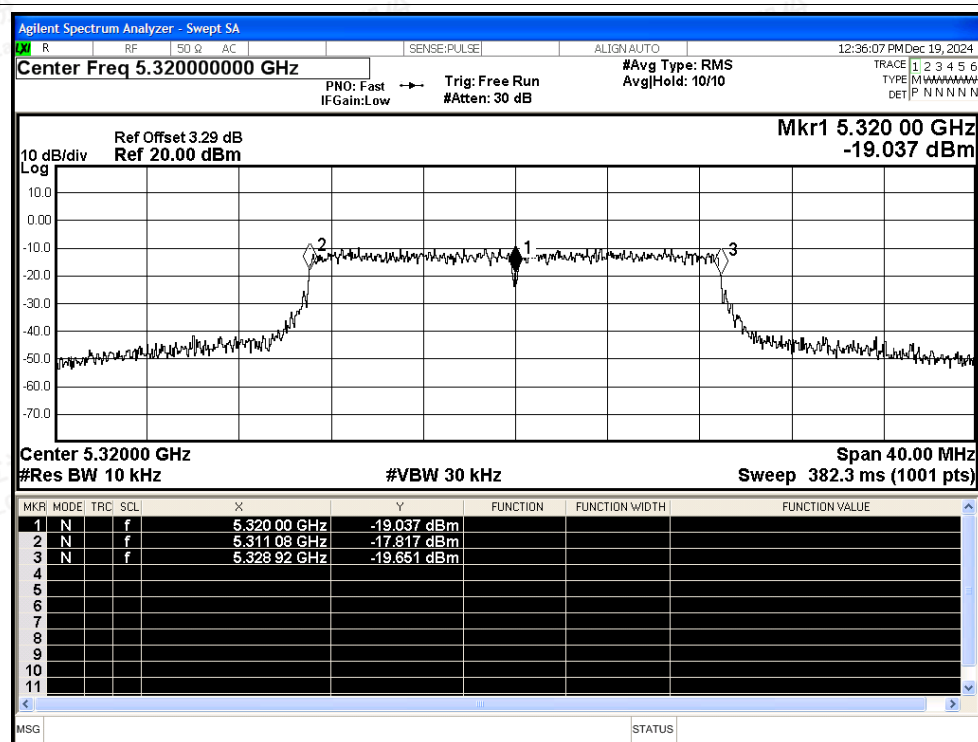

Freq. Stability NVNT ac40 5270MHz Ant2

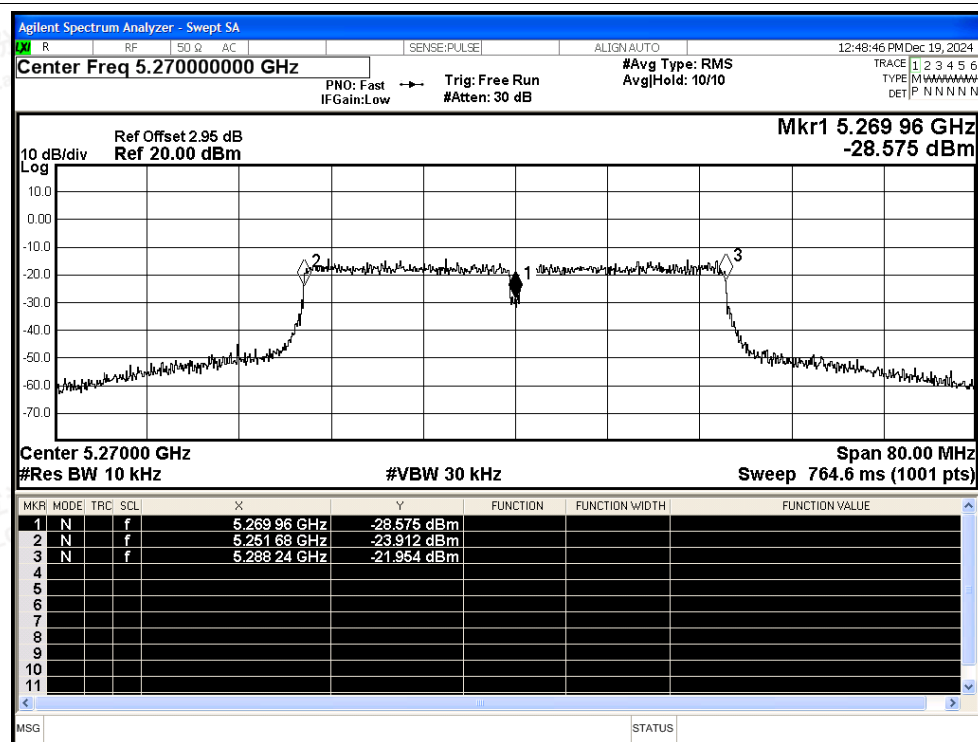

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant2

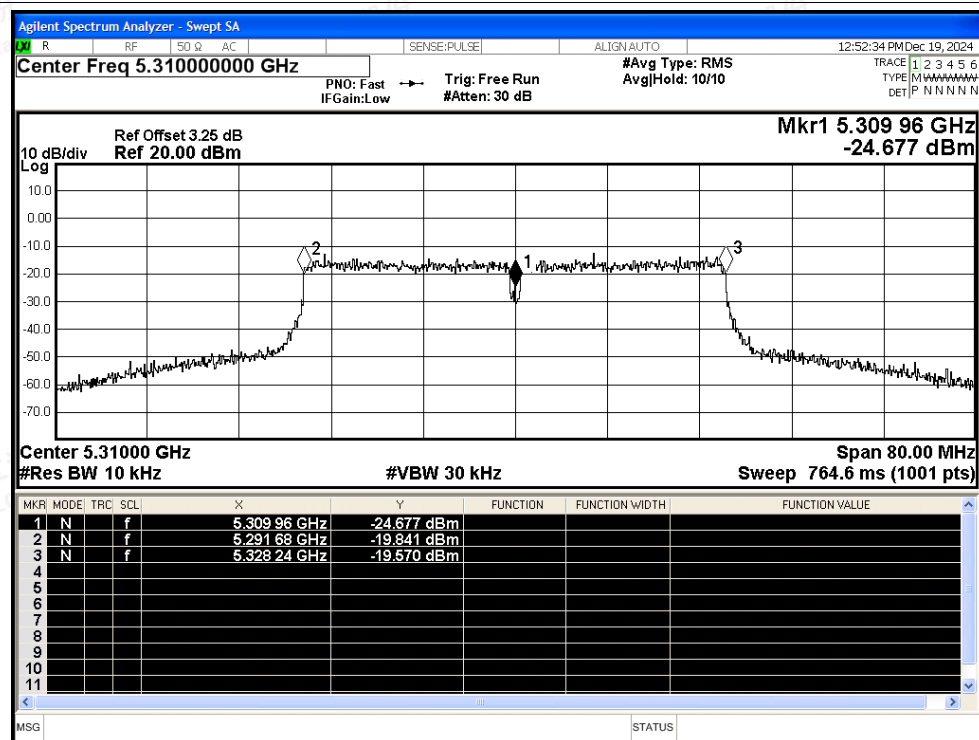

Freq. Stability NVNT ac80 5290MHz Ant2

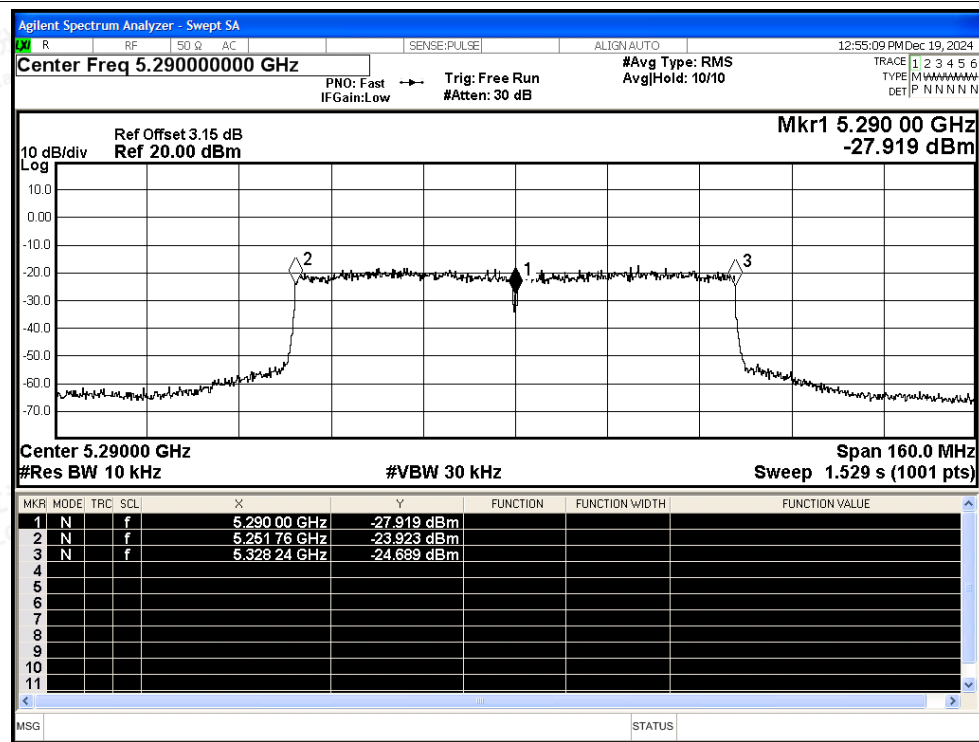

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant2

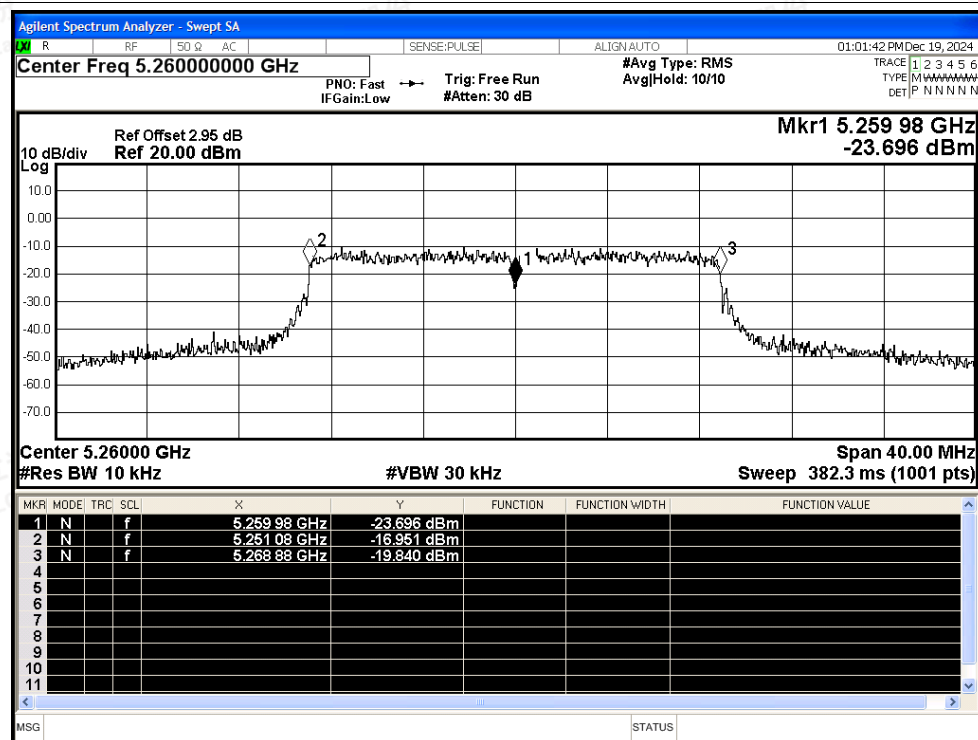

Freq. Stability NVNT ax20 5300MHz Ant2

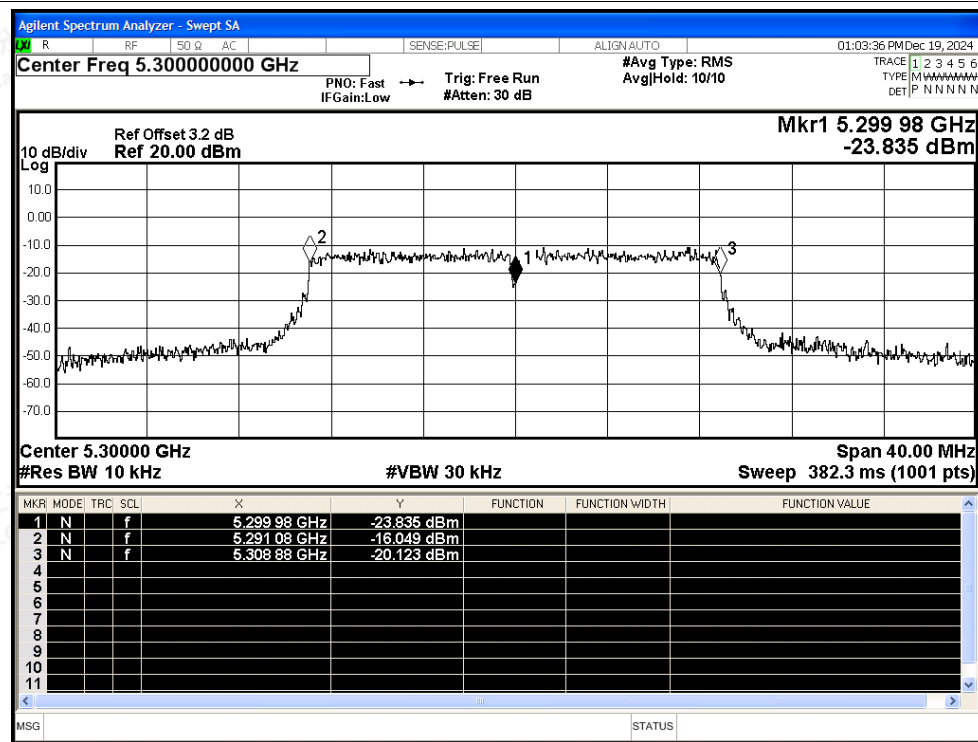

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant2

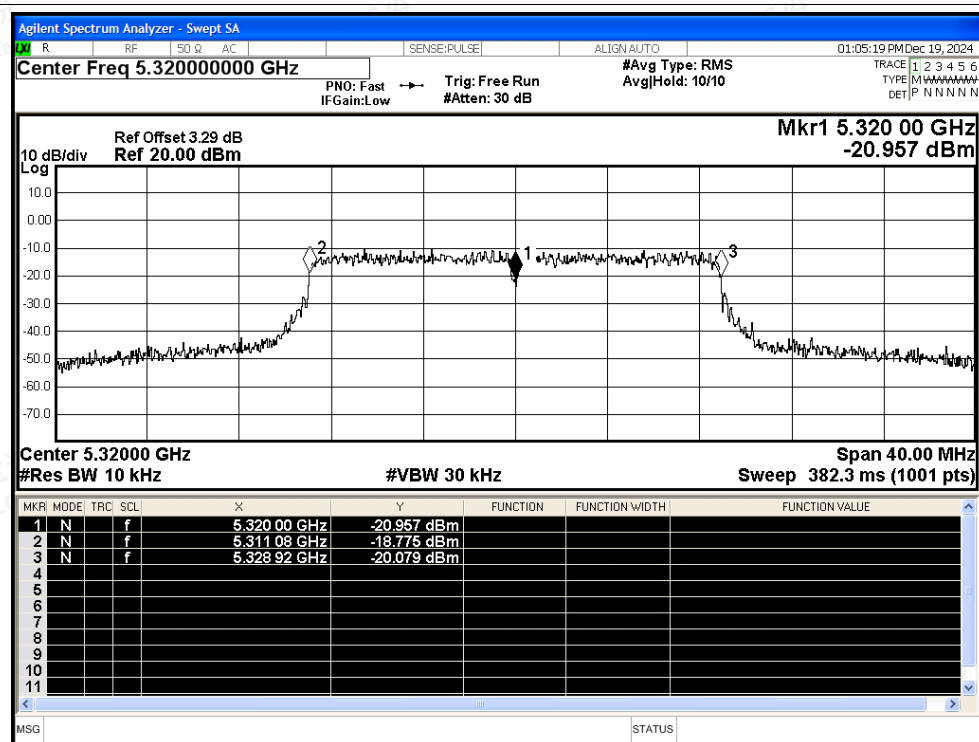

Freq. Stability NVNT ax40 5270MHz Ant2

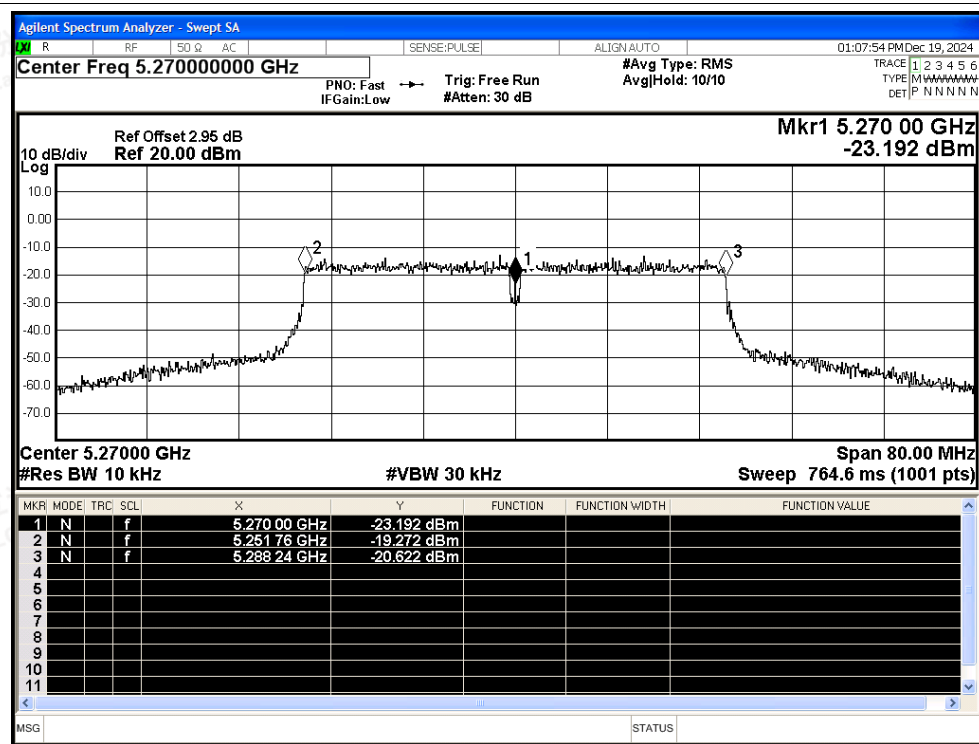

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant2

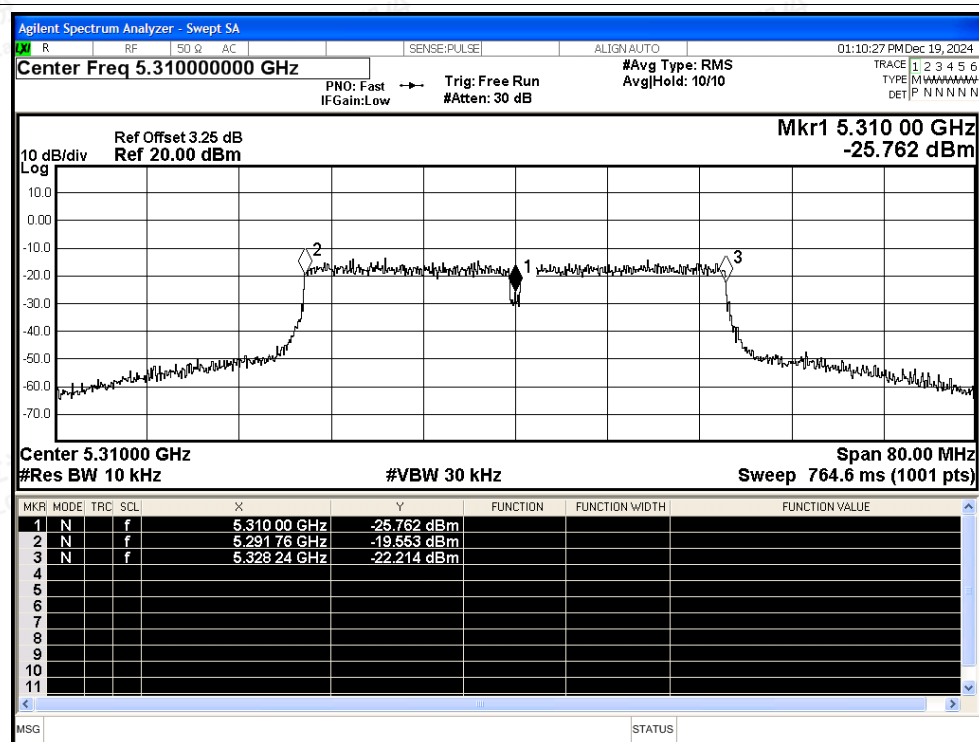

Freq. Stability NVNT ax80 5290MHz Ant2

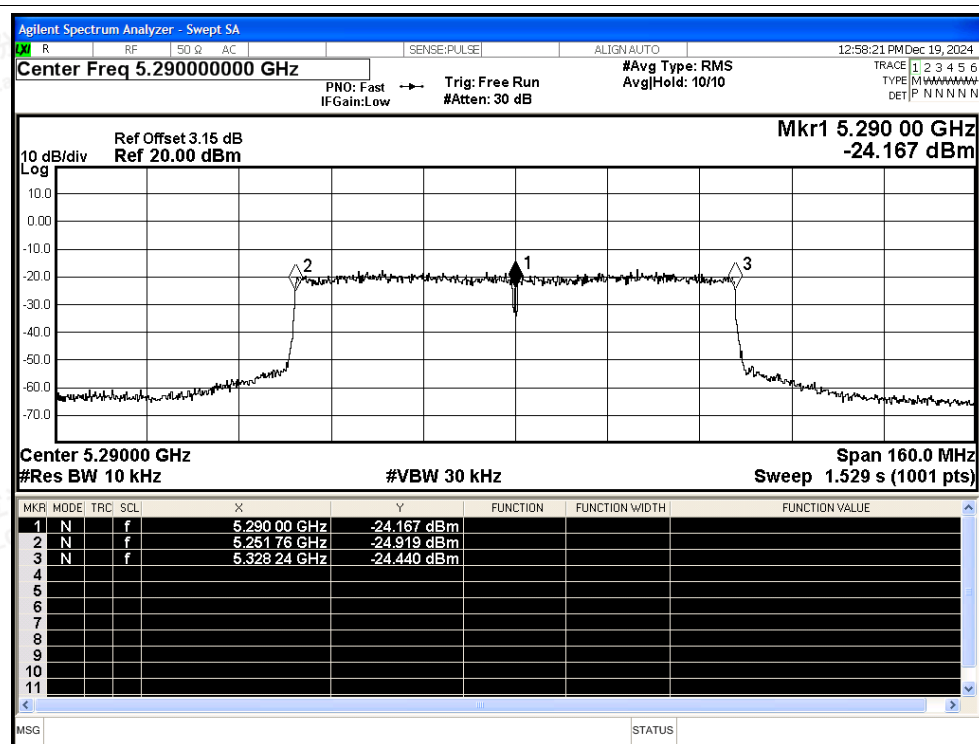

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	94.56	0.24	0.91
NVNT	a	5300	Ant1	94.65	0.24	0.91
NVNT	a	5320	Ant1	94.56	0.24	0.91
NVNT	n20	5260	Ant1	97.29	0.12	0.44
NVNT	n20	5300	Ant1	97.33	0.12	0.44
NVNT	n20	5320	Ant1	97.29	0.12	0.44
NVNT	n40	5270	Ant1	94.71	0.24	0.9
NVNT	n40	5310	Ant1	94.71	0.24	0.9
NVNT	ac20	5260	Ant1	97.3	0.12	0.44
NVNT	ac20	5300	Ant1	97.3	0.12	0.44
NVNT	ac20	5320	Ant1	97.34	0.12	0.44
NVNT	ac40	5270	Ant1	94.72	0.24	0.9
NVNT	ac40	5310	Ant1	94.81	0.23	0.9
NVNT	ac80	5290	Ant1	94.41	0.25	0.97
NVNT	ax20	5260	Ant1	97.34	0.12	0.44
NVNT	ax20	5300	Ant1	97.34	0.12	0.44
NVNT	ax20	5320	Ant1	97.34	0.12	0.44
NVNT	ax40	5270	Ant1	94.72	0.24	0.9
NVNT	ax40	5310	Ant1	94.72	0.24	0.9
NVNT	ax80	5290	Ant1	94.32	0.25	0.97






Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

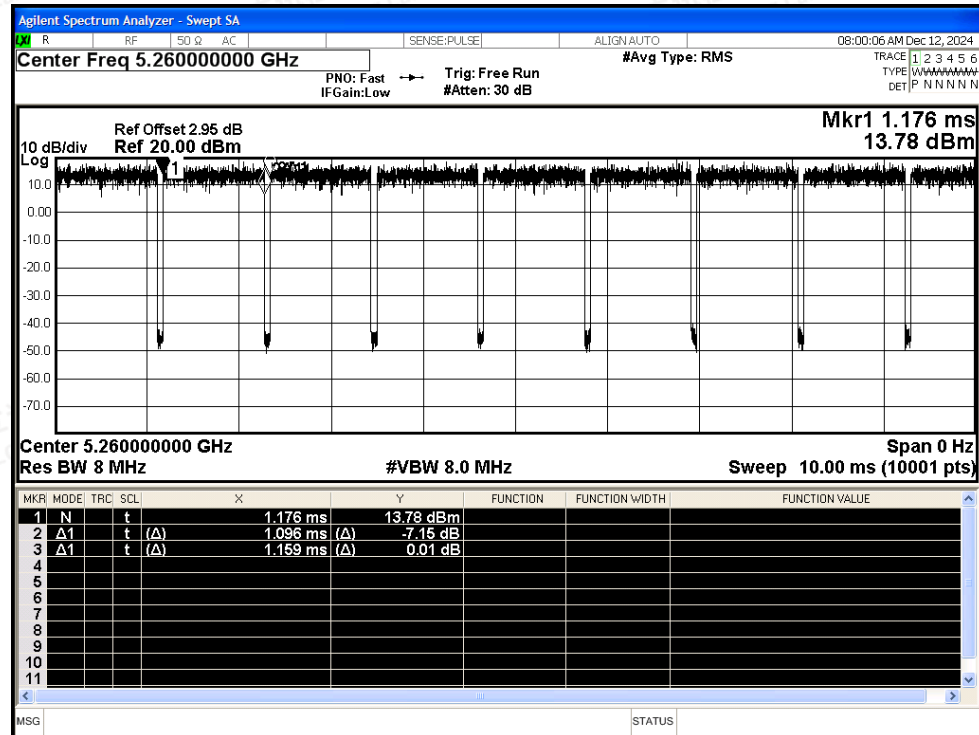

Duty Cycle NVNT a 5300MHz Ant1

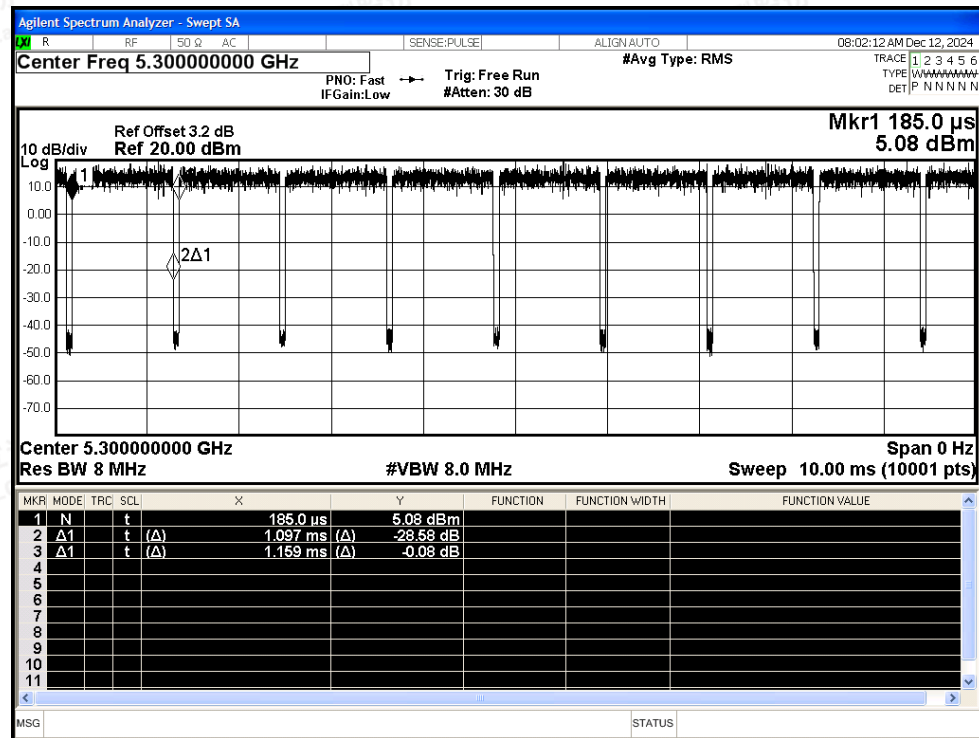

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

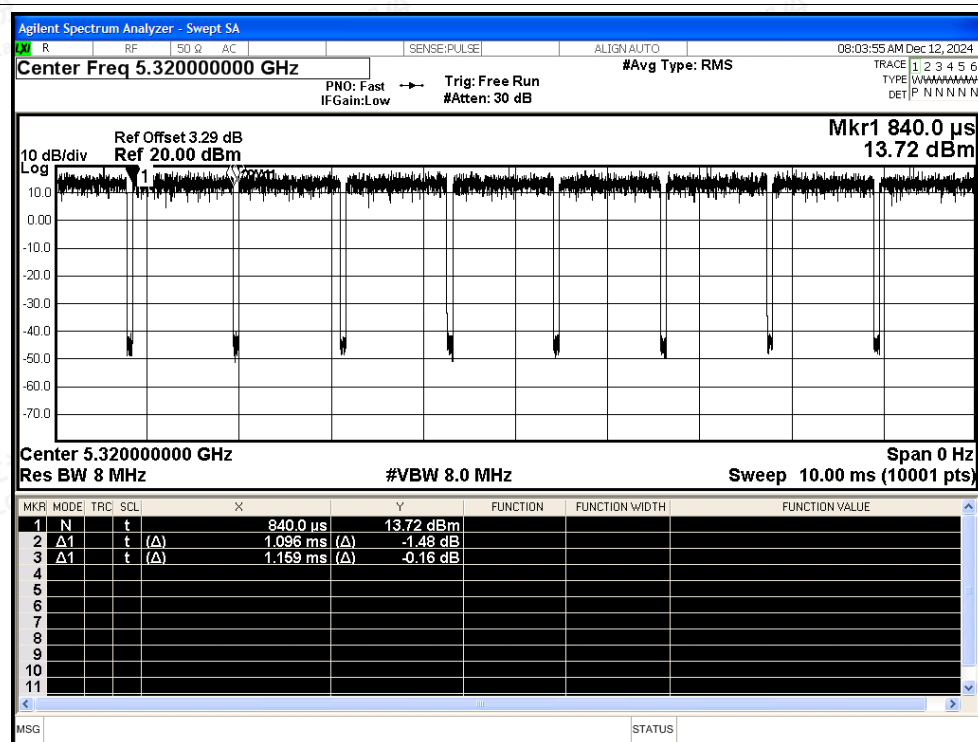

Duty Cycle NVNT n20 5260MHz Ant1

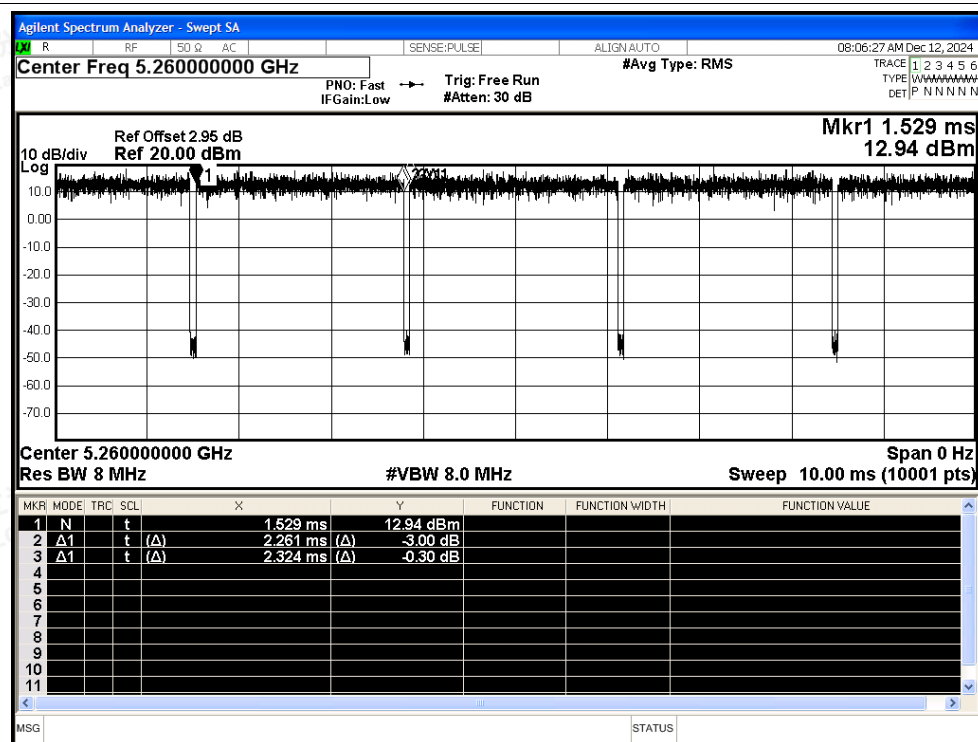

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant1

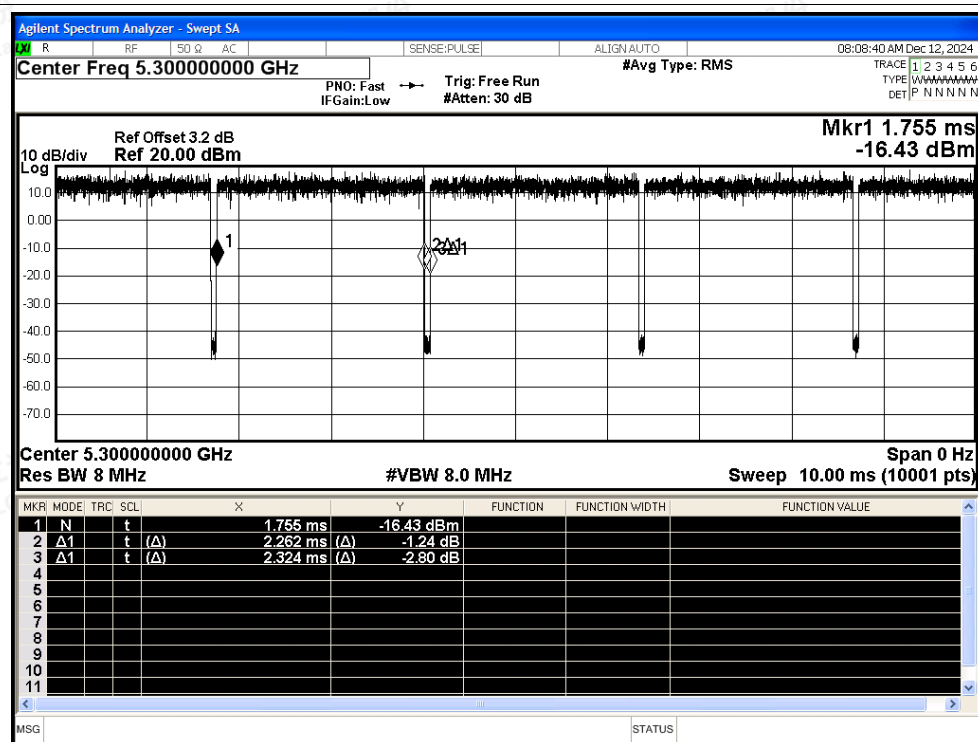

Duty Cycle NVNT n20 5320MHz Ant1

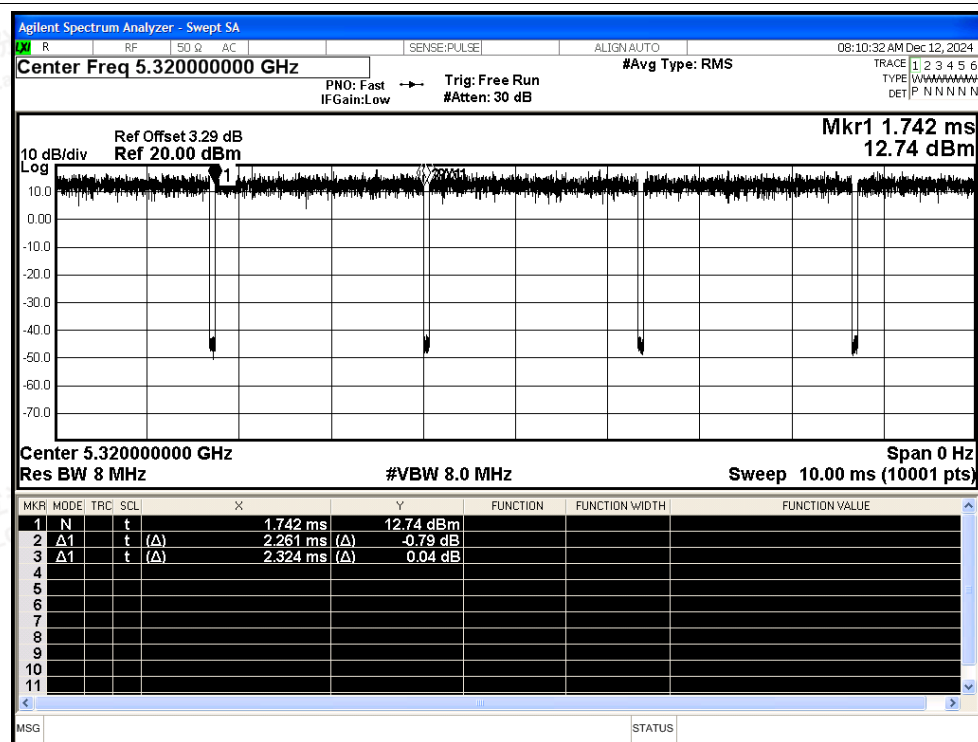

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant1

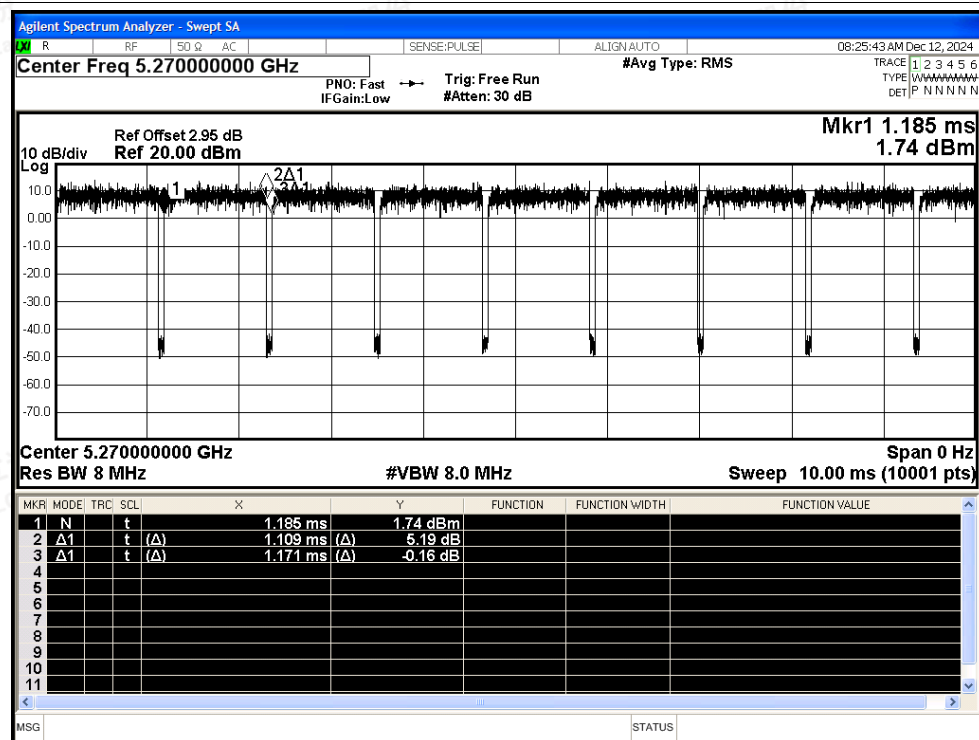

Duty Cycle NVNT n40 5310MHz Ant1

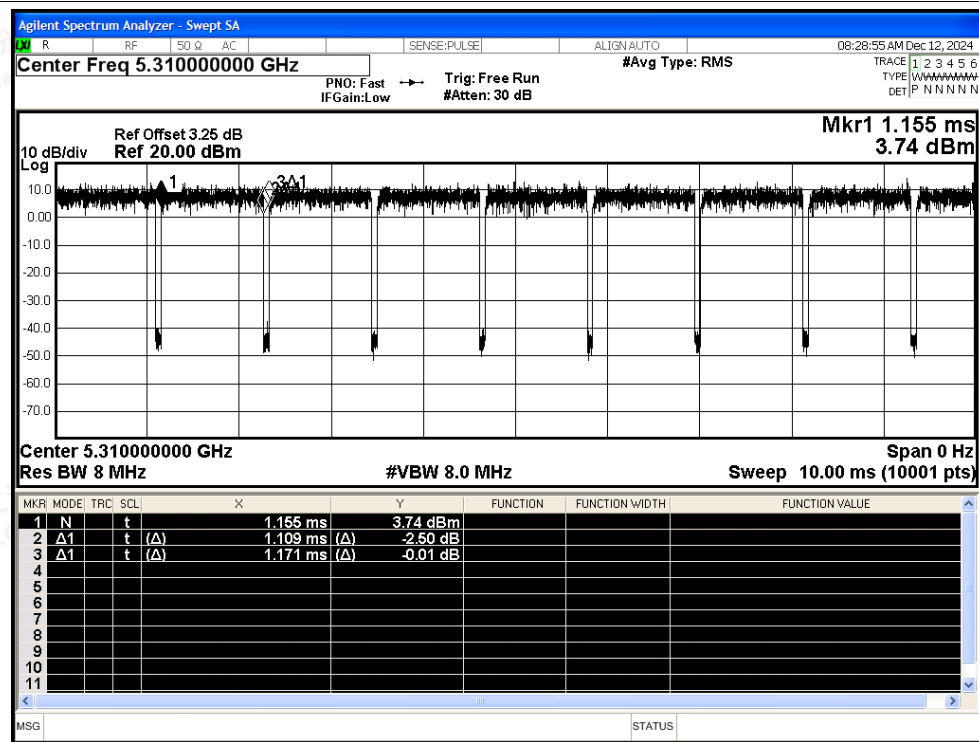

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

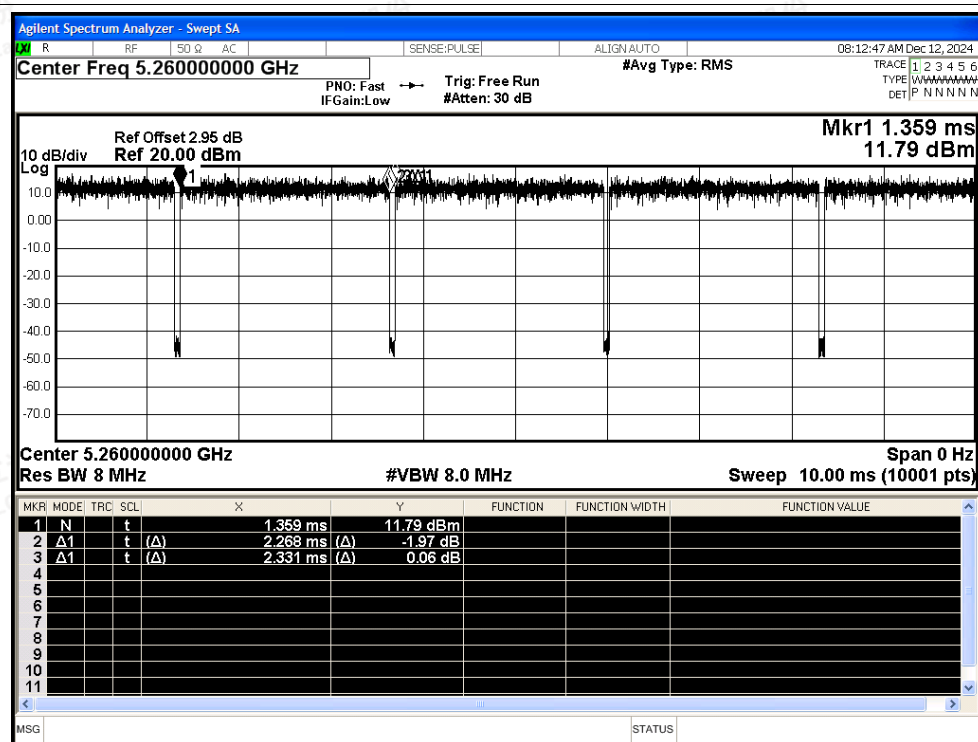

Duty Cycle NVNT ac20 5300MHz Ant1

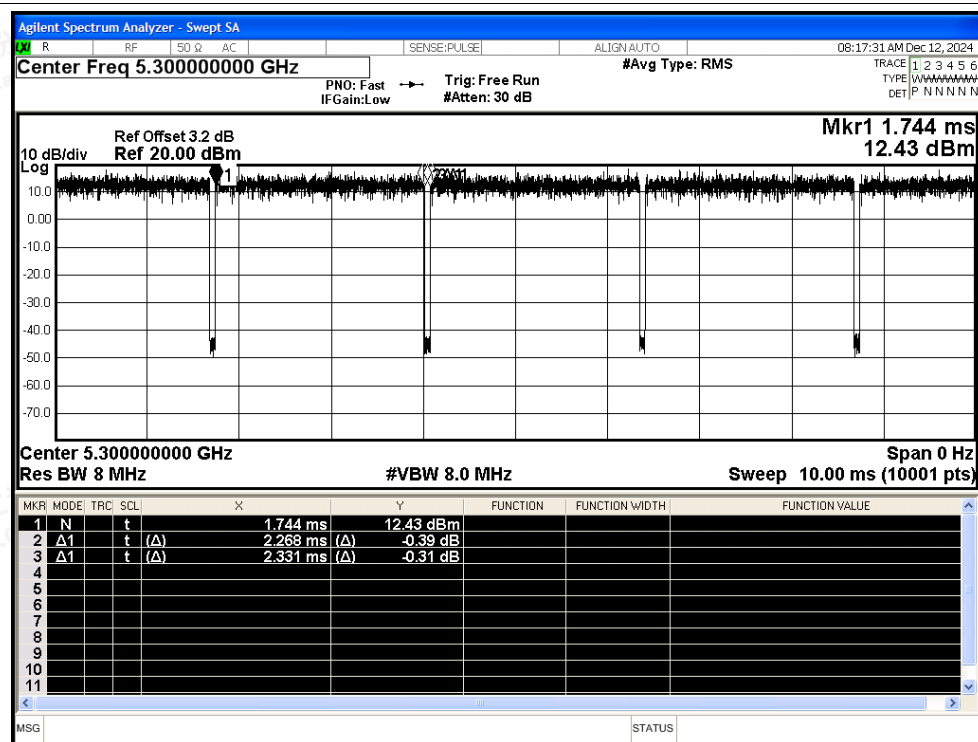

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

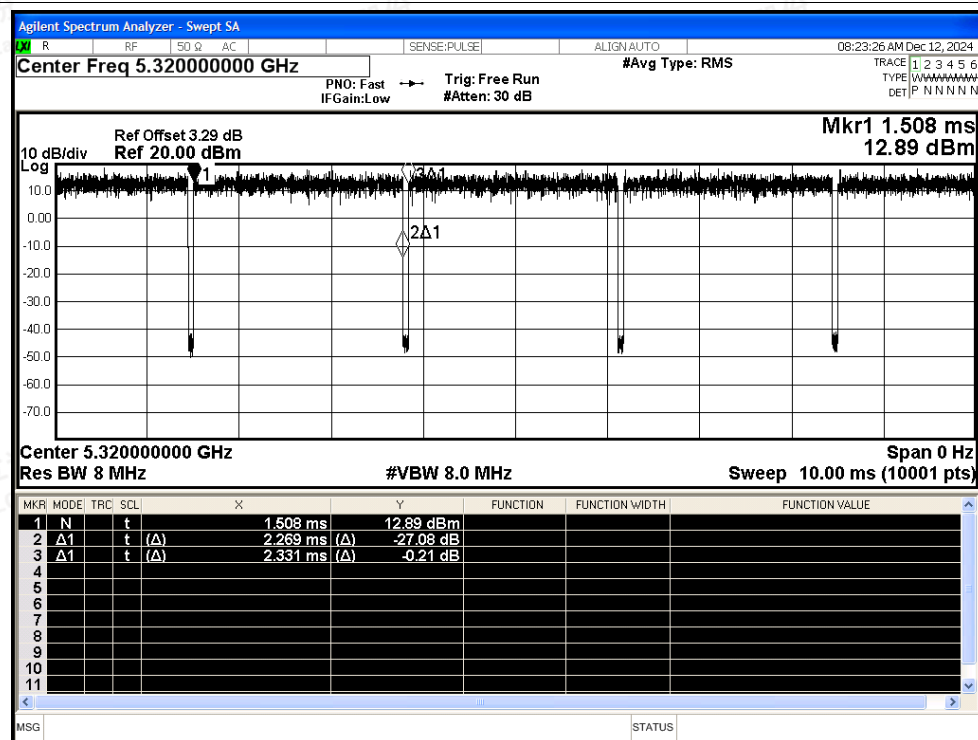

Duty Cycle NVNT ac40 5270MHz Ant1

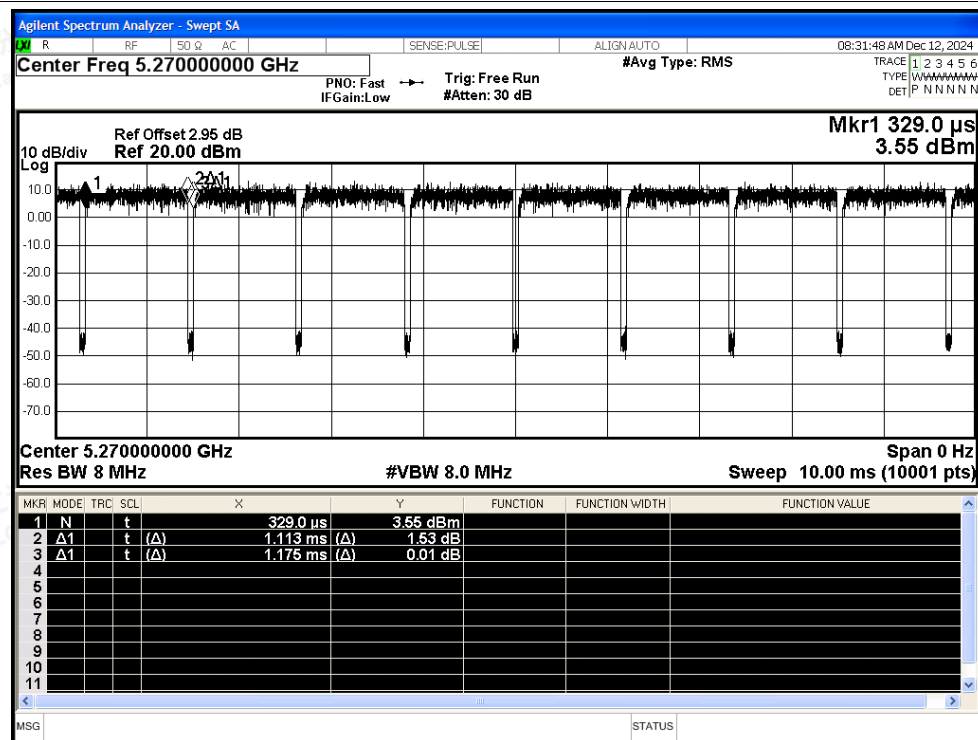

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity