

Test Graphs









10.7 APPENDIX: CONDUCTED SPURIOUS EMISSION

Test Result

TestMode	Antenna	Channel	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH1	Ant1	2402	Reference	4.81	4.81	---	PASS
			30~1000	30~1000	-57.193	<=-15.191	PASS
			1000~26500	1000~26500	-35.288	<=-15.191	PASS
		2441	Reference	4.44	4.44	---	PASS
			30~1000	30~1000	-56.714	<=-15.556	PASS
			1000~26500	1000~26500	-38.051	<=-15.556	PASS
		2480	Reference	4.30	4.30	---	PASS
			30~1000	30~1000	-56.658	<=-15.697	PASS
			1000~26500	1000~26500	-34.559	<=-15.697	PASS
2DH1	Ant1	2402	Reference	4.99	4.99	---	PASS
			30~1000	30~1000	-55.011	<=-15.015	PASS
			1000~26500	1000~26500	-40.813	<=-15.015	PASS
		2441	Reference	4.47	4.47	---	PASS
			30~1000	30~1000	-55.203	<=-15.531	PASS
			1000~26500	1000~26500	-38.838	<=-15.531	PASS
		2480	Reference	4.48	4.48	---	PASS
			30~1000	30~1000	-55.815	<=-15.52	PASS
			1000~26500	1000~26500	-41.979	<=-15.52	PASS


Test Graphs




DH1_Ant1_2441_0~Reference



DH1_Ant1_2441_30~1000

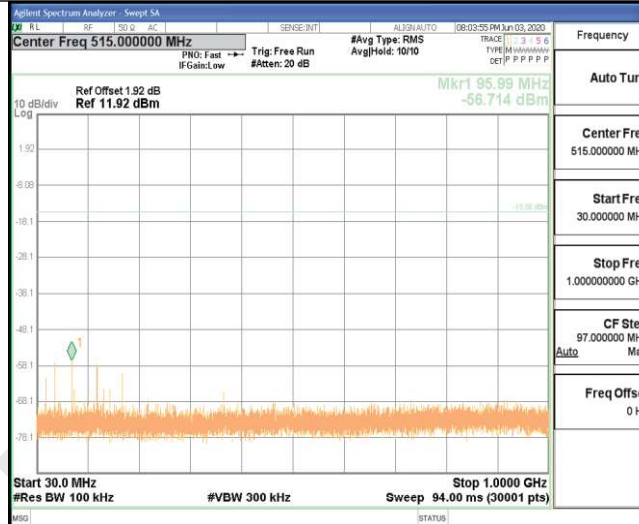


DH1_Ant1_2441_1000~26500

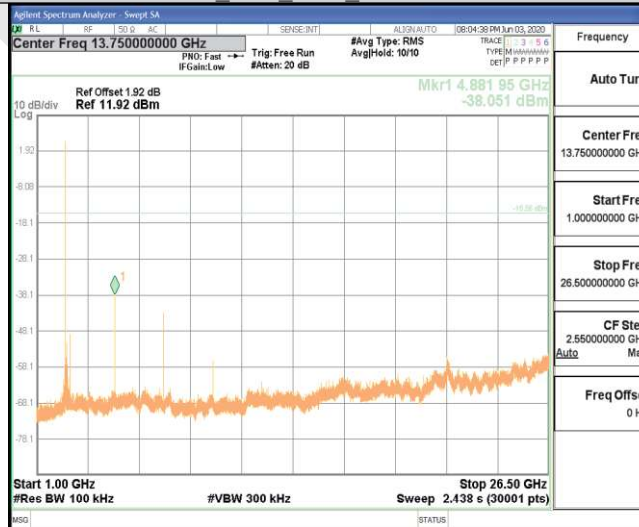


DH1_Ant1_2480_0~Reference



DH1_Ant1_2480_30~1000

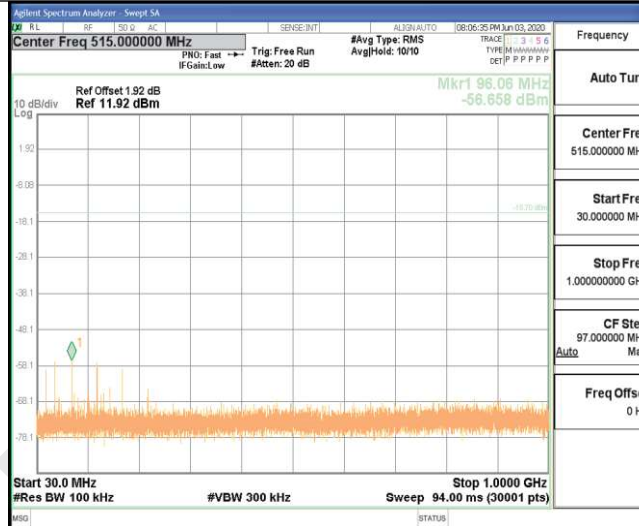


DH1_Ant1_2480_1000~26500

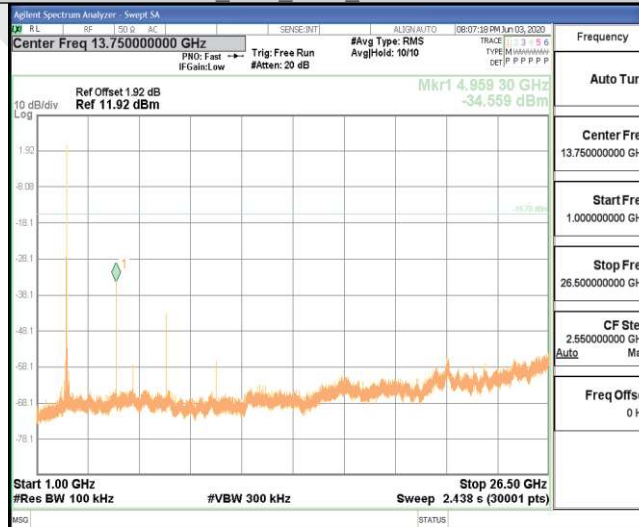


2DH1_Ant1_2402_0~Reference



2DH1_Ant1_2402_30~1000

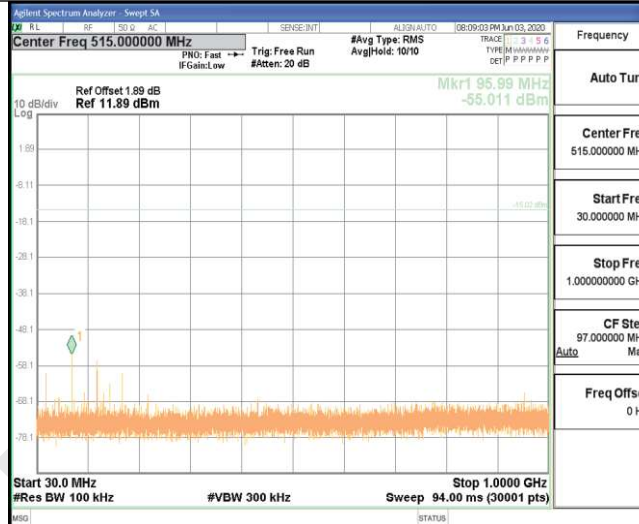


2DH1_Ant1_2402_1000~26500

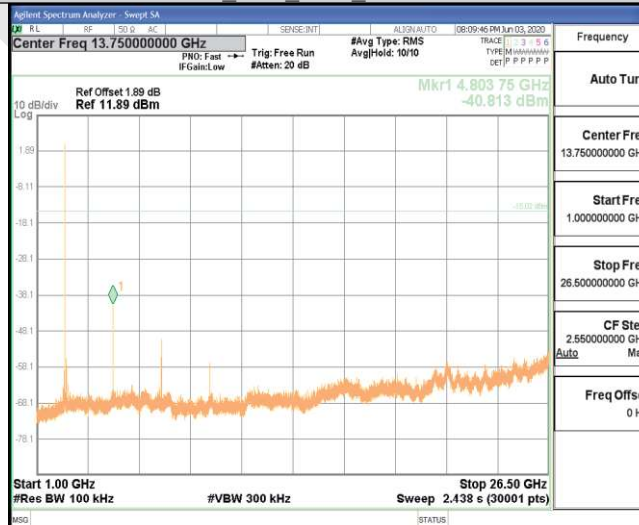


2DH1_Ant1_2441_0~Reference



2DH1_Ant1_2441_30~1000

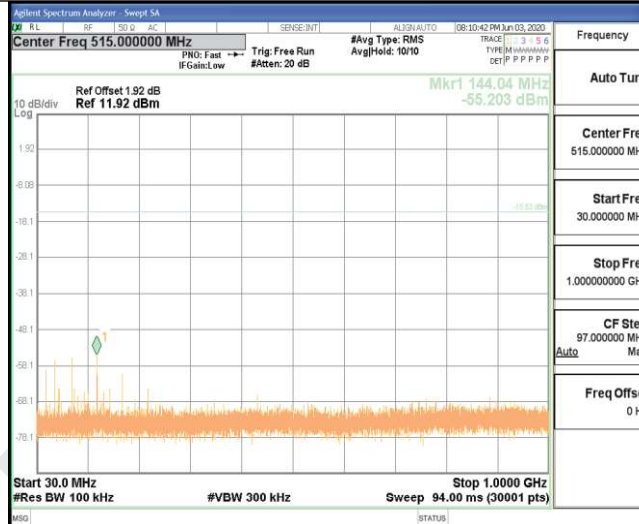



2DH1_Ant1_2441_1000~26500

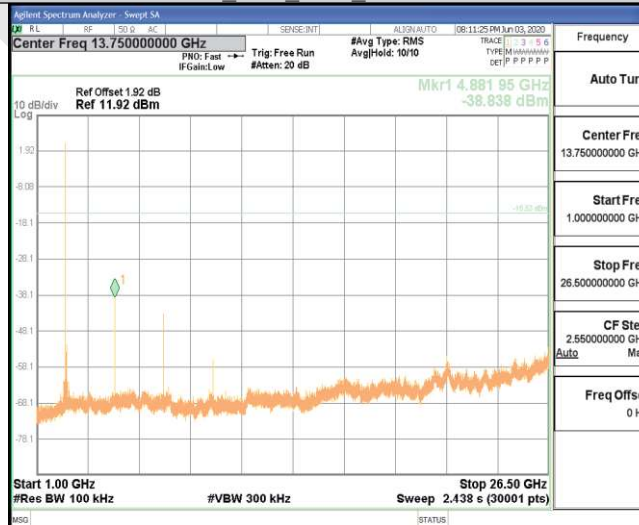



APPENDIX A: PHOTOGRAPHS OF TEST SETUP


Radiated Spurious Emissions

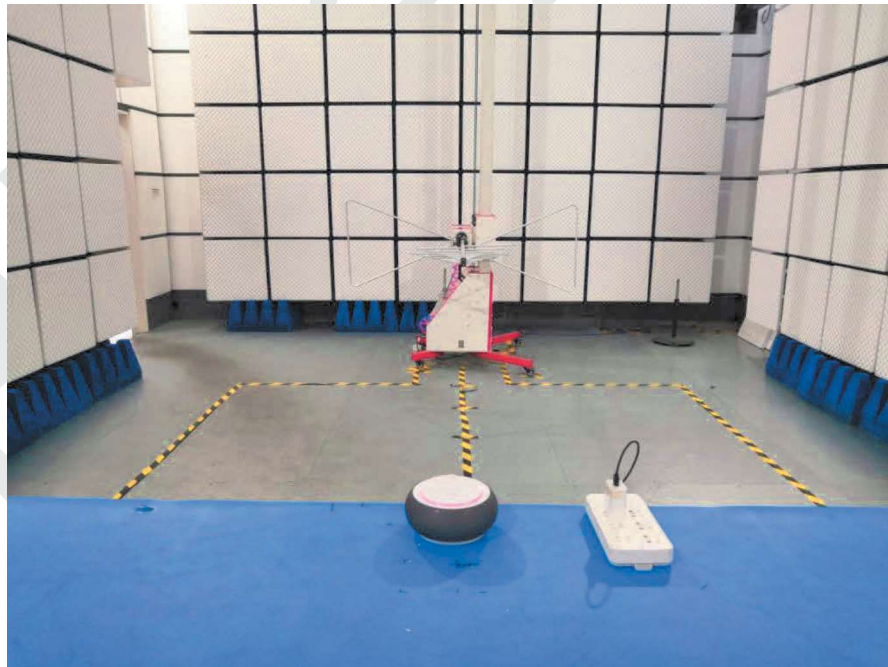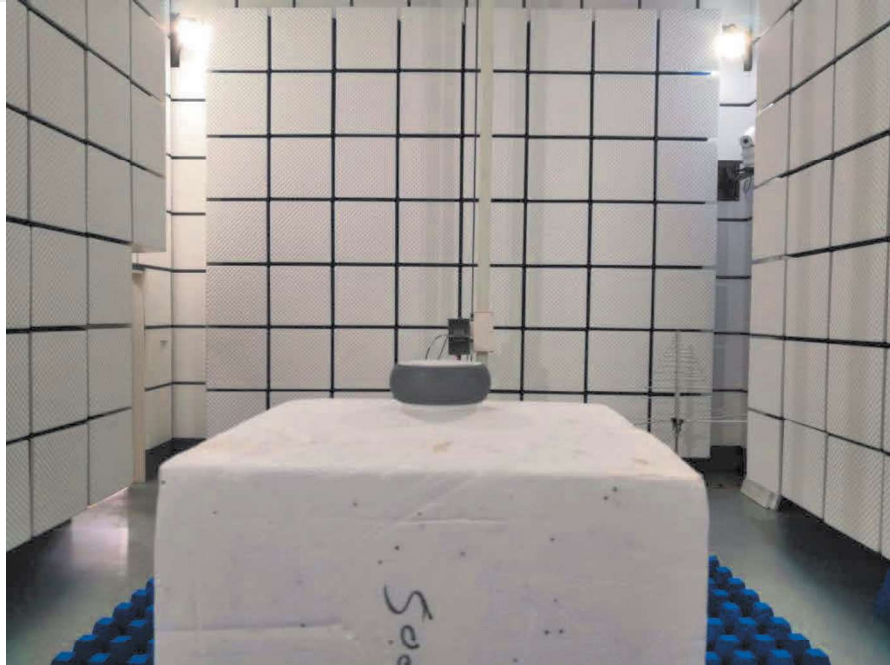




Conducted Emissions at AC Power Line (150kHz-30MHz)







APPENDIX B: PHOTOGRAPHS OF EUT

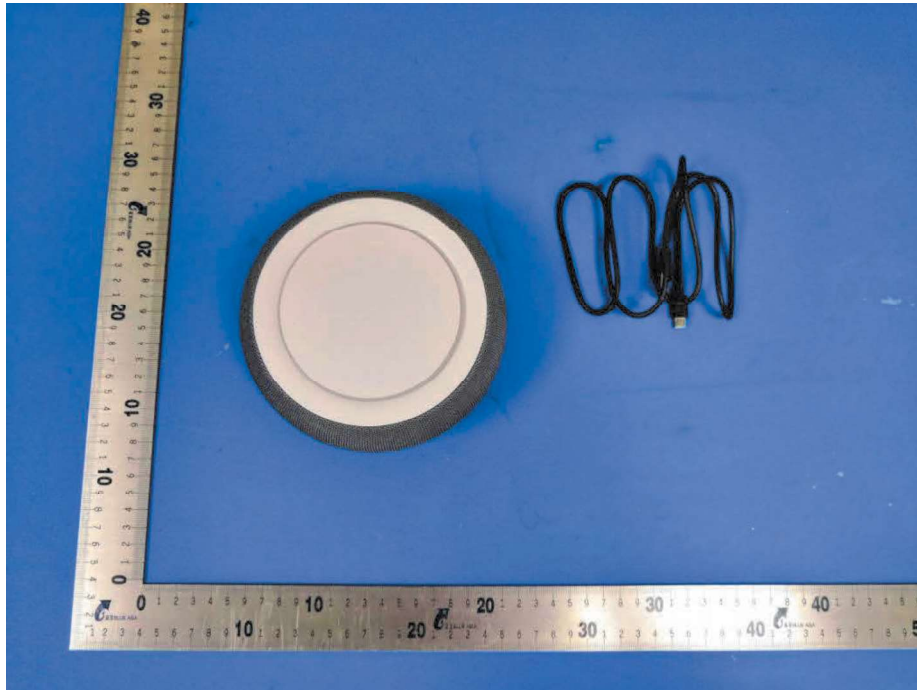

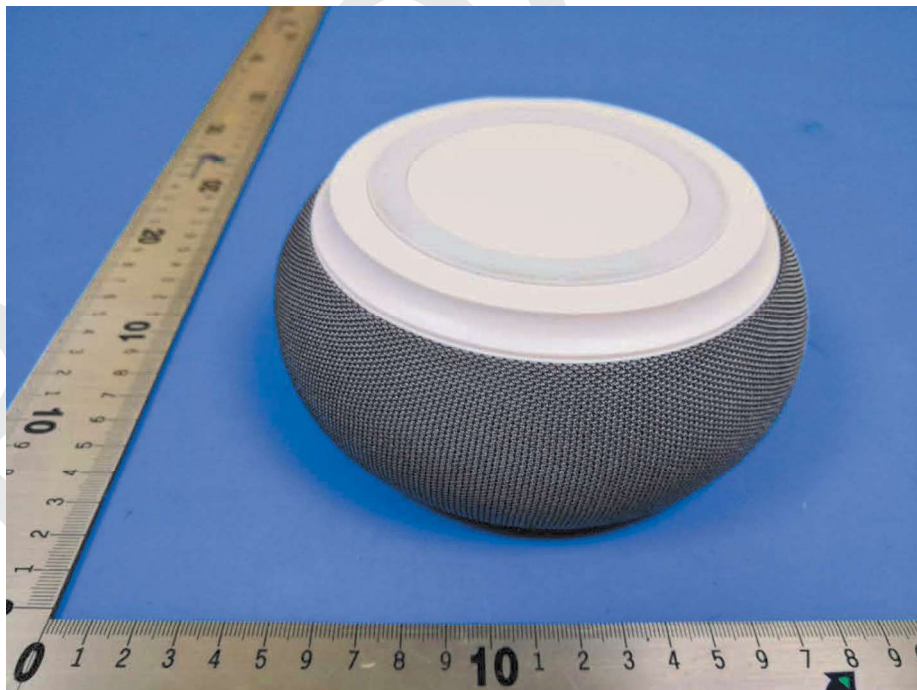

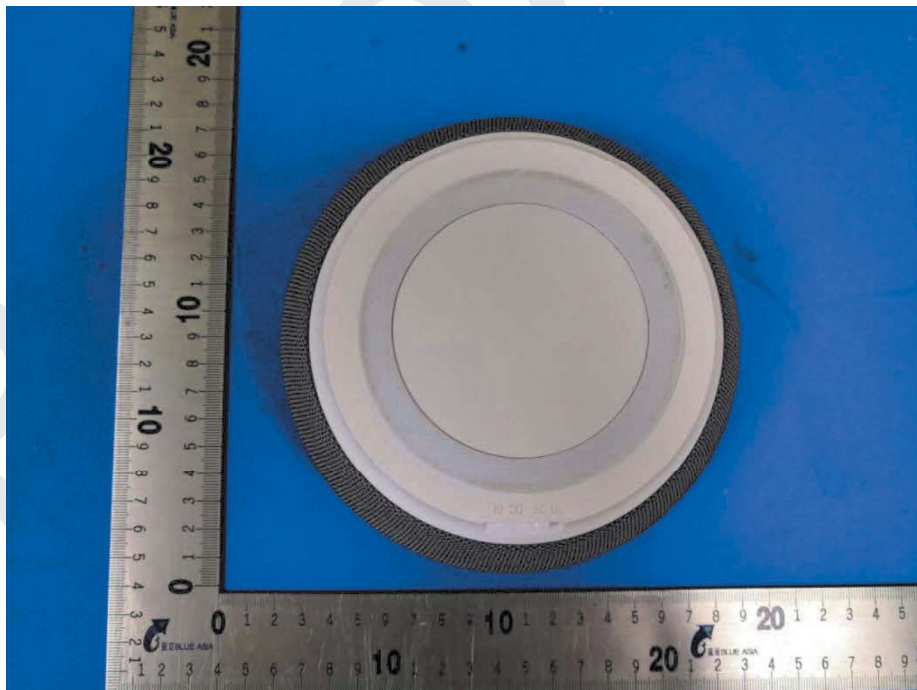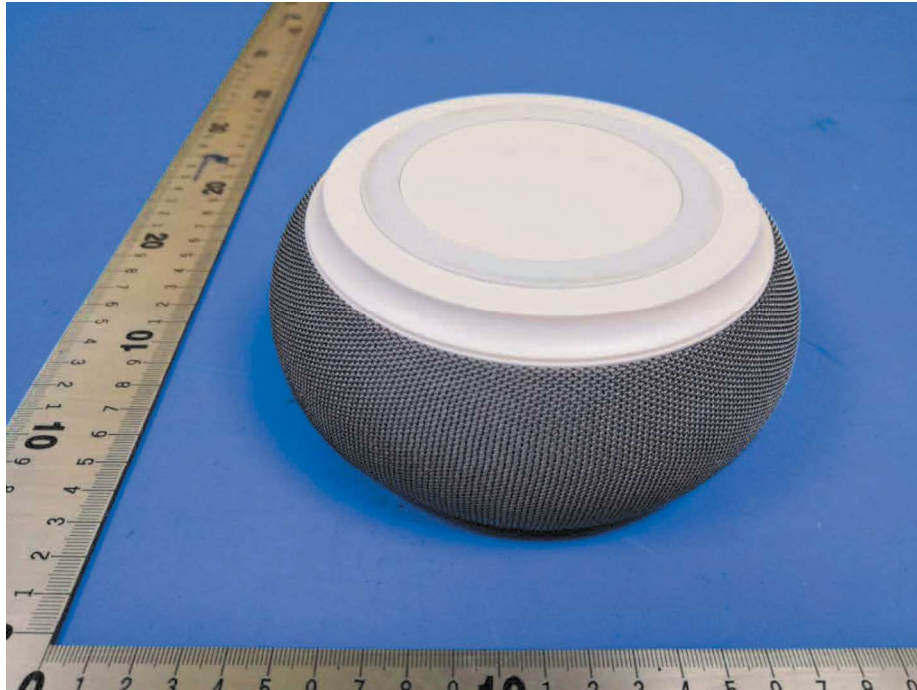

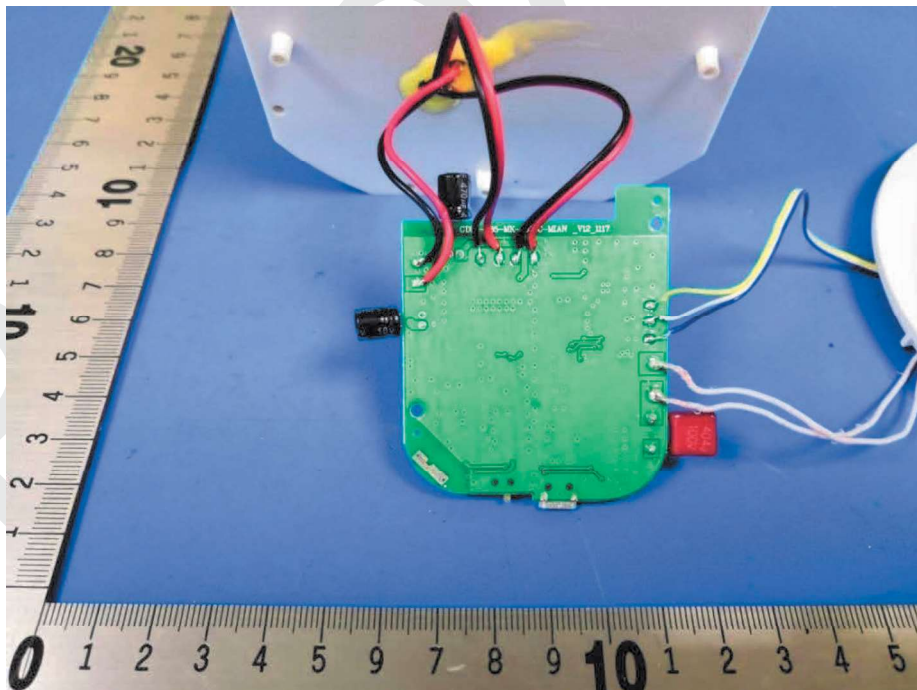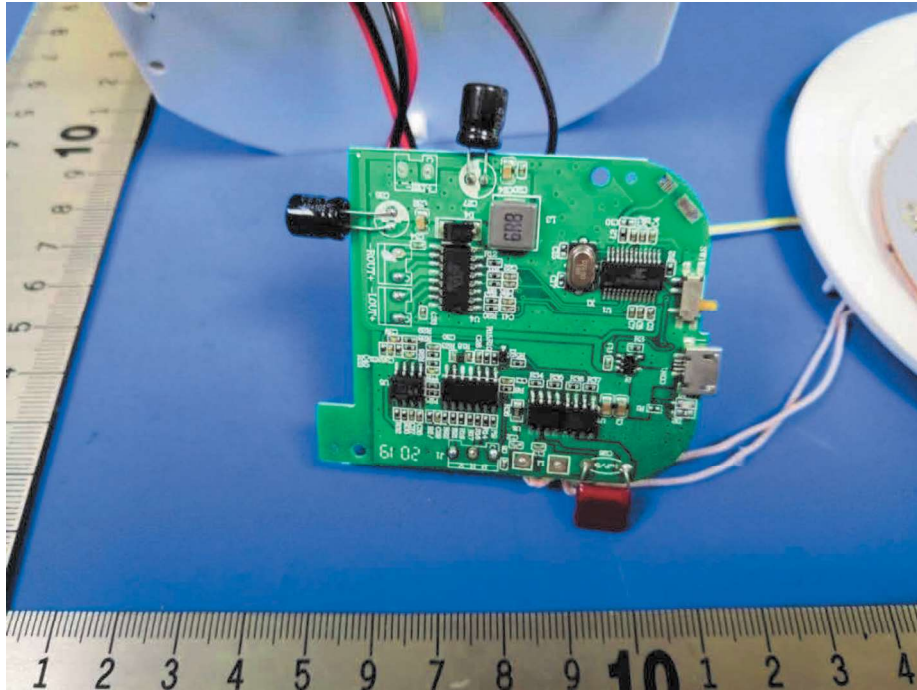

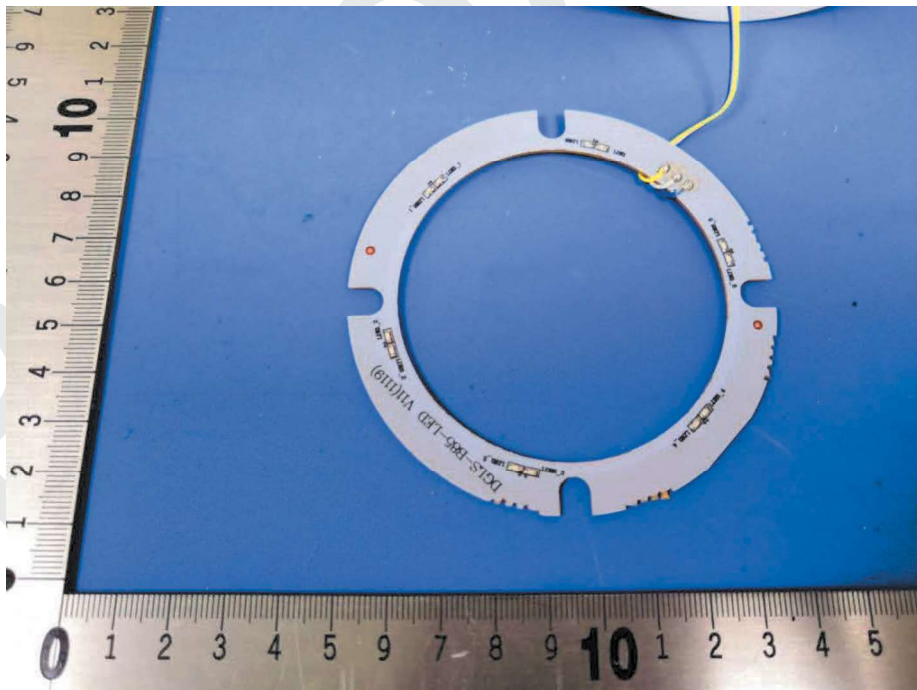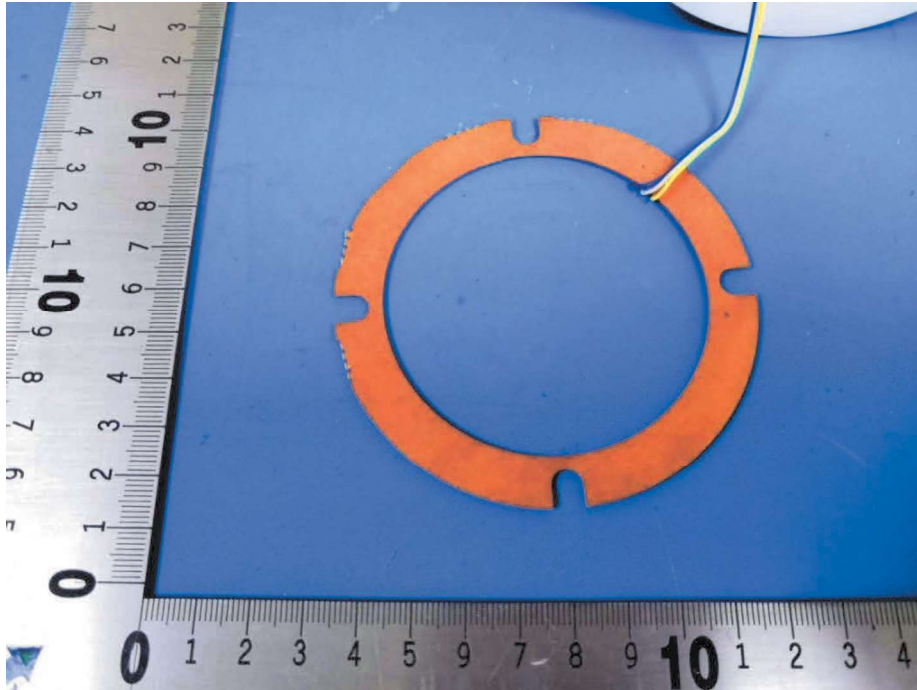

----END OF REPORT----

The test report is effective only with both signature and specialized stamp, The result(s) shown in this report refer only to the sample(s) tested. Without written approval of BlueAsia, this report can't be reproduced except in full.

BlueAsia