



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:52:17 AM

Humidity: 61.7 %

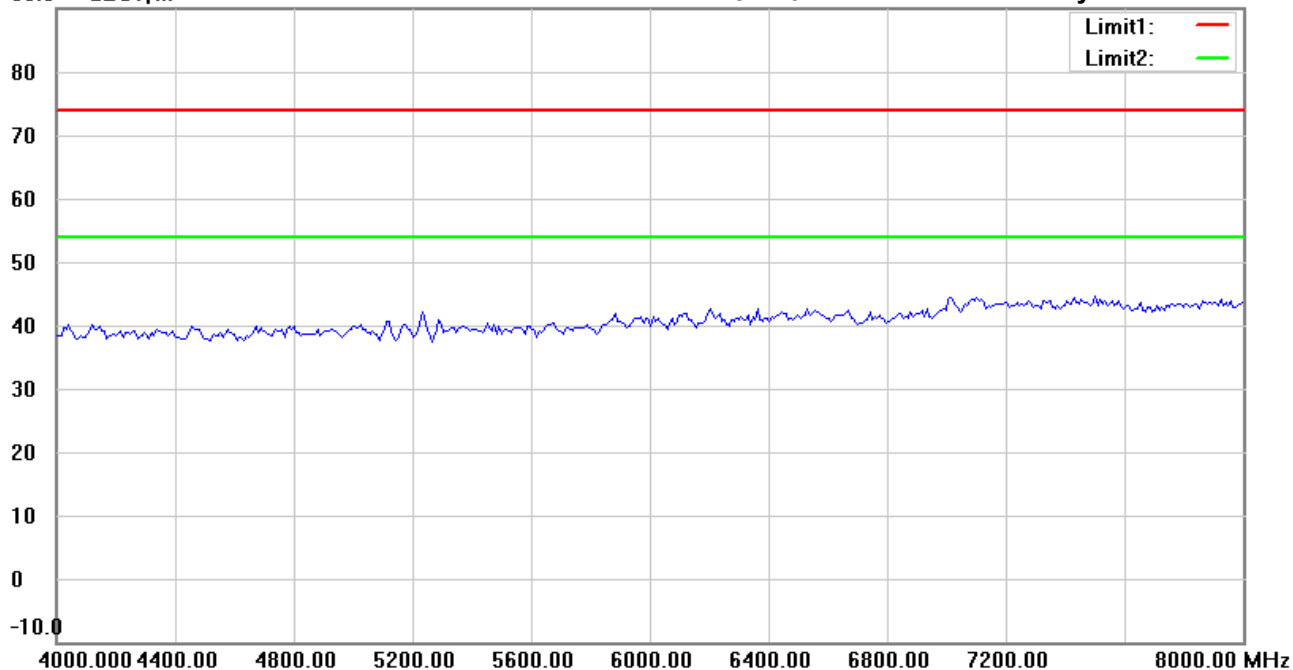

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:49:42 AM

Humidity: 61.7 %

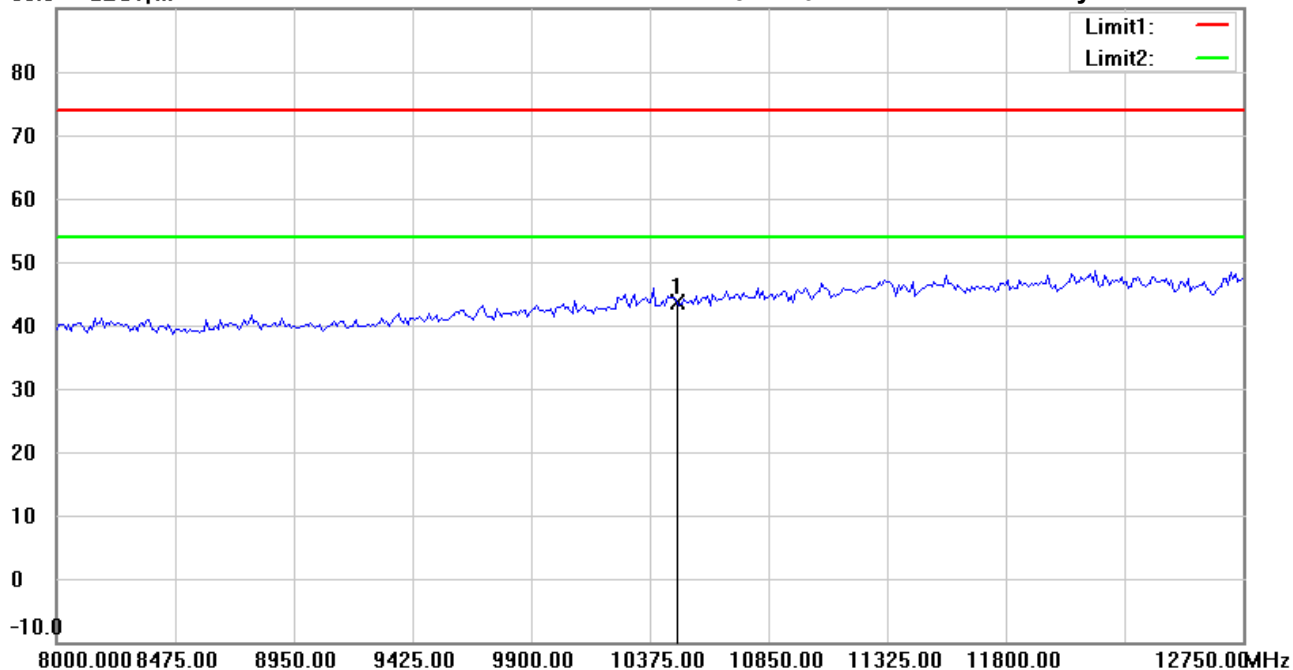

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10480.000	35.05	peak	8.46	43.51	74.00	150	340	-30.49	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:53:19 AM

Humidity: 61.7 %

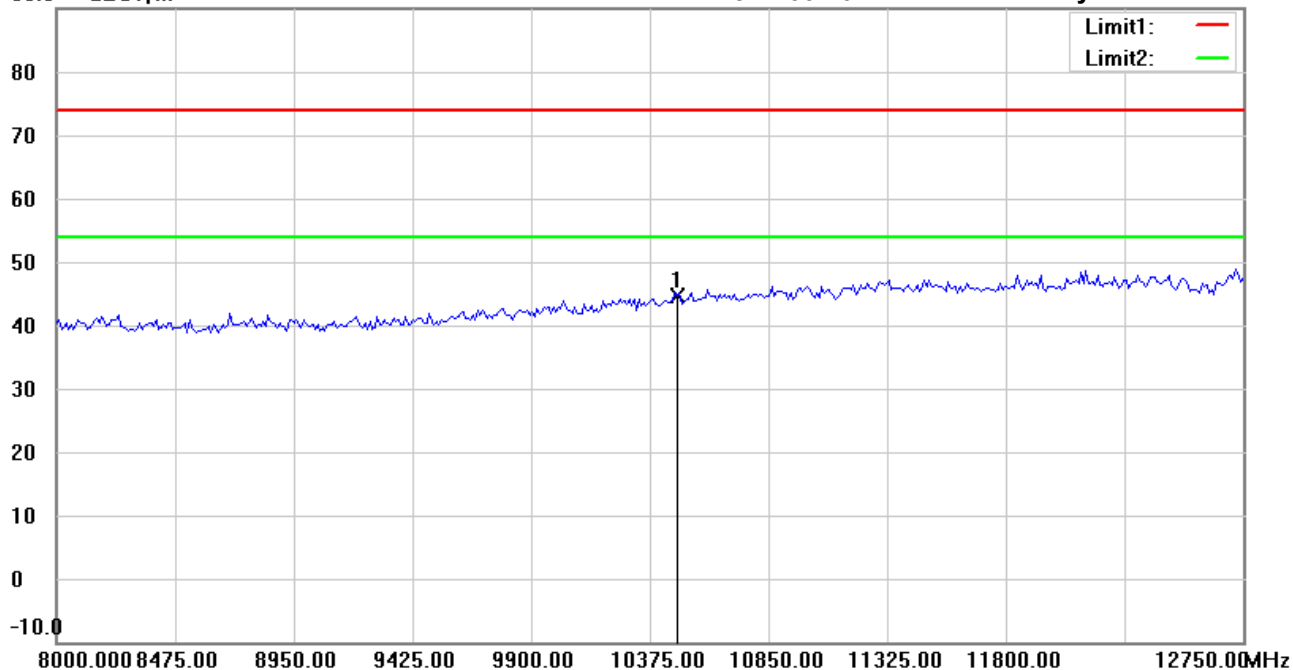

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10480.000	36.22	peak	8.46	44.68	74.00	150	330	-29.32	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:50:51 AM

Humidity: 61.7 %

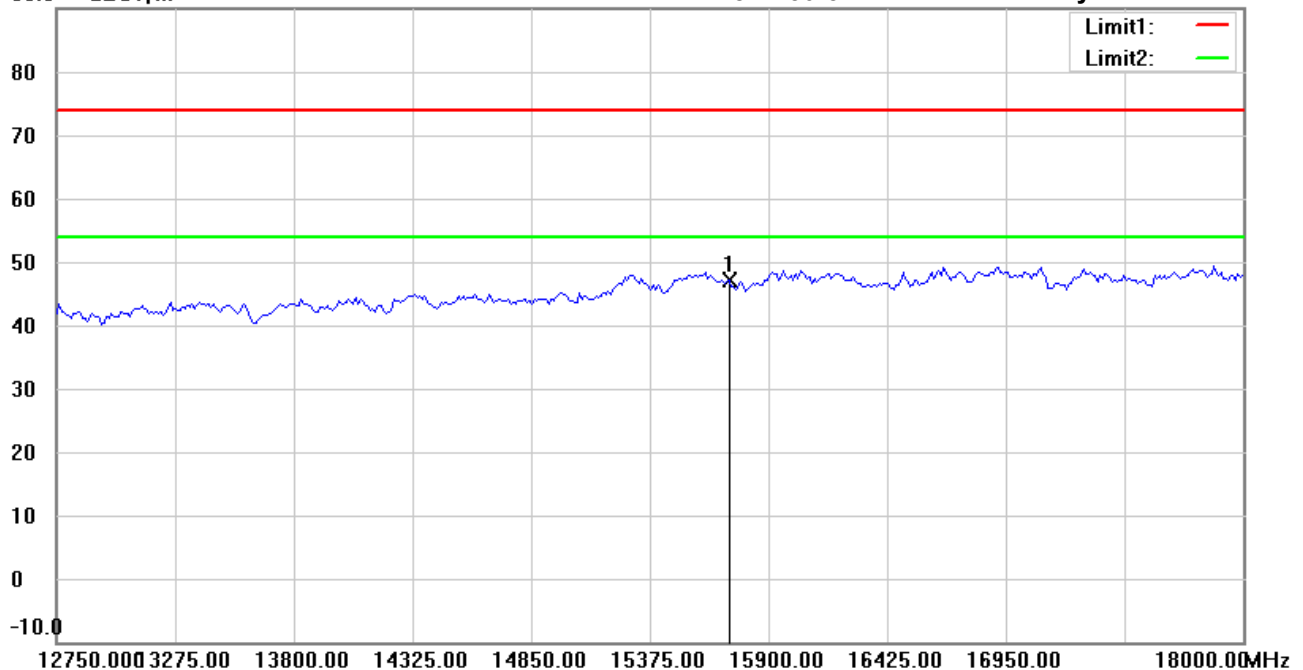

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15720.000	29.62	peak	17.44	47.06	74.00	150	10	-26.94	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:54:27 AM

Humidity: 61.7 %

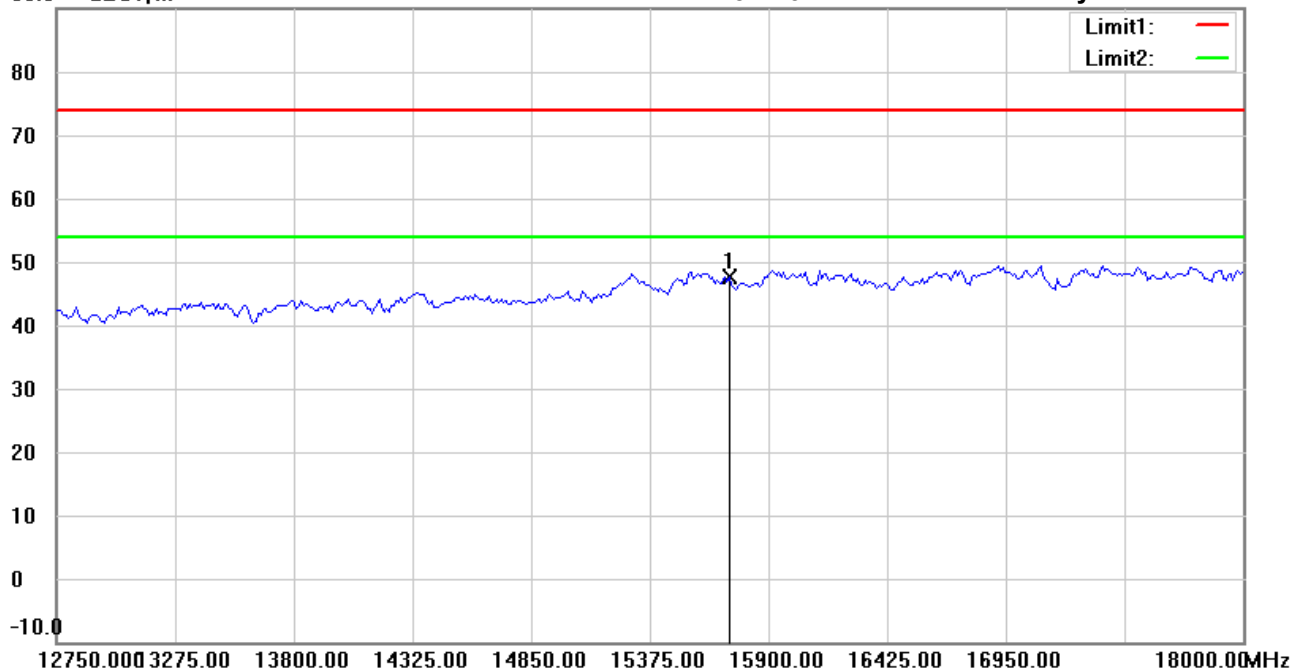

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15720.000	30.08	peak	17.44	47.52	74.00	150	240	-26.48	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #5


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:51:00 AM

Humidity: 61.7 %

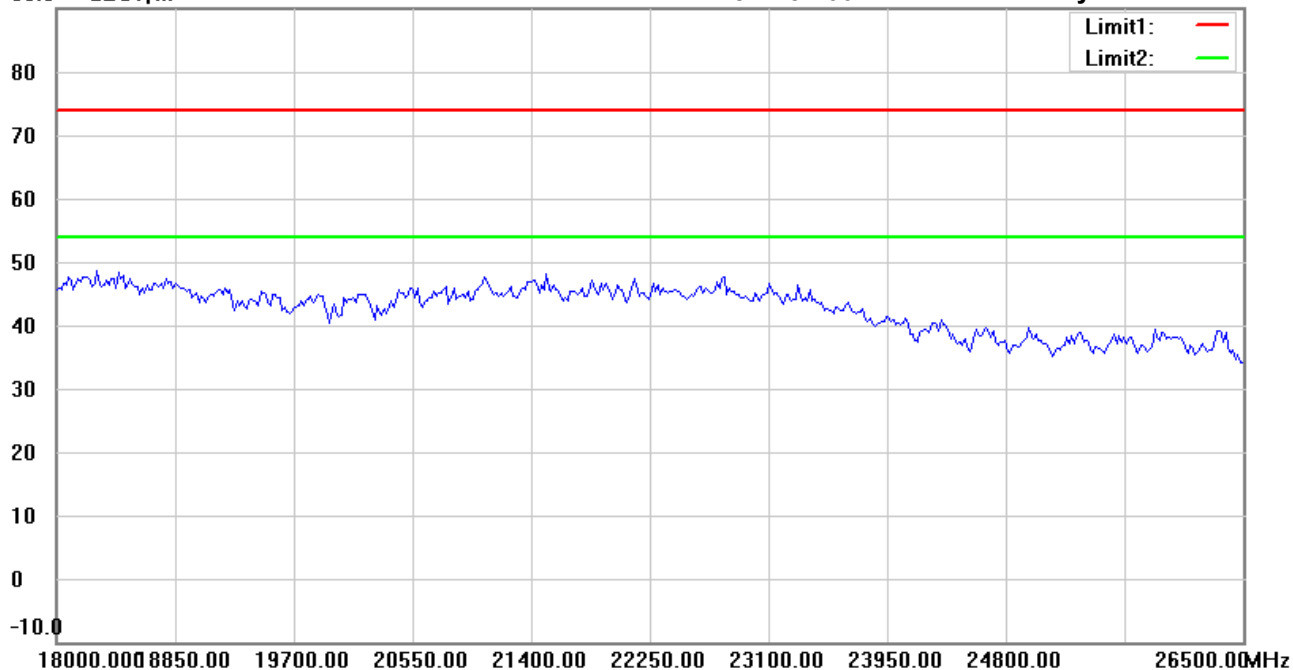

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 4:54:37 AM

Humidity:61.7 %

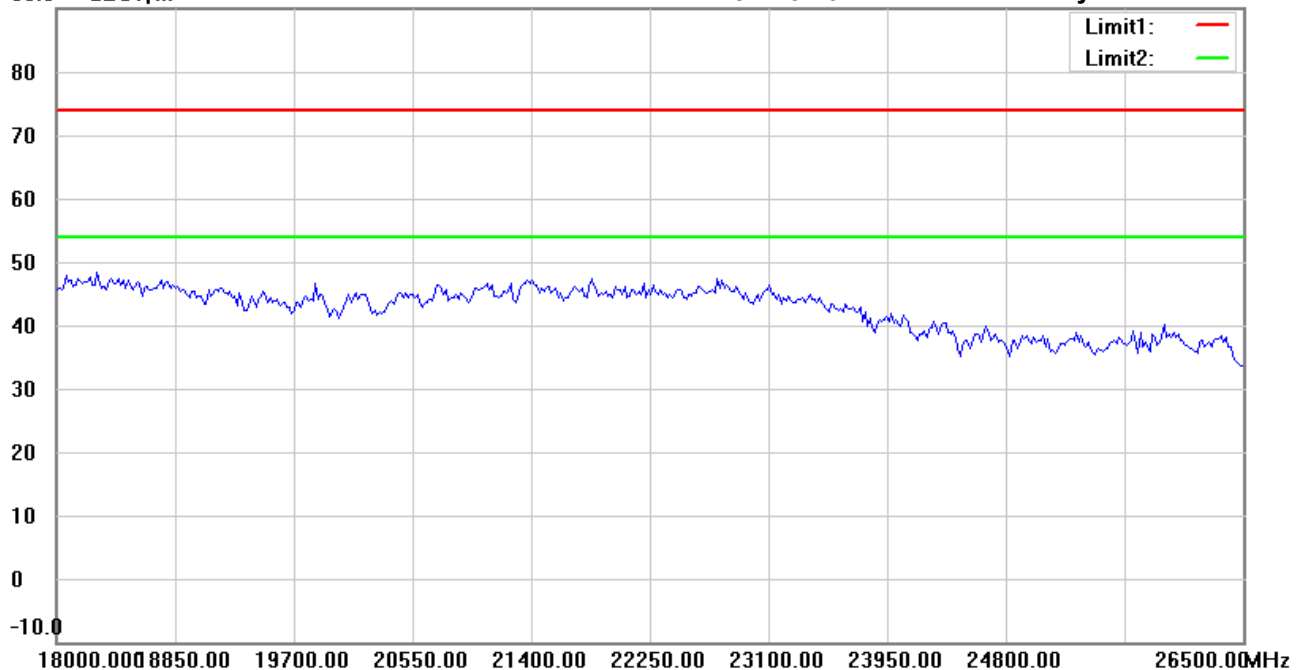

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#6


Date: 10/18/2019

Temperature: 22.1 °C

Time: 4:51:11 AM

Humidity: 61.7 %

90.0 dBuV/m

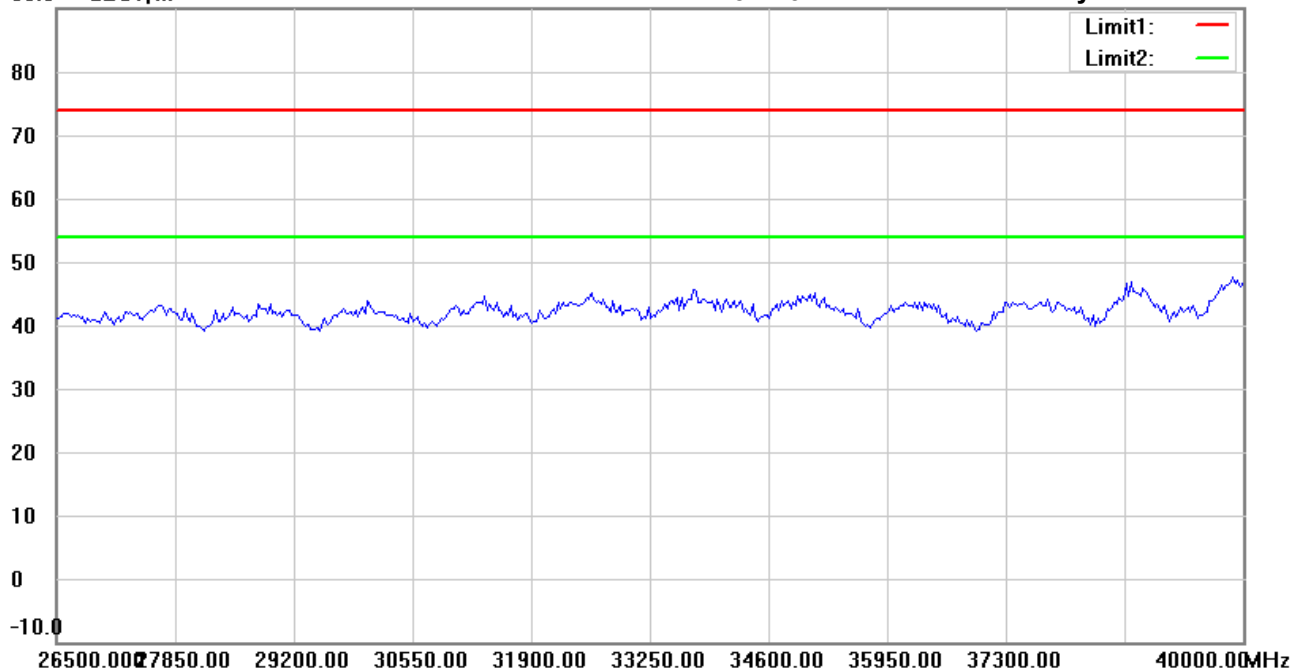

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 4:54:47 AM

Humidity:61.7 %

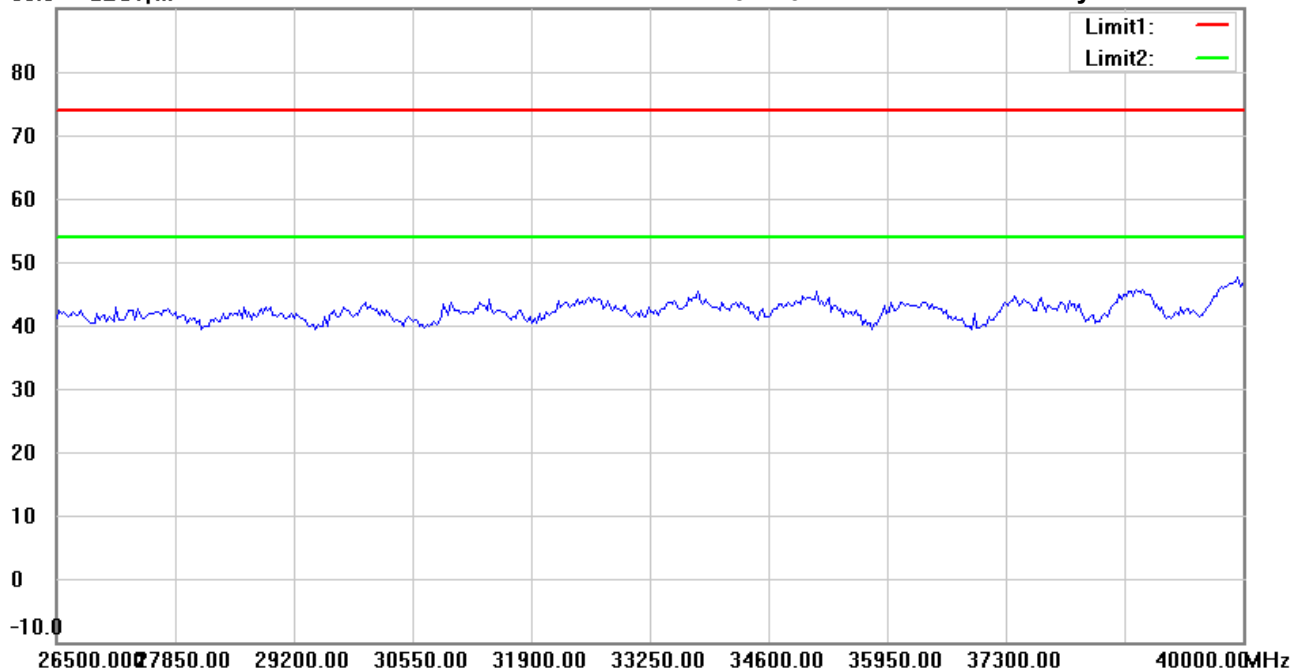

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:08:23 AM

Humidity:64.7 %

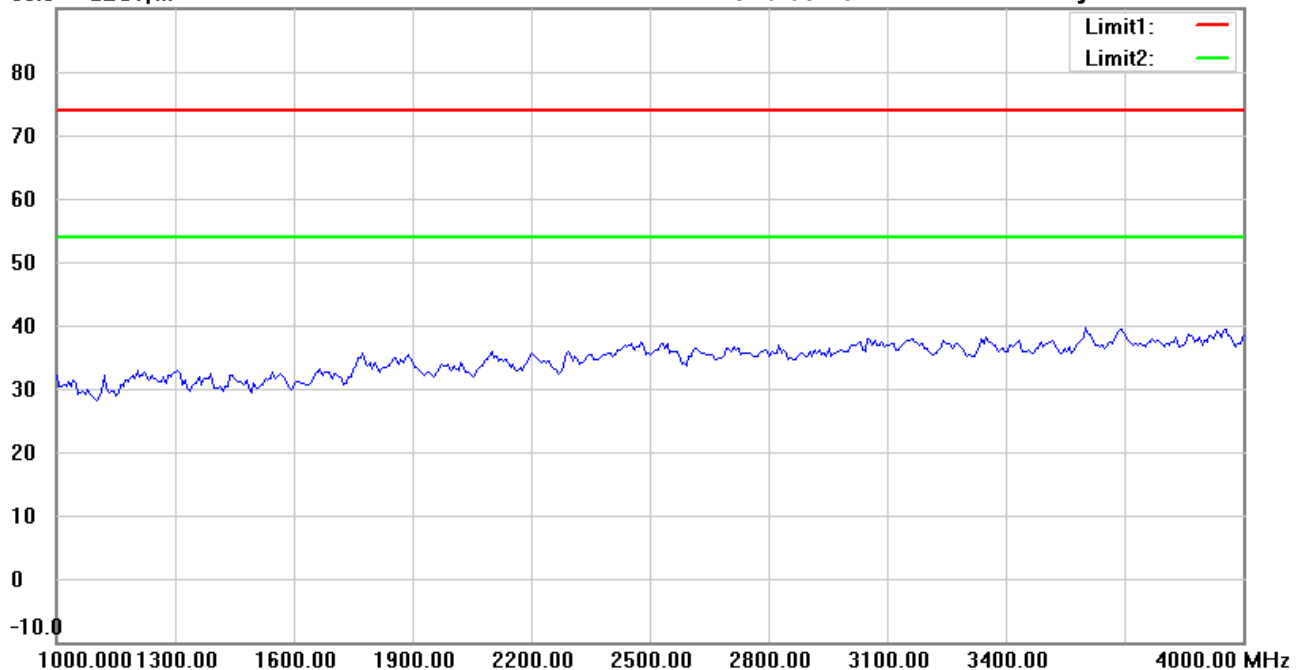

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:11:13 AM

Humidity:64.7 %

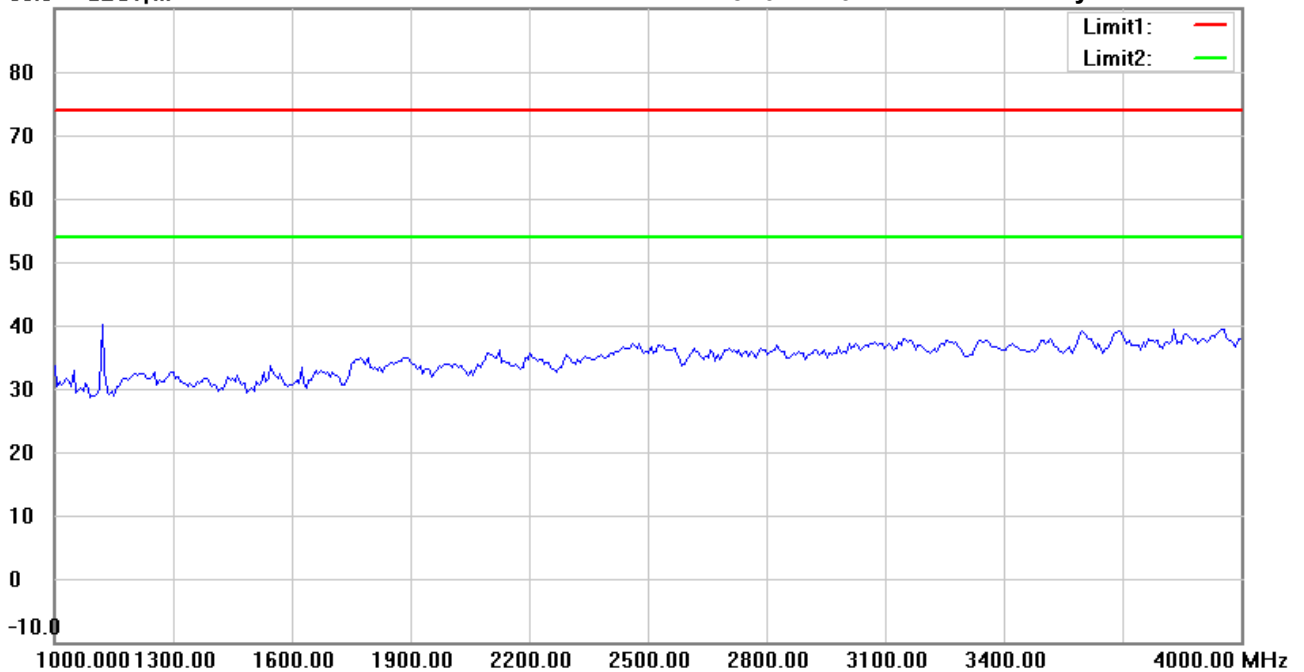

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:08:31 AM

Humidity: 64.7 %

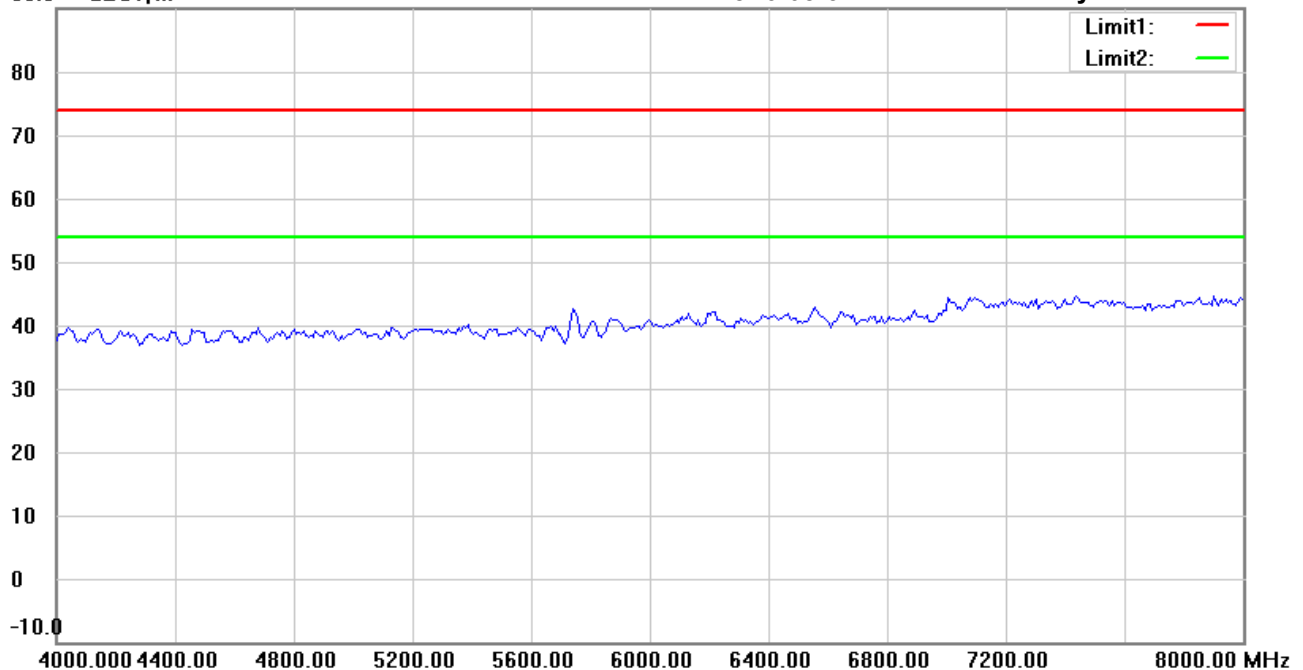

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:11:21 AM

Humidity: 64.7 %

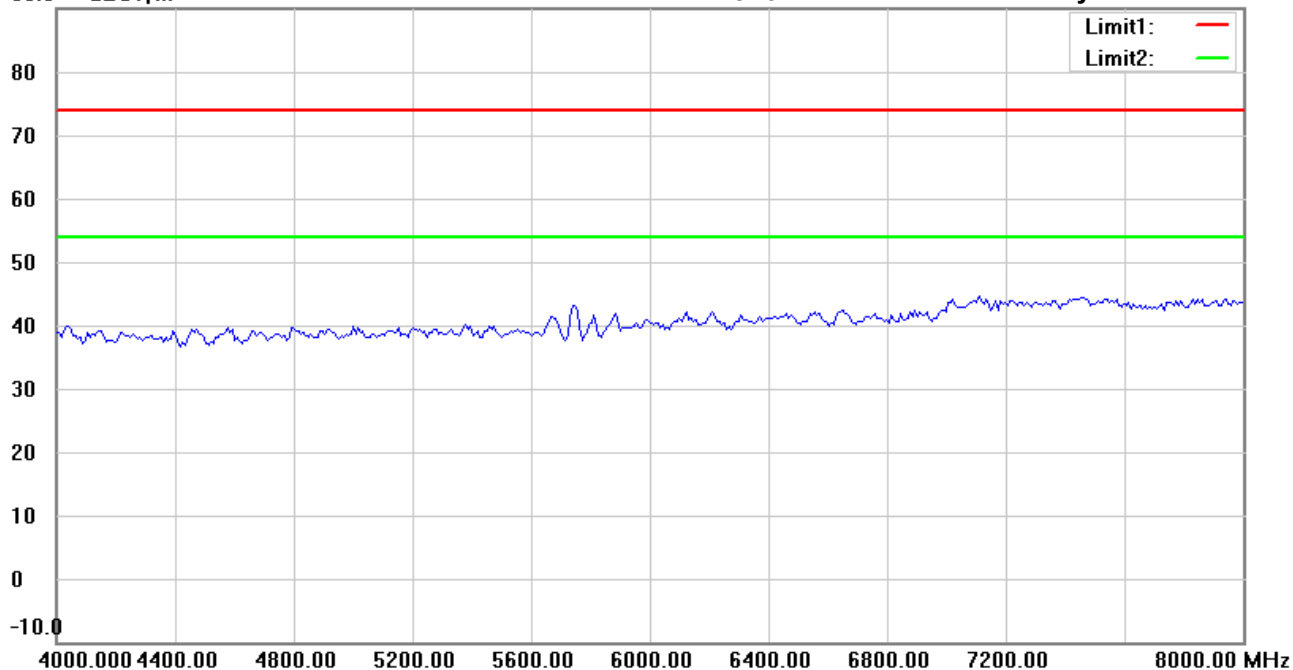

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:09:34 AM

Humidity:64.7 %

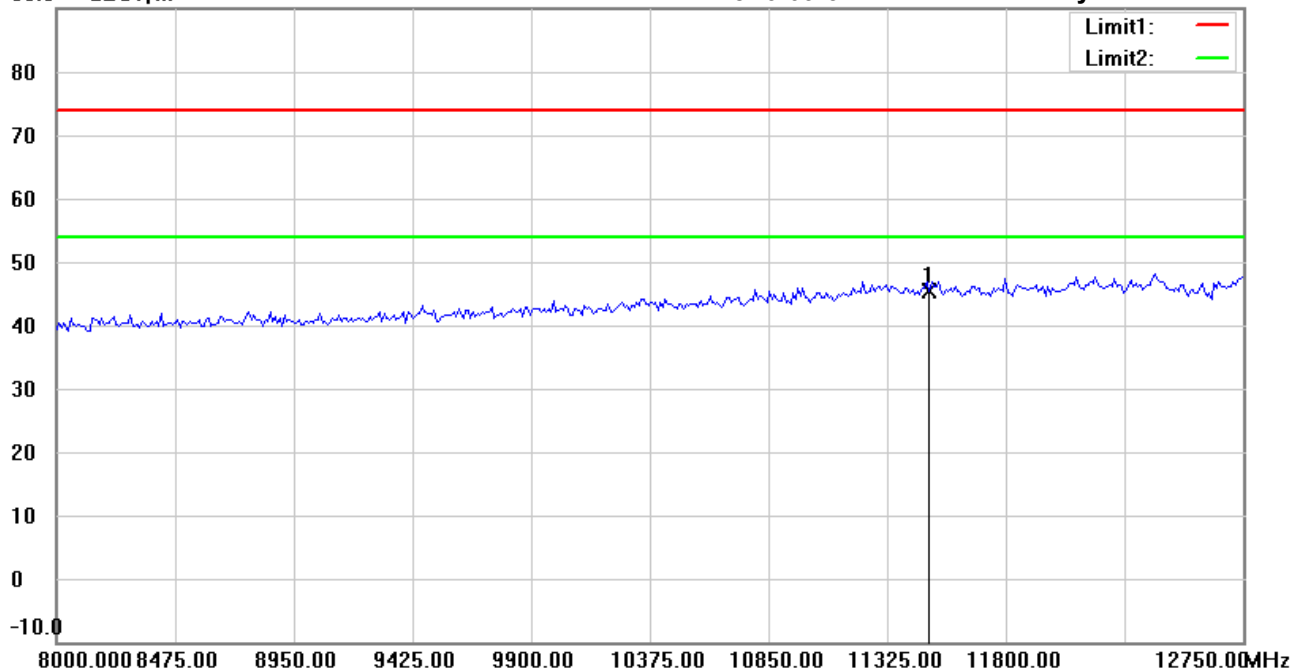

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11490.000	34.11	peak	11.36	45.47	74.00	150	10	-28.53	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:12:23 AM

Humidity: 64.7 %

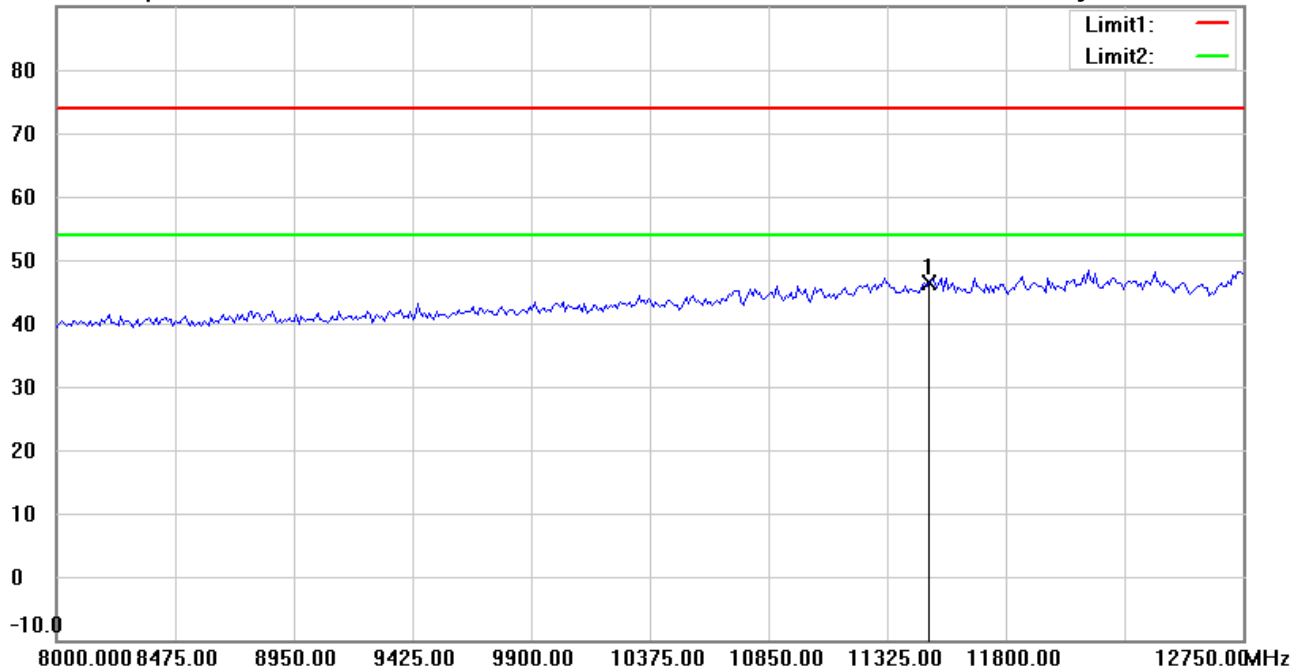

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11490.000	35.04	peak	11.36	46.40	74.00	150	80	-27.60	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:10:43 AM

Humidity: 64.7 %

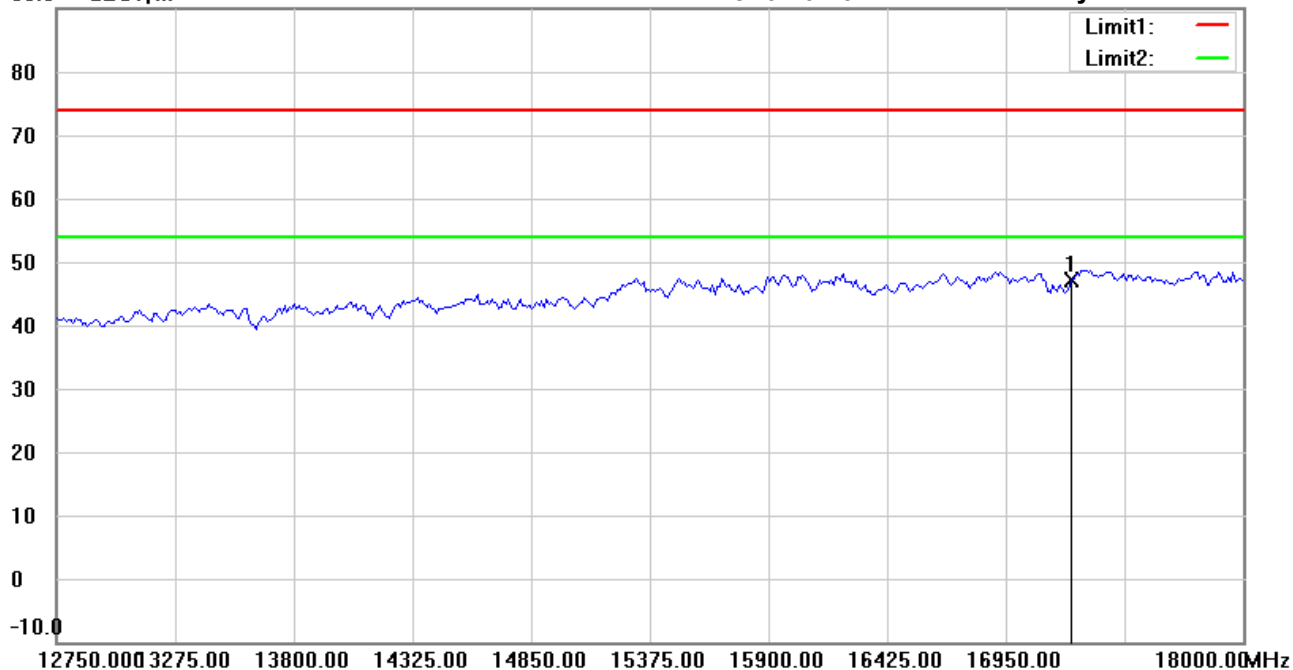

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17235.000	27.85	peak	19.23	47.08	74.00	150	260	-26.92	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:13:32 AM

Humidity: 64.7 %

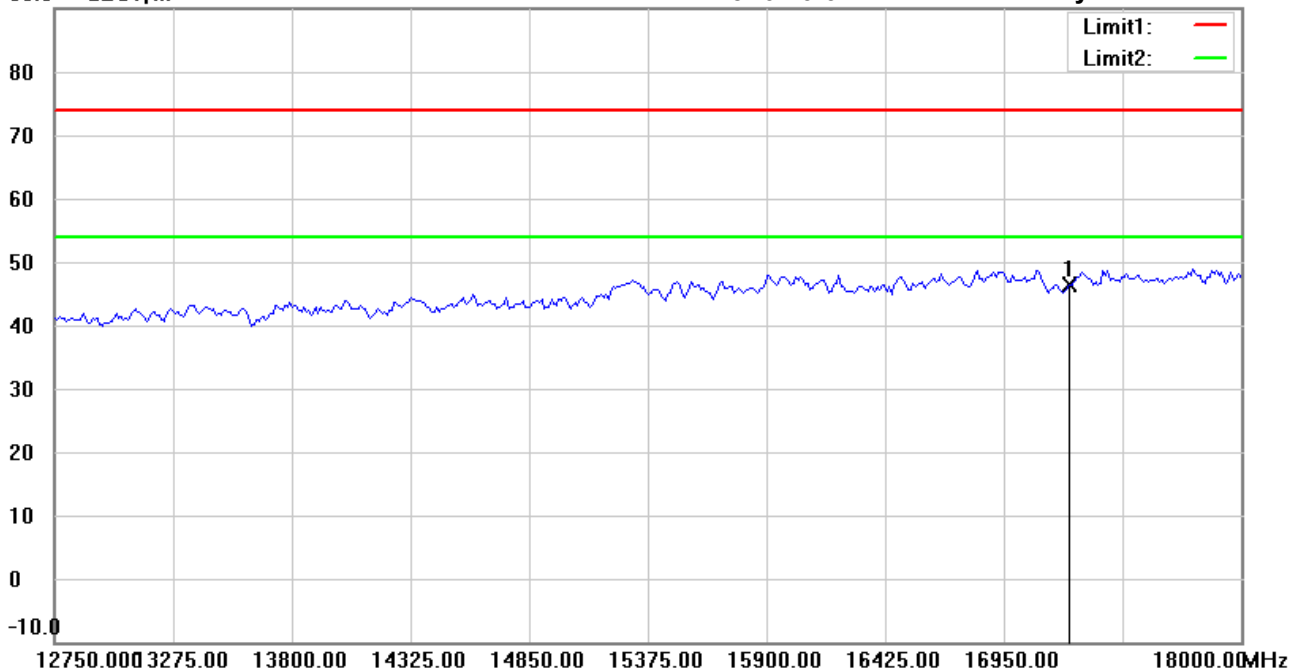

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17235.000	27.21	peak	19.23	46.44	74.00	150	245	-27.56	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #5


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:10:53 AM

Humidity: 64.7 %

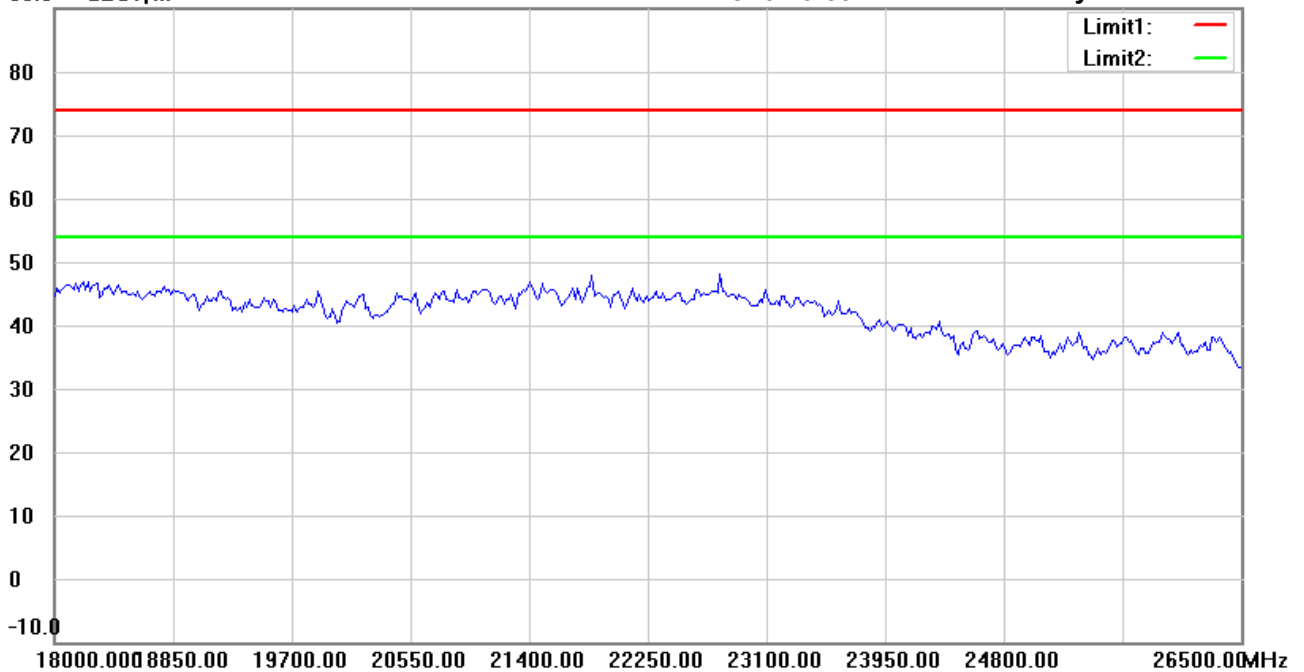

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:13:43 AM

Humidity:64.7 %

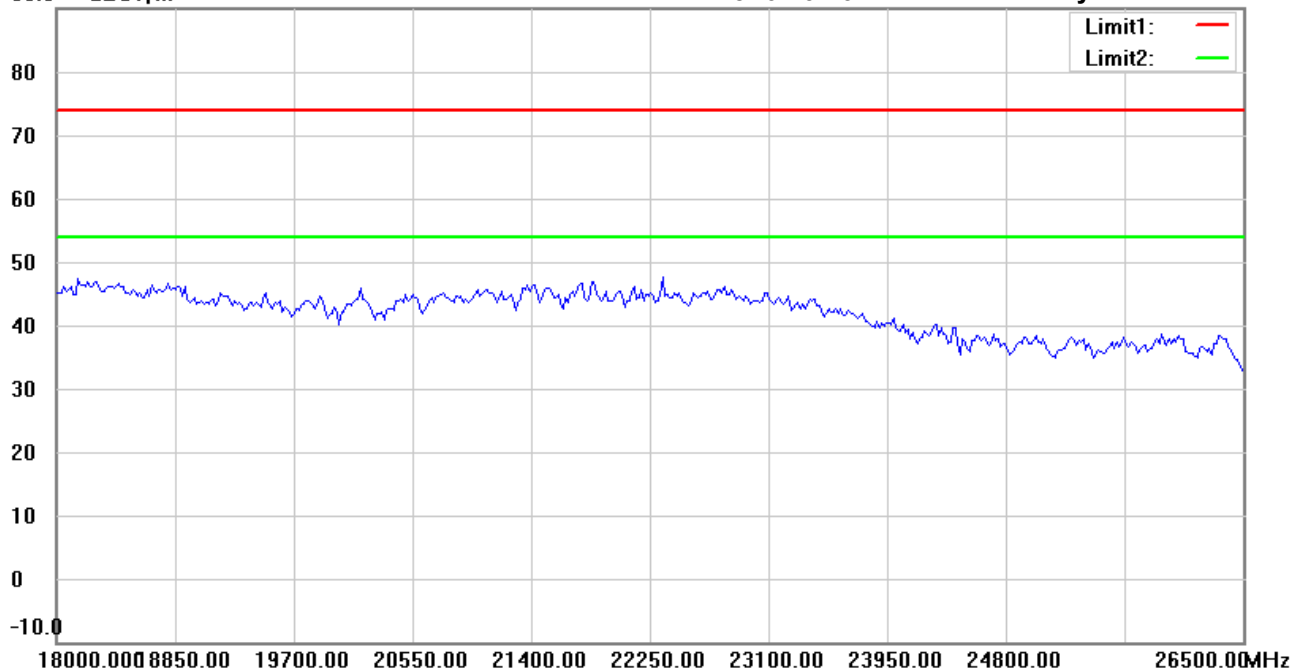

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:11:04 AM

Humidity: 64.7 %

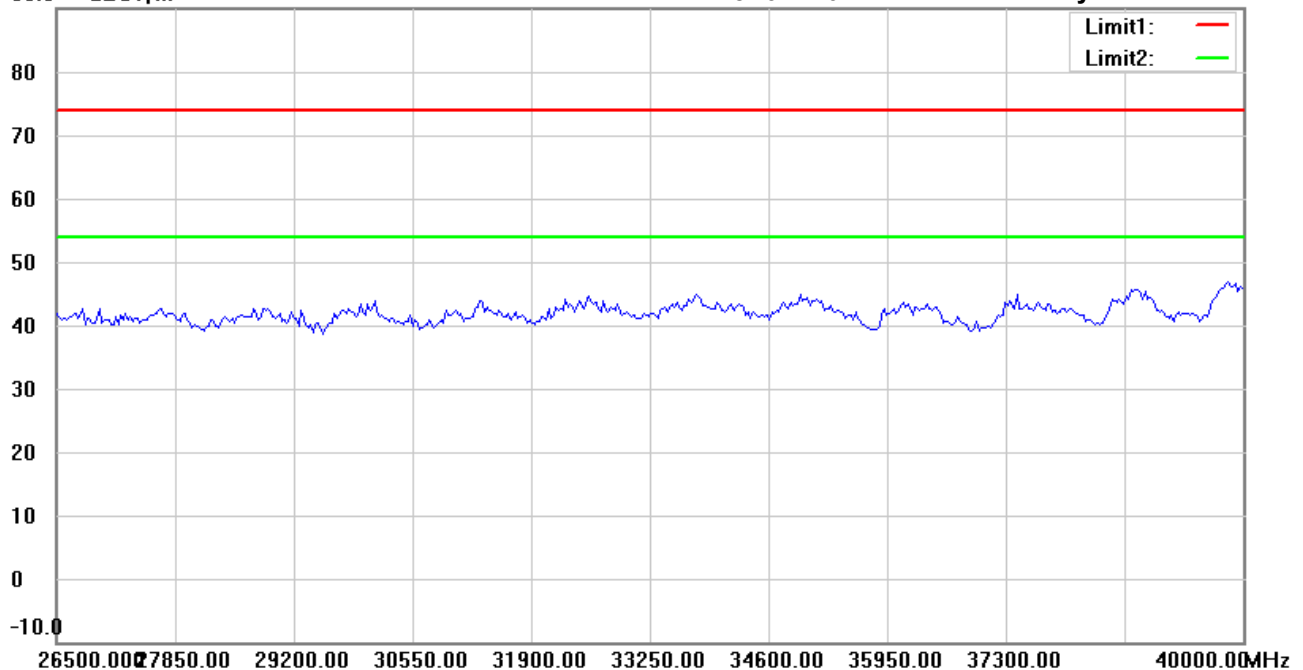

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:13:54 AM

Humidity: 64.7 %

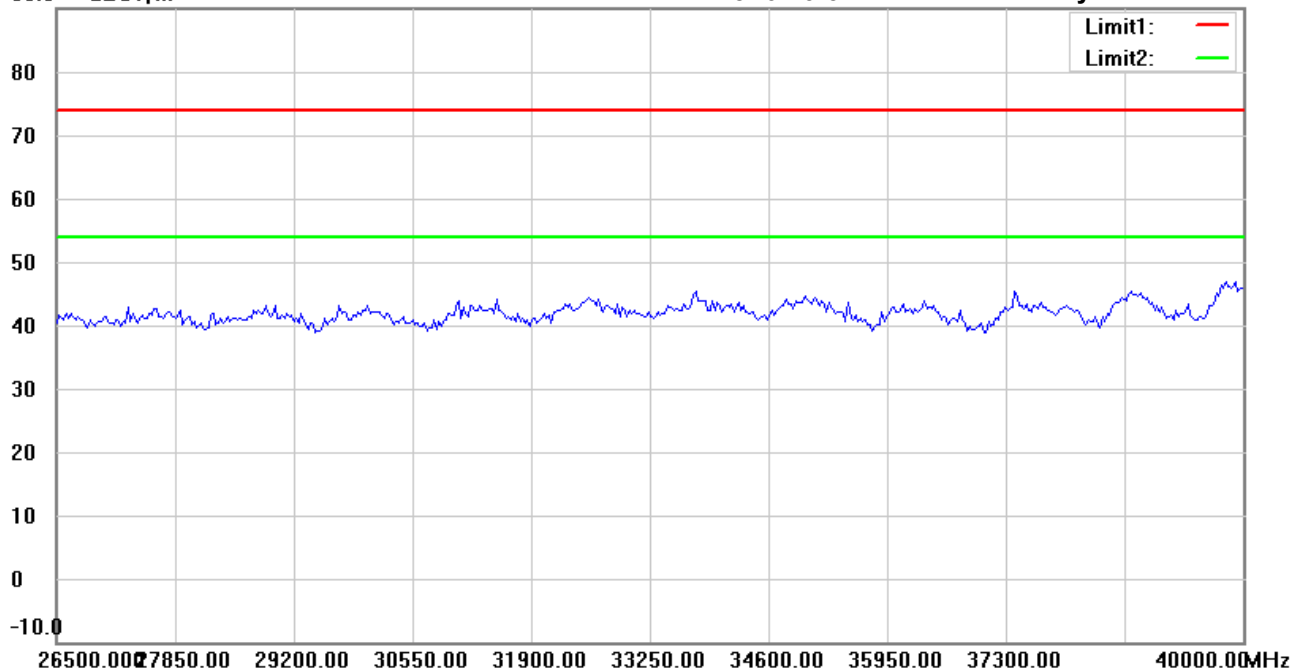

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:16:50 AM

Humidity:64.7 %

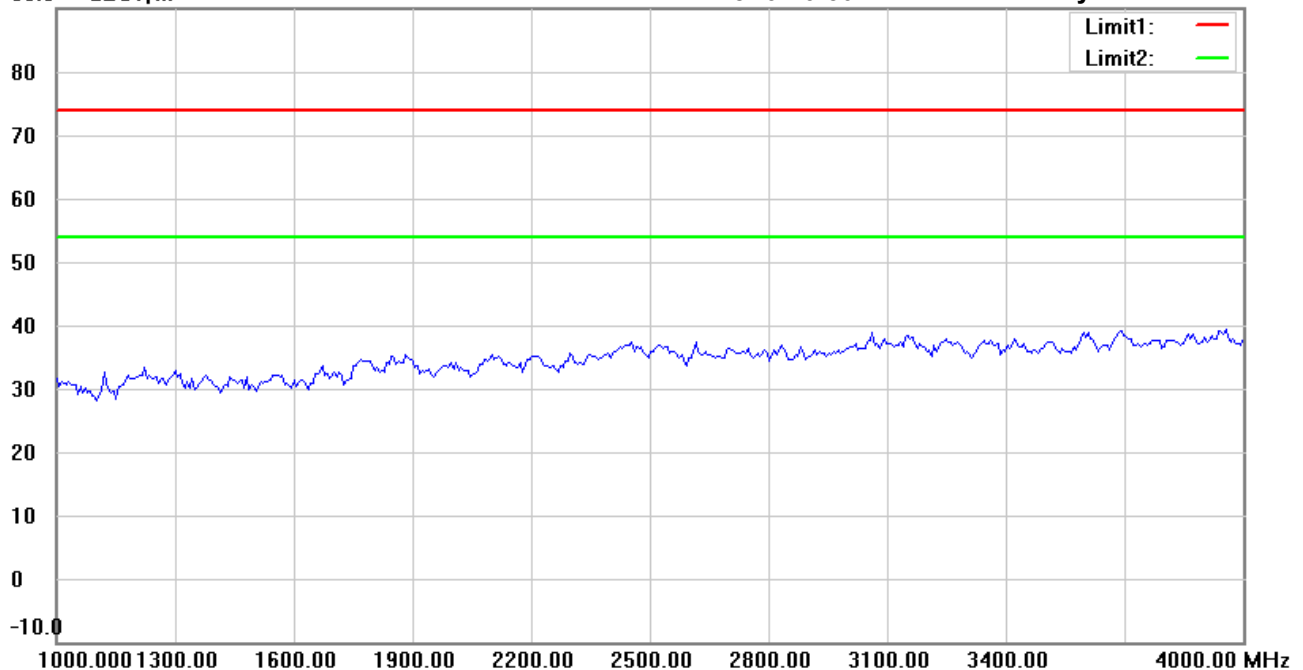

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:19:41 AM

Humidity:64.7 %

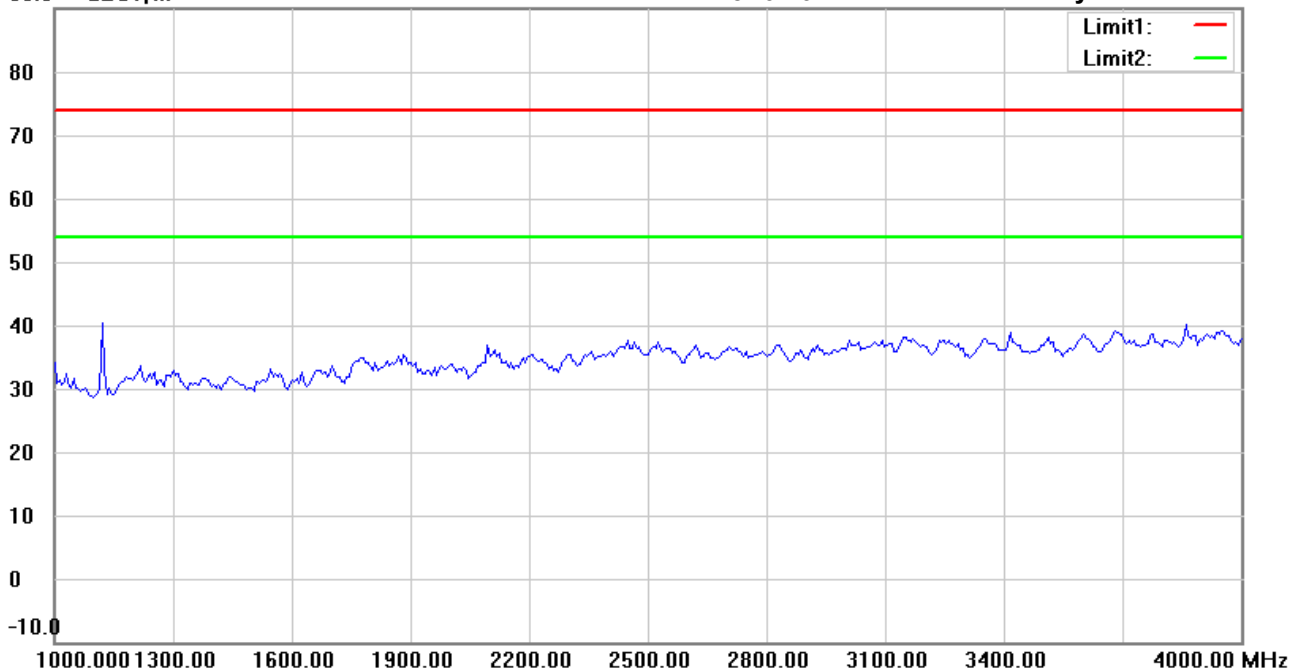

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:16:59 AM

Humidity: 64.7 %

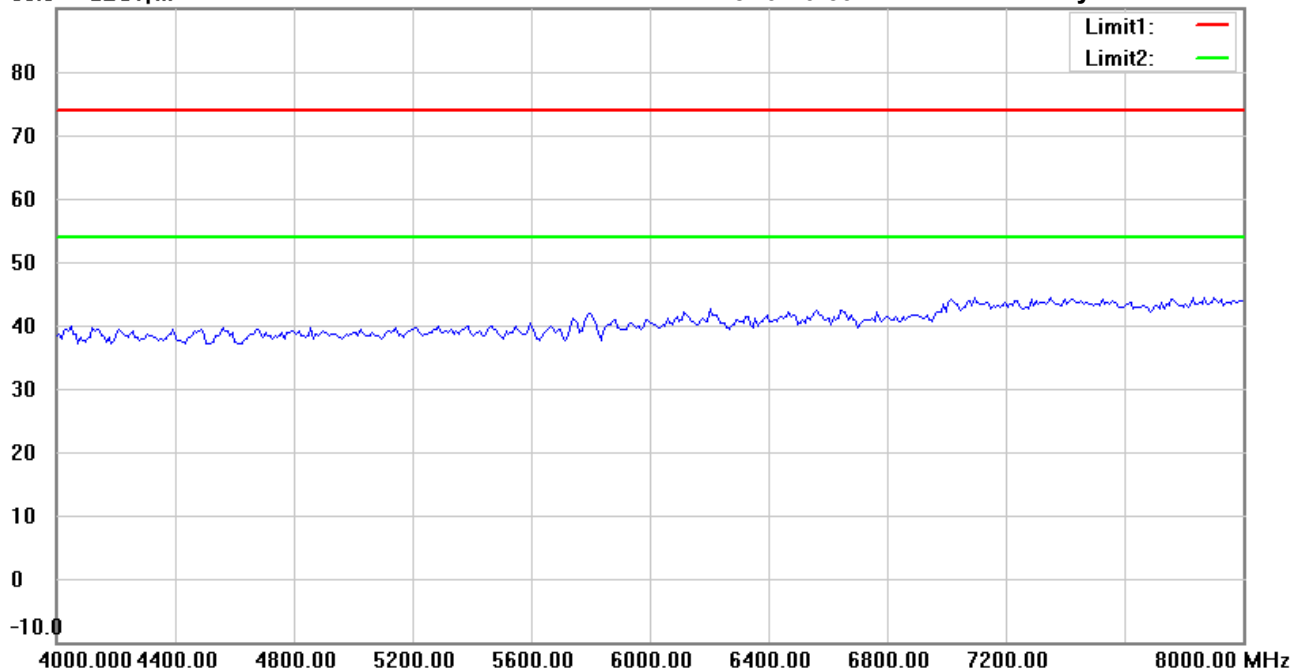

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:19:49 AM

Humidity:64.7 %

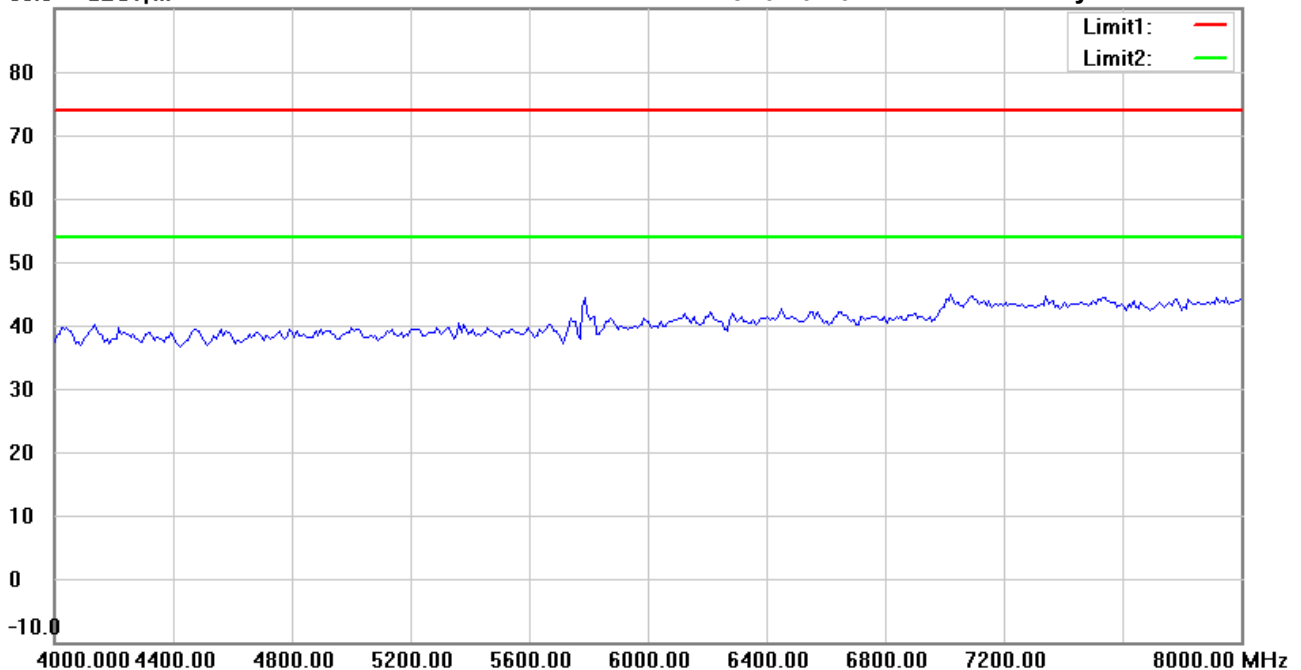

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:18:01 AM

Humidity: 64.7 %

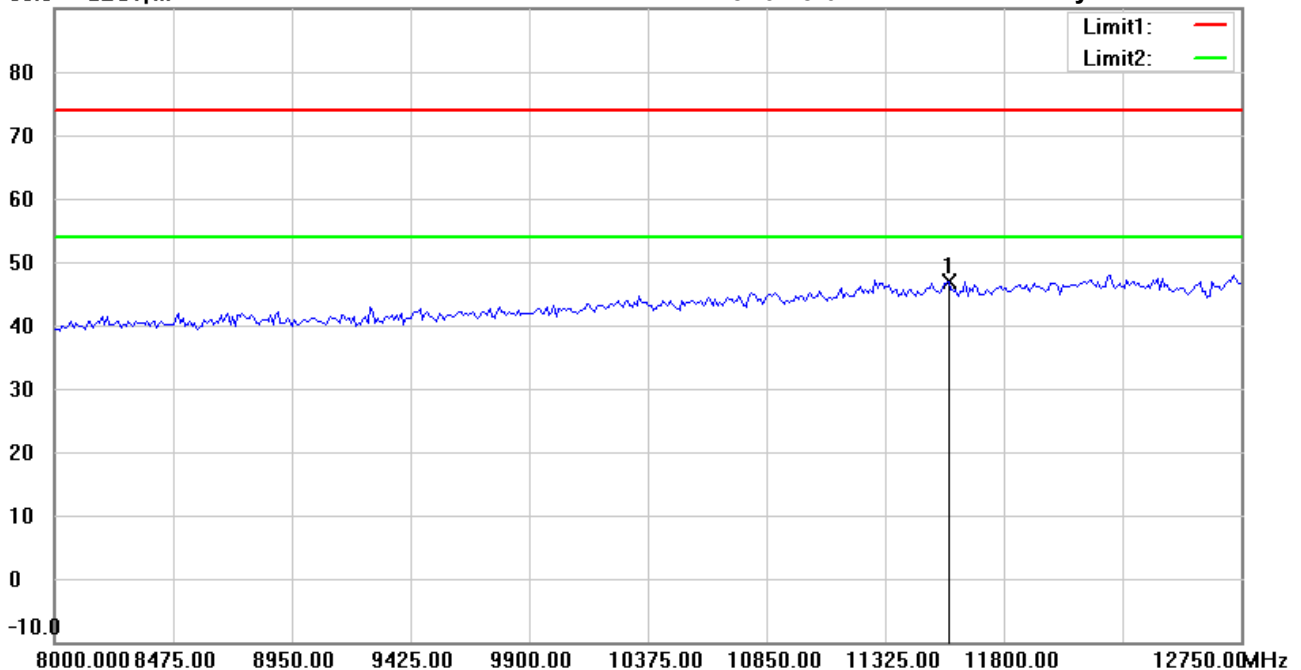

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	35.76	peak	11.12	46.88	74.00	150	300	-27.12	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:20:51 AM

Humidity: 64.7 %

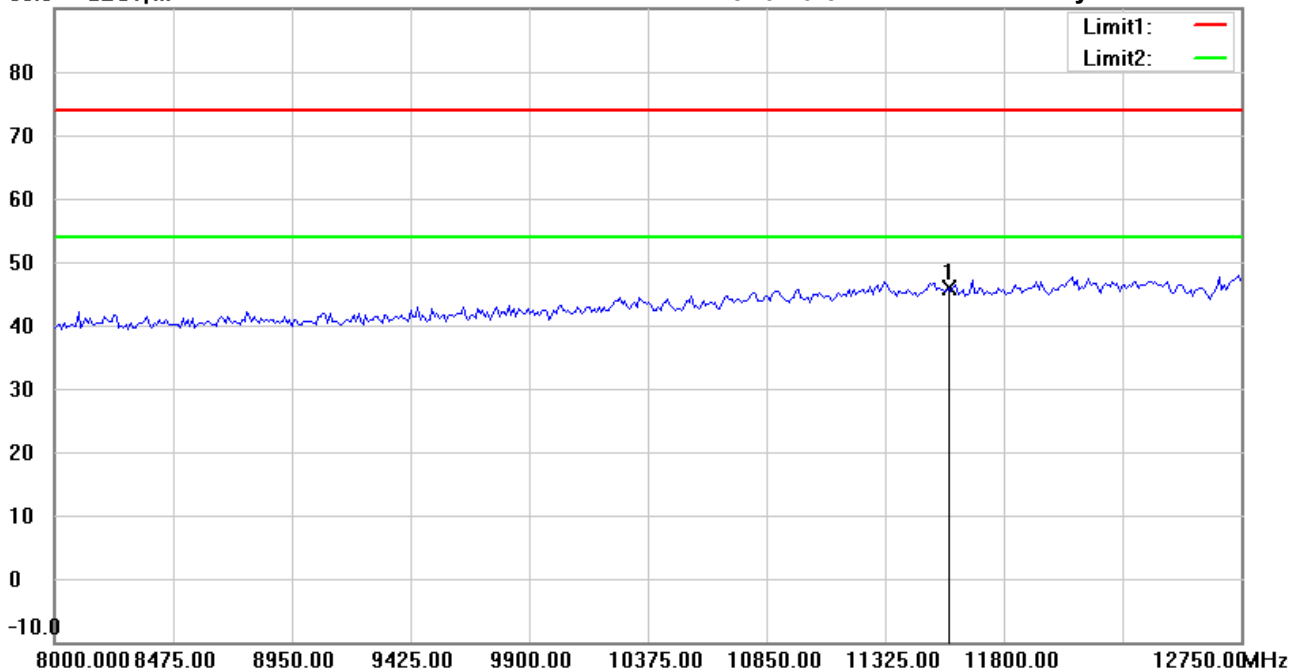

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	34.80	peak	11.12	45.92	74.00	150	250	-28.08	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:19:10 AM

Humidity: 64.7 %

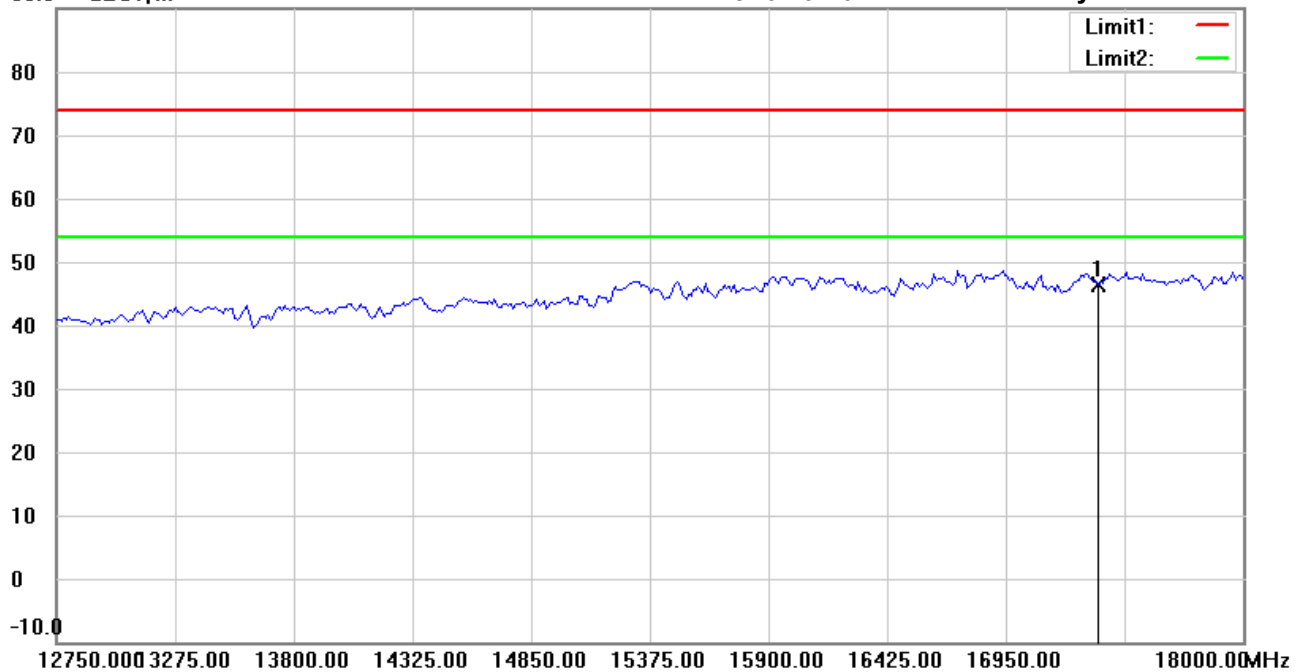

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	26.01	peak	20.45	46.46	74.00	150	185	-27.54	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:22:00 AM

Humidity:64.7 %

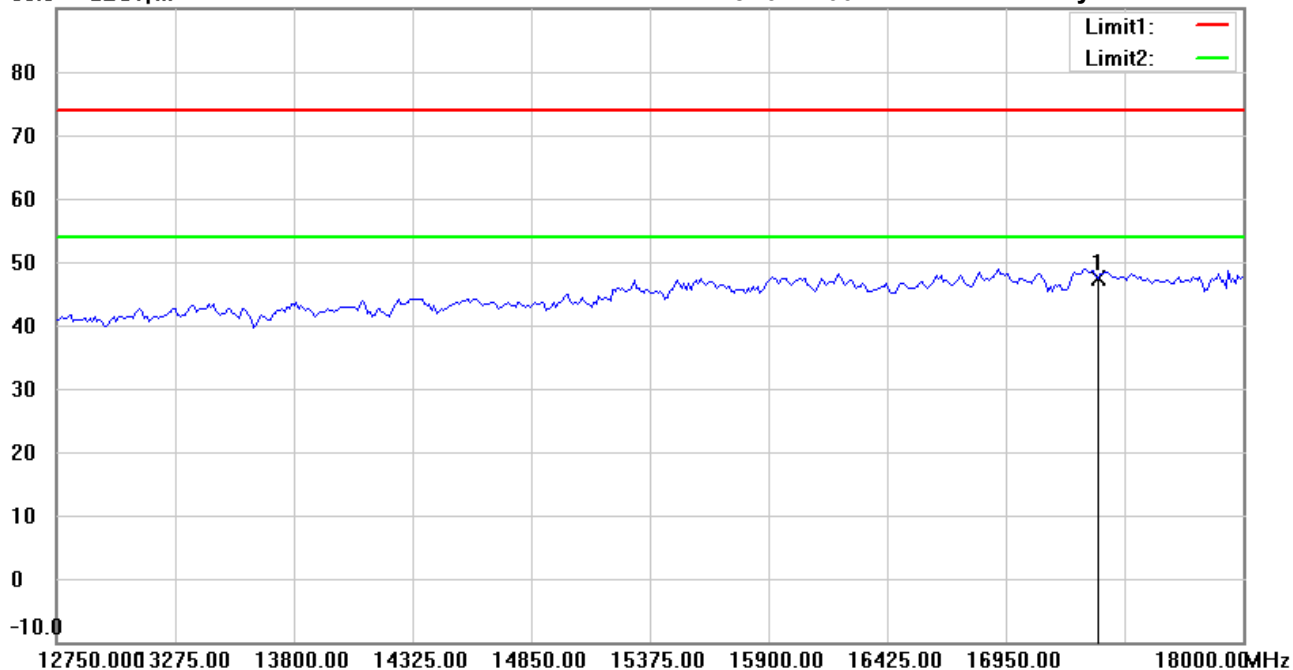

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	26.90	peak	20.45	47.35	74.00	150	5	-26.65	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:19:21 AM

Humidity:64.7 %

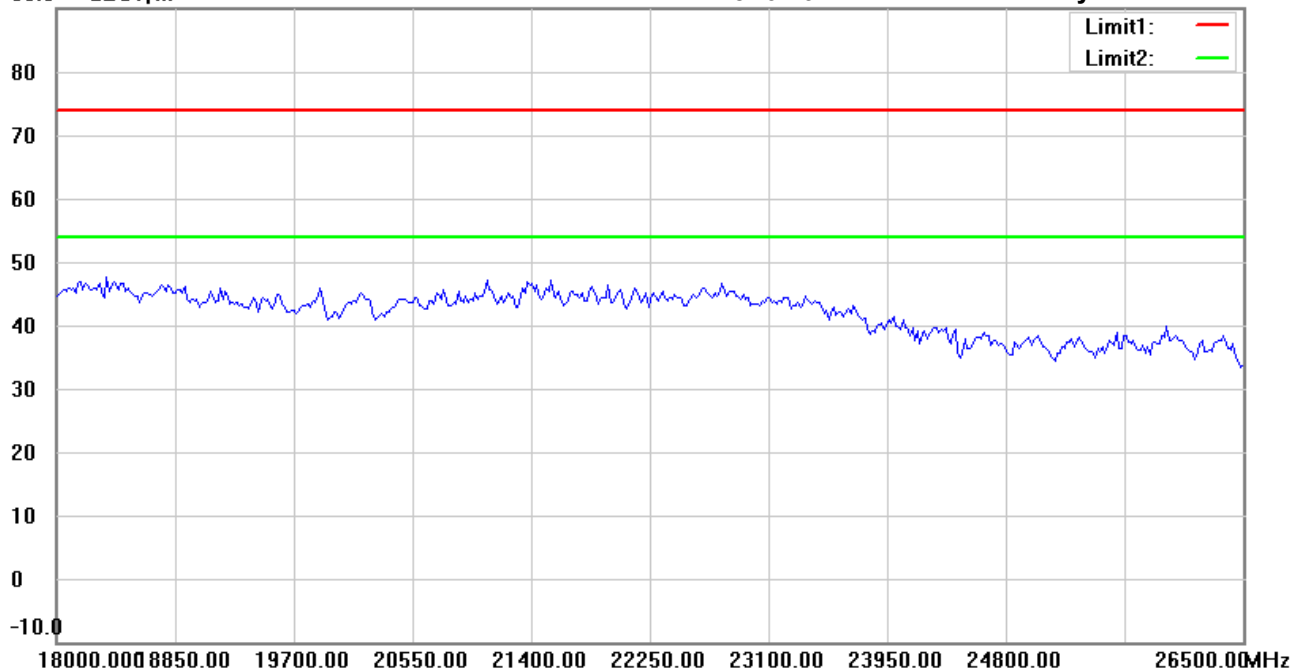

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:22:10 AM

Humidity:64.7 %

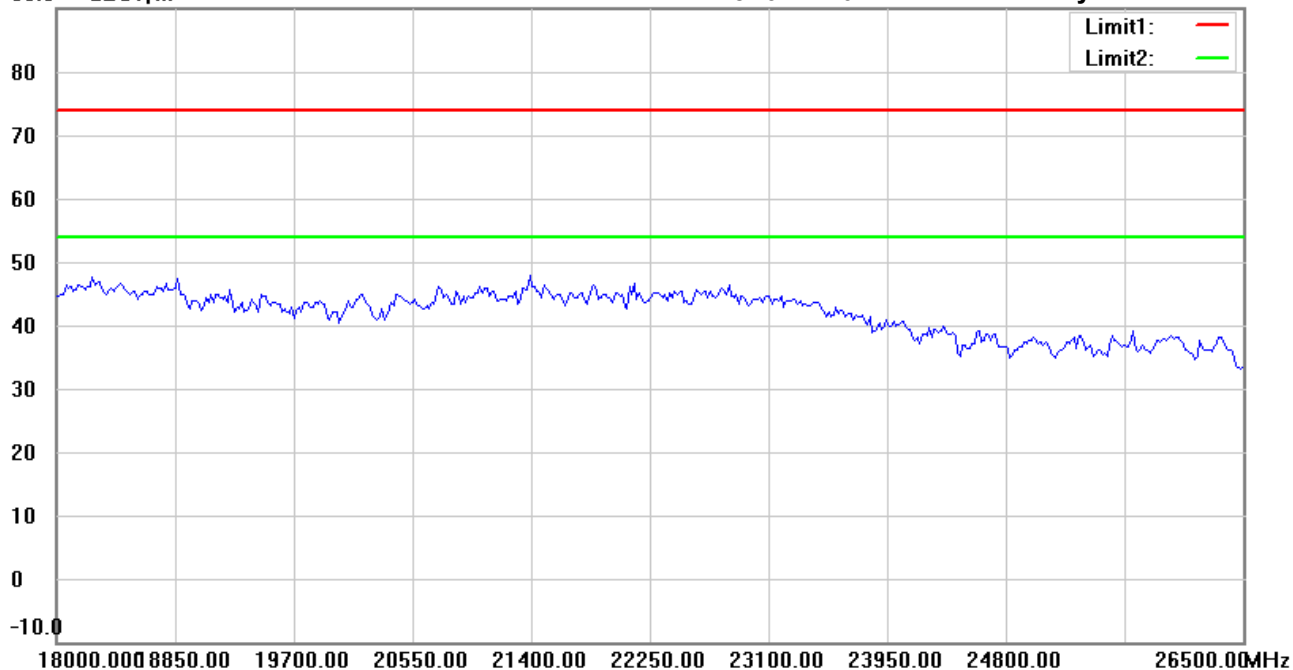

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:19:32 AM

Humidity: 64.7 %

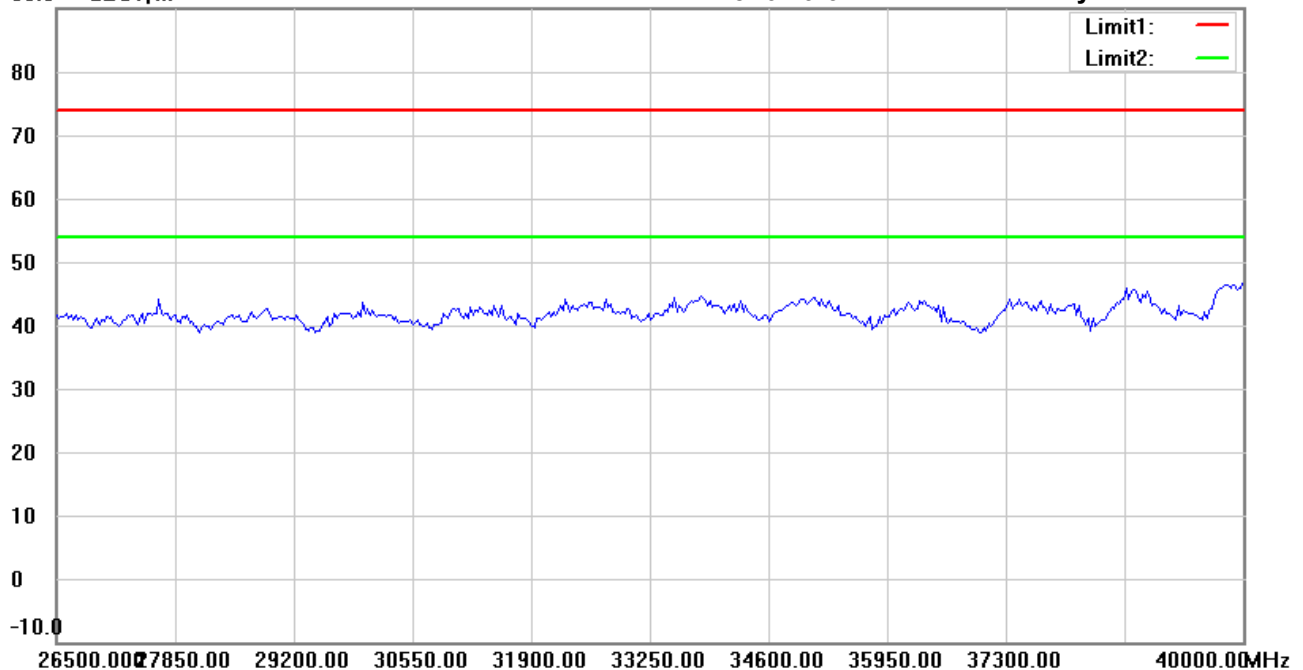

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:22:21 AM

Humidity: 64.7 %

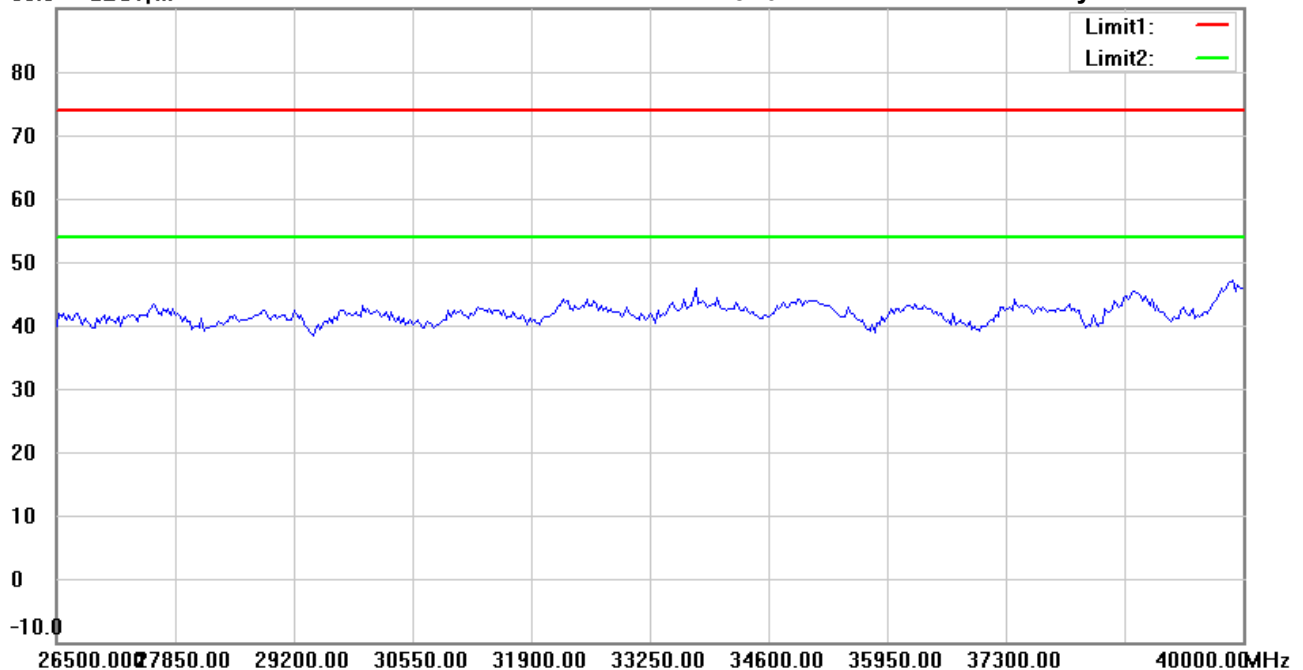

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:24:22 AM

Humidity:64.7 %

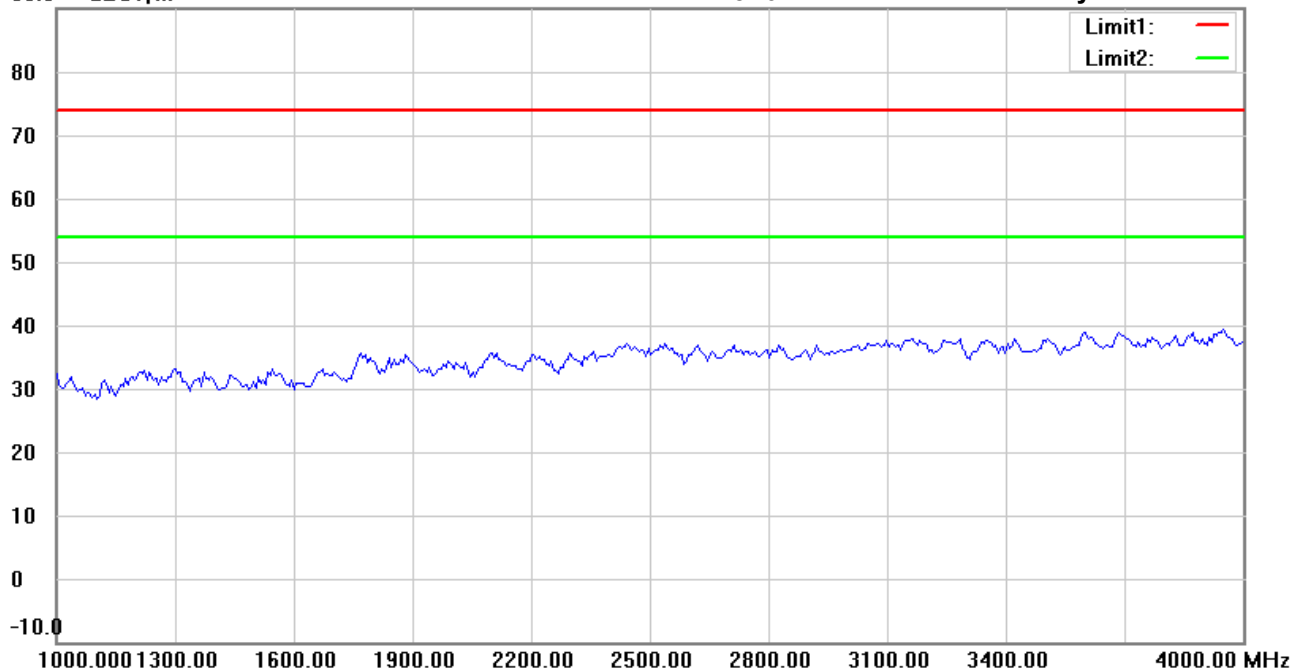

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:28:23 AM

Humidity:64.7 %

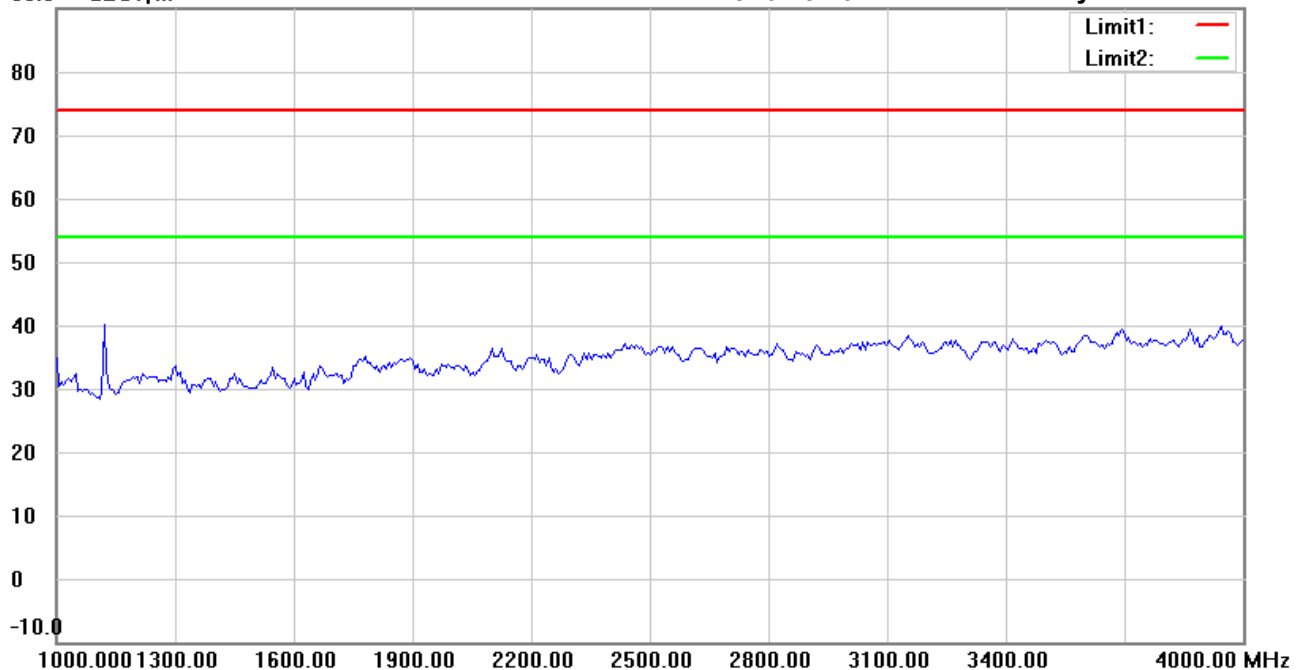

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:24:30 AM

Humidity: 64.7 %

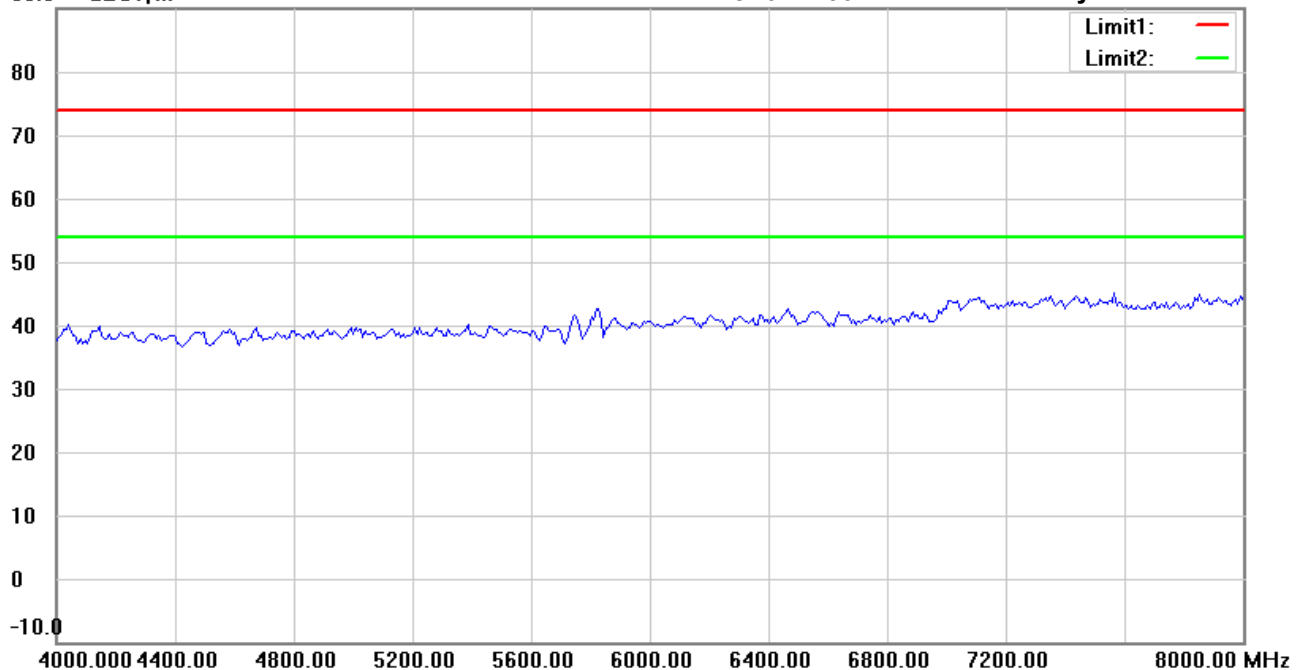

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:28:31 AM

Humidity: 64.7 %

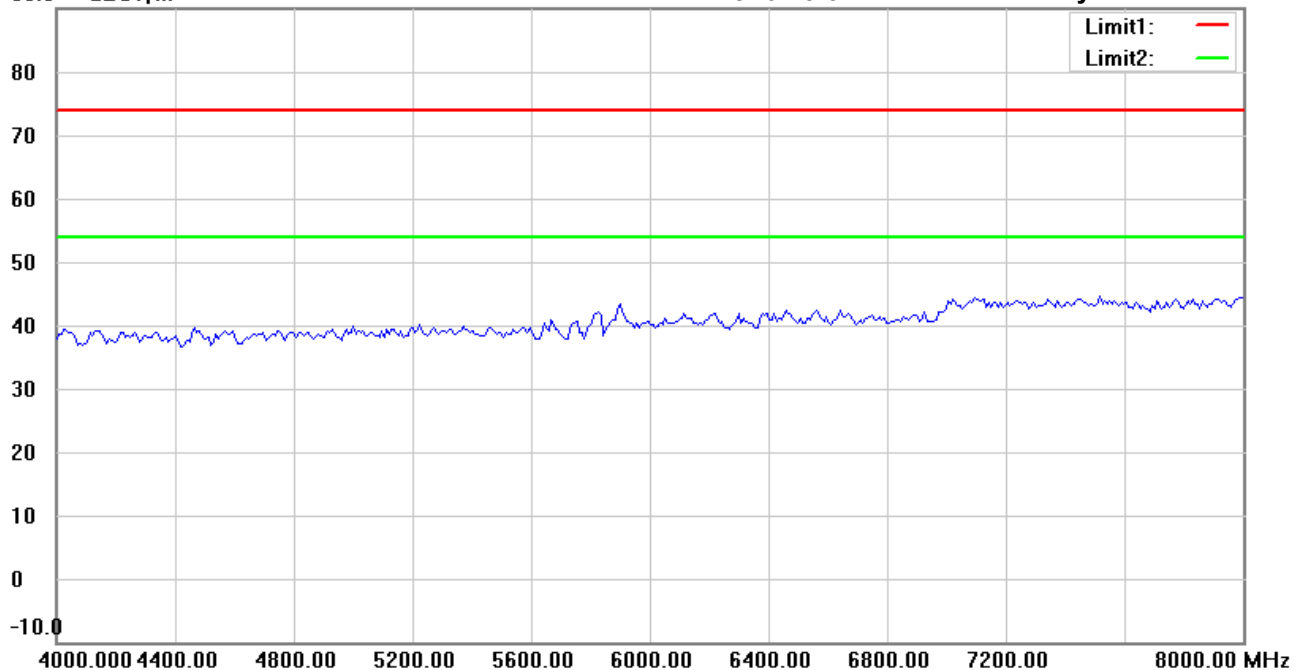

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:25:32 AM

Humidity: 64.7 %

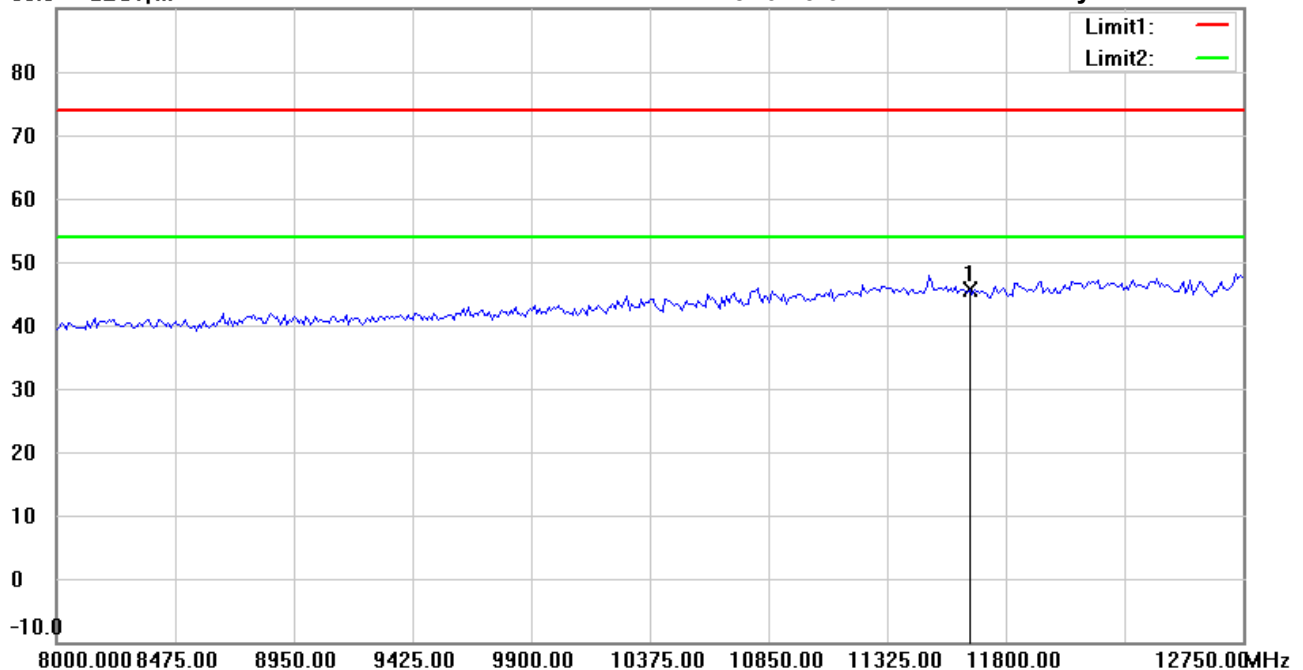

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	34.74	peak	10.97	45.71	74.00	150	55	-28.29	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:29:33 AM

Humidity: 64.7 %

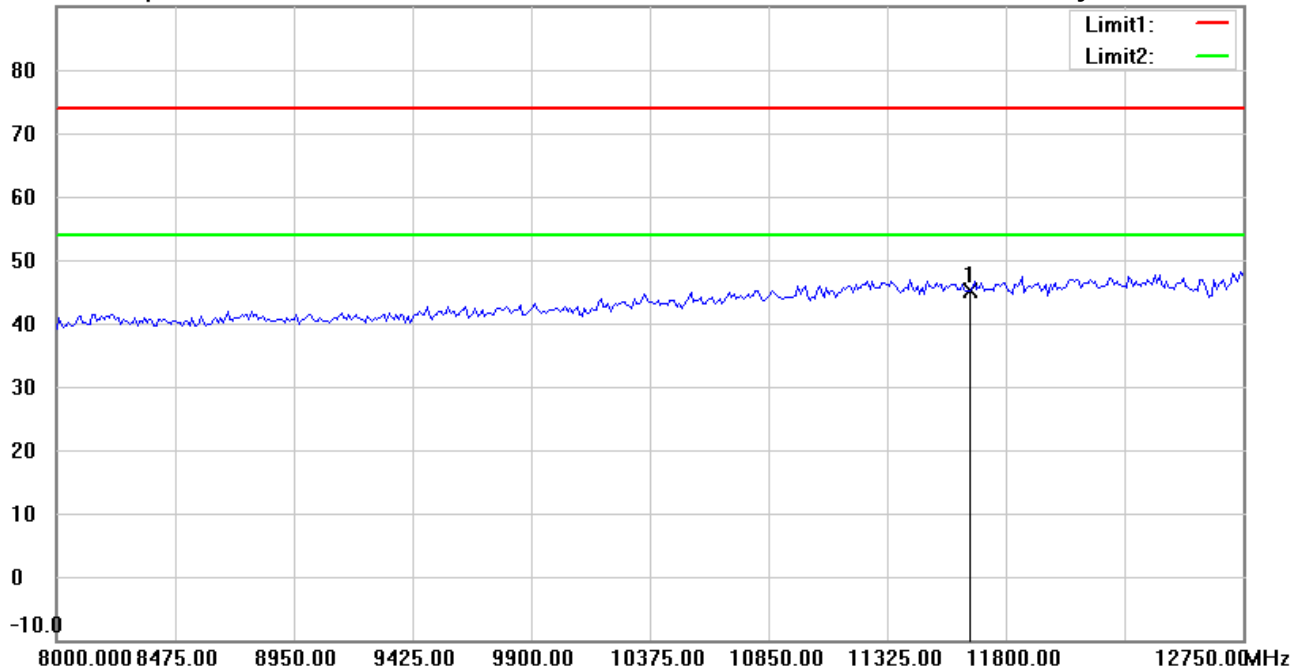

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	34.20	peak	10.97	45.17	74.00	150	340	-28.83	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:26:41 AM

Humidity: 64.7 %

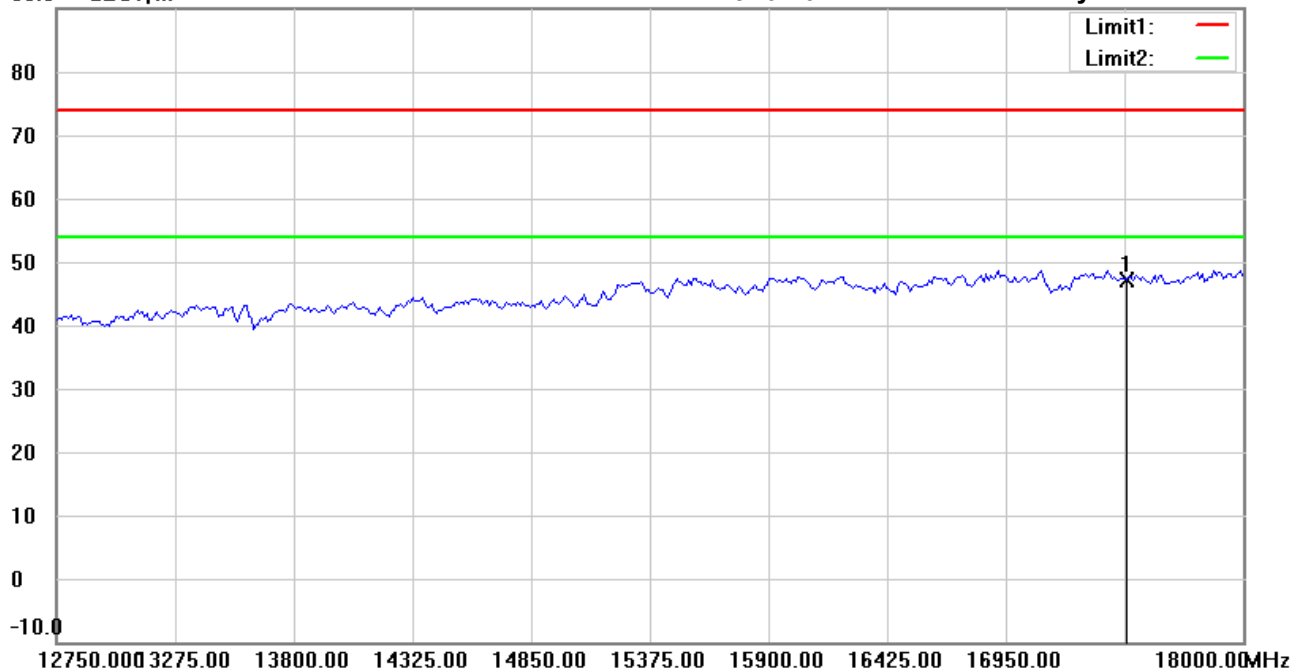

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	26.87	peak	20.33	47.20	74.00	150	360	-26.80	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:30:42 AM

Humidity: 64.7 %

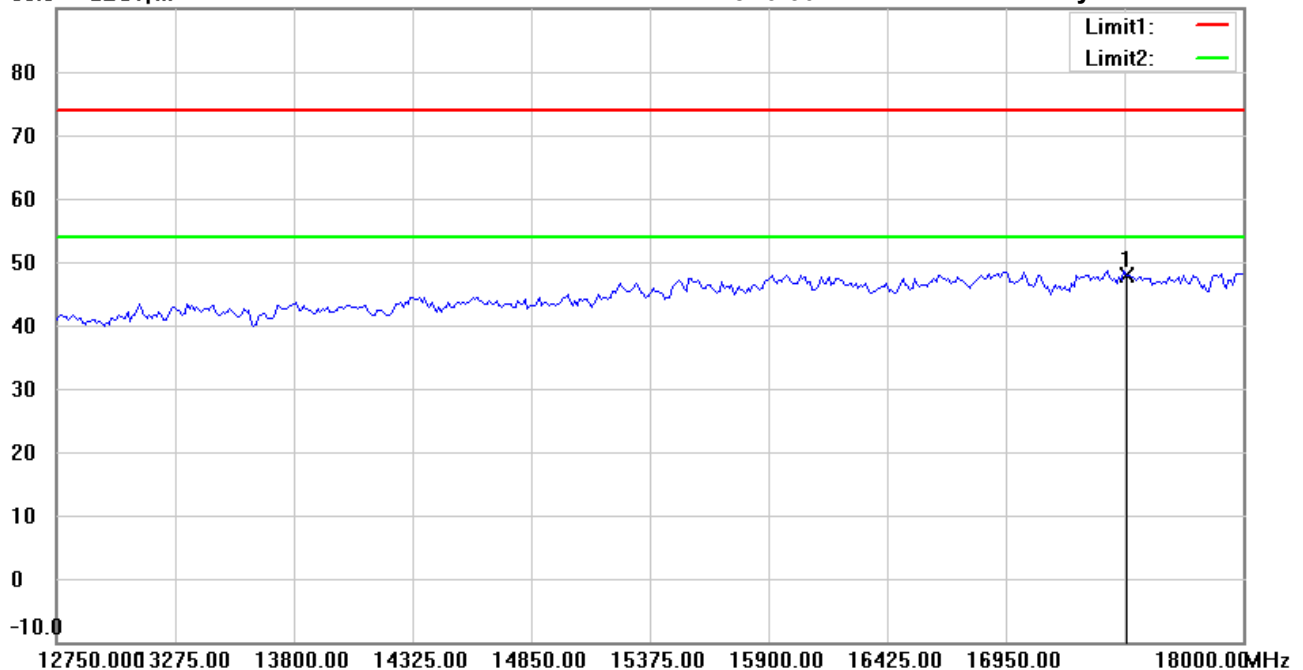

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	27.44	peak	20.33	47.77	74.00	150	135	-26.23	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #5


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:26:52 AM

Humidity: 64.7 %

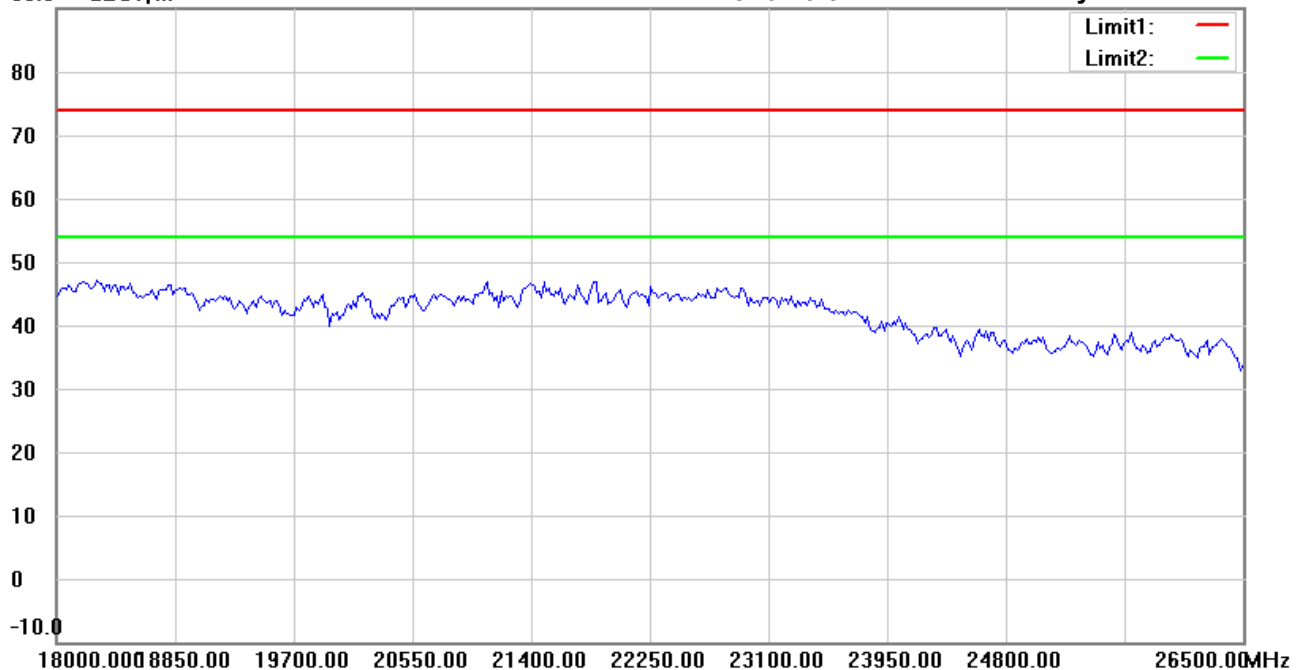

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:30:52 AM

Humidity:64.7 %

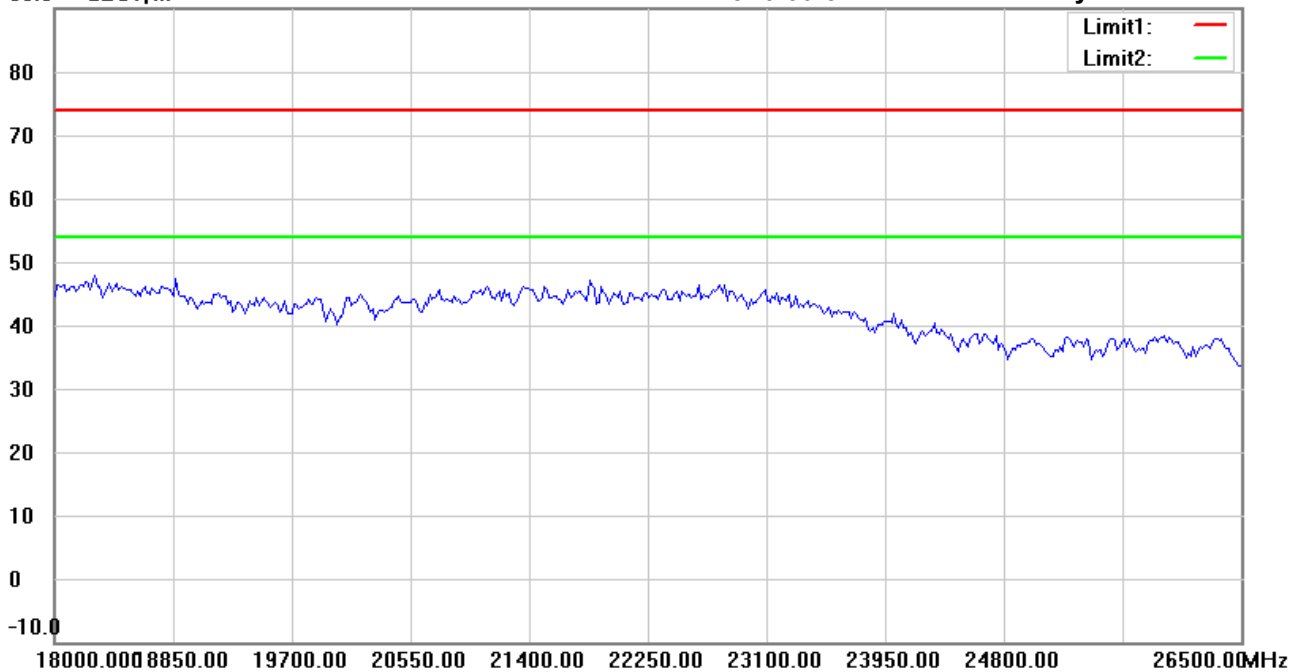

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:27:03 AM

Humidity: 64.7 %

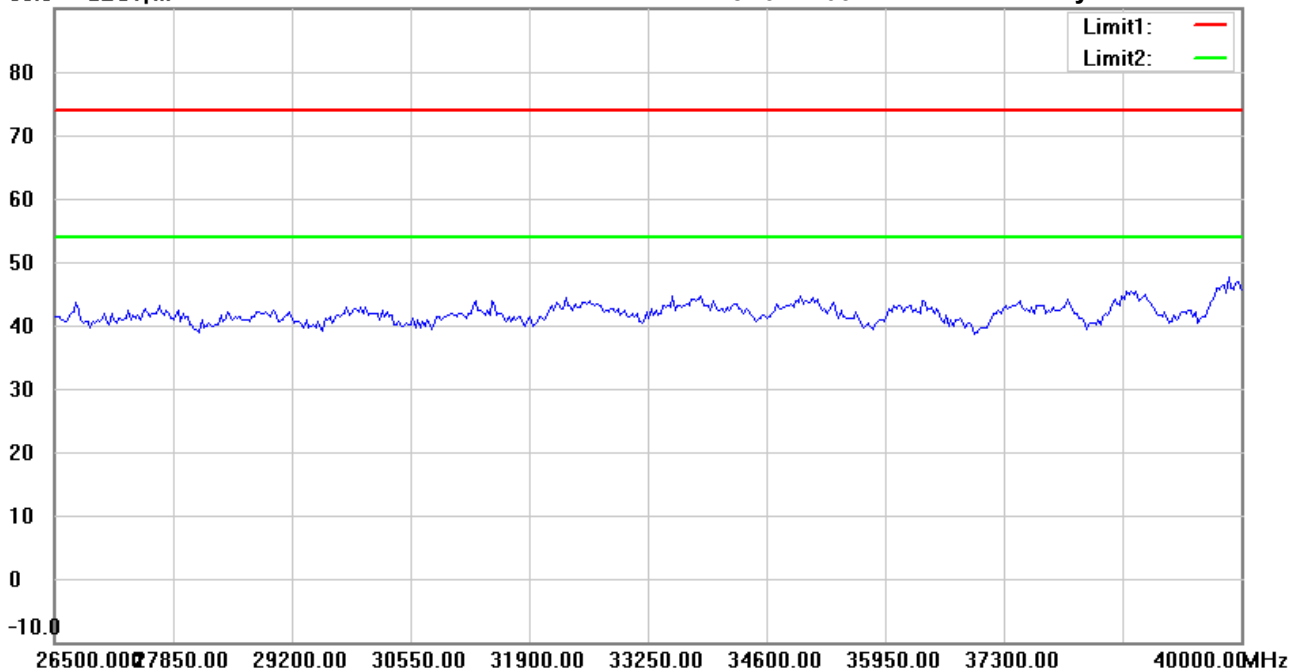

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:31:03 AM

Humidity:64.7 %

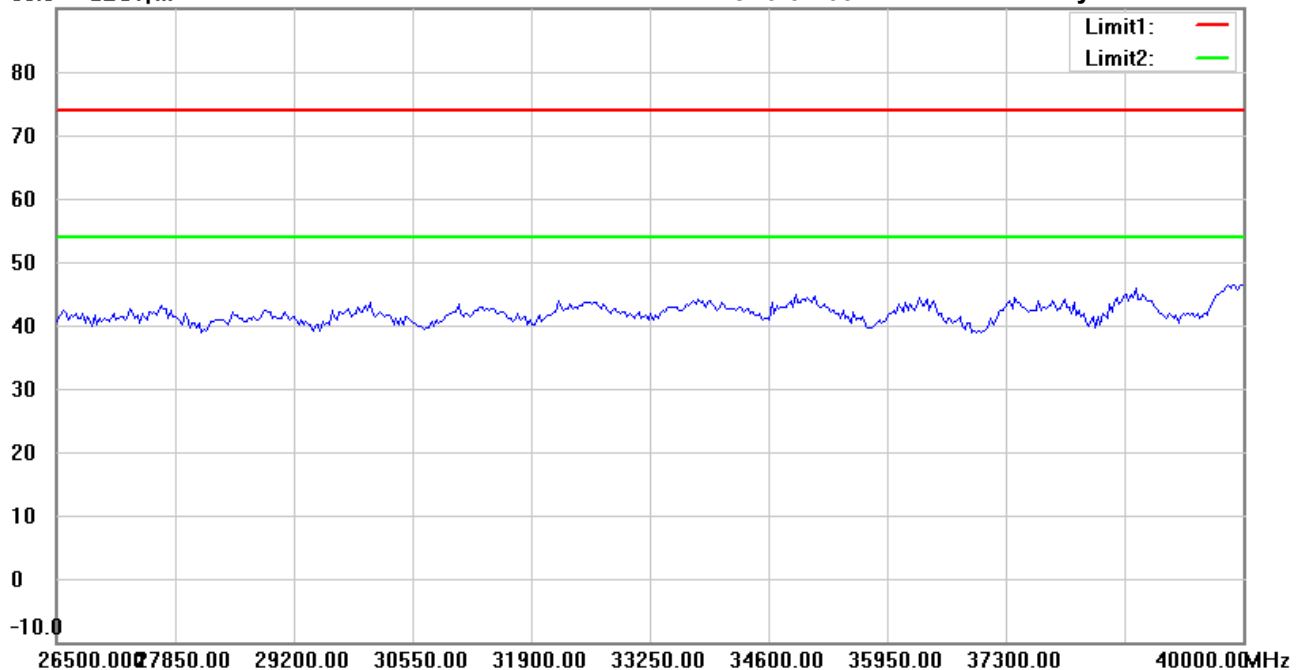

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File : 1_ANT4_TX 802

Data : #1


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:46:56 PM

Humidity: 72.8 %

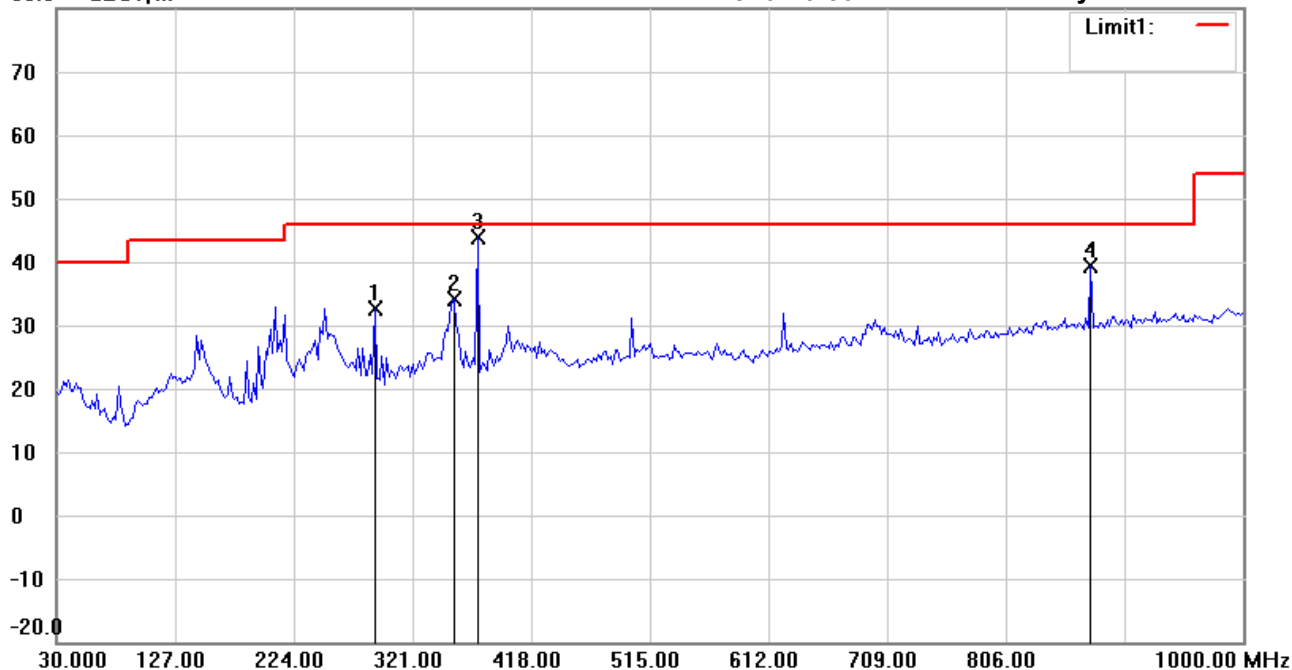

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

Polarization: *Horizontal*

EUT : W6M21903-18922

Power : 48 Vd.c.

M/N:

Distance: 3m

Test Mode : TX 802.11a CH36

Note :

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	290.4810	39.09	peak	-6.41	32.68	46.00	100	150	-13.32	
	354.6293	39.12	peak	-5.08	34.04	46.00	100	245	-11.96	
*	374.0681	48.38	peak	-4.50	43.88	46.00	100	195	-2.12	
	875.5912	36.36	peak	2.93	39.29	46.00	100	70	-6.71	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File : 1_ANT4_TX 802

Data : #2


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:48:41 PM

Humidity: 72.8 %

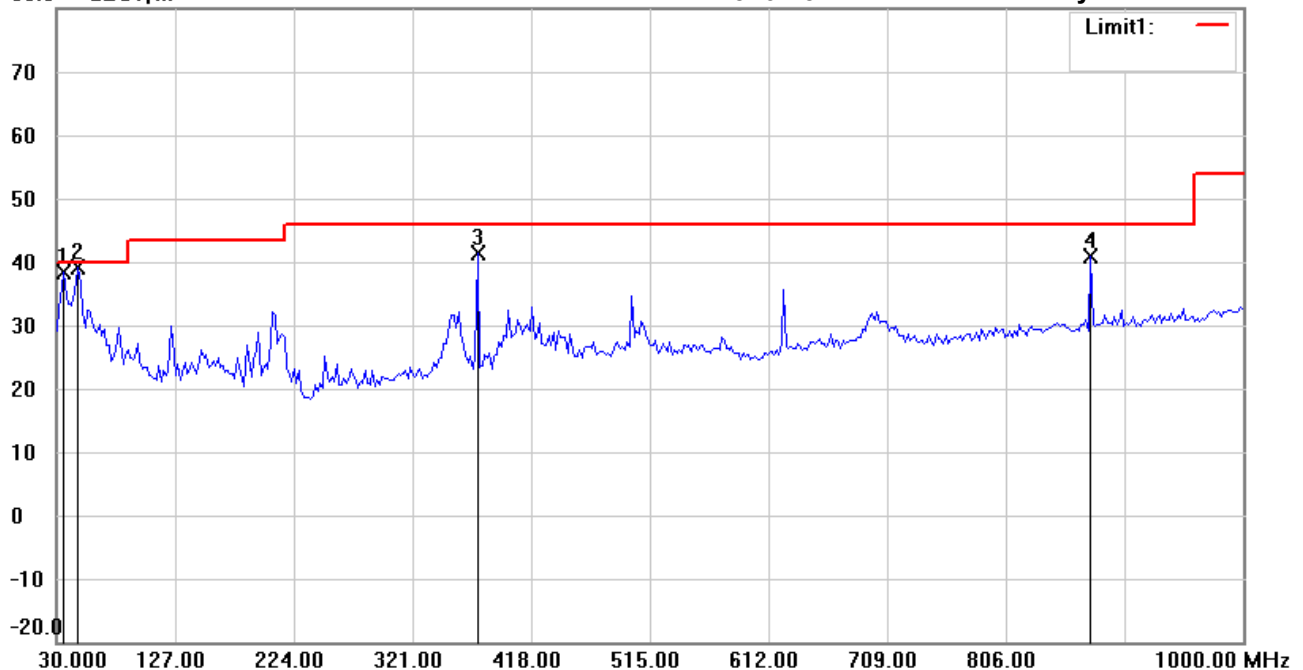

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	35.8316	47.37	peak	-8.95	38.42	40.00	100	55	-1.58	
*	47.4950	48.99	peak	-9.91	39.08	40.00	100	30	-0.92	
	374.0681	45.97	peak	-4.50	41.47	46.00	100	80	-4.53	
	875.5912	37.83	peak	2.93	40.76	46.00	100	160	-5.24	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:56:59 AM

Humidity: 61.7 %

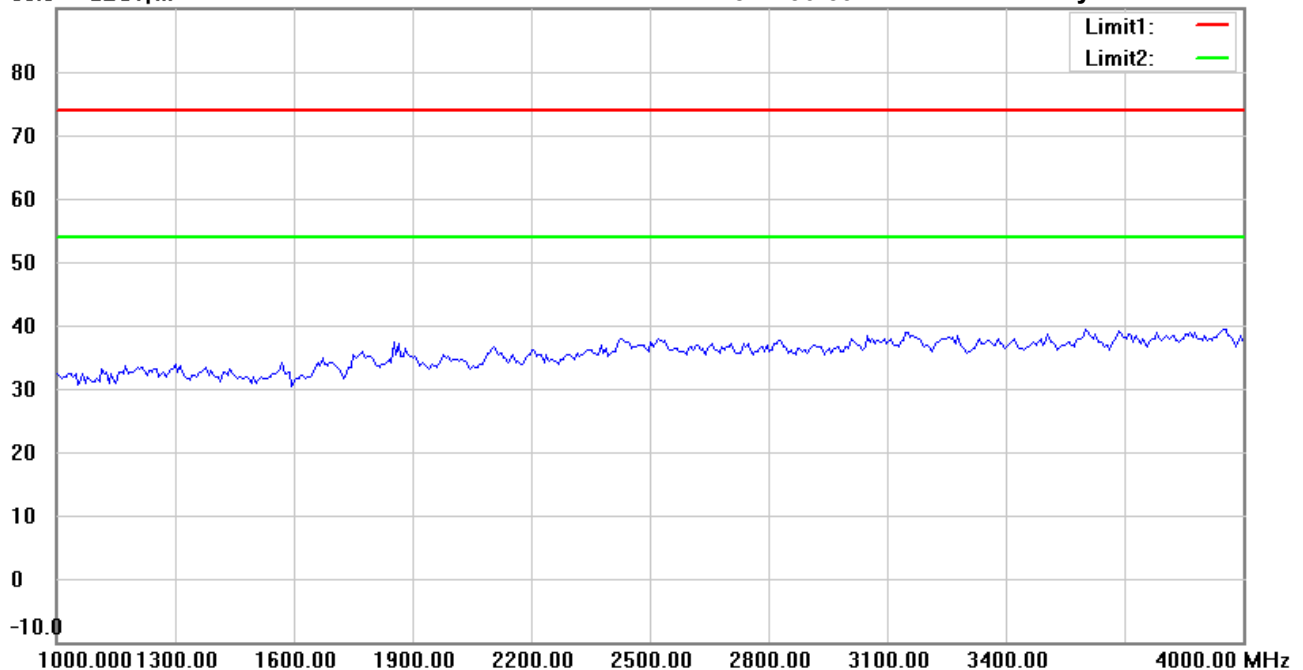

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:59:57 AM

Humidity: 61.7 %

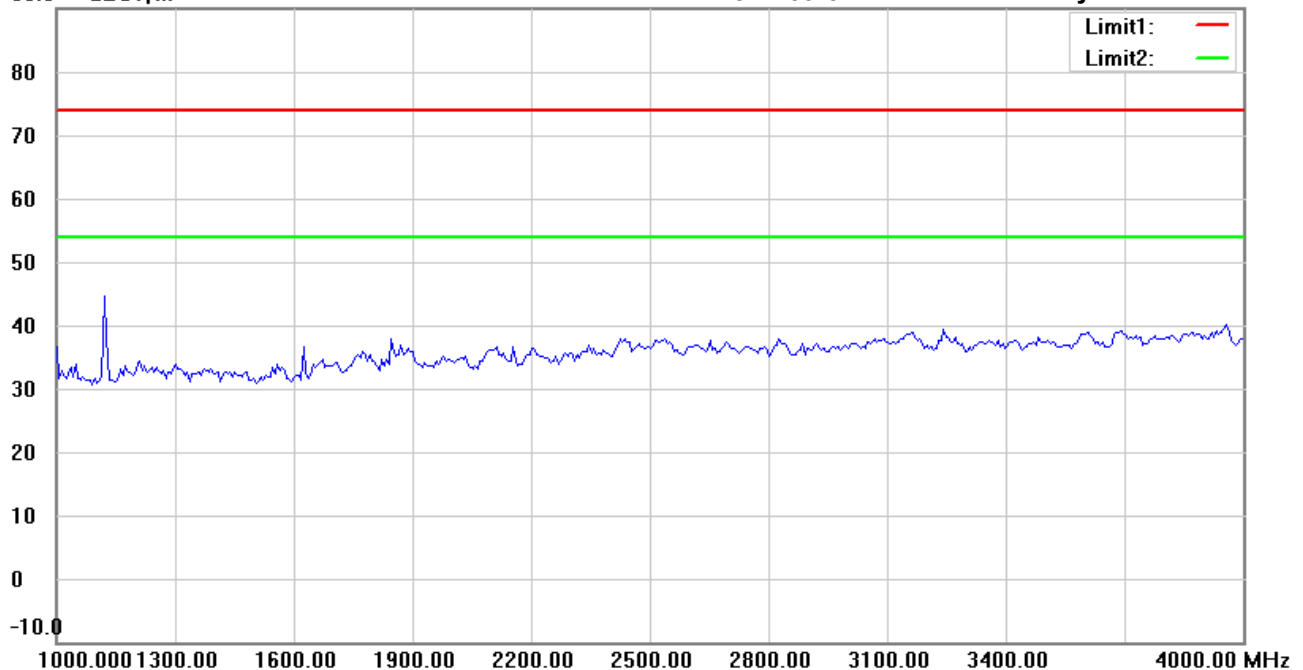

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:57:06 AM

Humidity: 61.7 %

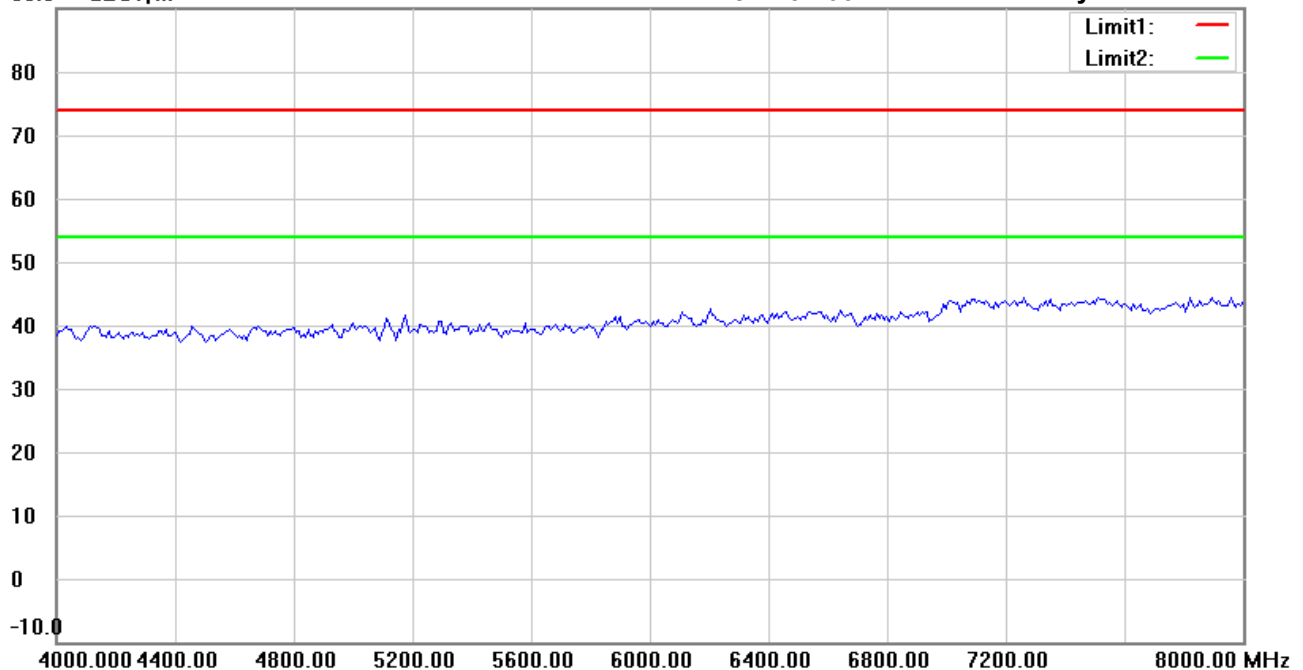

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:00:05 AM

Humidity: 61.7 %

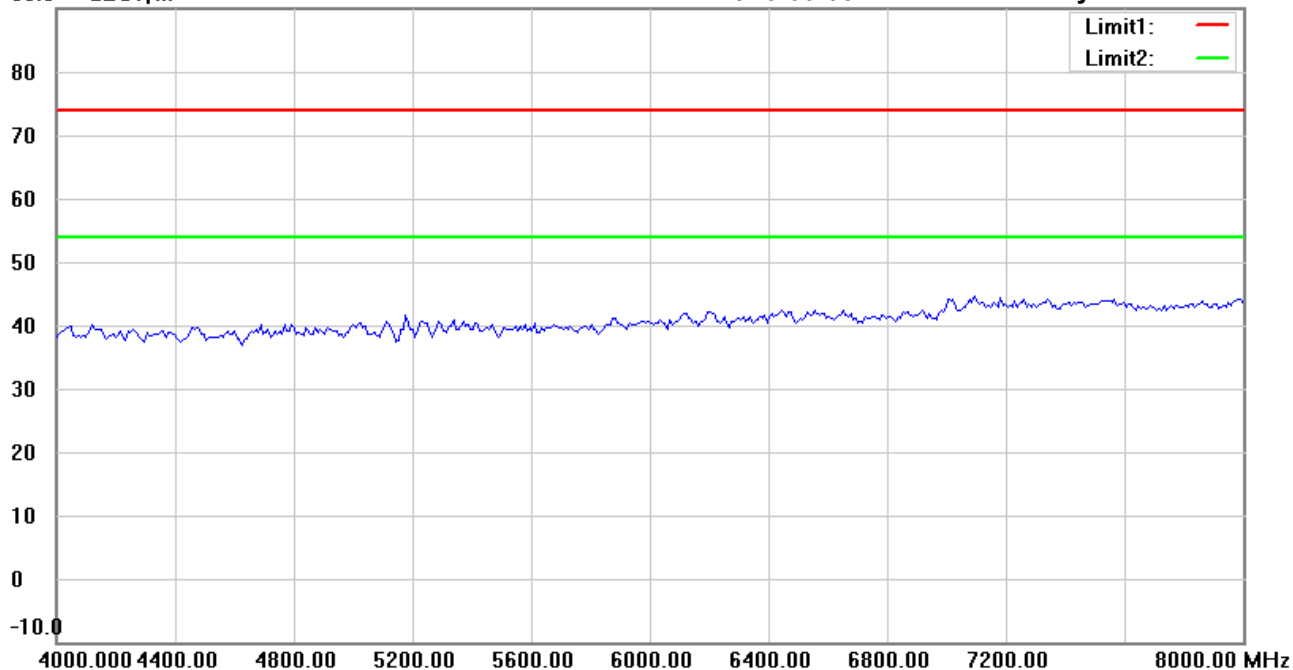

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

Time: 4:58:09 AM

Humidity: 61.7 %

90.0 dBuV/m

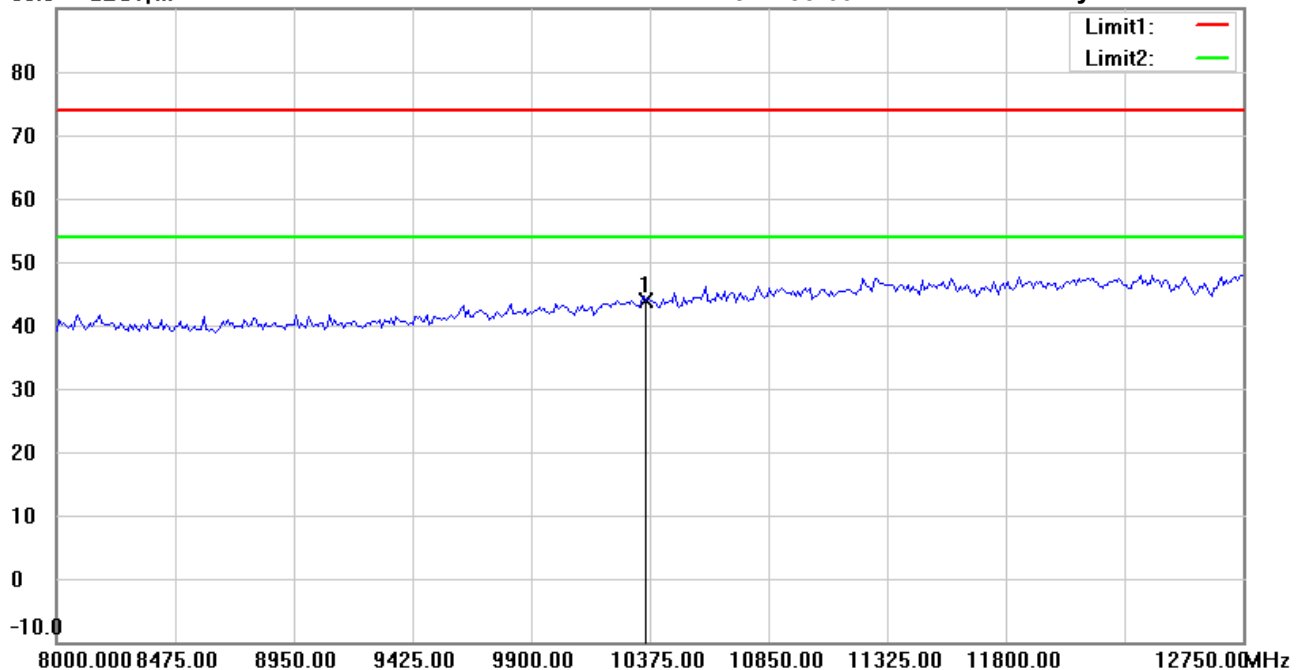

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10360.000	35.64	peak	8.23	43.87	74.00	150	70	-30.13	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:01:08 AM

Humidity: 61.7 %

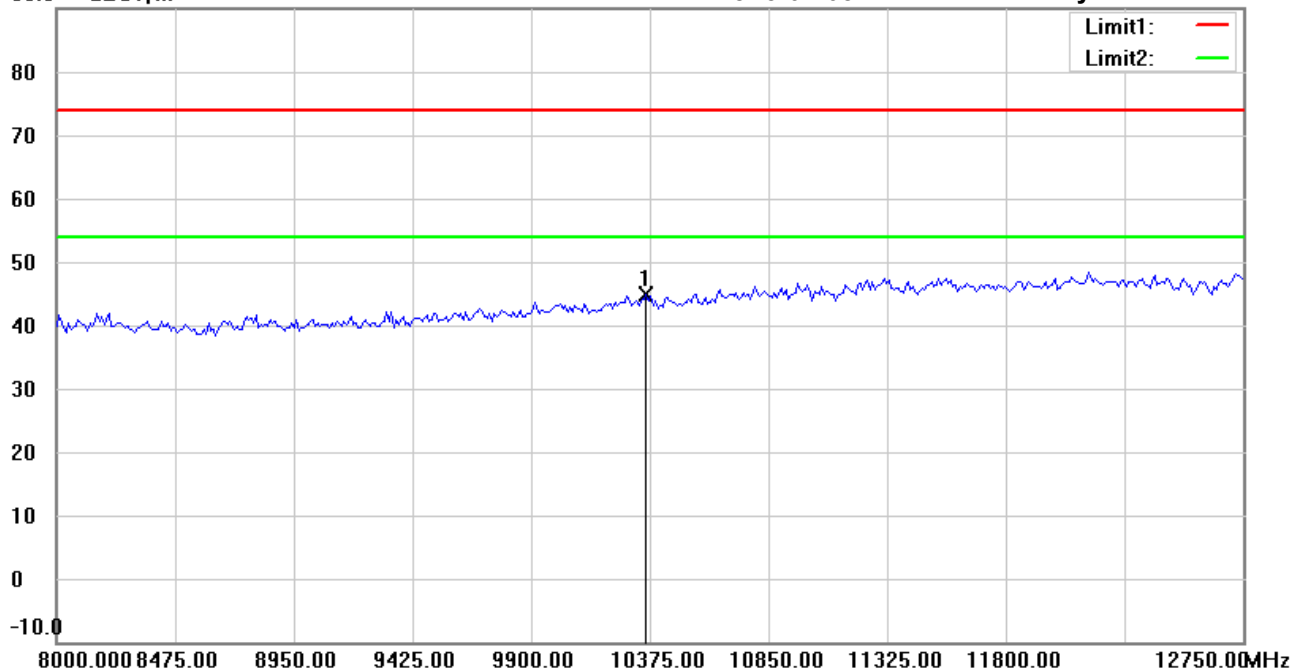

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10360.000	36.66	peak	8.23	44.89	74.00	150	40	-29.11	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:59:17 AM

Humidity: 61.7 %

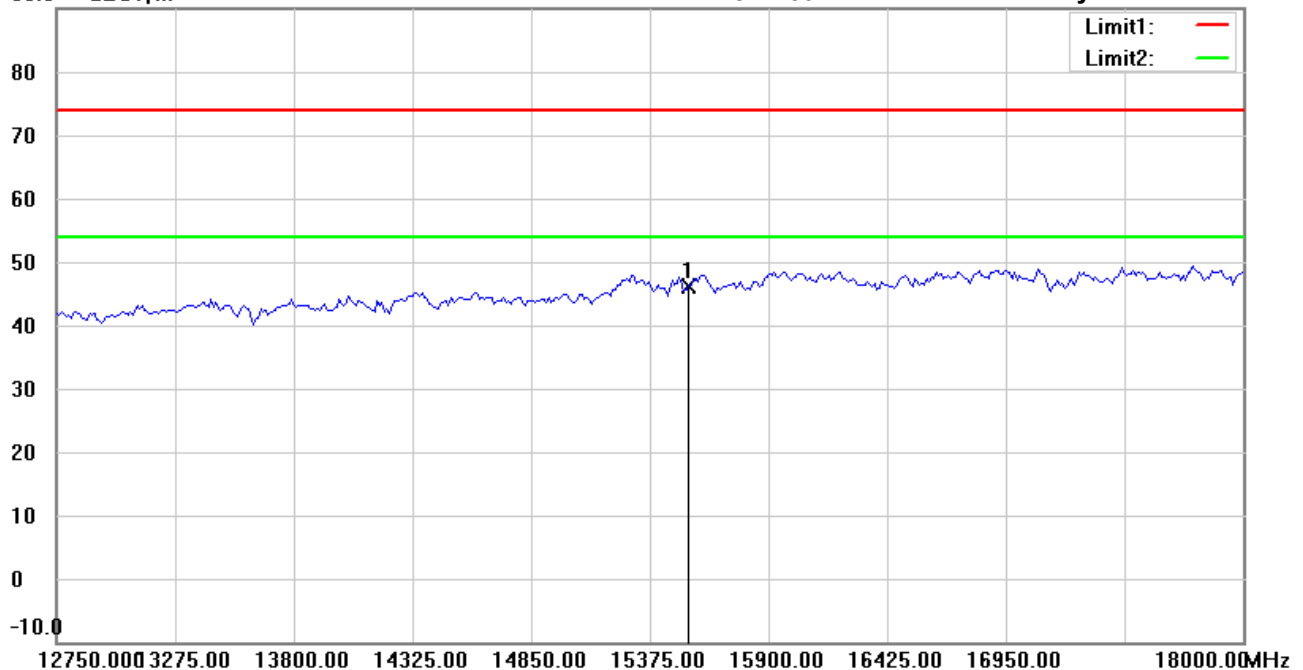

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15540.000	27.08	peak	18.95	46.03	74.00	150	130	-27.97	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:02:16 AM

Humidity: 61.7 %

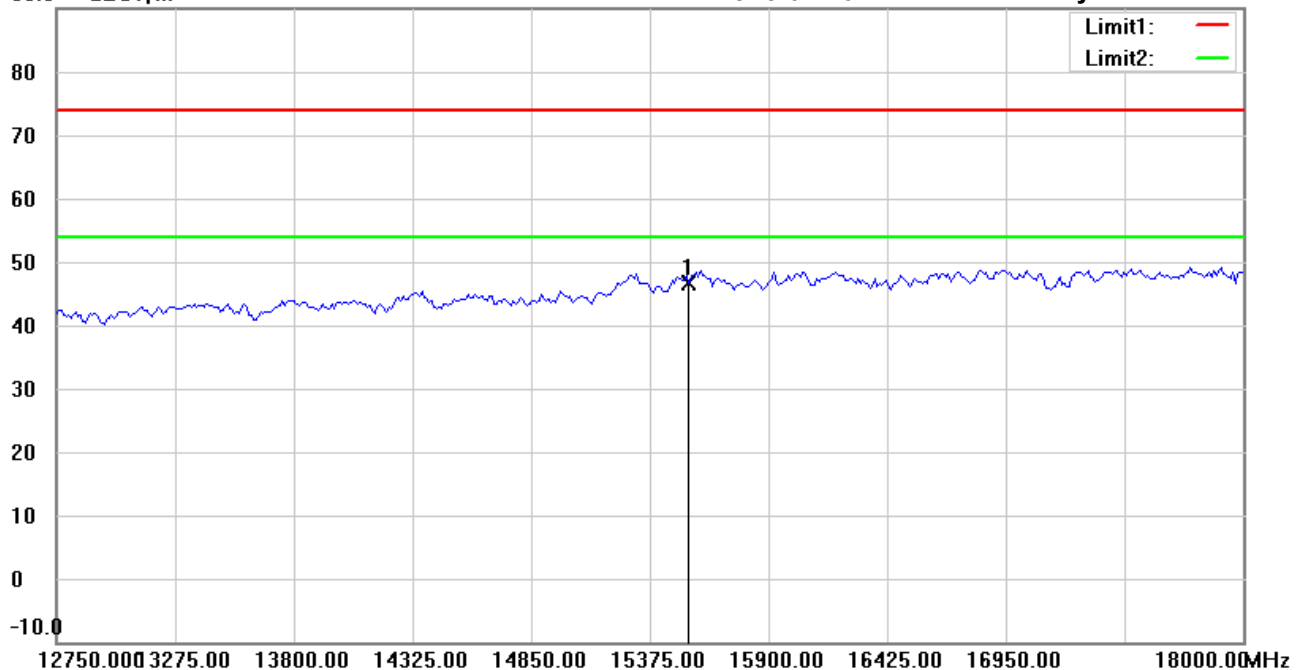

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15540.000	27.77	peak	18.95	46.72	74.00	150	205	-27.28	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 4:59:27 AM

Humidity:61.7 %

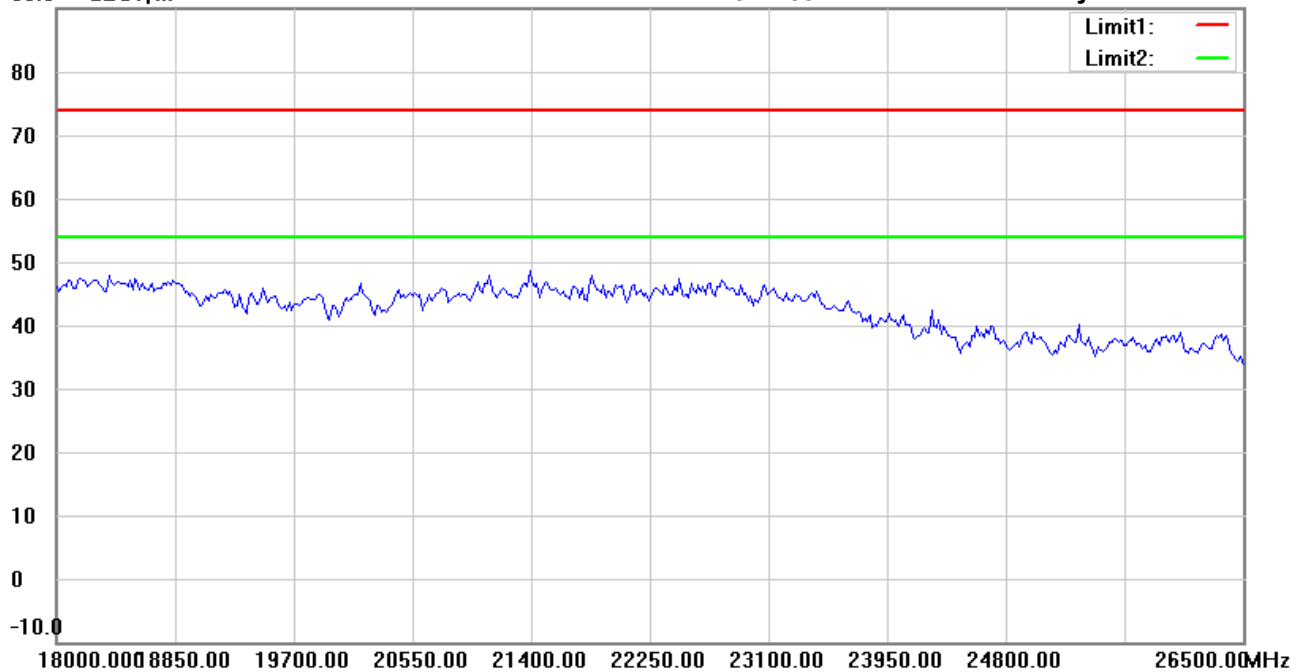

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:02:26 AM

Humidity:61.7 %

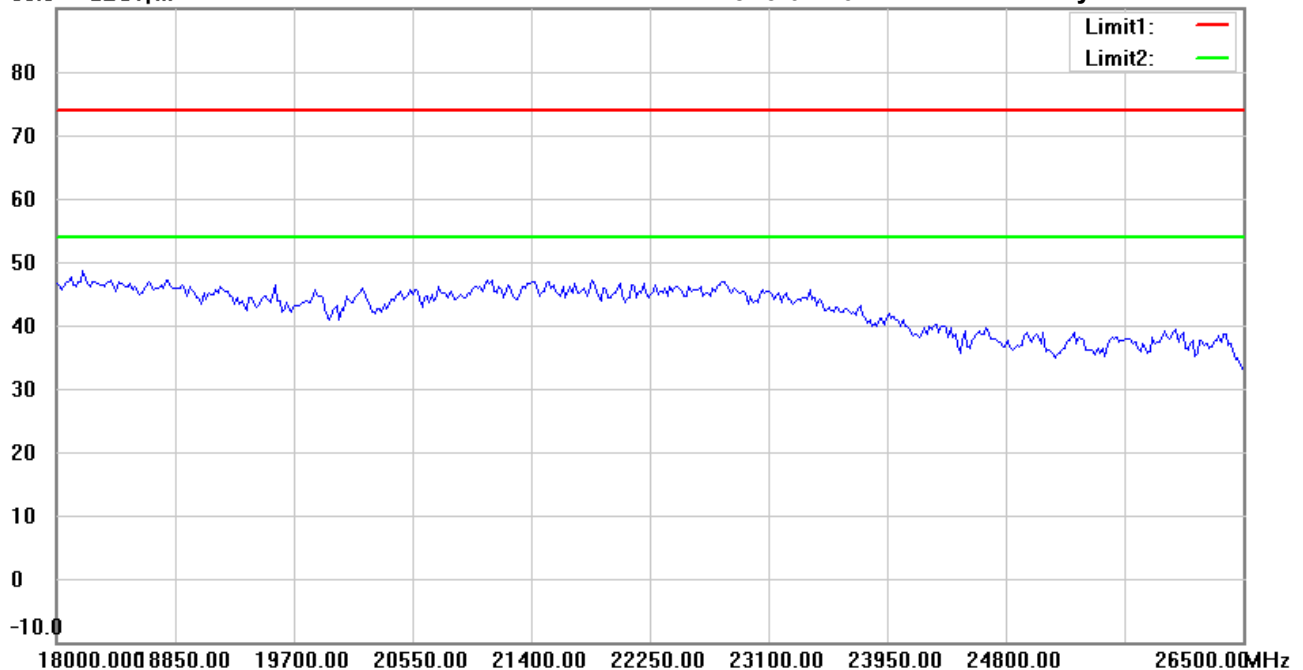

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 4:59:37 AM

Humidity: 61.7 %

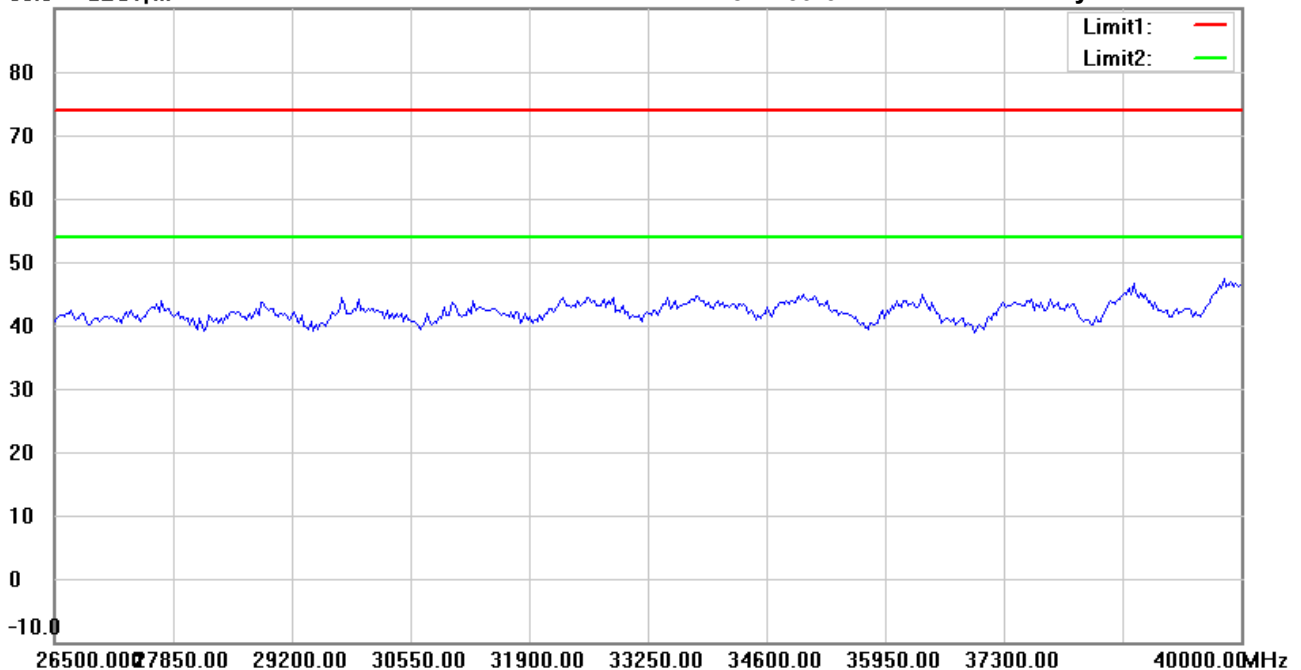

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:02:36 AM

Humidity: 61.7 %

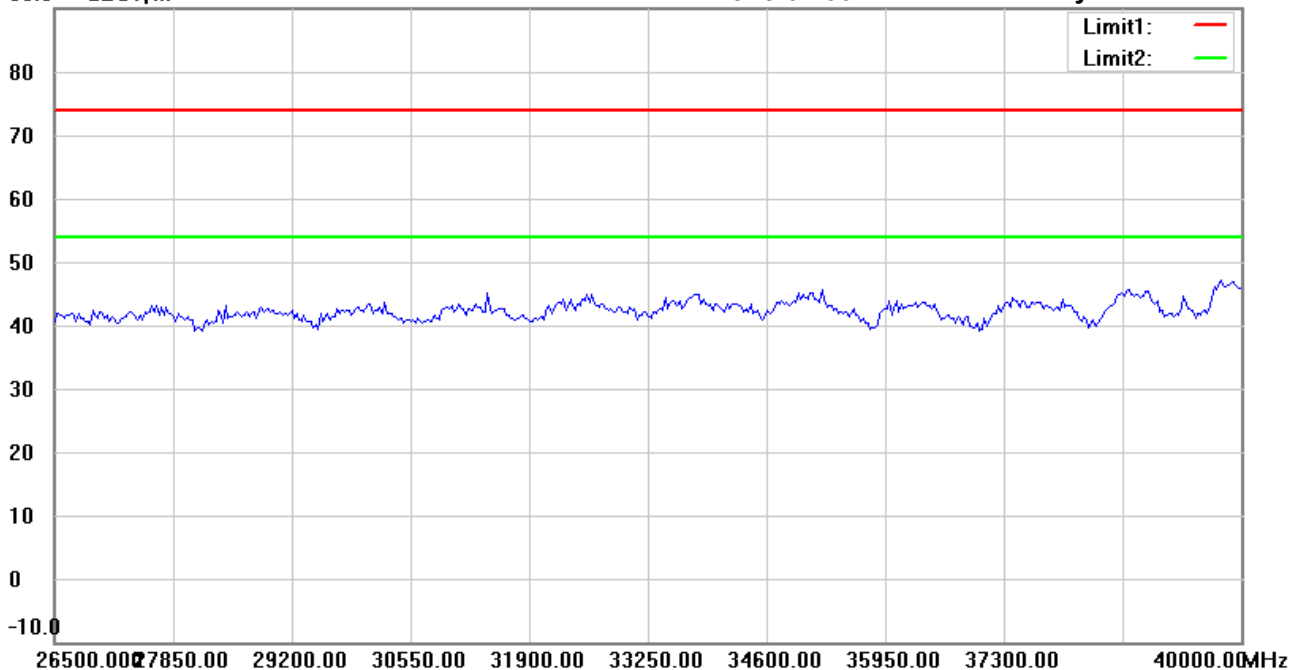

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:04:50 AM

Humidity:61.7 %

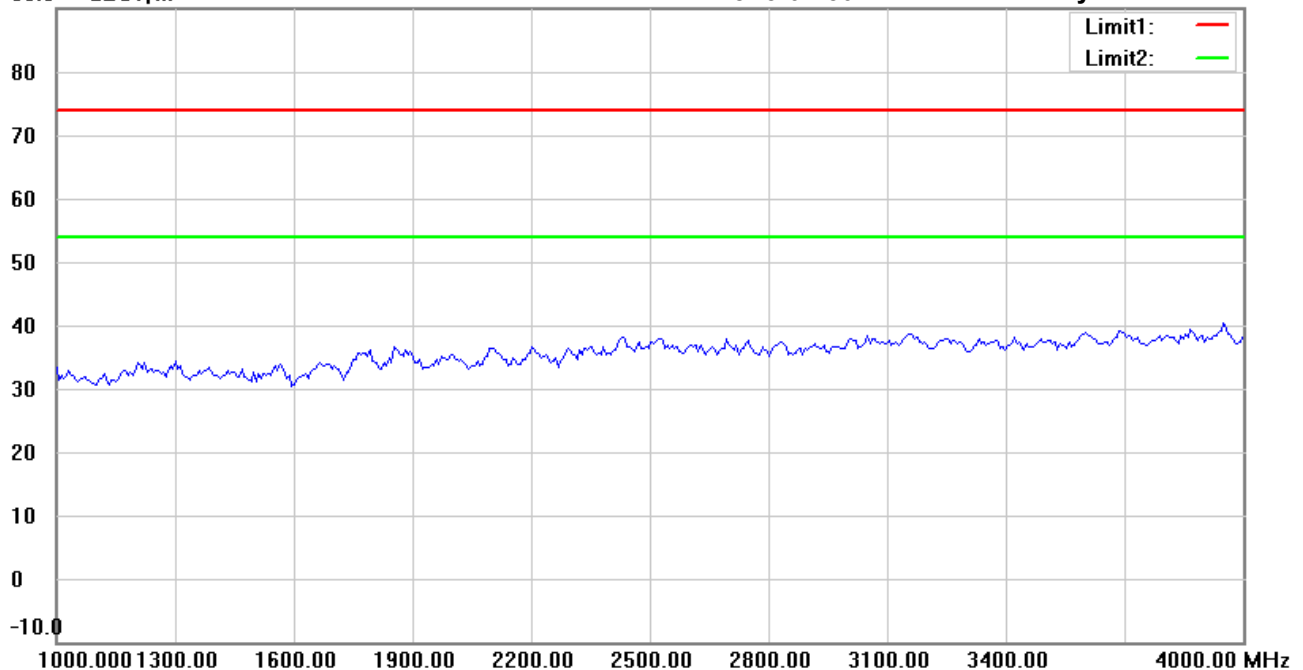

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:07:40 AM

Humidity: 61.7 %

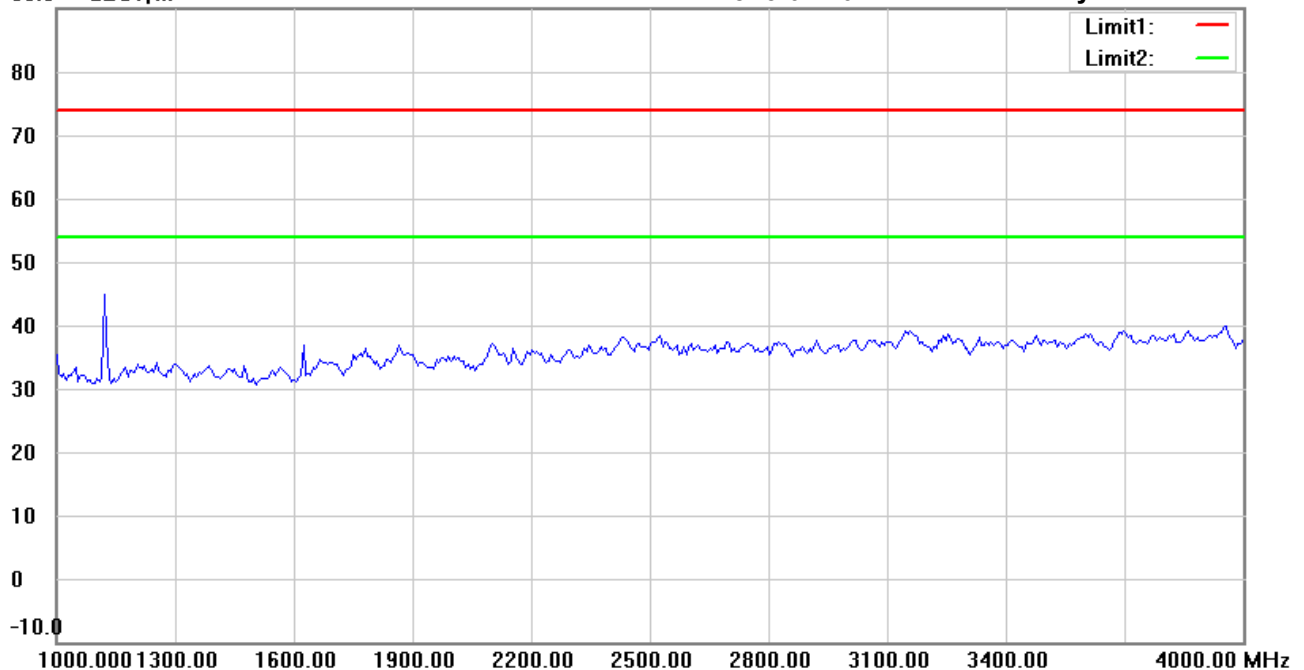

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:04:57 AM

Humidity: 61.7 %

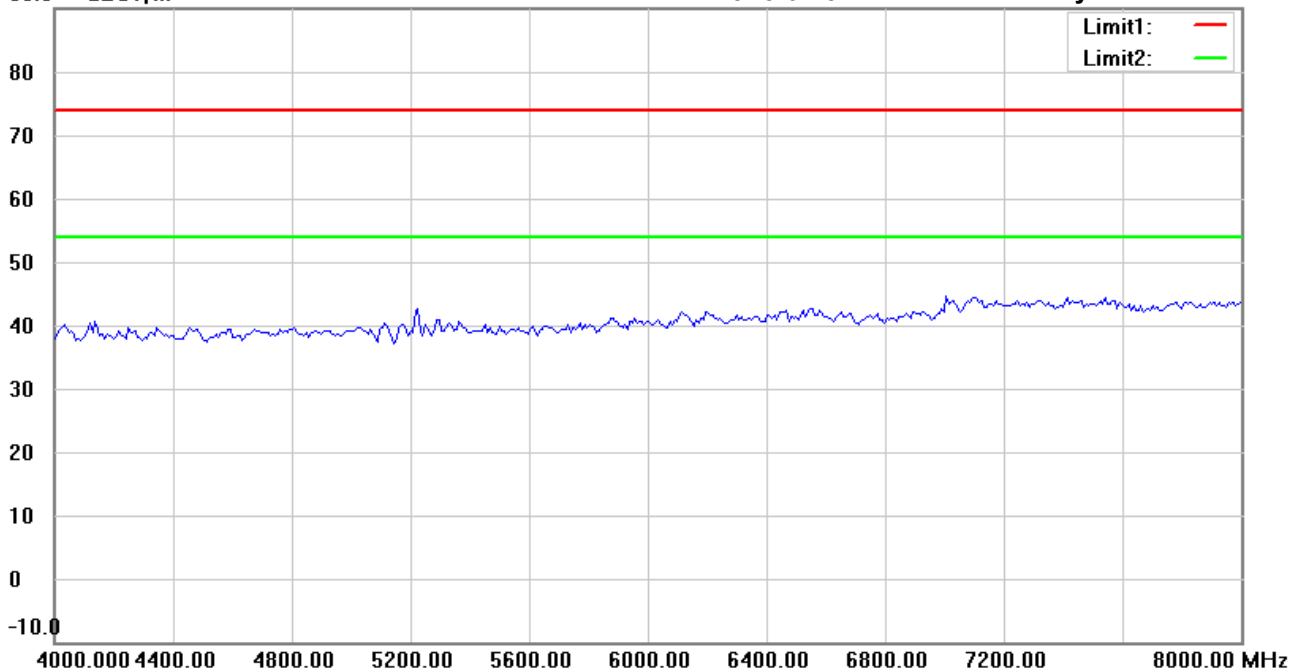

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:07:47 AM

Humidity: 61.7 %

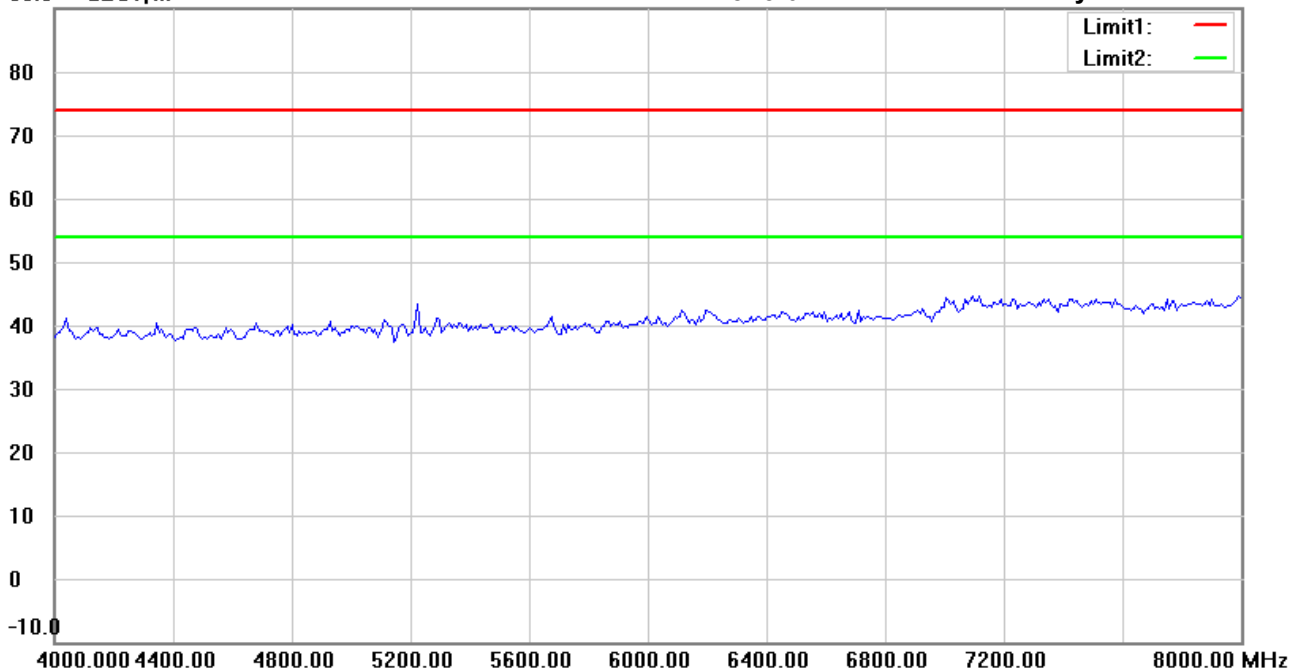

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:05:59 AM

Humidity: 61.7 %

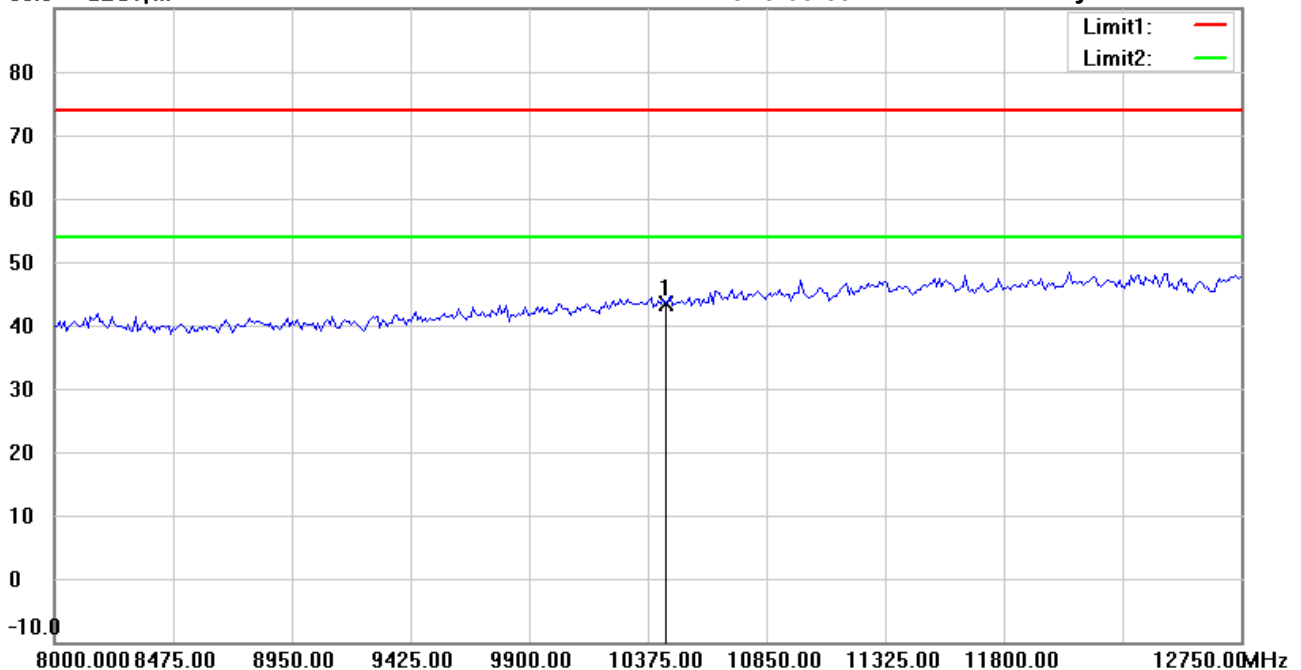

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10440.000	35.11	peak	8.33	43.44	74.00	150	155	-30.56	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:08:51 AM

Humidity: 61.7 %

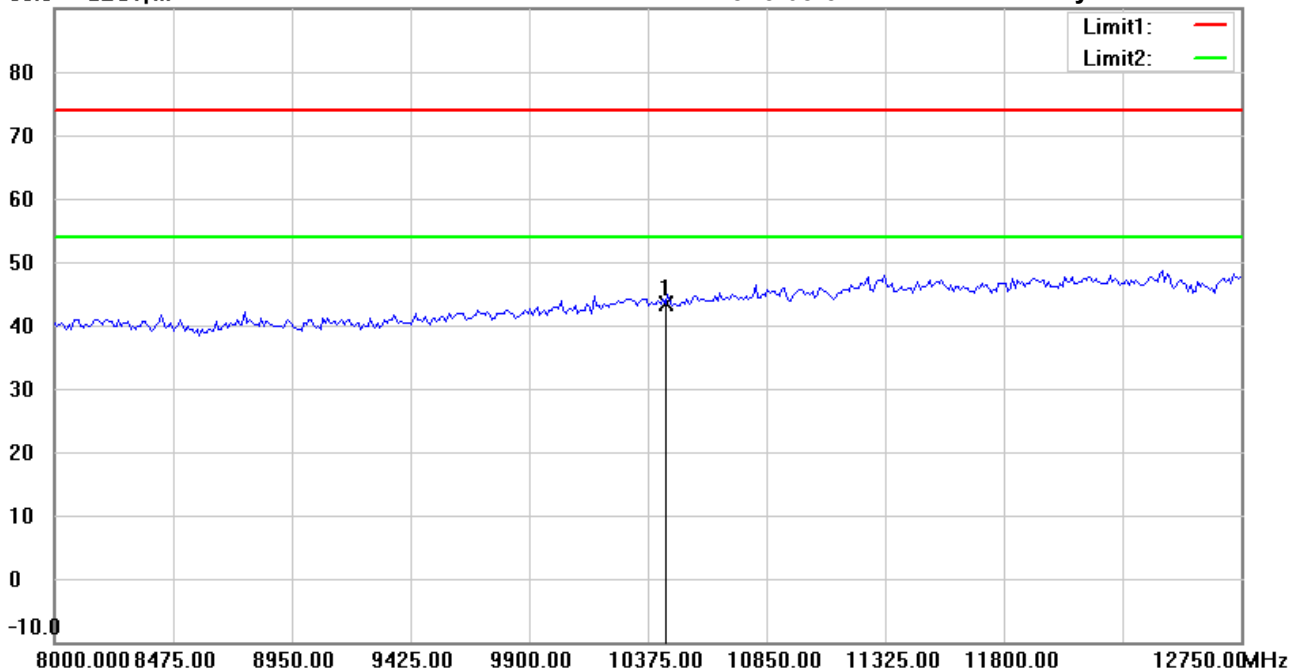

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10440.000	35.04	peak	8.33	43.37	74.00	150	270	-30.63	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

Time: 5:07:08 AM

Humidity: 61.7 %

90.0 dBuV/m

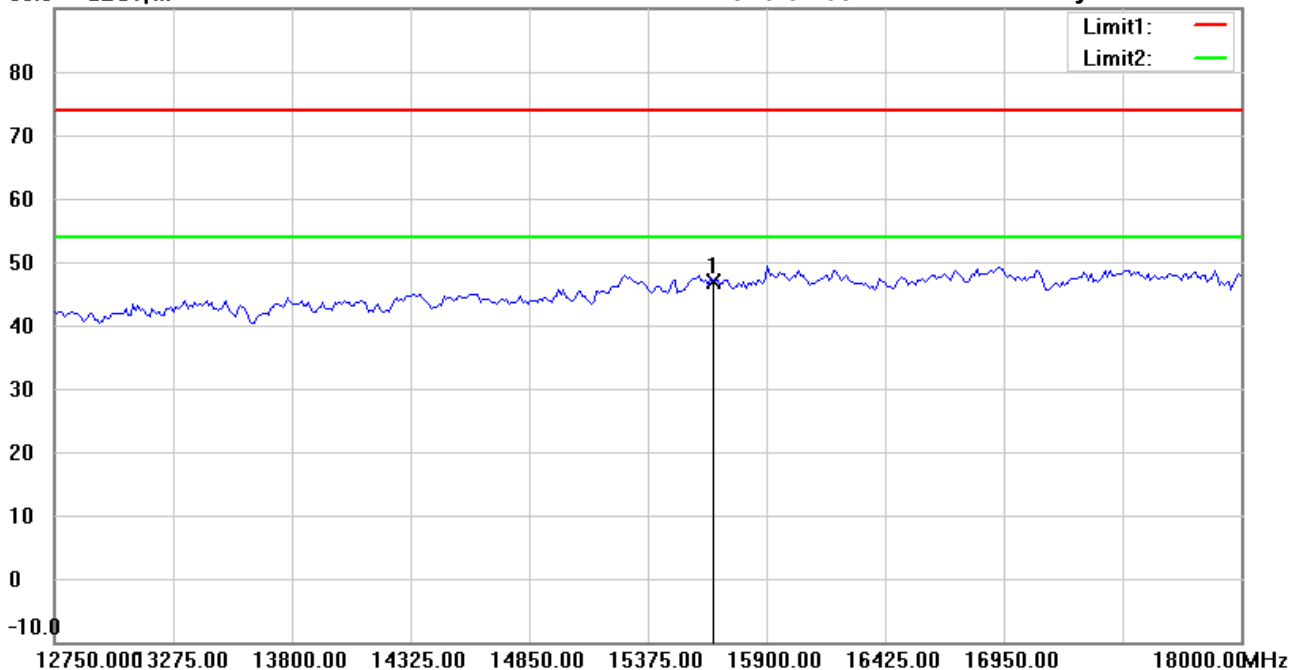

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15660.000	28.67	peak	18.33	47.00	74.00	150	160	-27.00	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:10:00 AM

Humidity:61.7 %

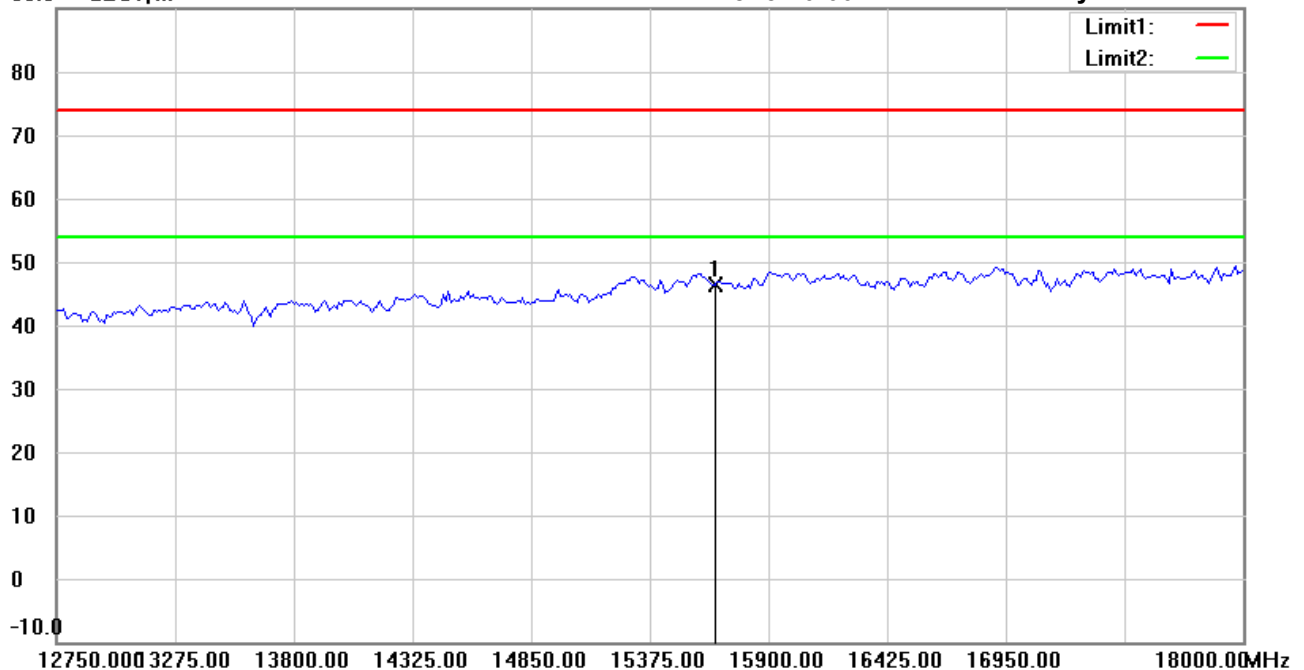

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15660.000	28.12	peak	18.33	46.45	74.00	150	0	-27.55	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:07:18 AM

Humidity: 61.7 %

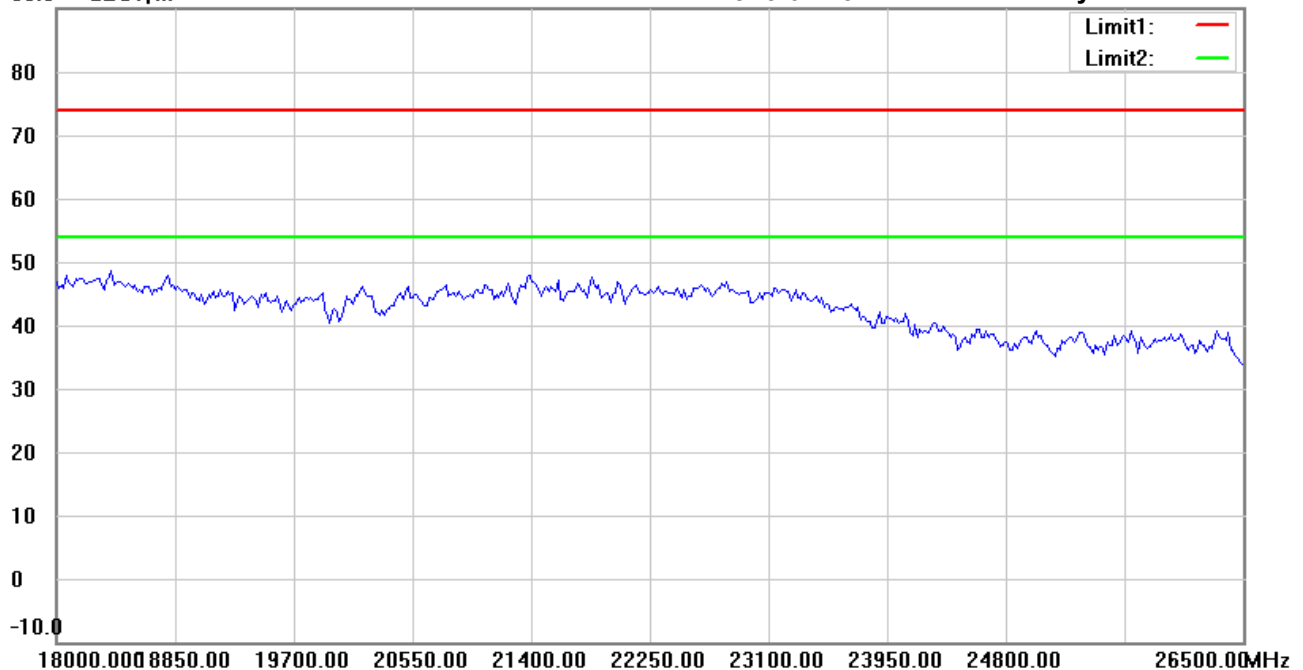

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #11


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:10:09 AM

Humidity: 61.7 %

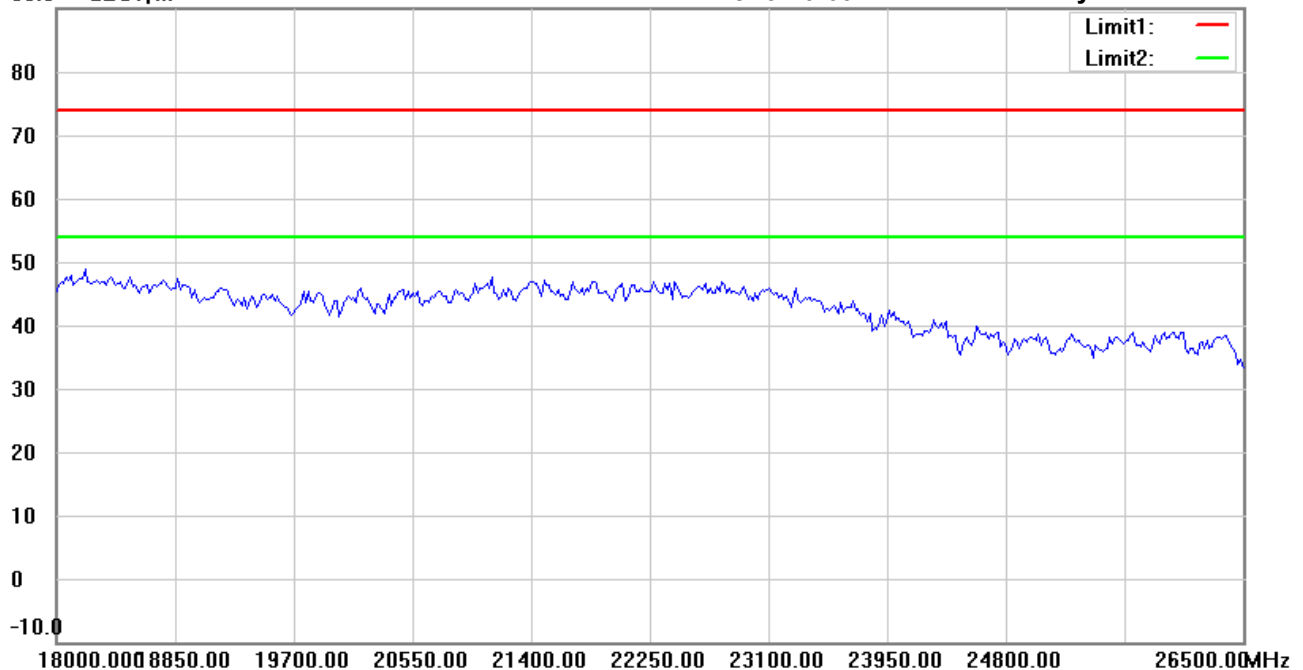

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:07:28 AM

Humidity: 61.7 %

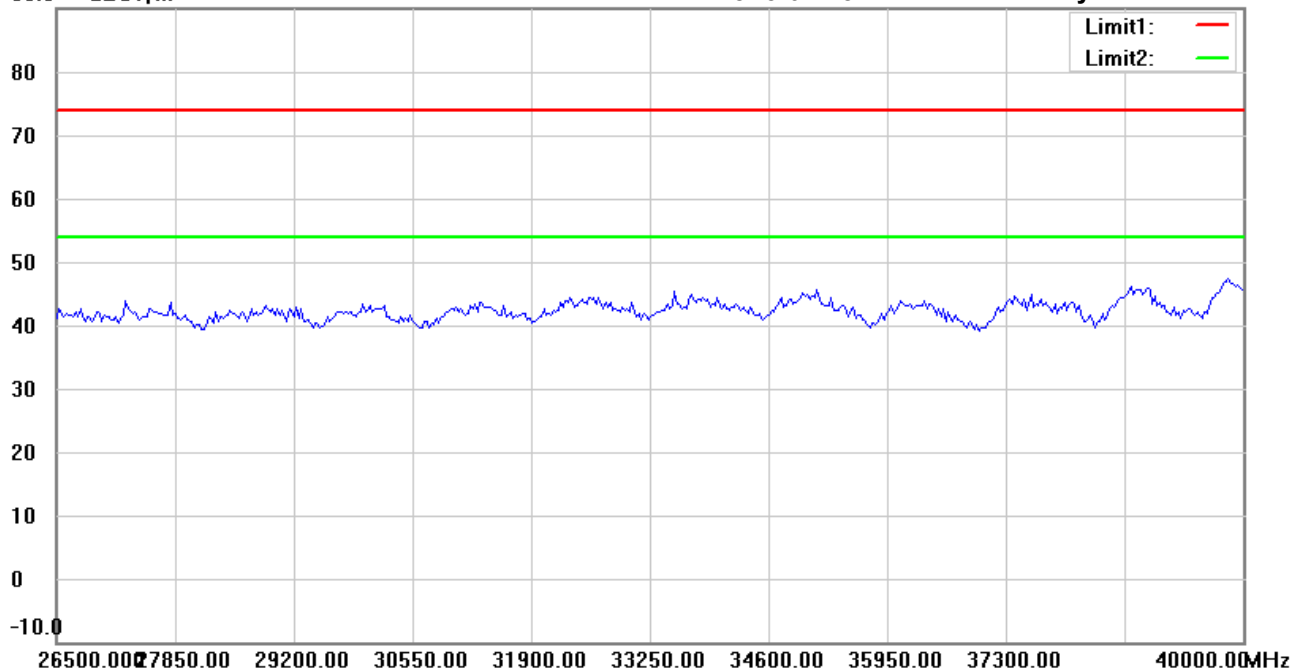

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:10:20 AM

Humidity: 61.7 %

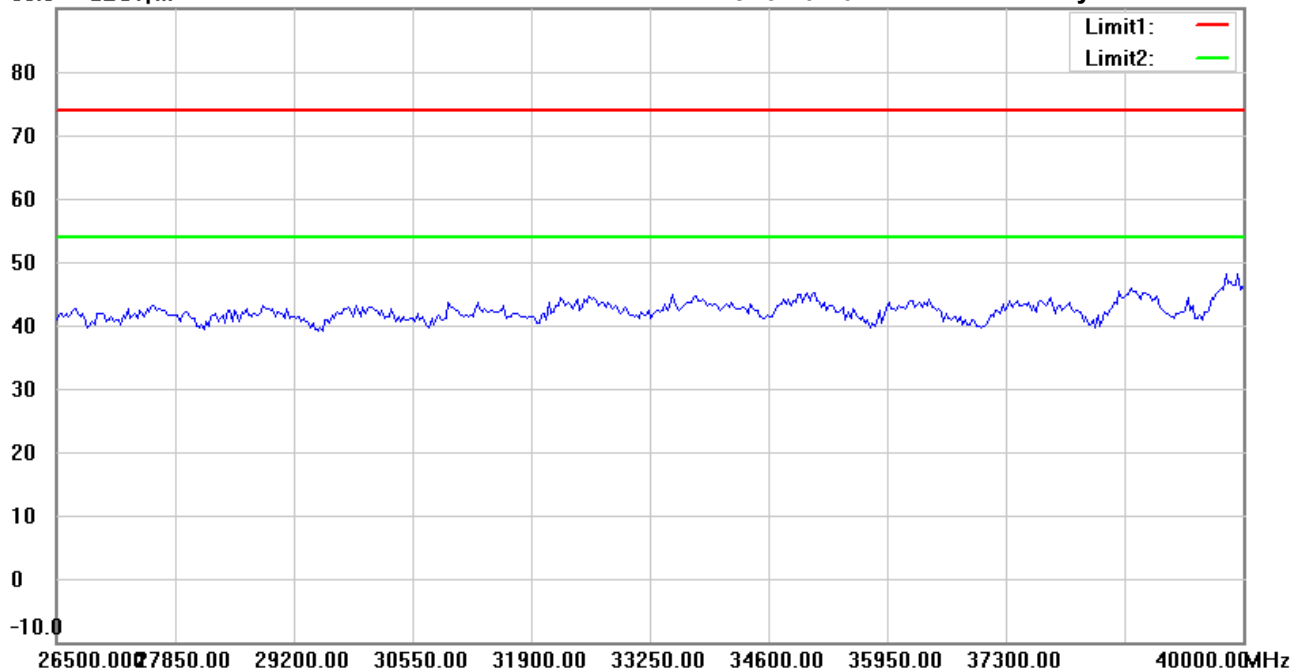

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH44

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:12:31 AM

Humidity:61.7 %

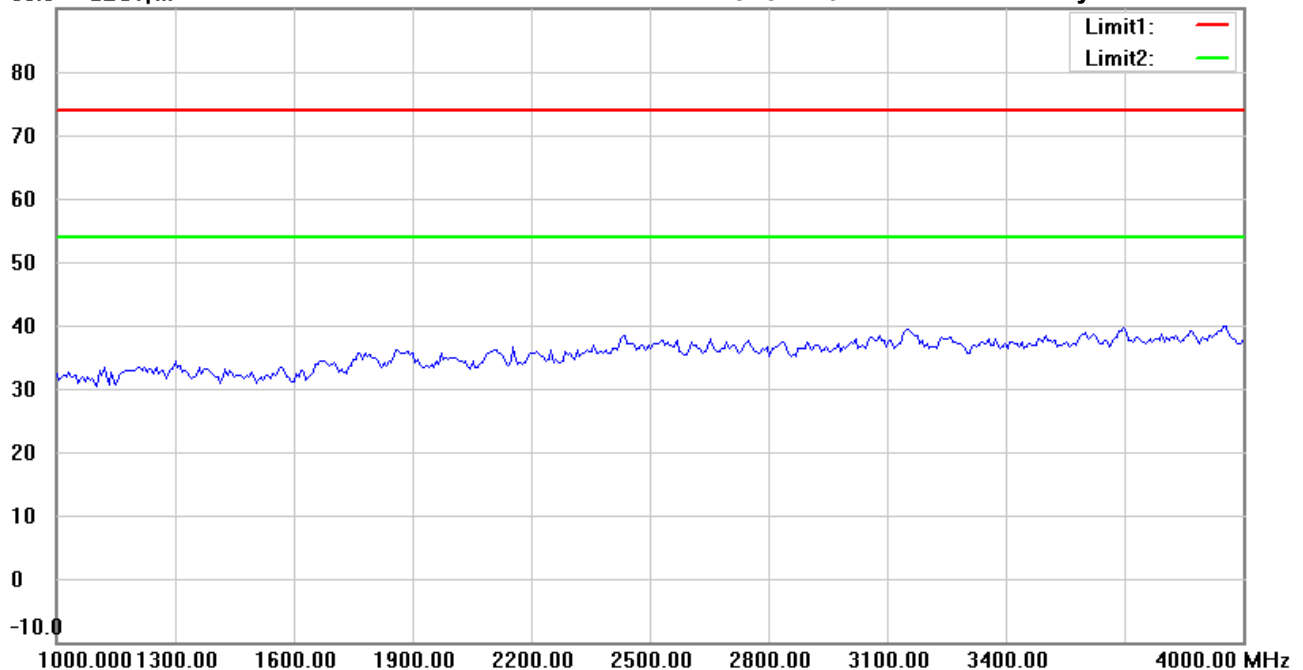

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:16:00 AM

Humidity: 61.7 %

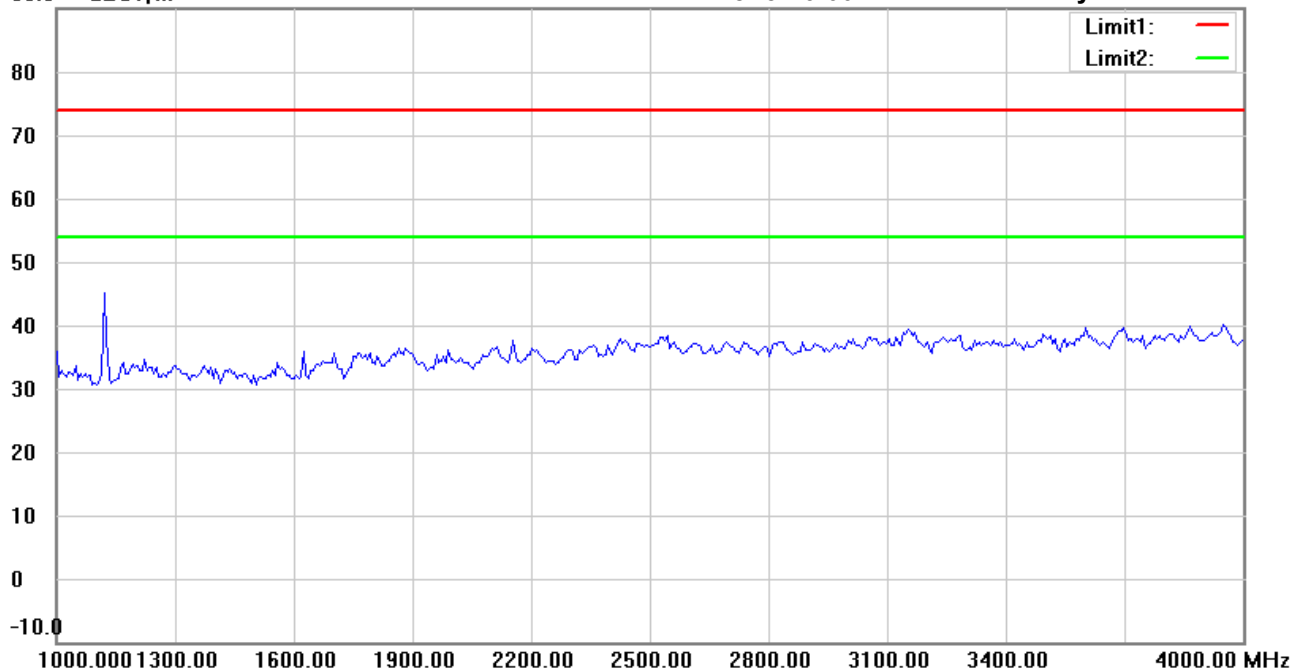

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:12:38 AM

Humidity: 61.7 %

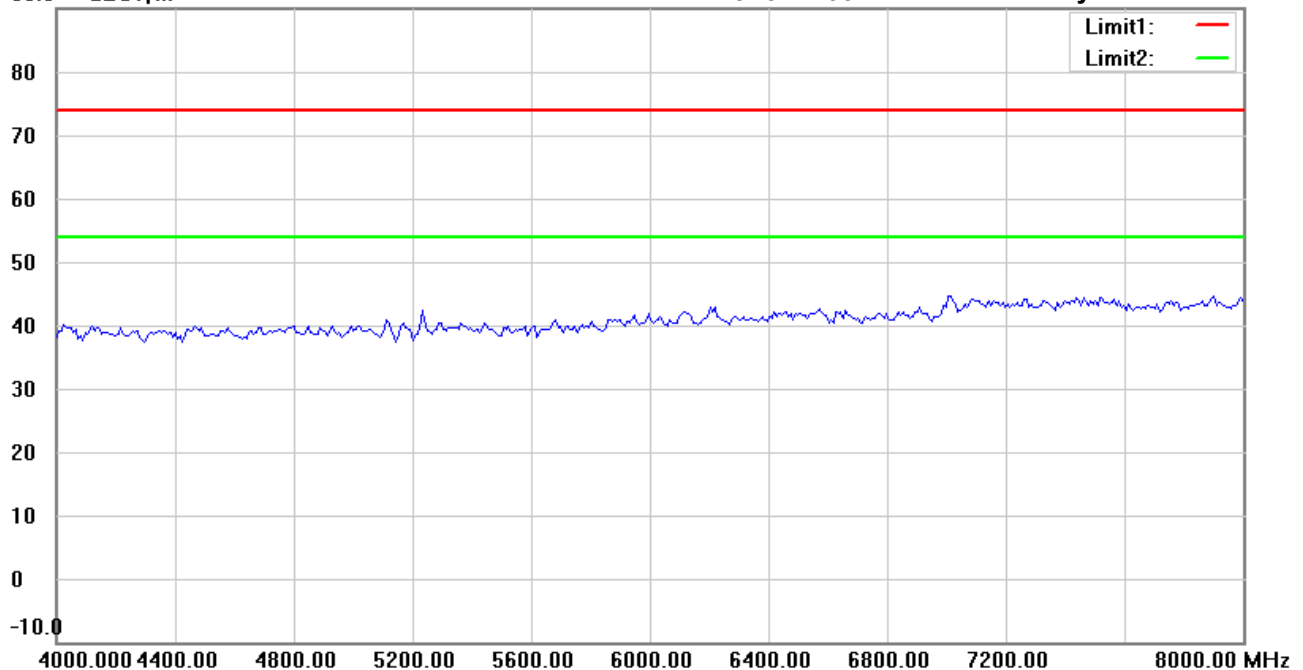

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:16:08 AM

Humidity: 61.7 %

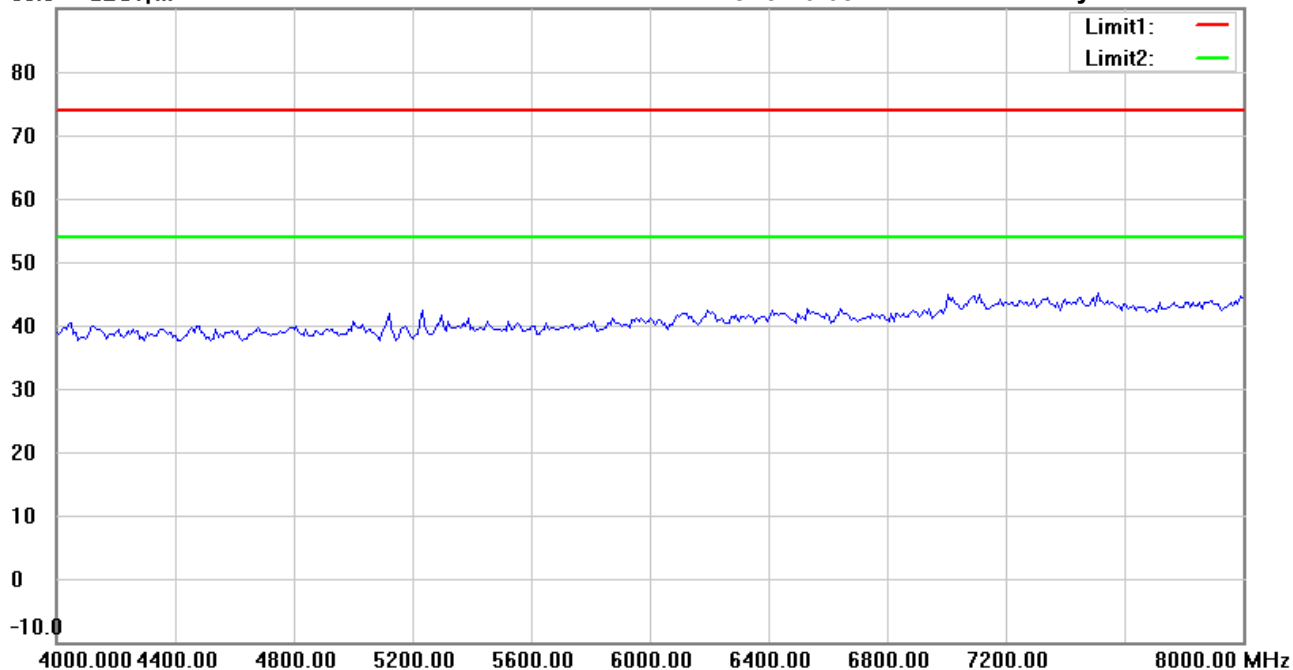

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:13:40 AM

Humidity:61.7 %

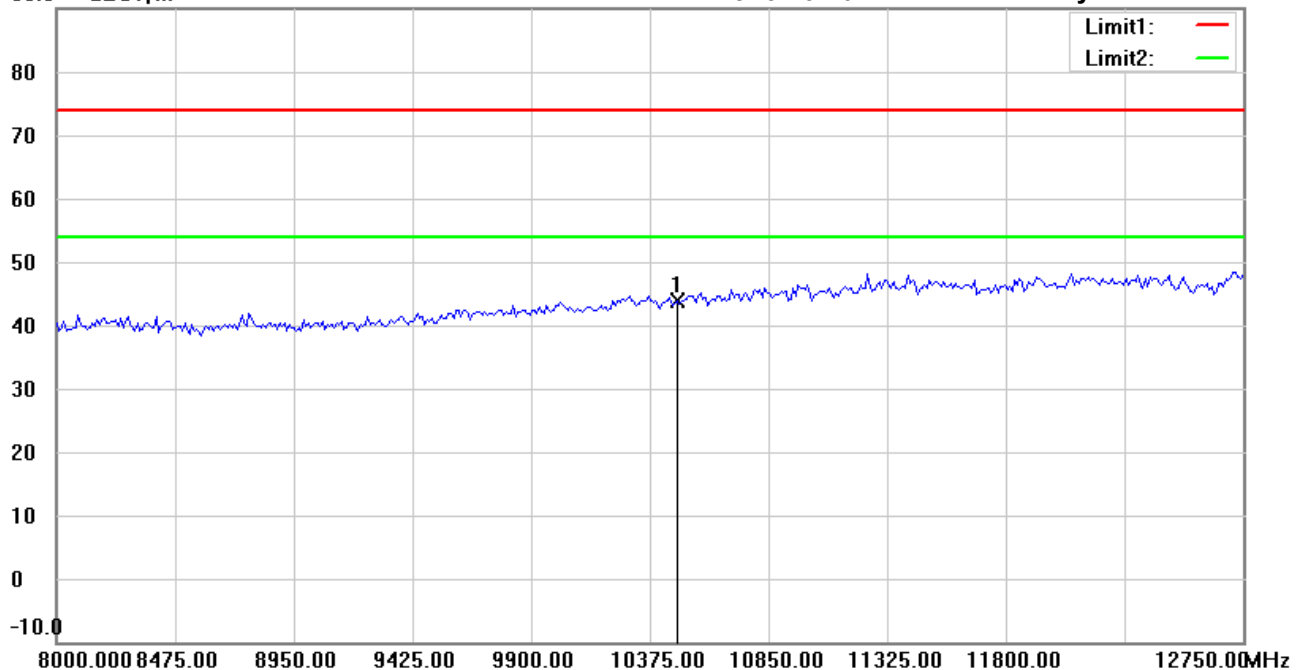

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10480.000	35.31	peak	8.46	43.77	74.00	150	20	-30.23	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:17:24 AM

Humidity: 61.7 %

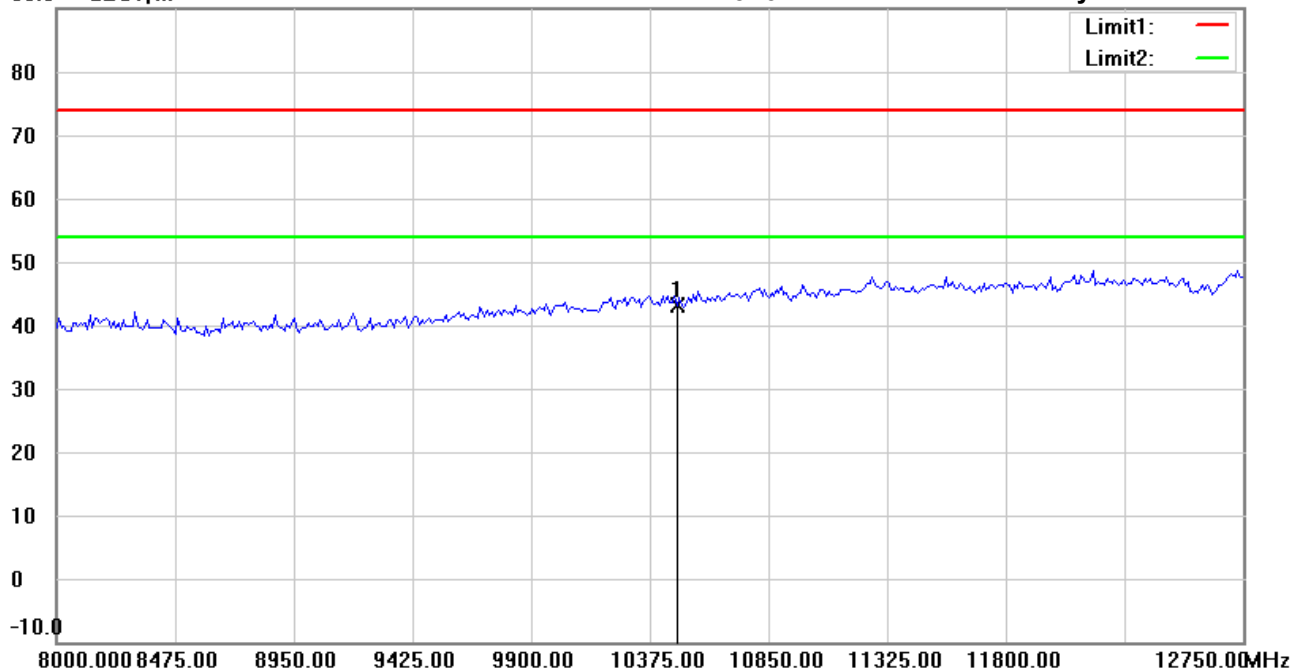

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10480.000	34.58	peak	8.46	43.04	74.00	150	175	-30.96	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:14:48 AM

Humidity: 61.7 %

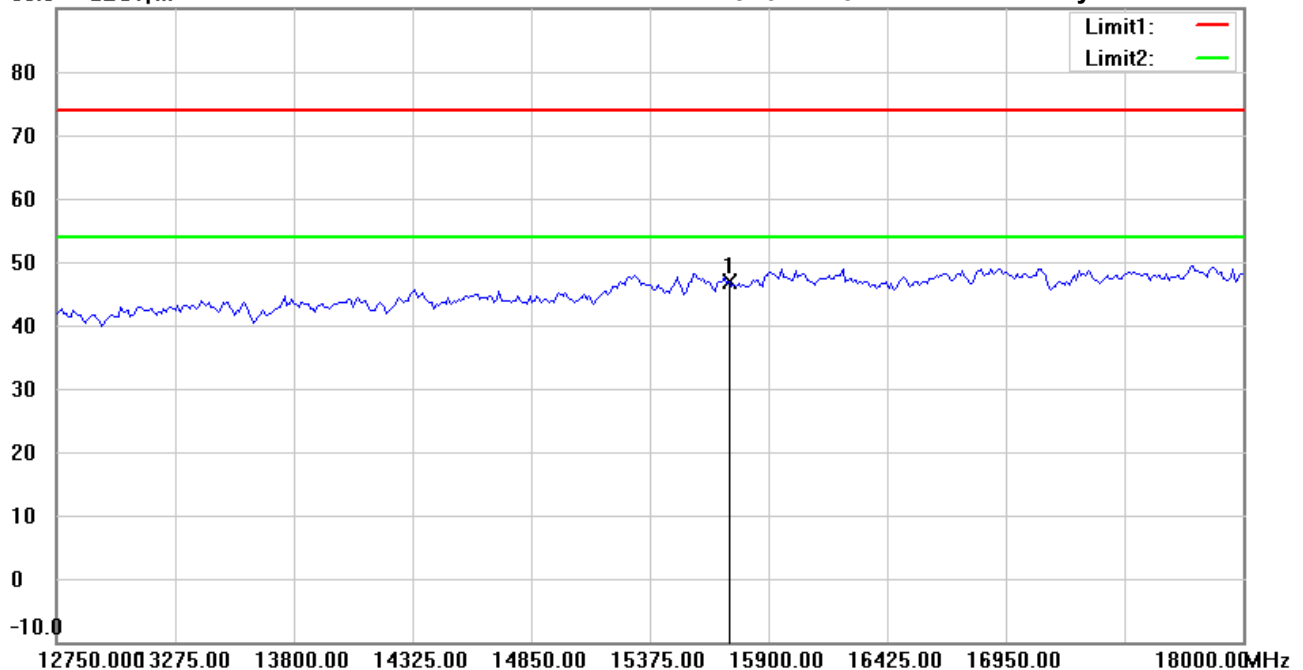

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15720.000	29.43	peak	17.44	46.87	74.00	150	255	-27.13	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:18:32 AM

Humidity:61.7 %

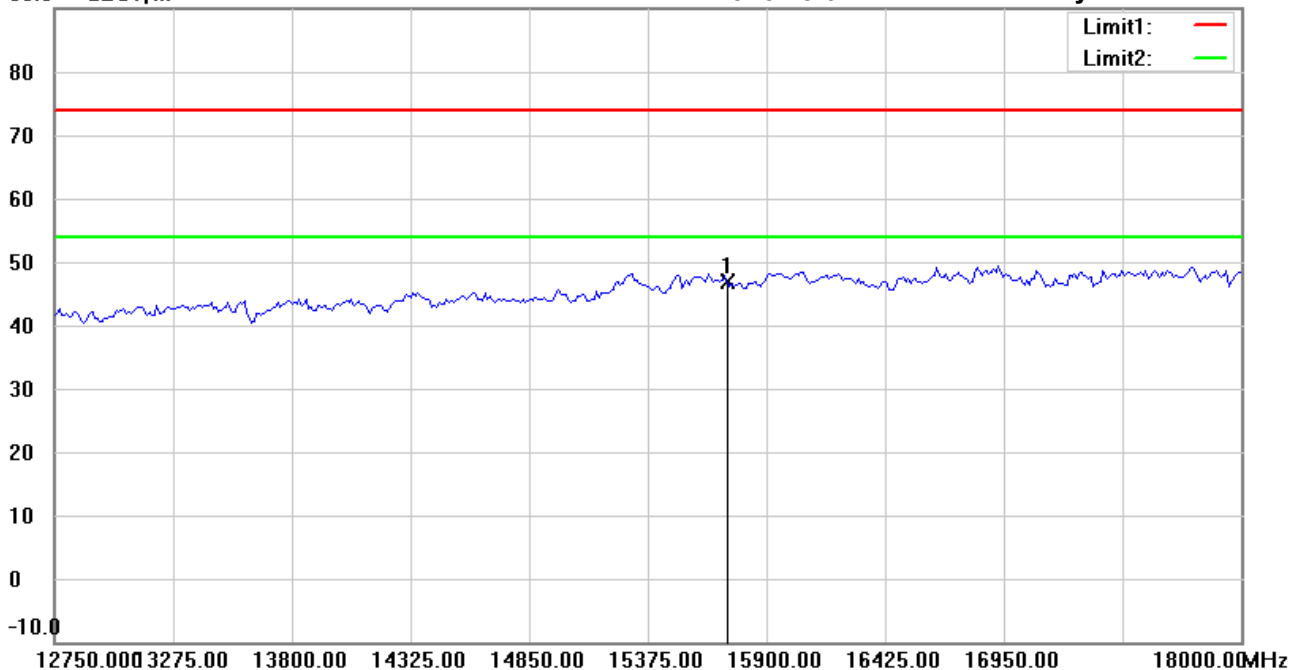

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15720.000	29.37	peak	17.44	46.81	74.00	150	30	-27.19	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:14:58 AM

Humidity: 61.7 %

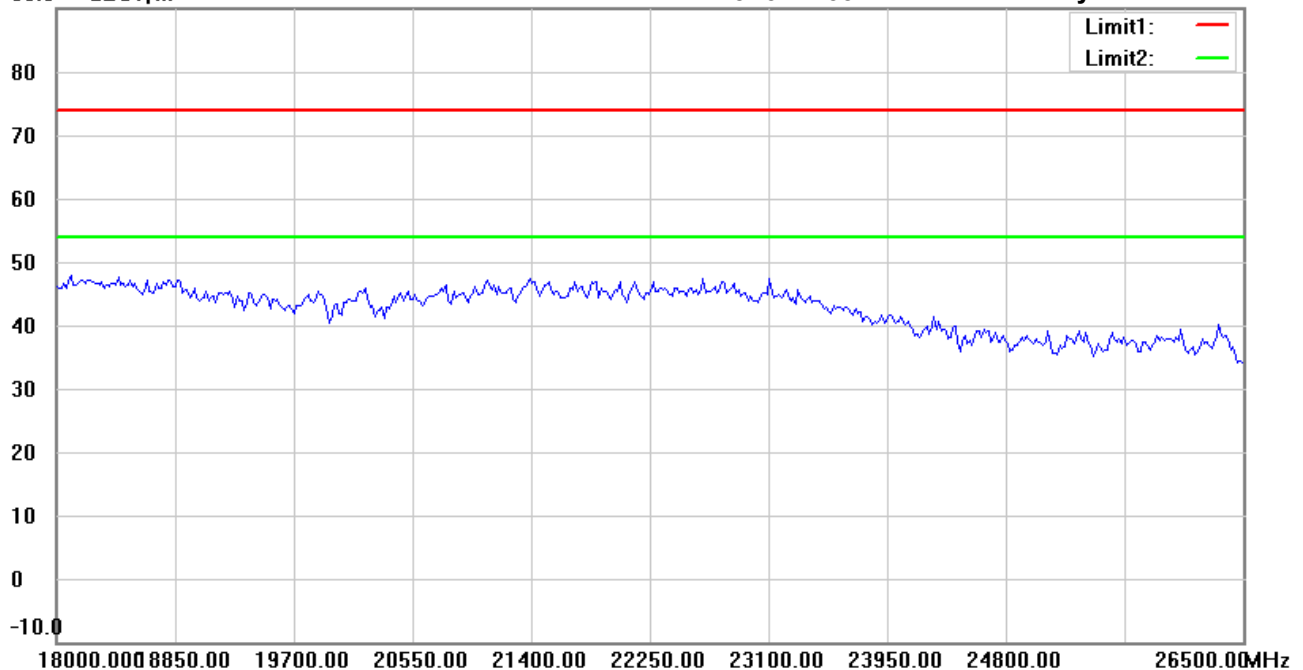

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:18:42 AM

Humidity:61.7 %

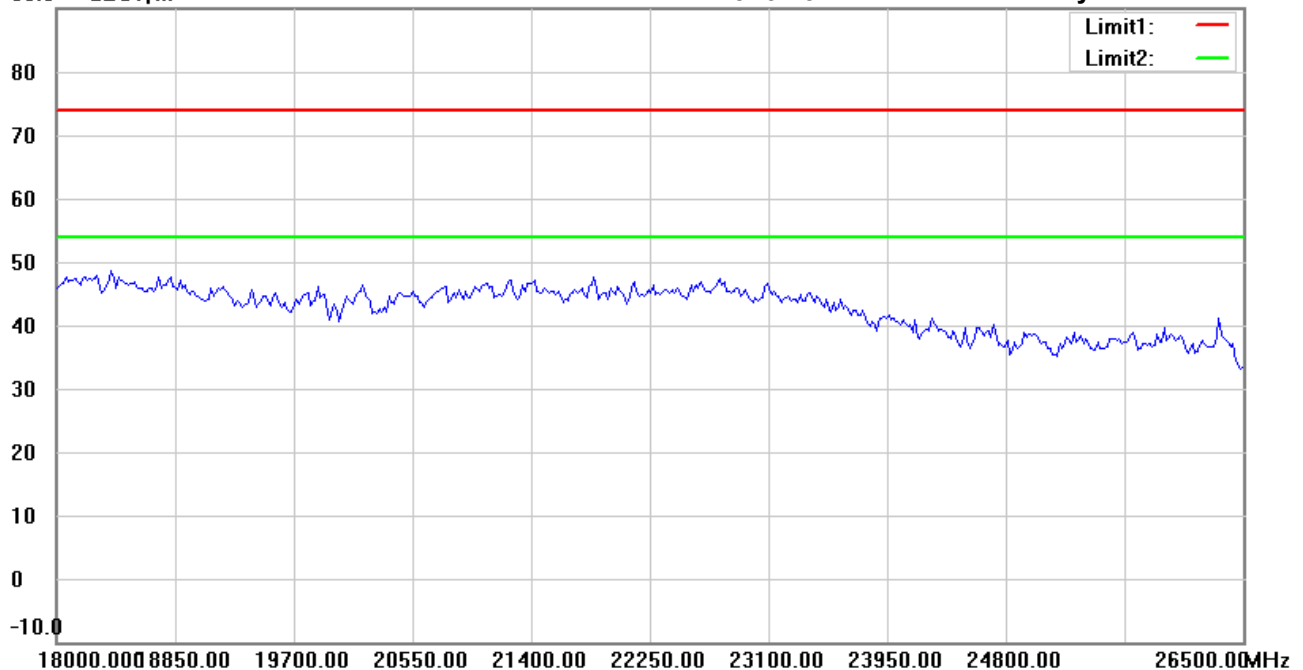

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:15:09 AM

Humidity: 61.7 %

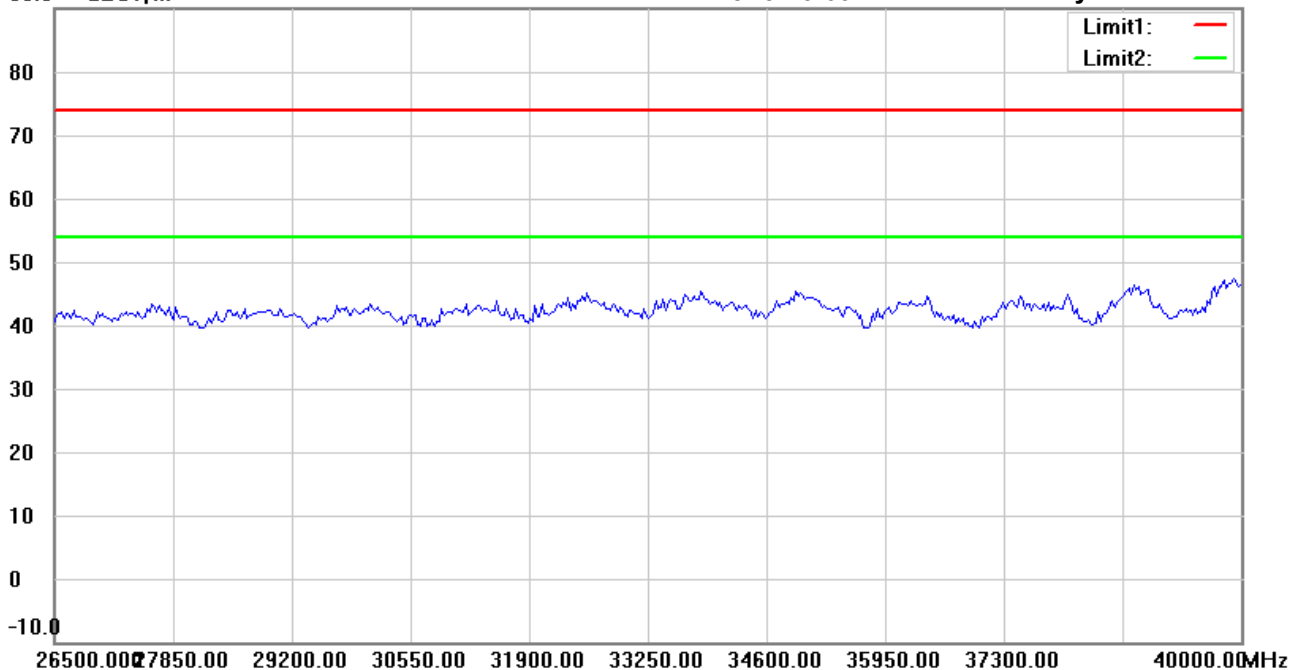

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:18:52 AM

Humidity: 61.7 %

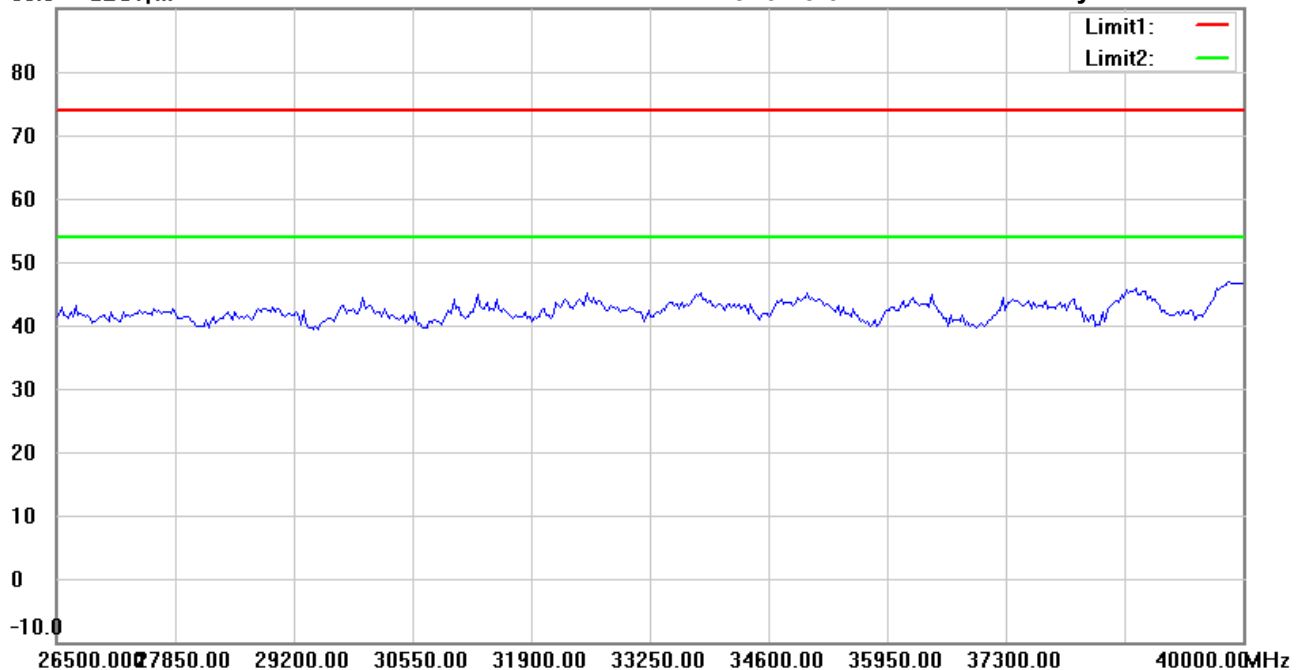

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH48

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:35:47 AM

Humidity:64.7 %

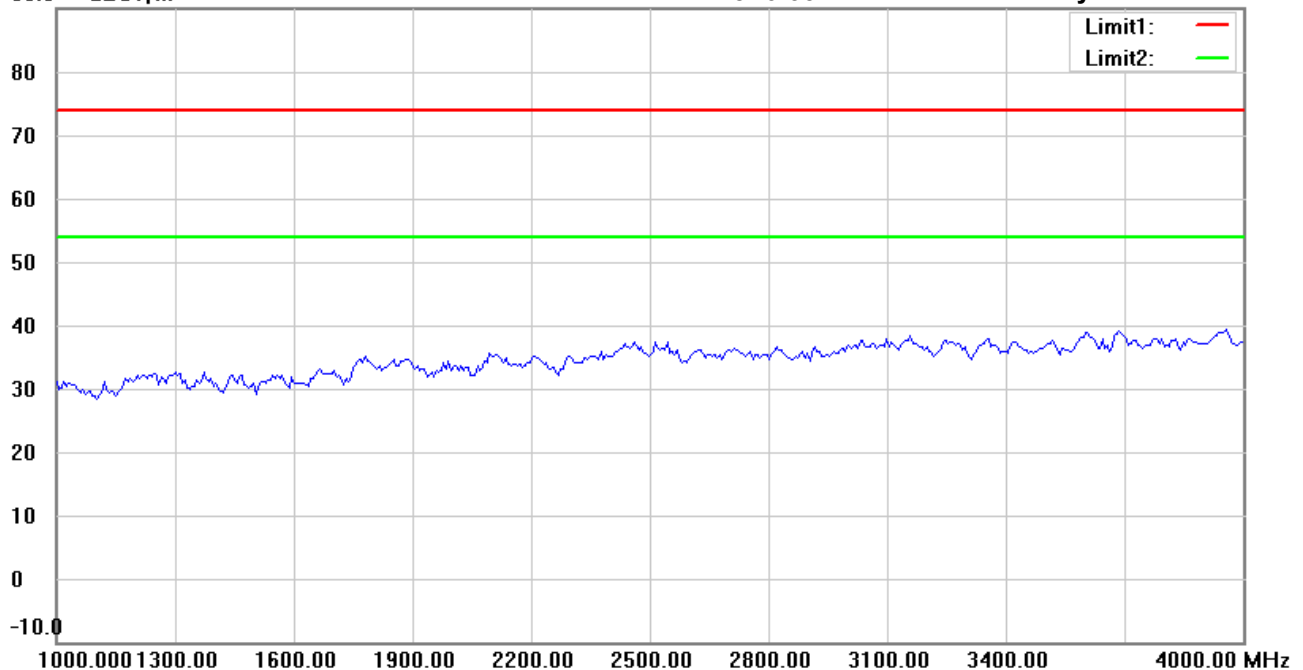

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:38:38 AM

Humidity:64.7 %

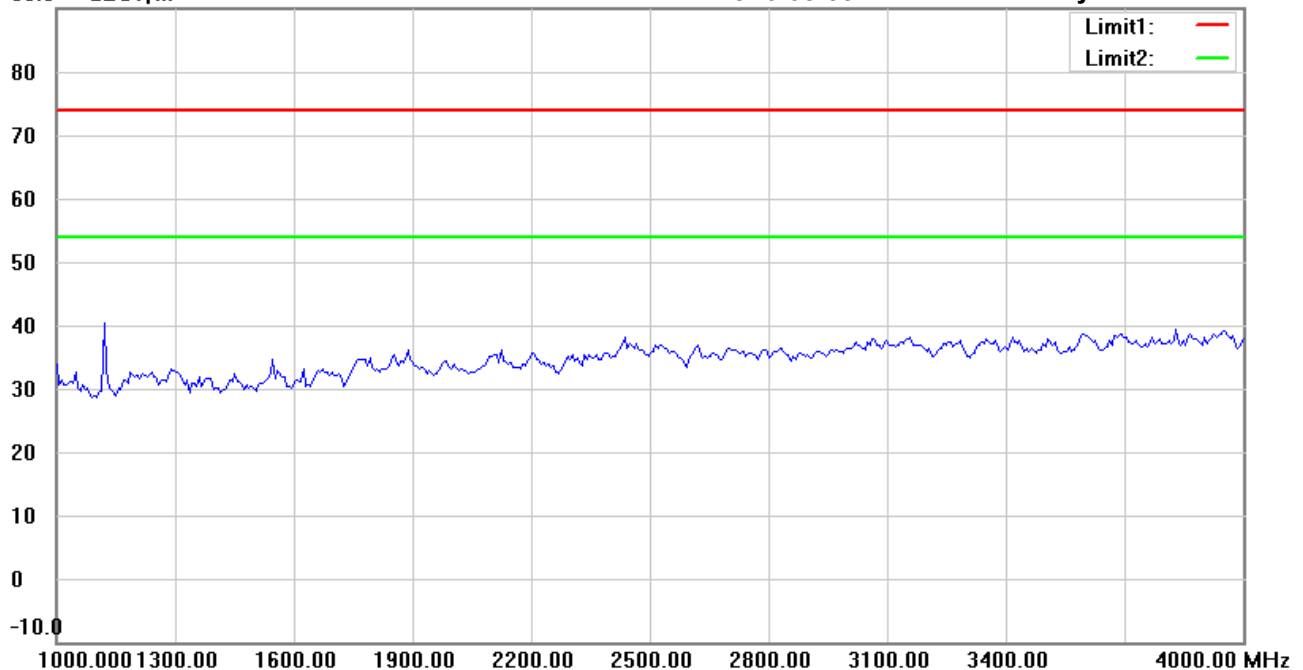

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#2


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:35:55 AM

Humidity:64.7 %

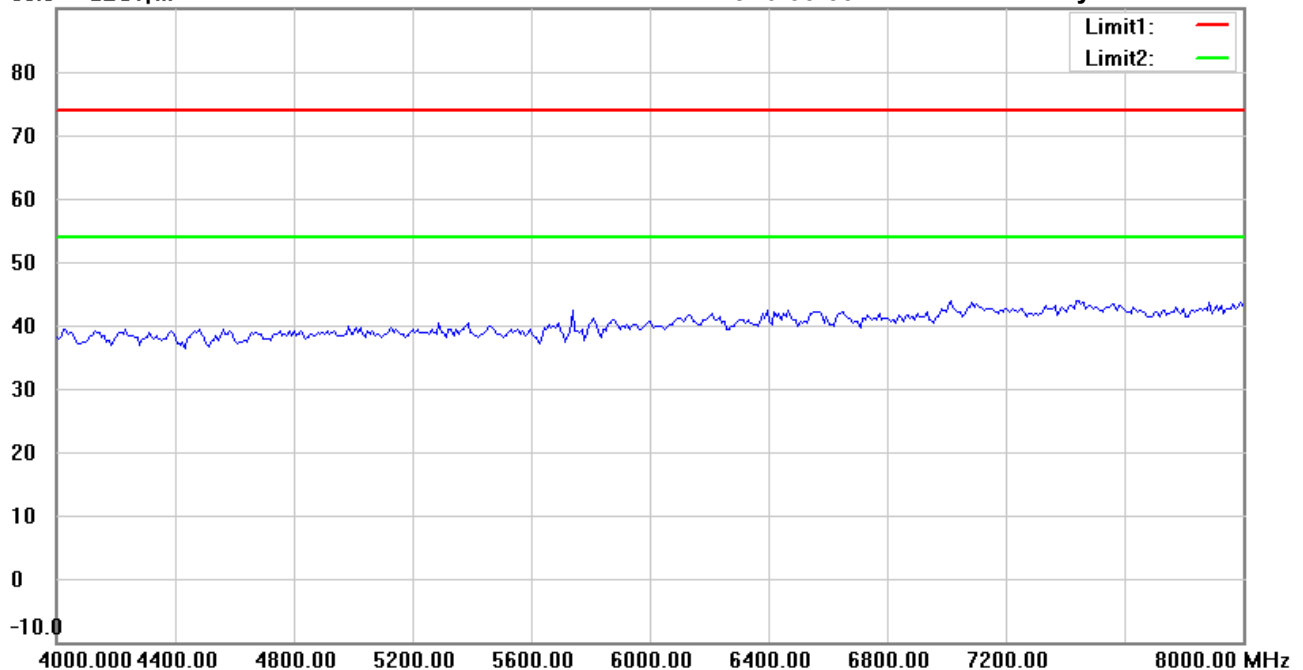

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:38:46 AM

Humidity:64.7 %

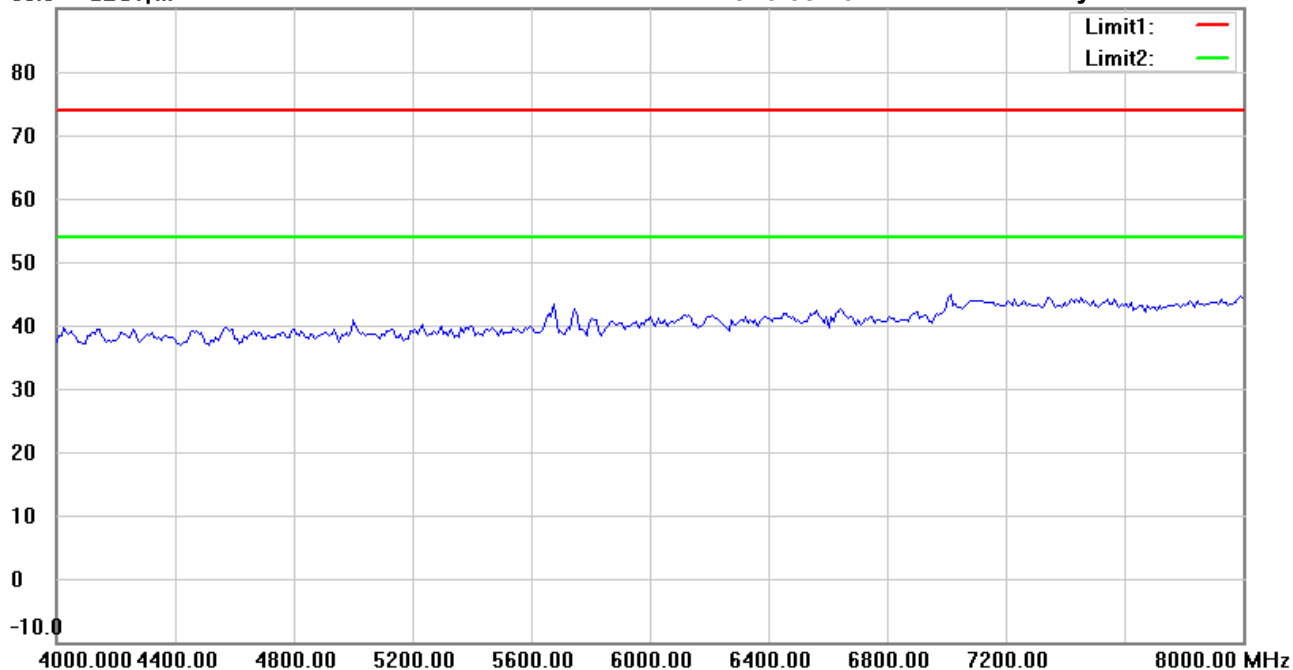

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:36:56 AM

Humidity: 64.7 %

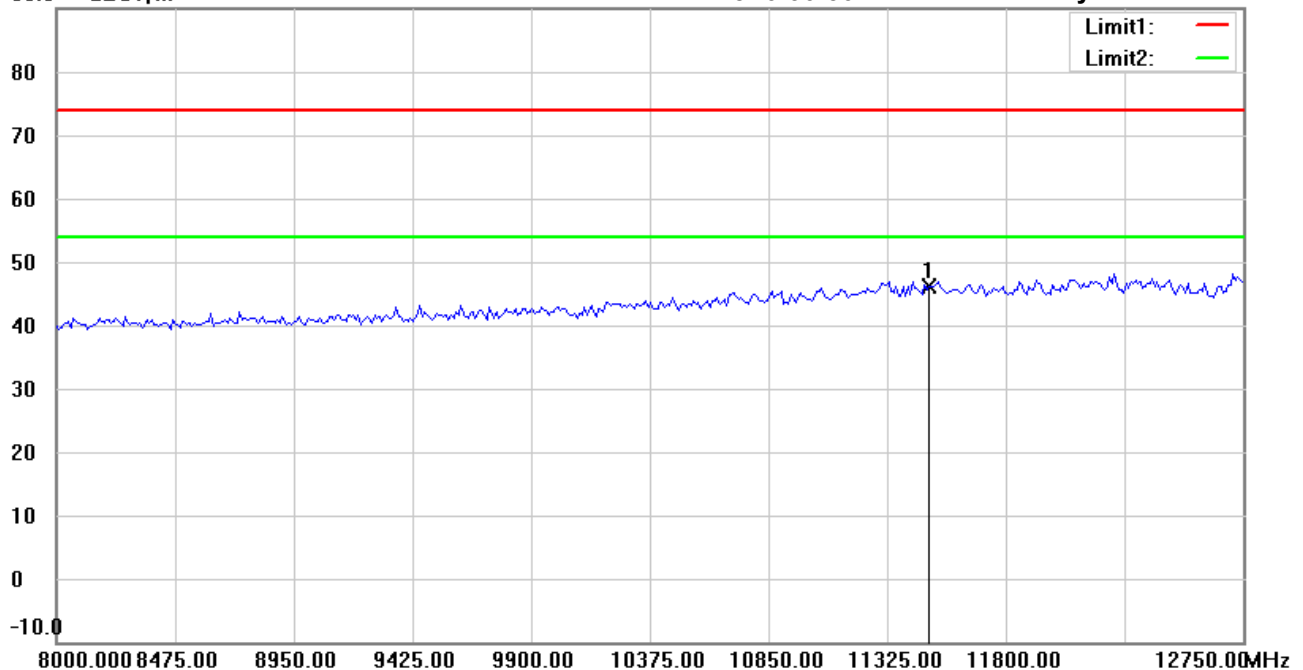

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11490.000	34.87	peak	11.36	46.23	74.00	150	50	-27.77	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:39:49 AM

Humidity: 64.7 %

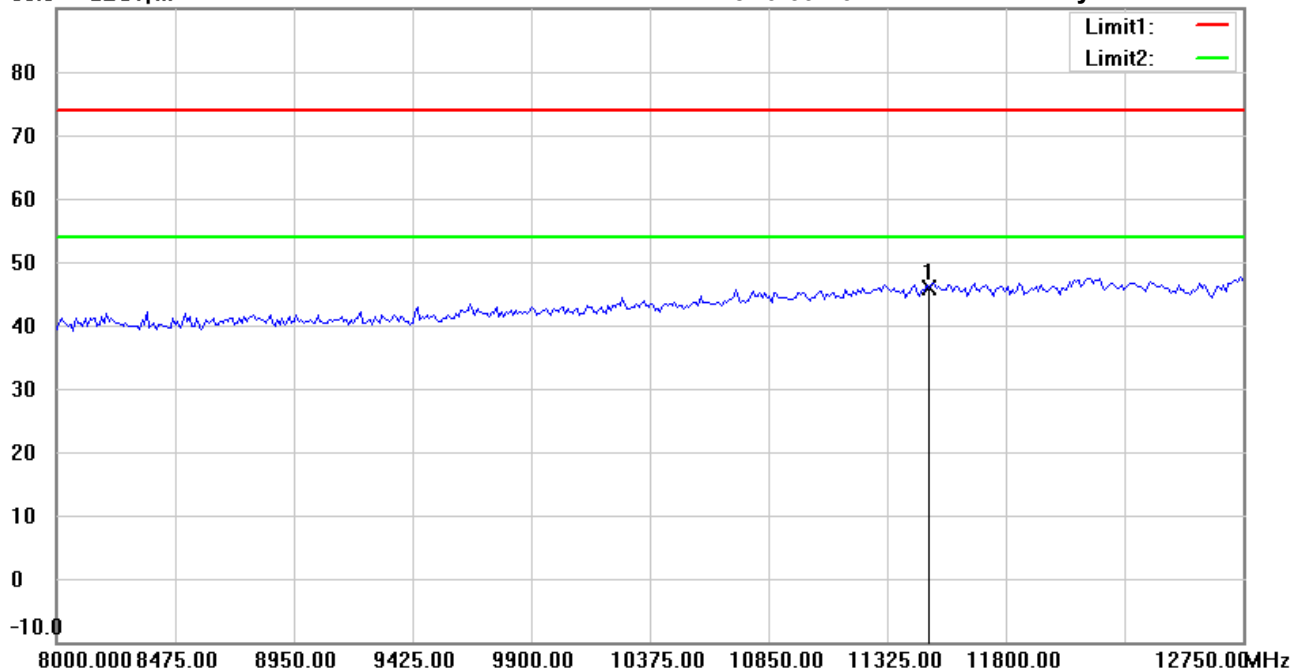

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11490.000	34.63	peak	11.36	45.99	74.00	150	275	-28.01	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:38:06 AM

Humidity: 64.7 %

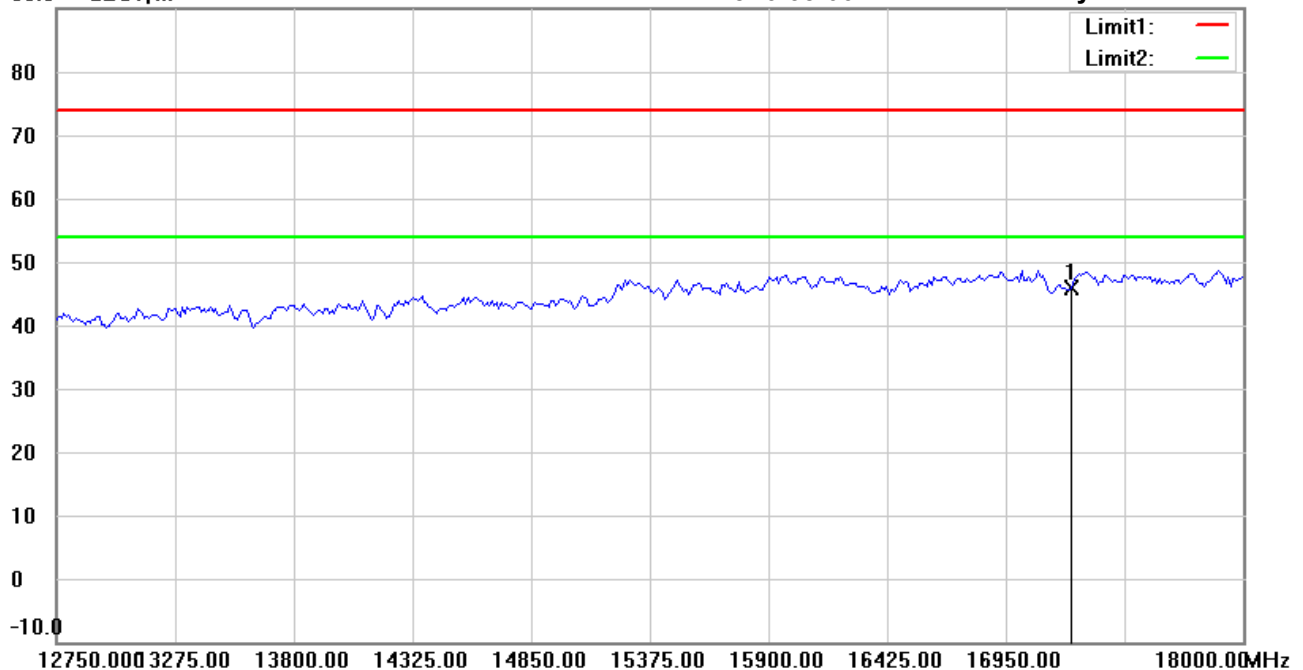

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17235.000	26.67	peak	19.23	45.90	74.00	150	335	-28.10	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/6/2019

Temperature: 22.3 °C

Time: 6:40:58 AM

Humidity: 64.7 %

90.0 dBuV/m

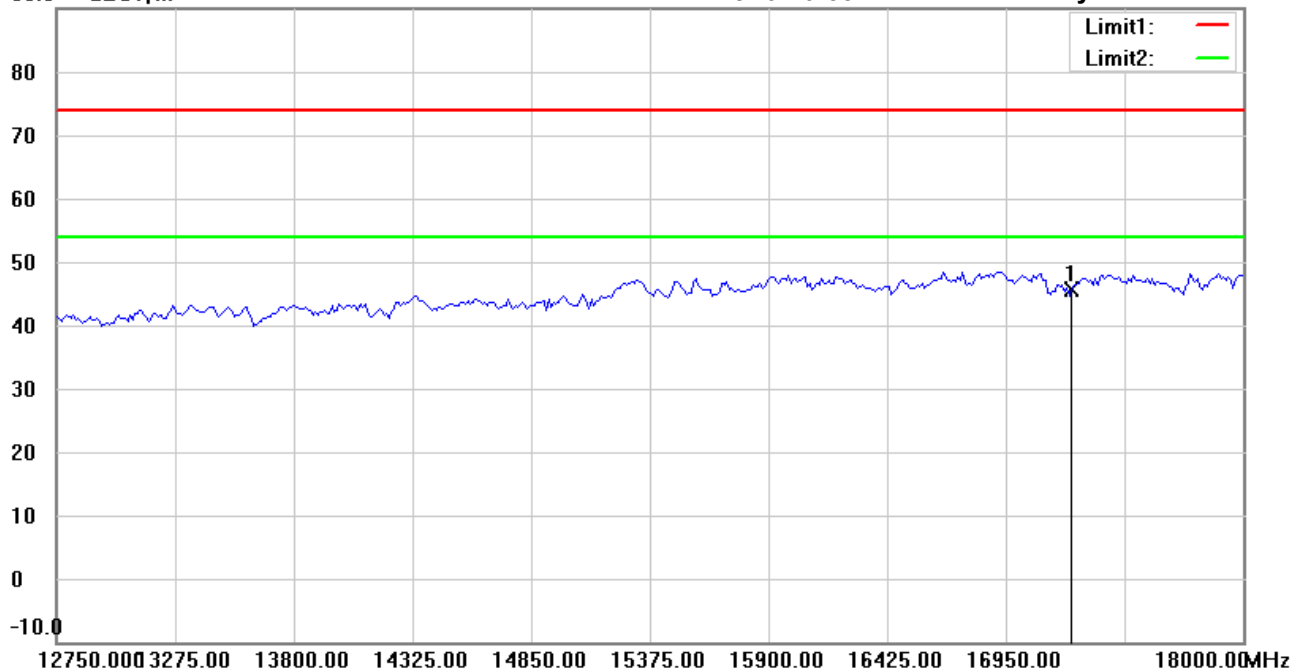

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17235.000	26.48	peak	19.23	45.71	74.00	150	220	-28.29	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:38:16 AM

Humidity:64.7 %

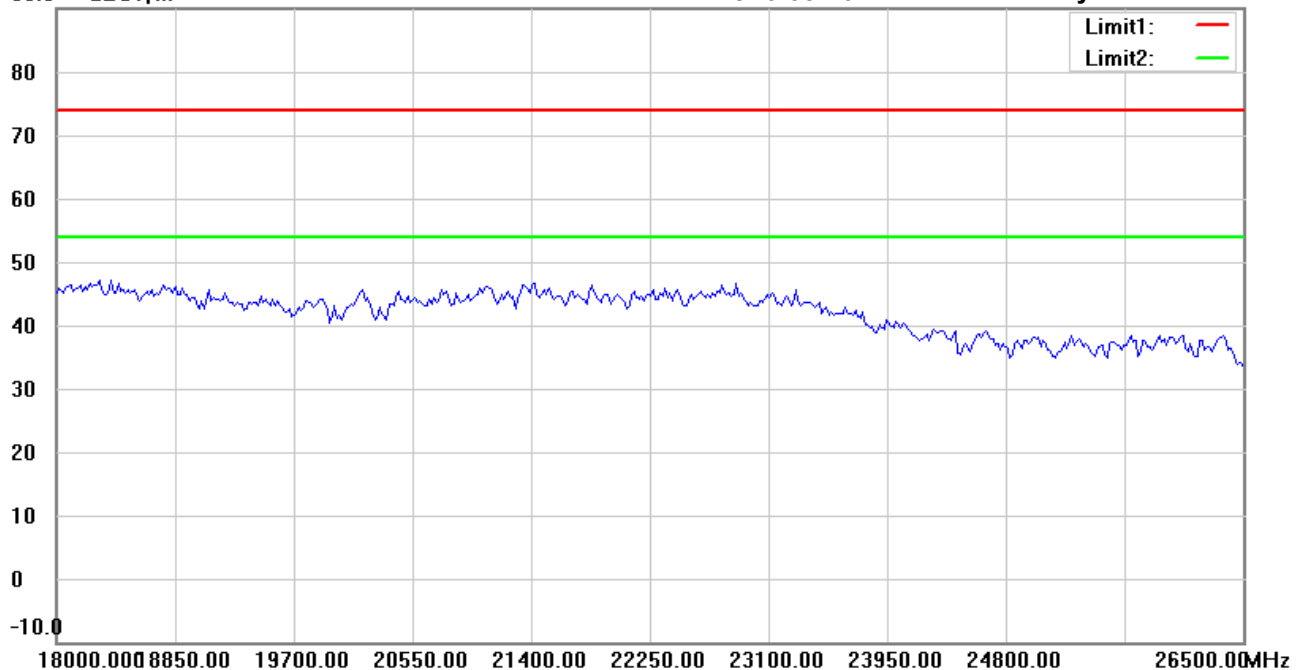

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #11


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:41:08 AM

Humidity: 64.7 %

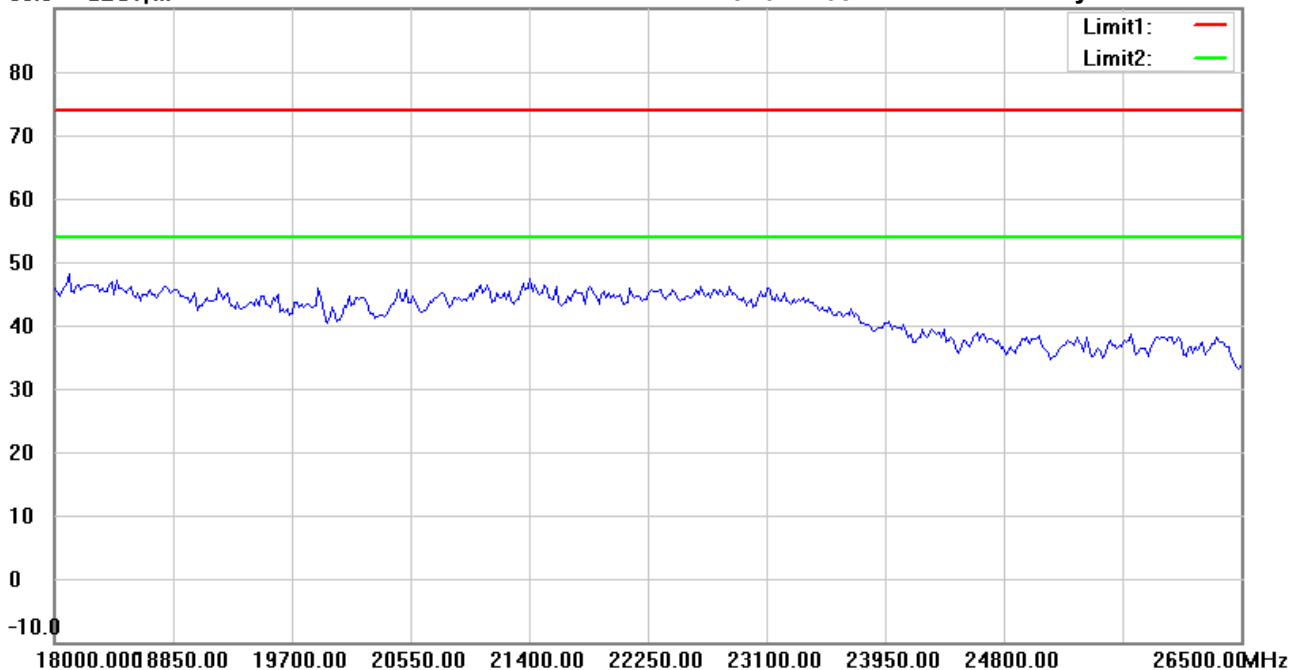

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:38:27 AM

Humidity: 64.7 %

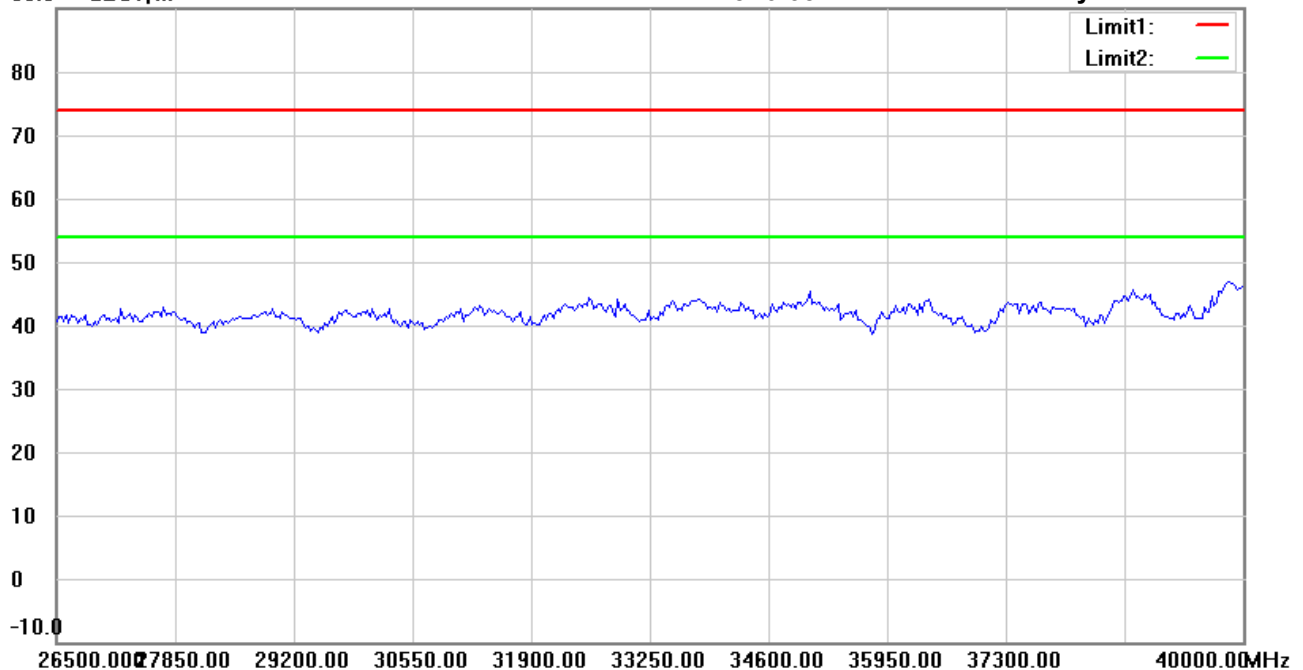

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:41:19 AM

Humidity: 64.7 %

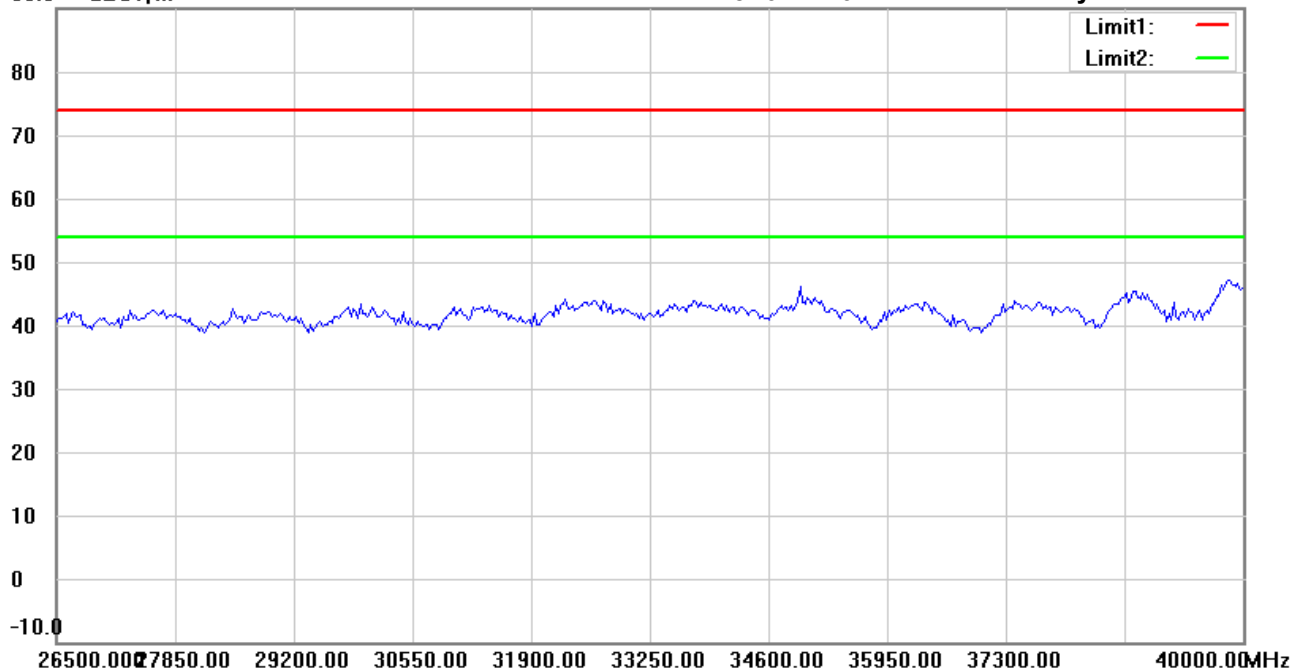

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:47:01 AM

Humidity:64.7 %

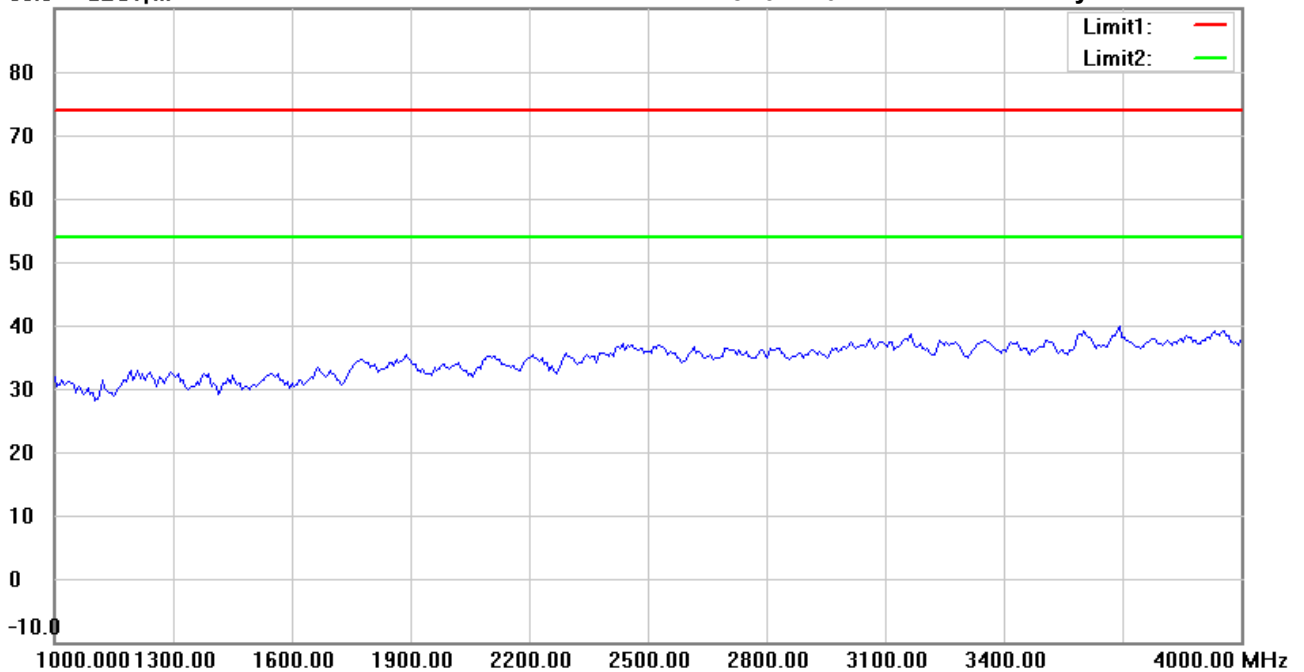

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:50:09 AM

Humidity: 64.7 %

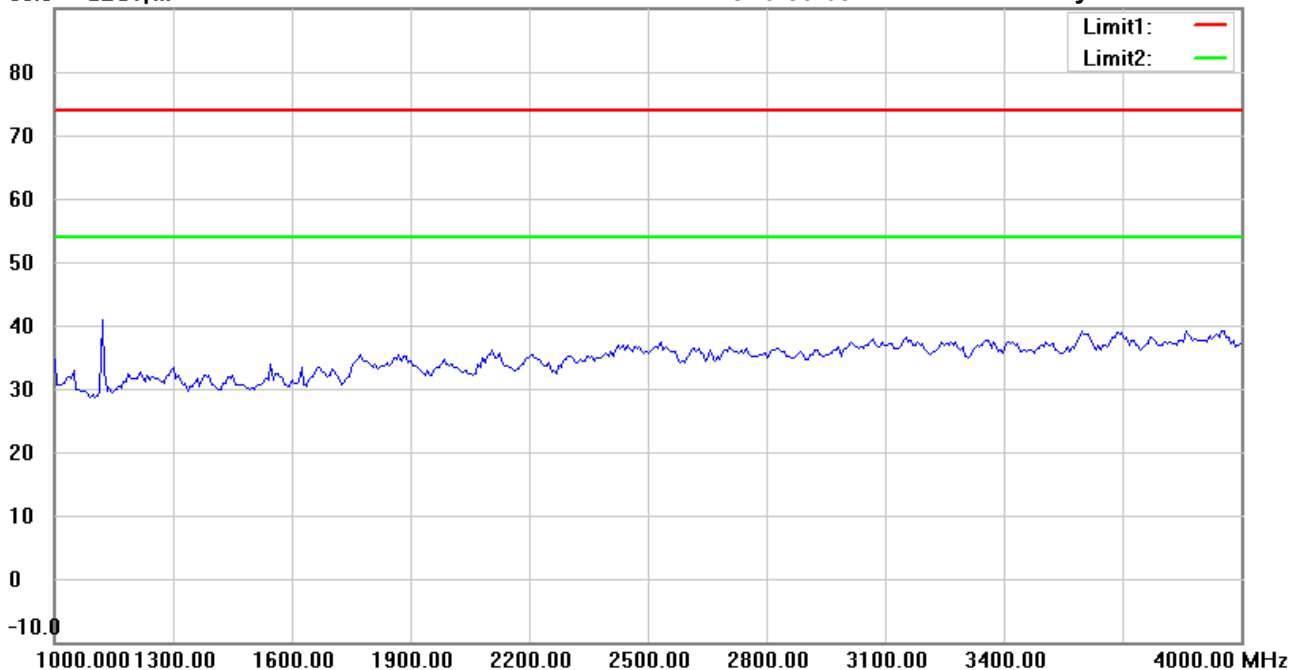

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:47:09 AM

Humidity: 64.7 %

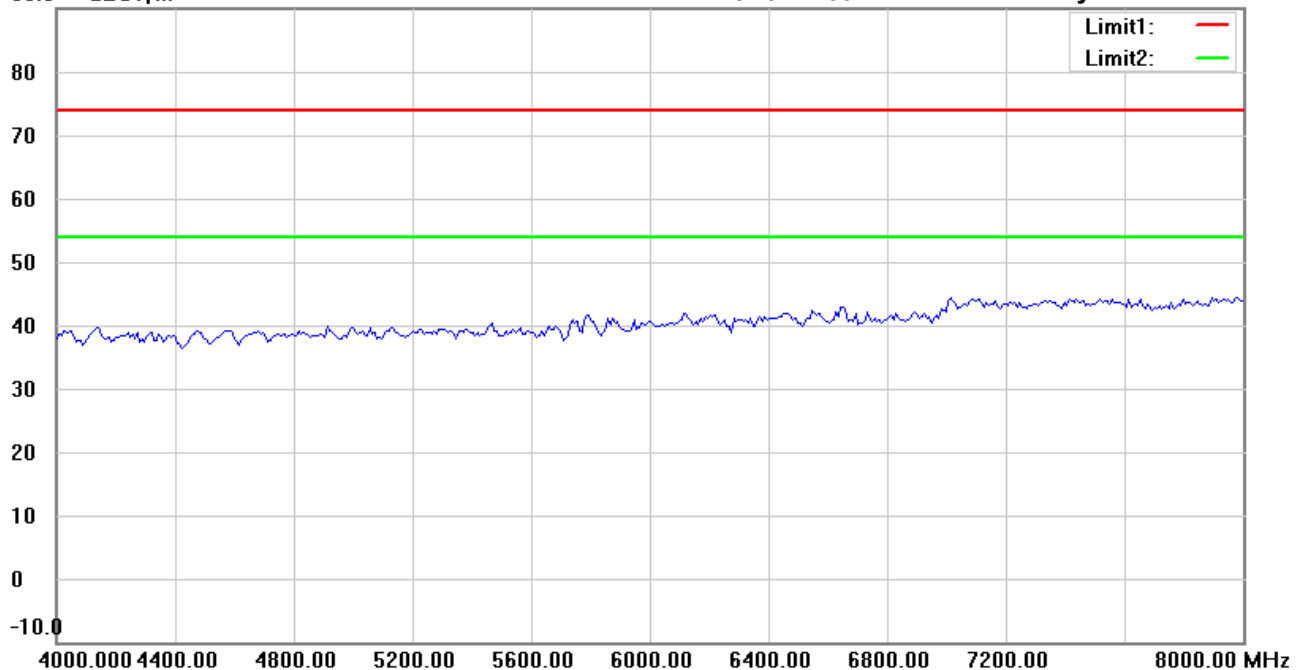

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:50:17 AM

Humidity:64.7 %

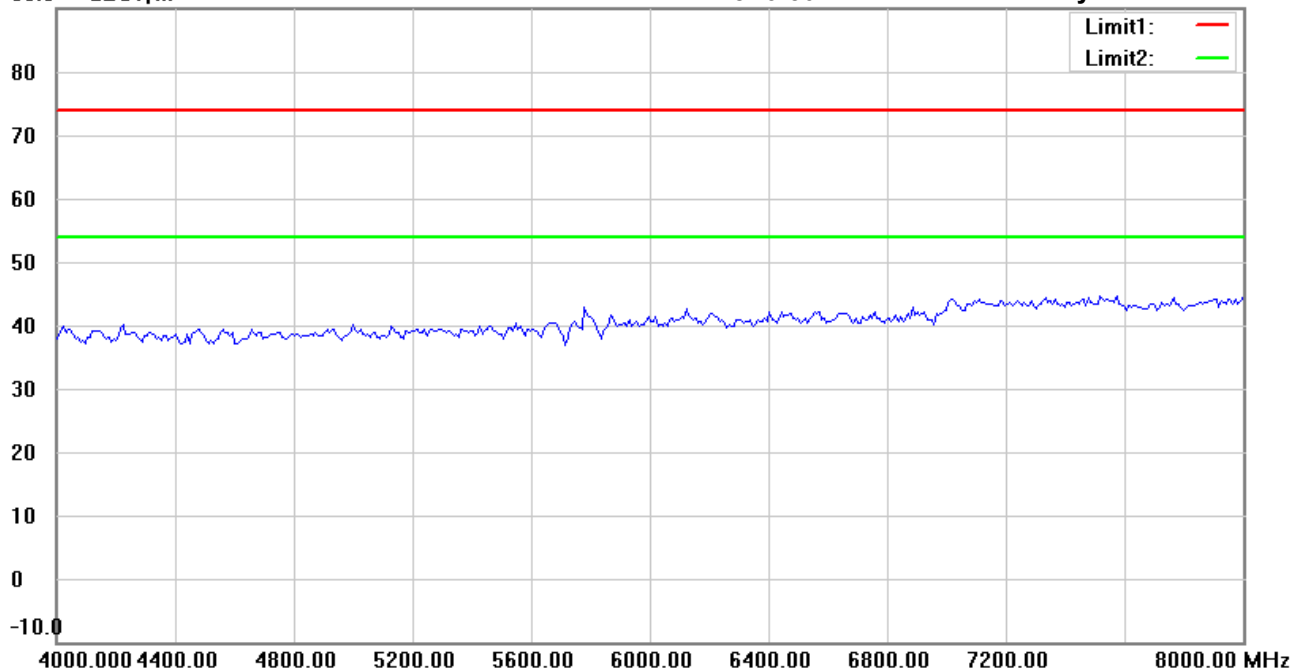

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:48:12 AM

Humidity: 64.7 %

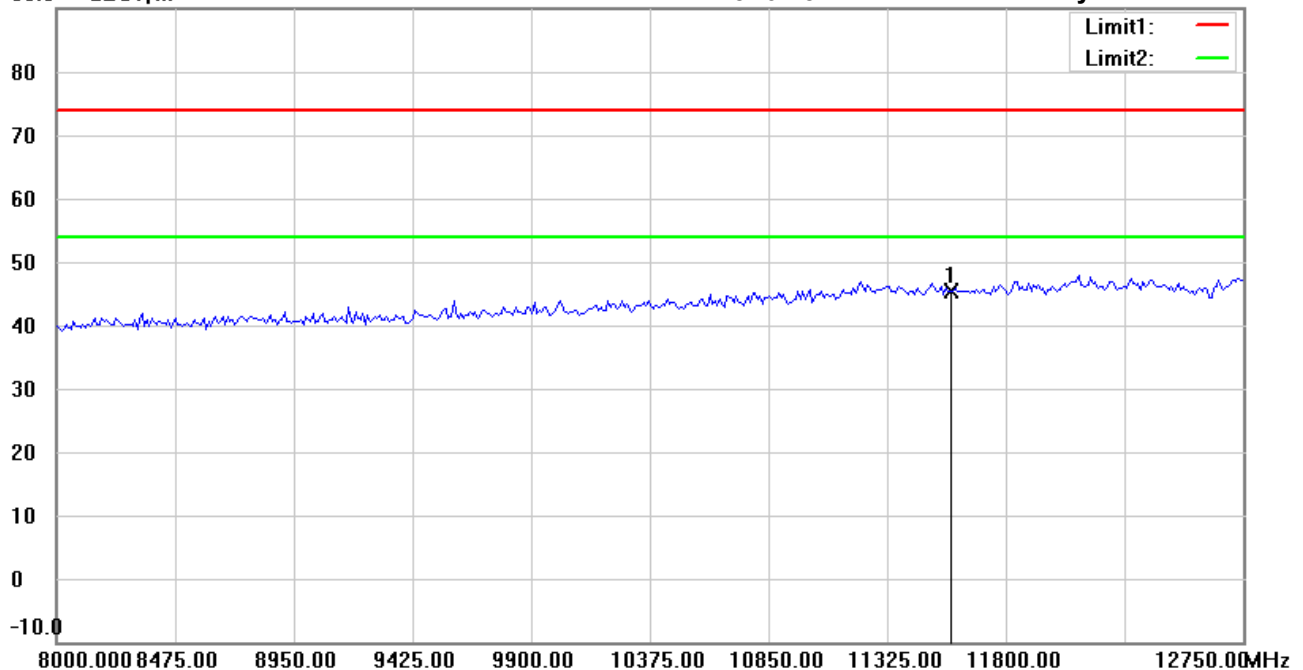

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	34.34	peak	11.12	45.46	74.00	150	175	-28.54	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:51:59 AM

Humidity: 64.7 %

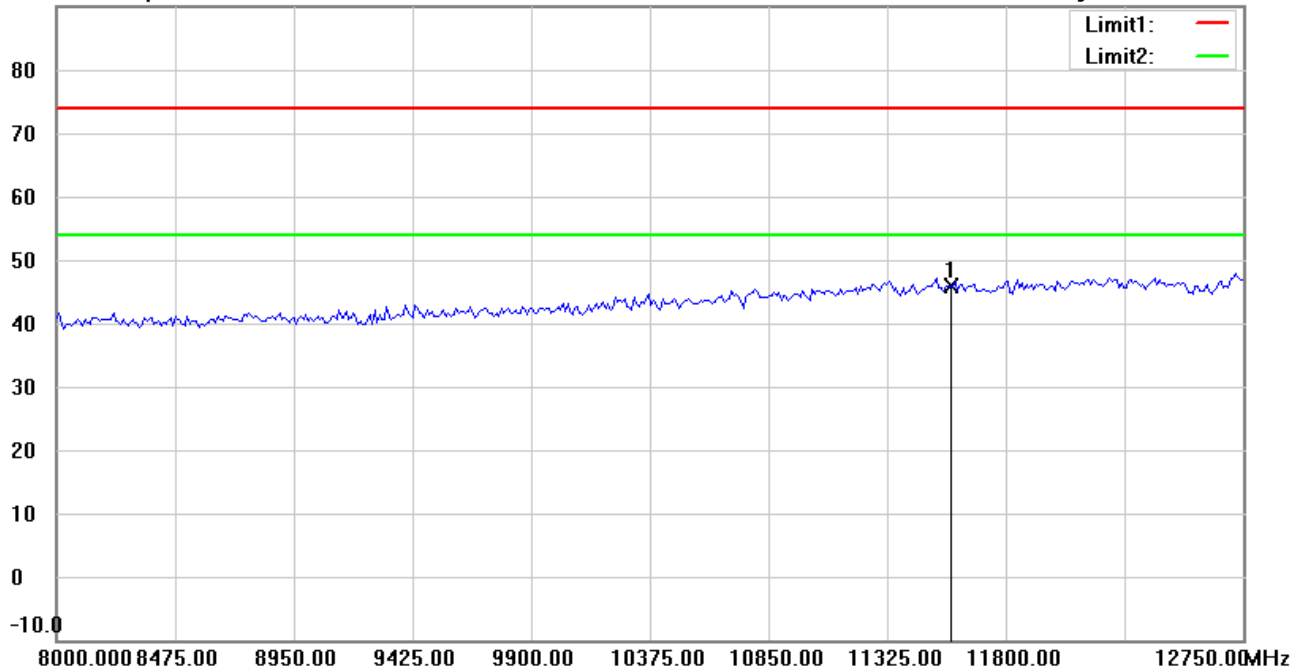

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	34.88	peak	11.12	46.00	74.00	150	0	-28.00	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:49:22 AM

Humidity: 64.7 %

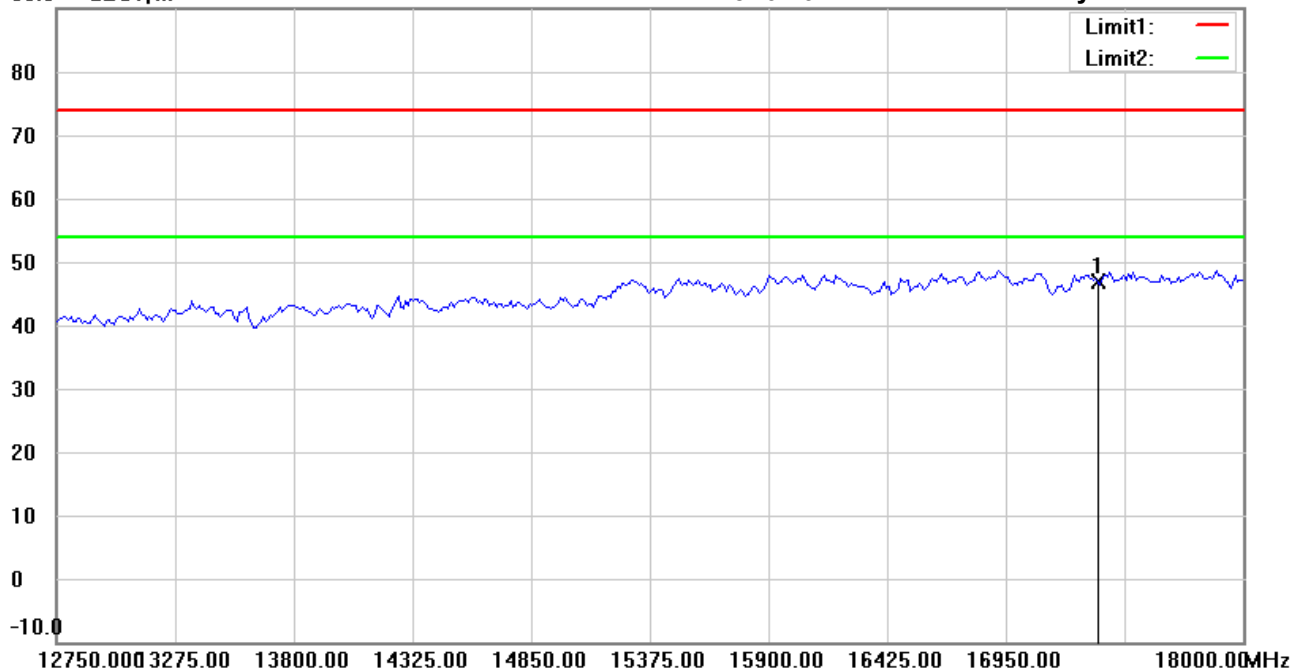

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	26.43	peak	20.45	46.88	74.00	150	205	-27.12	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:53:08 AM

Humidity: 64.7 %

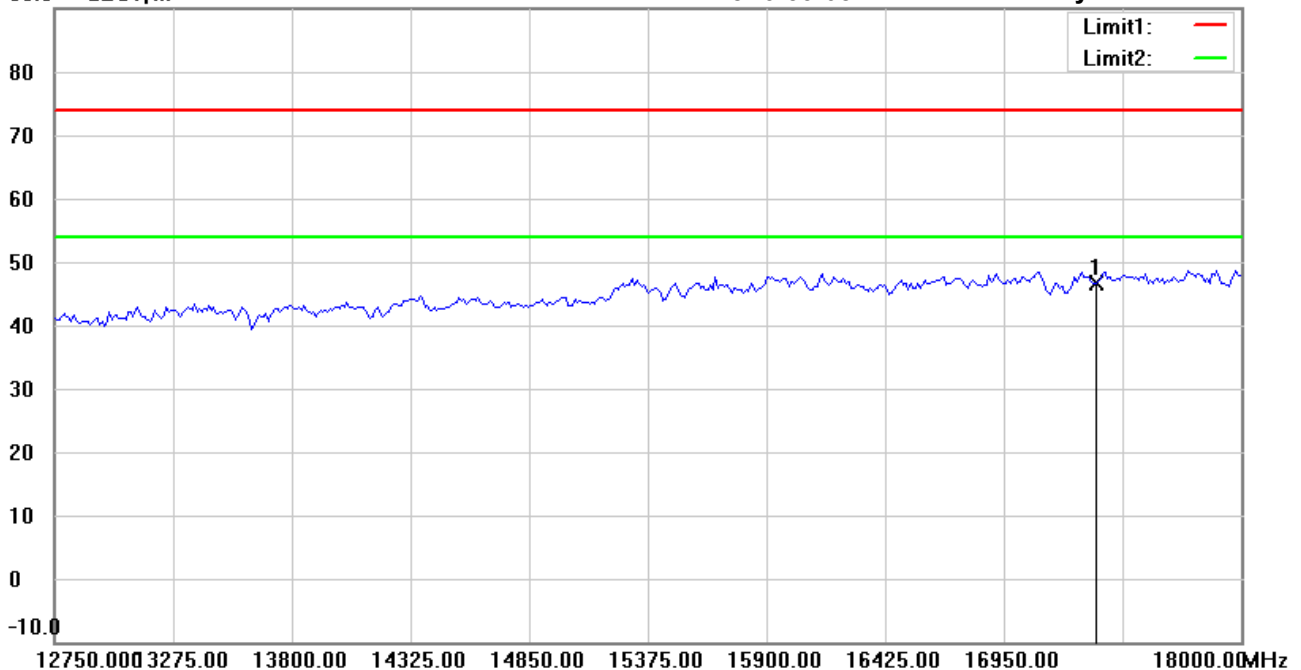

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	26.20	peak	20.45	46.65	74.00	150	280	-27.35	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:49:32 AM

Humidity:64.7 %

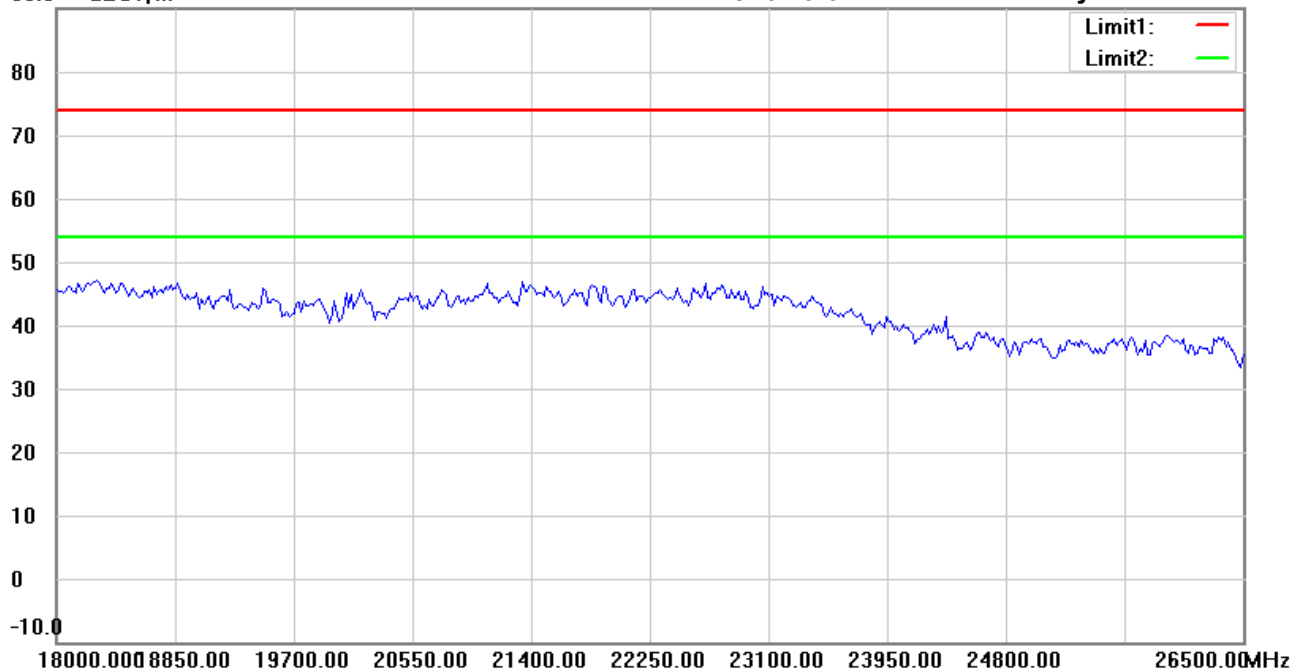

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #11


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:53:18 AM

Humidity: 64.7 %

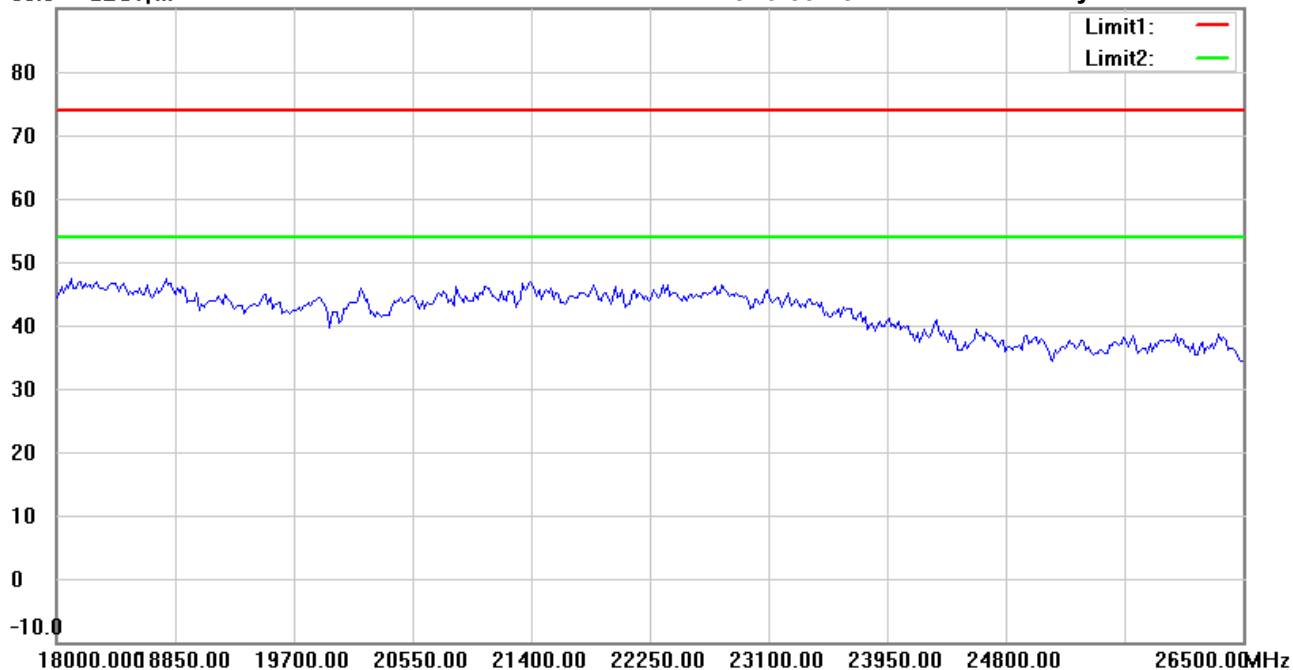

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:49:43 AM

Humidity: 64.7 %

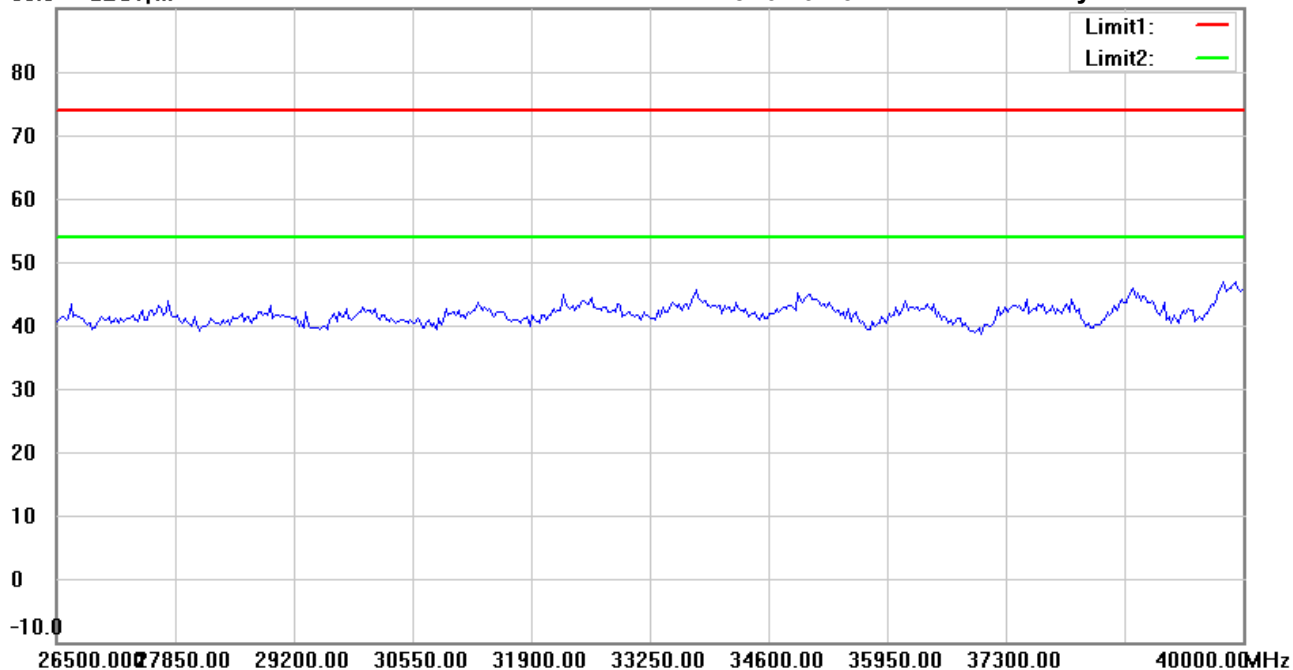

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:53:29 AM

Humidity:64.7 %

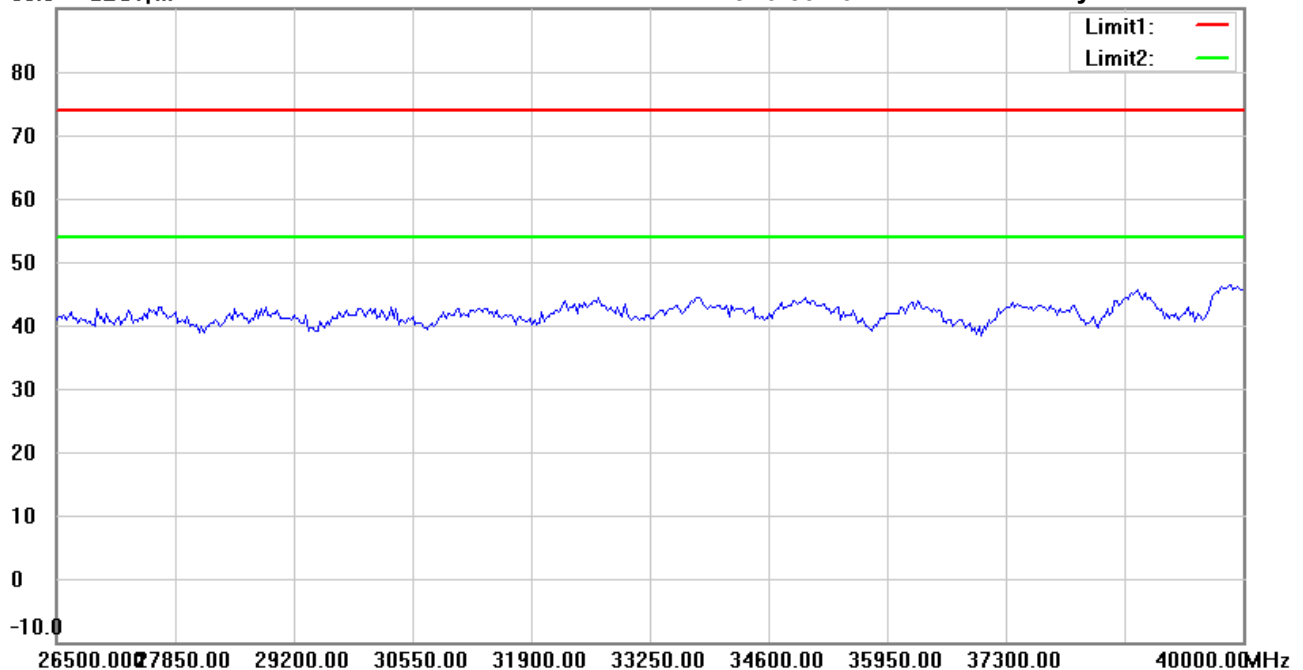

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

Time: 6:56:01 AM

Humidity:64.7 %

90.0 dBuV/m

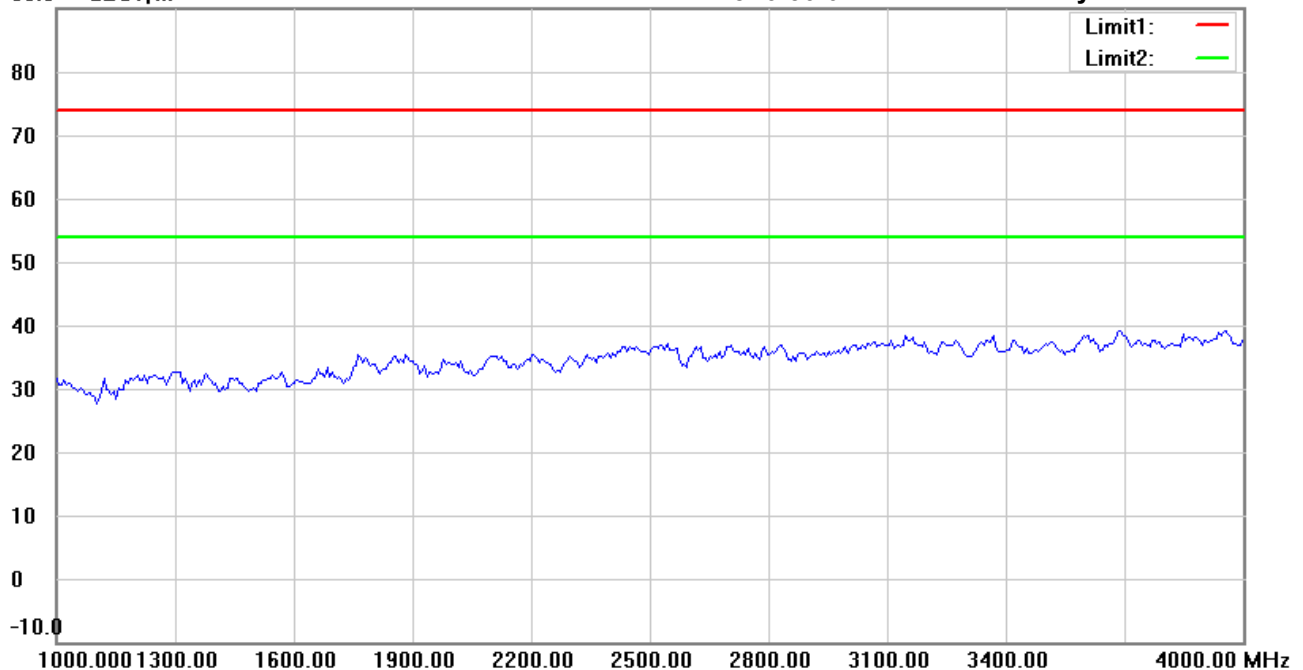

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:58:58 AM

Humidity:64.7 %

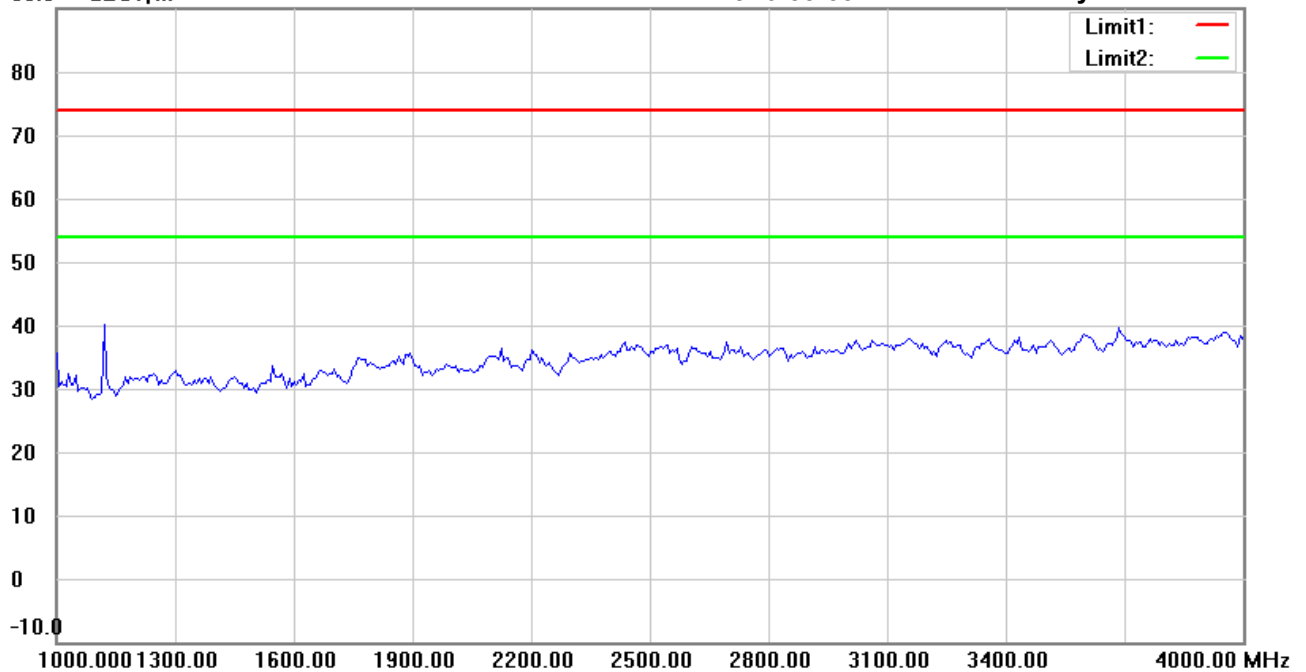

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:56:09 AM

Humidity: 64.7 %

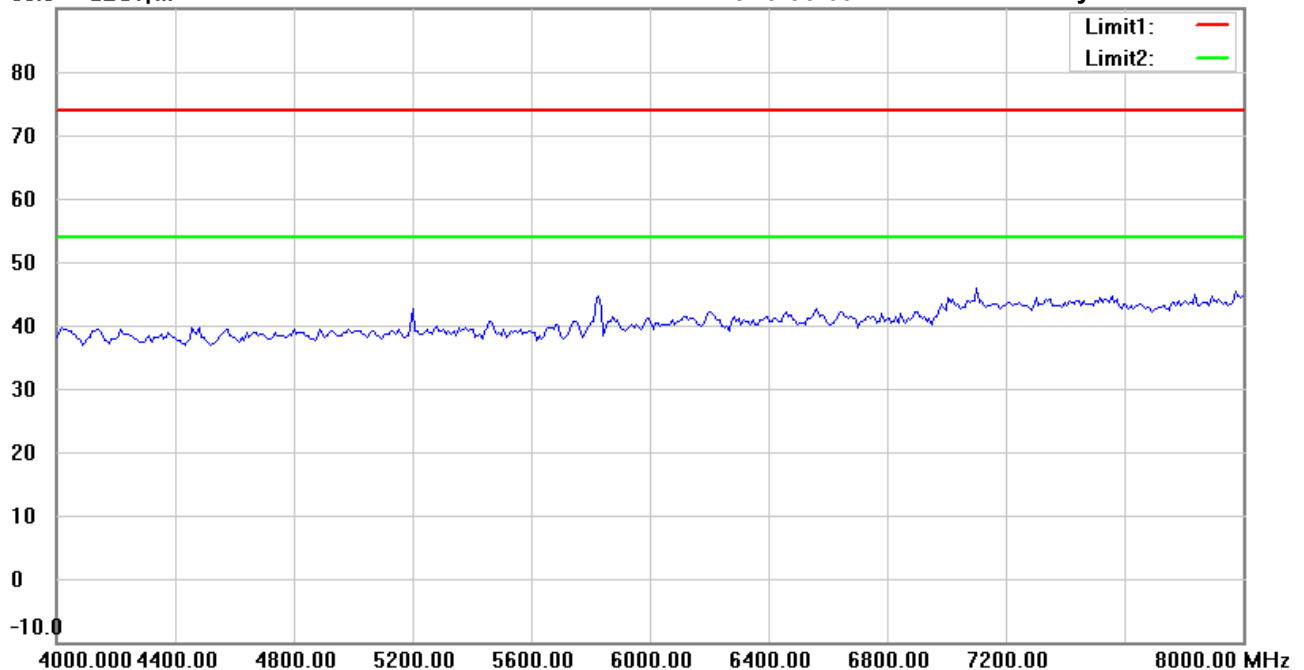

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:59:06 AM

Humidity: 64.7 %

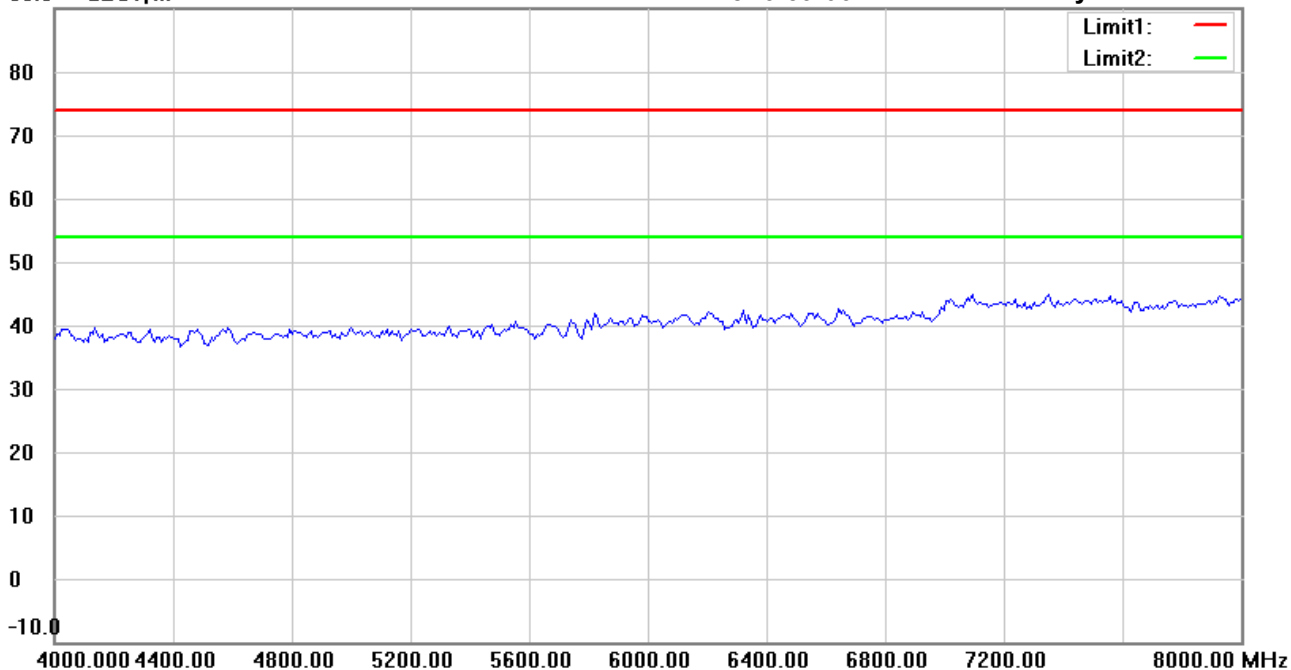

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:57:13 AM

Humidity: 64.7 %

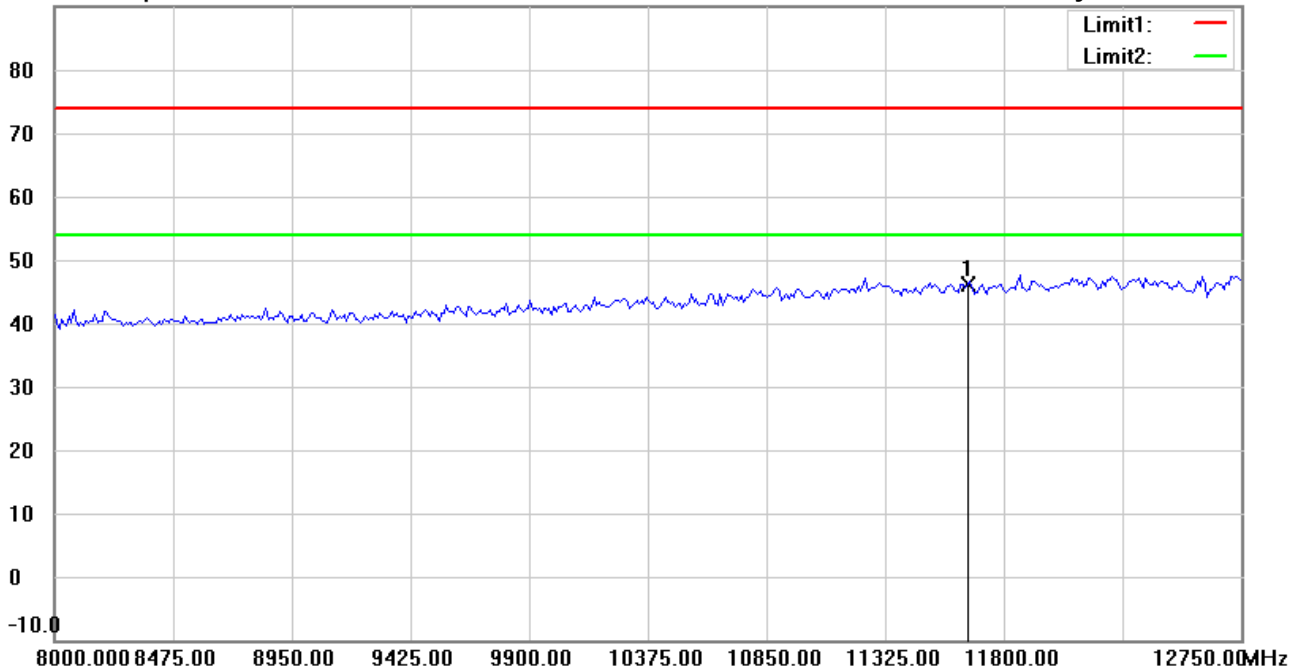

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	35.09	peak	10.97	46.06	74.00	150	350	-27.94	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:00:09 AM

Humidity: 64.7 %

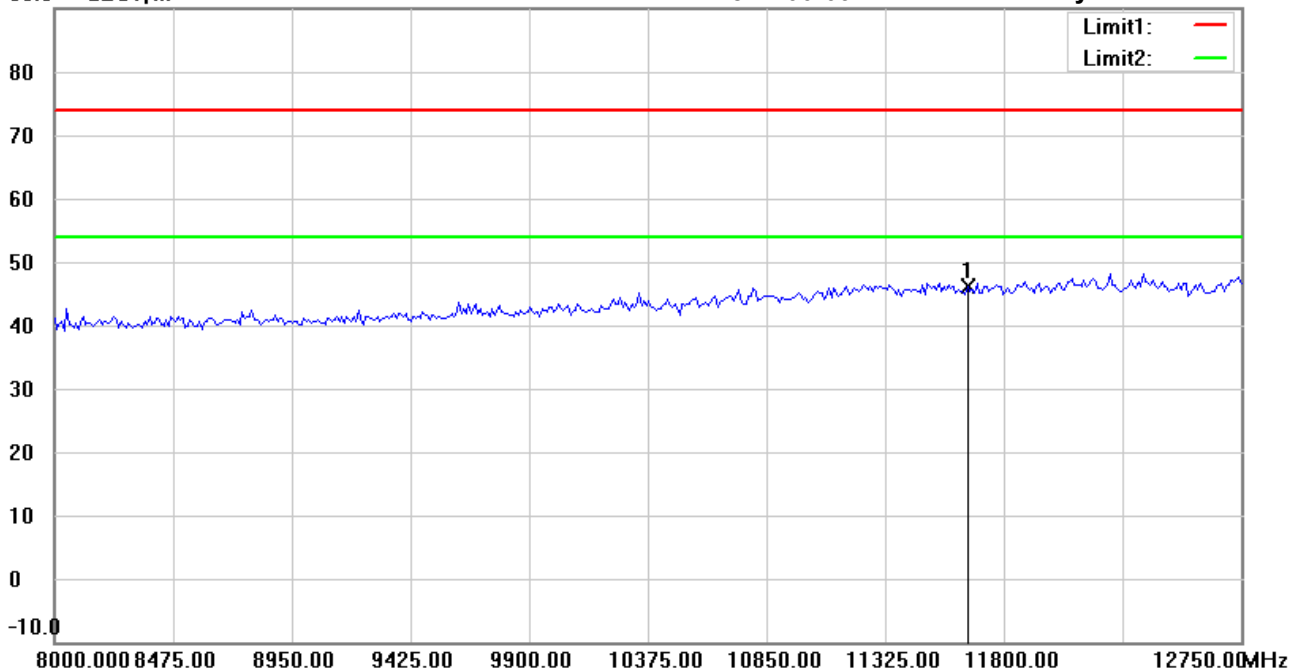

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	35.27	peak	10.97	46.24	74.00	150	275	-27.76	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:58:22 AM

Humidity: 64.7 %

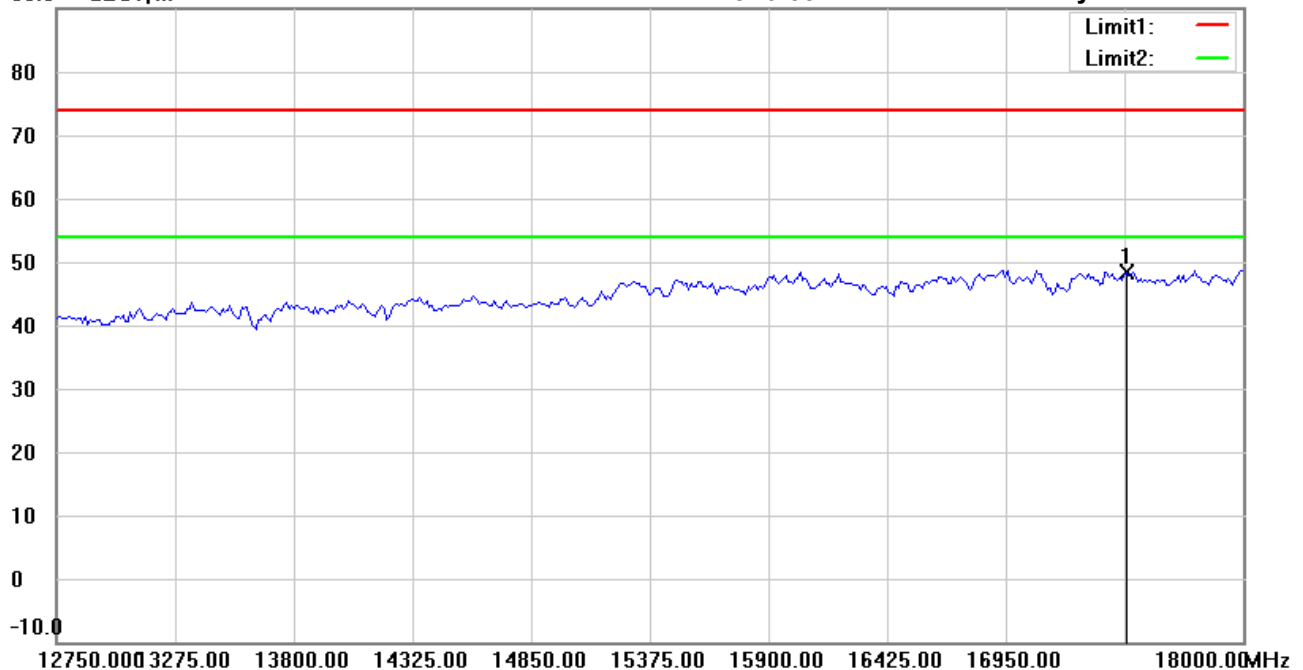

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	28.11	peak	20.33	48.44	74.00	150	60	-25.56	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:01:18 AM

Humidity:64.7 %

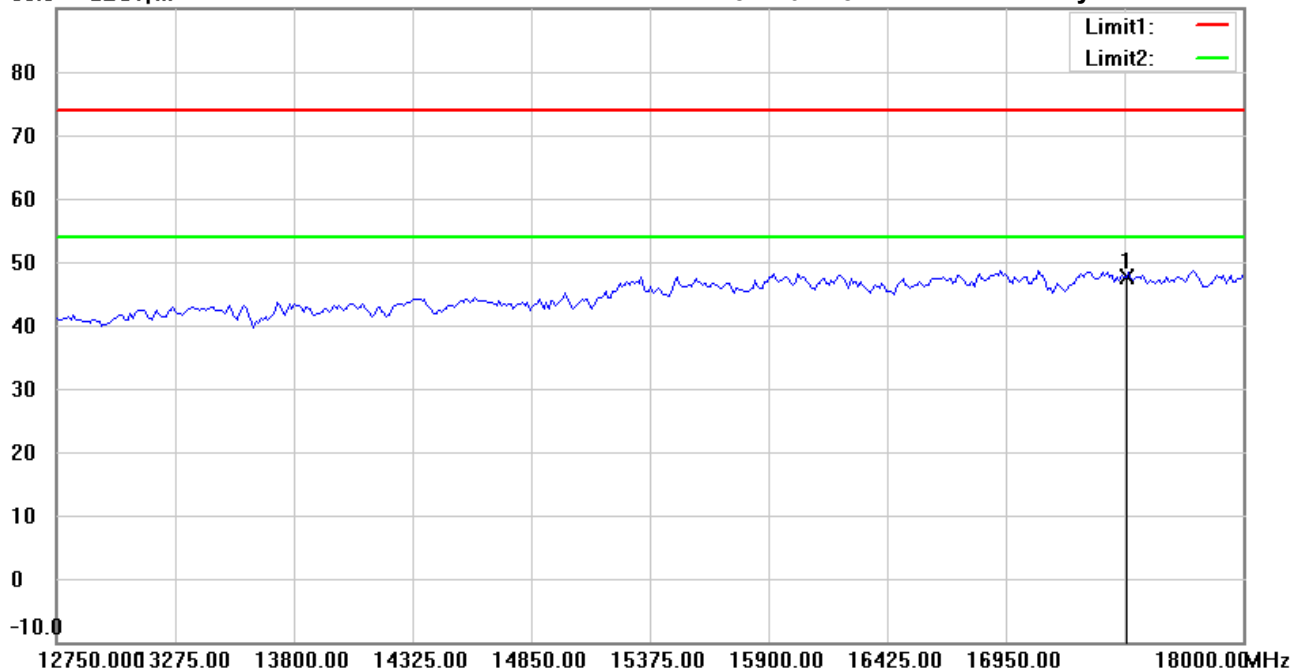

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	27.19	peak	20.33	47.52	74.00	150	230	-26.48	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 6:58:33 AM

Humidity:64.7 %

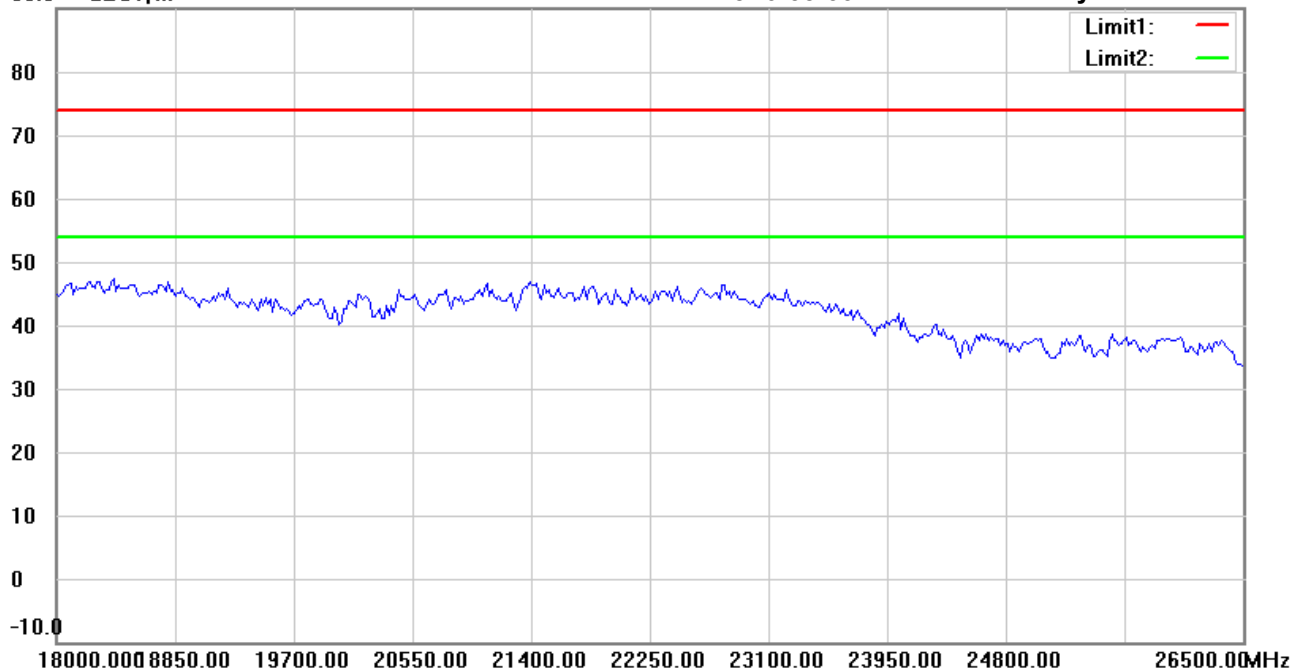

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #11


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:01:29 AM

Humidity: 64.7 %

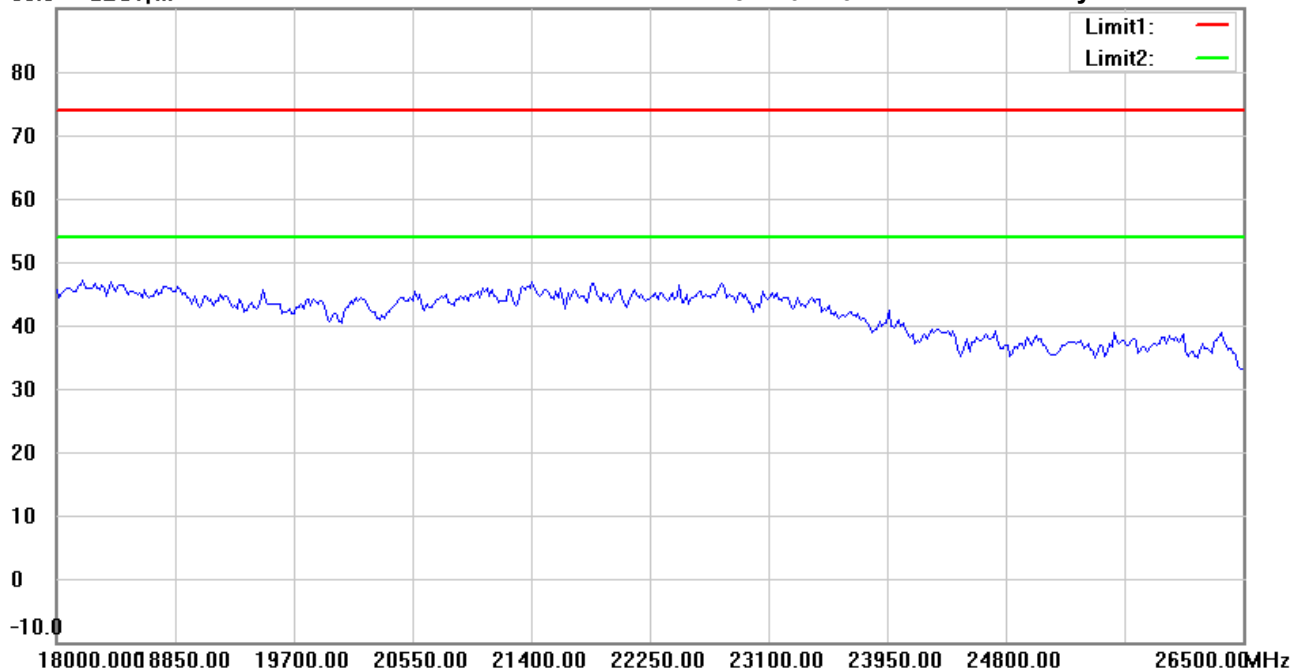

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 6:58:43 AM

Humidity: 64.7 %

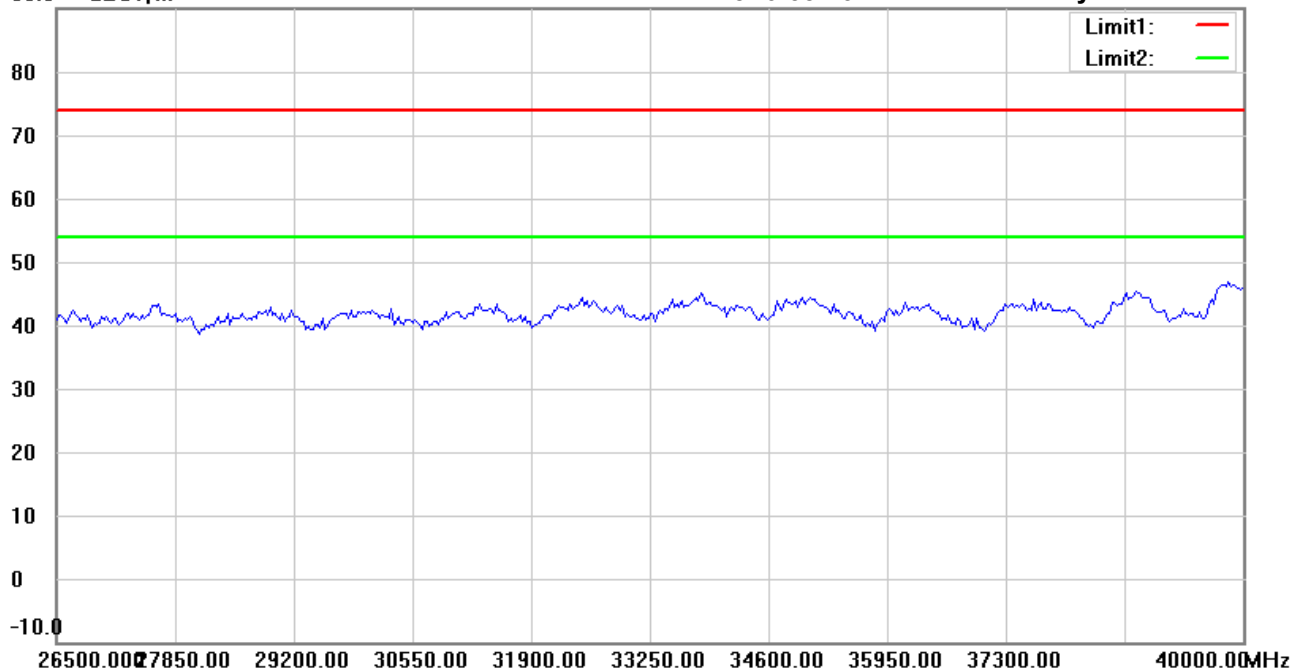

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:01:40 AM

Humidity:64.7 %

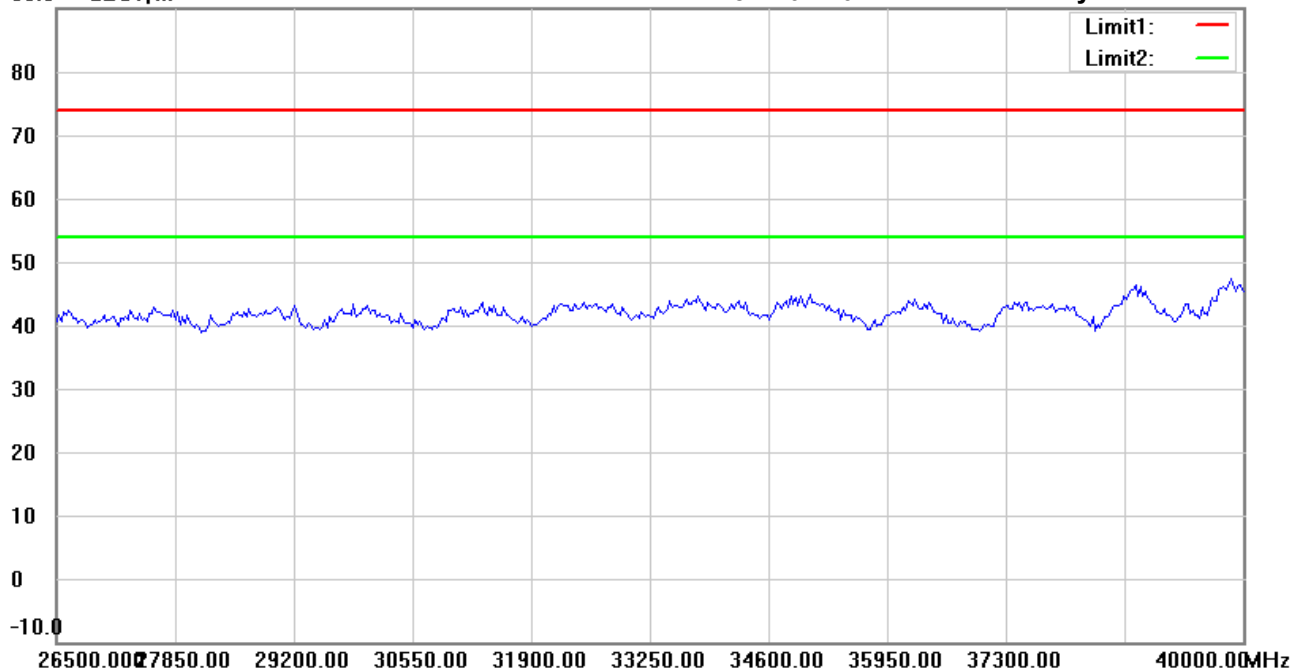

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Radiated Emission Measurement

Operator: Sky

File : 1_TX 802

Data : #1


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:51:41 PM

Humidity: 72.8 %

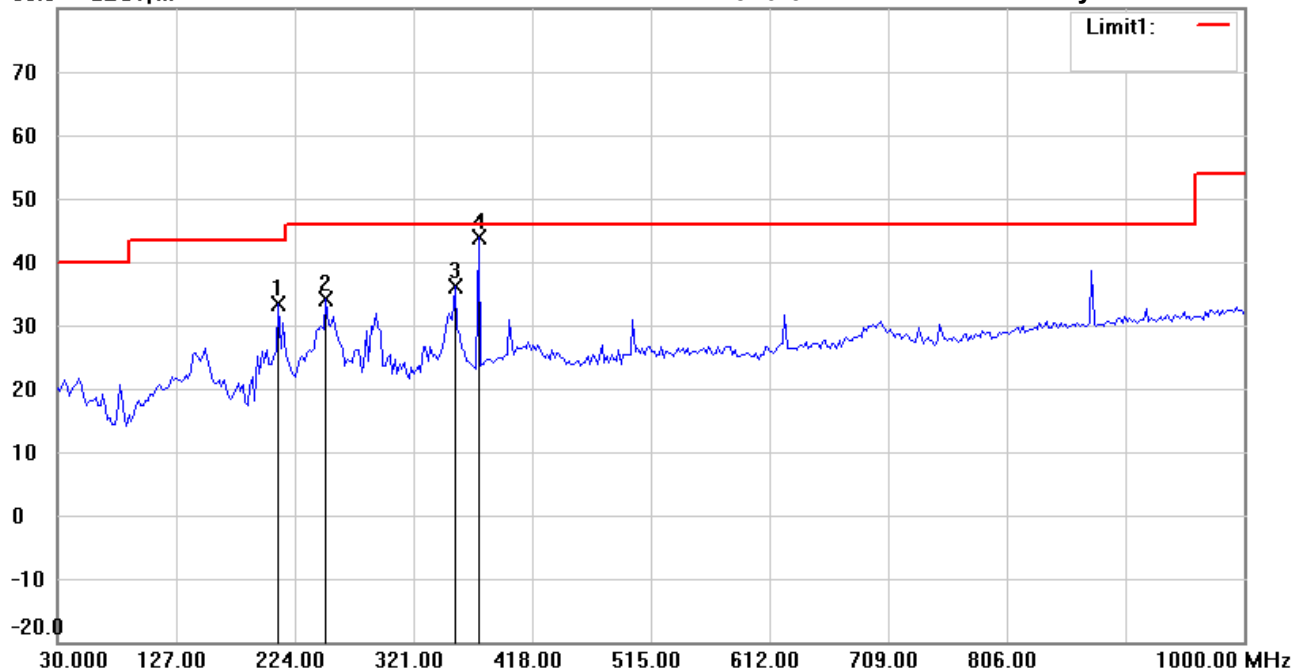

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

Polarization: *Horizontal*

EUT : W6M21903-18922

Power : 48 Vd.c.

M/N:

Distance: 3m

Test Mode : 802.11n20 CH36

Note :

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	210.7816	44.09	peak	-10.72	33.37	43.50	100	160	-10.13	
	249.6593	42.06	peak	-8.02	34.04	46.00	100	30	-11.96	
	354.6293	41.28	peak	-5.08	36.20	46.00	100	55	-9.80	
*	374.0681	48.37	peak	-4.50	43.87	46.00	100	170	-2.13	



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File : 1_TX 802

Data : #2


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:53:15 PM

Humidity: 72.8 %

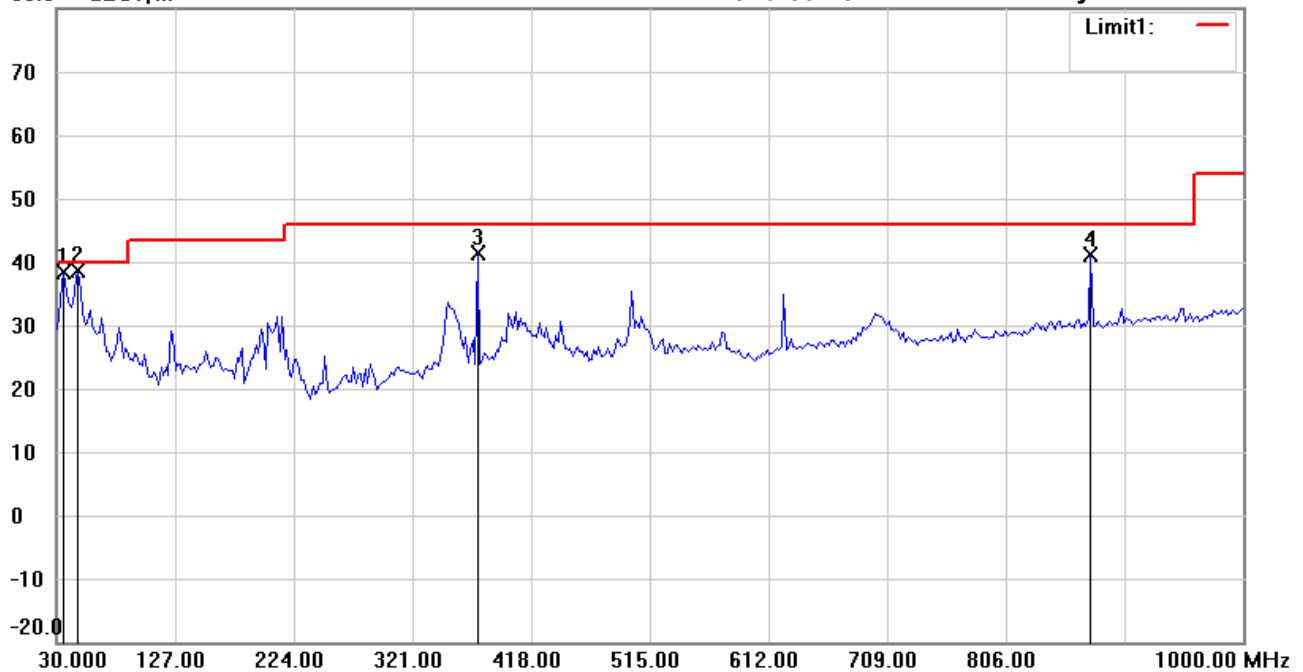

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n20 CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	35.8316	47.23	peak	-8.95	38.28	40.00	100	55	-1.72	
*	47.4950	48.49	peak	-9.91	38.58	40.00	100	30	-1.42	
	374.0681	45.93	peak	-4.50	41.43	46.00	100	255	-4.57	
	875.5912	38.22	peak	2.93	41.15	46.00	100	160	-4.85	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:42:08 AM

Humidity: 61.7 %

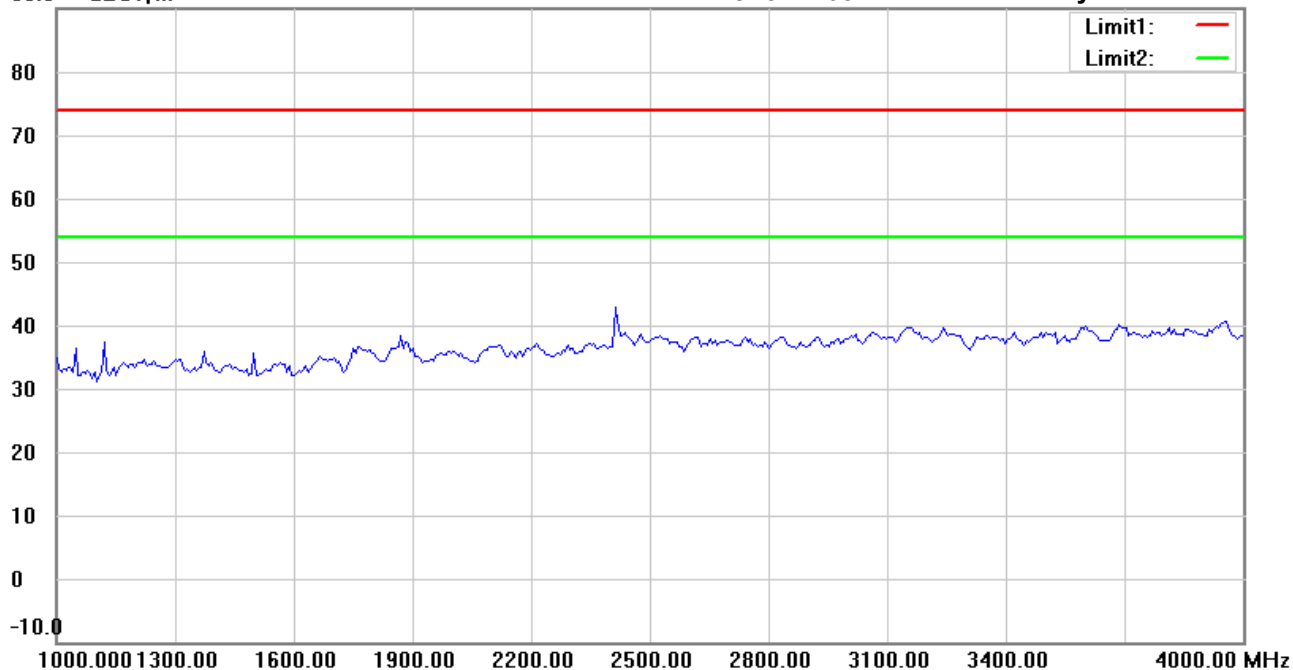

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:46:46 AM

Humidity: 61.7 %

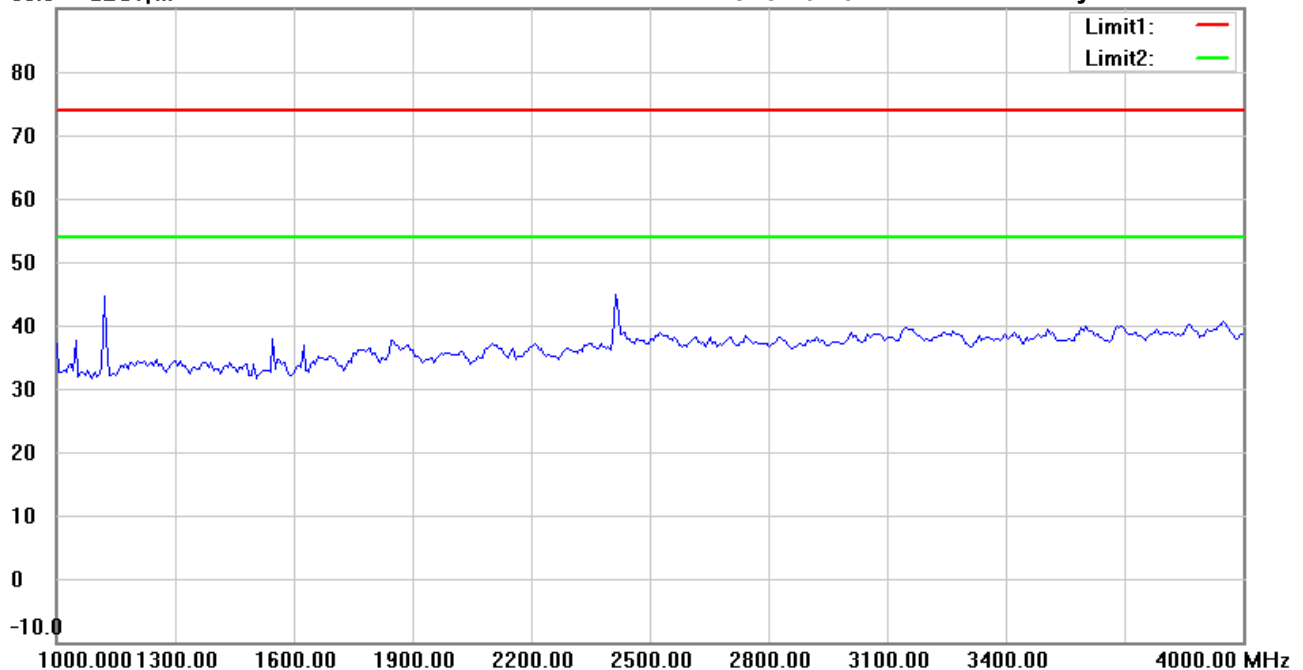

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:43:10 AM

Humidity: 61.7 %

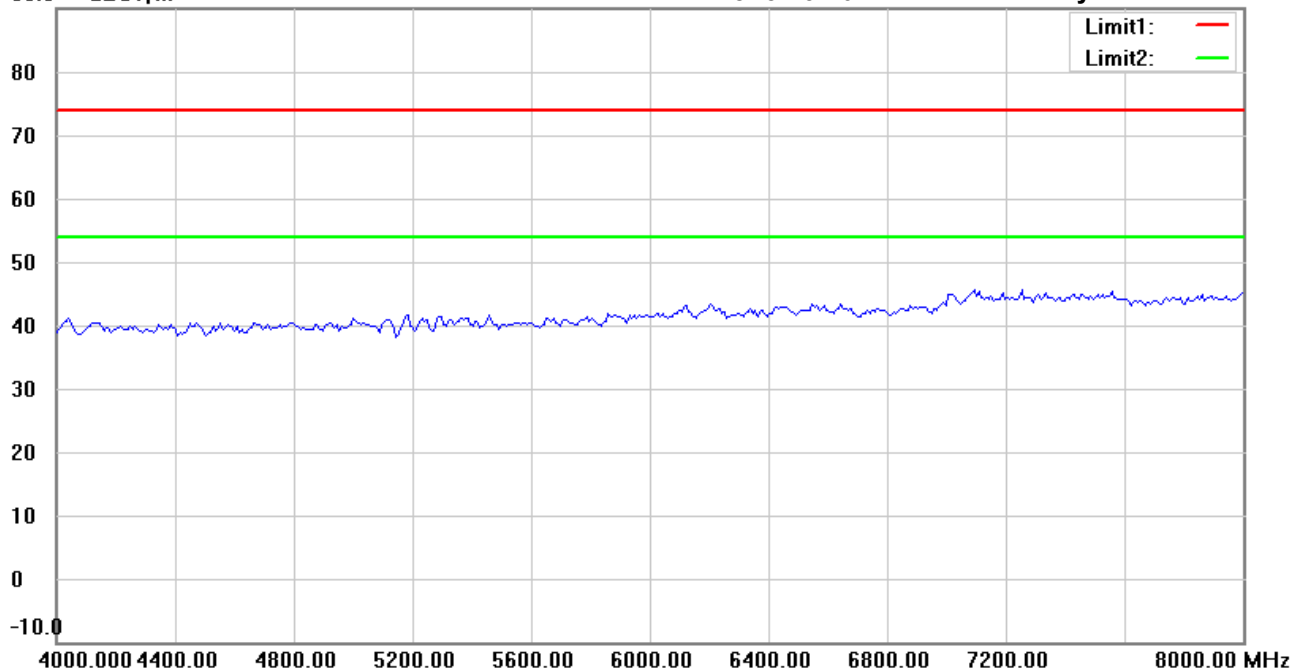

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:47:47 AM

Humidity: 61.7 %

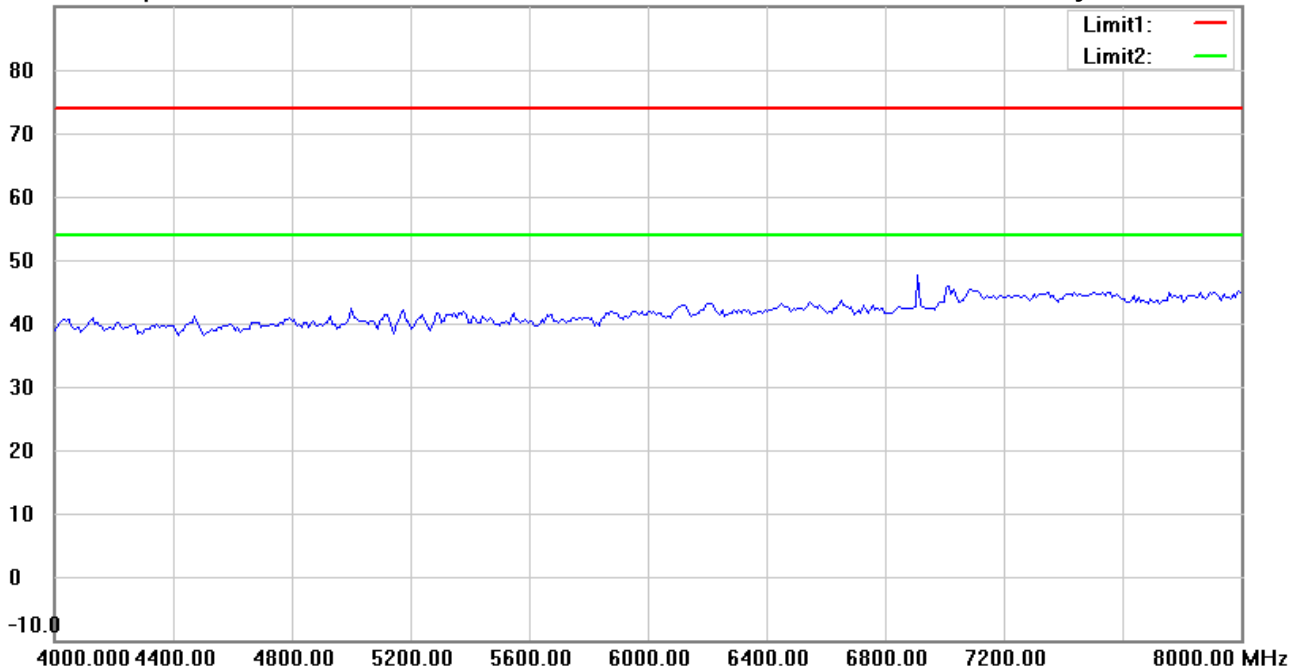

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:44:15 AM

Humidity:61.7 %

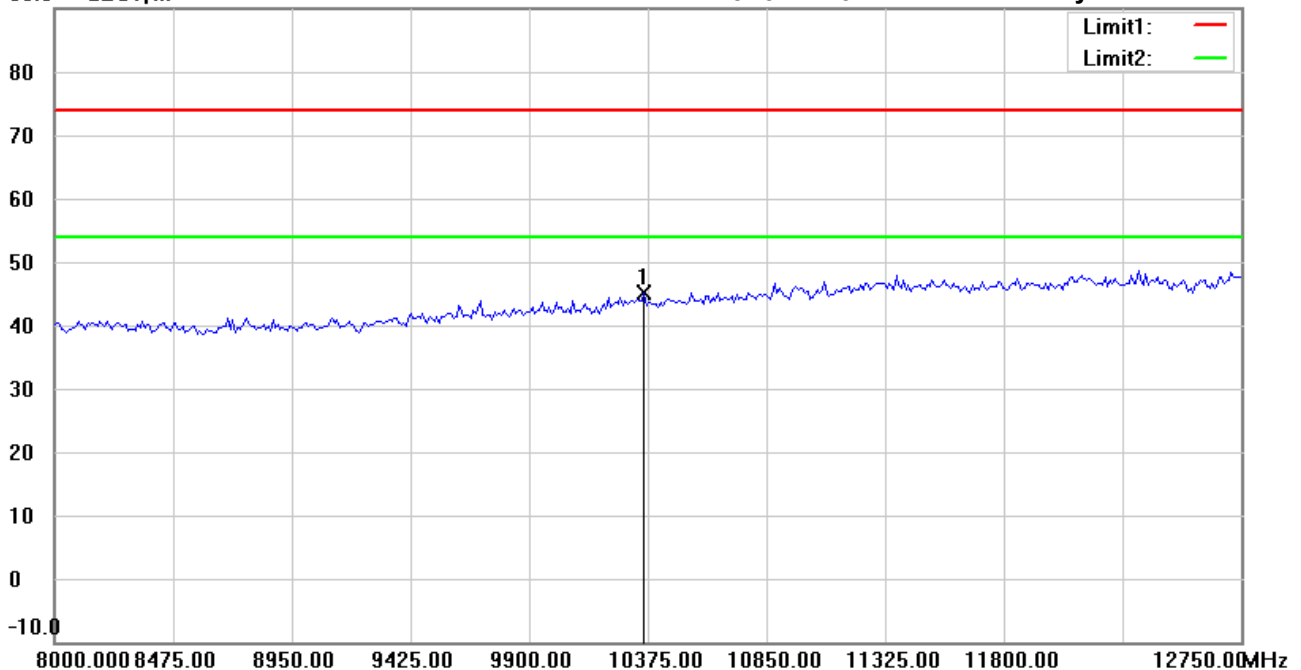

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10360.000	36.99	peak	8.23	45.22	74.00	150	150	-28.78	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:48:54 AM

Humidity: 61.7 %

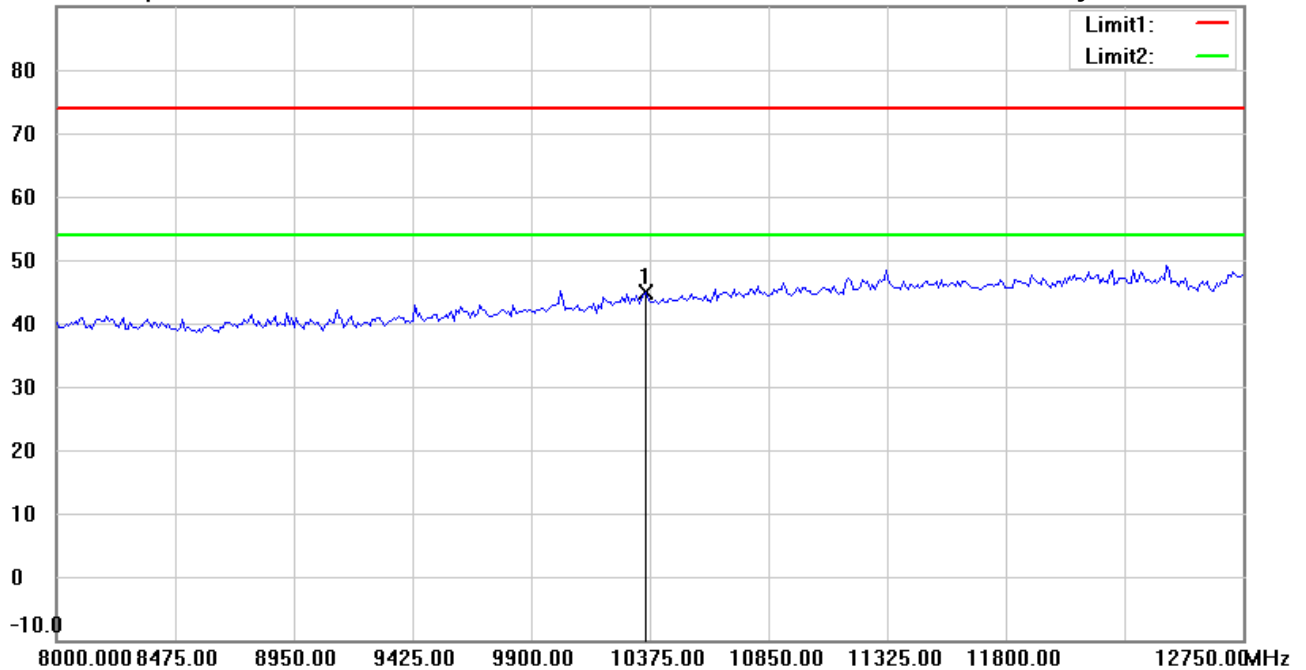

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10360.000	36.61	peak	8.23	44.84	74.00	150	45	-29.16	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:45:23 AM

Humidity: 61.7 %

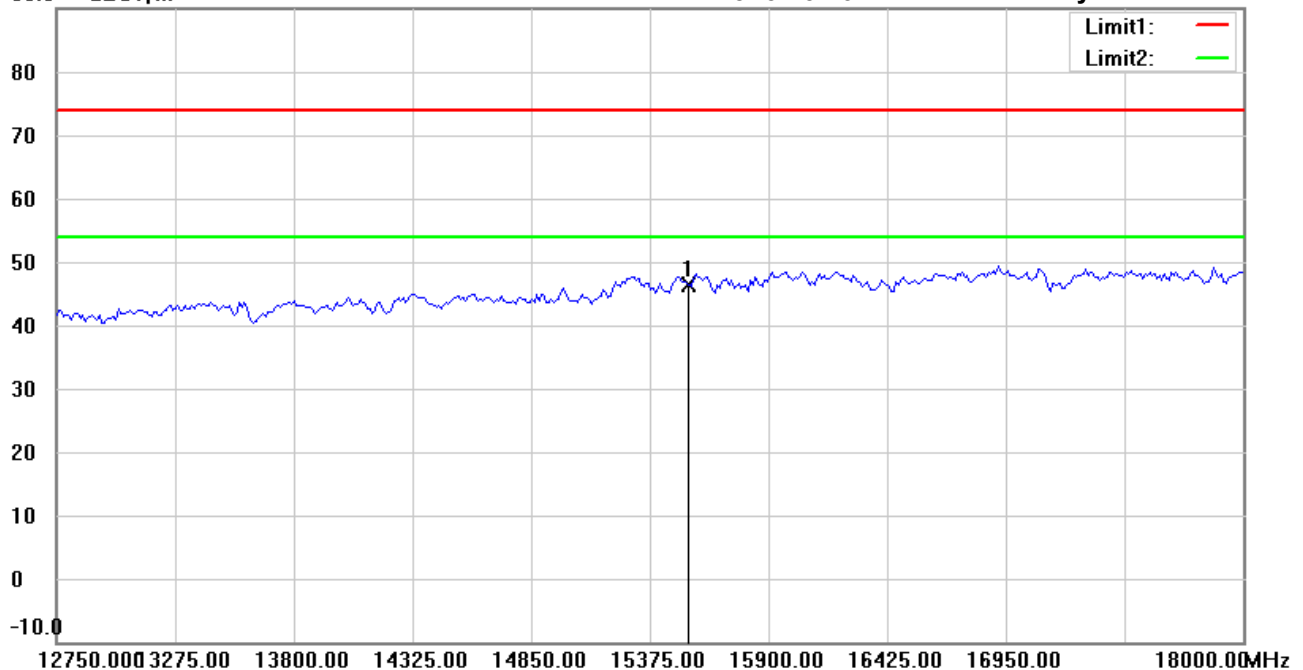

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15540.000	27.46	peak	18.95	46.41	74.00	150	185	-27.59	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:50:03 AM

Humidity: 61.7 %

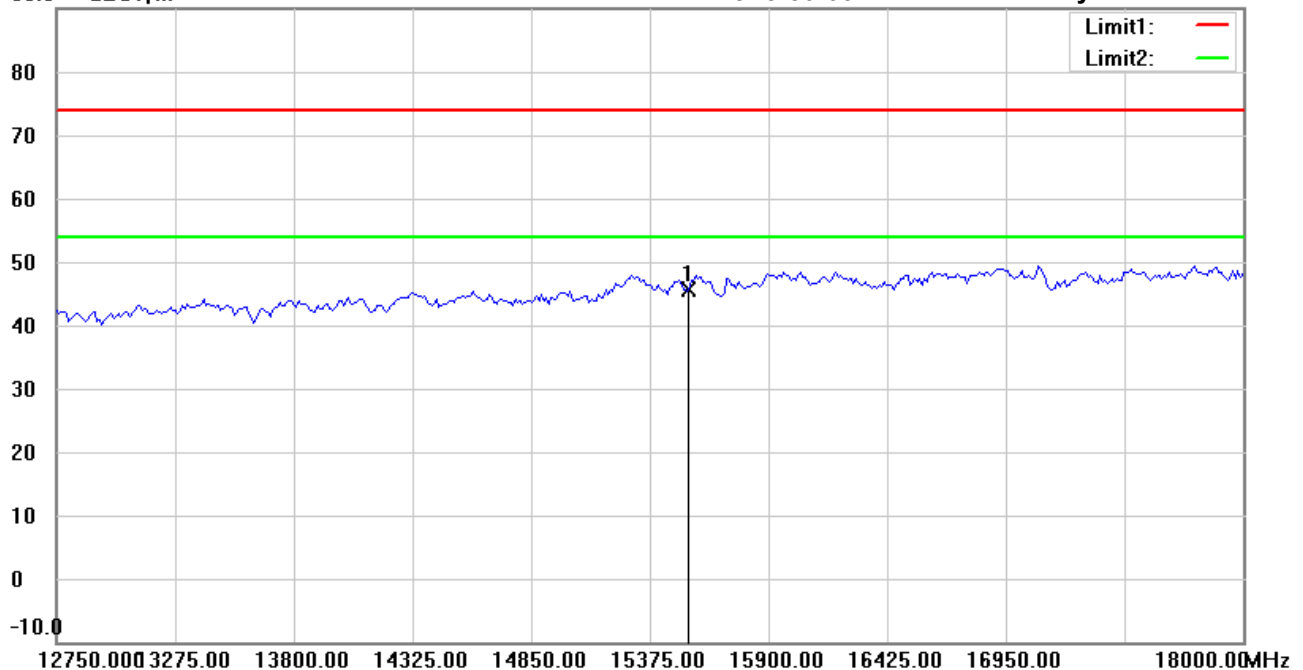

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15540.000	26.59	peak	18.95	45.54	74.00	150	230	-28.46	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:45:33 AM

Humidity: 61.7 %

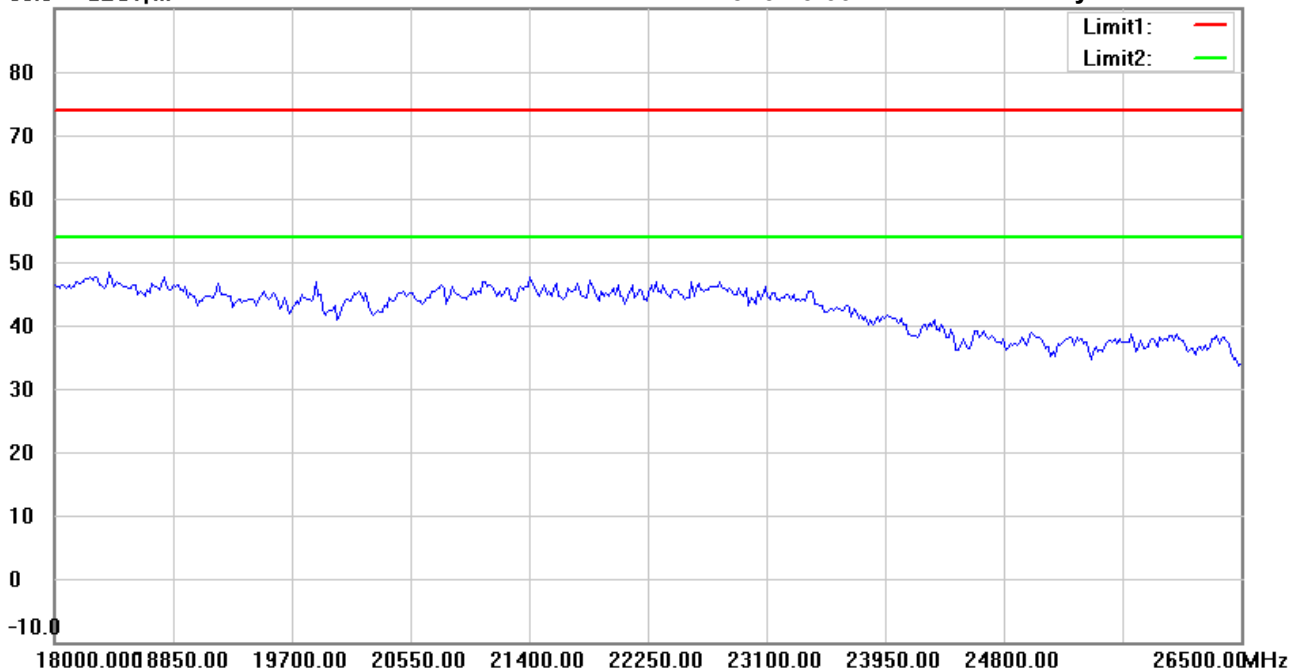

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 5:50:13 AM

Humidity:61.7 %

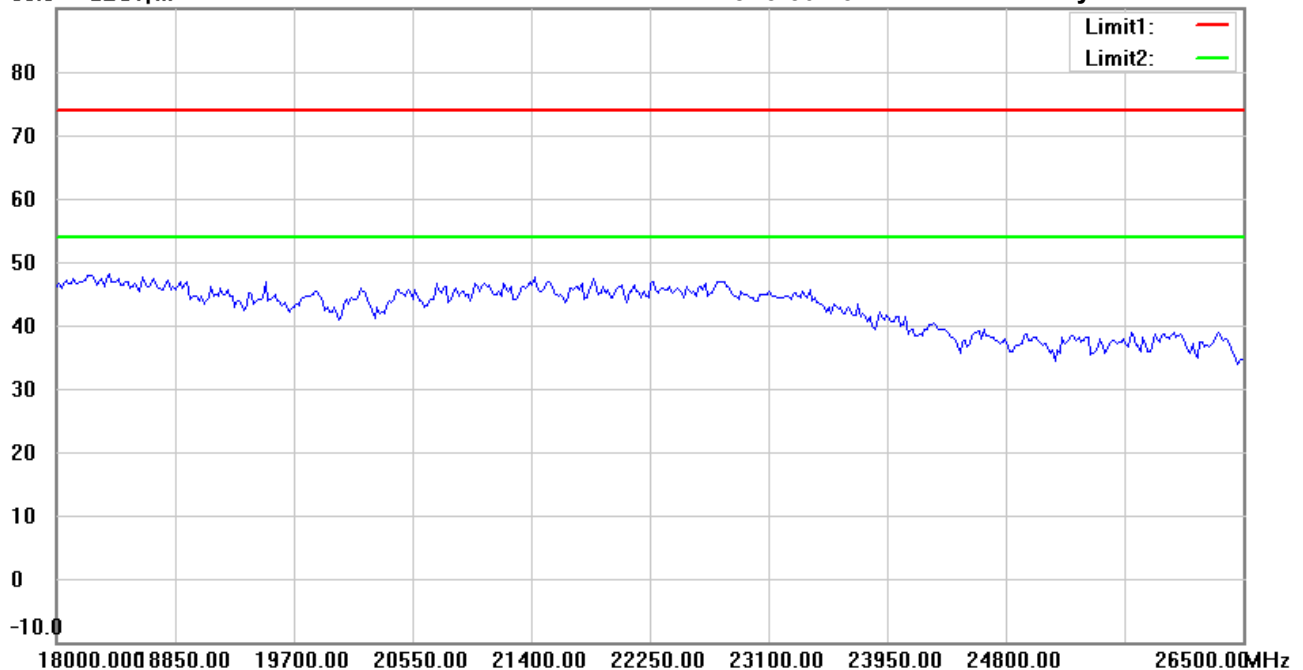

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:45:44 AM

Humidity: 61.7 %

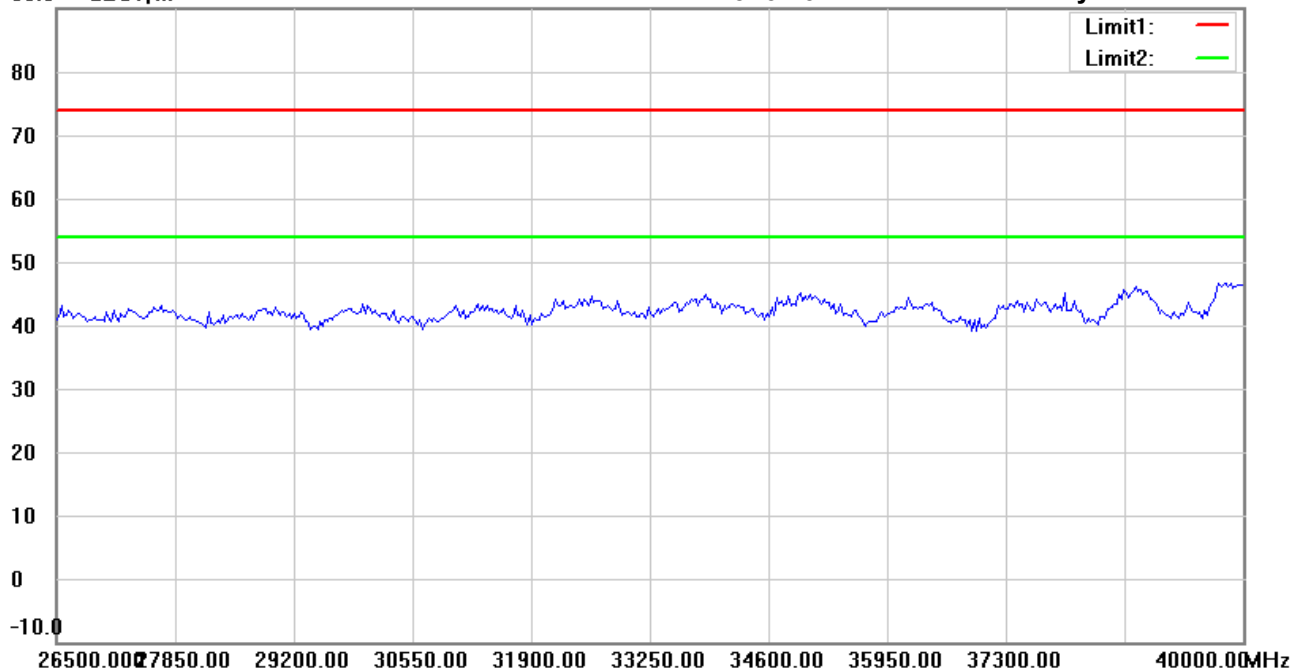

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 5:50:23 AM

Humidity: 61.7 %

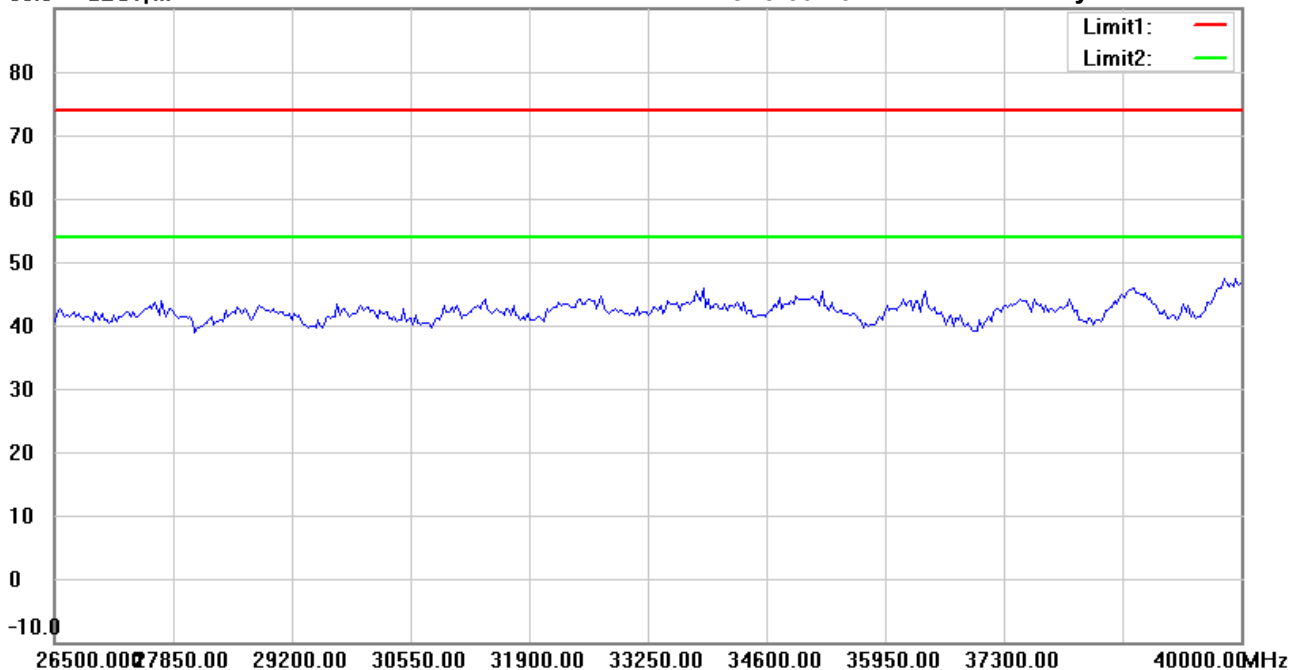

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH36

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:13:33 AM

Humidity: 61.7 %

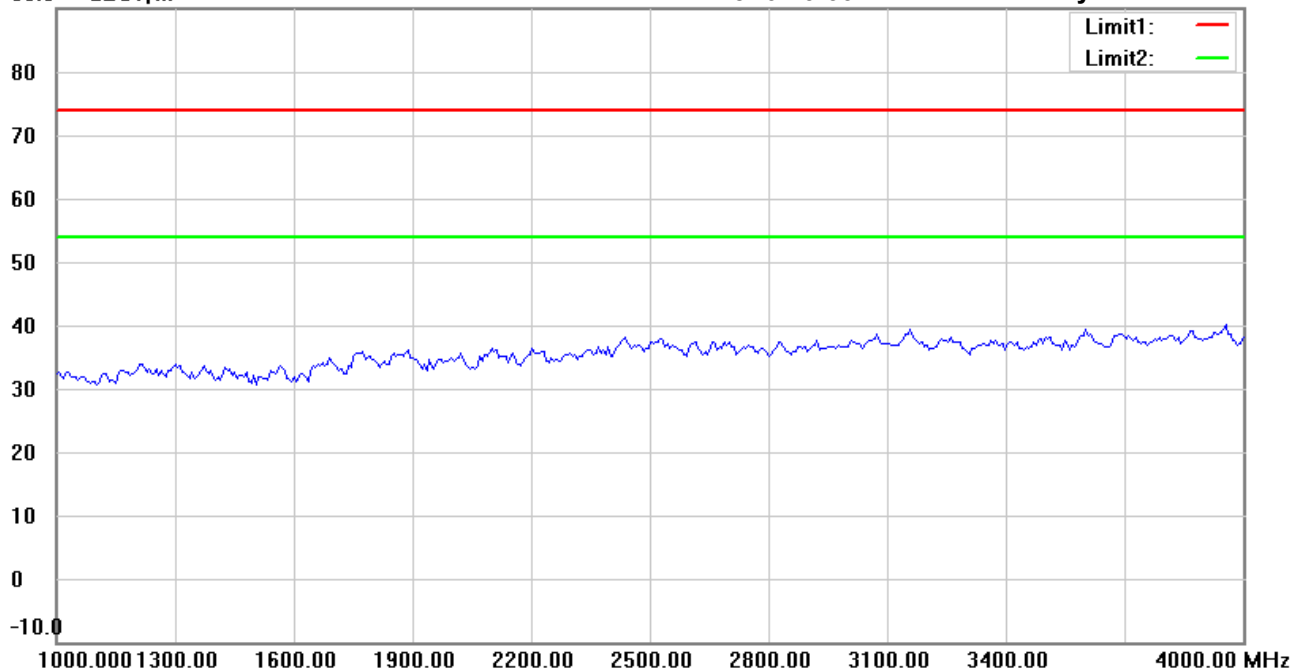

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:16:20 AM

Humidity:61.7 %

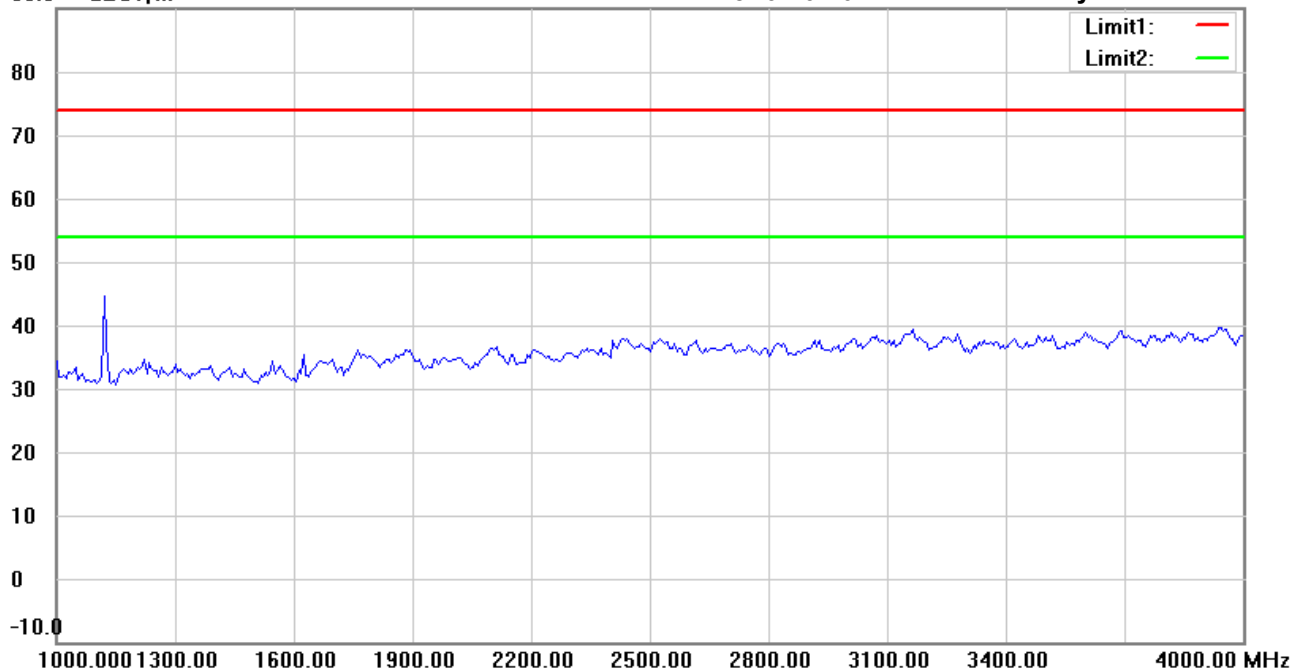

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:13:40 AM

Humidity: 61.7 %

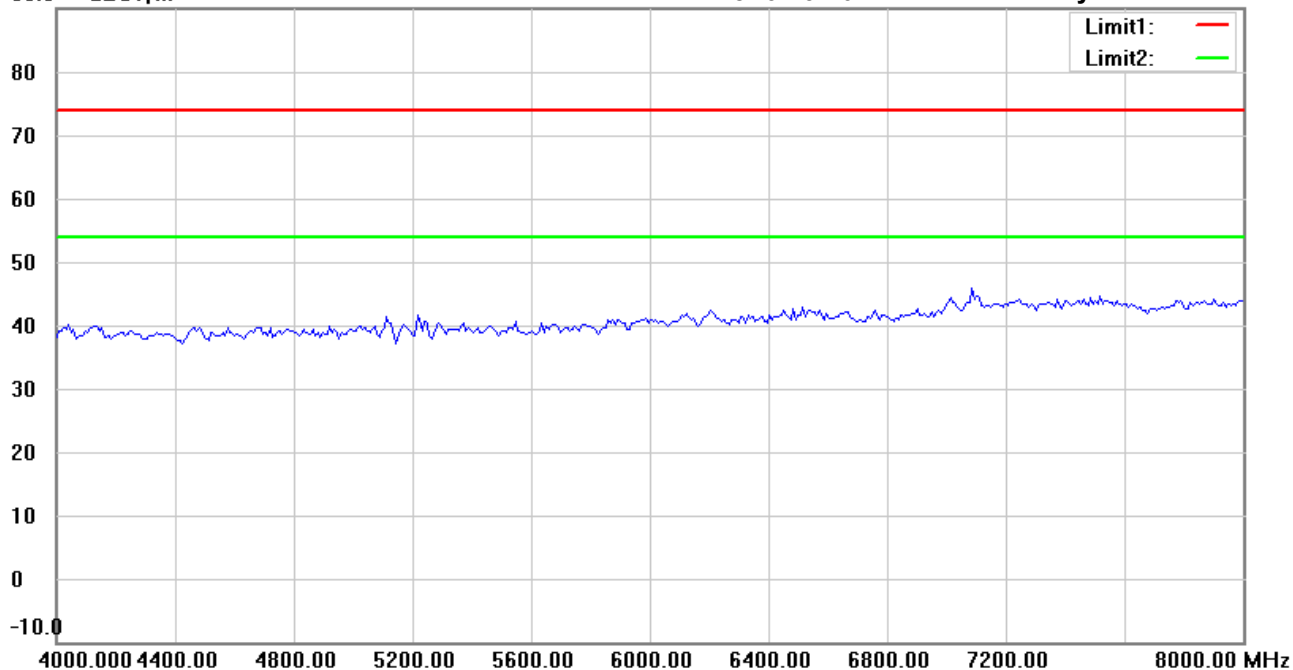

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:16:27 AM

Humidity: 61.7 %

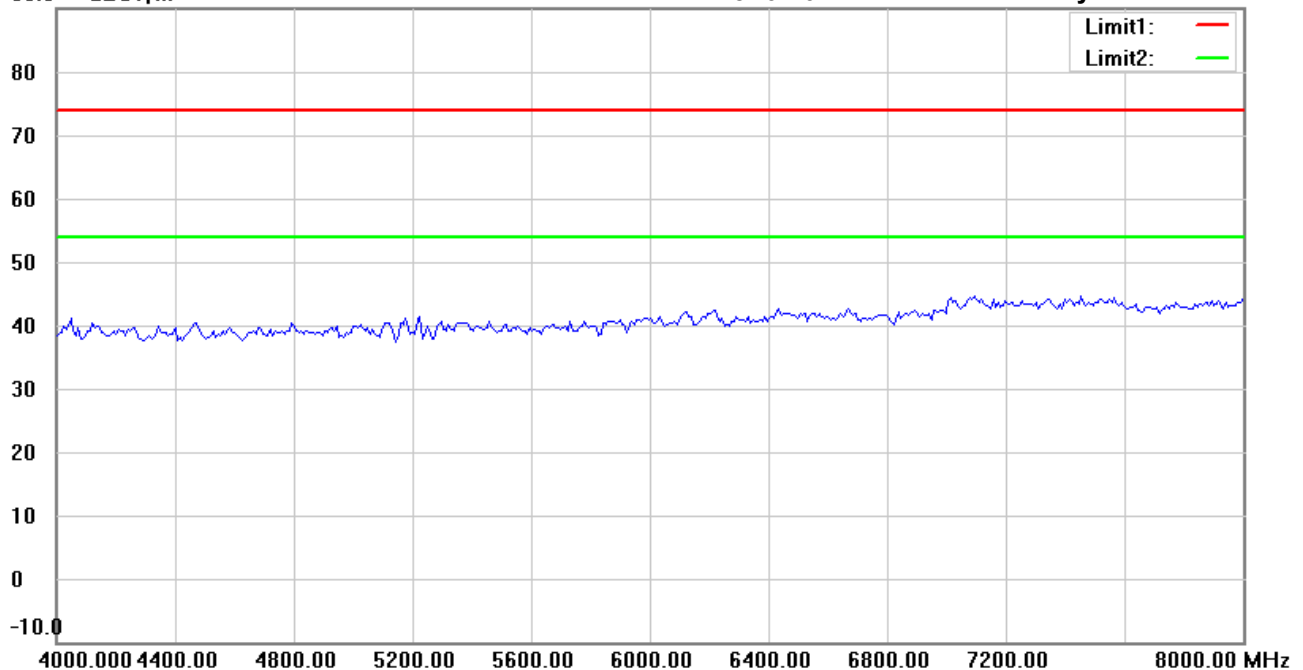

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:14:42 AM

Humidity: 61.7 %

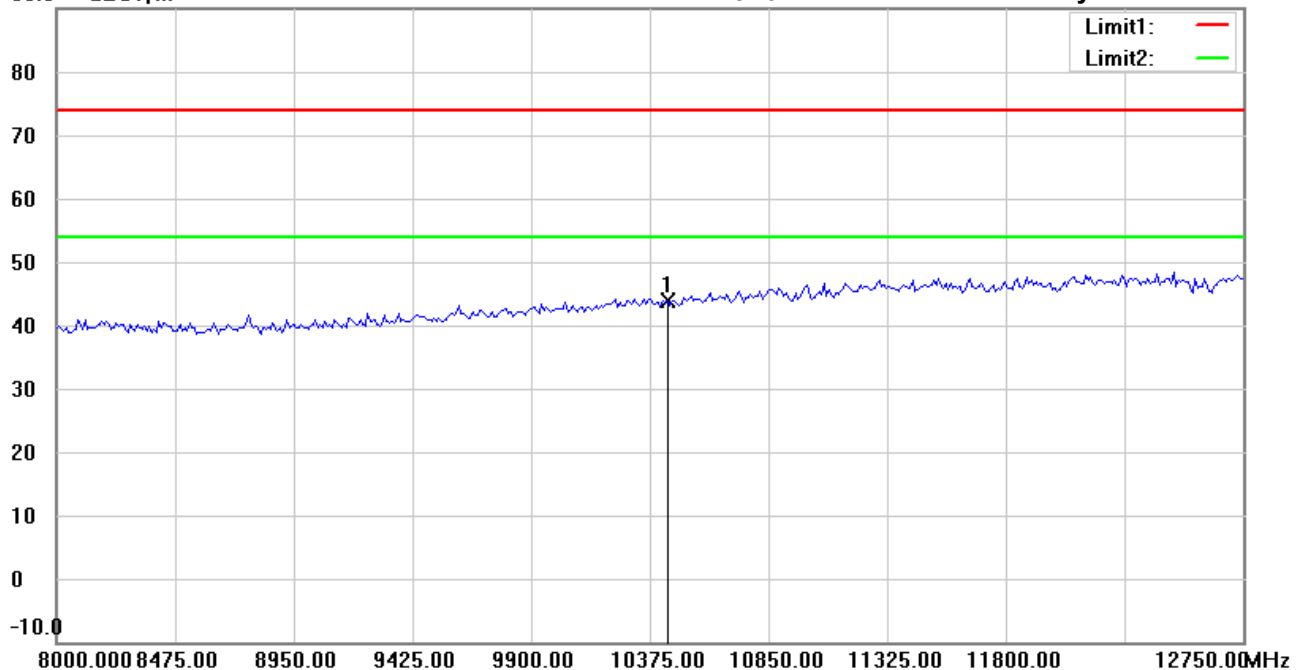

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10440.000	35.53	peak	8.33	43.86	74.00	150	175	-30.14	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:17:29 AM

Humidity: 61.7 %

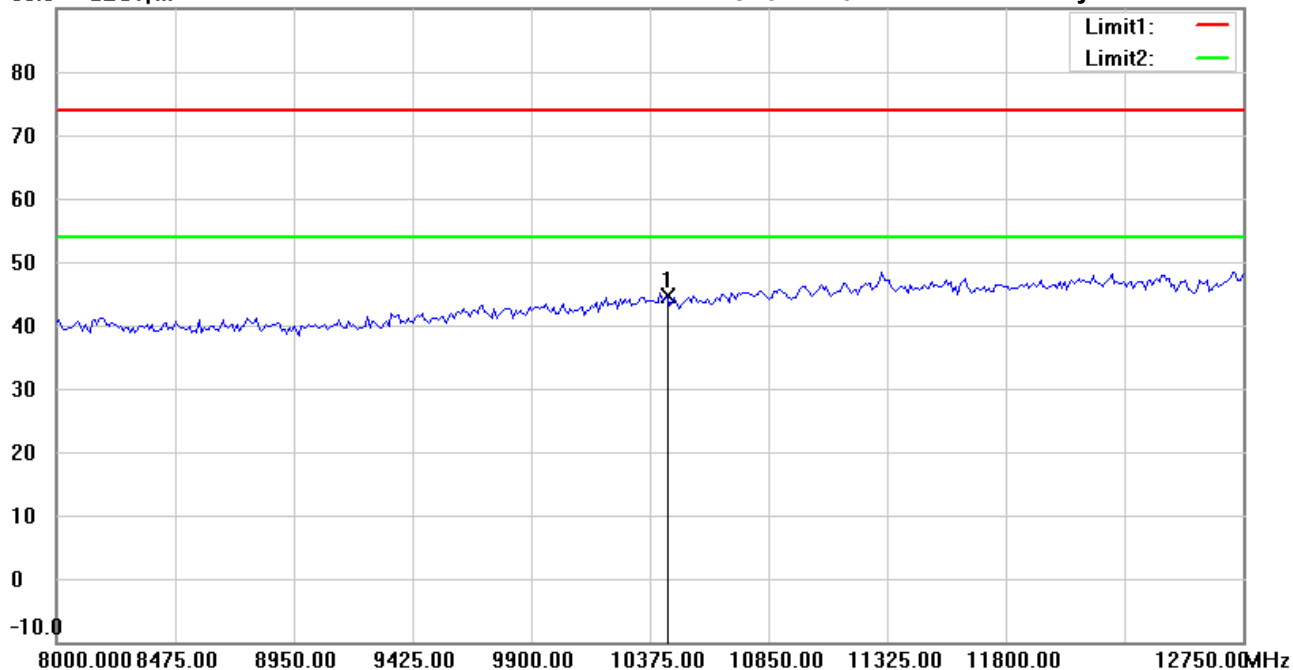

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10440.000	36.27	peak	8.33	44.60	74.00	150	75	-29.40	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:15:51 AM

Humidity: 61.7 %

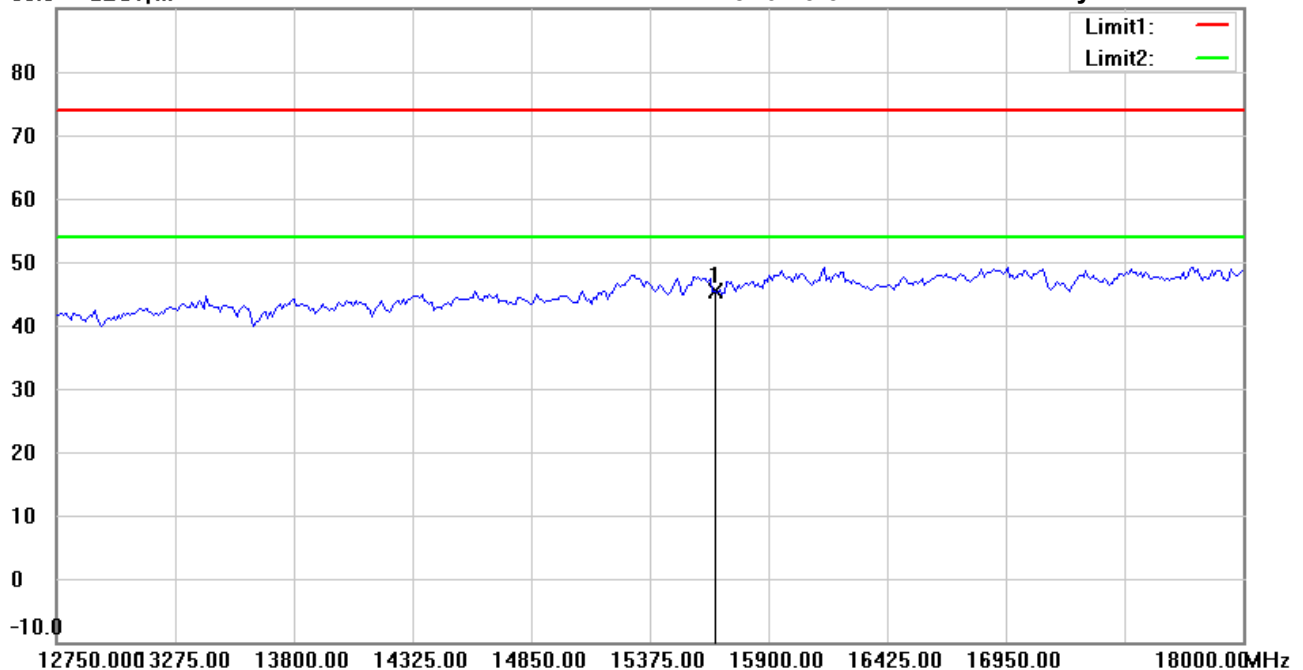

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15660.000	26.93	peak	18.33	45.26	74.00	150	15	-28.74	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:18:37 AM

Humidity: 61.7 %

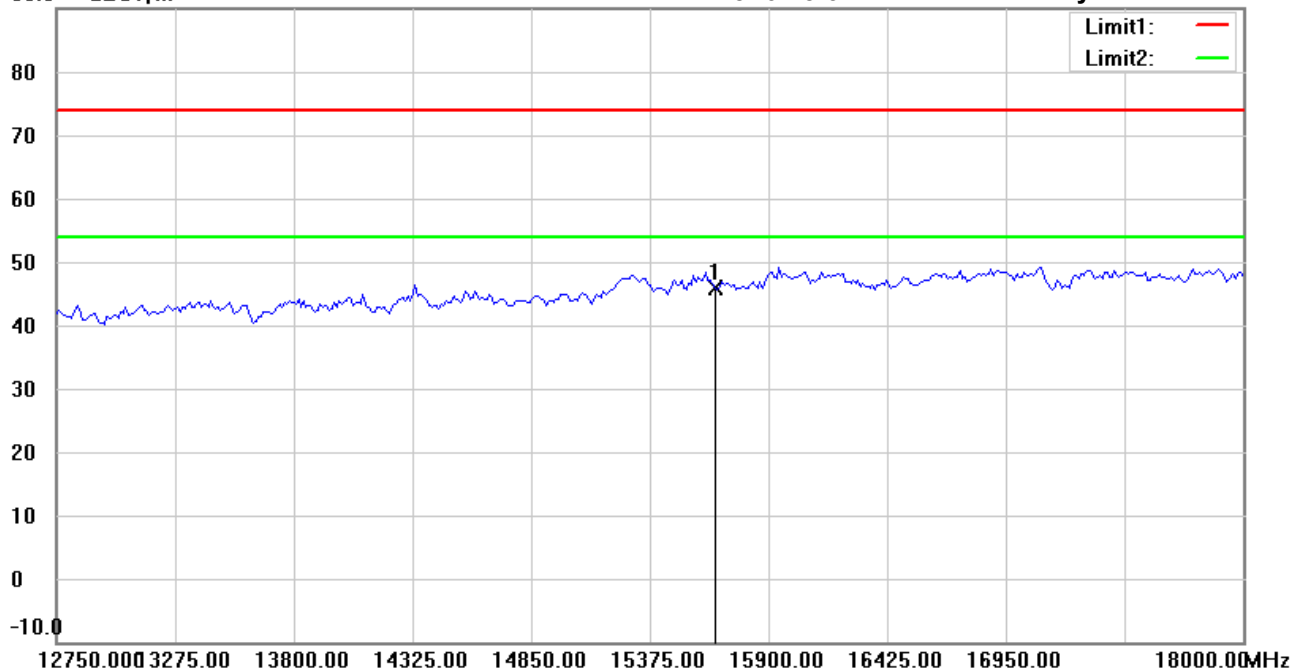

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15660.000	27.43	peak	18.33	45.76	74.00	150	200	-28.24	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:16:00 AM

Humidity:61.7 %

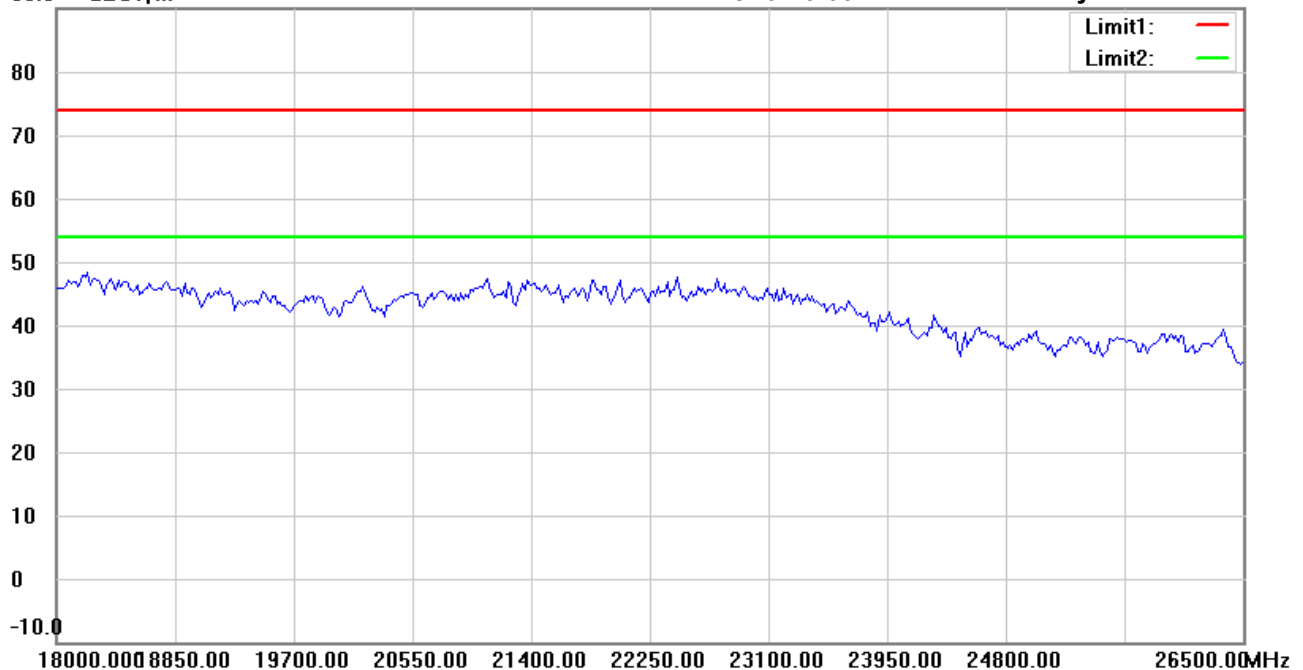

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:18:47 AM

Humidity:61.7 %

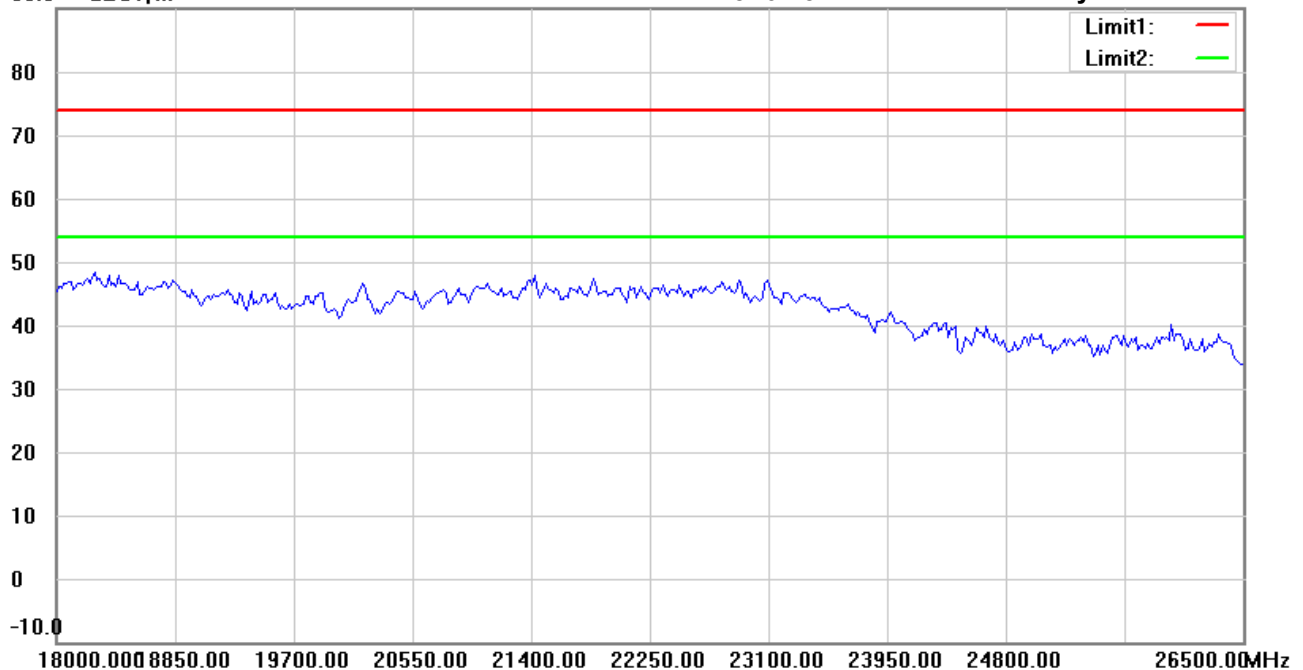

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:16:11 AM

Humidity: 61.7 %

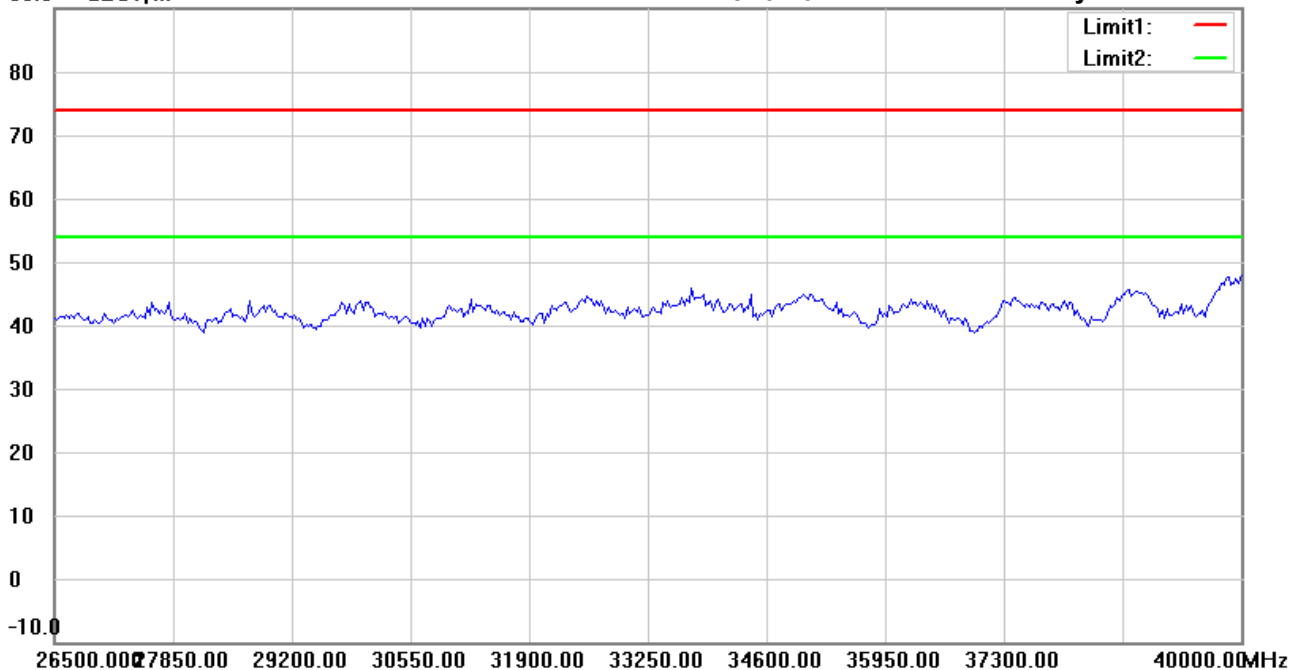

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:18:57 AM

Humidity: 61.7 %

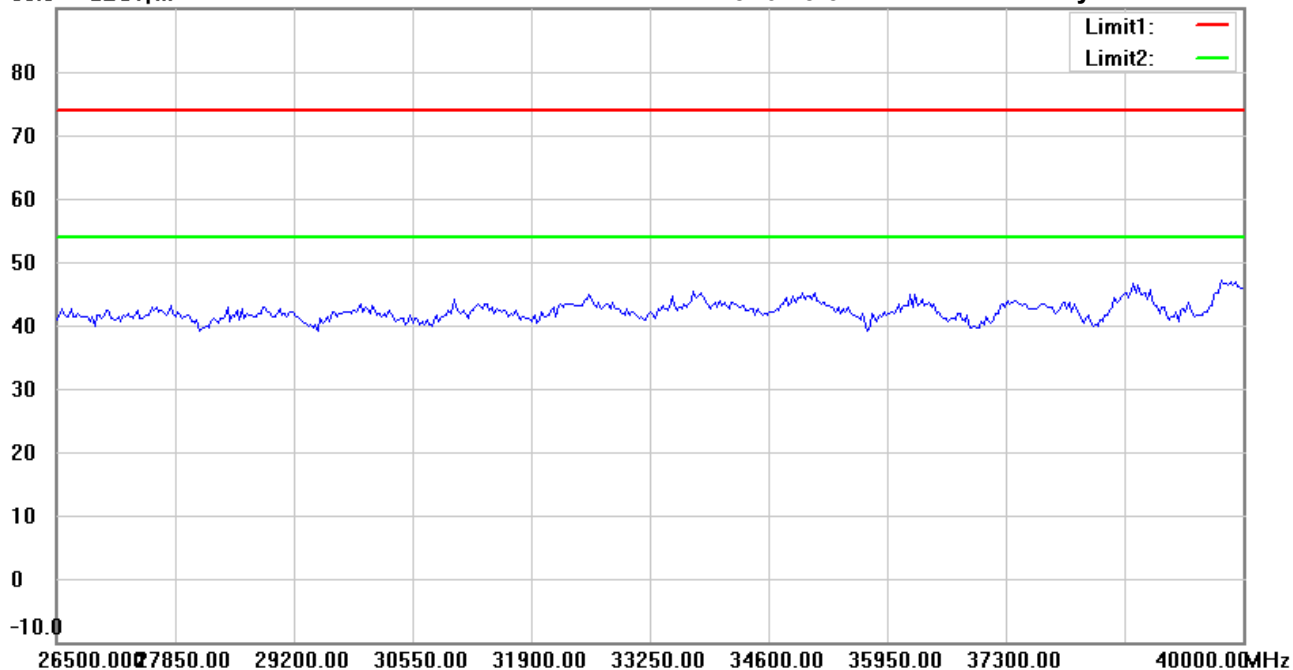

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH44

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:22:09 AM

Humidity:61.7 %

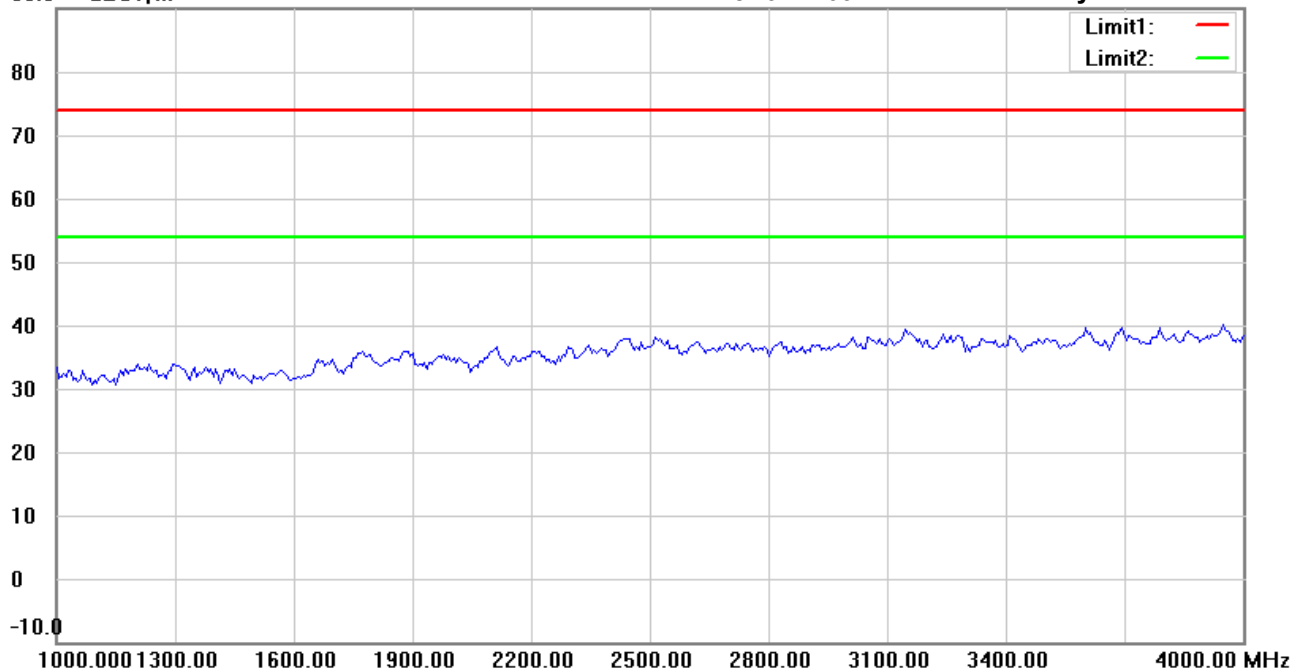

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:24:59 AM

Humidity: 61.7 %

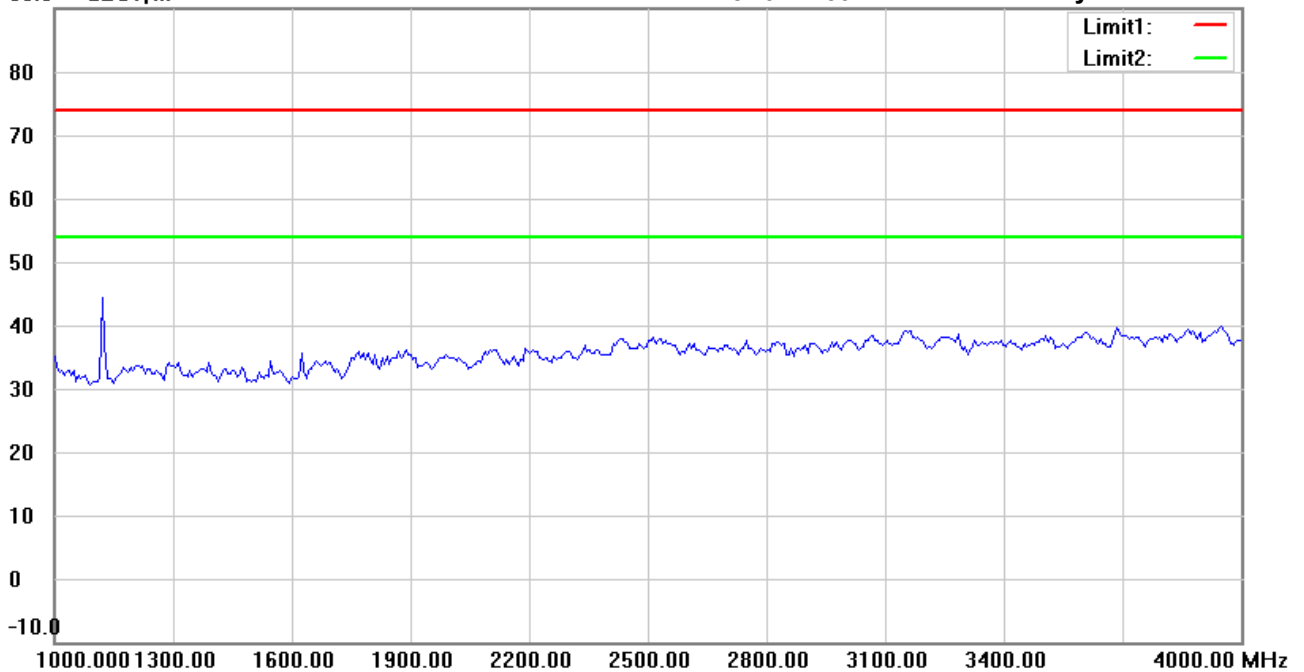

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:22:16 AM

Humidity: 61.7 %

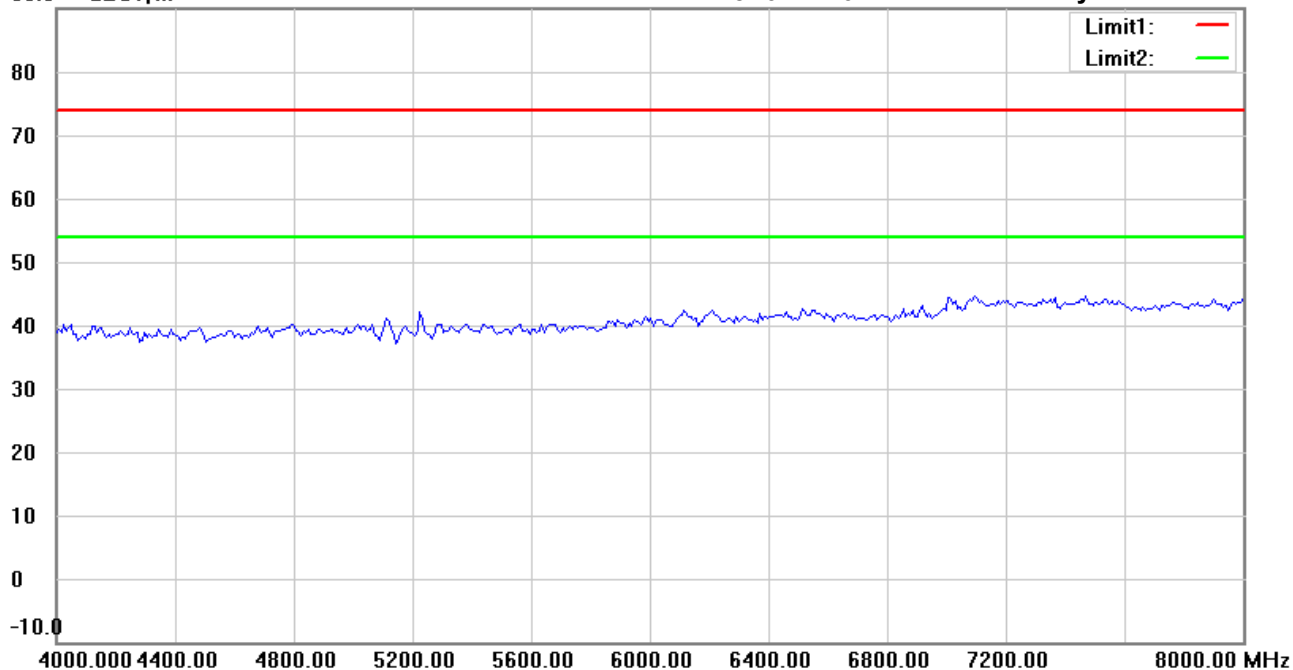

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:25:06 AM

Humidity: 61.7 %

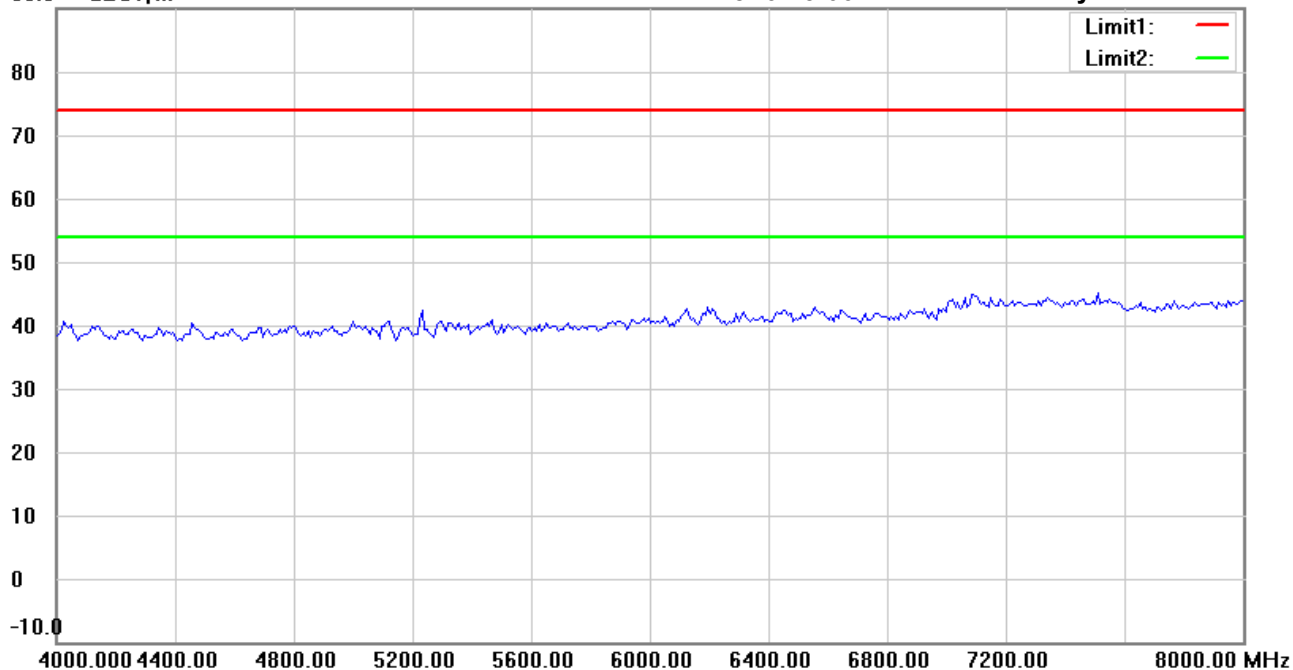

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:23:19 AM

Humidity: 61.7 %

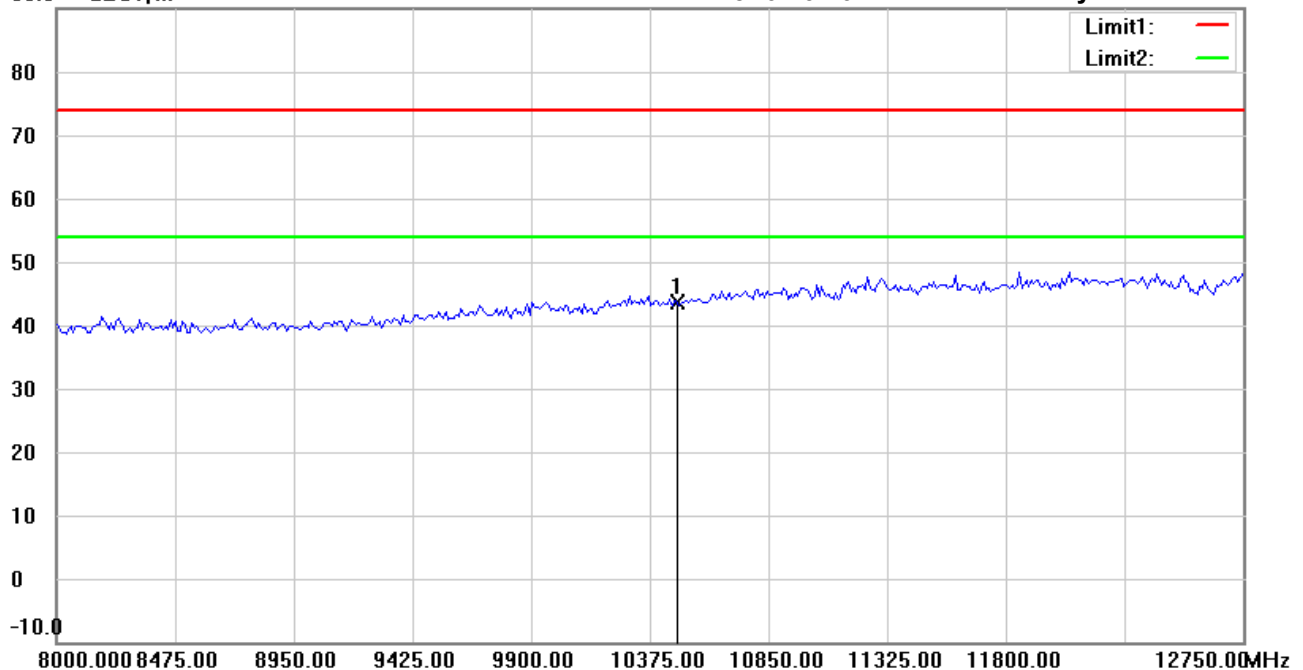

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10480.000	35.29	peak	8.46	43.75	74.00	150	335	-30.25	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:26:09 AM

Humidity: 61.7 %

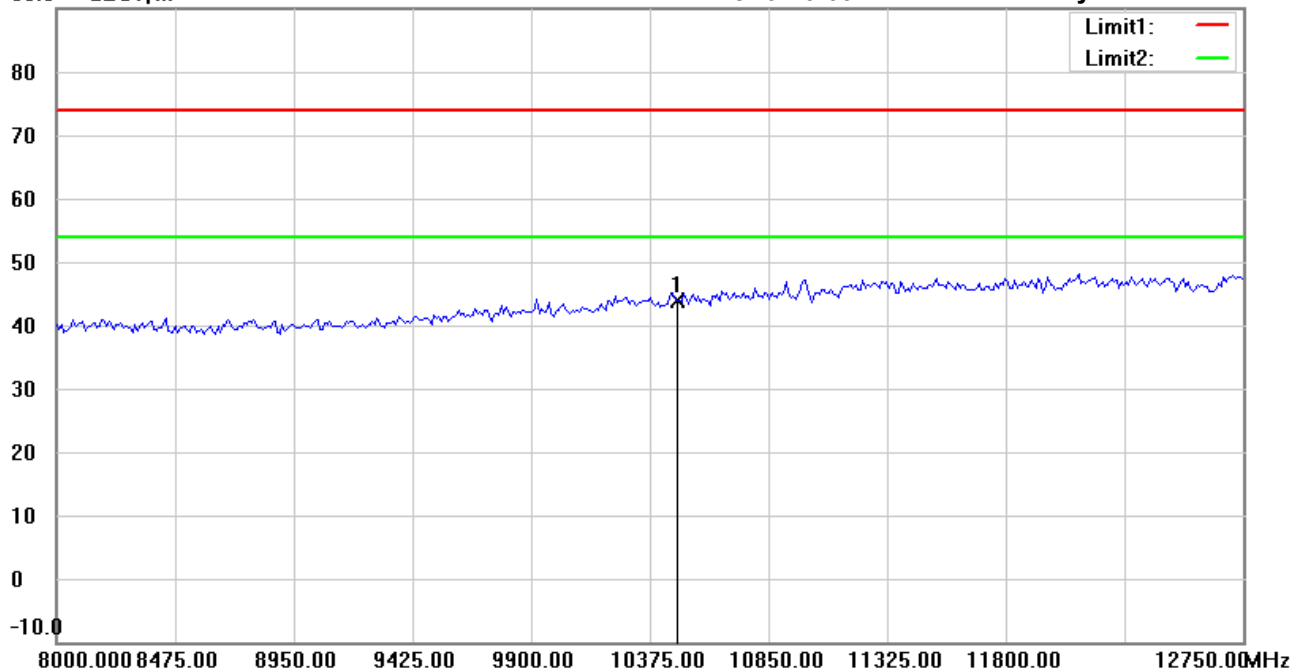

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10480.000	35.48	peak	8.46	43.94	74.00	150	110	-30.06	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:24:28 AM

Humidity: 61.7 %

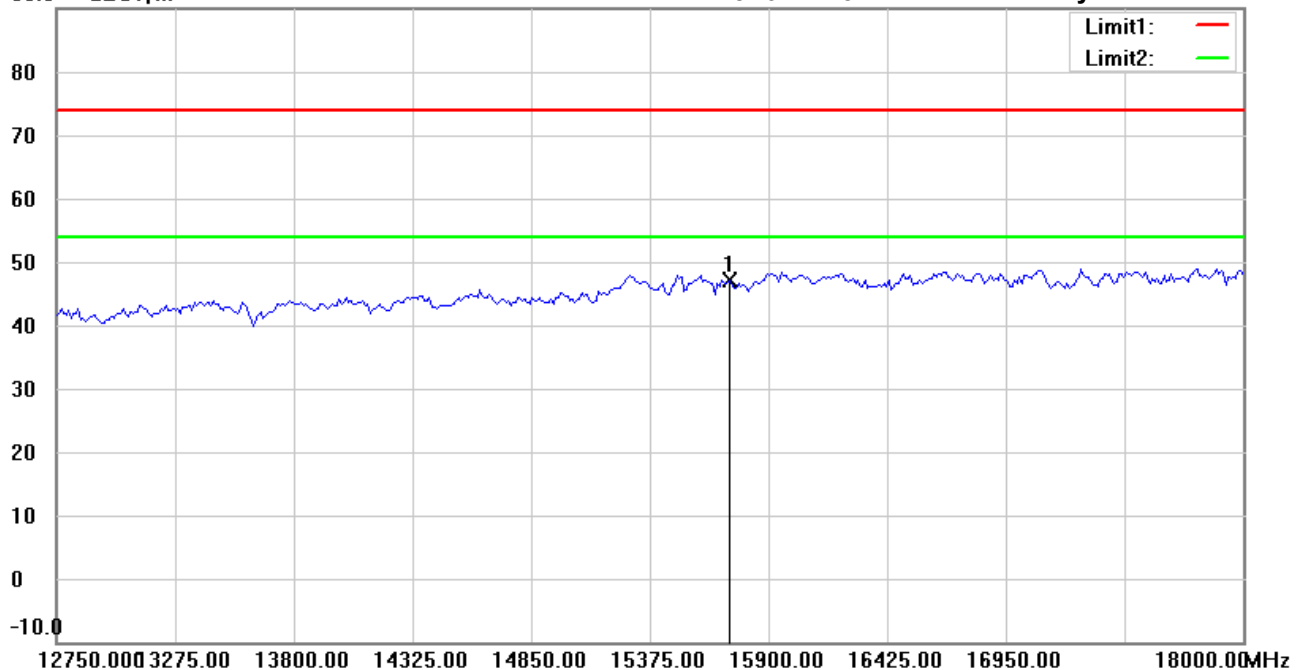

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15720.000	29.65	peak	17.44	47.09	74.00	150	10	-26.91	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:27:18 AM

Humidity: 61.7 %

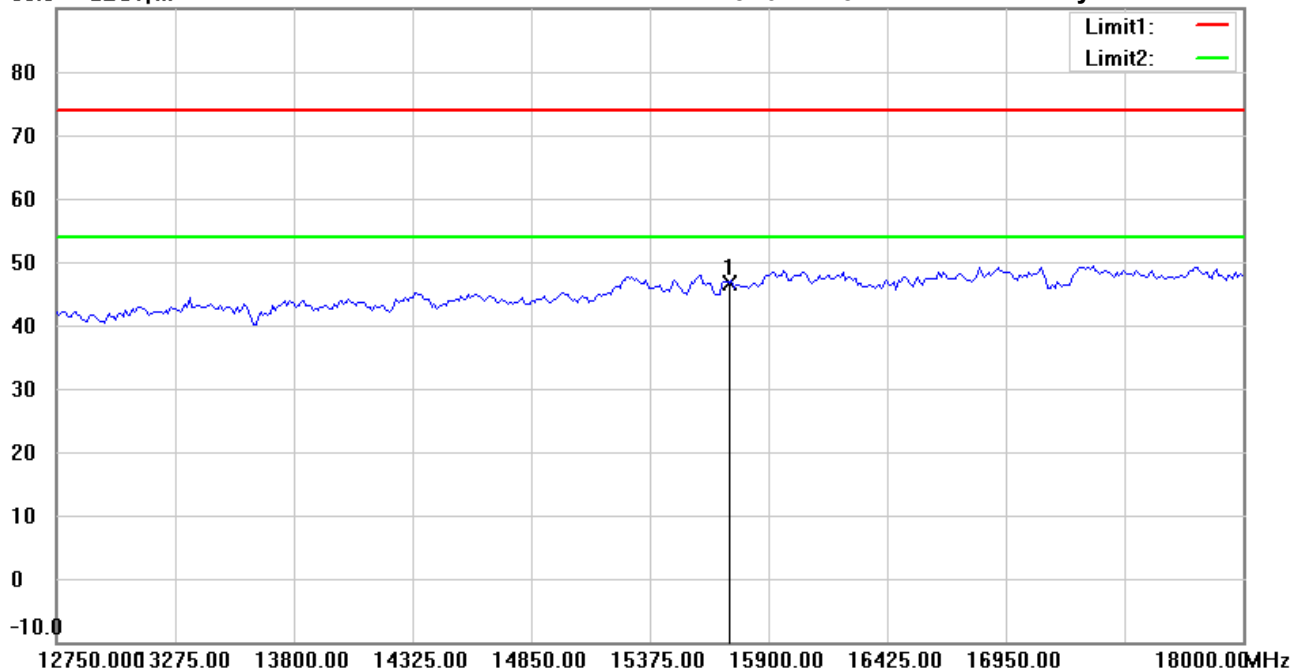

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15720.000	29.07	peak	17.44	46.51	74.00	150	215	-27.49	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:24:37 AM

Humidity:61.7 %

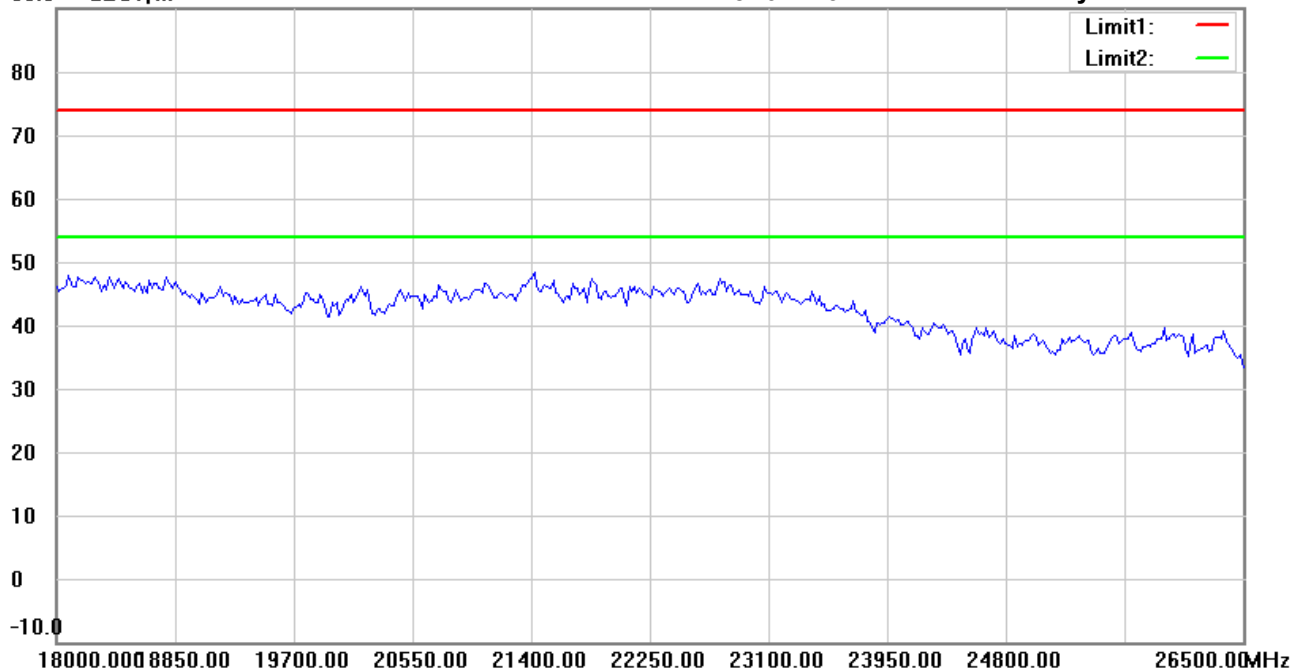

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #11


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:27:28 AM

Humidity: 61.7 %

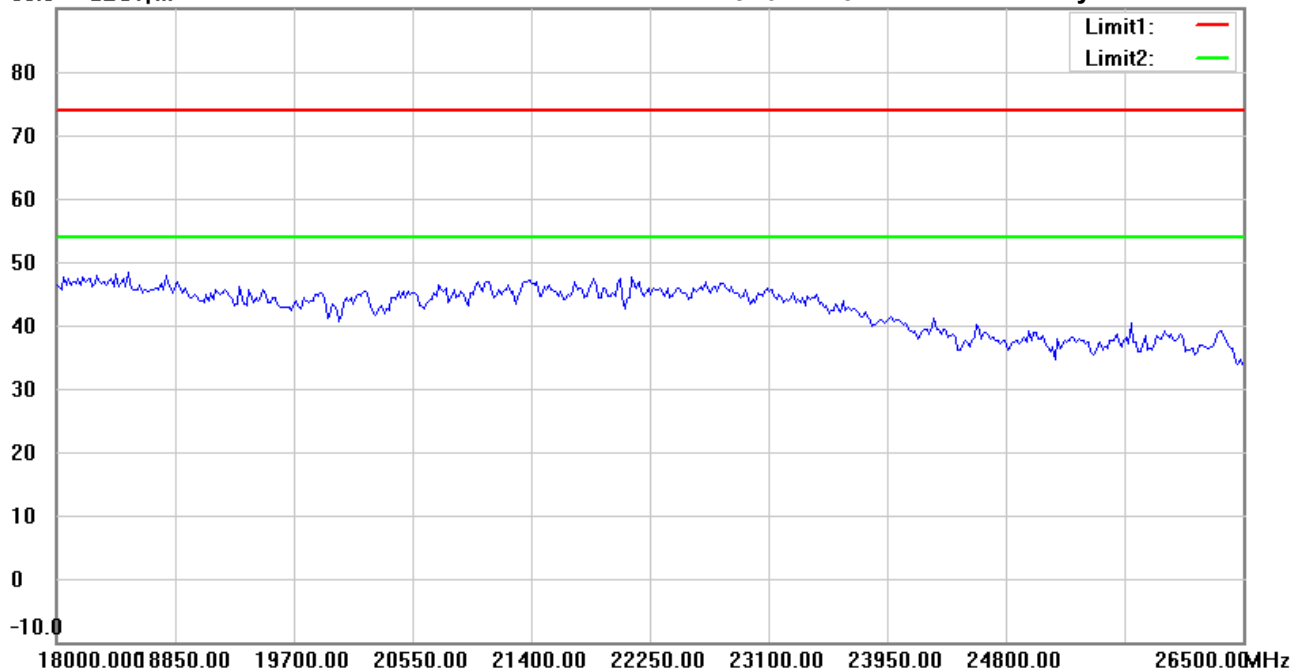

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:24:48 AM

Humidity: 61.7 %

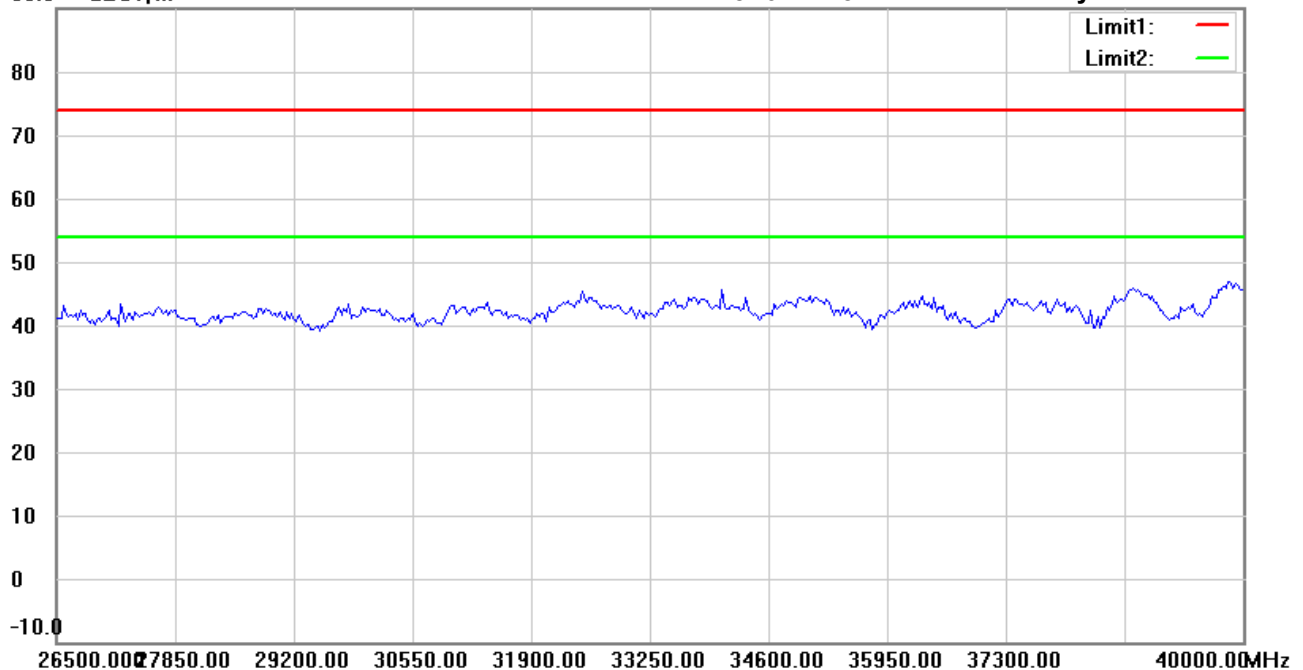

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:27:38 AM

Humidity: 61.7 %

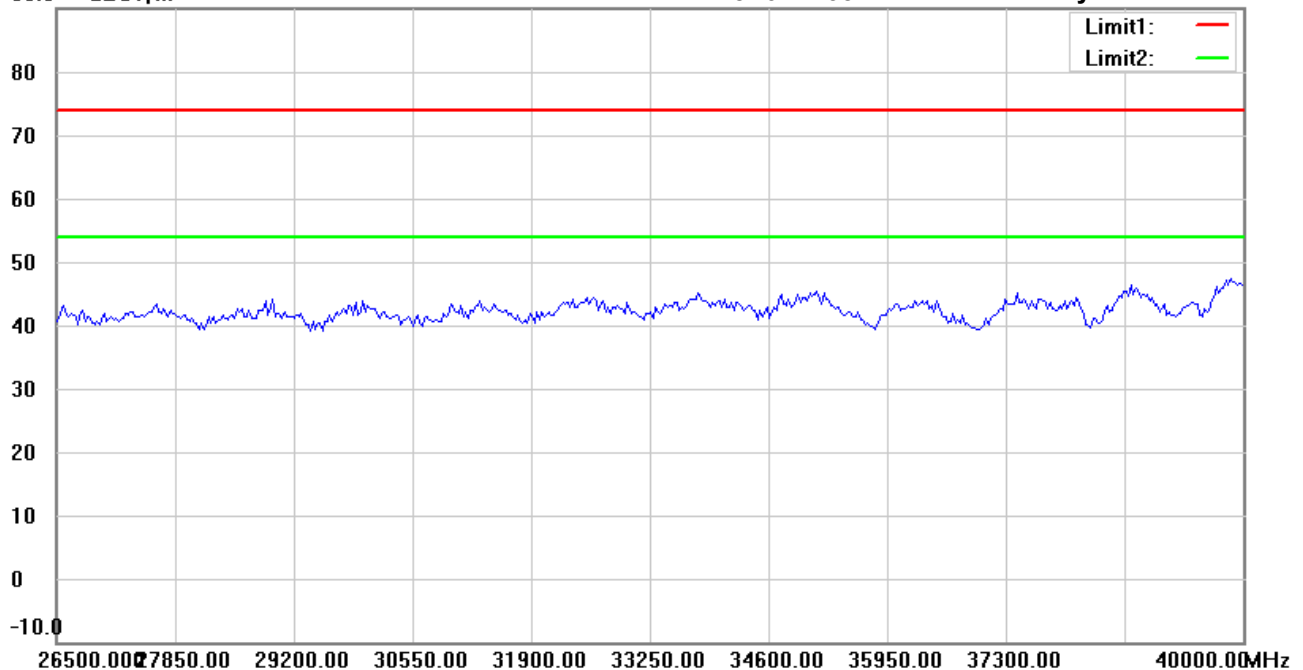

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH48

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:05:27 AM

Humidity:64.7 %

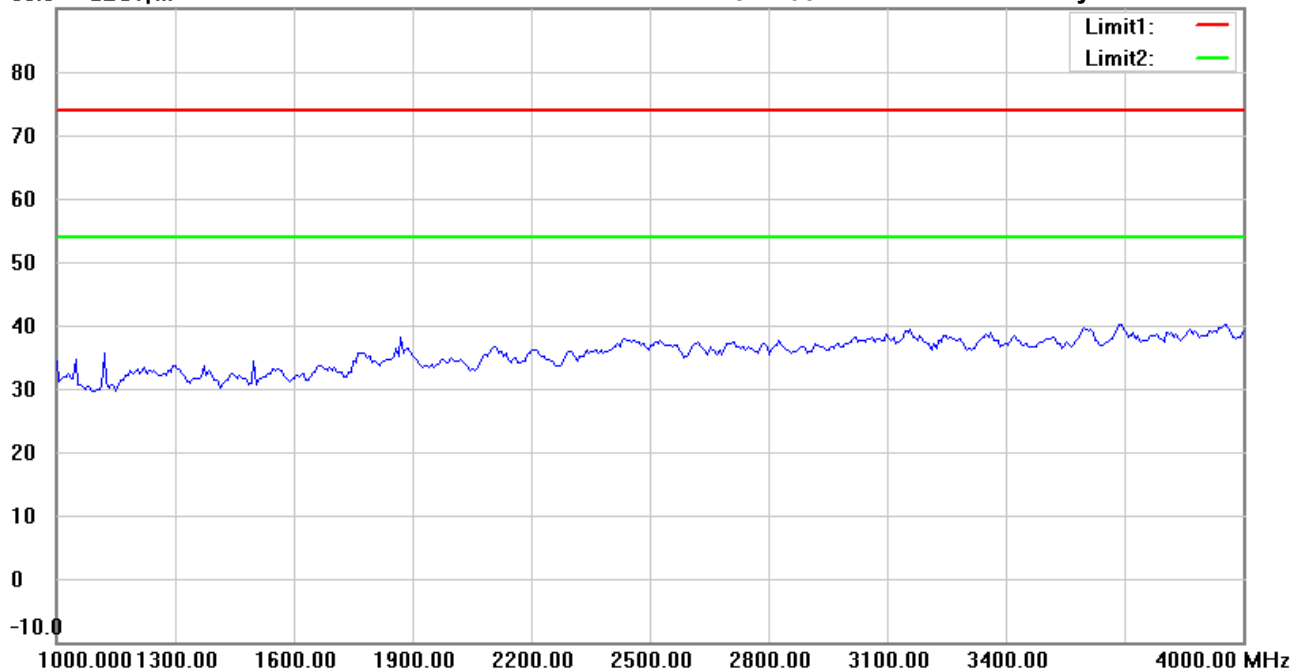

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:10:24 AM

Humidity:64.7 %

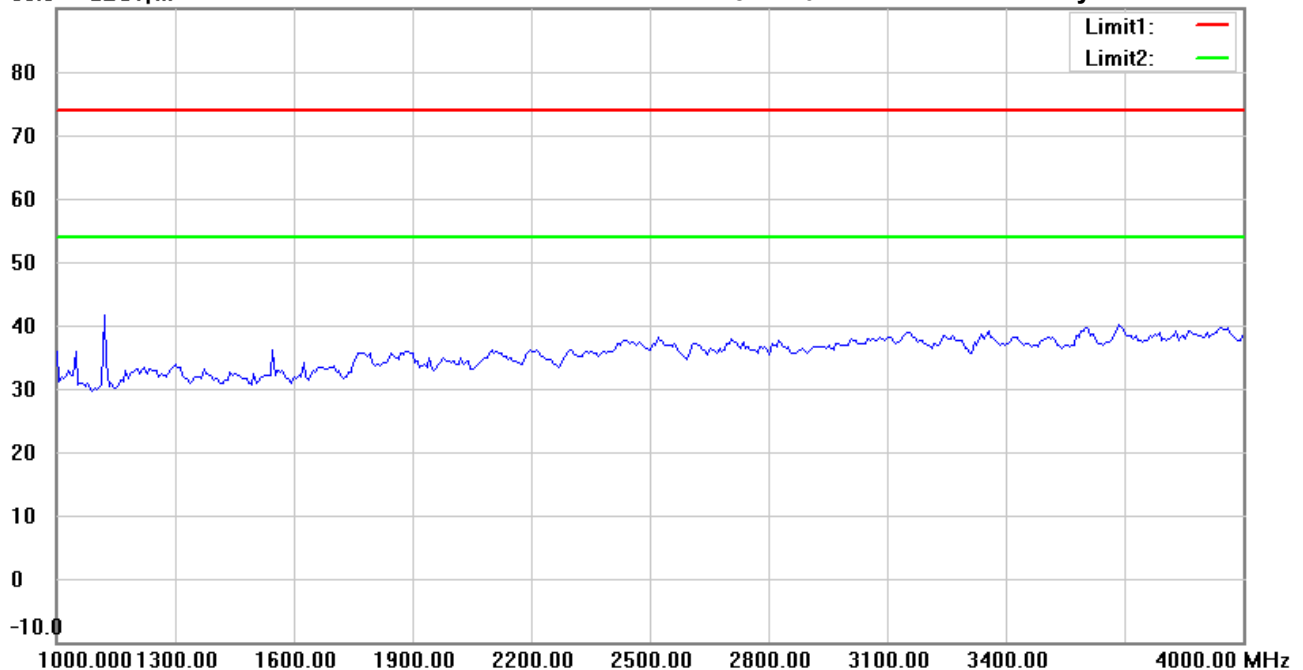

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:06:28 AM

Humidity: 64.7 %

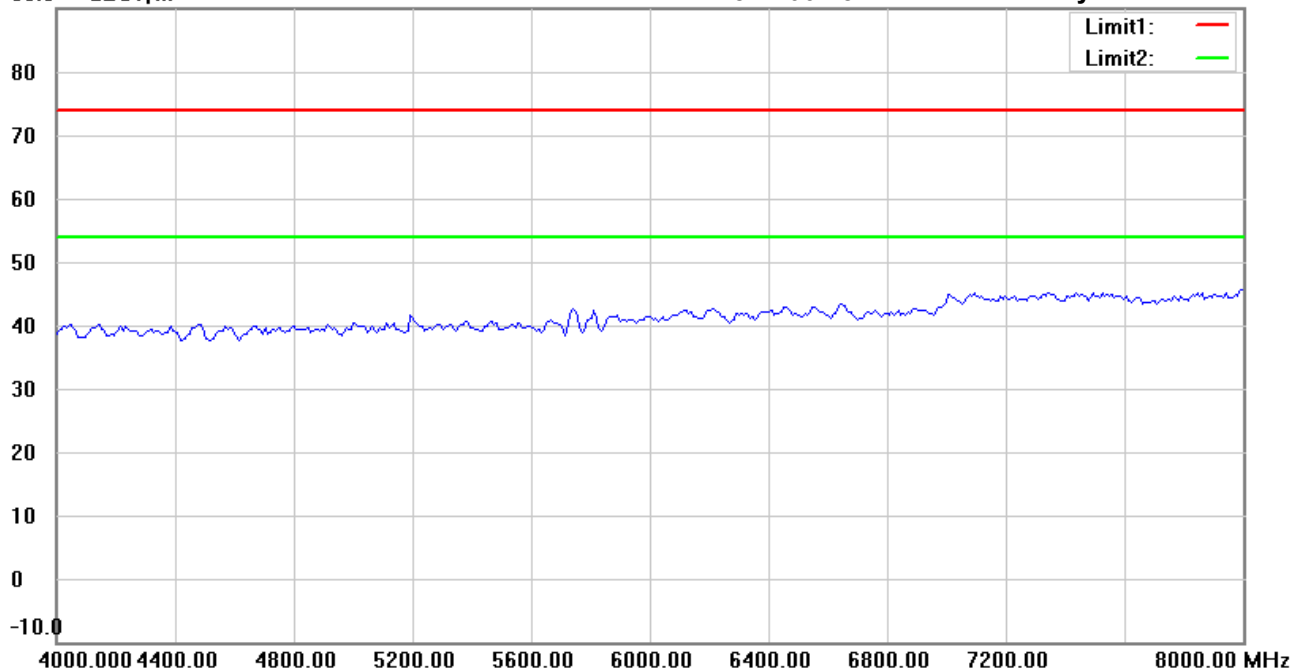

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:11:25 AM

Humidity: 64.7 %

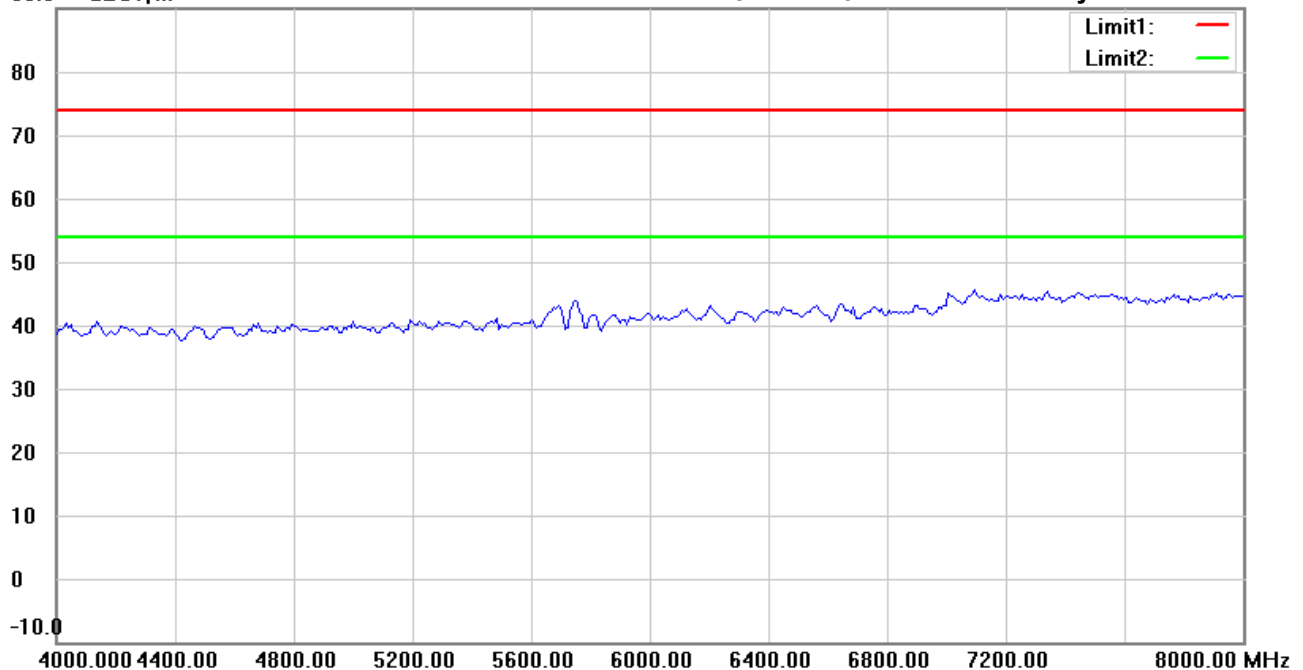

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:07:36 AM

Humidity:64.7 %

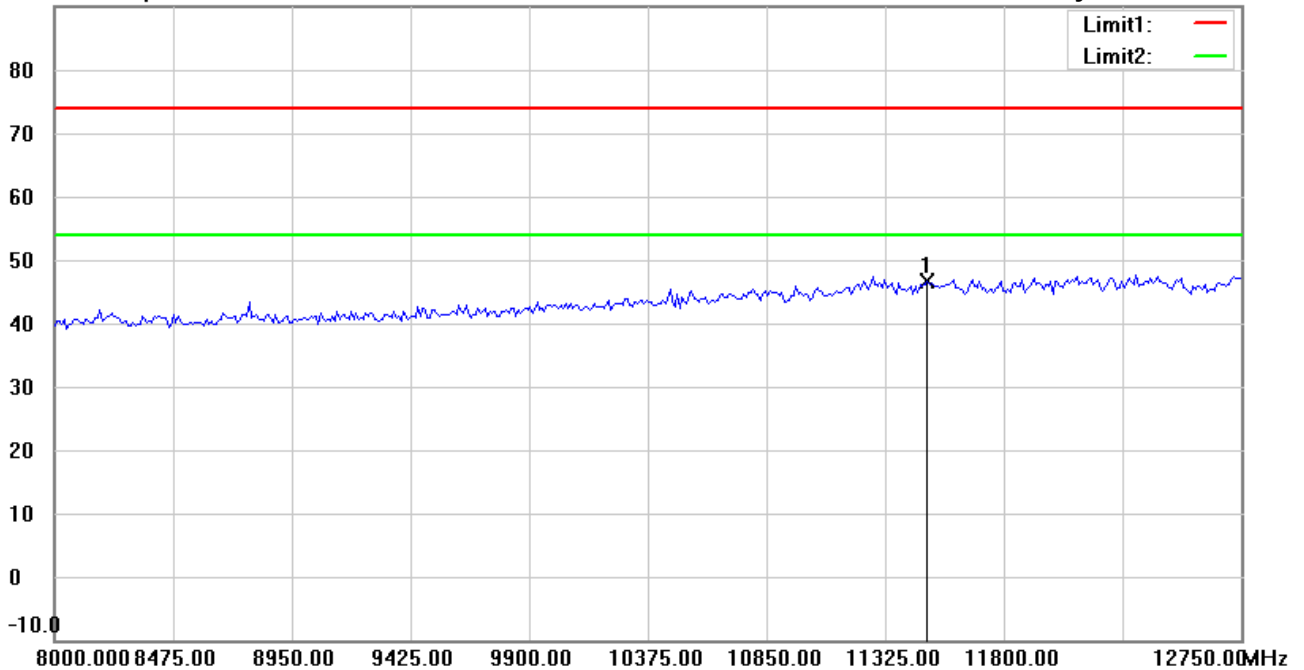

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11490.000	35.20	peak	11.36	46.56	74.00	150	315	-27.44	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:13:03 AM

Humidity: 64.7 %

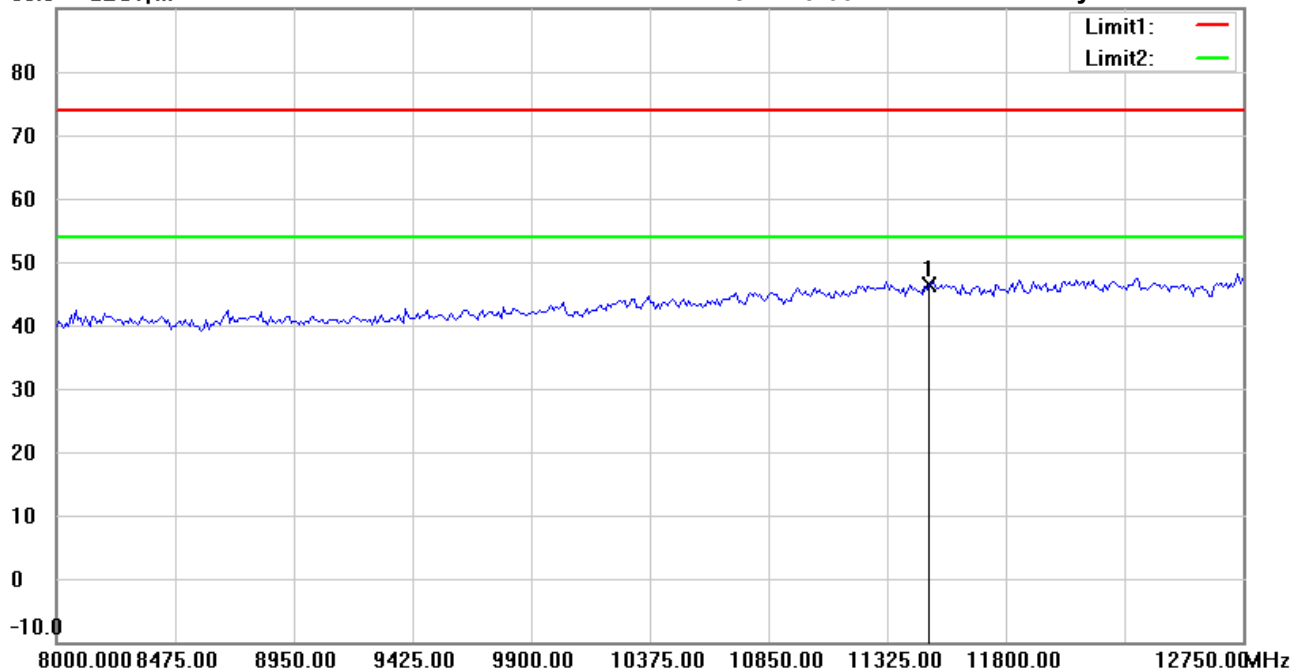

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11490.000	34.98	peak	11.36	46.34	74.00	150	225	-27.66	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

Time: 7:08:45 AM

Humidity: 64.7 %

90.0 dBuV/m

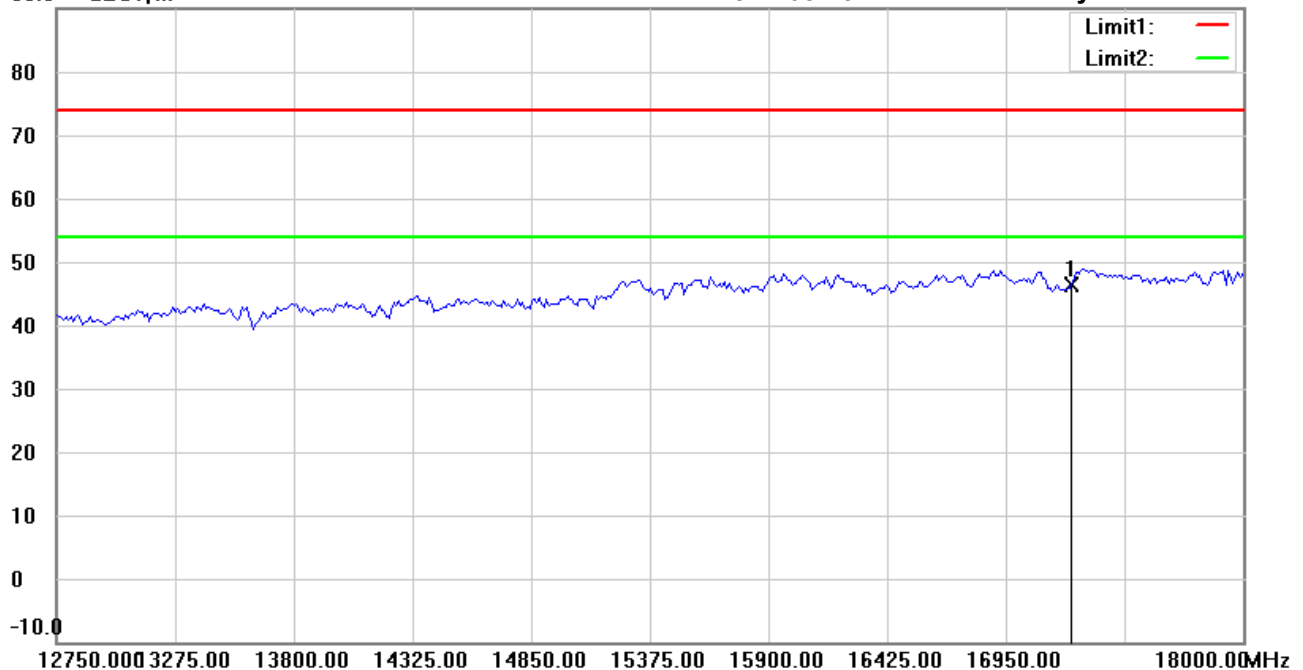

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17235.000	27.19	peak	19.23	46.42	74.00	150	180	-27.58	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:14:13 AM

Humidity: 64.7 %

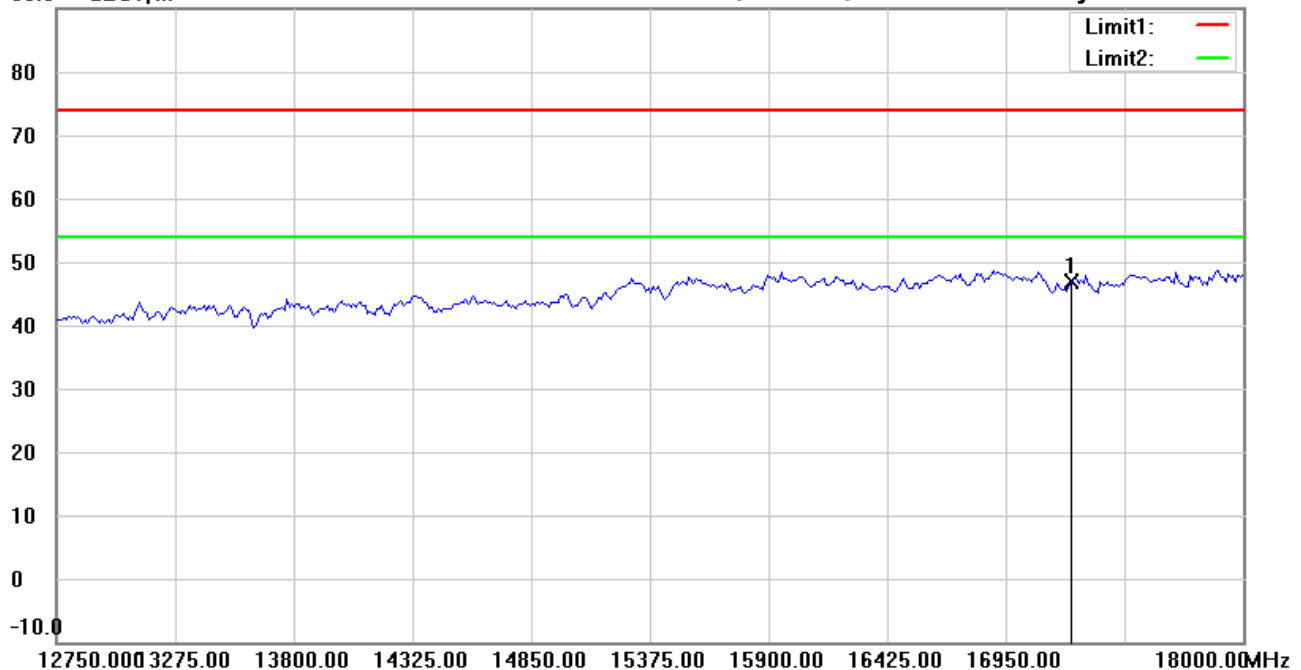

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17235.000	27.72	peak	19.23	46.95	74.00	150	40	-27.05	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:08:56 AM

Humidity: 64.7 %

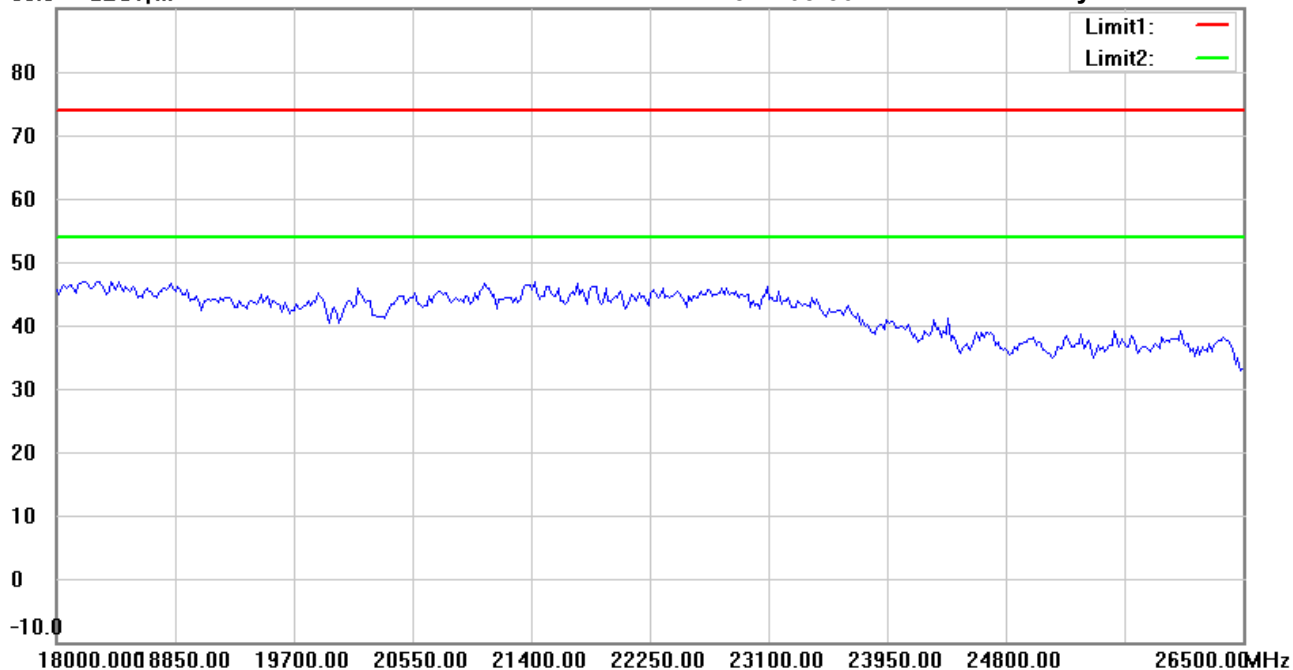

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:14:23 AM

Humidity:64.7 %

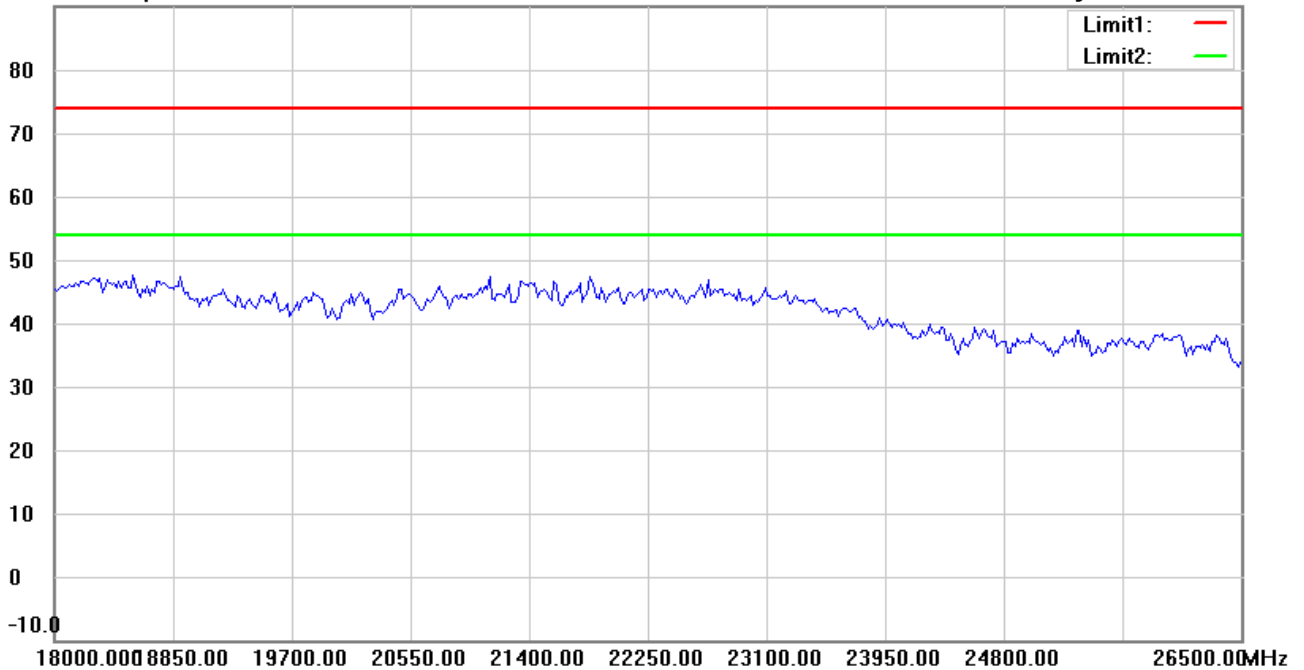

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:09:07 AM

Humidity: 64.7 %

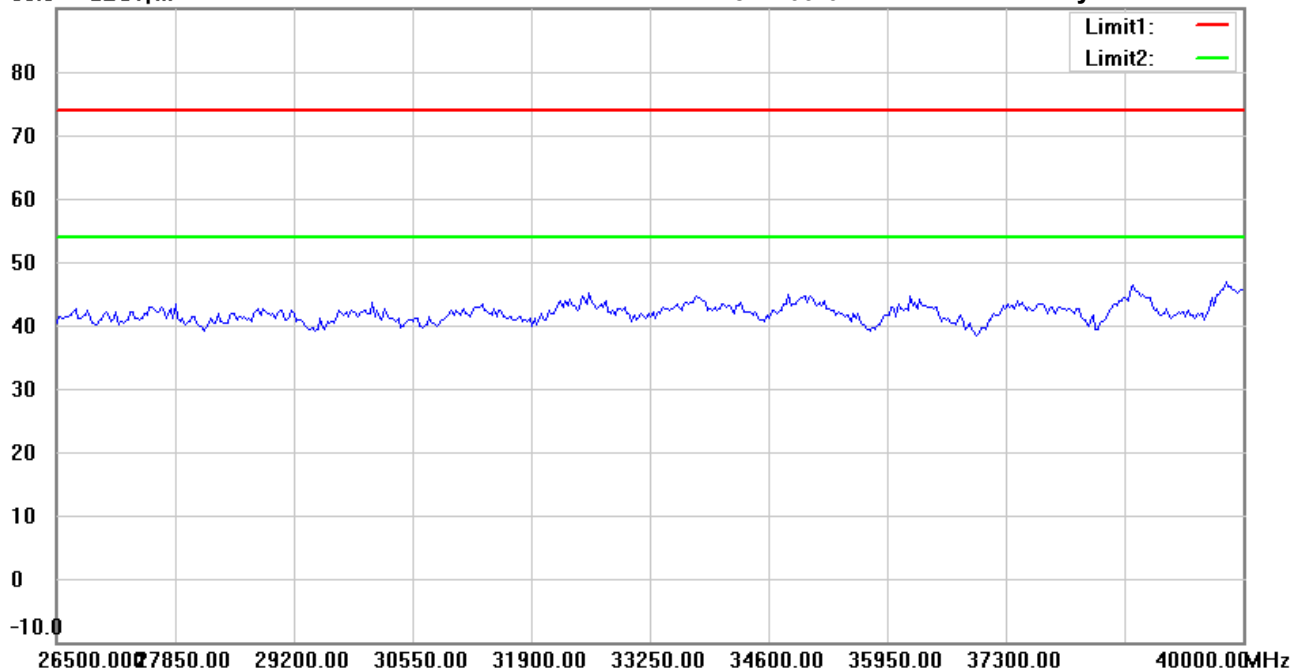

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:14:34 AM

Humidity: 64.7 %

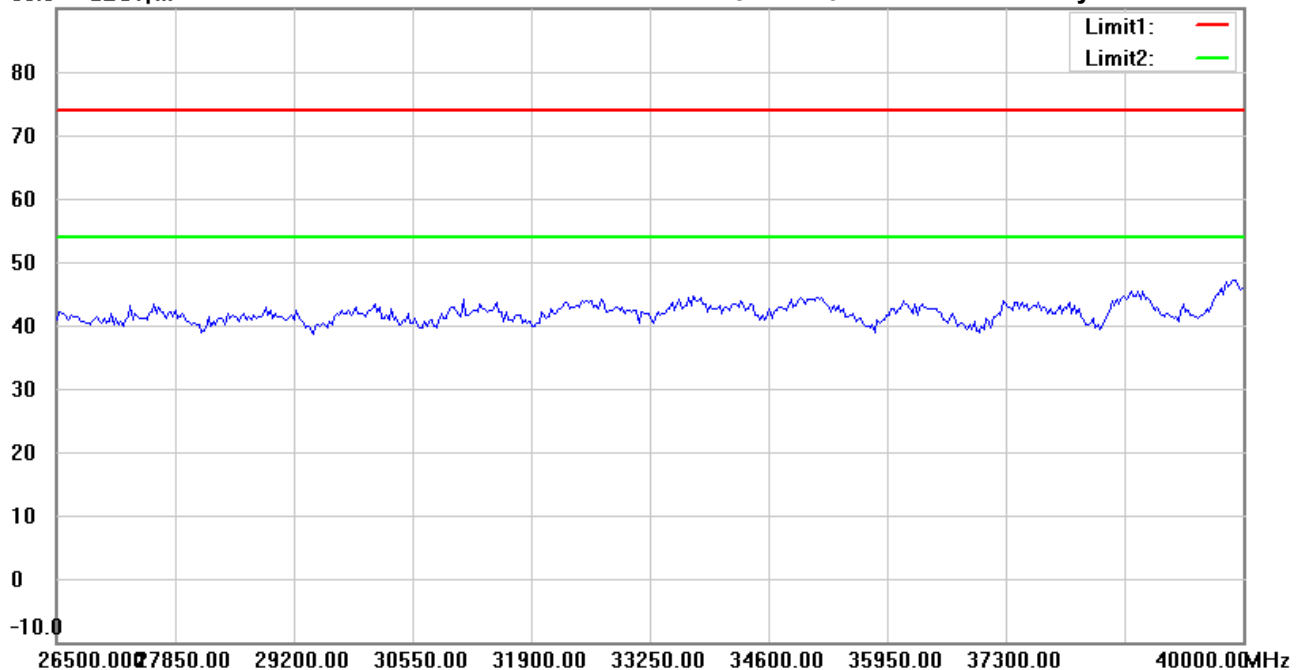

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:17:26 AM

Humidity:64.7 %

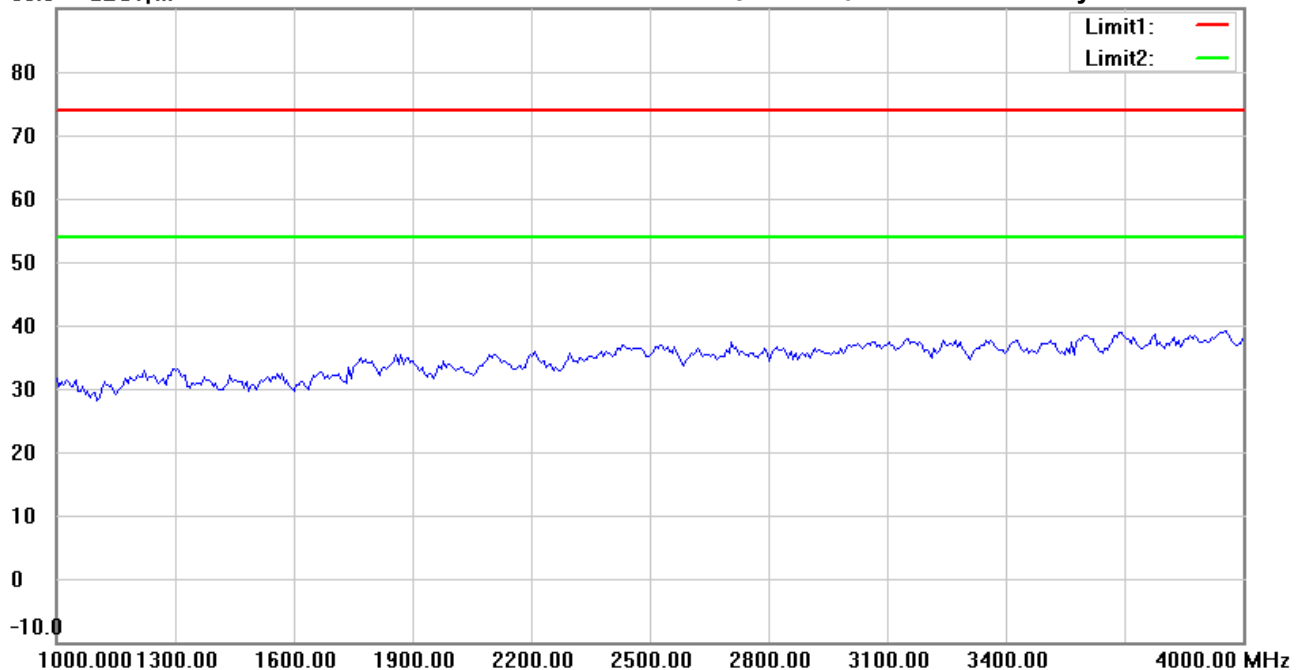

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

Time: 7:20:57 AM

Humidity:64.7 %

90.0 dBuV/m

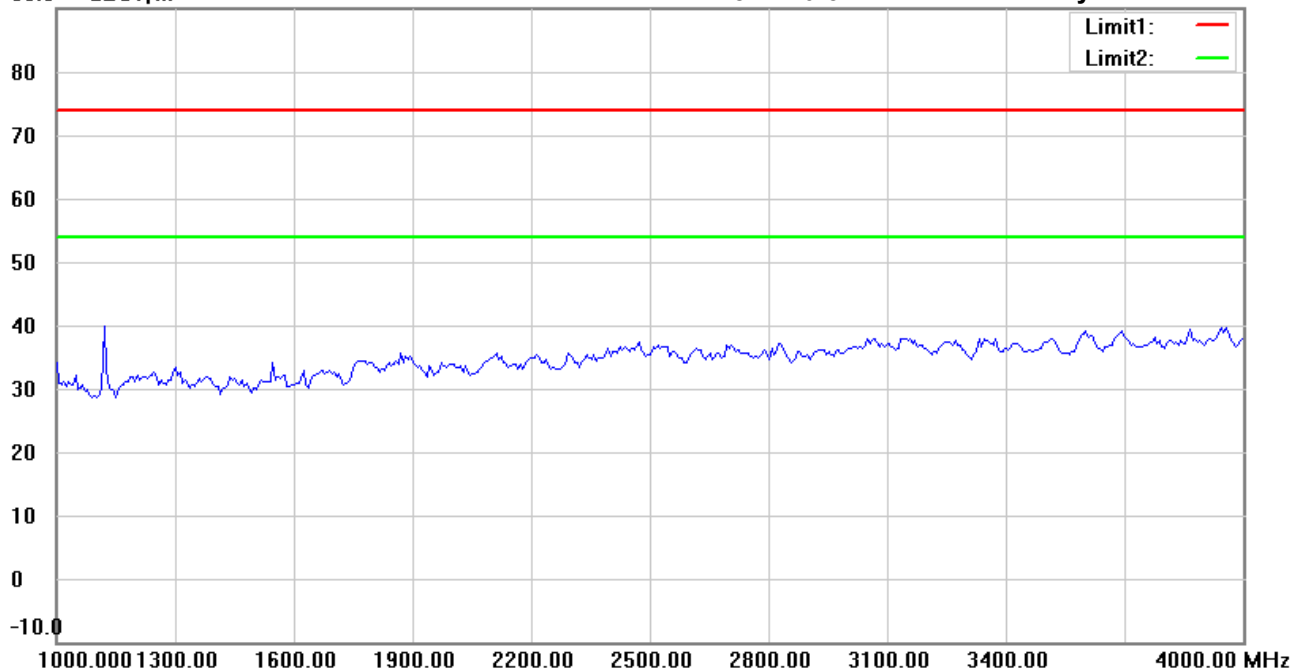

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#2


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:17:34 AM

Humidity:64.7 %

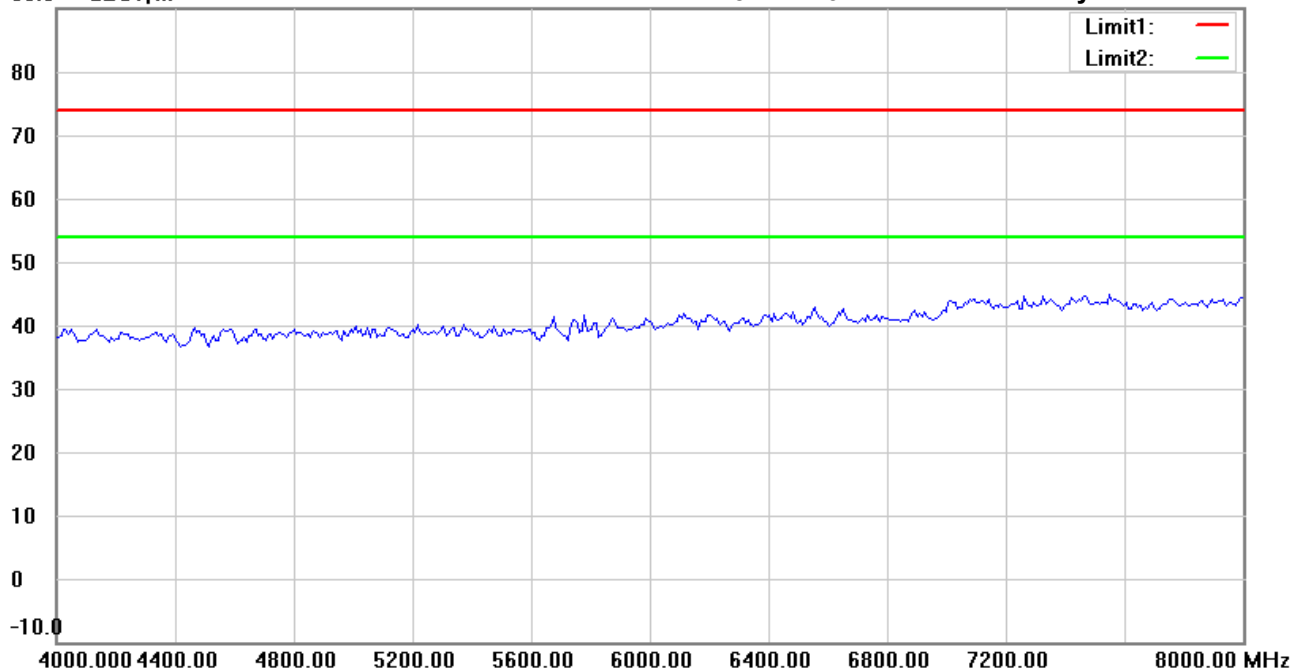

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:21:05 AM

Humidity:64.7 %

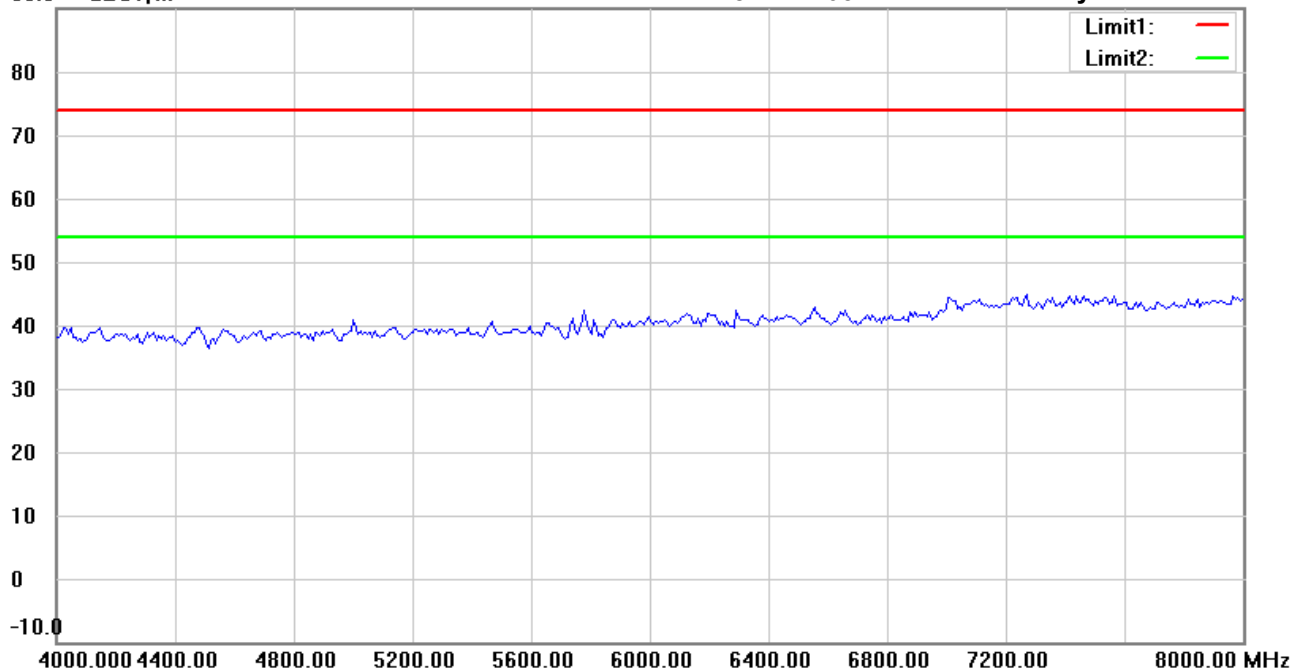

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:18:38 AM

Humidity: 64.7 %

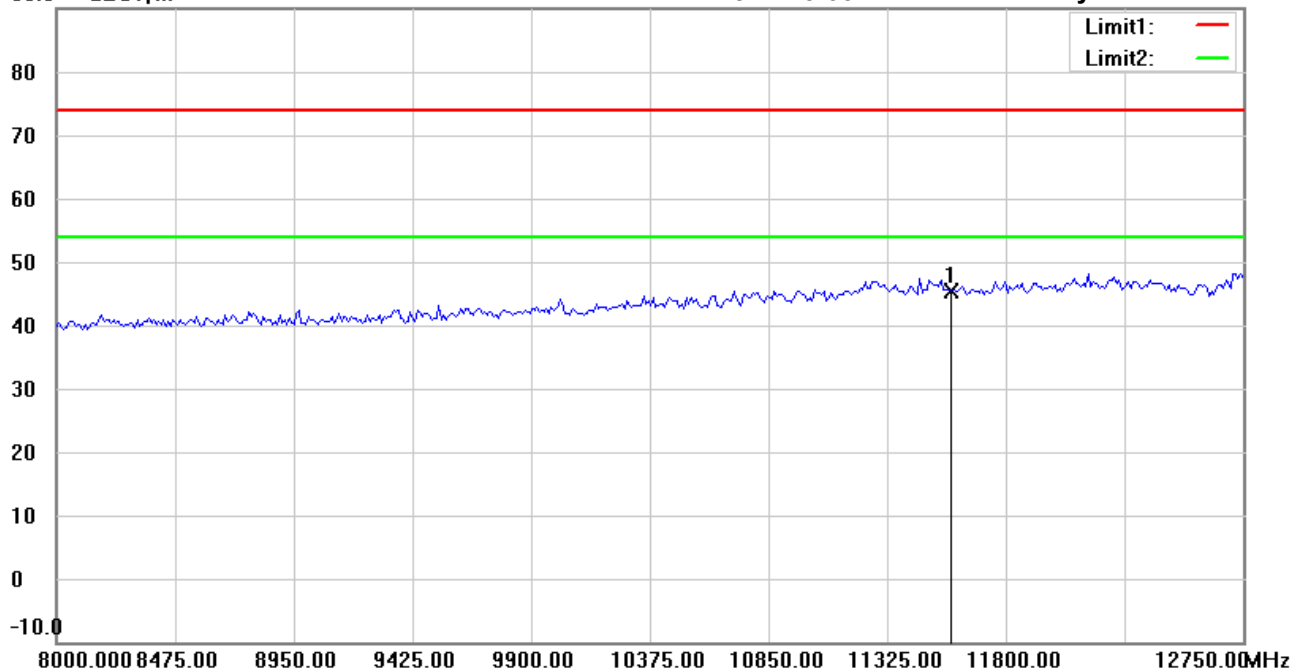

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	34.37	peak	11.12	45.49	74.00	150	135	-28.51	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#9


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:22:07 AM

Humidity:64.7 %

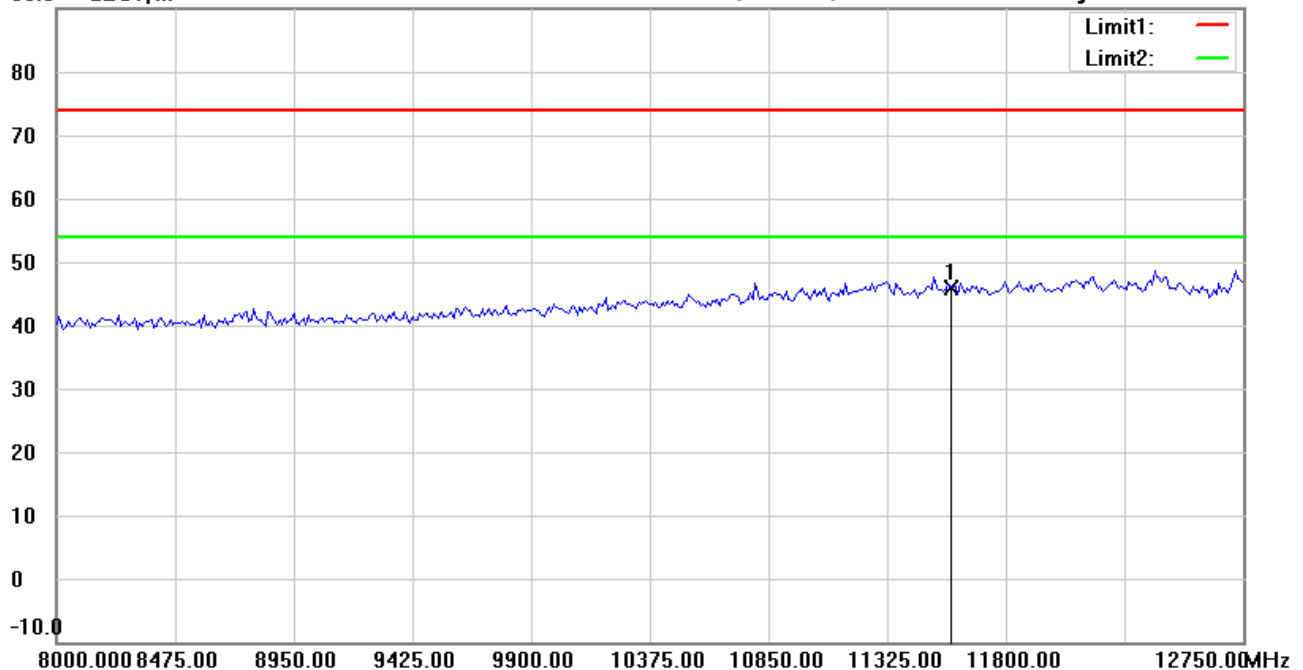

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	34.80	peak	11.12	45.92	74.00	150	10	-28.08	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:19:47 AM

Humidity: 64.7 %

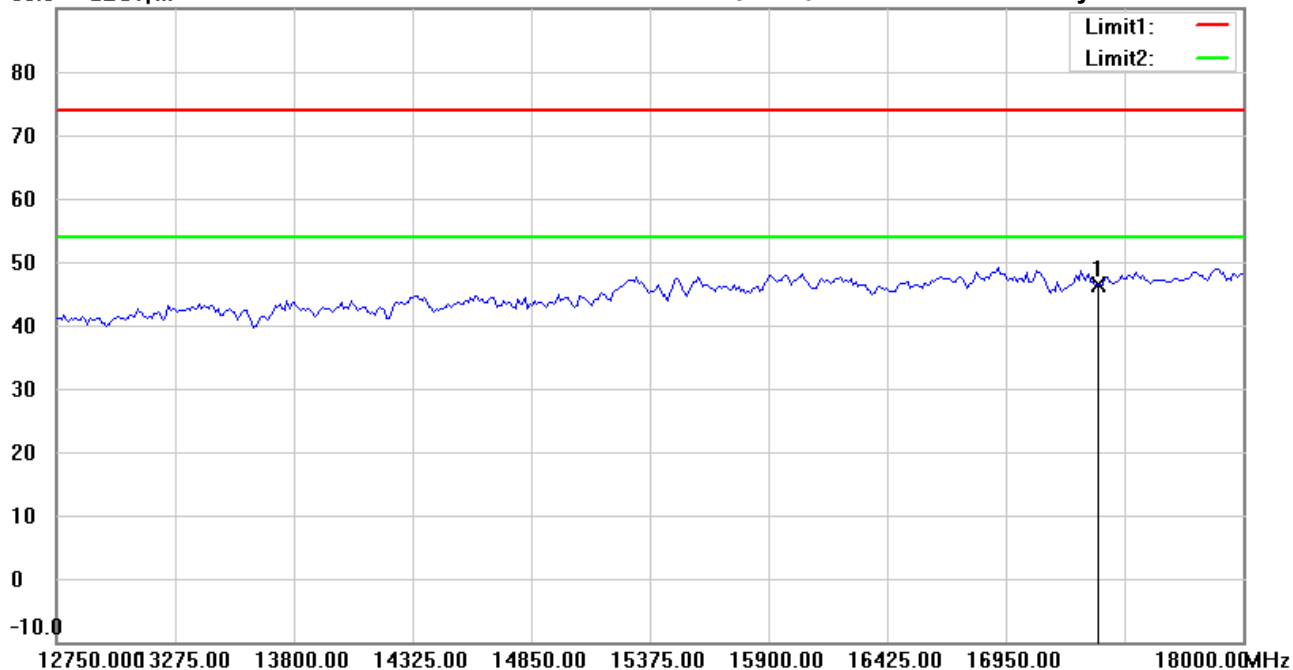

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	25.90	peak	20.45	46.35	74.00	150	90	-27.65	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:23:16 AM

Humidity: 64.7 %

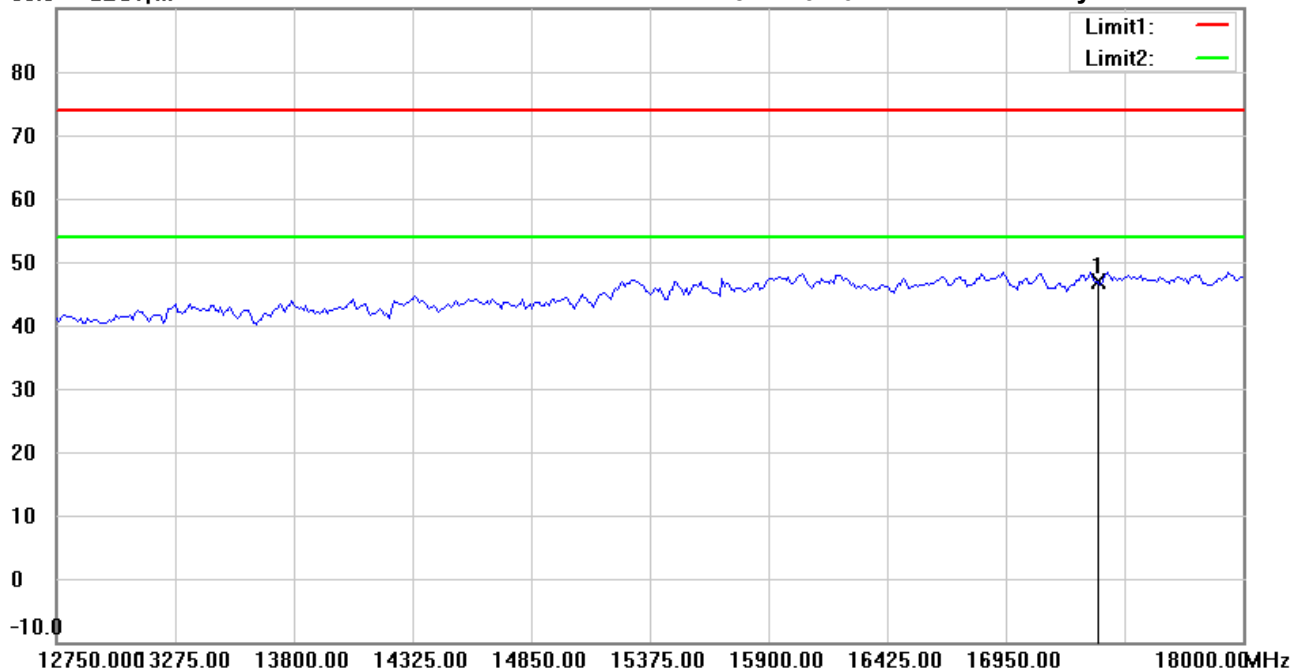

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	26.40	peak	20.45	46.85	74.00	150	75	-27.15	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:19:57 AM

Humidity:64.7 %

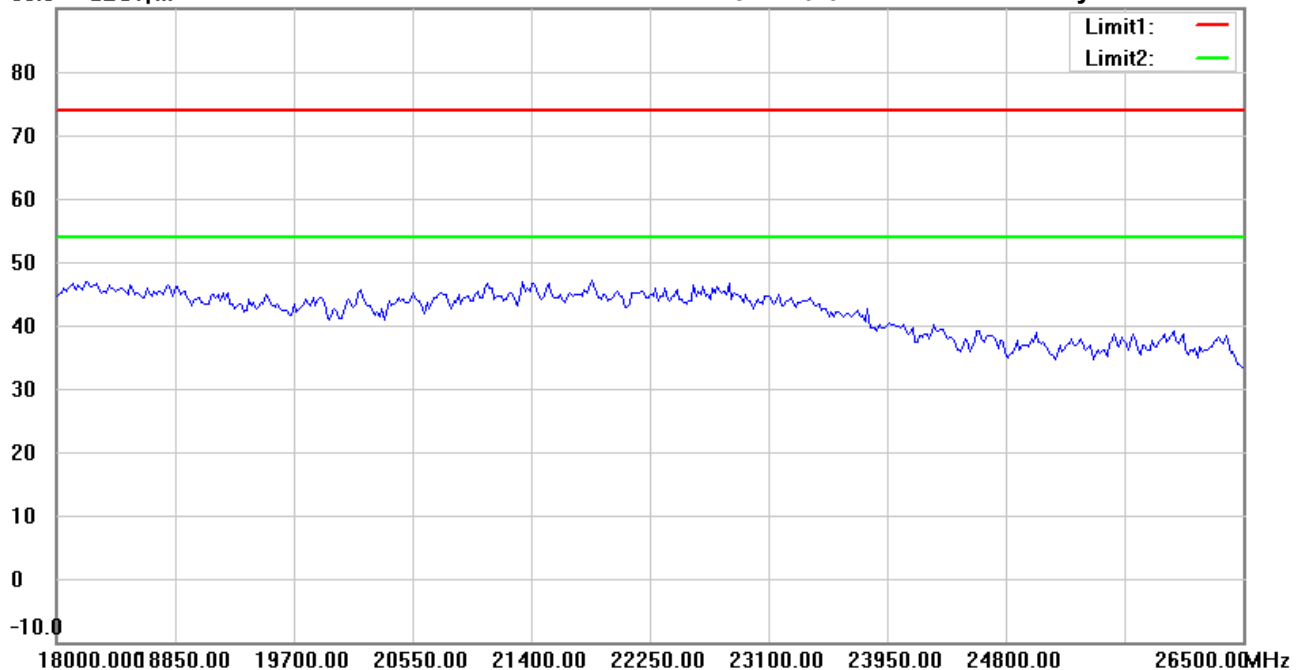

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:23:26 AM

Humidity:64.7 %

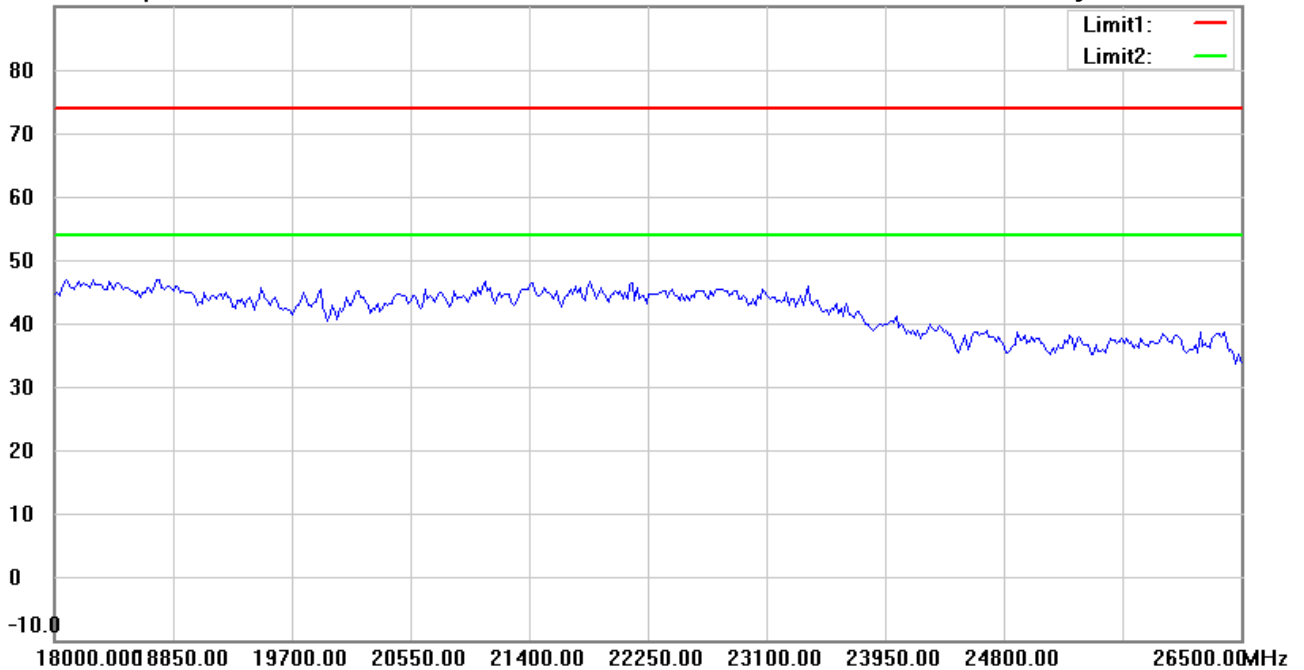

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:20:08 AM

Humidity: 64.7 %

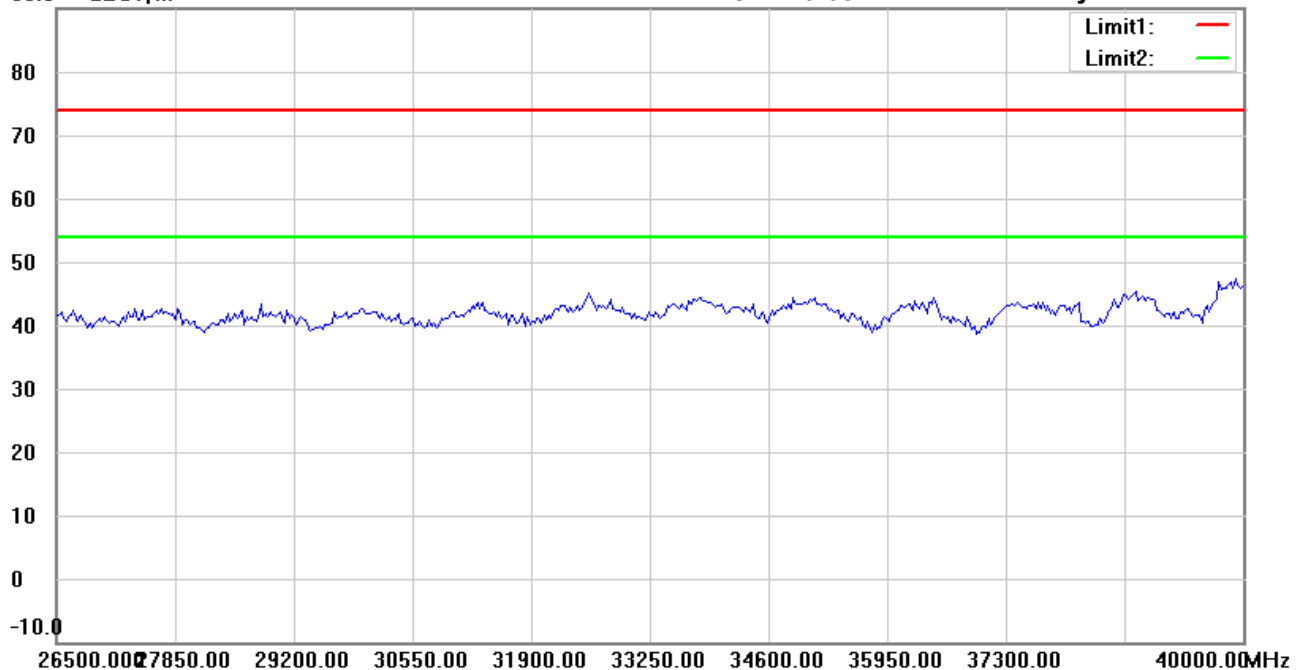

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:23:37 AM

Humidity:64.7 %

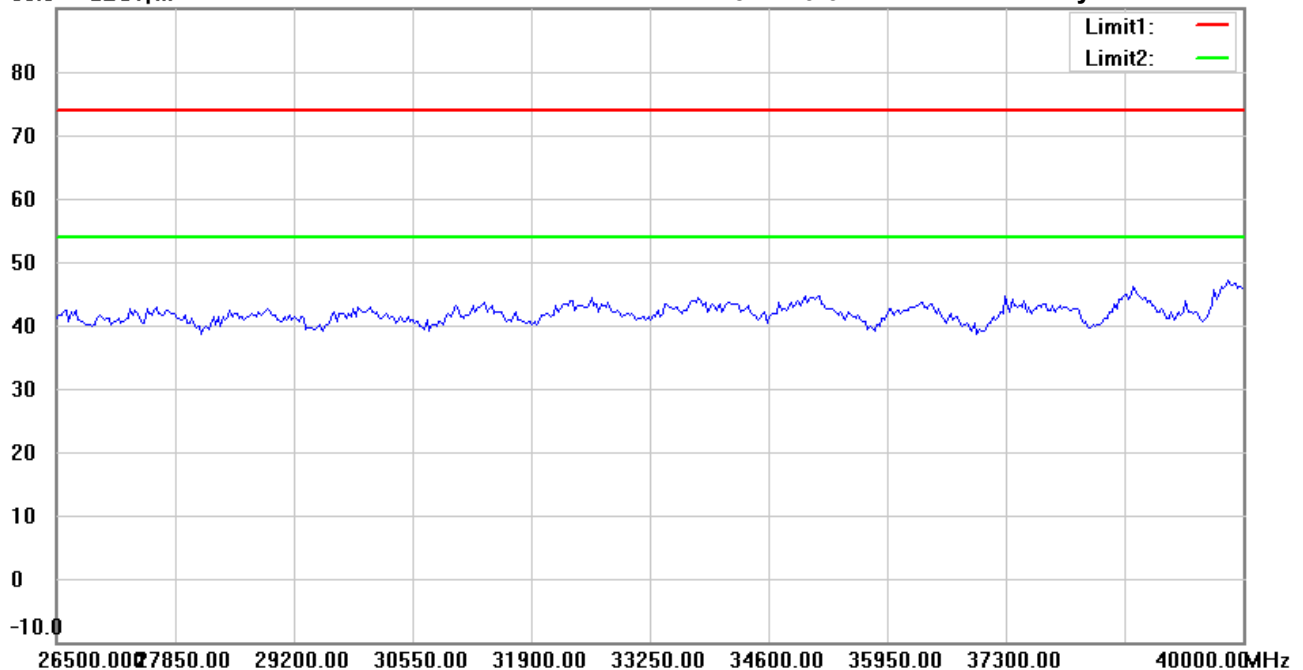

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:26:31 AM

Humidity: 64.7 %

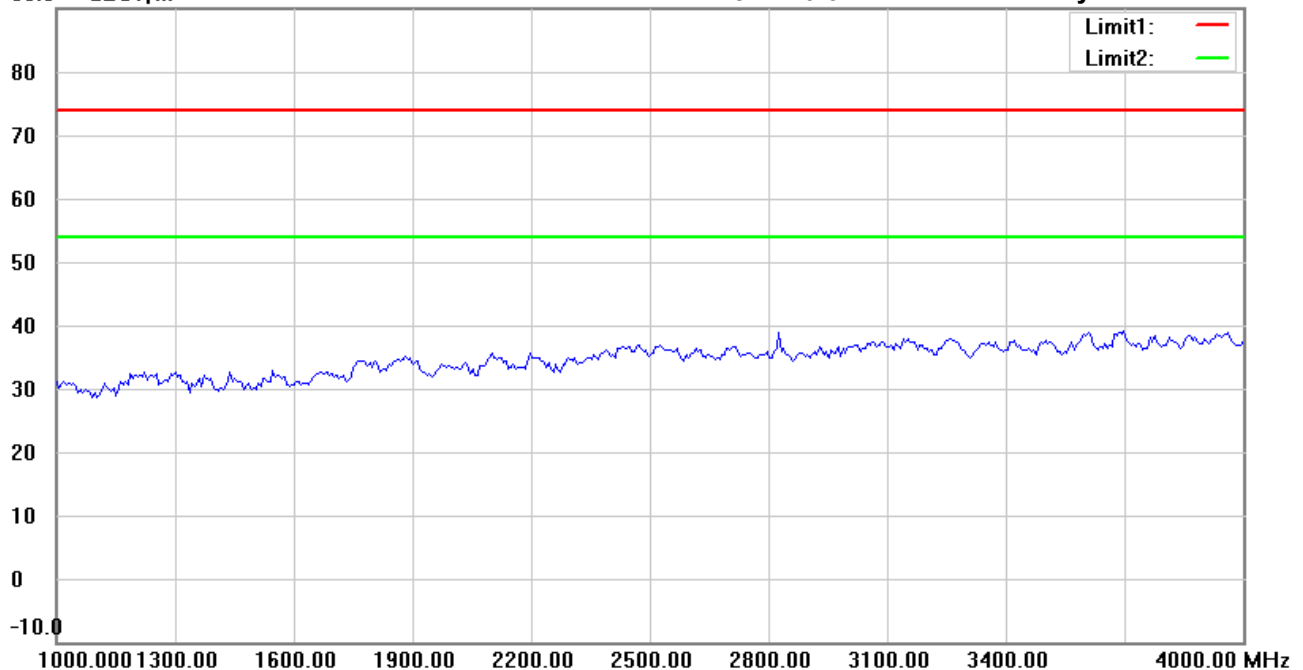

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:29:20 AM

Humidity:64.7 %

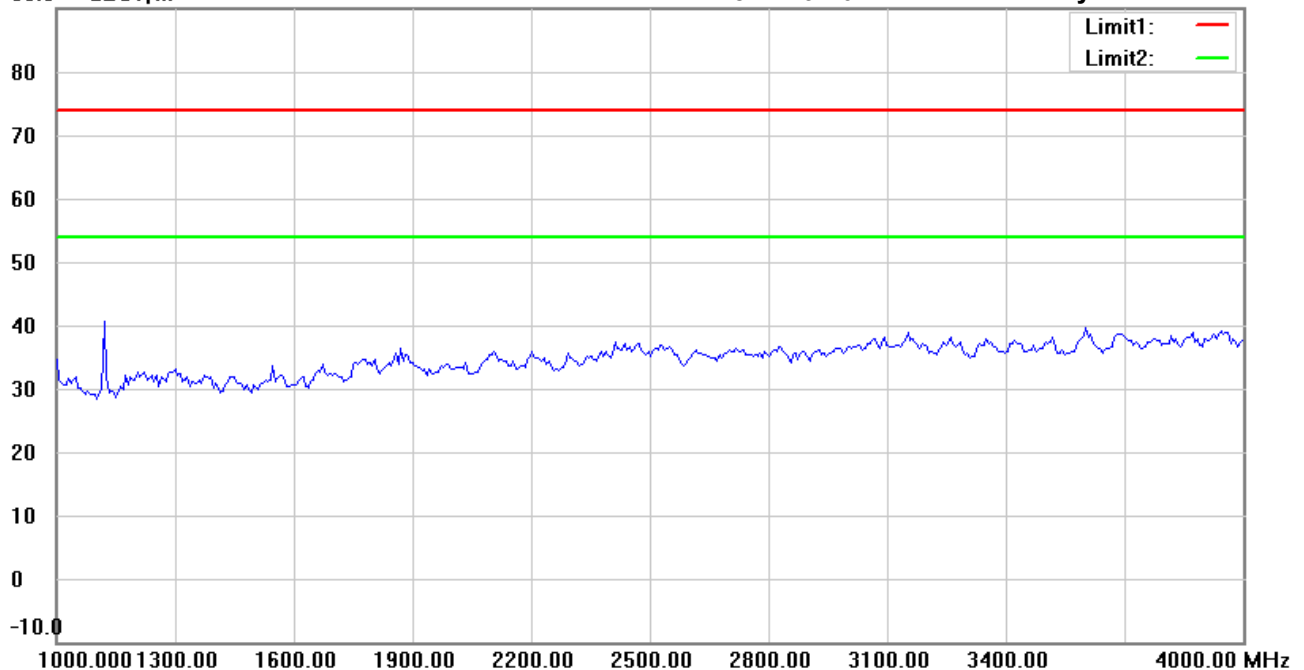

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:26:39 AM

Humidity: 64.7 %

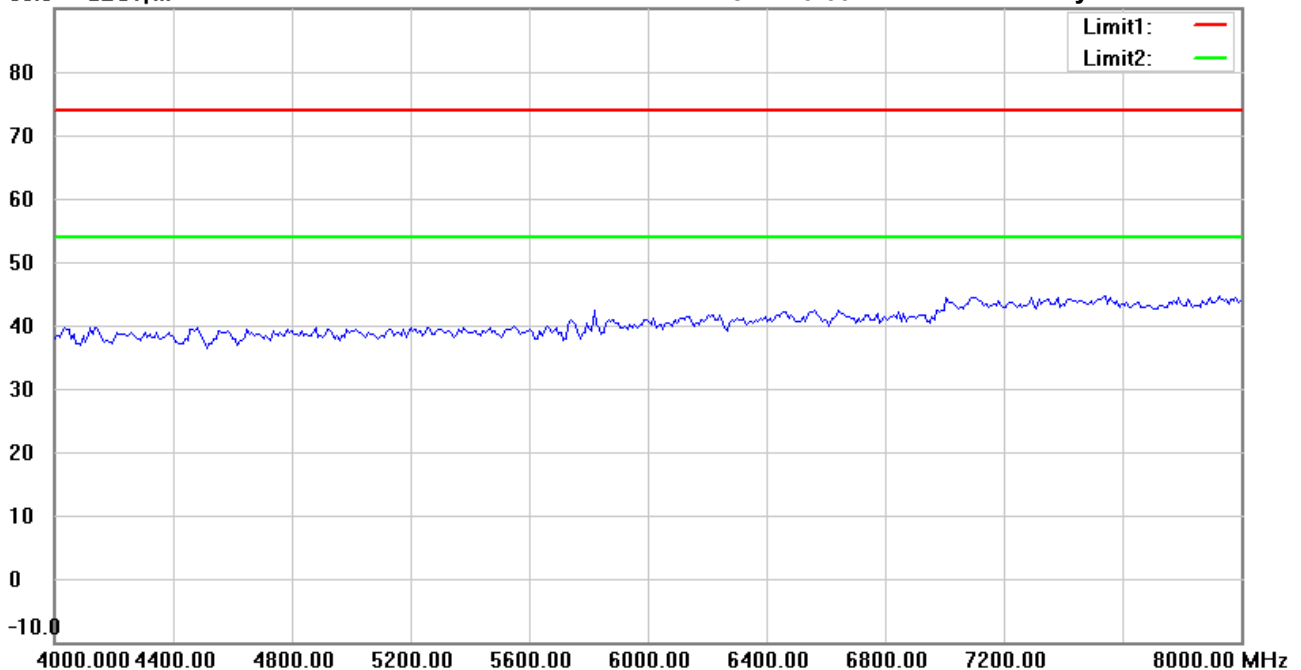

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:29:28 AM

Humidity:64.7 %

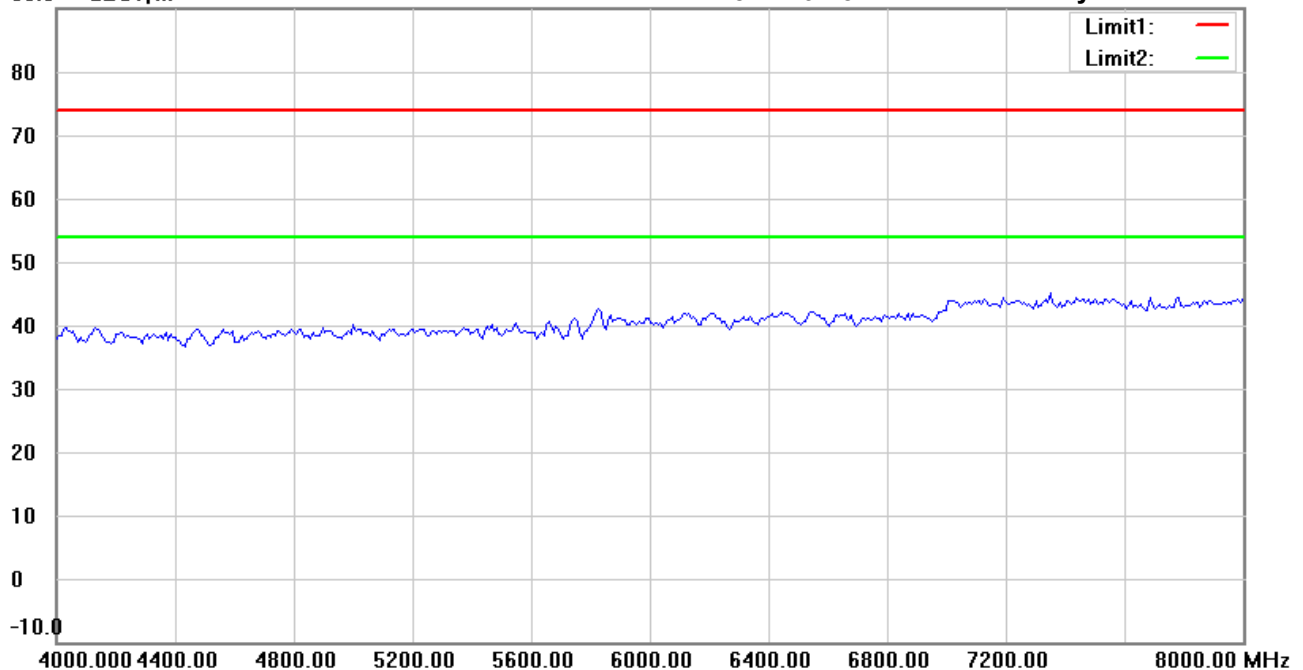

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:27:40 AM

Humidity: 64.7 %

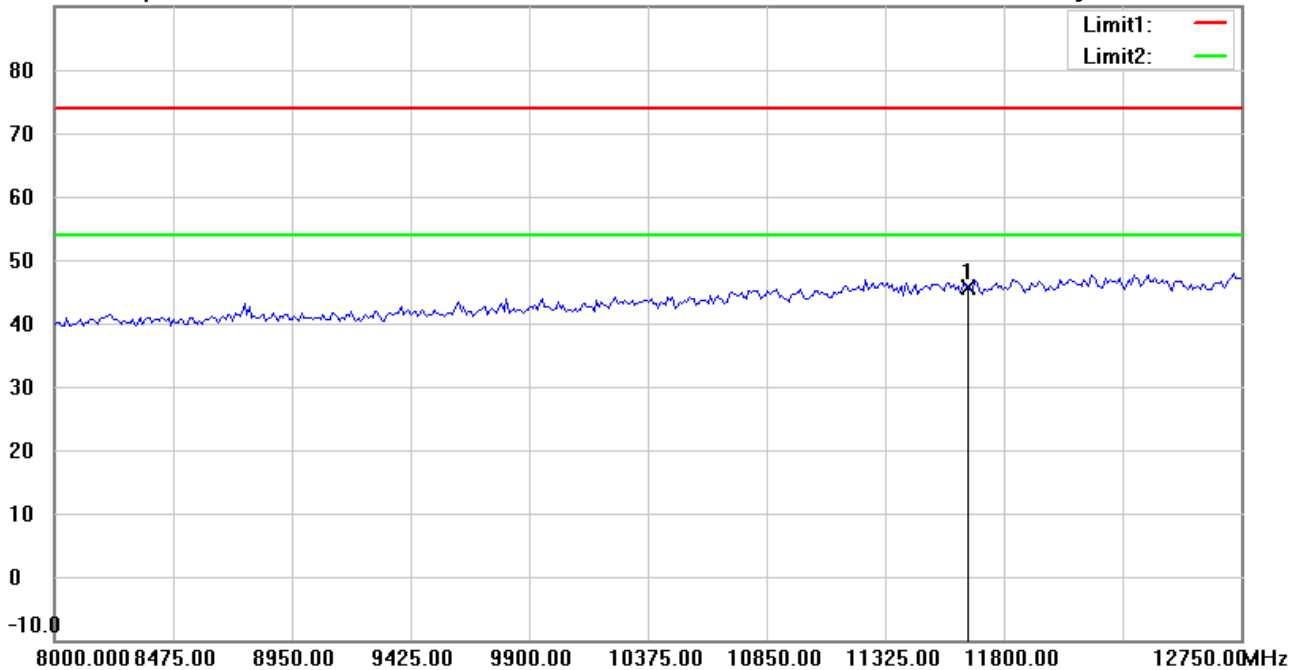

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	34.68	peak	10.97	45.65	74.00	150	95	-28.35	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:30:31 AM

Humidity: 64.7 %

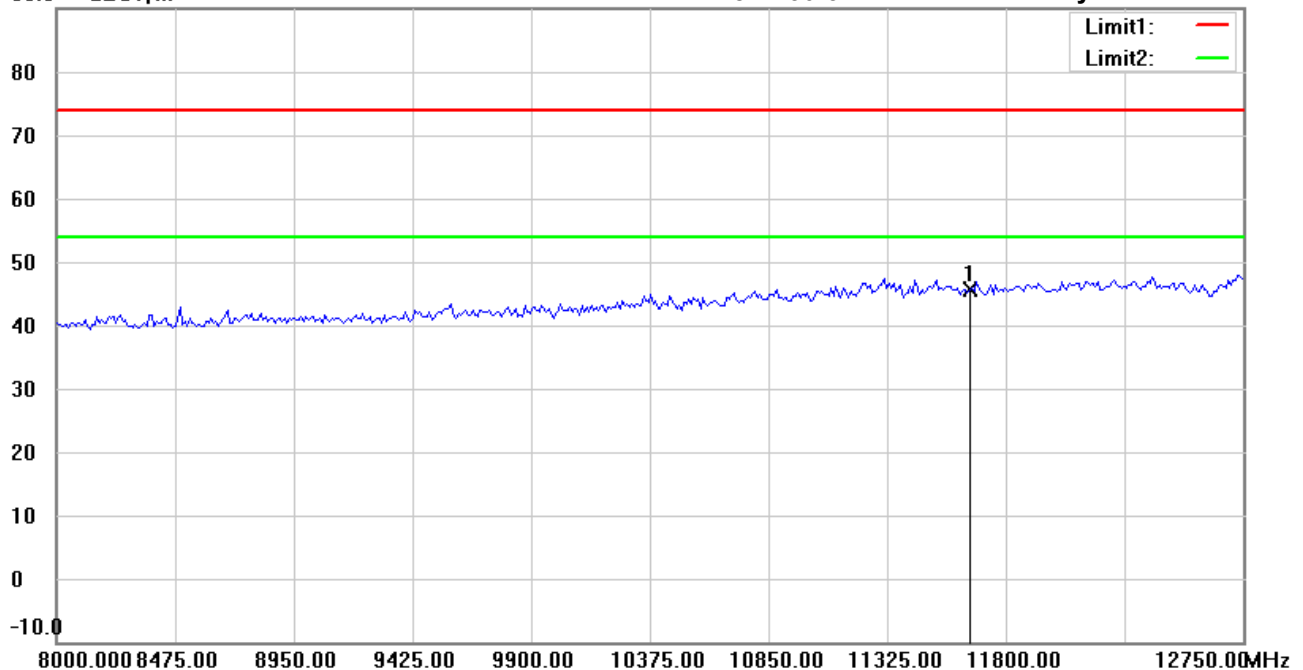

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	34.69	peak	10.97	45.66	74.00	150	80	-28.34	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:28:50 AM

Humidity: 64.7 %

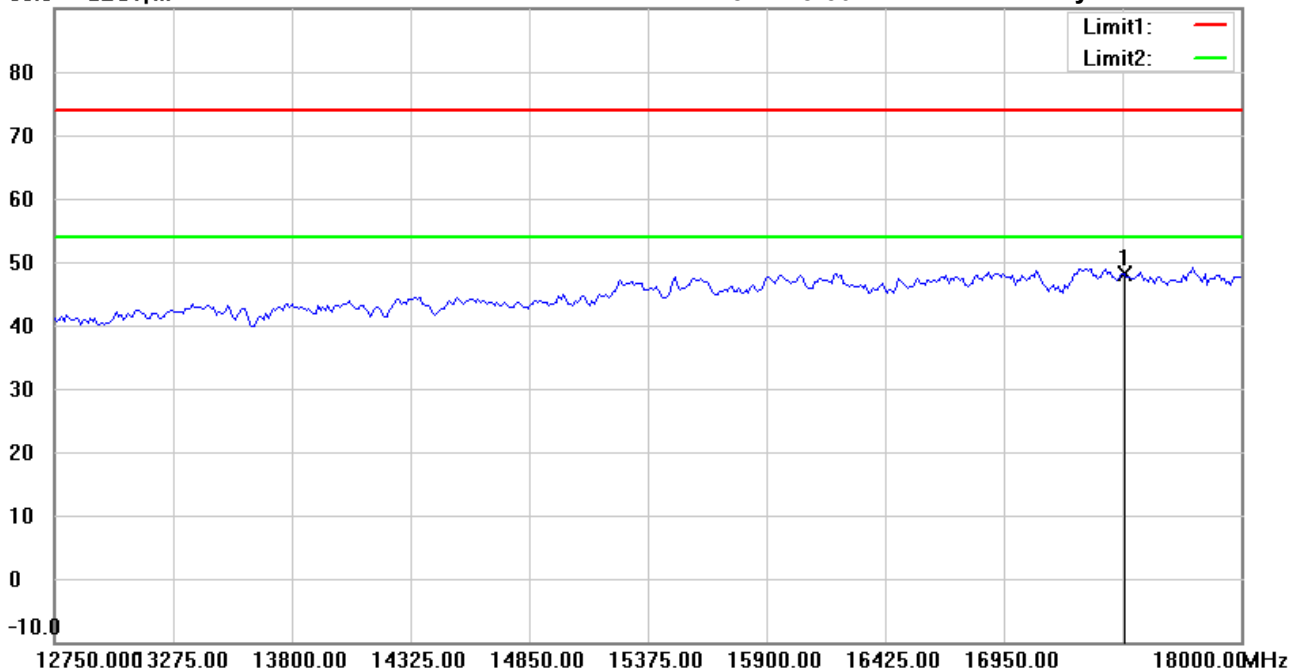

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	27.79	peak	20.33	48.12	74.00	150	255	-25.88	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:31:40 AM

Humidity: 64.7 %

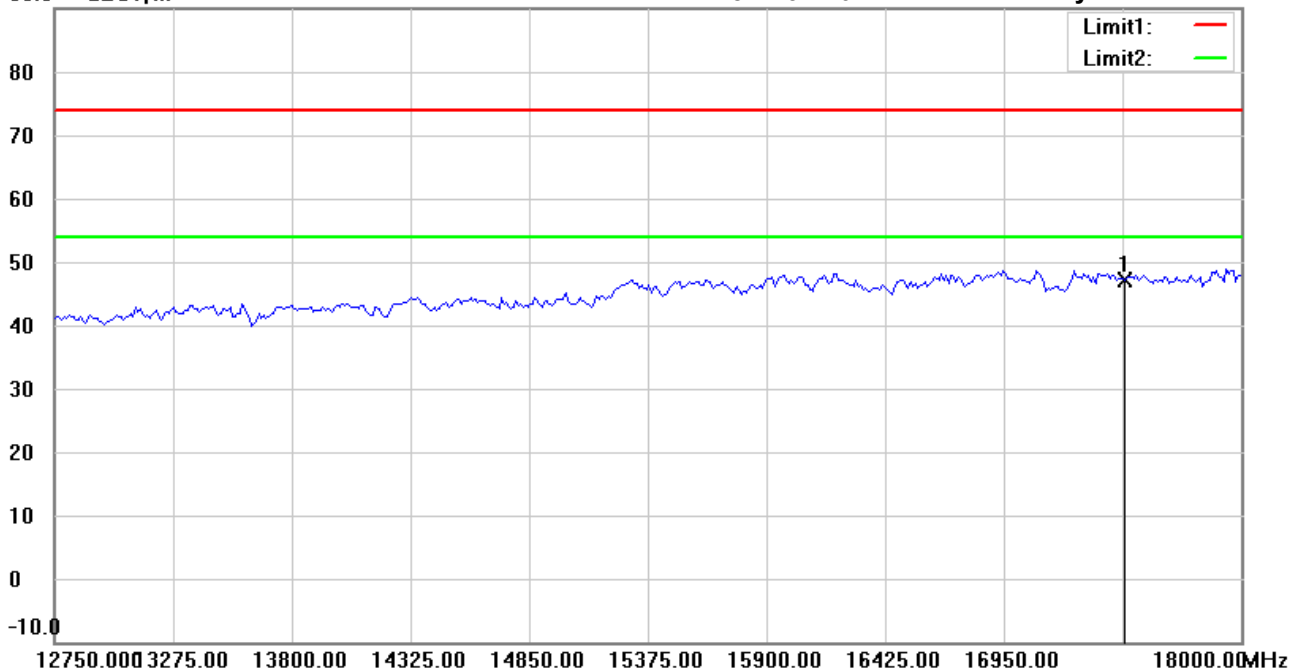

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	26.90	peak	20.33	47.23	74.00	150	215	-26.77	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:29:00 AM

Humidity:64.7 %

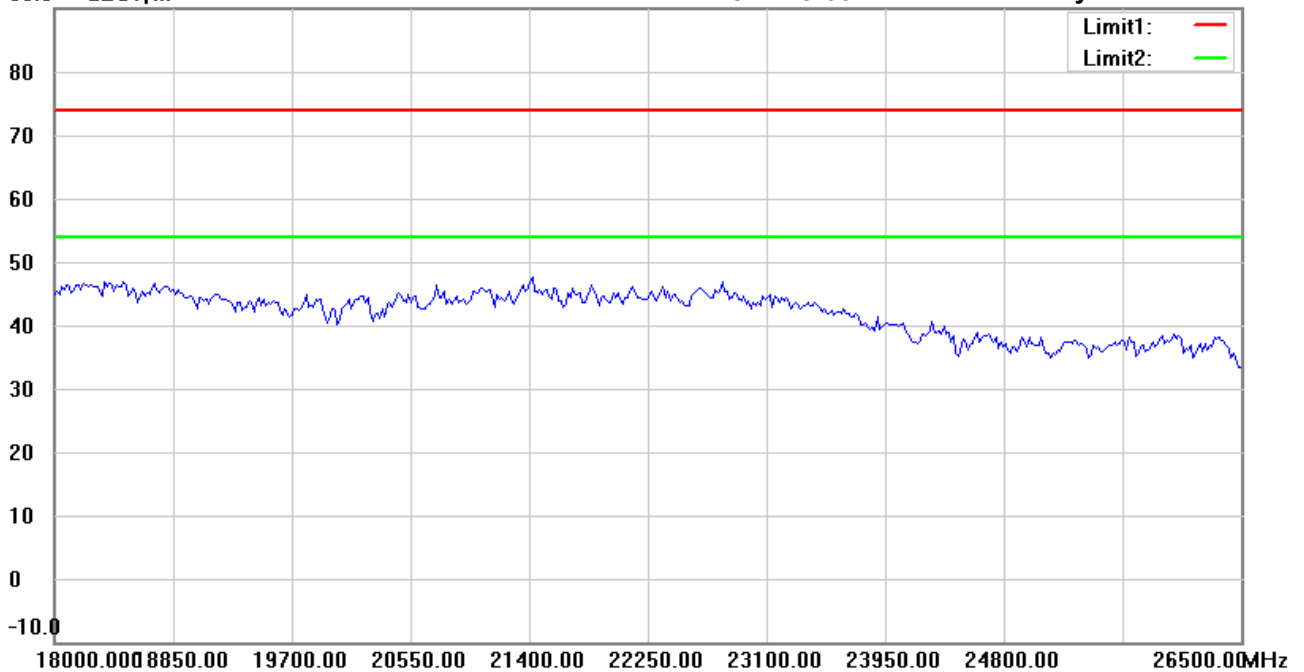

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:31:50 AM

Humidity: 64.7 %

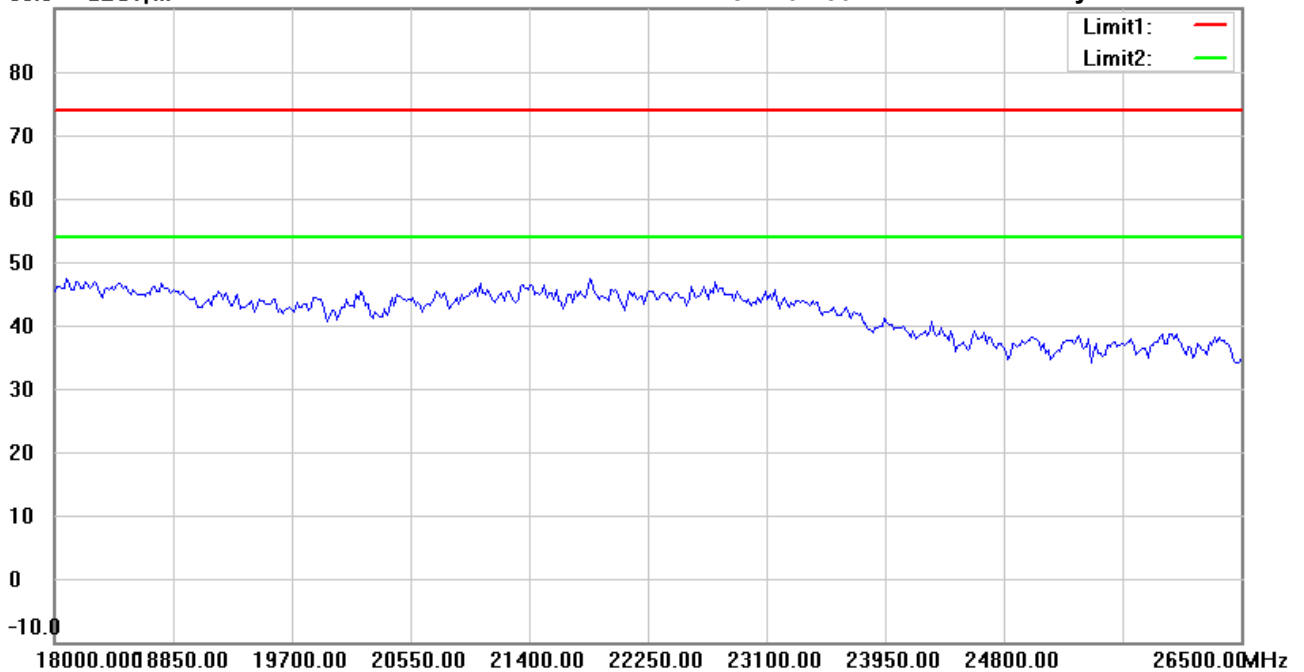

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#6


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:29:11 AM

Humidity:64.7 %

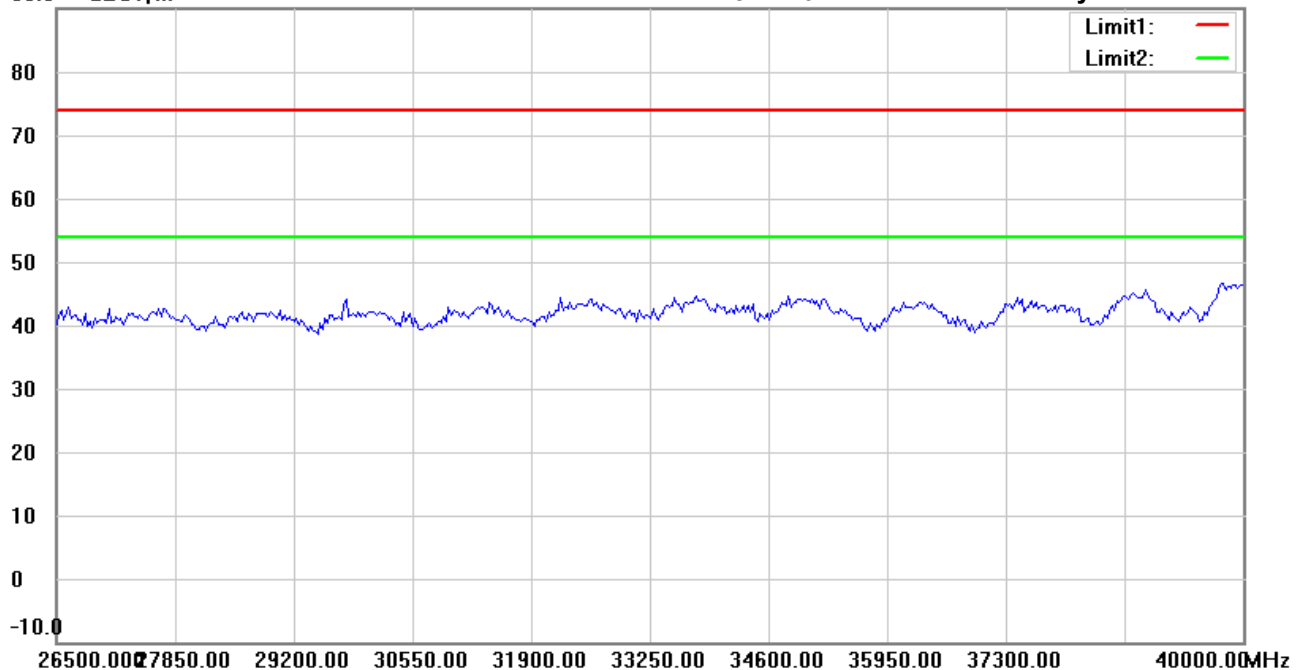

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:32:01 AM

Humidity: 64.7 %

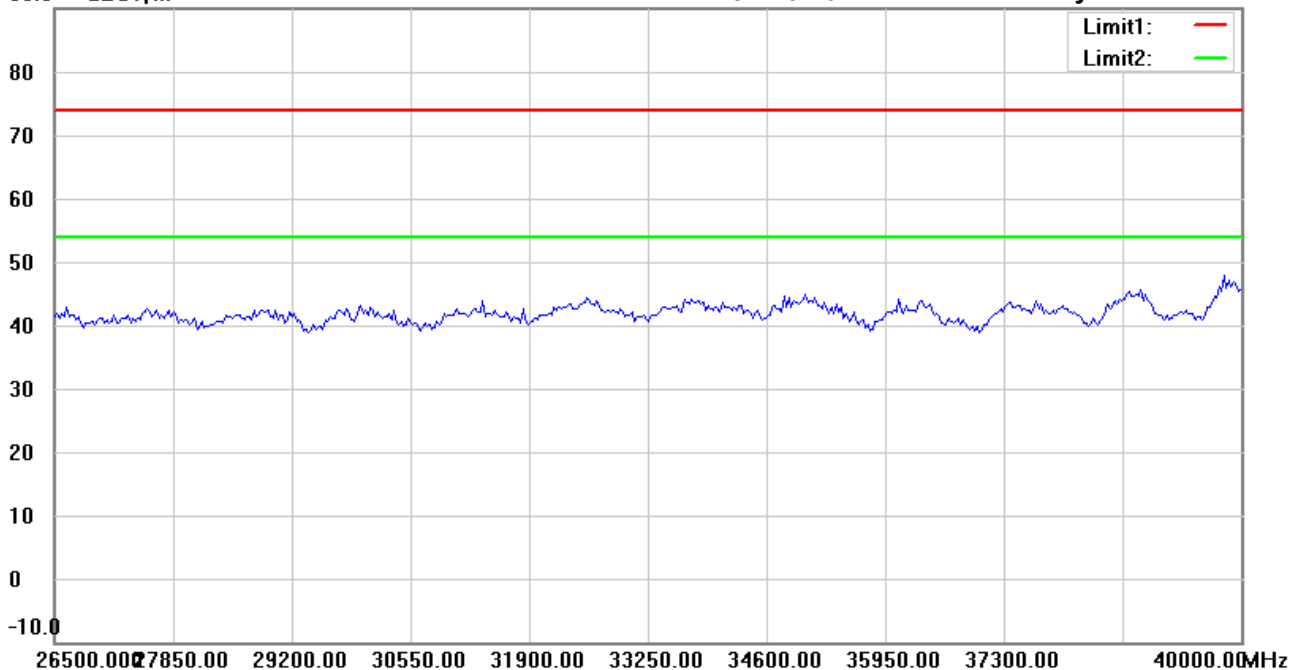

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File : 1_TX 802

Data : #1


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:55:06 PM

Humidity: 72.8 %

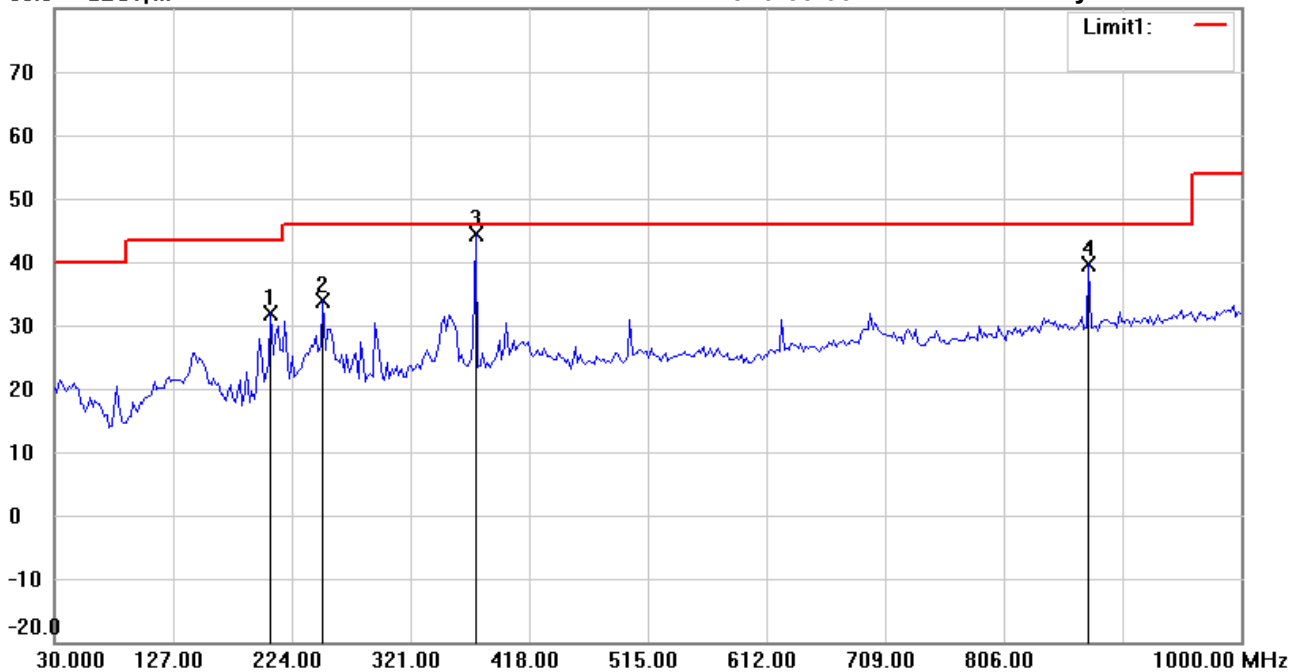

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	206.8938	42.60	peak	-10.83	31.77	43.50	100	55	-11.73	
	249.6593	41.83	peak	-8.02	33.81	46.00	100	30	-12.19	
*	374.0681	48.78	peak	-4.50	44.28	46.00	100	255	-1.72	
	875.5912	36.58	peak	2.93	39.51	46.00	100	160	-6.49	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File : 1_TX 802

Data : #2


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:56:30 PM

Humidity: 72.8 %

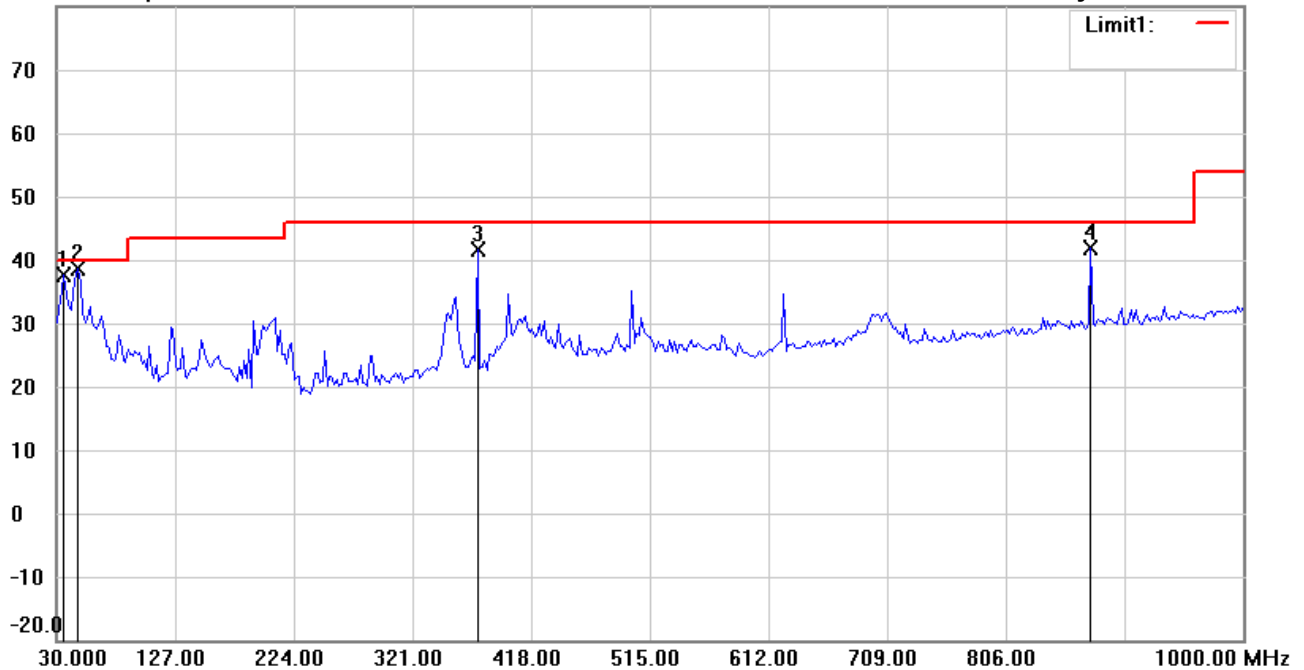

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	35.8316	46.53	peak	-8.95	37.58	40.00	100	200	-2.42	
*	47.4950	48.65	peak	-9.91	38.74	40.00	100	315	-1.26	
	374.0681	46.25	peak	-4.50	41.75	46.00	100	60	-4.25	
	875.5912	39.00	peak	2.93	41.93	46.00	100	55	-4.07	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:31:22 AM

Humidity: 61.7 %

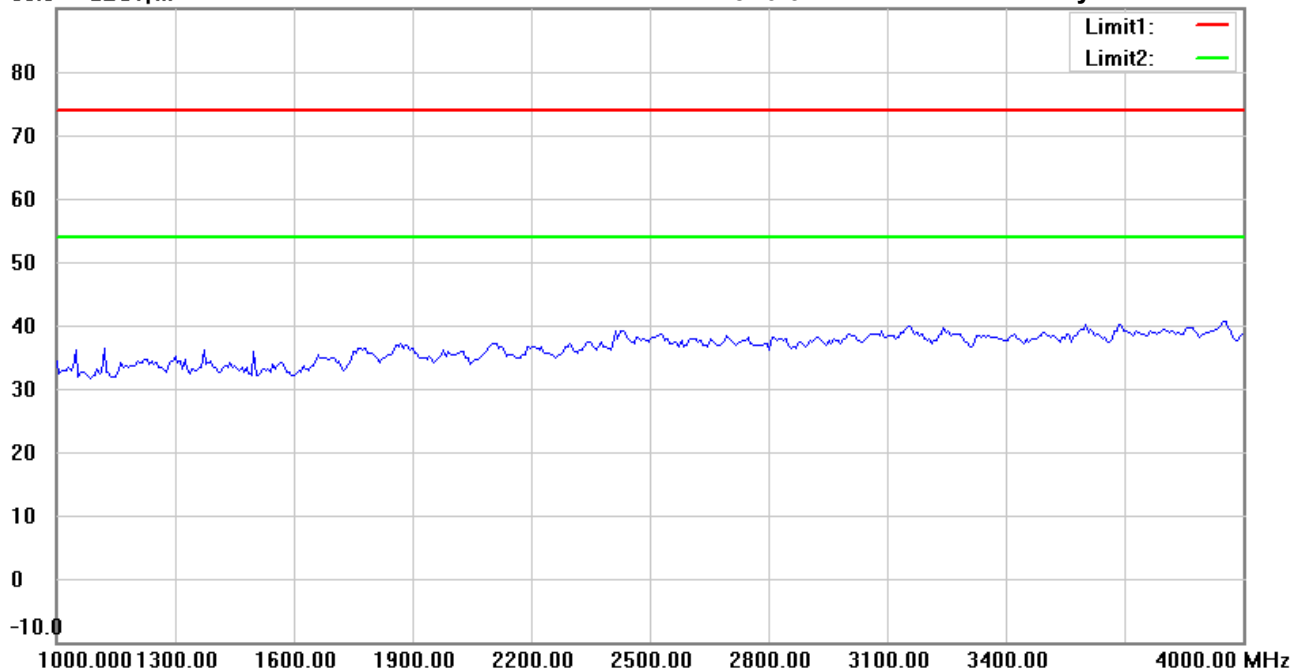

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:36:00 AM

Humidity: 61.7 %

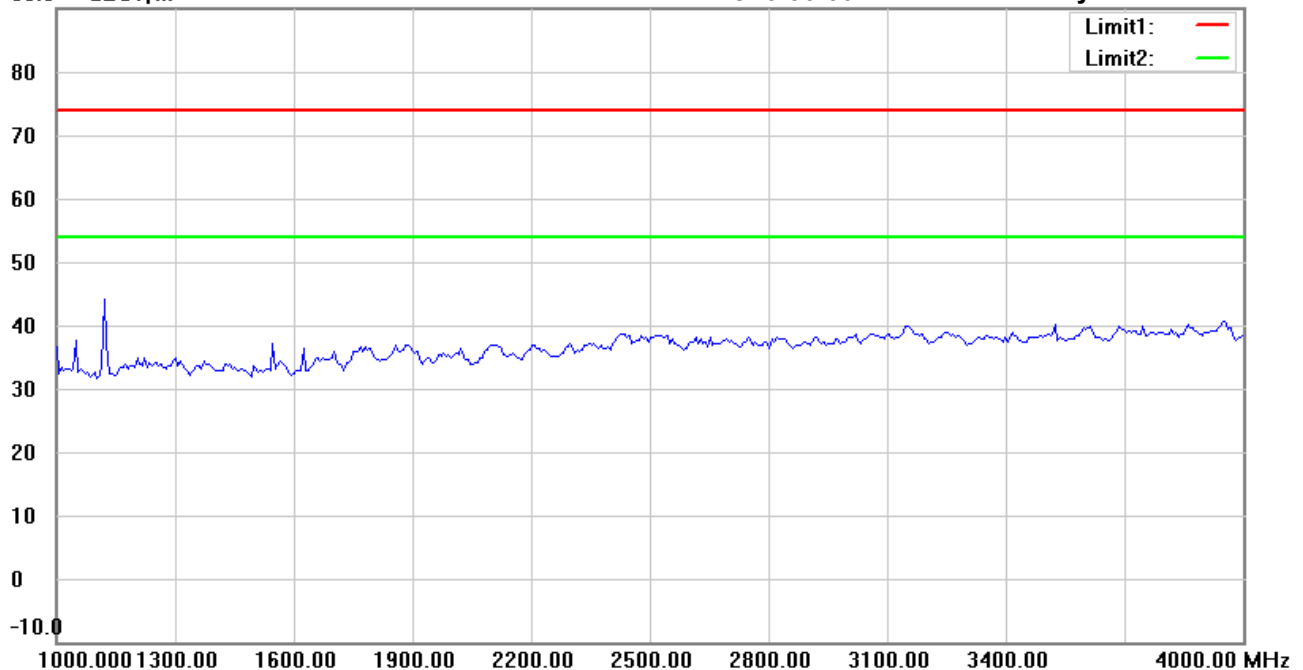

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:32:23 AM

Humidity: 61.7 %

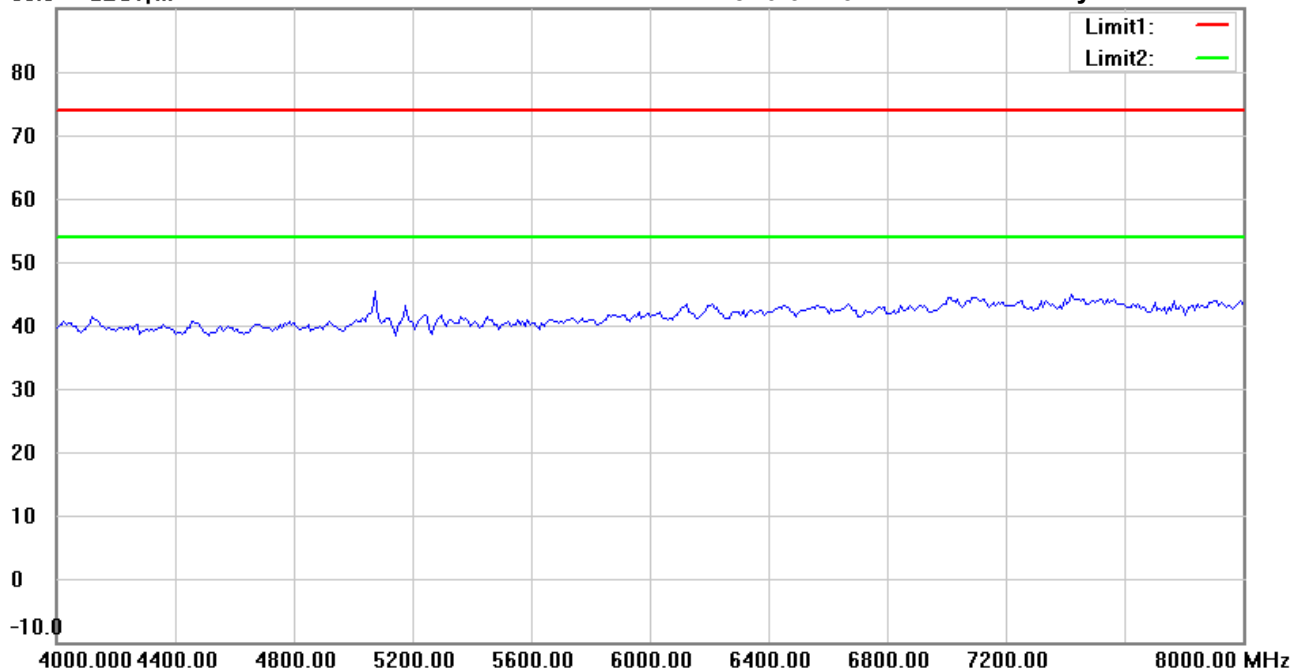

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:37:01 AM

Humidity: 61.7 %

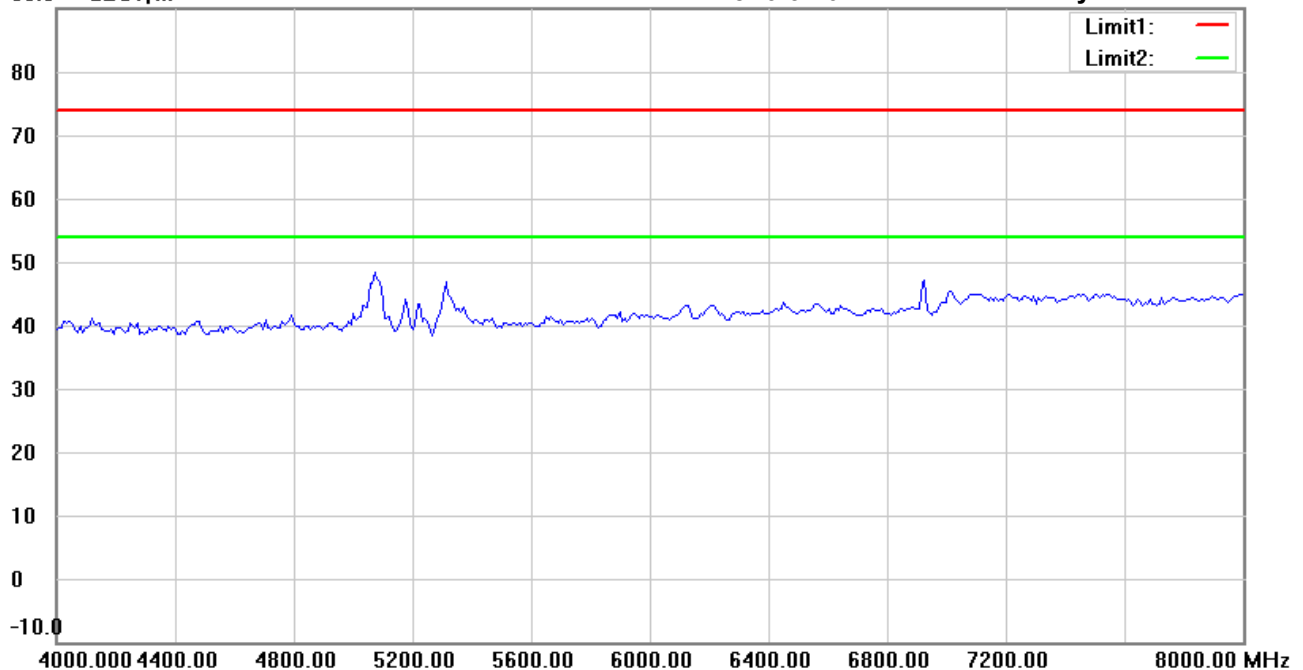

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:33:26 AM

Humidity: 61.7 %

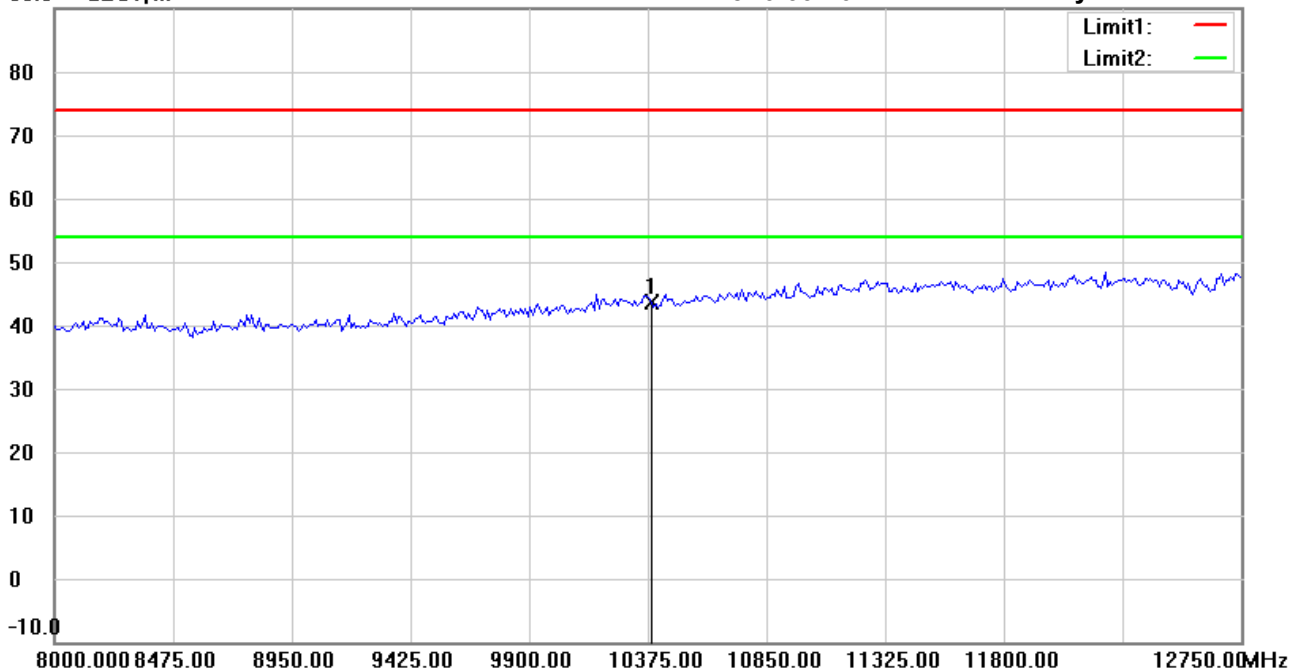

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10380.000	35.52	peak	8.22	43.74	74.00	150	300	-30.26	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

Time: 6:38:18 AM

Humidity: 61.7 %

90.0 dBuV/m

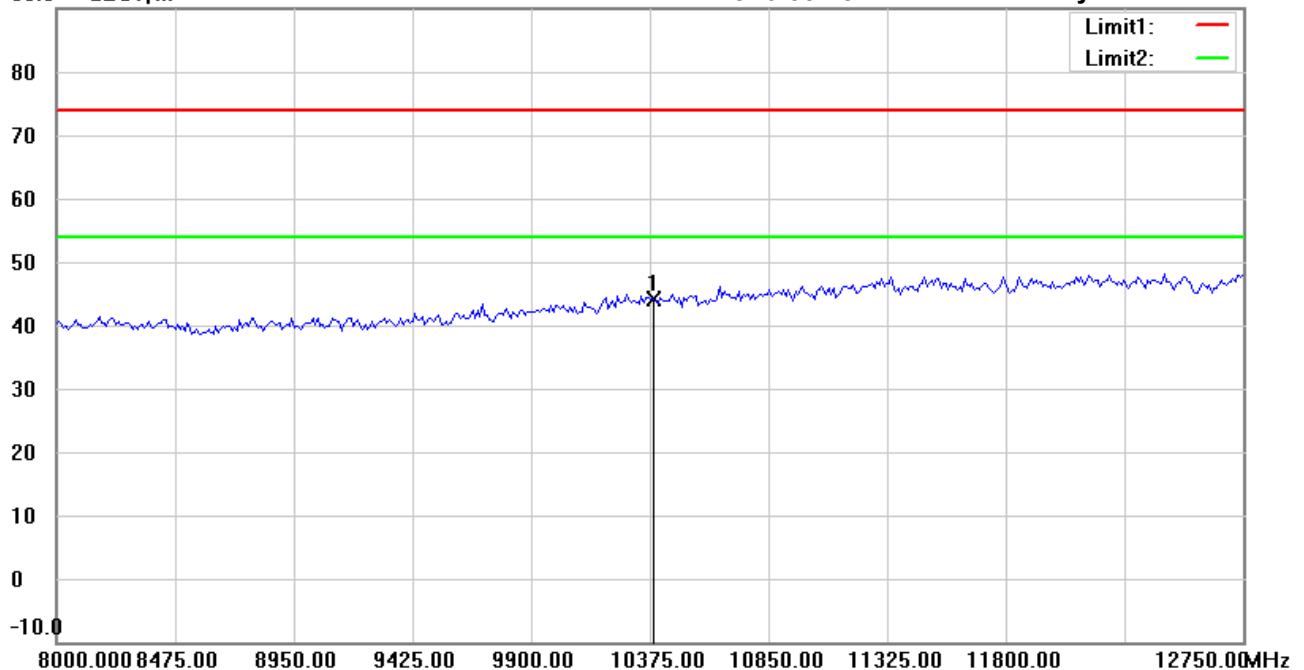

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10380.000	35.91	peak	8.22	44.13	74.00	150	70	-29.87	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:34:35 AM

Humidity: 61.7 %

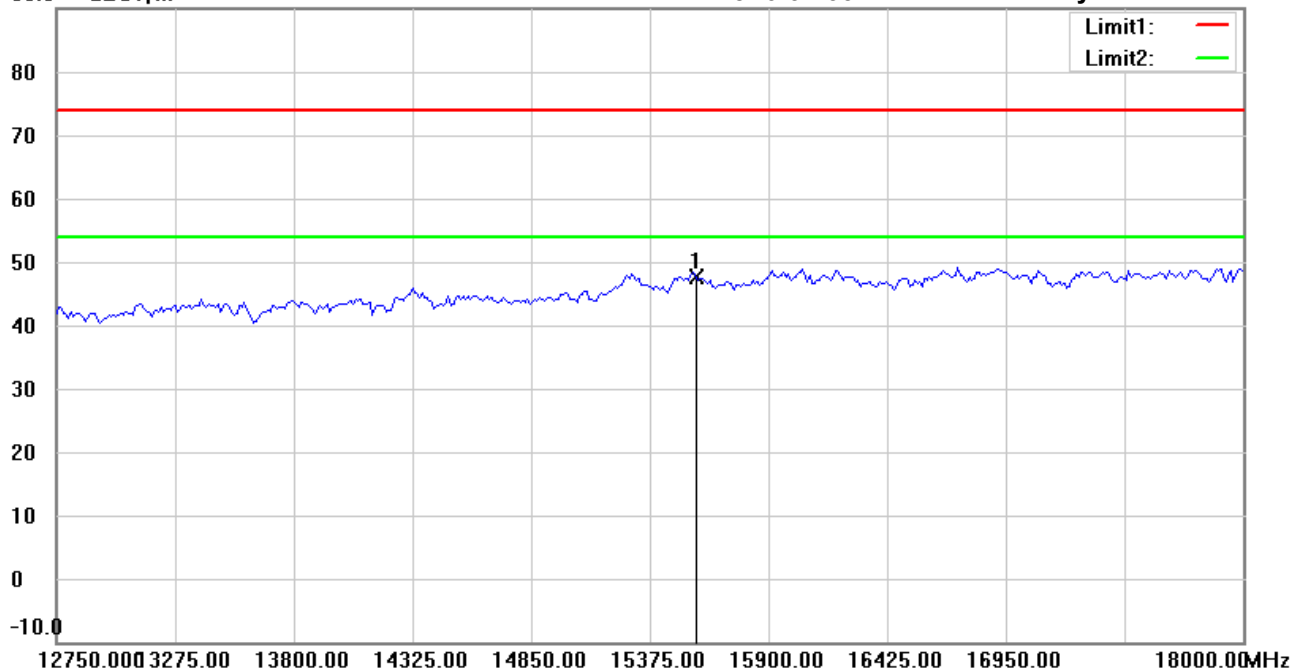

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15570.000	28.33	peak	19.36	47.69	74.00	150	80	-26.31	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:39:27 AM

Humidity: 61.7 %

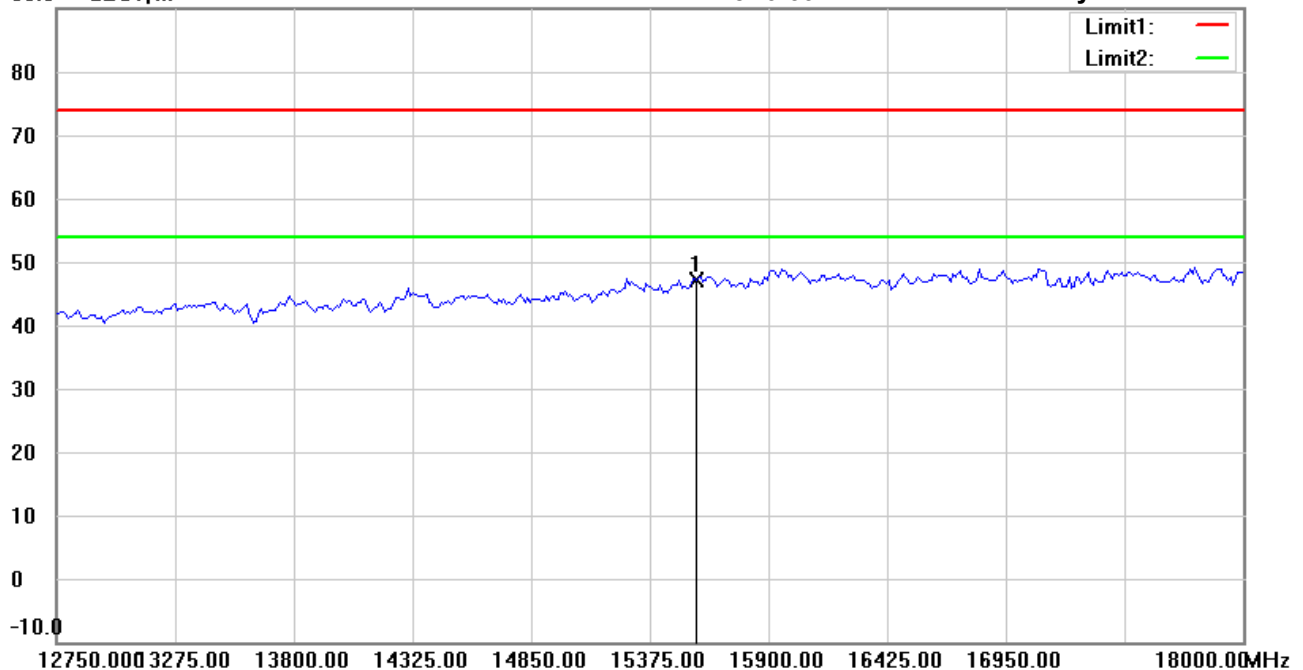

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15570.000	27.75	peak	19.36	47.11	74.00	150	280	-26.89	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:34:45 AM

Humidity: 61.7 %

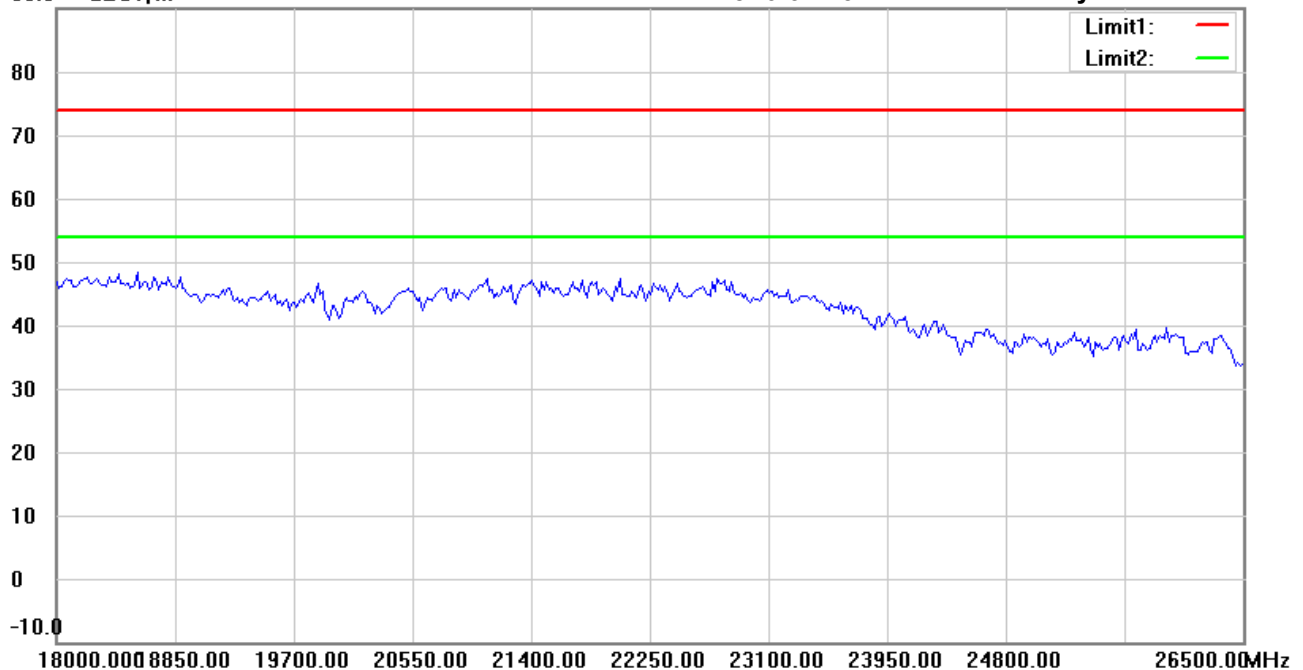

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #11


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:39:37 AM

Humidity: 61.7 %

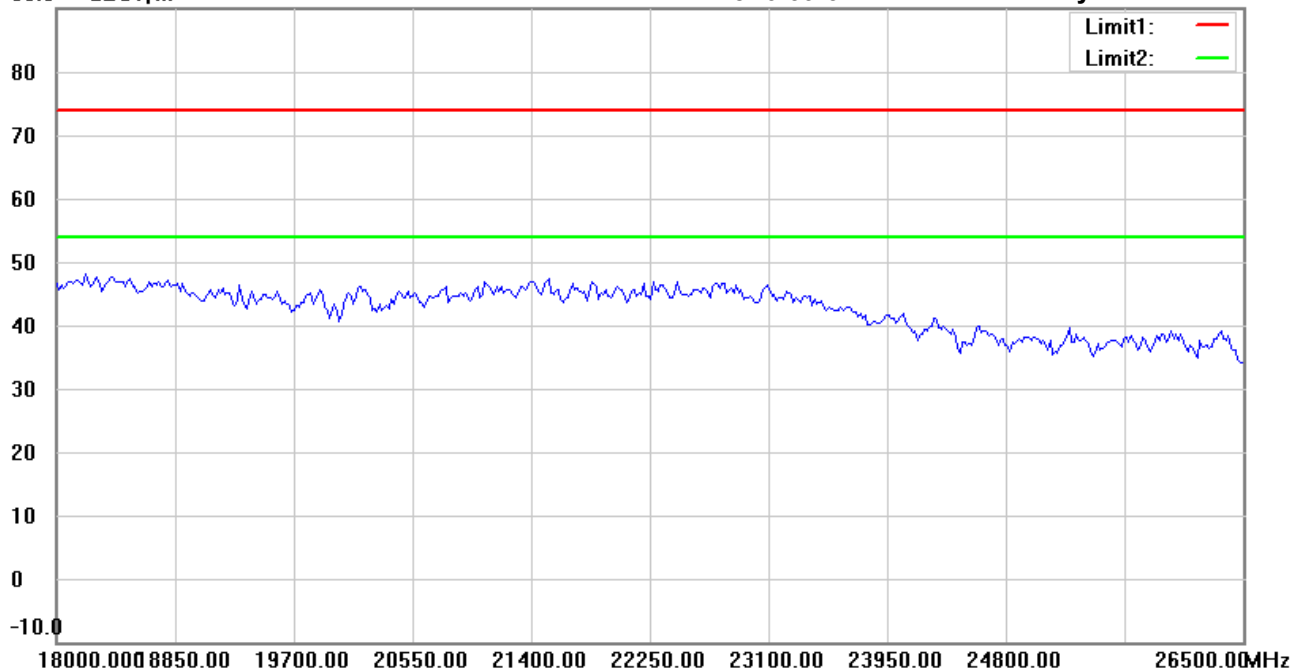

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:34:55 AM

Humidity: 61.7 %

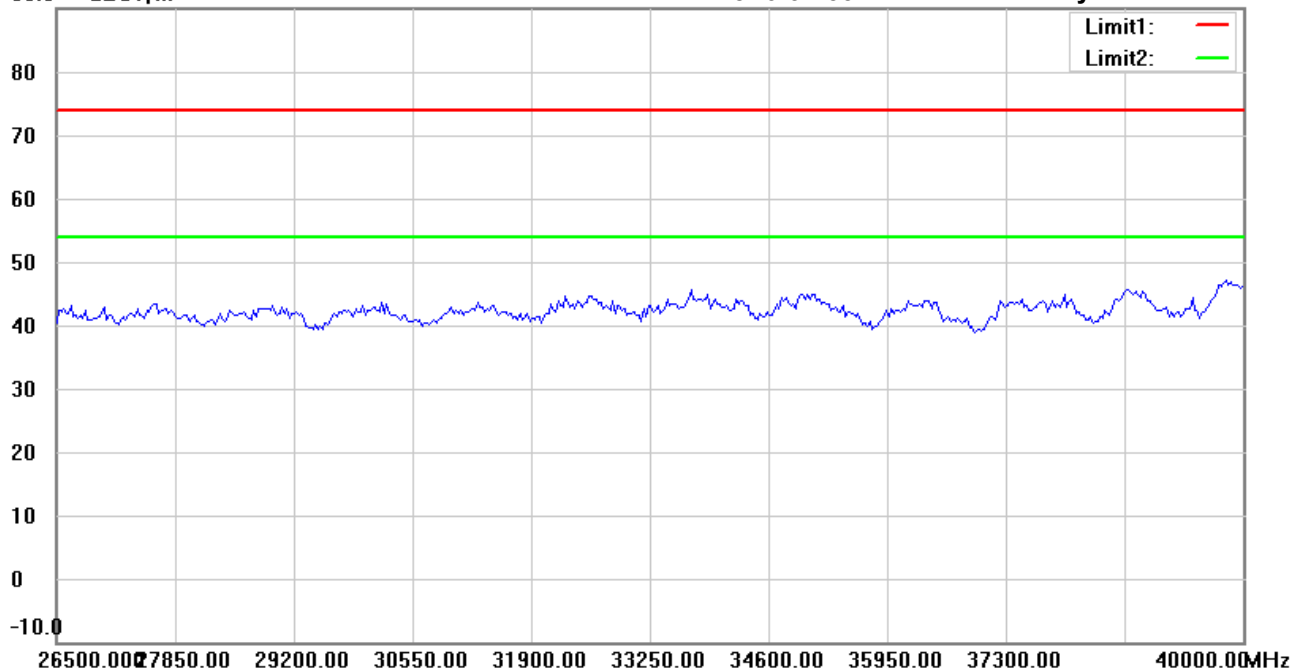

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:39:47 AM

Humidity: 61.7 %

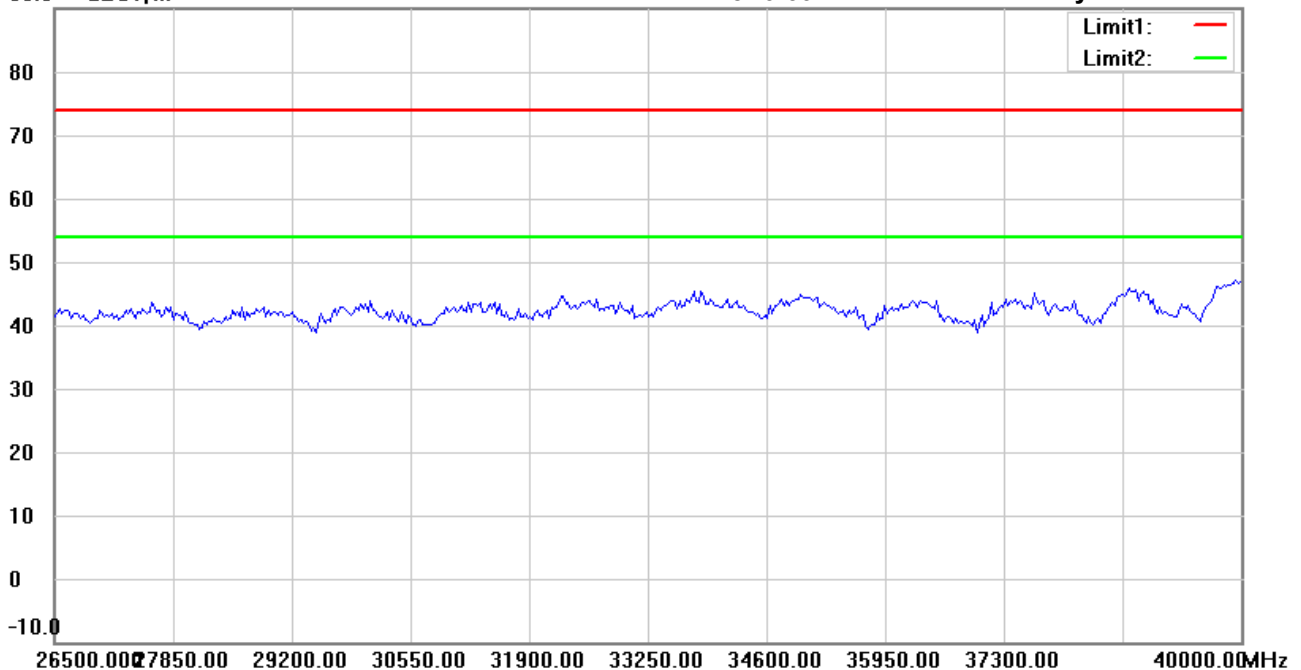

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:43:12 AM

Humidity: 61.7 %

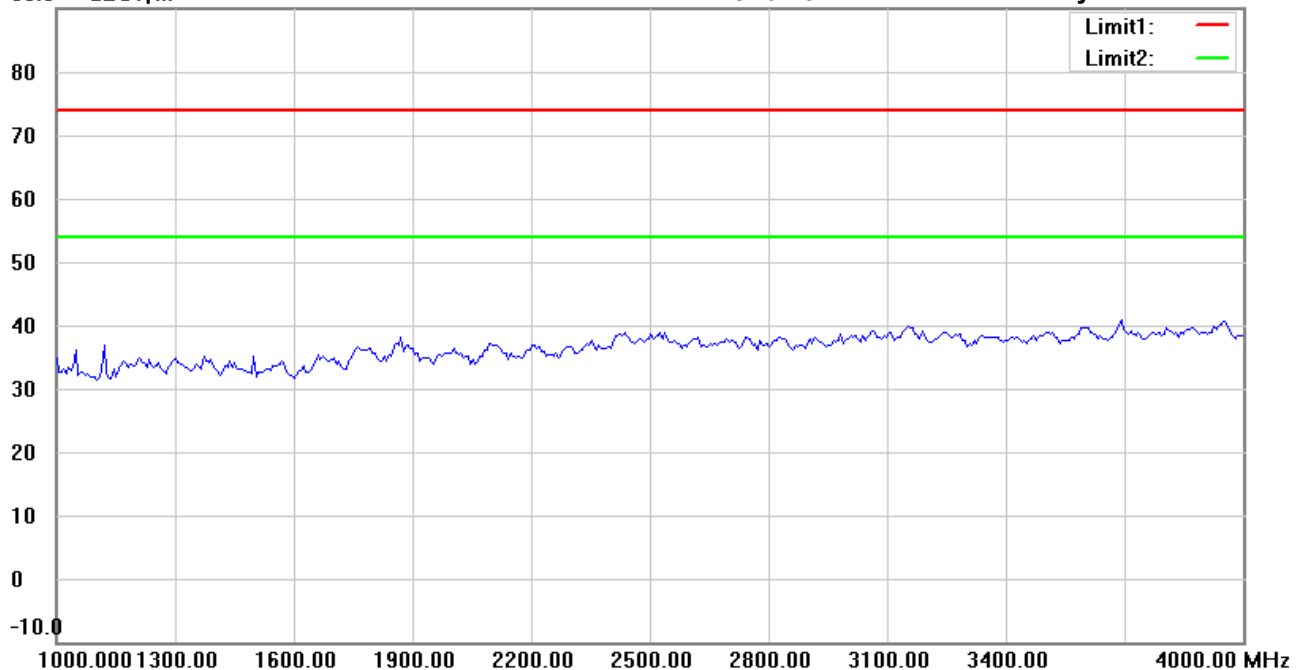

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #7


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:47:52 AM

Humidity: 61.7 %

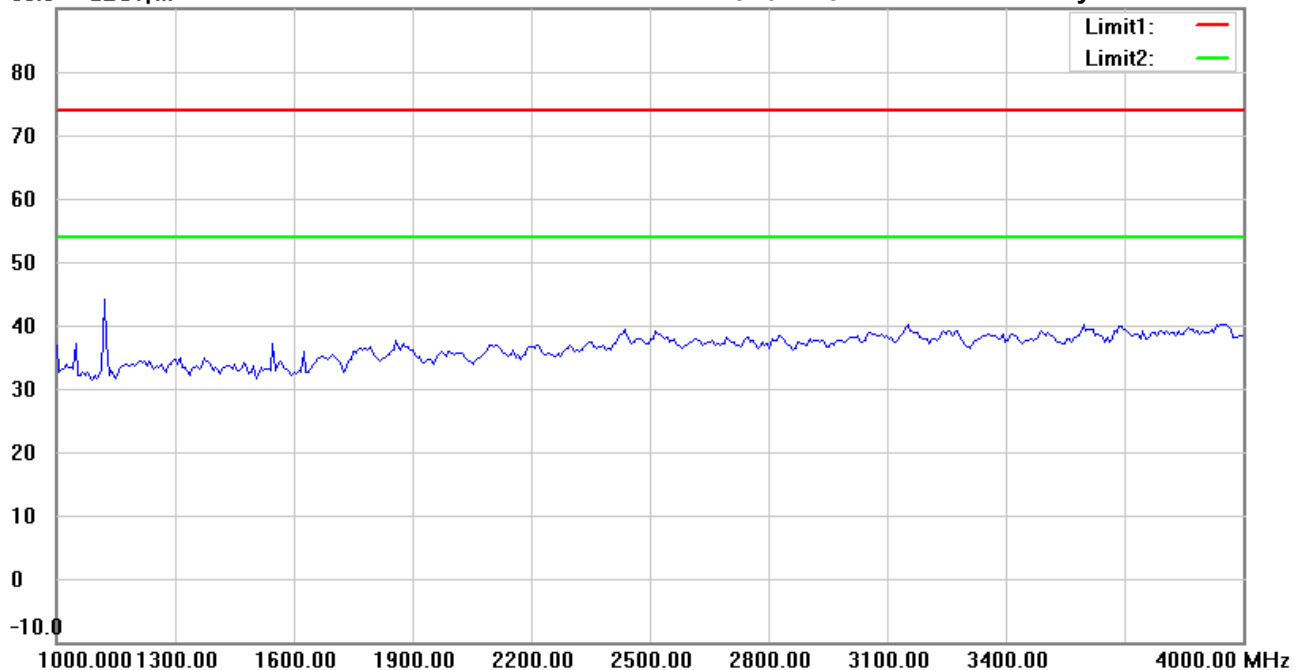

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#2


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:44:13 AM

Humidity:61.7 %

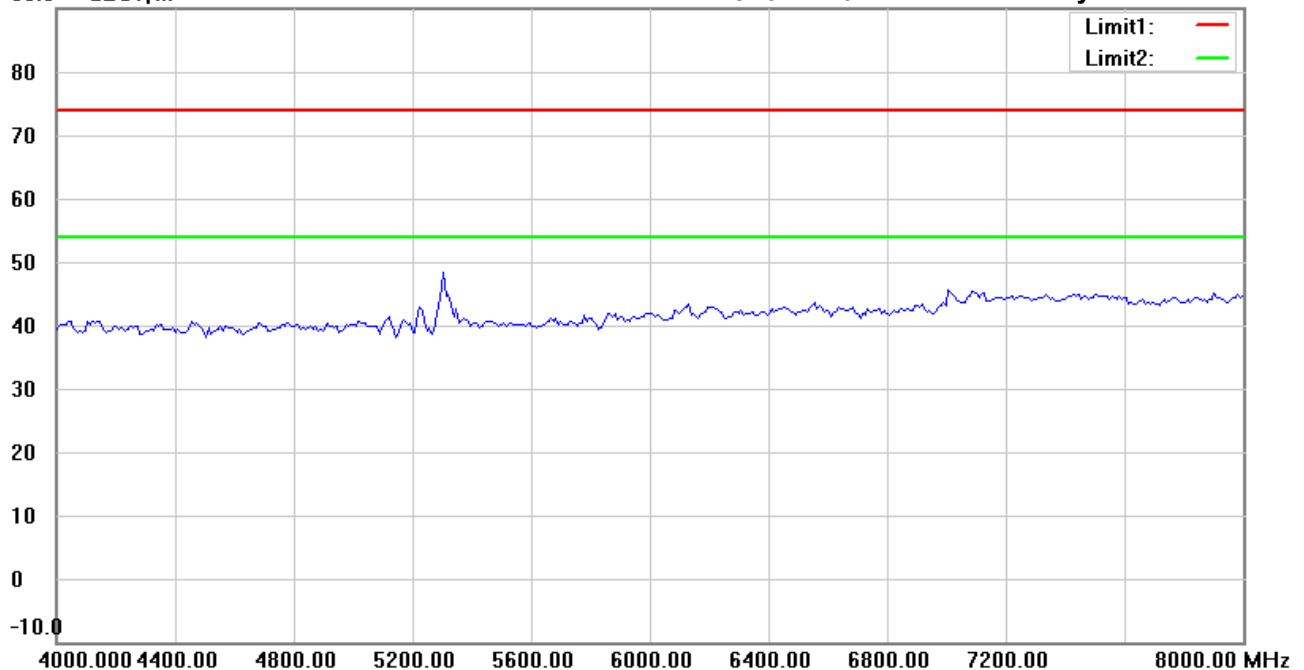

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:48:53 AM

Humidity: 61.7 %

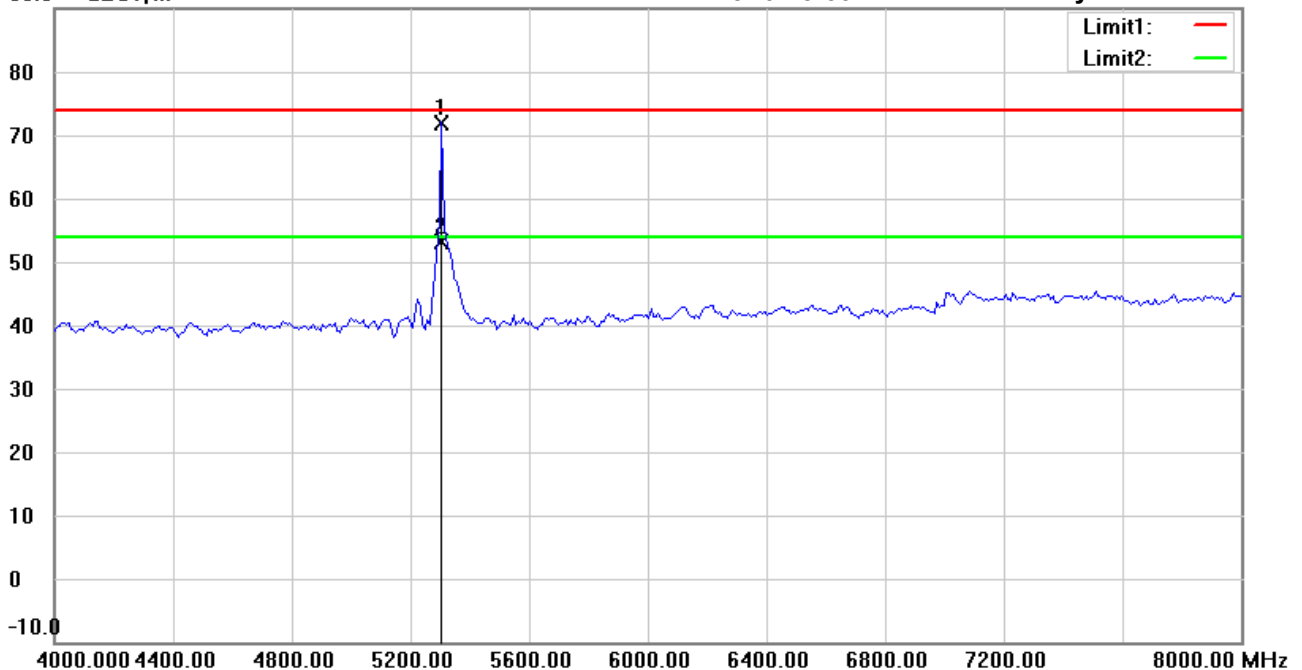

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	5306.593	72.25	peak	-0.45	71.80	74.00	150	99	-2.20	
*	5306.593	53.51	AVG	-0.45	53.06	54.00	150	99	-0.94	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:45:15 AM

Humidity: 61.7 %

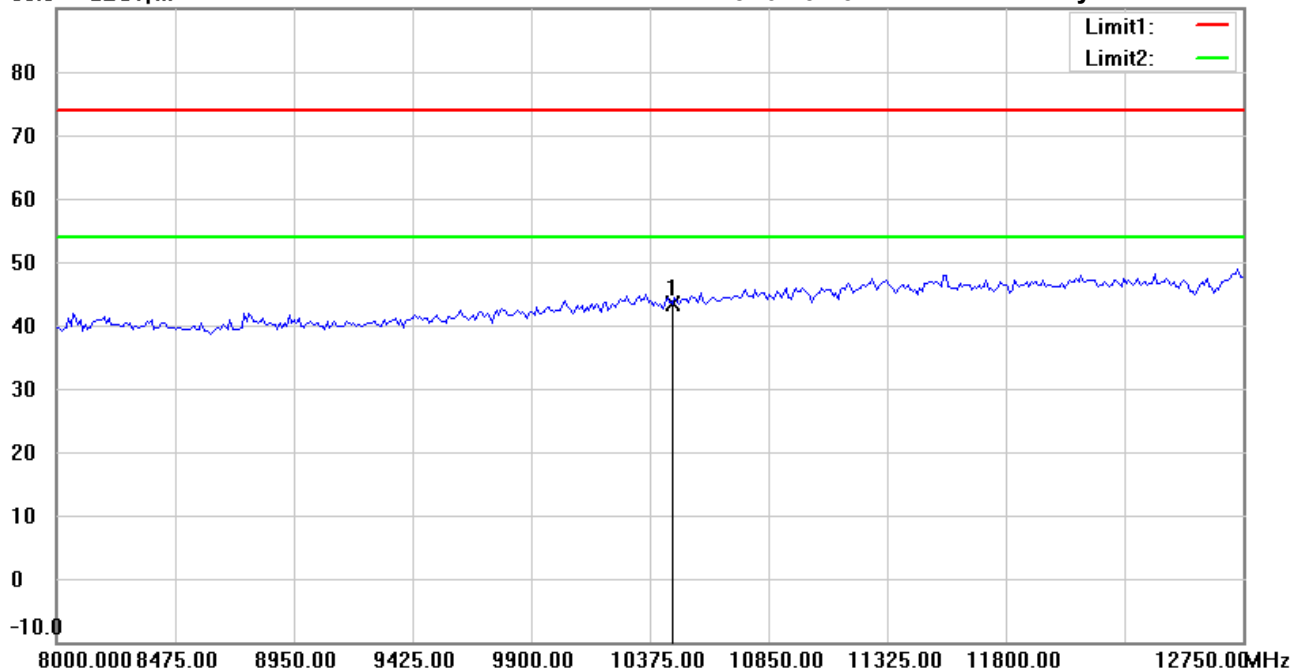

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10460.000	35.02	peak	8.40	43.42	74.00	150	190	-30.58	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:50:01 AM

Humidity: 61.7 %

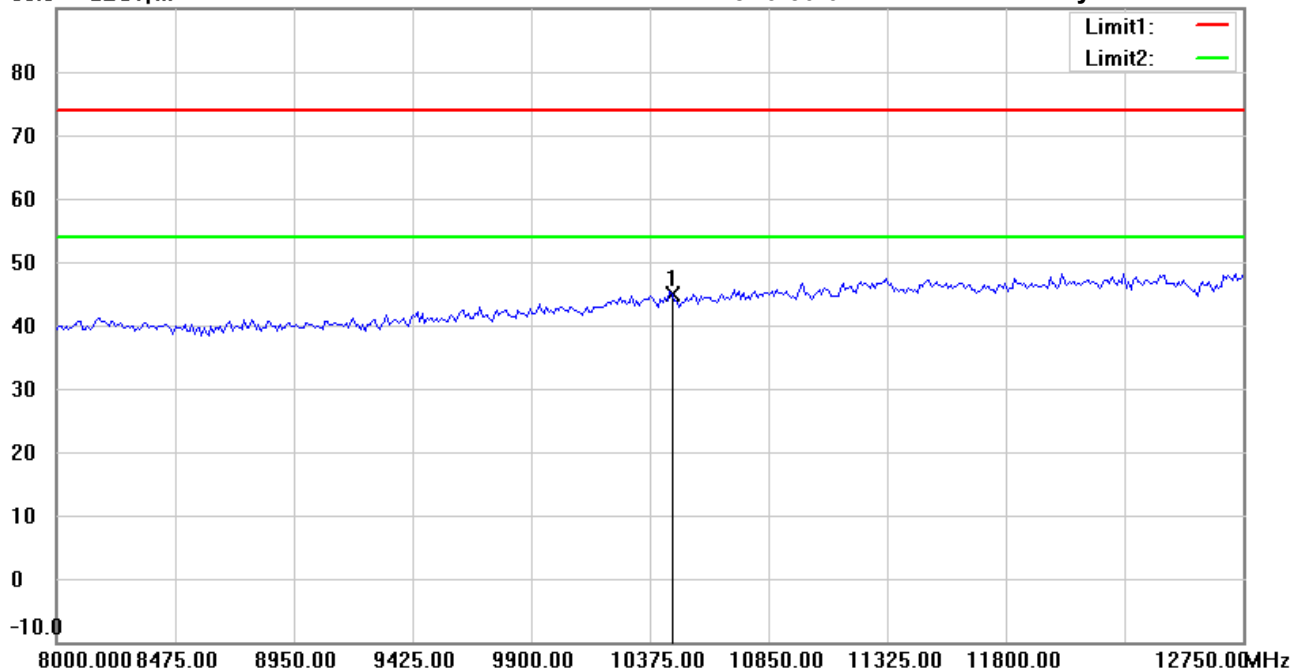

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10460.000	36.36	peak	8.40	44.76	74.00	150	30	-29.24	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:46:24 AM

Humidity: 61.7 %

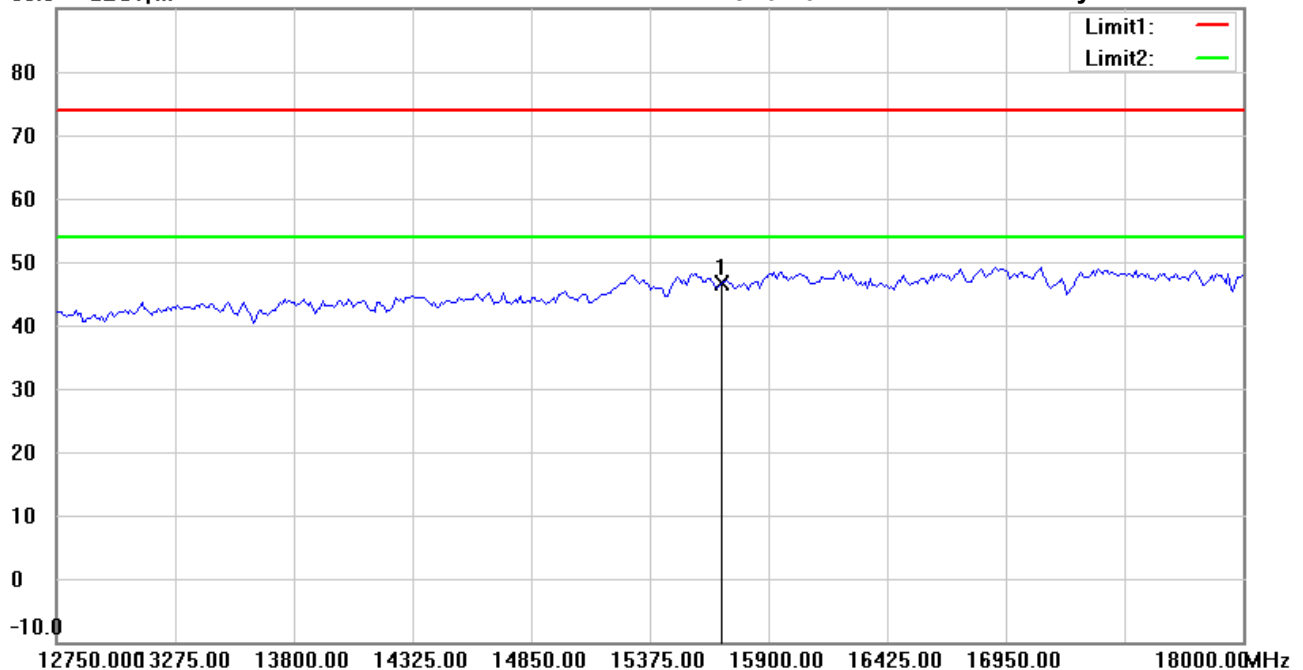

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15690.000	28.92	peak	17.61	46.53	74.00	150	215	-27.47	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:51:09 AM

Humidity: 61.7 %

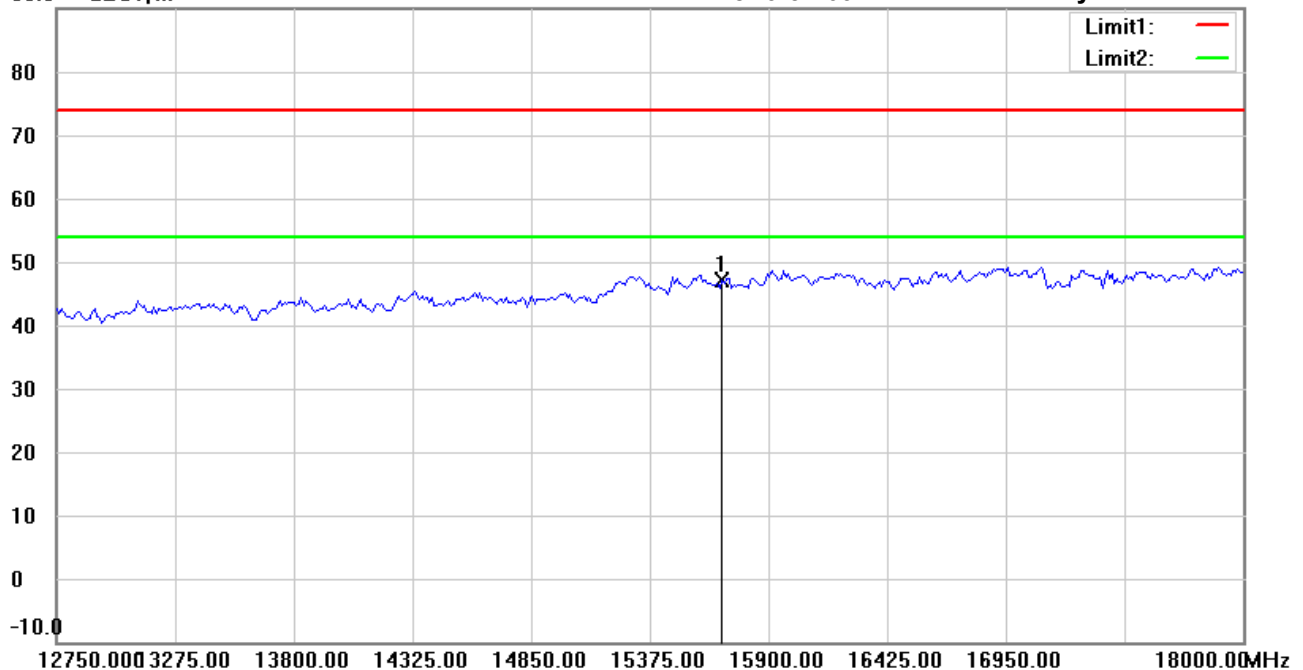

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15690.000	29.42	peak	17.61	47.03	74.00	150	225	-26.97	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Nei-hu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #5


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:46:34 AM

Humidity: 61.7 %

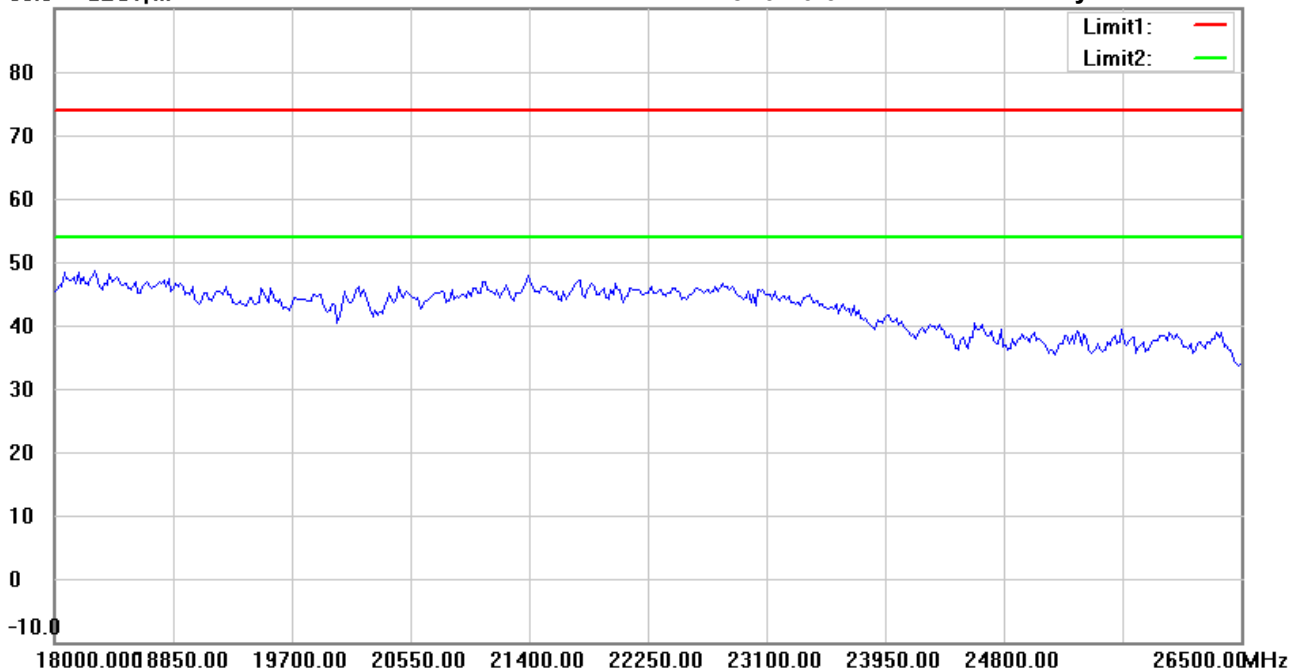

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:51:19 AM

Humidity:61.7 %

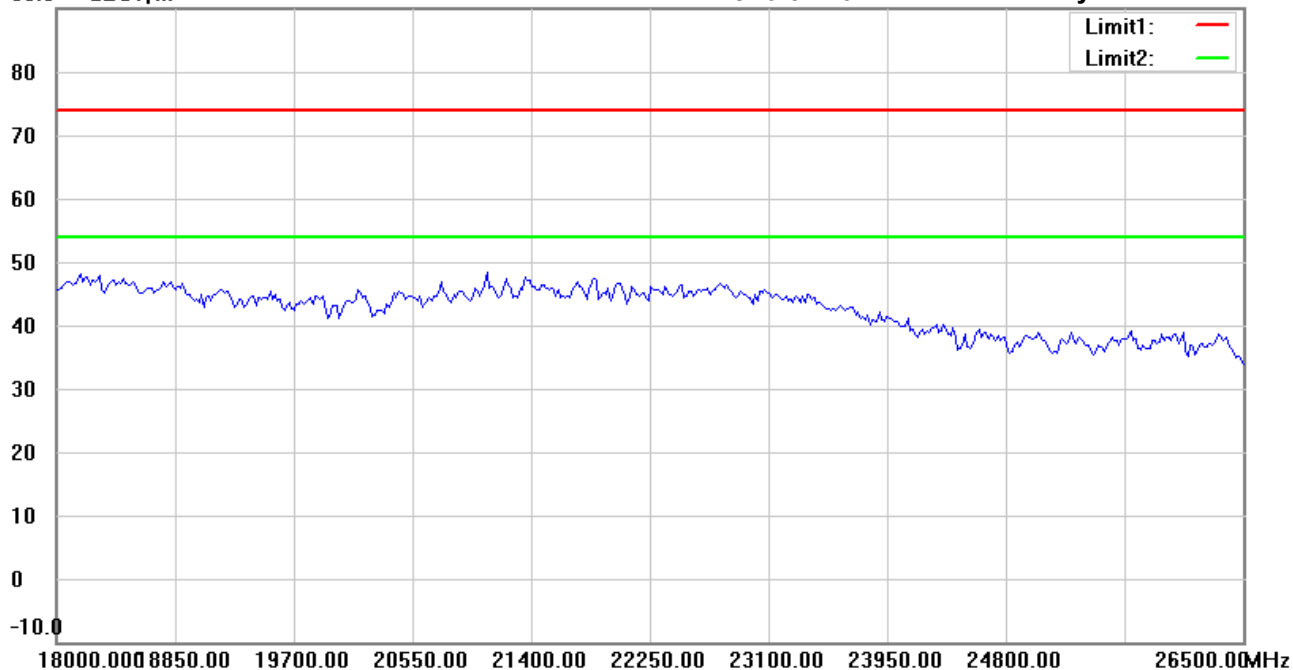

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:46:44 AM

Humidity: 61.7 %

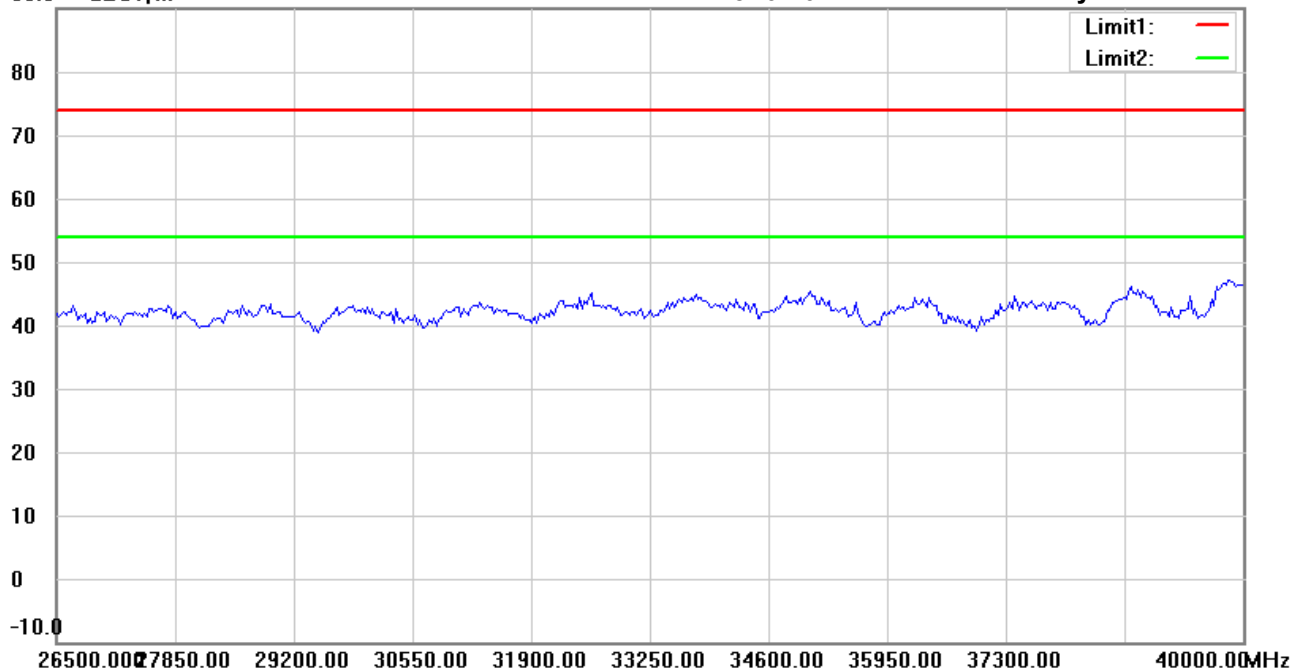

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 6:51:29 AM

Humidity: 61.7 %

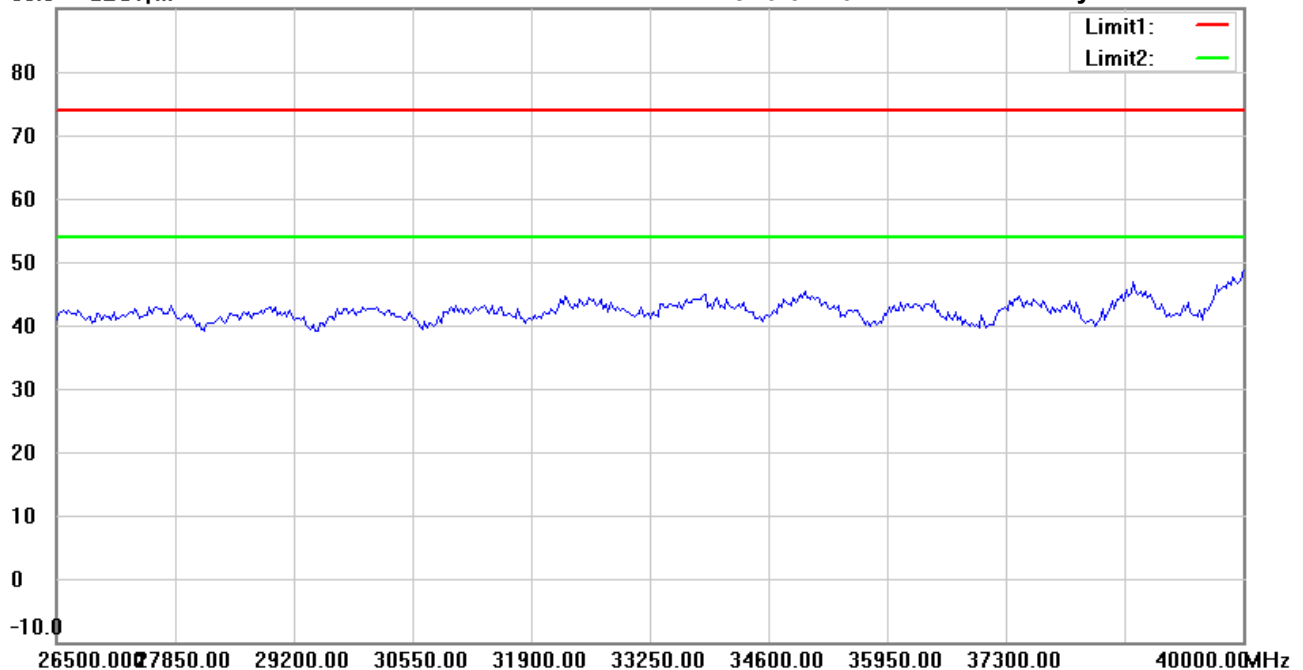

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH46

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:35:35 AM

Humidity:64.7 %

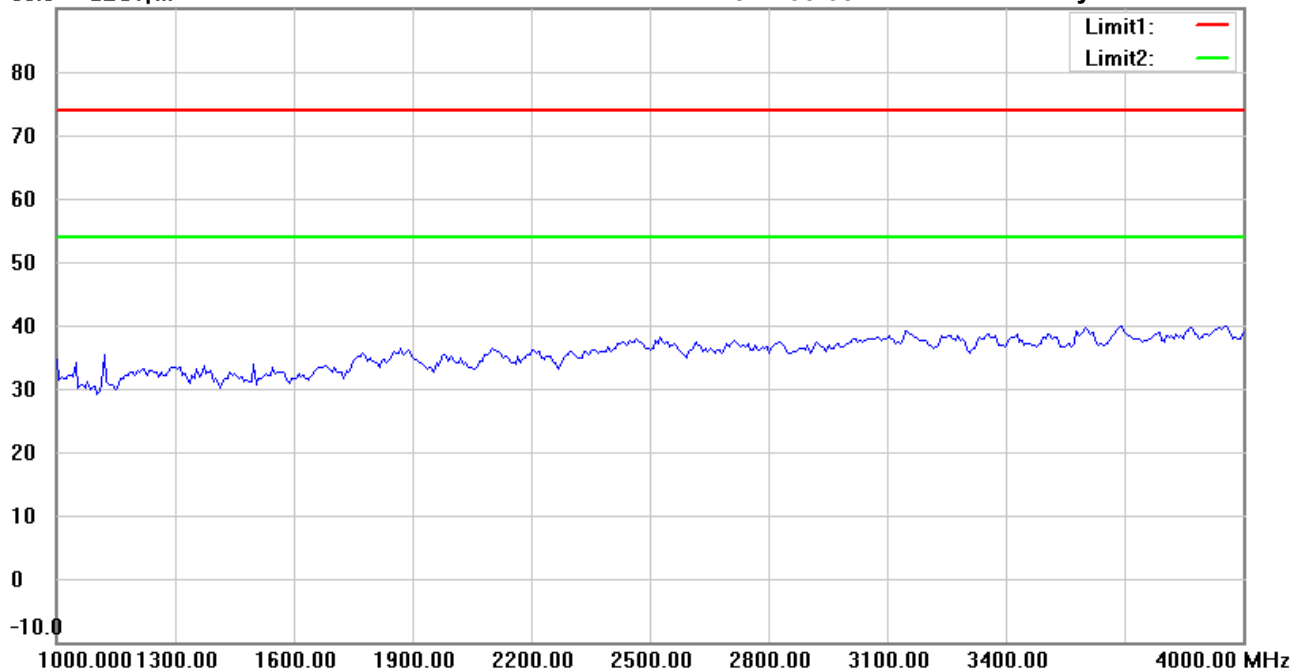

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:40:14 AM

Humidity:64.7 %

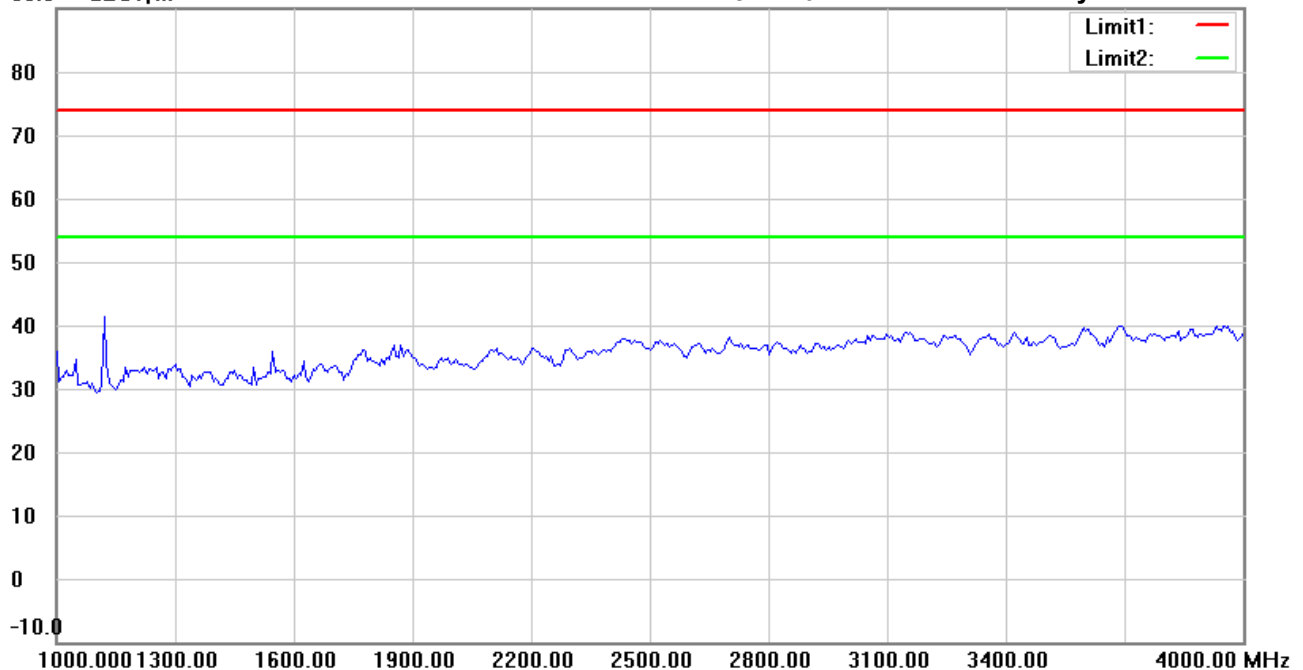

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:36:37 AM

Humidity: 64.7 %

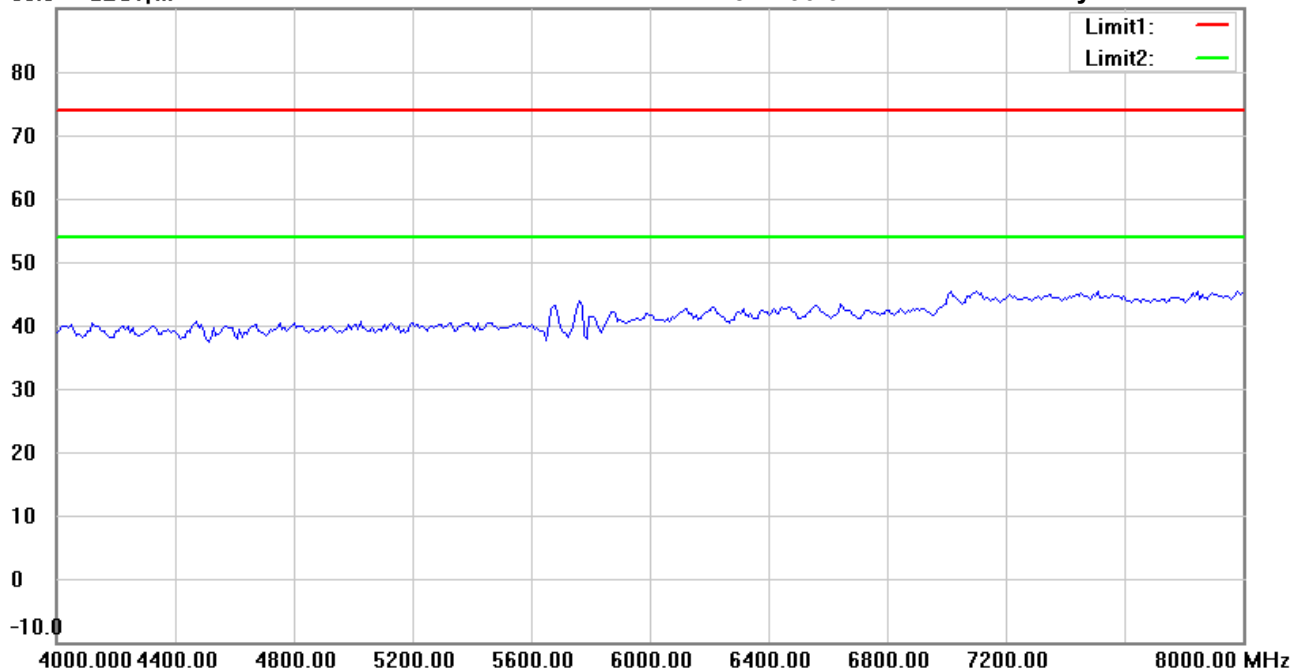

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:41:16 AM

Humidity: 64.7 %

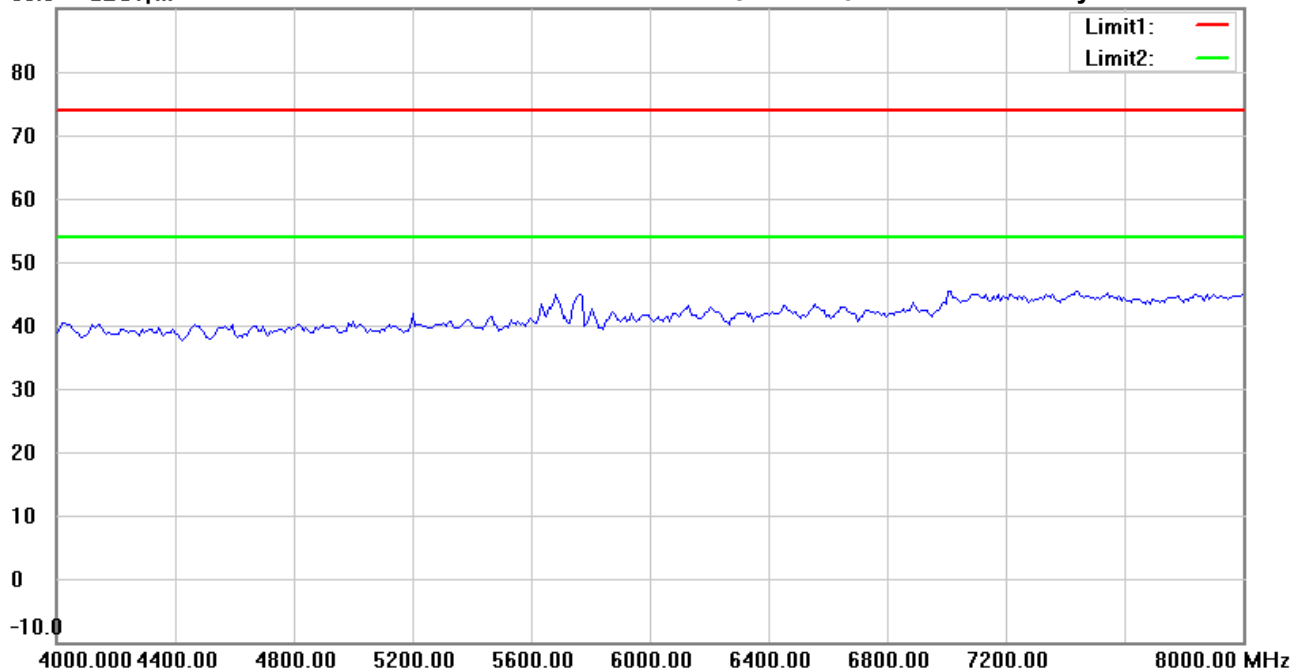

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:37:41 AM

Humidity: 64.7 %

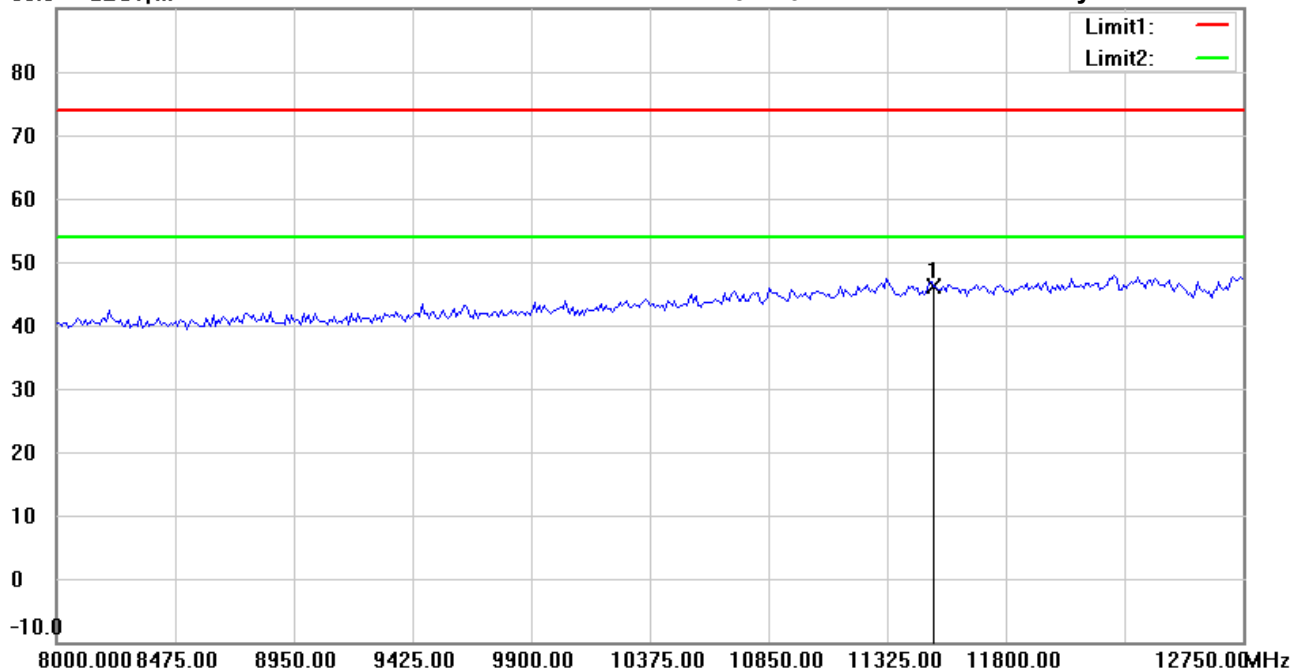

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11510.000	34.67	peak	11.39	46.06	74.00	150	75	-27.94	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:42:19 AM

Humidity: 64.7 %

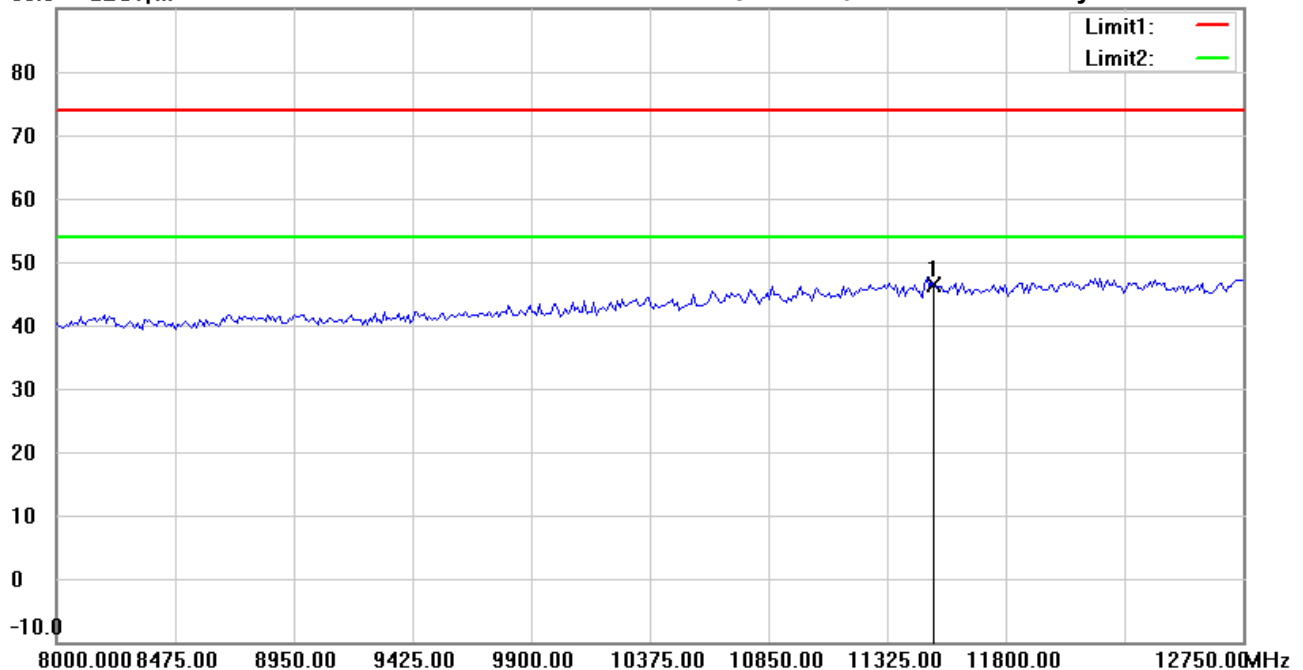

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11510.000	34.96	peak	11.39	46.35	74.00	150	60	-27.65	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:38:50 AM

Humidity: 64.7 %

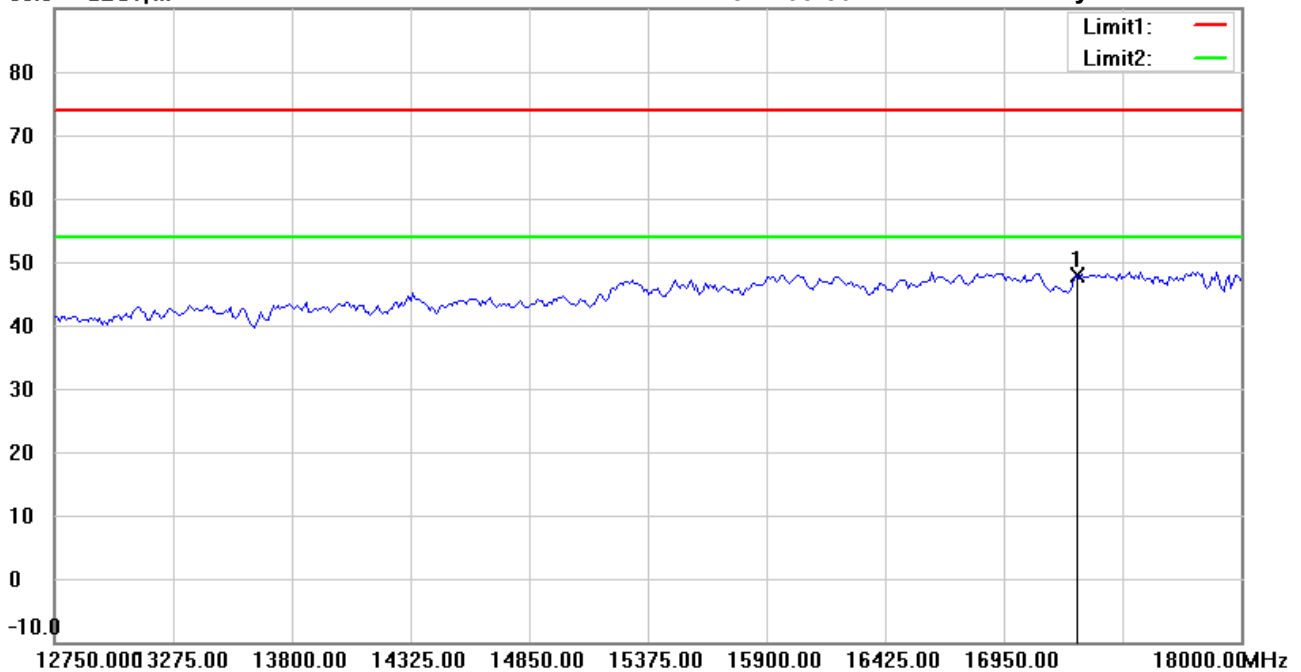

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17265.000	27.74	peak	20.02	47.76	74.00	150	300	-26.24	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #10


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:43:28 AM

Humidity: 64.7 %

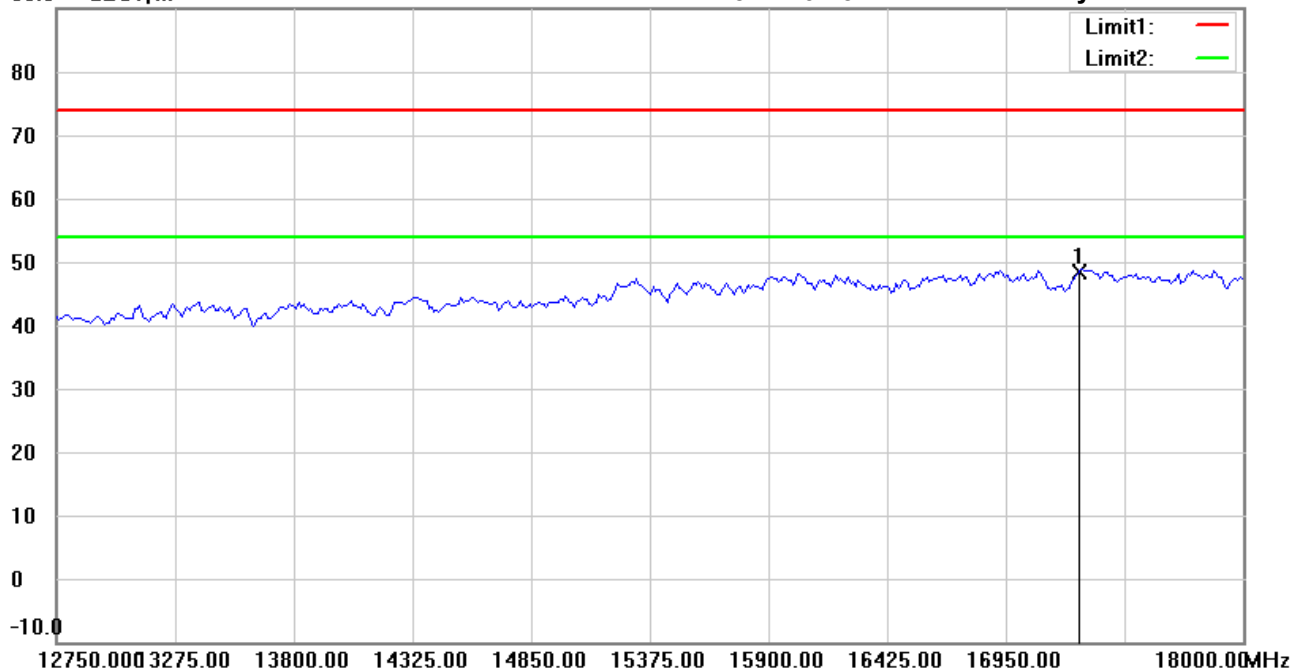

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17265.000	28.31	peak	20.02	48.33	74.00	150	175	-25.67	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:39:00 AM

Humidity:64.7 %

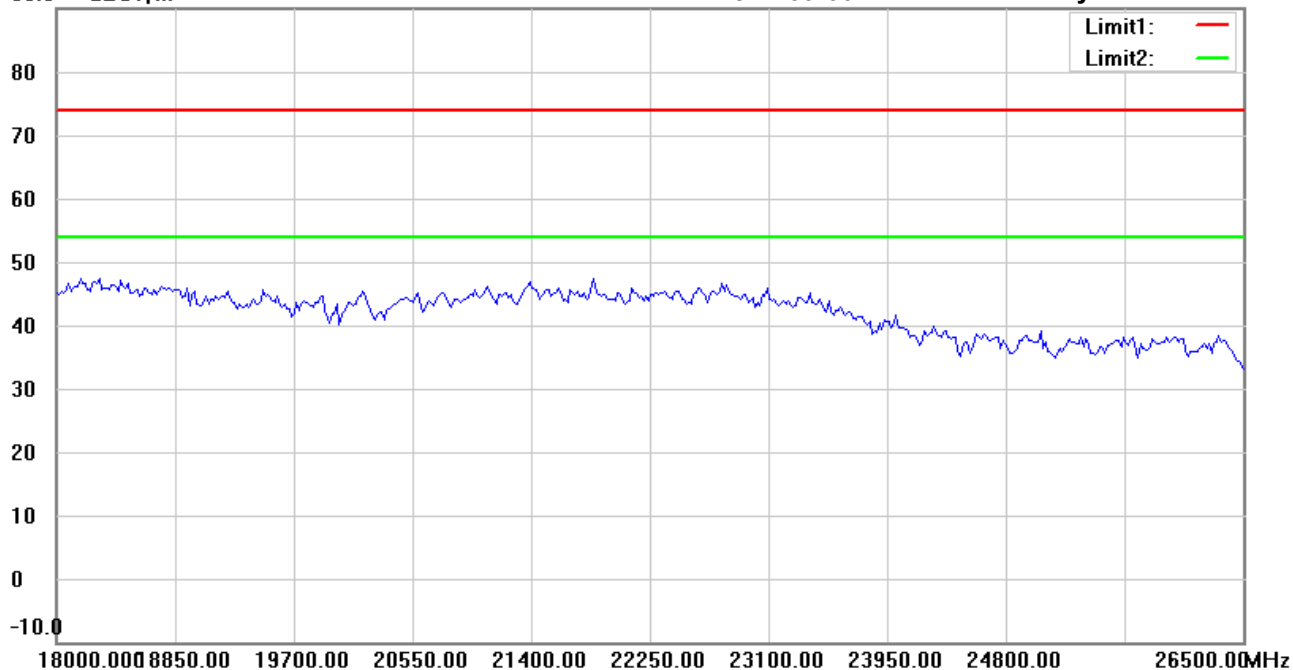

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/6/2019

Temperature:22.3 °C

90.0 dBuV/m

Time: 7:43:39 AM

Humidity:64.7 %

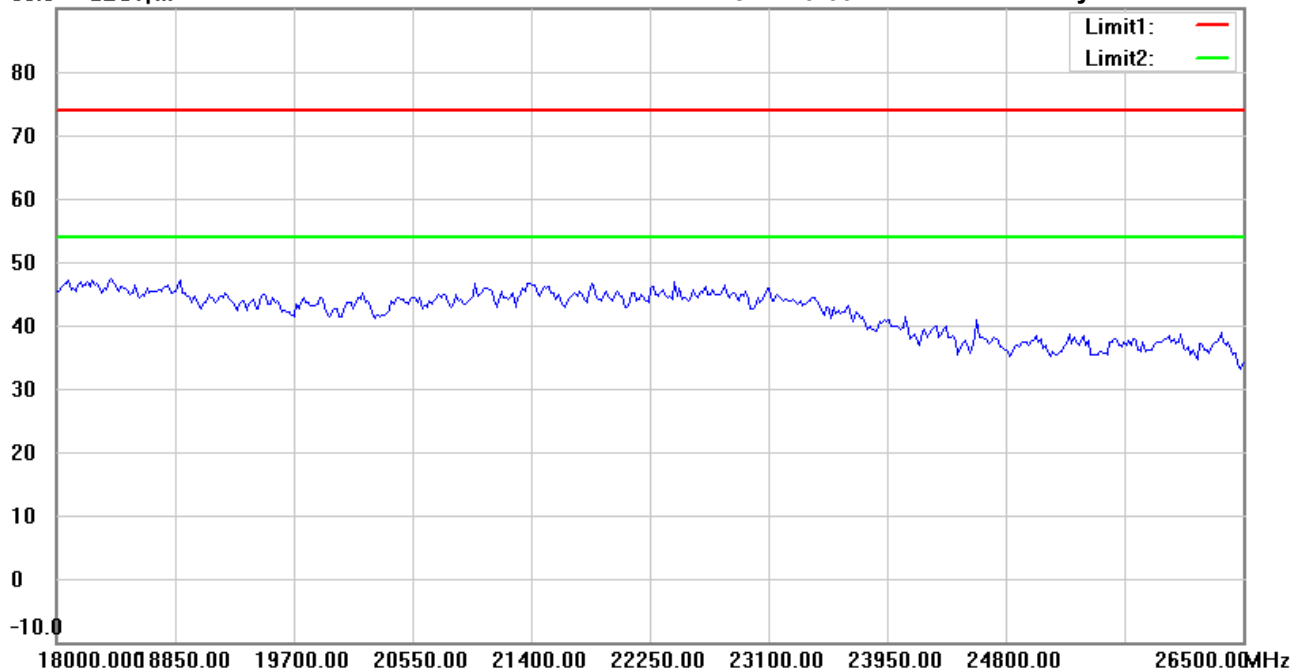

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:39:11 AM

Humidity: 64.7 %

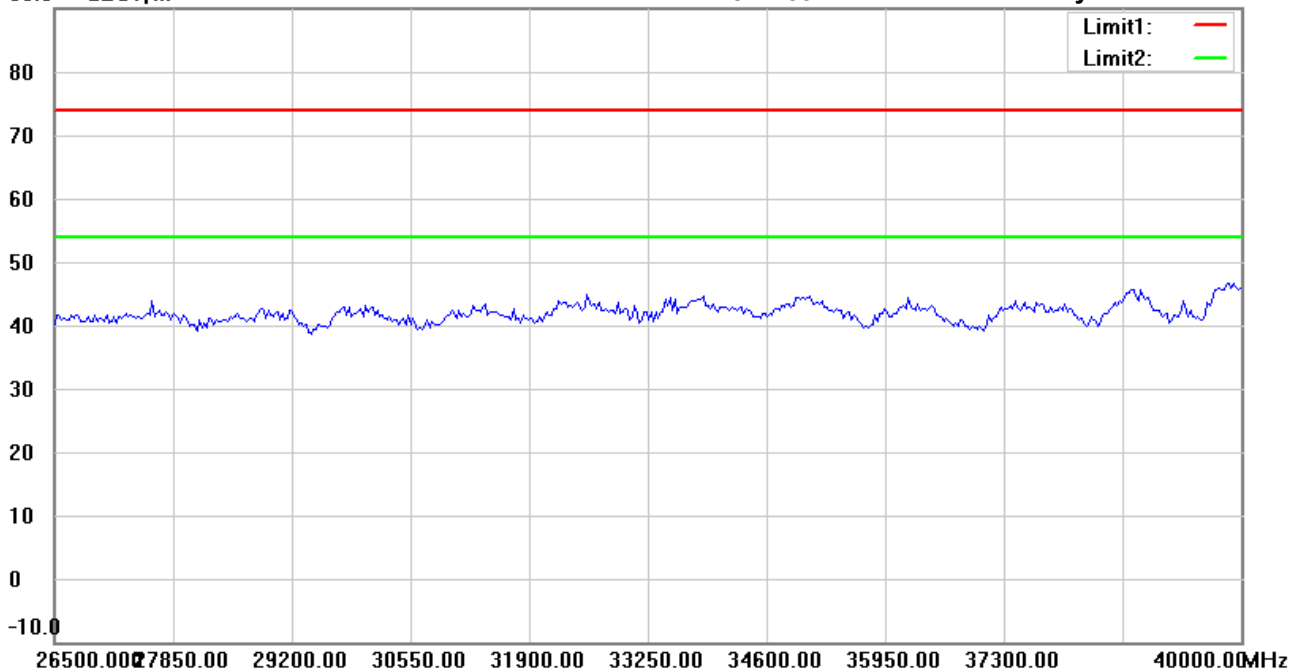

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 11/6/2019

Temperature: 22.3 °C

90.0 dBuV/m

Time: 7:43:50 AM

Humidity: 64.7 %

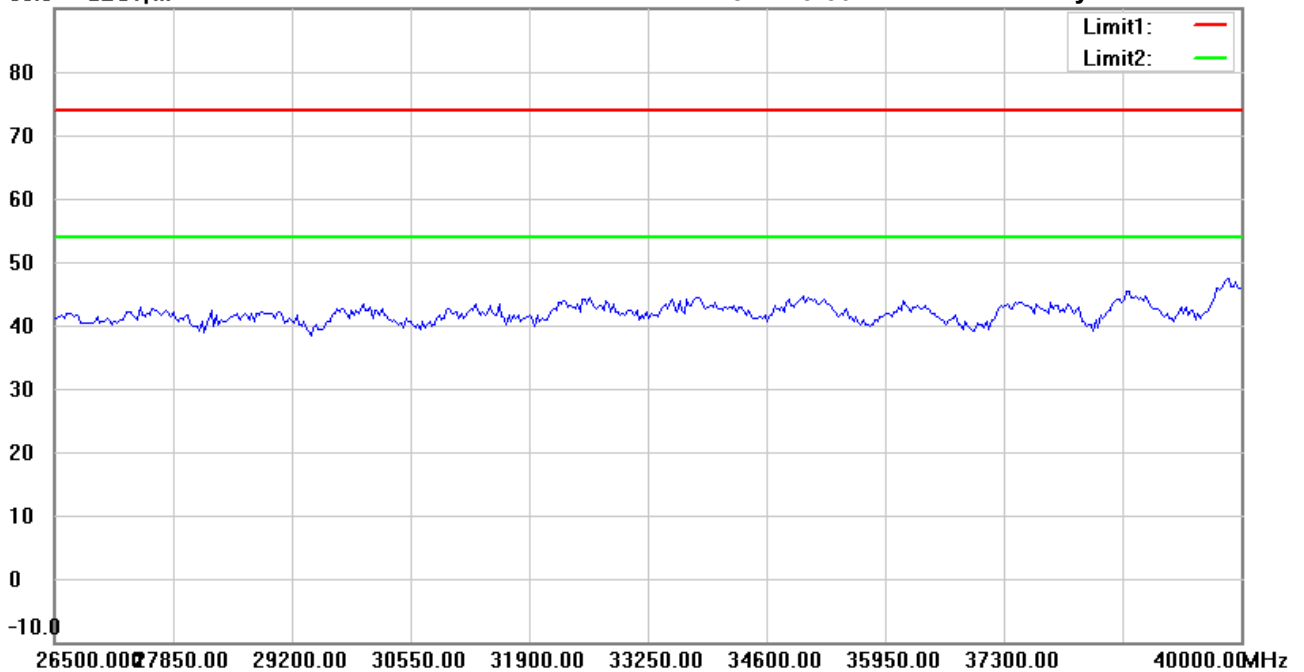

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH151

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #1


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:04:21 AM

Humidity: 67.7 %

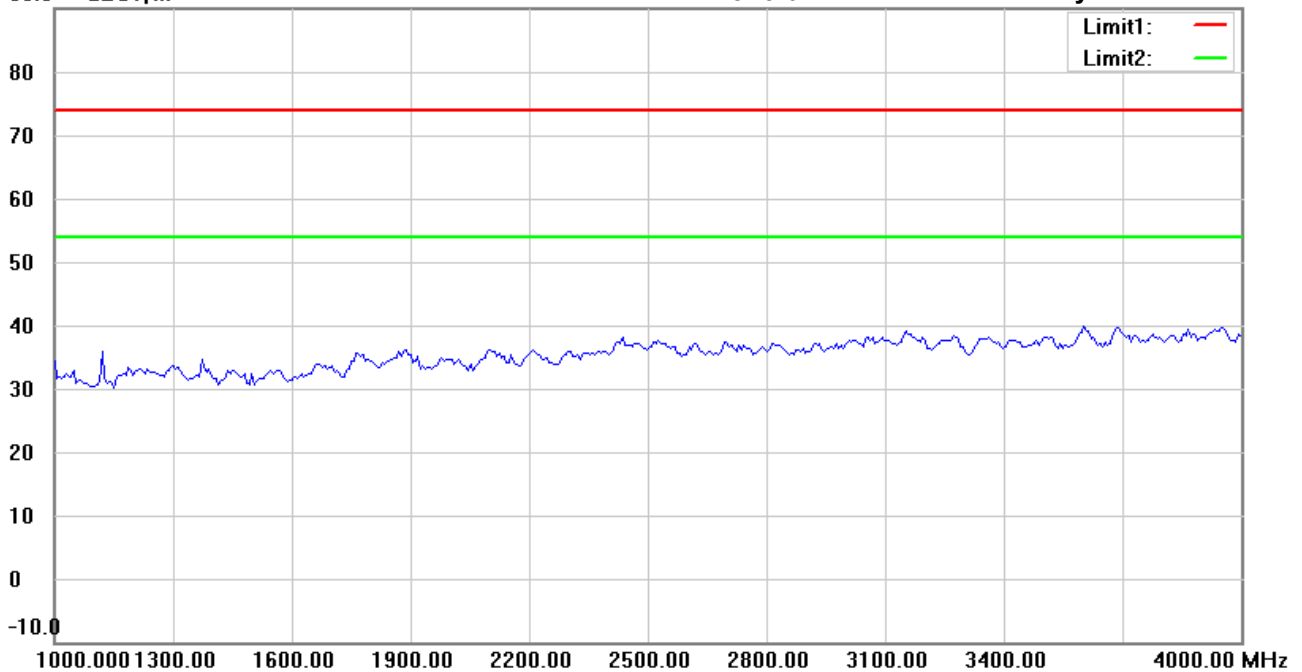

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:13:35 AM

Humidity:67.7 %

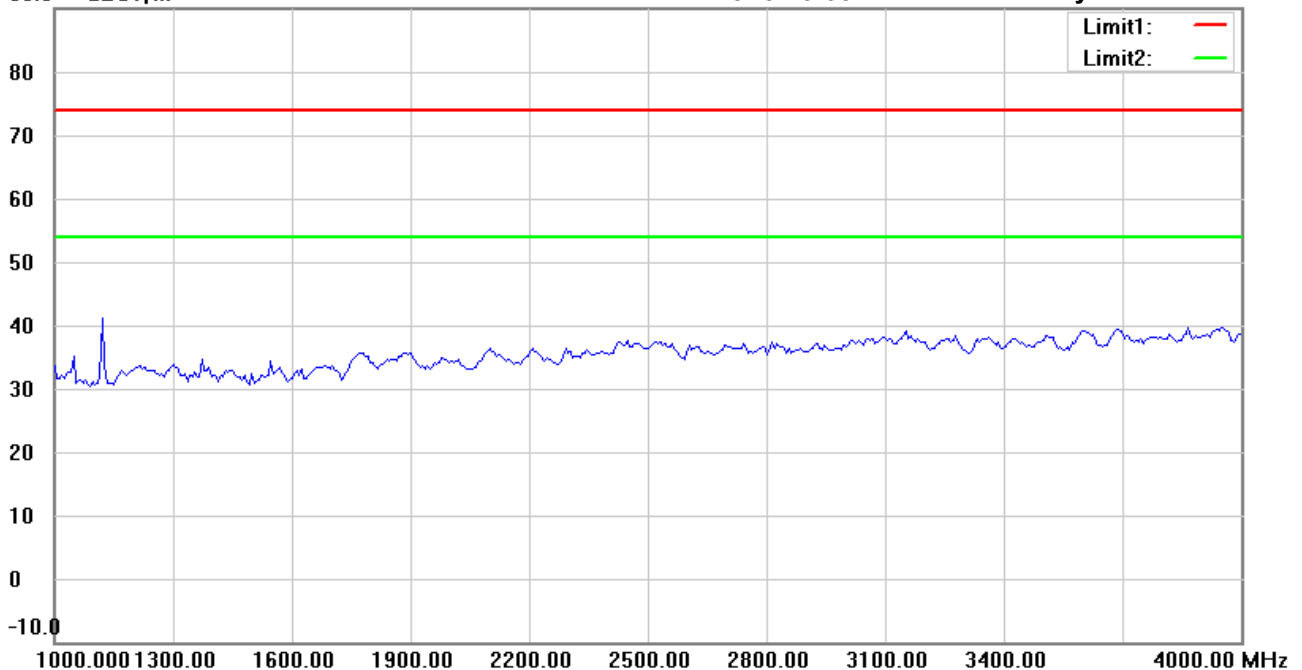

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:05:22 AM

Humidity: 67.7 %

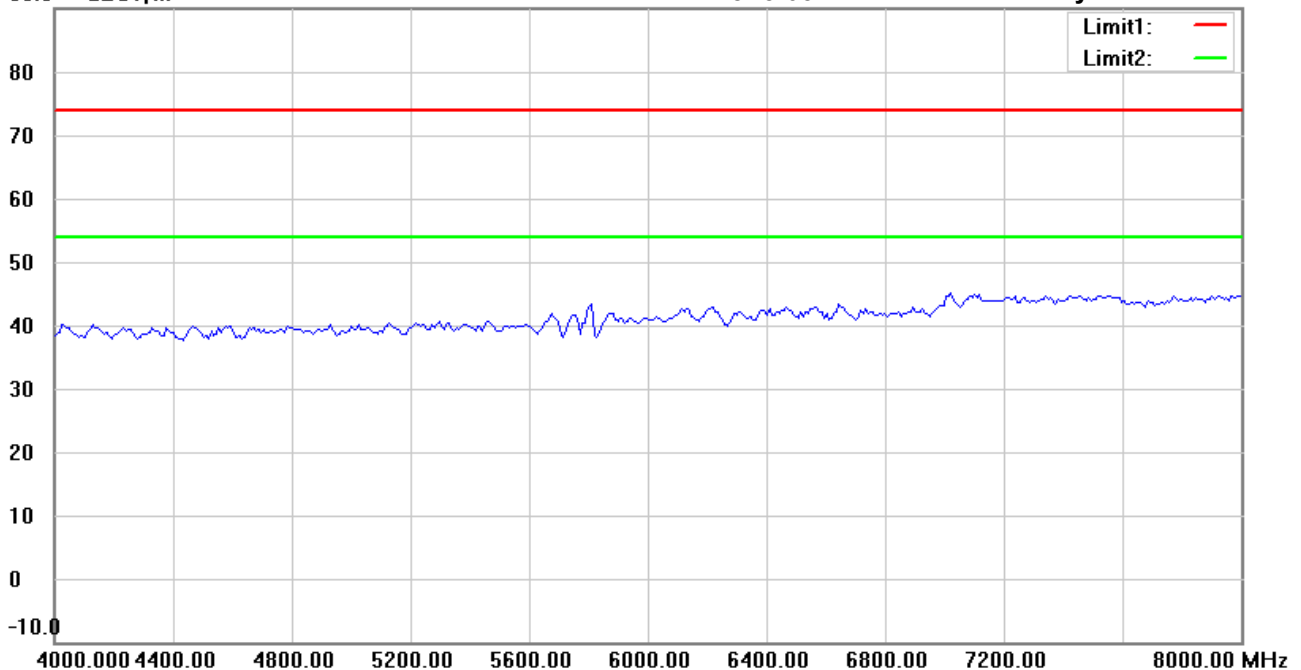

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:14:36 AM

Humidity: 67.7 %

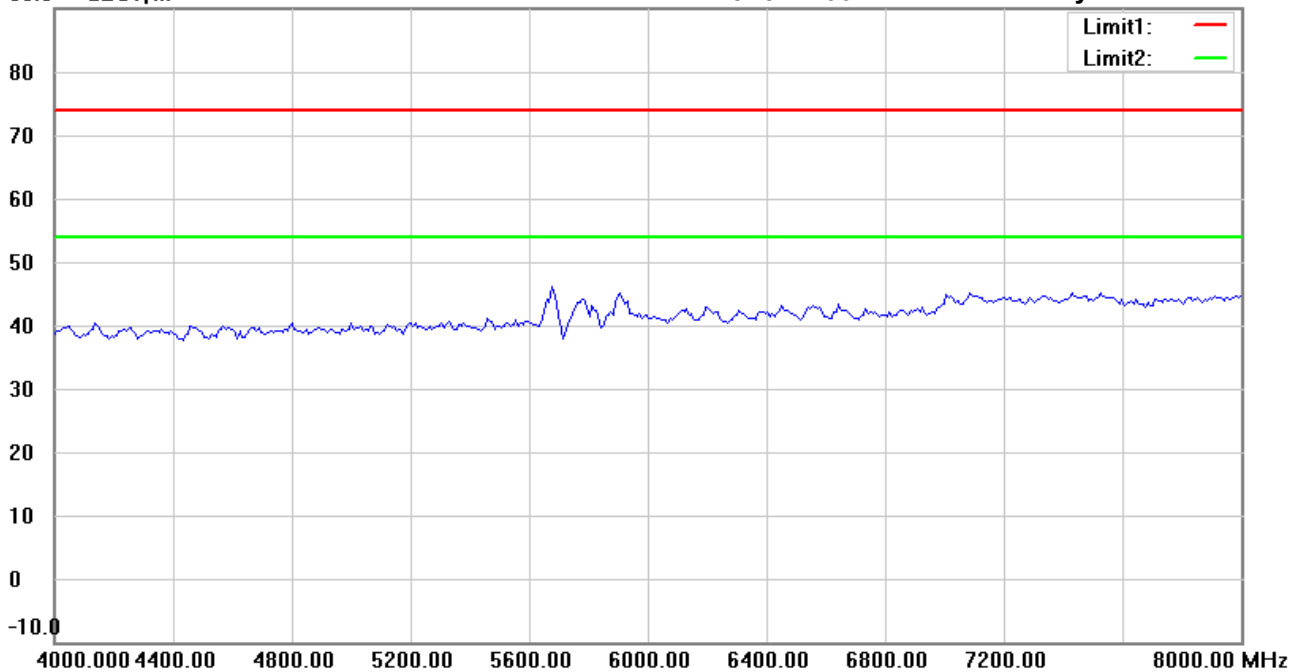

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:08:09 AM

Humidity: 67.7 %

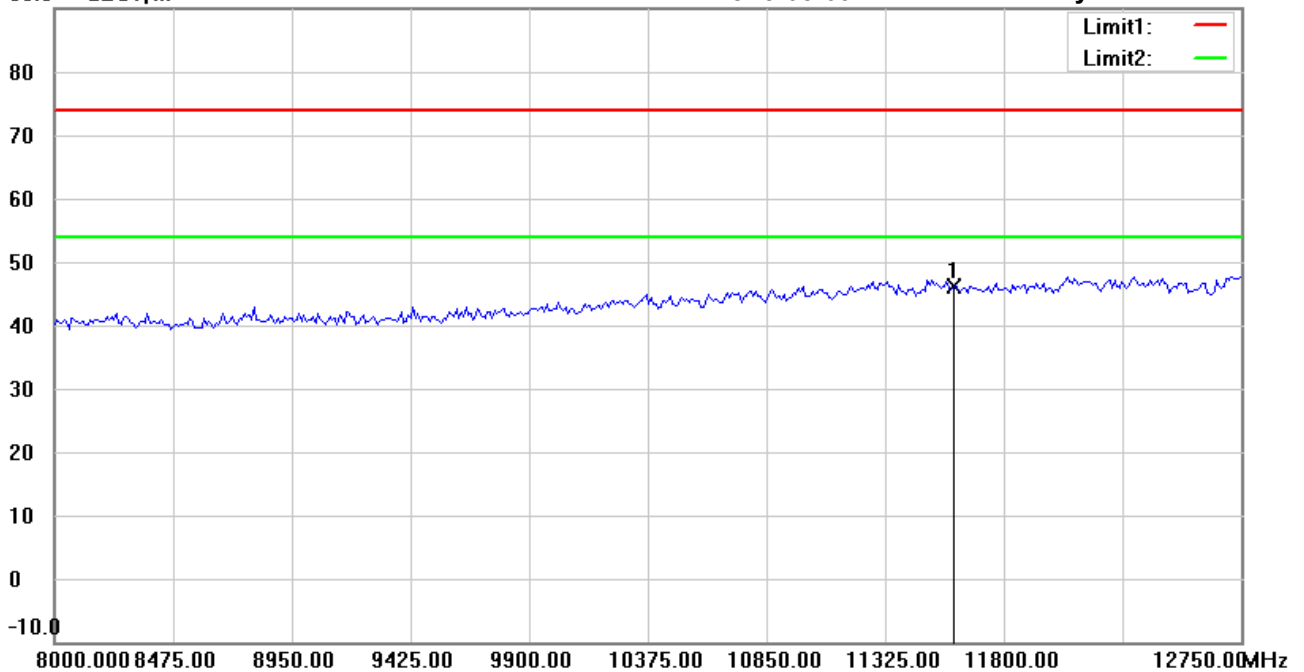

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11590.000	35.18	peak	11.03	46.21	74.00	150	185	-27.79	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:18:37 AM

Humidity: 67.7 %

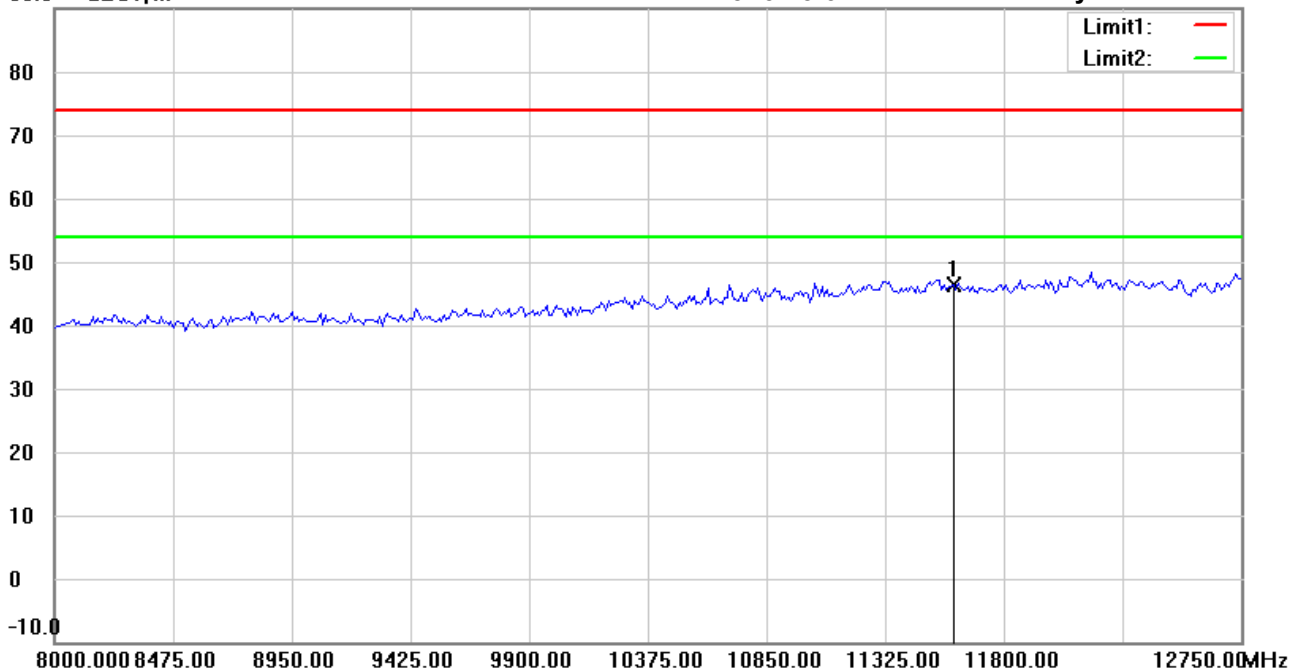

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11590.000	35.32	peak	11.03	46.35	74.00	150	20	-27.65	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:09:17 AM

Humidity: 67.7 %

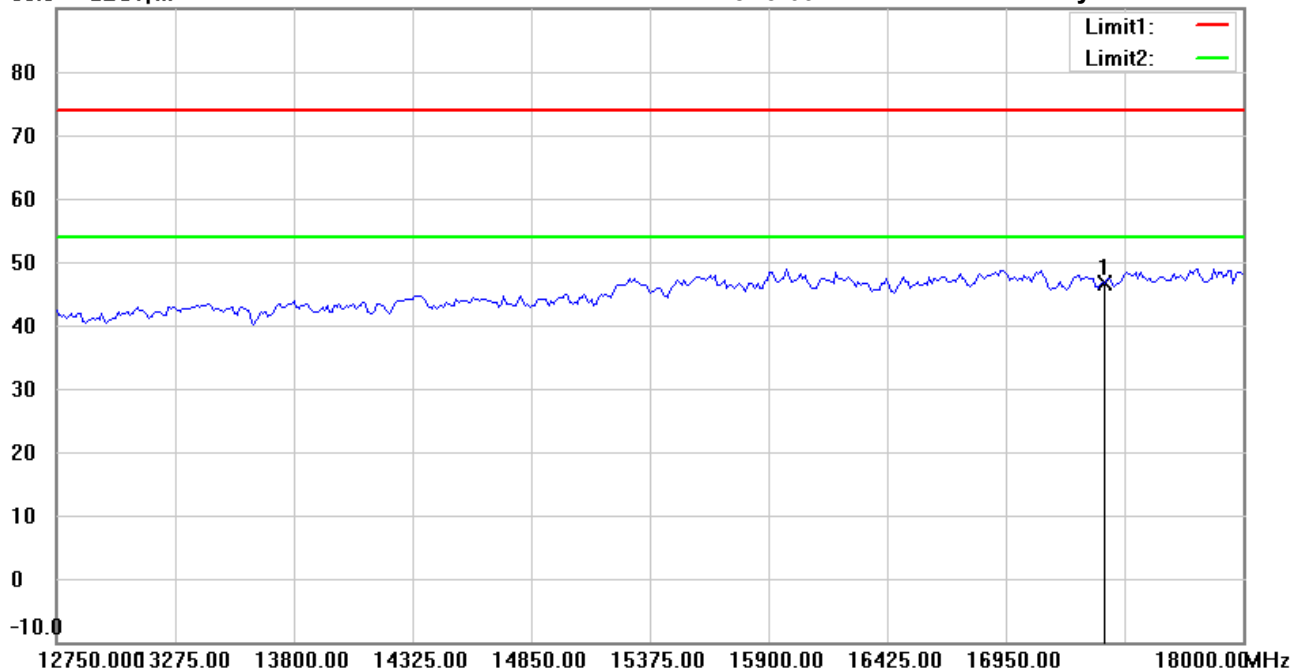

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17385.000	26.56	peak	20.18	46.74	74.00	150	70	-27.26	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:19:45 AM

Humidity:67.7 %

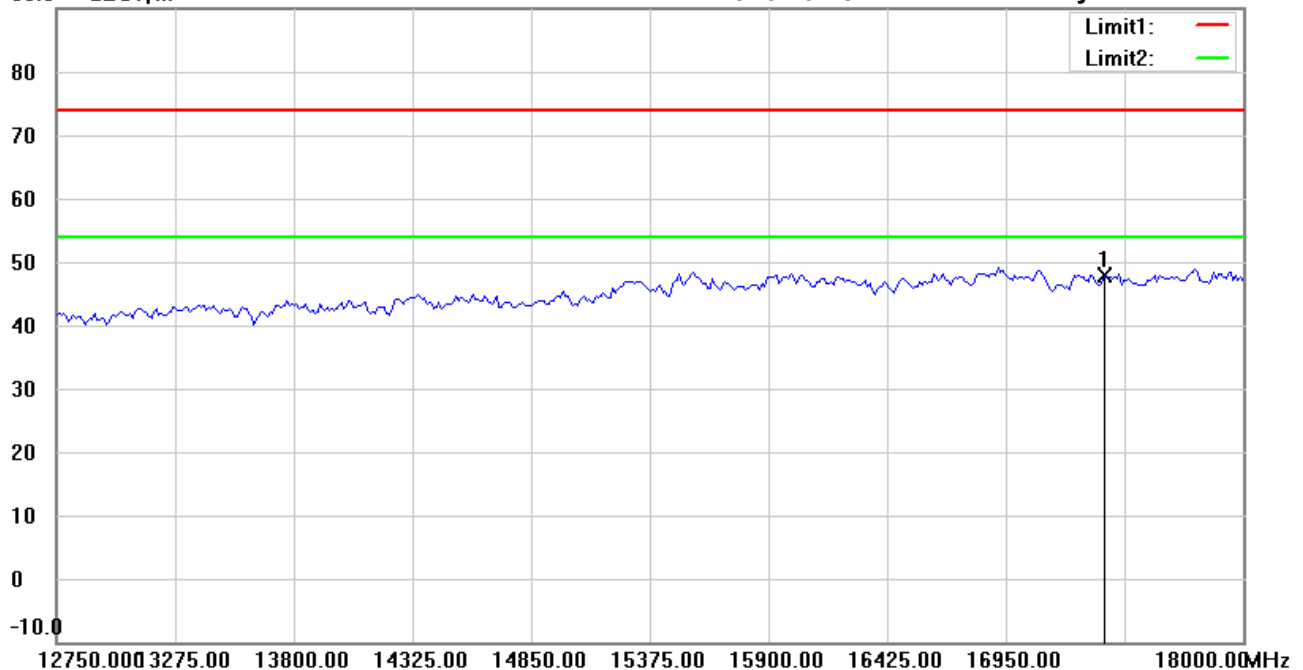

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17385.000	27.67	peak	20.18	47.85	74.00	150	230	-26.15	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:09:27 AM

Humidity:67.7 %

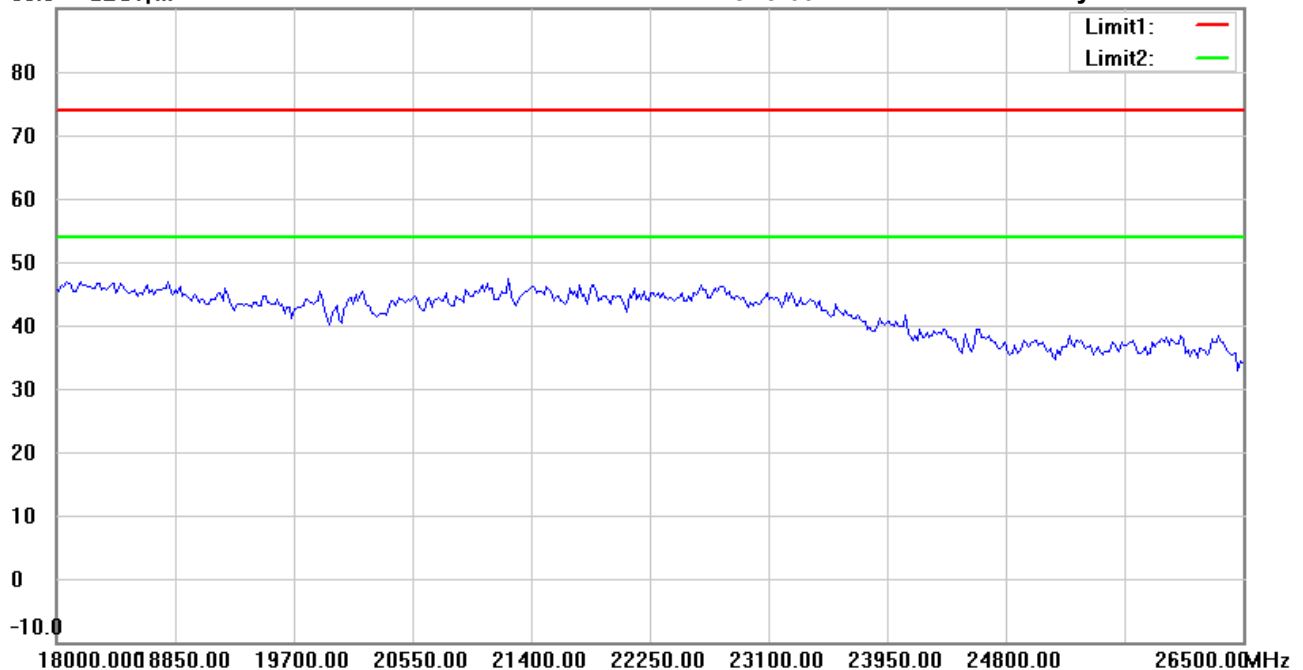

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihsu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:19:55 AM

Humidity: 67.7 %

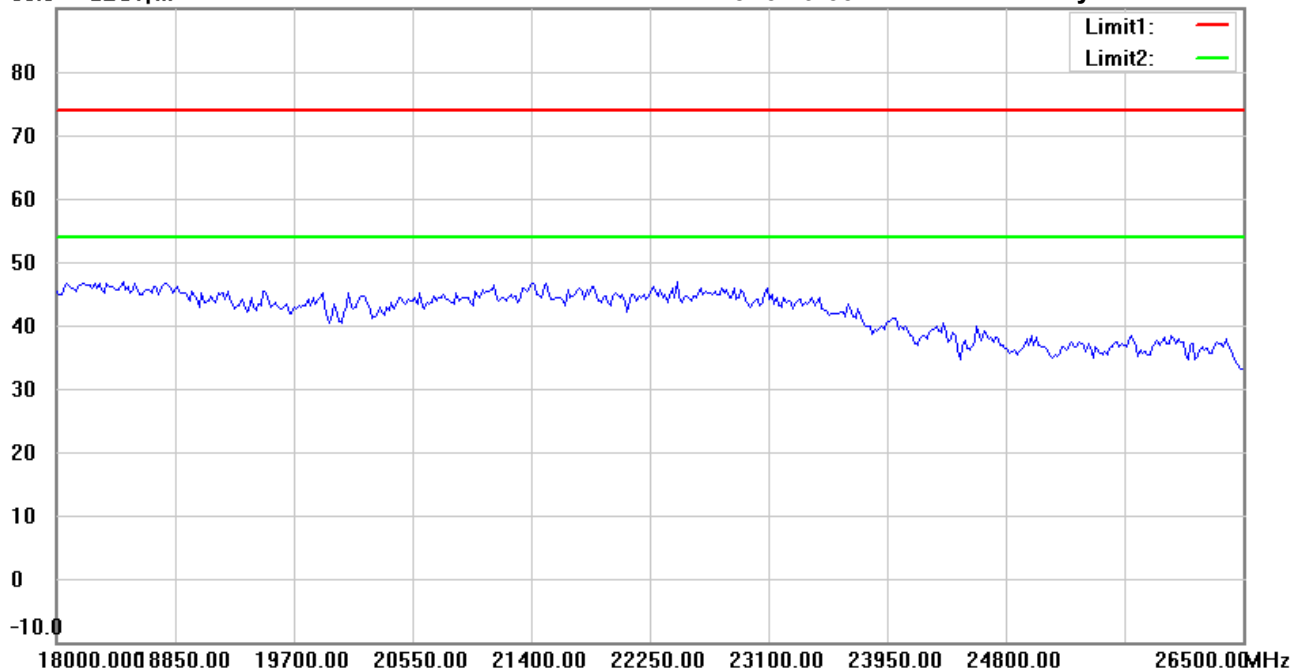

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#6


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:09:38 AM

Humidity: 67.7 %

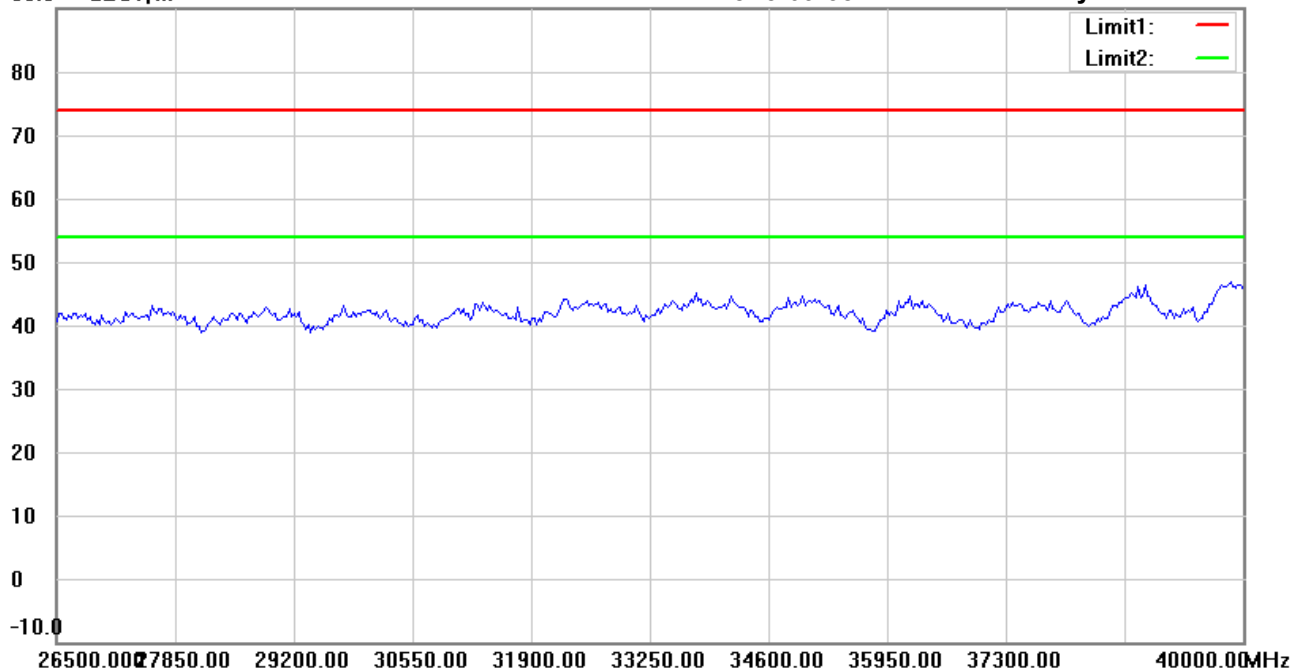

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:20:05 AM

Humidity: 67.7 %

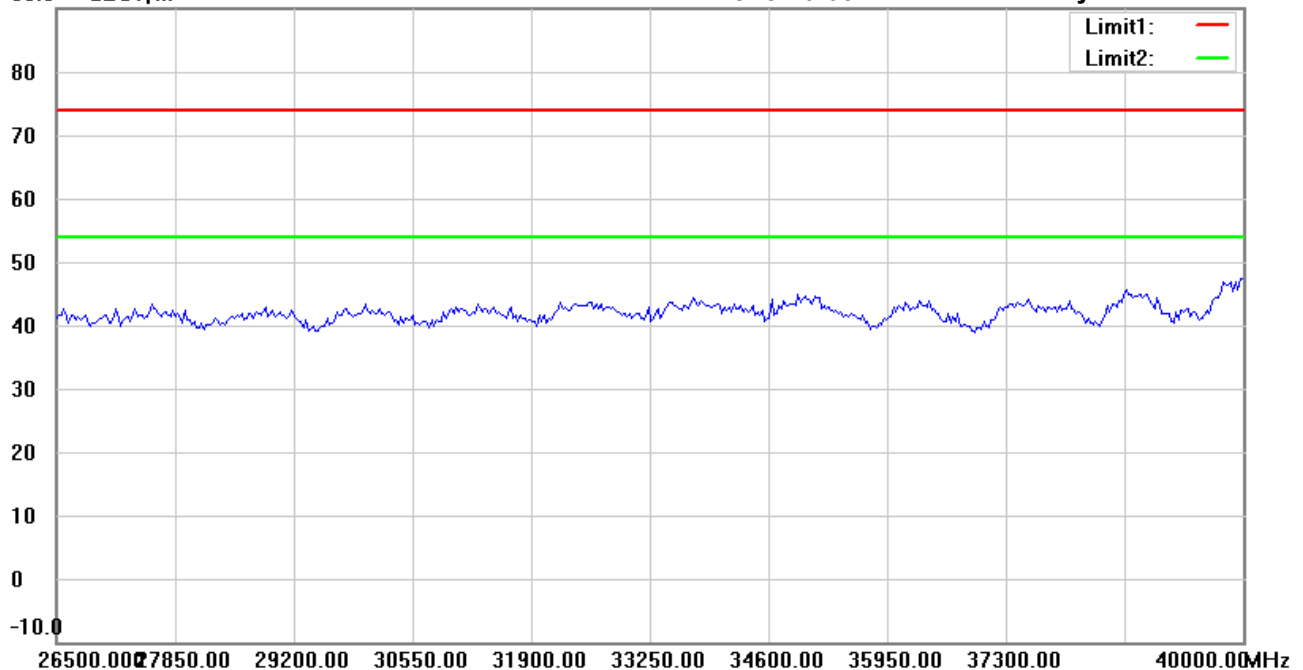

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11n40 CH159

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File : 1_TX 802

Data : #1


Date: 10/24/2019

Temperature: 23.4 °C

80.0 dBuV/m

Time: 9:58:31 PM

Humidity: 72.8 %

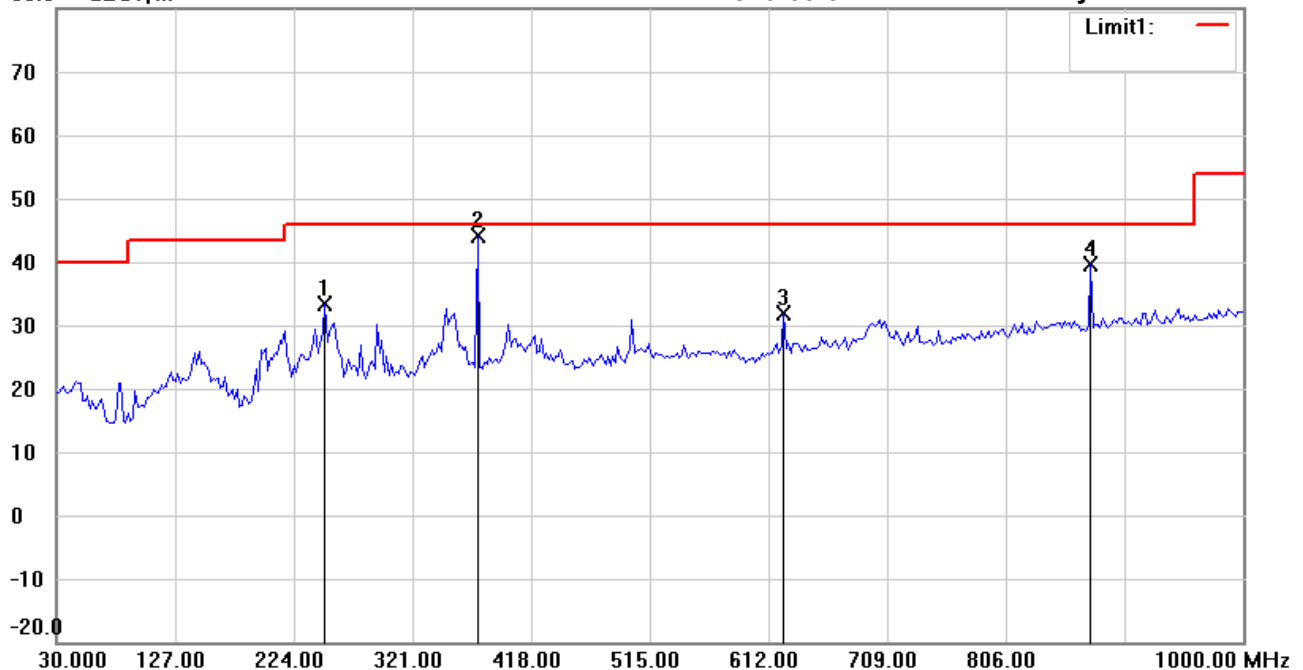

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	249.6593	41.29	peak	-8.02	33.27	46.00	100	160	-12.73	
*	374.0681	48.68	peak	-4.50	44.18	46.00	100	50	-1.82	
	624.8297	33.45	peak	-1.51	31.94	46.00	100	55	-14.06	
	875.5912	36.68	peak	2.93	39.61	46.00	100	310	-6.39	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Sky

File :1_TX 802

Data :#2


Date: 10/24/2019

Temperature:23.4 °C

80.0 dBuV/m

Time: 10:00:12 PM

Humidity:72.8 %

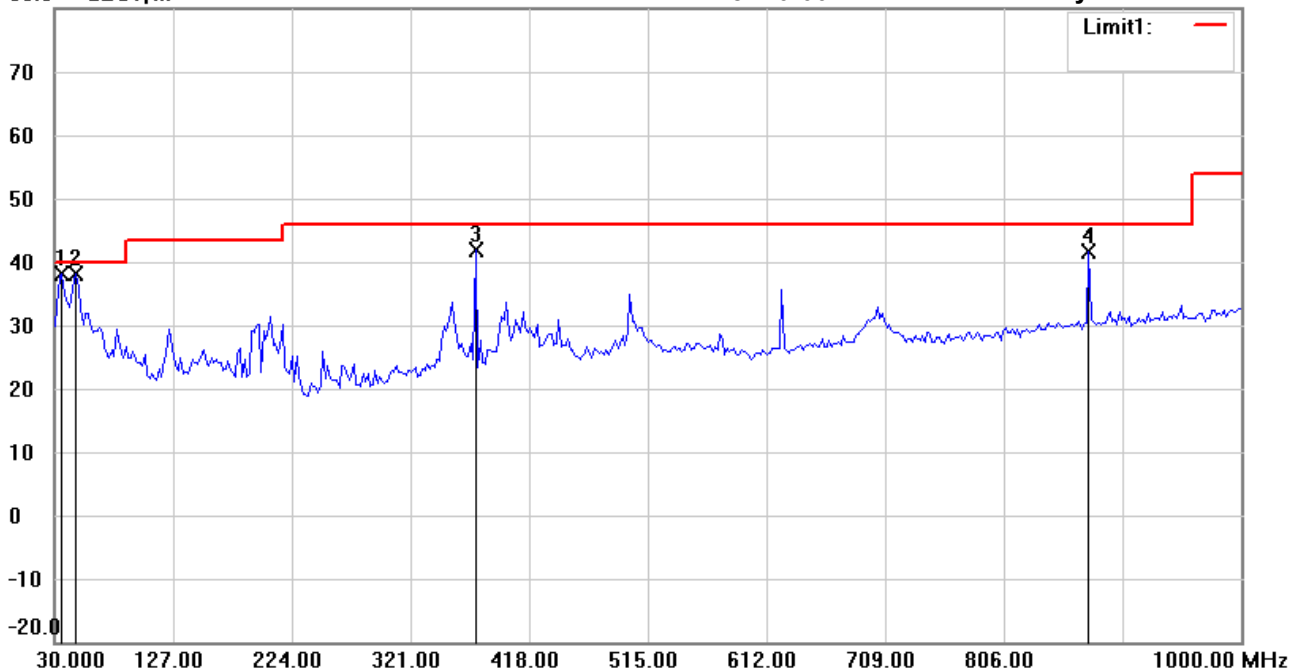

Site : Chamber

Condition : FCC_part 15 RE-Class E_30-1000MHz

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	35.8316	47.03	peak	-8.95	38.08	40.00	100	55	-1.92	
*	47.4950	48.11	peak	-9.91	38.20	40.00	100	310	-1.80	
	374.0681	46.26	peak	-4.50	41.76	46.00	100	90	-4.24	
	875.5912	38.74	peak	2.93	41.67	46.00	100	150	-4.33	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 6:59:42 AM

Humidity:61.7 %

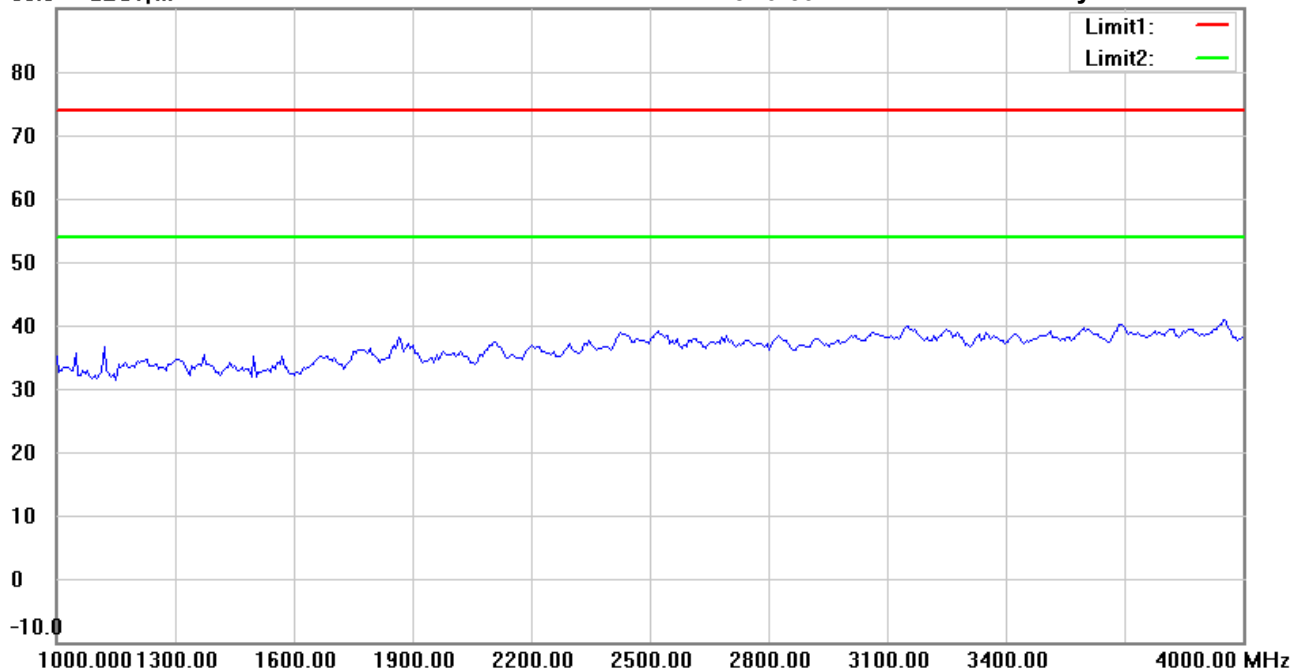

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 7:04:21 AM

Humidity:61.7 %

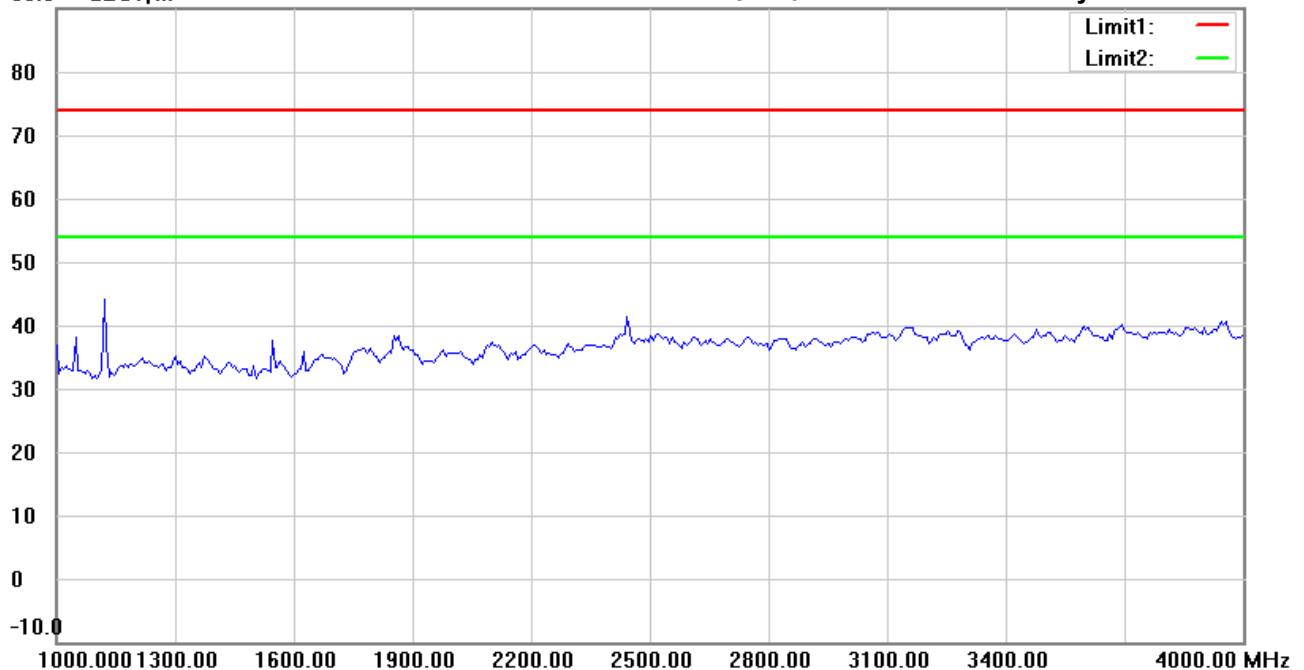

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#2


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 7:00:44 AM

Humidity:61.7 %

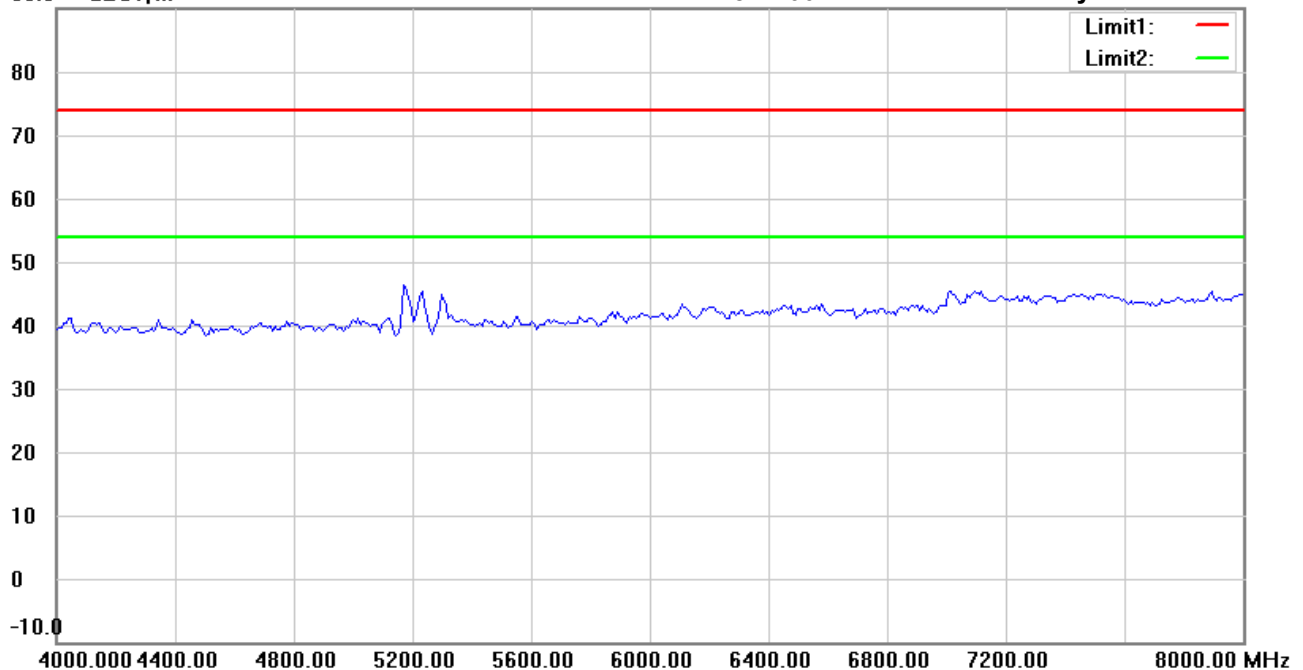

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #8


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 7:05:22 AM

Humidity: 61.7 %

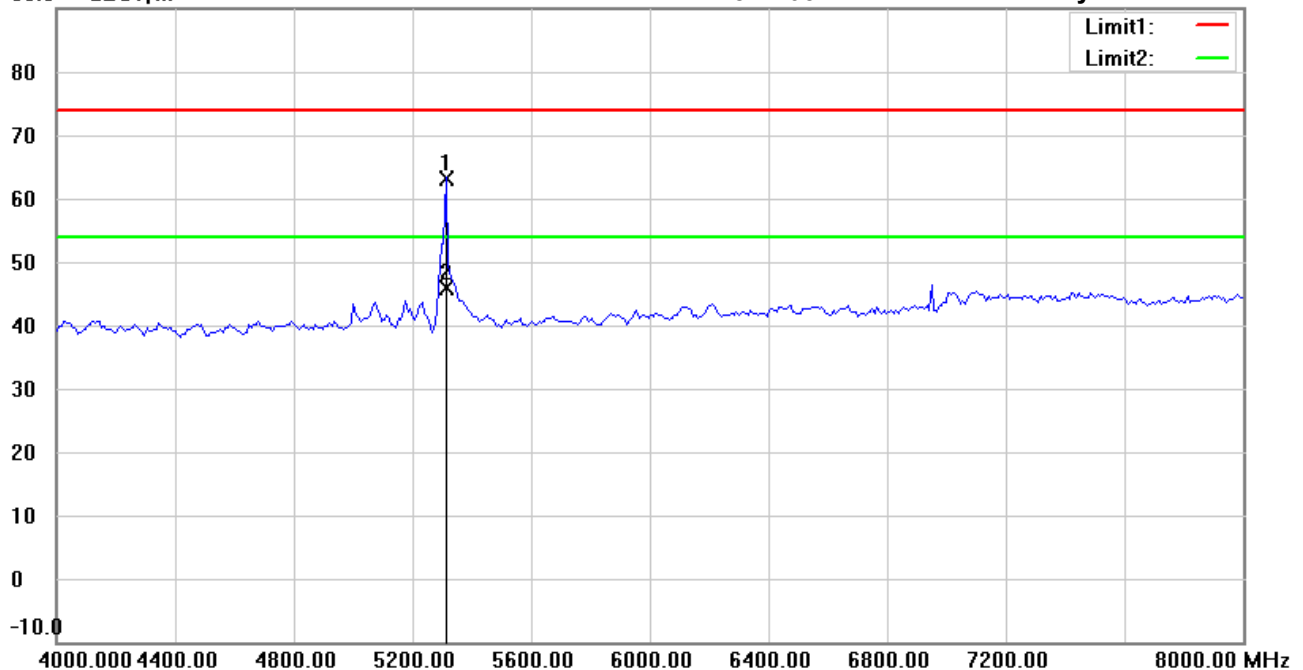

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	5307.675	63.64	peak	-0.44	63.20	74.00	165	235	-10.80	
*	5307.675	46.24	AVG	-0.44	45.80	54.00	165	235	-8.20	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#3


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 7:01:49 AM

Humidity:61.7 %

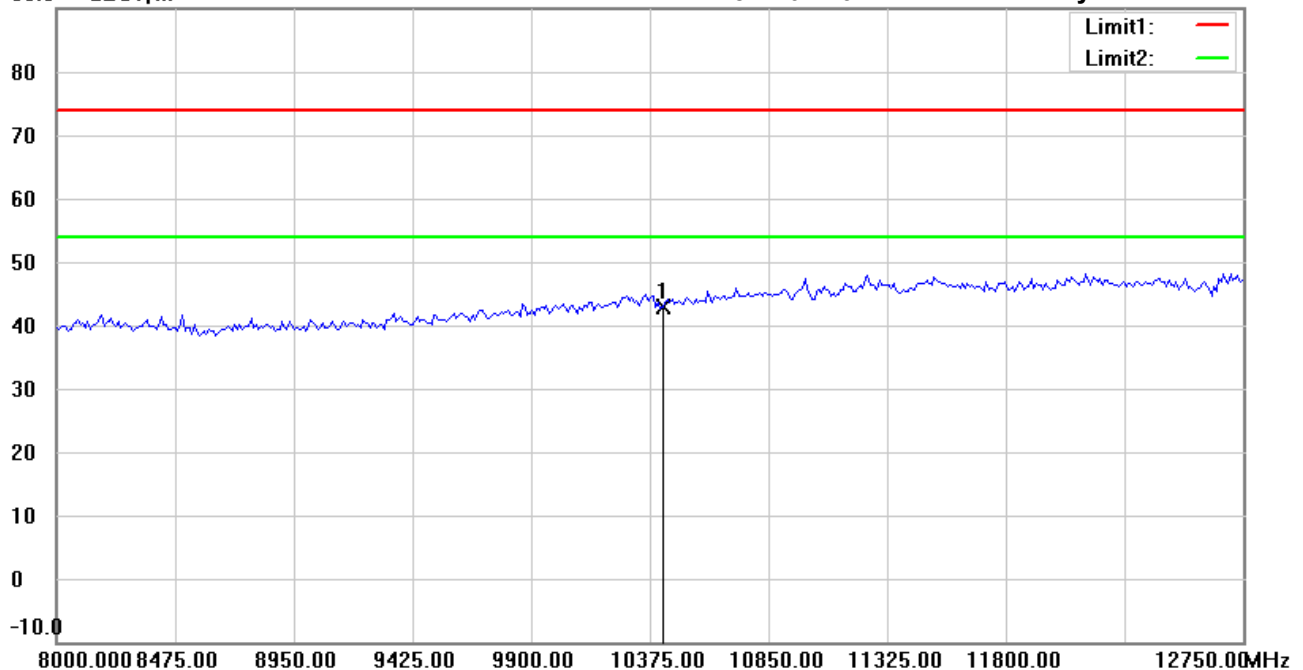

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10420.000	34.64	peak	8.27	42.91	74.00	150	130	-31.09	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #9


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 7:06:27 AM

Humidity: 61.7 %

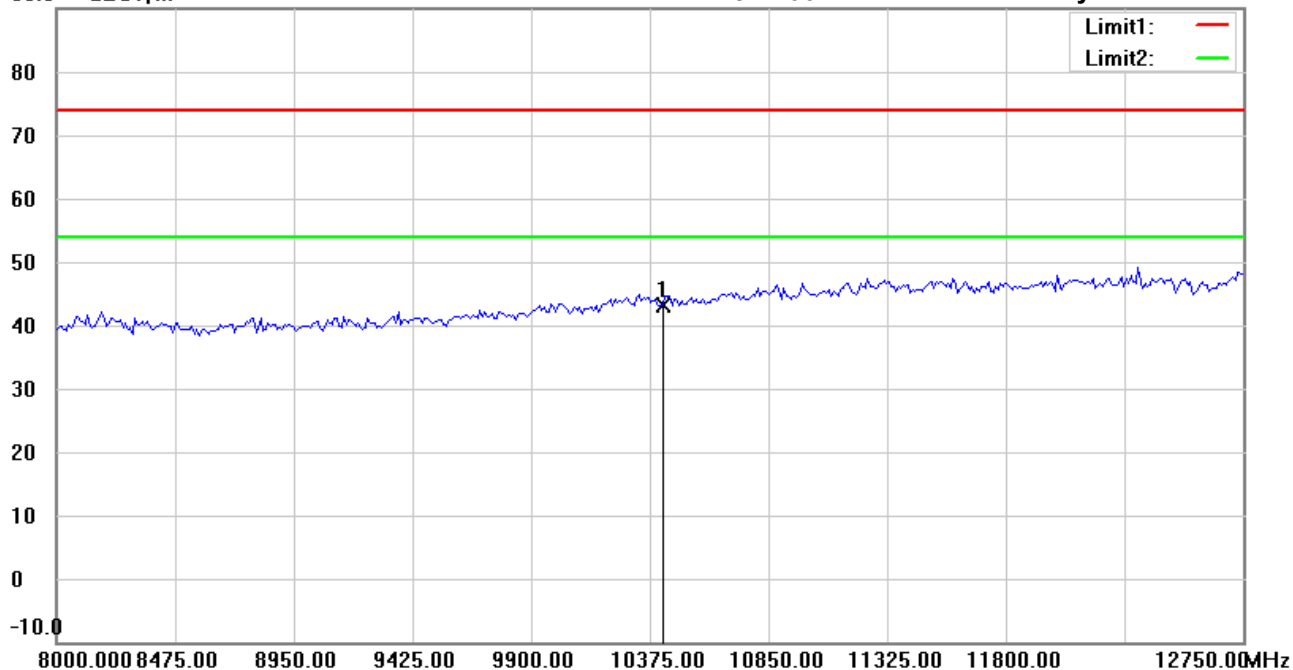

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	10420.000	34.95	peak	8.27	43.22	74.00	150	70	-30.78	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 7:02:57 AM

Humidity: 61.7 %

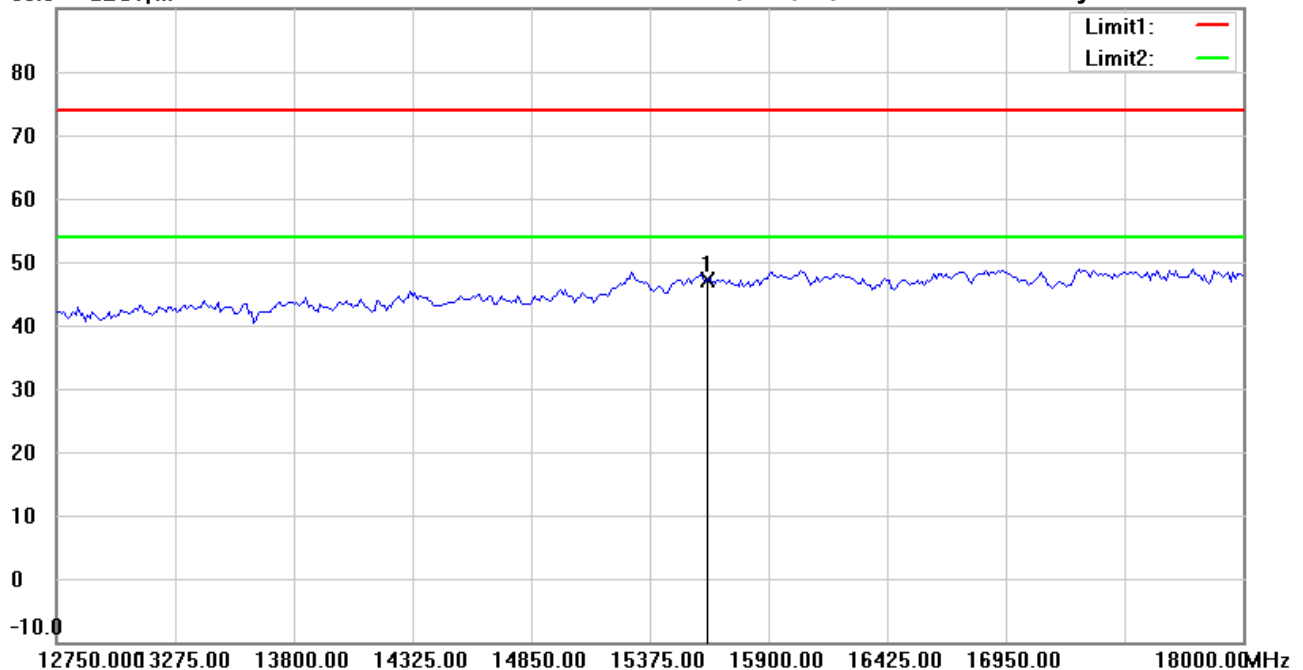

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15630.000	28.13	peak	19.06	47.19	74.00	150	140	-26.81	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 7:07:35 AM

Humidity: 61.7 %

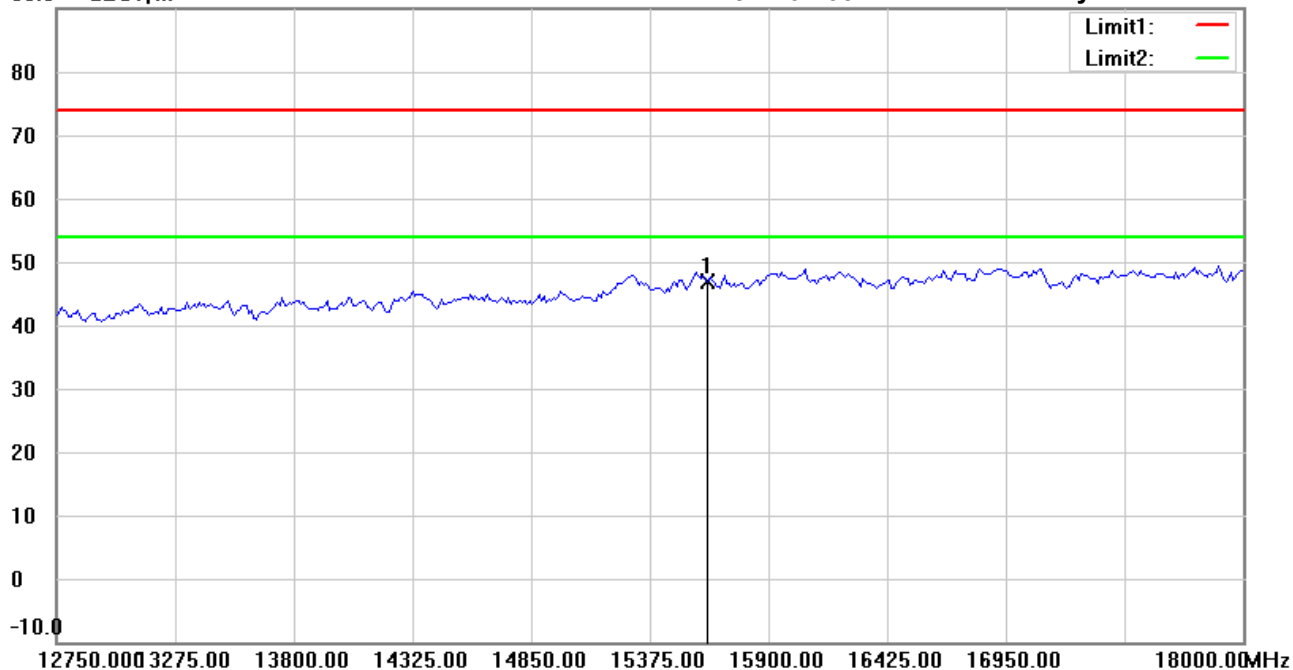

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	15630.000	27.86	peak	19.06	46.92	74.00	150	275	-27.08	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 7:03:07 AM

Humidity:61.7 %

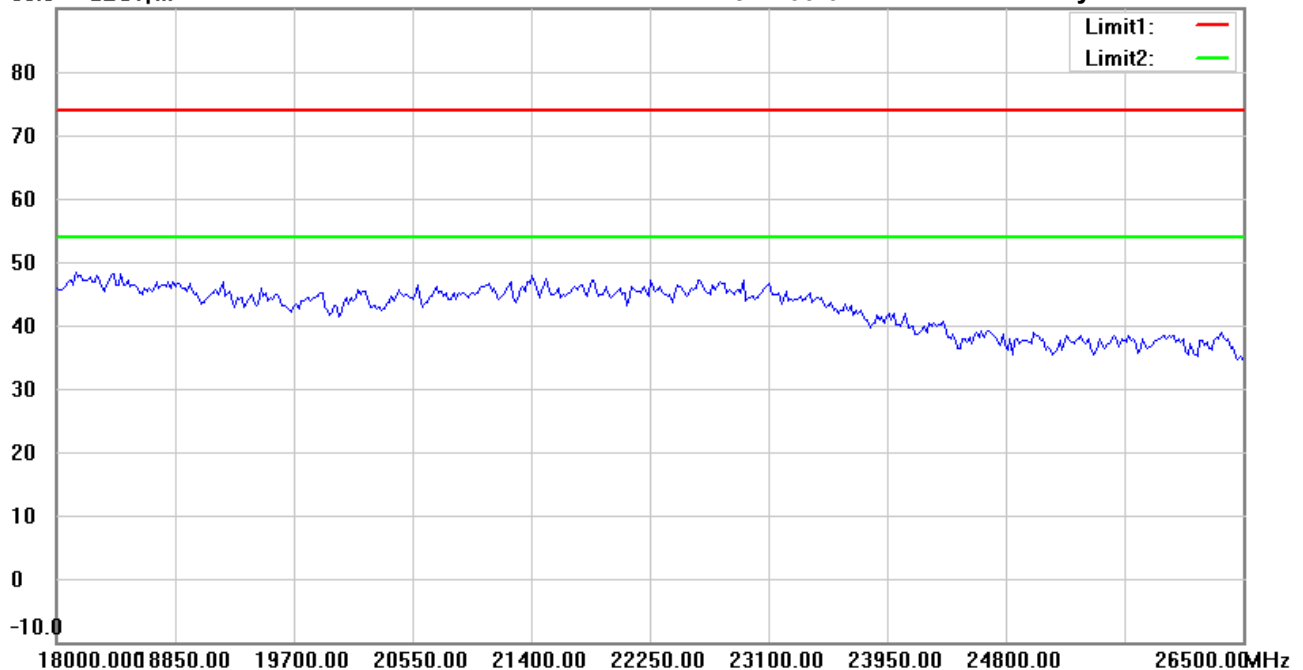

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 10/18/2019

Temperature:22.1 °C

90.0 dBuV/m

Time: 7:07:45 AM

Humidity:61.7 %

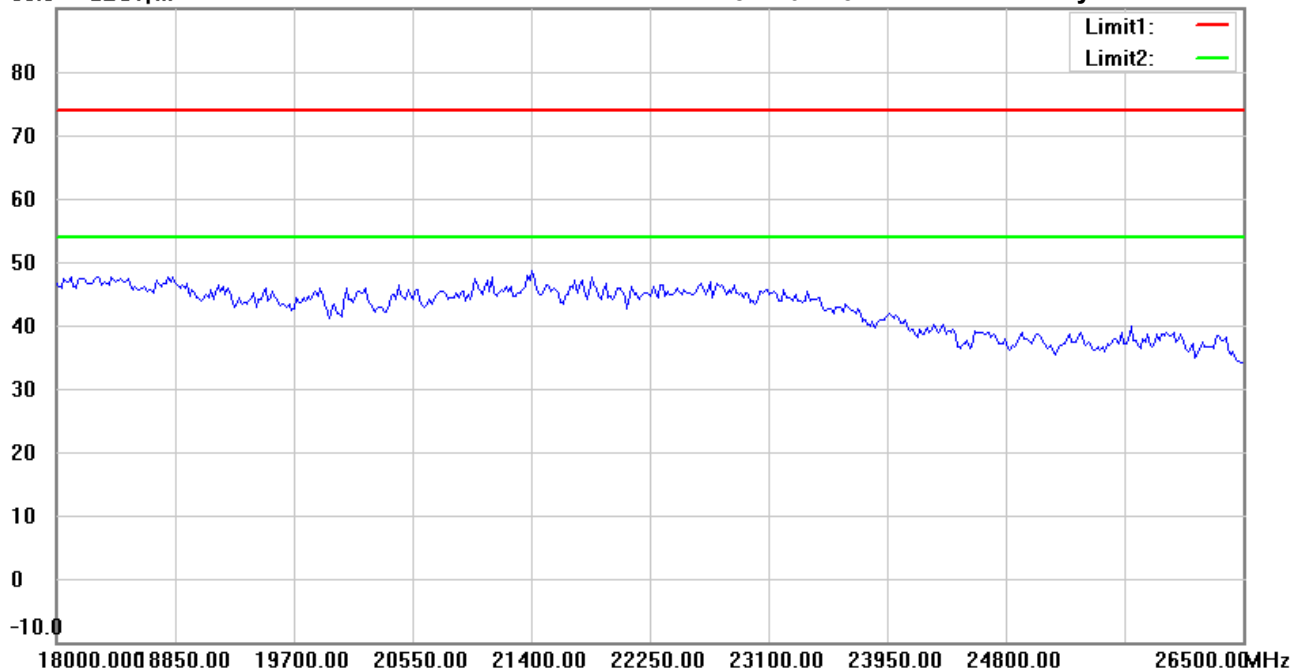

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 7:03:18 AM

Humidity: 61.7 %

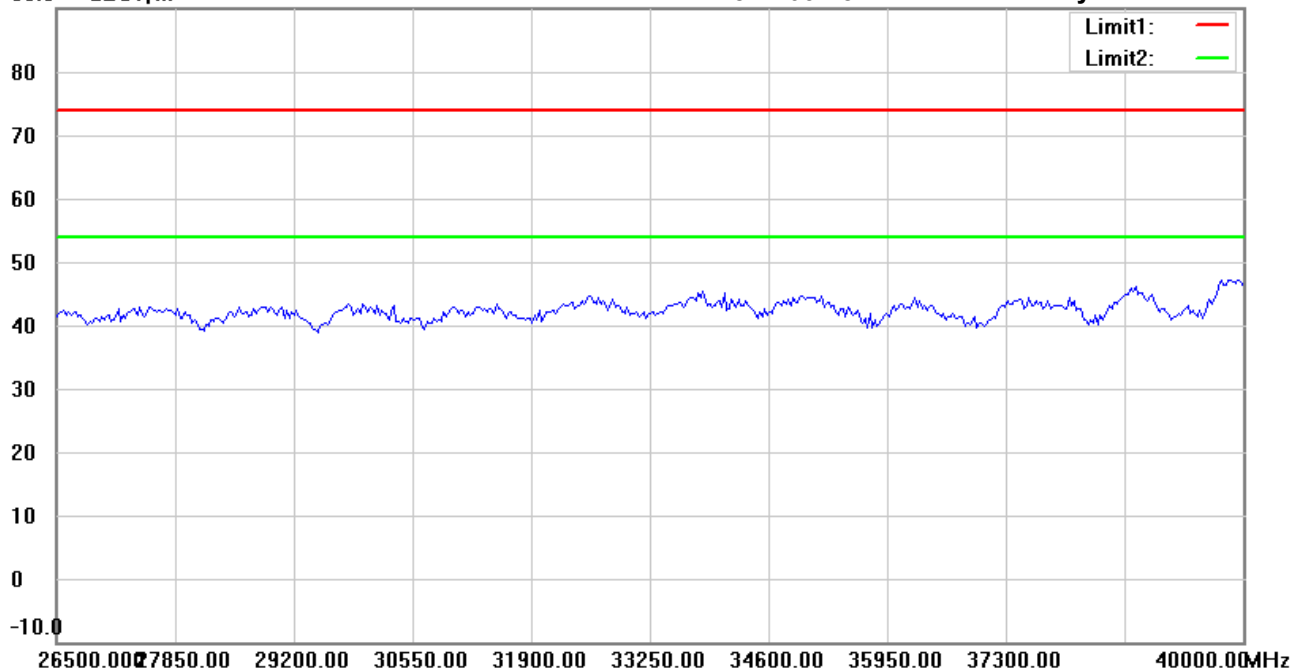

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #12


Date: 10/18/2019

Temperature: 22.1 °C

90.0 dBuV/m

Time: 7:07:56 AM

Humidity: 61.7 %

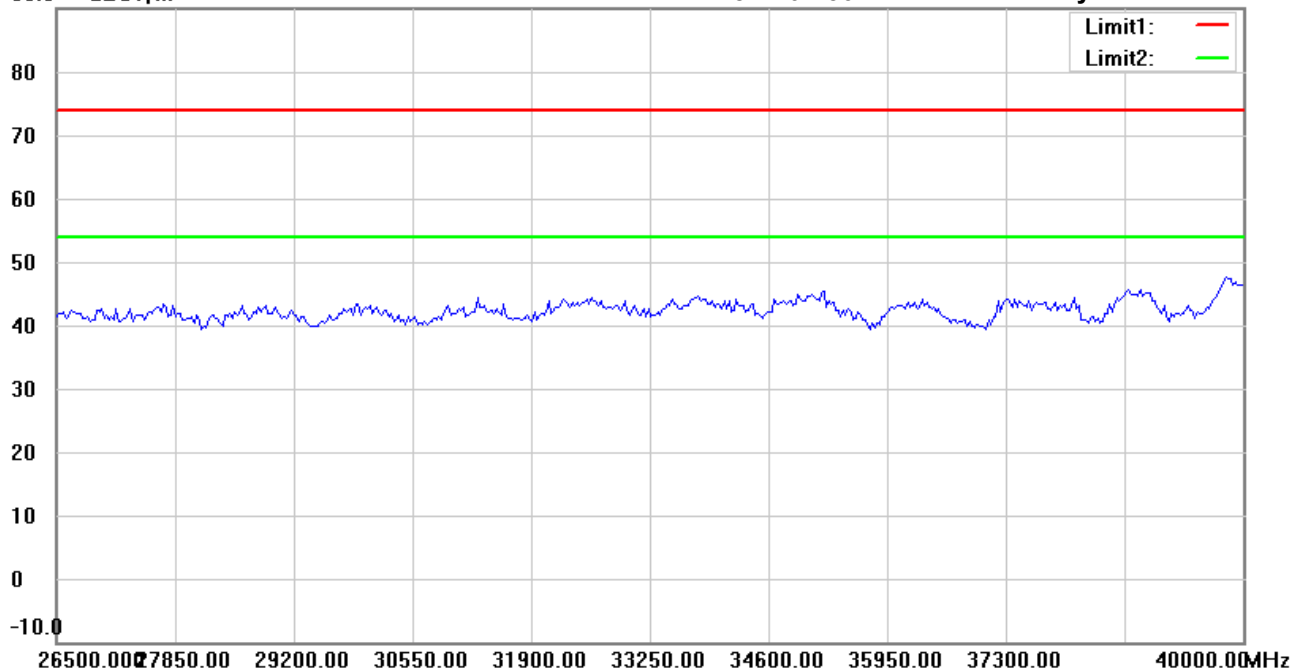

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH42

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#1


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:26:51 AM

Humidity:67.7 %

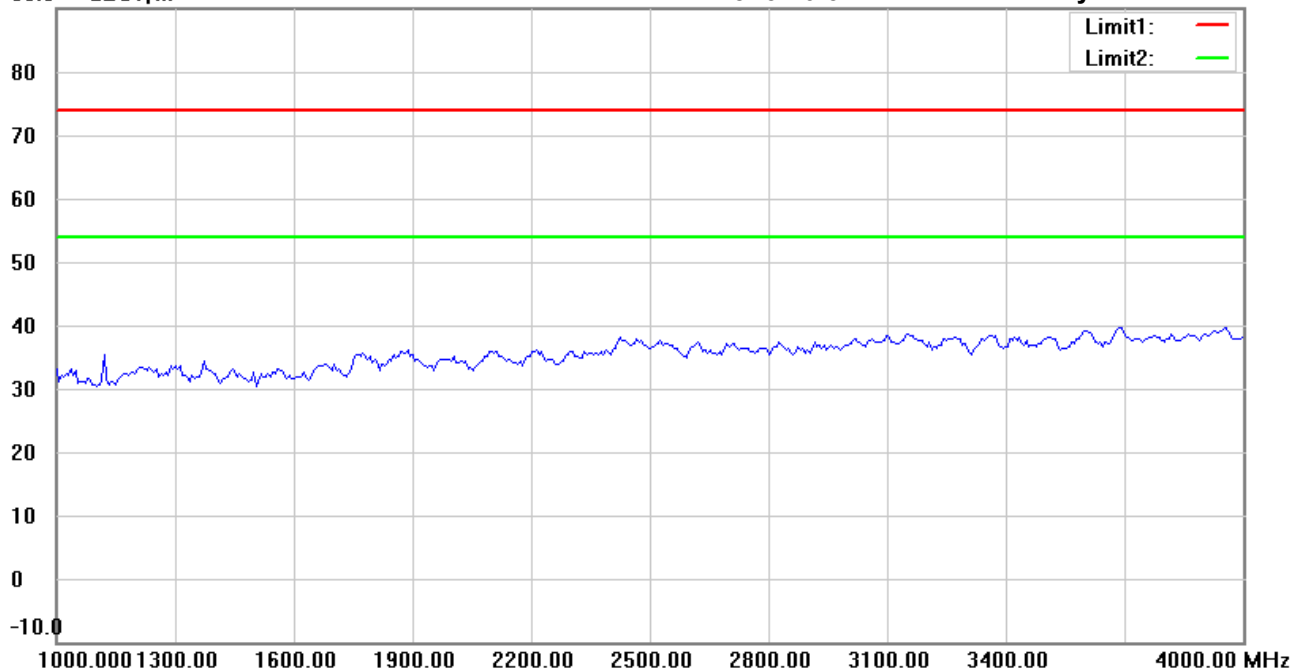

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#7


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:37:27 AM

Humidity:67.7 %

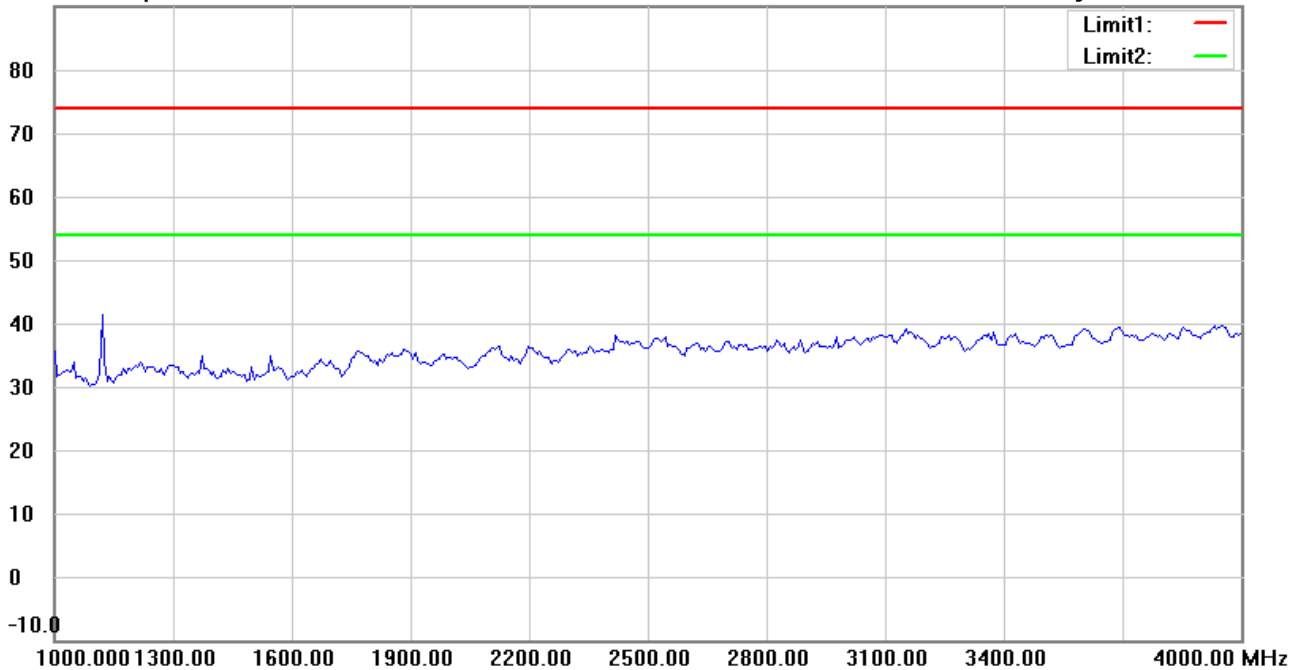

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: *Vertical*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #2


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:27:53 AM

Humidity: 67.7 %

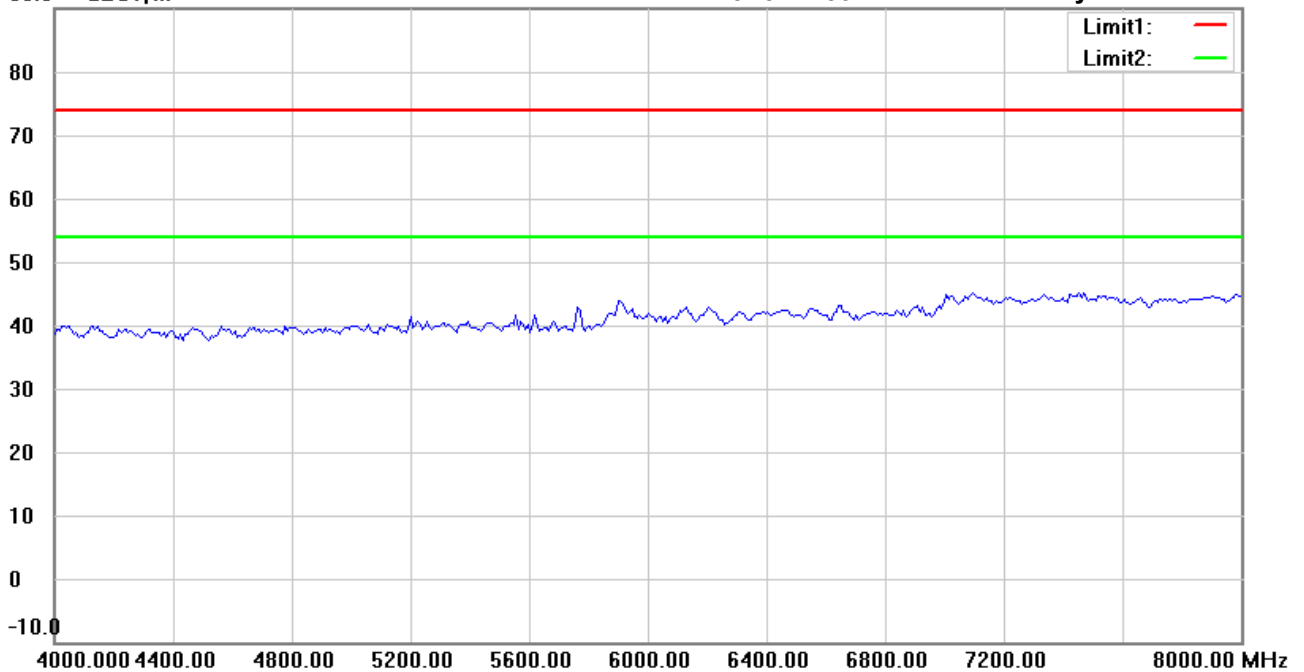

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#8


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:38:29 AM

Humidity:67.7 %

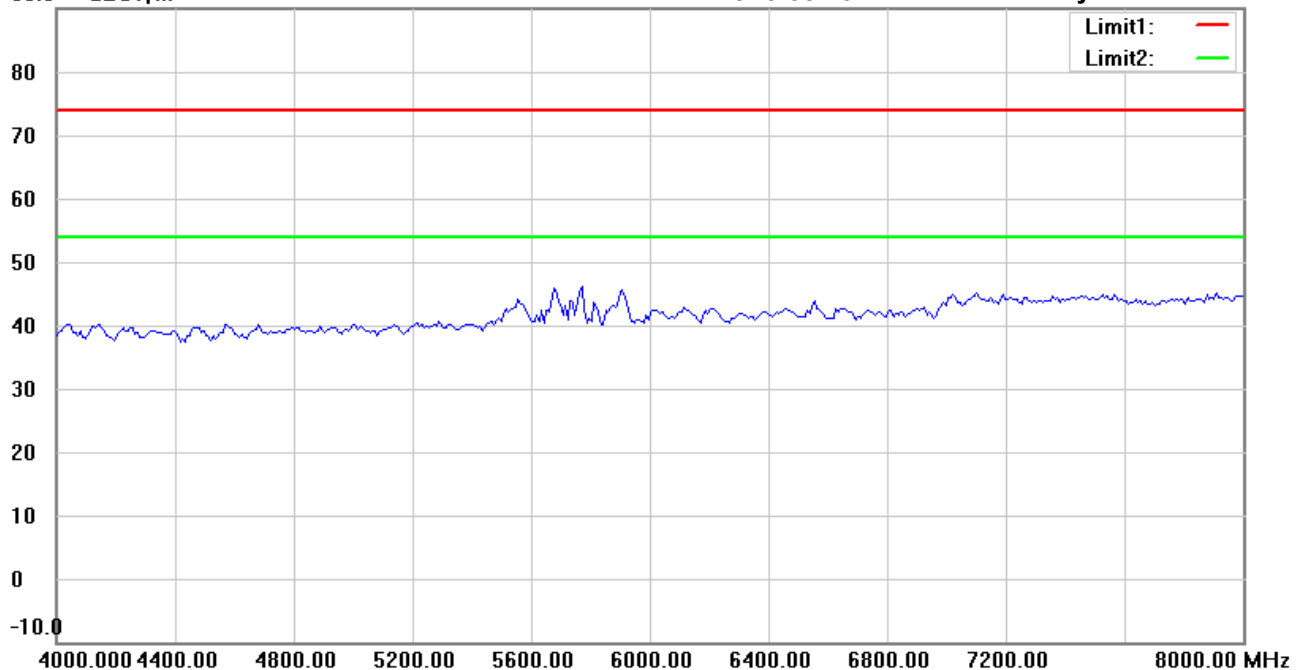

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #3


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:34:54 AM

Humidity: 67.7 %

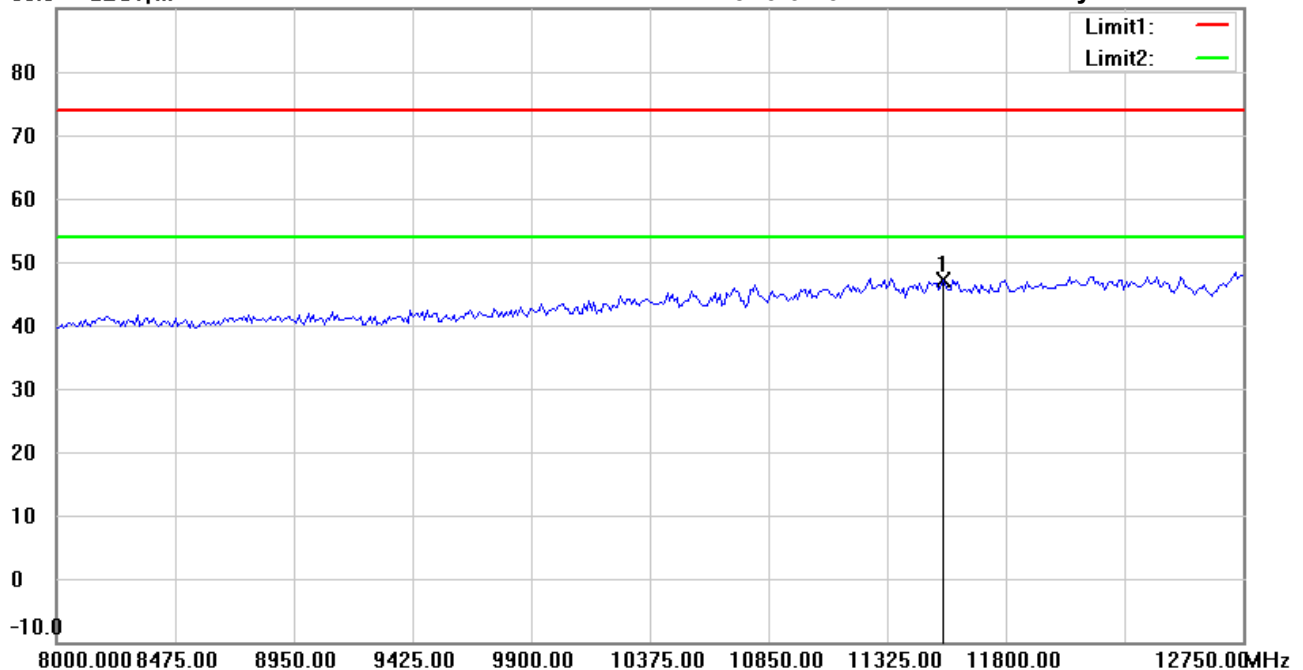

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11550.000	35.94	peak	11.21	47.15	74.00	150	5	-26.85	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#9


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:39:35 AM

Humidity:67.7 %

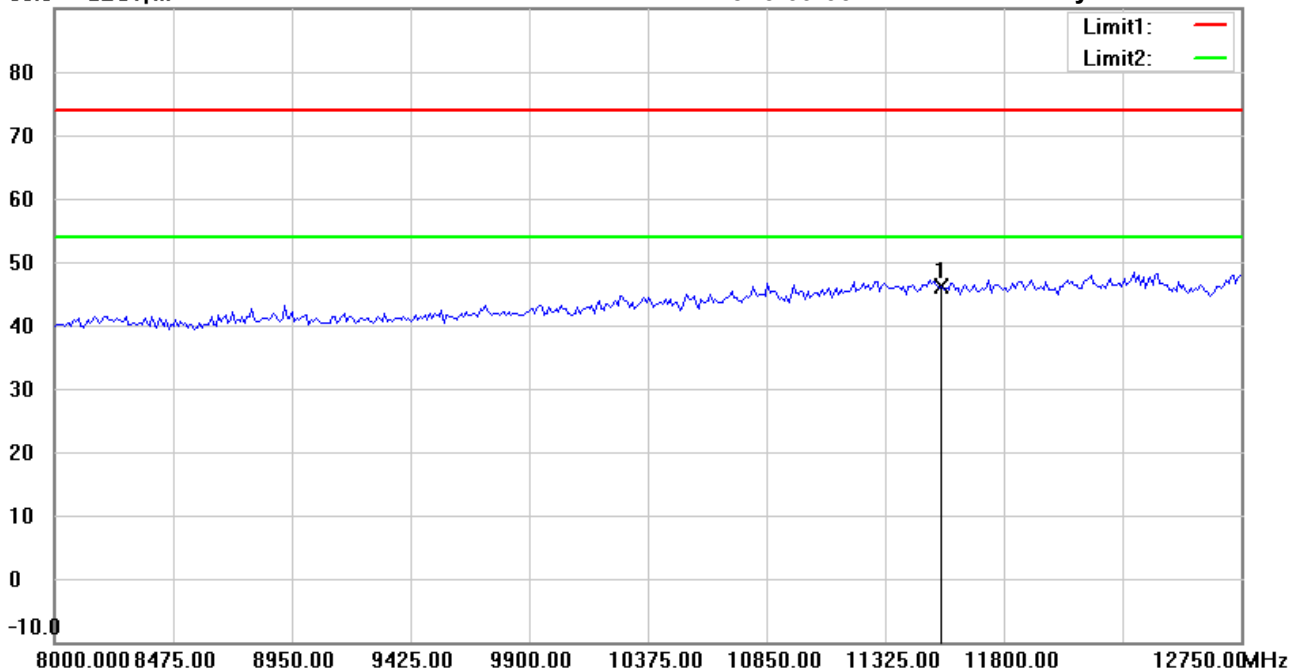

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11550.000	34.91	peak	11.21	46.12	74.00	150	45	-27.88	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#4


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:36:02 AM

Humidity: 67.7 %

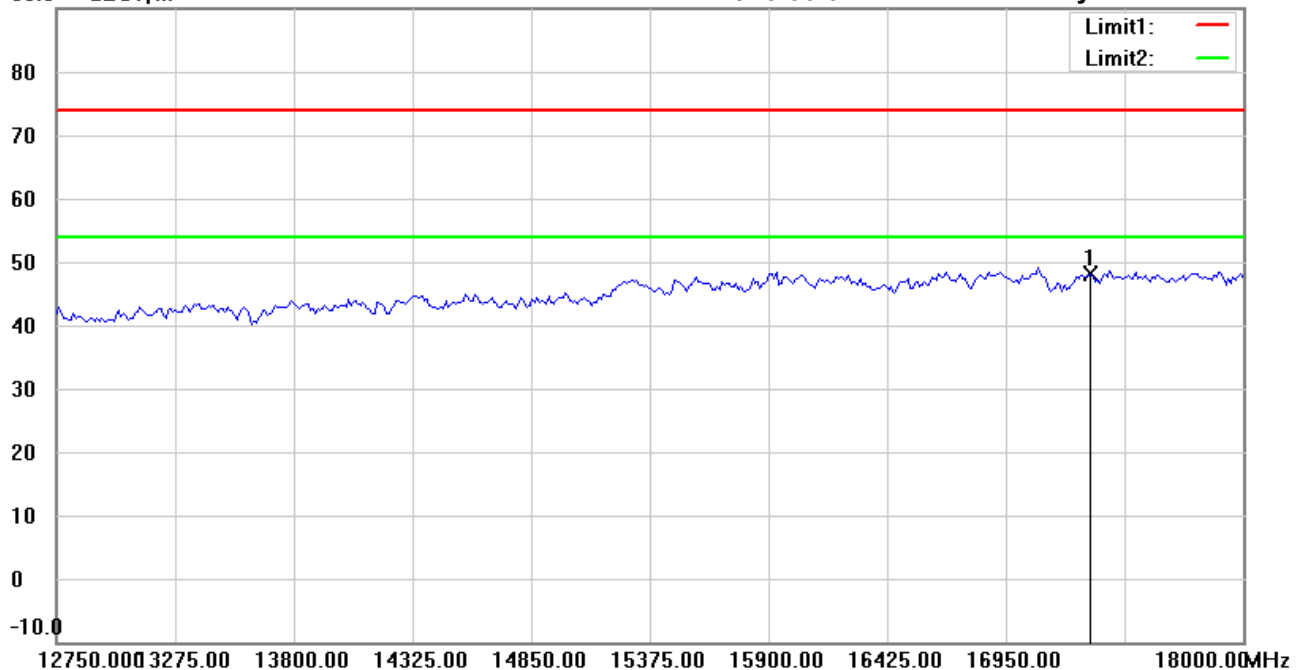

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: **Horizontal**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17325.000	27.38	peak	20.72	48.10	74.00	150	145	-25.90	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#10


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:40:44 AM

Humidity: 67.7 %

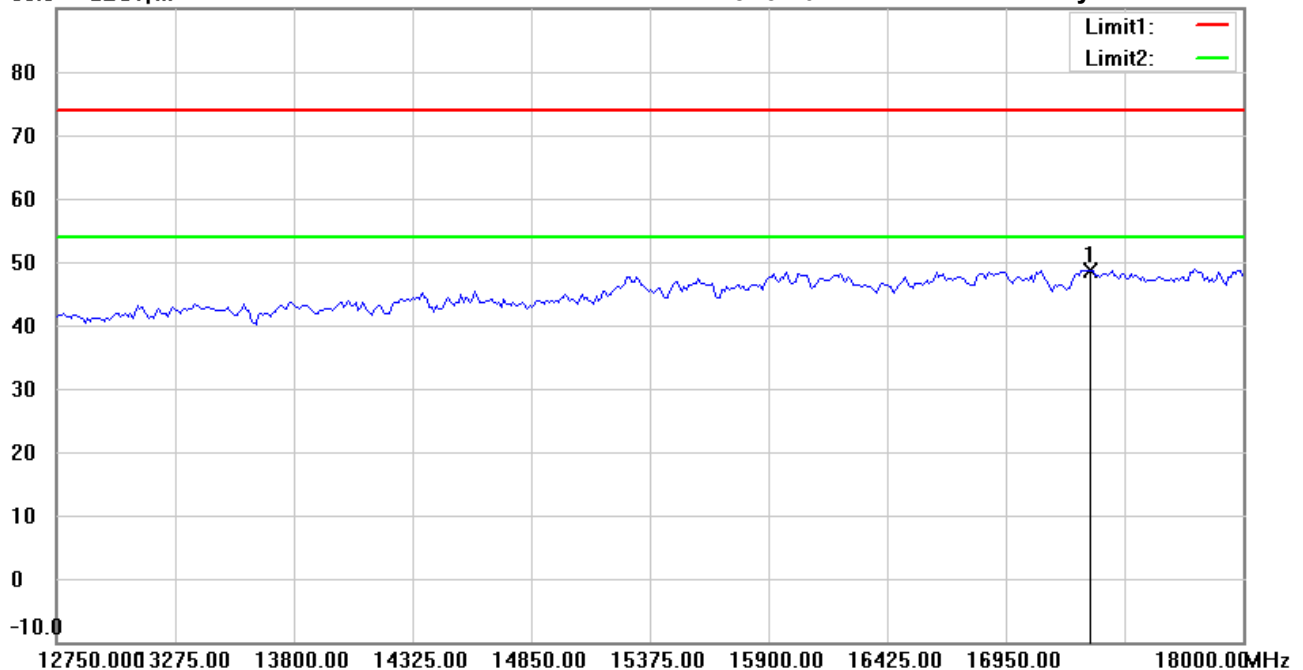

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: **Vertical**

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17325.000	28.00	peak	20.72	48.72	74.00	150	100	-25.28	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#5


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:36:12 AM

Humidity:67.7 %

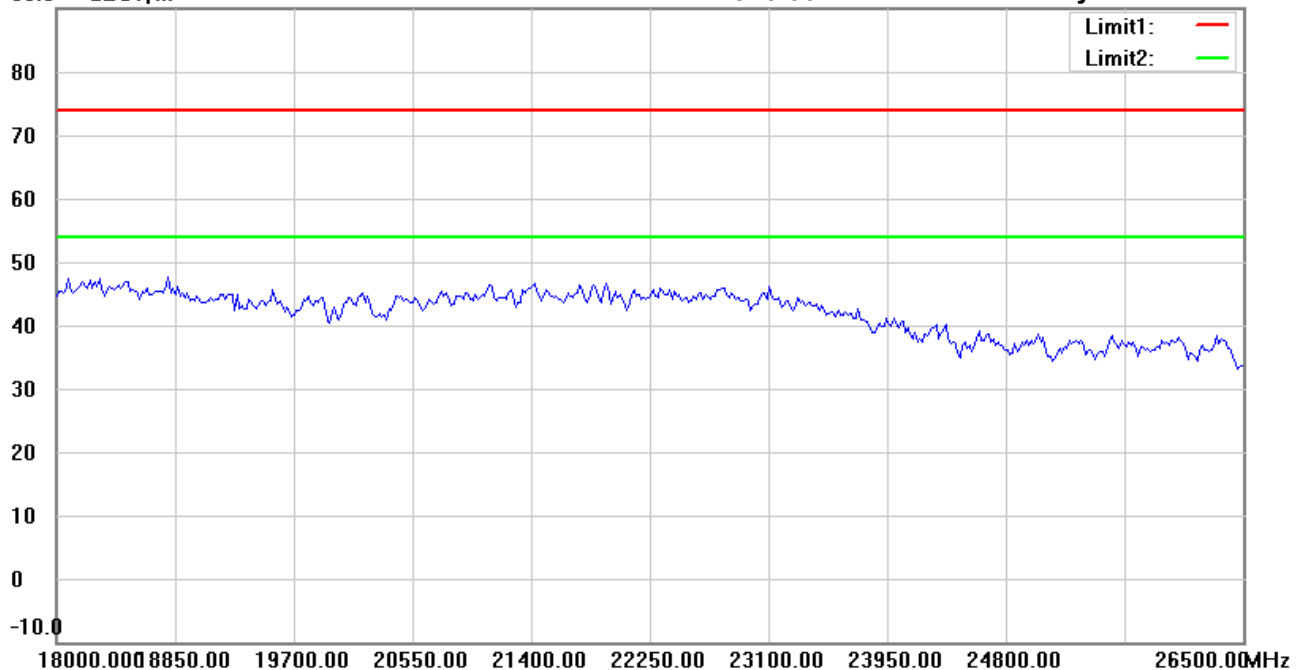

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: *Horizontal*

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#11


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:40:54 AM

Humidity:67.7 %

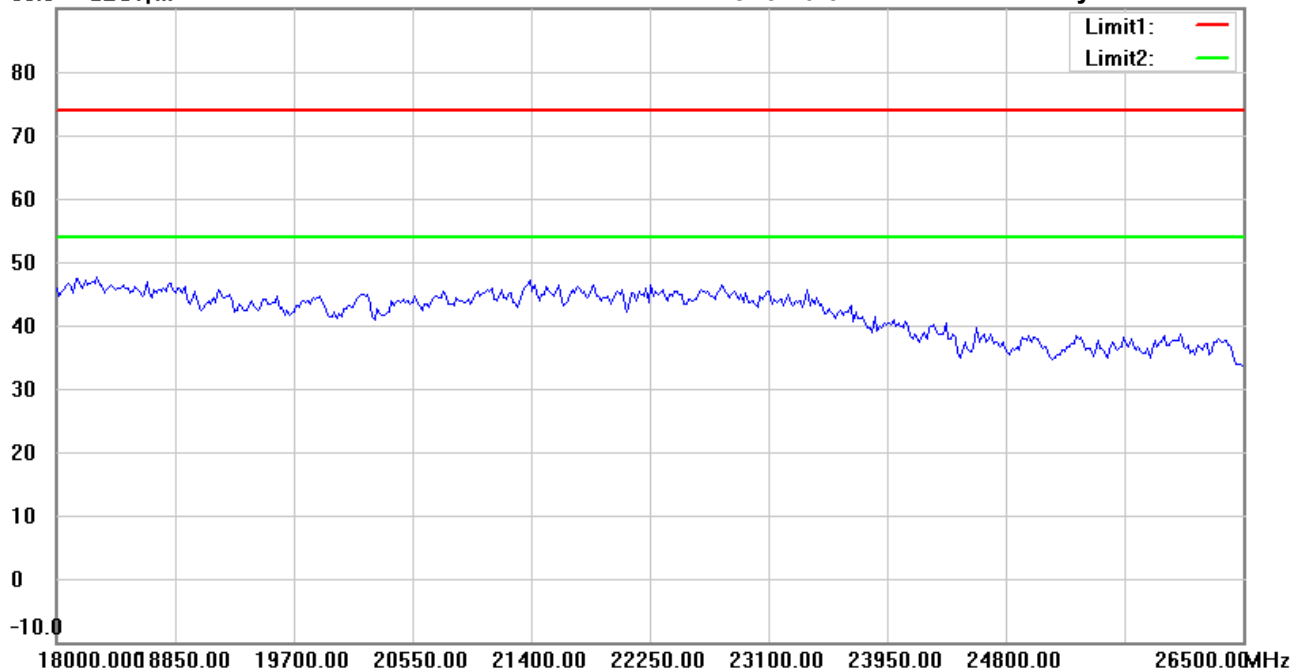

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File : 3

Data : #6


Date: 11/8/2019

Temperature: 22.4 °C

90.0 dBuV/m

Time: 5:36:23 AM

Humidity: 67.7 %

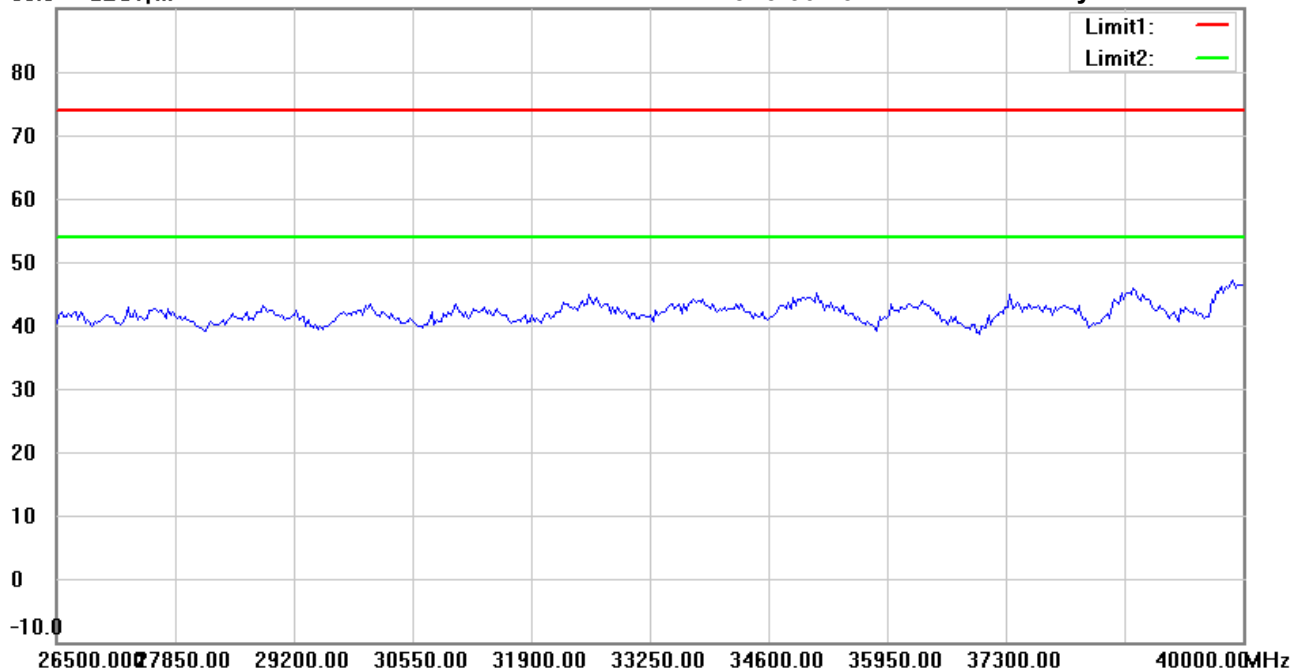

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :

Polarization: Horizontal

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Allen

File :3

Data :#12


Date: 11/8/2019

Temperature:22.4 °C

90.0 dBuV/m

Time: 5:41:04 AM

Humidity:67.7 %

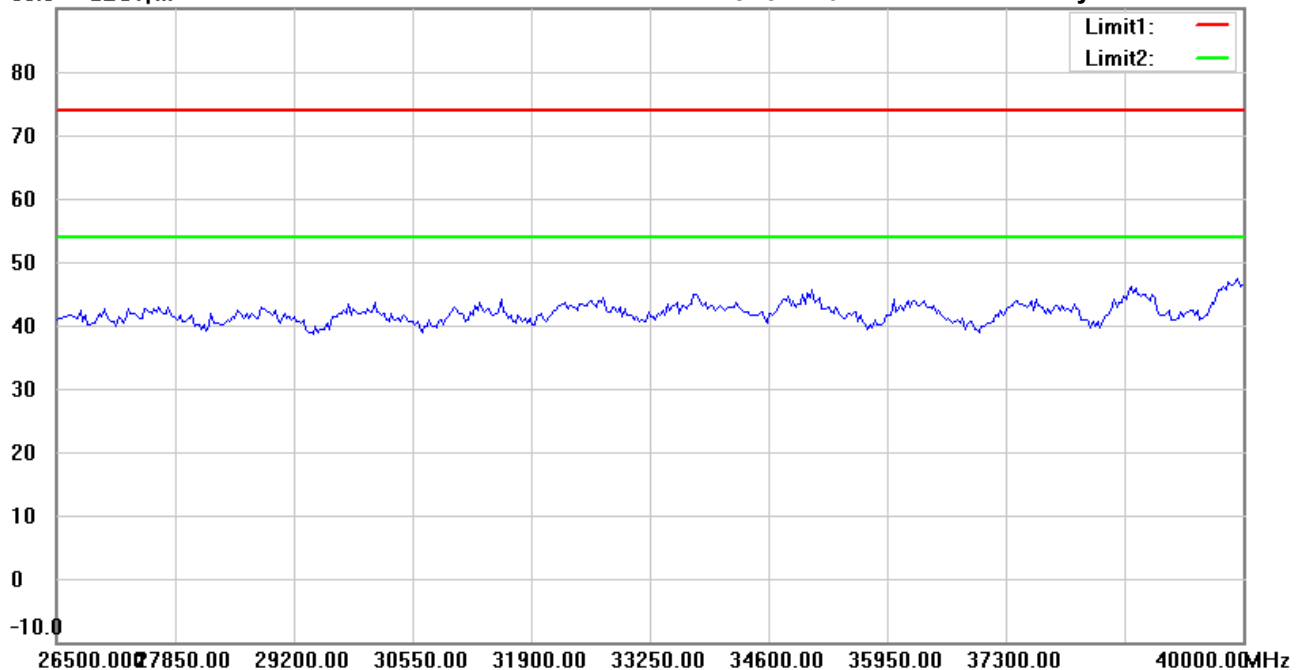

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M21903-18922

M/N:

Test Mode : TX 802.11ac CH155

Note :


Polarization: Vertical

Power : 48 Vd.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin

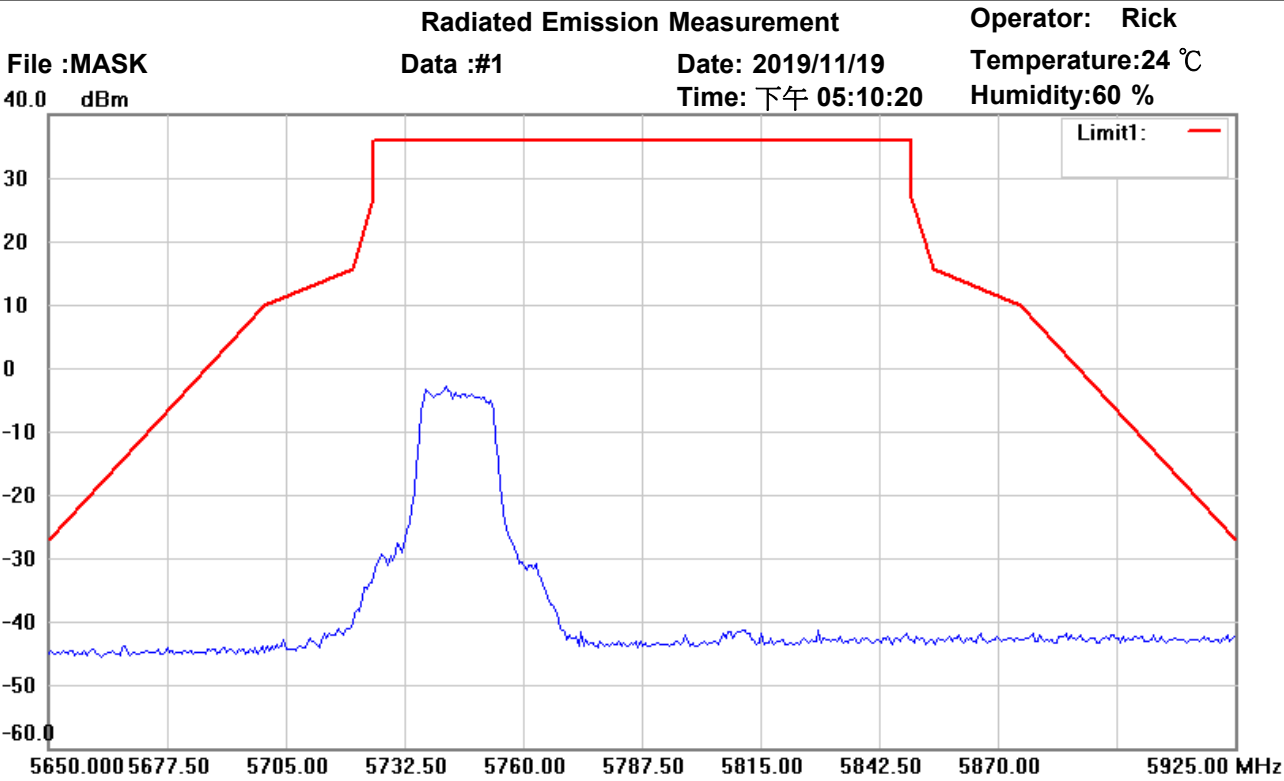

Site : Chamber
Condition : FCC_5G Band4 Mask
EUT : W6M21903-18922
M/N:
Test Mode : 802.11a TX CH149
Note :

Polarization: *Horizontal*
Power : POE 48V
Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 06:01:19

Humidity: 60 %

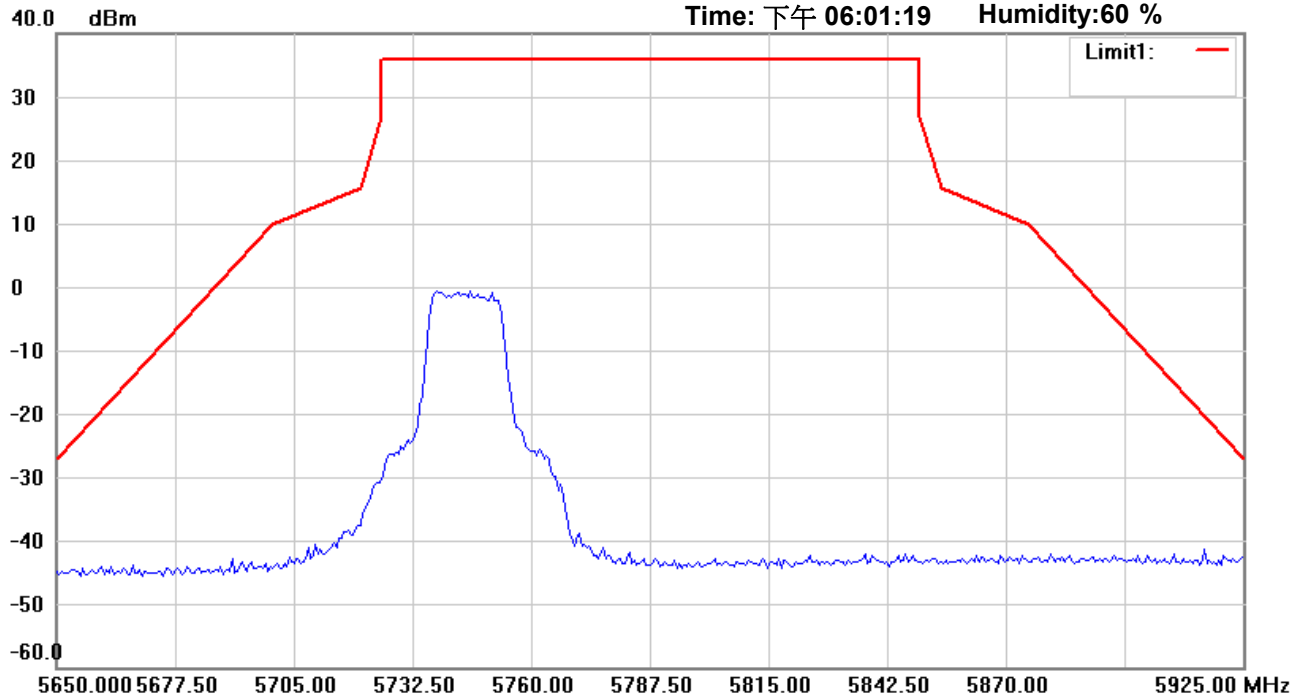

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:19:33

Humidity: 60 %

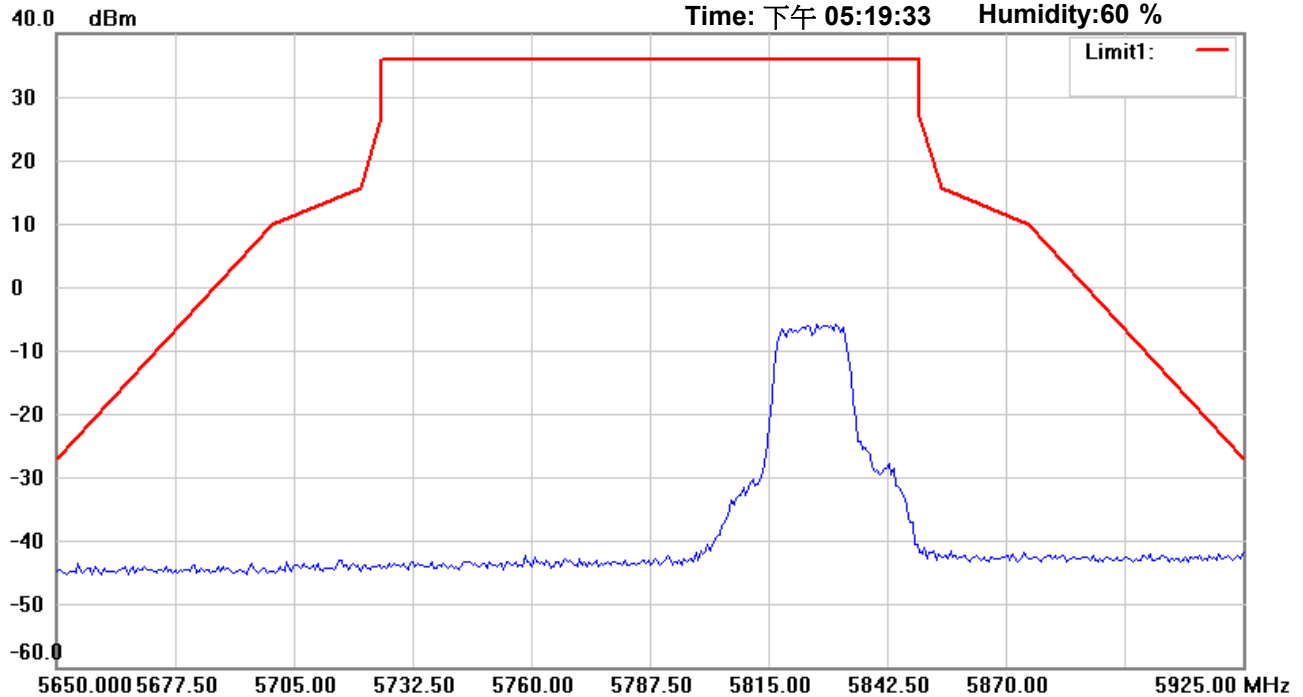

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 06:03:18

Humidity: 60 %

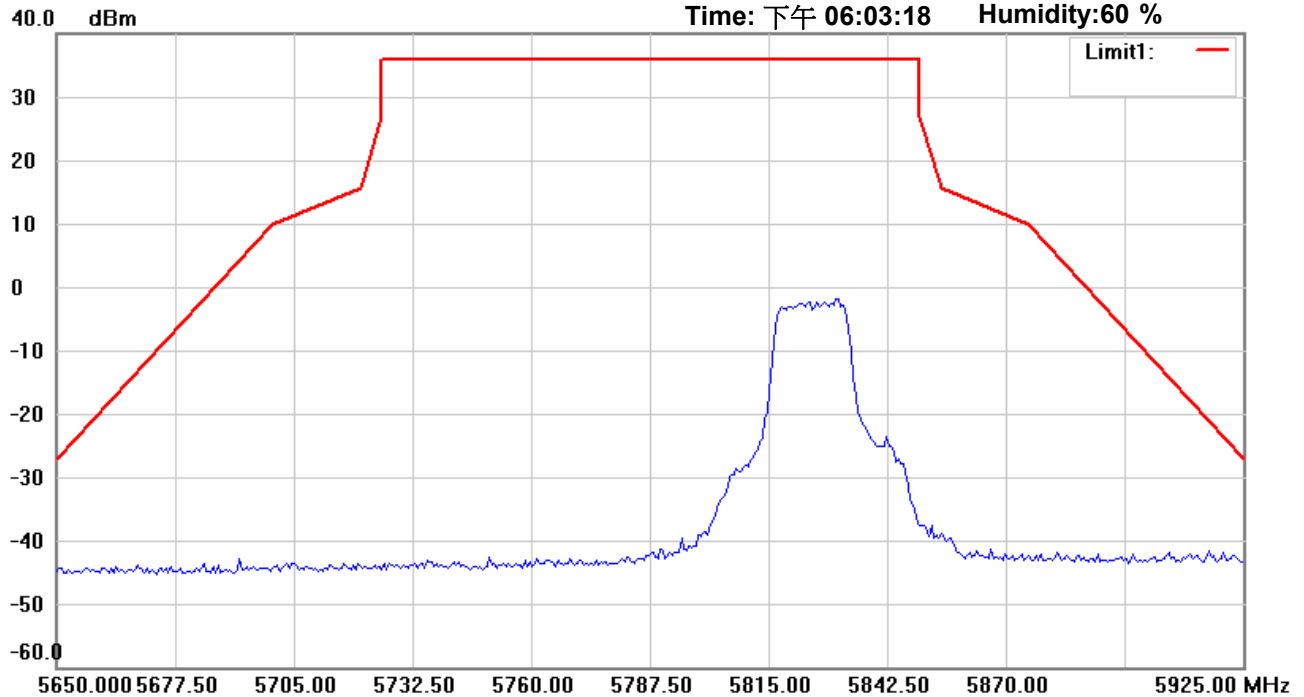

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: **Vertical**

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #1

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:12:05

Humidity: 60 %

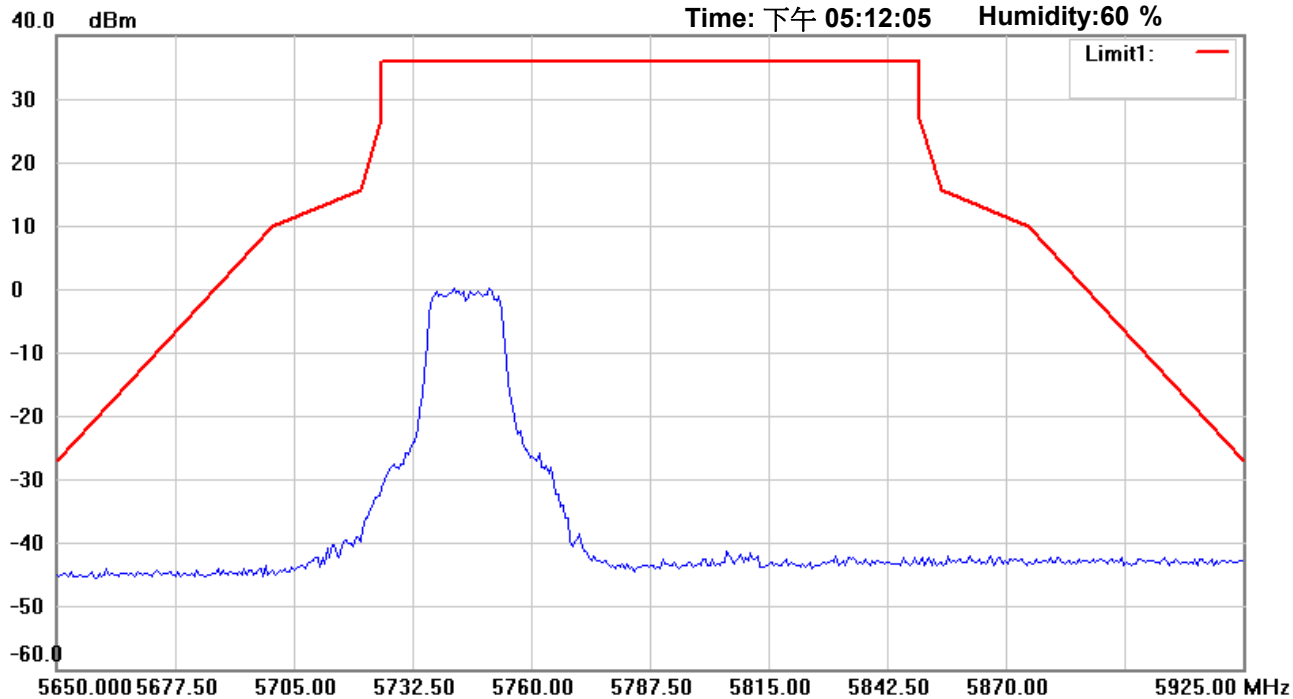

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 06:06:28

Humidity: 60 %

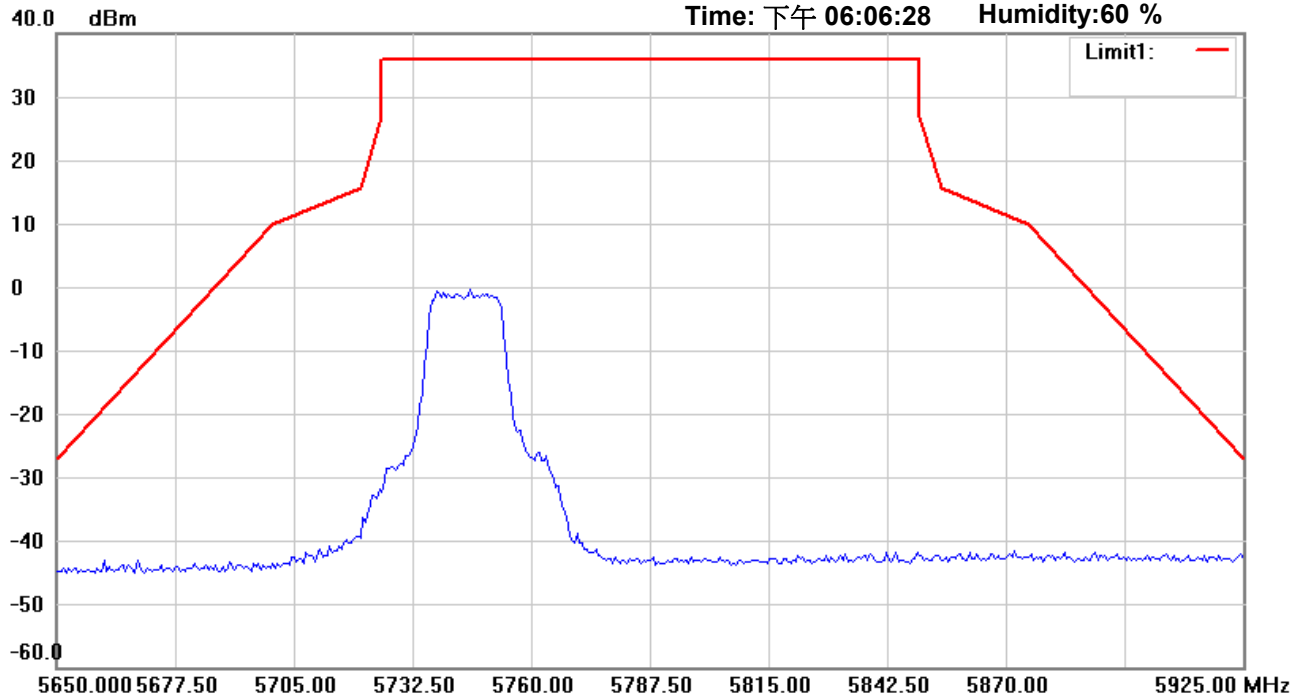

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:20:39

Humidity: 60 %

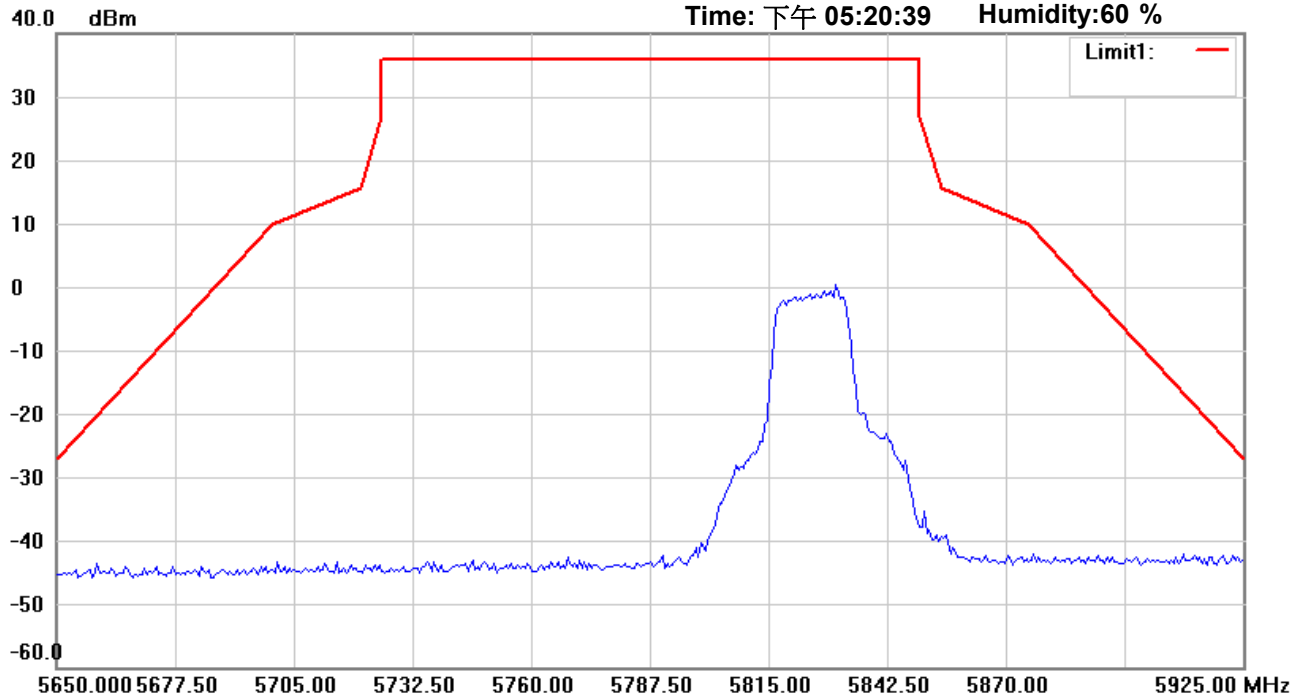

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 07:08:56

Humidity: 60 %

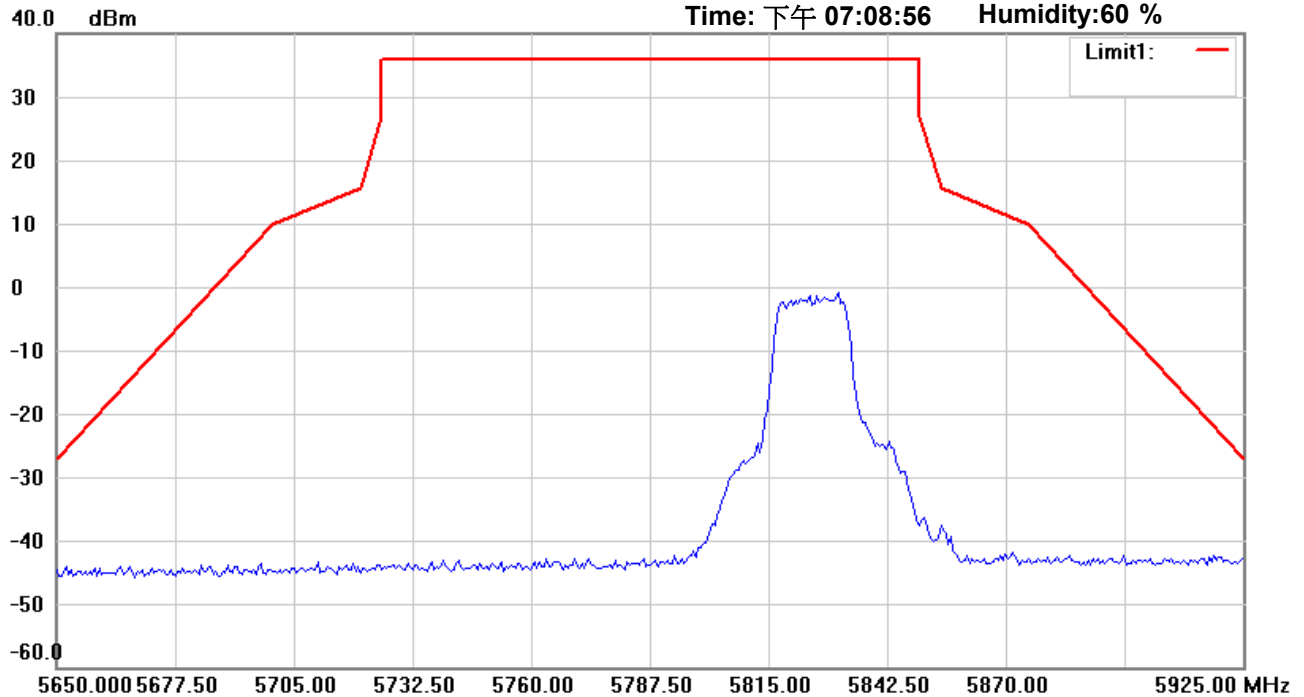

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: **Vertical**

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 05:13:47

Humidity: 60 %

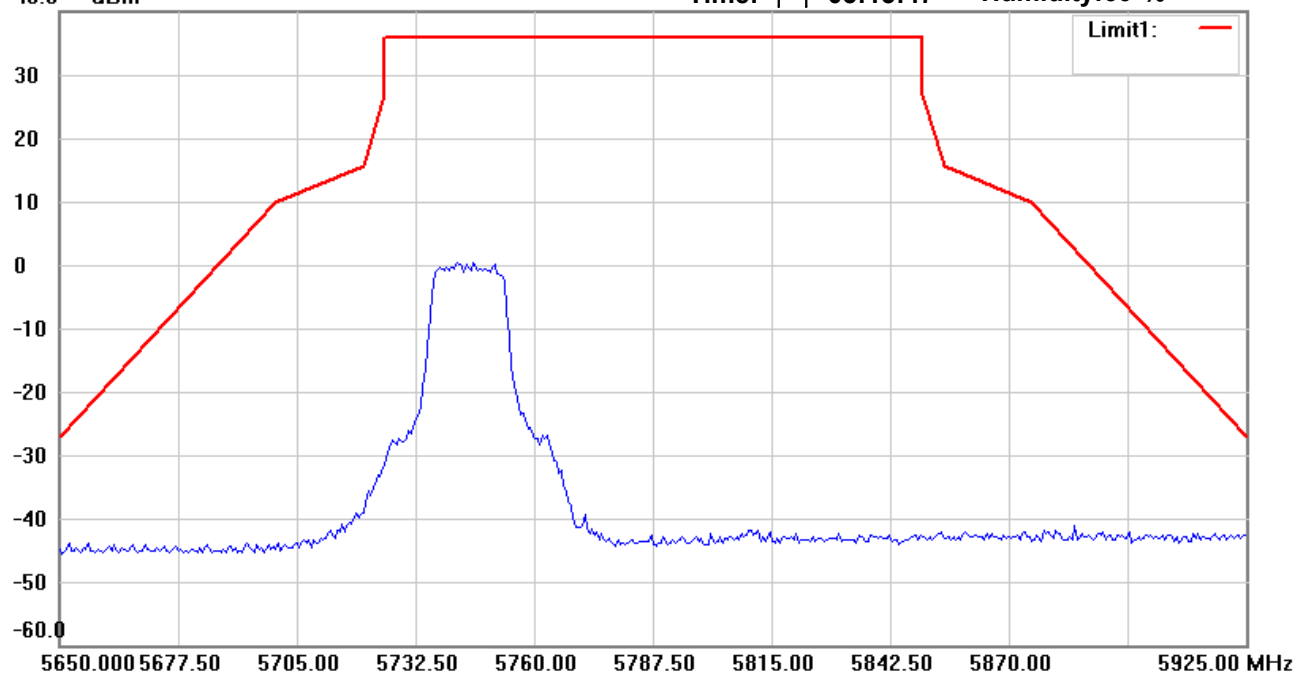

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #3


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 07:10:15

Humidity: 60 %

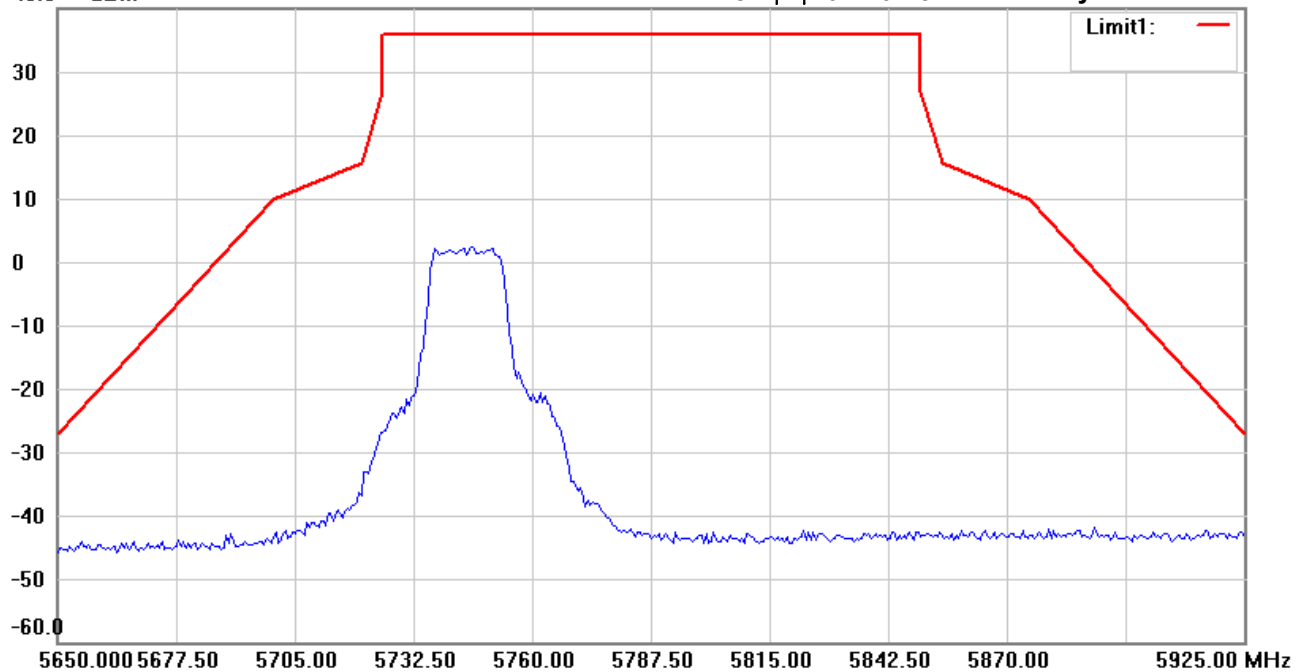

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:21:42

Humidity: 60 %

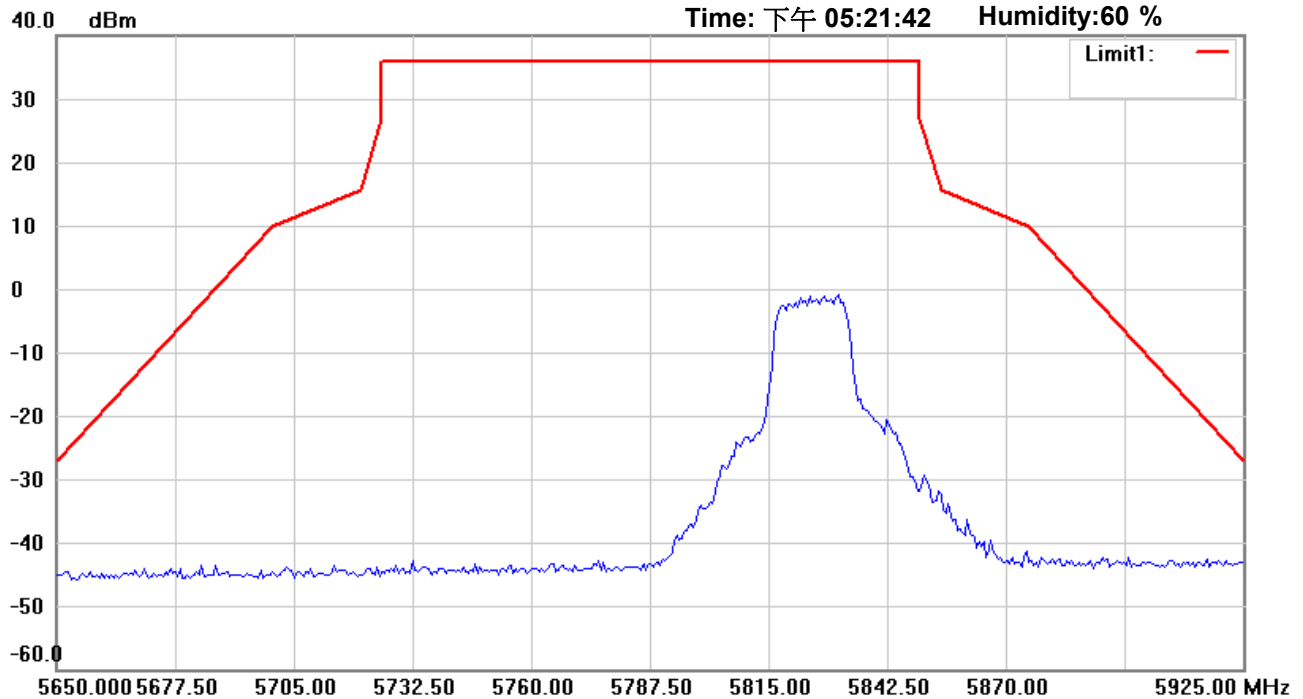

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 07:11:38

Humidity: 60 %

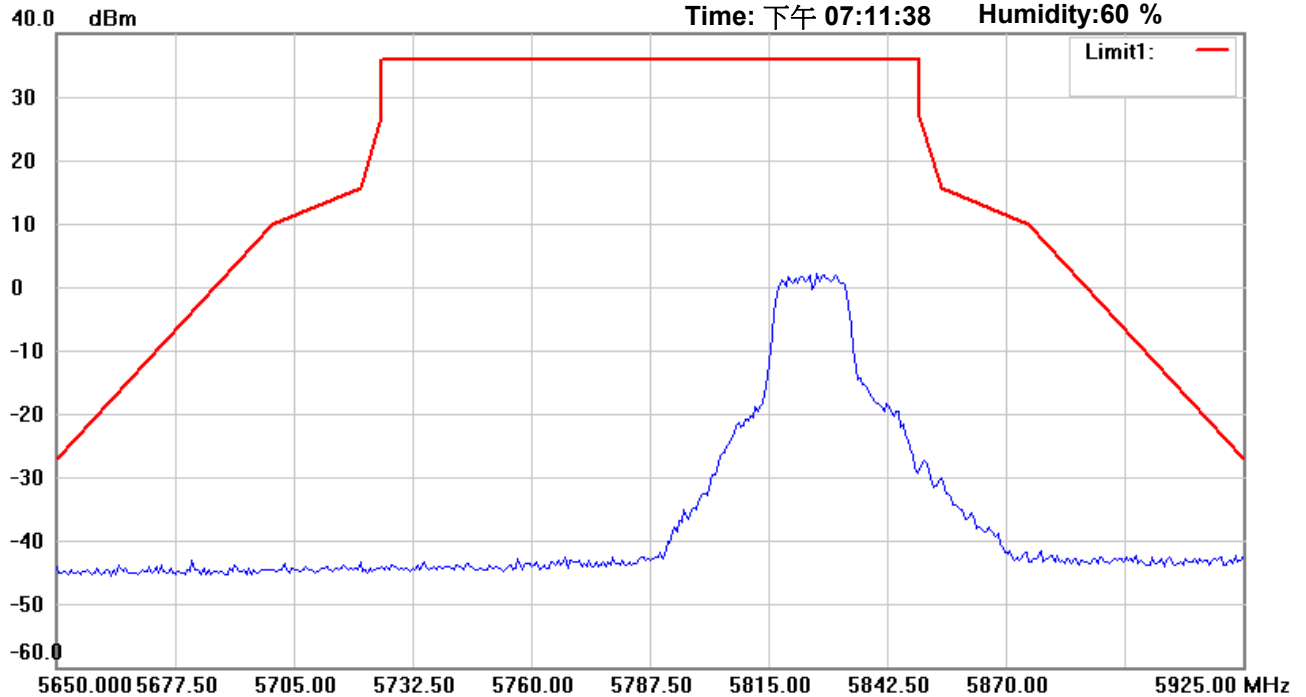

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 05:15:05

Humidity: 60 %

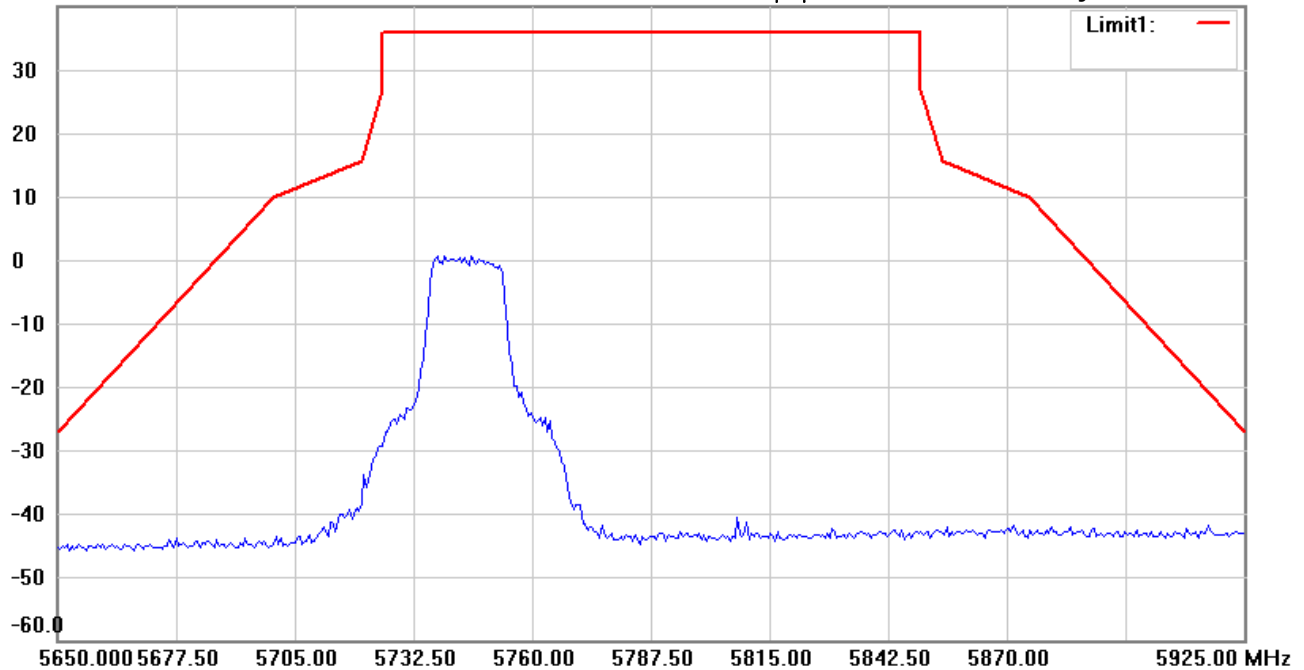

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 07:13:10

Humidity: 60 %

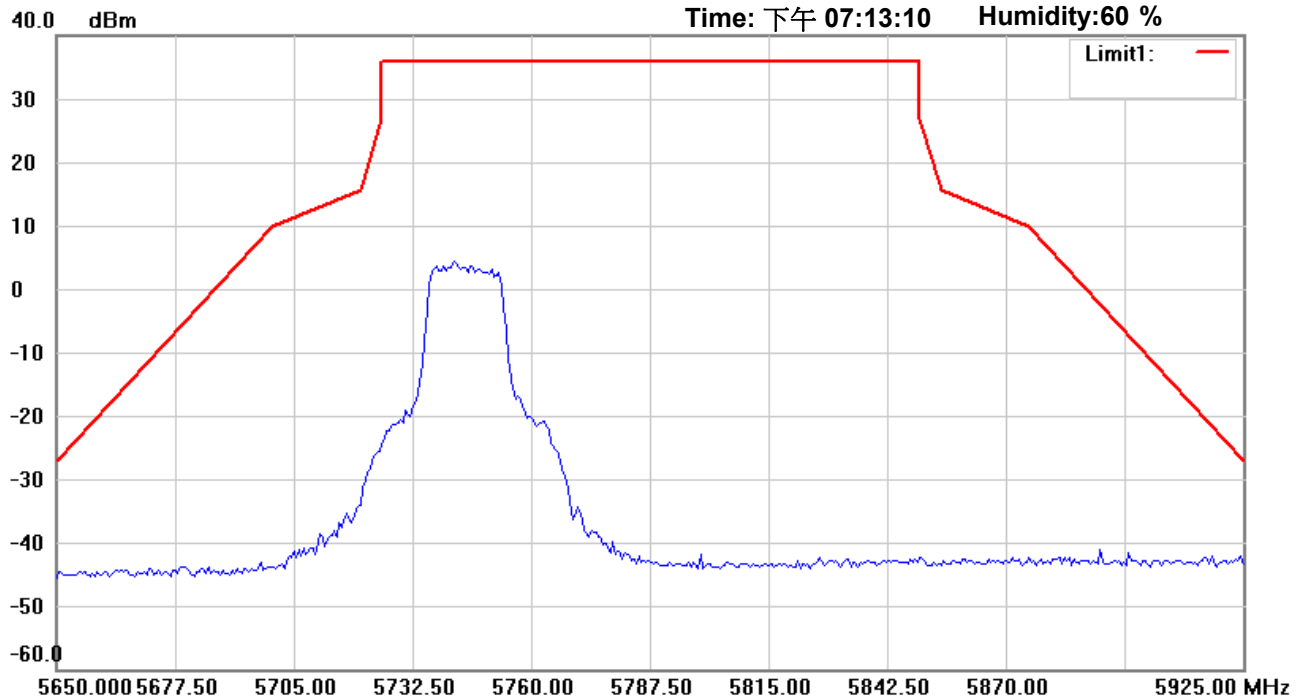

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:16:44

Humidity: 60 %

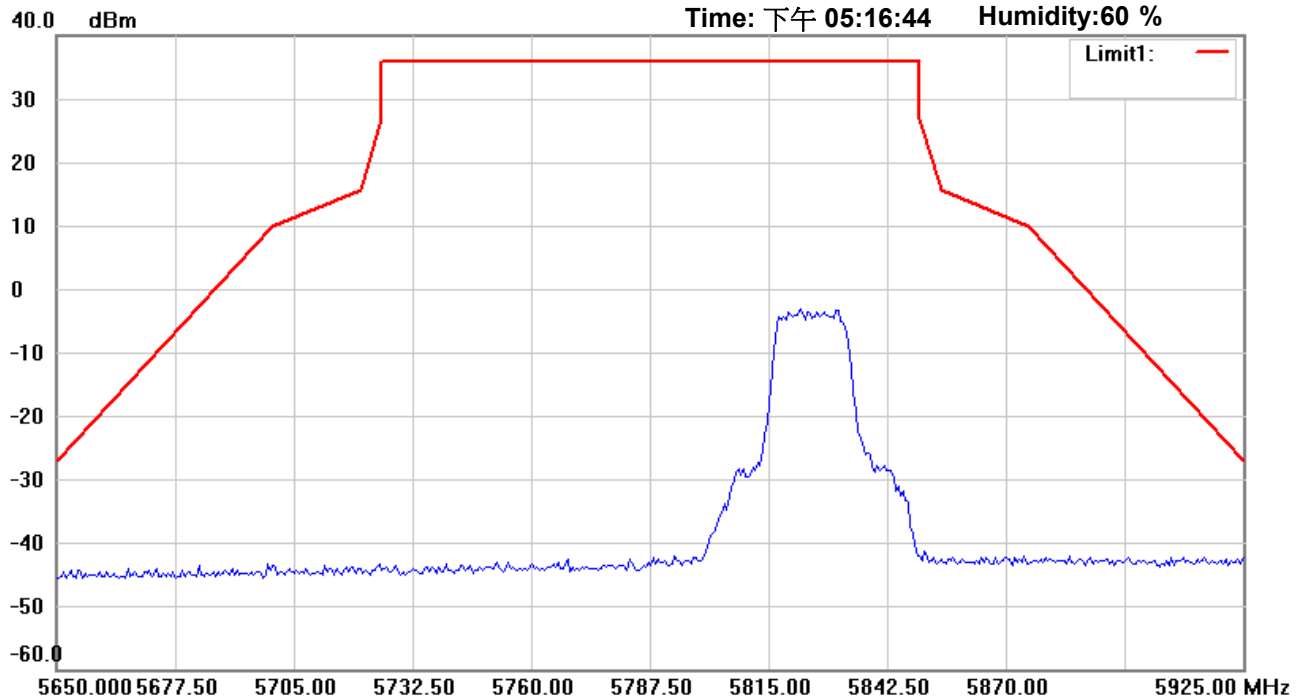

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 07:14:41

Humidity: 60 %

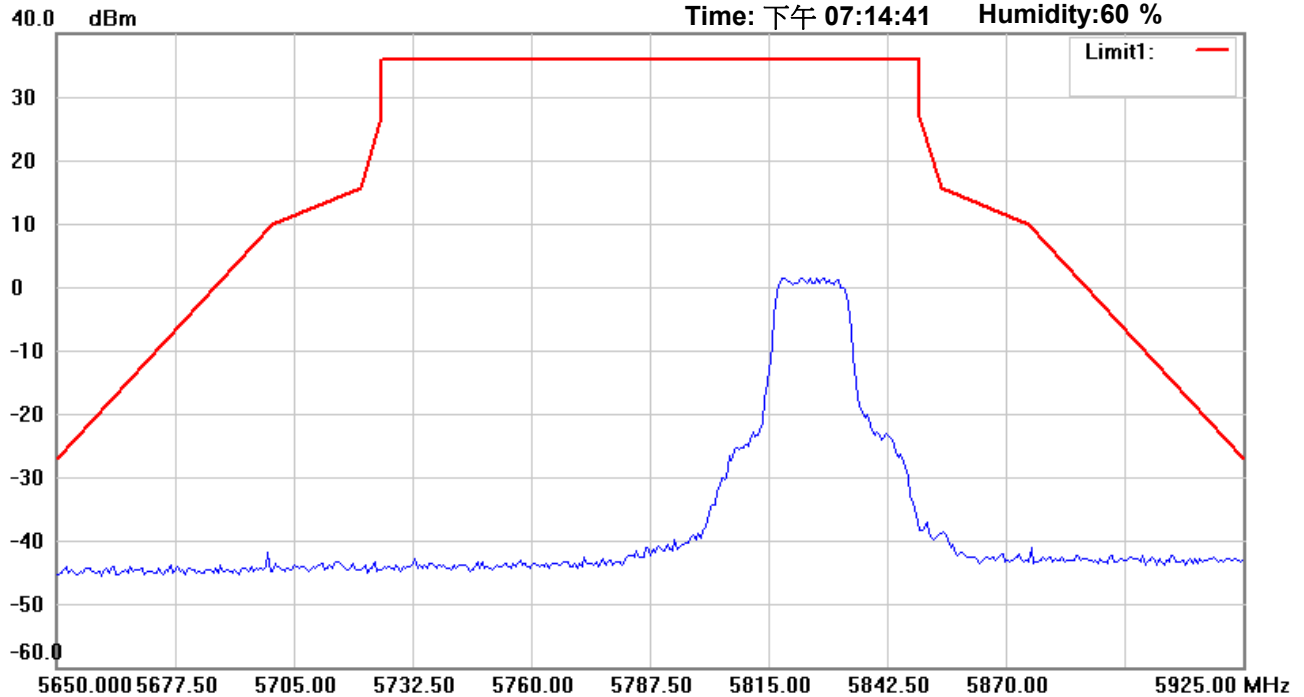

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 05:43:00

Humidity: 60 %

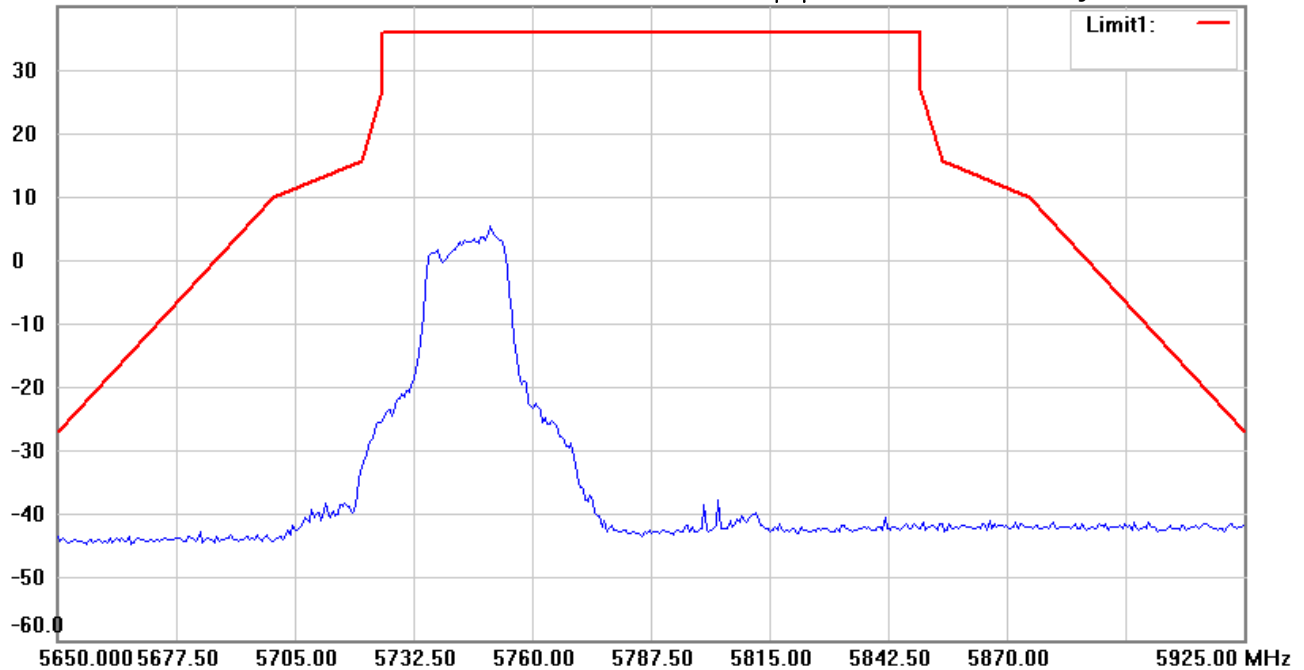

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:55:43

Humidity: 60 %

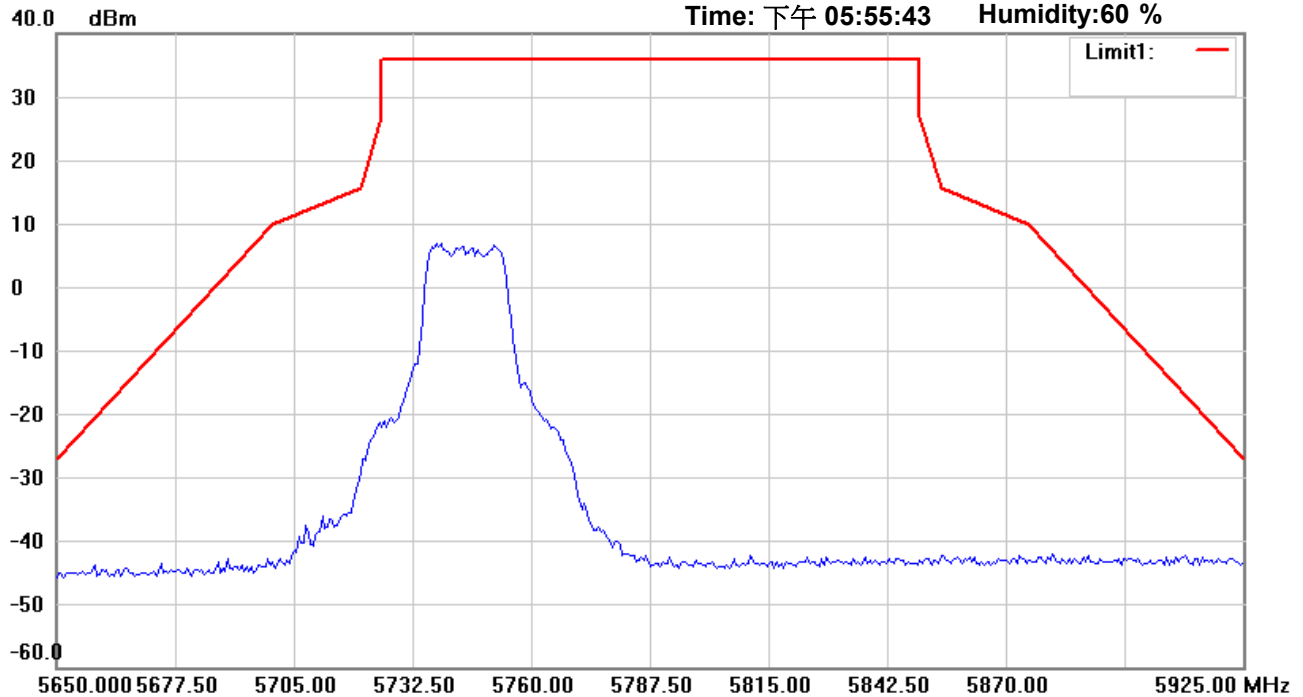

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:44:16

Humidity: 60 %

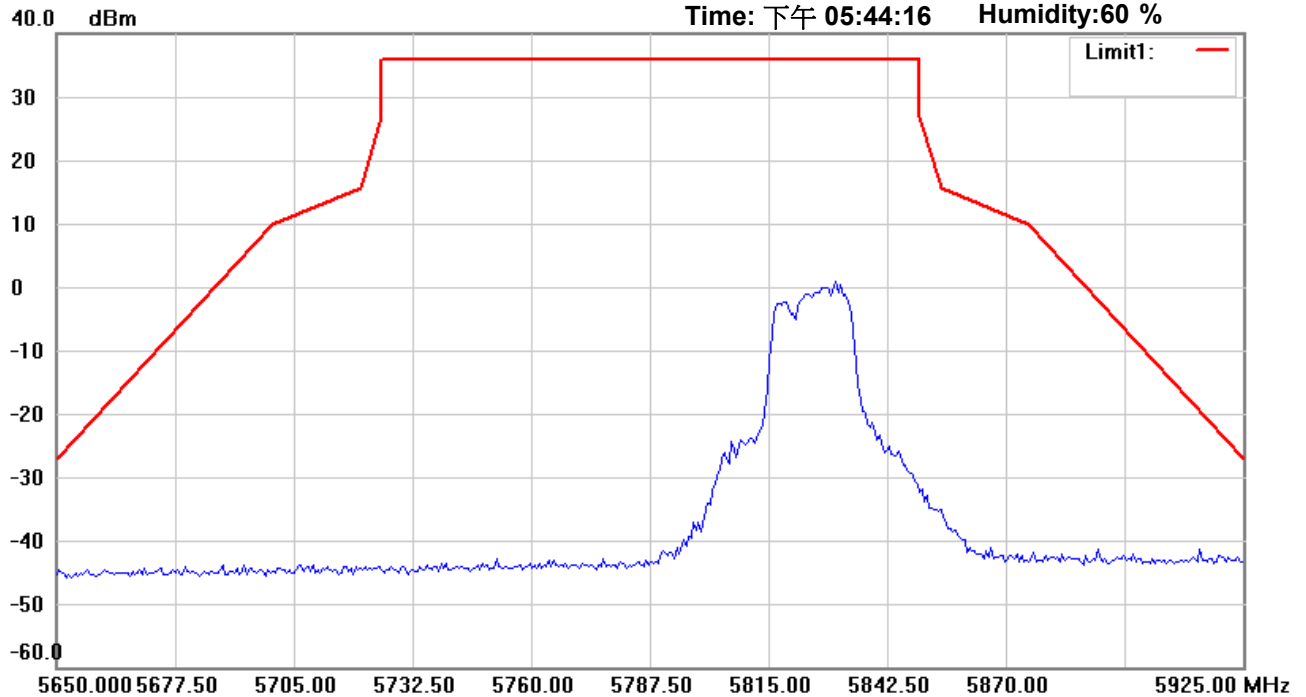

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:59:29

Humidity: 60 %

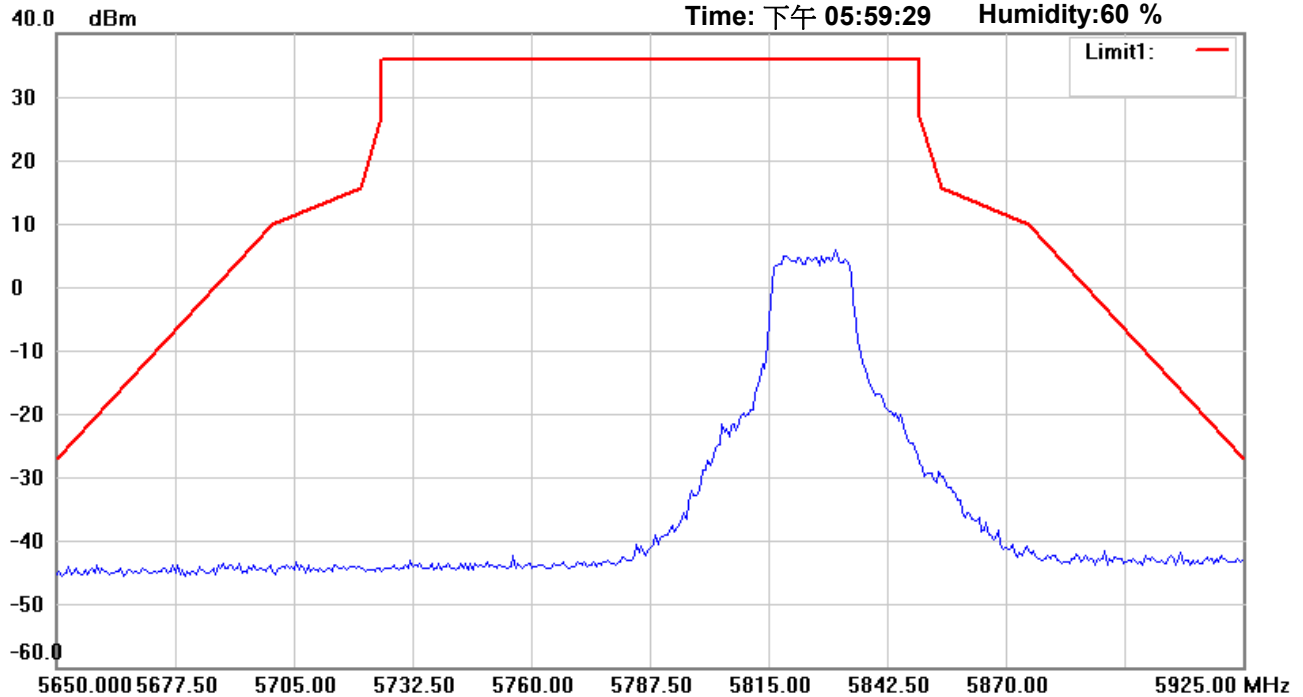

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #1

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:46:43

Humidity: 60 %

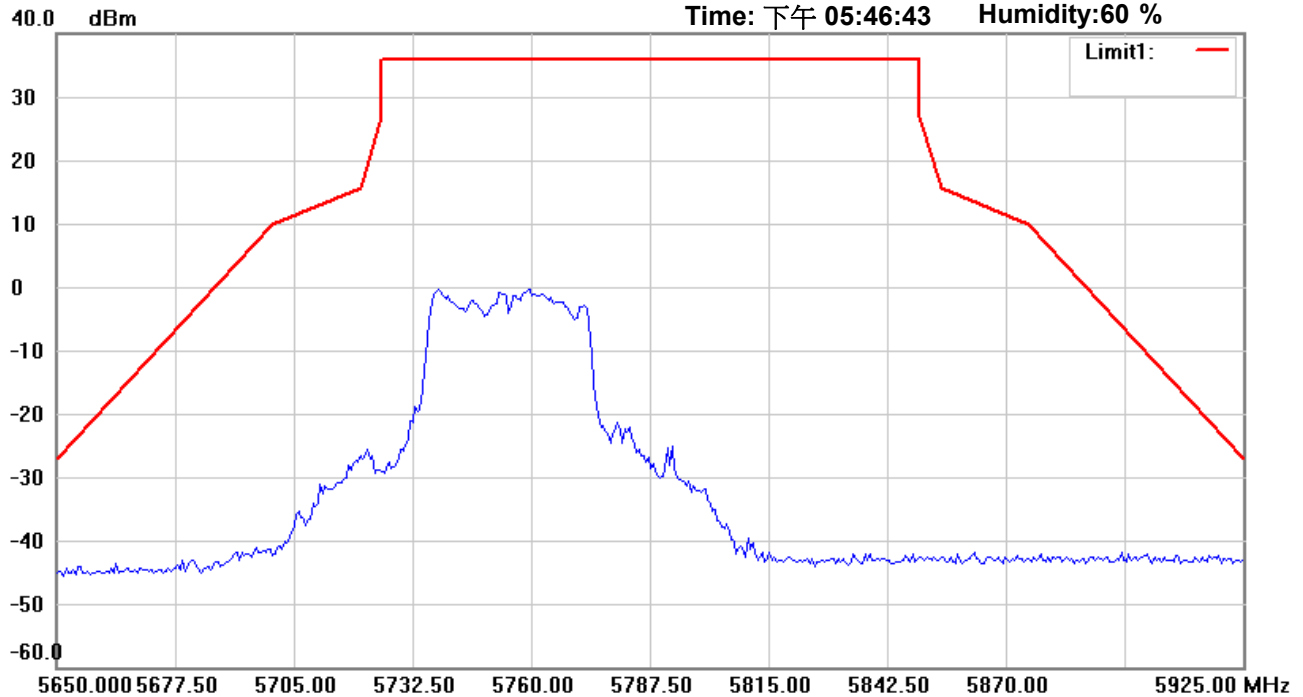

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH151

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:52:28

Humidity: 60 %

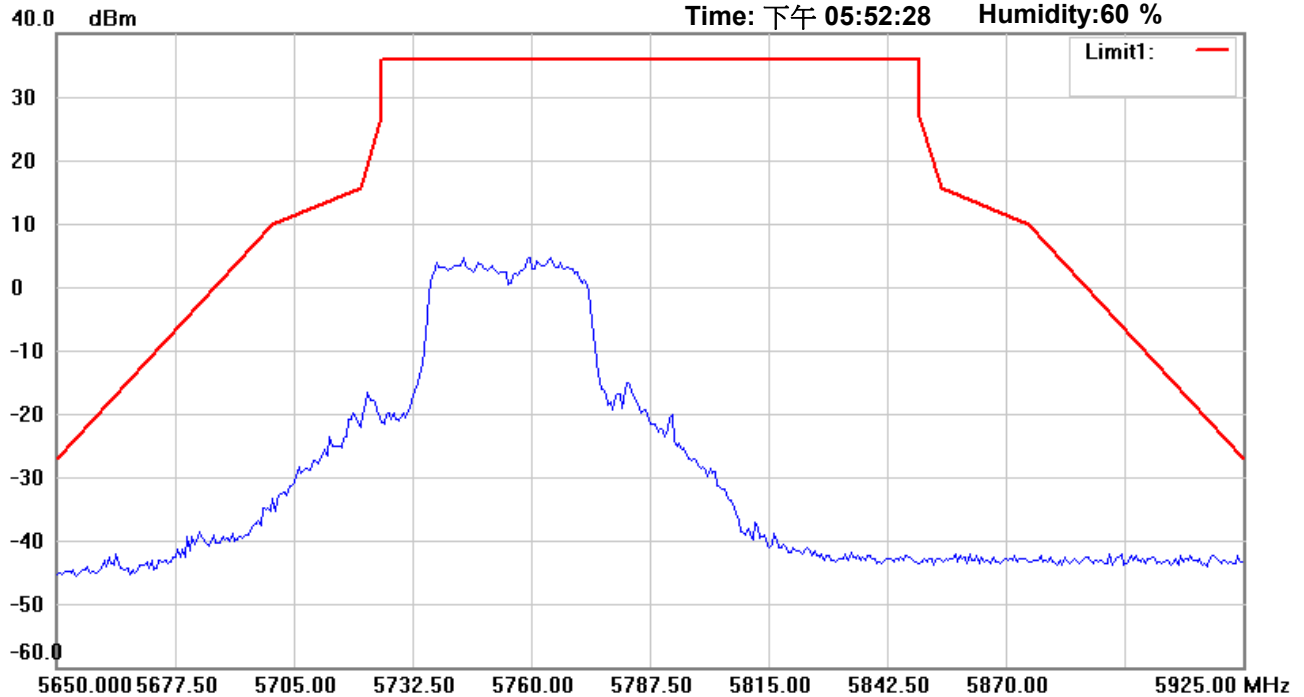

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH151

Note :

Polarization: **Vertical**

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:48:15

Humidity: 60 %

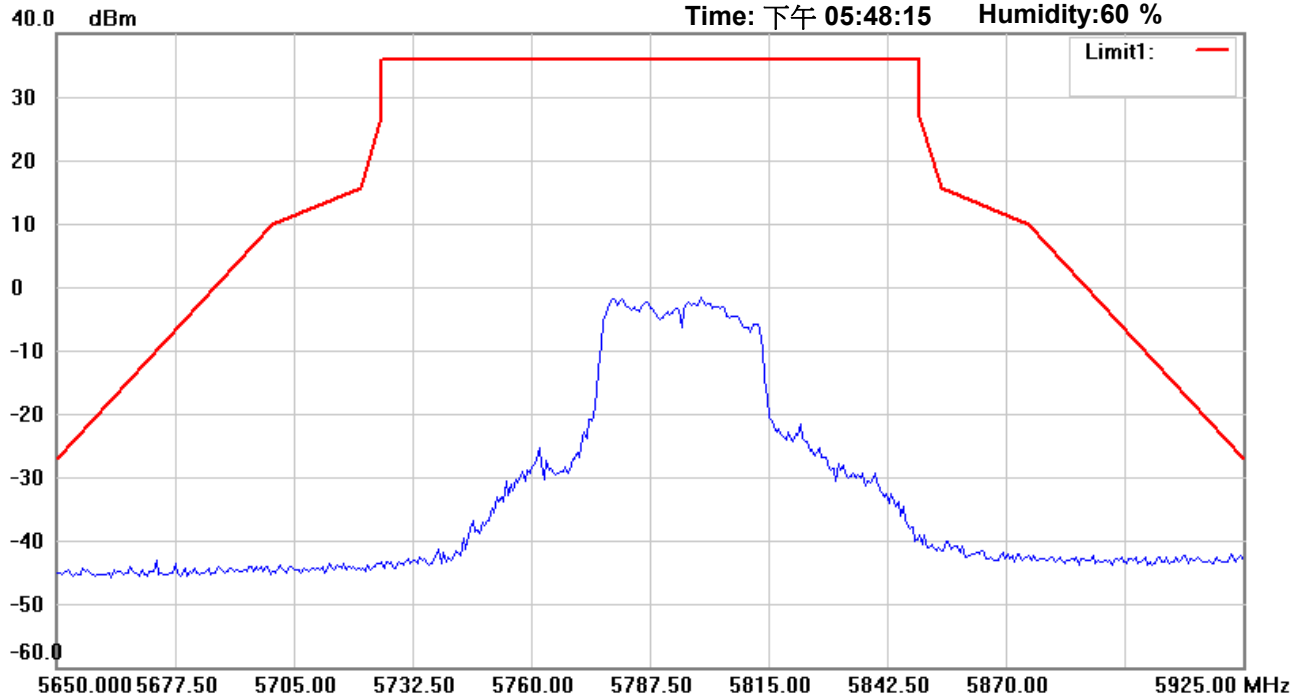

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH159

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #6

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:53:57

Humidity: 60 %

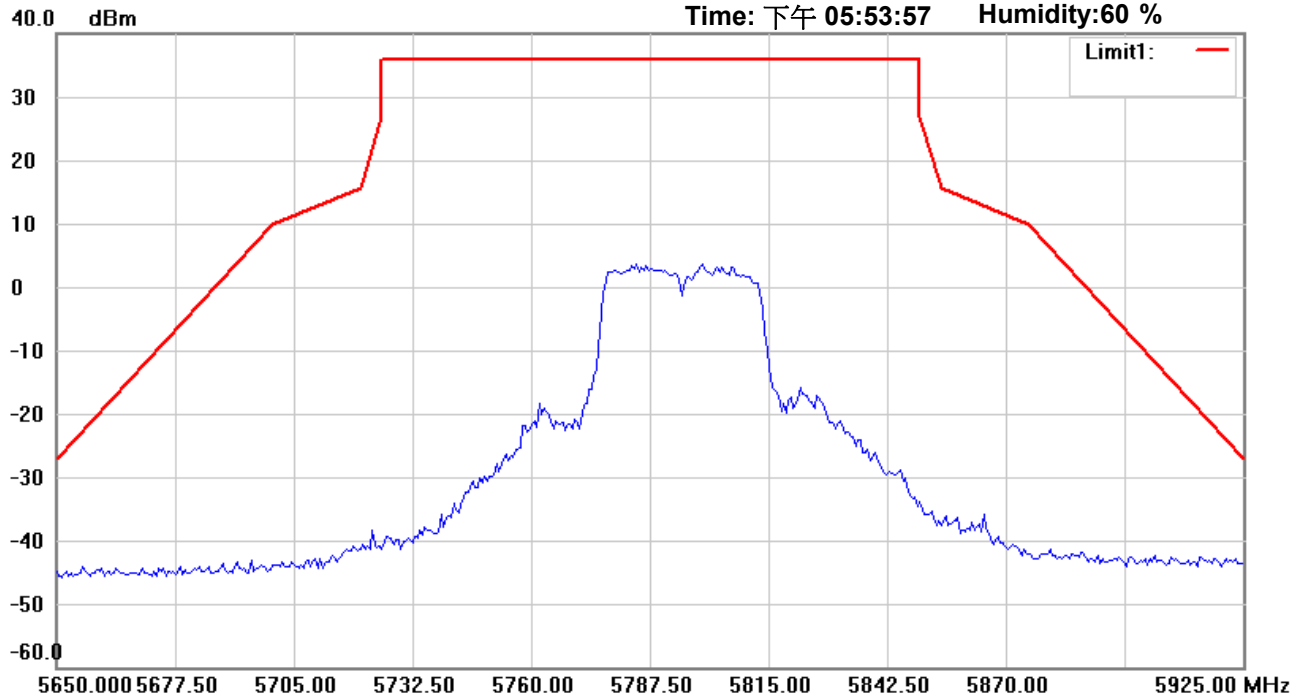

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH159

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #1

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:49:46

Humidity: 60 %

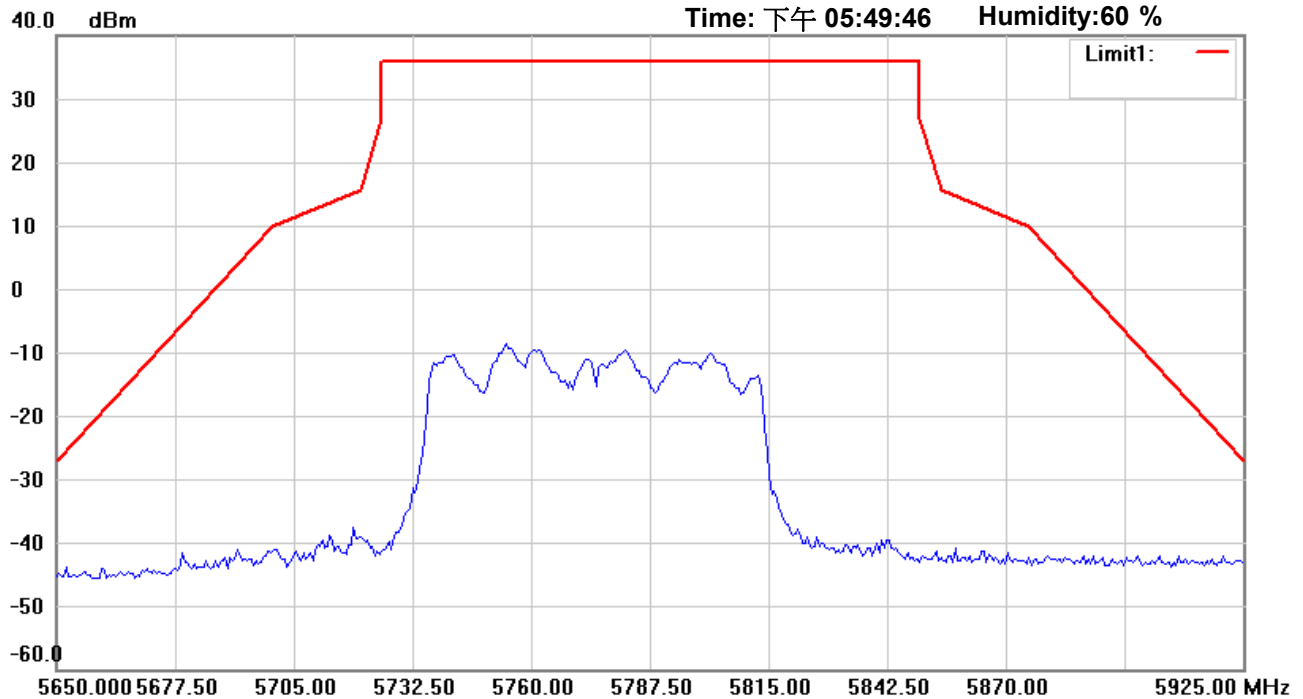

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11ac 80M TX CH155

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #2

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 05:50:54

Humidity: 60 %

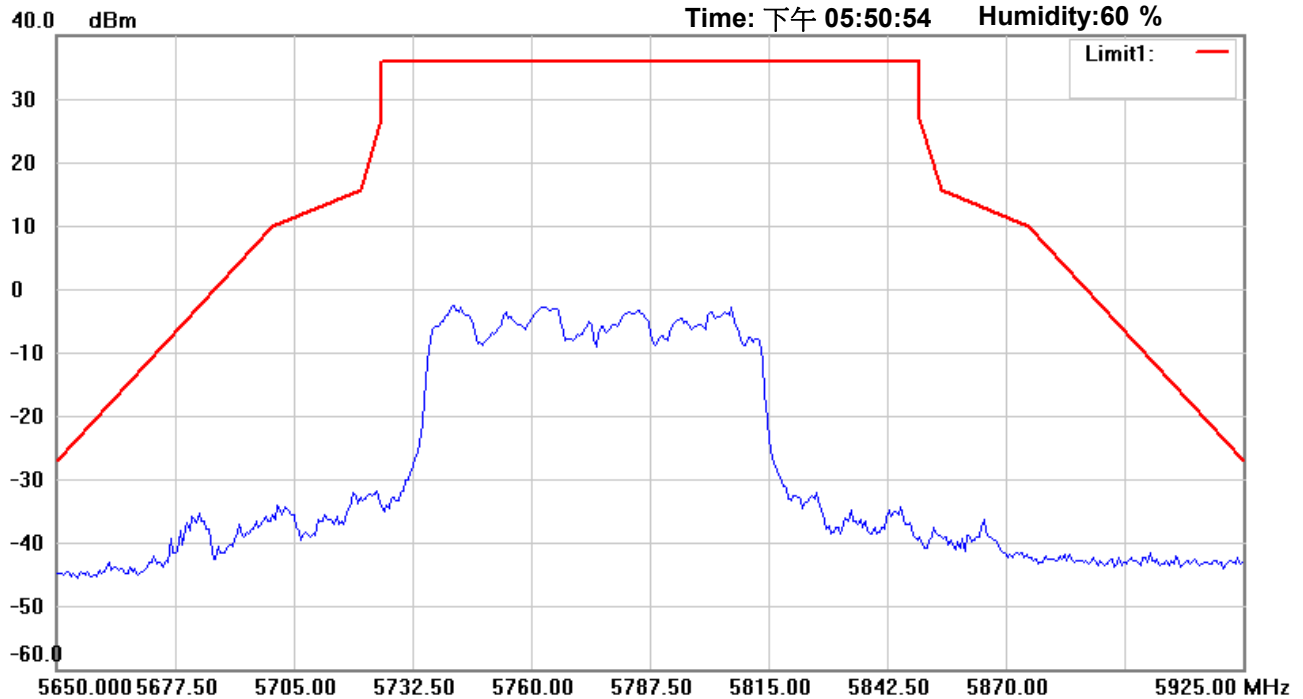

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11ac 80M TX CH155

Note :


Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin

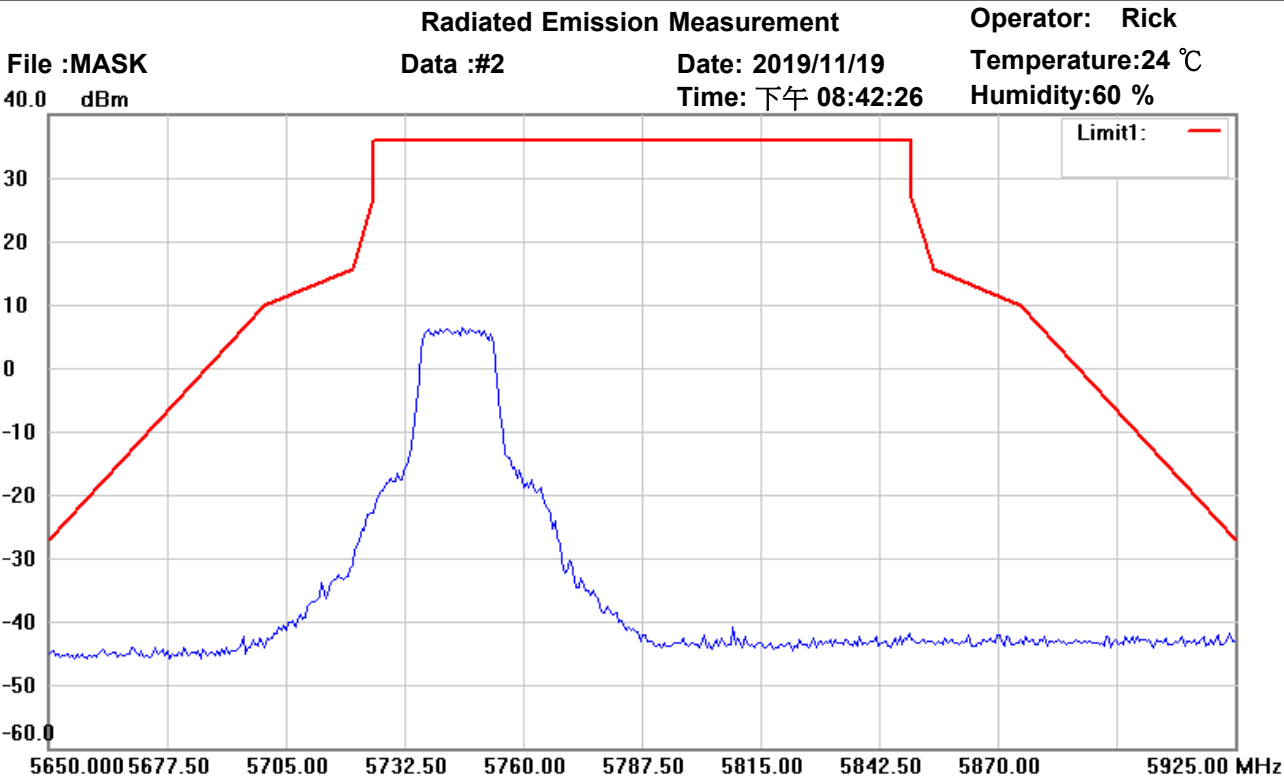

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: Horizontal

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:00:35

Humidity: 60 %

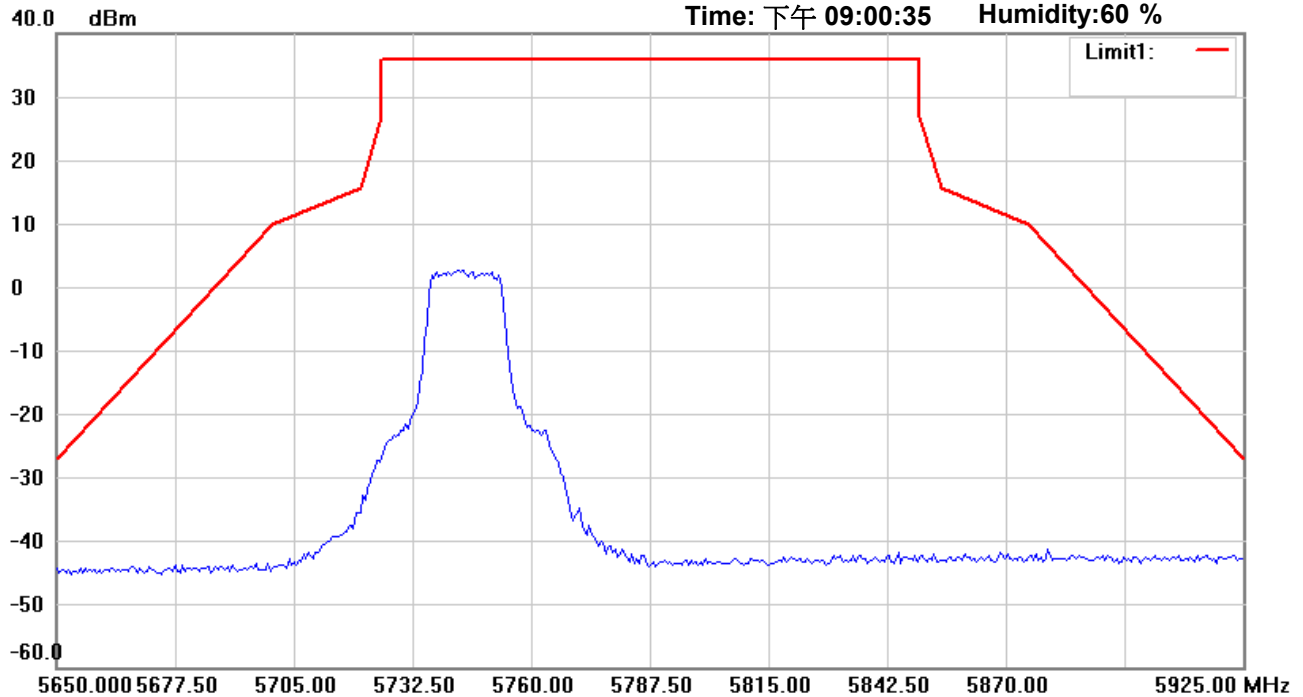

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:17:16

Humidity: 60 %

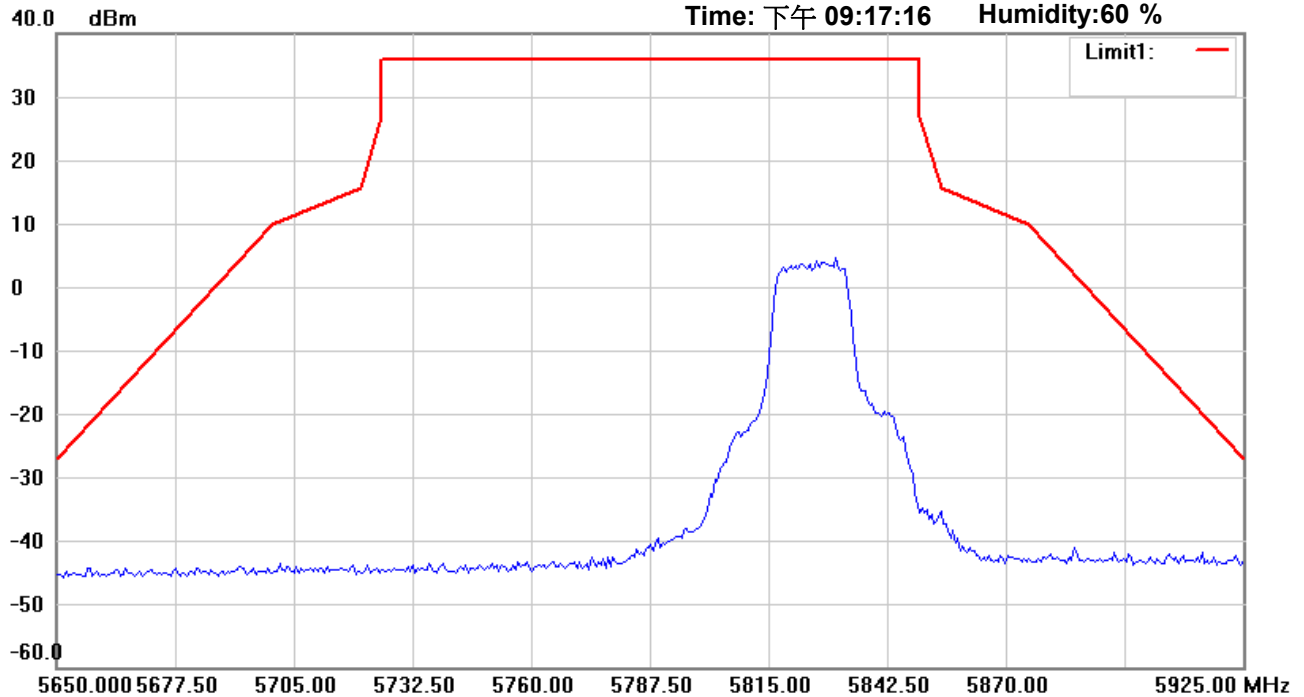

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:25:39

Humidity: 60 %

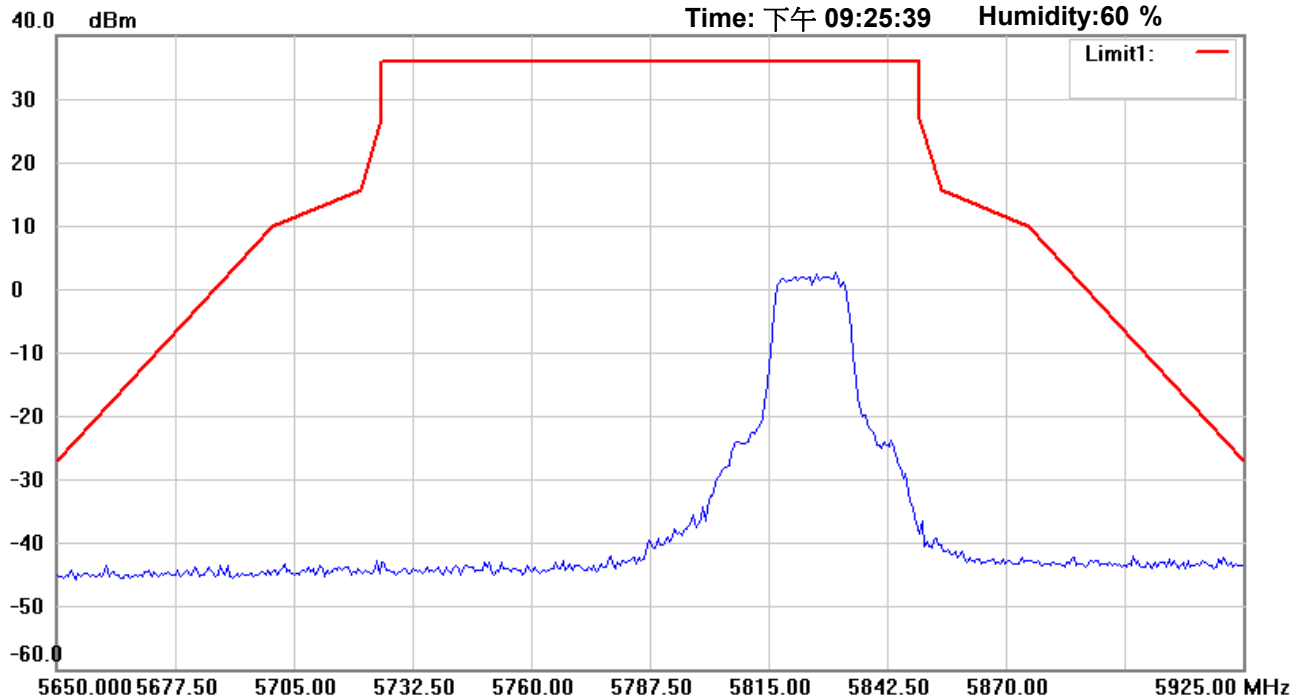

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:44:24

Humidity: 60 %

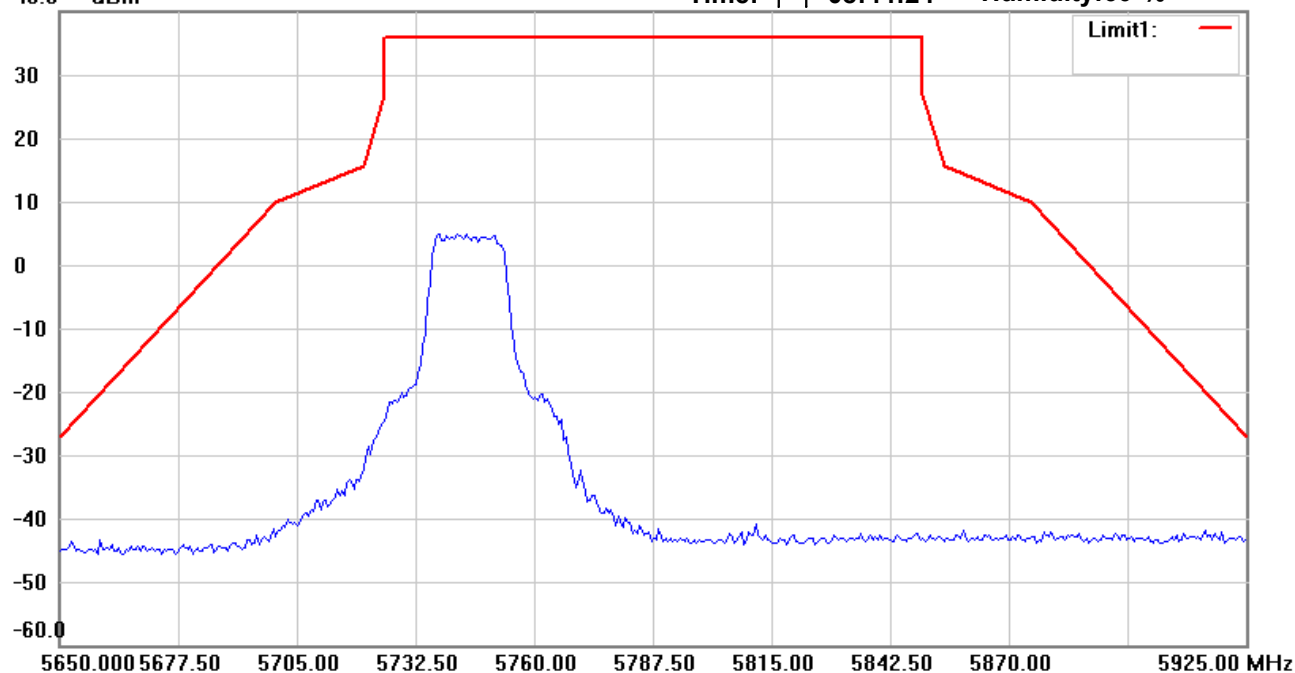

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #2


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 09:01:46

Humidity: 60 %

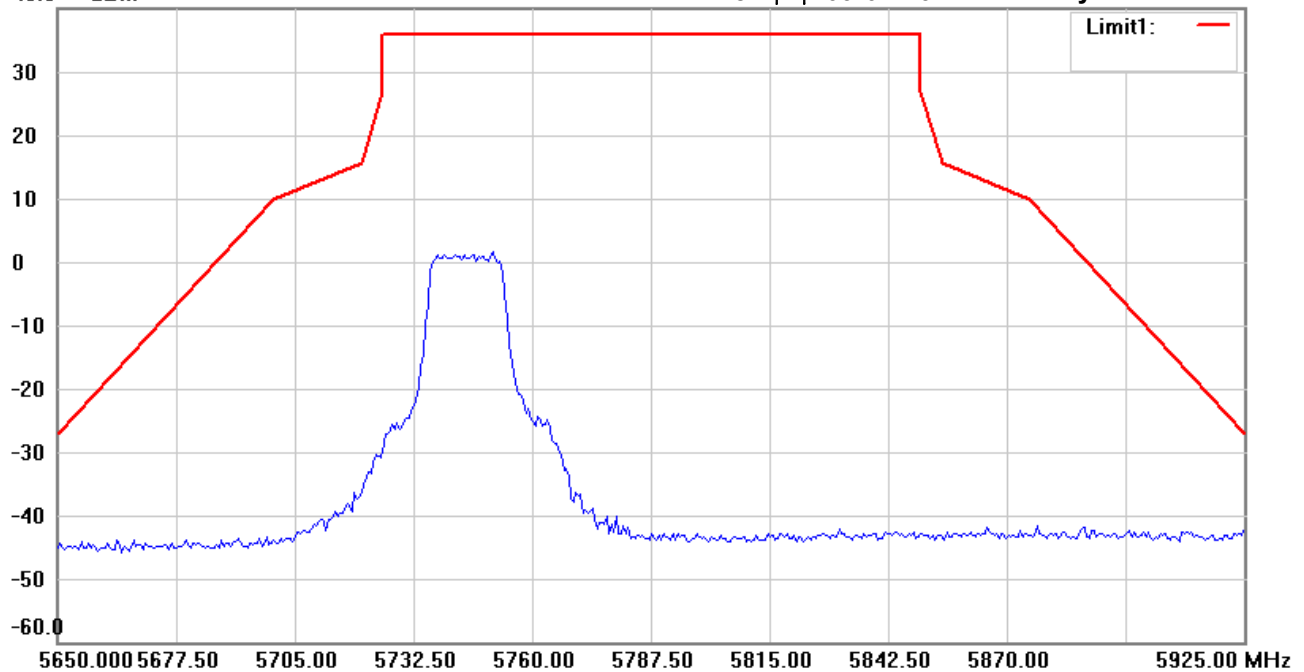

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File :MASK


Data :#3

Date: 2019/11/19

Temperature:24 °C

Time: 下午 09:16:17

Humidity:60 %

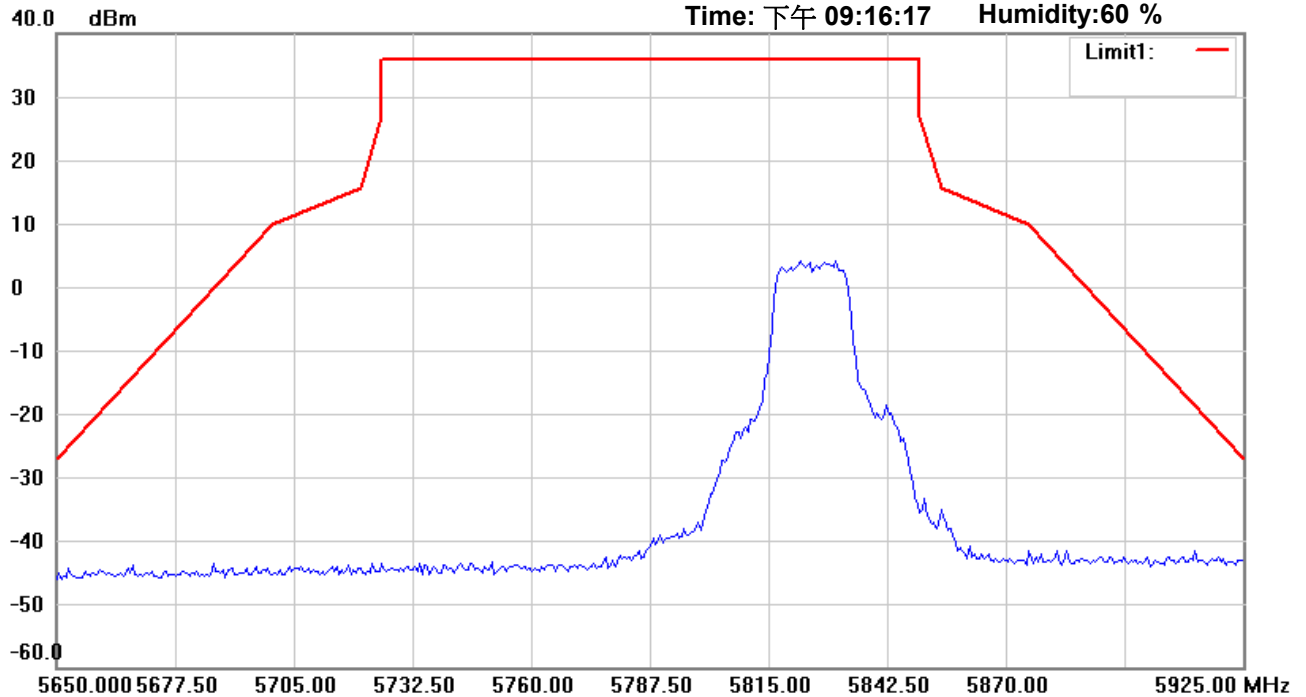

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:27:21

Humidity: 60 %

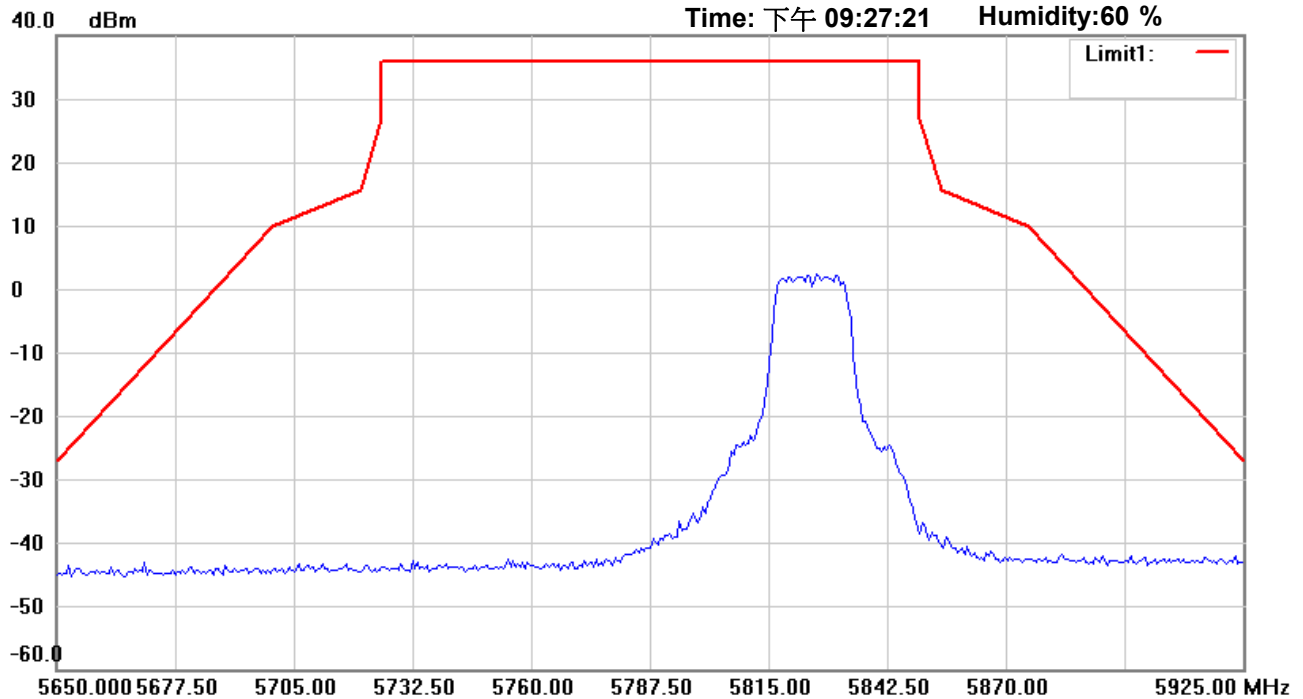

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:45:18

Humidity: 60 %

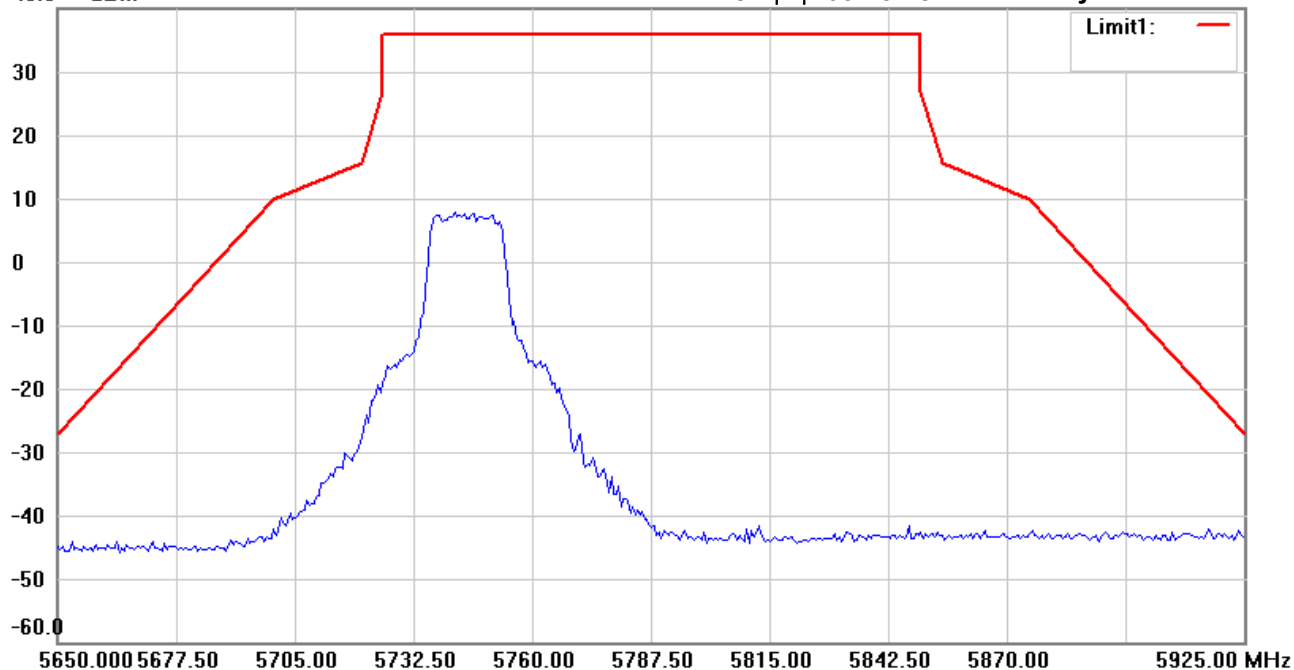

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #2

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:04:15

Humidity: 60 %

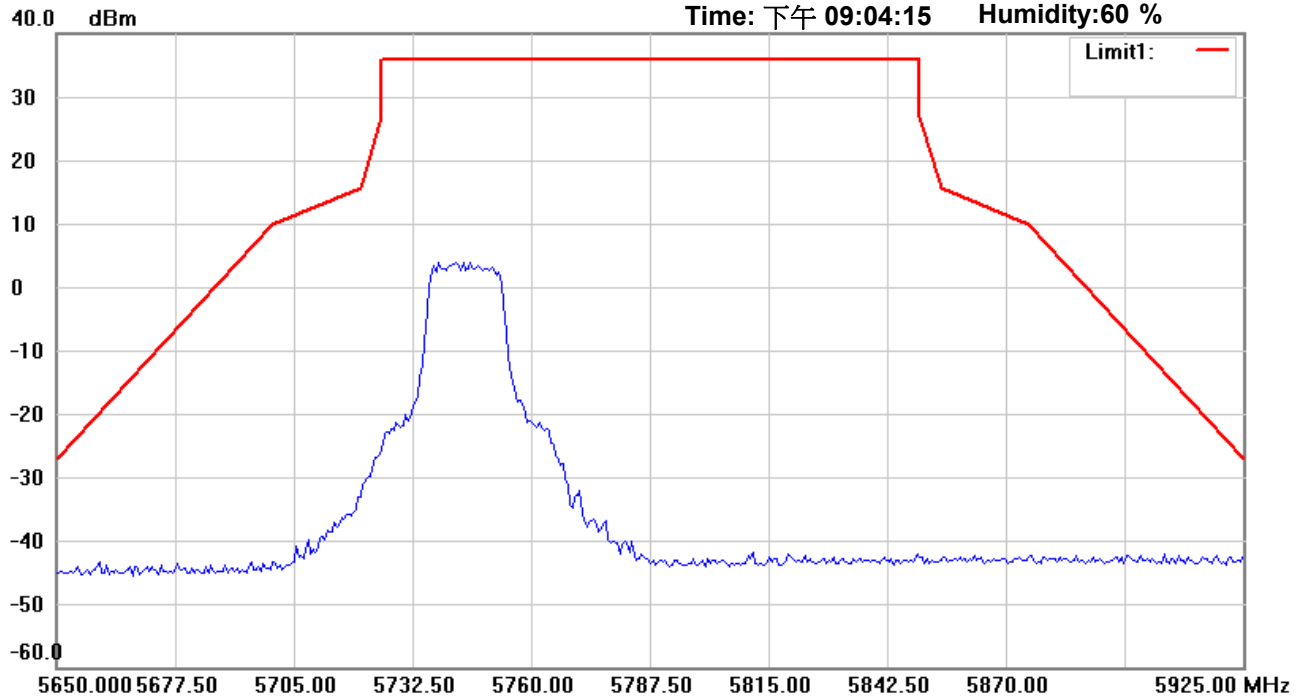

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:14:57

Humidity: 60 %

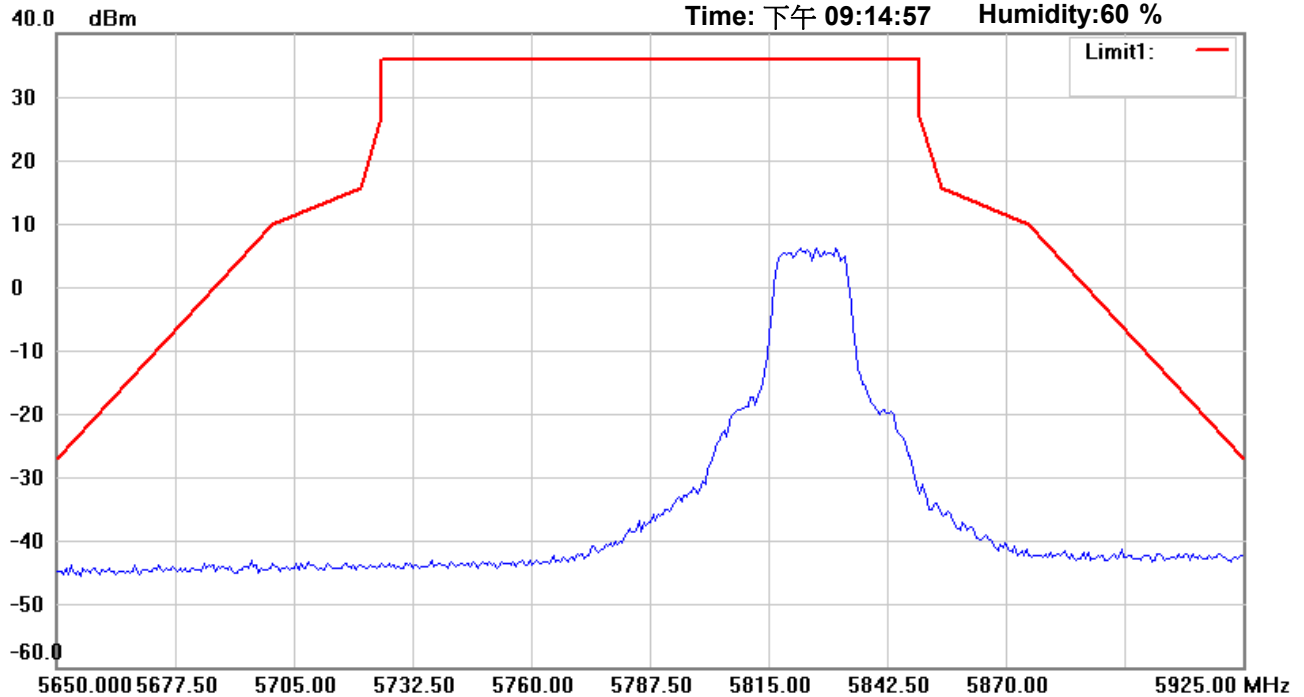

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:28:29

Humidity: 60 %

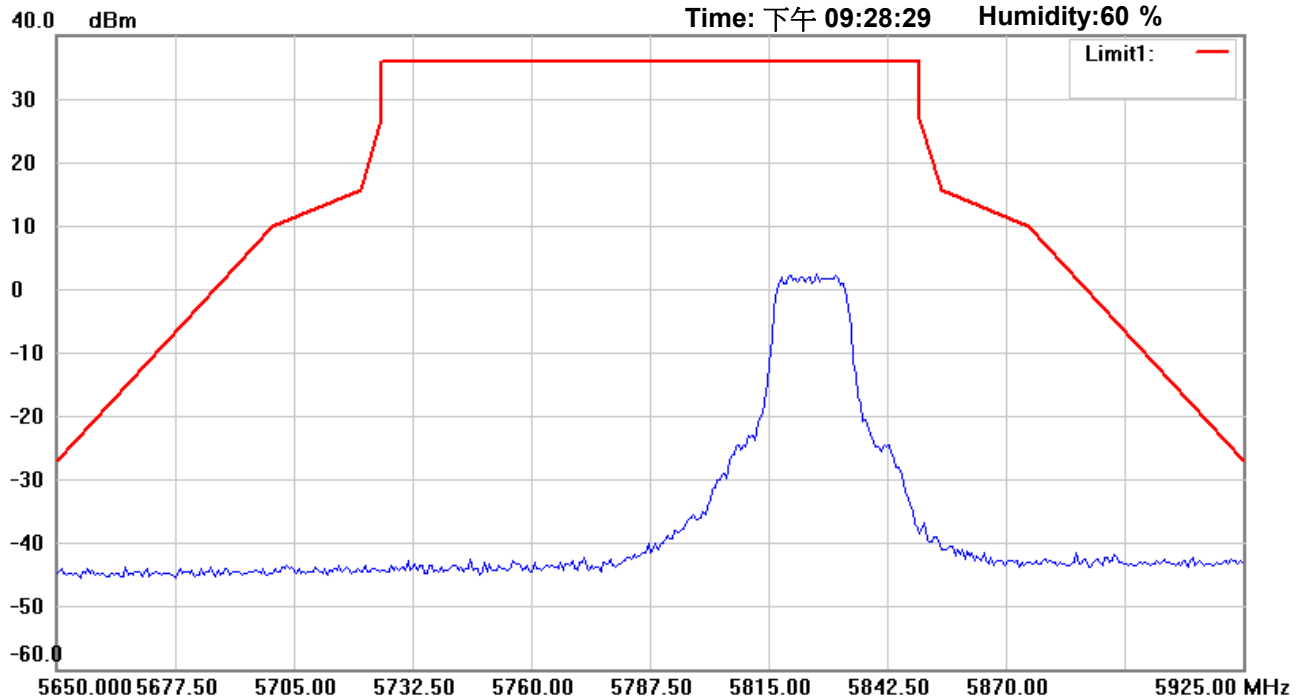

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: **Vertical**

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:46:07

Humidity: 60 %

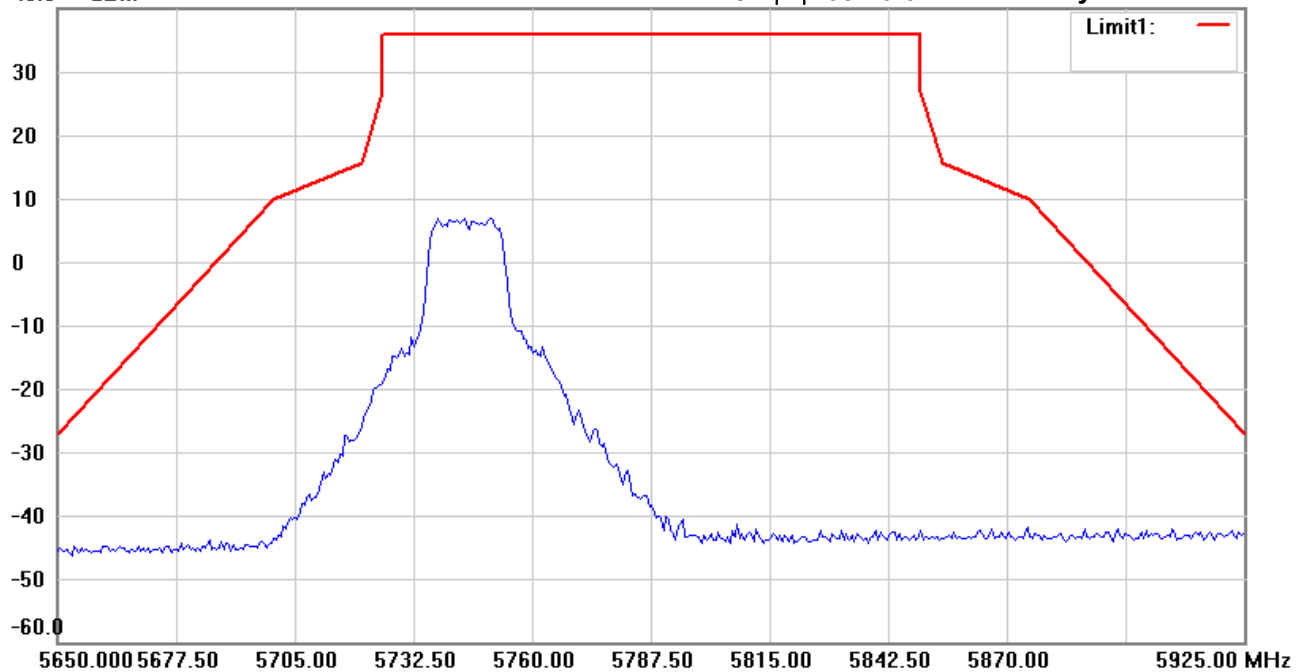

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #2

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:05:15

Humidity: 60 %

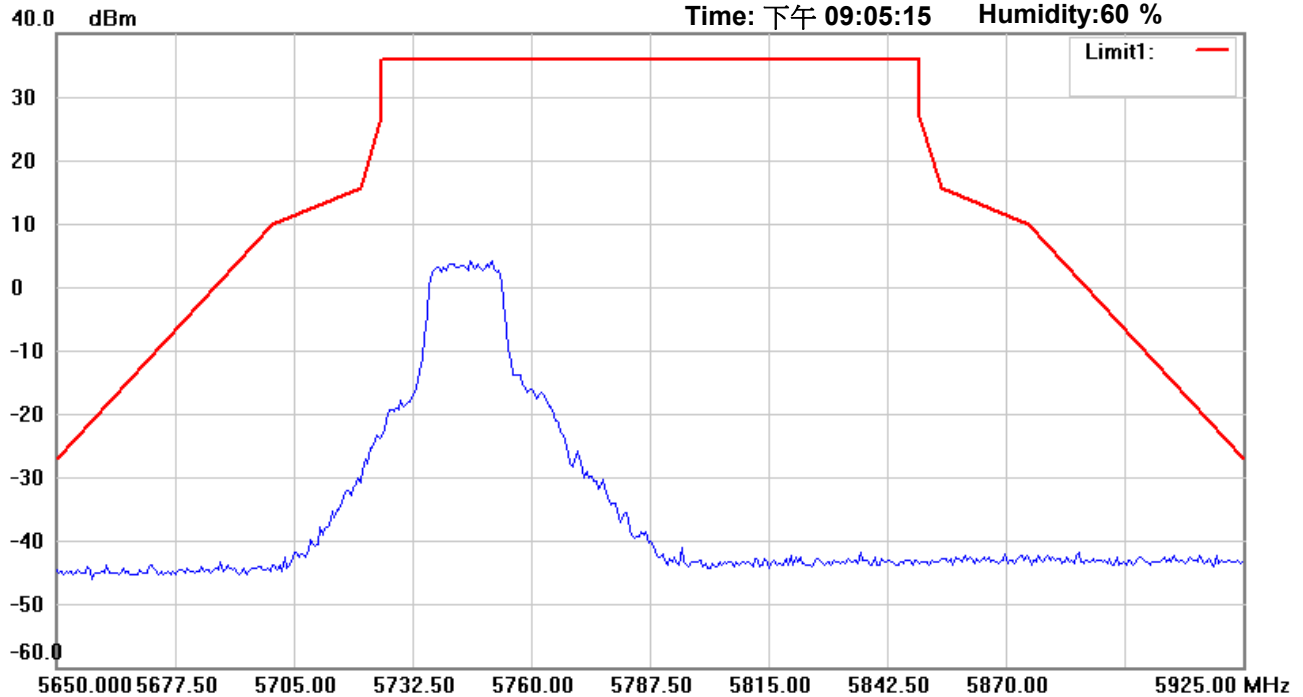

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH149

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:11:58

Humidity: 60 %

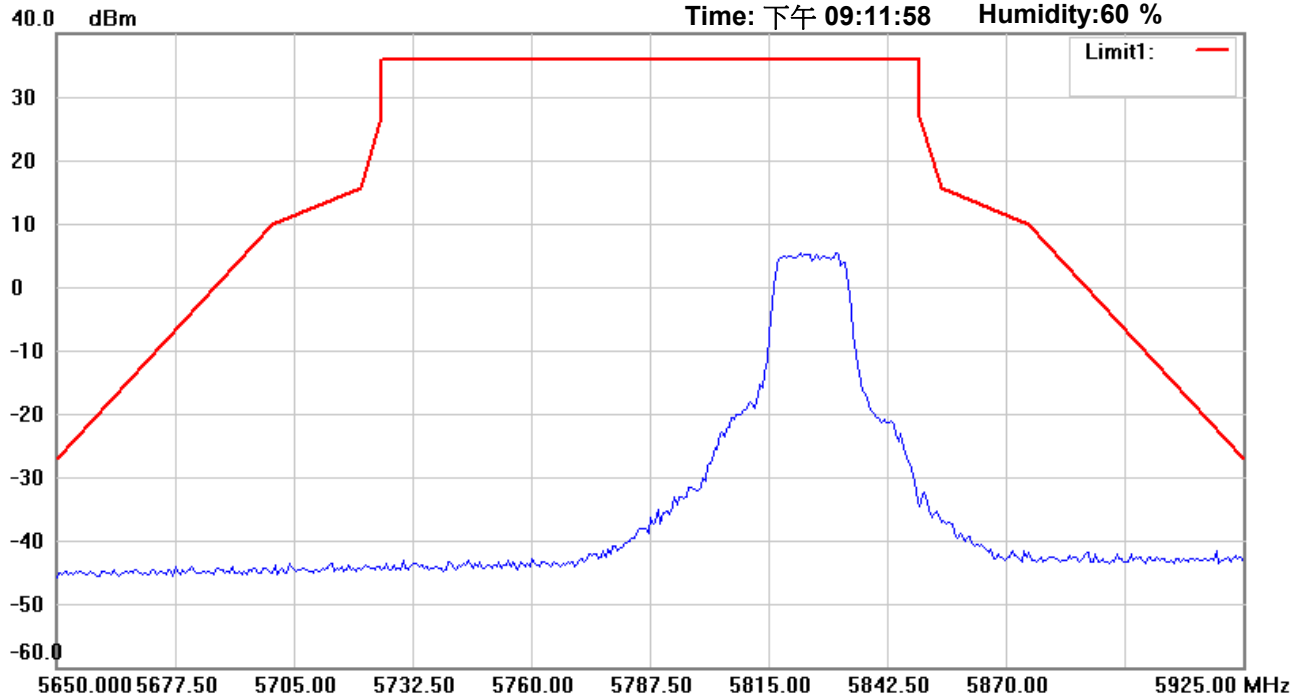

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:29:23

Humidity: 60 %

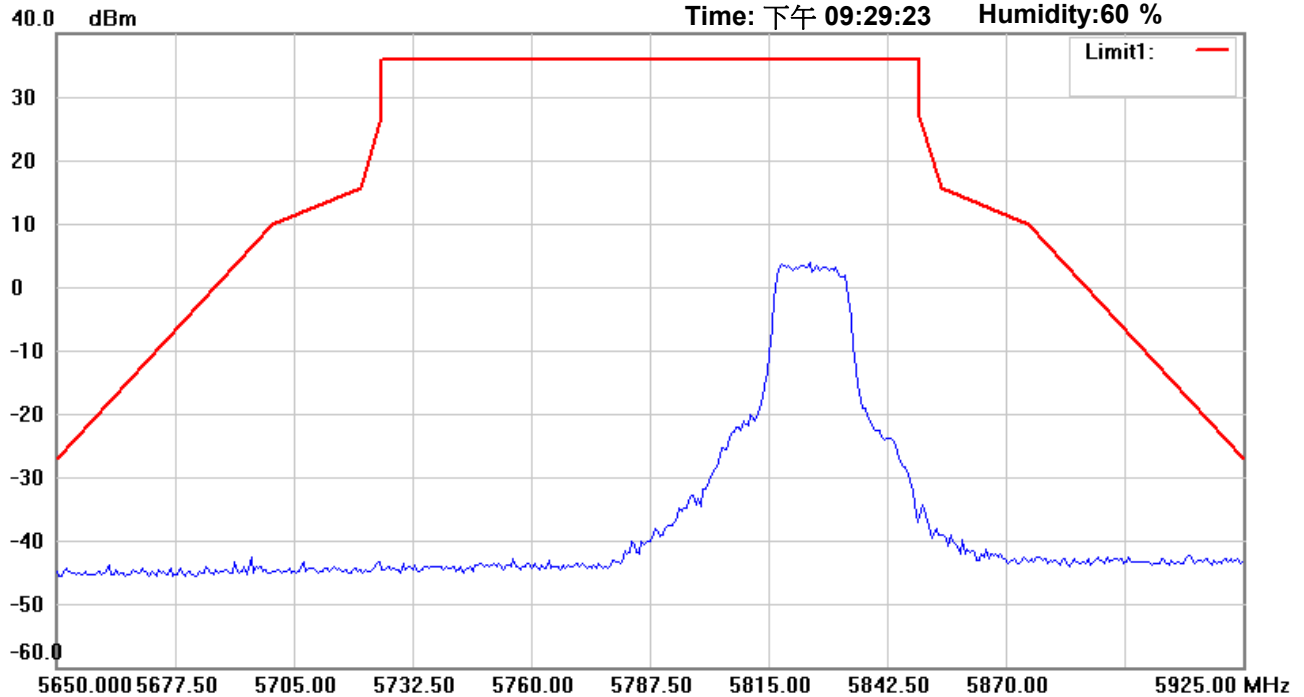

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11a TX CH165

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
 Tel: +886-2-6606-8877
 Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:47:45

Humidity: 60 %

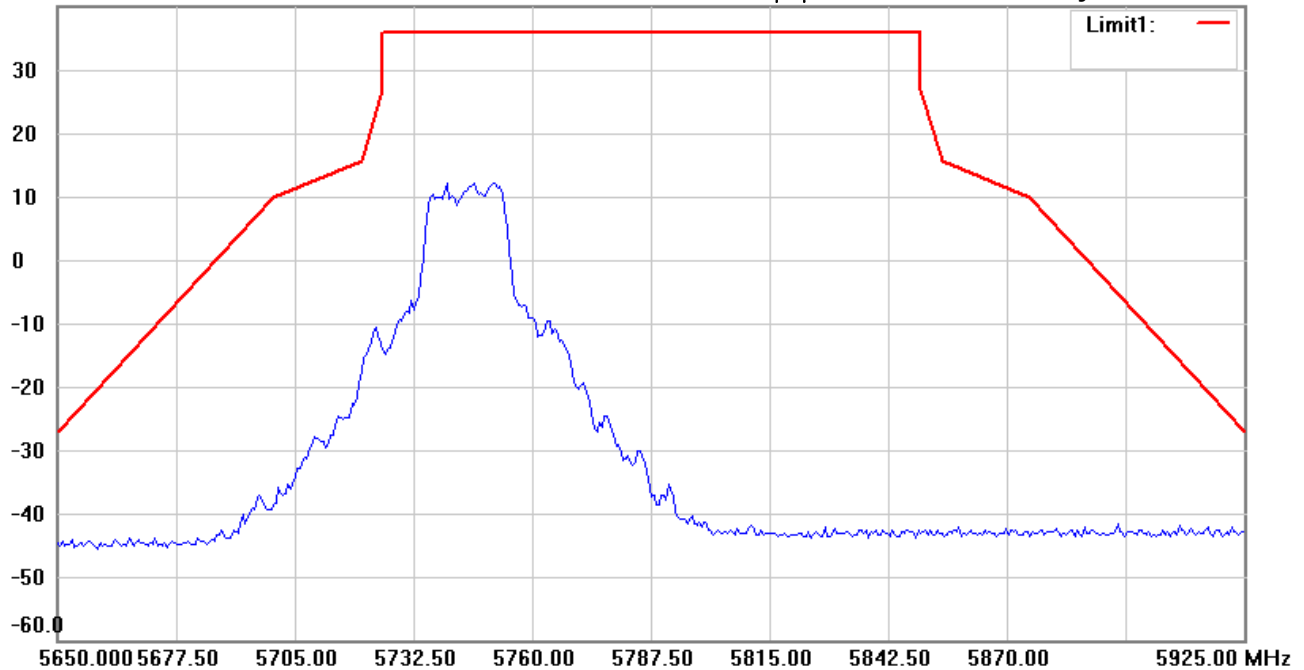

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH149

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #2

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 08:58:18

Humidity: 60 %

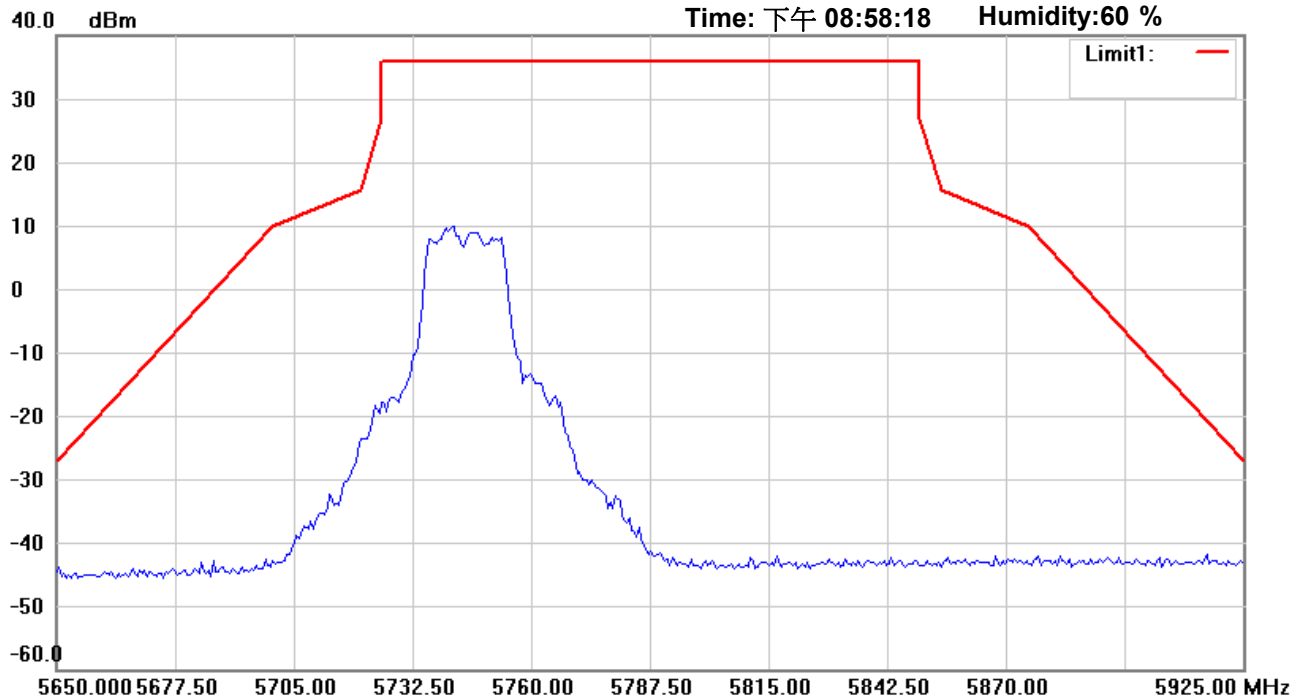

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH149

Note :

Polarization: **Vertical**

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:19:27

Humidity: 60 %

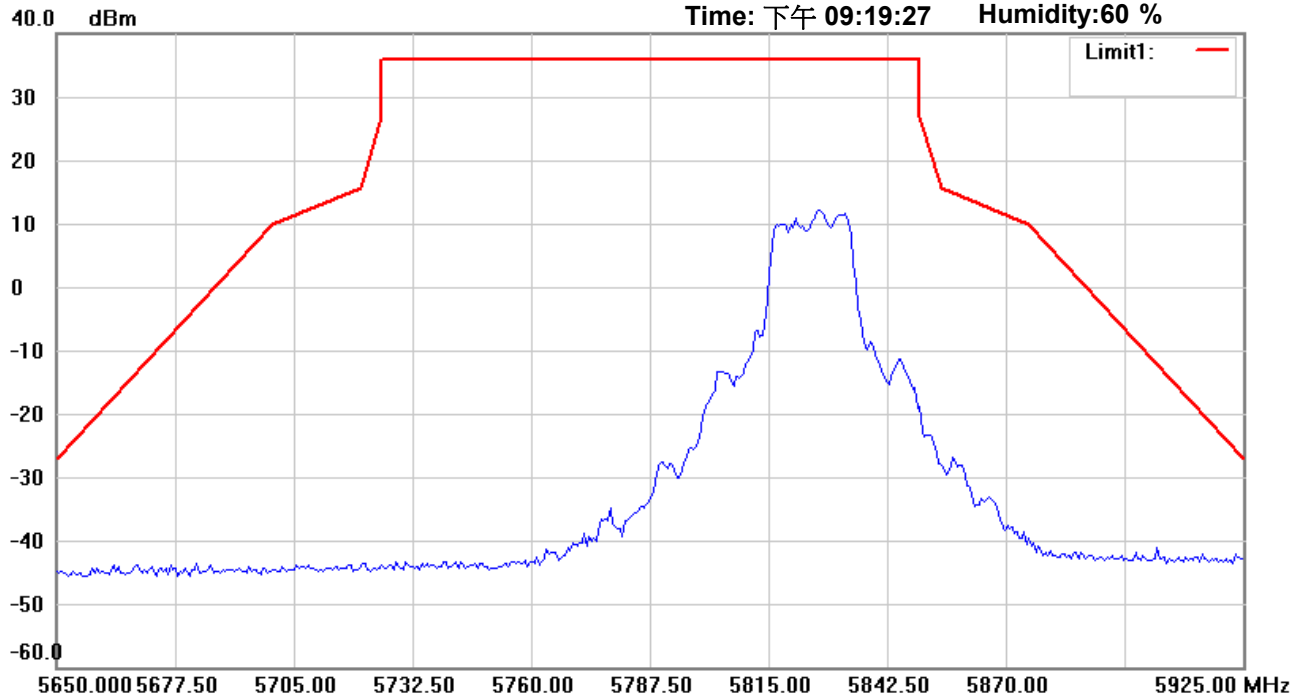

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH165

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #4

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:24:16

Humidity: 60 %

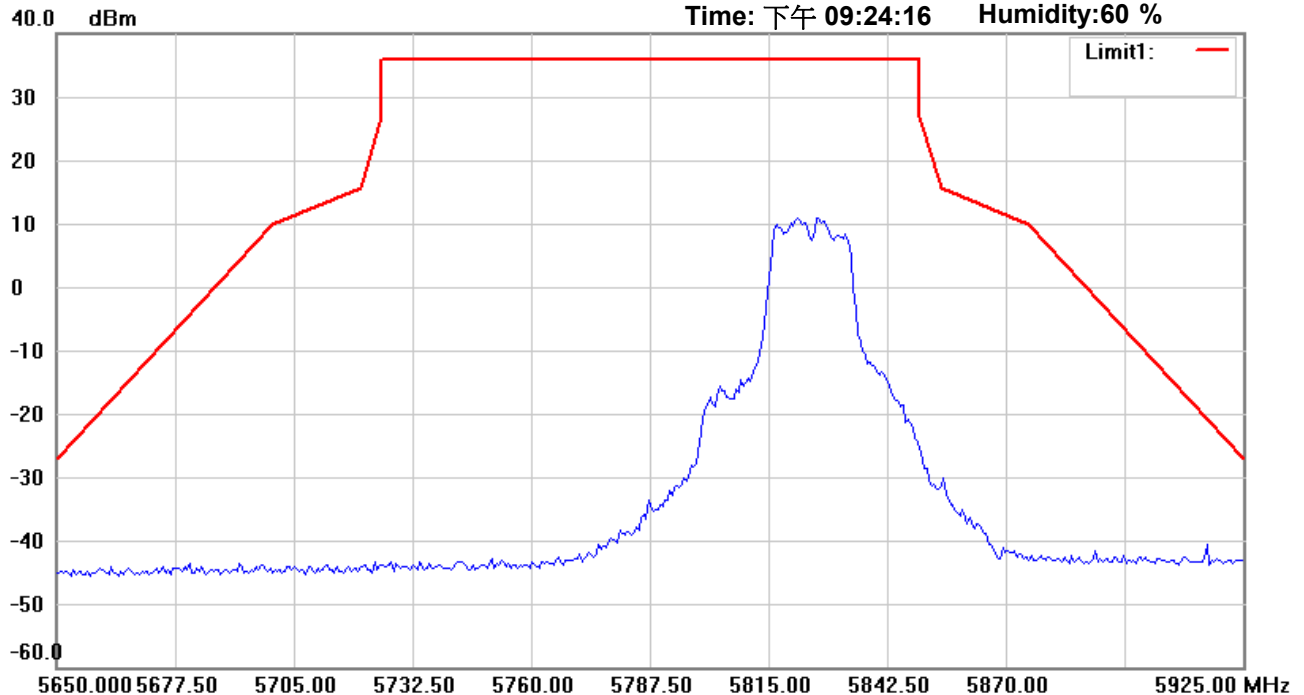

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 20M TX CH165

Note :

Polarization: **Vertical**

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #1

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 08:49:17

Humidity: 60 %

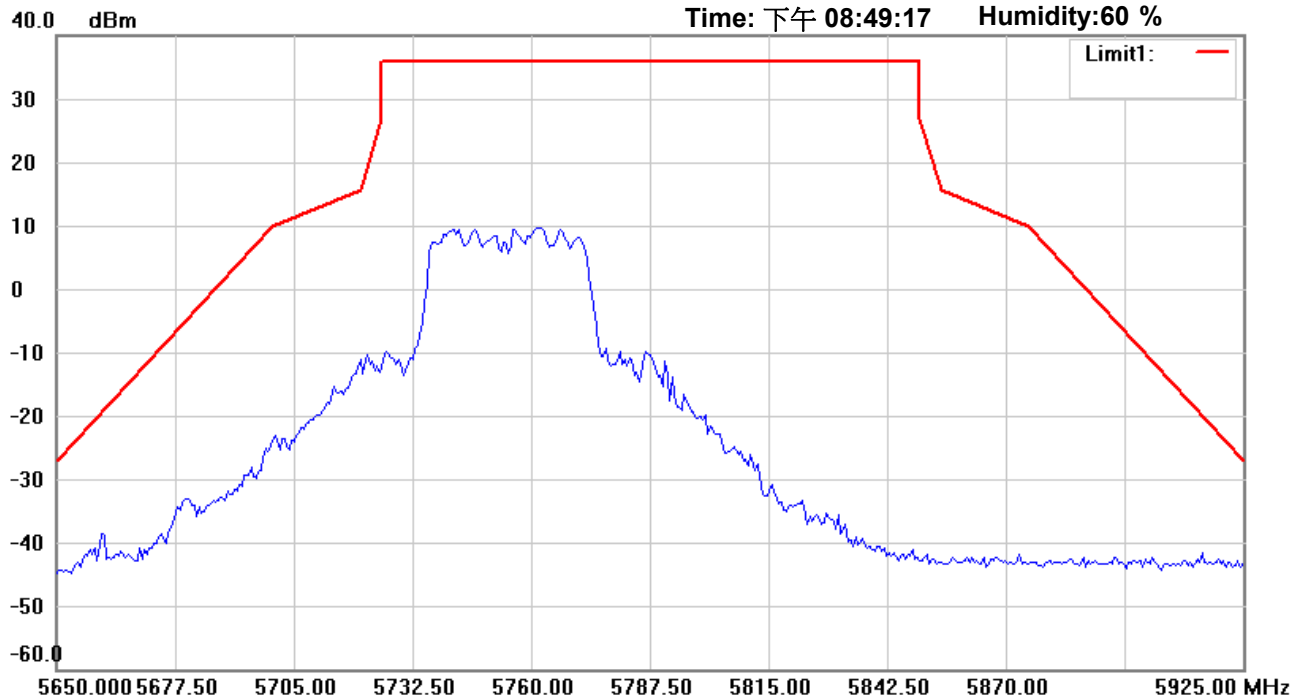

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH151

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #2


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:57:04

Humidity: 60 %

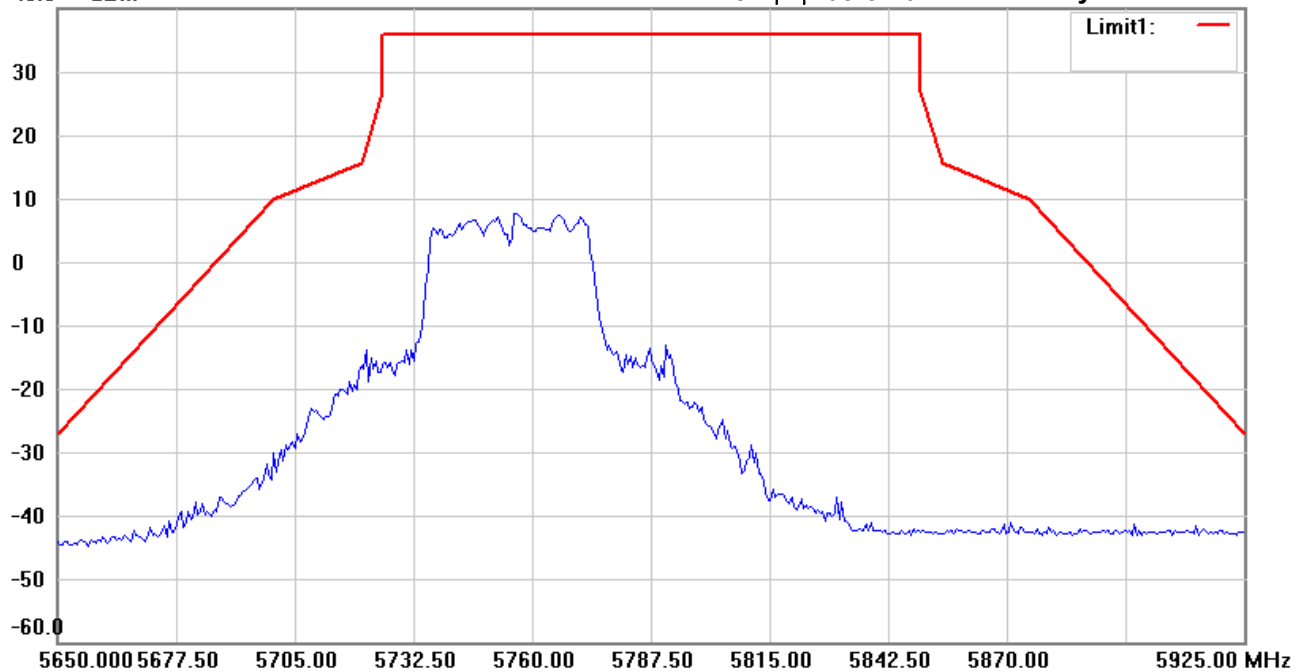

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH151

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #3

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:21:48

Humidity: 60 %

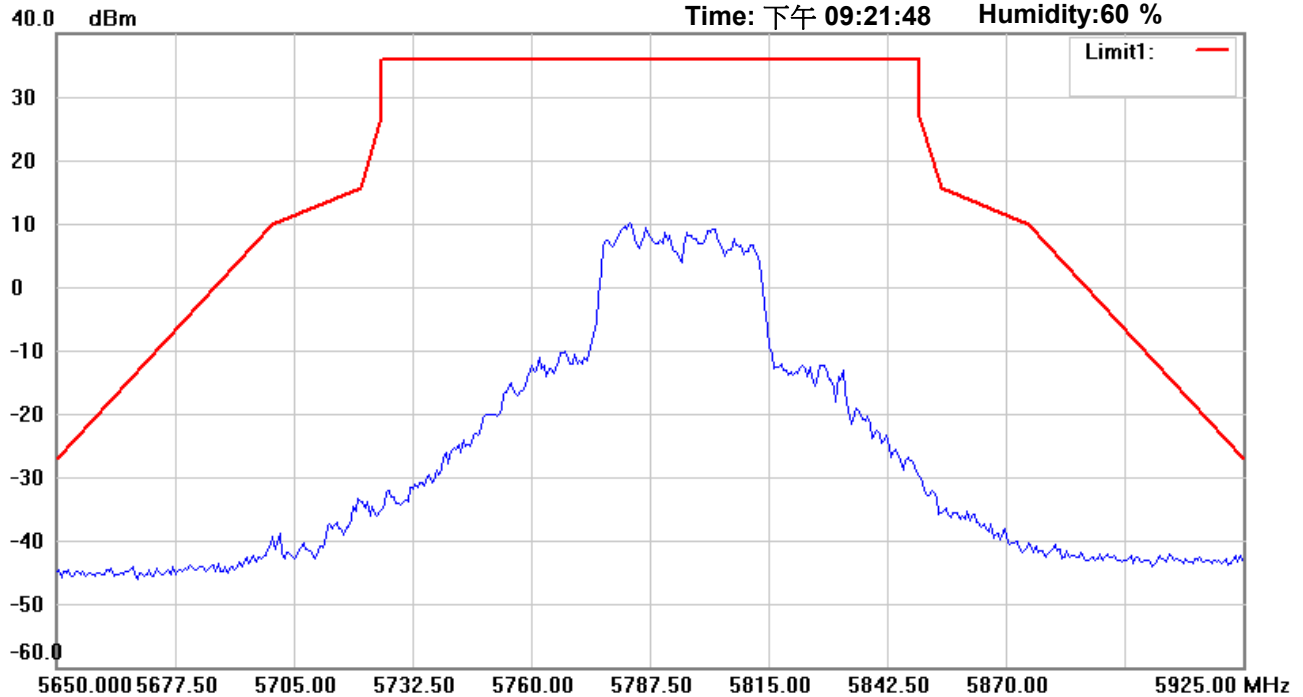

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH159

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK


Data : #5

Date: 2019/11/19

Temperature: 24 °C

Time: 下午 09:22:57

Humidity: 60 %

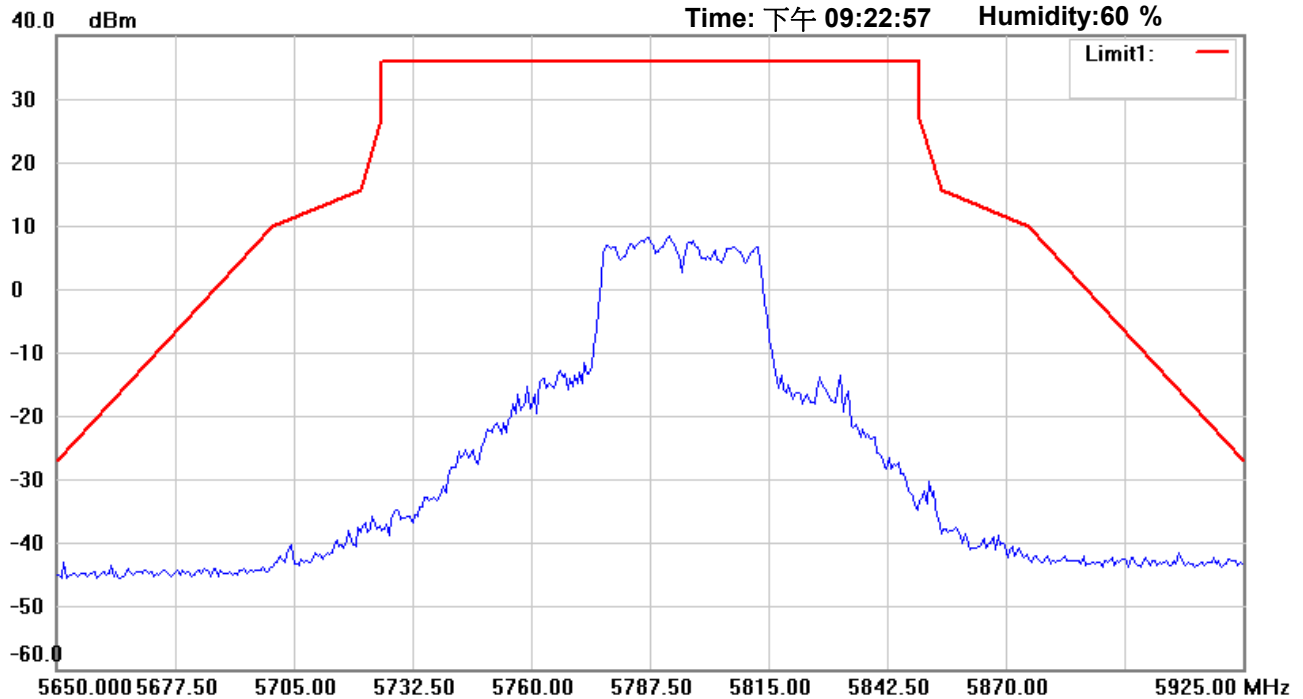

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11n 40M TX CH159

Note :

Polarization: *Vertical*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #1


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:50:40

Humidity: 60 %

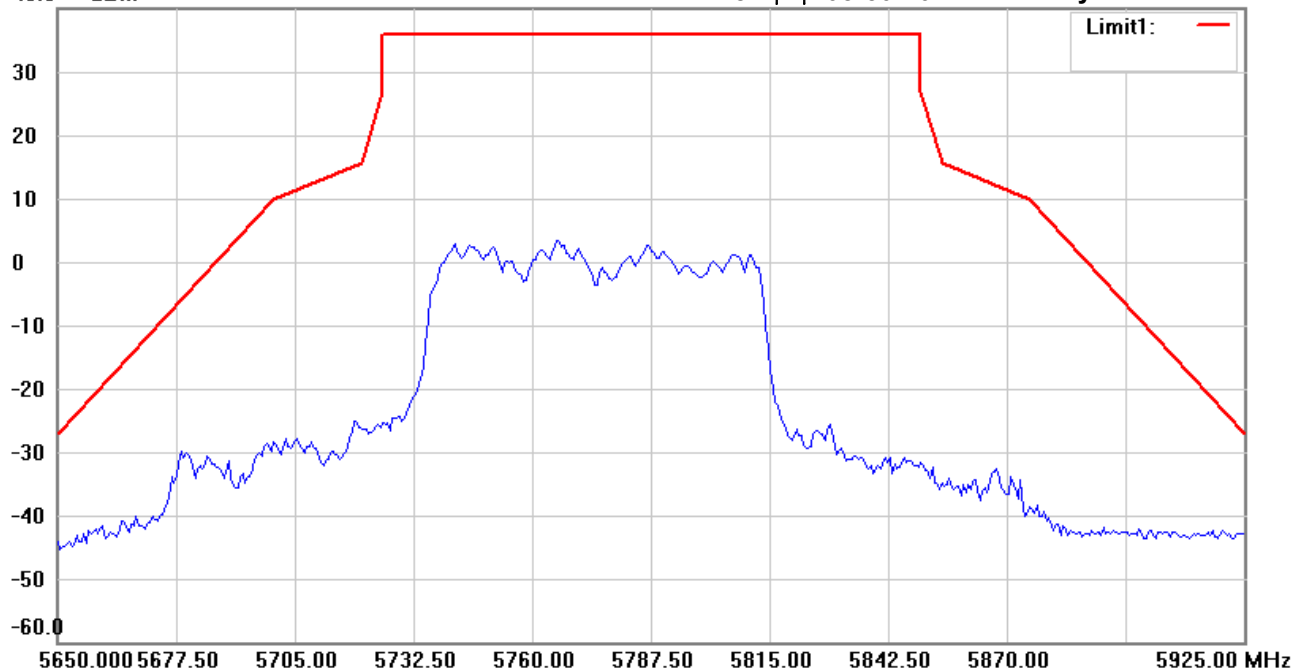

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11ac 80M TX CH155

Note :

Polarization: *Horizontal*

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8879

Radiated Emission Measurement

Operator: Rick

File : MASK

Data : #2


Date: 2019/11/19

Temperature: 24 °C

40.0 dBm

Time: 下午 08:52:27

Humidity: 60 %

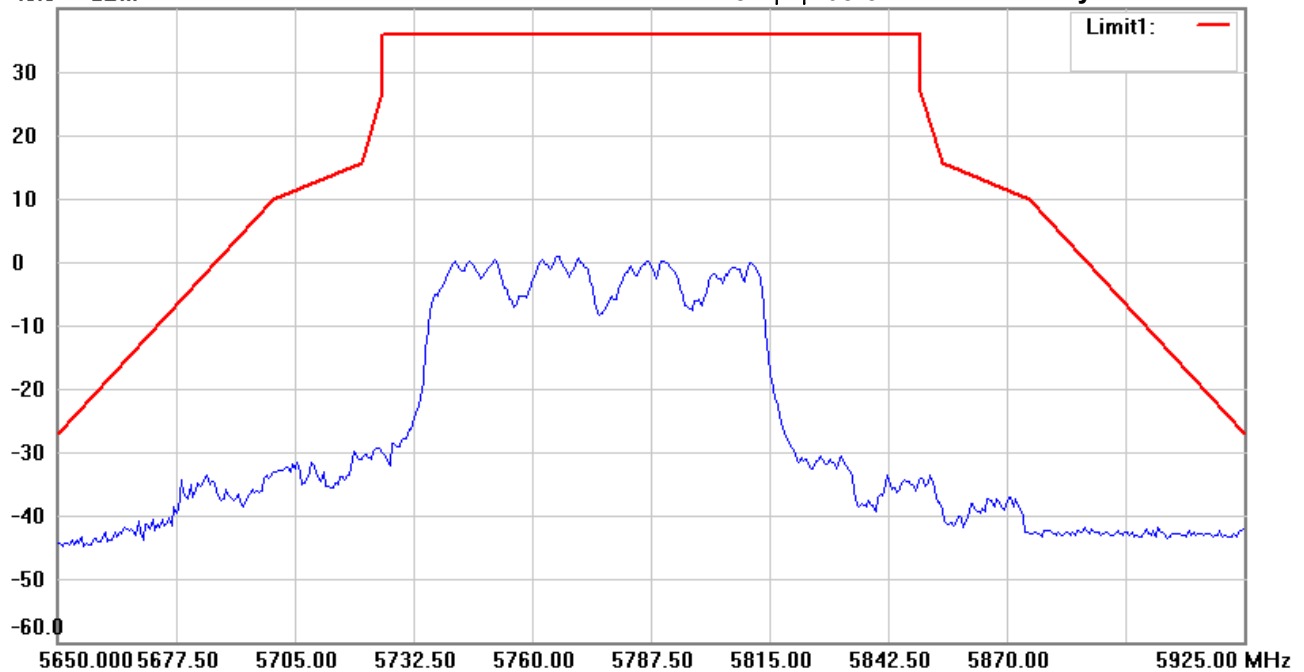

Site : Chamber

Condition : FCC_5G Band4 Mask

EUT : W6M21903-18922

M/N:

Test Mode : 802.11ac 80M TX CH155

Note :

Polarization: Vertical

Power : POE 48V

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	---------------	----------	-------------------	--------------	-------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin