





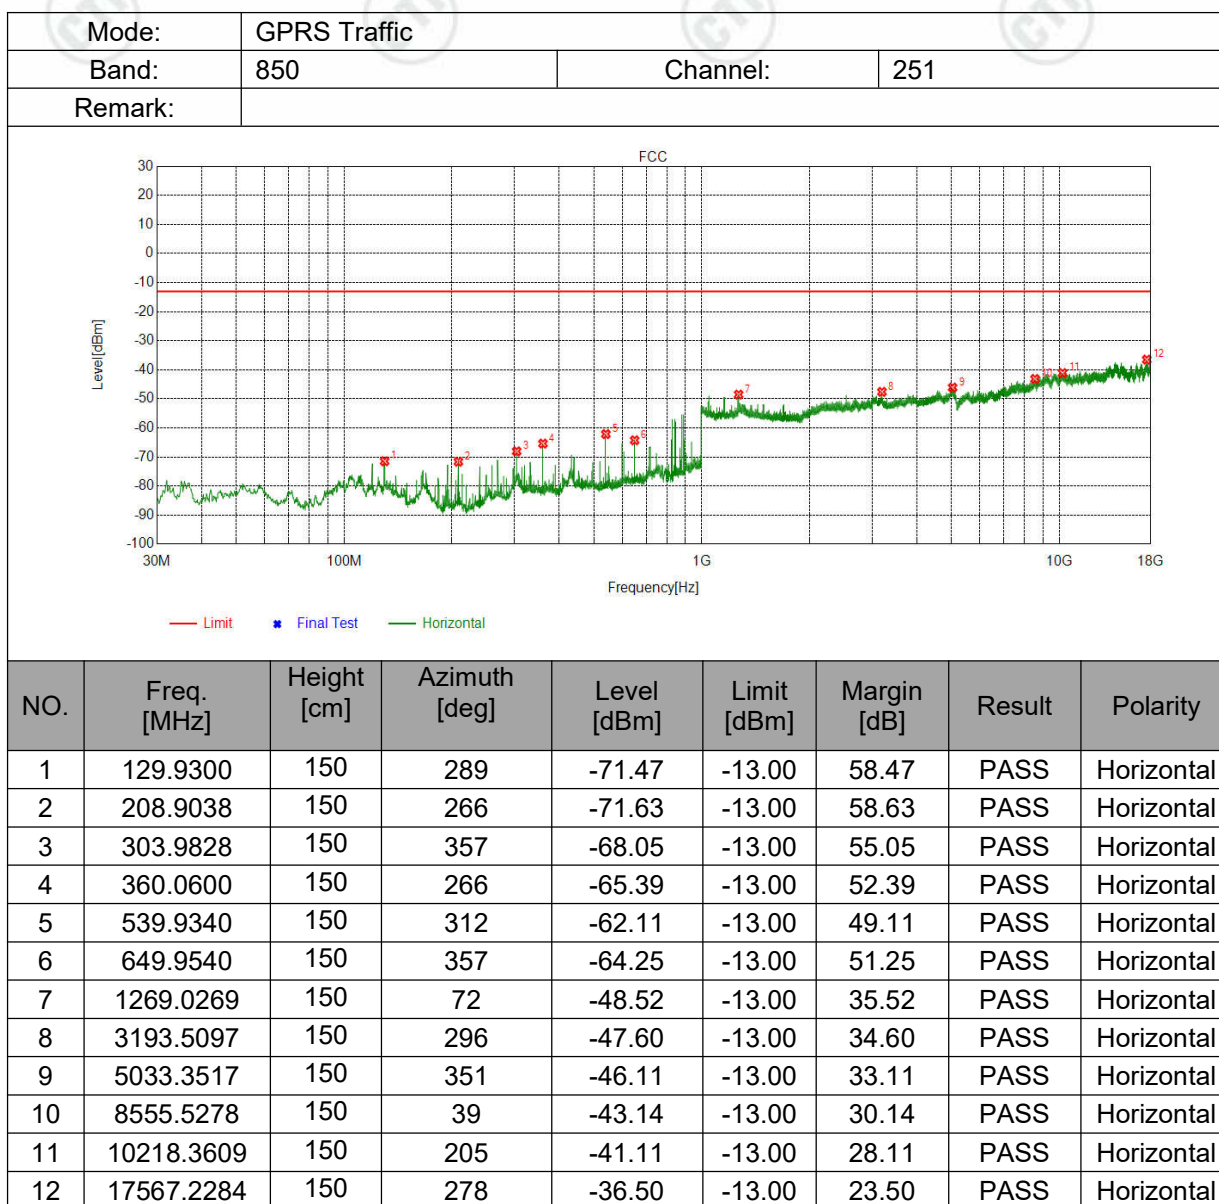

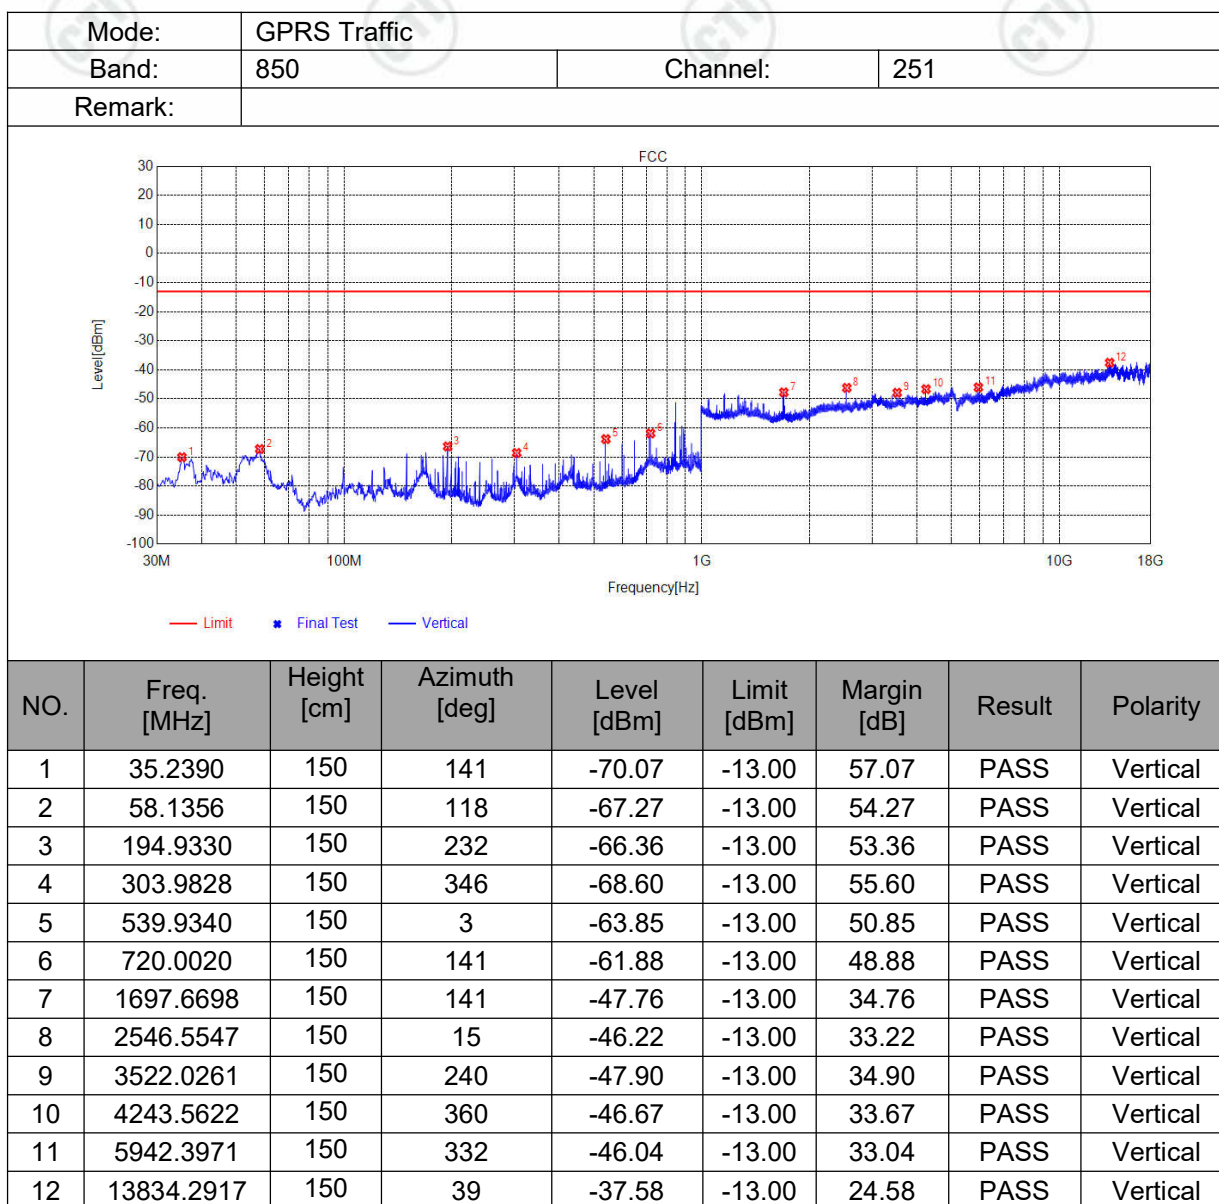


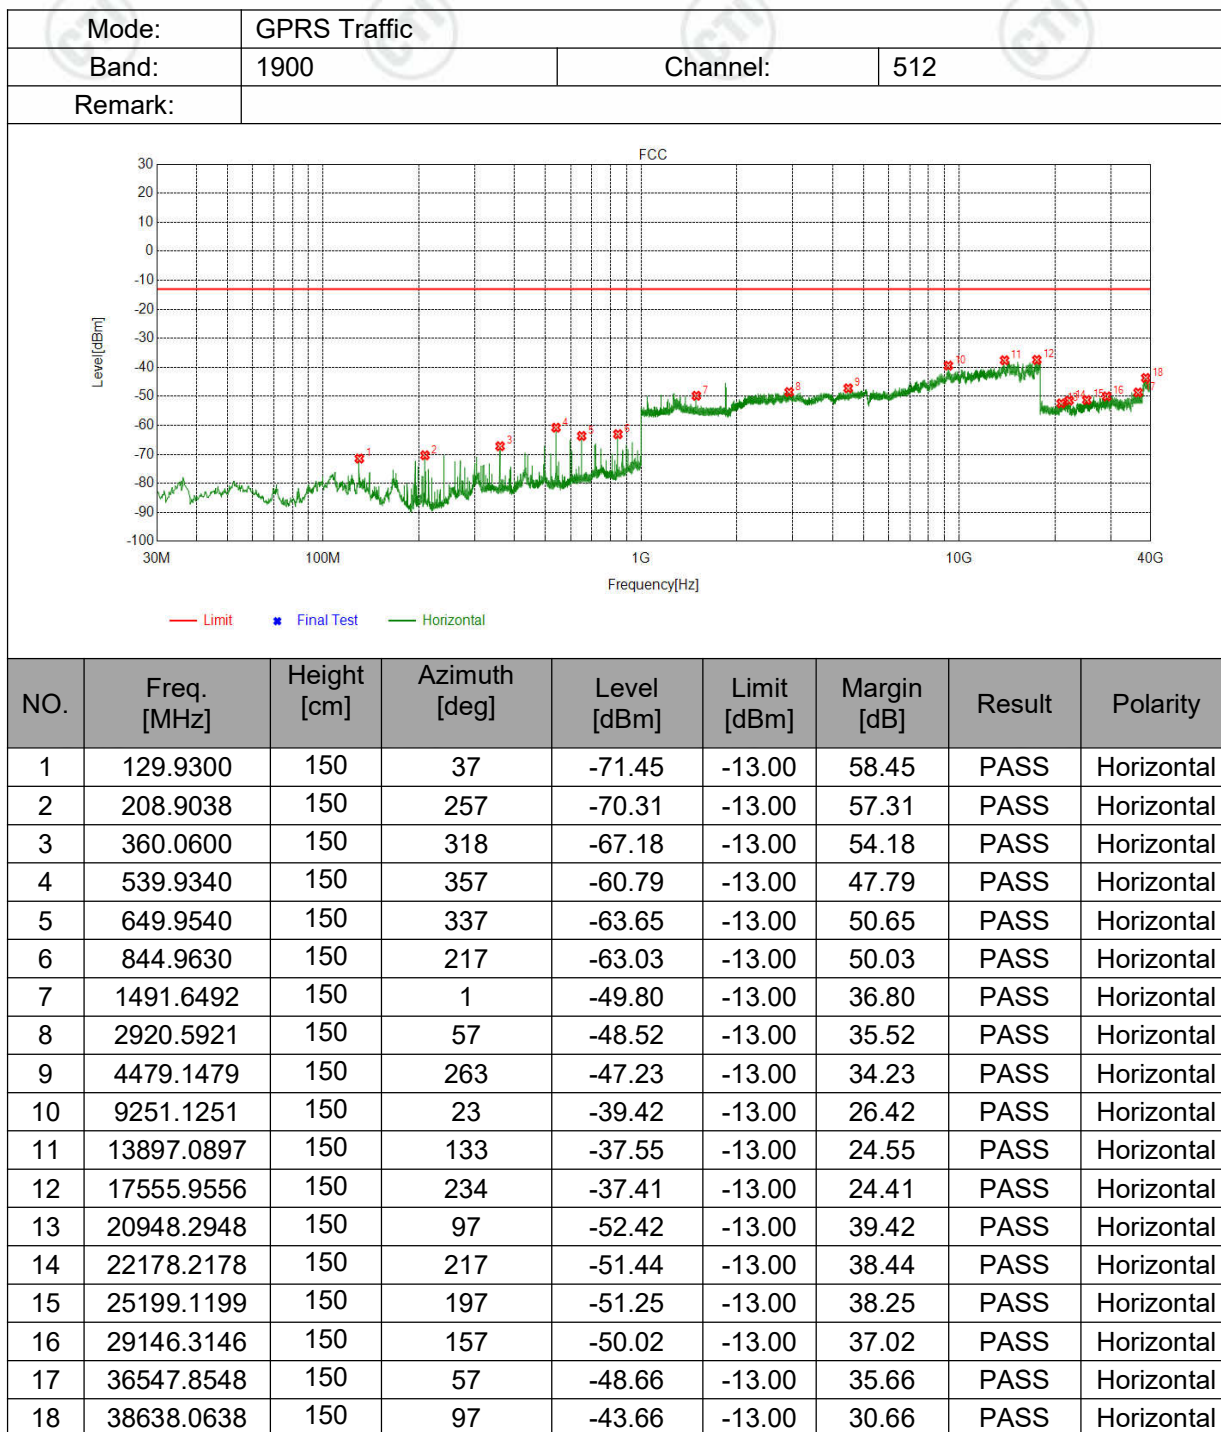



Mode:	GPRS Traffic		
Band:	1900	Channel:	512
Remark:			

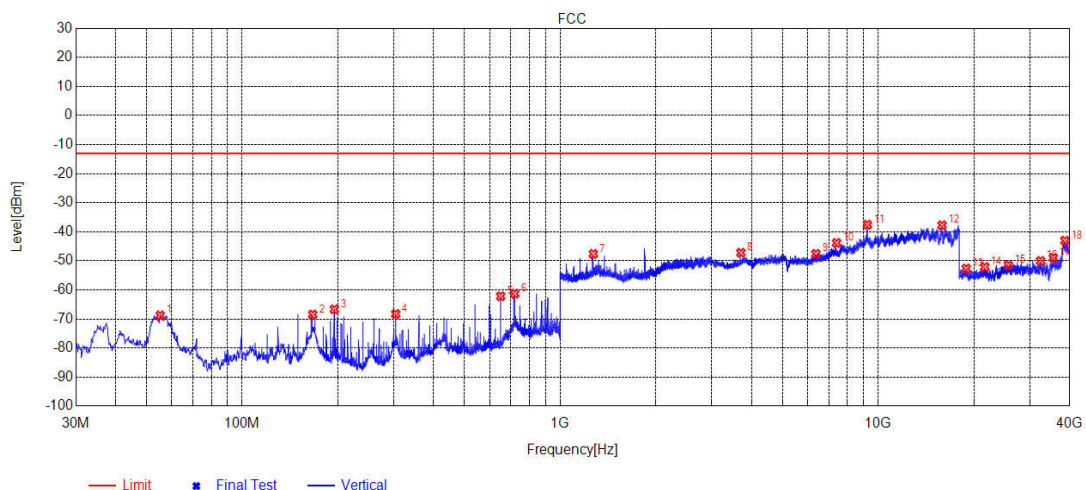


NO.	Freq. [MHz]	Height [cm]	Azimuth [deg]	Level [dBm]	Limit [dBm]	Margin [dB]	Result	Polarity
1	55.2250	150	257	-68.76	-13.00	55.76	PASS	Vertical
2	166.6033	150	136	-68.46	-13.00	55.46	PASS	Vertical
3	194.9330	150	357	-66.67	-13.00	53.67	PASS	Vertical
4	303.9828	150	297	-68.26	-13.00	55.26	PASS	Vertical
5	649.9540	150	317	-62.17	-13.00	49.17	PASS	Vertical
6	720.0020	150	357	-61.29	-13.00	48.29	PASS	Vertical
7	1271.4271	150	136	-47.60	-13.00	34.60	PASS	Vertical
8	3700.5701	150	53	-47.21	-13.00	34.21	PASS	Vertical
9	6370.8371	150	223	-47.56	-13.00	34.56	PASS	Vertical
10	7401.4401	150	22	-43.83	-13.00	30.83	PASS	Vertical
11	9251.1251	150	294	-37.55	-13.00	24.55	PASS	Vertical
12	15887.7888	150	63	-37.73	-13.00	24.73	PASS	Vertical
13	18924.0924	150	277	-52.62	-13.00	39.62	PASS	Vertical
14	21652.3652	150	237	-52.08	-13.00	39.08	PASS	Vertical
15	25665.5666	150	116	-51.48	-13.00	38.48	PASS	Vertical
16	32429.0429	150	257	-50.02	-13.00	37.02	PASS	Vertical
17	35566.5567	150	217	-48.95	-13.00	35.95	PASS	Vertical
18	38668.8669	150	157	-43.03	-13.00	30.03	PASS	Vertical

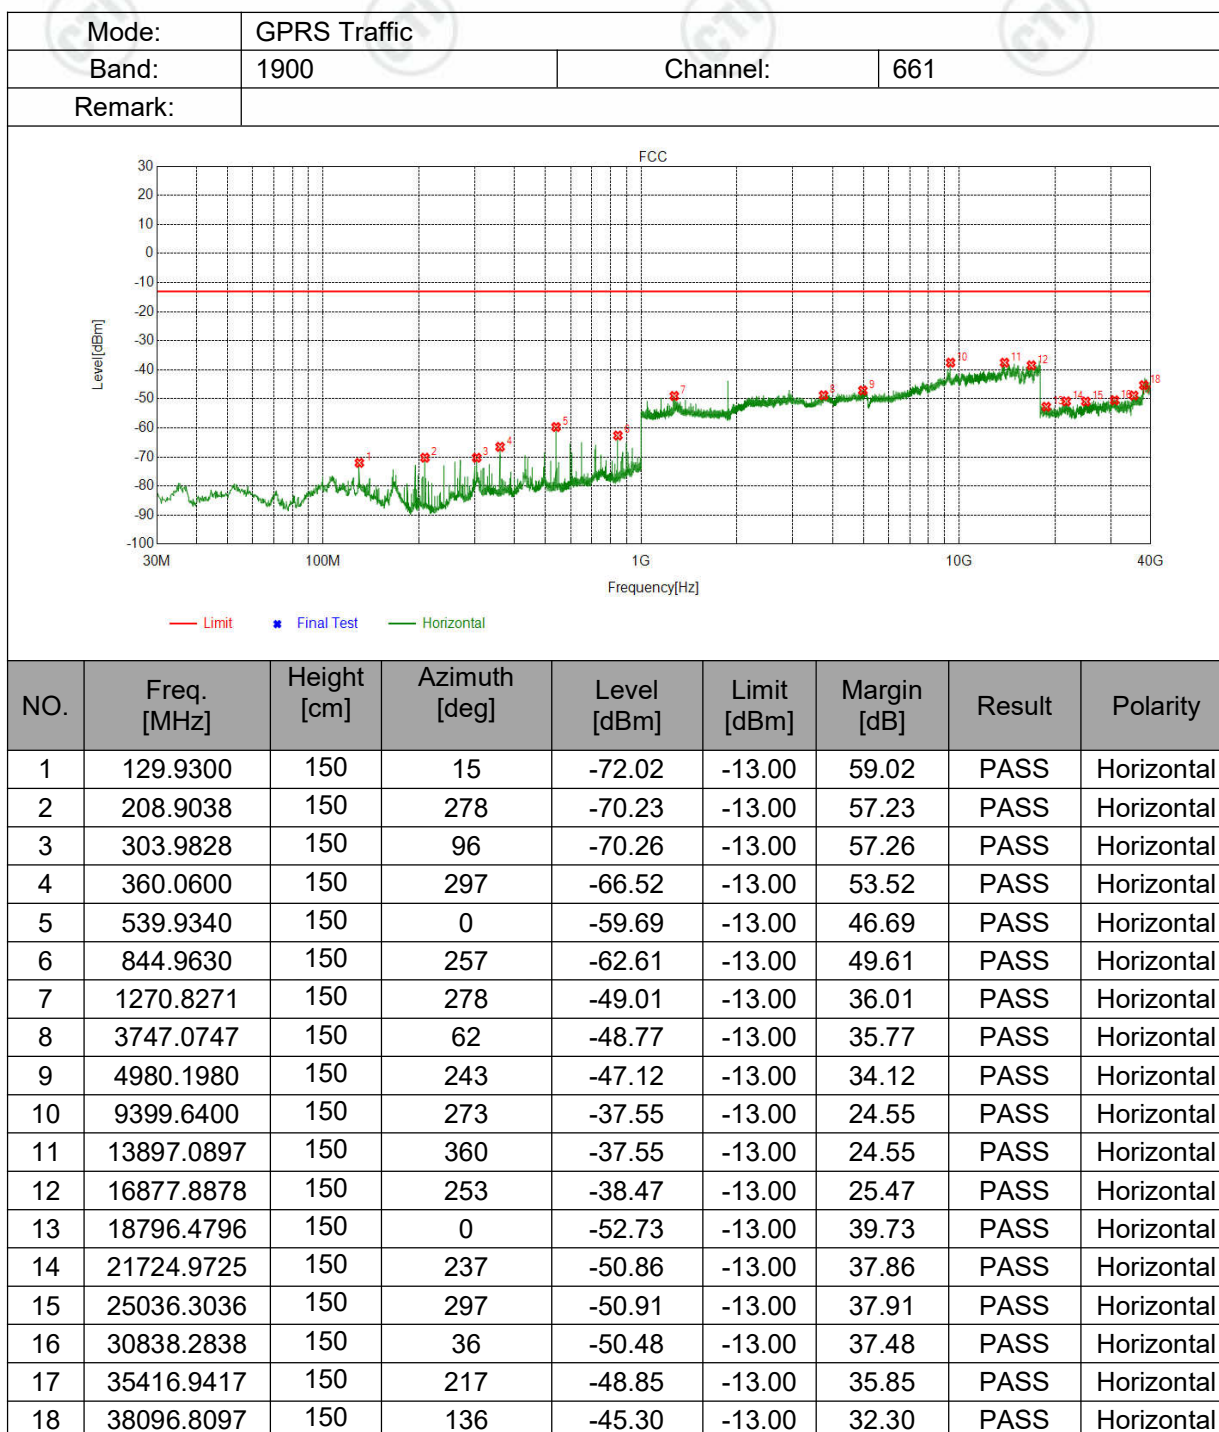


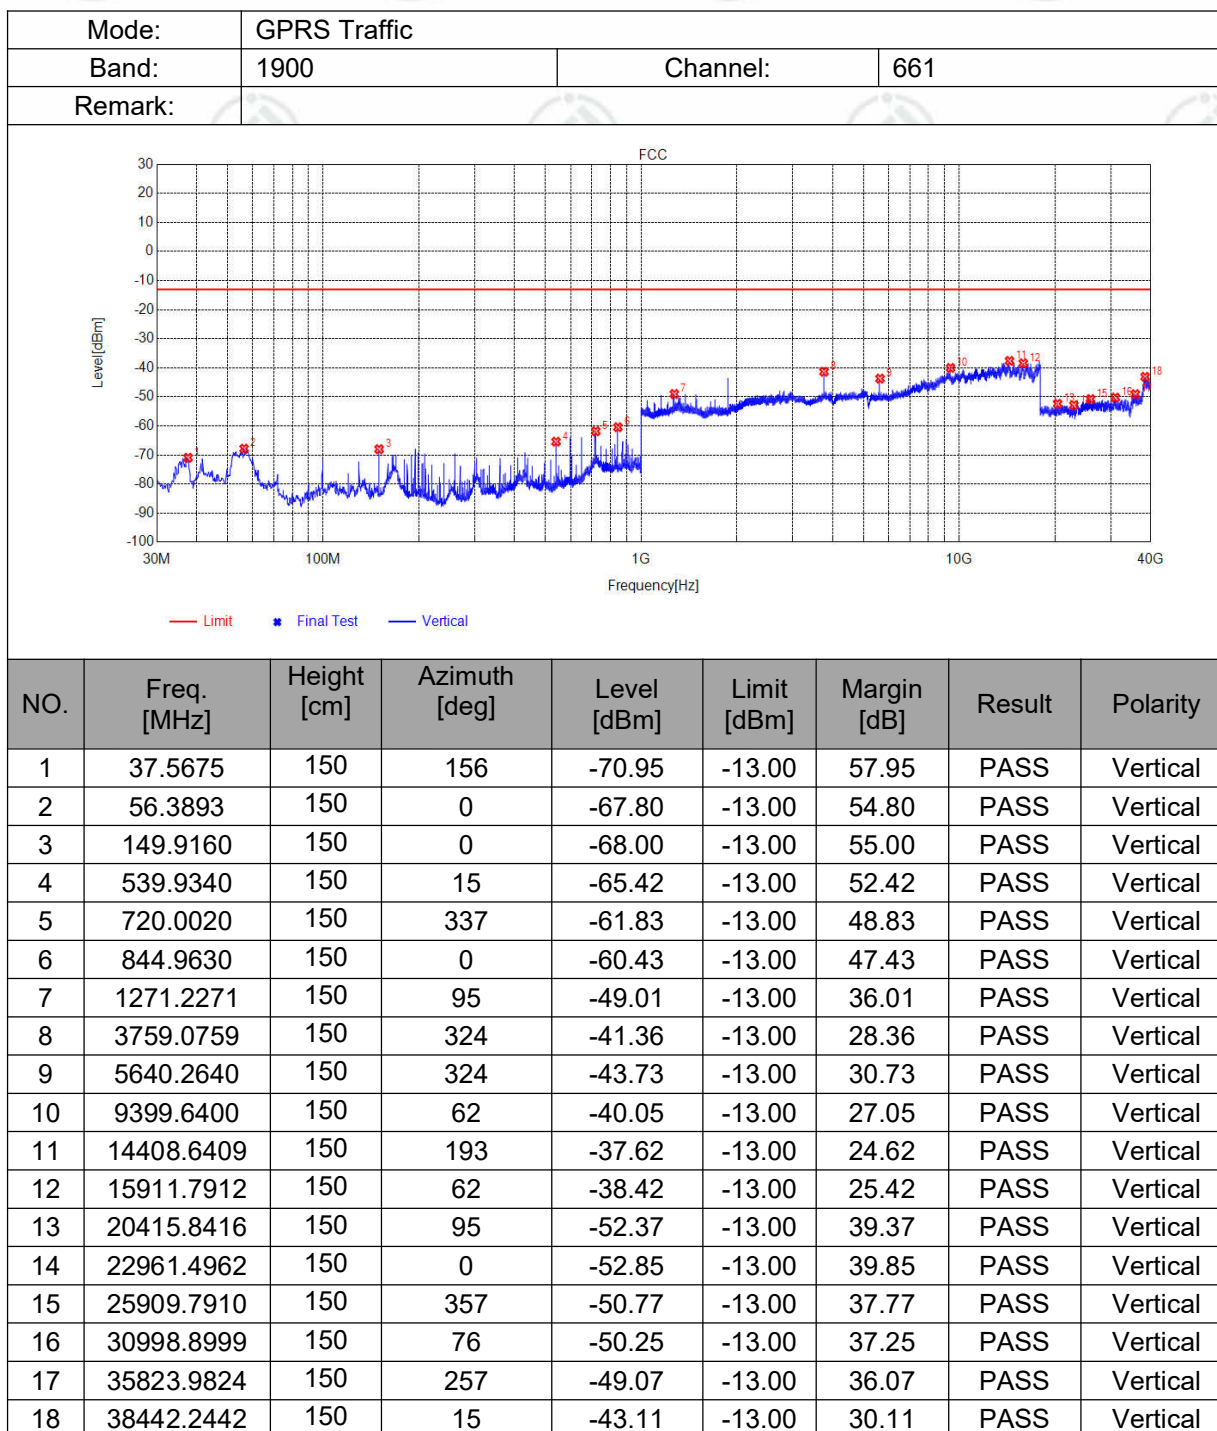

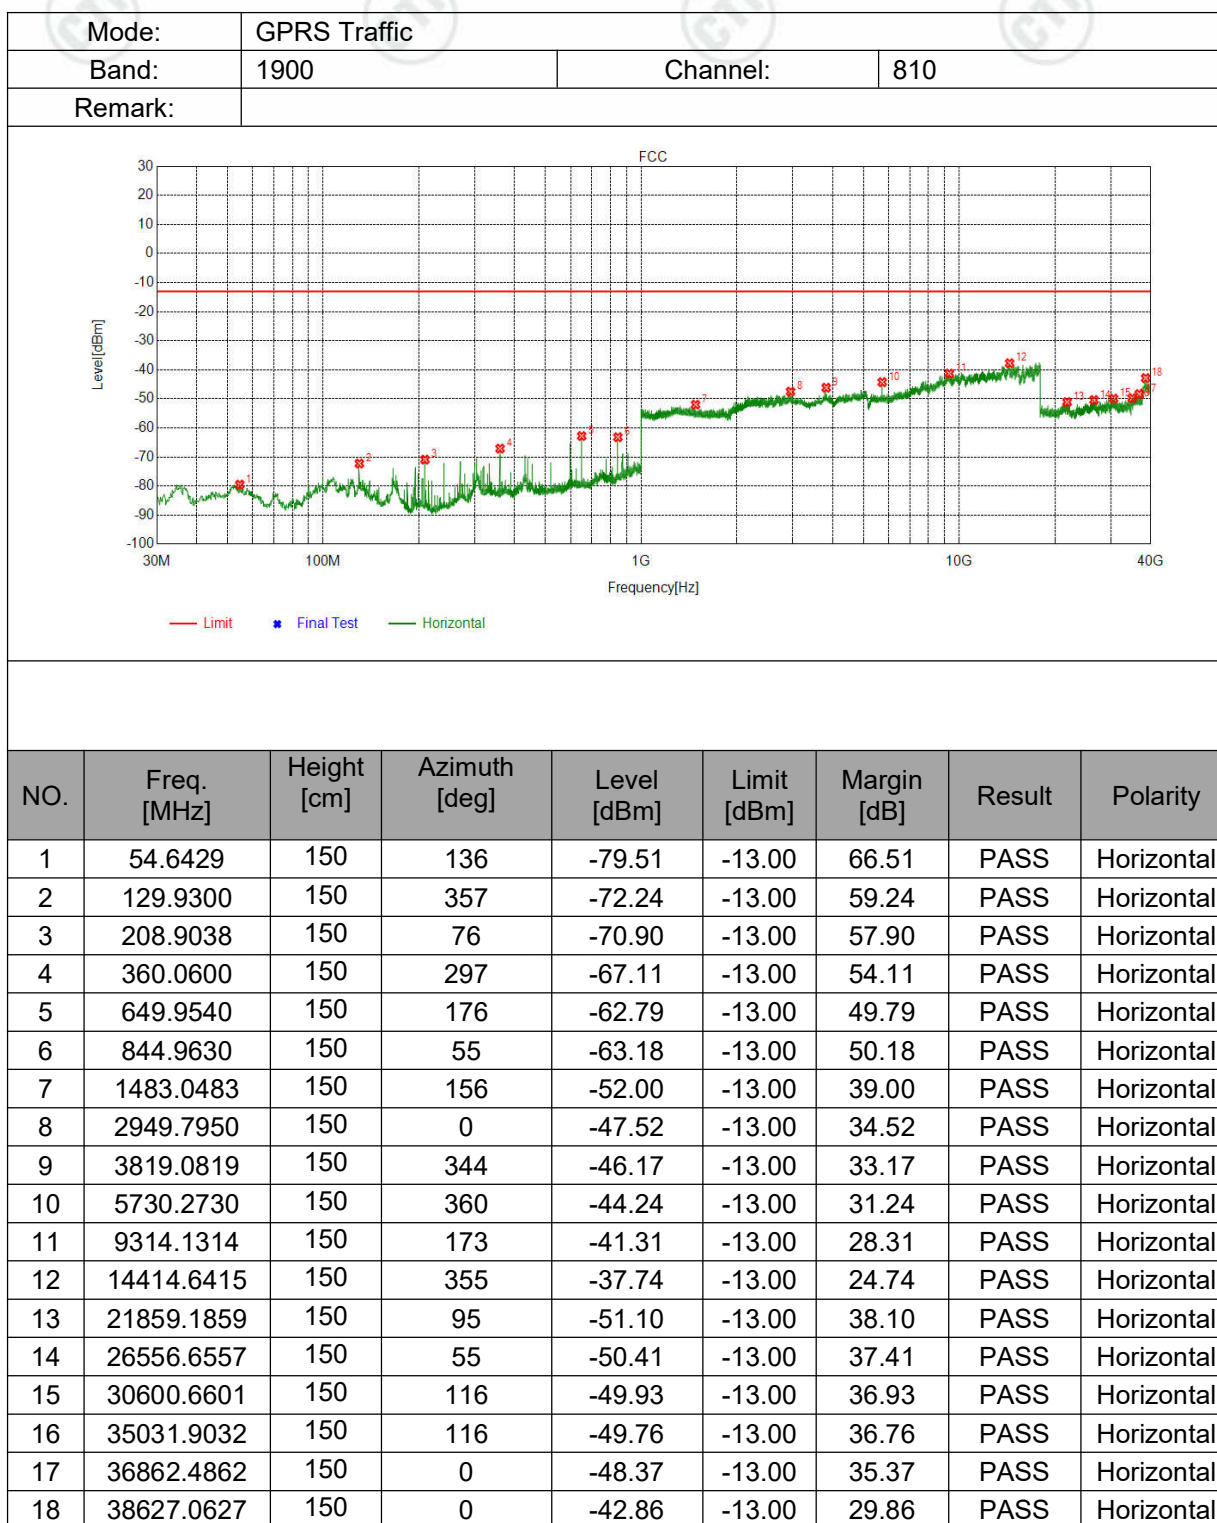


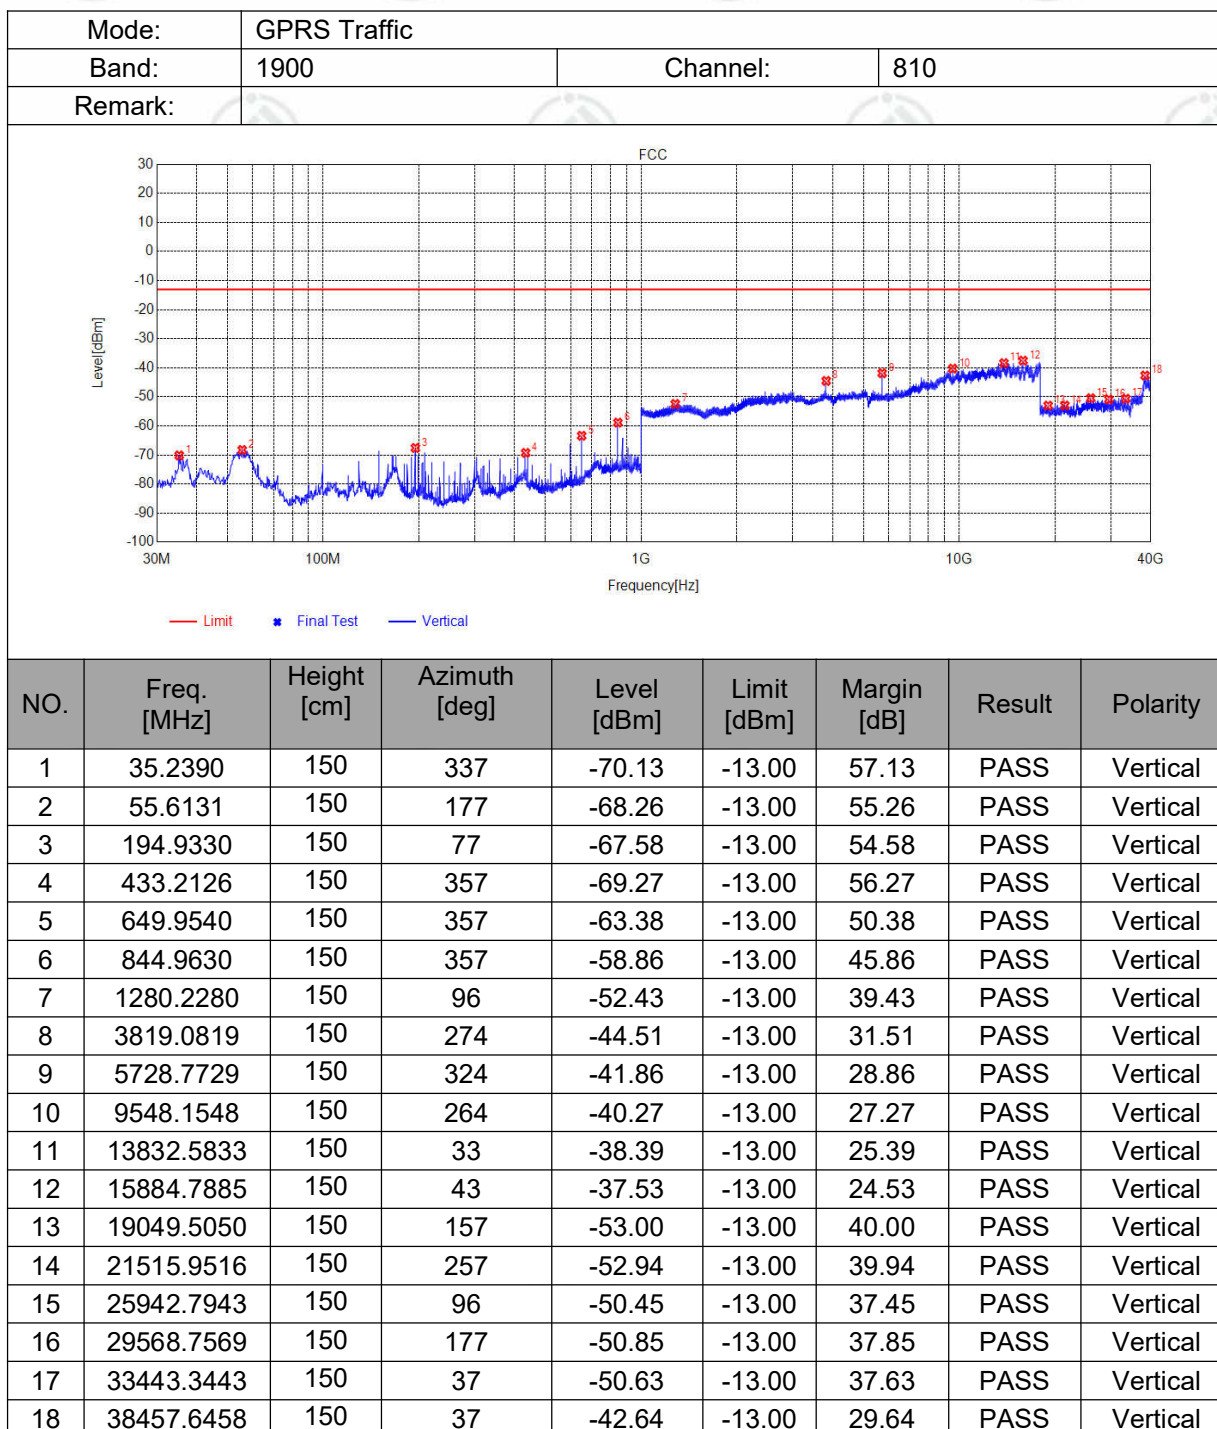



Mode:	EGPRS Traffic		
Band:	850	Channel:	128
Remark:			

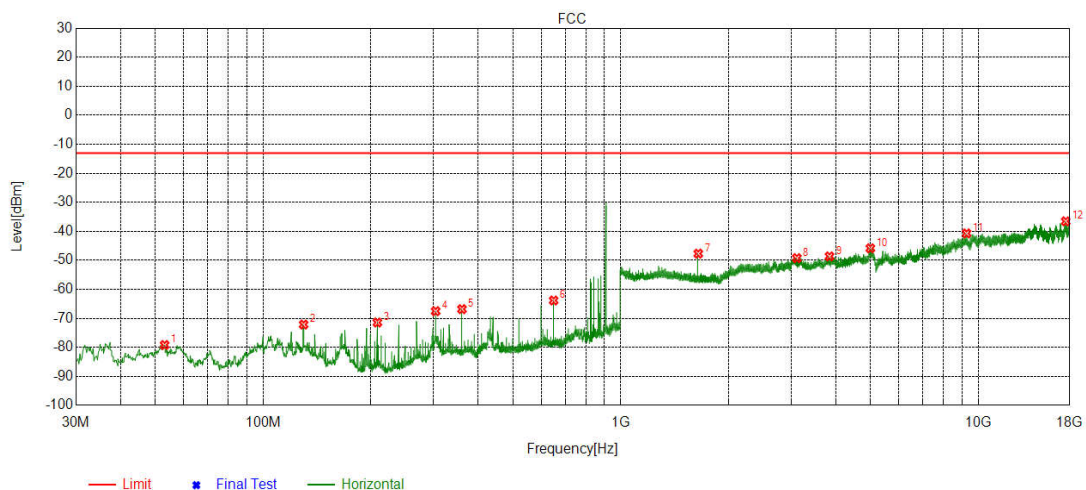



NO.	Freq. [MHz]	Height [cm]	Azimuth [deg]	Level [dBm]	Limit [dBm]	Margin [dB]	Result	Polarity
1	53.0906	150	357	-79.18	-13.00	66.18	PASS	Horizontal
2	129.9300	150	294	-72.12	-13.00	59.12	PASS	Horizontal
3	208.9038	150	294	-71.43	-13.00	58.43	PASS	Horizontal
4	303.9828	150	3	-67.52	-13.00	54.52	PASS	Horizontal
5	360.0600	150	248	-66.82	-13.00	53.82	PASS	Horizontal
6	649.9540	150	111	-63.83	-13.00	50.83	PASS	Horizontal
7	1648.6649	150	266	-47.68	-13.00	34.68	PASS	Horizontal
8	3110.2555	150	149	-49.22	-13.00	36.22	PASS	Horizontal
9	3837.7919	150	280	-48.62	-13.00	35.62	PASS	Horizontal
10	4992.8496	150	352	-45.84	-13.00	32.84	PASS	Horizontal
11	9274.0637	150	18	-40.70	-13.00	27.70	PASS	Horizontal
12	17560.4780	150	192	-36.55	-13.00	23.55	PASS	Horizontal

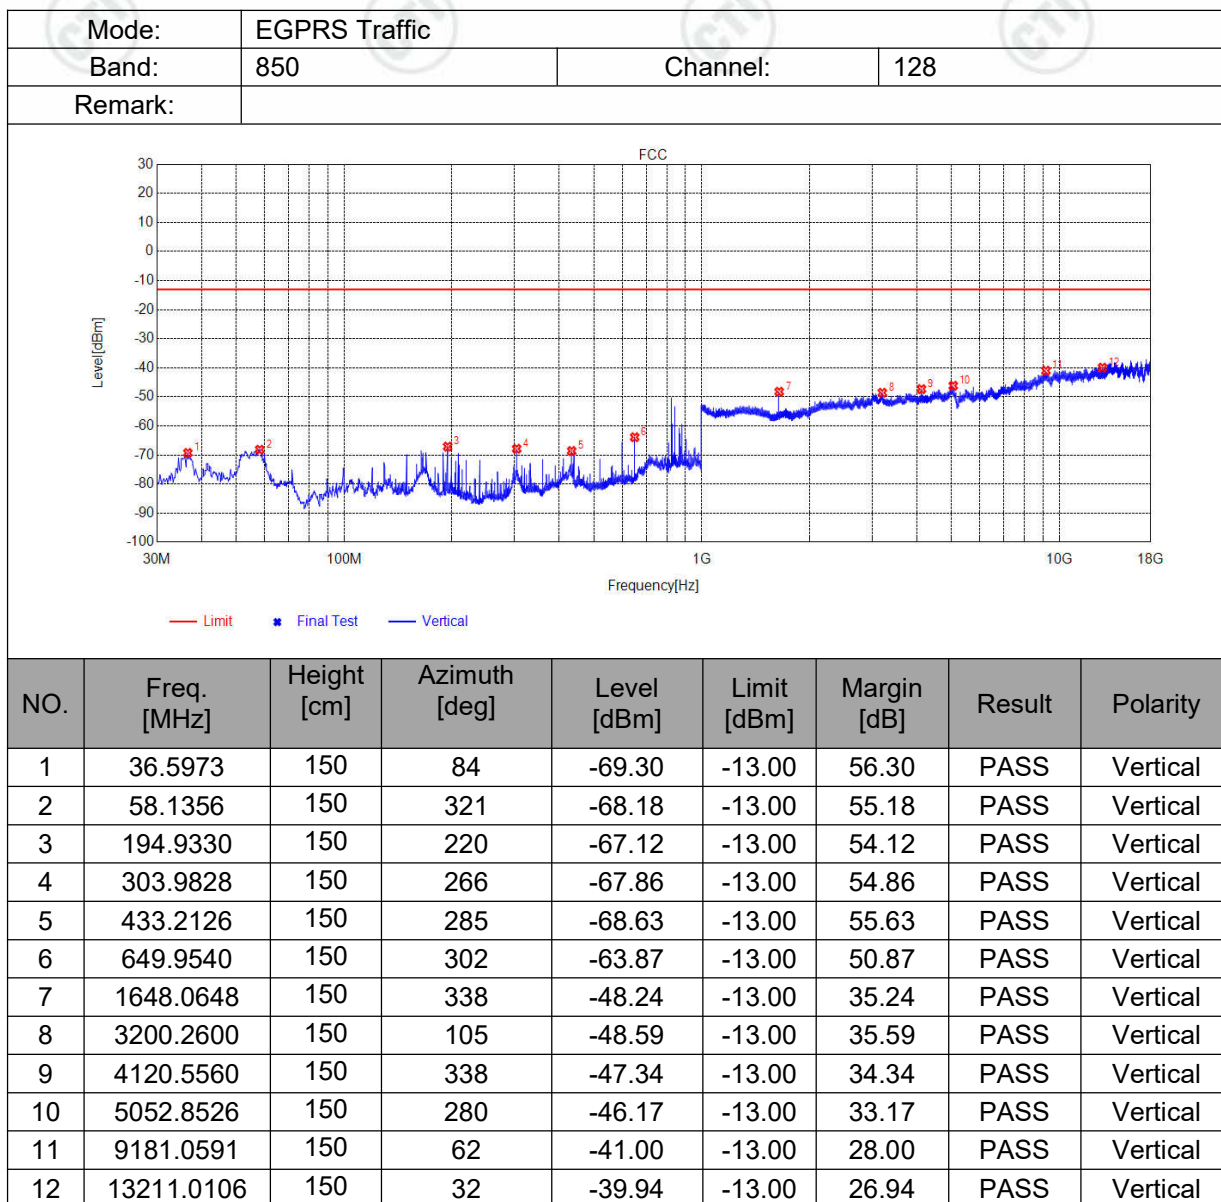


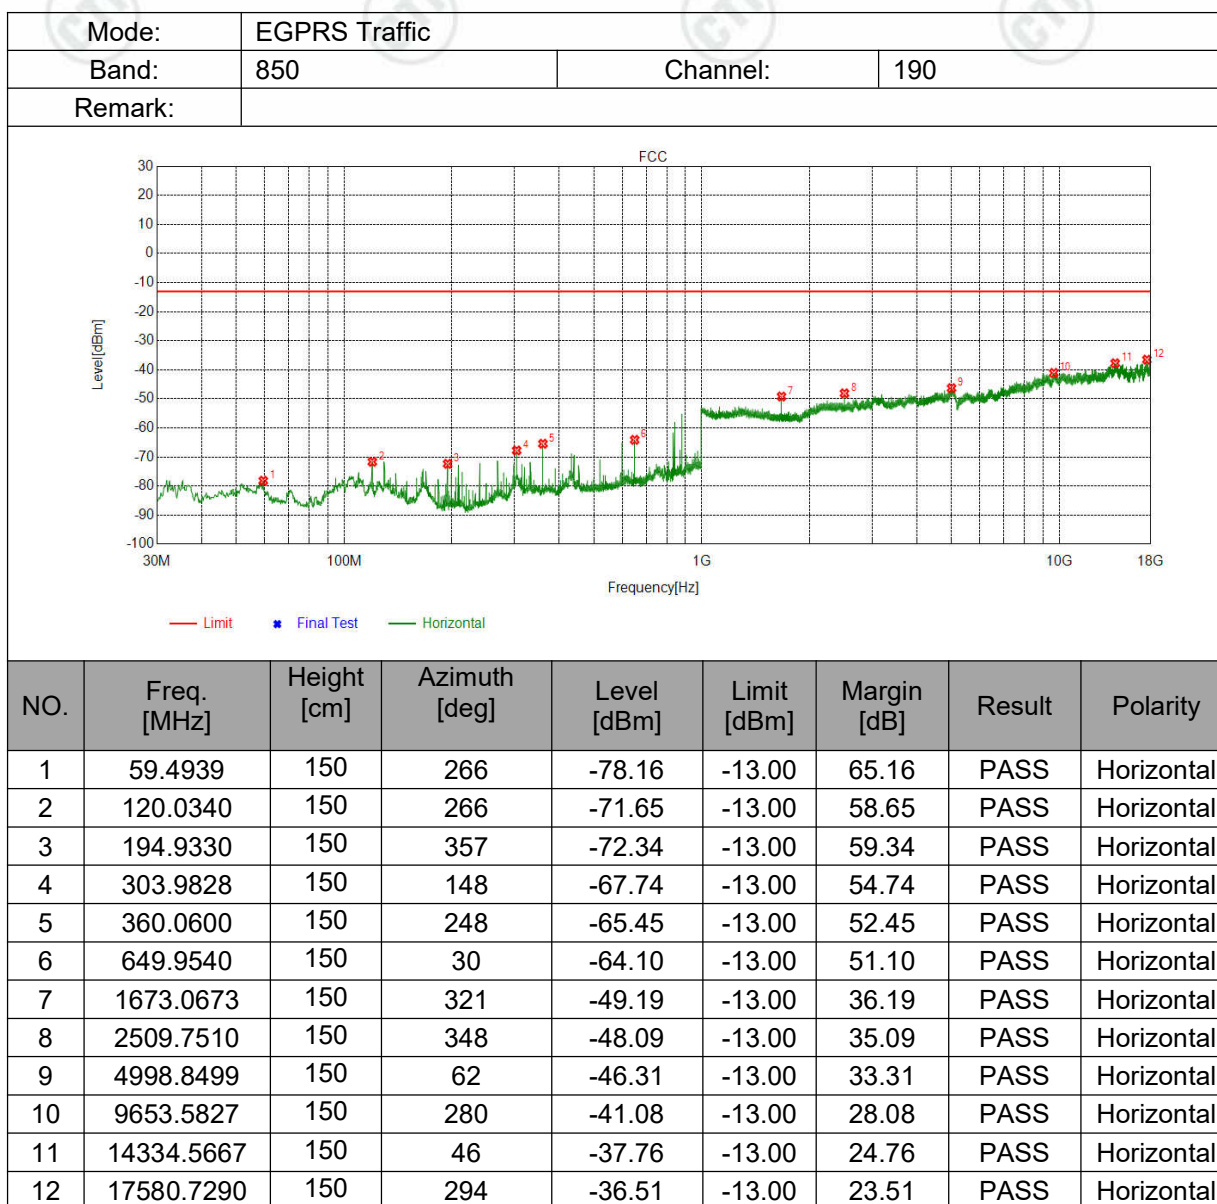


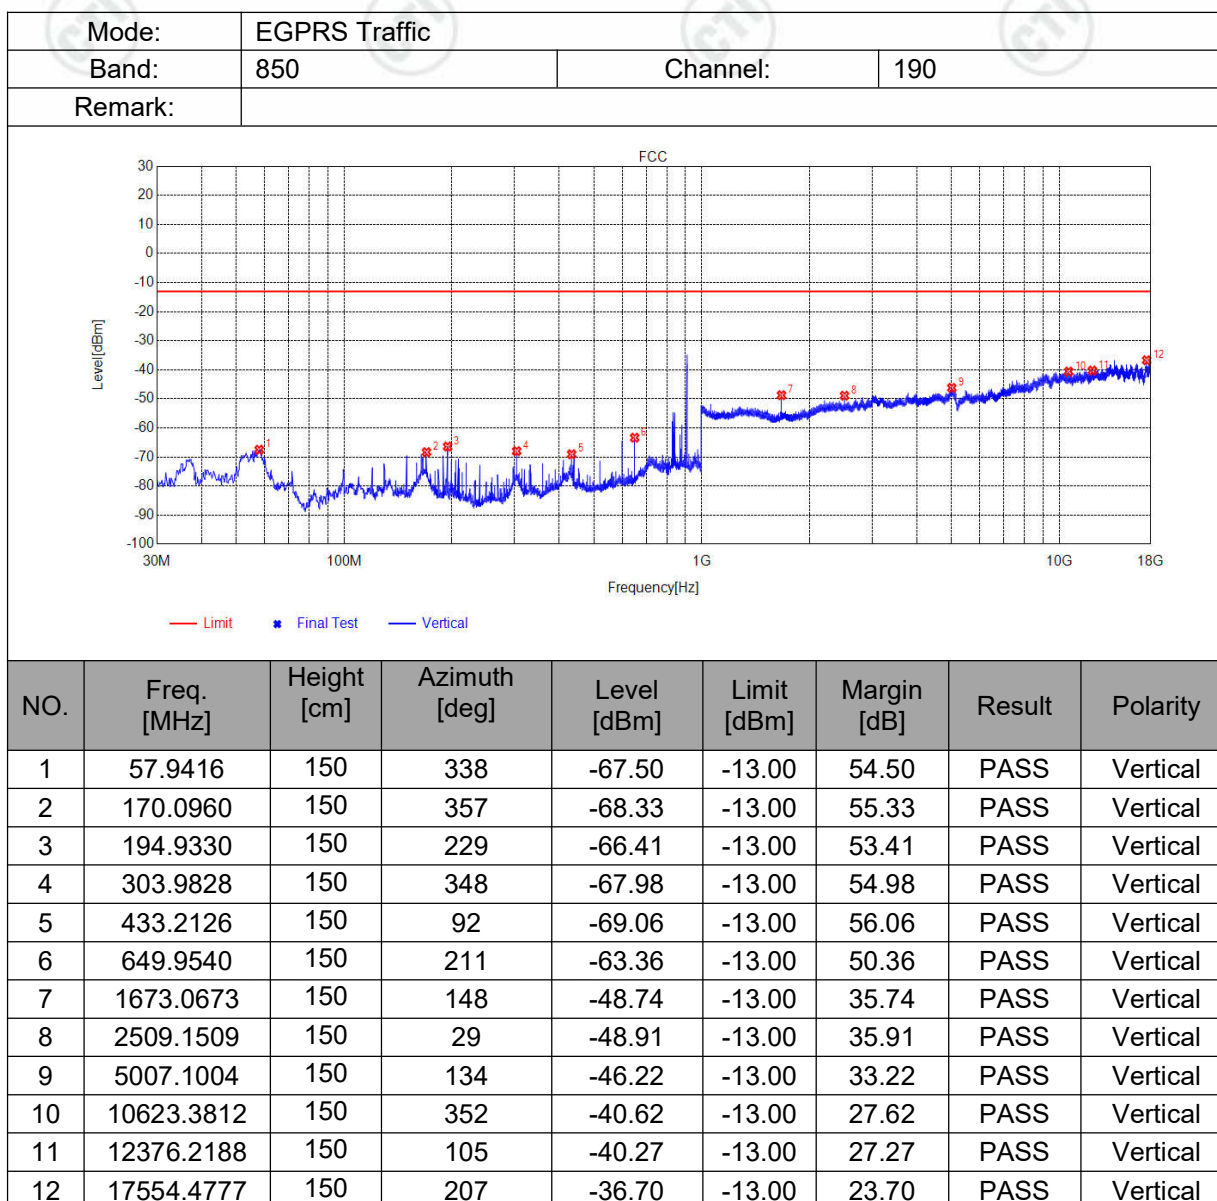


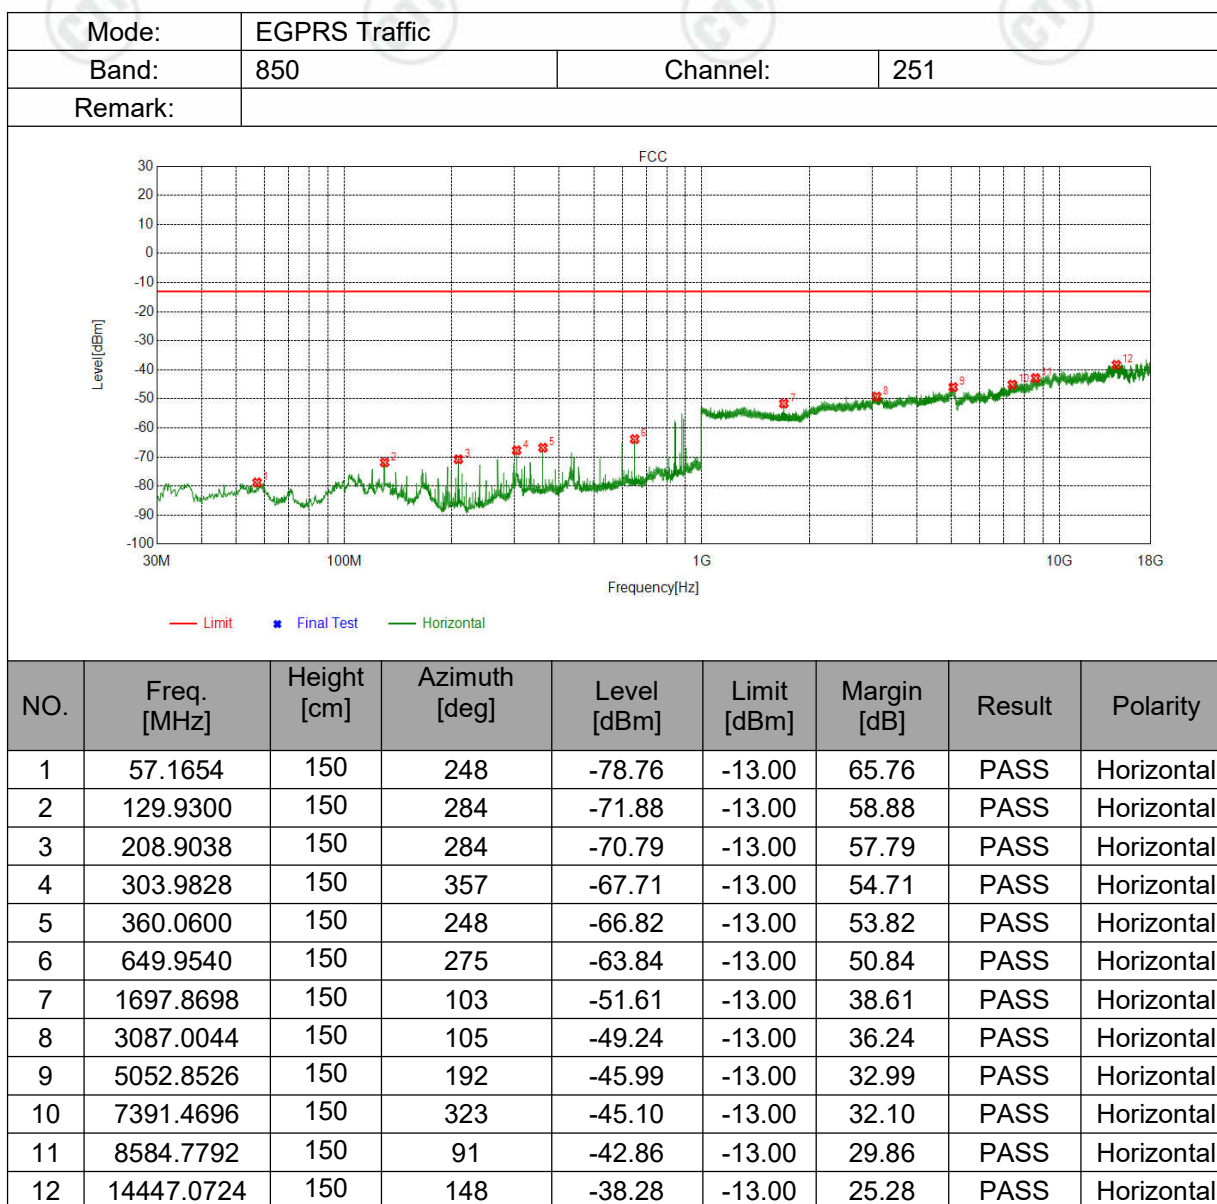


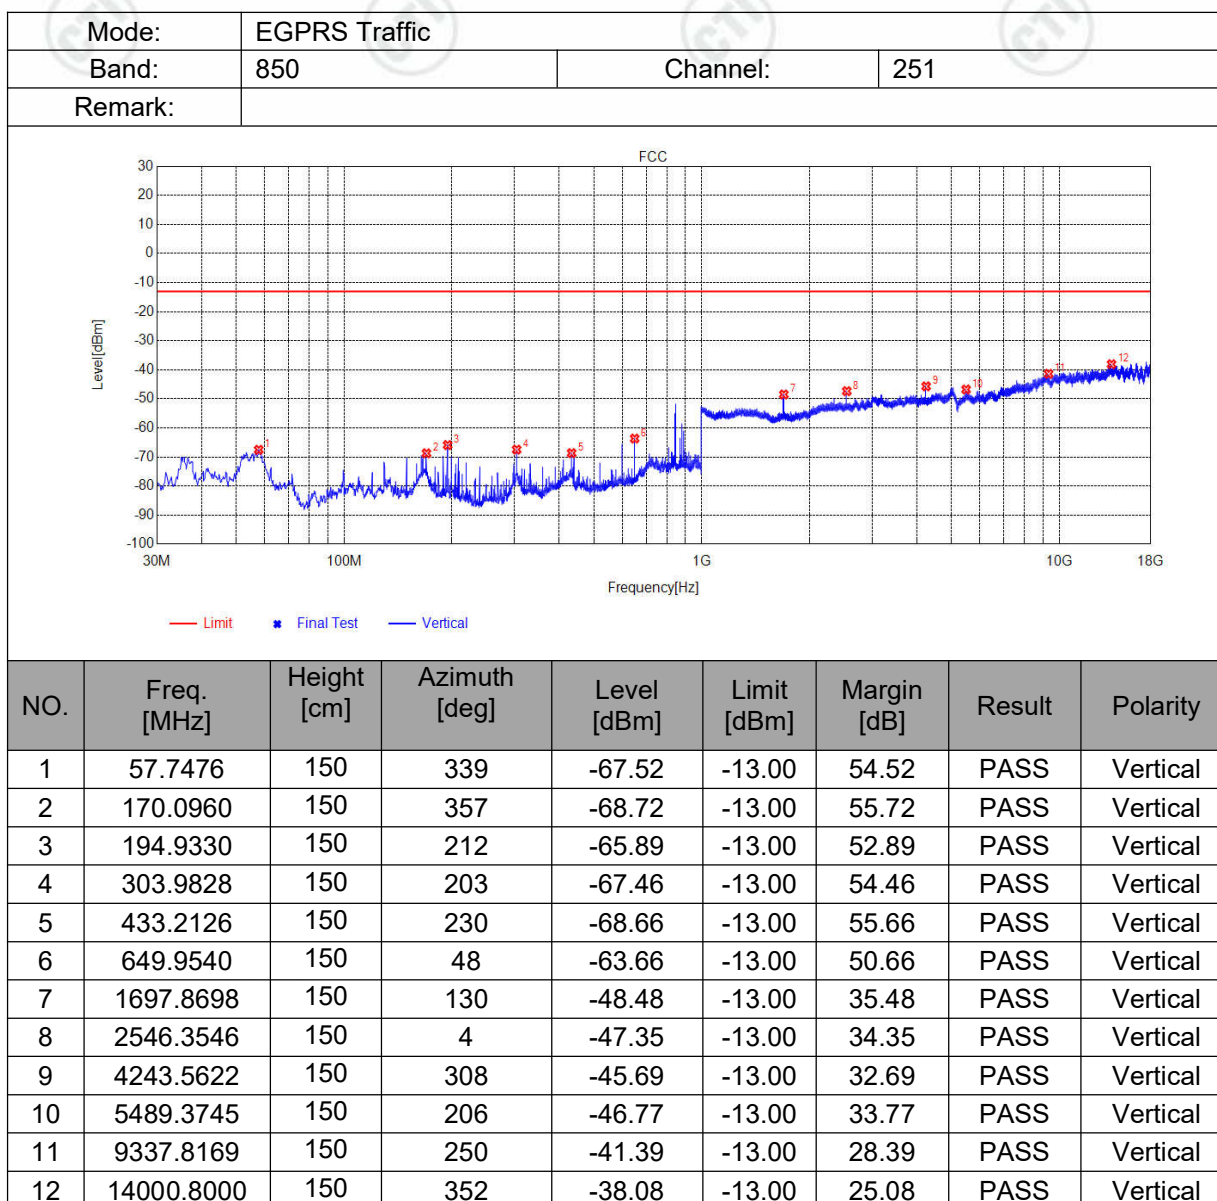


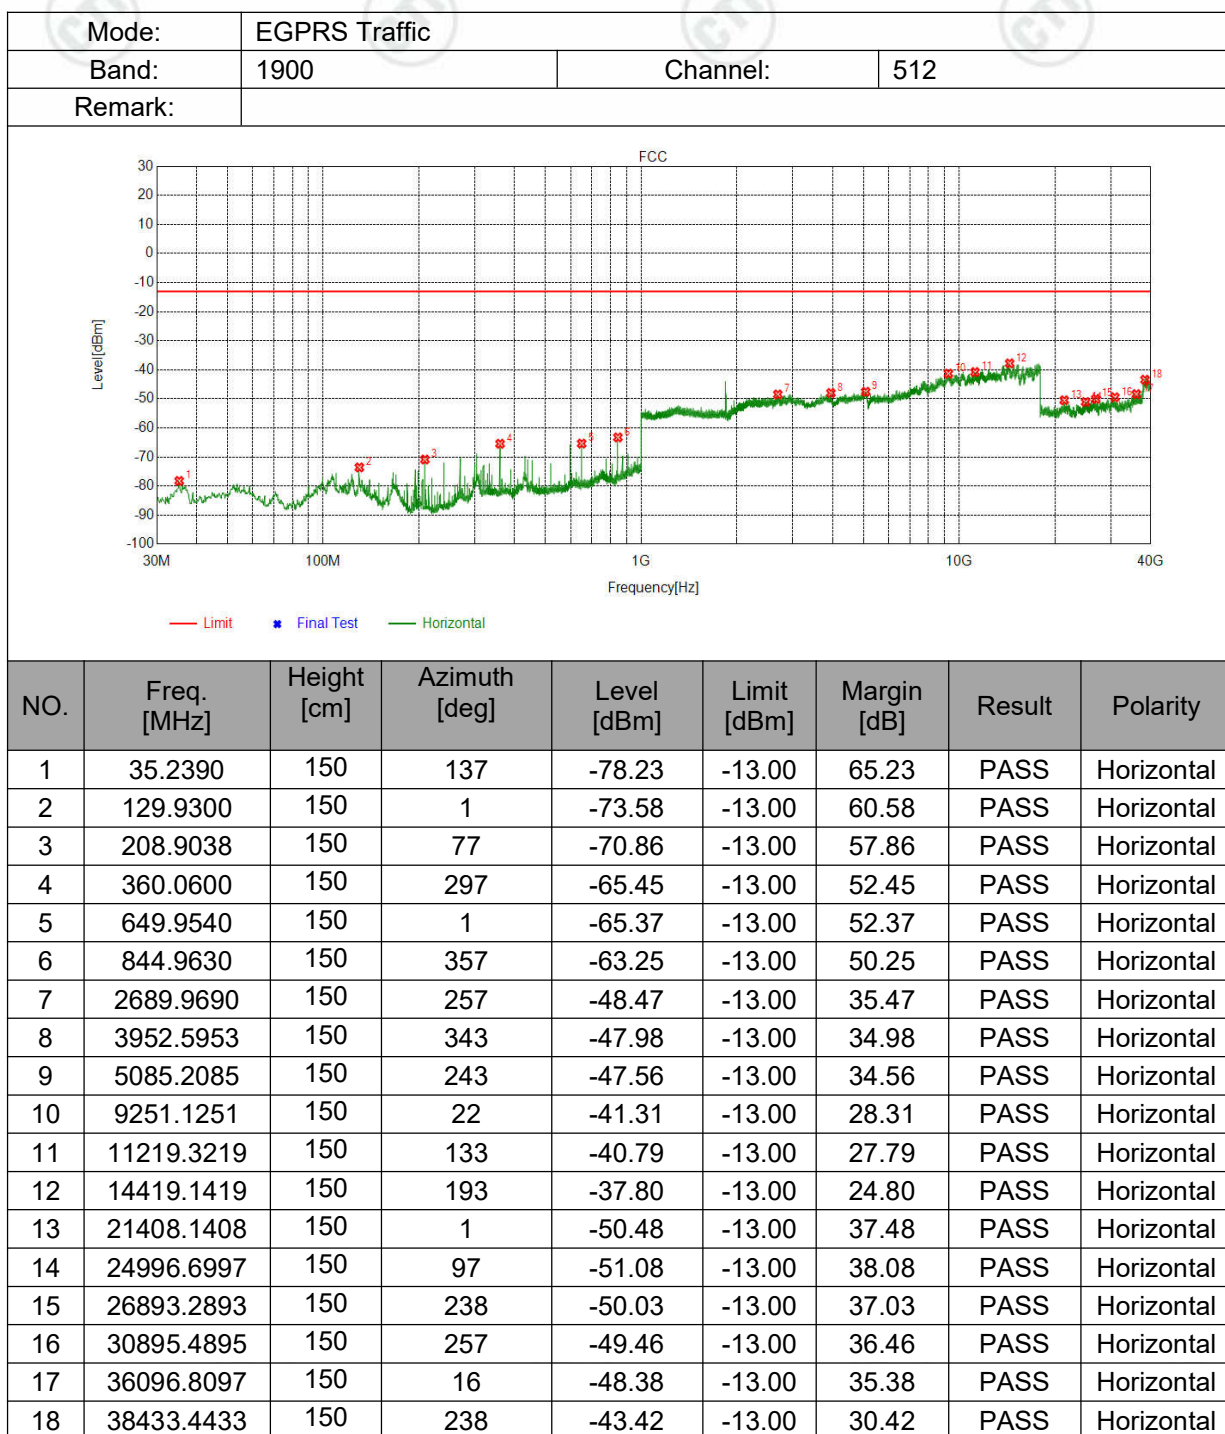


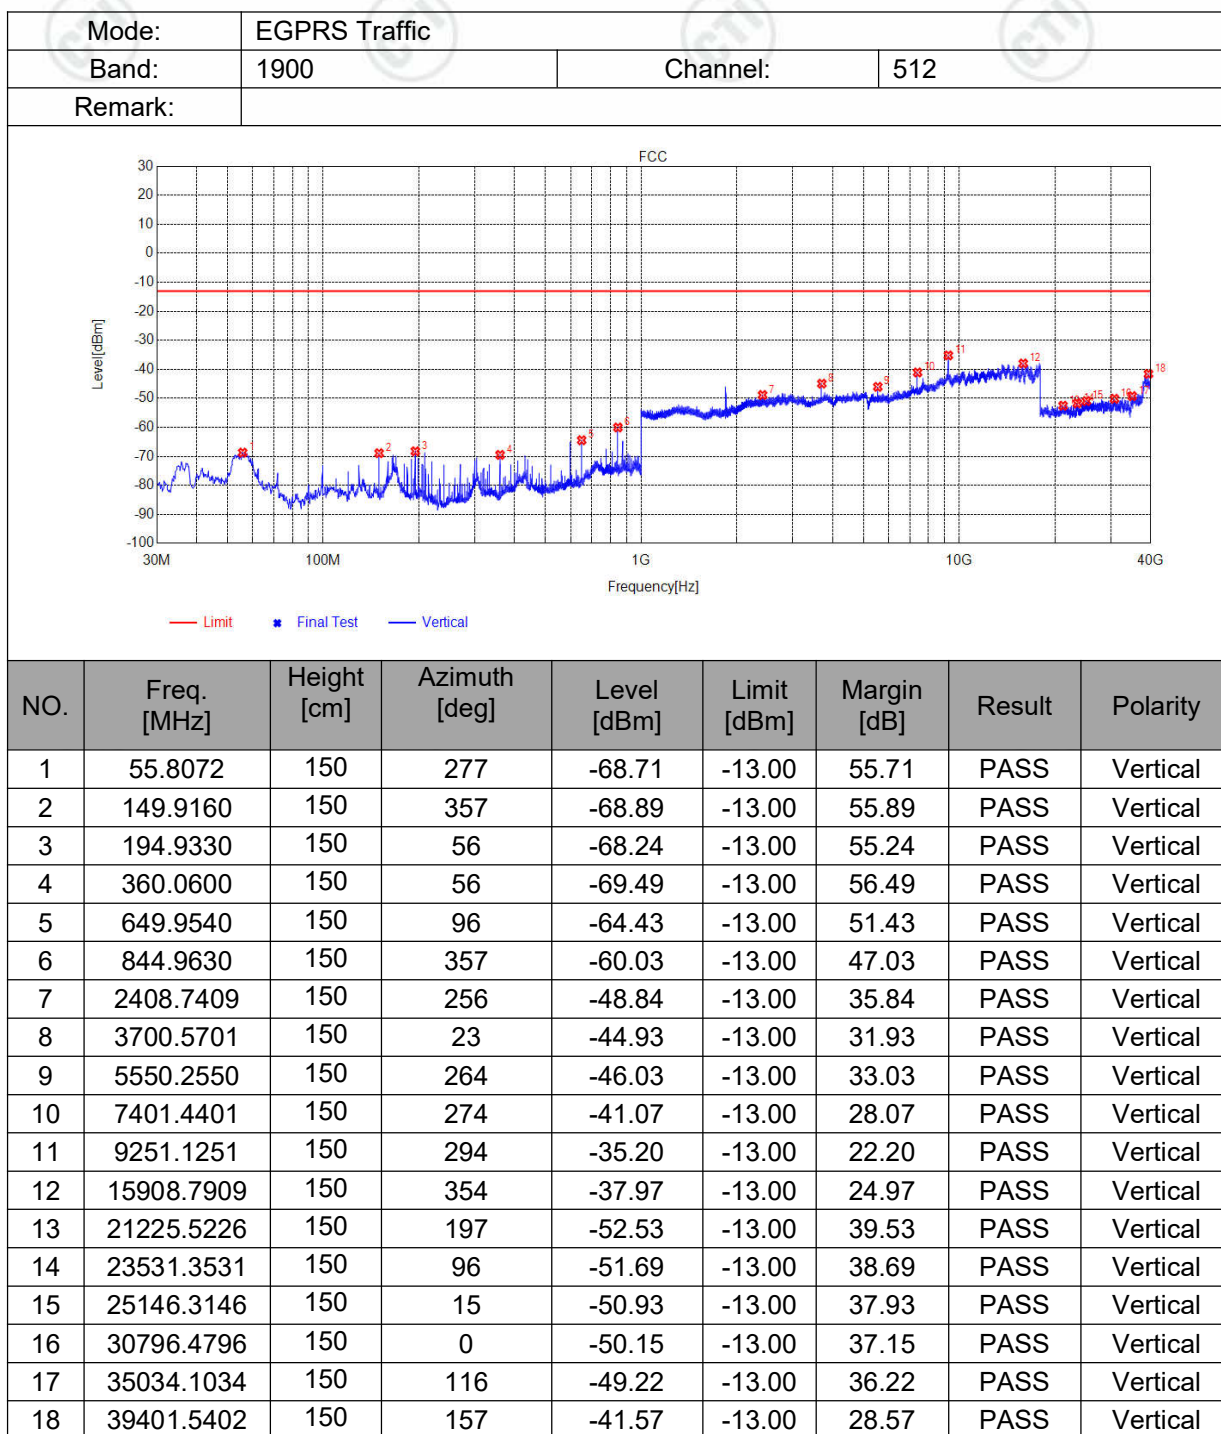


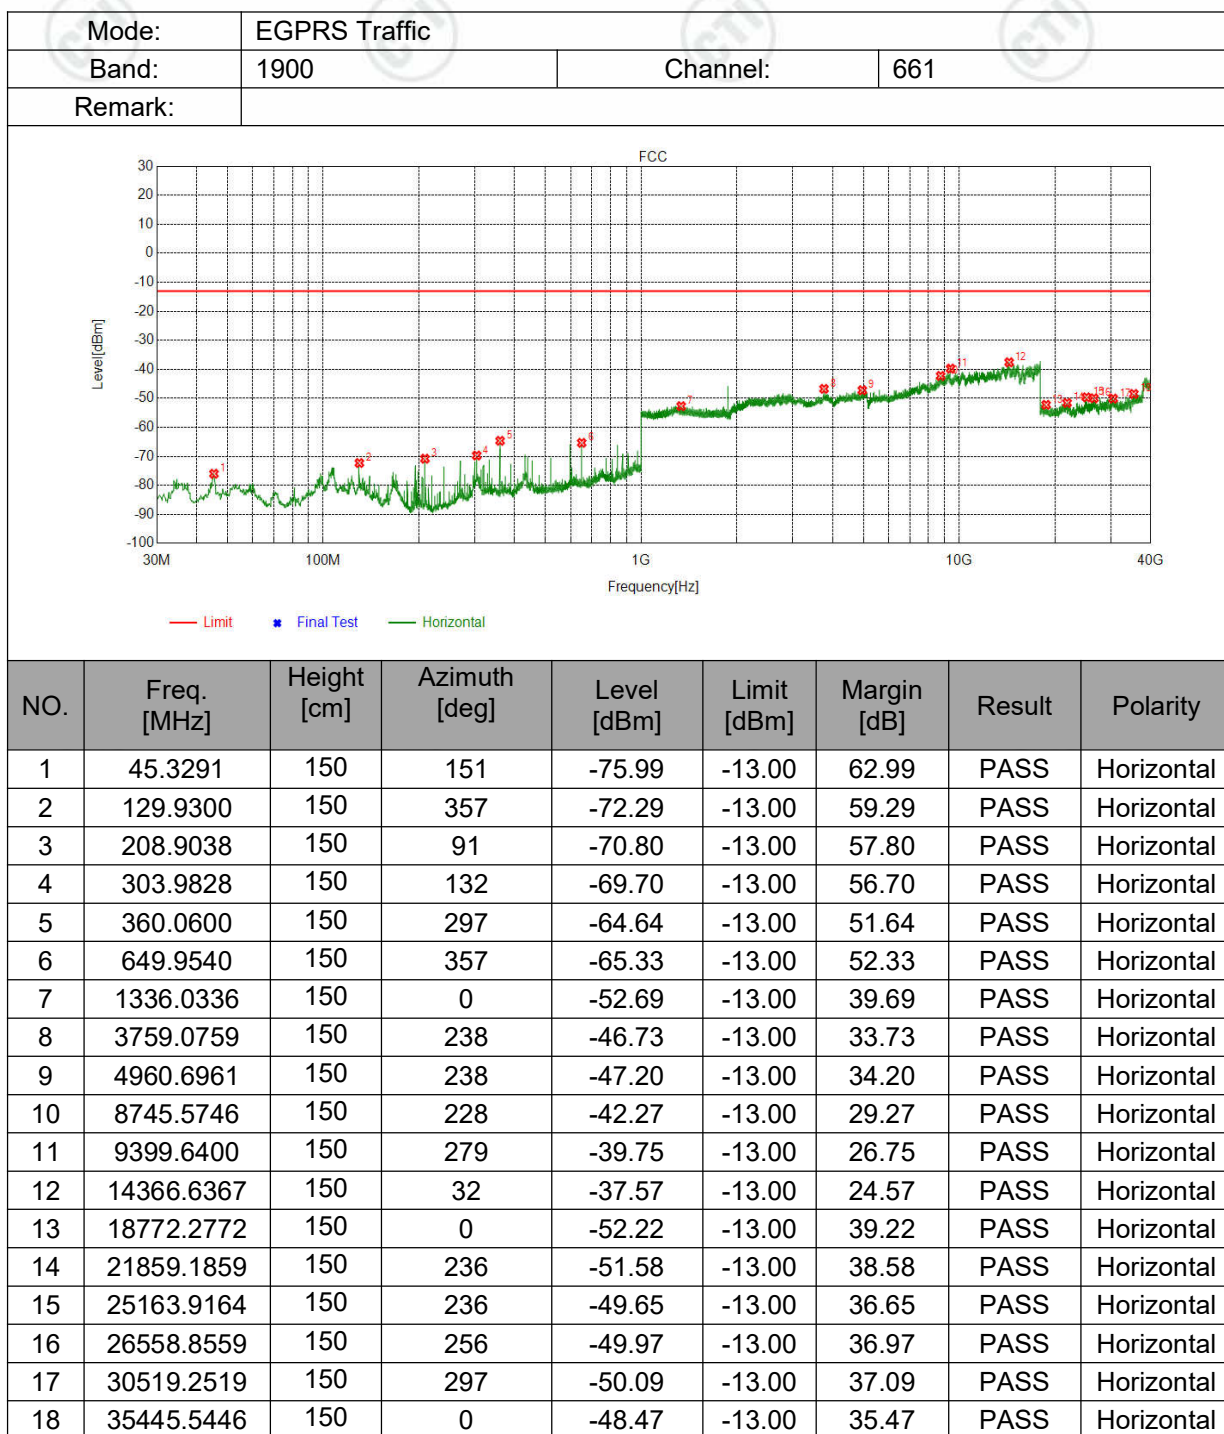


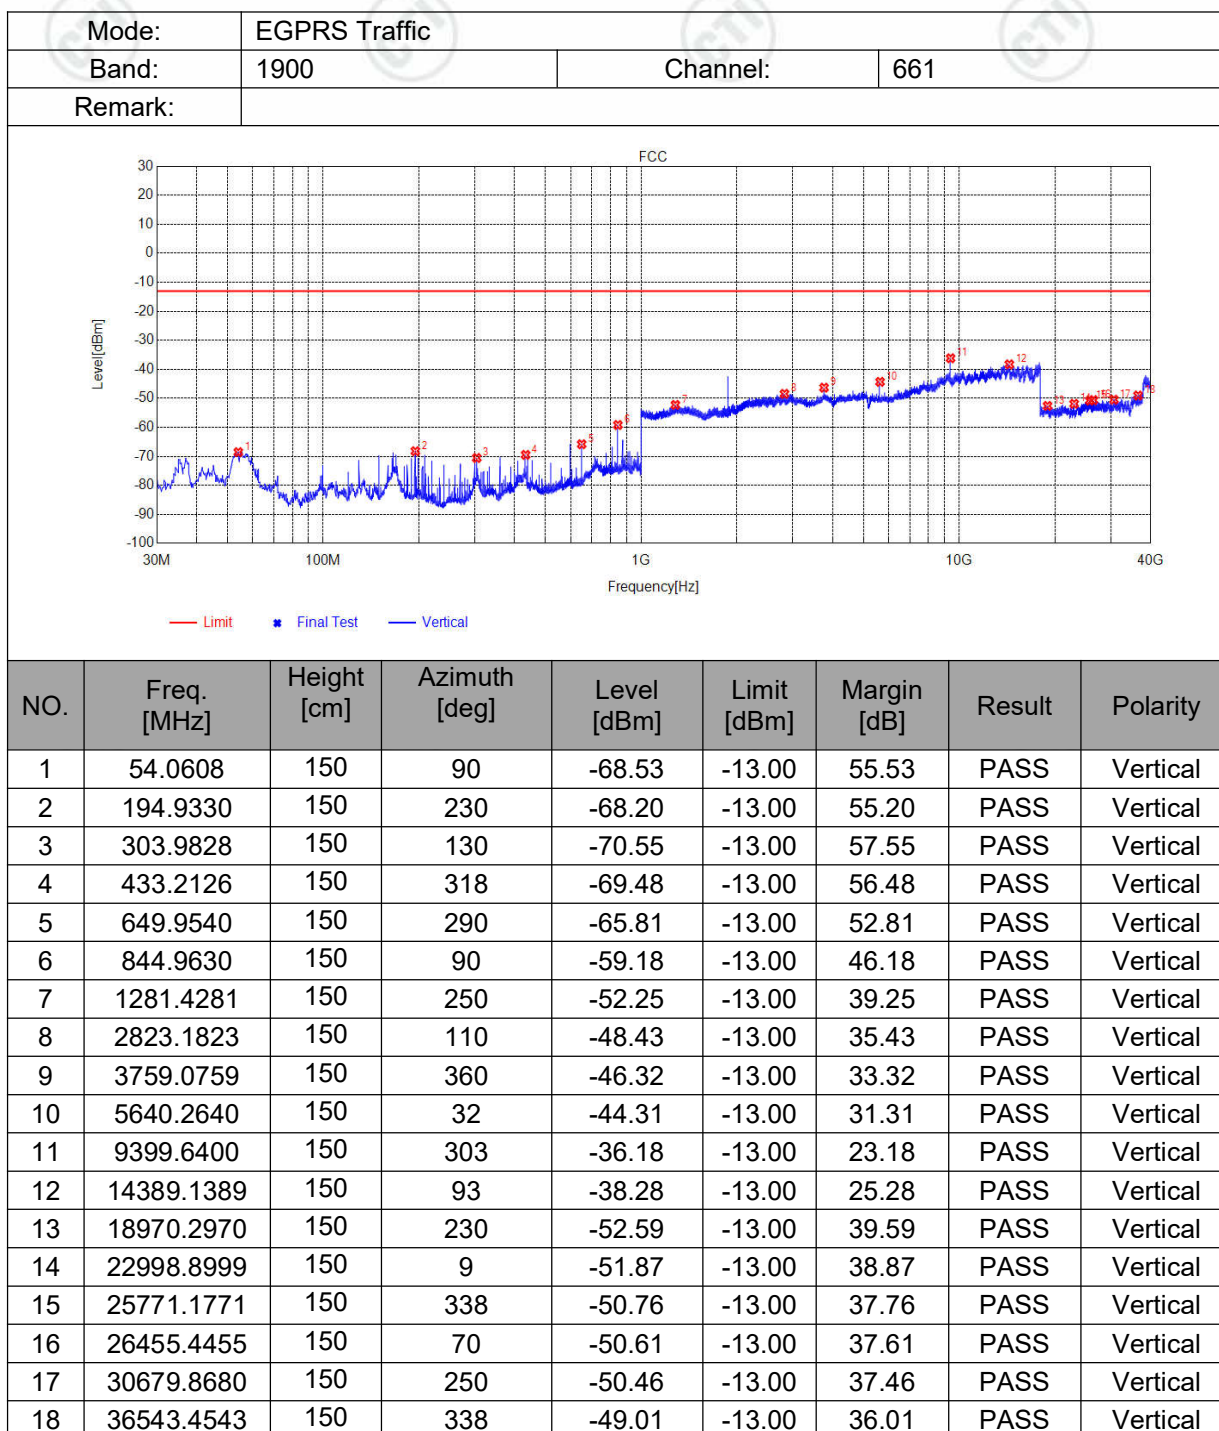


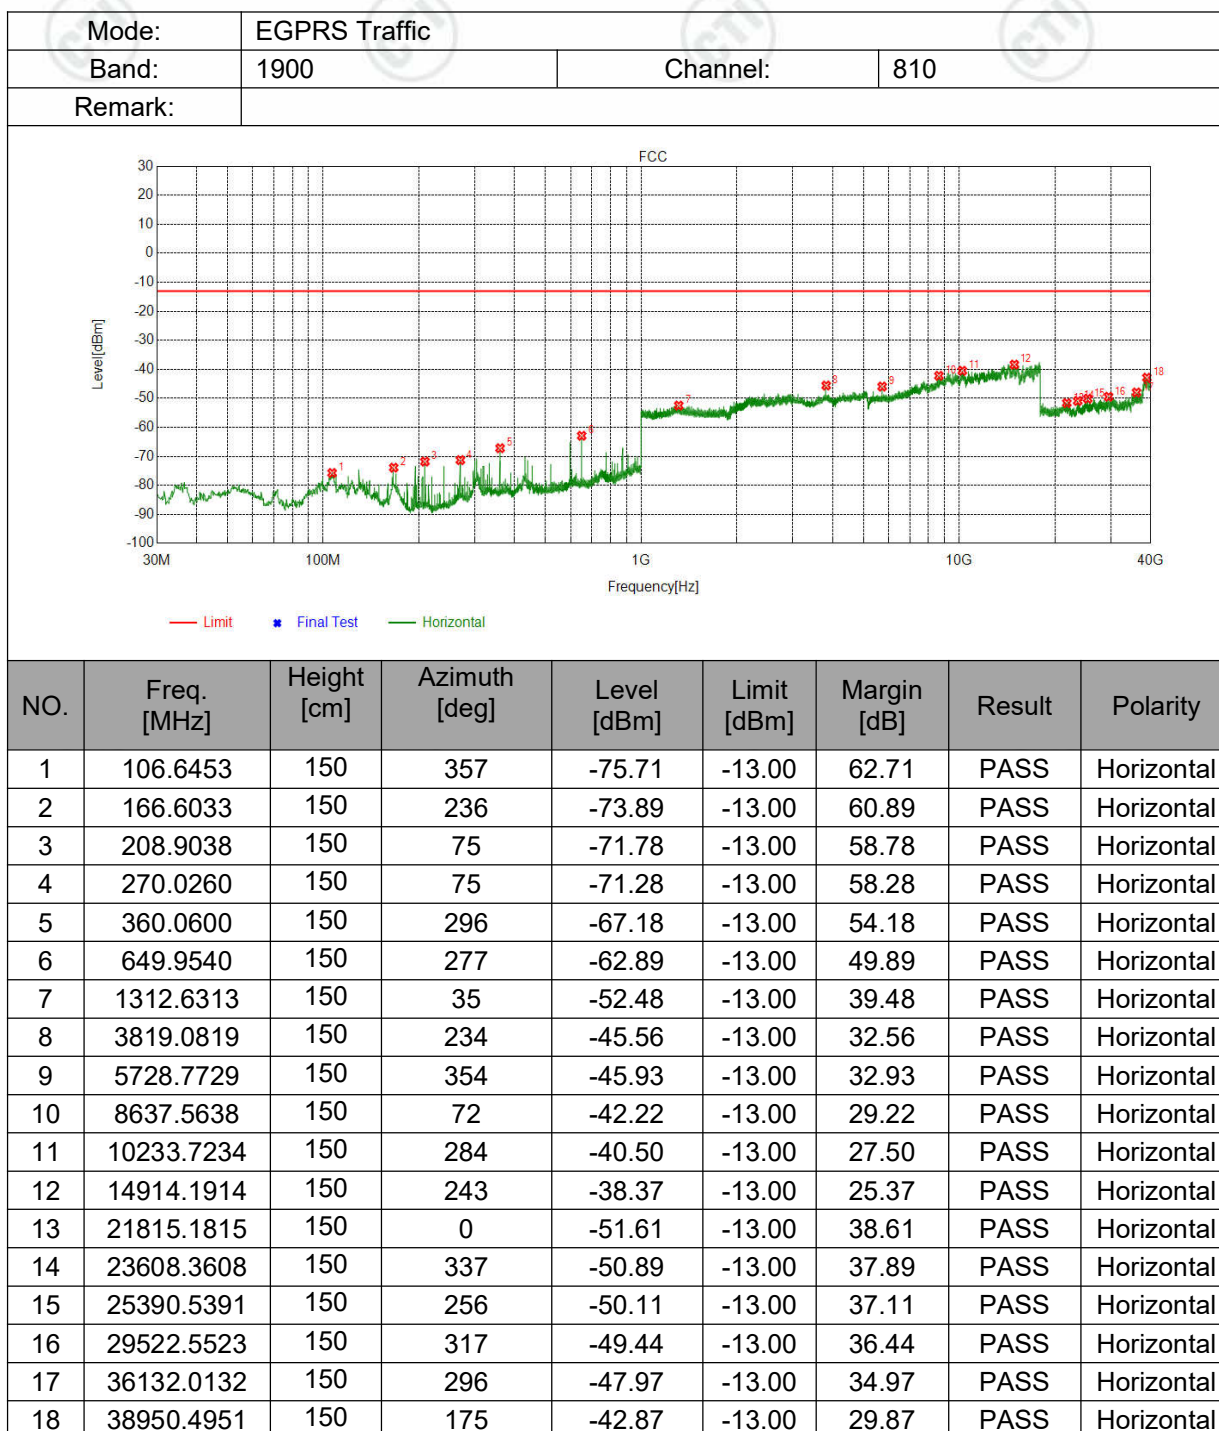


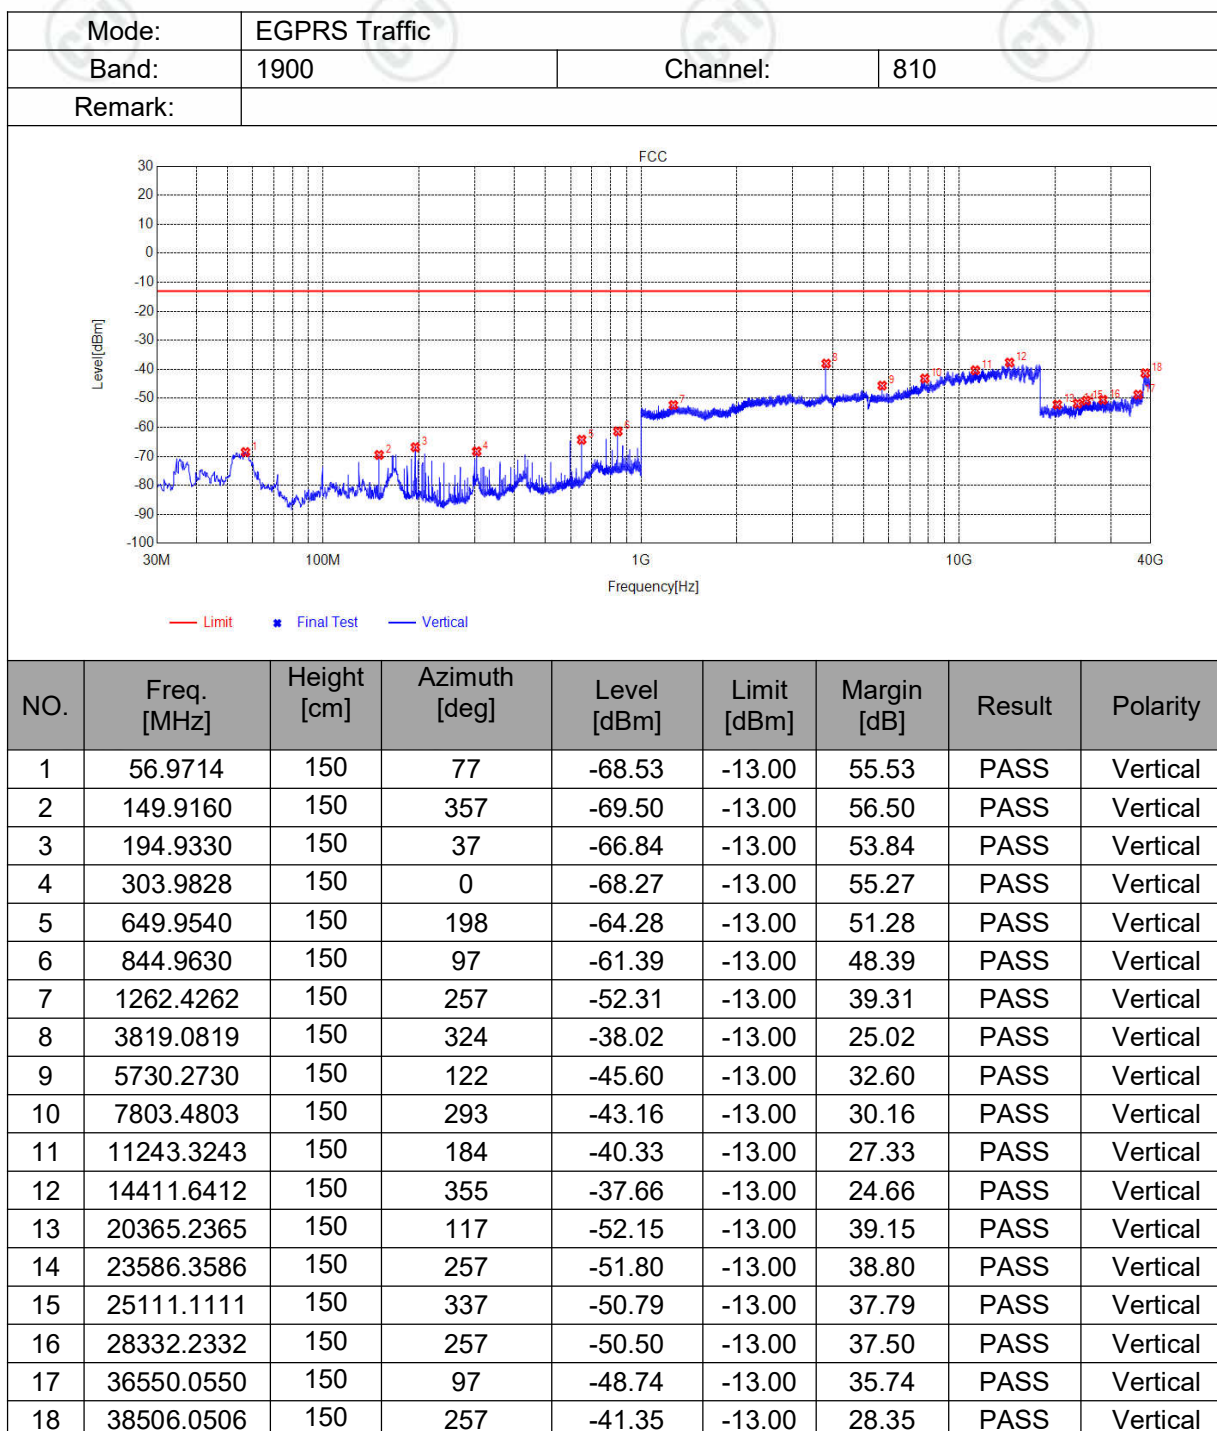


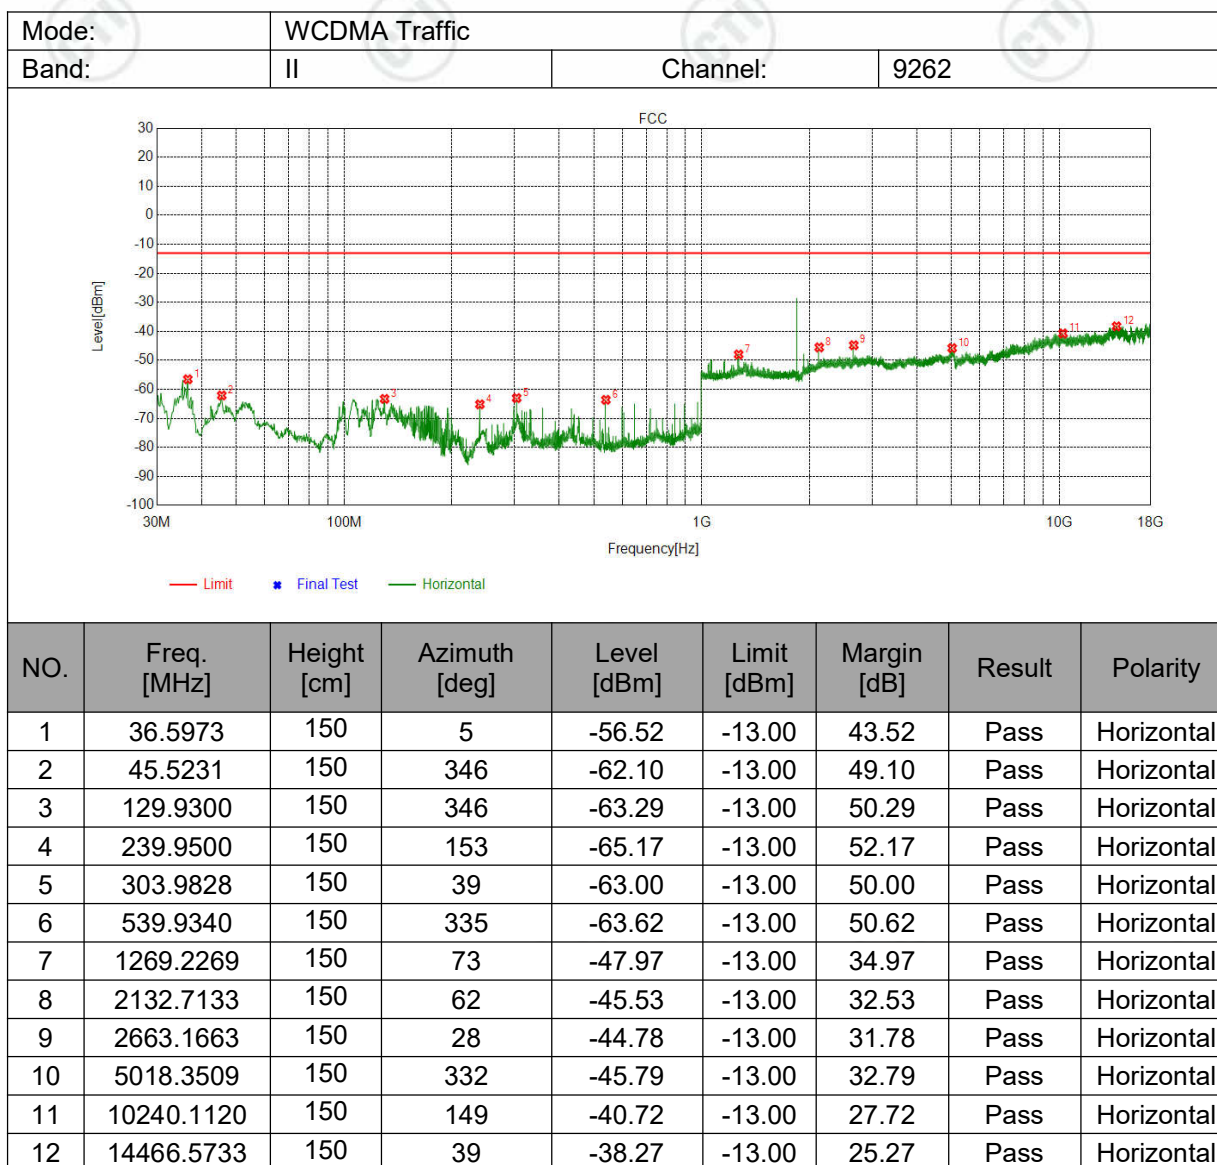


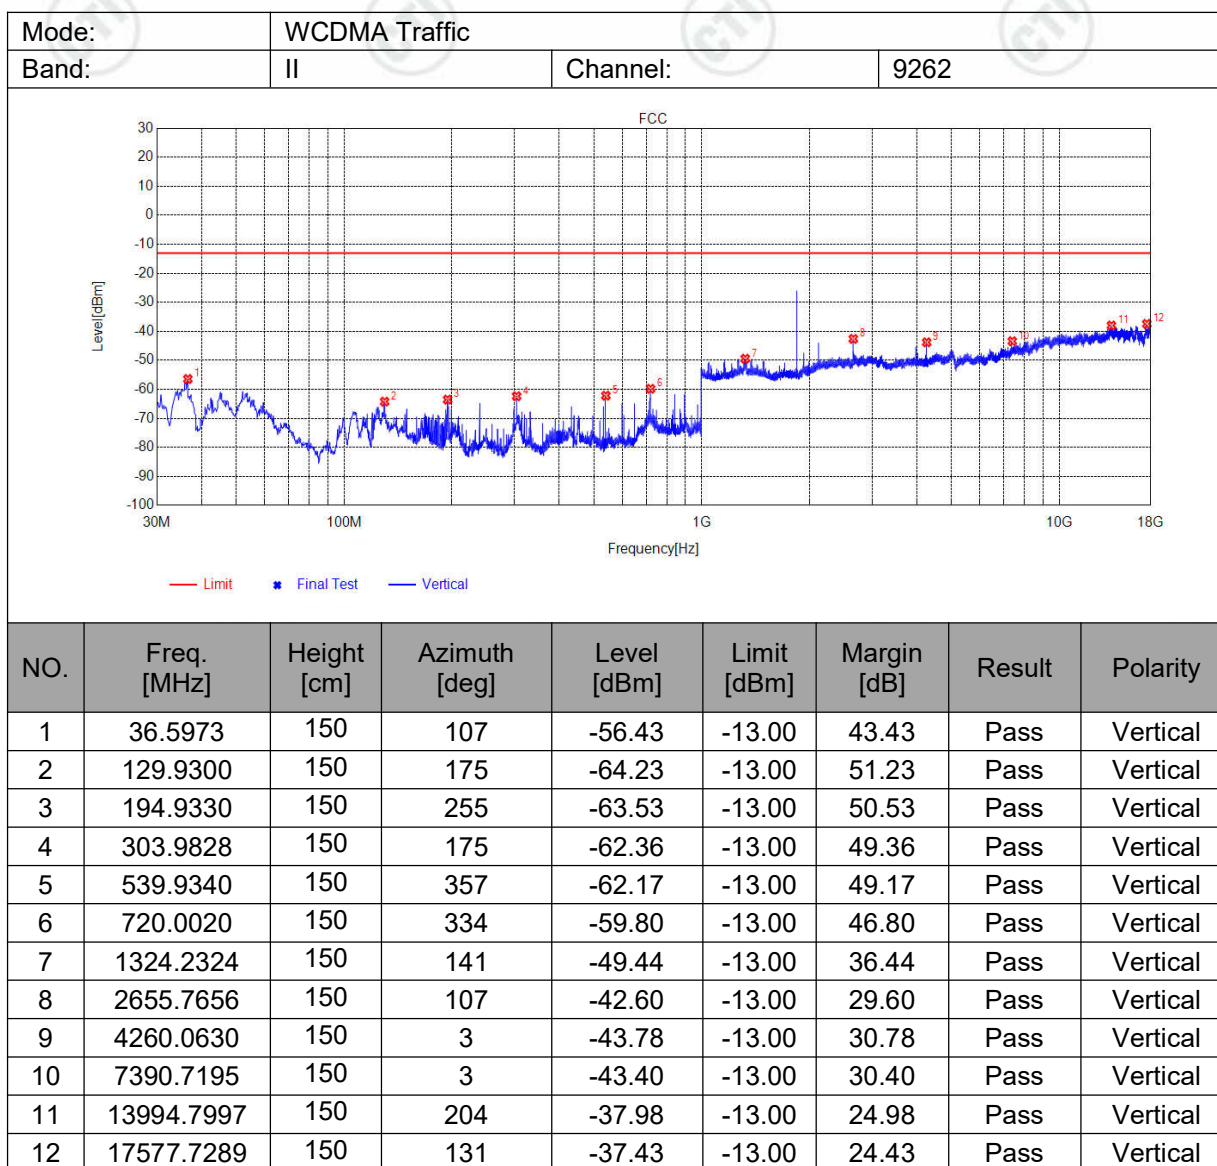


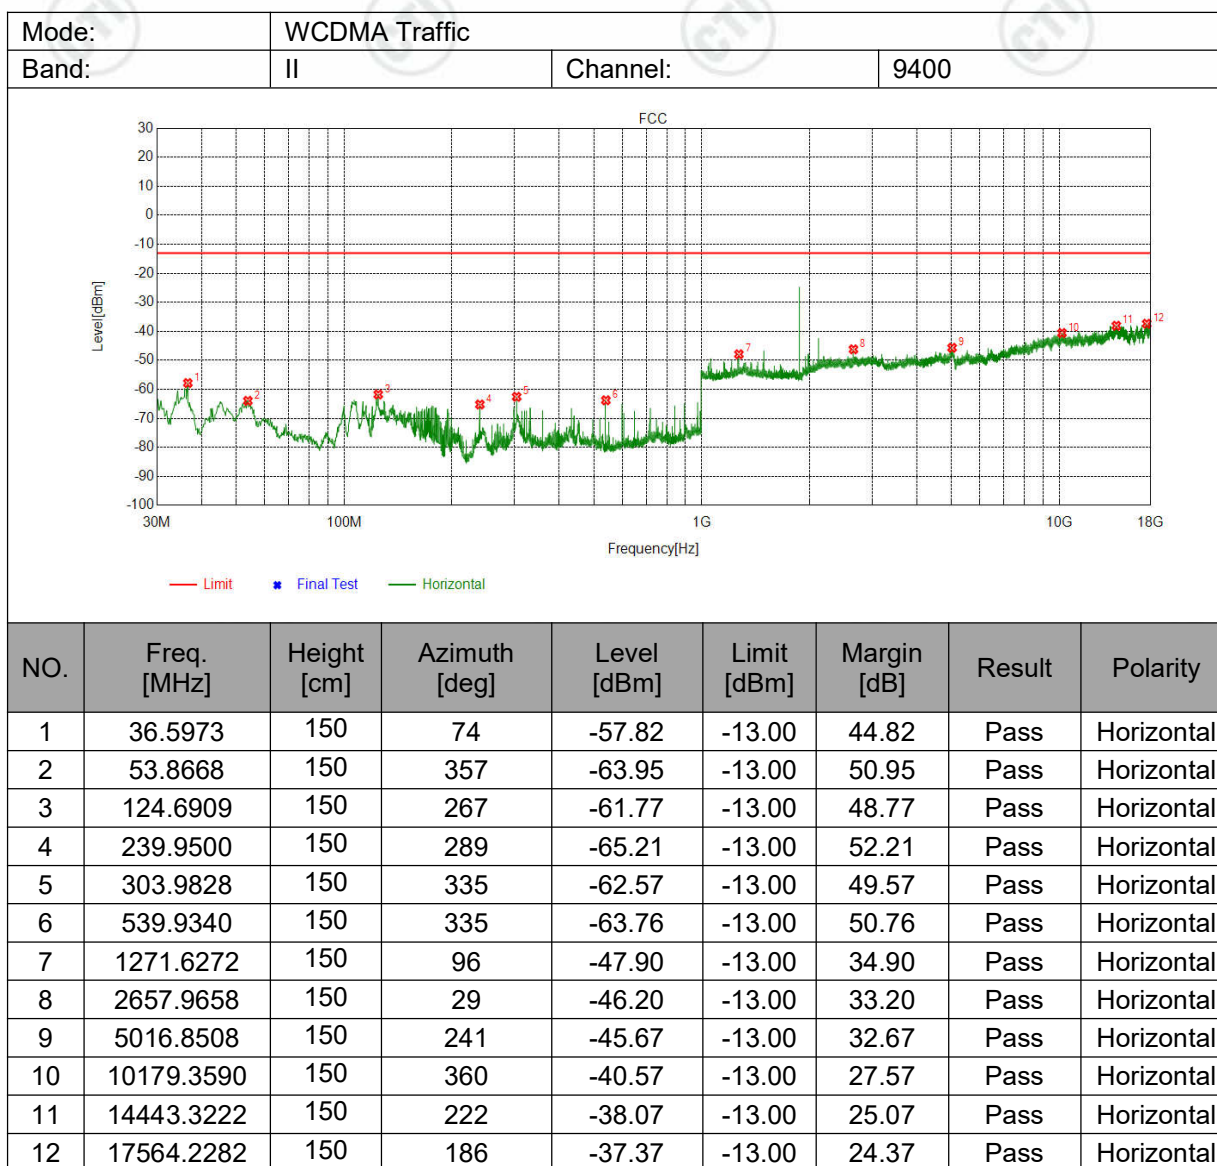


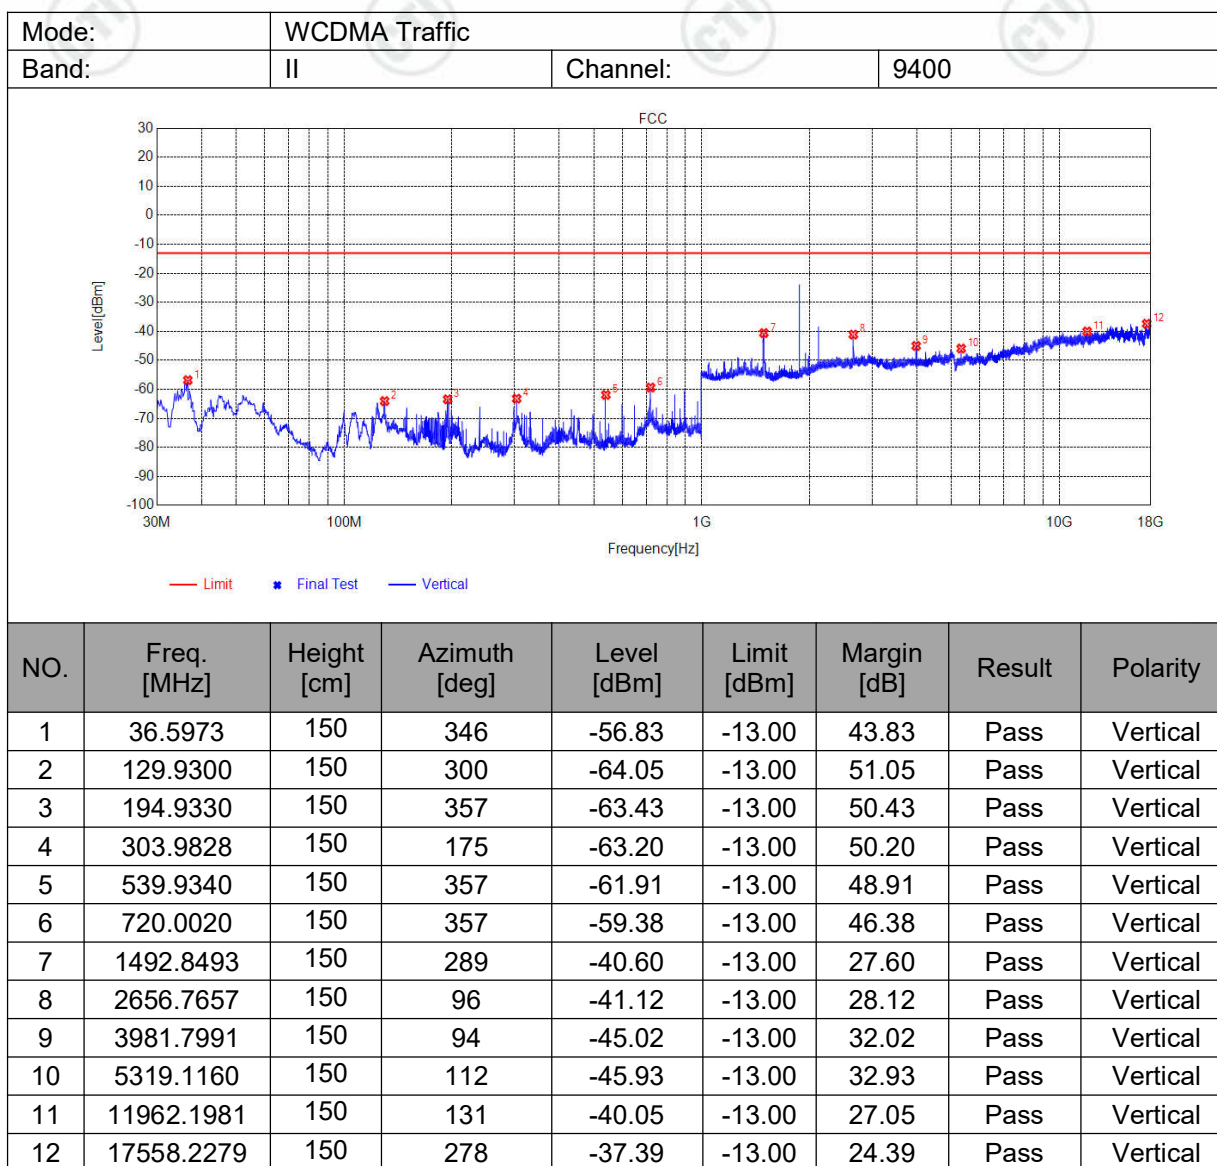


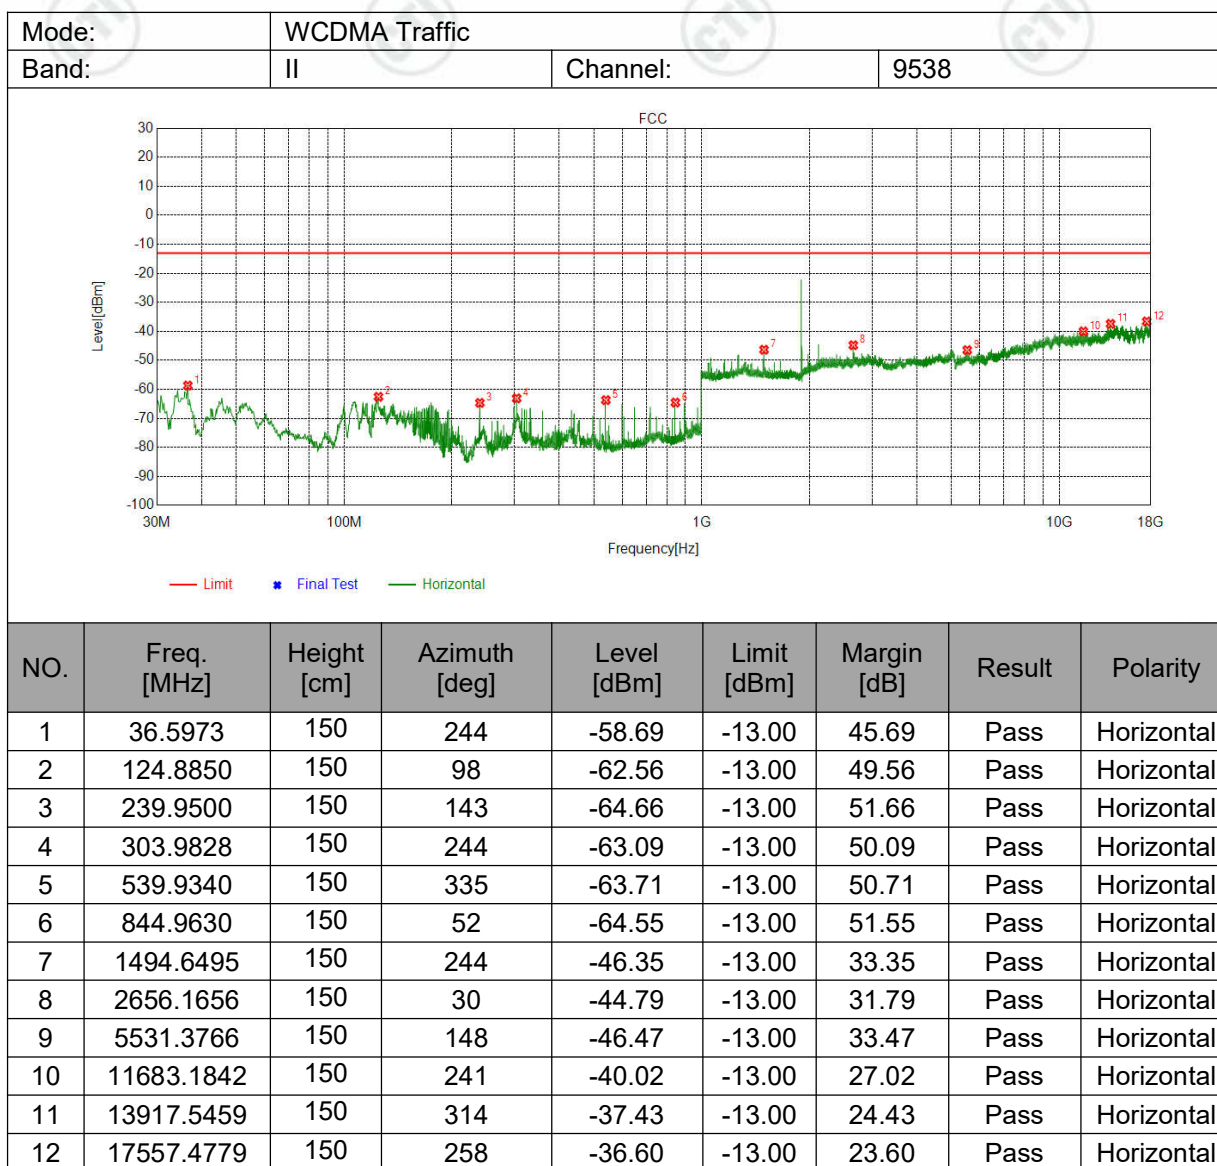


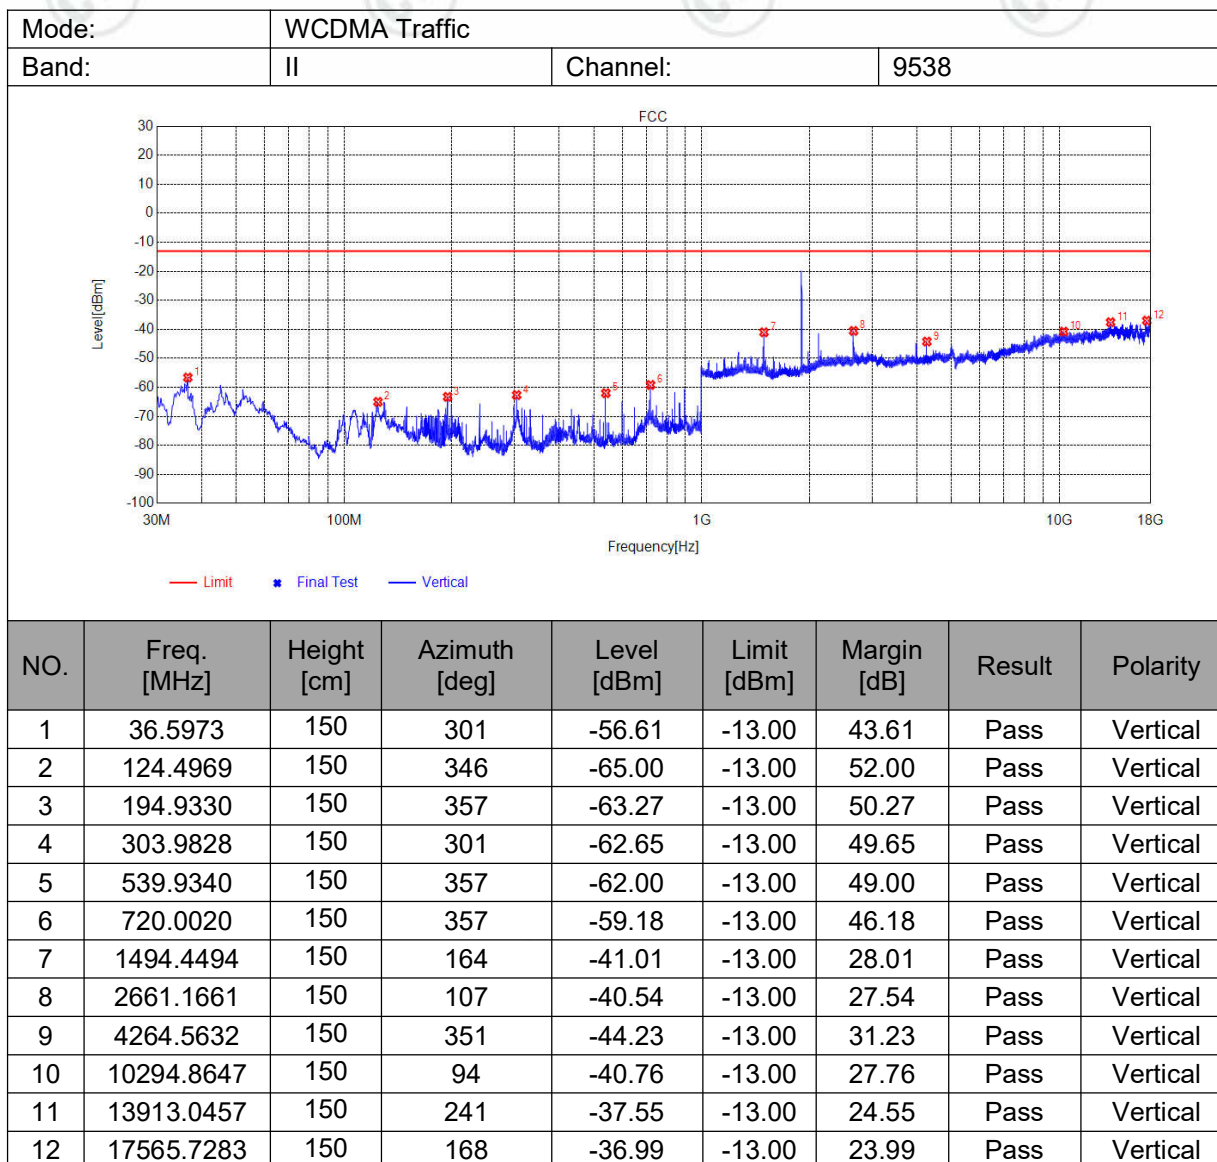


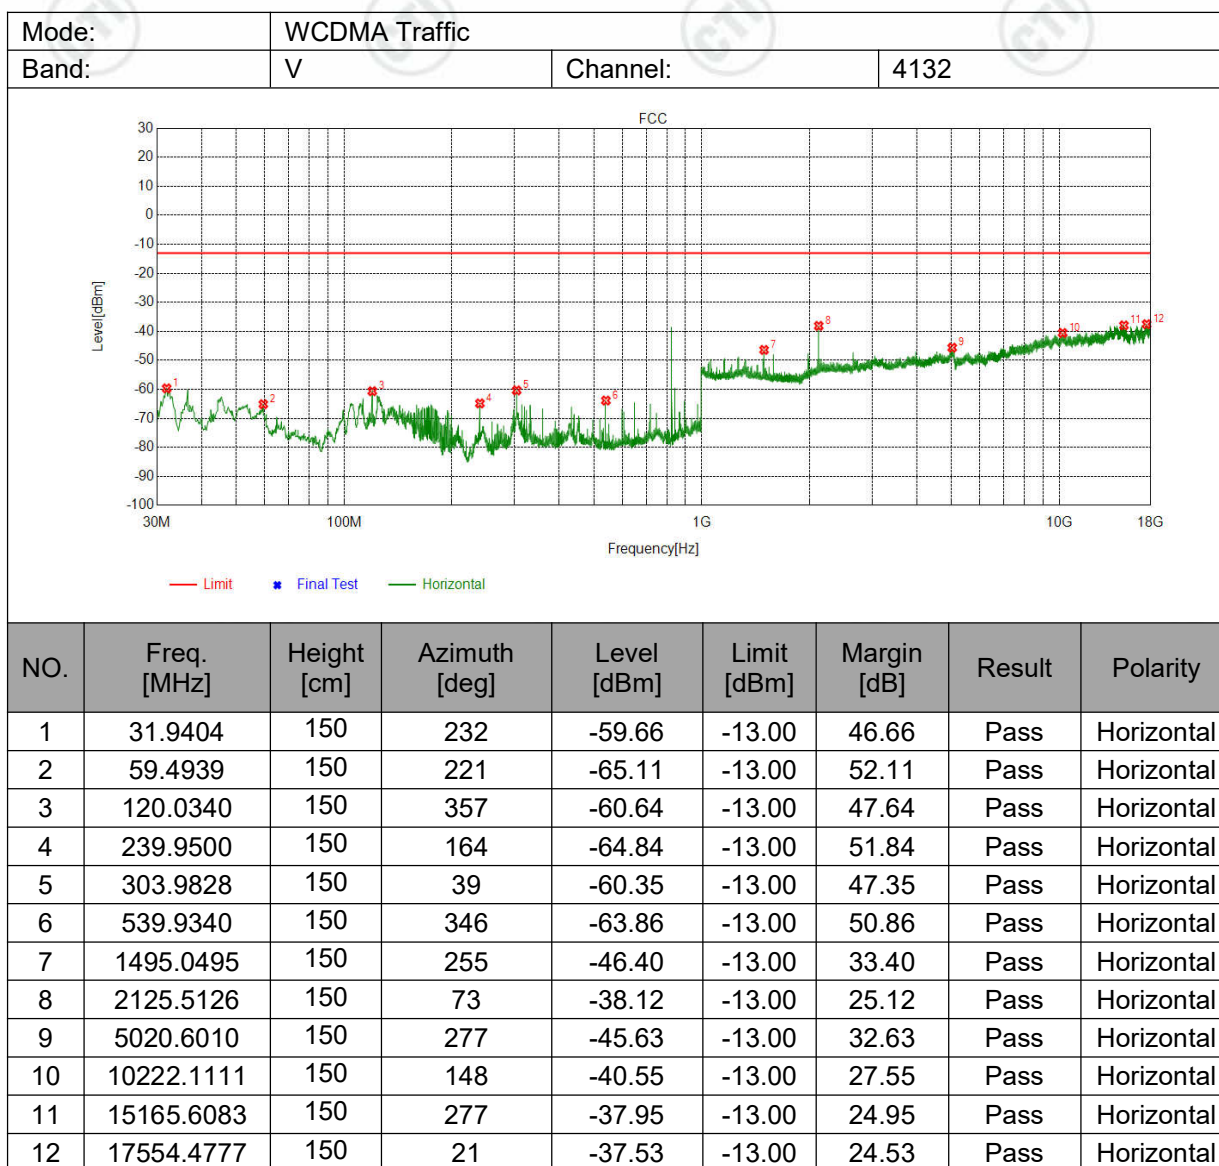


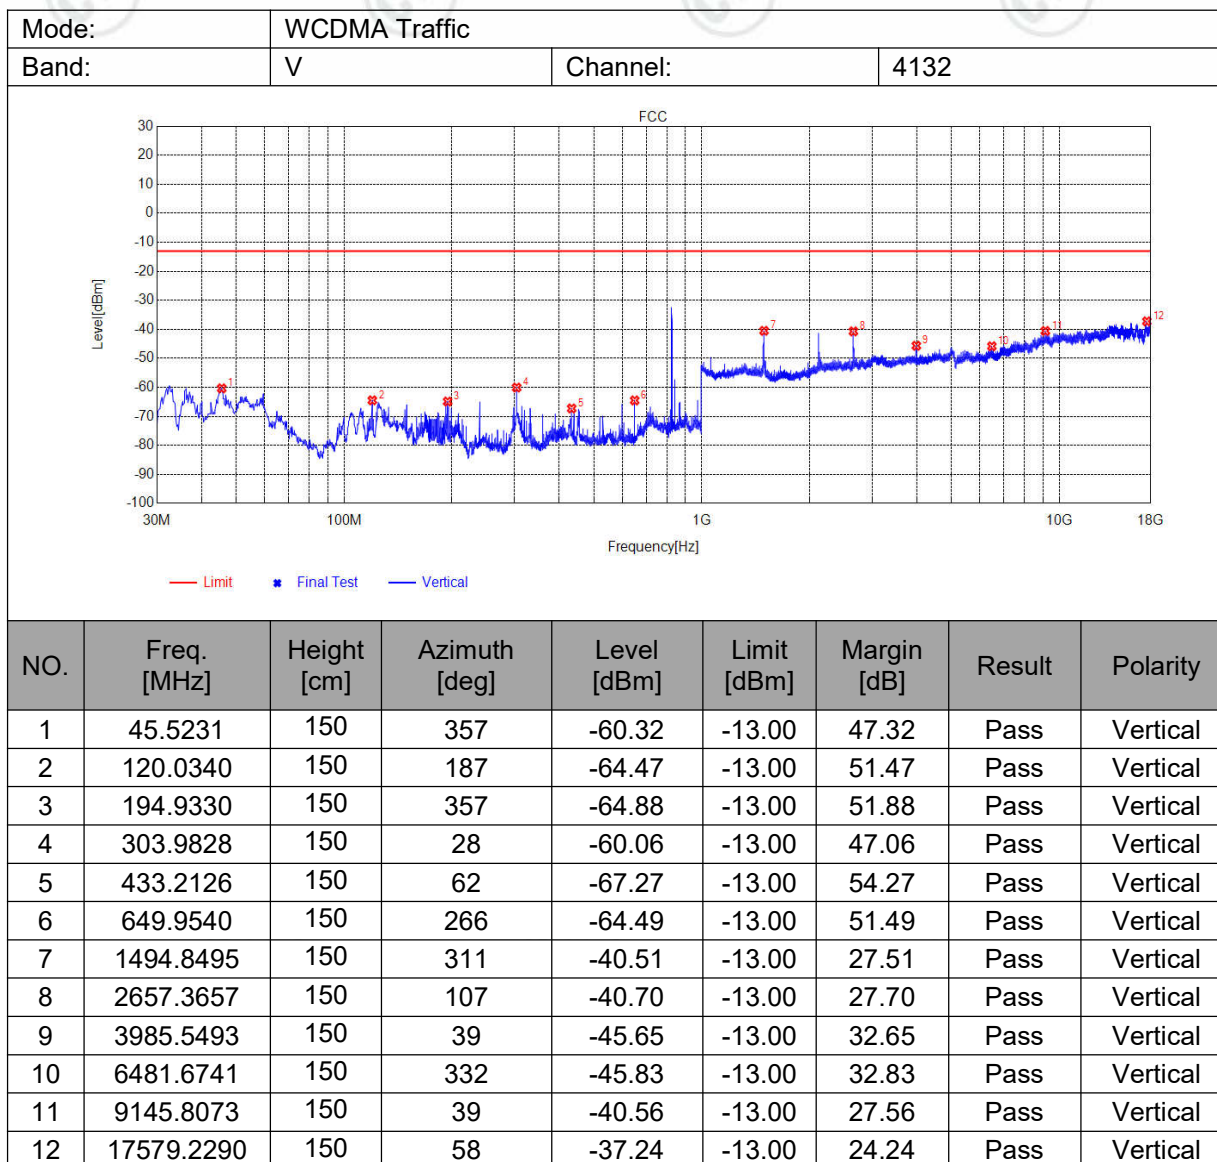

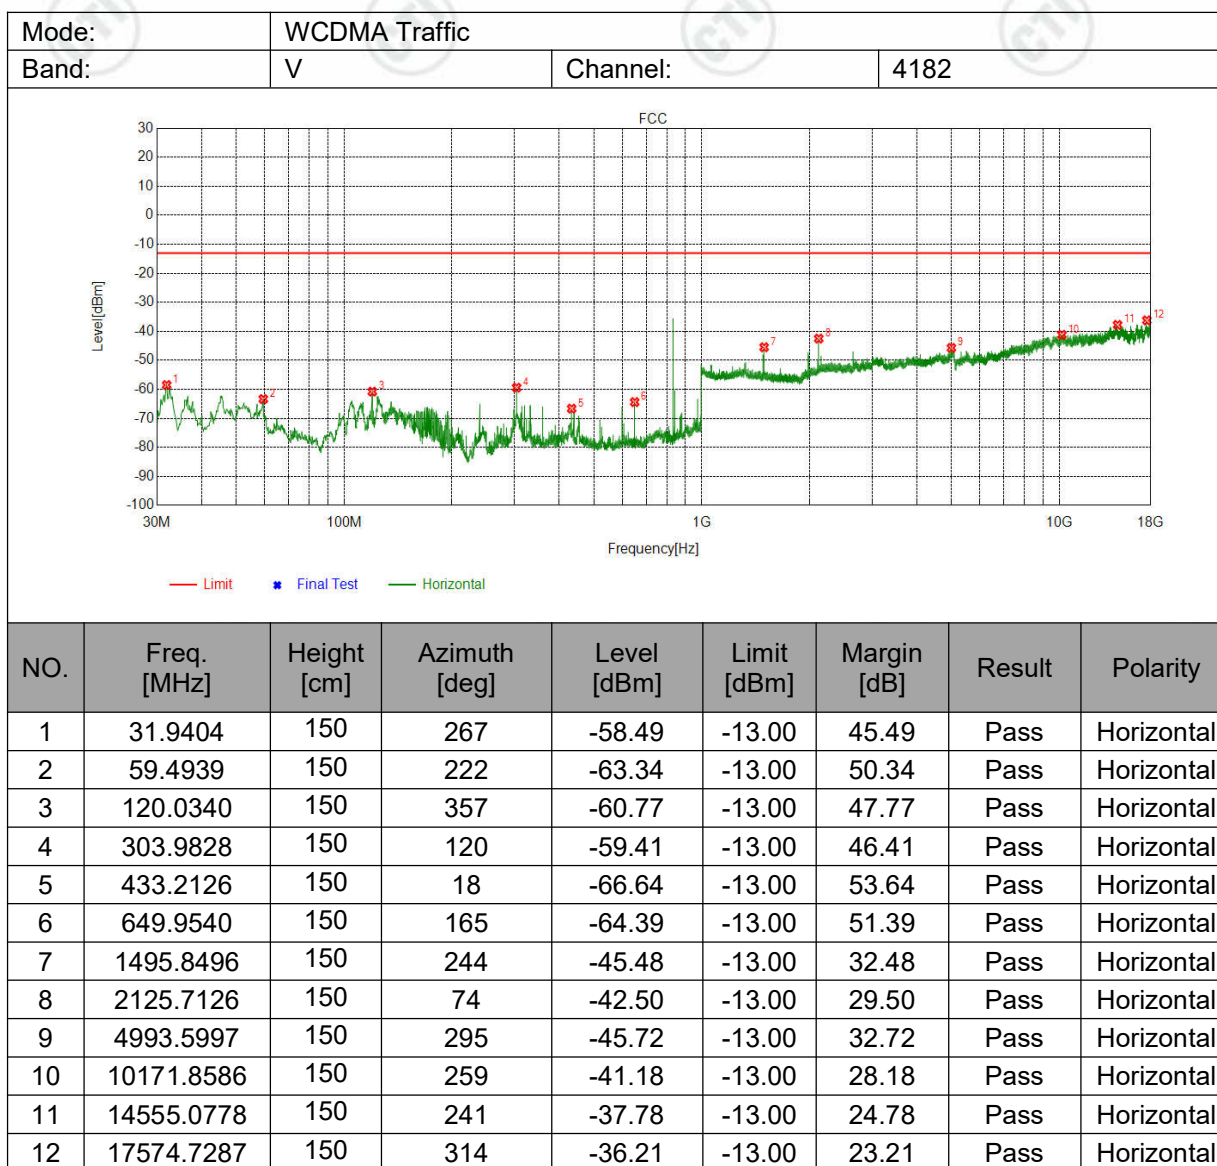

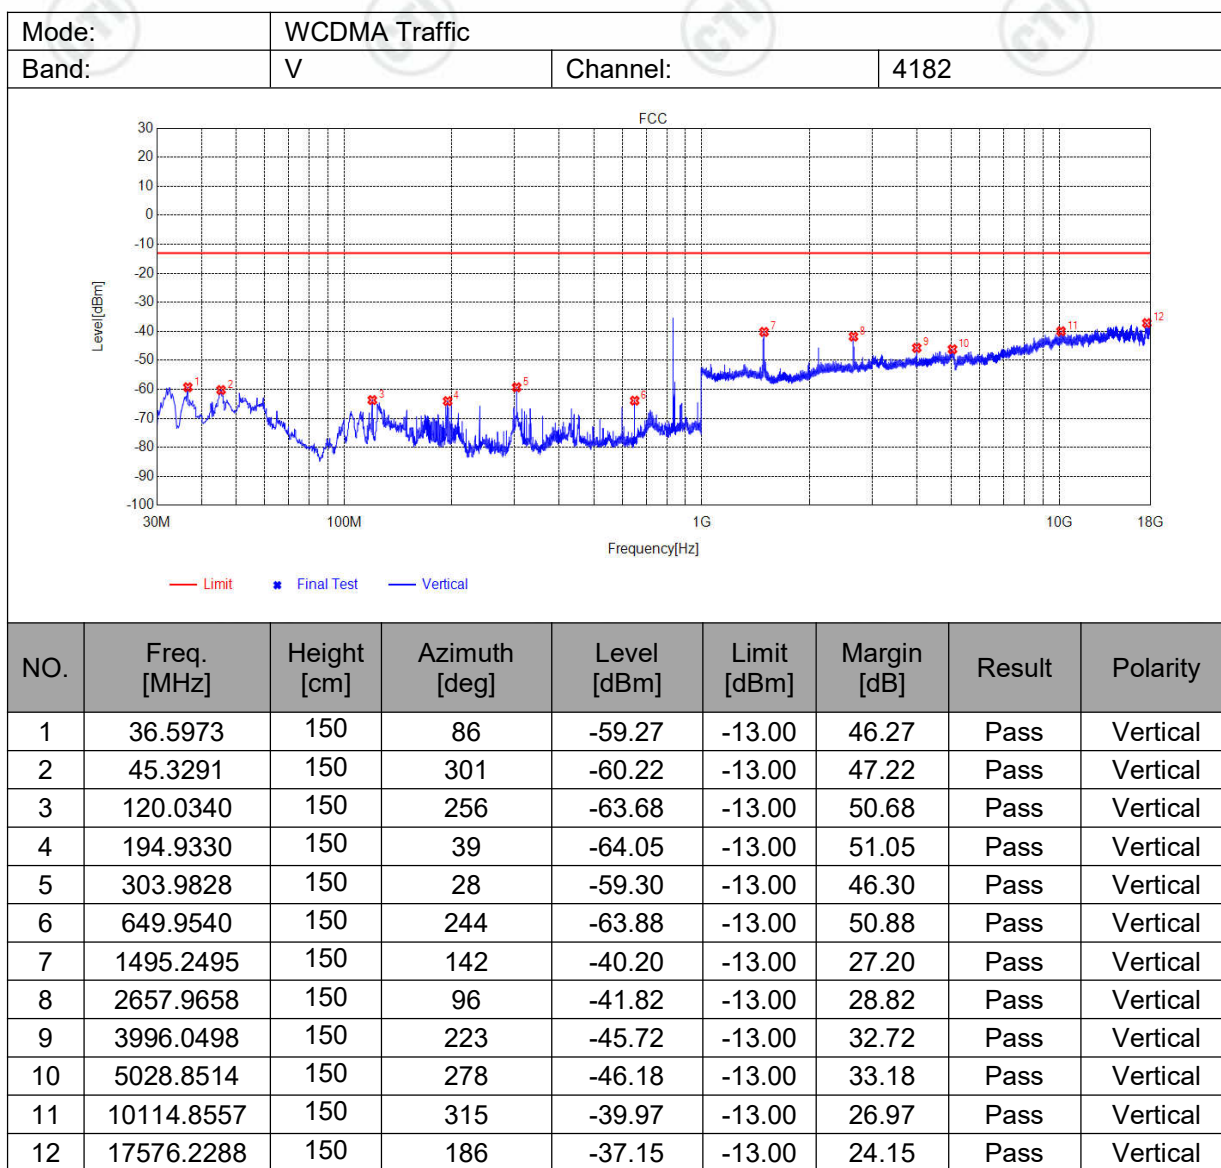

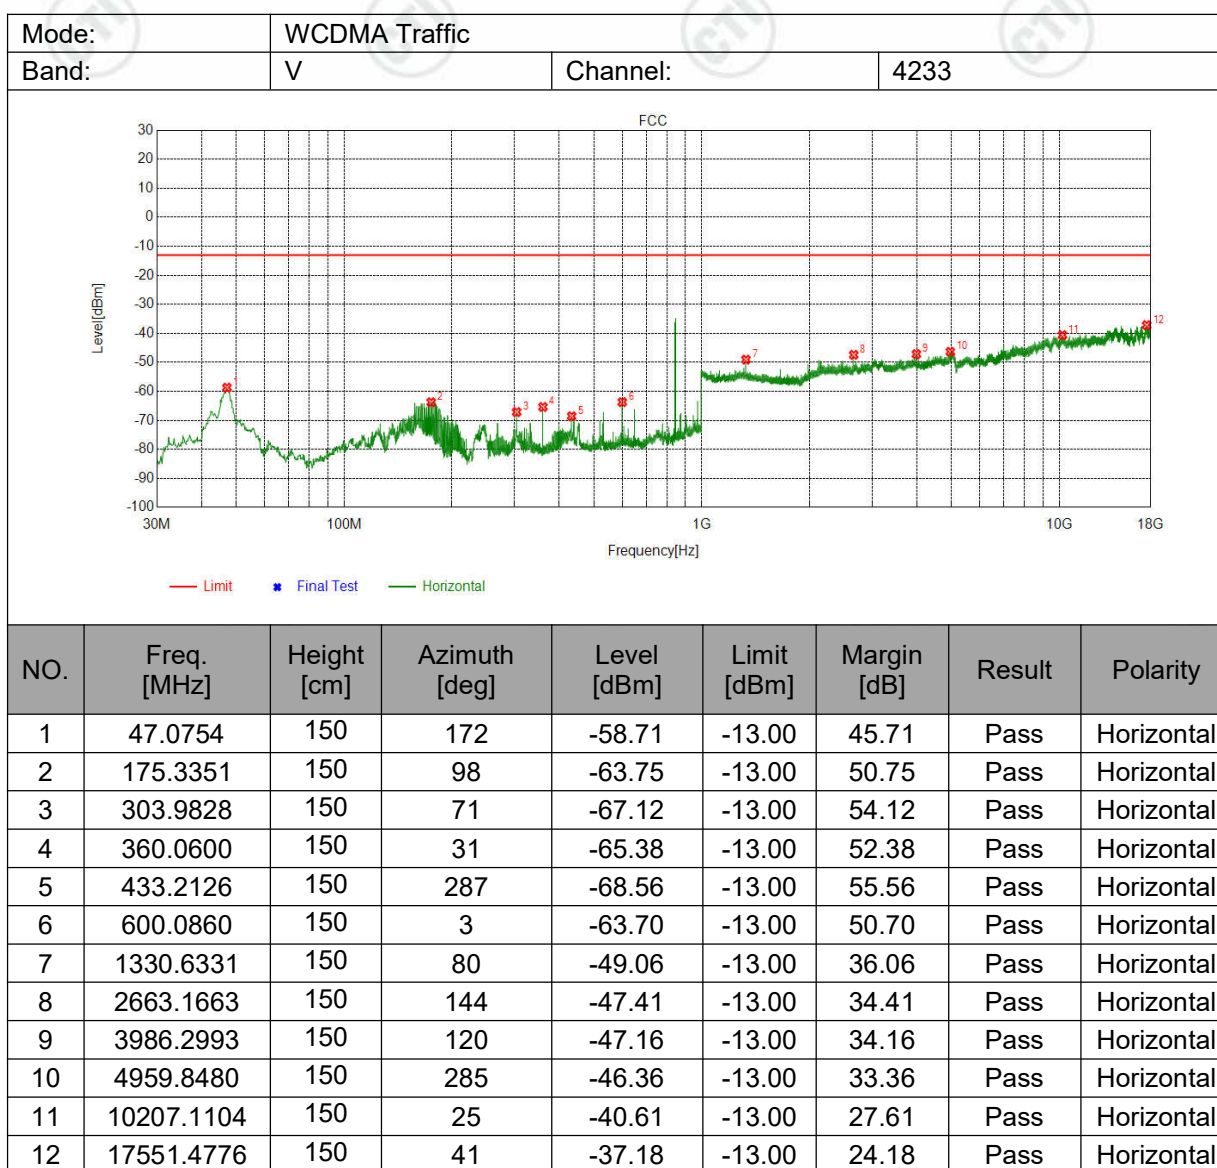

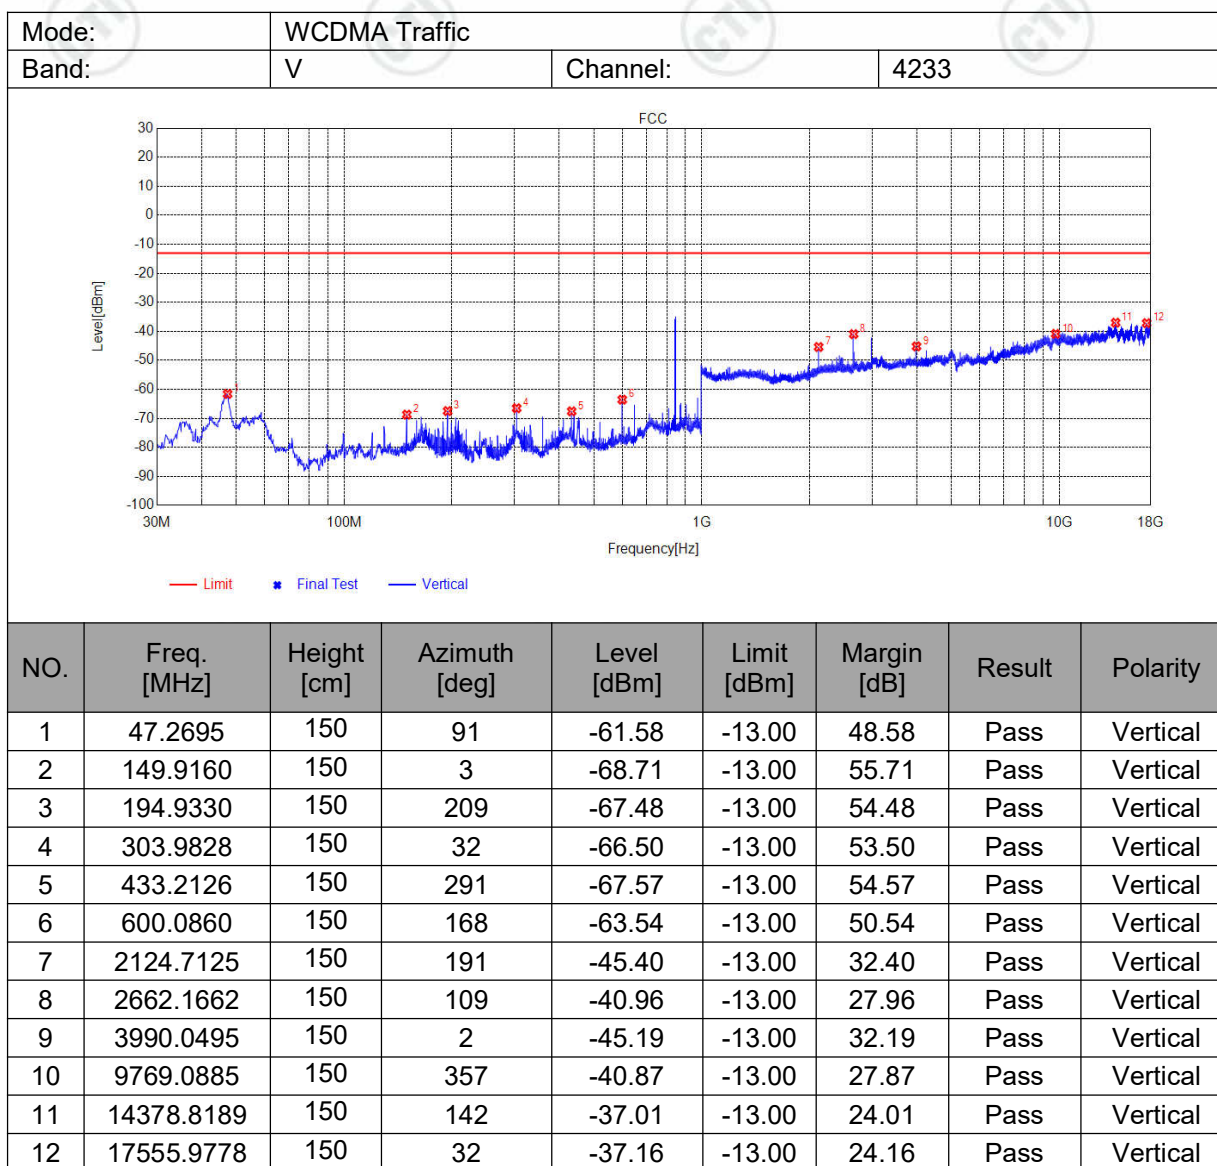

Note:

1) Scan from 9kHz to 25GHz, the disturbance above 18GHz and below 30MHz was very low, and the above harmonics were the highest point could be found when testing, so only the above harmonics had been displayed. The amplitude of spurious emissions from the radiator which are attenuated more than 20dB below the limit need not be reported.