



11G_Ant1_Low_2412_Peak




11G_Ant1_High_2462_AV

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

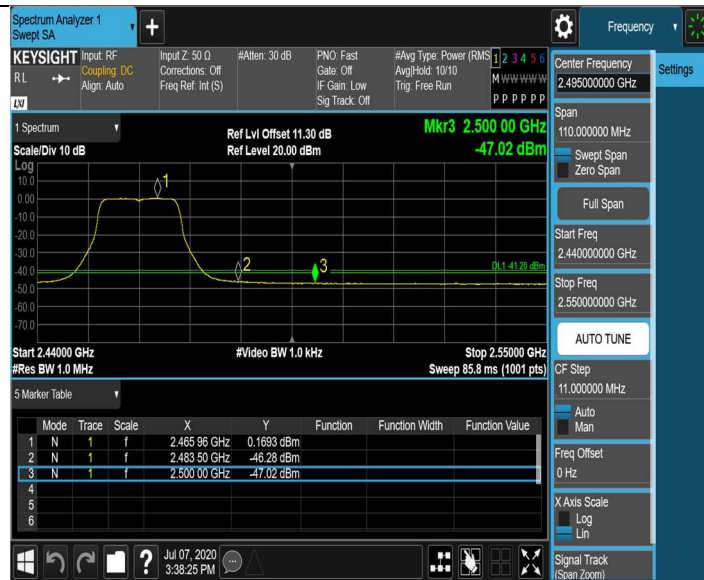

11G_Ant1_High_2462_Peak



11N20SISO_Ant1_Low_2412_AV

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11N20SISO_Ant1_Low_2412_Peak



11N20SISO_Ant1_High_2462_AV

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11N20SISO_Ant1_High_2462_Peak



11N40SISO_Ant1_Low_2422_AV

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11N40SISO_Ant1_Low_2422_Peak



11N40SISO_Ant1_High_2452_AV

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11N40SISO_Ant1_High_2452_Peak



Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

Appendix G: Spurious RF conducted emissions Test Result

TestMode	Antenna	Channel	FreqRange [Mhz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	Reference	2.90	2.90	---	PASS
			30~1000	30~1000	-62.646	<=-17.1	PASS
			1000~26500	1000~26500	-38.082	<=-17.1	PASS
		2437	Reference	3.28	3.28	---	PASS
			30~1000	30~1000	-62.137	<=-16.72	PASS
			1000~26500	1000~26500	-53.578	<=-16.72	PASS
		2462	Reference	3.23	3.23	---	PASS
			30~1000	30~1000	-62.383	<=-16.771	PASS
			1000~26500	1000~26500	-53.454	<=-16.771	PASS
11G	Ant1	2412	Reference	-5.80	-5.80	---	PASS
			30~1000	30~1000	-61.828	<=-25.799	PASS
			1000~26500	1000~26500	-36.808	<=-25.799	PASS
		2437	Reference	-5.58	-5.58	---	PASS
			30~1000	30~1000	-62.373	<=-25.578	PASS
			1000~26500	1000~26500	-53.253	<=-25.578	PASS
		2462	Reference	-5.57	-5.57	---	PASS
			30~1000	30~1000	-61.887	<=-25.565	PASS
			1000~26500	1000~26500	-52.553	<=-25.565	PASS
11N20SISO	Ant1	2412	Reference	-7.77	-7.77	---	PASS
			30~1000	30~1000	-61.614	<=-27.774	PASS
			1000~26500	1000~26500	-41.632	<=-27.774	PASS
		2437	Reference	-7.47	-7.47	---	PASS
			30~1000	30~1000	-61.76	<=-27.47	PASS
			1000~26500	1000~26500	-53.56	<=-27.47	PASS

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

11N40SISO	Ant1	2462	Reference	-7.63	-7.63	---	PASS
			30~1000	30~1000	-62.269	<=-27.633	PASS
			1000~26500	1000~26500	-53.536	<=-27.633	PASS
		2422	Reference	-11.94	-11.94	---	PASS
			30~1000	30~1000	-62.402	<=-31.939	PASS
			1000~26500	1000~26500	-53.366	<=-31.939	PASS
		2437	Reference	-11.33	-11.33	---	PASS
			30~1000	30~1000	-62.569	<=-31.332	PASS
			1000~26500	1000~26500	-53.647	<=-31.332	PASS
		2452	Reference	-11.23	-11.23	---	PASS
			30~1000	30~1000	-61.655	<=-31.226	PASS
			1000~26500	1000~26500	-53.381	<=-31.226	PASS

Test Graphs

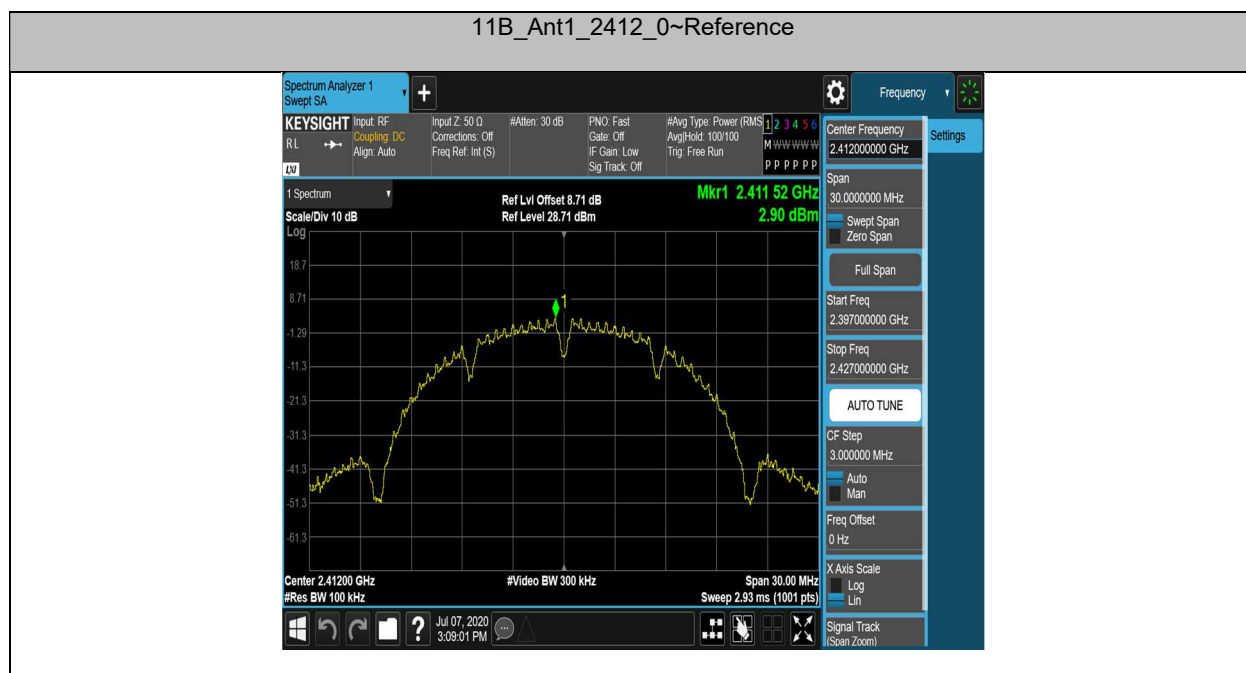


Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

11B_Ant1_2412_30~1000

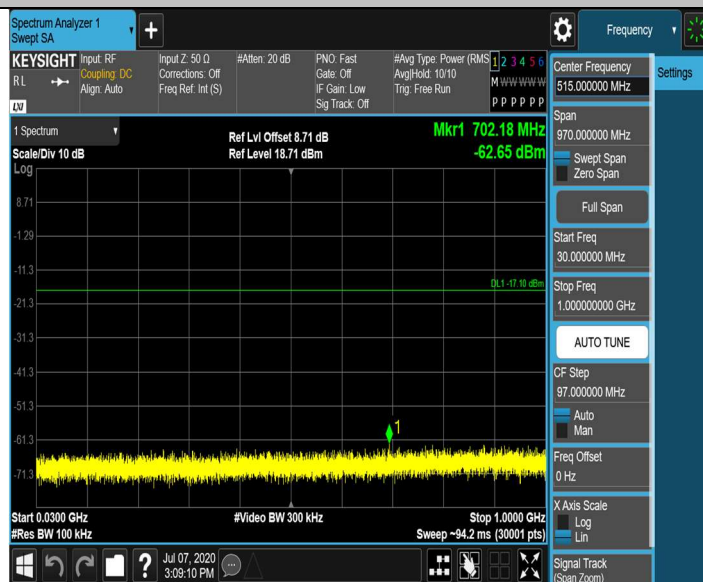

11B_Ant1_2412_1000~26500

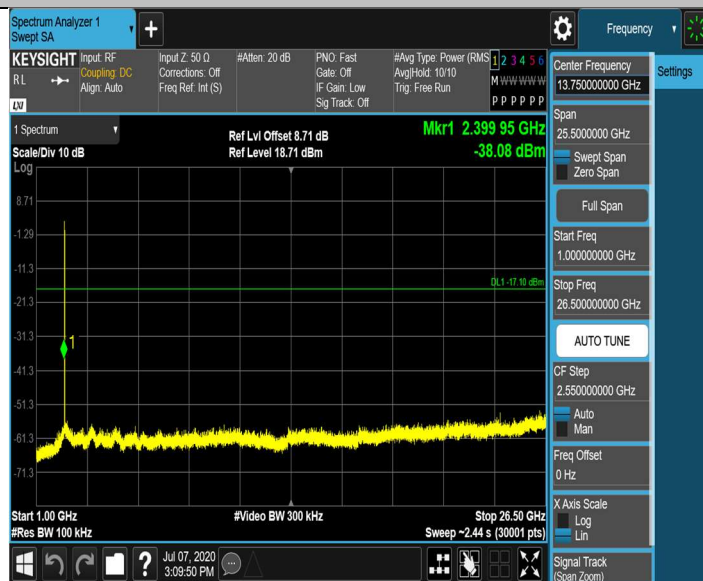

11B_Ant1_2437_0~Reference

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11B_Ant1_2437_30~1000

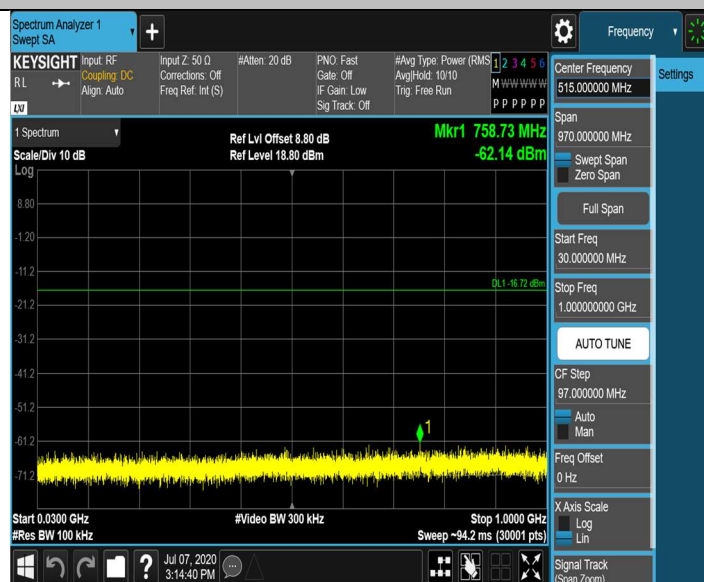


11B_Ant1_2437_1000~26500

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

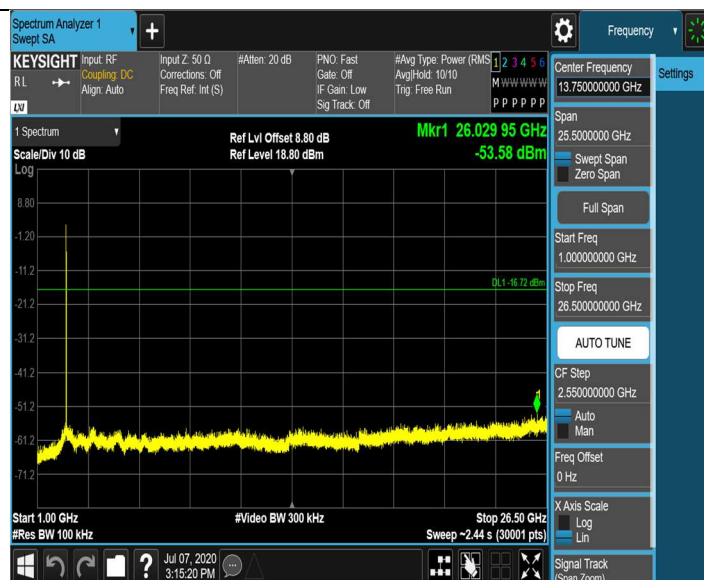

11B_Ant1_2462_0~Reference



11B_Ant1_2462_30~1000

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11B_Ant1_2462_1000~26500

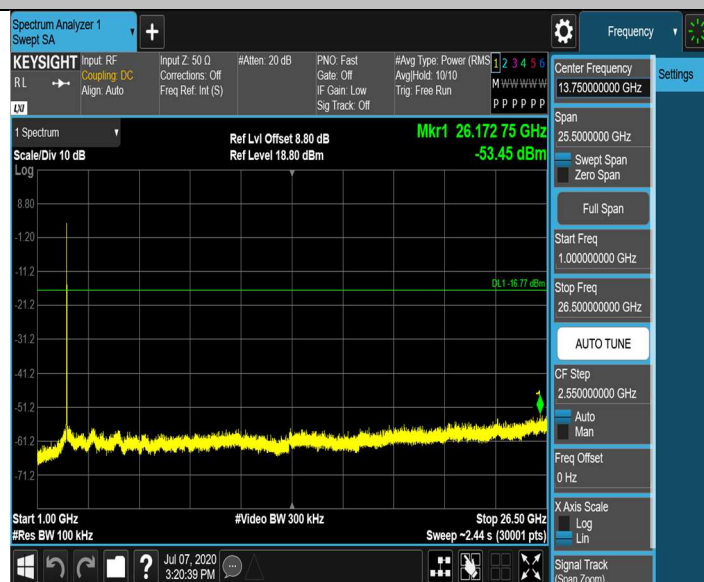


11G_Ant1_2412_0~Reference

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

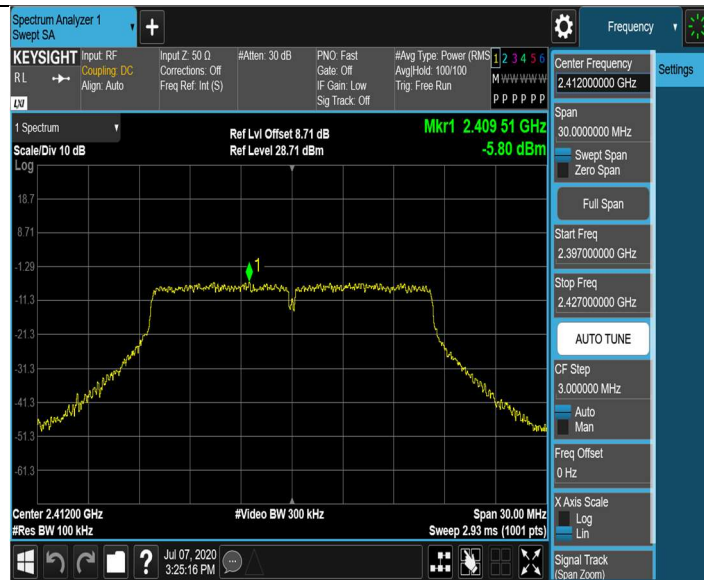

11G_Ant1_2412_30~1000

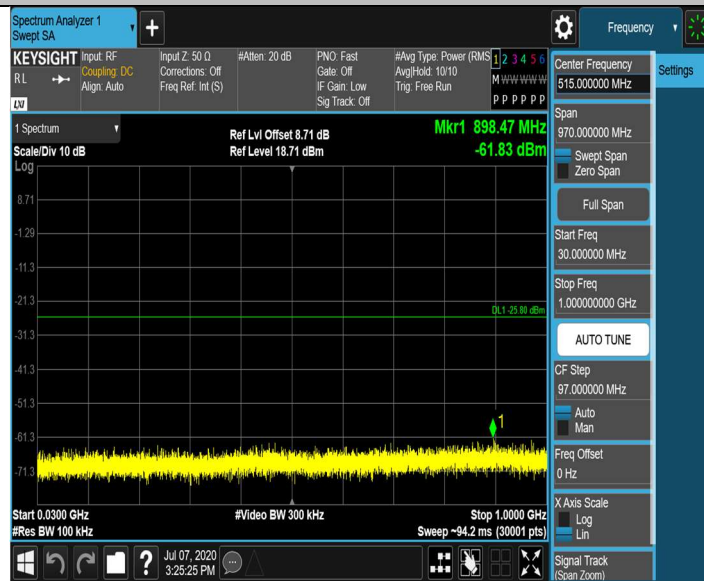


11G_Ant1_2412_1000~26500

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

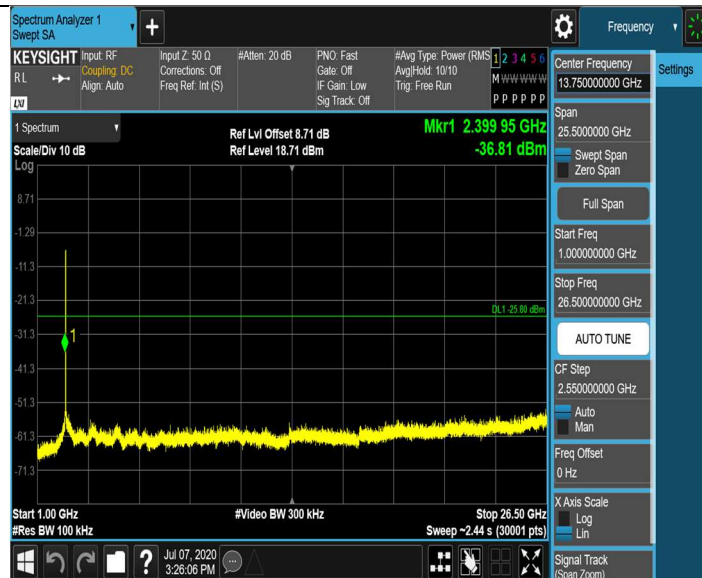

11G_Ant1_2437_0~Reference

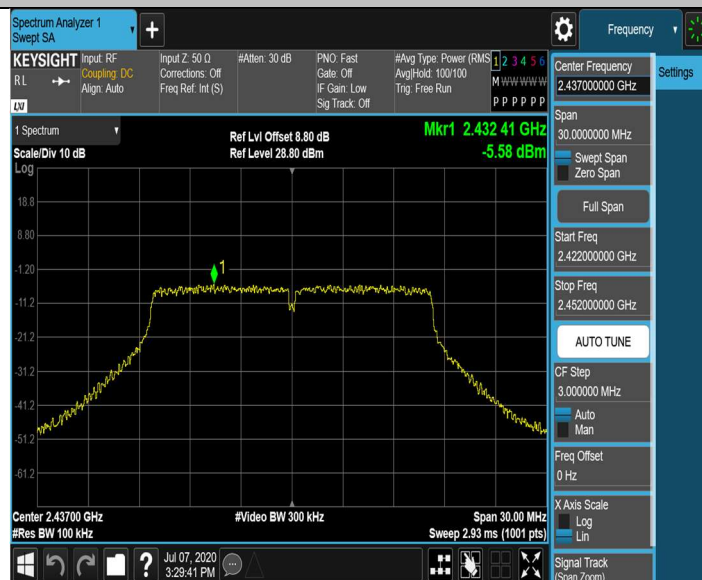


11G_Ant1_2437_30~1000

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

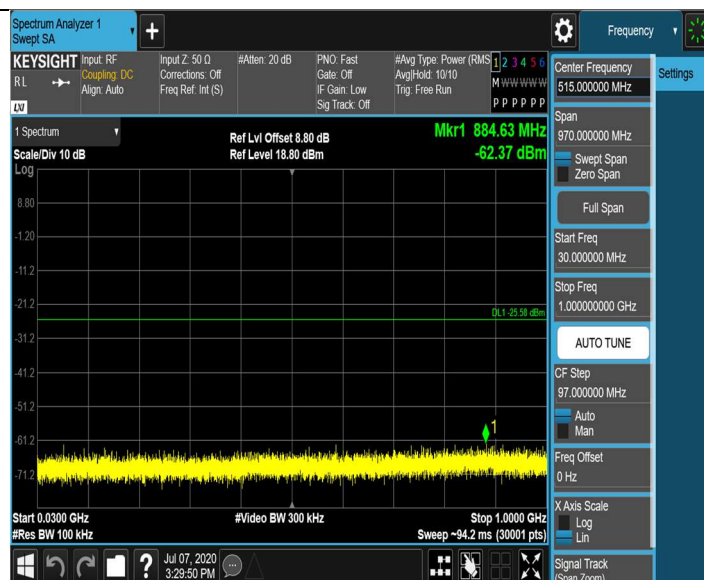

11G_Ant1_2437_1000~26500

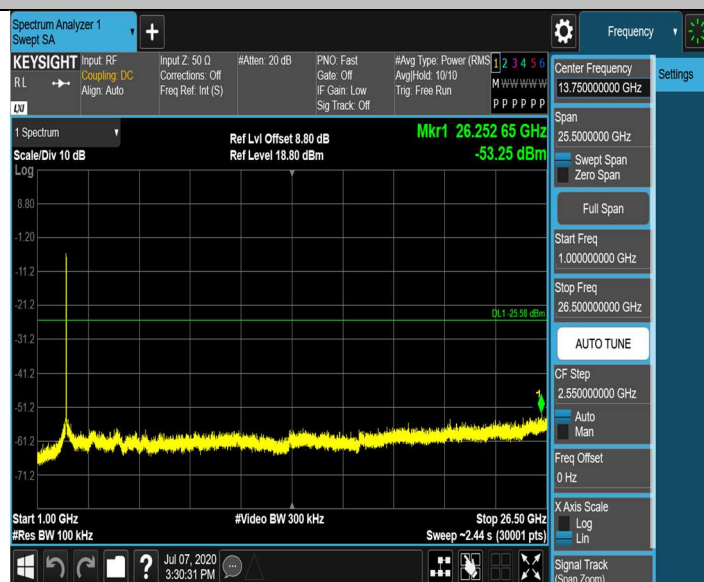


11G_Ant1_2462_0~Reference

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

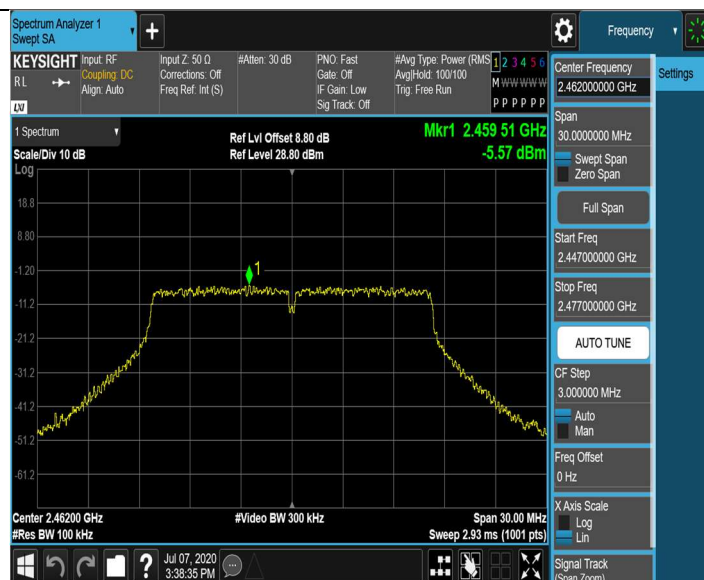

11G_Ant1_2462_30~1000

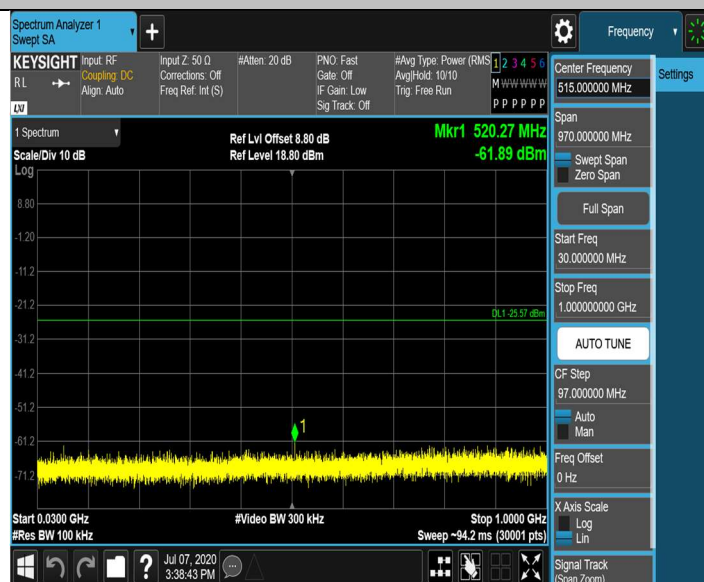


11G_Ant1_2462_1000~26500

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

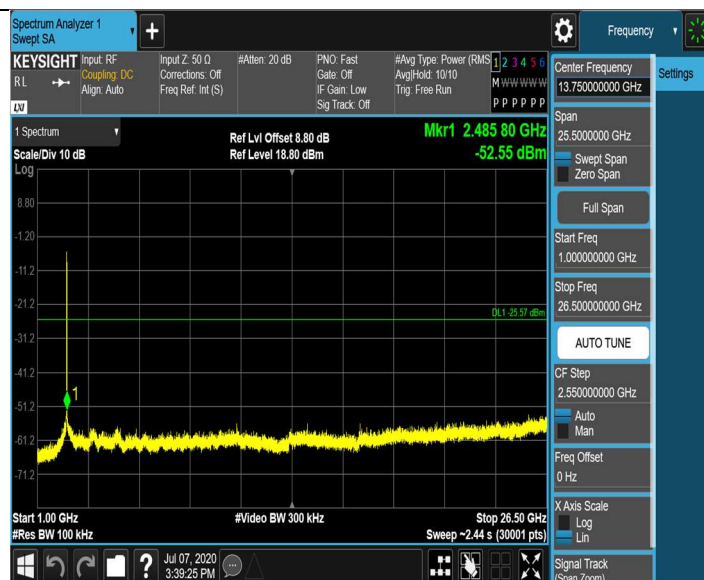

11N20SISO_Ant1_2412_0~Reference




11N20SISO_Ant1_2412_30~1000

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

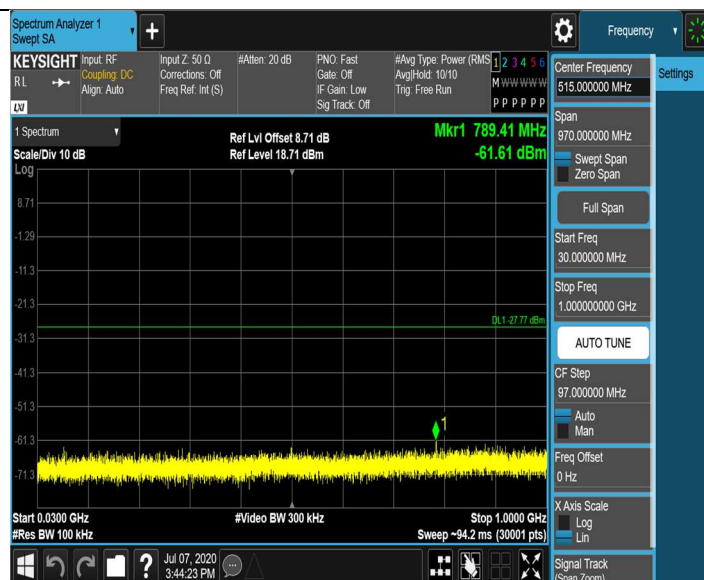

11N20SISO_Ant1_2412_1000~26500

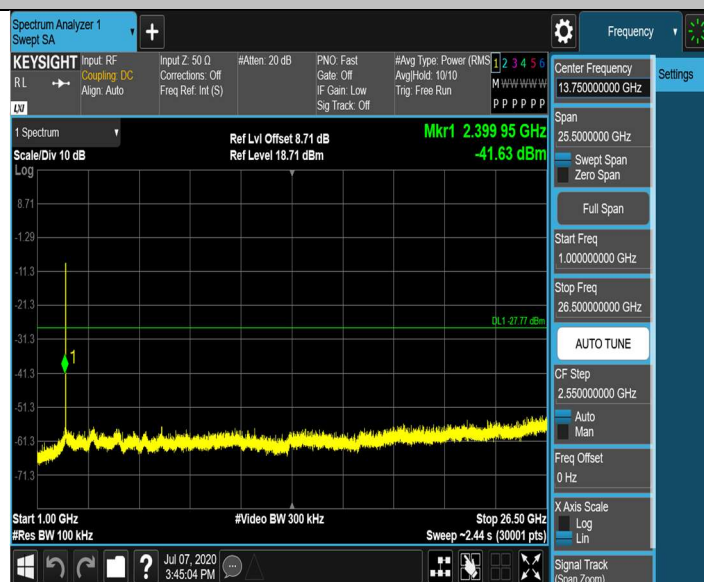


11N20SISO_Ant1_2437_0~Reference

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

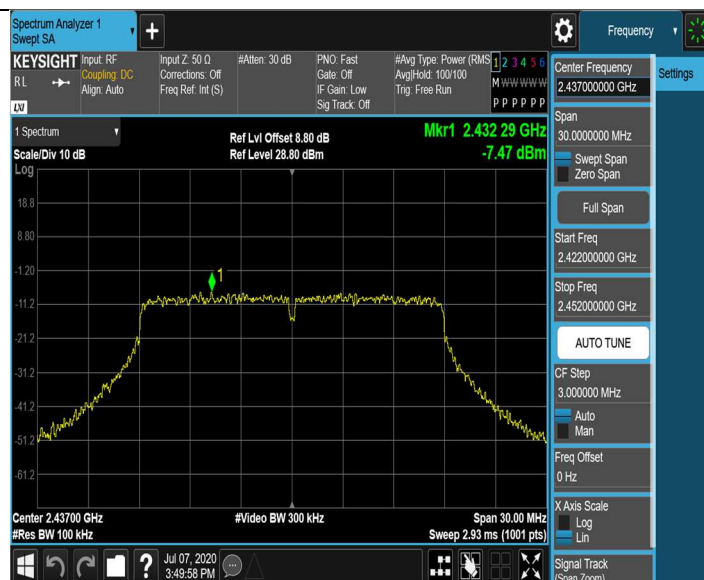

11N20SISO_Ant1_2437_30~1000

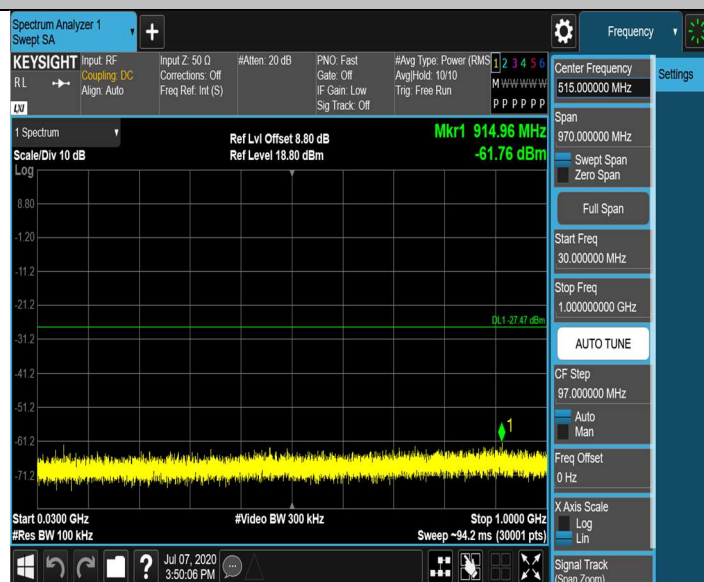


11N20SISO_Ant1_2437_1000~26500

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

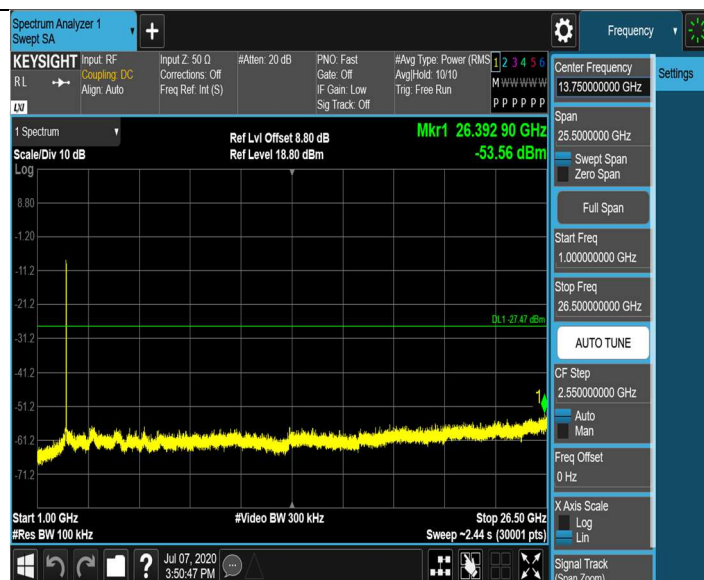

11N20SISO_Ant1_2462_0~Reference




11N20SISO_Ant1_2462_30~1000

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

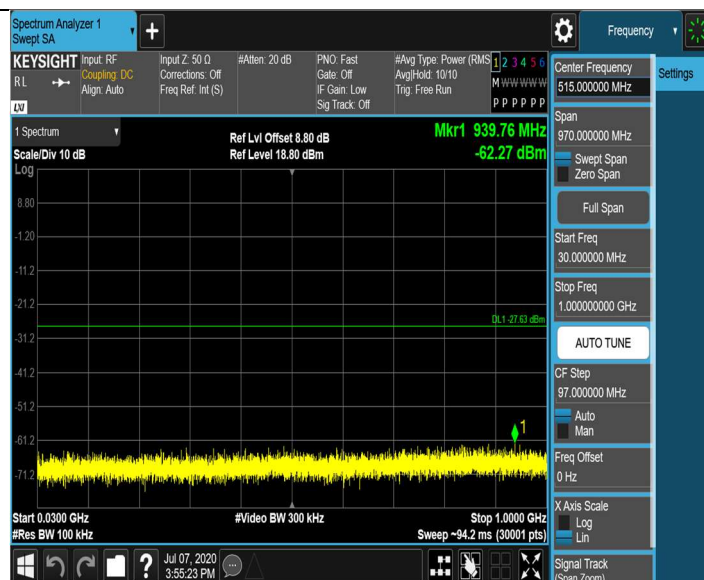

11N20SISO_Ant1_2462_1000~26500

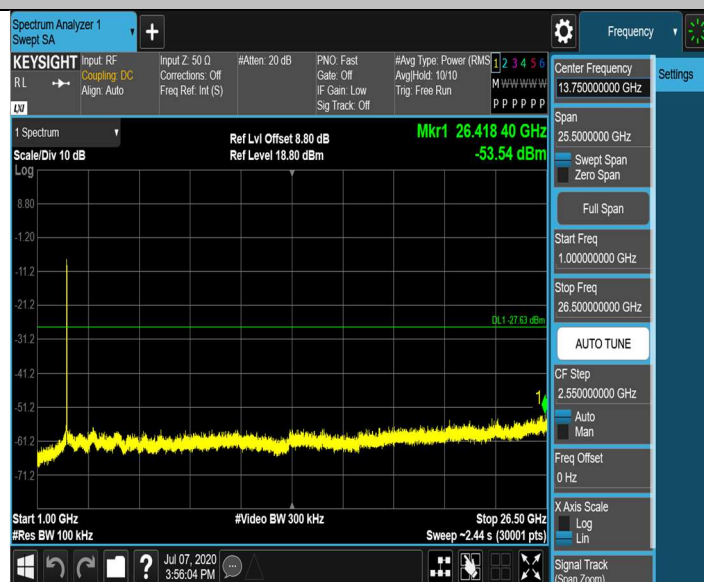


11N40SISO_Ant1_2422_0~Reference

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

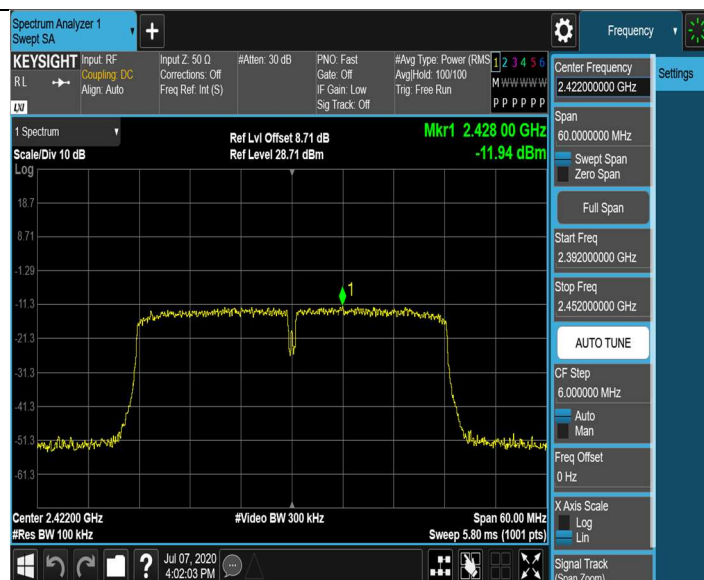

11N40SISO_Ant1_2422_30~1000

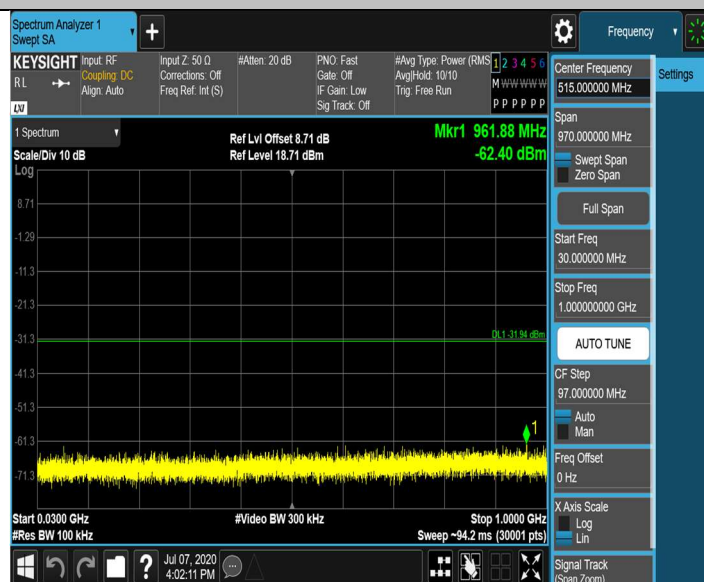


11N40SISO_Ant1_2422_1000~26500

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

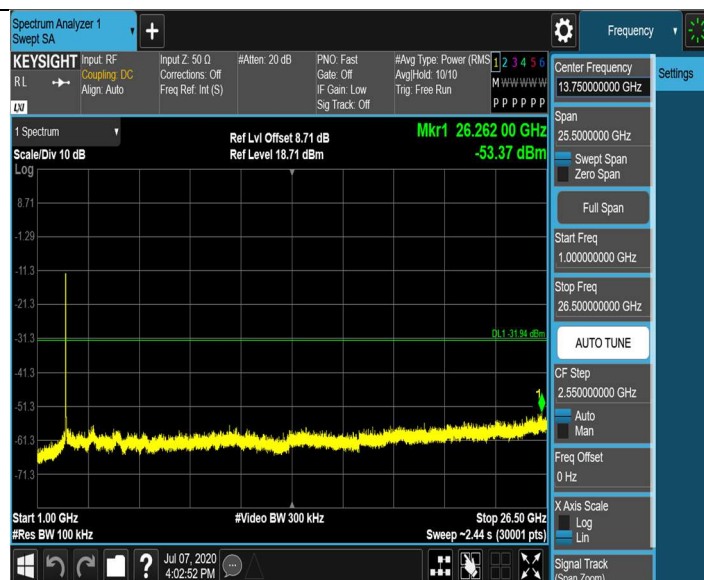

11N40SISO_Ant1_2437_0~Reference

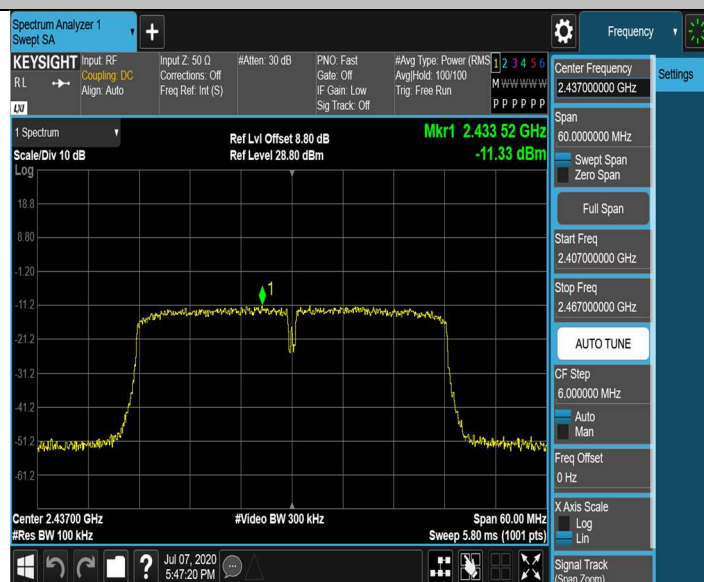


11N40SISO_Ant1_2437_30~1000

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

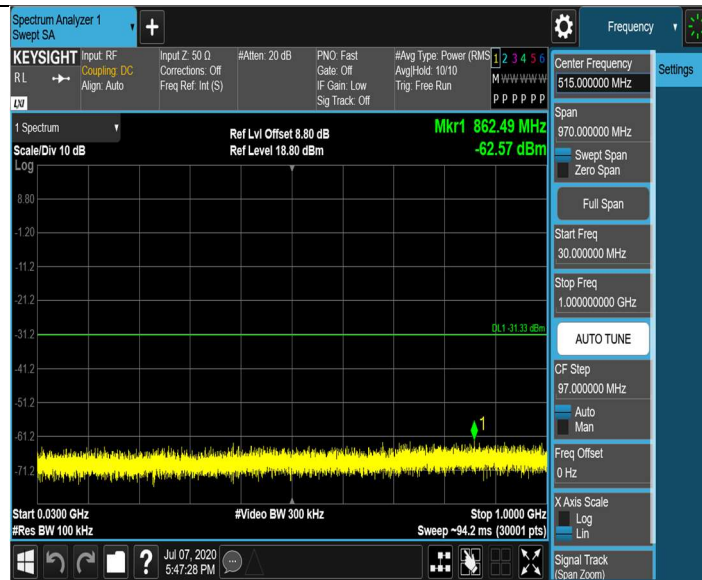

11N40SISO_Ant1_2437_1000~26500

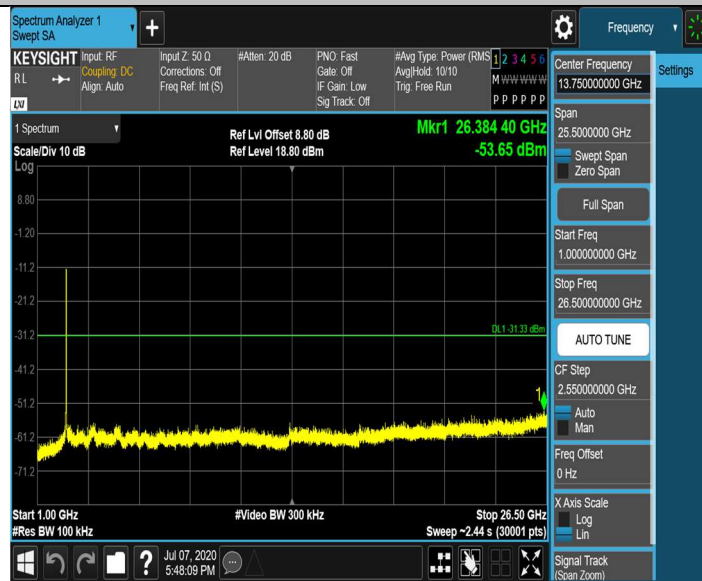

11N40SISO_Ant1_2452_0~Reference

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11N40SISO_Ant1_2452_30~1000

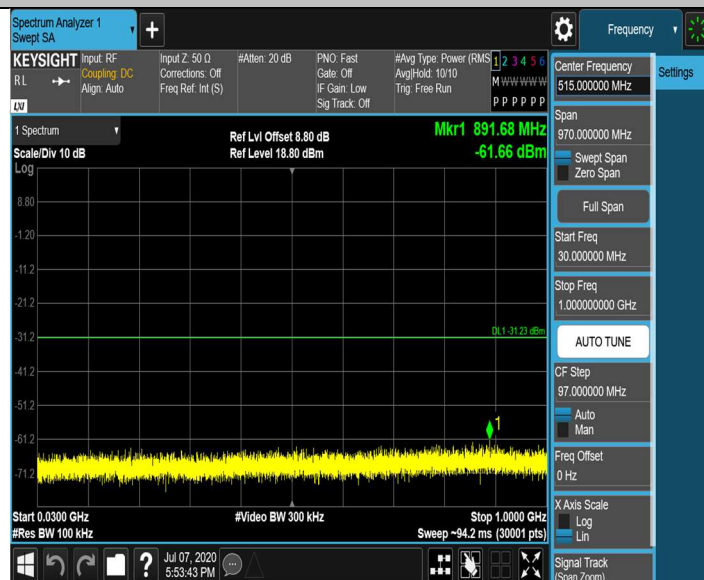


11N40SISO_Ant1_2452_1000~26500

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

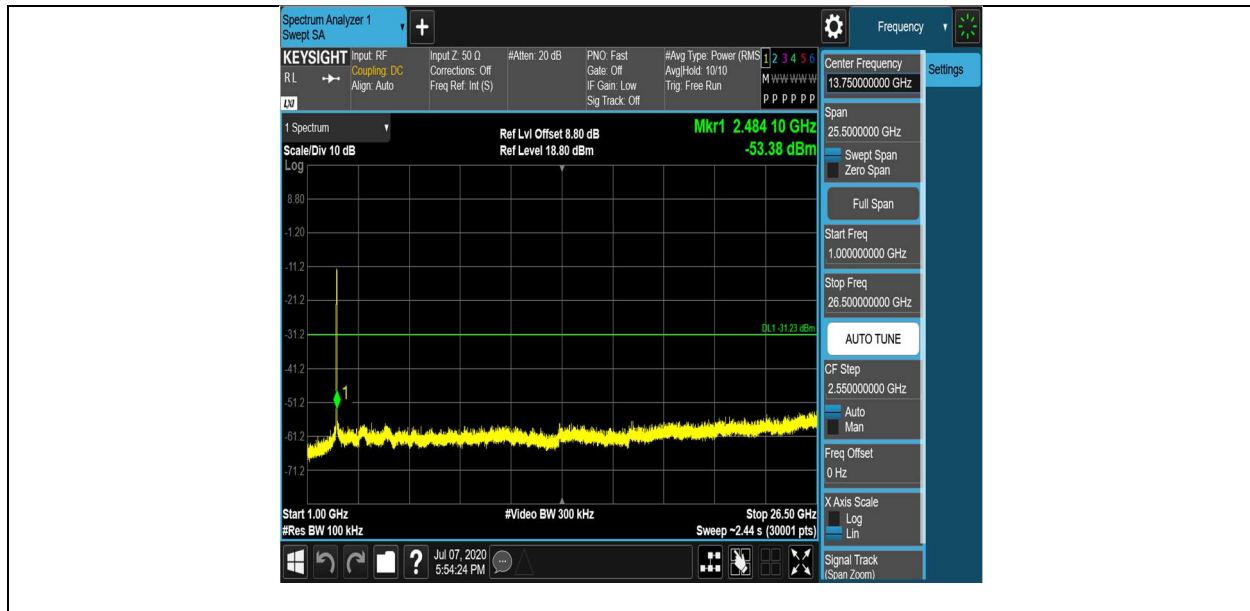

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749