






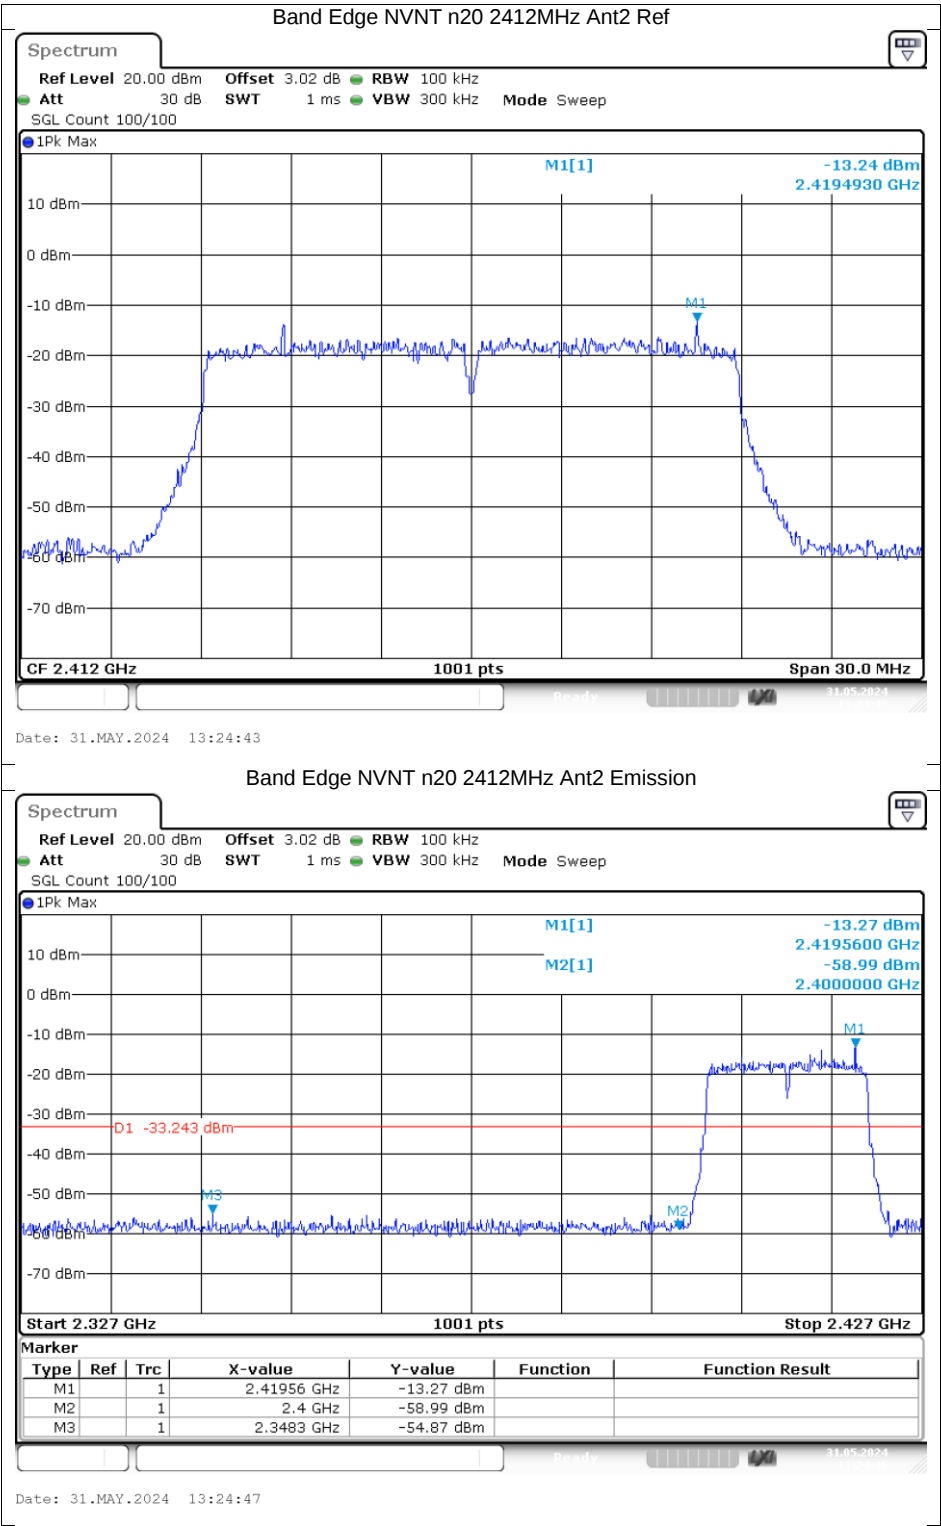


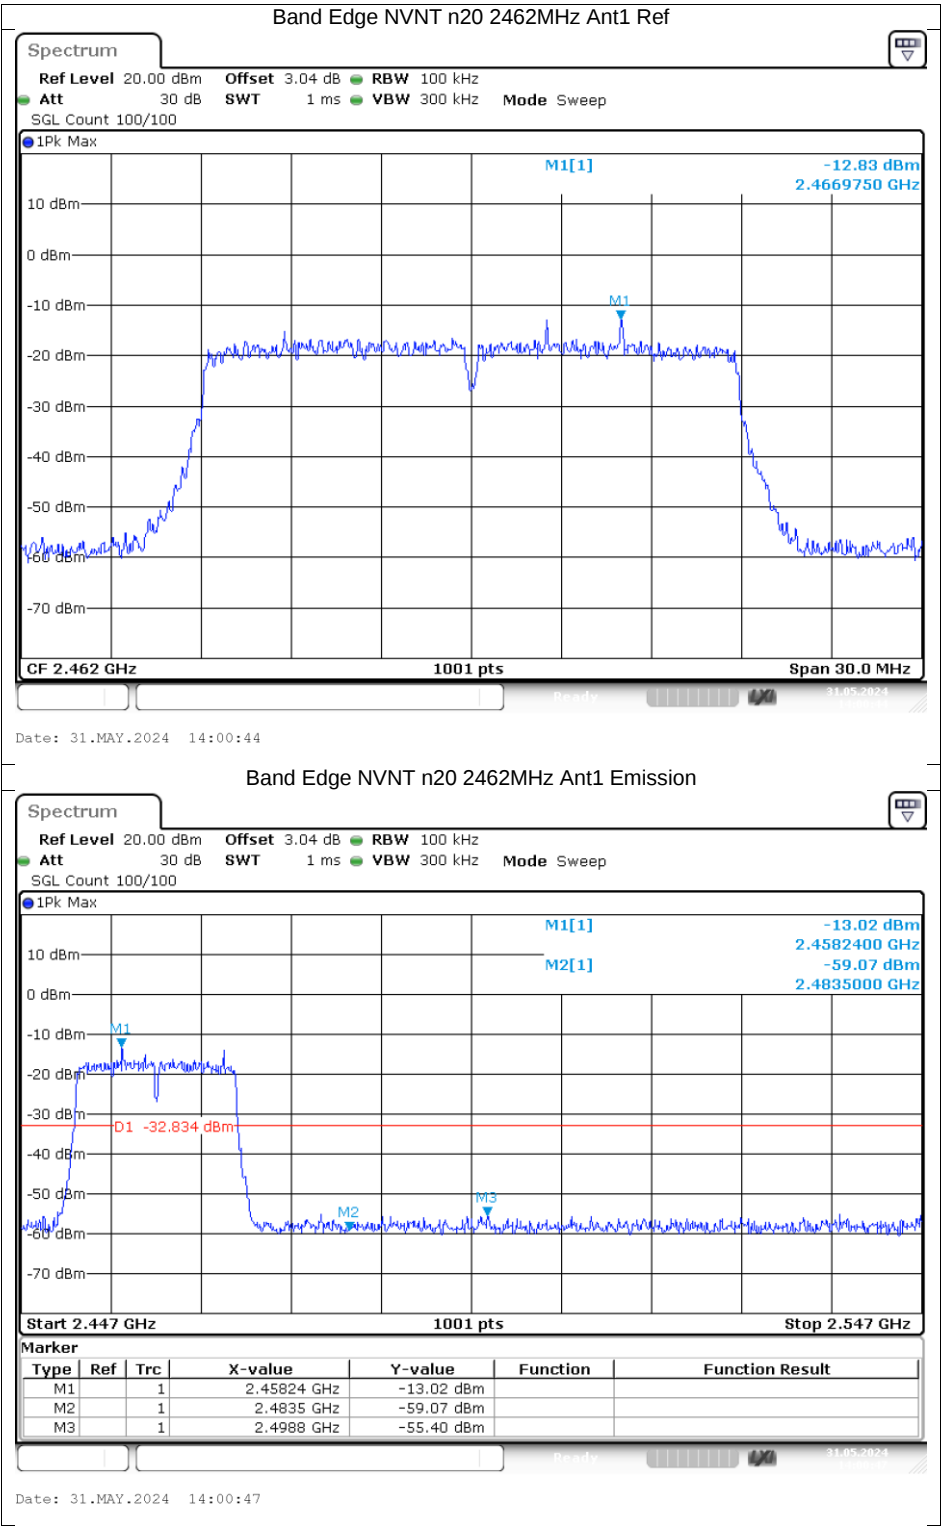


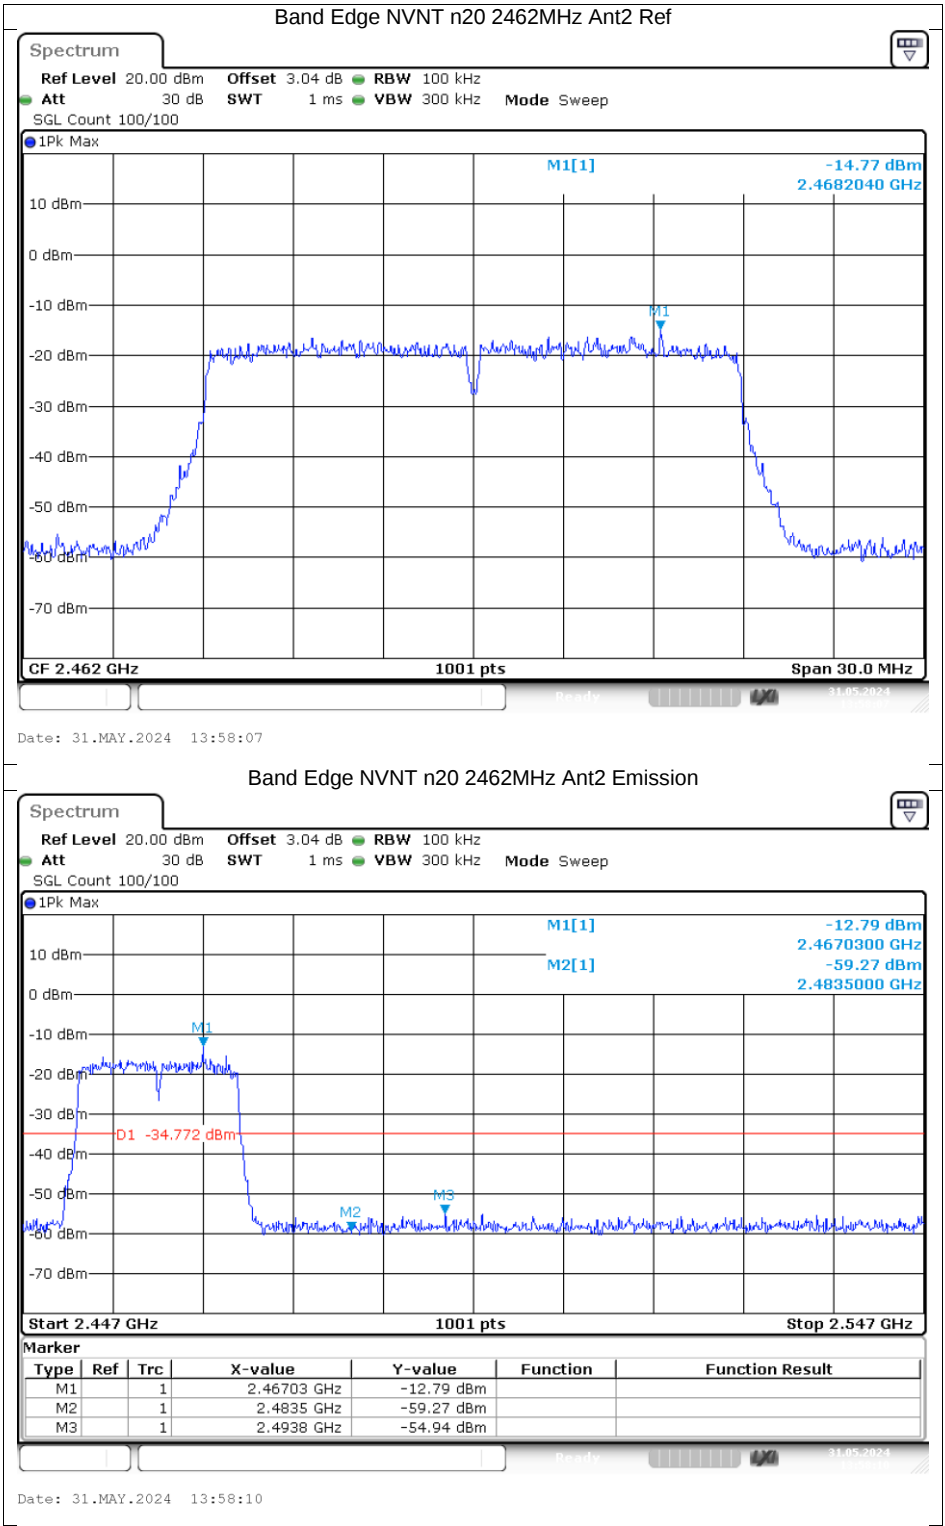

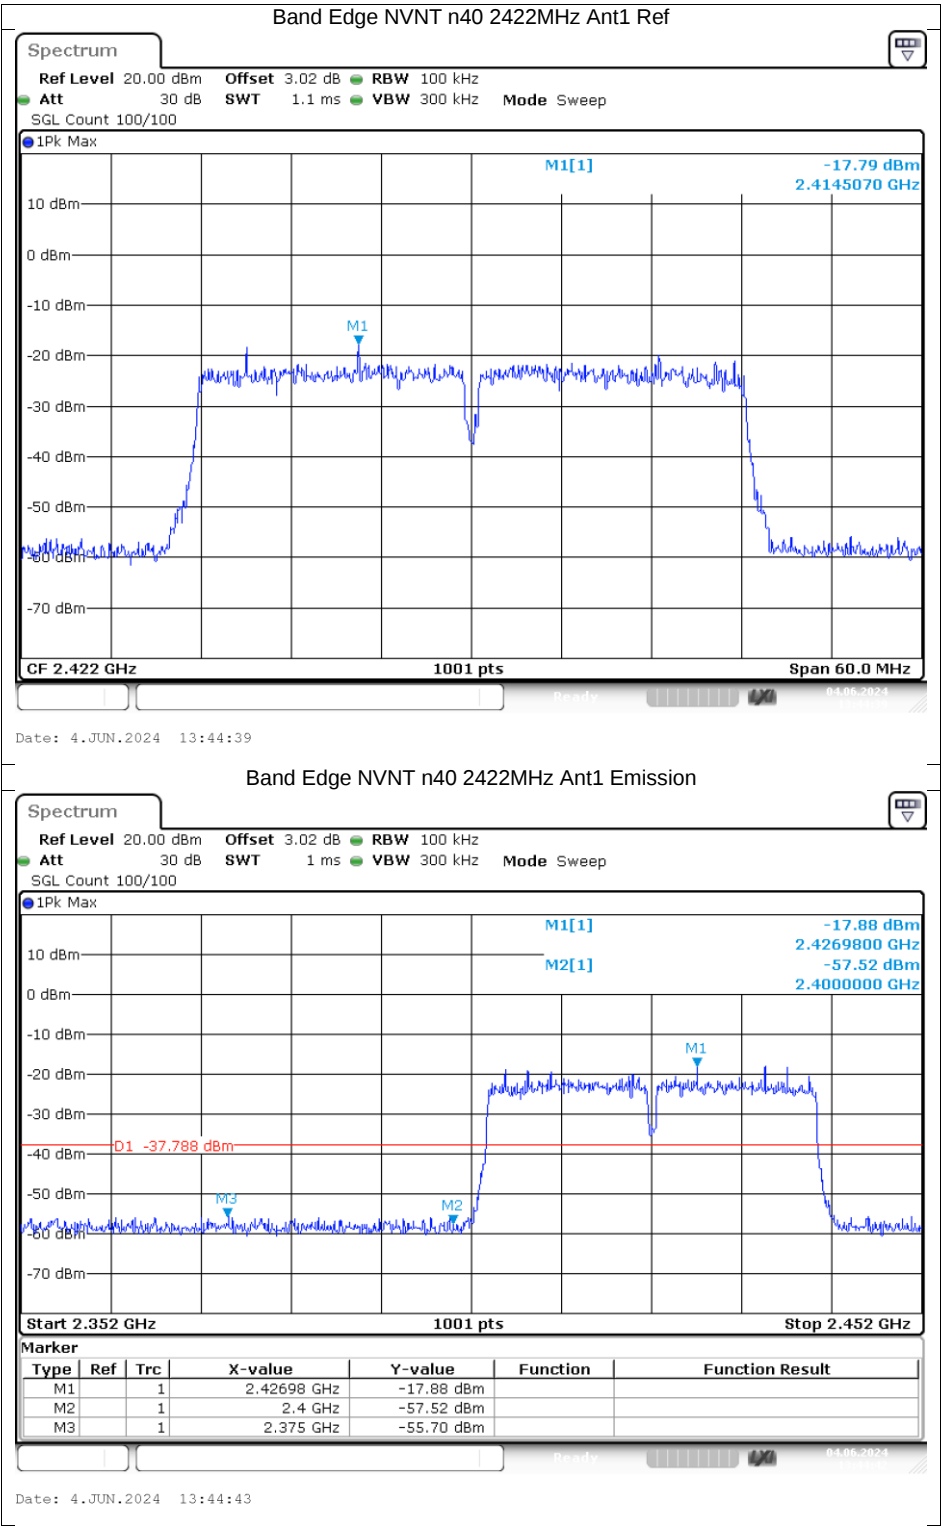

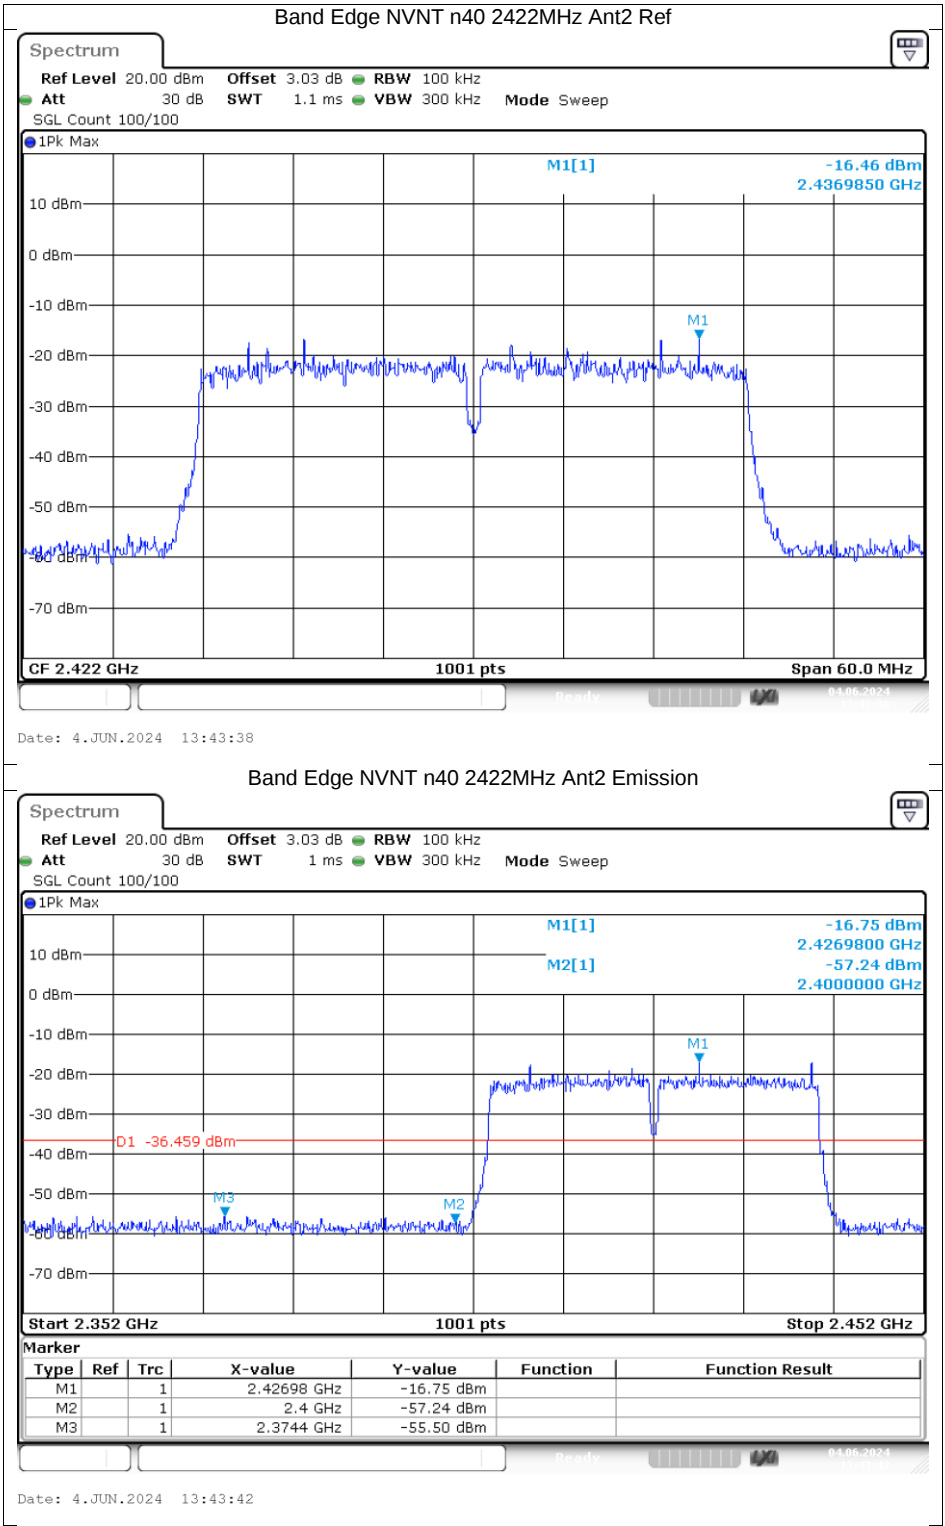


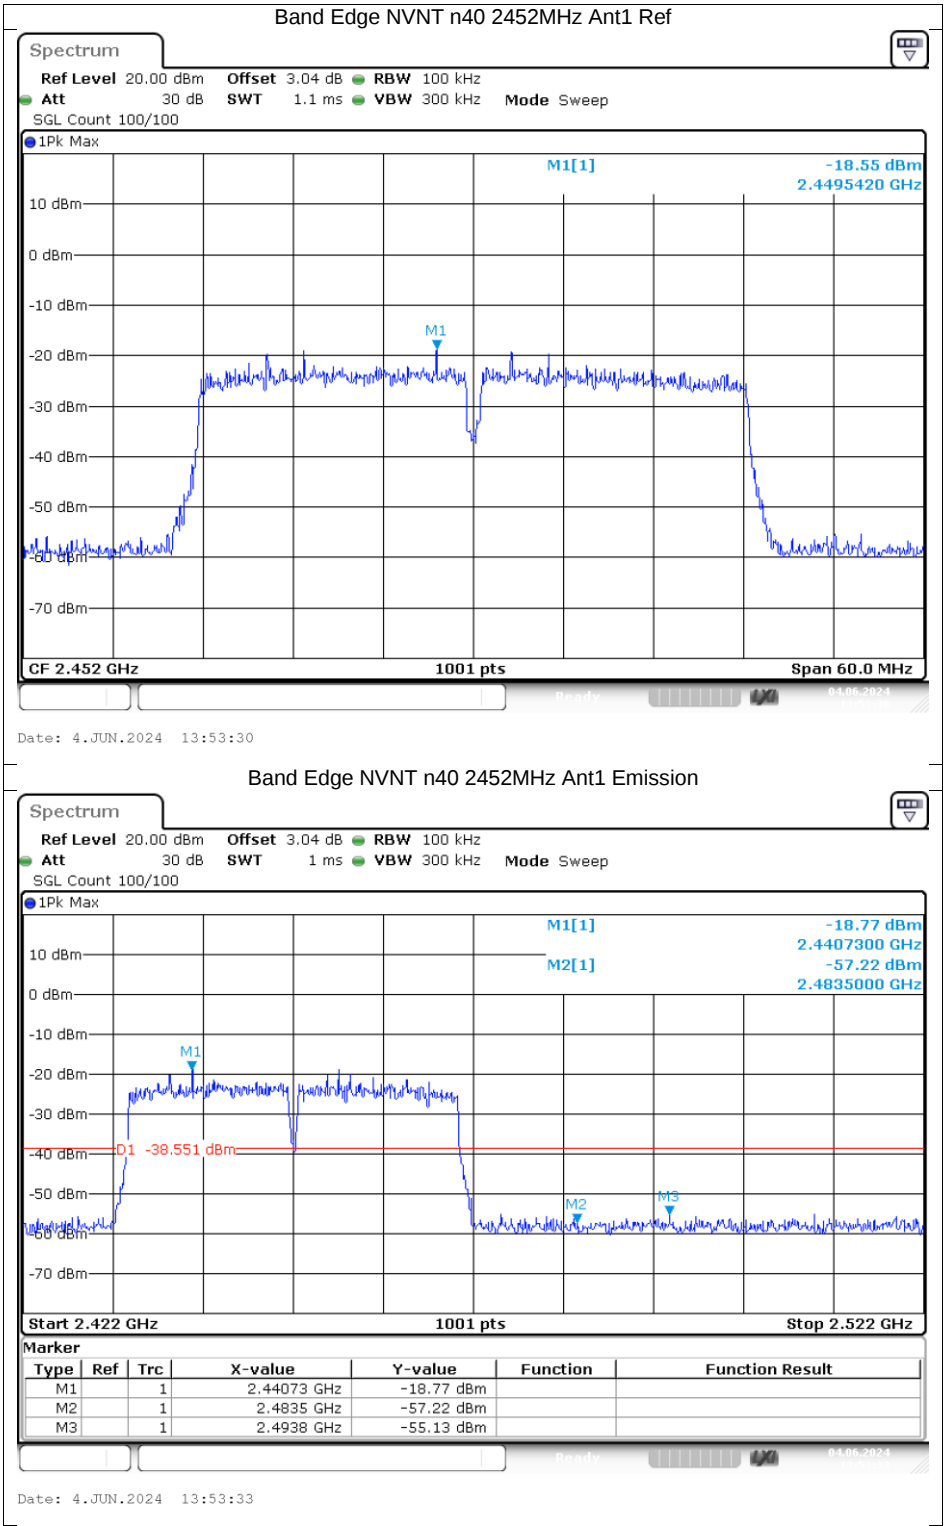


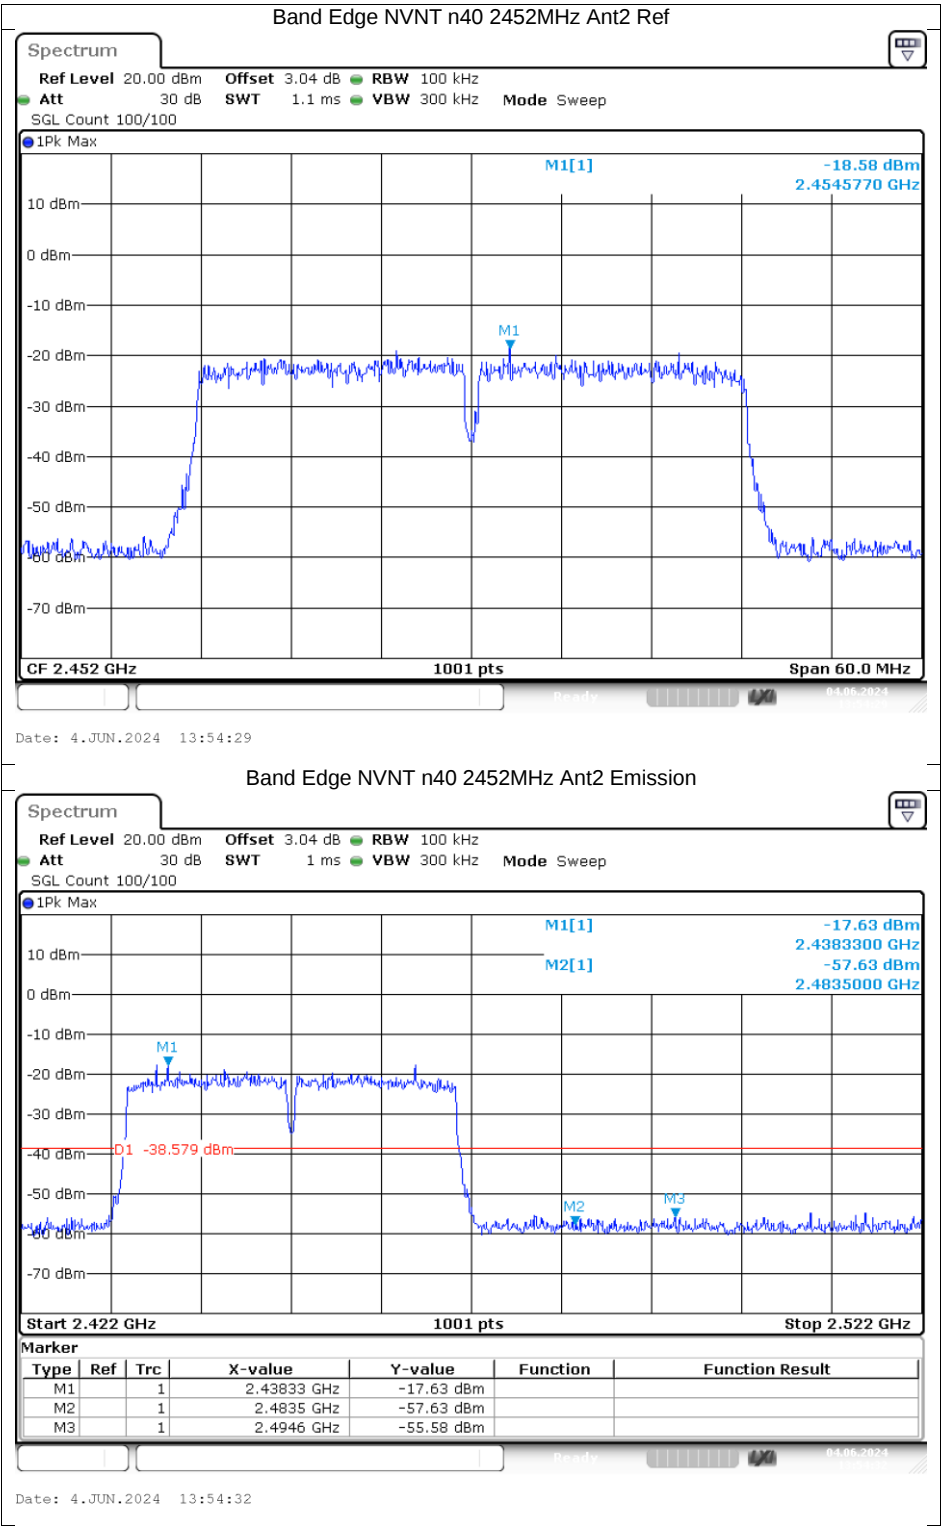



Conducted RF Spurious Emission


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant1	-44.73	-20	Pass
NVNT	b	2412	Ant2	-42.79	-20	Pass
NVNT	b	2437	Ant1	-44.18	-20	Pass
NVNT	b	2437	Ant2	-40.88	-20	Pass
NVNT	b	2462	Ant1	-42.83	-20	Pass
NVNT	b	2462	Ant2	-42.81	-20	Pass
NVNT	g	2412	Ant1	-37.96	-20	Pass
NVNT	g	2412	Ant2	-38.7	-20	Pass
NVNT	g	2437	Ant1	-35.38	-20	Pass
NVNT	g	2437	Ant2	-37.93	-20	Pass
NVNT	g	2462	Ant1	-35.92	-20	Pass
NVNT	g	2462	Ant2	-37.35	-20	Pass
NVNT	n20	2412	Ant1	-35.45	-20	Pass
NVNT	n20	2412	Ant2	-35.8	-20	Pass
NVNT	n20	2437	Ant1	-35.68	-20	Pass
NVNT	n20	2437	Ant2	-35.69	-20	Pass
NVNT	n20	2462	Ant1	-35.49	-20	Pass
NVNT	n20	2462	Ant2	-35.86	-20	Pass
NVNT	n40	2422	Ant1	-30.71	-20	Pass
NVNT	n40	2422	Ant2	-31.71	-20	Pass
NVNT	n40	2437	Ant1	-31.62	-20	Pass
NVNT	n40	2437	Ant2	-30.96	-20	Pass
NVNT	n40	2452	Ant1	-30.3	-20	Pass
NVNT	n40	2452	Ant2	-31.26	-20	Pass

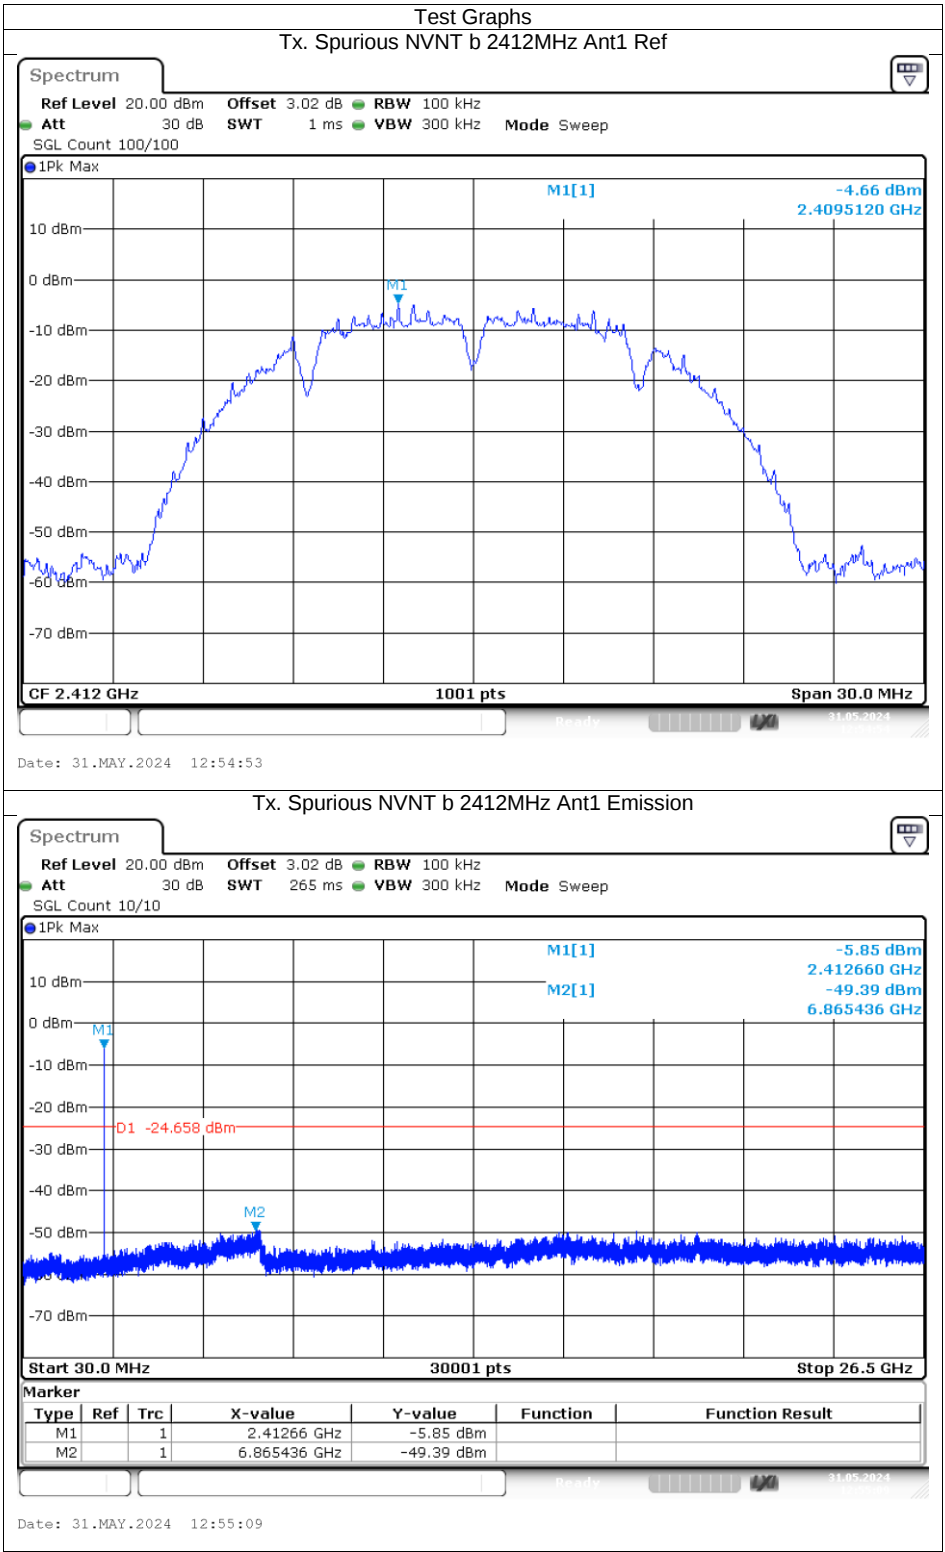


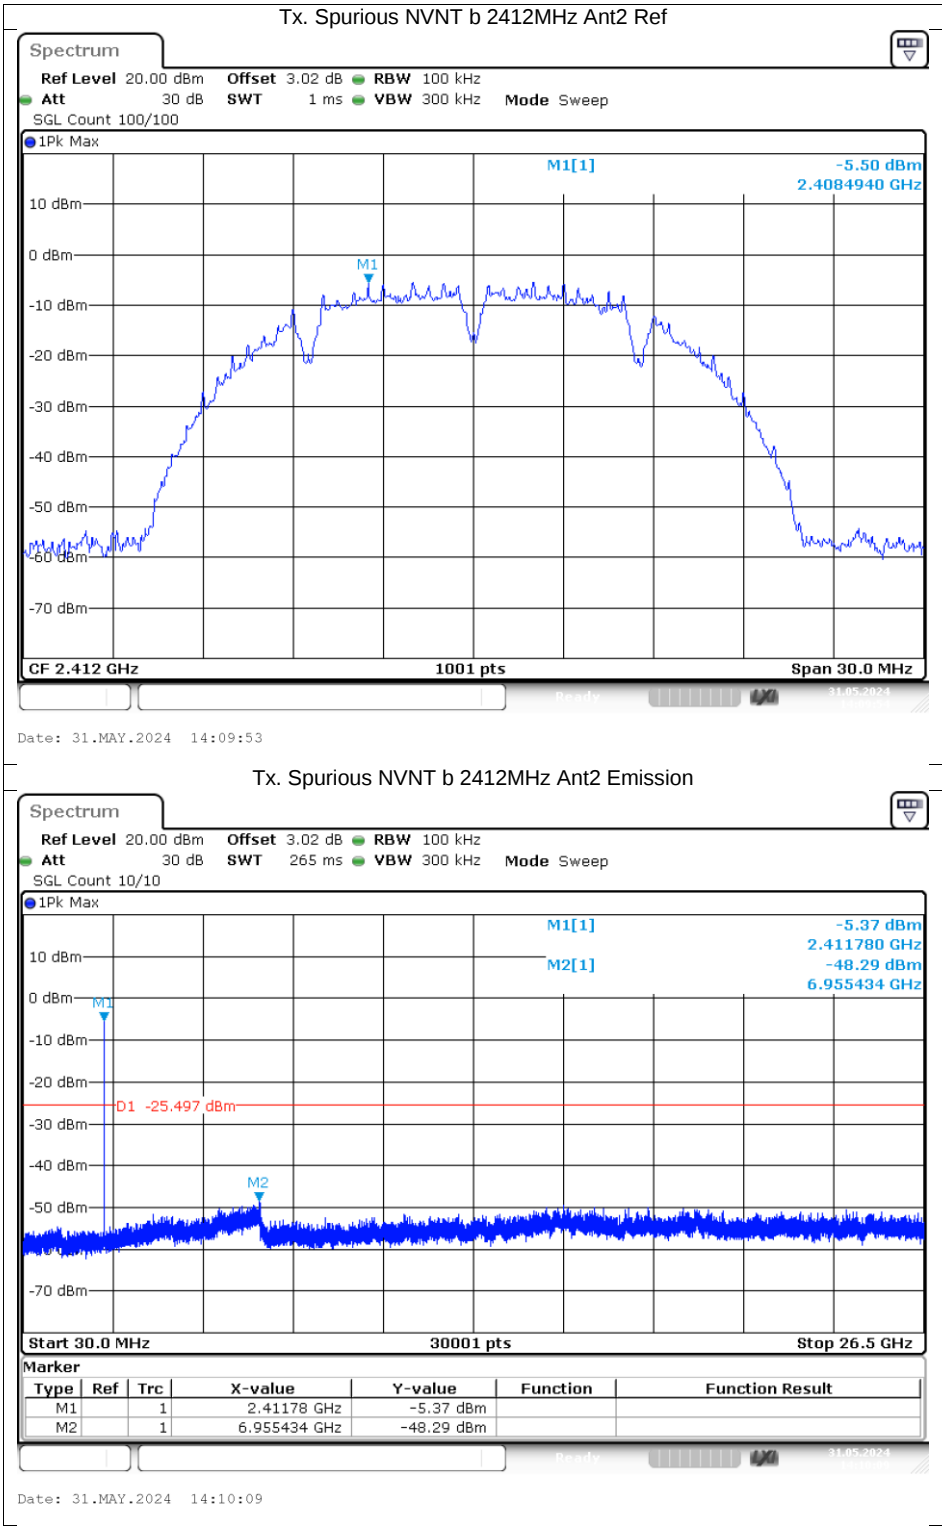


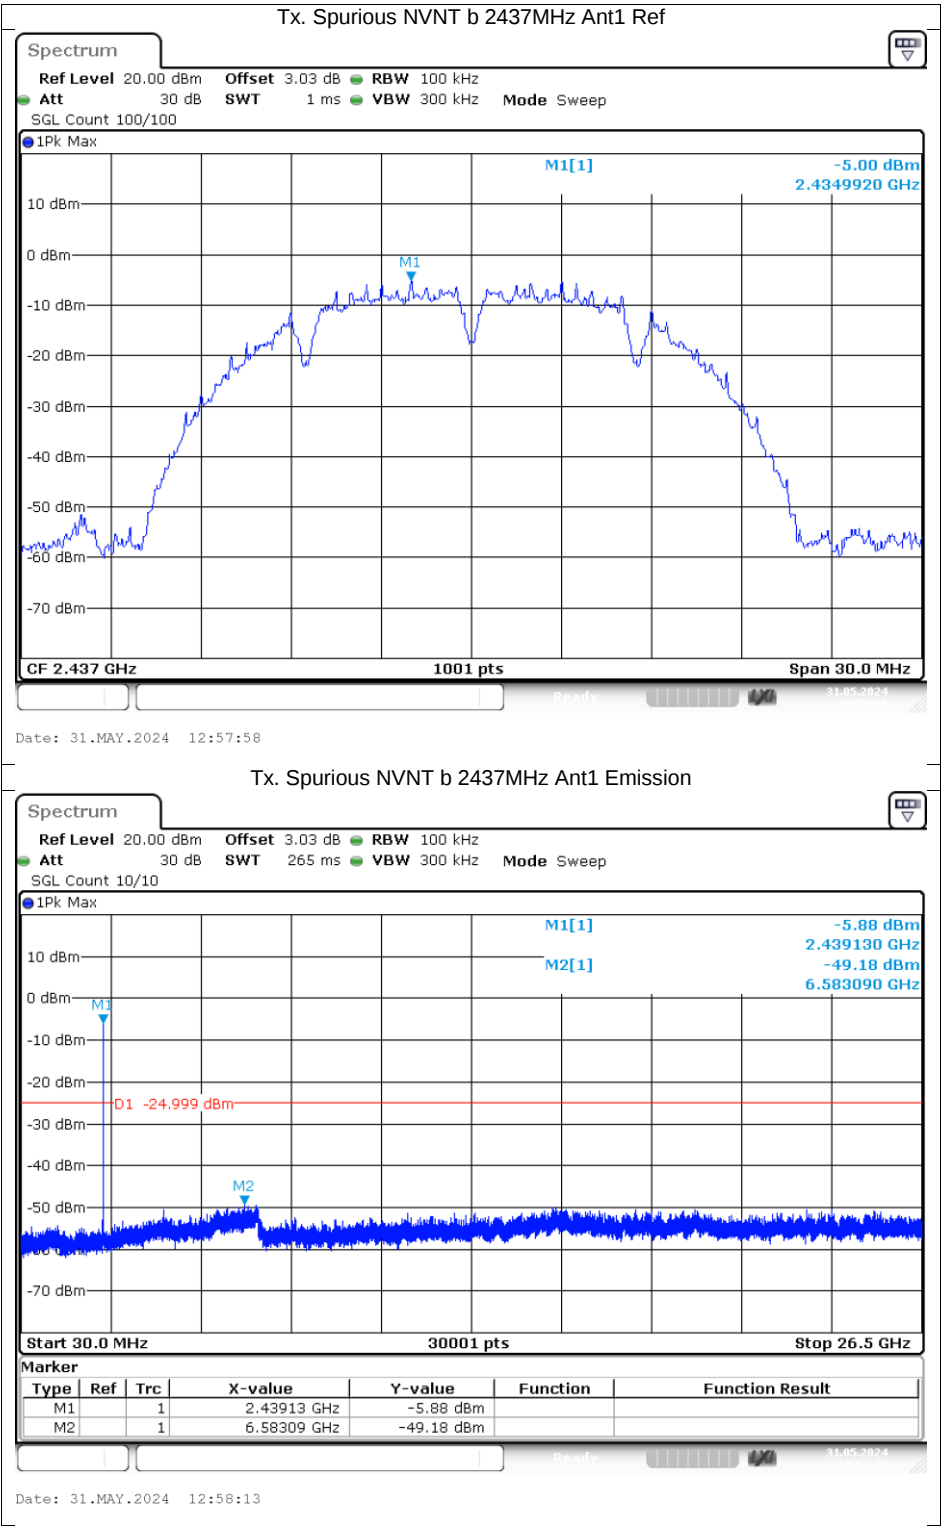


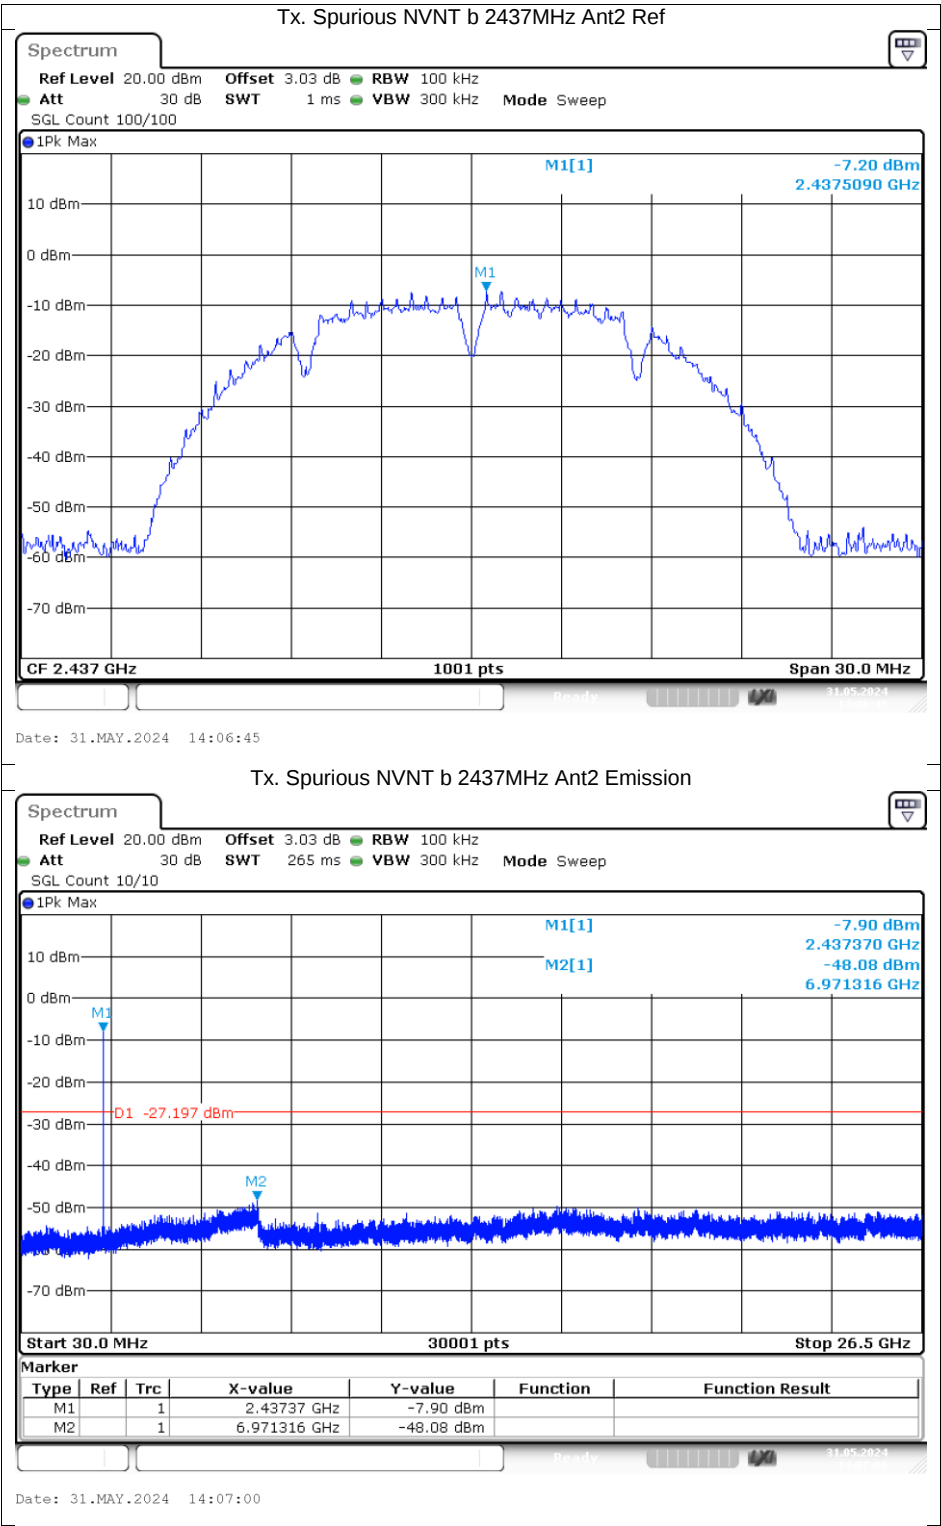


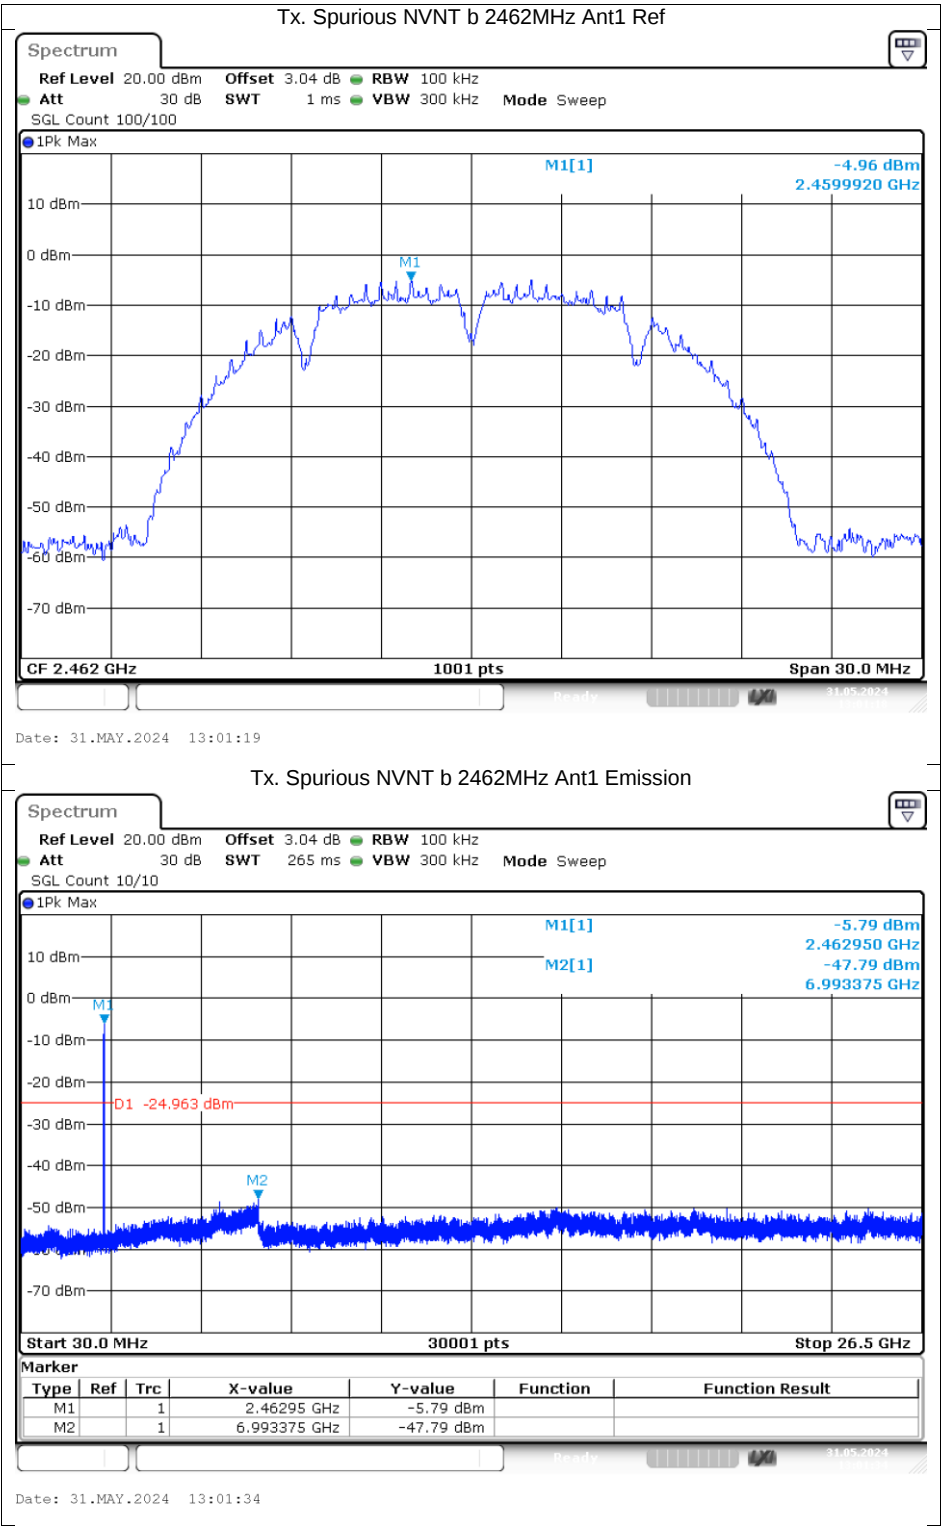


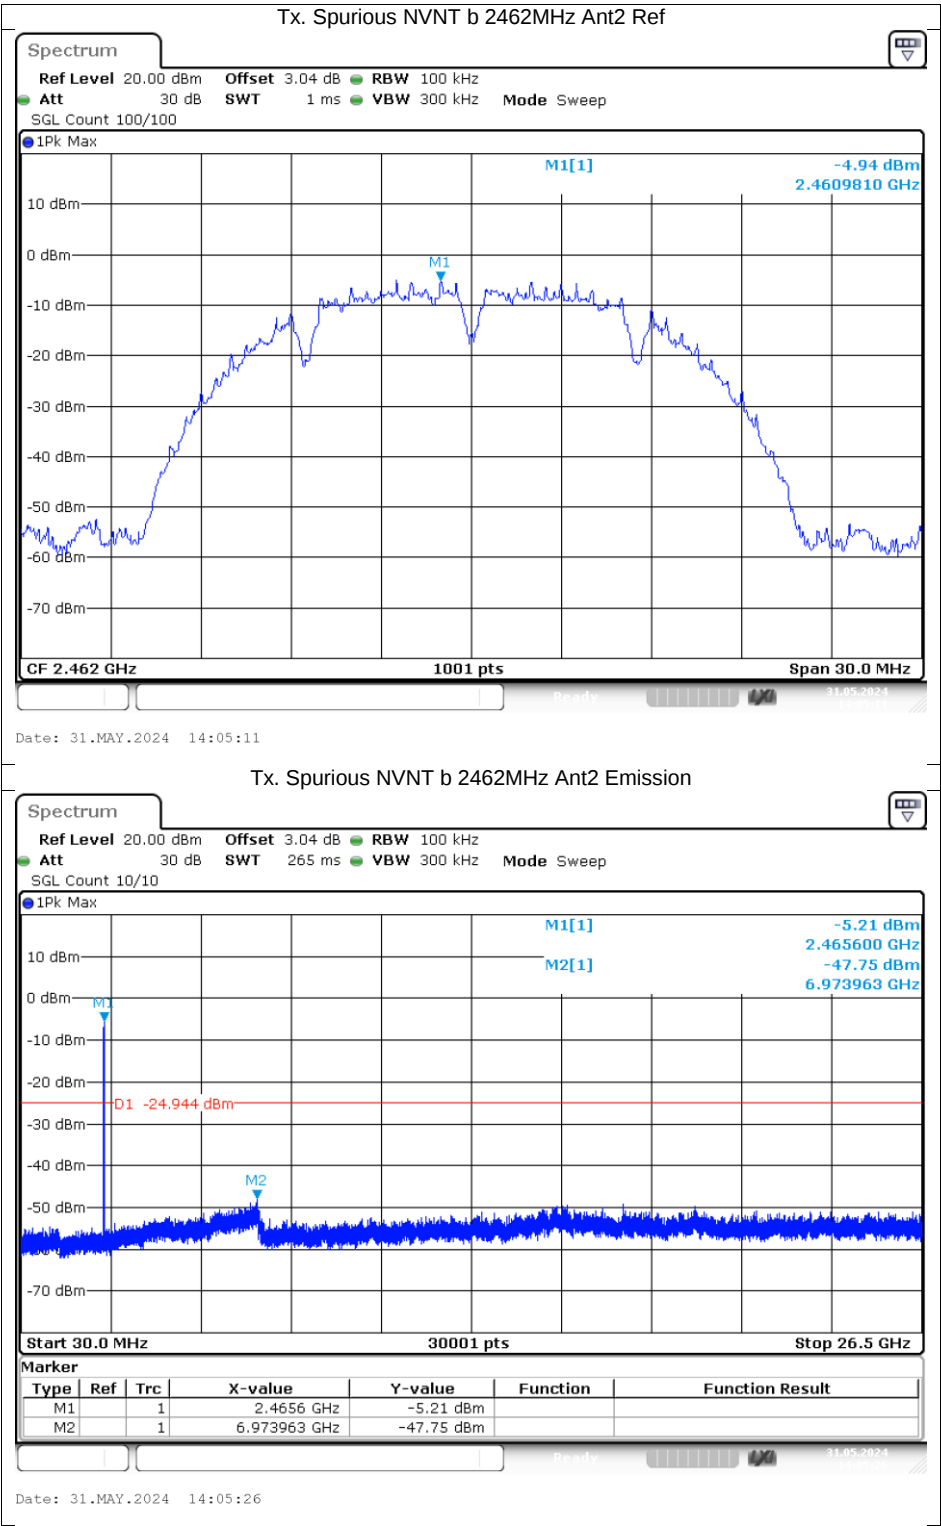


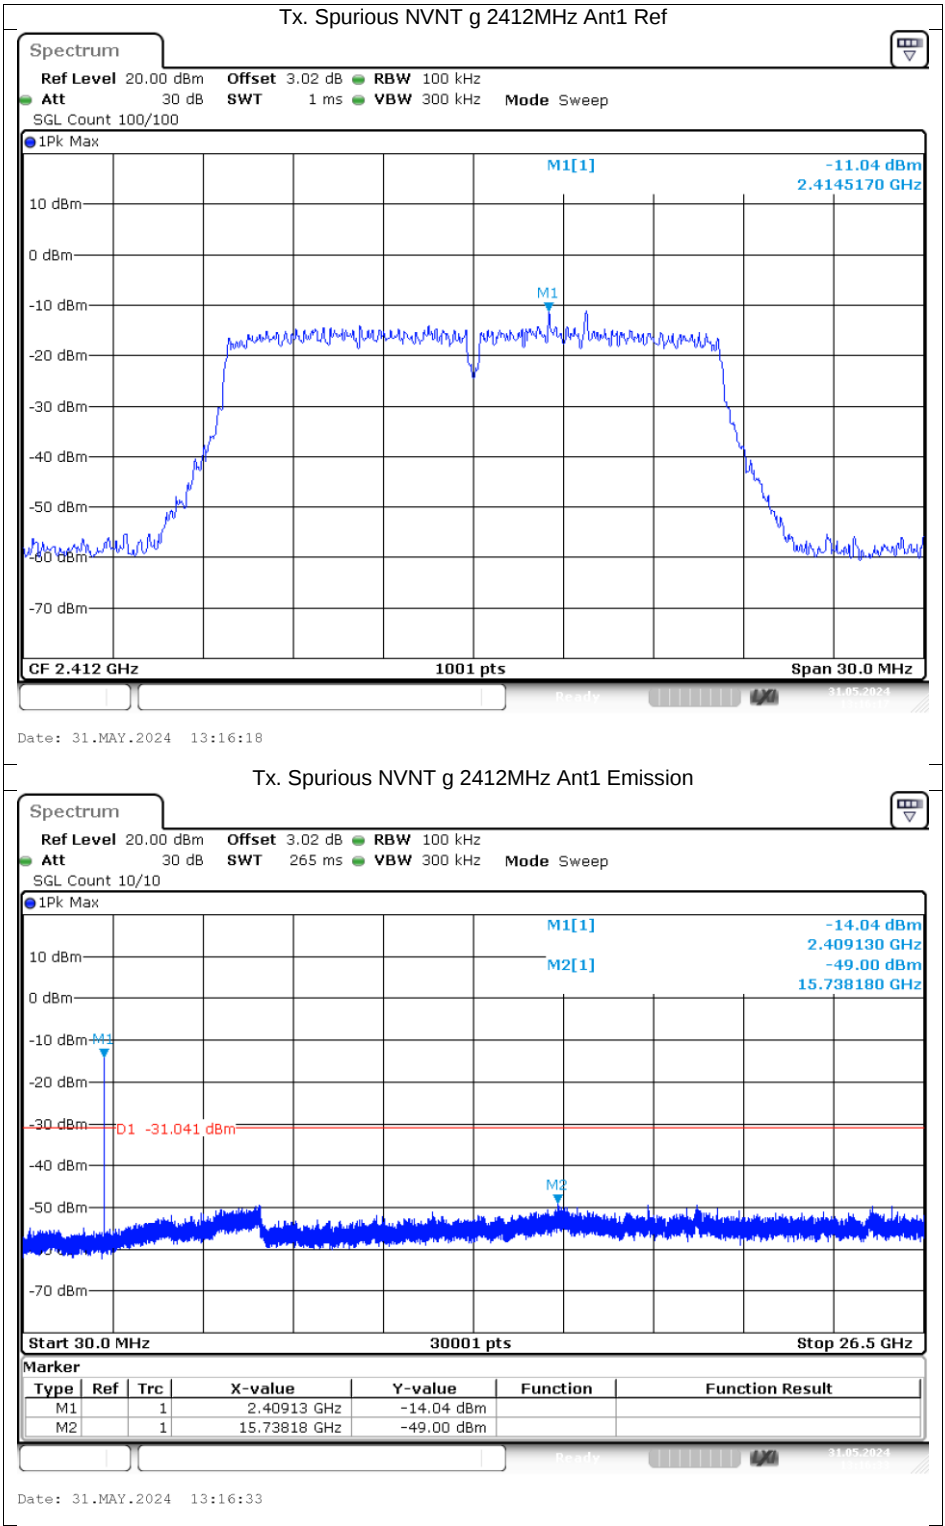


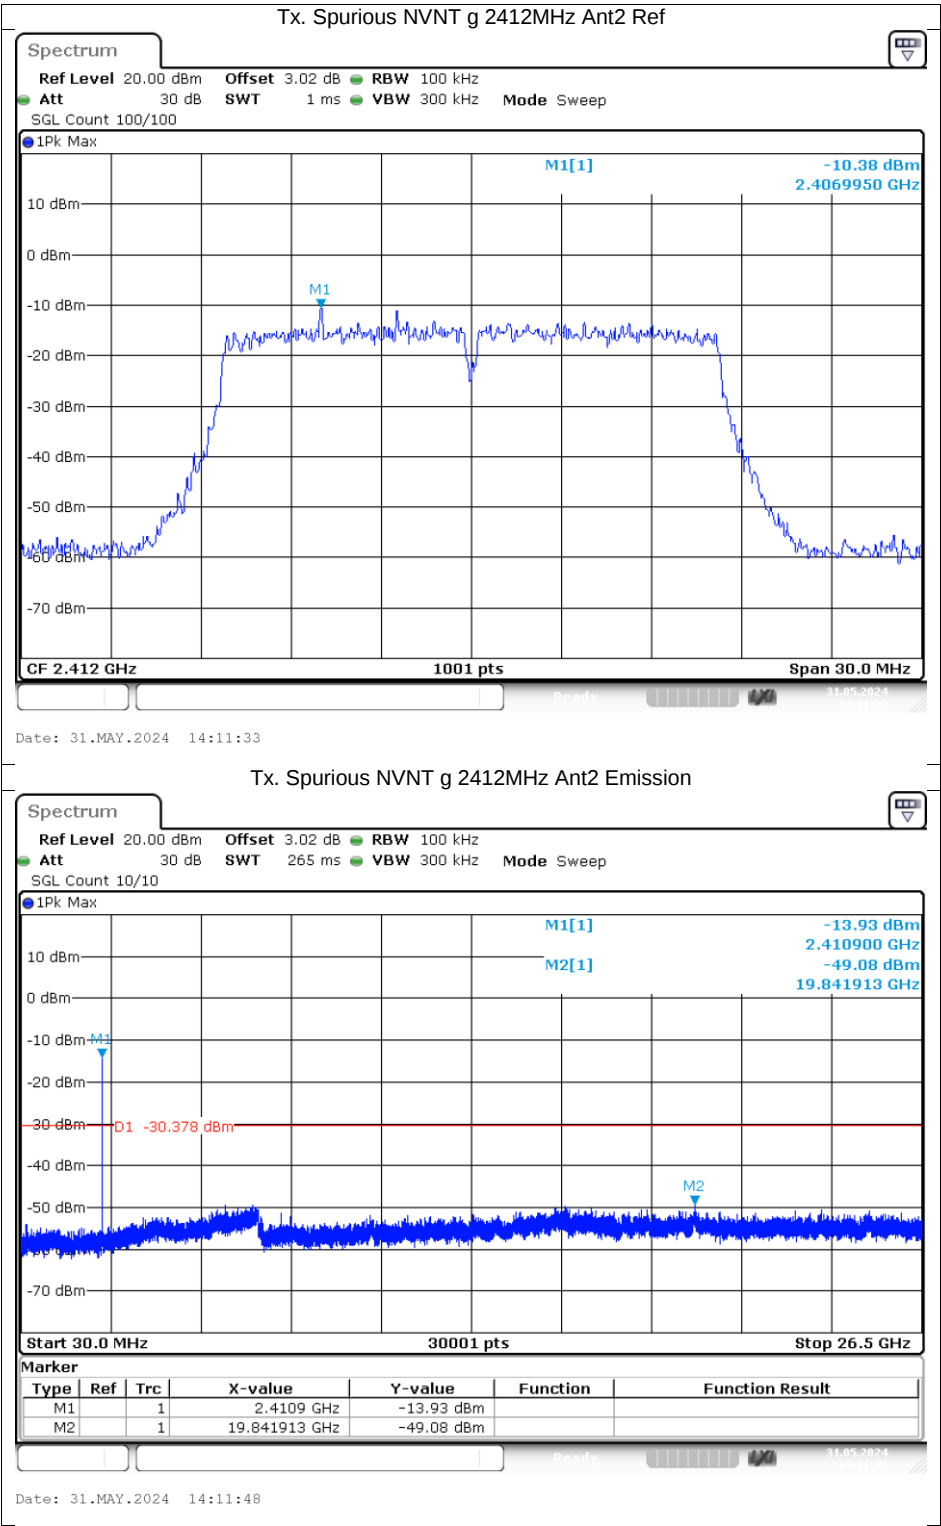


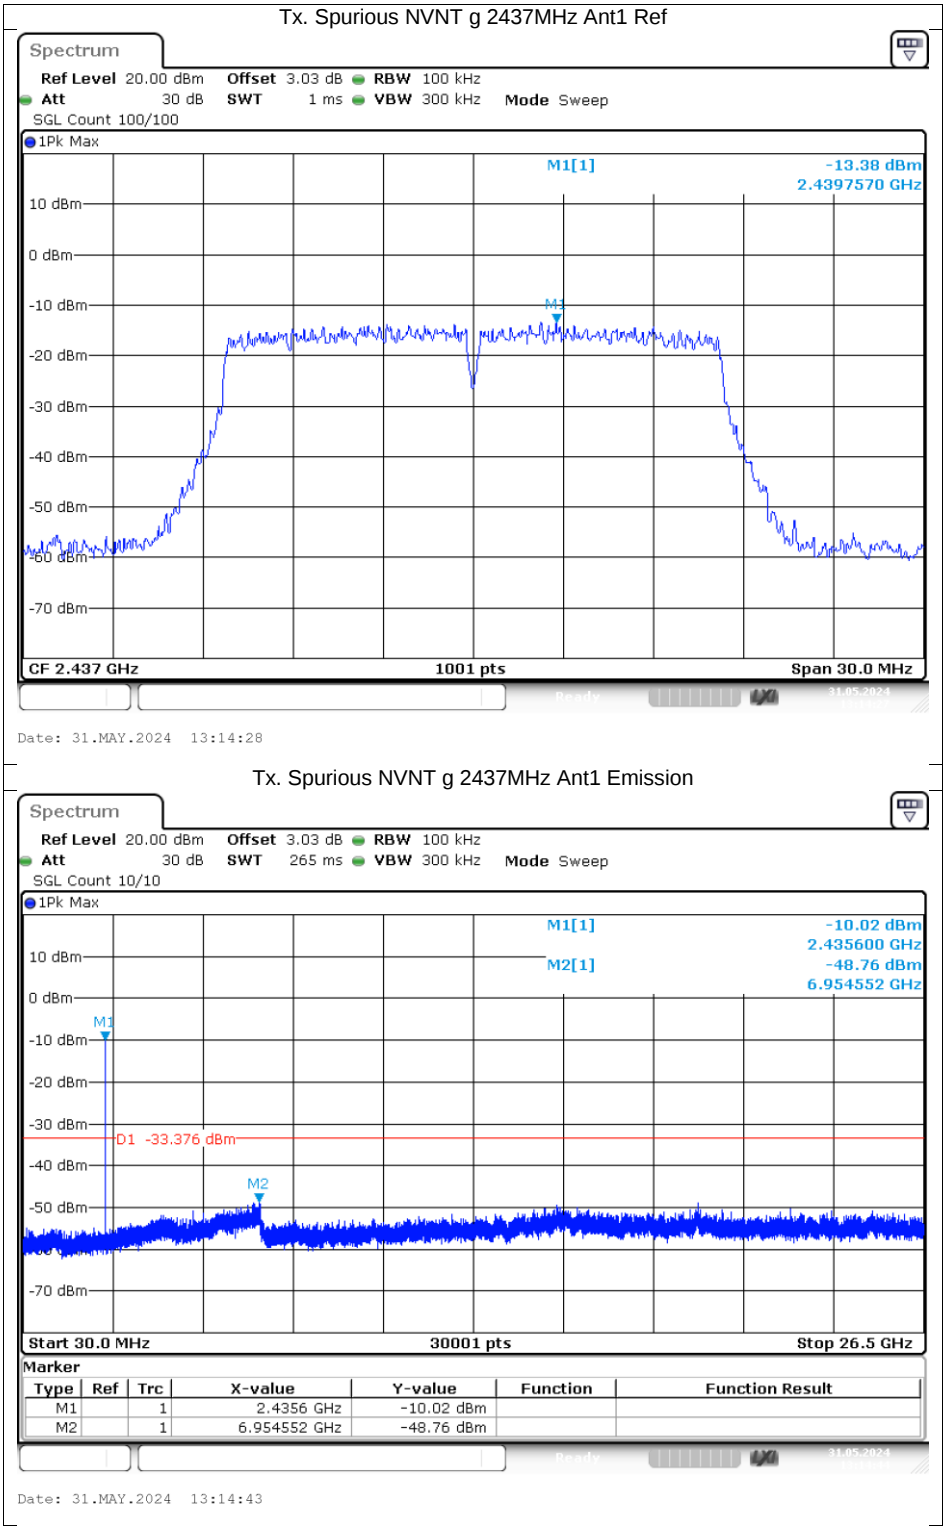


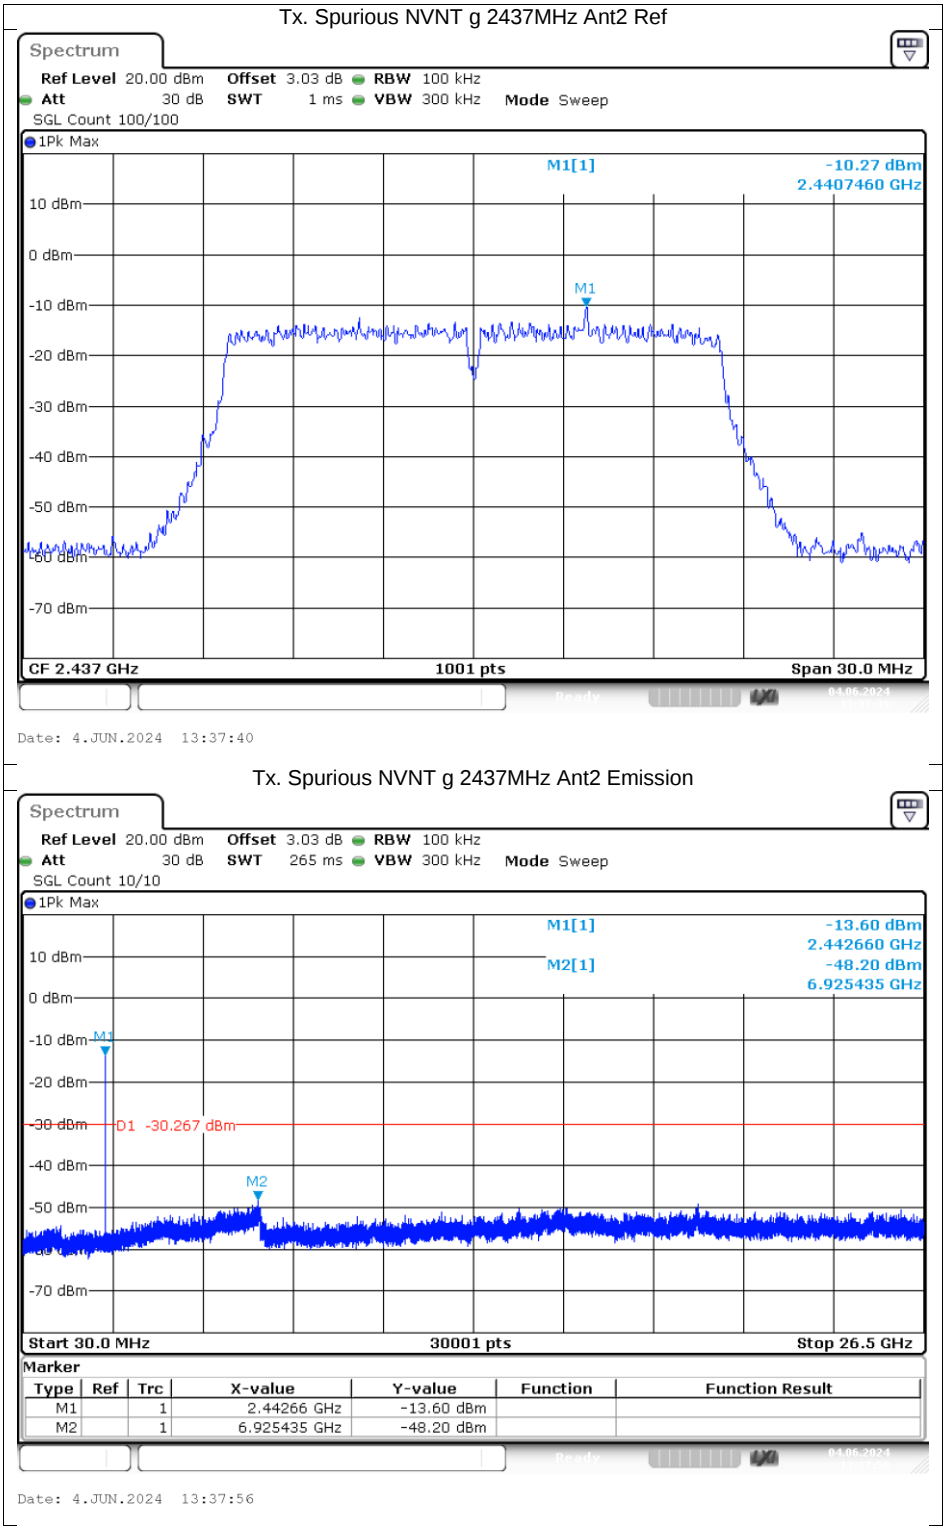


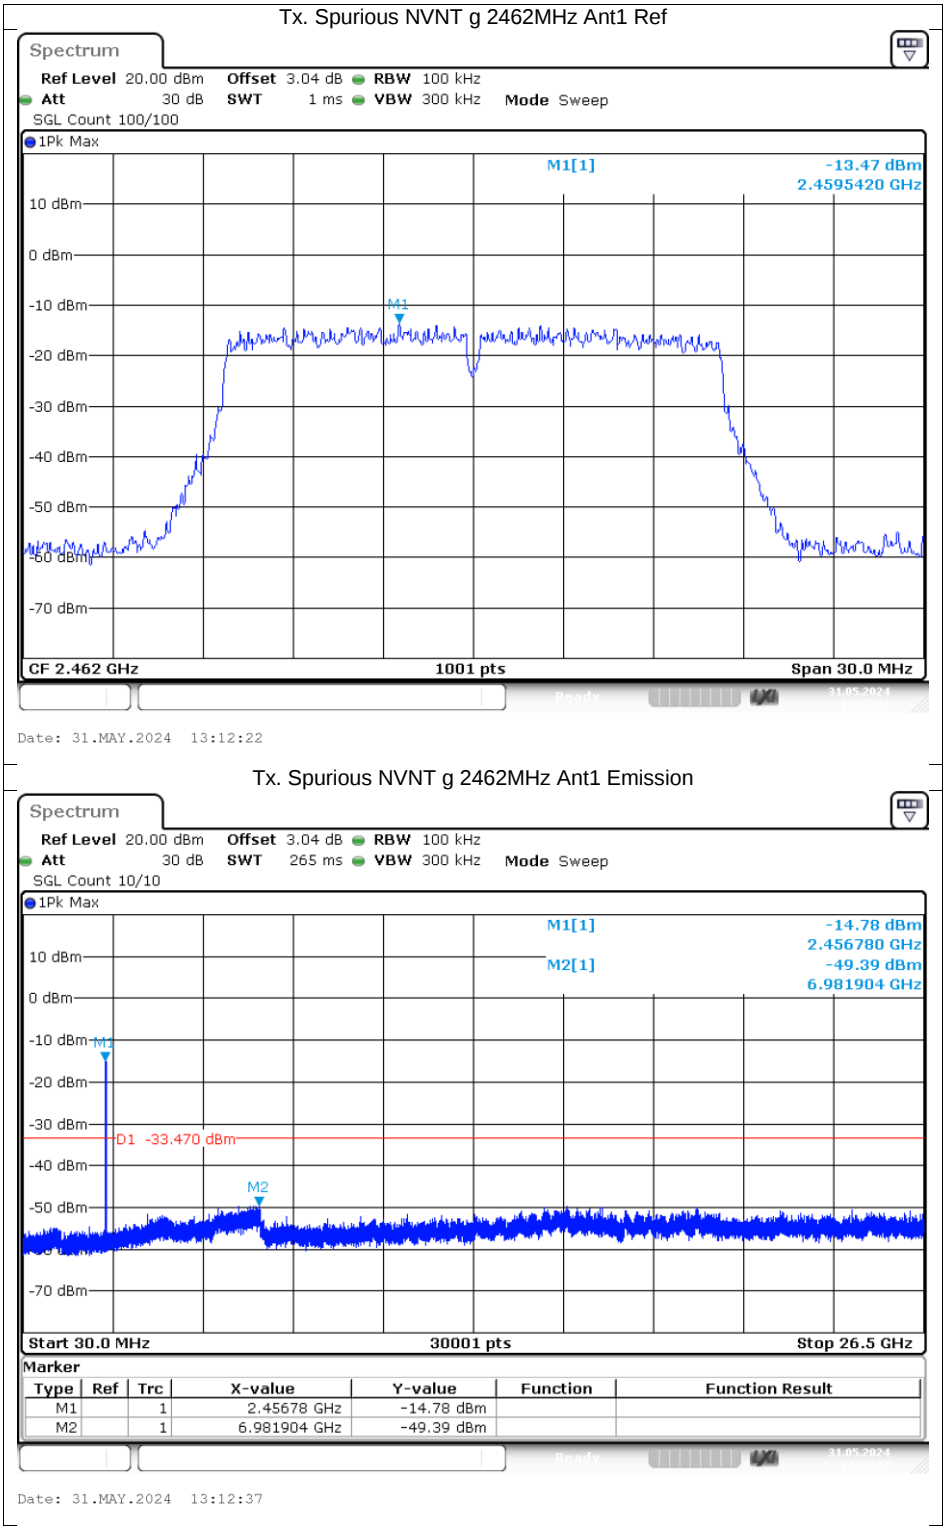


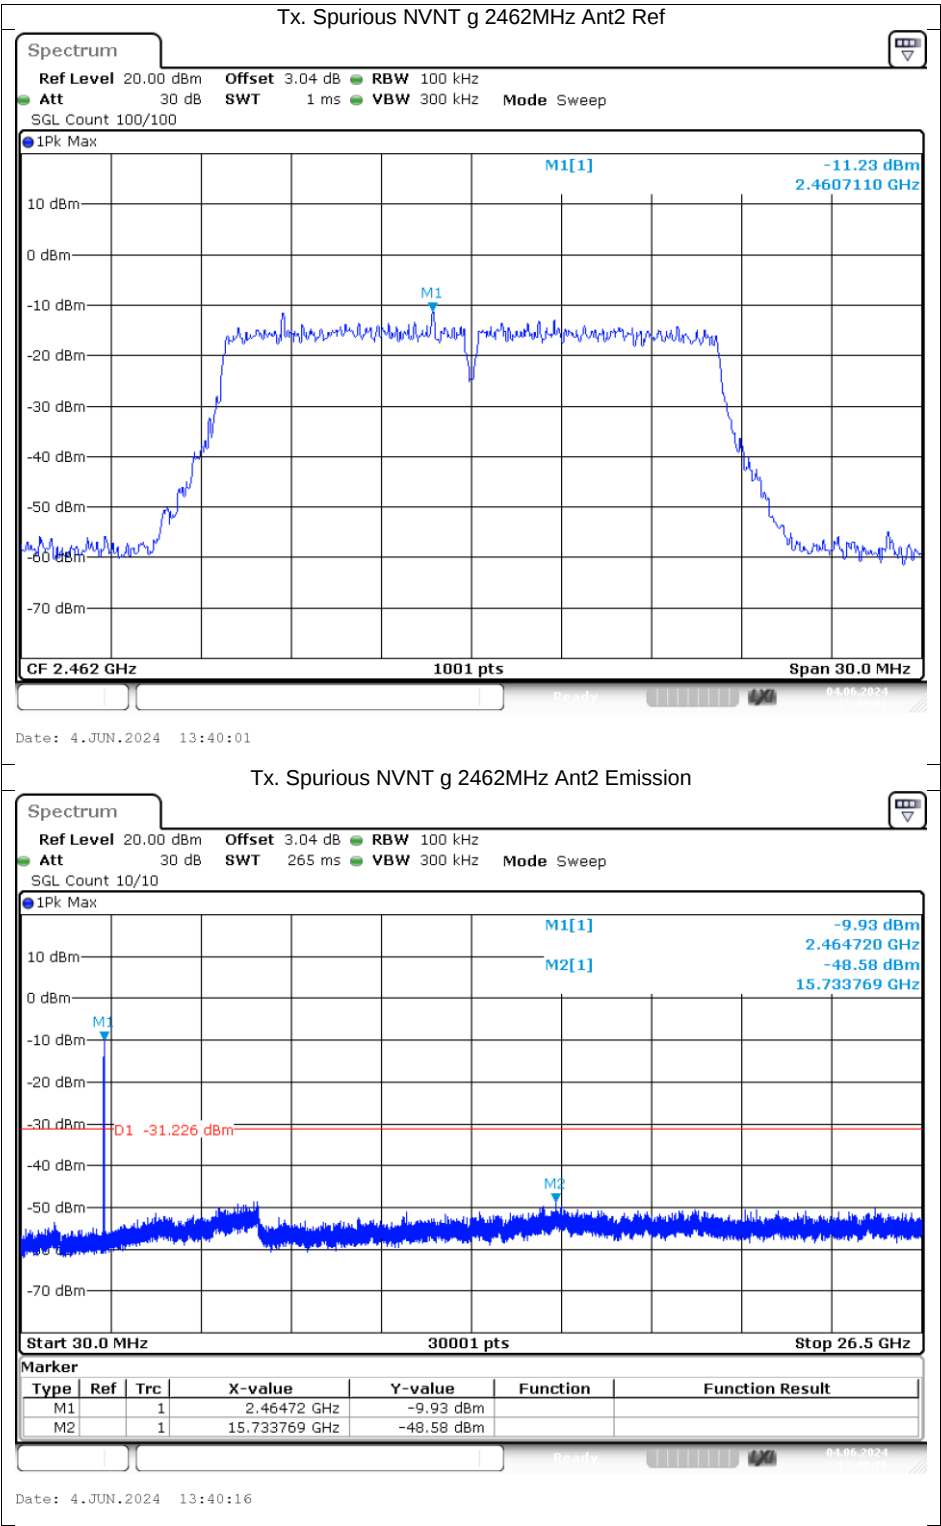


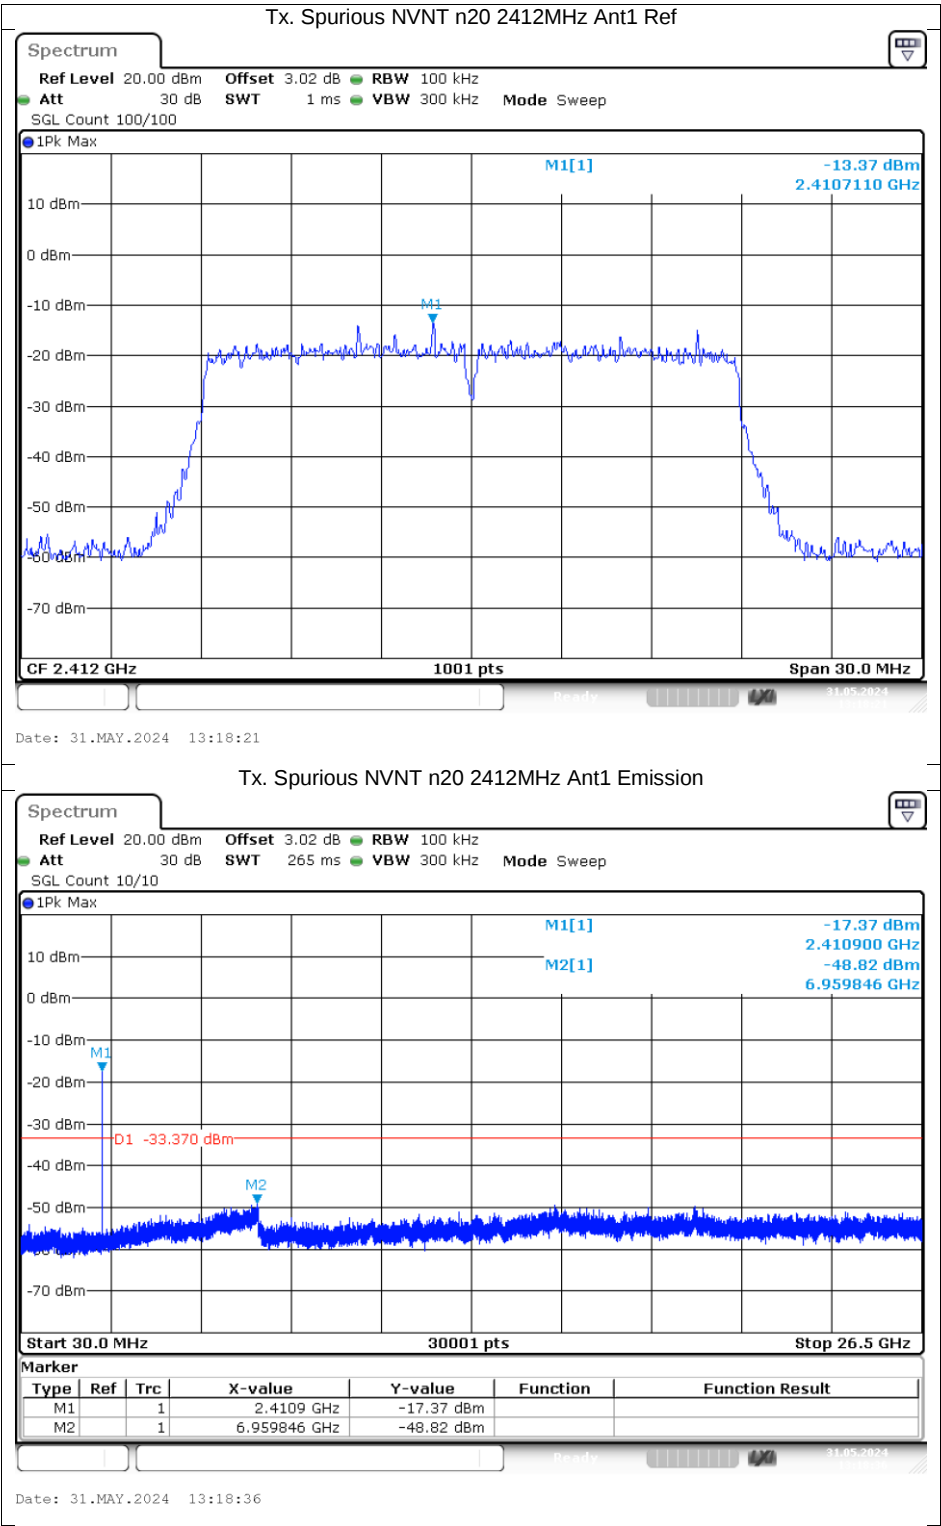


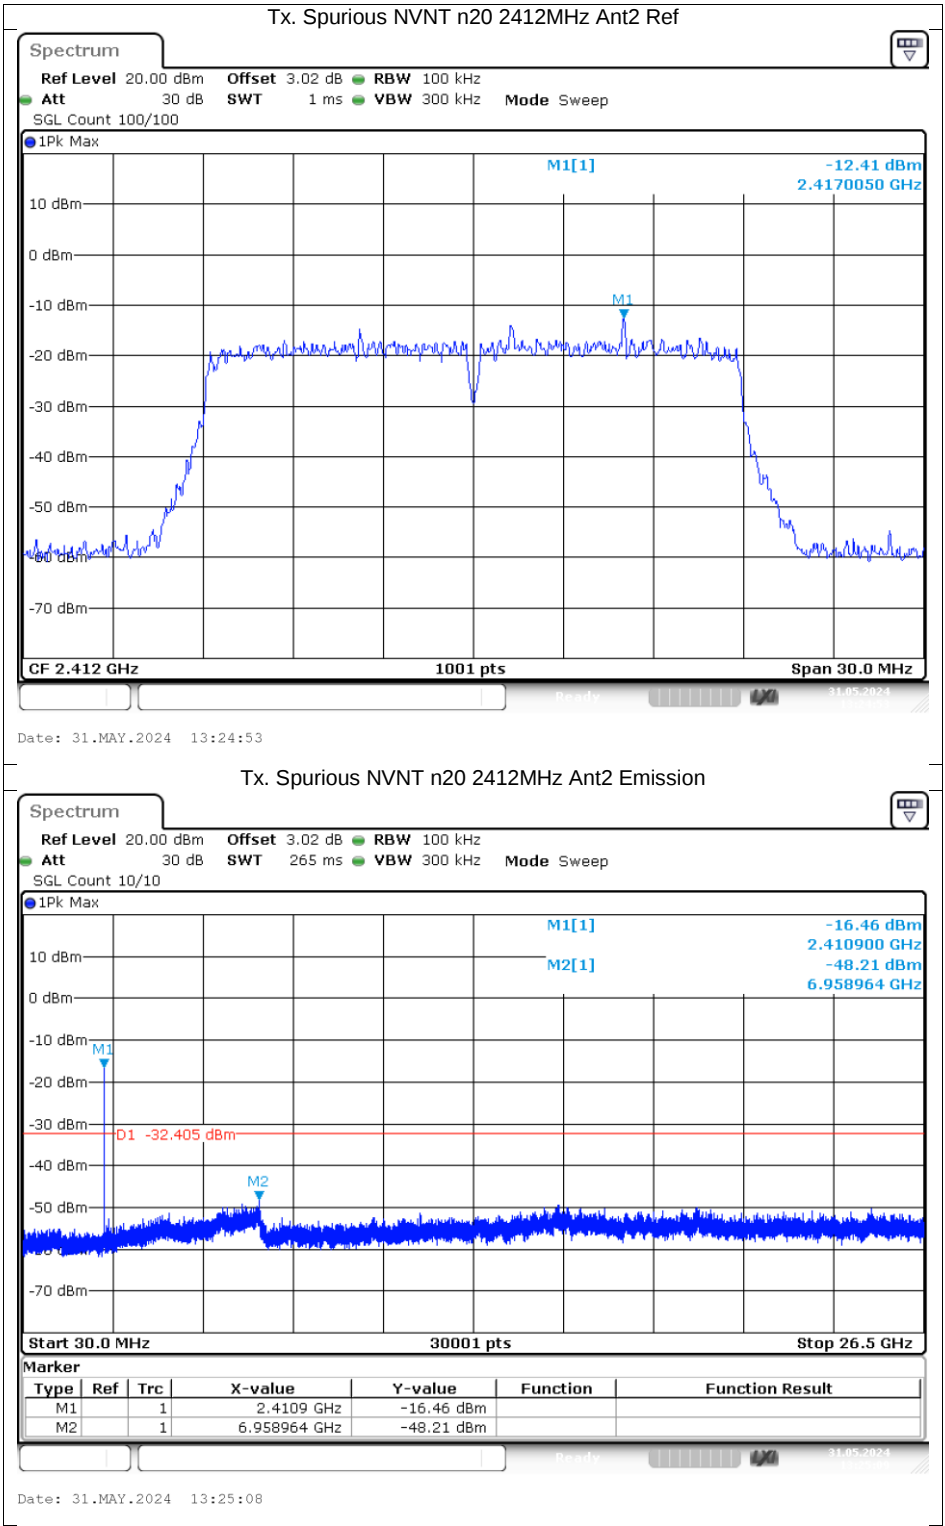


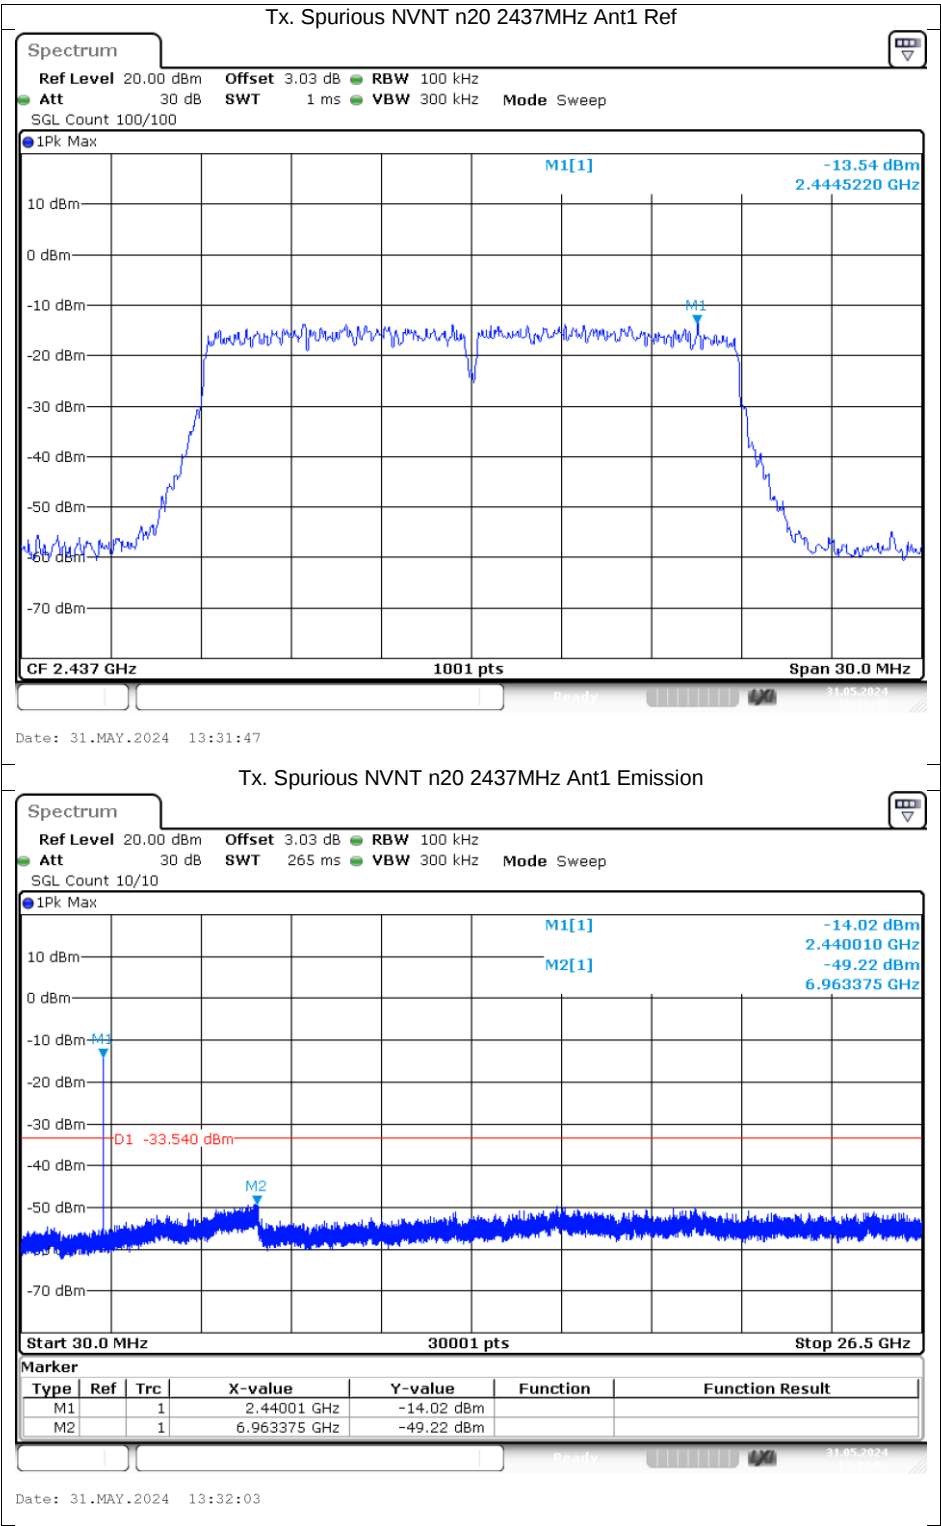


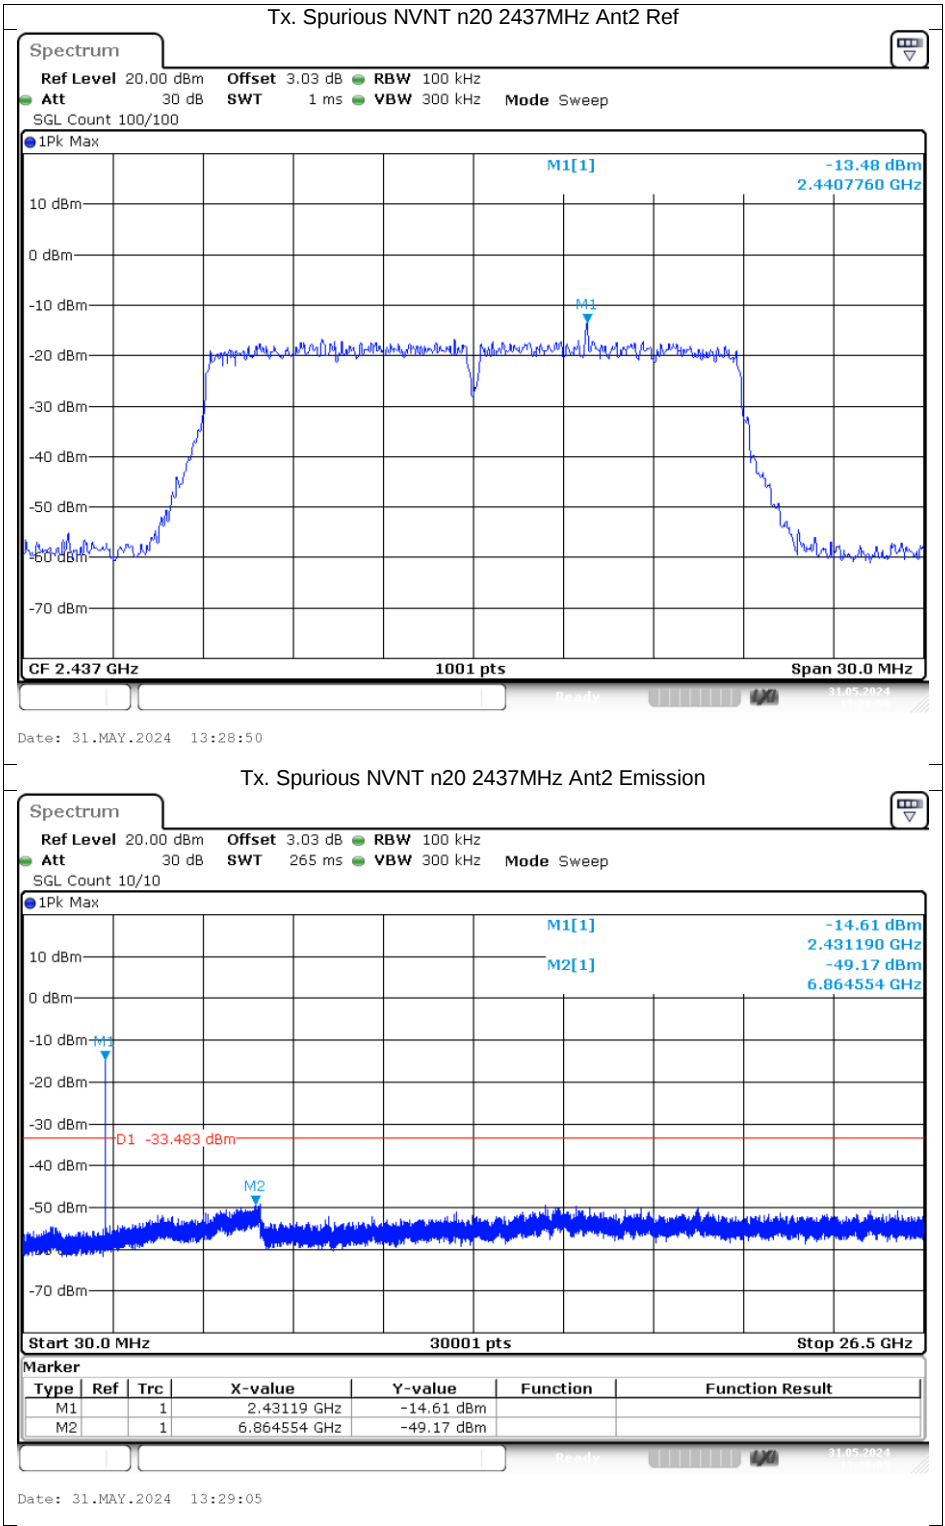


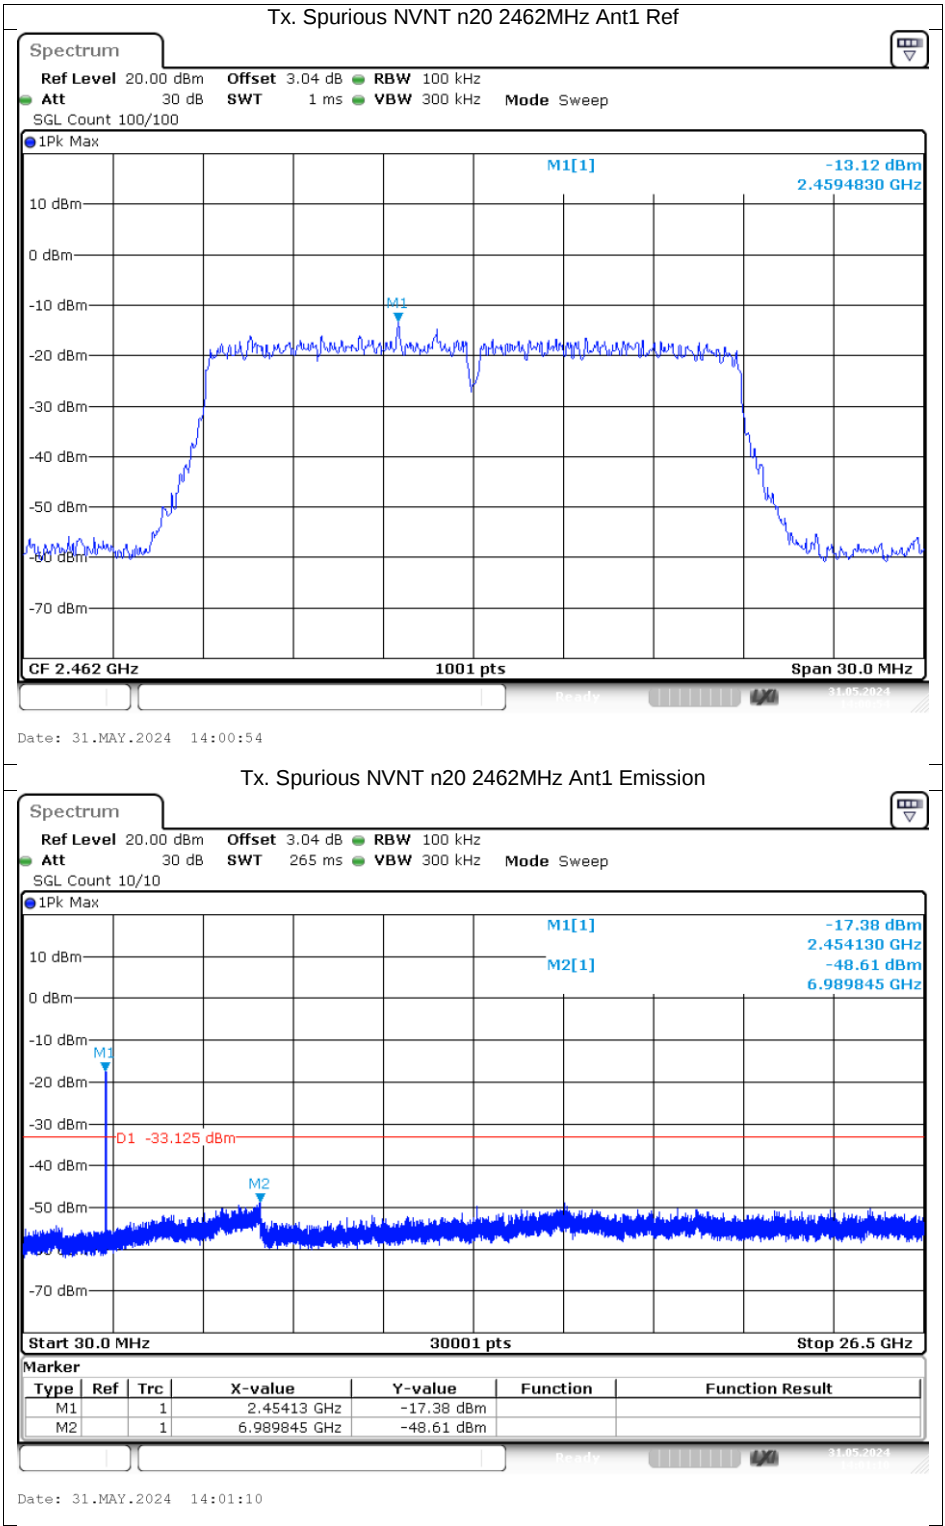


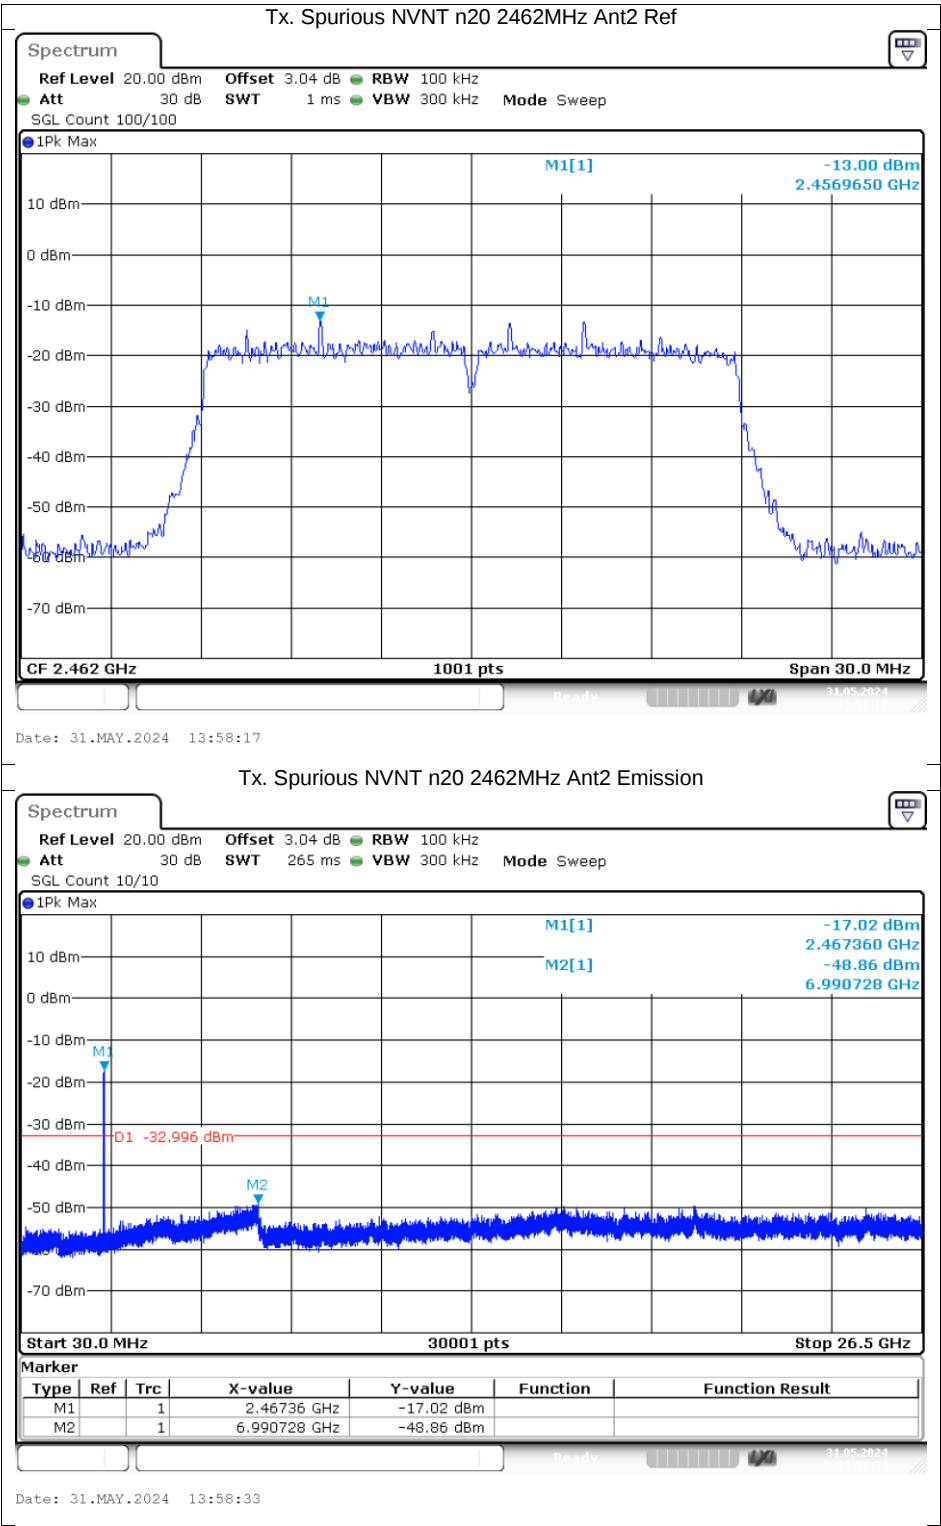


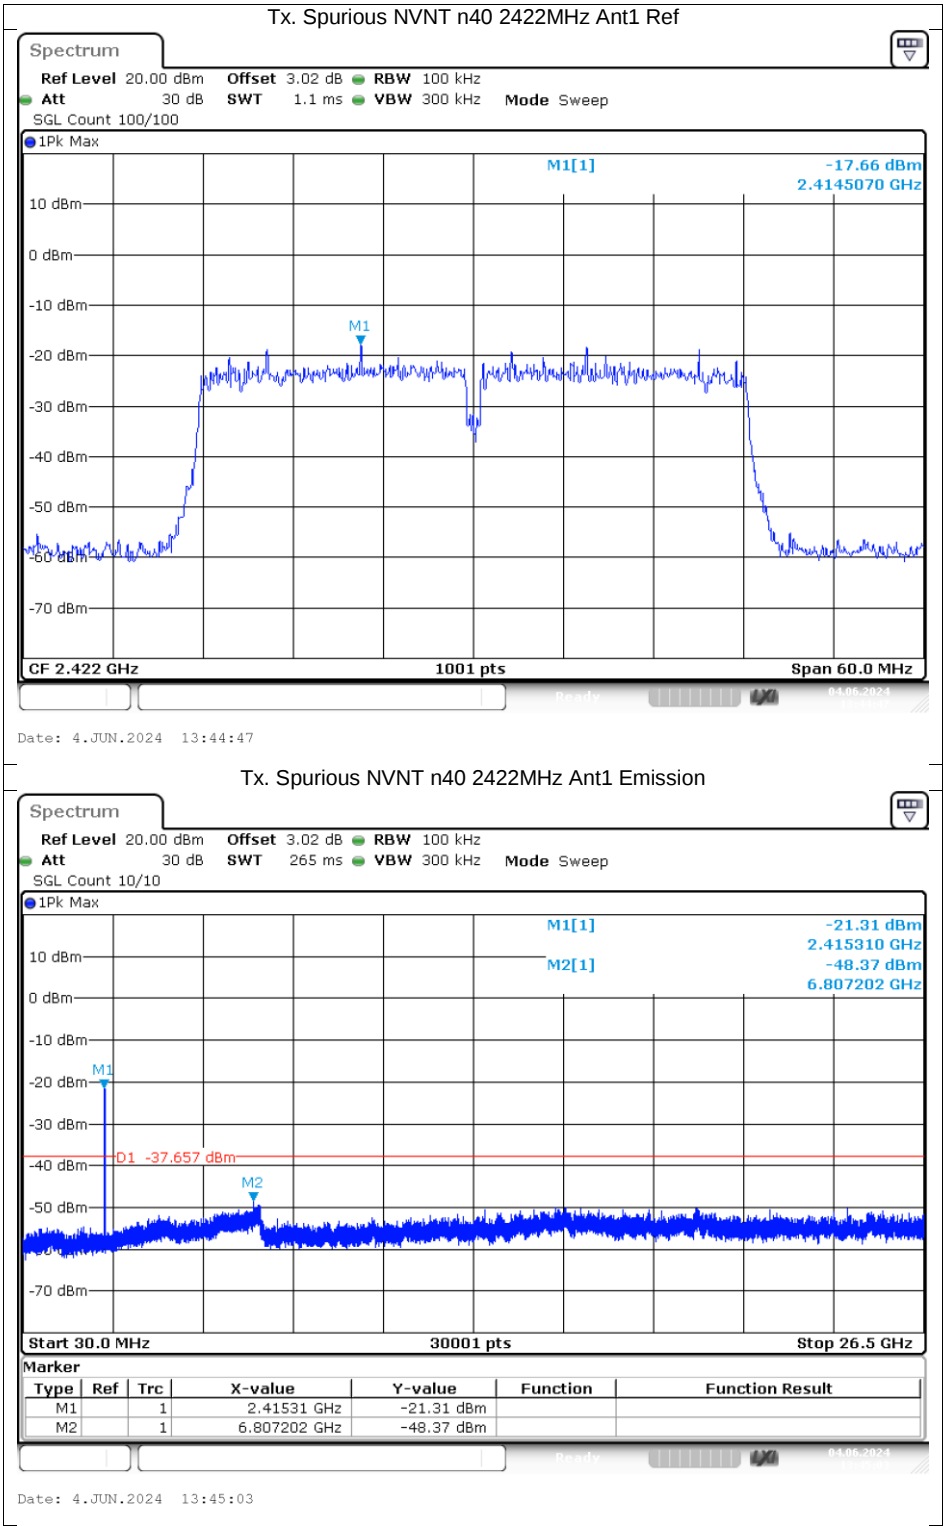


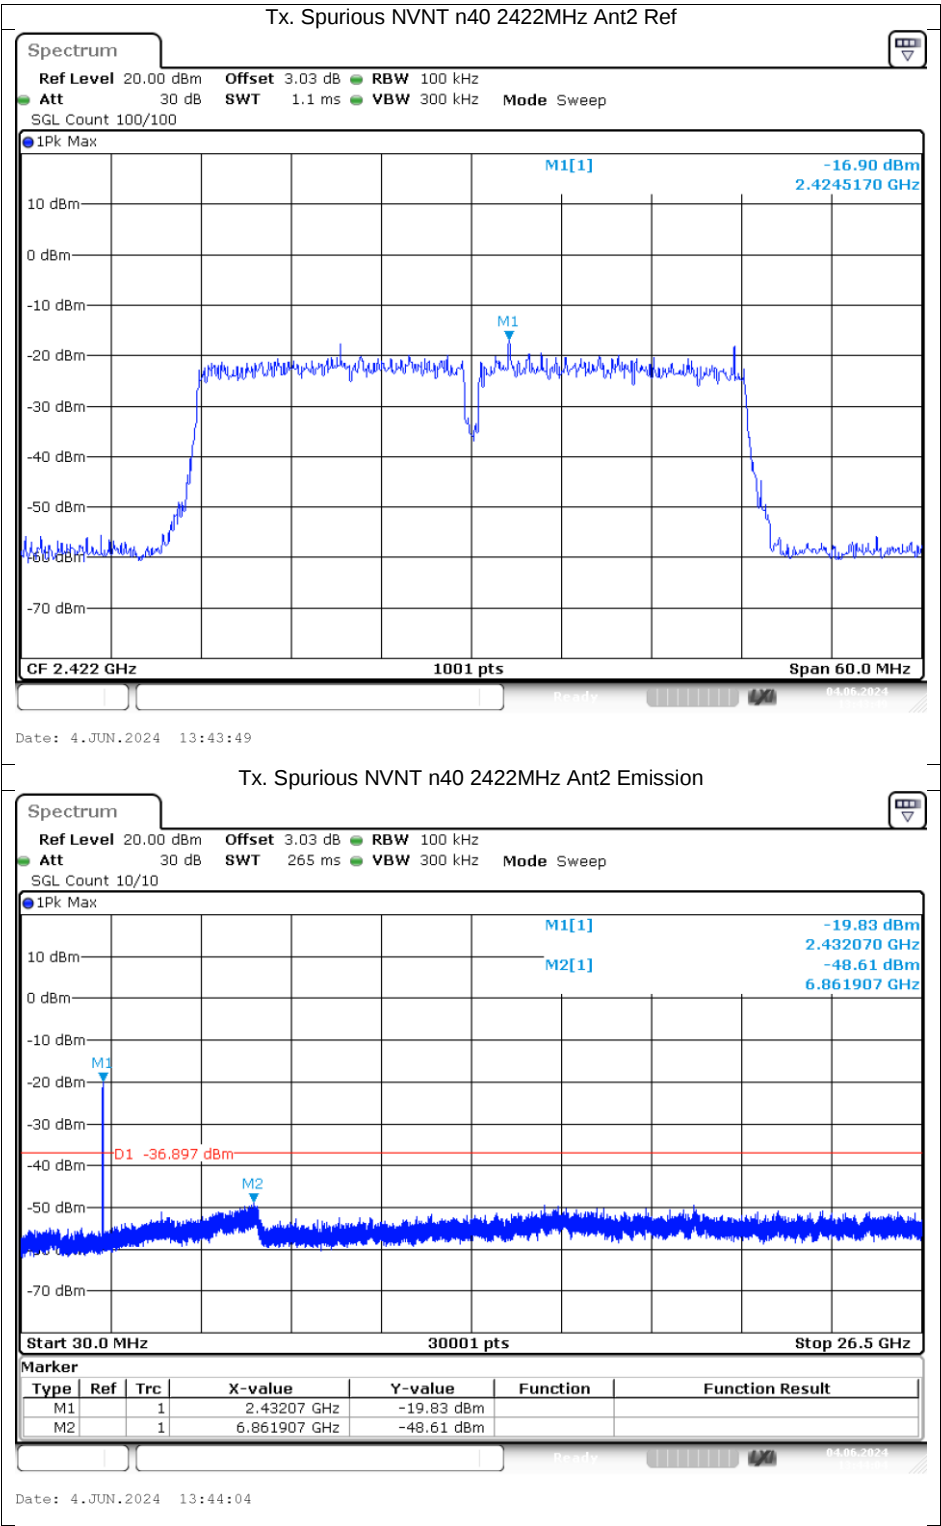

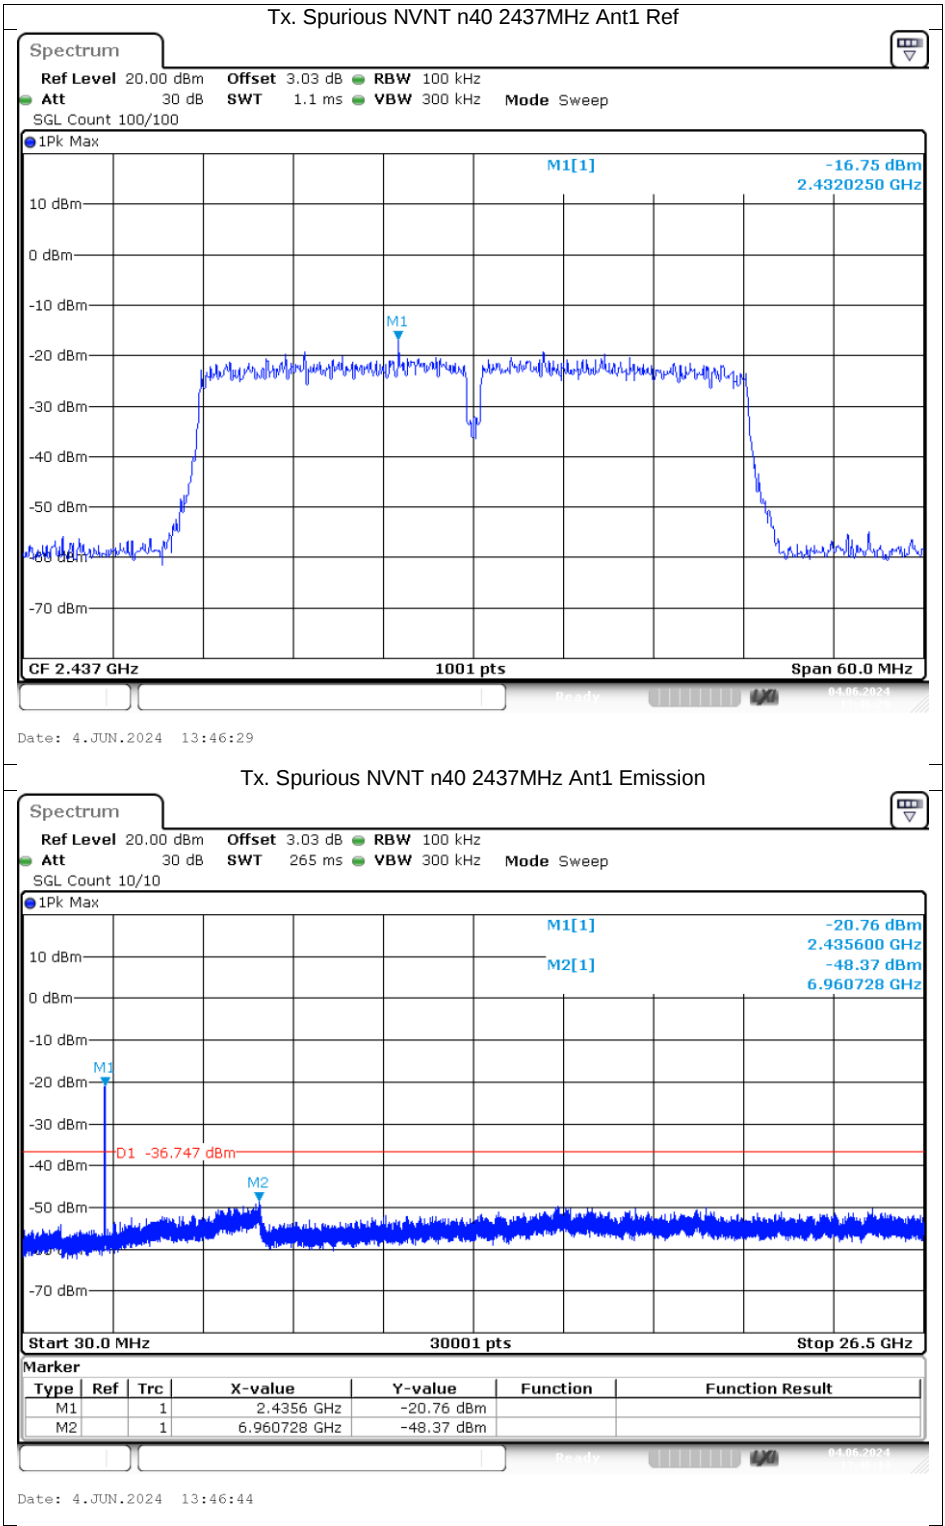

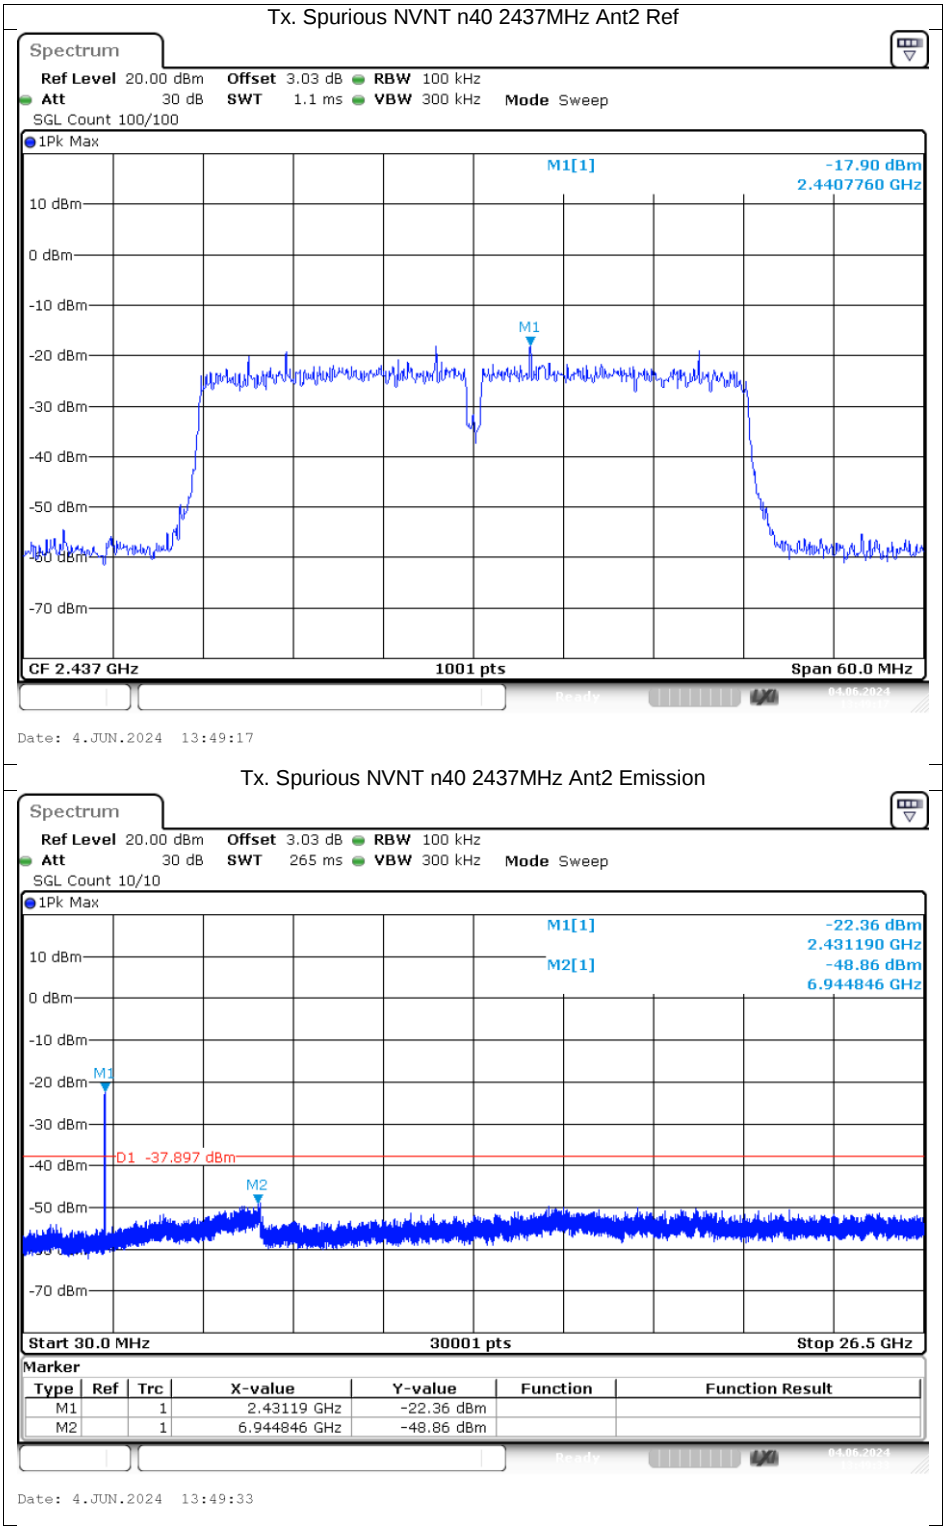


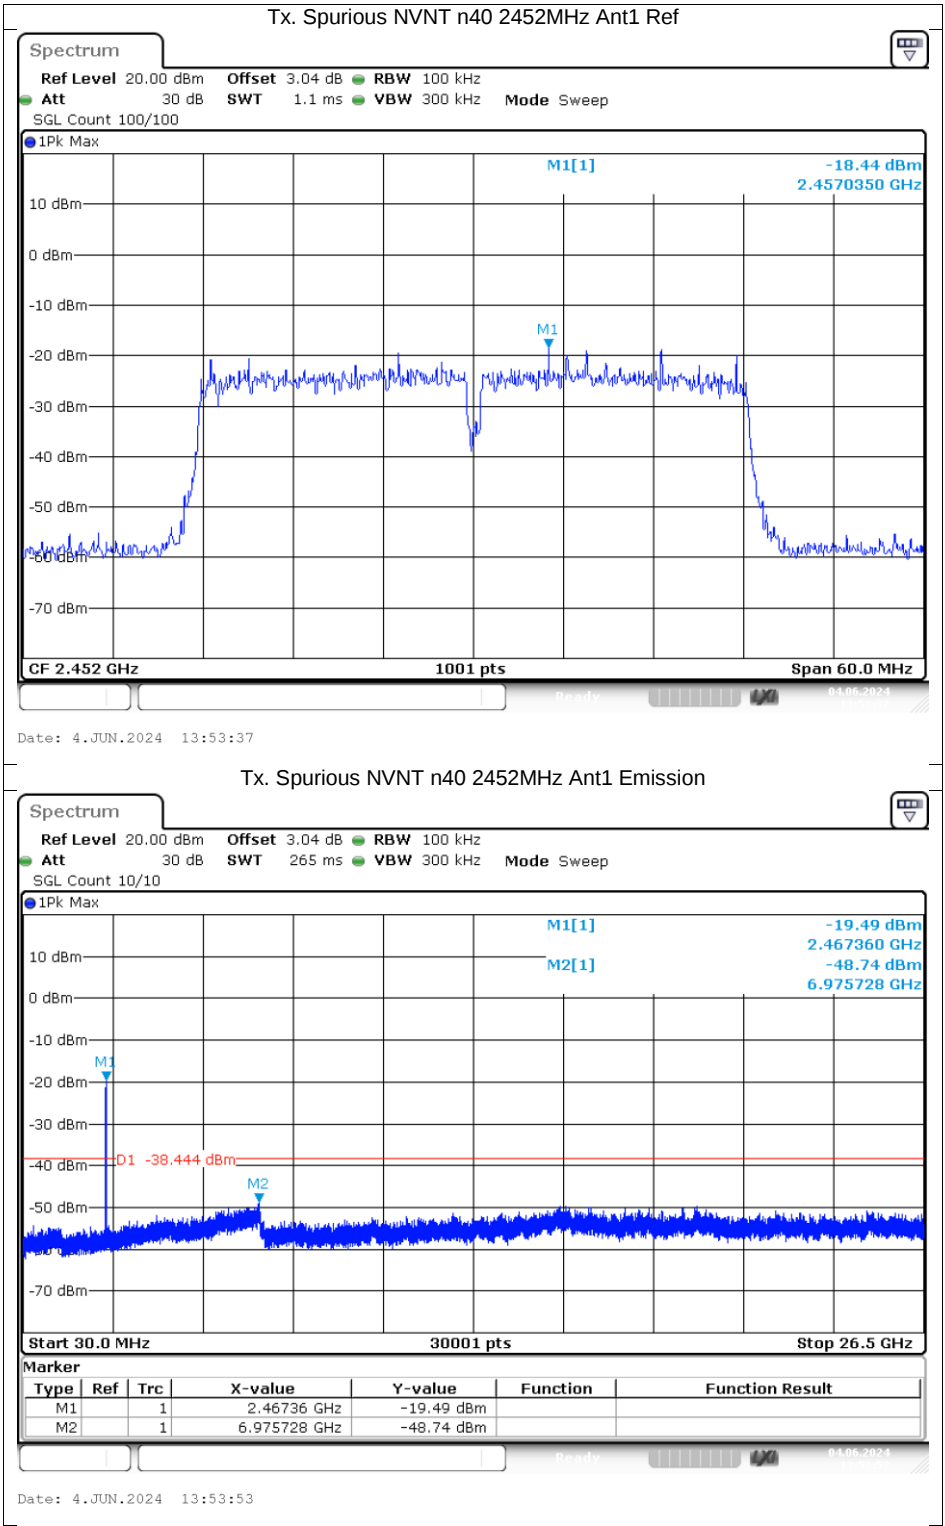

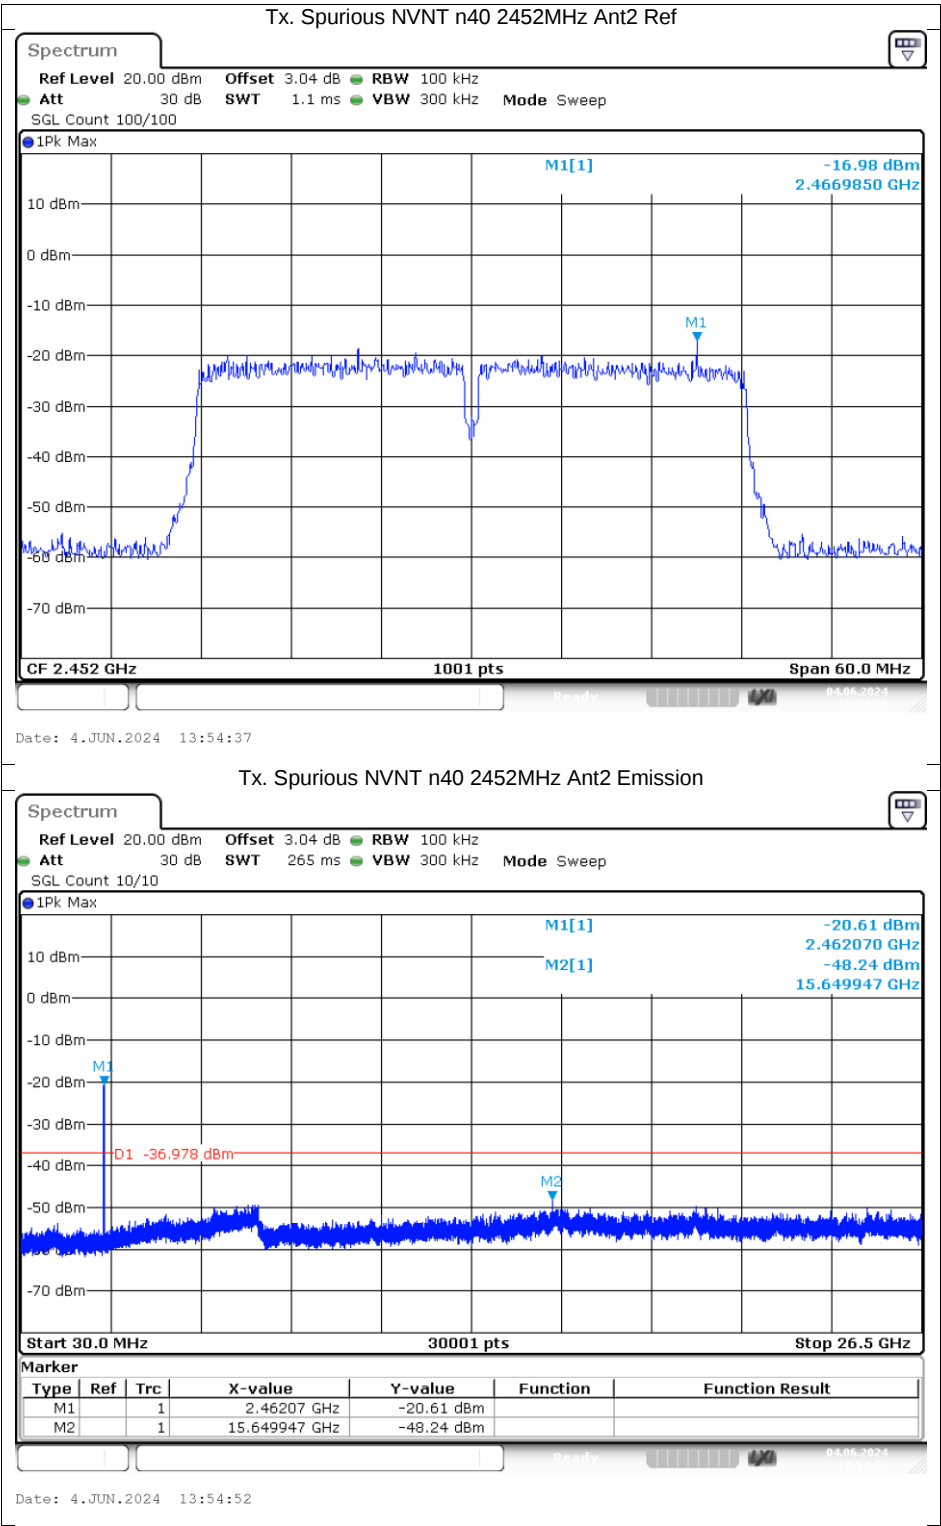



APPENDIX: PHOTOGRAPHS OF TEST CONFIGURATION

AC Power Line Conducted Emission

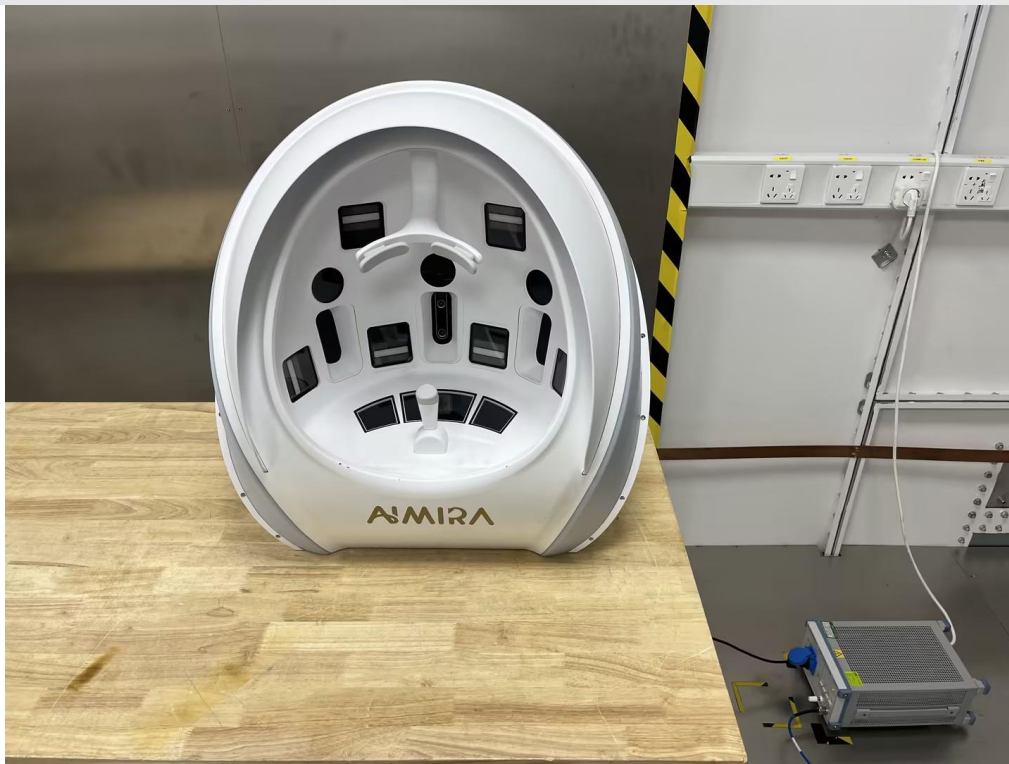

Radiated Band edge and Spurious Emission

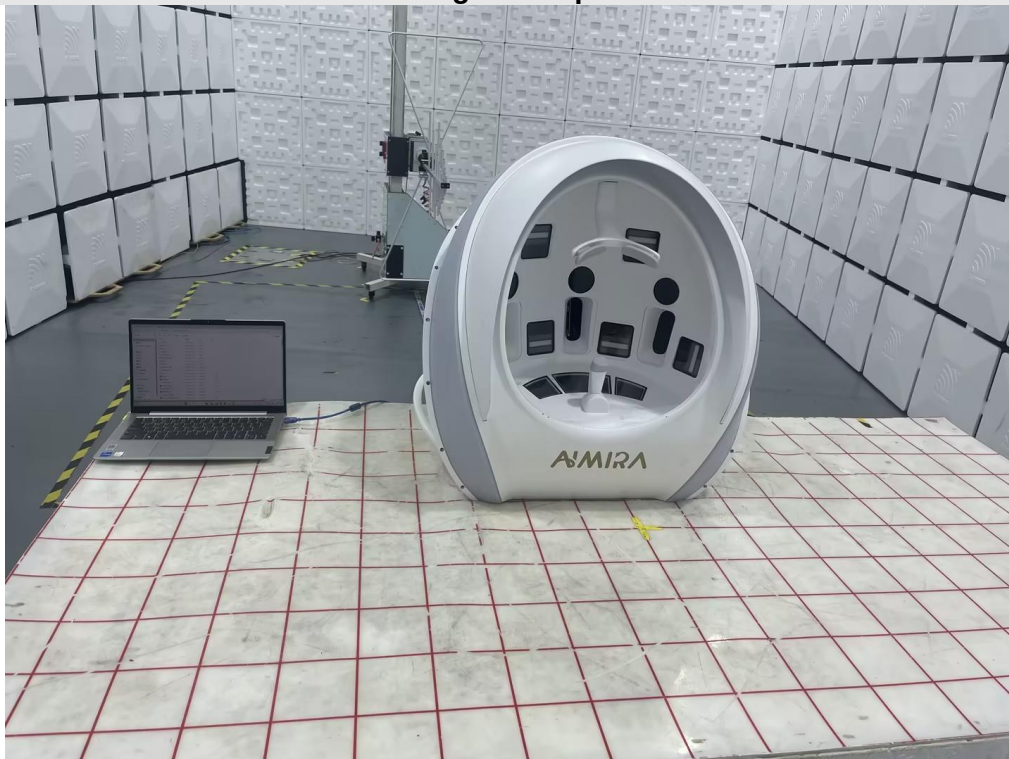

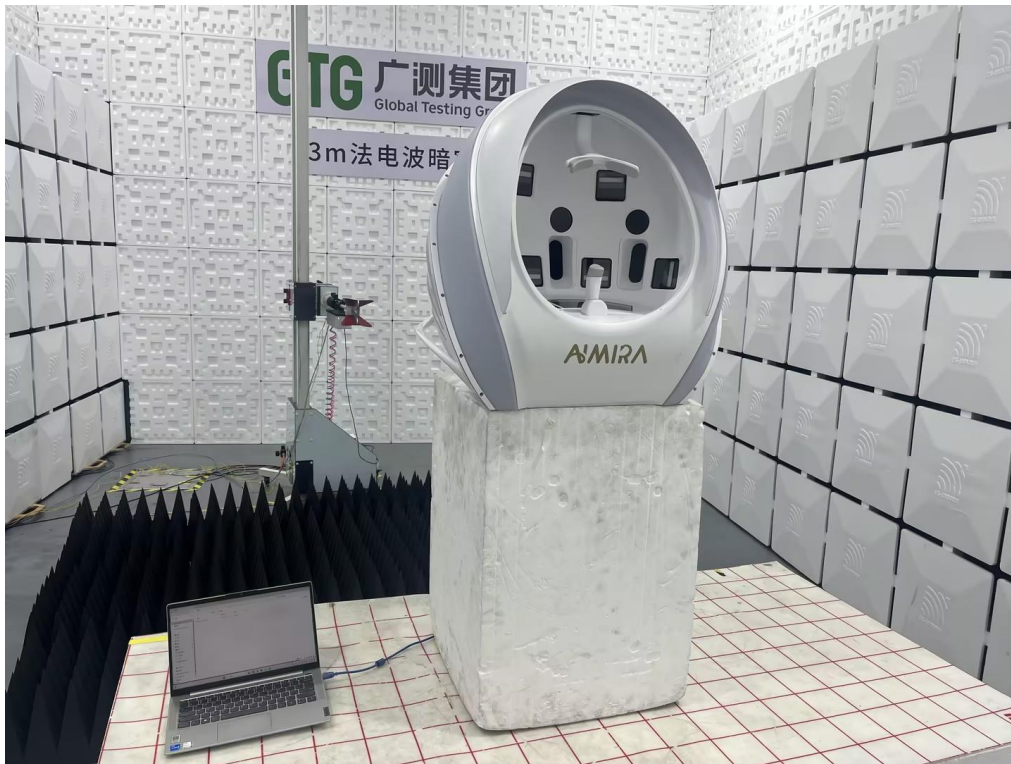

END OF REPORT