






DH5_Ant1_High_Hop_2480

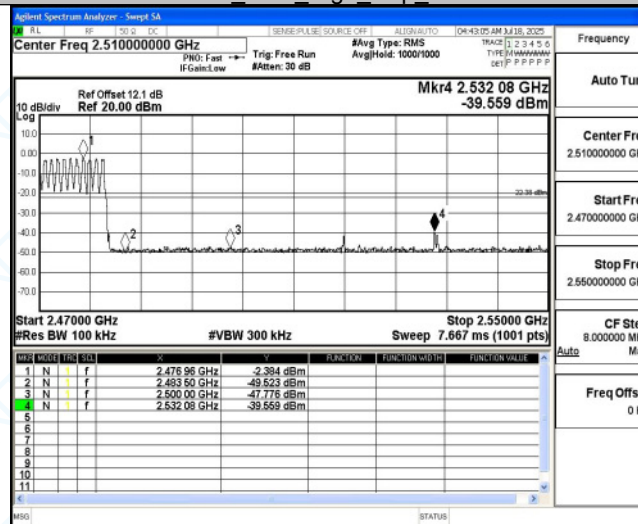

2DH5_Ant1_Low_2402

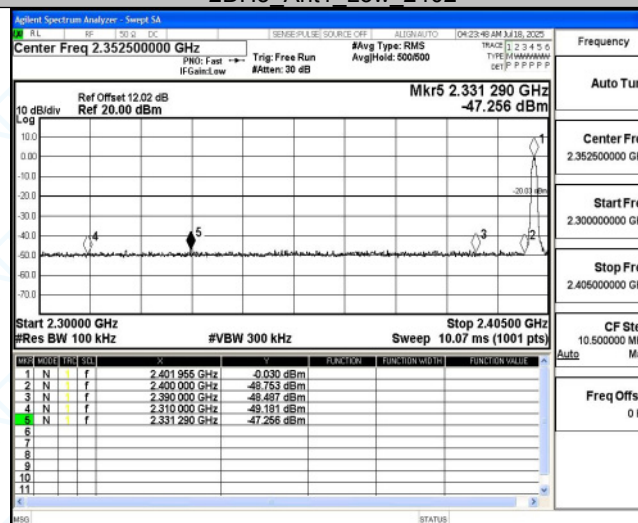


2DH5_Ant1_High_2480

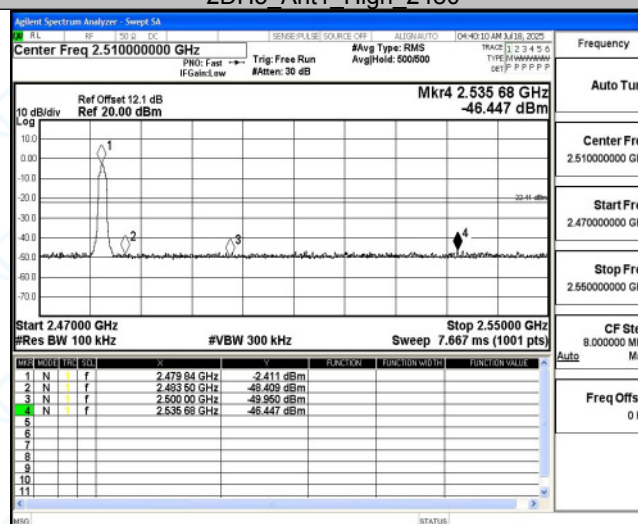




2DH5 Ant1 Low Hop 2402

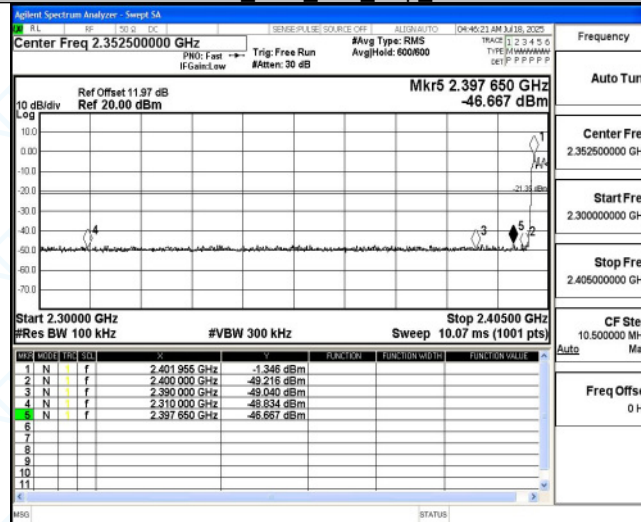

2DH5 Ant1 High Hop 2480

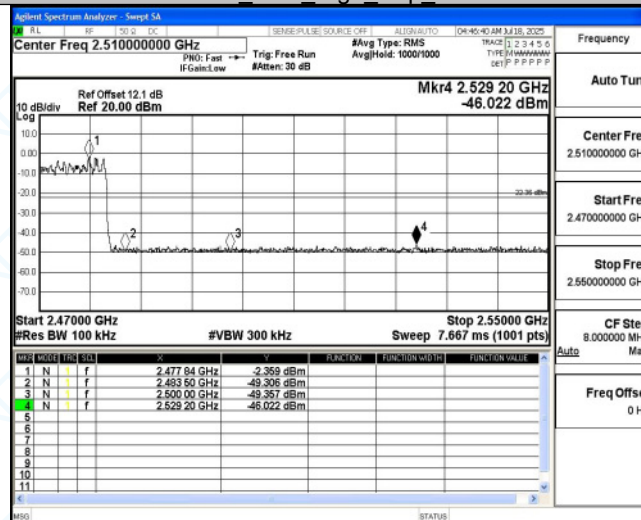



Appendix G: Conducted Spurious Emission

Test Result

TestMode	Antenna	Freq(MHz)	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	Reference	-0.33	-0.33	---	PASS
			30~1000	-0.33	-58.48	≤ -20.33	PASS
			1000~26500	-0.33	-30.81	≤ -20.33	PASS
		2441	Reference	-1.24	-1.24	---	PASS
			30~1000	-1.24	-58.84	≤ -21.24	PASS
			1000~26500	-1.24	-37.9	≤ -21.24	PASS
		2480	Reference	-2.53	-2.53	---	PASS
			30~1000	-2.53	-59.23	≤ -22.53	PASS
			1000~26500	-2.53	-35.56	≤ -22.53	PASS
2DH5	Ant1	2402	Reference	-0.53	-0.53	---	PASS
			30~1000	-0.53	-58.74	≤ -20.53	PASS
			1000~26500	-0.53	-38.85	≤ -20.53	PASS
		2441	Reference	-1.24	-1.24	---	PASS
			30~1000	-1.24	-59.11	≤ -21.24	PASS
			1000~26500	-1.24	-34.83	≤ -21.24	PASS
		2480	Reference	-2.56	-2.56	---	PASS
			30~1000	-2.56	-58.88	≤ -22.56	PASS
			1000~26500	-2.56	-28.88	≤ -22.56	PASS


Note :

Both Left glasses leg and Right glasses leg have tested, The Right glasses leg is the worst, only the worse case was reported.




Test Graphs


DH5_Ant1_2402_0~Reference

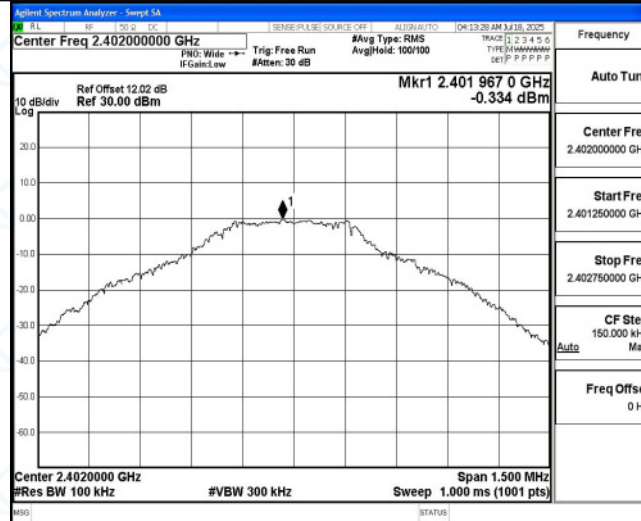

DH5_Ant1_2402_30~1000

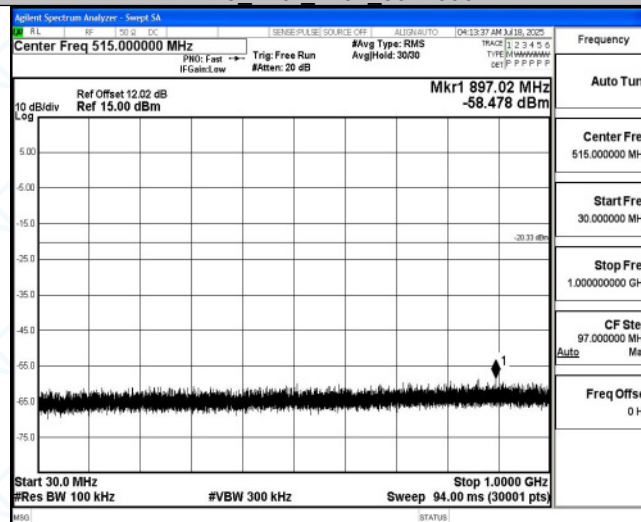


DH5_Ant1_2402_1000~26500

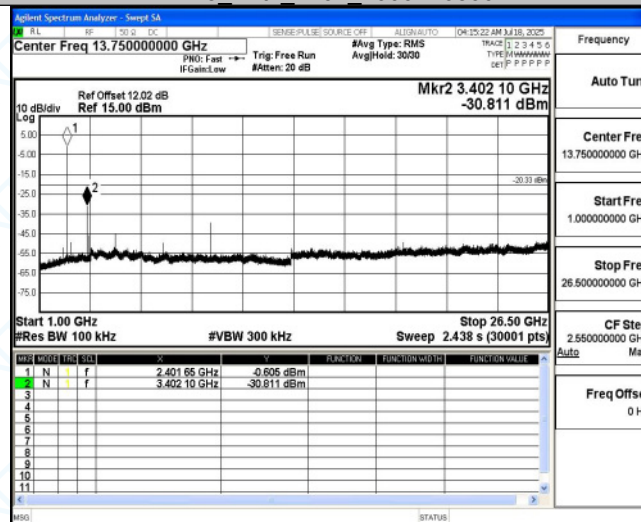





DH5_Ant1_2441_0~Reference

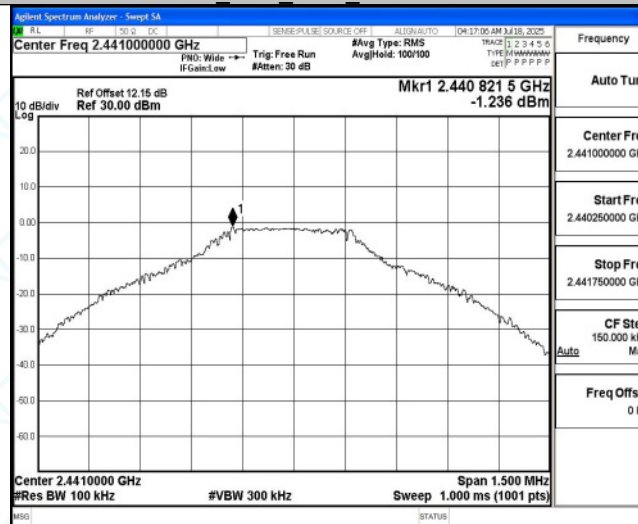

DH5_Ant1_2441_30~1000

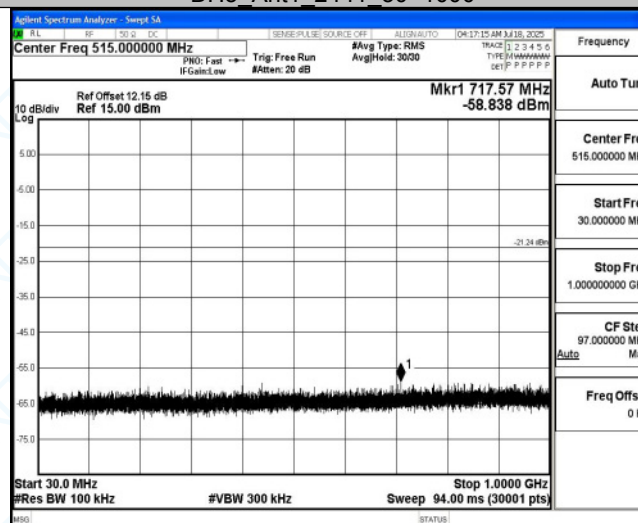


DH5_Ant1_2441_1000~26500

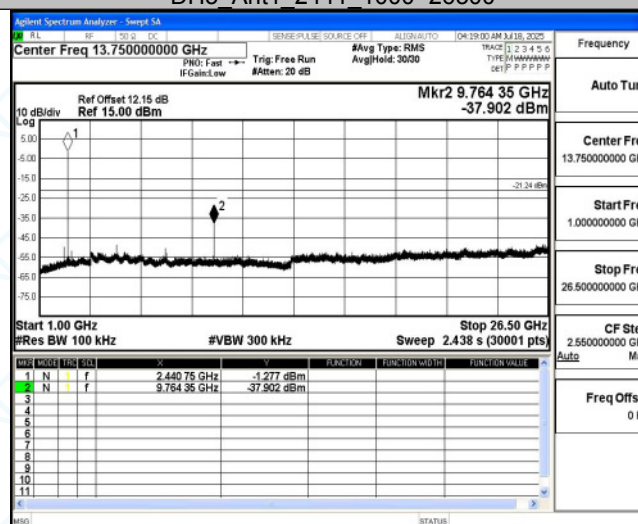





DH5_Ant1_2480_0~Reference

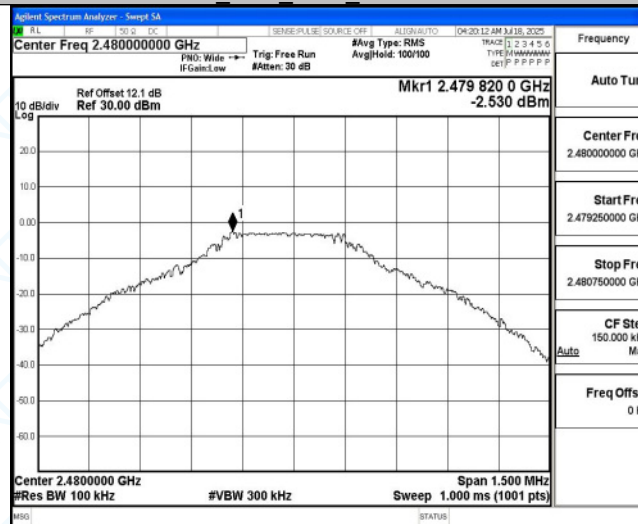

DH5_Ant1_2480_30~1000

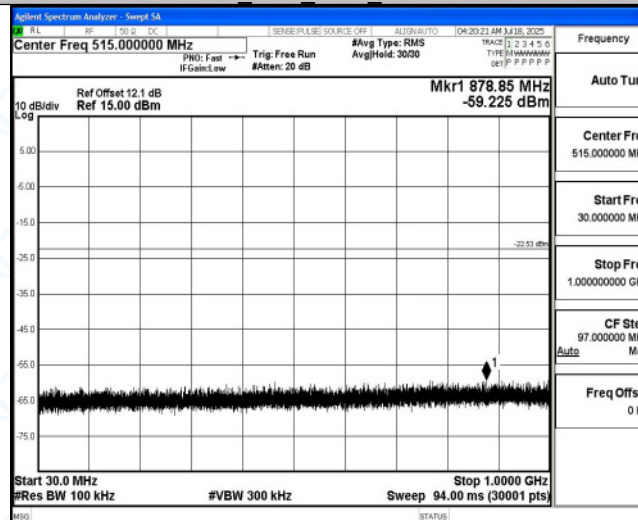


DH5_Ant1_2480_1000~26500

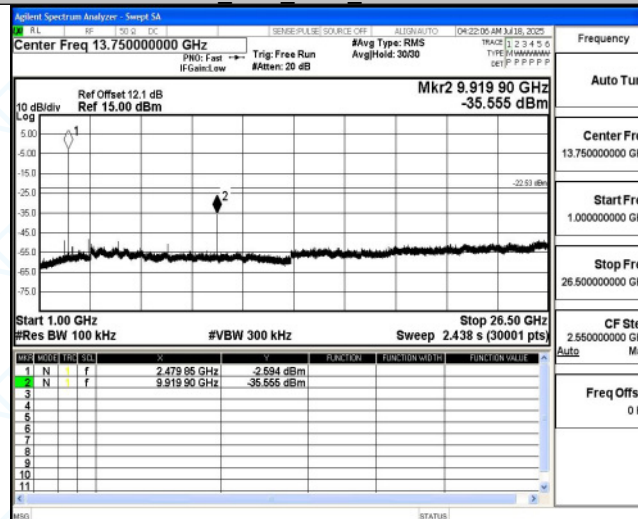





2DH5_Ant1_2402_0~Reference

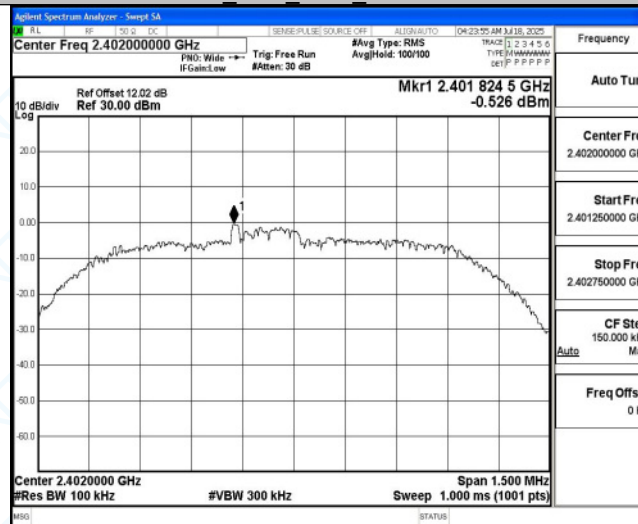

2DH5_Ant1_2402_30~1000

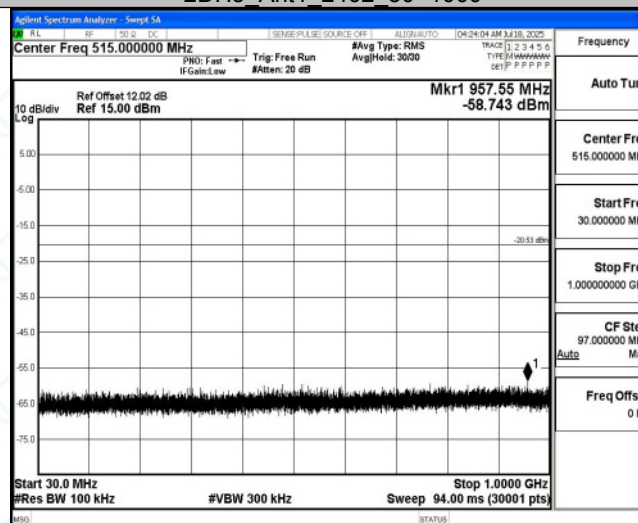


2DH5_Ant1_2402_1000~26500

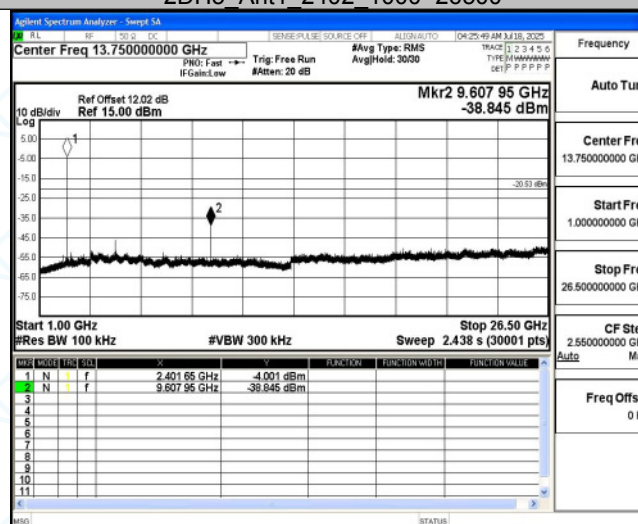





2DH5_Ant1_2441_0~Reference

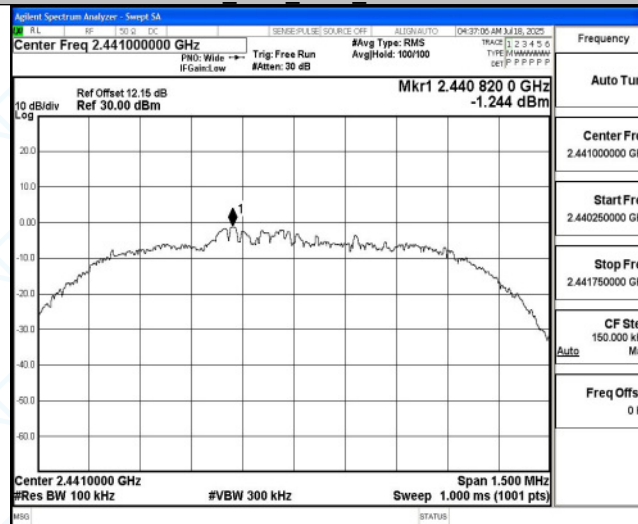

2DH5_Ant1_2441_30~1000

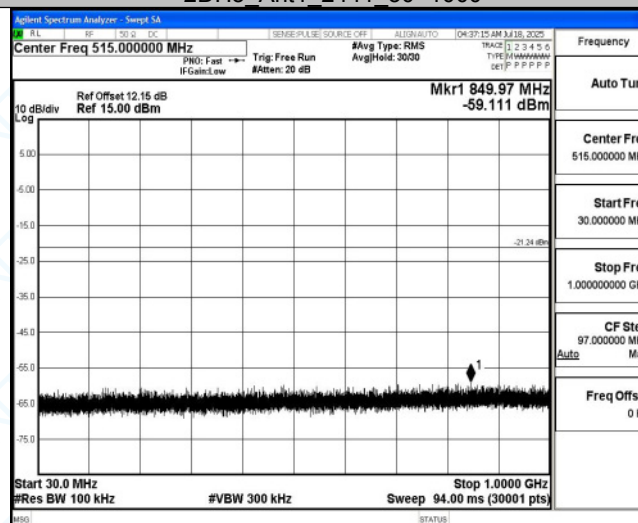


2DH5_Ant1_2441_1000~26500

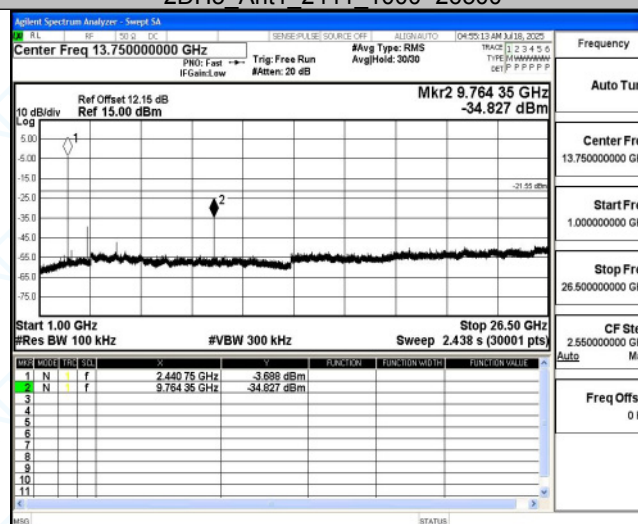





2DH5_Ant1_2480_0~Reference

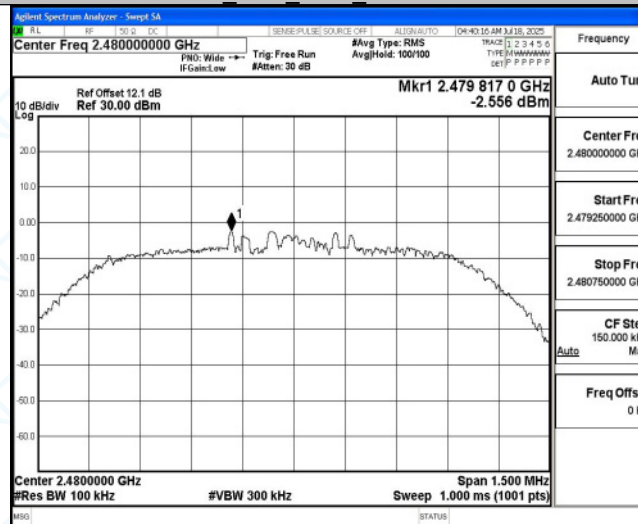

2DH5_Ant1_2480_30~1000

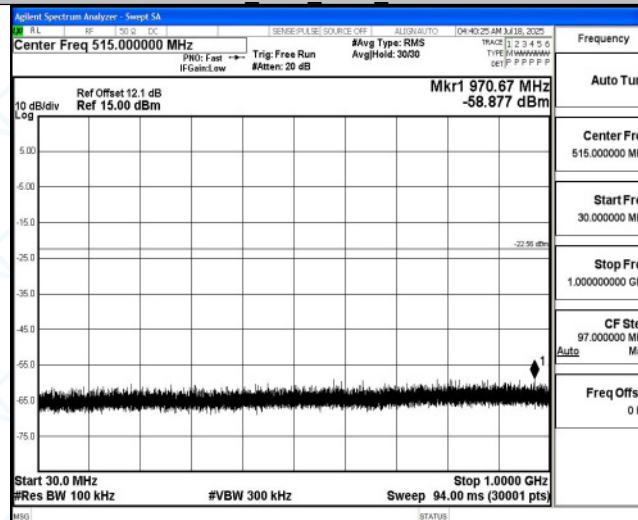

2DH5_Ant1_2480_1000~26500

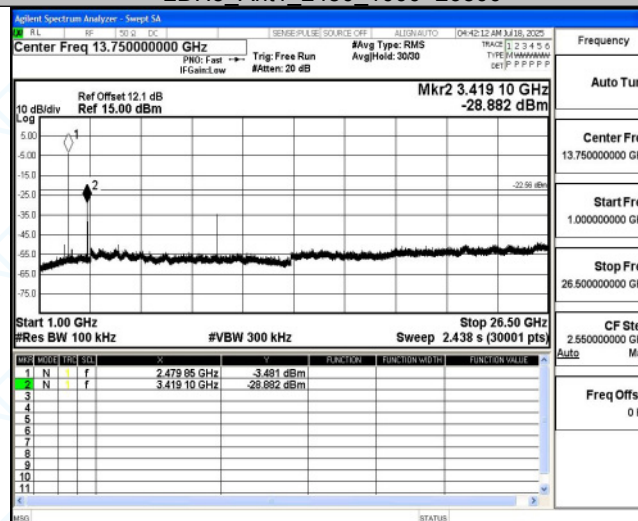

The End Report

Dongguan DN Testing Co., Ltd.

Add: No. 1, West Fourth Street, Xingfa South Road, Wusha Community, Chang 'an Town, Dongguan City, Guangdong P.R.China

Web: www.dn-testing.com

Tel: +86-769-88087383

E-mail: service@dn-testing.com