


Appendix F: Number of hopping frequencies

Test Result

TestMode	Antenna	Channel	Result[Num]	Limit[Num]	Verdict
DH5	Ant1	Hop	79	≥ 15	PASS
2DH5	Ant1	Hop	79	≥ 15	PASS
3DH5	Ant1	Hop	79	≥ 15	PASS


Test Graphs

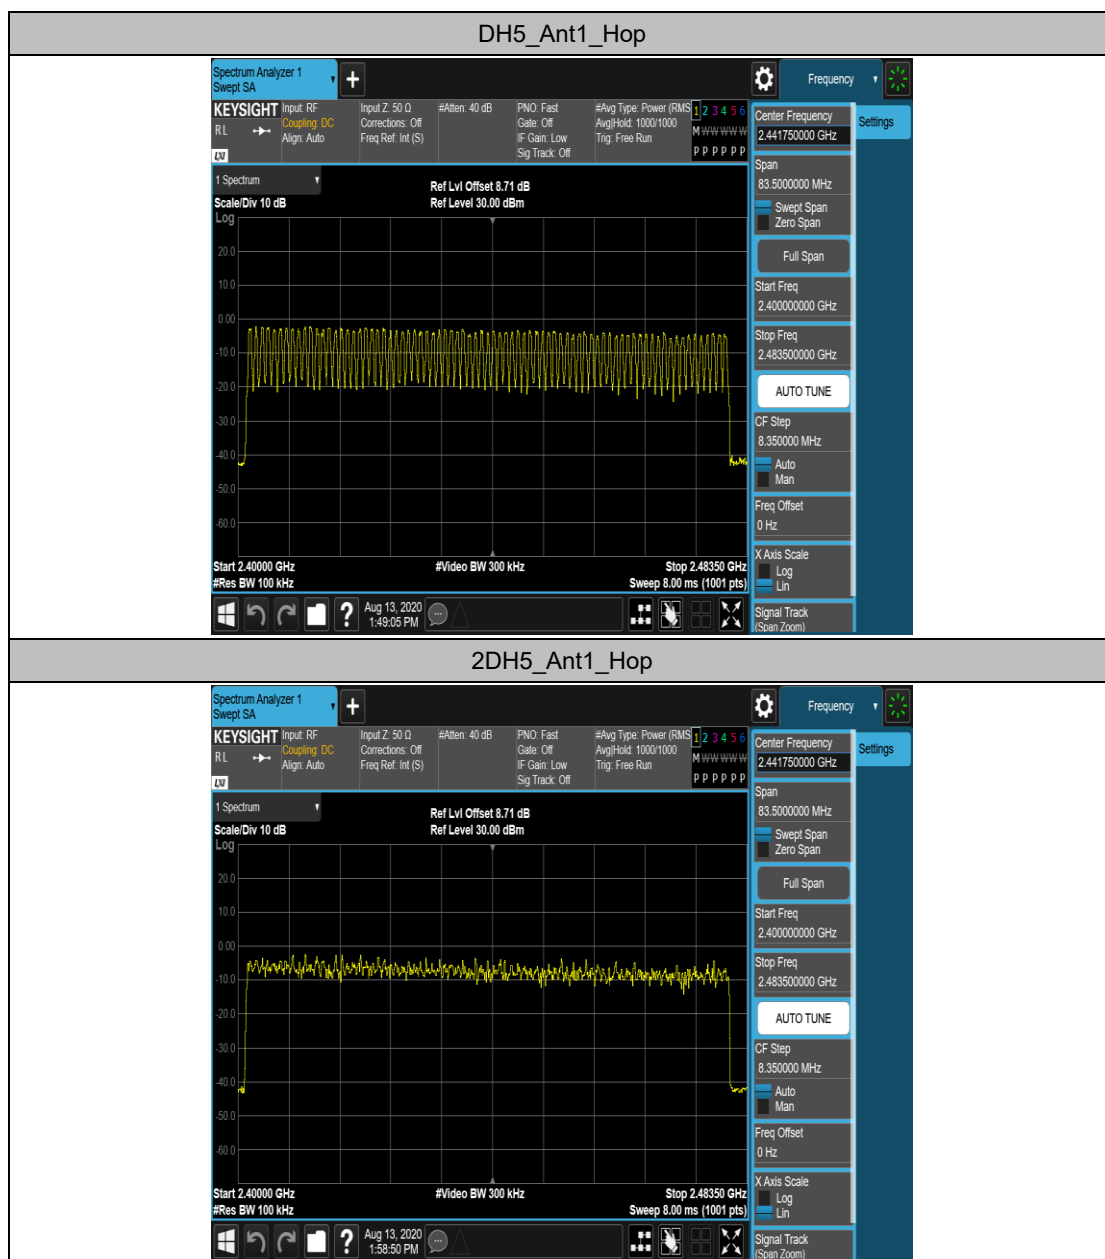

Test Report No.: EFGX20080028-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

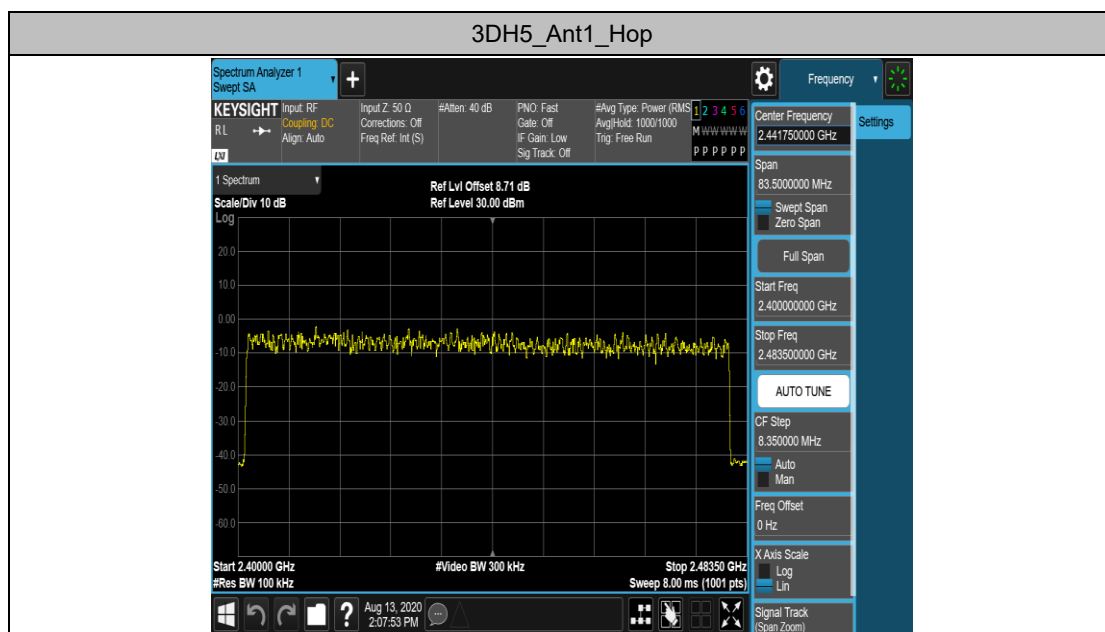


Appendix G: Out-of-band emission

Test Result

TestMode	Antenna	ChName	Channel	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	-1.58	-41.52	<=-21.58	PASS
		High	2480	-4.13	-45.02	<=-24.13	PASS
		Low	Hop_2402	-2.09	-50.31	-22.09	PASS
		High	Hop_2480	-4.10	-49.98	-24.1	PASS
2DH5	Ant1	Low	2402	-1.83	-49.88	<=-21.83	PASS
		High	2480	-4.42	-49.16	<=-24.42	PASS
		Low	Hop_2402	-2.25	-43.51	-22.25	PASS
		High	Hop_2480	-5.74	-49.90	-25.74	PASS
3DH5	Ant1	Low	2402	-1.61	-45.98	<=-21.61	PASS
		High	2480	-4.08	-49.83	<=-24.08	PASS
		Low	Hop_2402	-4.74	-50.56	-24.74	PASS
		High	Hop_2480	-4.11	-49.49	-24.11	PASS


Test Graphs

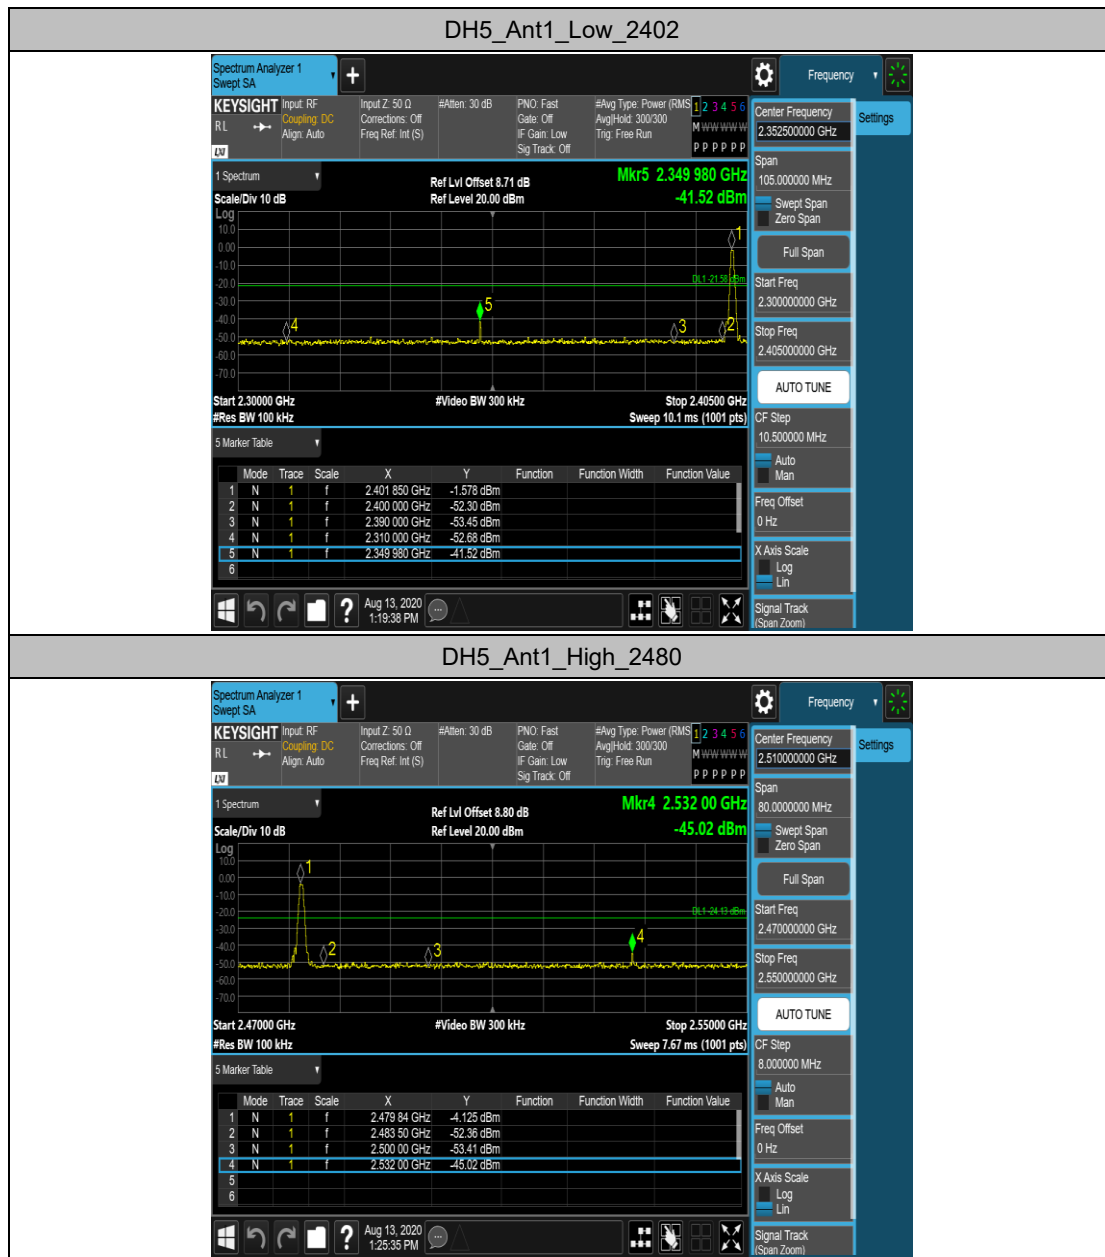



Test Report No.: EFGX20080028-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

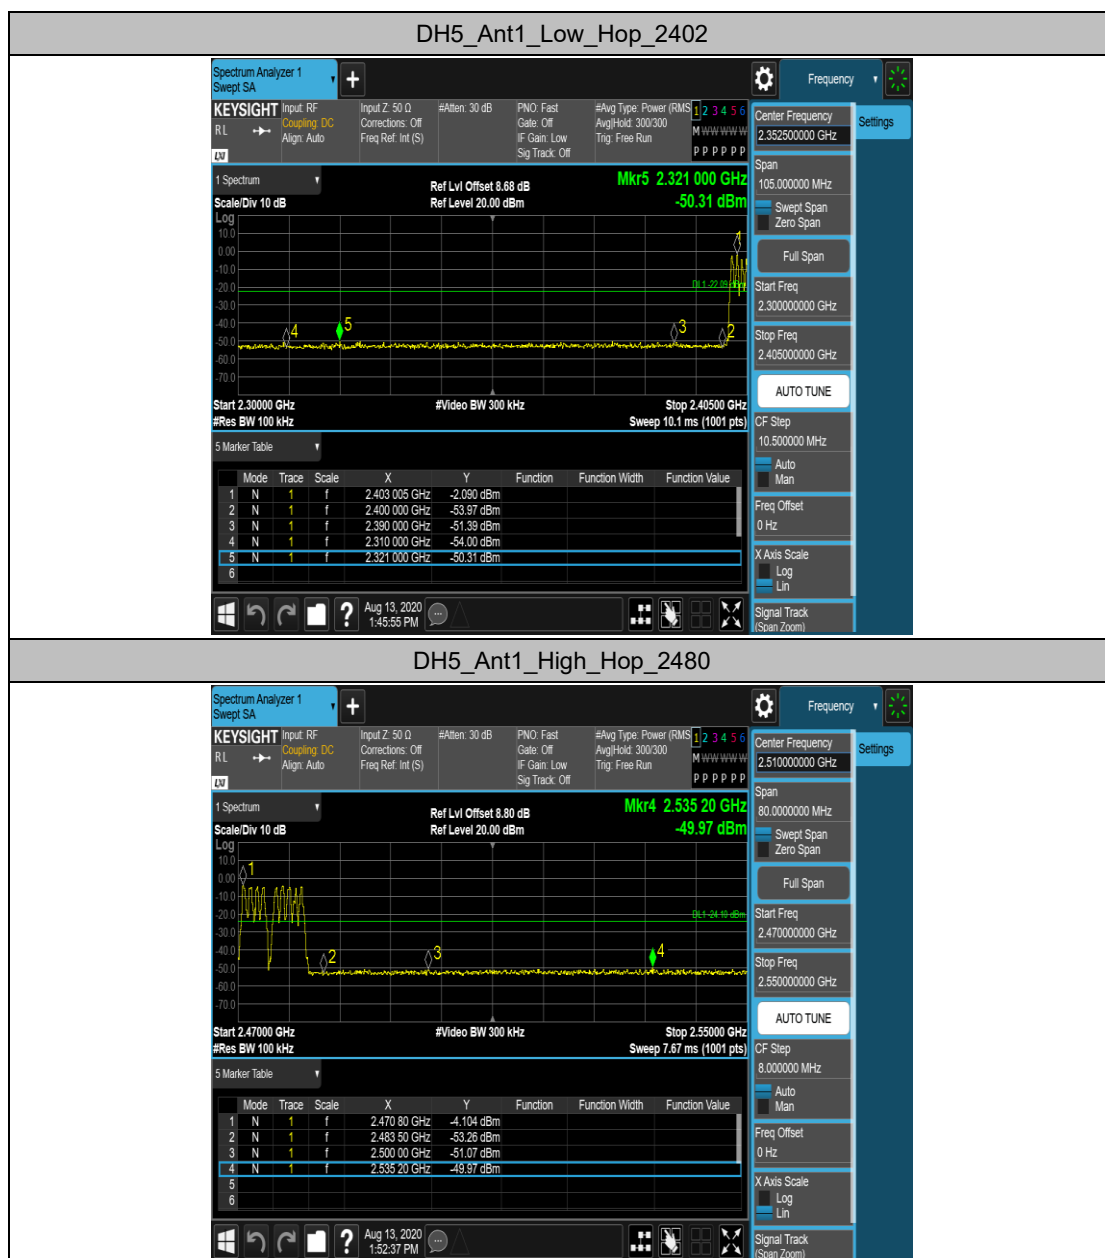

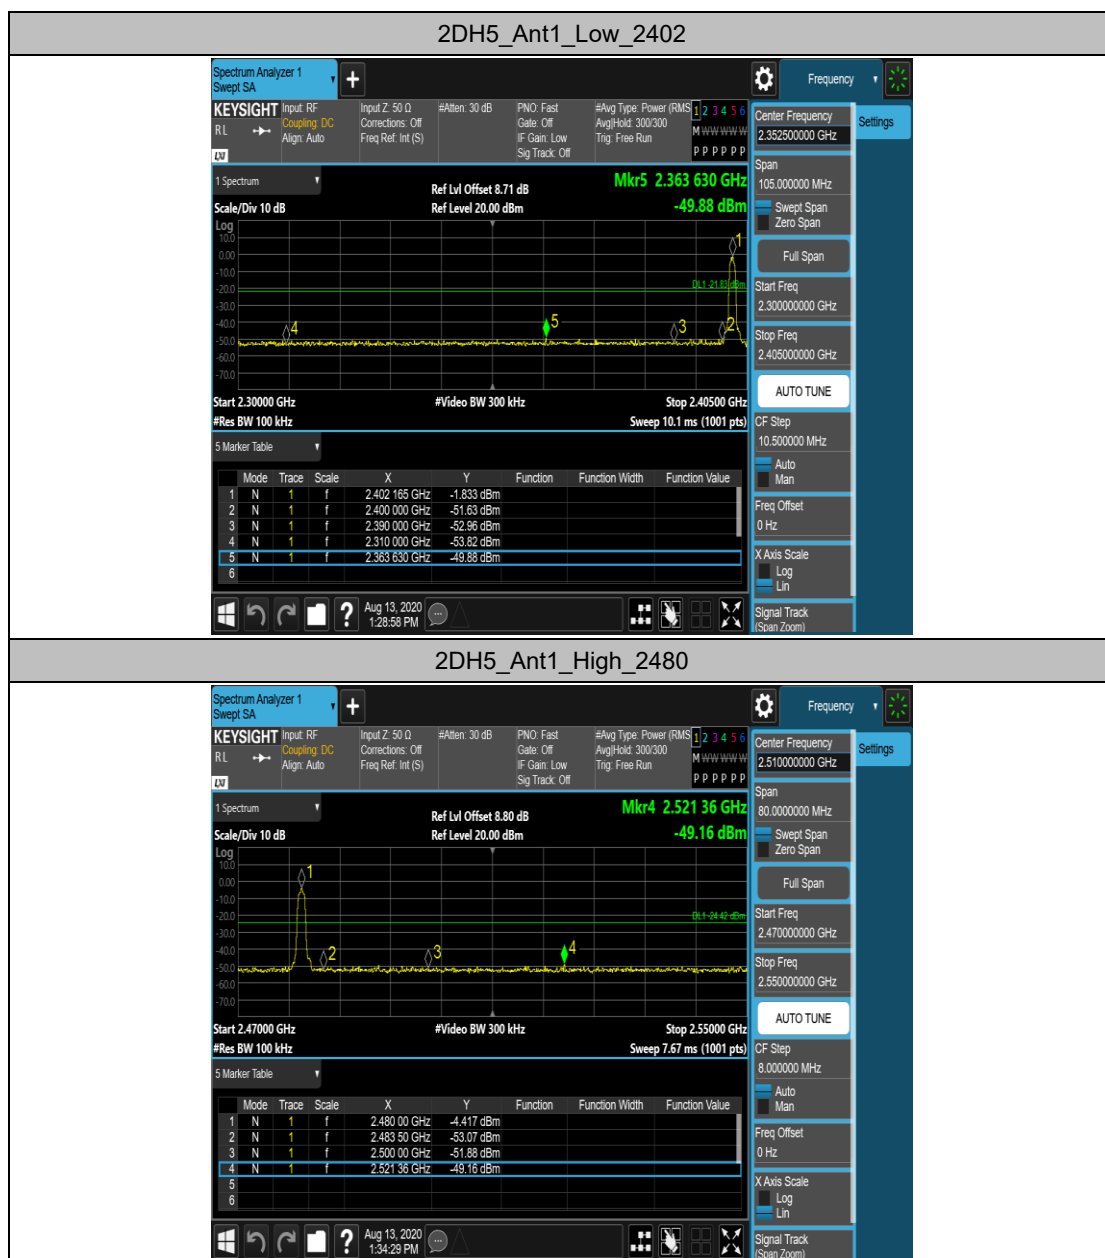

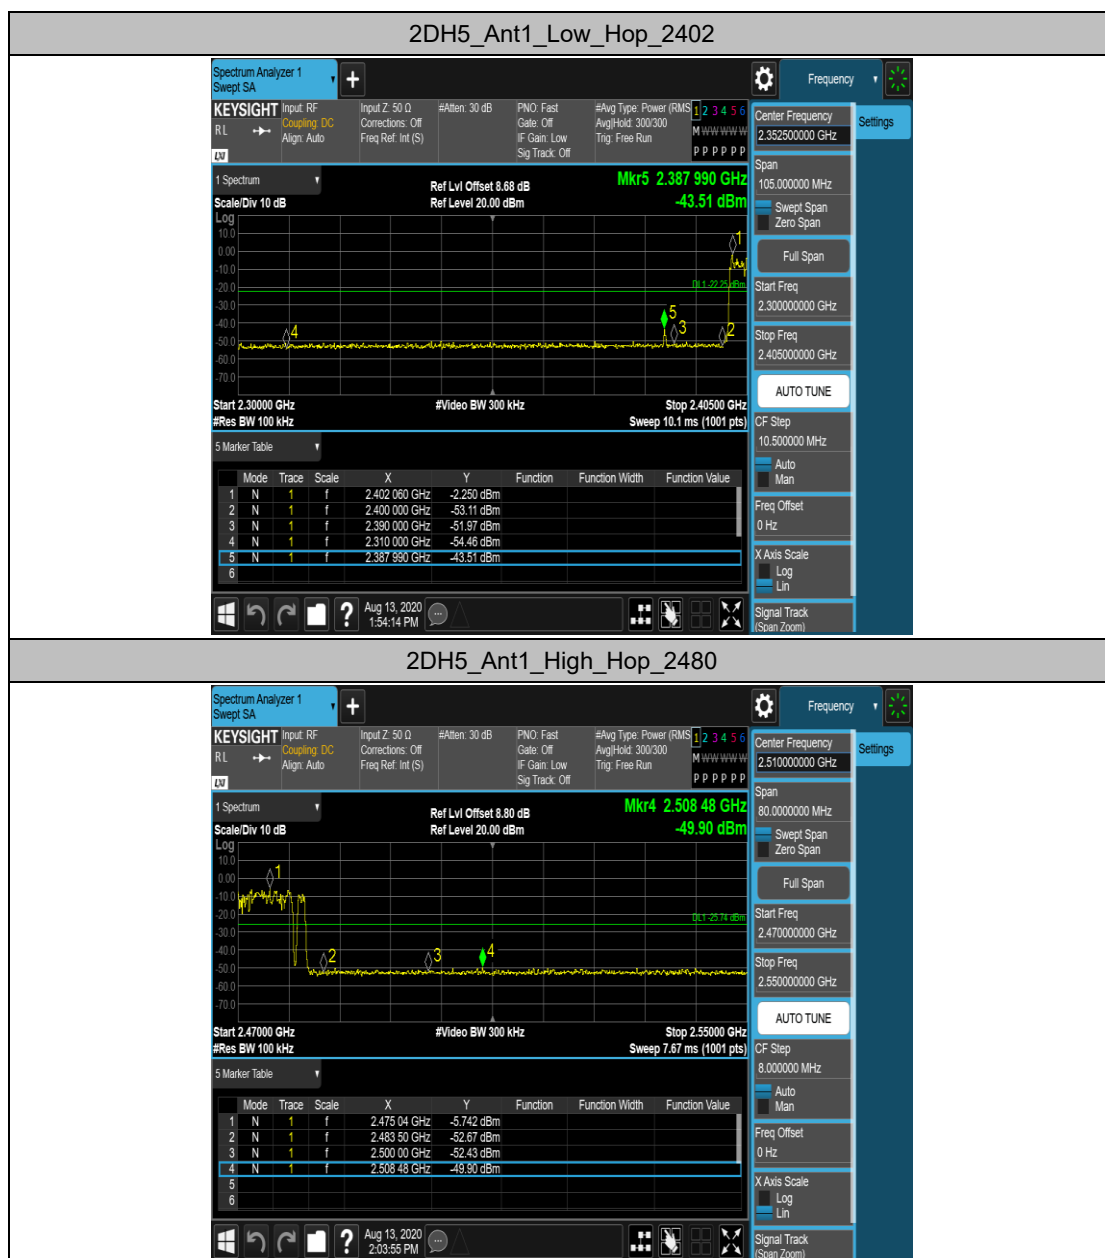

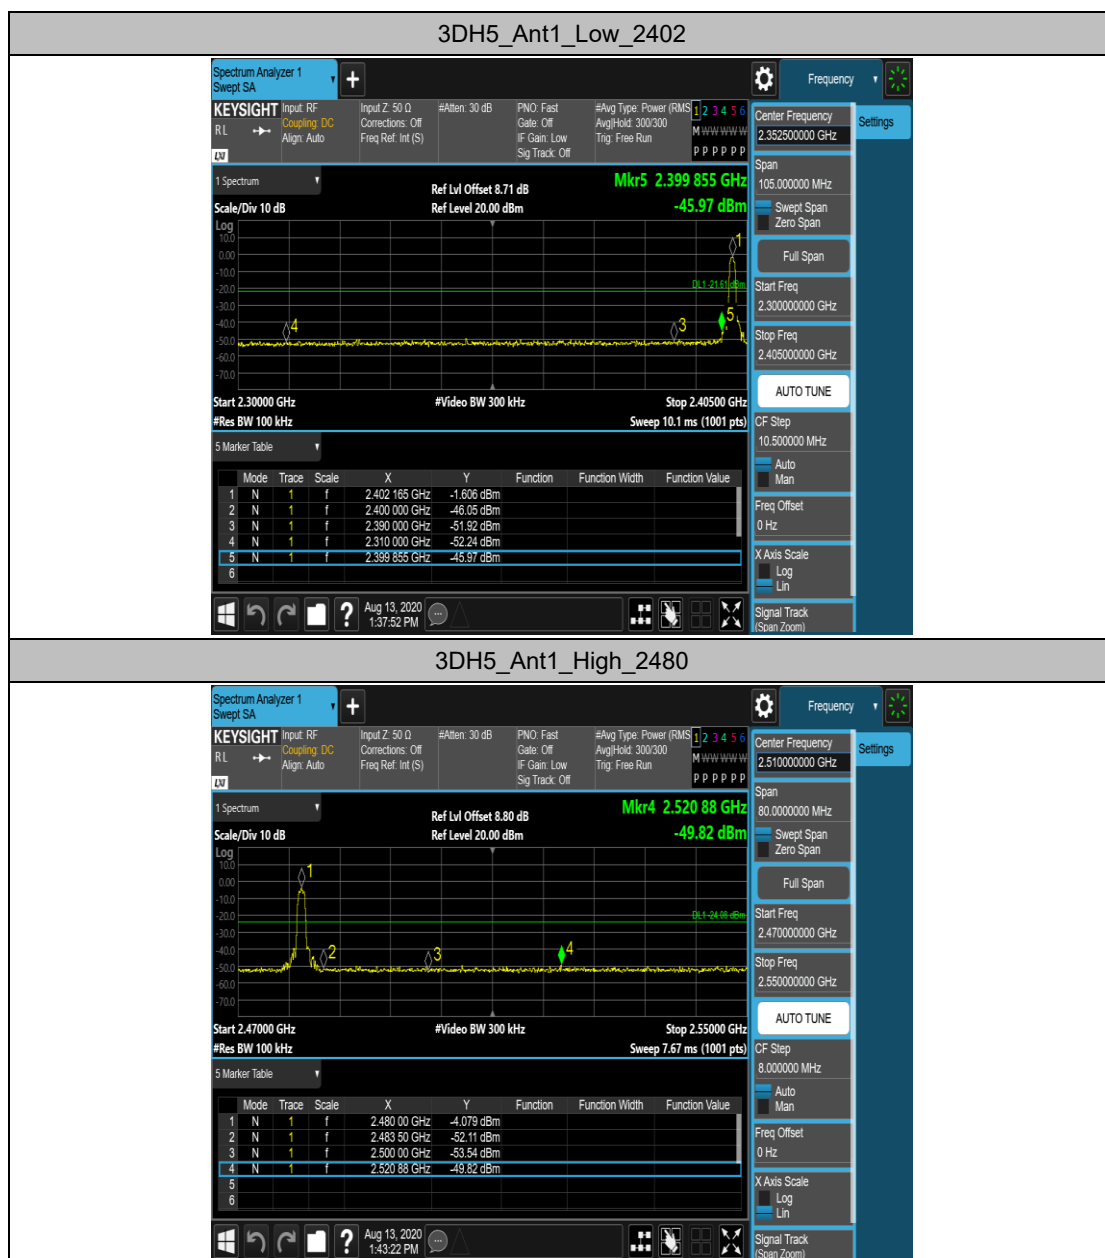

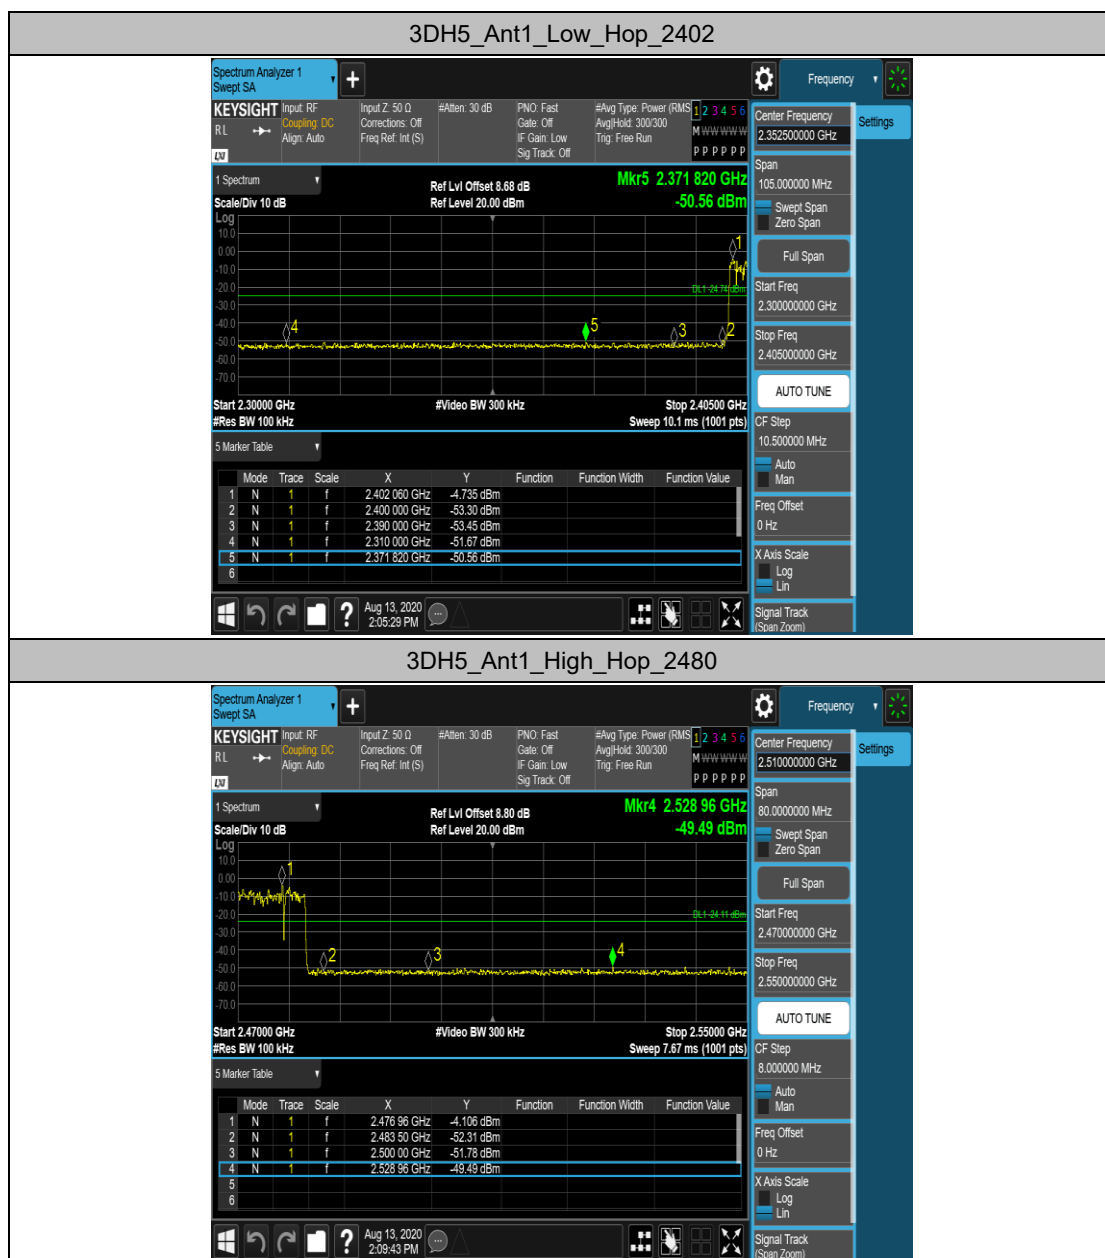


Appendix H: Spurious RF conducted emissions

Test Result

TestMode	Antenna	Channel	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	Reference	-1.62	-1.62	---	PASS
			30~1000	30~1000	-59.532	<=-21.624	PASS
			1000~26500	1000~26500	-45.391	<=-21.624	PASS
		2441	Reference	-2.82	-2.82	---	PASS
			30~1000	30~1000	-58.099	<=-22.818	PASS
			1000~26500	1000~26500	-48.322	<=-22.818	PASS
		2480	Reference	-4.55	-4.55	---	PASS
			30~1000	30~1000	-58.926	<=-24.554	PASS
			1000~26500	1000~26500	-50.502	<=-24.554	PASS
2DH5	Ant1	2402	Reference	-2.30	-2.30	---	PASS
			30~1000	30~1000	-56.848	<=-22.299	PASS
			1000~26500	1000~26500	-48.107	<=-22.299	PASS
		2441	Reference	-3.60	-3.60	---	PASS
			30~1000	30~1000	-58.234	<=-23.595	PASS
			1000~26500	1000~26500	-43.053	<=-23.595	PASS
		2480	Reference	-6.01	-6.01	---	PASS
			30~1000	30~1000	-59.102	<=-26.006	PASS
			1000~26500	1000~26500	-52.324	<=-26.006	PASS
3DH5	Ant1	2402	Reference	-2.02	-2.02	---	PASS
			30~1000	30~1000	-58.915	<=-22.017	PASS
			1000~26500	1000~26500	-47	<=-22.017	PASS
		2441	Reference	-3.30	-3.30	---	PASS
			30~1000	30~1000	-58.307	<=-23.299	PASS
			1000~26500	1000~26500	-49.482	<=-23.299	PASS
		2480	Reference	-4.12	-4.12	---	PASS
			30~1000	30~1000	-54.706	<=-24.116	PASS
			1000~26500	1000~26500	-52.846	<=-24.116	PASS


Test Graphs

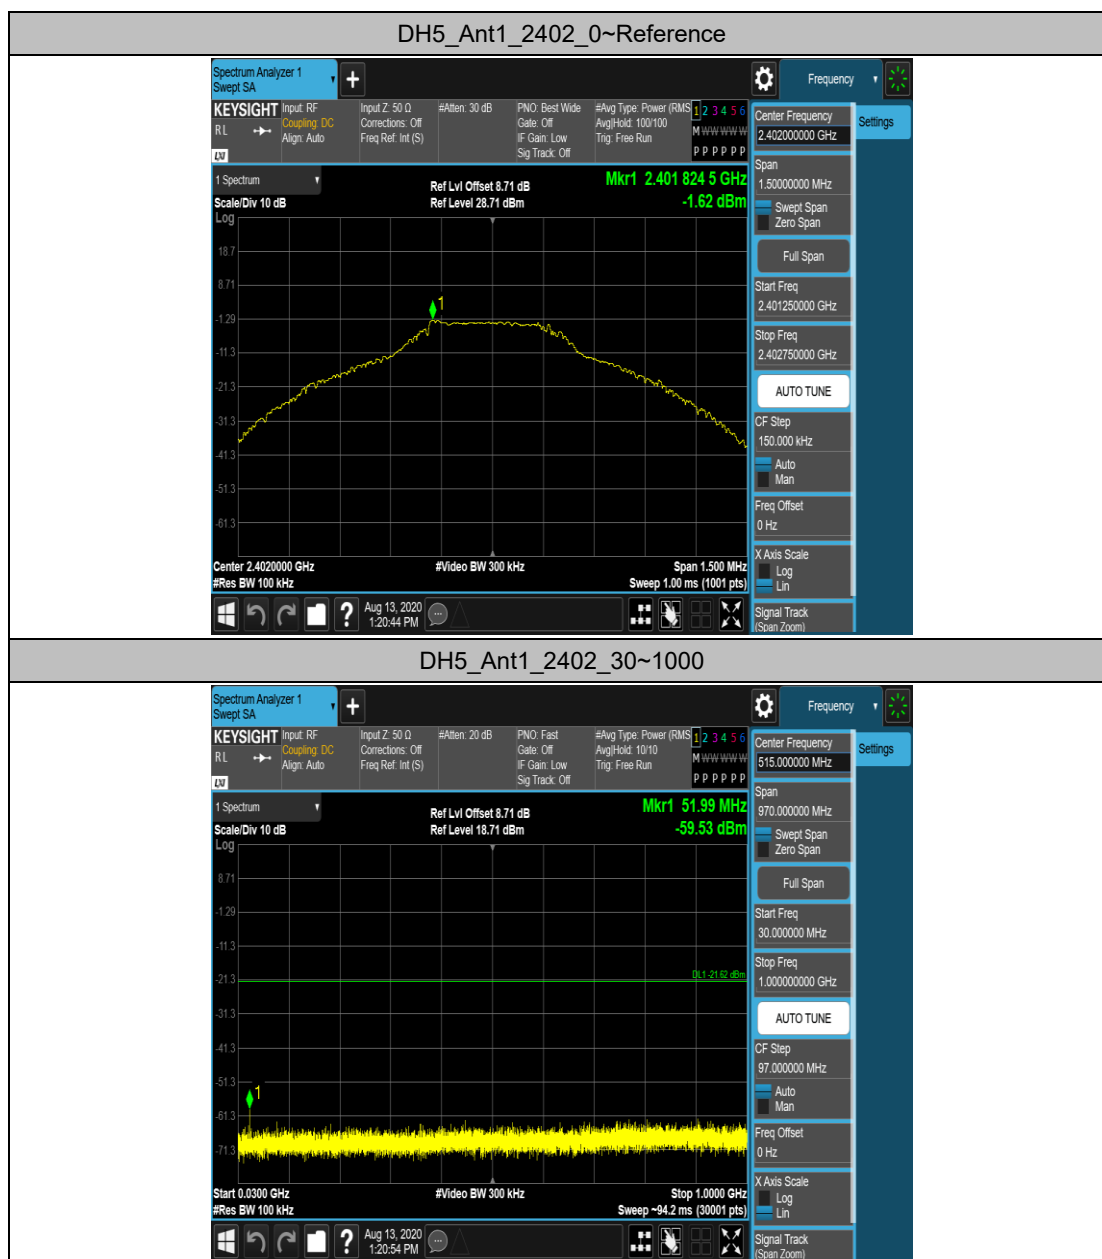

Test Report No.: EFGX20080028-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

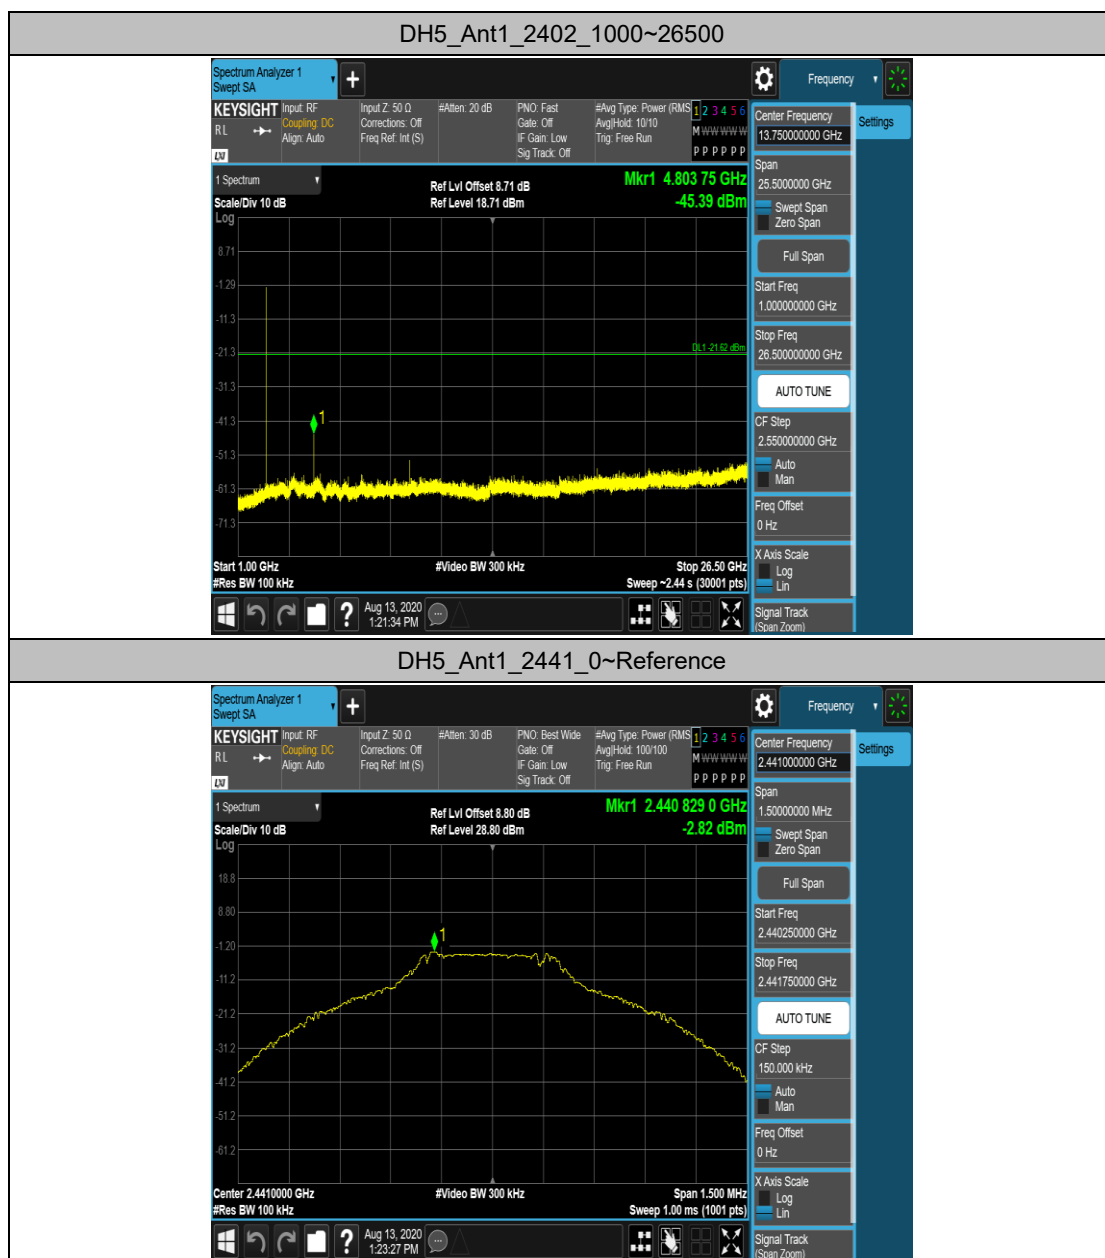

Test Report No.: EFGX20080028-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749




Test Report No.: EFGX20080028-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

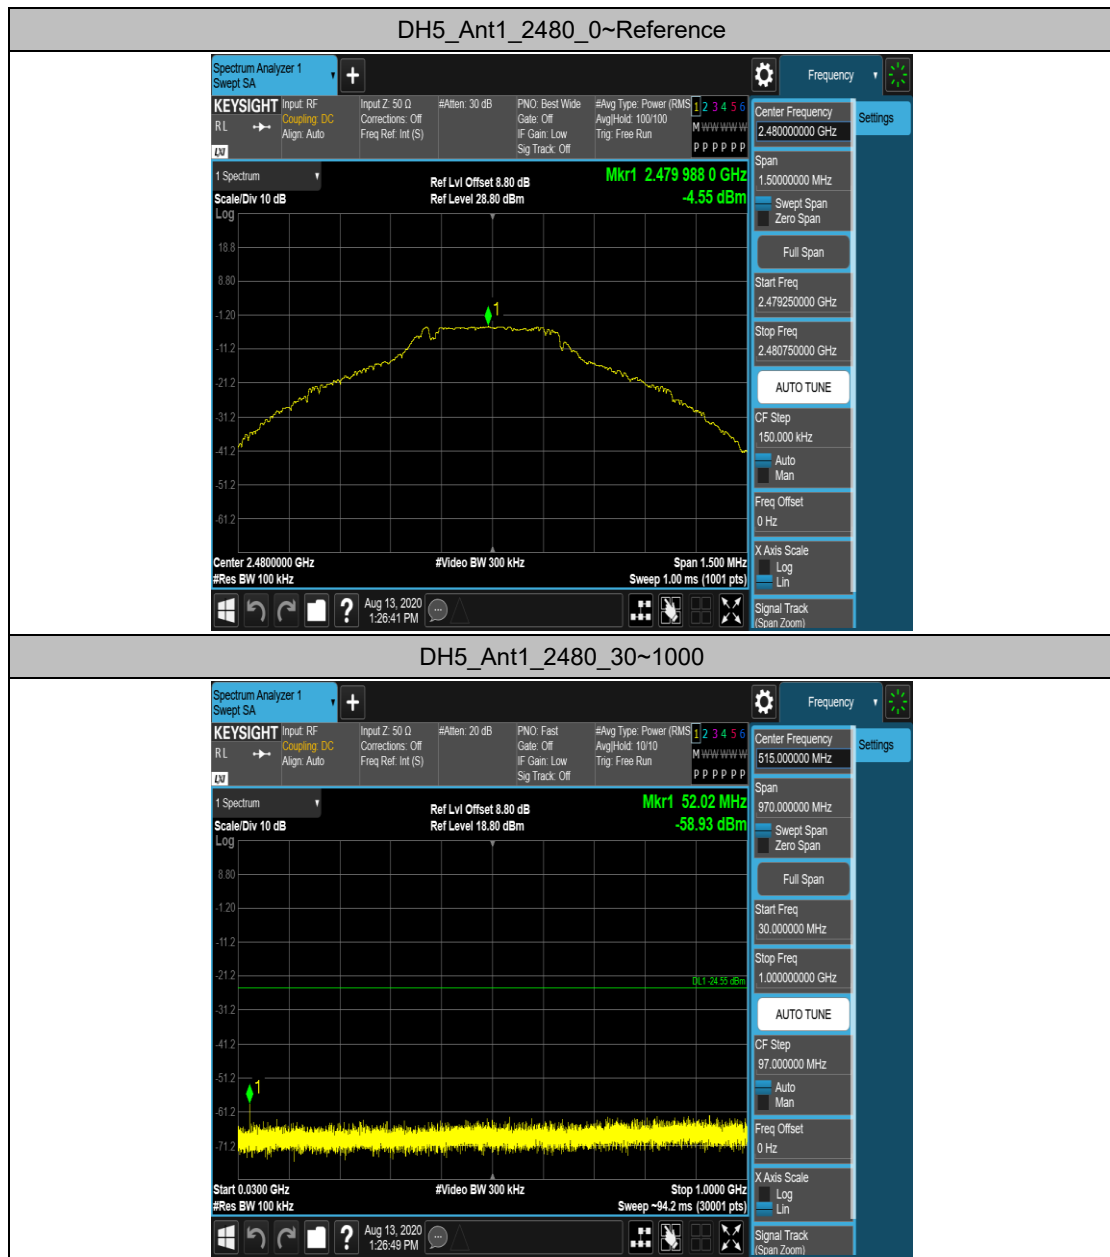


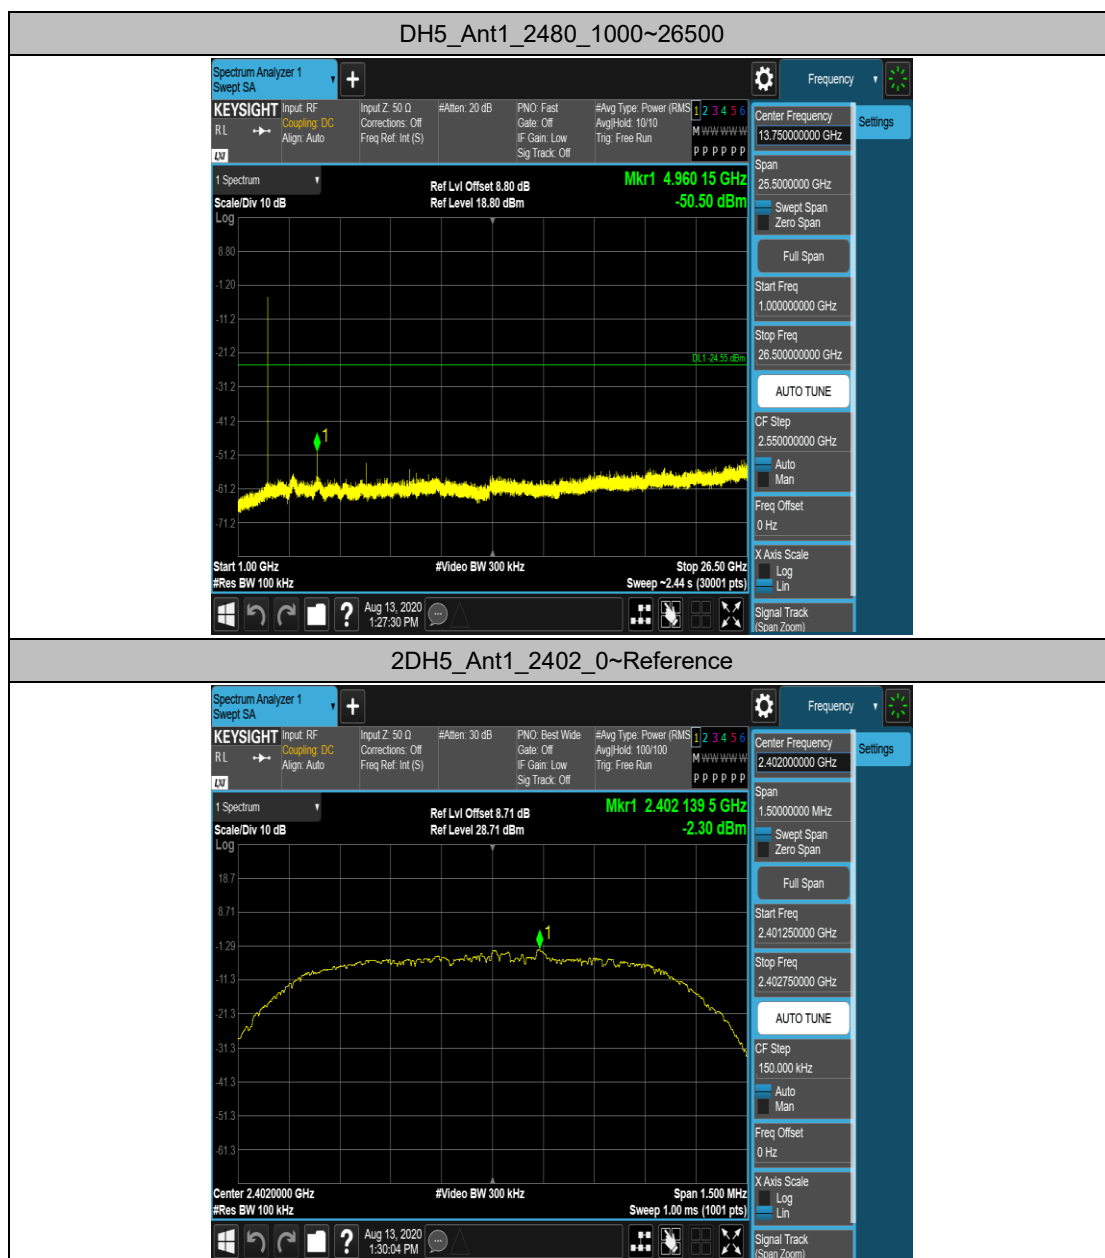

Test Report No.: EFGX20080028-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

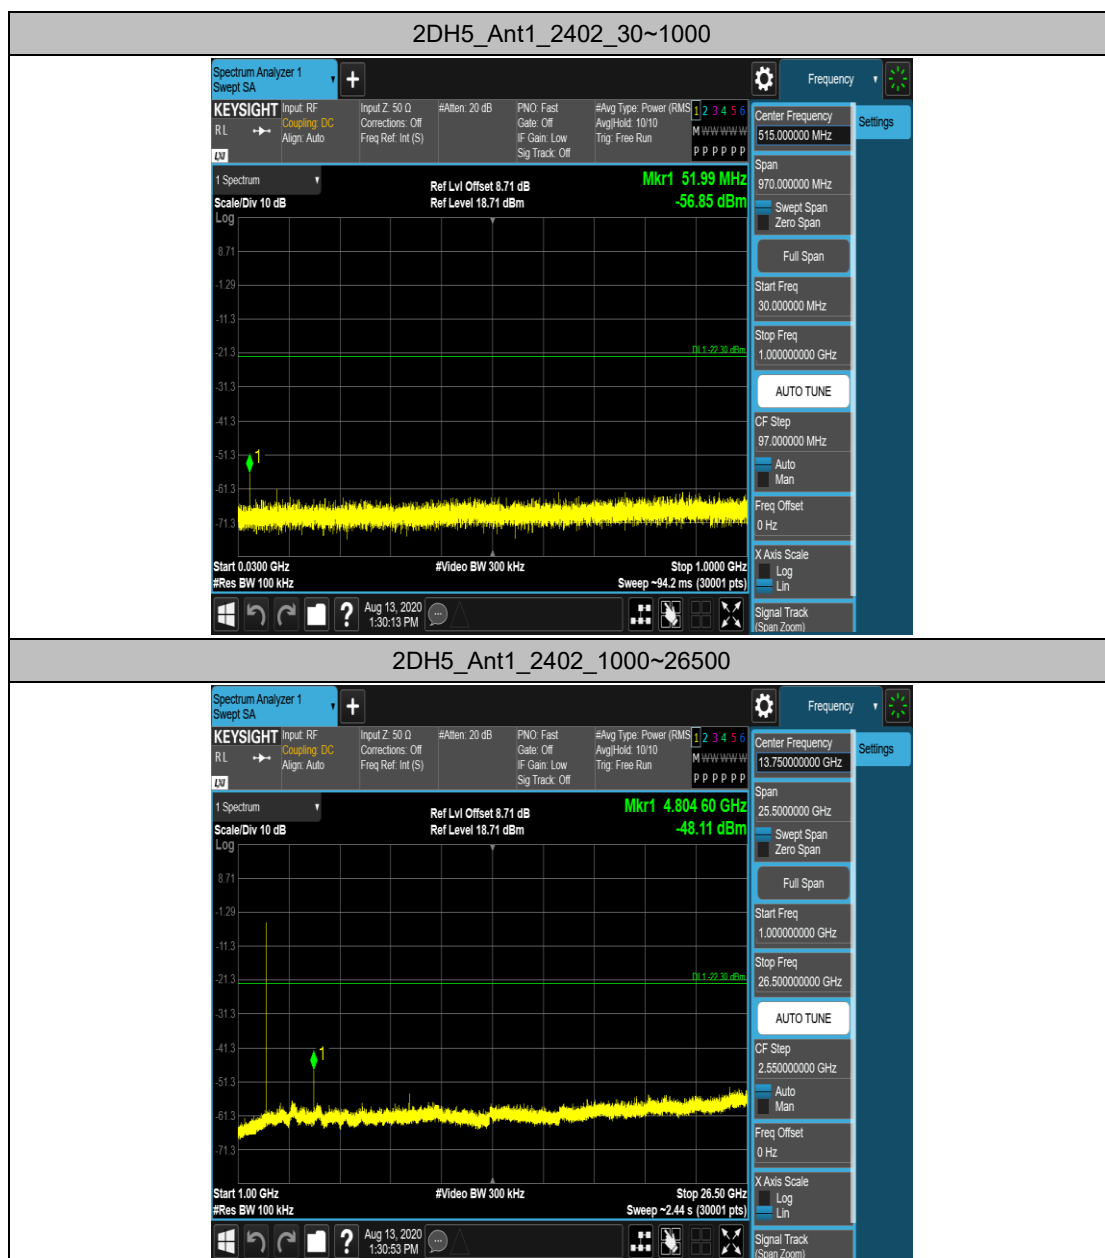



Test Report No.: EFGX20080028-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

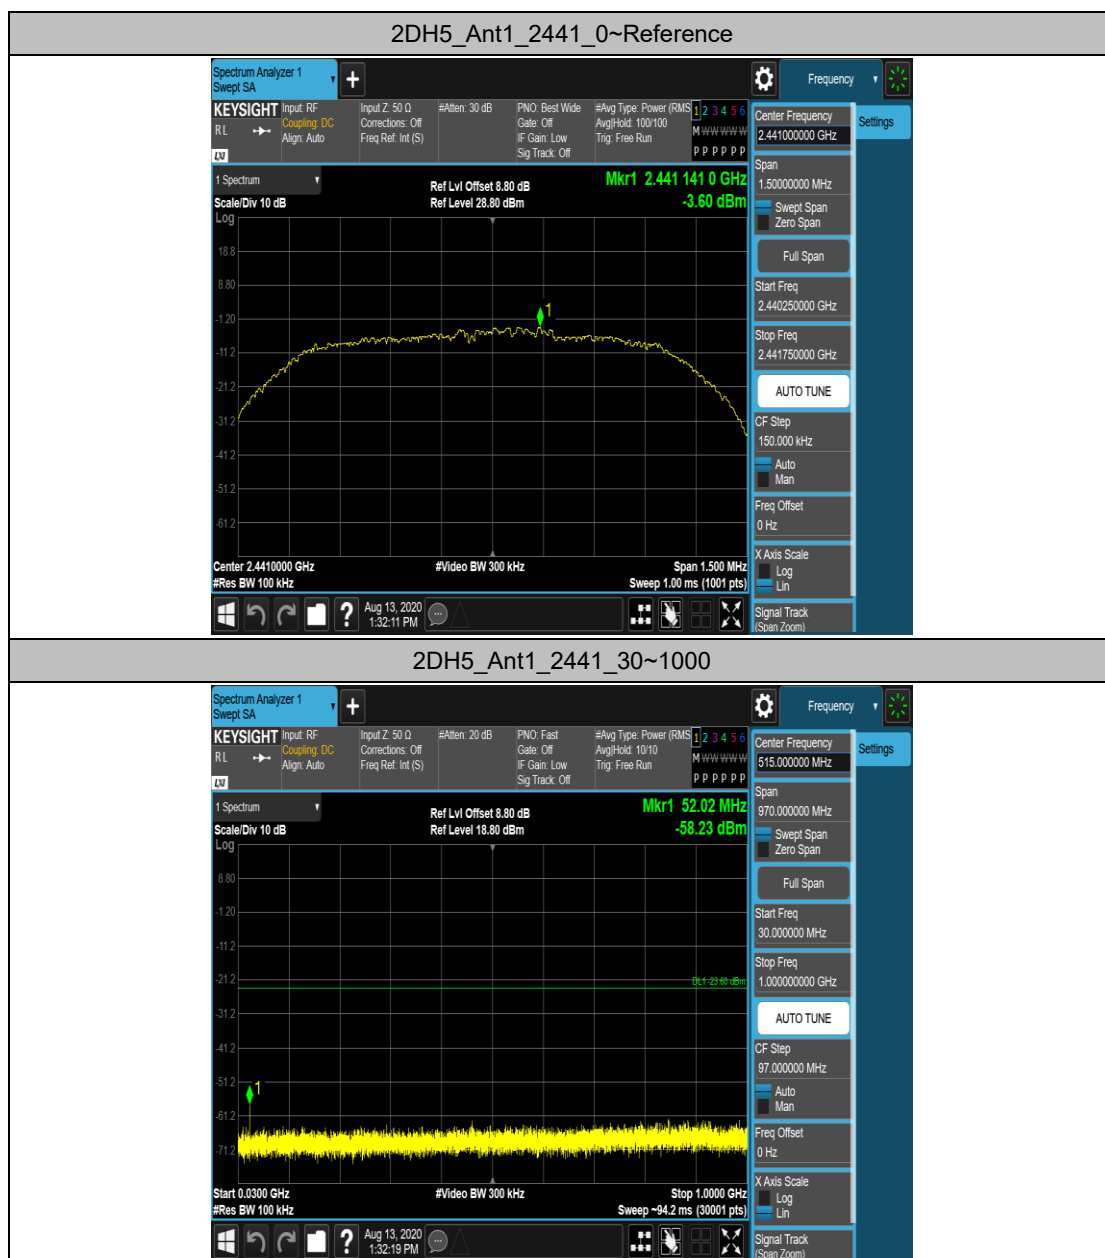


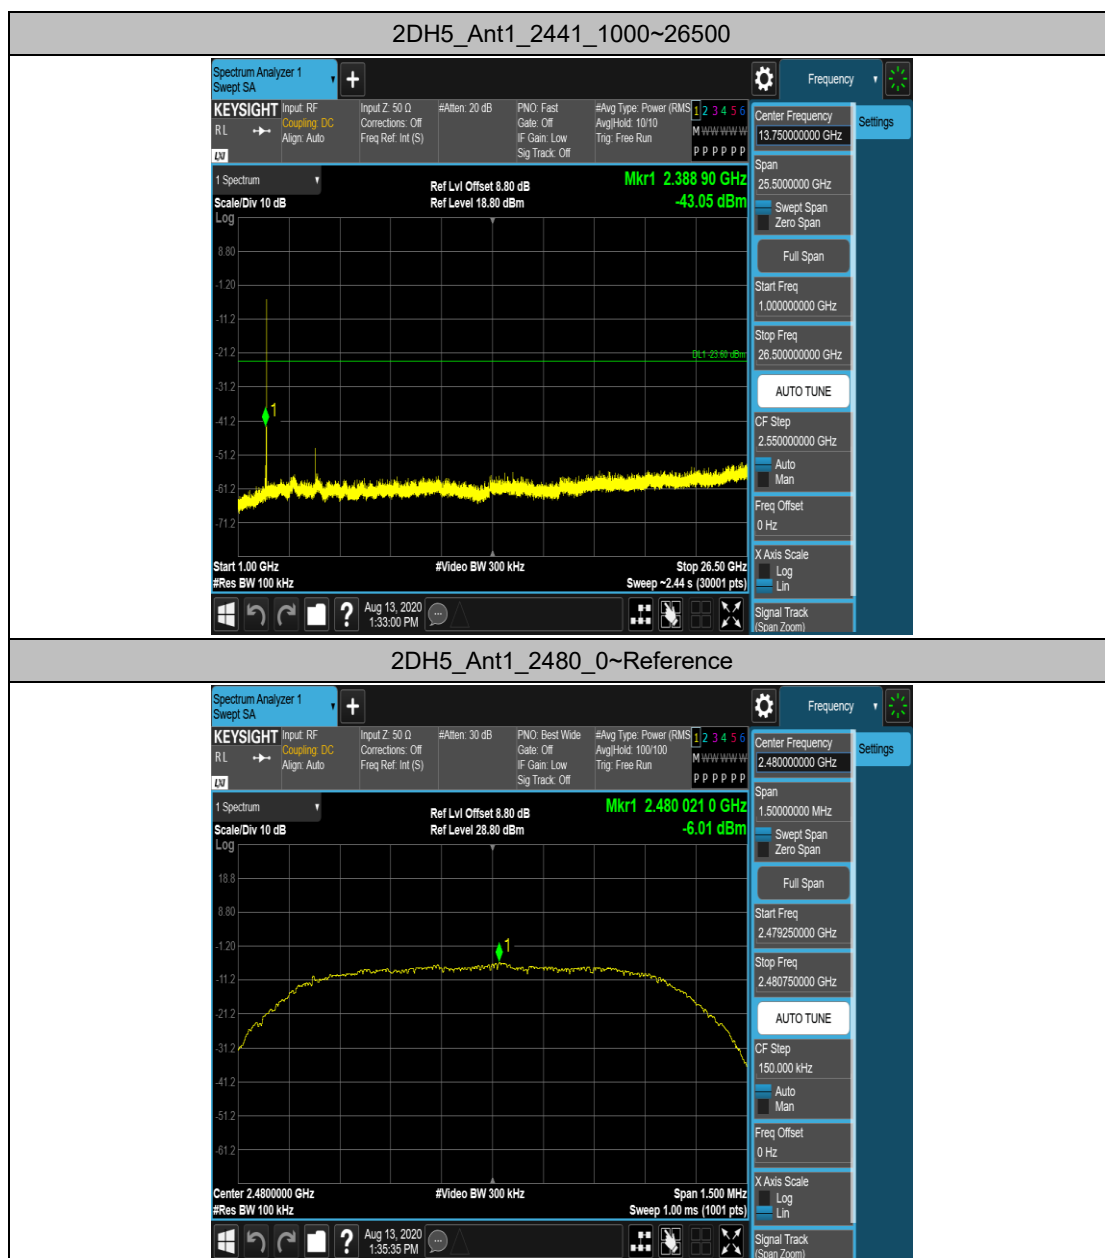


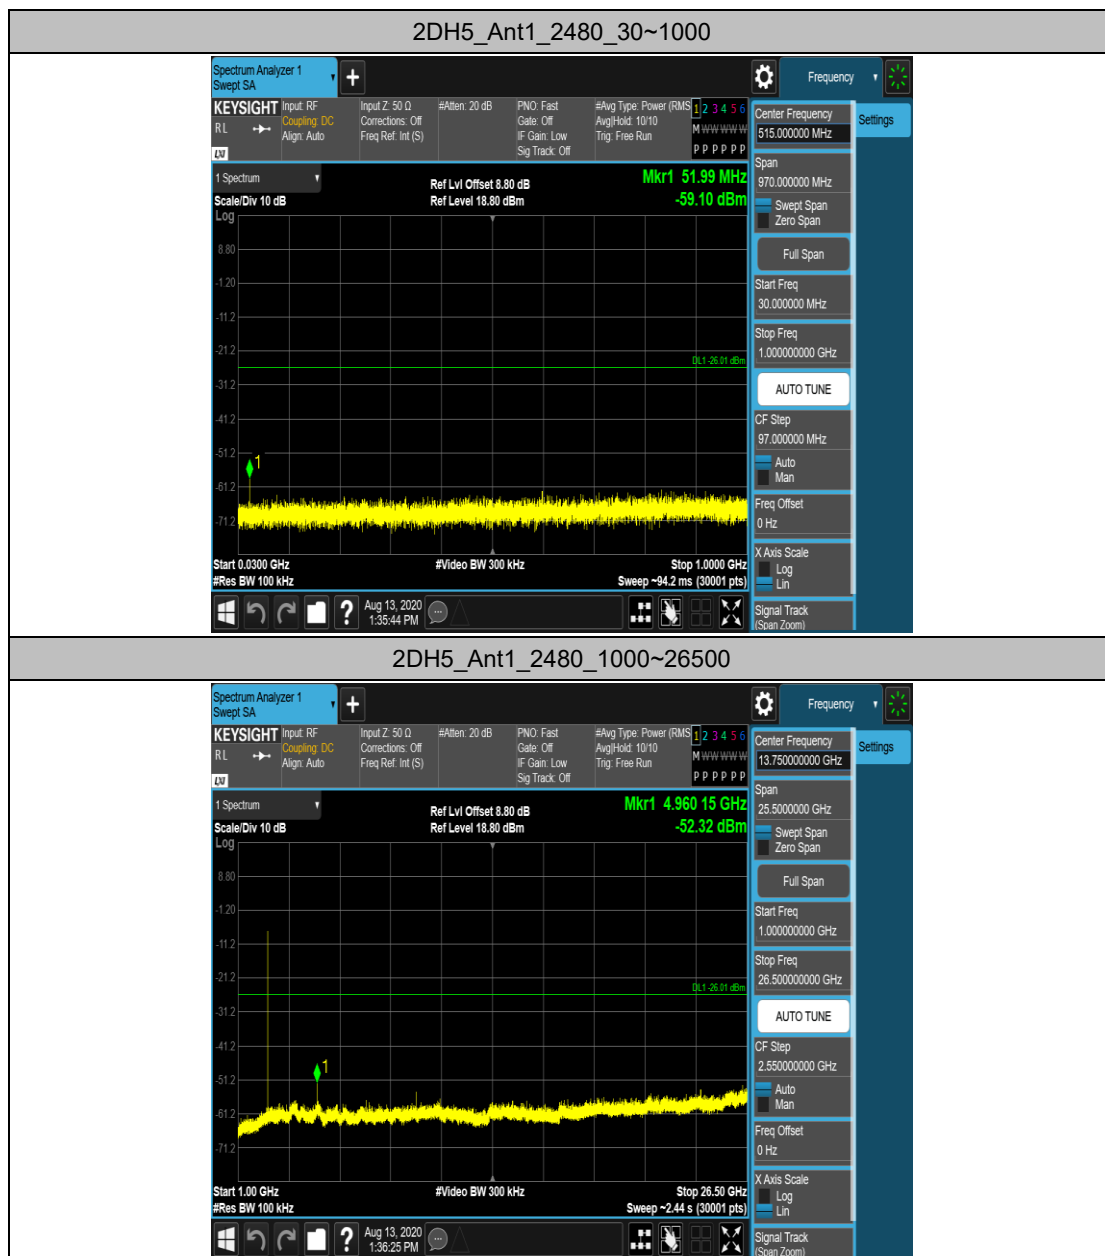


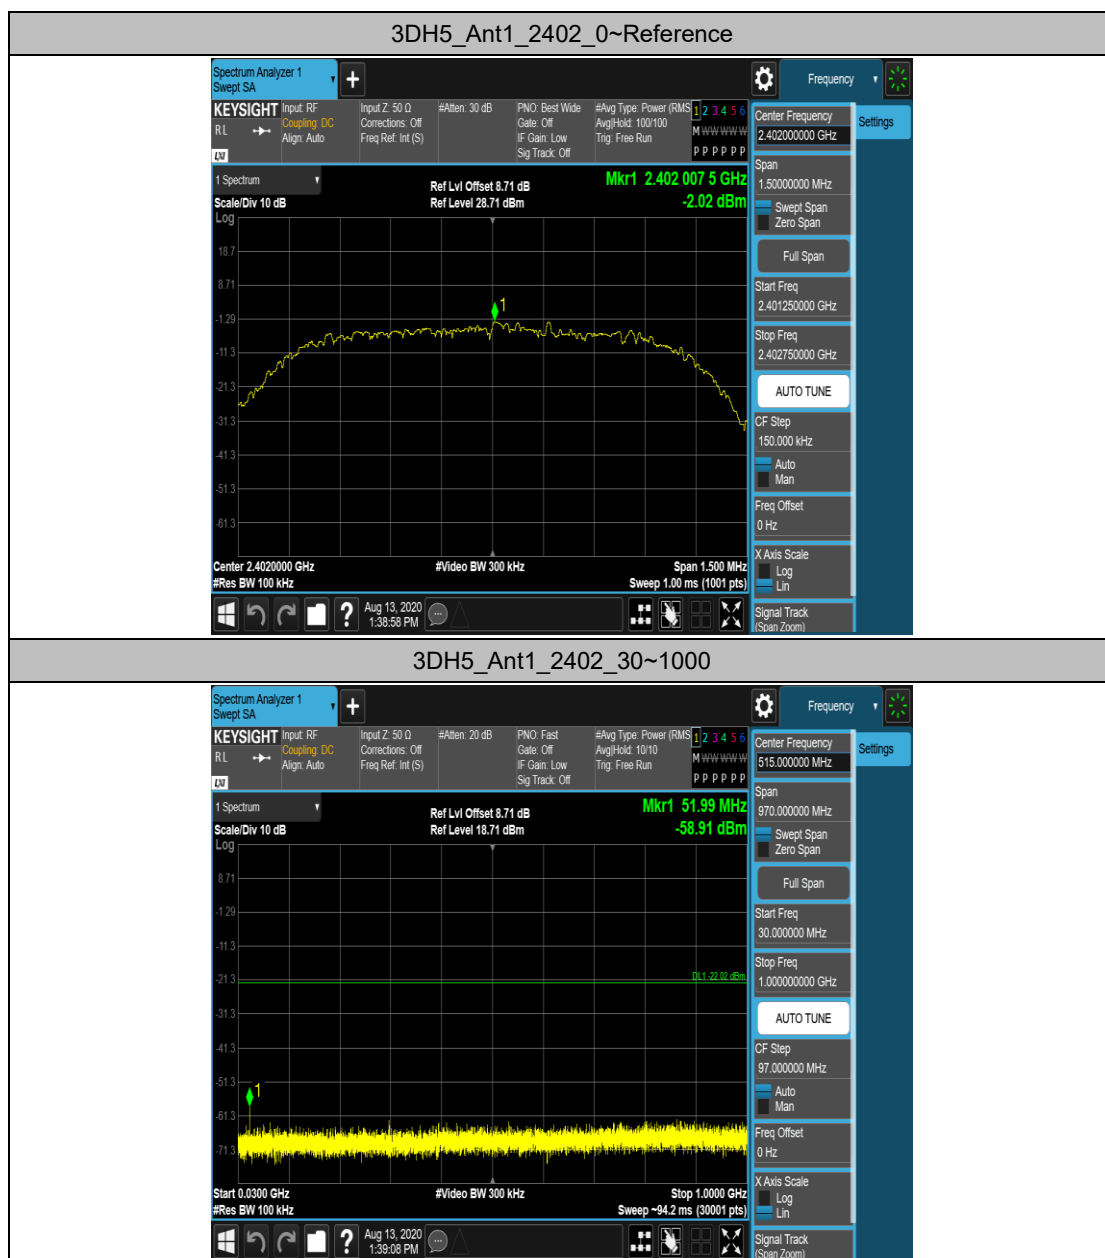

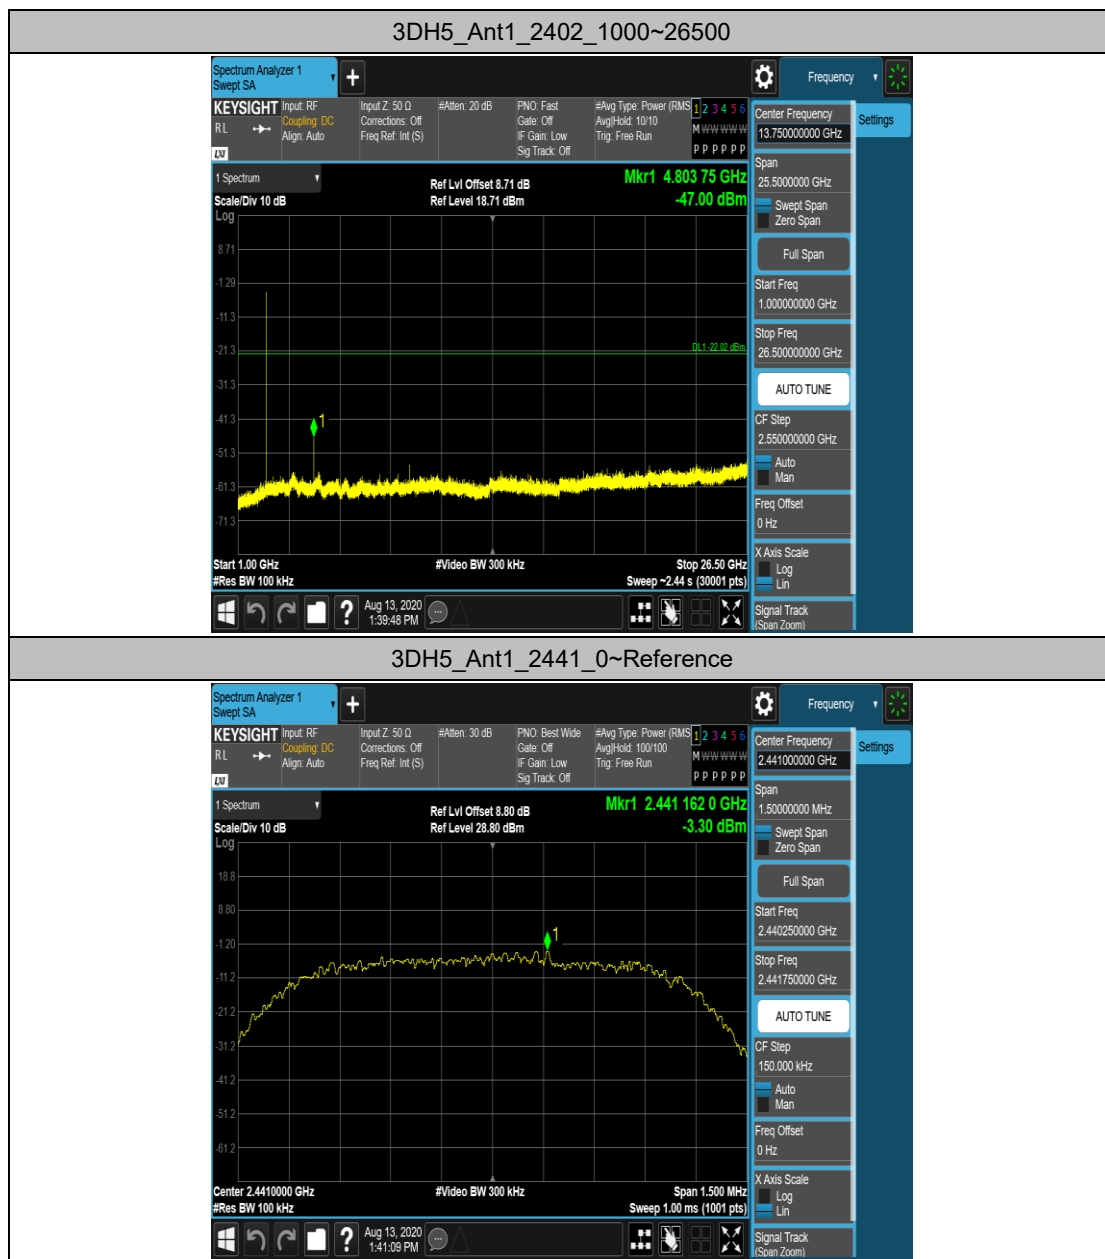

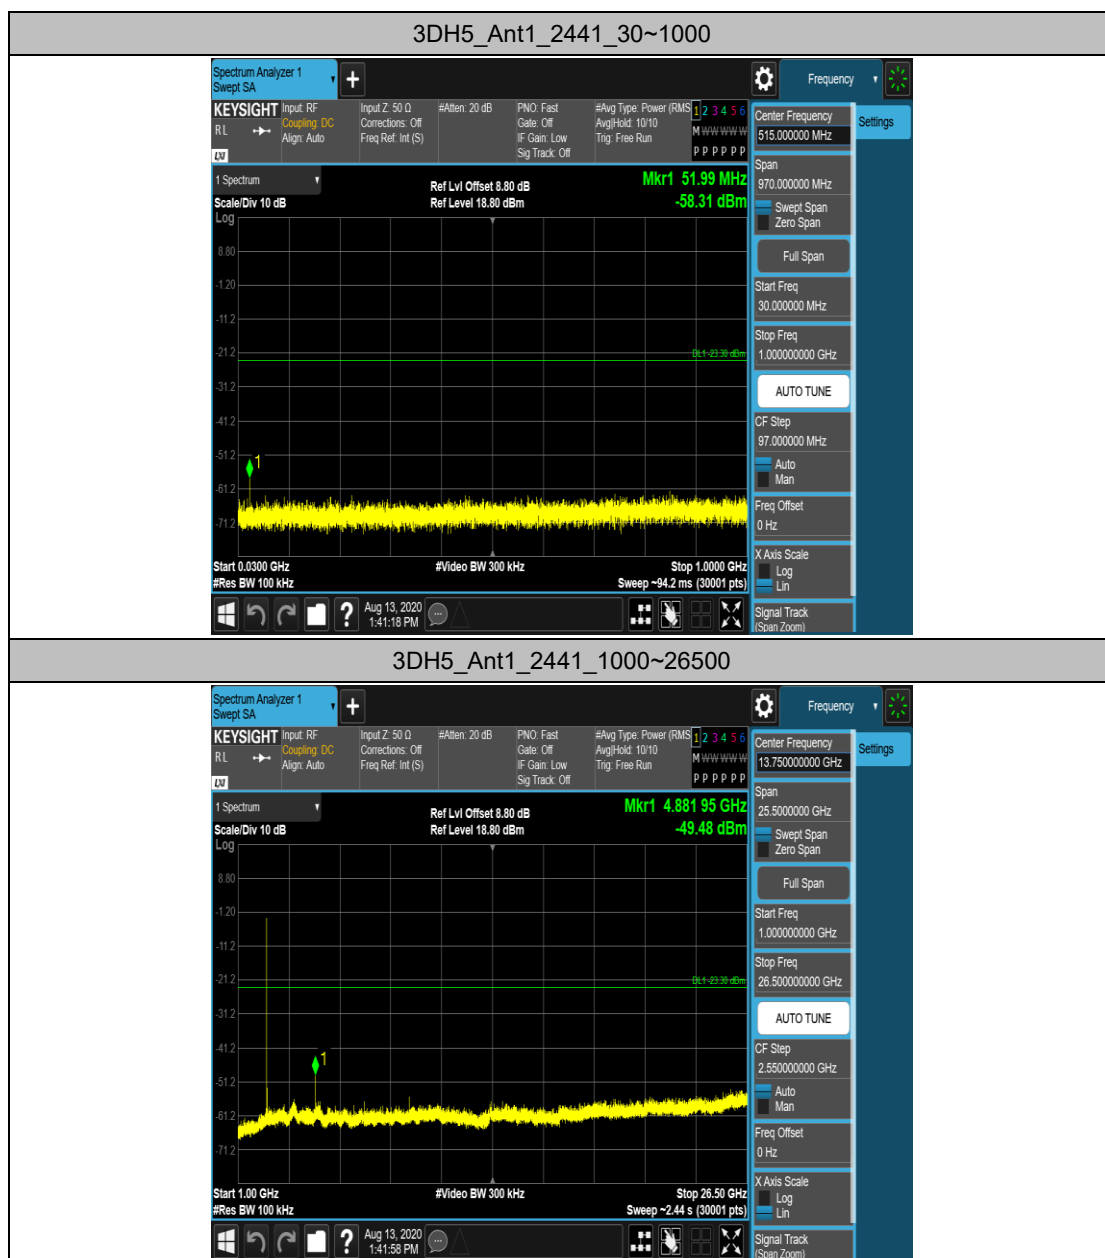

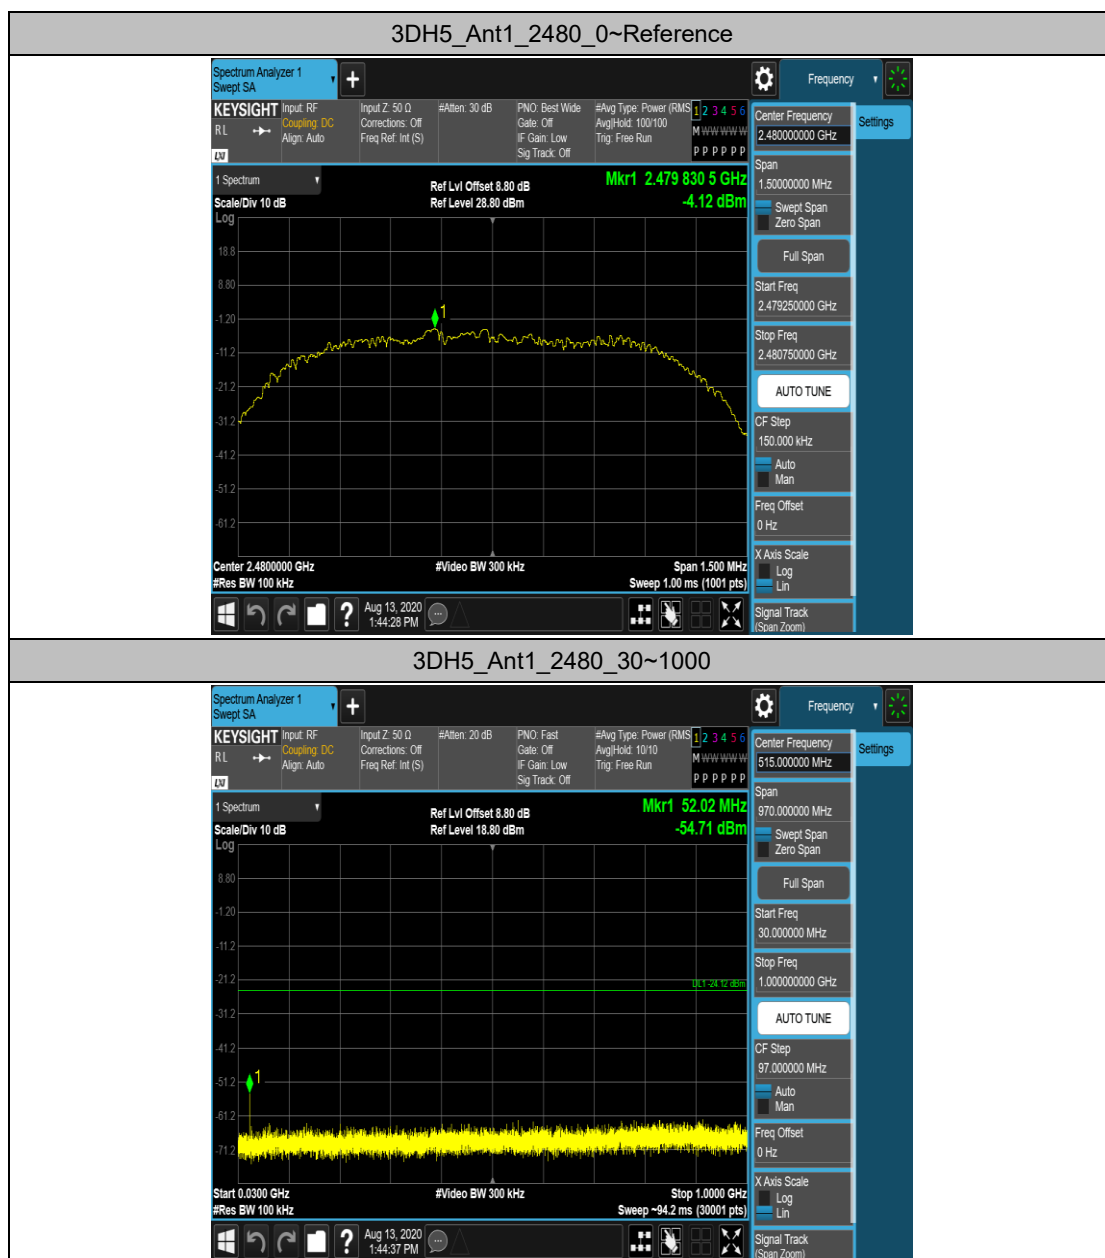

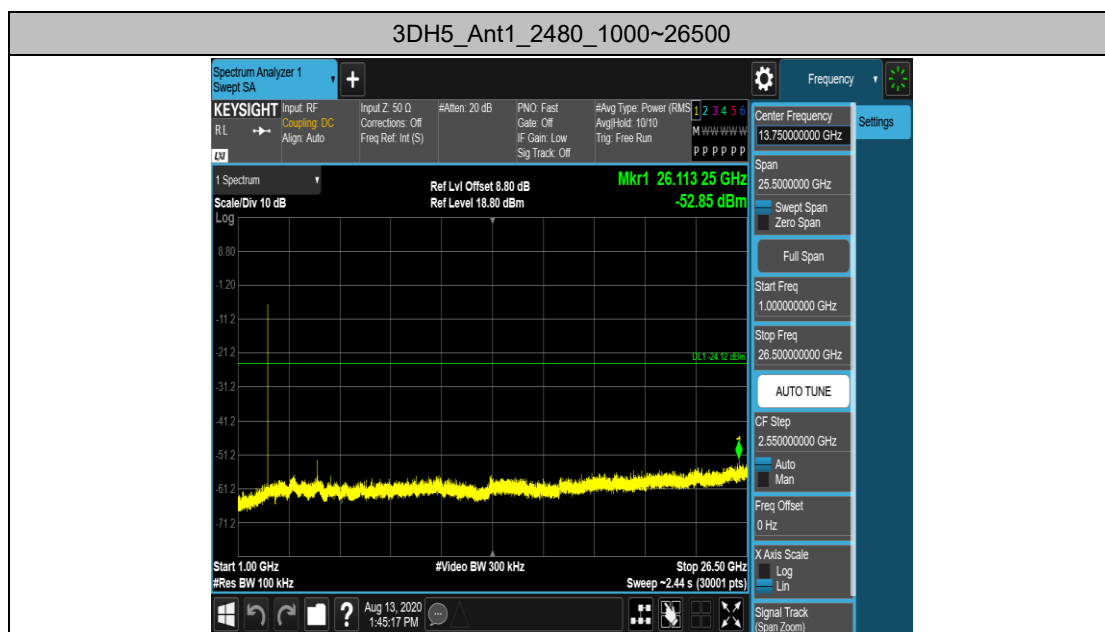

Appendix I: Duty Cycle

Test Result

TestMode	Antenna	Channel	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
DH5	Ant1	2402	2.90	3.75	77.33
		2441	2.90	3.75	77.30
		2480	2.90	3.75	77.33
2DH5	Ant1	2402	2.91	3.75	77.47
		2441	2.91	3.75	77.47
		2480	2.91	3.75	77.47
3DH5	Ant1	2402	2.91	3.75	77.54
		2441	2.91	3.75	77.54
		2480	2.91	3.75	77.57

Test Graphs



Test Report No.: EFGX20080028-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749







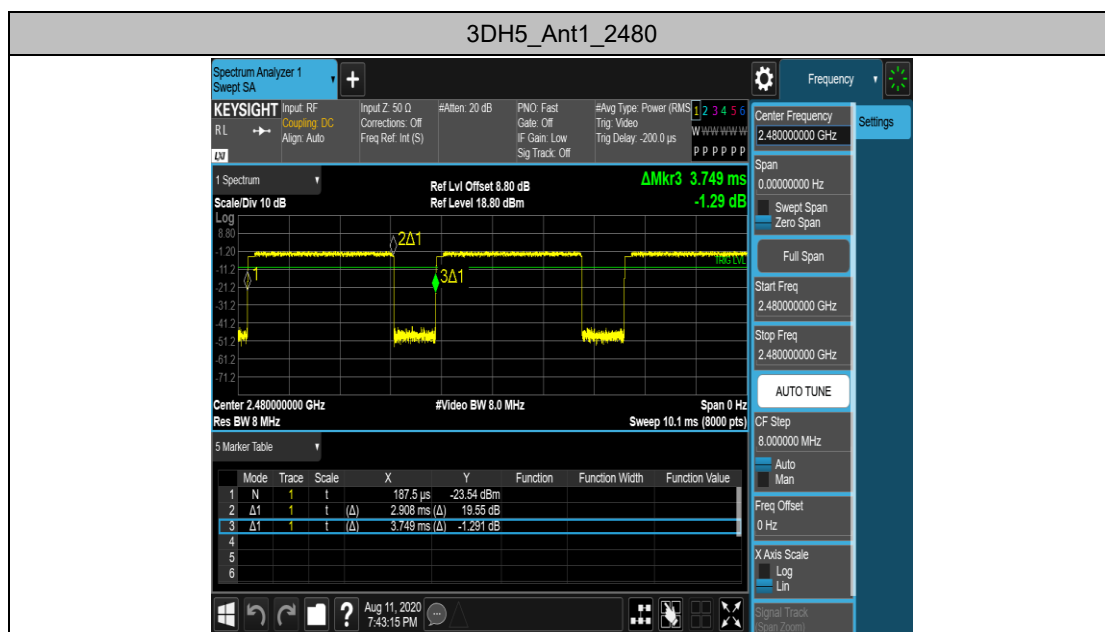

Test Report No.: EFGX20080028-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen. P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749