

Report No.: 9808478

Tested By: Hong, Report No.: 9808478


Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement: H QP

Meas Time: 1 s
Subranges: 18
Acc Margin: 20dB

Transducer No.	Start	Stop	Name
3	9k	30M	EI078

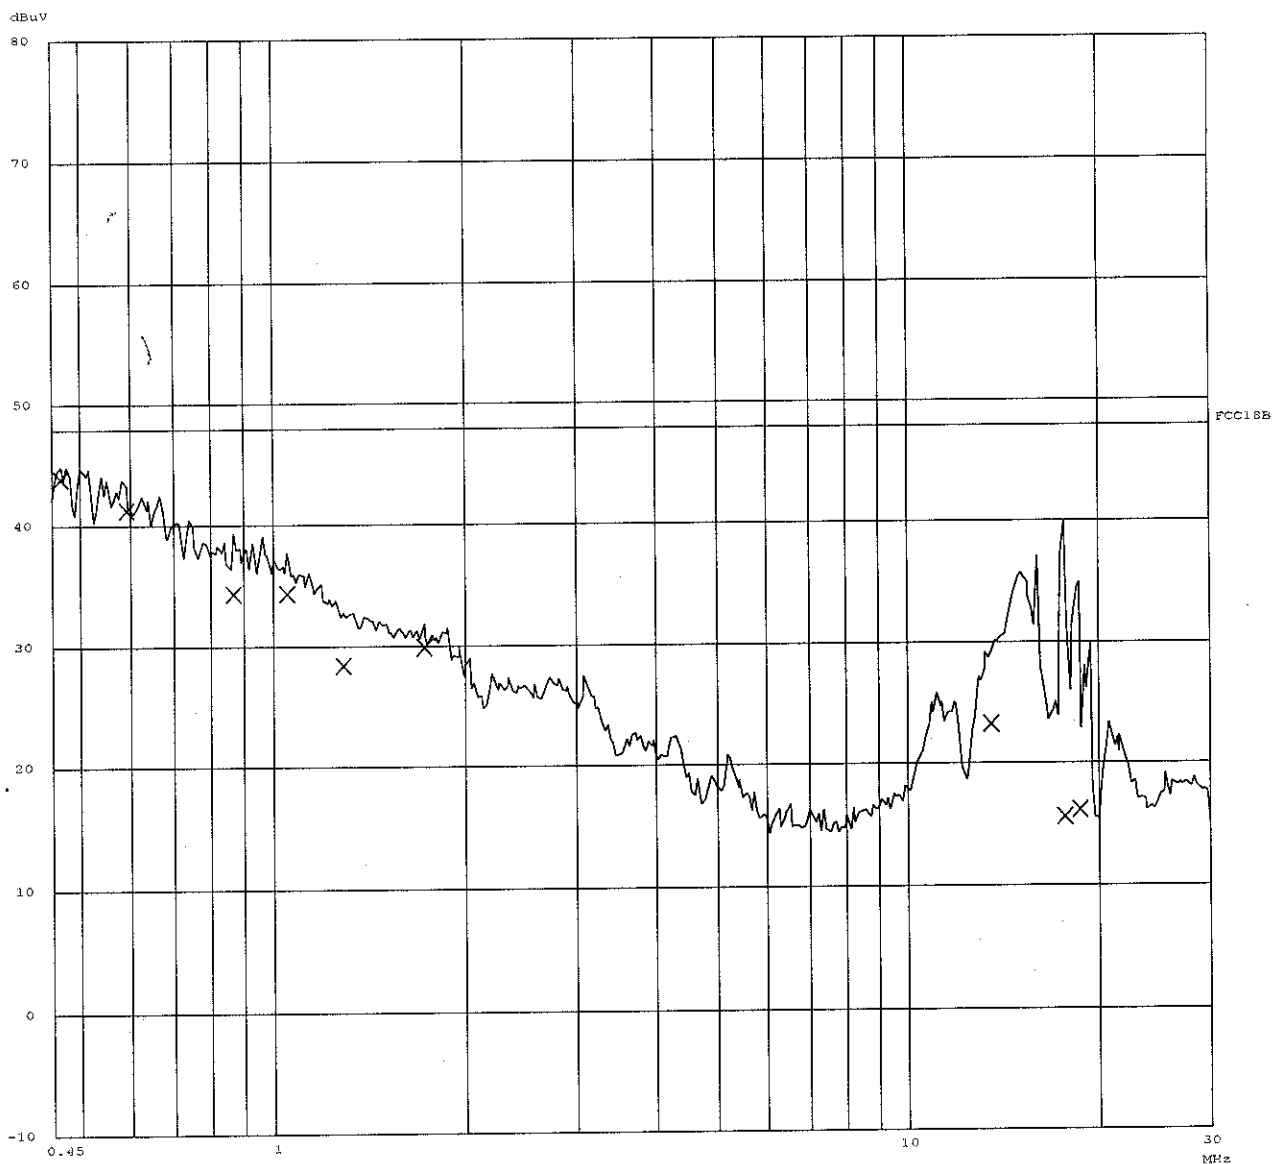

Ctrl. No.: N/A

Report No.: 9808478

Tested By: Hong, Report No.: 9808478

Scan Settings (1 Range)

----- Frequencies -----			----- Receiver Settings -----					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency MHz	QP Level dBuV	QP Limit dBuV
0.46500	43.8	48.0
0.59000	41.2	48.0
0.87000	34.3	48.0
1.05500	34.3	48.0
1.29000	28.4	48.0
1.72500	29.9	48.0
13.52000	23.2	48.0
17.66500	15.6	48.0
18.68000	16.1	48.0

* limit exceeded

Ctrl. No.: N/A