

20M -2152.5MHz-TM2.0-Port 1 ~4:

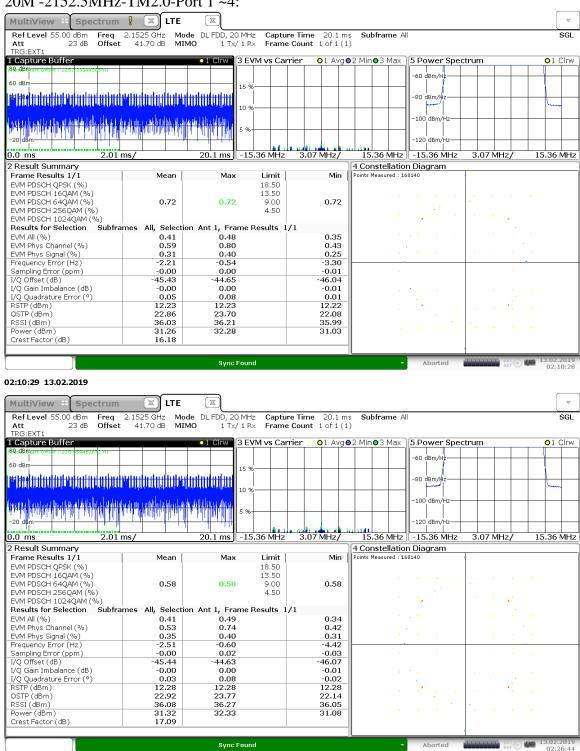

02:26:45 13.02.2019


Report No.:WT198001218 Page 130 of 291

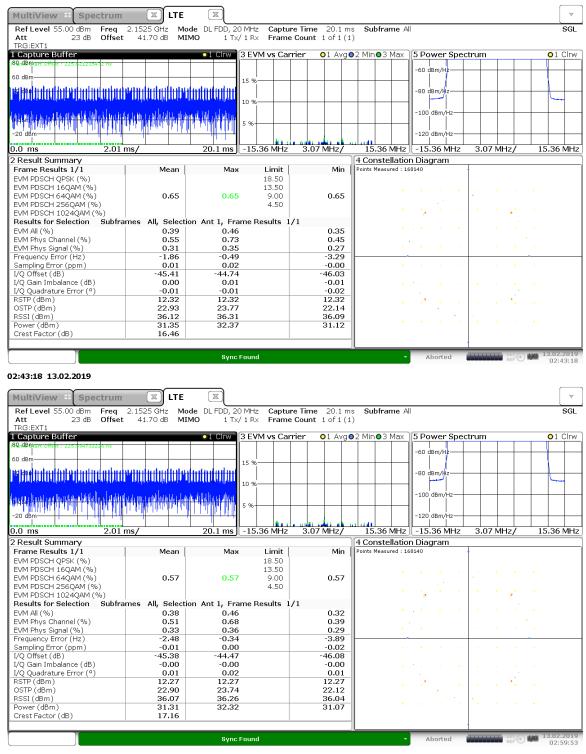

02:59:53 13.02.2019

Report No.:WT198001218 Page 131 of 291

20M -2152.5MHz-TM3.1-Port 1 ~4:

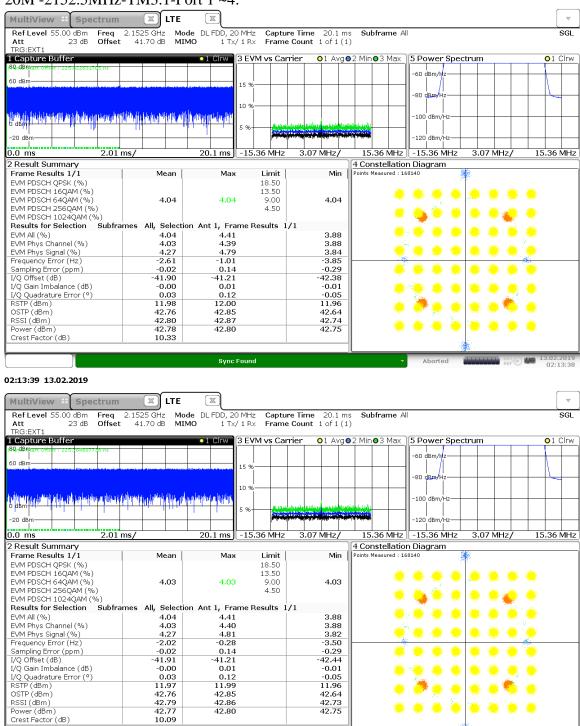


13.02.2019 02:29:55

02:29:55 13.02.2019

Report No.:WT198001218 Page 132 of 291


Sync Found

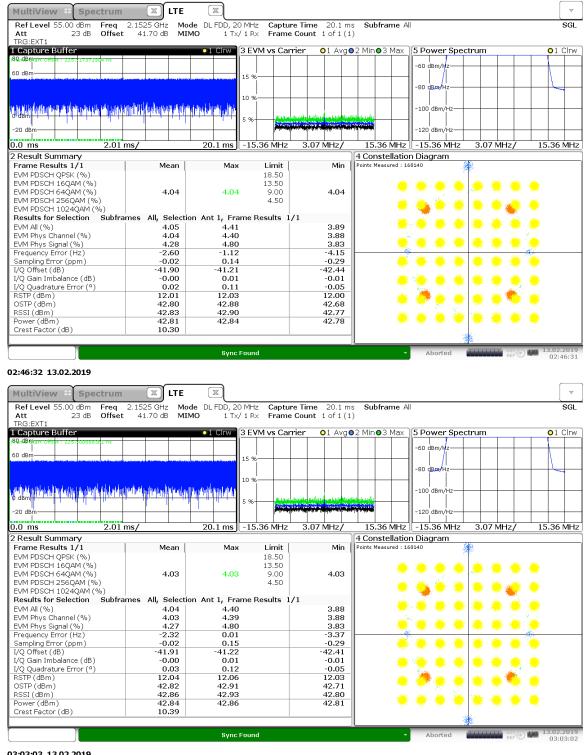

03:03:03 13.02.2019


Report No.:WT198001218 Page 133 of 291

20M -2152.5MHz-TM3.2-Port 1 ~4:

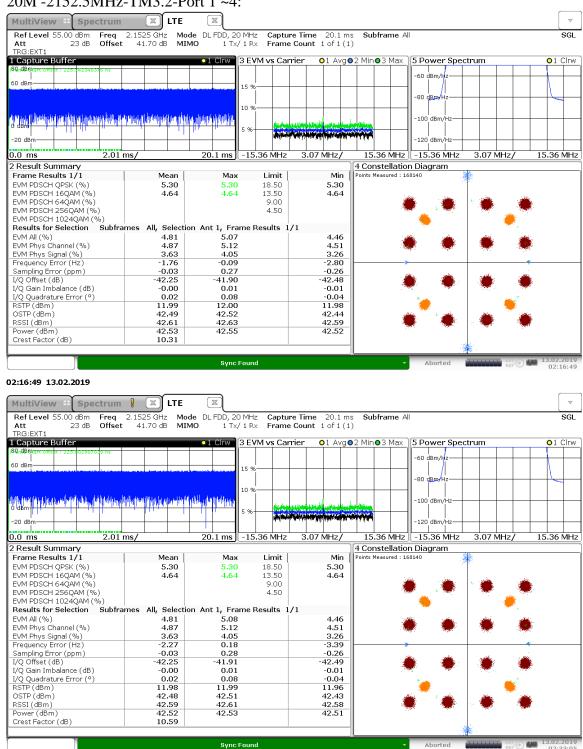

02:33:05 13.02.2019


Report No.:WT198001218 Page 134 of 291

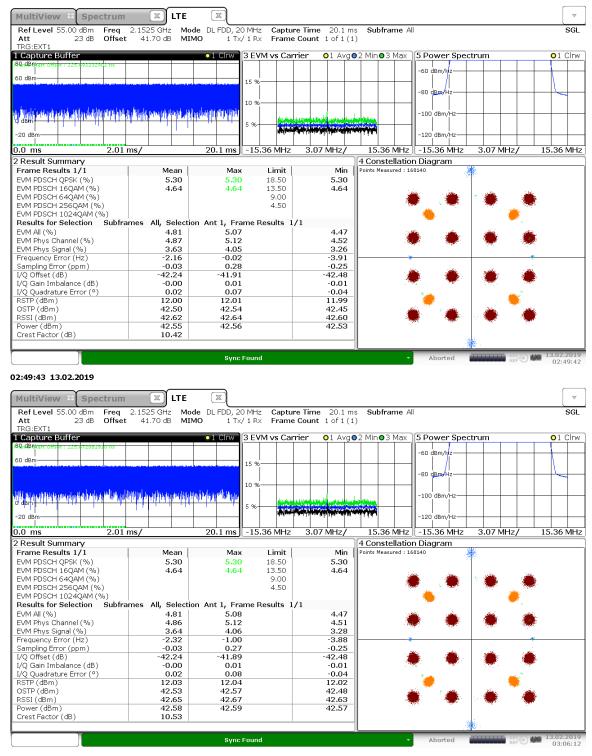

03:06:13 13.02.2019

Report No.:WT198001218 Page 135 of 291


20M -2152.5MHz-TM3.3-Port 1 ~4:

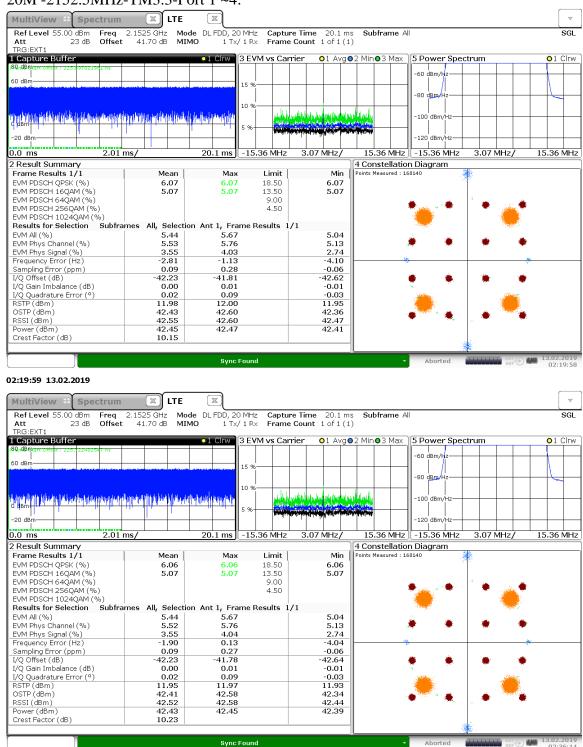

02:36:14

02:36:15 13.02.2019

Report No.:WT198001218 Page 136 of 291

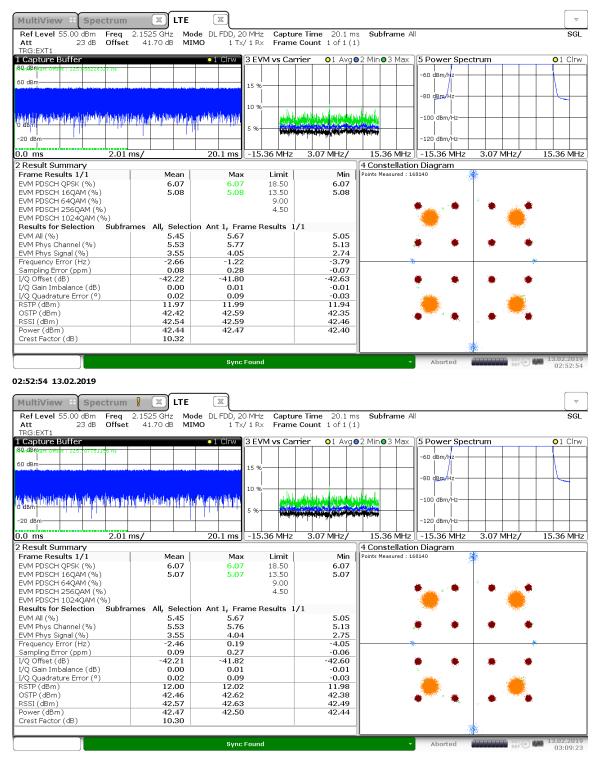


03:09:23 13.02.2019

Report No.:WT198001218 Page 137 of 291

Channel Bandwidth :20M+20M(2135MHz+2160MHz)

| Frequency (MHz) | Test mode | Port | EVM(%) |
|-----------------|-----------|------|--------|
| , , , | | 1 | 0.78 |
| | T1 40 0 | 2 | 0.75 |
| | TM2.0 | 3 | 1.43 |
| | | 4 | 1.24 |
| | | 1 | 4.06 |
| | TMO 4 | 2 | 4.05 |
| | TM3.1 | 3 | 4.07 |
| 2135 | | 4 | 4.05 |
| 2133 | | 1 | 4.65 |
| | TM3.2 | 2 | 4.67 |
| | 11013.2 | 3 | 4.66 |
| | | 4 | 4.66 |
| | | 1 | 6.10 |
| | TM3.3 | 2 | 6.11 |
| | TIVIS.S | 3 | 6.12 |
| | | 4 | 6.10 |
| | | 1 | 0.61 |
| | TM2.0 | 2 | 1.34 |
| | 11012.0 | 3 | 0.64 |
| | | 4 | 0.67 |
| | | 1 | 4.03 |
| | TM3.1 | 2 | 4.05 |
| | 1 1013. 1 | 3 | 4.04 |
| 2160 | | 4 | 4.04 |
| 2100 | | 1 | 4.65 |
| | TM2.2 | 2 | 4.64 |
| | TM3.2 | 3 | 4.64 |
| | | 4 | 4.65 |
| | | 1 | 6.07 |
| | TM2.2 | 2 | 6.08 |
| | TM3.3 | 3 | 6.09 |
| | | 4 | 6.07 |

20M -2135MHz-TM2.0-Port 1 ~4:

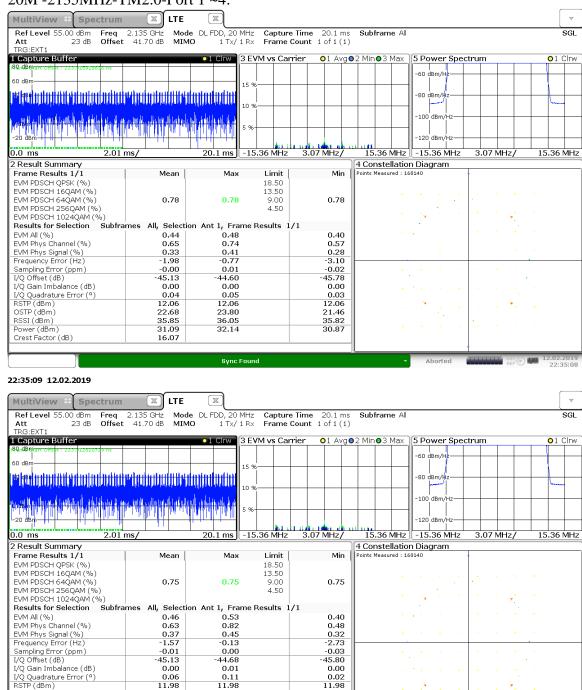

21.35

35.74

30.79

22:51:58 12.02.2019

22.58

35.78

15.98

23.71

35.97


32.06

Sync Found

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

Report No.:WT198001218 Page 139 of 291

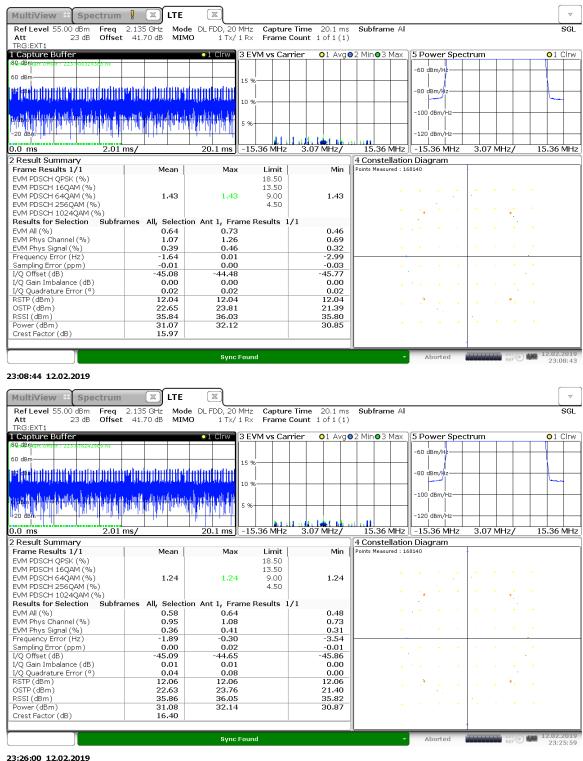

Report No.:WT198001218 Page 140 of 291

20M -2135MHz-TM3.1-Port 1 ~4:



22:55:07 12.02.2019

I/Q Quadrature Error (°) RSTP (dBm)

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

-0.01 11.78

42.62

42.57

42.57

9.90

0.07 11.80

42.71

42.61

42.61

Sync Found

-0.07 11.75


42.48

42.53

42.54

12.02


Report No.:WT198001218 Page 141 of 291

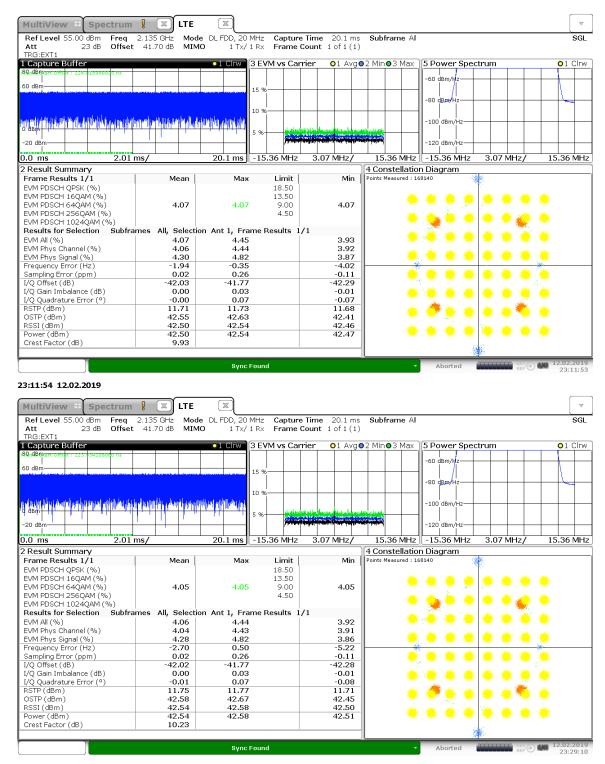

23:29:10 12.02.2019

Report No.:WT198001218 Page 142 of 291

20M -2135MHz-TM3.2-Port 1 ~4:

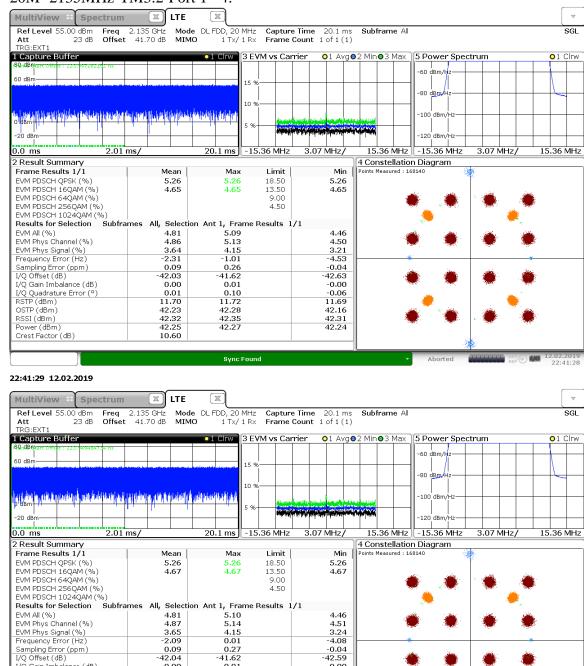

-0.00

-0.06 11.75

42.22

42.37

42.30

22:58:16 12:02:2019

I/Q Gain Imbalance (dB)

I/Q Quadrature Error (°) RSTP (dBm)

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

0.00

0.01 11.76

42.29

42.38

42.31 10.64

0.01

0.11 11.78


42.34

42.41

42.33

Sync Found


Report No.:WT198001218 Page 143 of 291

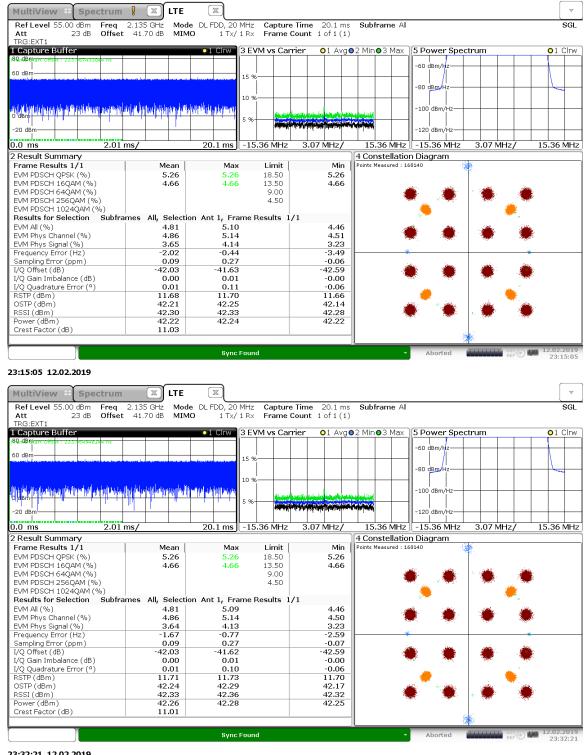

23:32:21 12.02.2019

Report No.:WT198001218 Page 144 of 291

20M -2135MHz-TM3.3-Port 1 ~4:

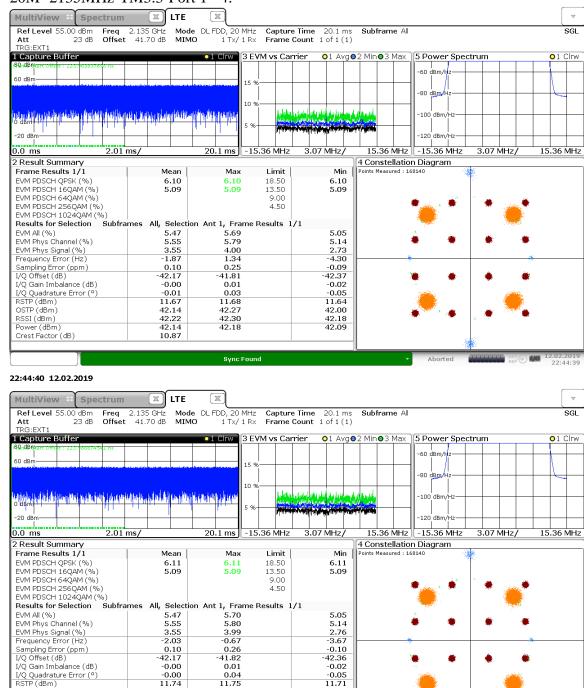

23:01:26 12.02.2019

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

Report No.:WT198001218 Page 145 of 291

42.34

42.37

42.24

Sync Found

42.07


42.25

42.16

42.21

42.29


42.21 10.84

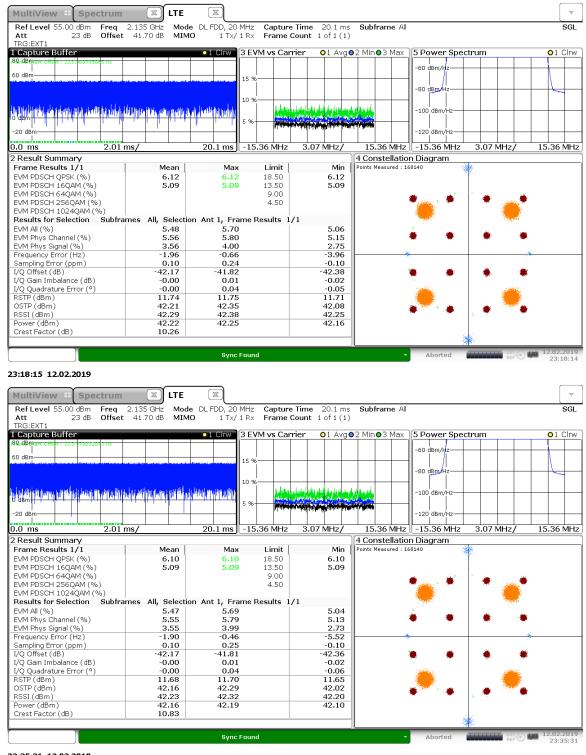

23:35:31 12.02.2019

Report No.:WT198001218 Page 146 of 291

20M -2160MHz-TM2.0-Port 1 ~4:

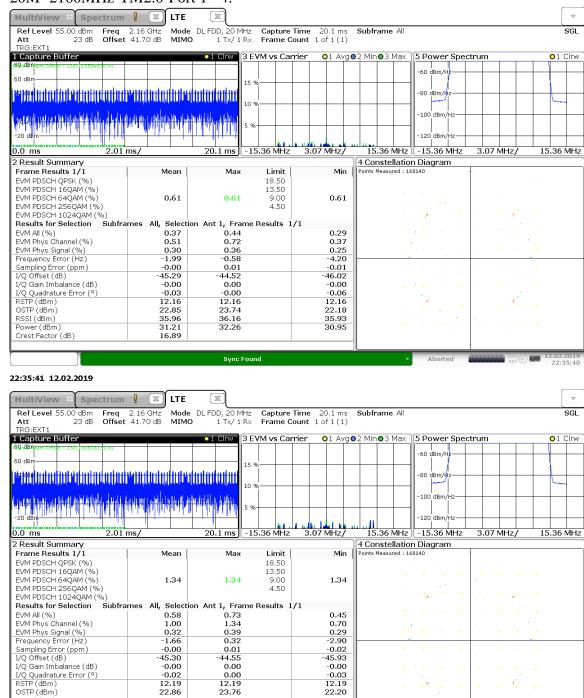

22:52:29 12:02:2019

I/Q Quadrature Error (°) RSTP (dBm)

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

-0.02 12.19

22.86

35.99

16.75

0.00

23.76

36.19


32.28

Sync Found

35.96

30.97


Report No.:WT198001218 Page 147 of 291

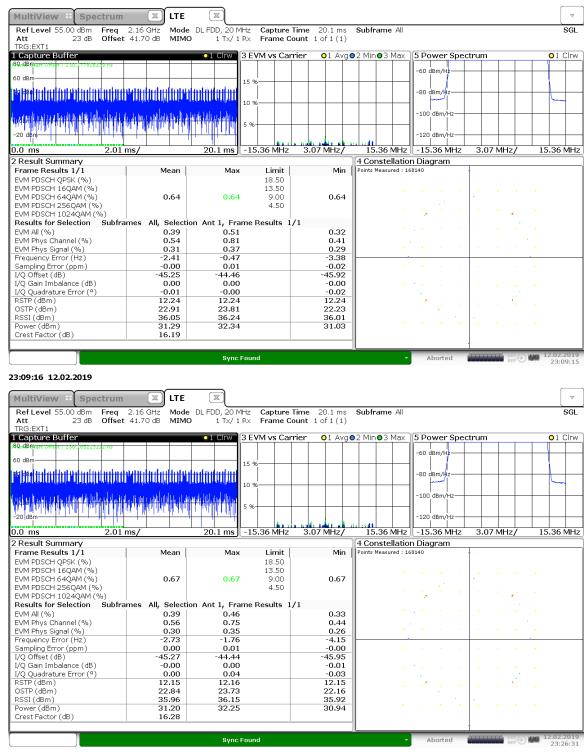

23:26:31 12.02.2019

Report No.:WT198001218 Page 148 of 291

20M -2160MHz-TM3.1-Port 1 ~4:

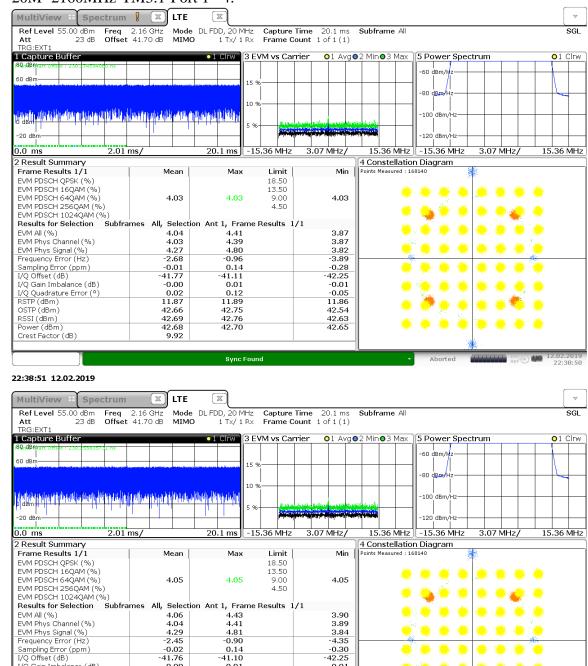

22:55:39 12:02:2019

I/O Gain Imbalance (dB)

I/Q Quadrature Error (°) RSTP (dBm)

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

Report No.:WT198001218 Page 149 of 291

-0.90

0.01

0.12 11.96

42.81

42.83

42.76

Sync Found

-0.30 -42.25

-0.01

-0.05 11.92

42.60 42.69

42.71

EXT 12.02

-0.02 -41.76


-0.00

0.02 11.94

42.72

42.76


42.74 10.40

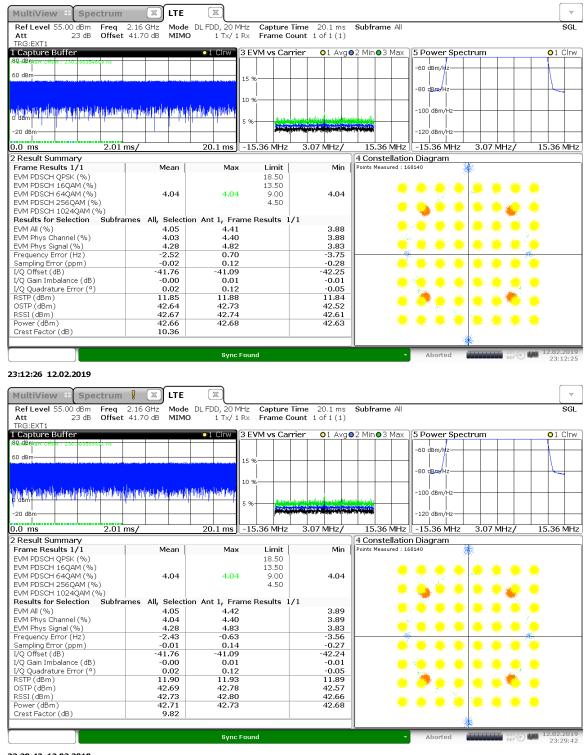

23:29:42 12.02.2019

Report No.:WT198001218 Page 150 of 291

20M -2160MHz-TM3.2-Port 1 ~4:

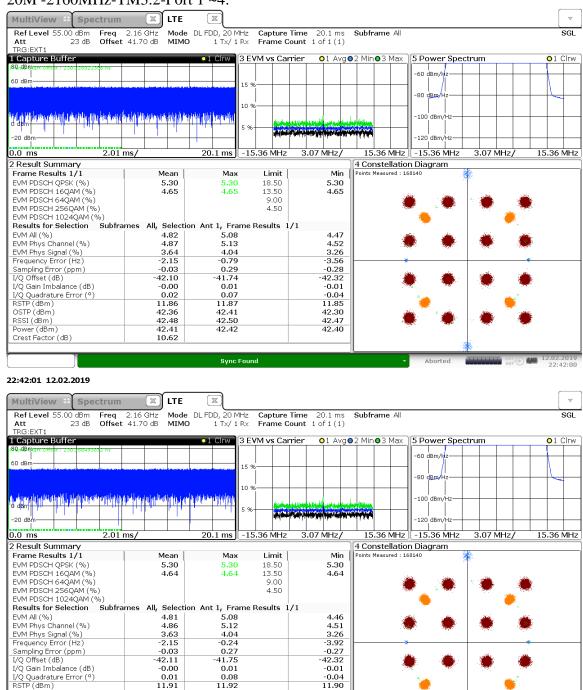

22:58:48 12.02.2019

OSTP (dBm)

RSSI (dBm)
Power (dBm)
Crest Factor (dB)

Report No.:WT198001218 Page 151 of 291

42.45

42.55

42.47


Sync Found

42.41

42.53

42.46 10.30 42.35 42.52


42.44

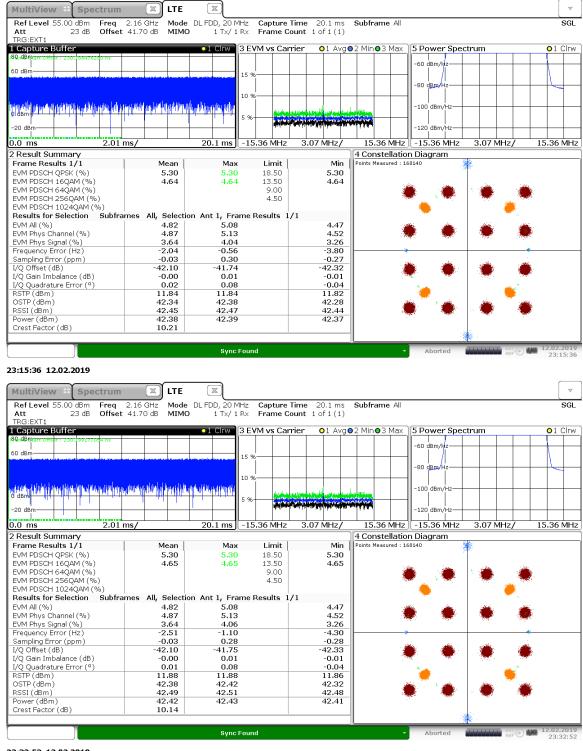

23:32:53 12.02.2019


Report No.:WT198001218 Page 152 of 291

20M -2160MHz-TM3.3-Port 1 ~4:

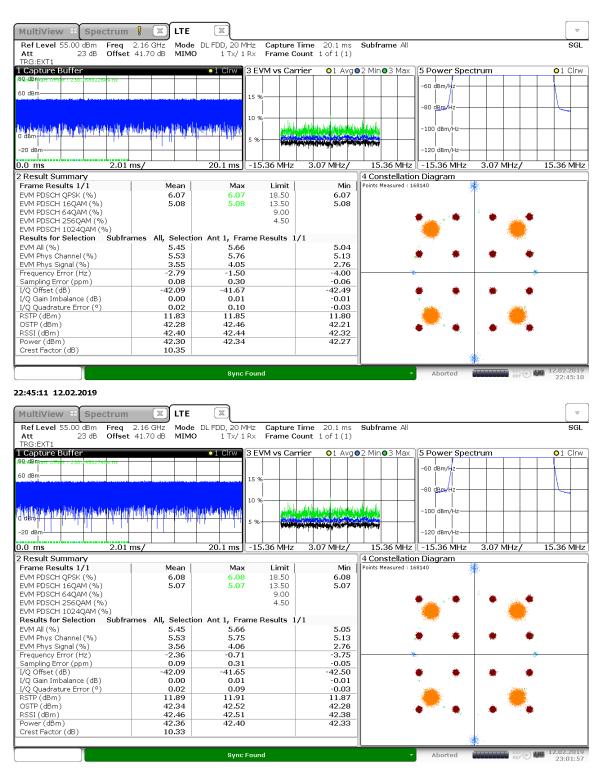

23:01:58 12.02.2019

Report No.:WT198001218 Page 153 of 291

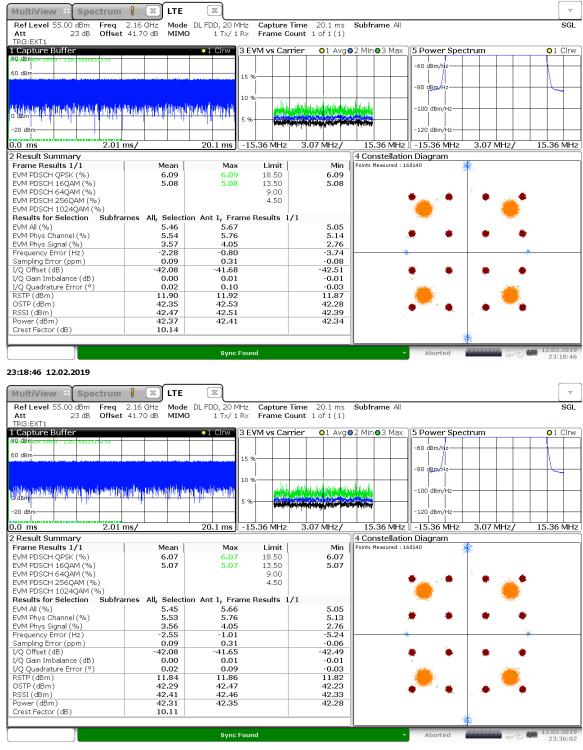

23:36:03 12.02.2019

Report No.:WT198001218 Page 154 of 291

7. SPURIOUS RADIATED EMISSIONS

7.1. Applicable Standard:

FCC CFR 47 §2.1053


7.2. Test Equipment List and Details:

| Manufacturer | Description | Model | Serial Number | Calibration Date | Calibration Due Date |
|--------------|--------------------------------|----------|---------------|---------------------|----------------------|
| R&S | EMI Test Receiver | ESI26 | SB3436 | 2018.11.19 | 2019.11.18 |
| Albatross | anechoic chamber | 3m Site | SB9555/01 | 2018.09.11 | 2019.09.10 |
| Schwarzbeck | Trilog Broadband Antenna | VULB9163 | SB3955 | 2018.06.12 | 2019.06.11 |
| R&S | Horn Antenna | HF907 | SB13958 | 2018.05.22 | 2019.05.21 |

^{*}statement of traceability: SMQ attests that all calibration has been performed per the A2LA requirements, traceable to NIM.

7.3. Test Procedure:

EUT Setup

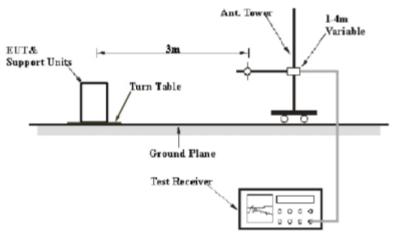

The radiated emission tests were performed in the 3-meter Chamber, using the setup accordance with the FCC part 2.1053. The specification used was the FCC 2.1053 limits. (dB):0dB

The transmitter was placed on a wooden turntable, and it was transmitting into a non-radiating load, which was also placed on the turntable.

The measurement antenna was placed at a distance of 3 meters from the EUT. During the tests, the antenna height and polarization as well as EUT azimuth were varied in order to identify the maximum level of emissions from the EUT. The test was performed by placing the EUT on 3-orthogonal axis.

The frequency range up to teeth harmonic of the fundamental frequency was investigated.

Report No.:WT198001218 Page 155 of 291

Remove the EUT and replace it with substitution antenna. A signal generator was connected to the substitution antenna by a non-radiating cable. The absolute levels of the spurious emissions were measured by the substitution. Spurious emissions in dB =10 1g (TX pwr in Watts/0.001)-the absolute level Spurious attenuation limit in dB =43+10 Log P (power out in Watts) The resolution bandwidth of the spectrum analyzer was set at 1 percent as specified for 30MHz to 1GHz scaning, set at 1MHz for 1GHz to 20GHz scaning.

7.4. Environmental Conditions:

| Temperature: | 21°C |
|--------------------|-----------|
| Relative Humidity: | 40 % |
| ATM Pressure: | 1012 mbar |


7.5.Test Result: Pass

7.6.Test Mode: Transmitting LTE

7.7. Test Data:

30M-1GHz(Horizontal)

30M-1GHz_Direct_Hor

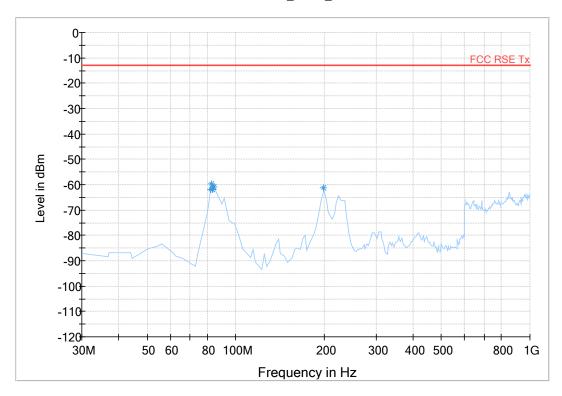


Data Reduction Result 1 [1]

| | | L | 4 | | | | |
|-----------|-----------------|----------|--------------|---------|--------|--------|-------|
| Frequency | MaxPeak-MaxHold | Height | Polarization | Azimuth | Corr. | Margin | Limit |
| (MHz) | (dBm) | (cm) | | (deg) | (dB) | (dB) | (dBm) |
| 82.400000 | -61.7 | 150.0 | Н | 0.0 | -129.5 | 48.7 | -13.0 |
| 82.850000 | -59.6 | 150.0 | Н | 0.0 | -129.4 | 16.6 | -13.0 |
| 83.300000 | -62.0 | 150.0 | Н | 0.0 | -129.4 | 49.0 | -13.0 |
| 83.660000 | -60.9 | 150.0 | Н | 0.0 | -129.4 | 47.9 | -13.0 |
| 84.110000 | -61.0 | 150.0 | Н | 0.0 | -129.5 | 48.0 | -13.0 |
| 199.40000 | -61.1 | 150.0 | Н | 0.0 | -122.9 | 48.1 | -13.0 |

Report No.:WT198001218 Page 157 of 291

30M-1GHz(Vertical)

30M-1GHz_Direct_Ver

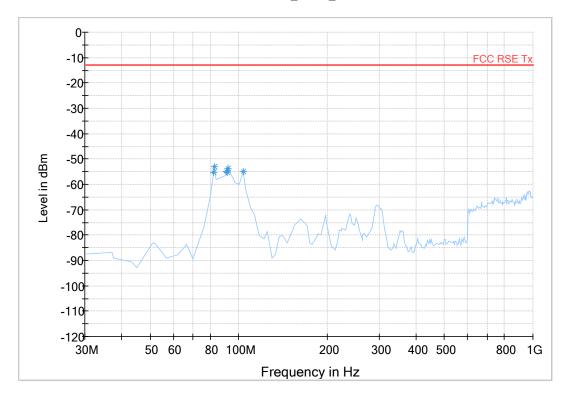


Data Reduction Result 1 [1]

| Frequency | MaxPeak-MaxHold | Height | Polarization | Azimuth | Corr. | Margin | Limit |
|-----------|-----------------|--------|--------------|---------|--------|--------|-------|
| (MHz) | (dBm) | (cm) | | (deg) | (dB) | (dB) | (dBm) |
| 82.220000 | -55.4 | 150.0 | ٧ | 0.0 | -127.2 | 42.4 | -13.0 |
| 82.580000 | -53.0 | 150.0 | ٧ | 0.0 | -126.9 | 40.0 | -13.0 |
| 91.130000 | -55.0 | 150.0 | V | 0.0 | -120.7 | 42.0 | -13.0 |
| 91.490000 | -55.3 | 150.0 | ٧ | 0.0 | -120.6 | 42.3 | -13.0 |
| 91.940000 | -53.6 | 150.0 | ٧ | 0.0 | -120.5 | 40.6 | -13.0 |
| 103.91000 | -54.8 | 150.0 | V | 0.0 | -112.8 | 41.8 | -13.0 |

Report No.:WT198001218 Page 158 of 291

1-6GHz(Horizontal)

1GHz-6GHz HPF3.0

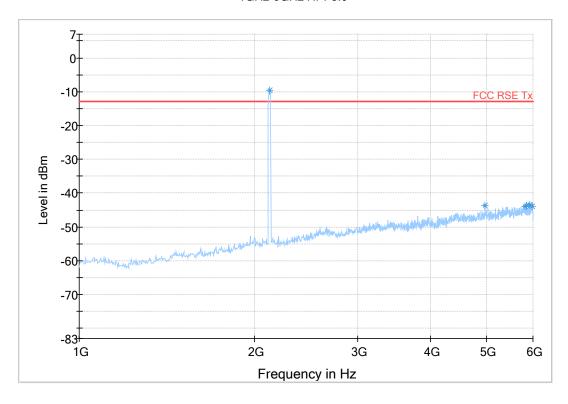


Data Reduction Result 1 [2]

| Frequency | MaxPeak-MaxHold | Height | Polarization | Azimuth | Corr. | Margin | Limit |
|------------|-----------------|--------|--------------|---------|--------|--------|-------|
| (MHz) | (dBm) | (cm) | | (deg) | (dB) | (dB) | (dBm) |
| 2118.10000 | -9.5 | 150.0 | Н | 0.0 | -103.2 | -3.5 | -13.0 |
| 4963.95000 | -43.7 | 150.0 | Н | 0.0 | -93.9 | 30.7 | -13.0 |
| 5809.80000 | -43.9 | 150.0 | Н | 0.0 | -92.6 | 30.9 | -13.0 |
| 5844.60000 | -43.6 | 150.0 | Н | 0.0 | -93.0 | 30.6 | -13.0 |
| 5921.85000 | -43.3 | 150.0 | Н | 0.0 | -92.7 | 30.3 | -13.0 |
| 5971.65000 | -43.8 | 150.0 | Н | 0.0 | -92.3 | 30.8 | -13.0 |

Report No.:WT198001218 Page 159 of 291

1-6GHz(Vertical)

1GHz-6GHz HPF3.0

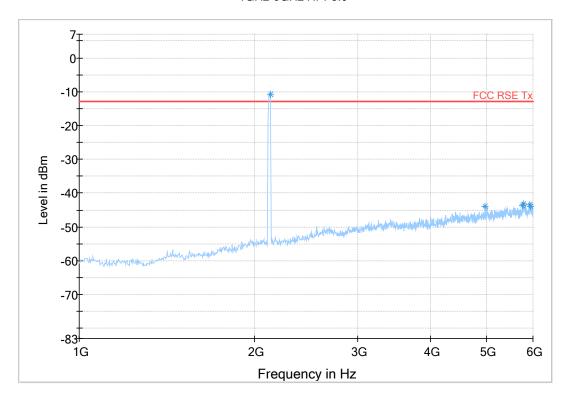


Data Reduction Result 1 [2]

| Frequency | MaxPeak-MaxHold | Height | Polarization | Azimuth | Corr. | Margin | Limit |
|------------|-----------------|--------|--------------|---------|--------|--------|-------|
| (MHz) | (dBm) | (cm) | | (deg) | (dB) | (dB) | (dBm) |
| 2125.90000 | -10.7 | 150.0 | ٧ | 352.0 | -103.3 | -2.3 | -13.0 |
| 4964.70000 | -43.9 | 150.0 | ٧ | 0.0 | -94.0 | 30.9 | -13.0 |
| 5755.65000 | -43.6 | 150.0 | ٧ | 0.0 | -93.0 | 30.6 | -13.0 |
| 5773.50000 | -43.3 | 150.0 | ٧ | 0.0 | -92.7 | 30.3 | -13.0 |
| 5927.40000 | -43.4 | 150.0 | ٧ | 0.0 | -92.8 | 30.4 | -13.0 |
| 5948.85000 | -43.9 | 150.0 | ٧ | 0.0 | -92.5 | 30.9 | -13.0 |

Report No.:WT198001218 Page 160 of 291

6-12.75GHz(Horizontal)

6GHz-18GHz HPF6.0

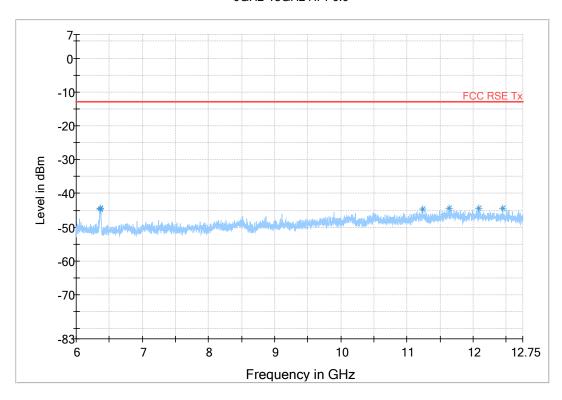


Data Reduction Result 1 [2]

| Frequency | MaxPeak-MaxHold | Height | Polarization | Azimuth | Corr. | Margin | Limit |
|-------------|-----------------|--------|--------------|---------|-------|--------|-------|
| (MHz) | (dBm) | (cm) | | (deg) | (dB) | (dB) | (dBm) |
| 6357.975000 | -44.3 | 150.0 | Н | 229.0 | -90.4 | 31.3 | -13.0 |
| 6368.325000 | -44.6 | 150.0 | Н | 229.0 | -90.5 | 31.6 | -13.0 |
| 11239.35000 | -44.7 | 150.0 | Н | 0.0 | -83.5 | 31.7 | -13.0 |
| 11638.95000 | -44.3 | 150.0 | Н | 334.0 | -83.1 | 31.3 | -13.0 |
| 12084.67500 | -44.4 | 150.0 | Н | 13.0 | -82.7 | 31.4 | -13.0 |
| 12444.67500 | -44.4 | 150.0 | Н | 0.0 | -82.7 | 31.4 | -13.0 |

Report No.:WT198001218 Page 161 of 291

6-12.75GHz(Vertical)

6GHz-18GHz HPF6.0

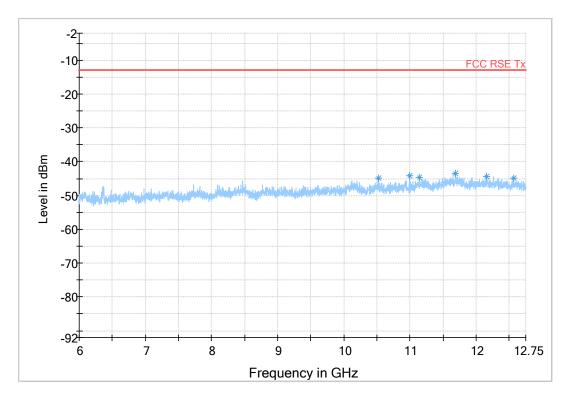

Data Reduction Result 1 [2]

| Frequency | MaxPeak-MaxHold | Height | Polarization | Azimuth | Corr. | Margin | Limit |
|--------------|-----------------|--------|--------------|---------|-------|--------|-------|
| (MHz) | (dBm) | (cm) | | (deg) | (dB) | (dB) | (dBm) |
| 10523.62500 | -45.0 | 150.0 | ٧ | 104.0 | -84.8 | 32.0 | -13.0 |
| 10991.62500 | -44.2 | 150.0 | ٧ | 13.0 | -84.6 | 31.2 | -13.0 |
| 11143.275000 | -44.6 | 150.0 | ٧ | 172.0 | -83.3 | 31.6 | -13.0 |
| 11685.75000 | -43.4 | 150.0 | ٧ | 141.0 | -82.7 | 30.4 | -13.0 |
| 12155.77500 | -44.3 | 150.0 | ٧ | 283.0 | -82.7 | 31.3 | -13.0 |
| 12565.05000 | -44.9 | 150.0 | ٧ | 65.0 | -82.6 | 31.9 | -13.0 |

Report No.:WT198001218 Page 162 of 291

8. SPURIOUS AND EMISSIONS AT ANTENNA TERMINALS

8.1. Applicable Standard:

FCC§2.1051, §27.53


The spectrum was to be investigated to the tenth harmonics of the highest fundamental frequency as specified.

8.2. Test Equipment List and Details:

| Manufacturer | Description | Model | Serial Number | Calibration Date | Calibration Due Date |
|--------------|----------------------------------|---------------|---------------|---------------------|-------------------------|
| R&S | Signal & Spectrum Analyzer | FSW26 | SB12724/01 | 2018.06.06 | 2019.06.05 |
| DTS | DTS 40dB Attenuator | DTS100-40-3-1 | 09112005 | 2018.07.19 | 2019.07.19 |
| Radiall | RF Cable | 1807188 | | | |

^{*}statement of traceability: SMQ attests that all calibration has been performed per the A2LA requirements, traceable to NIM.

8.3. Test Procedure:

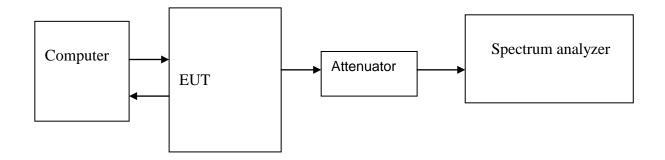

REMARKS: Attenuator loss (dB)=40dB, Cable Loss (dB)=1.5dB.

The RF output of the transceiver was connected to a spectrum analyzer through appropriate attenuation. Compliance with this provision is based on the use of measurement instrumentation employing a resolution bandwidth of 100 kilohertz or greater. However, in the 100 kilohertz bands immediately outside and adjacent to a licensee's frequency block, a resolution bandwidth of at least 30 kHz may be employed. Sufficient scans were taken to show any out of band emissions up to 10th harmonic.

8.4. Environmental Conditions:

| Temperature: | 21 °C |
|--------------------|-----------|
| Relative Humidity: | 45 % |
| ATM Pressure: | 1017 mbar |


Report No.:WT198001218 Page 163 of 291

8.5.Test Result: Pass

8.6.Test Mode: Transmitting LTE

8.7. Test Data:

Dual Carrier:

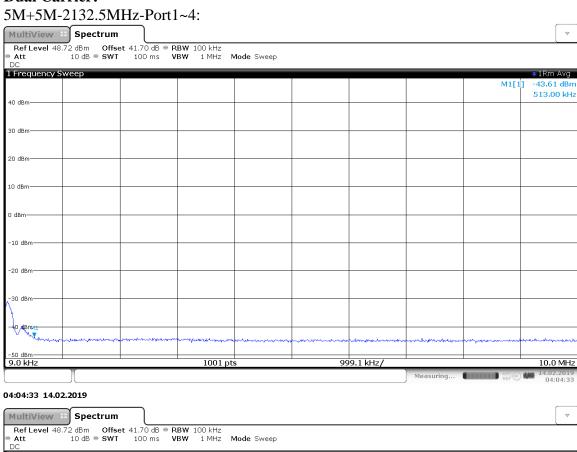




04:04:39 14.02.2019

Report No.:WT198001218 Page 164 of 291




04:04:52 14.02.2019

Report No.:WT198001218 Page 165 of 291

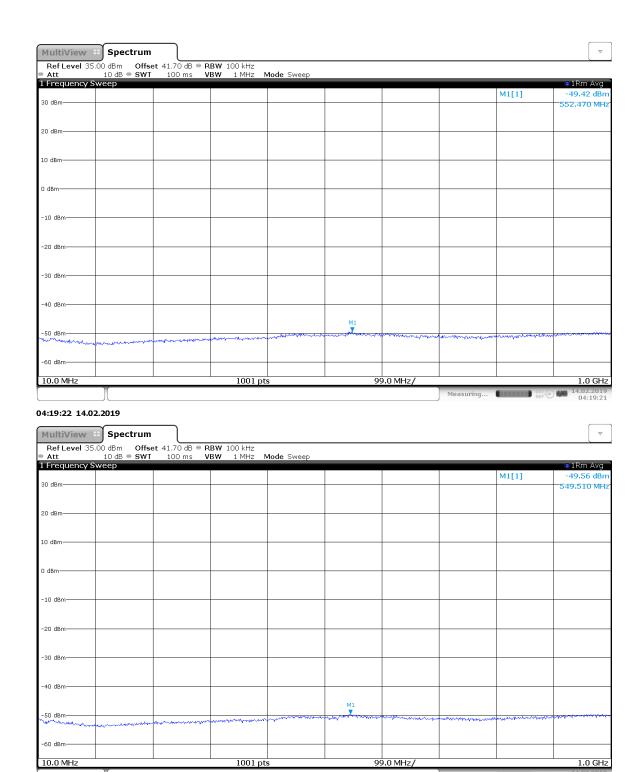


04:19:25 14.02.2019


Report No.:WT198001218 Page 166 of 291

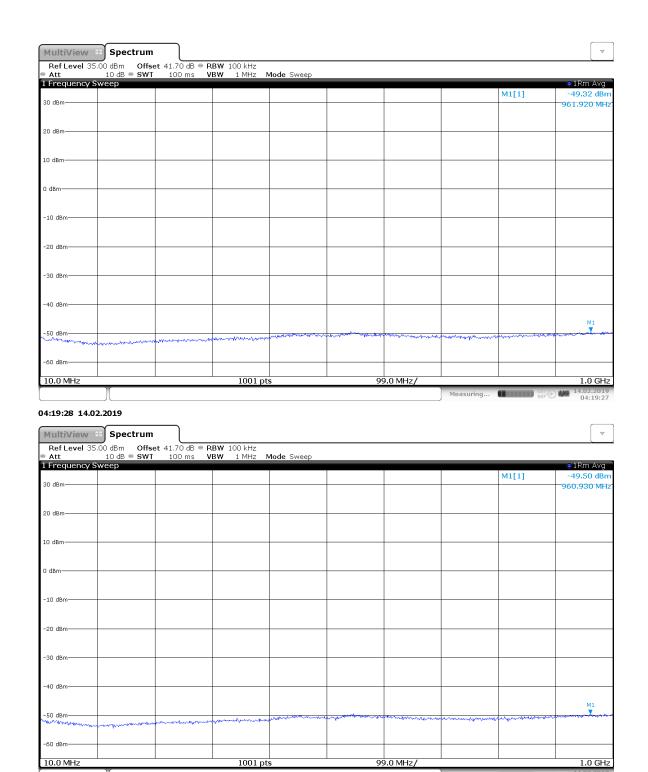

04:19:35 14.02.2019


Report No.:WT198001218 Page 167 of 291

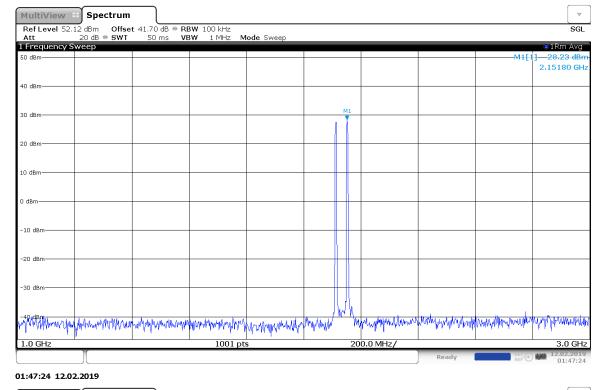


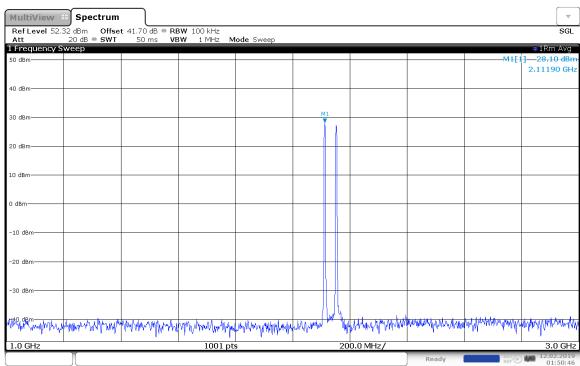

01:50:47 12.02.2019


Report No.:WT198001218 Page 168 of 291

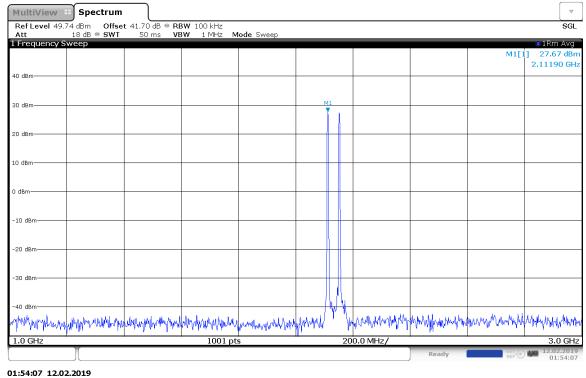

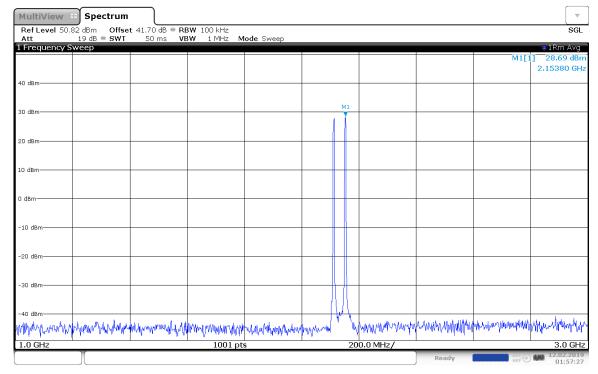

01:57:28 12.02.2019

Report No.:WT198001218 Page 169 of 291

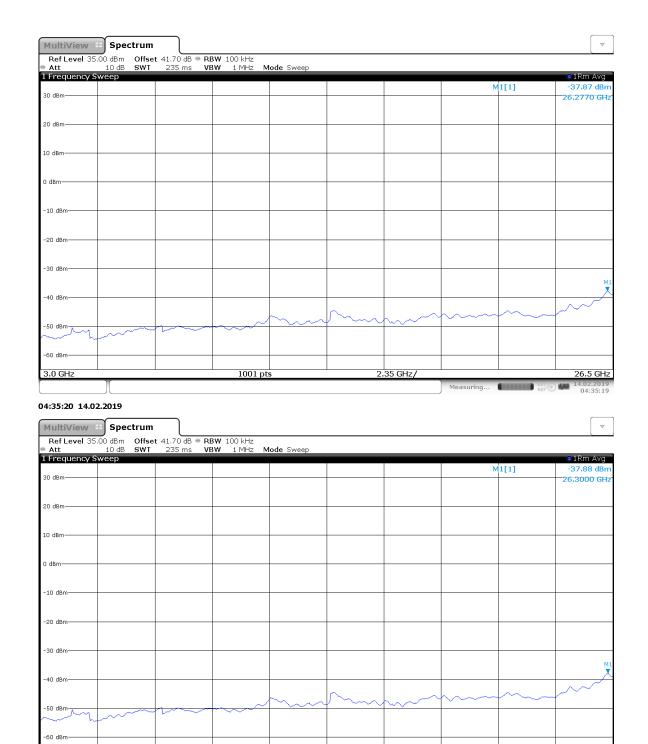


04:35:25 14.02.2019


Report No.:WT198001218 Page 170 of 291

1001 pts

2.35 GHz/

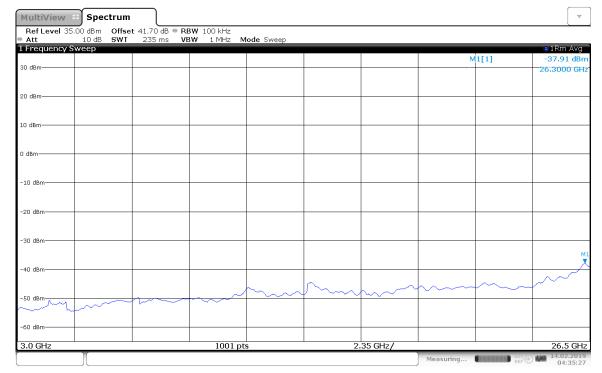


04:35:28 14.02.2019

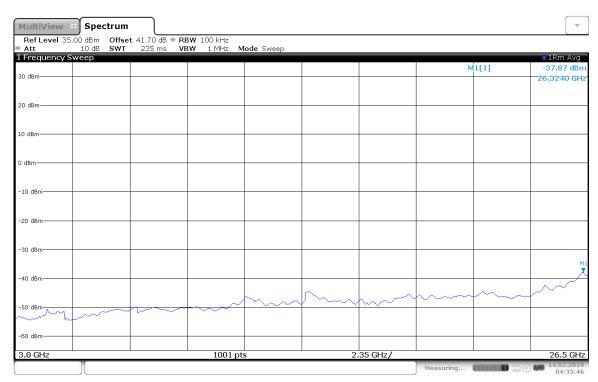

04:35:46 14.02.2019

Report No.:WT198001218 Page 171 of 291

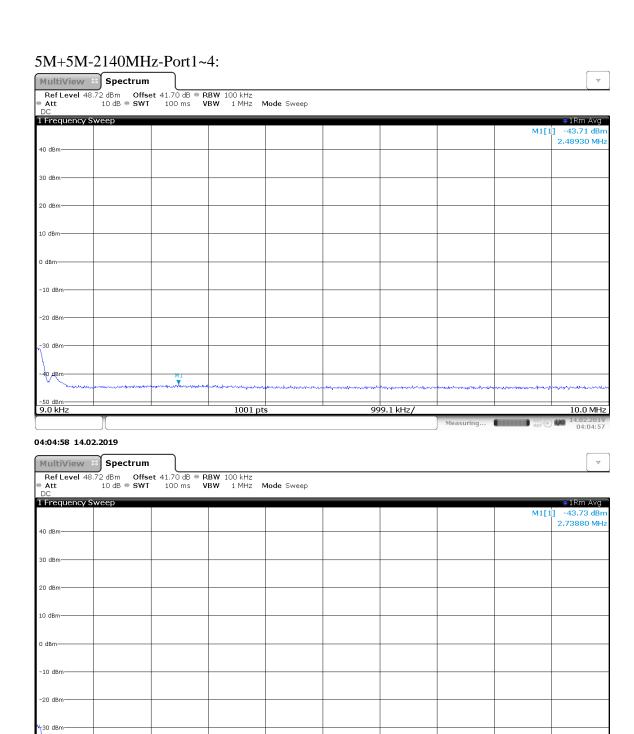

04:05:04 14.02.2019

-50 dBm-**9.0 kH**z

Report No.:WT198001218 Page 172 of 291

1001 pts

999.1 kHz/


10.0 MHz

Measuring... 14.02.2019 04:05:03




04:05:16 14.02.2019

Report No.:WT198001218 Page 173 of 291

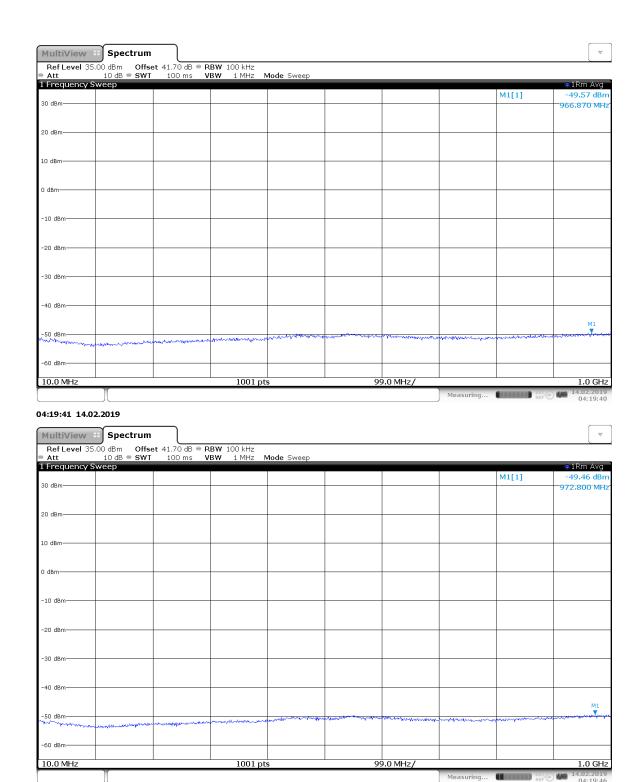


04:19:47 14.02.2019


Report No.:WT198001218 Page 174 of 291

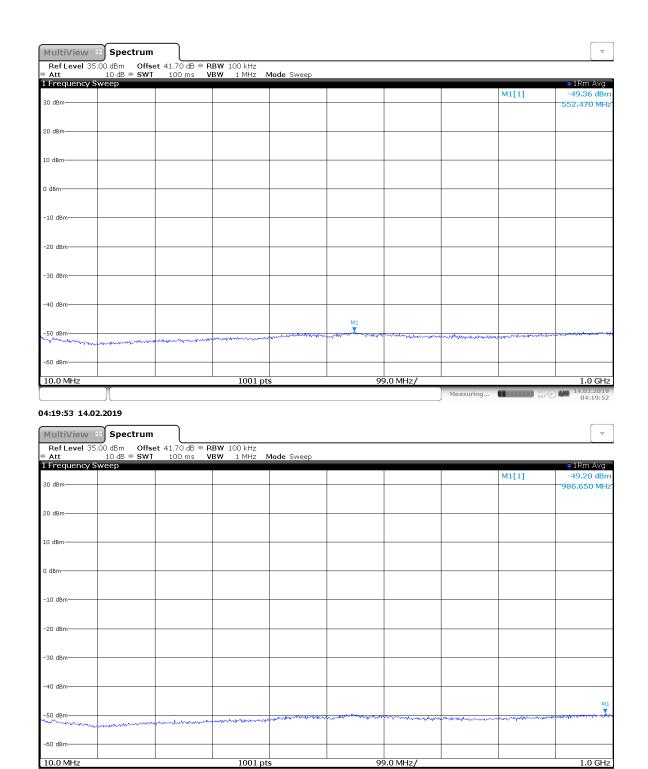

04:19:59 14.02.2019


Report No.:WT198001218 Page 175 of 291

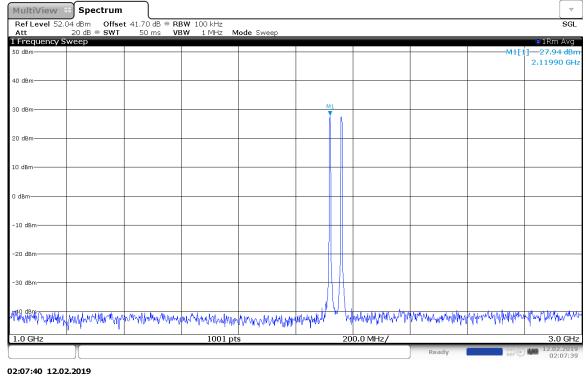


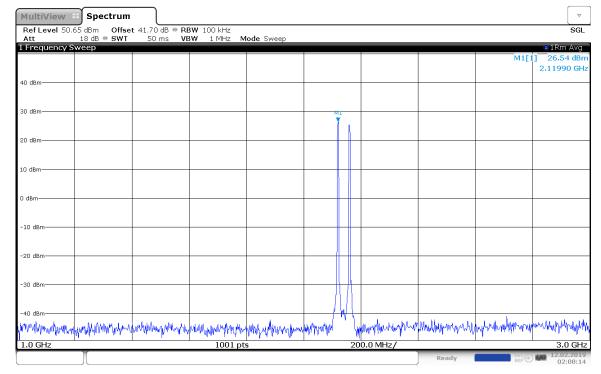

02:08:15 12.02.2019


Report No.:WT198001218 Page 176 of 291

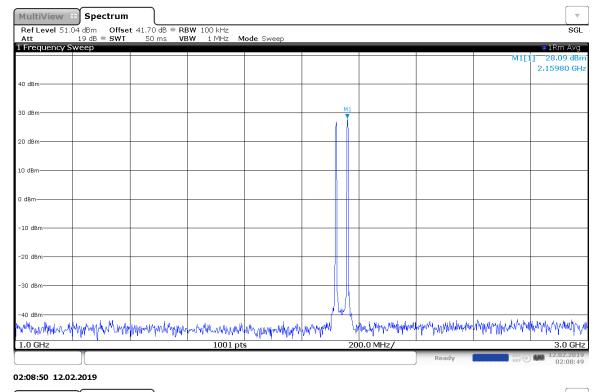

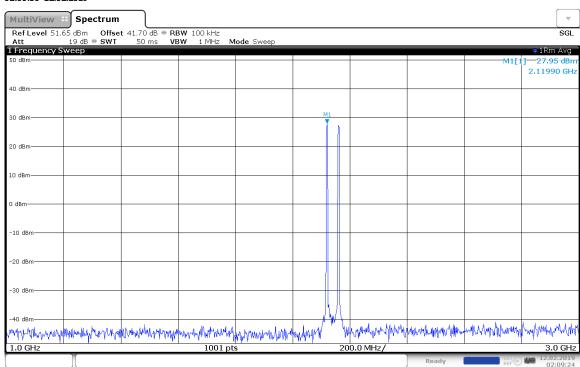

02:09:25 12.02.2019

Report No.:WT198001218 Page 177 of 291

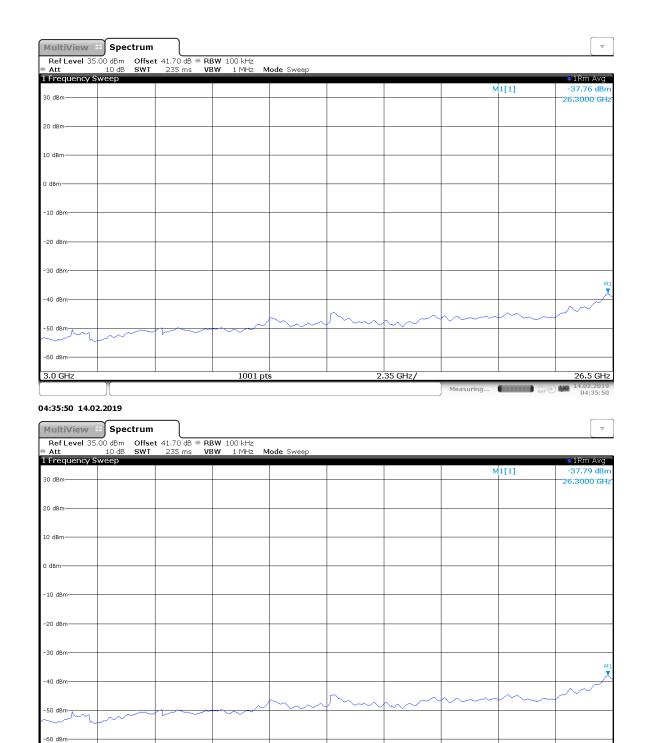


04:35:54 14.02.2019

Report No.:WT198001218 Page 178 of 291

1001 pts


2.35 GHz/

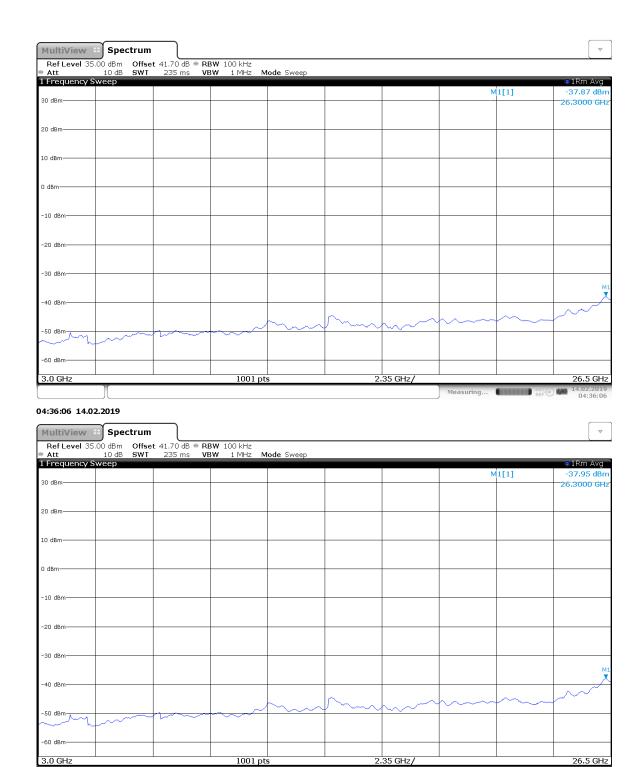

04:36:12 14.02.2019

Report No.:WT198001218 Page 179 of 291

5M+5M-2147.5MHz-Port1~4:

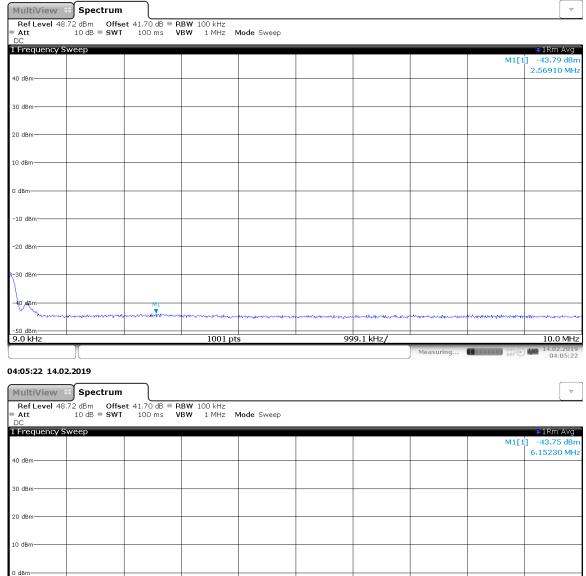

04:05:28 14.02.2019

-10 dBm

-20 dBm

30 dBm

-50 dBm-**9.0 kH**z

Report No.:WT198001218 Page 180 of 291

1001 pts

999.1 kHz/

10.0 MHz

Measuring... 14.02.2019 04:05:27